



Appendix E: Band edge measurements

Test Result


TestMode	Antenna	ChName	Frequency[MHz]	RefLevel[dBm]	Result[dBm]	Limit[dBm]	Verdict
TX	Ant1	Low	2402	5.17	-45.07	≤-14.83	PASS
TX	Ant2	Low	2402	3.71	-42.64	≤-16.29	PASS
TX	Ant3	Low	2402	2.28	-44.64	≤-17.72	PASS
TX	Ant4	Low	2402	4.55	-43.92	≤-15.45	PASS
TX	Ant1	High	2480	4.14	-47.87	≤-15.86	PASS
TX	Ant2	High	2480	3.16	-48.75	≤-16.85	PASS
TX	Ant3	High	2480	1.31	-48.67	≤-18.69	PASS
TX	Ant4	High	2480	3.31	-47.87	≤-16.69	PASS

Test Graphs

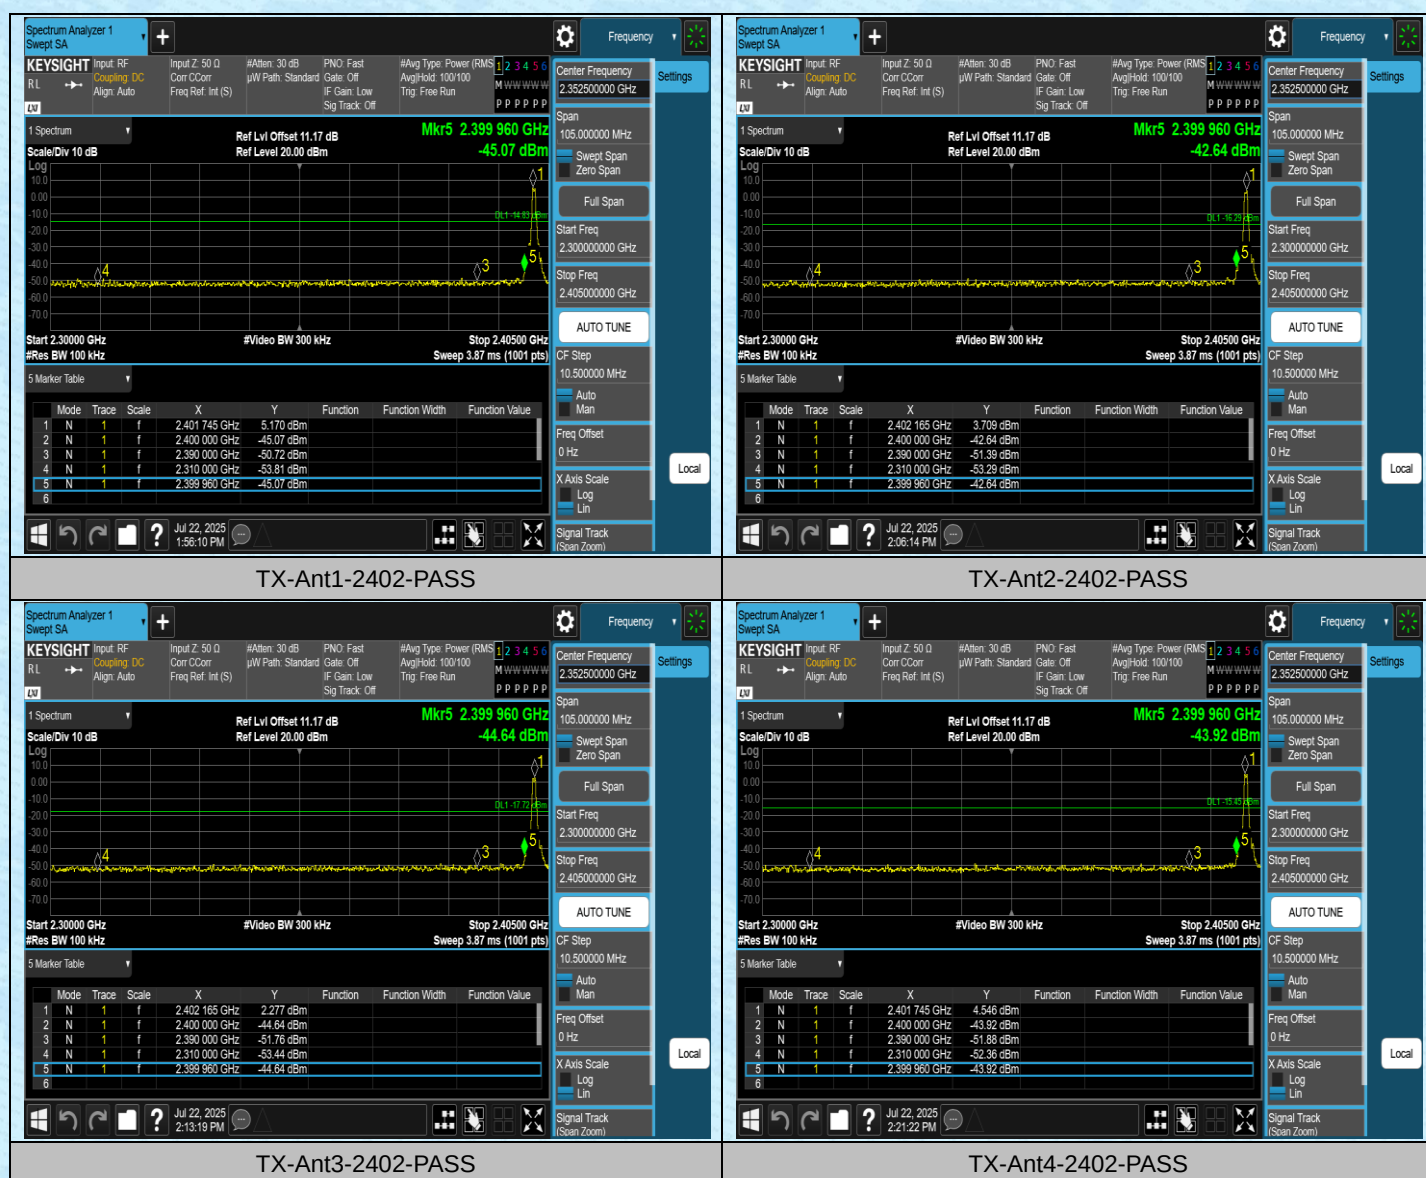


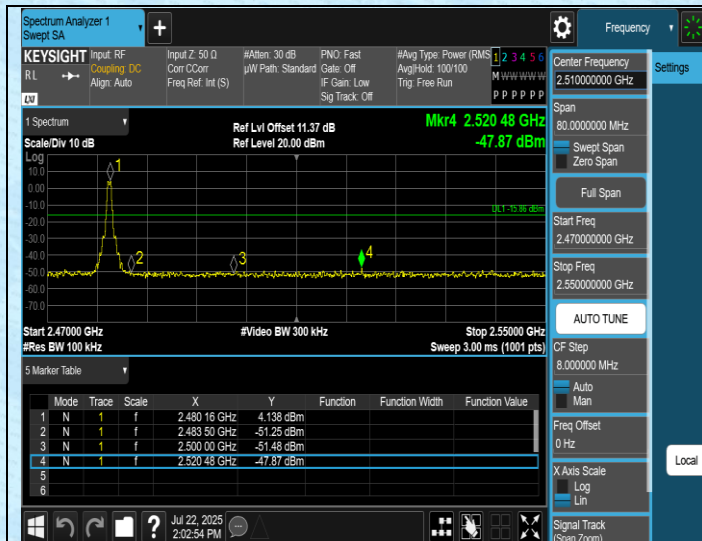


TX-Ant1-2480-PASS

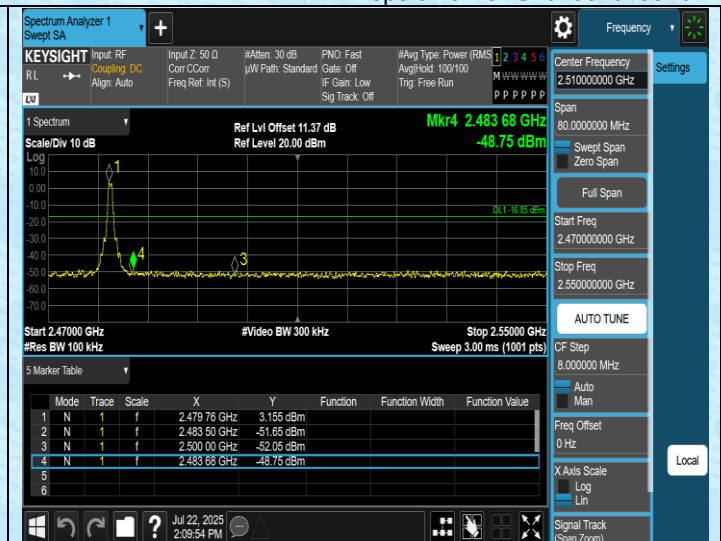

TX-Ant2-2480-PASS

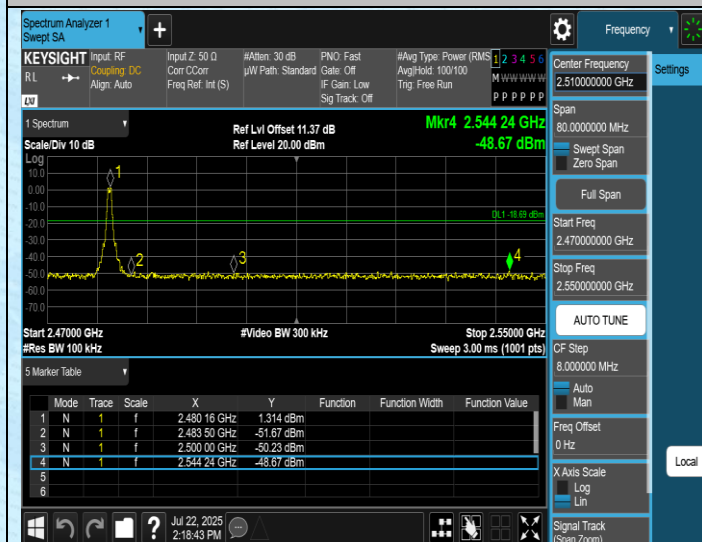

TX-Ant3-2480-PASS

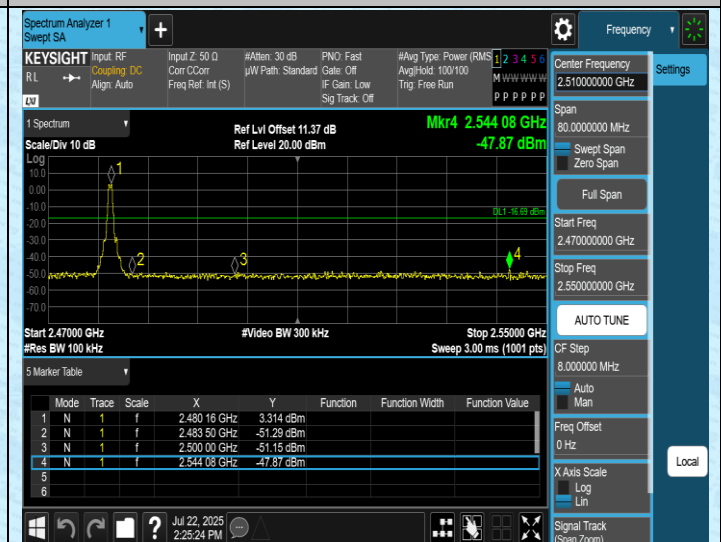

TX-Ant4-2480-PASS




Appendix F: Conducted Spurious Emission




Test Result





TestMode	Antenna	Frequency[MHz]	FreqRange [MHz]	RefLevel [dBm]	Result[dBm]	Limit[dBm]	Verdict
TX	Ant1	2402	0~Reference	5.15	5.15	---	PASS
TX	Ant1	2402	30~1000	5.15	-61.62	≤-14.85	PASS
TX	Ant1	2402	1000~26500	5.15	-41.65	≤-14.85	PASS
TX	Ant2	2402	0~Reference	3.79	3.79	---	PASS
TX	Ant2	2402	30~1000	3.79	-60.49	≤-16.21	PASS
TX	Ant2	2402	1000~26500	3.79	-42.21	≤-16.21	PASS
TX	Ant3	2402	0~Reference	2.31	2.31	---	PASS
TX	Ant3	2402	30~1000	2.31	-62.07	≤-17.69	PASS
TX	Ant3	2402	1000~26500	2.31	-40.58	≤-17.69	PASS
TX	Ant4	2402	0~Reference	4.49	4.49	---	PASS
TX	Ant4	2402	30~1000	4.49	-61.72	≤-15.51	PASS
TX	Ant4	2402	1000~26500	4.49	-41.99	≤-15.51	PASS
TX	Ant1	2440	0~Reference	4.98	4.98	---	PASS
TX	Ant1	2440	30~1000	4.98	-62.36	≤-15.02	PASS
TX	Ant1	2440	1000~26500	4.98	-42.17	≤-15.02	PASS
TX	Ant2	2440	0~Reference	3.77	3.77	---	PASS
TX	Ant2	2440	30~1000	3.77	-61.07	≤-16.23	PASS
TX	Ant2	2440	1000~26500	3.77	-41.85	≤-16.23	PASS
TX	Ant3	2440	0~Reference	2.23	2.23	---	PASS
TX	Ant3	2440	30~1000	2.23	-61.85	≤-17.77	PASS
TX	Ant3	2440	1000~26500	2.23	-41.89	≤-17.77	PASS
TX	Ant4	2440	0~Reference	4.25	4.25	---	PASS
TX	Ant4	2440	30~1000	4.25	-60.99	≤-15.75	PASS
TX	Ant4	2440	1000~26500	4.25	-42.15	≤-15.75	PASS
TX	Ant1	2480	0~Reference	4.29	4.29	---	PASS
TX	Ant1	2480	30~1000	4.29	-61.15	≤-15.71	PASS
TX	Ant1	2480	1000~26500	4.29	-41.71	≤-15.71	PASS
TX	Ant2	2480	0~Reference	3.21	3.21	---	PASS
TX	Ant2	2480	30~1000	3.21	-60.81	≤-16.79	PASS
TX	Ant2	2480	1000~26500	3.21	-41.54	≤-16.79	PASS
TX	Ant3	2480	0~Reference	1.46	1.46	---	PASS
TX	Ant3	2480	30~1000	1.46	-60.82	≤-18.54	PASS
TX	Ant3	2480	1000~26500	1.46	-42.17	≤-18.54	PASS
TX	Ant4	2480	0~Reference	3.39	3.39	---	PASS
TX	Ant4	2480	30~1000	3.39	-61.06	≤-16.61	PASS
TX	Ant4	2480	1000~26500	3.39	-42.26	≤-16.61	PASS



Test Graphs







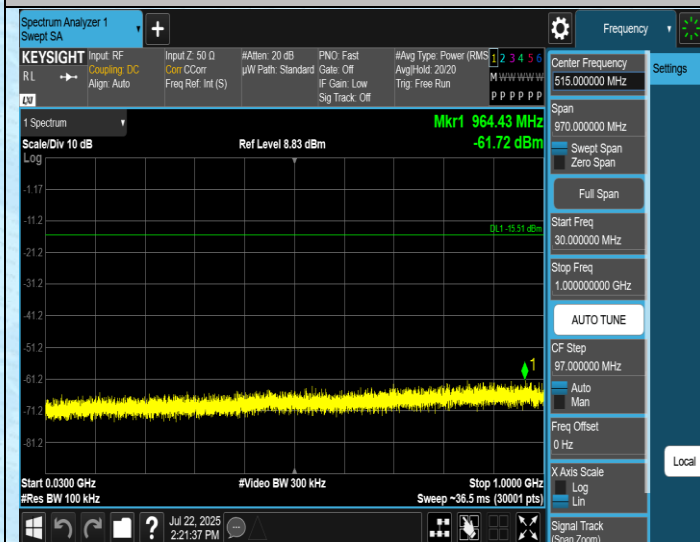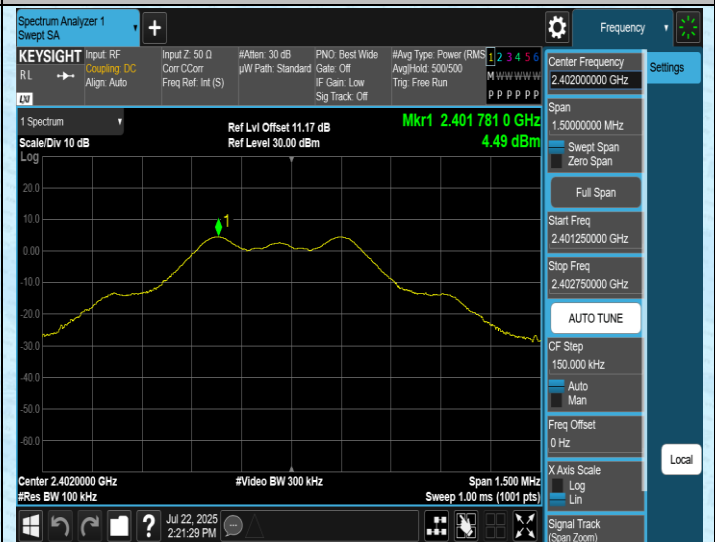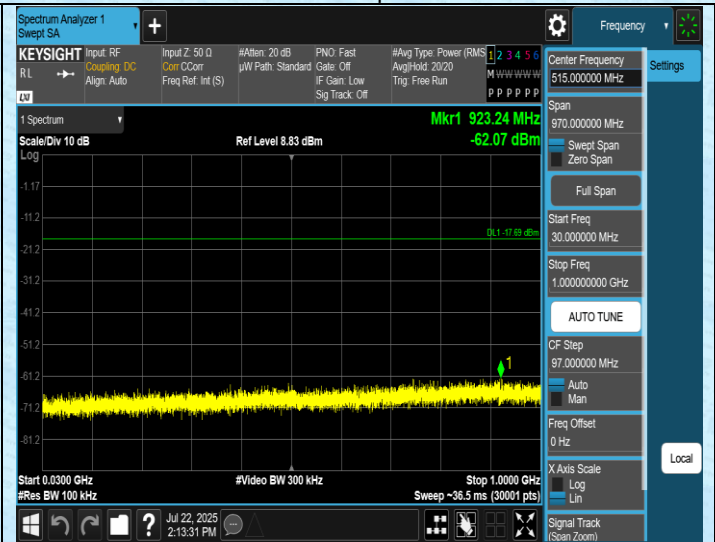

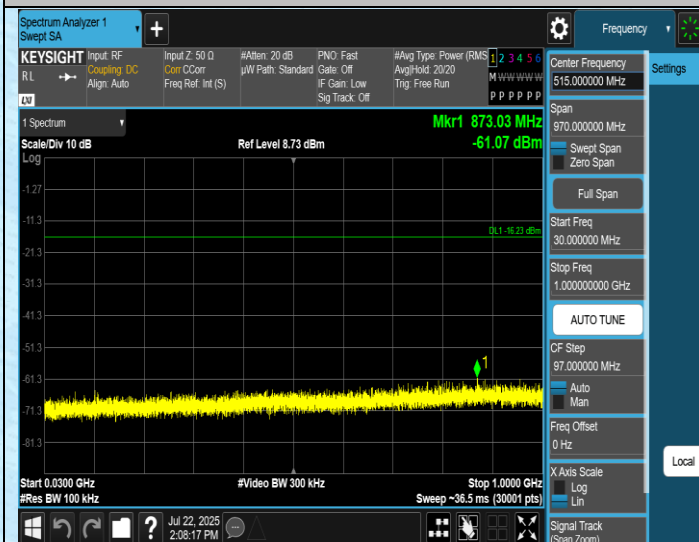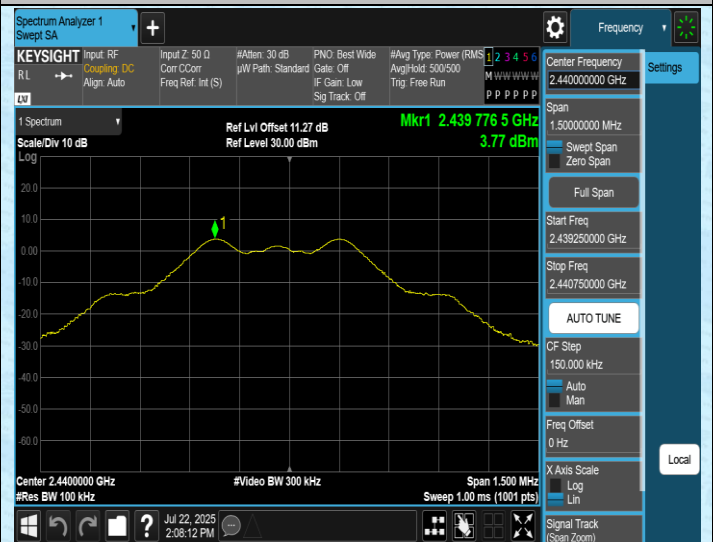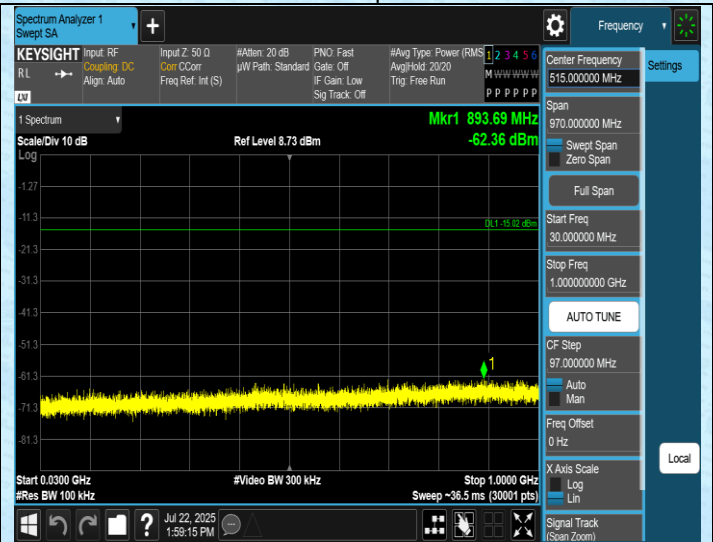

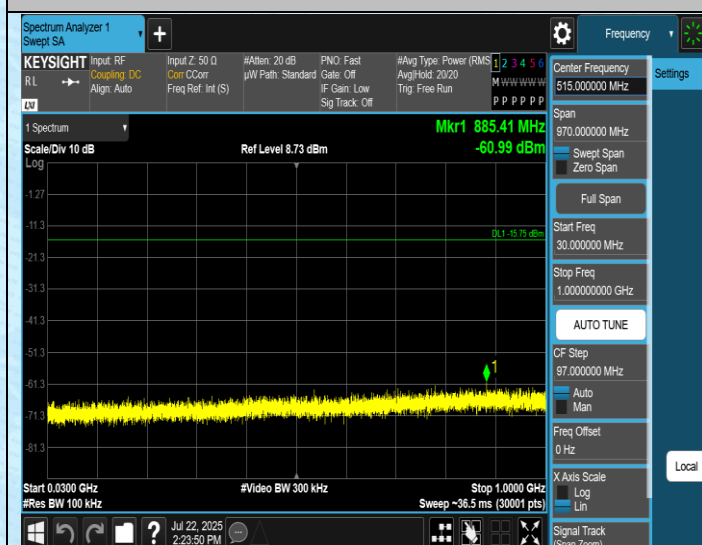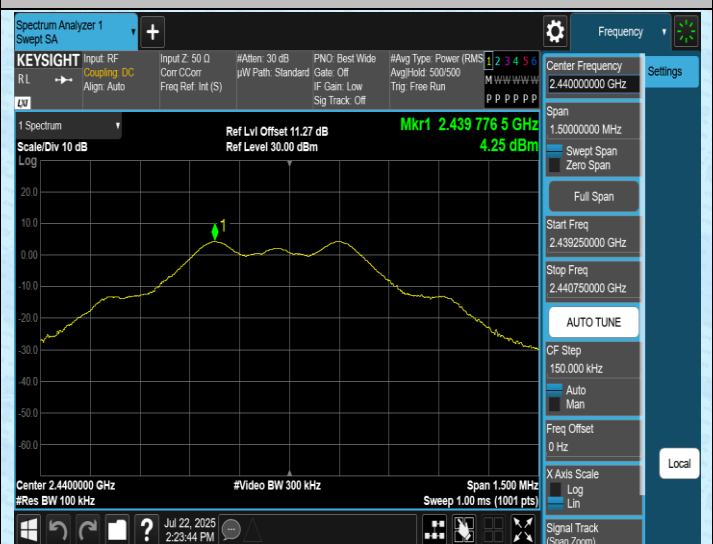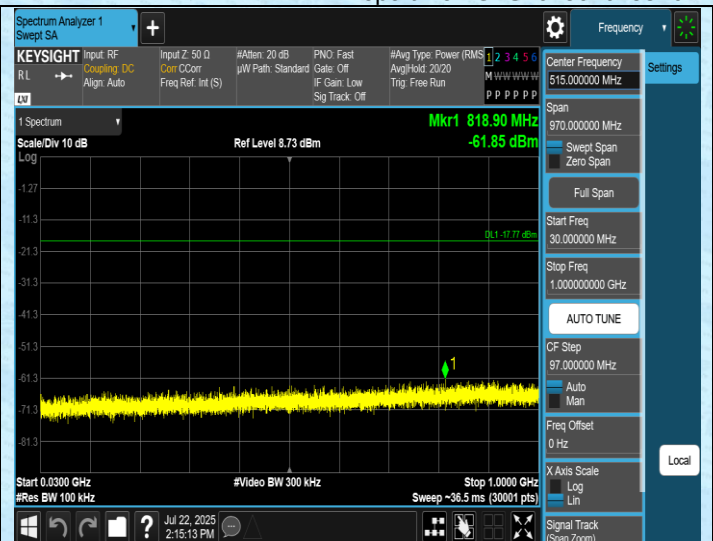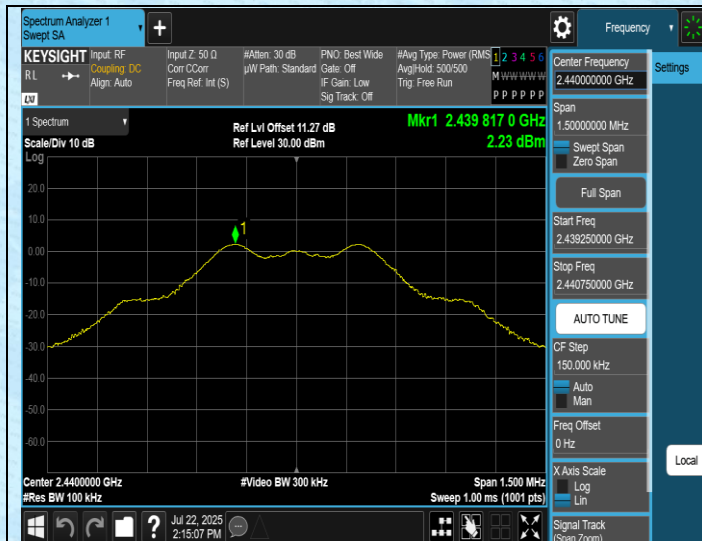

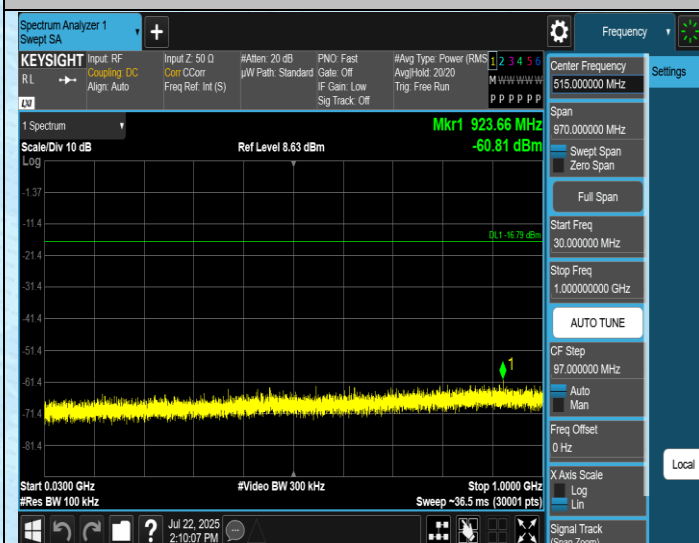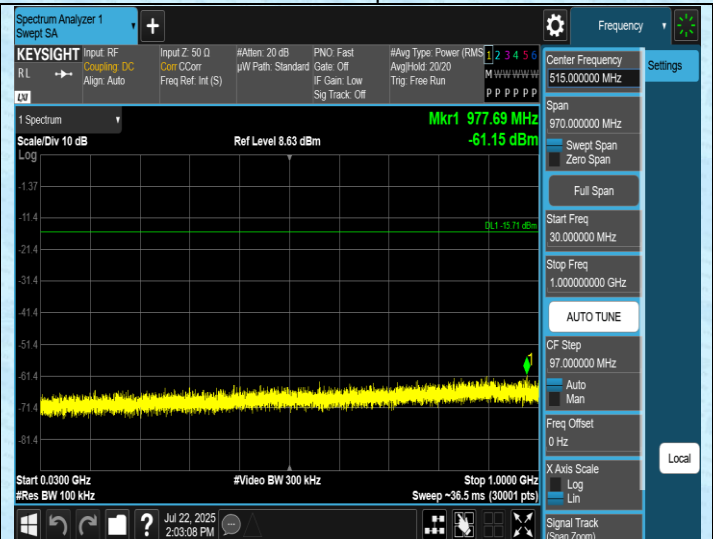

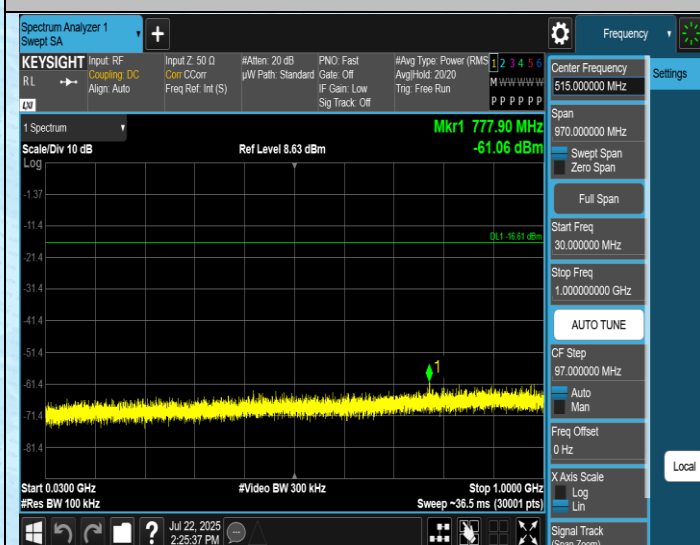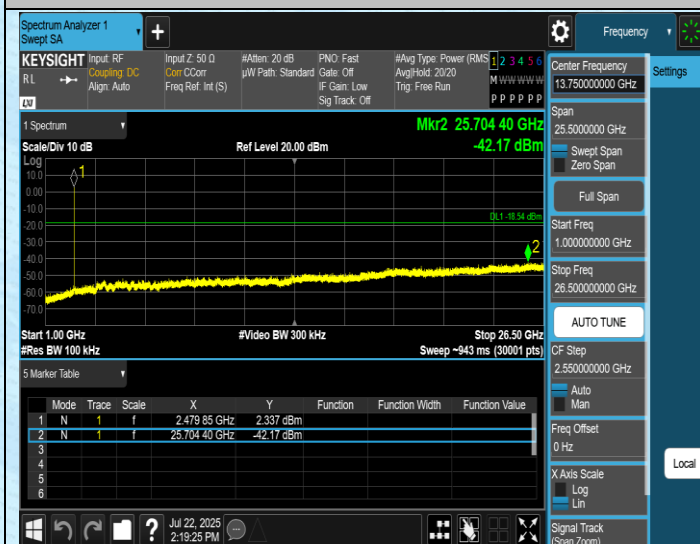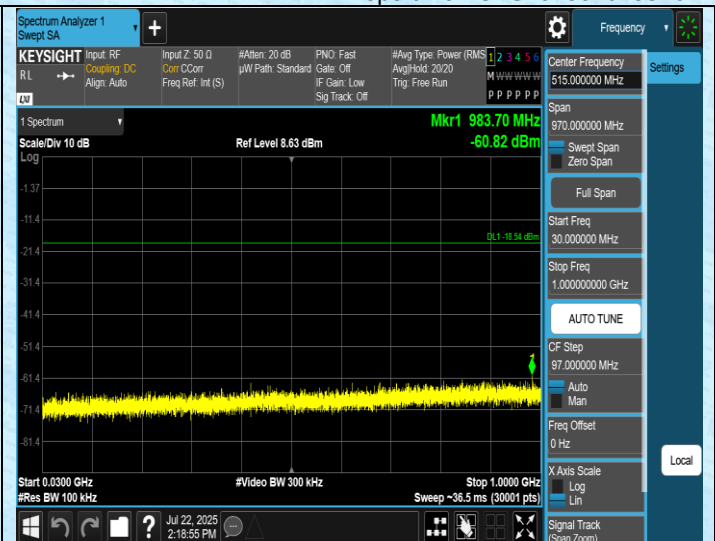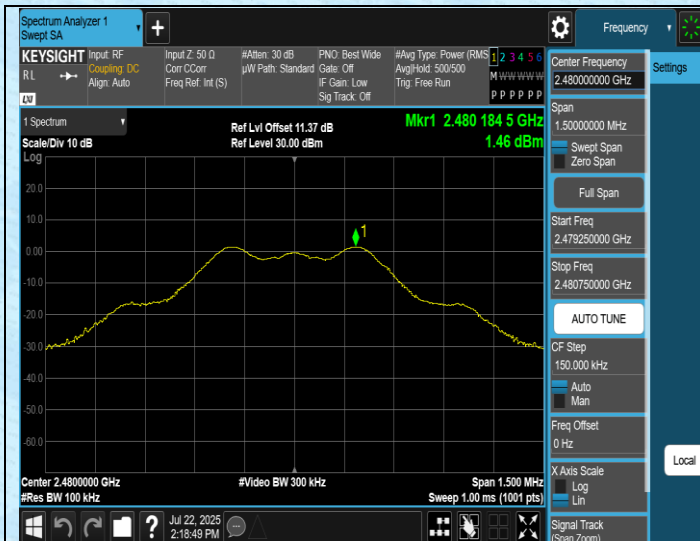

-----End-----