






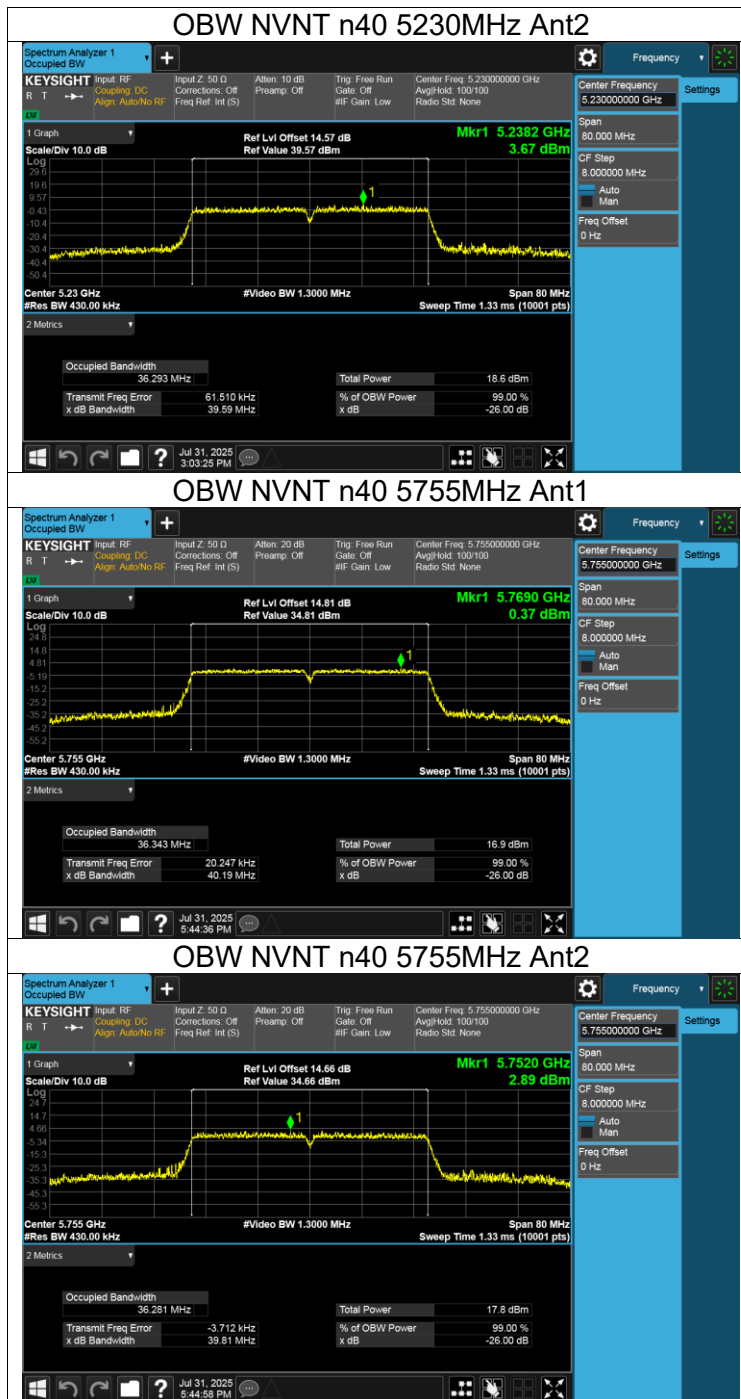


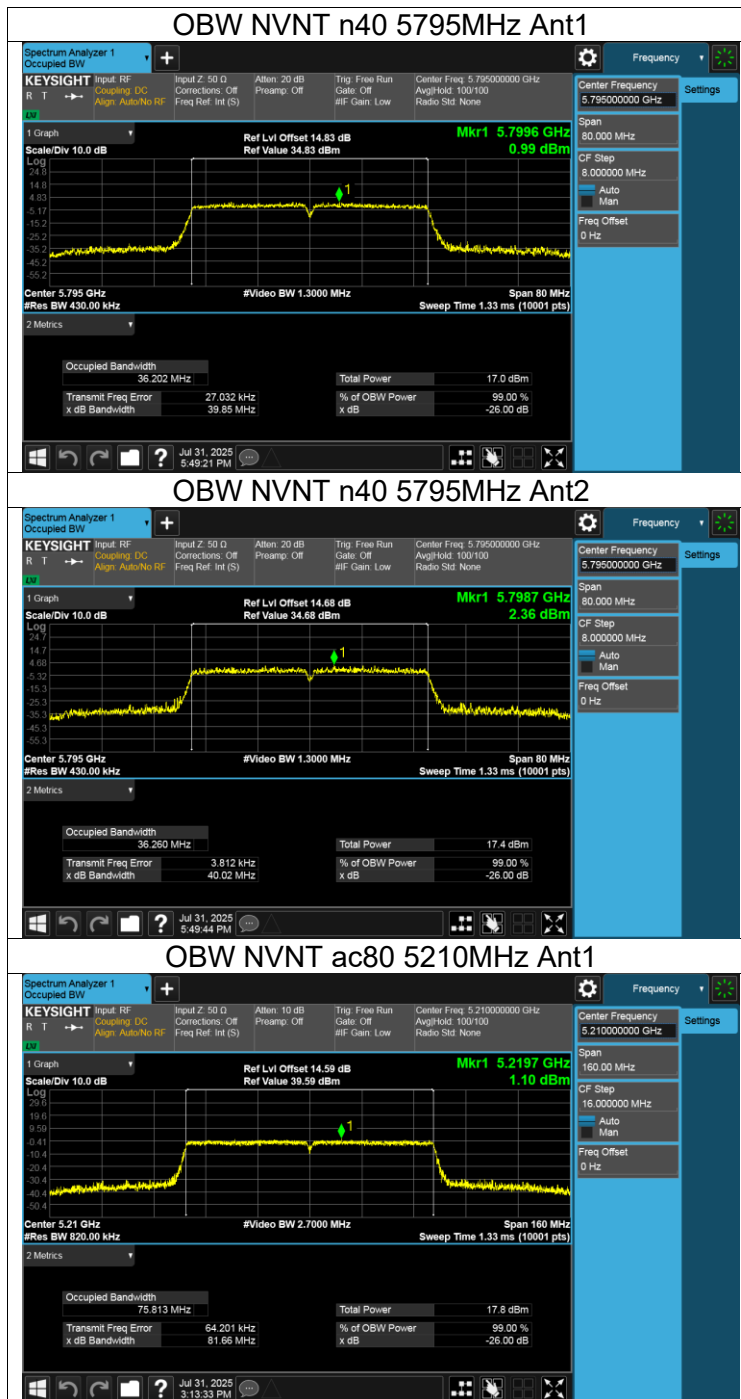


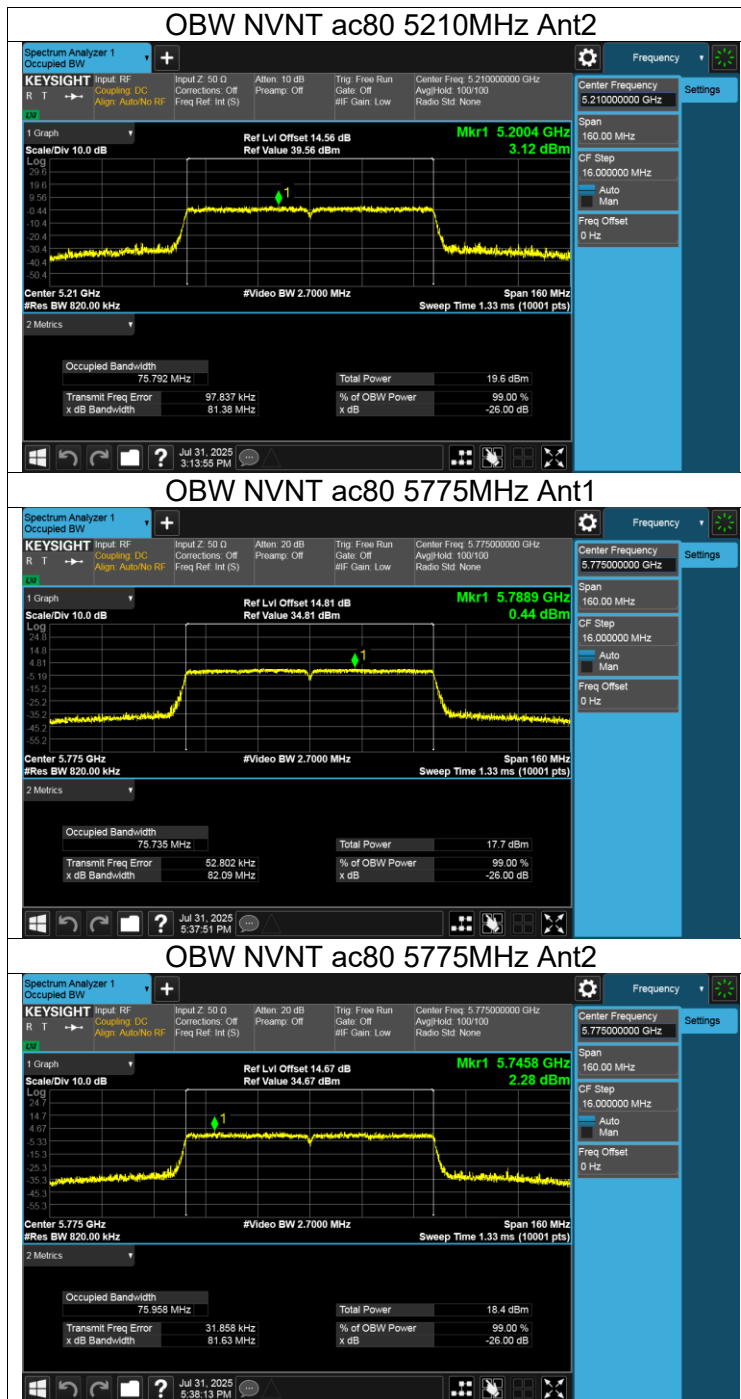


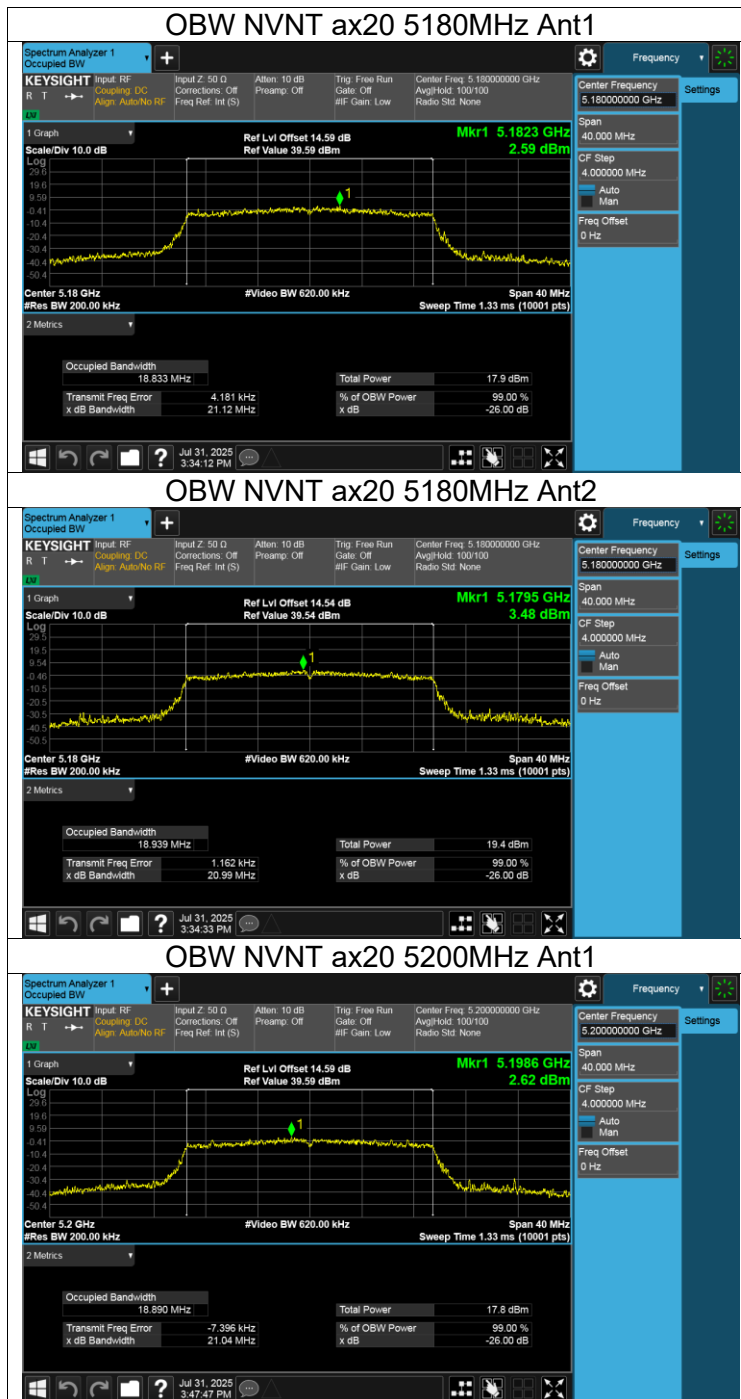


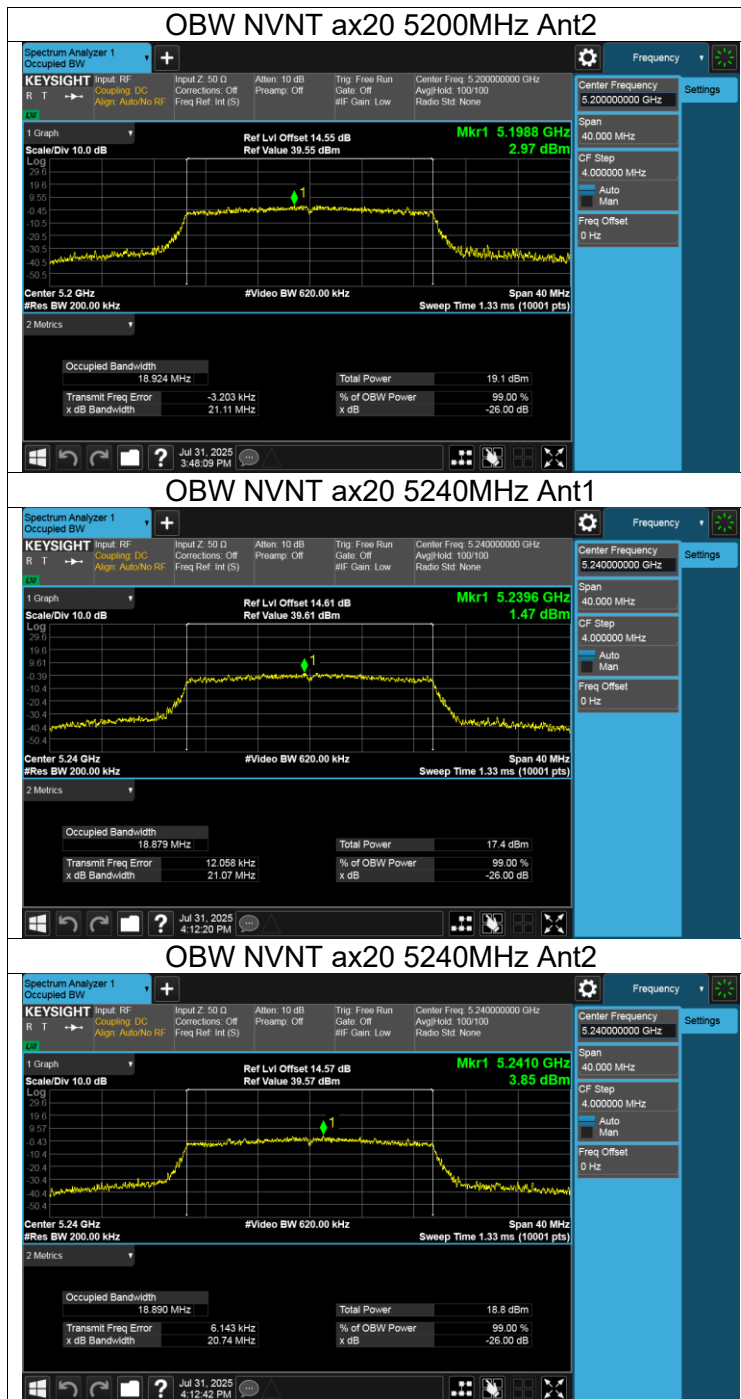


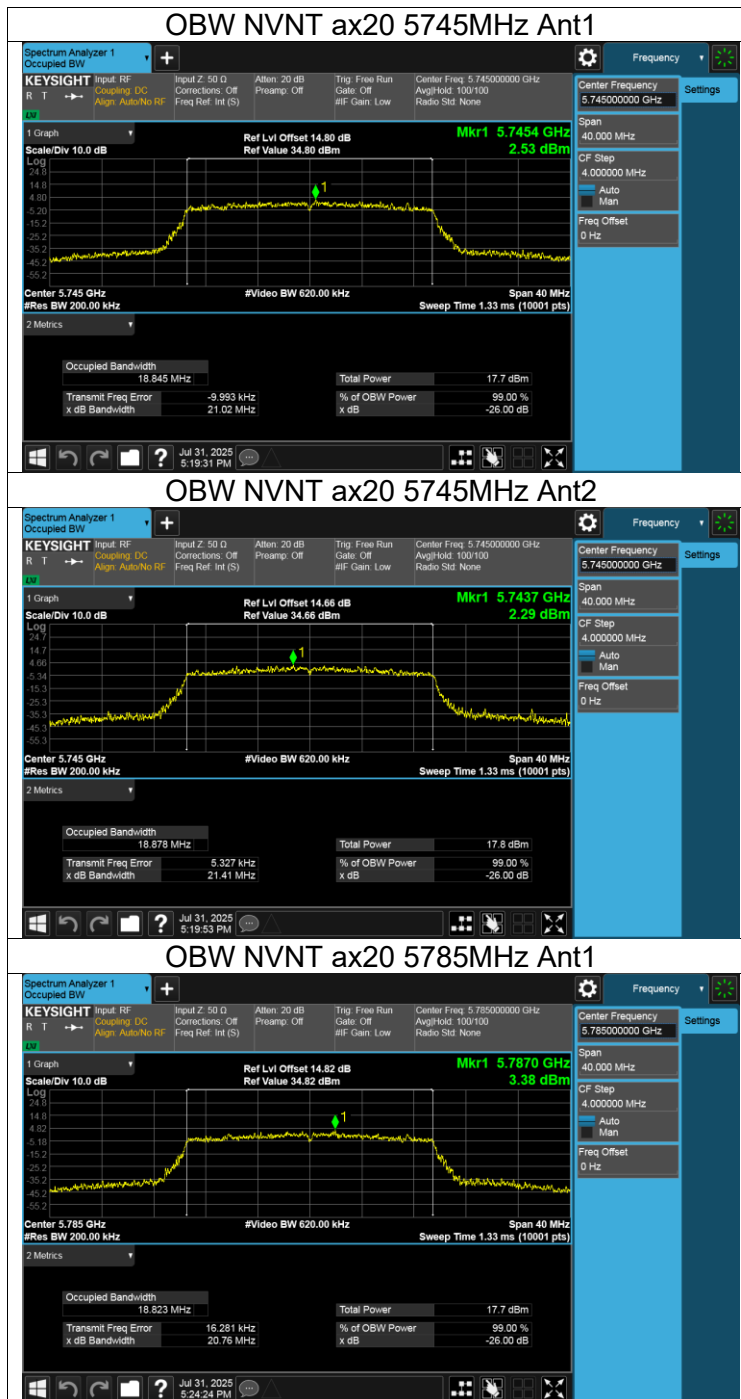


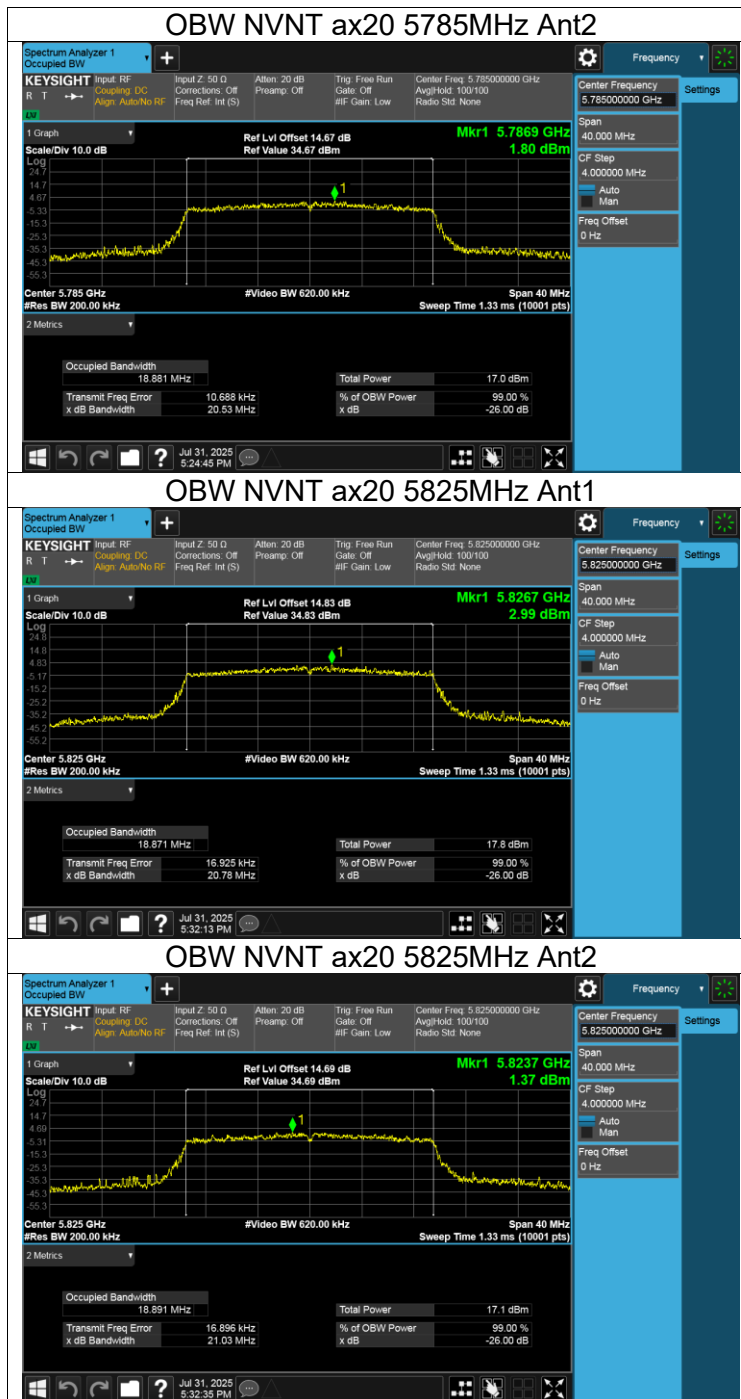

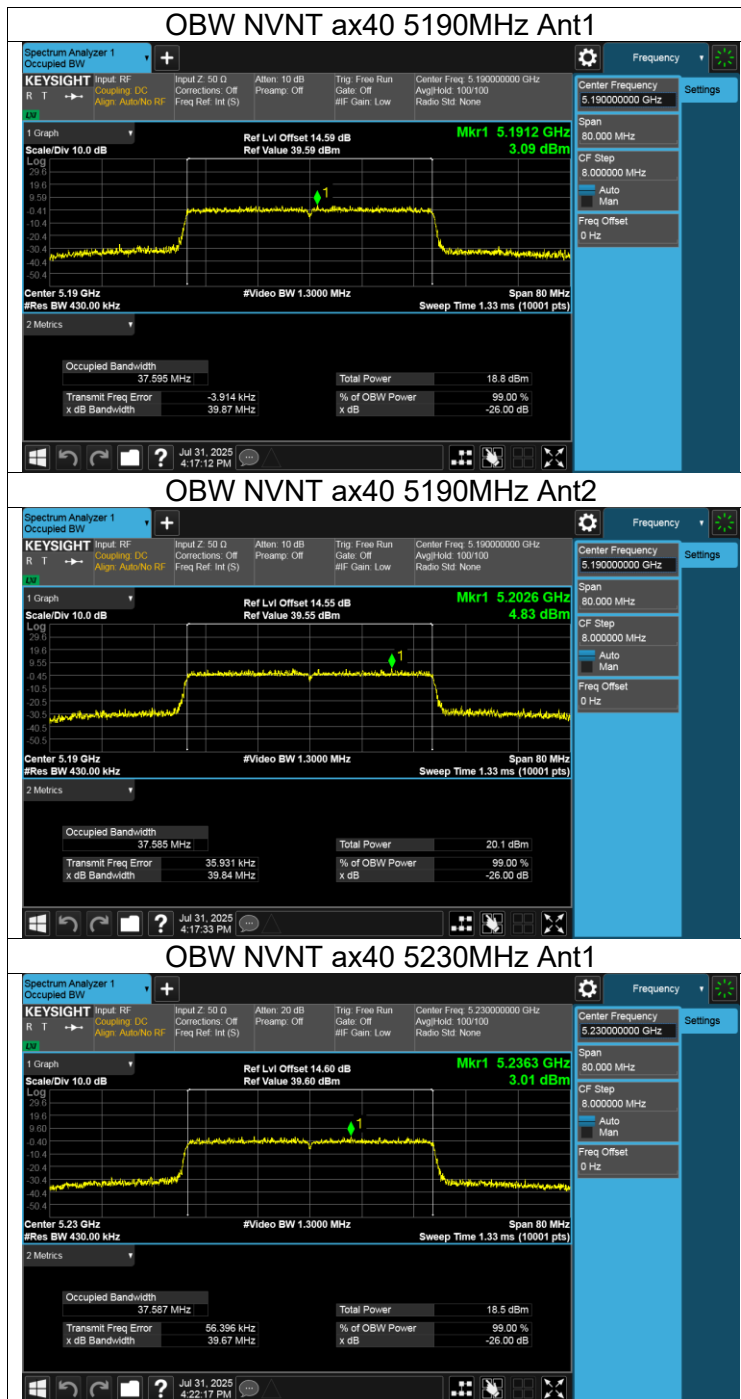

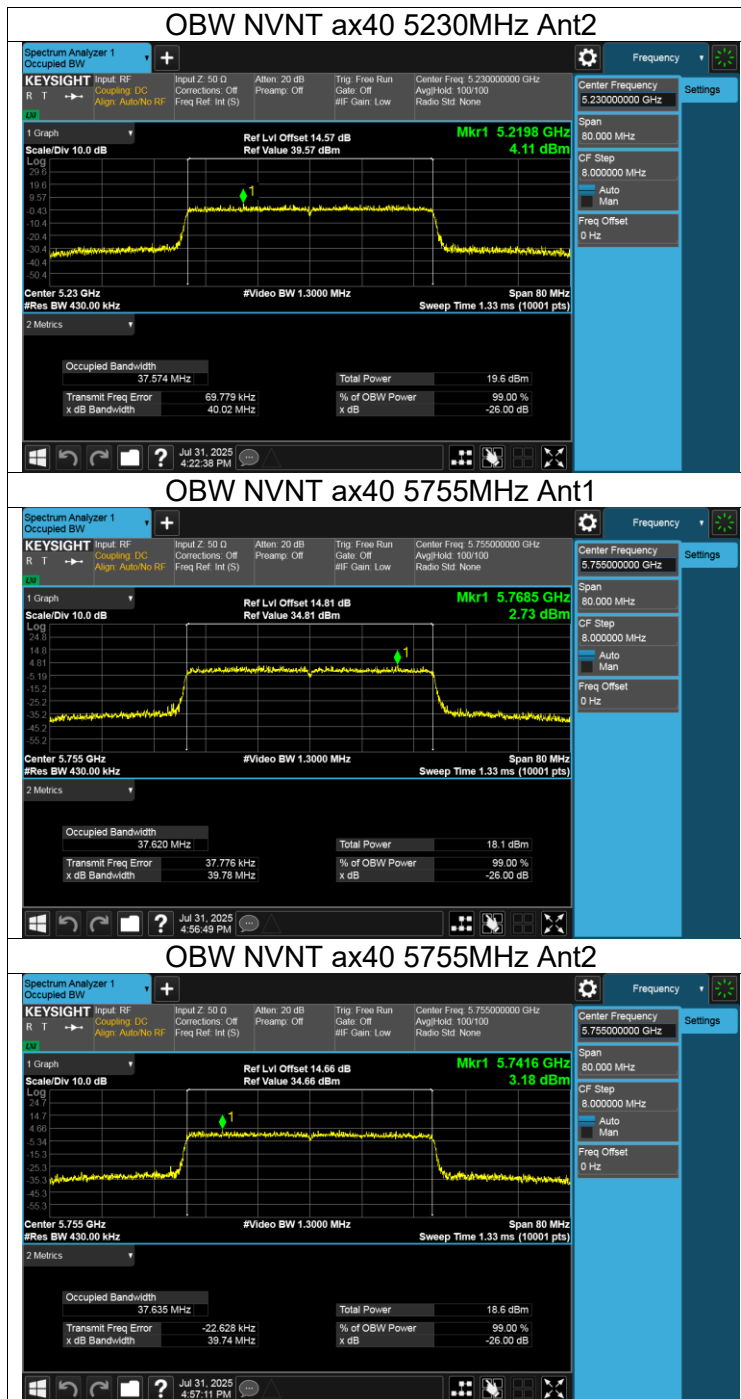

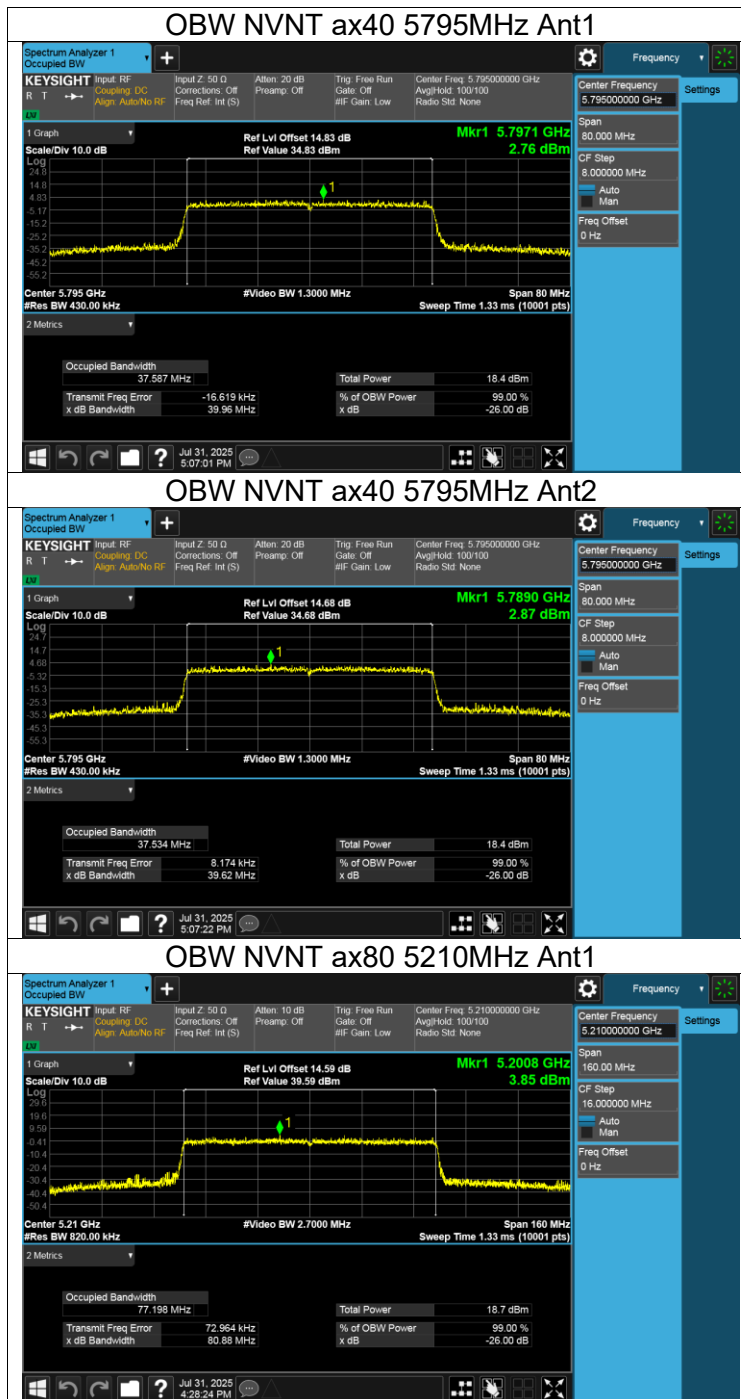


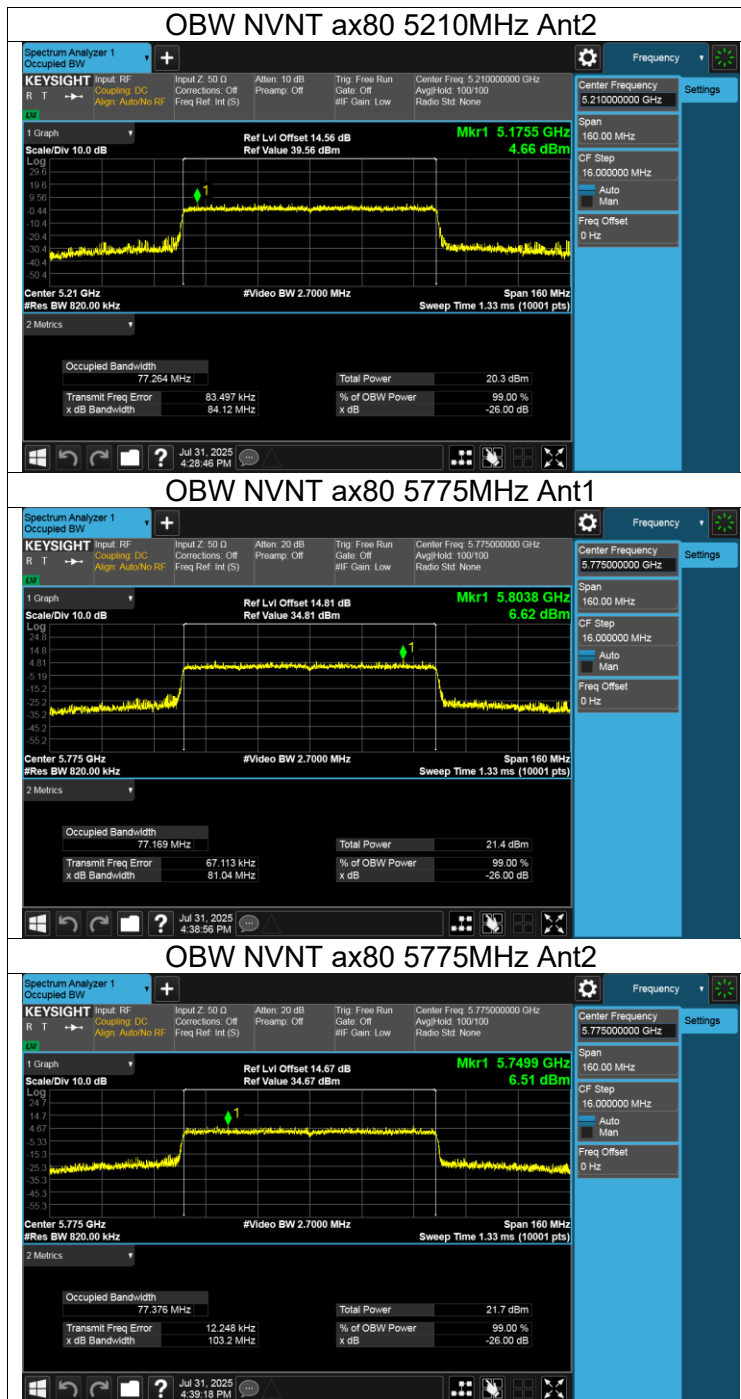


Appendix E:Maximum Power Spectral Density Level


Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
a	5180	Ant1	3.64	0.29	3.93	11	Pass
a	5200	Ant1	3.71	0.29	4	11	Pass
a	5240	Ant1	3.41	0.29	3.7	11	Pass
a	5745	Ant1	5.68	0.29	5.97	30	Pass
a	5785	Ant1	6.17	0.29	6.46	30	Pass
a	5825	Ant1	5.76	0.29	6.05	30	Pass
a	5180	Ant2	4.57	0.29	4.86	11	Pass
a	5200	Ant2	4.62	0.29	4.91	11	Pass
a	5240	Ant2	4.84	0.29	5.13	11	Pass
a	5745	Ant2	6.3	0.29	6.59	30	Pass
a	5785	Ant2	5.53	0.29	5.82	30	Pass
a	5825	Ant2	5.55	0.29	5.84	30	Pass
n20	5180	Ant1	2.68	0.31	2.99	11	Pass
n20	5180	Ant2	4.07	0.31	4.38	11	Pass
n20	5180	Sum	6.44	0.31	6.75	11	Pass
n20	5200	Ant1	2.26	0.31	2.57	11	Pass
n20	5200	Ant2	3.72	0.31	4.03	11	Pass
n20	5200	Sum	6.06	0.31	6.37	11	Pass
n20	5240	Ant1	2.15	0.31	2.46	11	Pass
n20	5240	Ant2	3.4	0.31	3.71	11	Pass
n20	5240	Sum	5.83	0.31	6.14	11	Pass
n20	5745	Ant1	2.61	0.31	2.92	30	Pass
n20	5745	Ant2	3.38	0.31	3.69	30	Pass
n20	5745	Sum	6.02	0.31	6.33	30	Pass
n20	5785	Ant1	2.87	0.31	3.18	30	Pass
n20	5785	Ant2	2.97	0.31	3.28	30	Pass
n20	5785	Sum	5.93	0.31	6.24	30	Pass
n20	5825	Ant1	2.88	0.31	3.19	30	Pass
n20	5825	Ant2	3.14	0.31	3.45	30	Pass
n20	5825	Sum	6.02	0.31	6.33	30	Pass
n40	5190	Ant1	-2.47	0.61	-1.86	11	Pass
n40	5190	Ant2	-1.41	0.61	-0.8	11	Pass
n40	5190	Sum	1.1	0.61	1.71	11	Pass
n40	5230	Ant1	-2.96	0.61	-2.35	11	Pass
n40	5230	Ant2	-1.26	0.61	-0.65	11	Pass
n40	5230	Sum	0.98	0.61	1.59	11	Pass
n40	5755	Ant1	-2.18	0.61	-1.57	30	Pass
n40	5755	Ant2	-1.69	0.61	-1.08	30	Pass
n40	5755	Sum	1.08	0.61	1.69	30	Pass
n40	5795	Ant1	-1.93	0.61	-1.32	30	Pass
n40	5795	Ant2	-2.22	0.61	-1.61	30	Pass
n40	5795	Sum	0.94	0.61	1.55	30	Pass
ac80	5210	Ant1	-5.86	0.65	-5.21	11	Pass
ac80	5210	Ant2	-4.4	0.65	-3.75	11	Pass
ac80	5210	Sum	-2.06	0.65	-1.41	11	Pass
ac80	5775	Ant1	-5.63	0.65	-4.98	30	Pass

ac80	5775	Ant2	-4.97	0.65	-4.32	30	Pass
ac80	5775	Sum	-2.28	0.65	-1.63	30	Pass
ax20	5180	Ant1	1.3	0.4	1.7	11	Pass
ax20	5180	Ant2	3.18	0.4	3.58	11	Pass
ax20	5180	Sum	5.35	0.4	5.75	11	Pass
ax20	5200	Ant1	1.27	0.4	1.67	11	Pass
ax20	5200	Ant2	2.54	0.4	2.94	11	Pass
ax20	5200	Sum	4.96	0.4	5.36	11	Pass
ax20	5240	Ant1	0.95	0.4	1.35	11	Pass
ax20	5240	Ant2	2.57	0.4	2.97	11	Pass
ax20	5240	Sum	4.85	0.4	5.25	11	Pass
ax20	5745	Ant1	1.8	0.4	2.2	30	Pass
ax20	5745	Ant2	1.69	0.4	2.09	30	Pass
ax20	5745	Sum	4.76	0.4	5.16	30	Pass
ax20	5785	Ant1	1.45	0.4	1.85	30	Pass
ax20	5785	Ant2	1.51	0.4	1.91	30	Pass
ax20	5785	Sum	4.49	0.4	4.89	30	Pass
ax20	5825	Ant1	1.34	0.4	1.74	30	Pass
ax20	5825	Ant2	1.19	0.4	1.59	30	Pass
ax20	5825	Sum	4.28	0.4	4.68	30	Pass
ax40	5190	Ant1	-1.89	0.4	-1.49	11	Pass
ax40	5190	Ant2	-0.74	0.4	-0.34	11	Pass
ax40	5190	Sum	1.73	0.4	2.13	11	Pass
ax40	5230	Ant1	-2.45	0.4	-2.05	11	Pass
ax40	5230	Ant2	-1.03	0.4	-0.63	11	Pass
ax40	5230	Sum	1.33	0.4	1.73	11	Pass
ax40	5755	Ant1	-1.71	0.4	-1.31	30	Pass
ax40	5755	Ant2	-1.23	0.4	-0.83	30	Pass
ax40	5755	Sum	1.55	0.4	1.95	30	Pass
ax40	5795	Ant1	-1.09	0.4	-0.69	30	Pass
ax40	5795	Ant2	-1.53	0.4	-1.13	30	Pass
ax40	5795	Sum	1.71	0.4	2.11	30	Pass
ax80	5210	Ant1	-5.71	0.76	-4.95	11	Pass
ax80	5210	Ant2	-3.84	0.76	-3.08	11	Pass
ax80	5210	Sum	-1.66	0.76	-0.9	11	Pass
ax80	5775	Ant1	-5.32	0.76	-4.56	30	Pass
ax80	5775	Ant2	-5.2	0.76	-4.44	30	Pass
ax80	5775	Sum	-2.25	0.76	-1.49	30	Pass

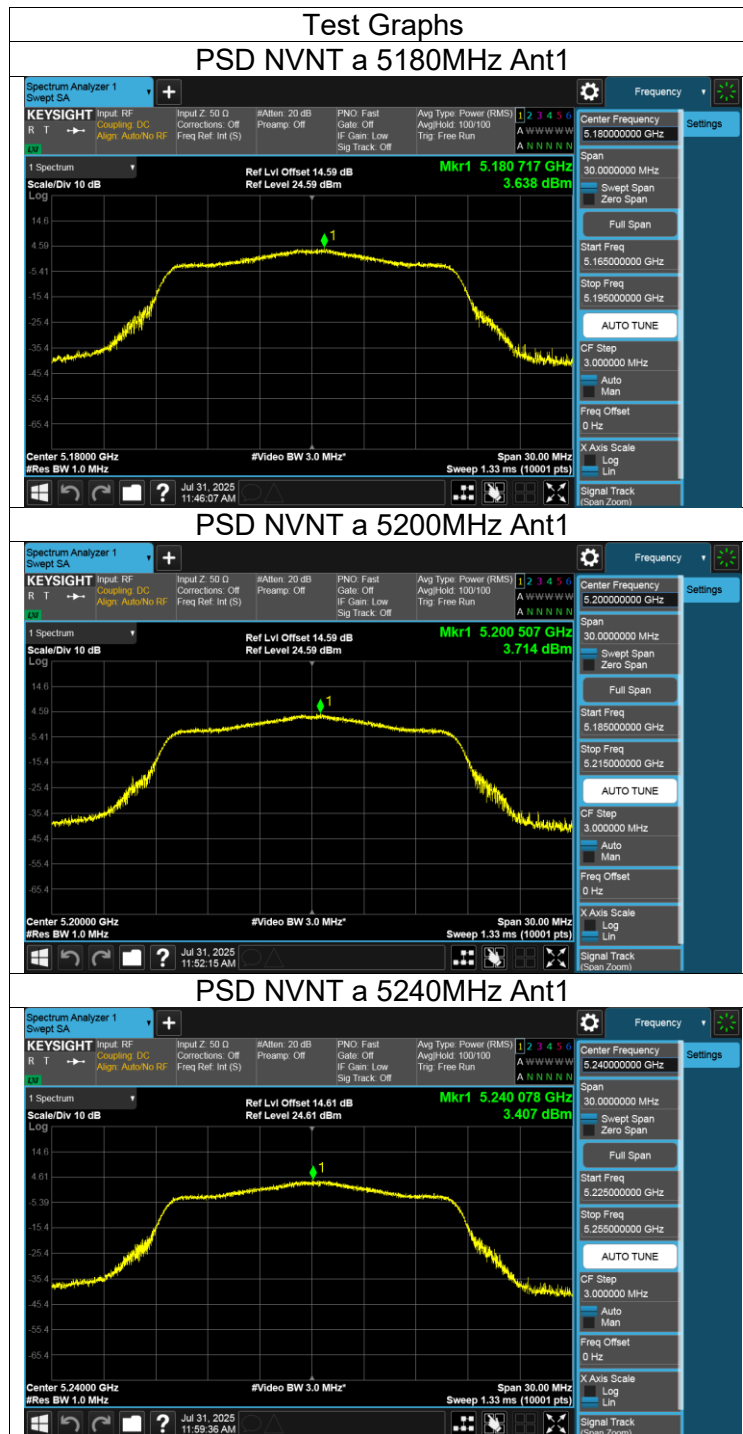


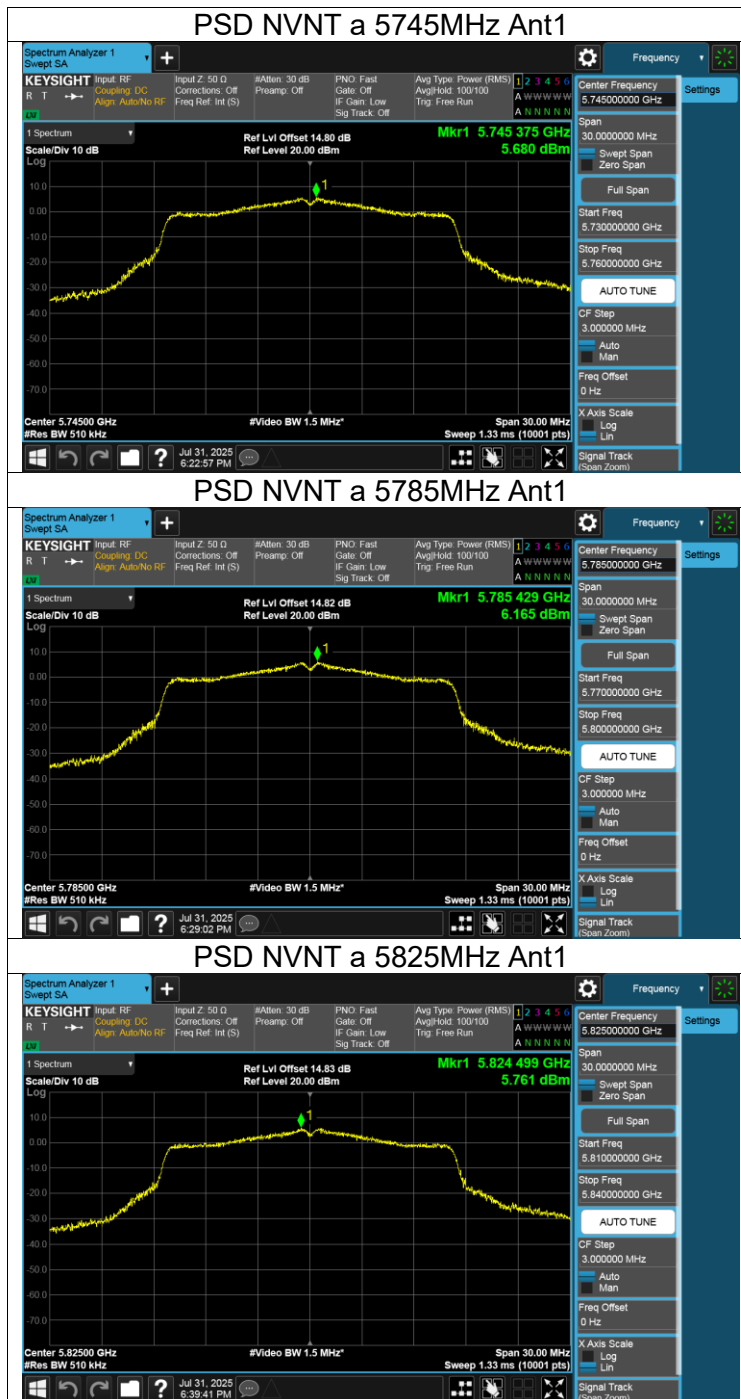

PSD NVNT a 5180MHz Ant2

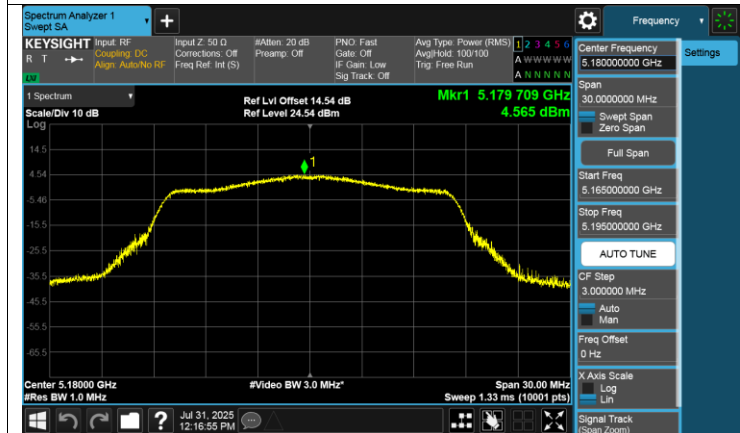

PSD NVNT a 5200MHz Ant2

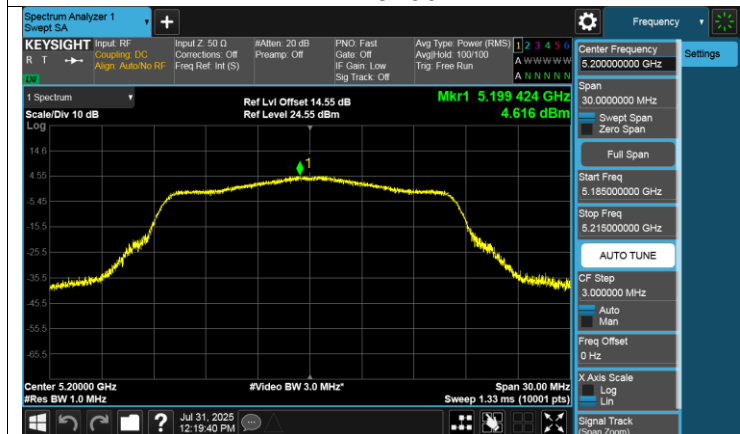

PSD NVNT a 5240MHz Ant2

