


Appendix Test Data

Report No.:	1811C50628416201-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-6	Finish Test Date:	2026-1-7
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	21.8°C	Relative Humidity:	37%
Pressure:	101kPa		

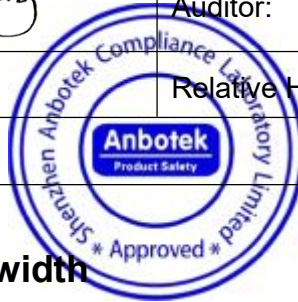


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.957	2401.544	2402.501	---	---
DH5	Ant1	2441	0.951	2440.547	2441.498	---	---
DH5	Ant1	2480	0.957	2479.547	2480.504	---	---
2DH5	Ant1	2402	1.275	2401.382	2402.657	---	---
2DH5	Ant1	2441	1.326	2440.343	2441.669	---	---
2DH5	Ant1	2480	1.284	2479.376	2480.660	---	---
3DH5	Ant1	2402	1.197	2401.403	2402.600	---	---
3DH5	Ant1	2441	1.275	2440.382	2441.657	---	---
3DH5	Ant1	2480	1.272	2479.397	2480.669	---	---


Test Graphs

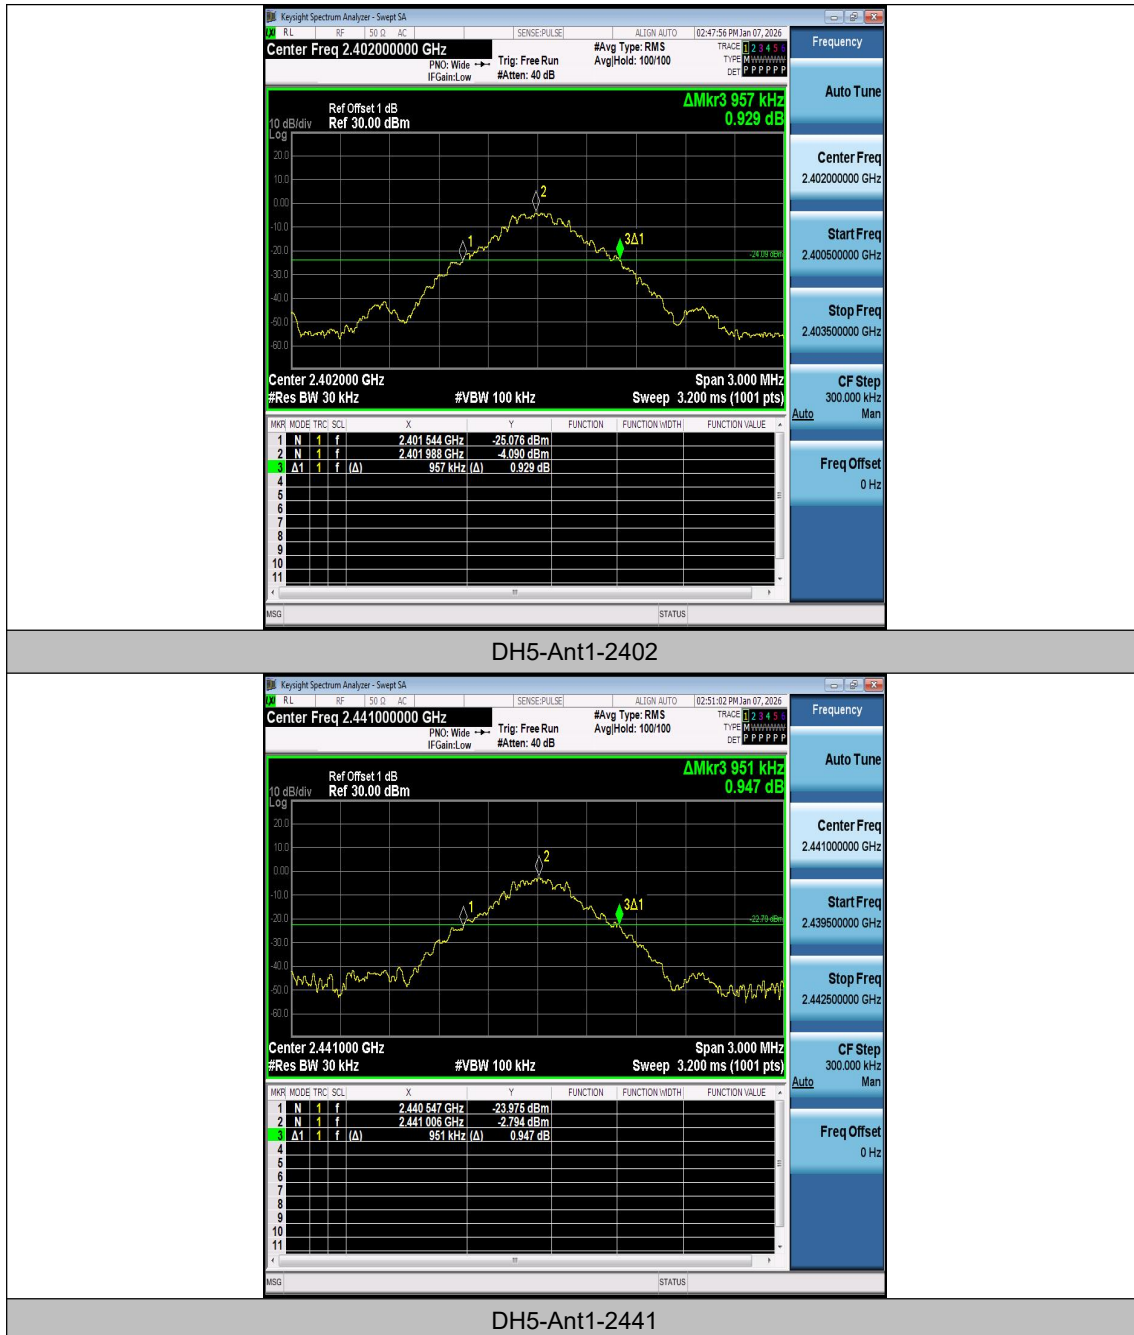


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

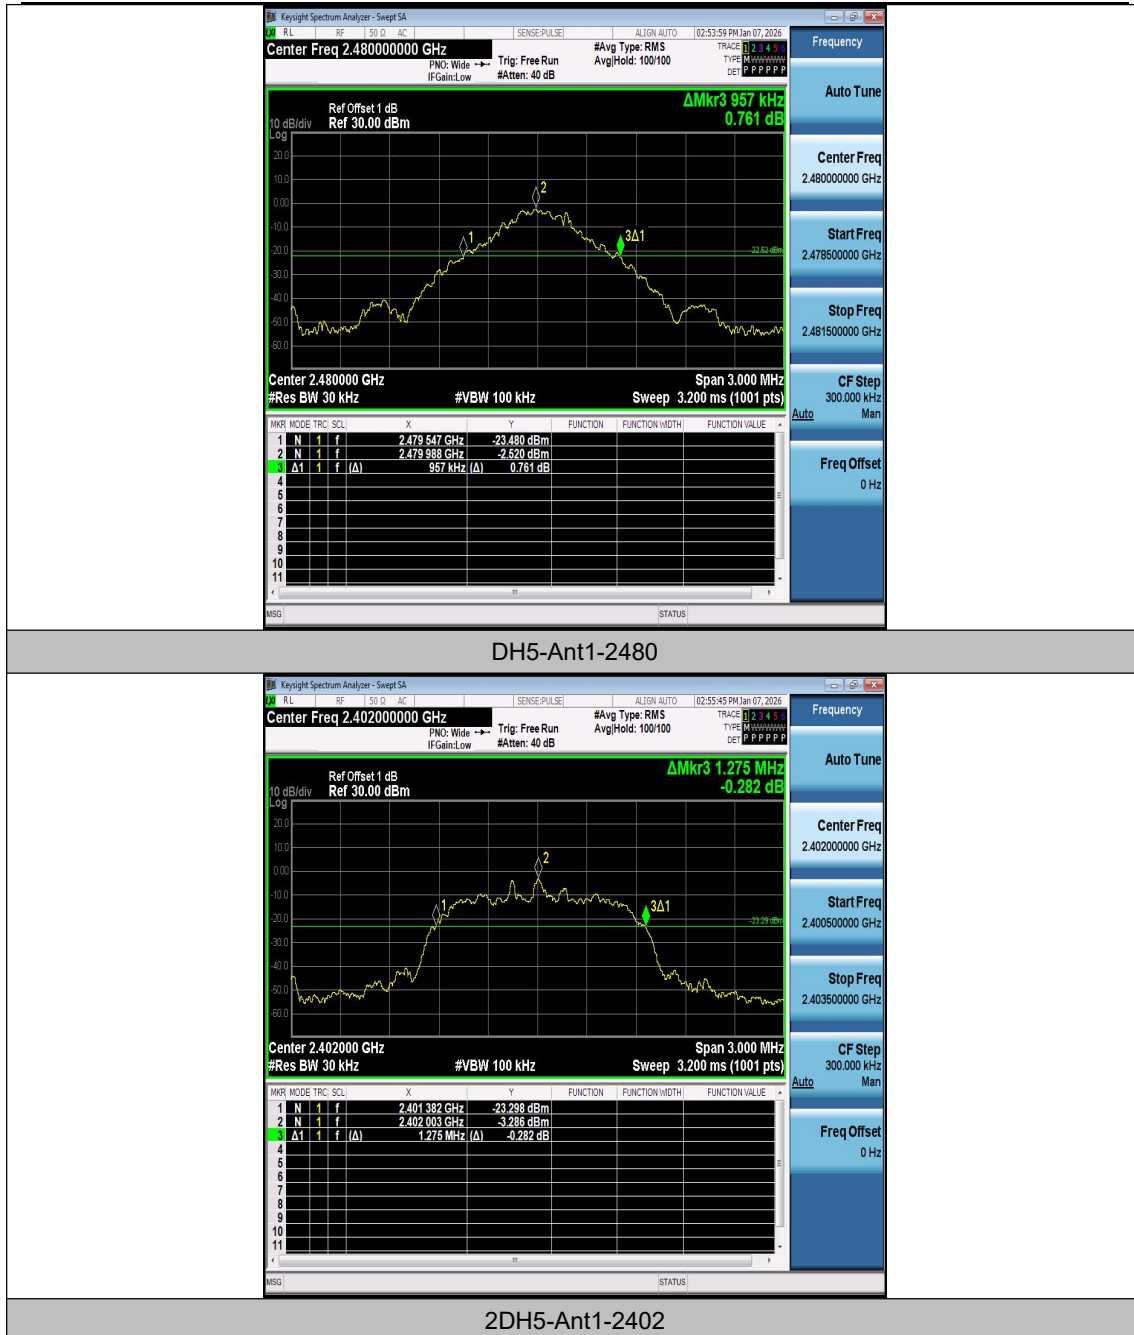



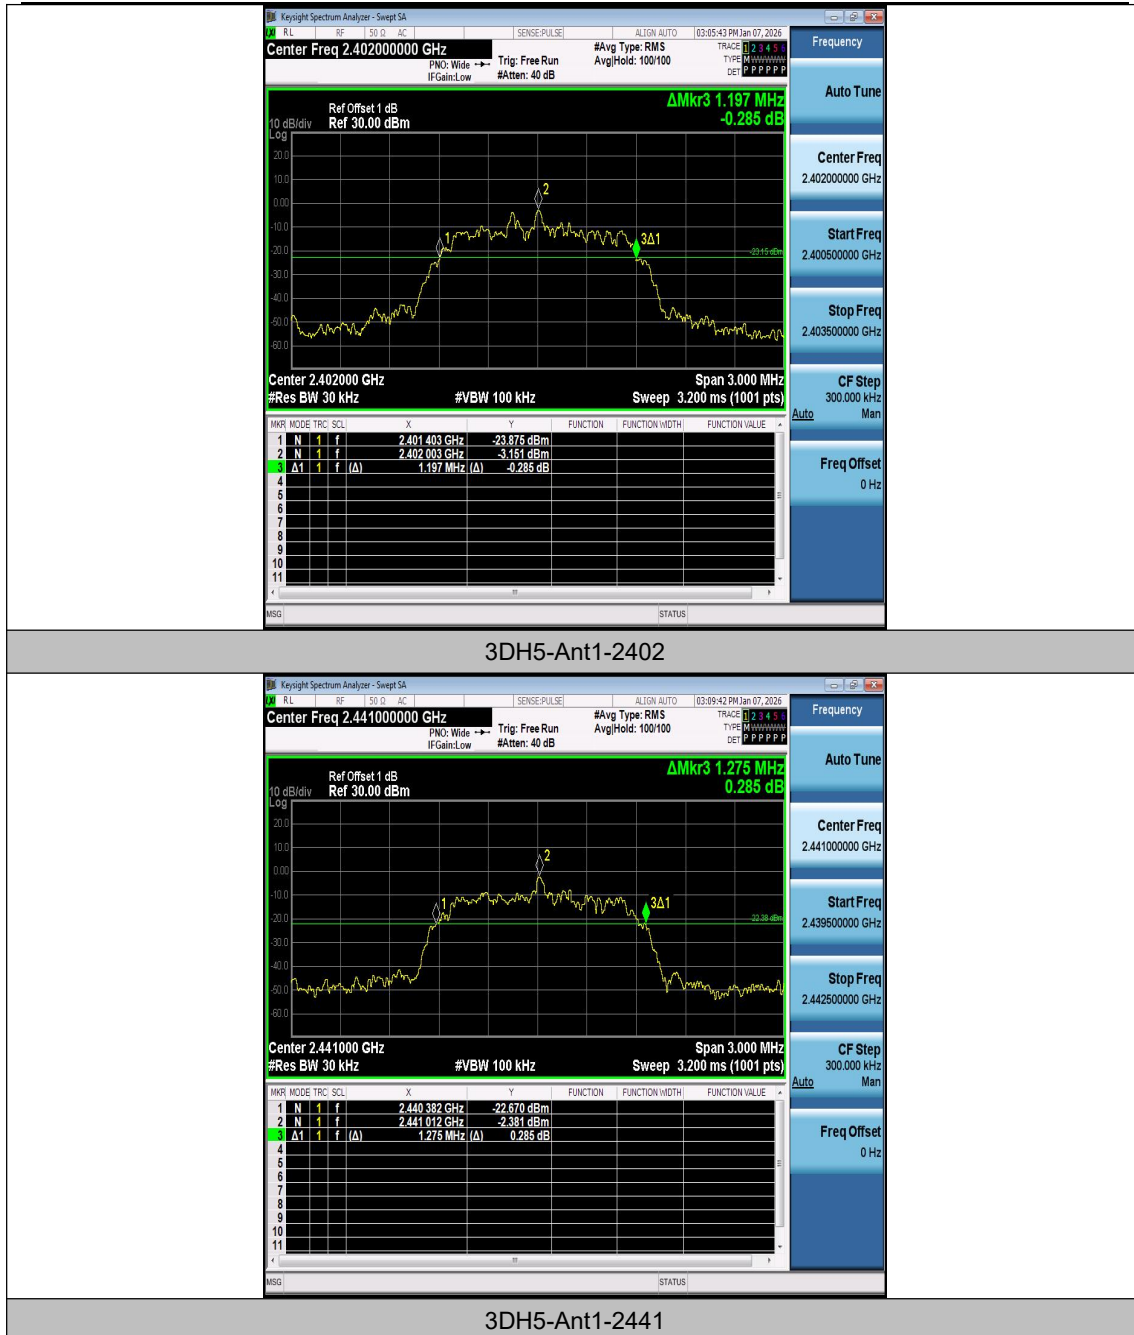



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.86506	2401.5748	2402.4399	---	---
DH5	Ant1	2441	0.87386	2440.5704	2441.4442	---	---
DH5	Ant1	2480	0.85491	2479.5779	2480.4328	---	---
2DH5	Ant1	2402	1.1832	2401.4150	2402.5982	---	---
2DH5	Ant1	2441	1.1827	2440.4156	2441.5983	---	---
2DH5	Ant1	2480	1.1894	2479.4138	2480.6032	---	---
3DH5	Ant1	2402	1.1851	2401.4197	2402.6048	---	---
3DH5	Ant1	2441	1.1869	2440.4162	2441.6031	---	---
3DH5	Ant1	2480	1.1772	2479.4175	2480.5947	---	---

Test Graphs

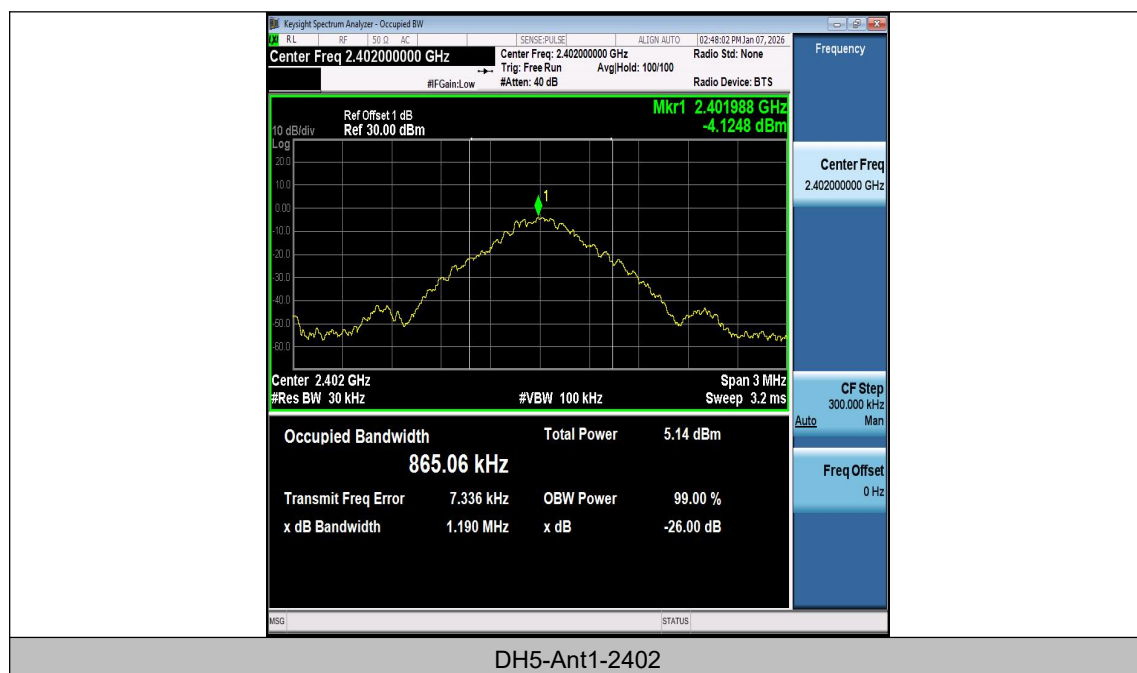



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	-1.42	≤20.97	PASS
DH5	Ant1	2441	-0.35	≤20.97	PASS
DH5	Ant1	2480	0.10	≤20.97	PASS
2DH5	Ant1	2402	-0.45	≤20.97	PASS
2DH5	Ant1	2441	0.31	≤20.97	PASS
2DH5	Ant1	2480	1.10	≤20.97	PASS
3DH5	Ant1	2402	-0.20	≤20.97	PASS
3DH5	Ant1	2441	0.56	≤20.97	PASS
3DH5	Ant1	2480	0.87	≤20.97	PASS

Test Graphs

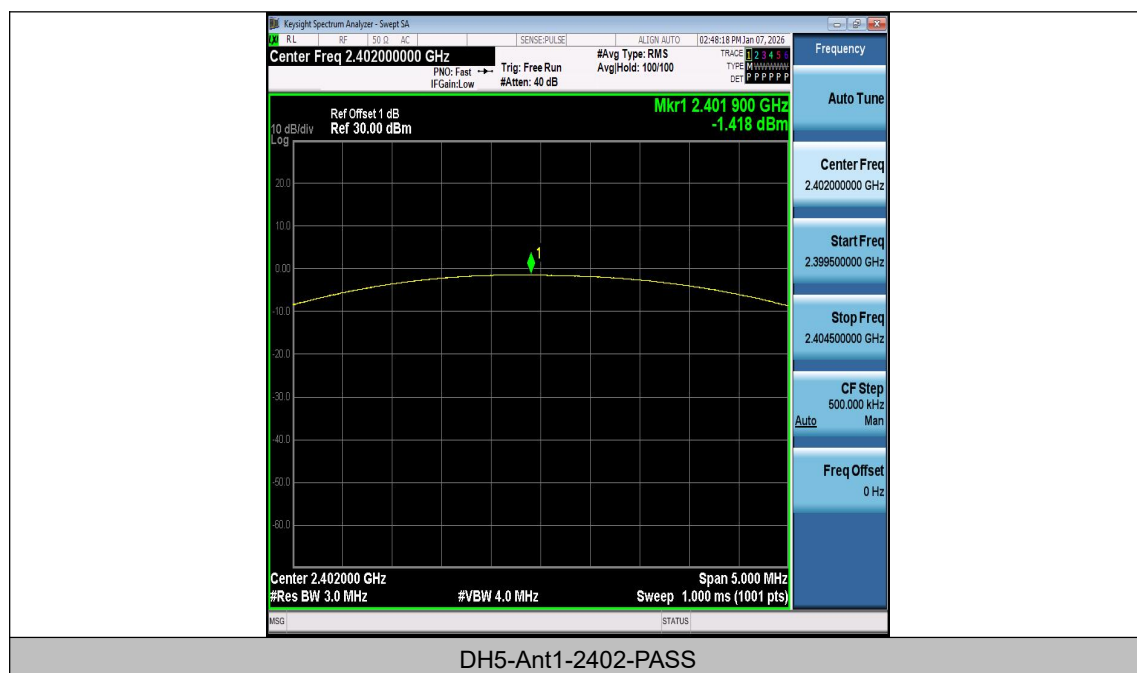


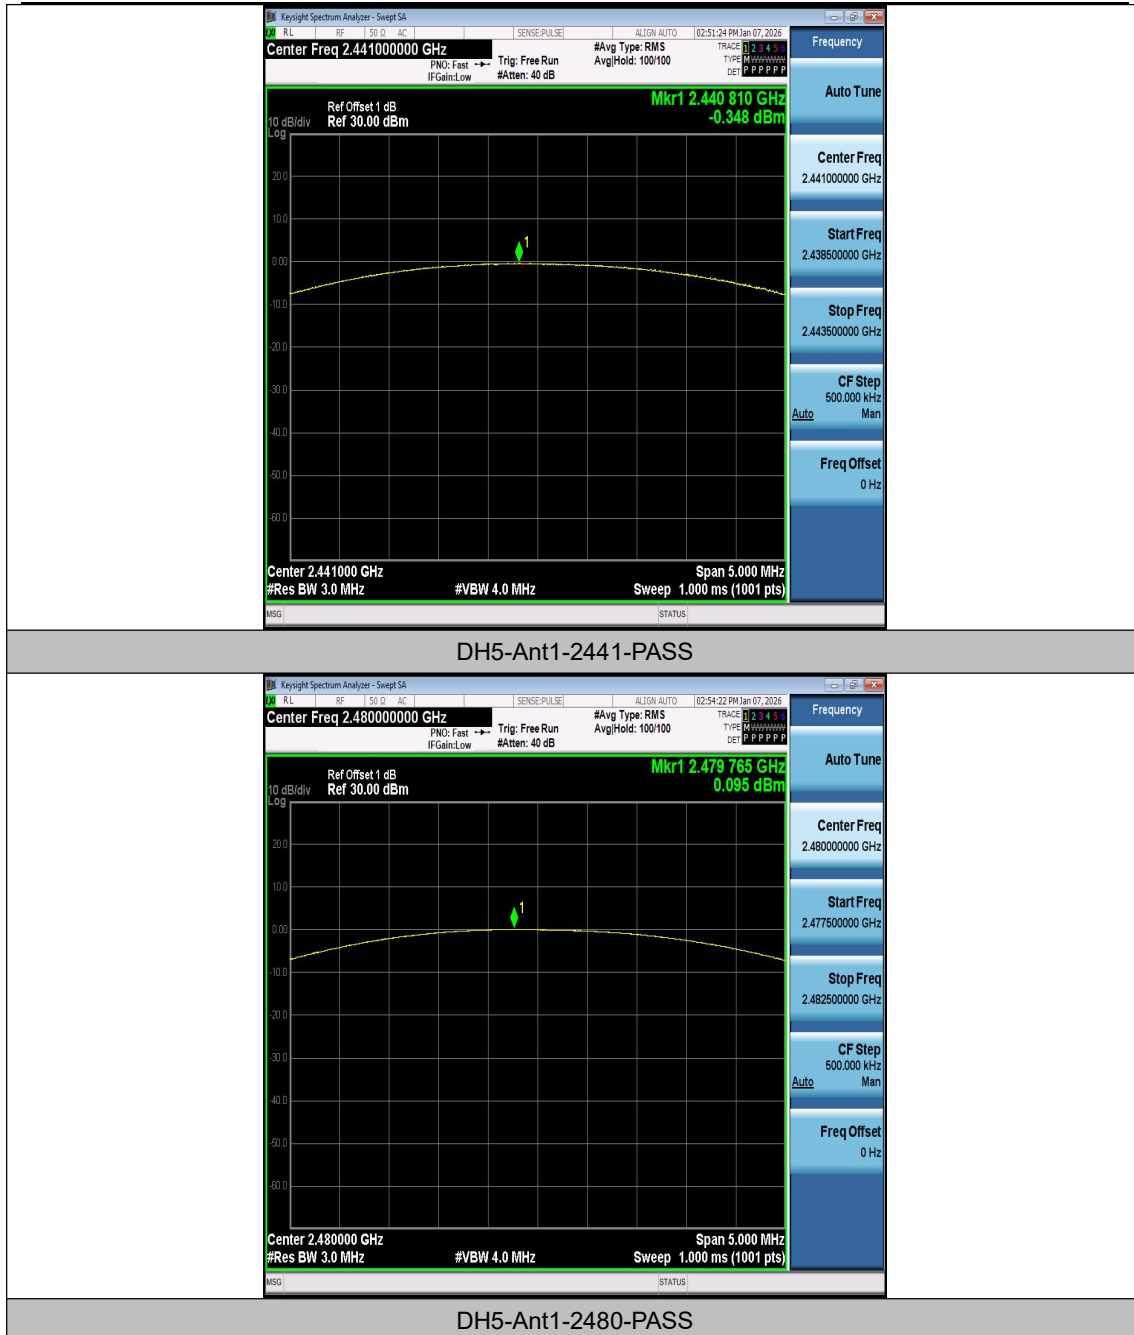

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

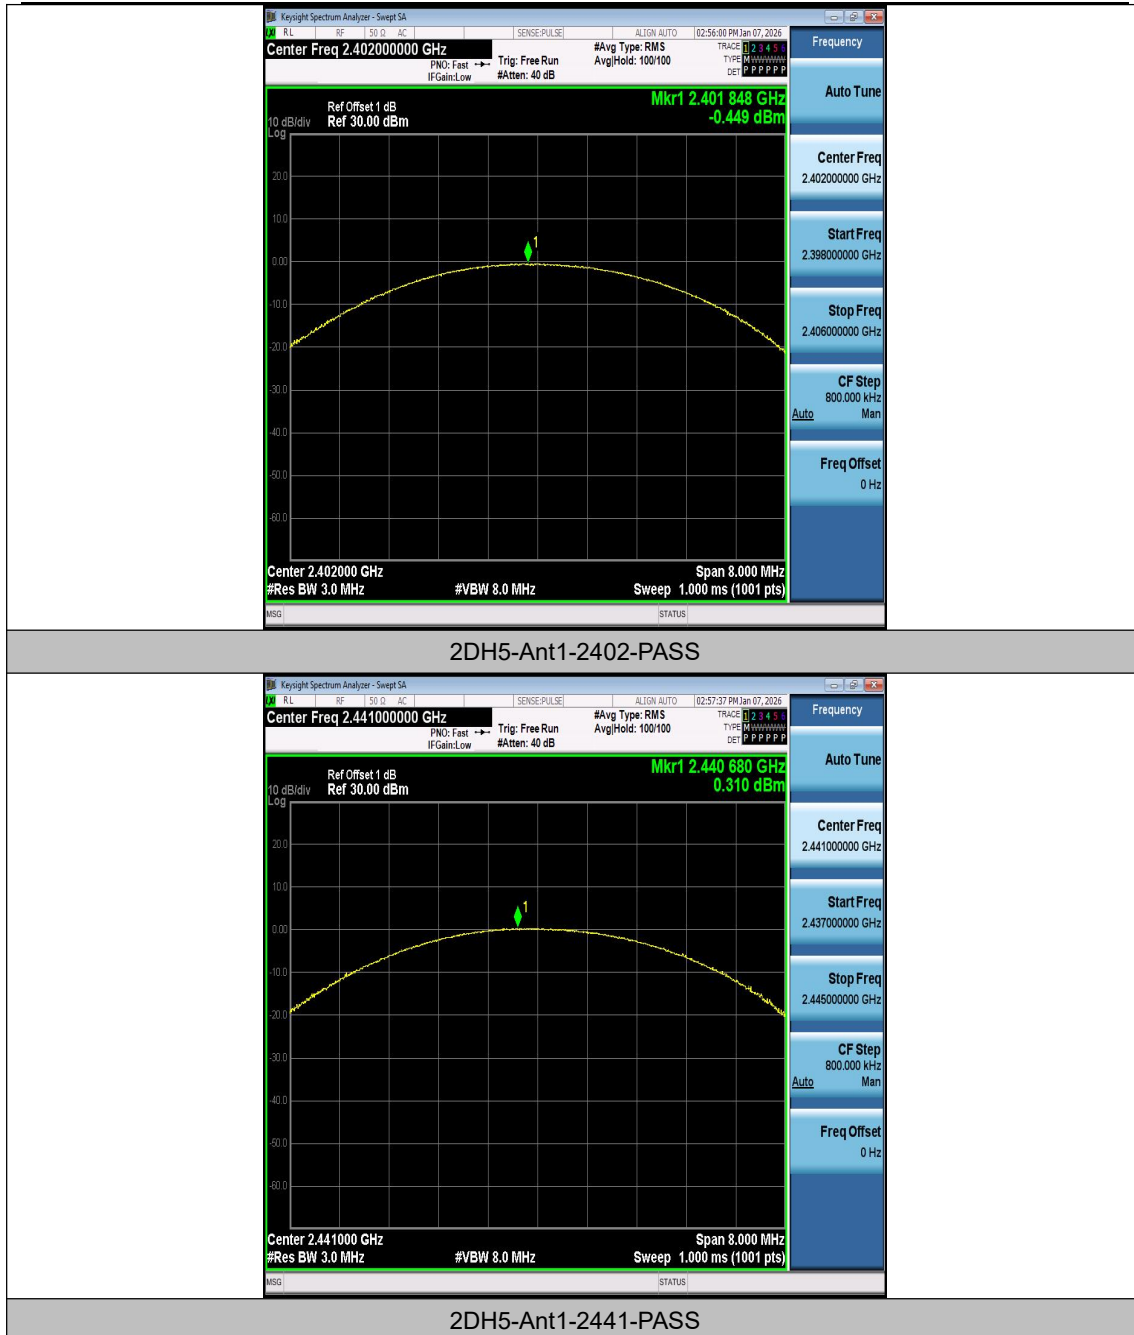

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

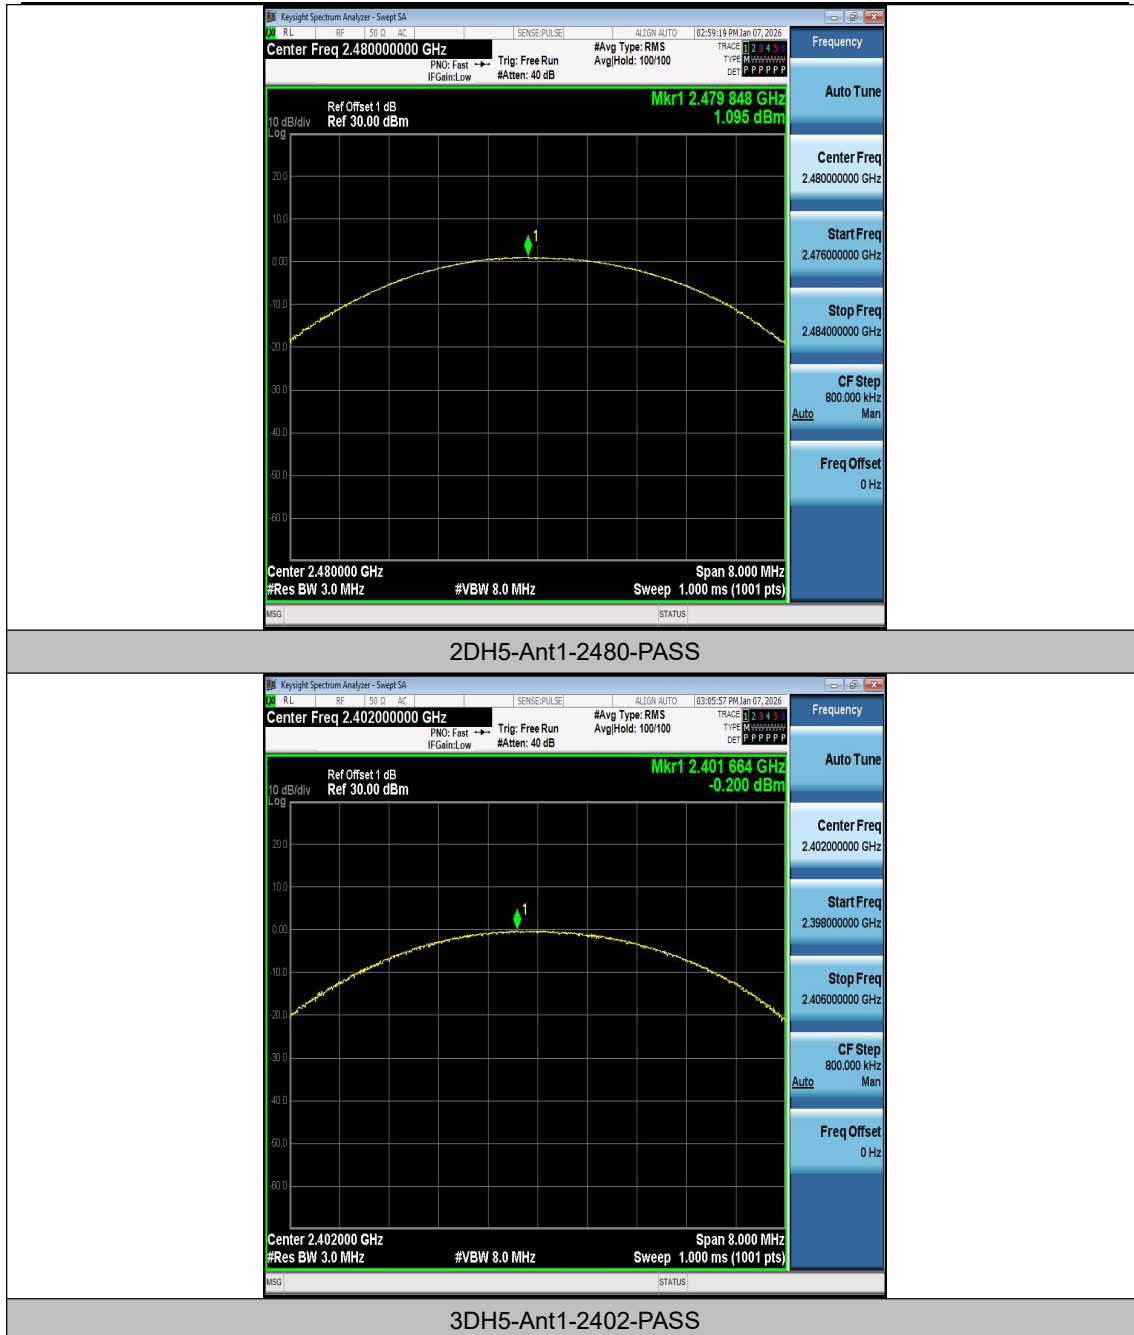

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

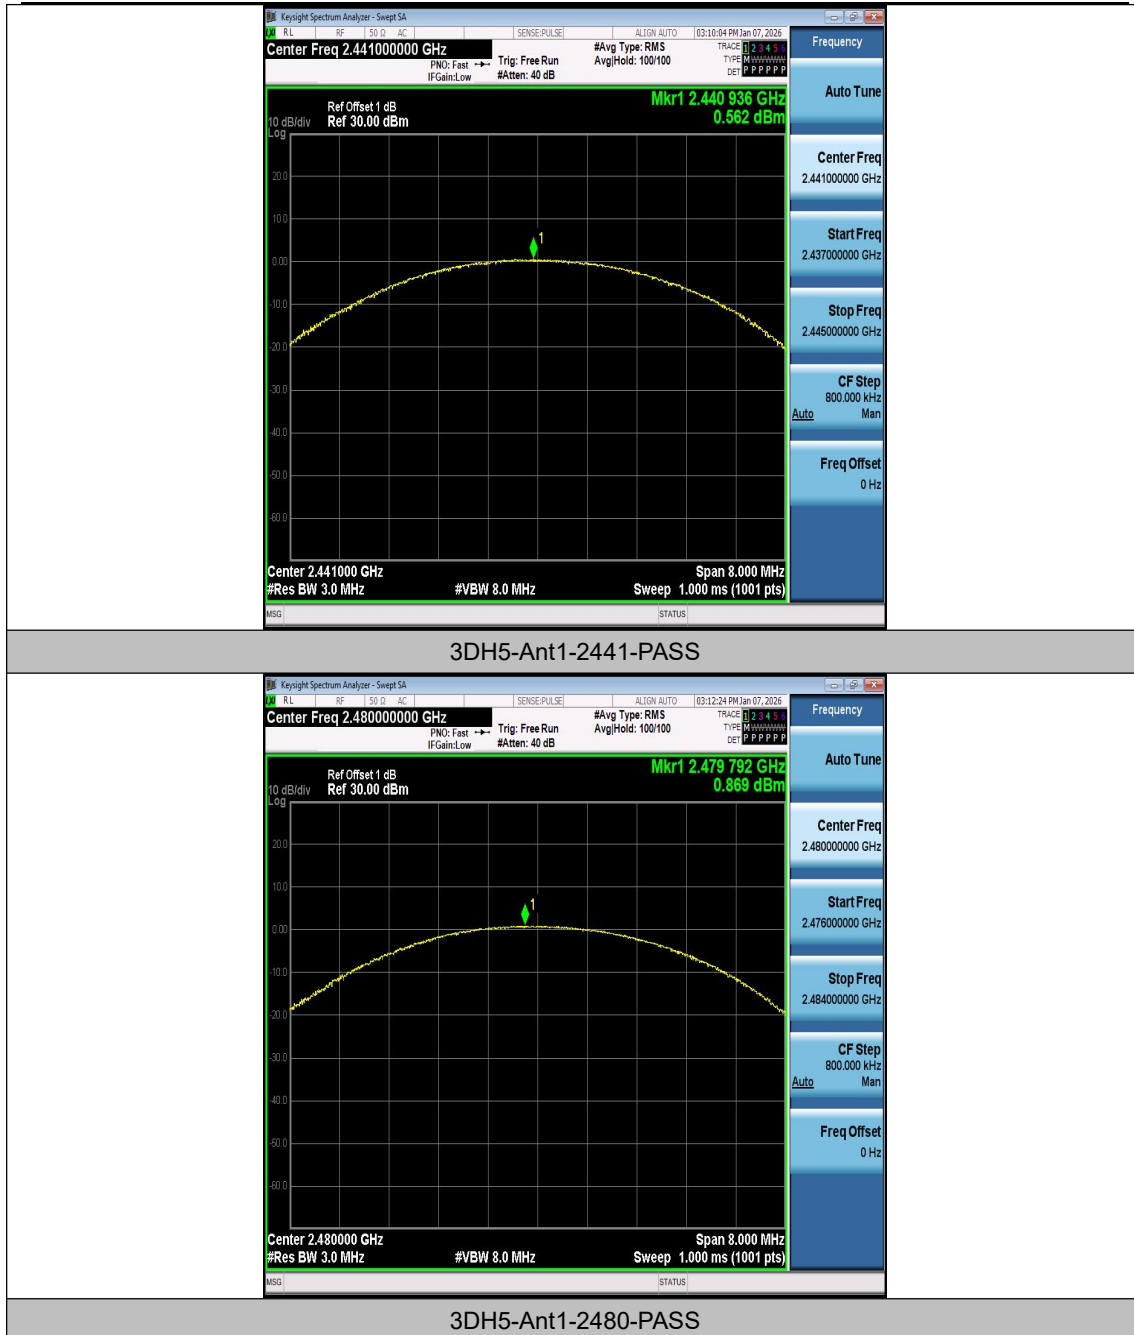

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.99	≥0.638	PASS
2DH5	Ant1	Hop	0.974	≥0.884	PASS
3DH5	Ant1	Hop	1.008	≥0.850	PASS

Test Graphs

