




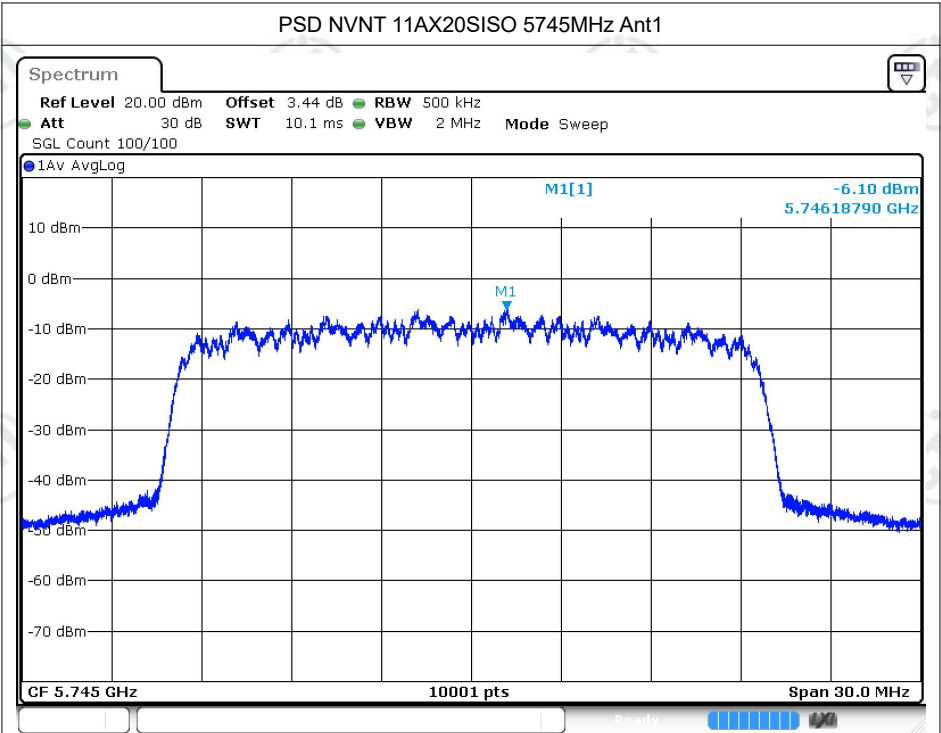


Date: 28.FEB.2026 15:53:24

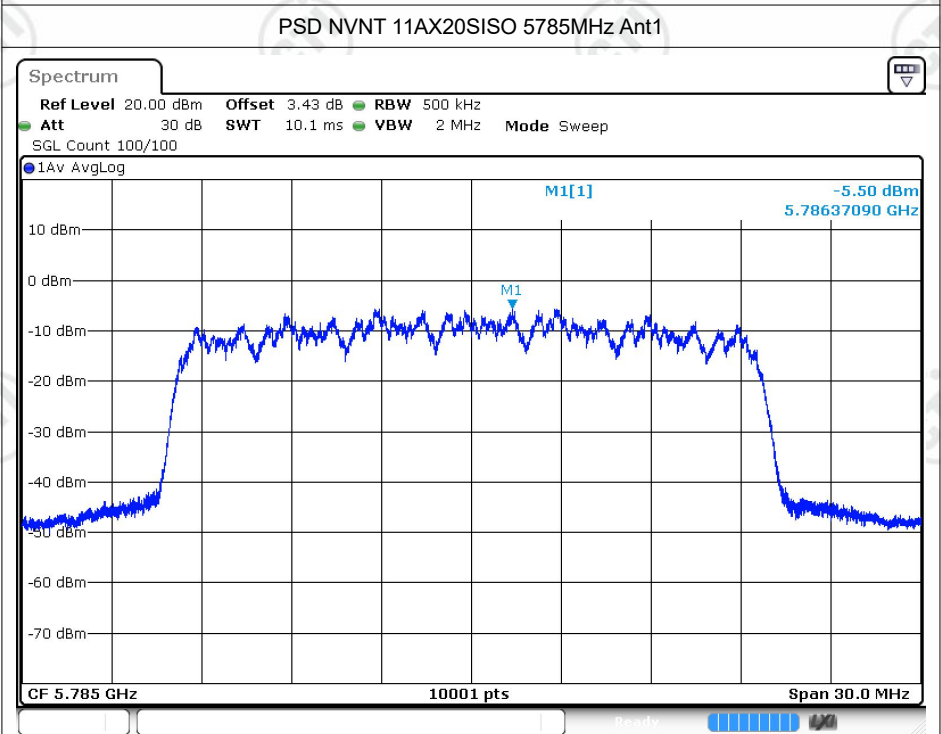



Date: 28.FEB.2026 15:53:55


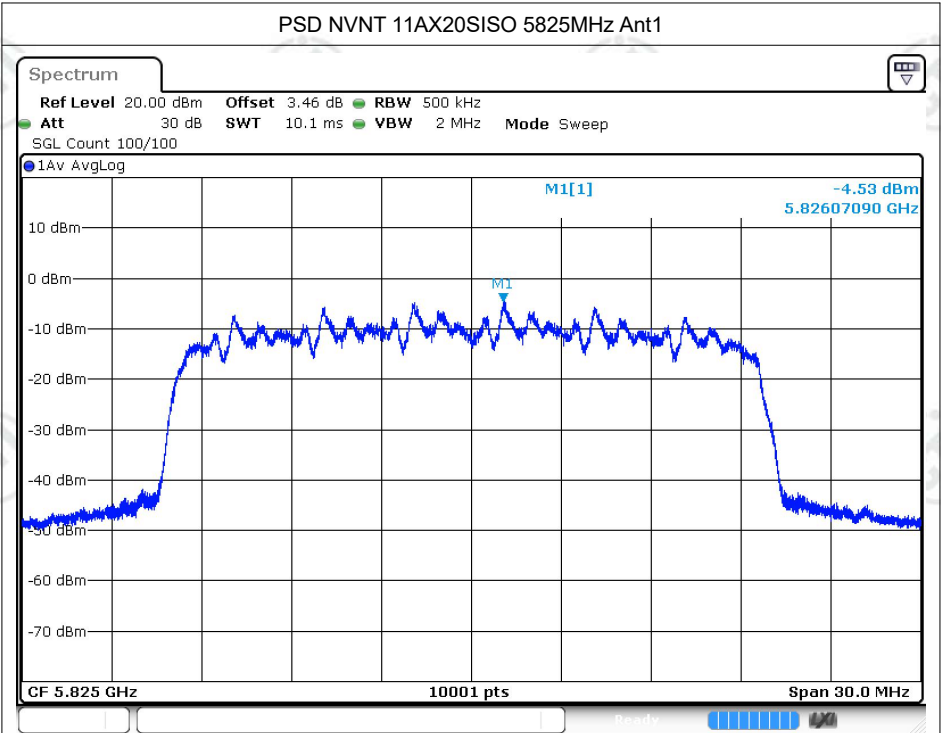




Date: 28.FEB.2026 15:55:48


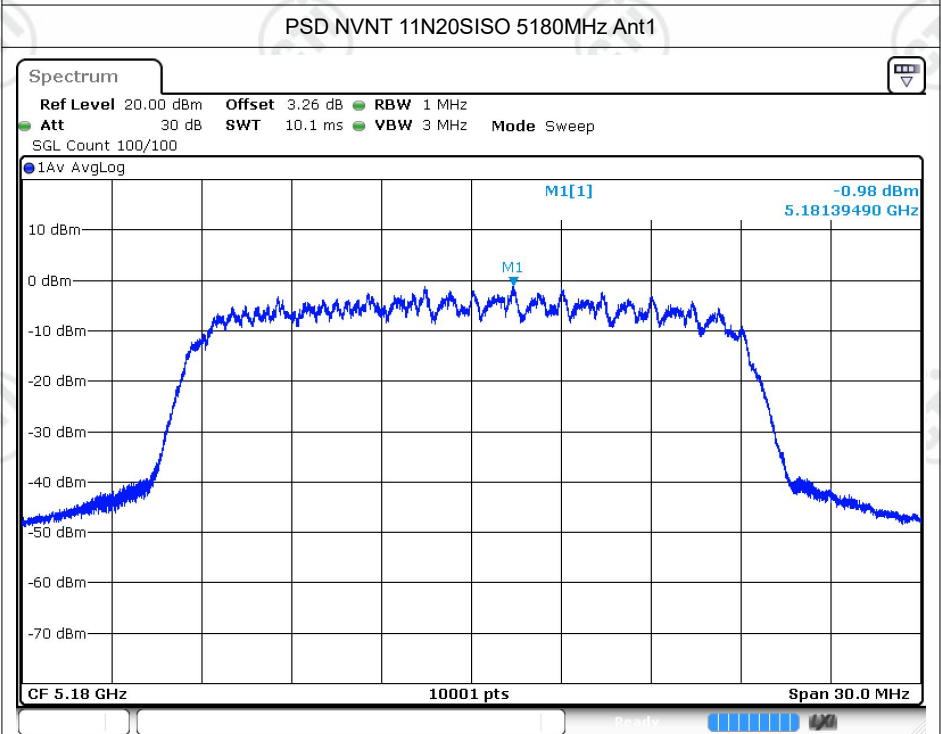



Date: 28.FEB.2026 14:55:19

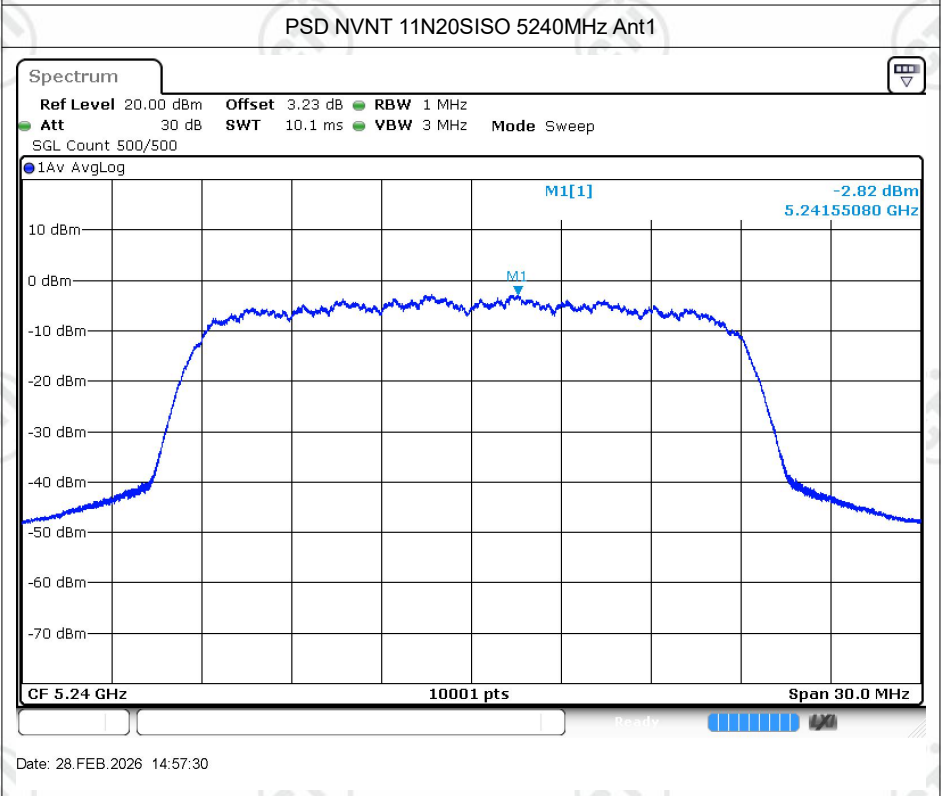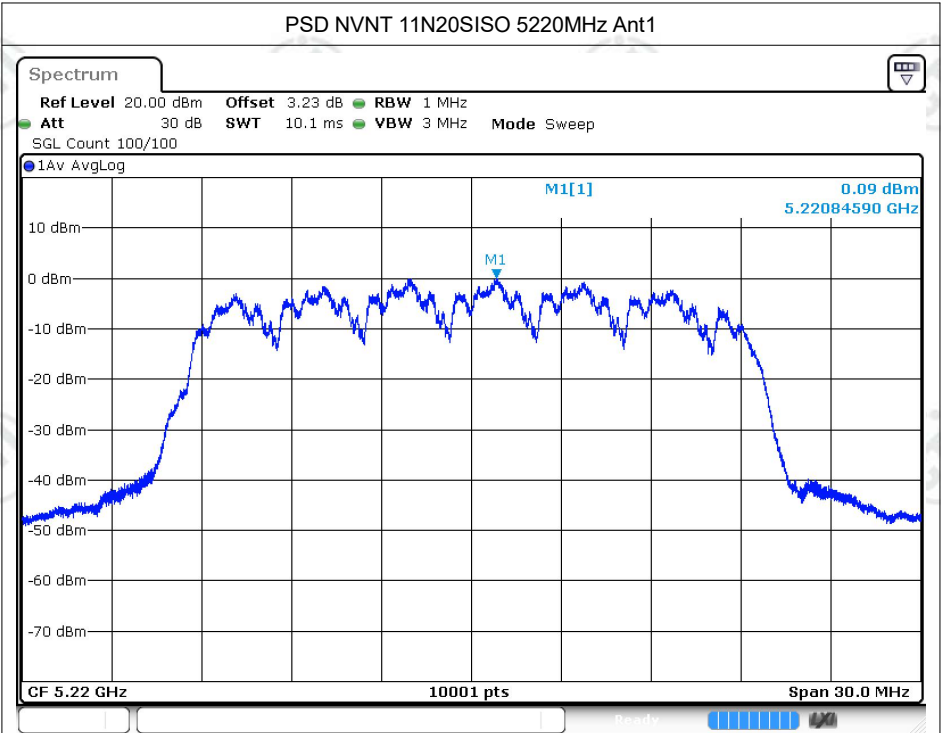

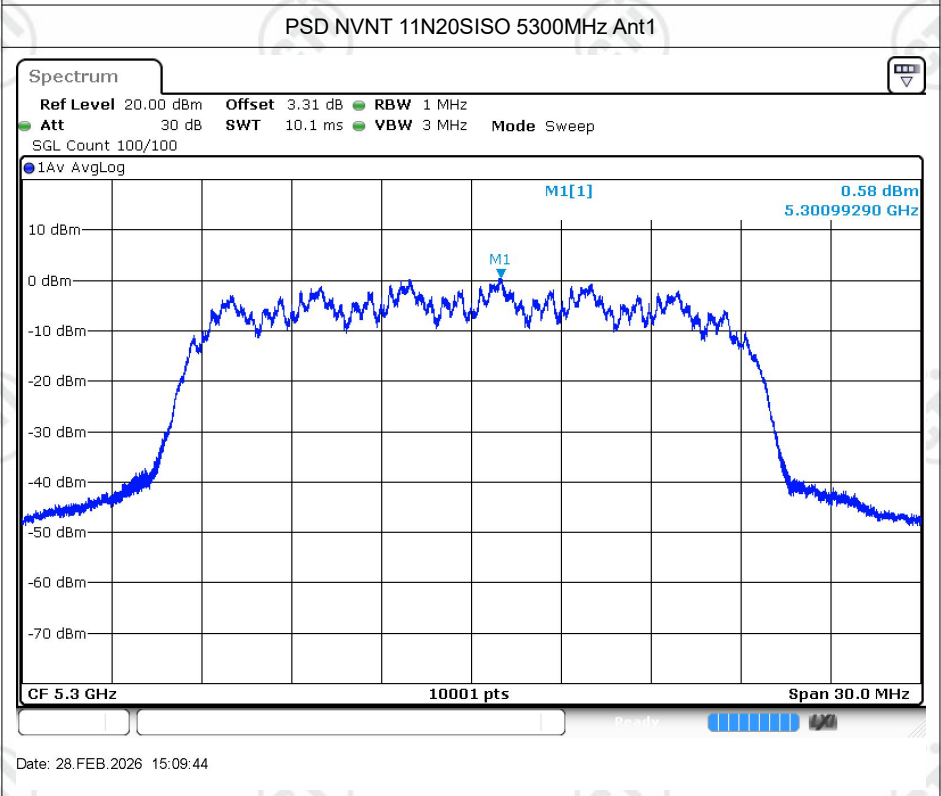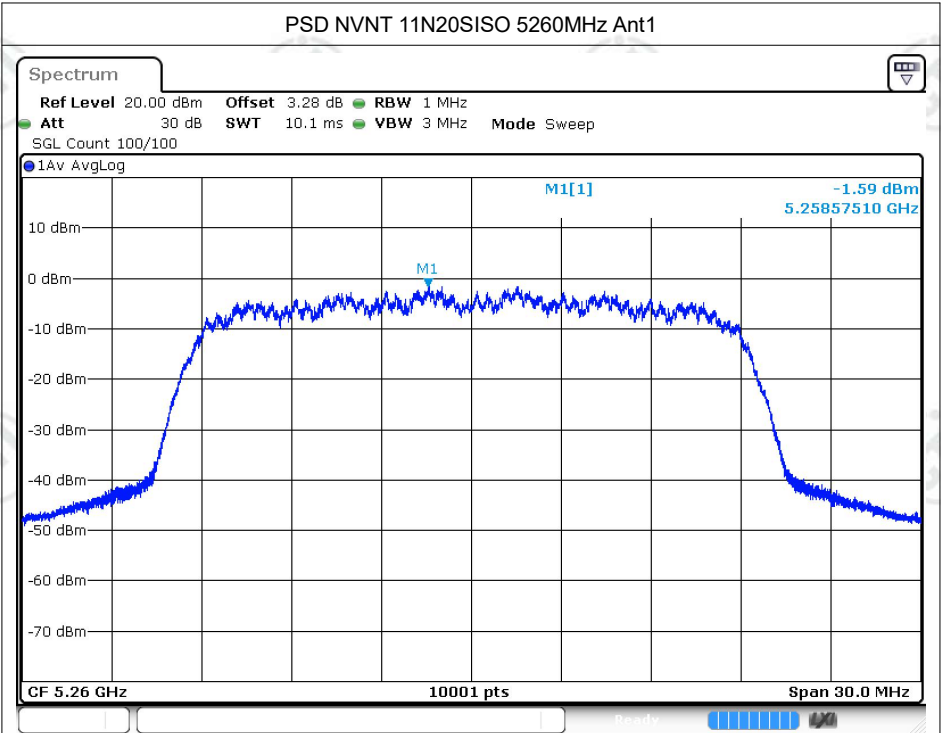


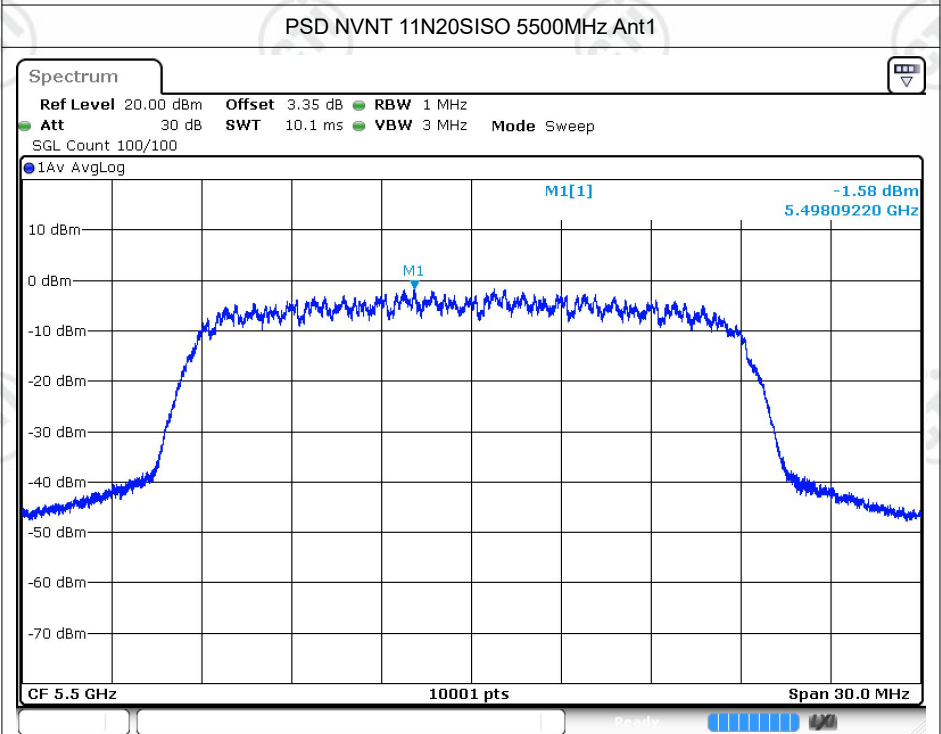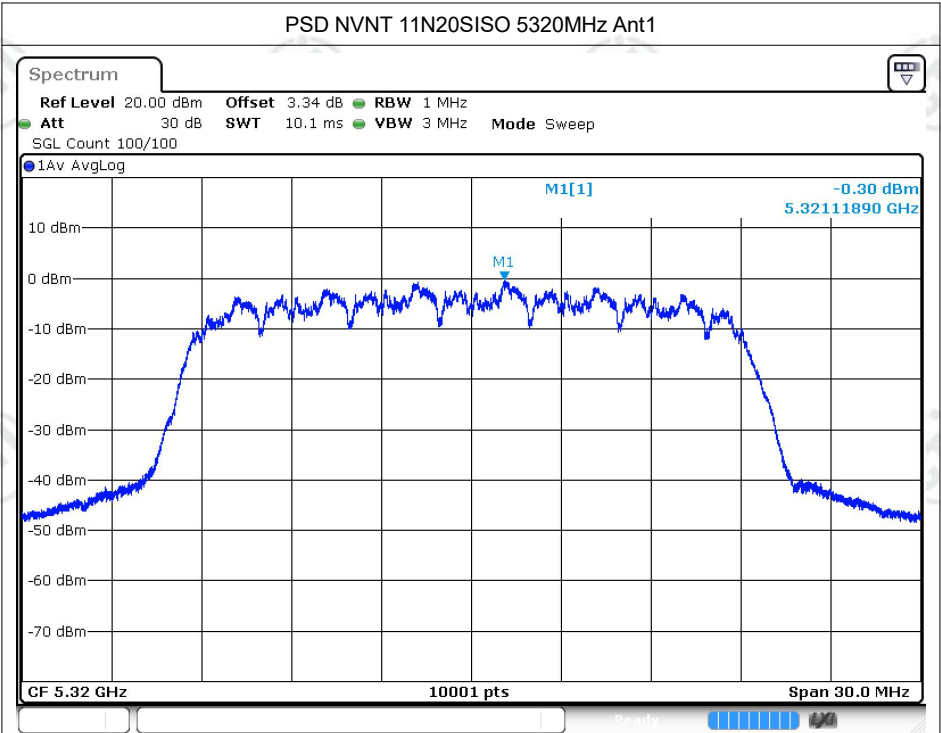

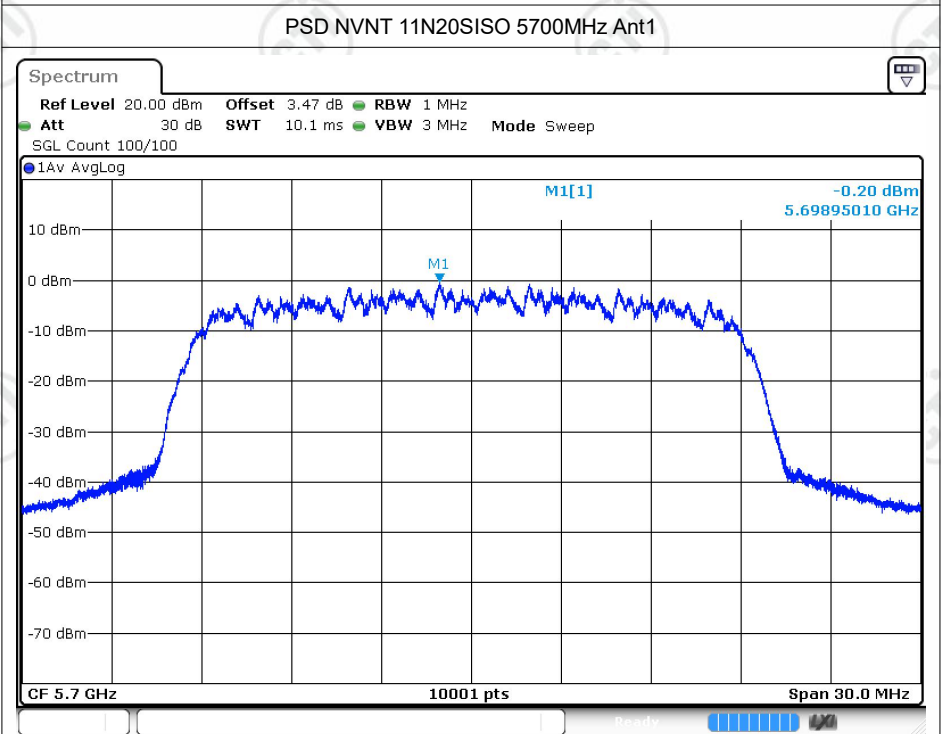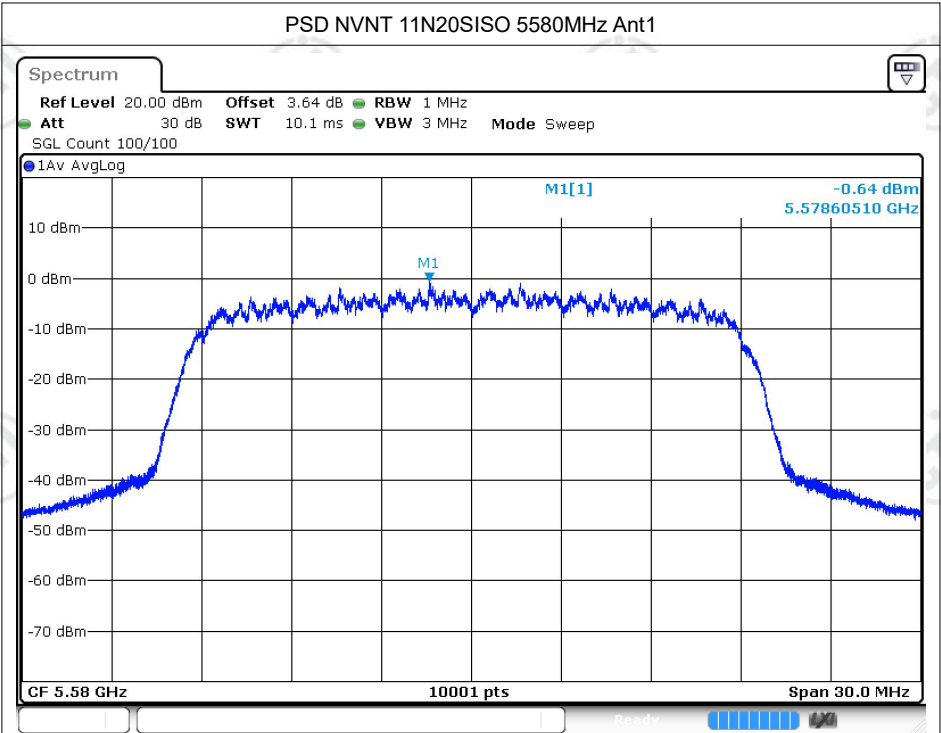


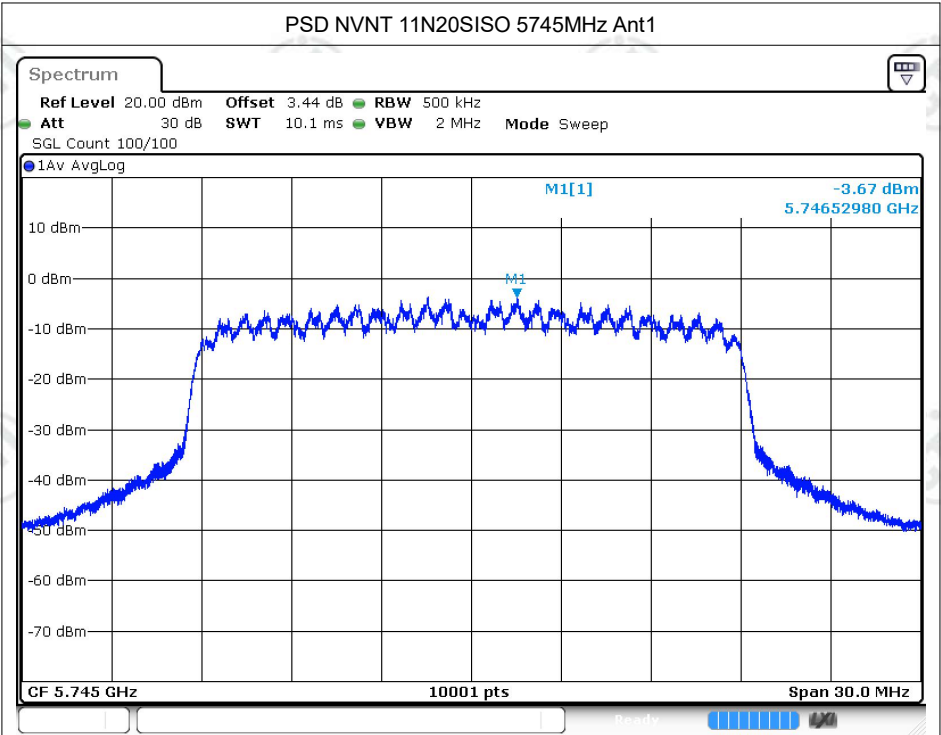

Date: 28.FEB.2026 14:58:53

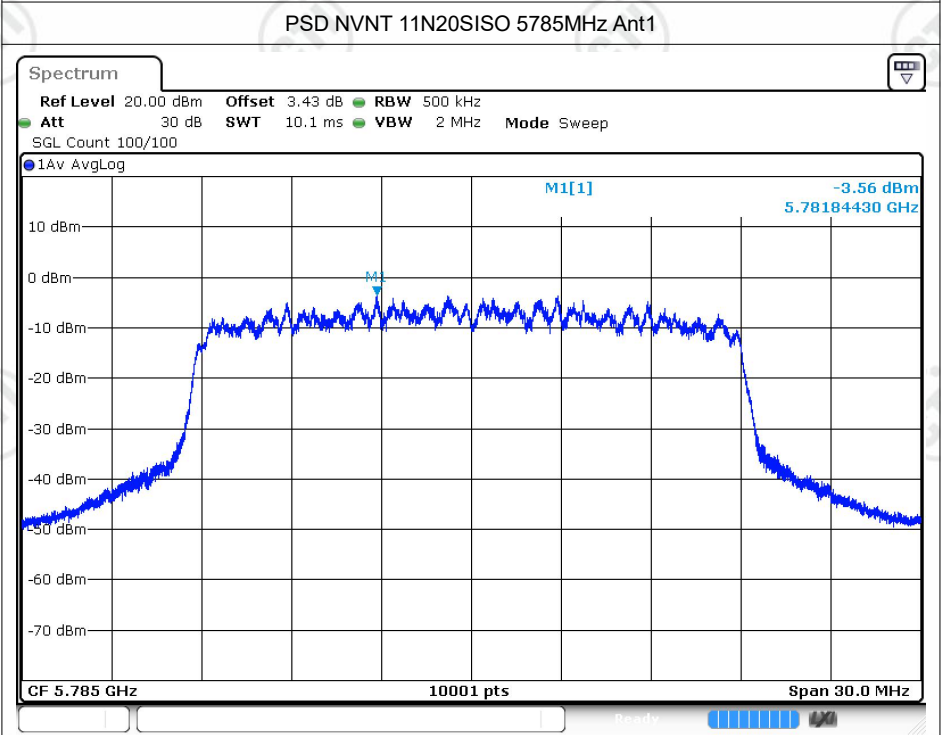

Date: 28.FEB.2026 15:02:07

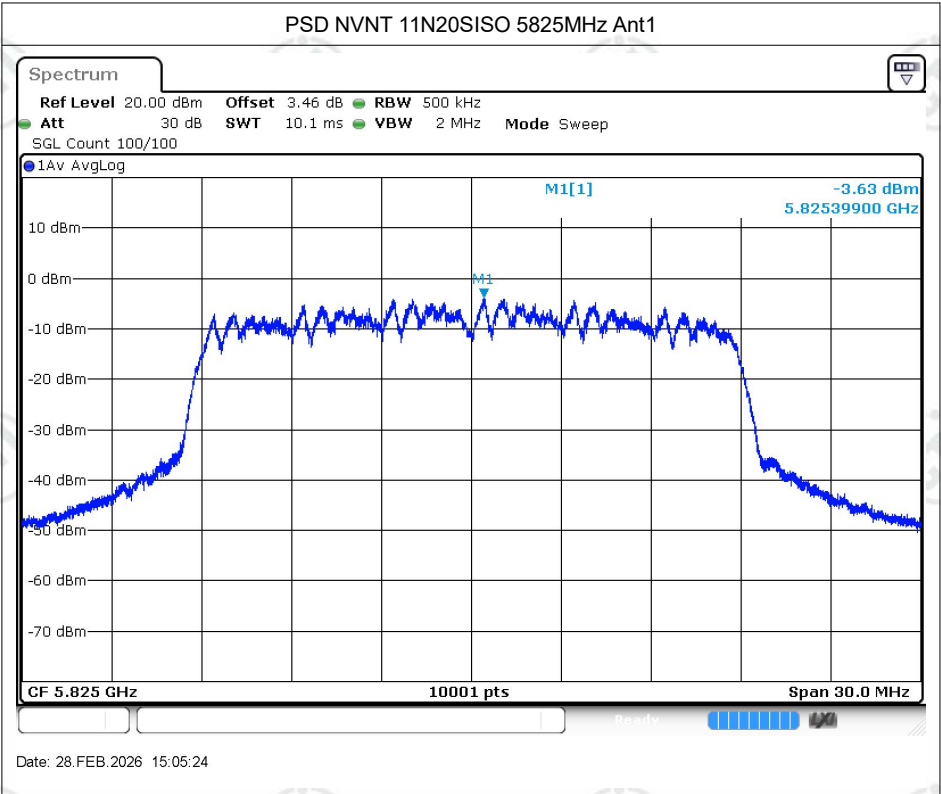

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 138V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-20C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
0C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
10C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
30C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
40C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 120V	11A	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 102V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
20C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
20C 138V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
-20C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
-10C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
0C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
10C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
30C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
40C 120V	11A	5220	Ant1	5219.92	-80000	-15.33	25	Pass
50C 120V	11A	5220	Ant1	5219.94	-60000	-11.49	25	Pass
20C 102V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-10C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
0C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
10C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
30C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
50C 120V	11A	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 102V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
20C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
20C 138V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
-20C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
-10C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
0C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
10C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
30C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass

40C 120V	11A	5260	Ant1	5259.94	-60000	-11.41	25	Pass
50C 120V	11A	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 102V	11A	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
20C 138V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
-20C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
-10C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
0C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
10C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
30C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
40C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
50C 120V	11A	5300	Ant1	5299.94	-60000	-11.32	25	Pass
20C 102V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 138V	11A	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-20C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
-10C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
0C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
10C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
30C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
40C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
50C 120V	11A	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 102V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 138V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
-20C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
-10C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
0C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
10C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
30C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
40C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
50C 120V	11A	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 102V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
20C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
20C 138V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
-20C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
-10C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
0C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
10C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
30C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
40C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass
50C 120V	11A	5580	Ant1	5579.94	-60000	-10.75	25	Pass

20C 102V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 138V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
-20C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
-10C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
0C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
10C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
30C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
40C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
50C 120V	11A	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 102V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 138V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	11A	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
10C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
30C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
50C 120V	11A	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 138V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-20C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-10C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
0C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
10C 120V	11A	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
40C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
50C 120V	11A	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 102V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 138V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-20C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-10C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
0C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
30C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	11A	5825	Ant1	5824.92	-80000	-13.73	25	Pass
50C 120V	11A	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass

20C 138V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
-20C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
-10C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
0C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
10C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
30C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
40C 120V	11N20SISO	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 120V	11N20SISO	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 102V	11N20SISO	5220	Ant1	5219.94	-60000	-11.49	25	Pass
20C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
20C 138V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
-20C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
-10C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
0C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
10C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
30C 120V	11N20SISO	5220	Ant1	5219.94	-60000	-11.49	25	Pass
40C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
50C 120V	11N20SISO	5220	Ant1	5219.92	-80000	-15.33	25	Pass
20C 102V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 138V	11N20SISO	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-10C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
0C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
10C 120V	11N20SISO	5240	Ant1	5239.94	-60000	-11.45	25	Pass
30C 120V	11N20SISO	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
50C 120V	11N20SISO	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 102V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 120V	11N20SISO	5260	Ant1	5259.94	-60000	-11.41	25	Pass
20C 138V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-20C 120V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-10C 120V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
0C 120V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 120V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
30C 120V	11N20SISO	5260	Ant1	5259.94	-60000	-11.41	25	Pass
40C 120V	11N20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
50C 120V	11N20SISO	5260	Ant1	5259.92	-80000	-15.21	25	Pass
20C 102V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
20C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
20C 138V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
-20C 120V	11N20SISO	5300	Ant1	5299.94	-60000	-11.32	25	Pass

-10C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
0C 120V	11N20SISO	5300	Ant1	5299.94	-60000	-11.32	25	Pass
10C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
30C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
40C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
50C 120V	11N20SISO	5300	Ant1	5299.92	-80000	-15.09	25	Pass
20C 102V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
20C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
20C 138V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
-20C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
-10C 120V	11N20SISO	5320	Ant1	5319.94	-60000	-11.28	25	Pass
0C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
10C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
30C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
40C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
50C 120V	11N20SISO	5320	Ant1	5319.92	-80000	-15.04	25	Pass
20C 102V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 138V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
-20C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
-10C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
0C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
10C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
30C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
40C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
50C 120V	11N20SISO	5500	Ant1	5499.92	-80000	-14.55	25	Pass
20C 102V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
20C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
20C 138V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
-20C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
-10C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
0C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
10C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
30C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
40C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
50C 120V	11N20SISO	5580	Ant1	5579.92	-80000	-14.34	25	Pass
20C 102V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 138V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
-20C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
-10C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
0C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass

10C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
30C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
40C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
50C 120V	11N20SISO	5700	Ant1	5699.92	-80000	-14.04	25	Pass
20C 102V	11N20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 138V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
0C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
10C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
30C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
50C 120V	11N20SISO	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 138V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-20C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-10C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
0C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
10C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
30C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
40C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
50C 120V	11N20SISO	5785	Ant1	5784.92	-80000	-13.83	25	Pass
20C 102V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 120V	11N20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-20C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-10C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
0C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	11N20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
30C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
50C 120V	11N20SISO	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 102V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-10C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
30C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass

40C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	11AC20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 138V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
-20C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
-10C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
0C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
10C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
30C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
40C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
50C 120V	11AC20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 102V	11AC20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	11AC20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 120V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	11AC20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 120V	11AC20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	11AC20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 138V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-20C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-10C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
0C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
30C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
50C 120V	11AC20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 102V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 138V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
-20C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
-10C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
0C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
10C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
30C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
40C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
50C 120V	11AC20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass

20C 102V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 138V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-20C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-10C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
0C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
10C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
30C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
40C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
50C 120V	11AC20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 138V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
-20C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
-10C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
0C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
10C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
30C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
40C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
50C 120V	11AC20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 102V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 138V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
-20C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
-10C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
0C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
10C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
30C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
40C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
50C 120V	11AC20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 102V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 120V	11AC20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
20C 138V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
-20C 120V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
-10C 120V	11AC20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
0C 120V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
10C 120V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
30C 120V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
40C 120V	11AC20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
50C 120V	11AC20SISO	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 102V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	11AC20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass

20C 138V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-20C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	11AC20SISO	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-10C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	11AC20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-10C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	11AC20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-10C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
30C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	11AX20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 138V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
-20C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass

-10C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
0C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
10C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
30C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
40C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
50C 120V	11AX20SISO	5220	Ant1	5219.96	-40000	-7.66	25	Pass
20C 102V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-10C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	11AX20SISO	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 138V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-20C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-10C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
0C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
30C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
50C 120V	11AX20SISO	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 102V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 138V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
-20C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
-10C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
0C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
10C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
30C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
40C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
50C 120V	11AX20SISO	5300	Ant1	5299.96	-40000	-7.55	25	Pass
20C 102V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 138V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-20C 120V	11AX20SISO	5320	Ant1	5319.94	-60000	-11.28	25	Pass
-10C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
0C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass

10C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
30C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
40C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
50C 120V	11AX20SISO	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
20C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
20C 138V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
-20C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
-10C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
0C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
10C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
30C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
40C 120V	11AX20SISO	5500	Ant1	5499.96	-40000	-7.27	25	Pass
50C 120V	11AX20SISO	5500	Ant1	5499.94	-60000	-10.91	25	Pass
20C 102V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
20C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
20C 138V	11AX20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
-20C 120V	11AX20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
-10C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
0C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
10C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
30C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
40C 120V	11AX20SISO	5580	Ant1	5579.96	-40000	-7.17	25	Pass
50C 120V	11AX20SISO	5580	Ant1	5579.94	-60000	-10.75	25	Pass
20C 102V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
20C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
20C 138V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
-20C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
-10C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
0C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
10C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
30C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
40C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
50C 120V	11AX20SISO	5700	Ant1	5699.94	-60000	-10.53	25	Pass
20C 102V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-10C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass

40C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	11AX20SISO	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 138V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-10C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
0C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
10C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
40C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
50C 120V	11AX20SISO	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 102V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-20C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-10C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
0C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
10C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
30C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
40C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass
50C 120V	11AX20SISO	5825	Ant1	5824.94	-60000	-10.3	25	Pass

-6dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	11A	5745	Ant1	15.12	0.5	Pass
NVNT	11A	5785	Ant1	15.126	0.5	Pass
NVNT	11A	5825	Ant1	15.096	0.5	Pass
NVNT	11N20SISO	5745	Ant1	15.126	0.5	Pass
NVNT	11N20SISO	5785	Ant1	15.099	0.5	Pass
NVNT	11N20SISO	5825	Ant1	15.123	0.5	Pass
NVNT	11AC20SISO	5745	Ant1	15.138	0.5	Pass
NVNT	11AC20SISO	5785	Ant1	15.135	0.5	Pass
NVNT	11AC20SISO	5825	Ant1	15.111	0.5	Pass
NVNT	11AX20SISO	5745	Ant1	17.151	0.5	Pass
NVNT	11AX20SISO	5785	Ant1	16.506	0.5	Pass
NVNT	11AX20SISO	5825	Ant1	15.51	0.5	Pass