

## Appendix Test Data

|                  |                     |                    |                    |
|------------------|---------------------|--------------------|--------------------|
| Report No.:      | 1812C50390312501-01 | Test Sample No.:   | 1-2-2              |
| Start Test Date: | 2025-09-05          | Finish Test Date:  | 2025-09-23         |
| Test Engineer:   | <i>dylan. Ma</i>    | Auditor:           | <i>Justin Feng</i> |
| Temperature:     | 25.4°C              | Relative Humidity: | 49%                |
| Pressure:        | 101kPa              |                    |                    |



## Appendix A: 6dB Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | 6dB BW [MHz] | FL[MHz] | FH[MHz] | Limit[MHz] | Verdict |
|------------|---------|----------------|--------------|---------|---------|------------|---------|
| 11B        | Ant0    | 2412           | 10.40        | 2406.80 | 2417.20 | 0.5        | PASS    |
| 11B        | Ant2    | 2412           | 10.36        | 2406.80 | 2417.16 | 0.5        | PASS    |
| 11B        | Ant0    | 2437           | 10.40        | 2431.80 | 2442.20 | 0.5        | PASS    |
| 11B        | Ant2    | 2437           | 10.36        | 2431.80 | 2442.16 | 0.5        | PASS    |
| 11B        | Ant0    | 2462           | 10.36        | 2456.80 | 2467.16 | 0.5        | PASS    |
| 11B        | Ant2    | 2462           | 10.36        | 2456.80 | 2467.16 | 0.5        | PASS    |
| 11G        | Ant0    | 2412           | 15.00        | 2404.36 | 2419.36 | 0.5        | PASS    |
| 11G        | Ant2    | 2412           | 14.68        | 2405.00 | 2419.68 | 0.5        | PASS    |
| 11G        | Ant0    | 2437           | 15.04        | 2429.68 | 2444.72 | 0.5        | PASS    |
| 11G        | Ant2    | 2437           | 15.44        | 2429.28 | 2444.72 | 0.5        | PASS    |
| 11G        | Ant0    | 2462           | 14.92        | 2454.56 | 2469.48 | 0.5        | PASS    |
| 11G        | Ant2    | 2462           | 15.76        | 2454.08 | 2469.84 | 0.5        | PASS    |
| 11N20MIMO  | Ant0    | 2412           | 15.16        | 2404.04 | 2419.20 | 0.5        | PASS    |
| 11N20MIMO  | Ant2    | 2412           | 15.32        | 2404.44 | 2419.76 | 0.5        | PASS    |
| 11N20MIMO  | Ant0    | 2437           | 15.64        | 2429.04 | 2444.68 | 0.5        | PASS    |
| 11N20MIMO  | Ant2    | 2437           | 13.72        | 2430.44 | 2444.16 | 0.5        | PASS    |
| 11N20MIMO  | Ant0    | 2462           | 15.36        | 2453.72 | 2469.08 | 0.5        | PASS    |
| 11N20MIMO  | Ant2    | 2462           | 16.68        | 2453.56 | 2470.24 | 0.5        | PASS    |
| 11N40MIMO  | Ant0    | 2422           | 35.12        | 2404.40 | 2439.52 | 0.5        | PASS    |
| 11N40MIMO  | Ant2    | 2422           | 35.12        | 2404.16 | 2439.28 | 0.5        | PASS    |
| 11N40MIMO  | Ant0    | 2437           | 31.92        | 2420.20 | 2452.12 | 0.5        | PASS    |
| 11N40MIMO  | Ant2    | 2437           | 33.68        | 2420.76 | 2454.44 | 0.5        | PASS    |
| 11N40MIMO  | Ant0    | 2452           | 32.40        | 2436.16 | 2468.56 | 0.5        | PASS    |
| 11N40MIMO  | Ant2    | 2452           | 35.20        | 2434.08 | 2469.28 | 0.5        | PASS    |
| 11AX20MIMO | Ant0    | 2412           | 18.04        | 2402.68 | 2420.72 | 0.5        | PASS    |

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


|            |      |      |       |         |         |     |      |
|------------|------|------|-------|---------|---------|-----|------|
| 11AX20MIMO | Ant2 | 2412 | 16.24 | 2403.24 | 2419.48 | 0.5 | PASS |
| 11AX20MIMO | Ant0 | 2437 | 14.92 | 2428.36 | 2443.28 | 0.5 | PASS |
| 11AX20MIMO | Ant2 | 2437 | 14.72 | 2430.56 | 2445.28 | 0.5 | PASS |
| 11AX20MIMO | Ant0 | 2462 | 14.72 | 2453.24 | 2467.96 | 0.5 | PASS |
| 11AX20MIMO | Ant2 | 2462 | 14.84 | 2453.36 | 2468.20 | 0.5 | PASS |
| 11AX40MIMO | Ant0 | 2422 | 24.72 | 2409.36 | 2434.08 | 0.5 | PASS |
| 11AX40MIMO | Ant2 | 2422 | 31.92 | 2406.16 | 2438.08 | 0.5 | PASS |
| 11AX40MIMO | Ant0 | 2437 | 32.08 | 2419.88 | 2451.96 | 0.5 | PASS |
| 11AX40MIMO | Ant2 | 2437 | 32.16 | 2420.12 | 2452.28 | 0.5 | PASS |
| 11AX40MIMO | Ant0 | 2452 | 33.52 | 2434.72 | 2468.24 | 0.5 | PASS |
| 11AX40MIMO | Ant2 | 2452 | 31.36 | 2435.44 | 2466.80 | 0.5 | PASS |


**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Test Graphs

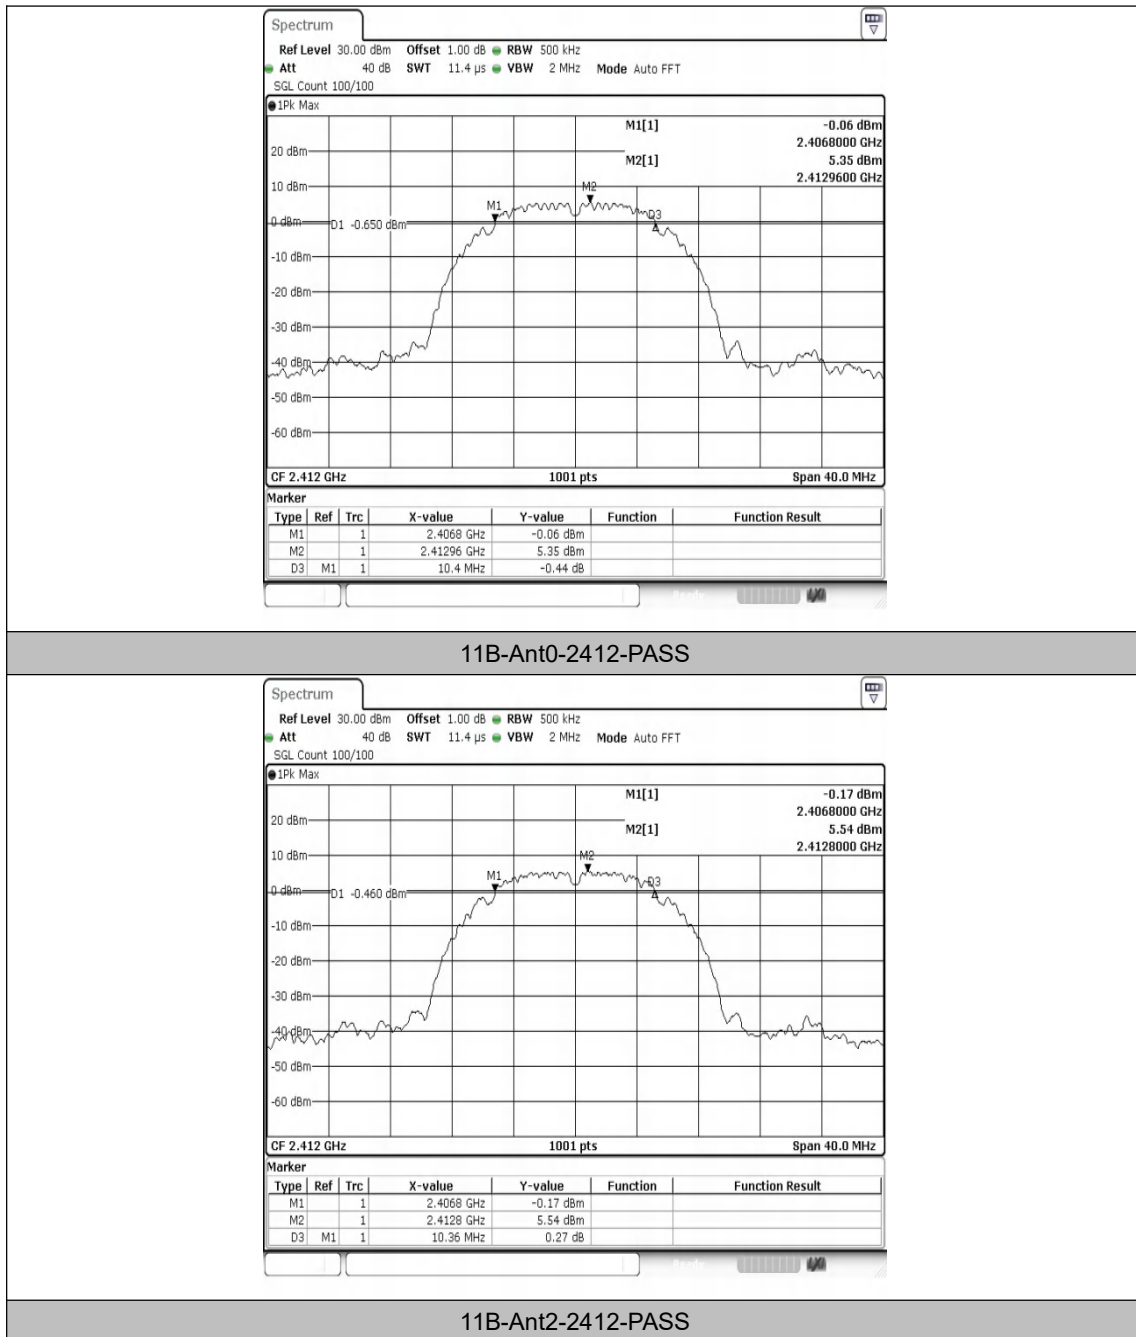

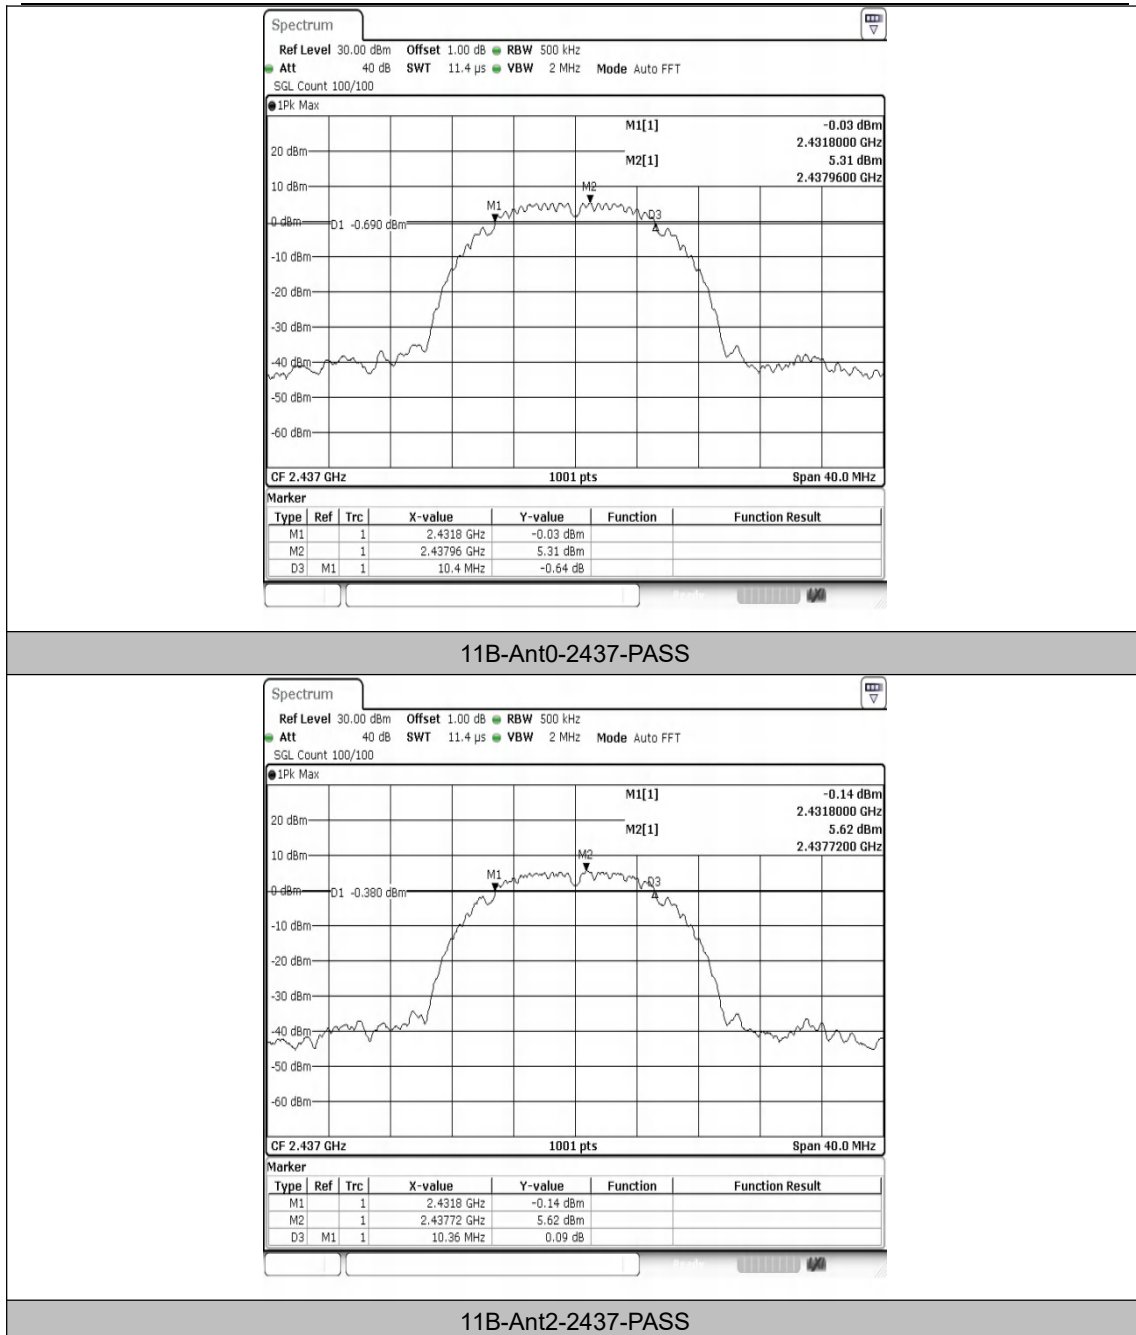


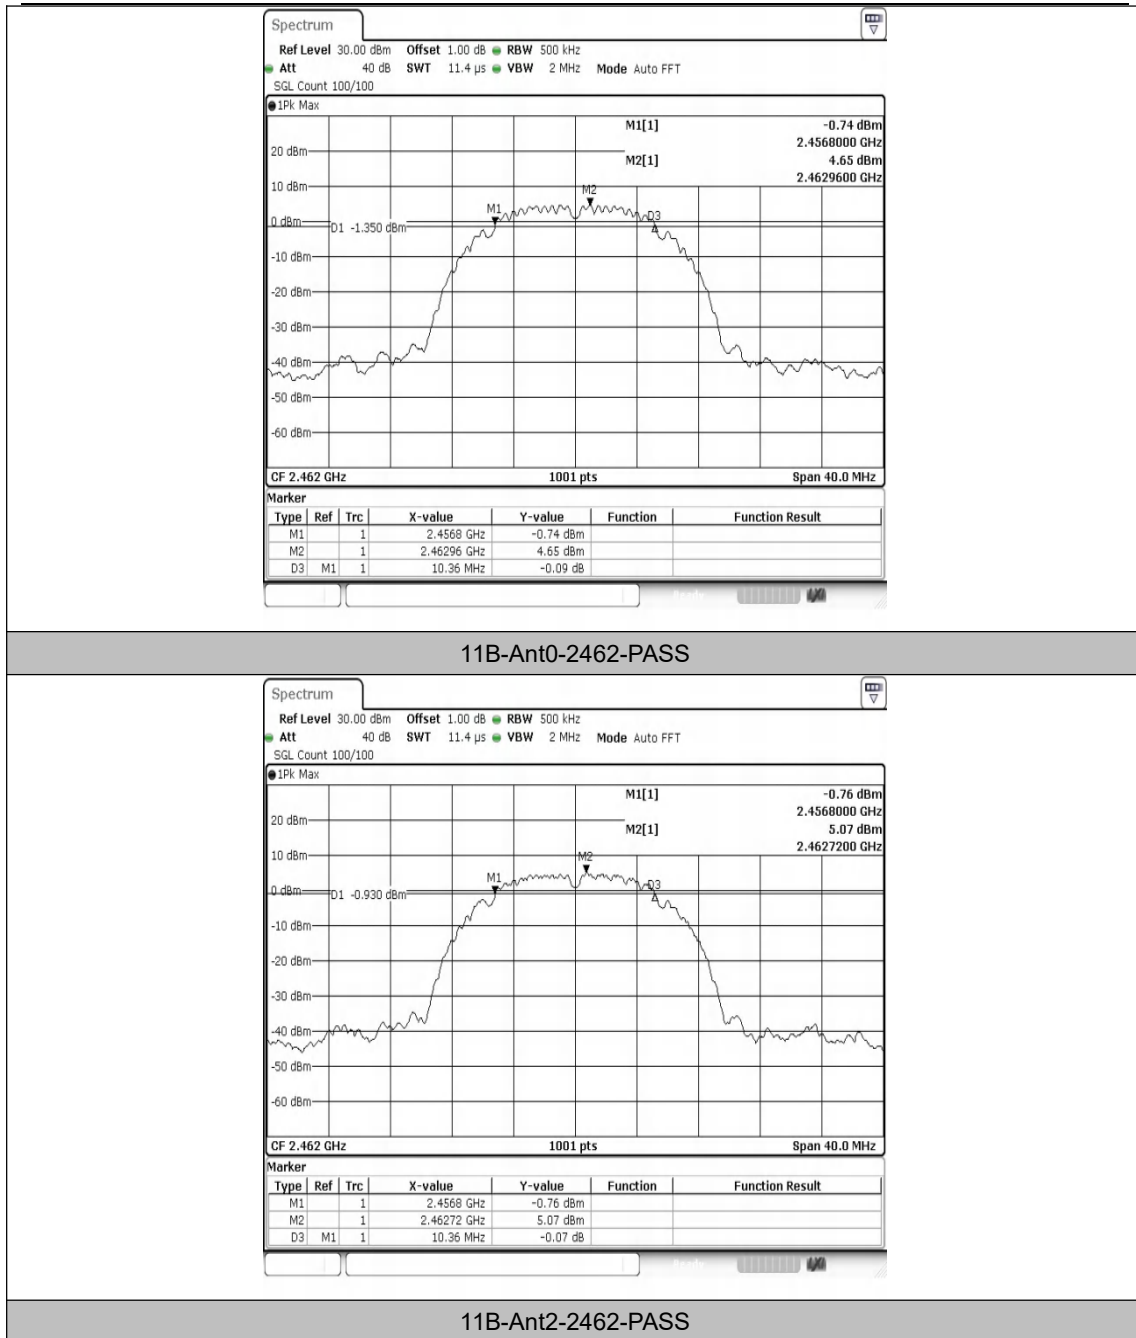



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

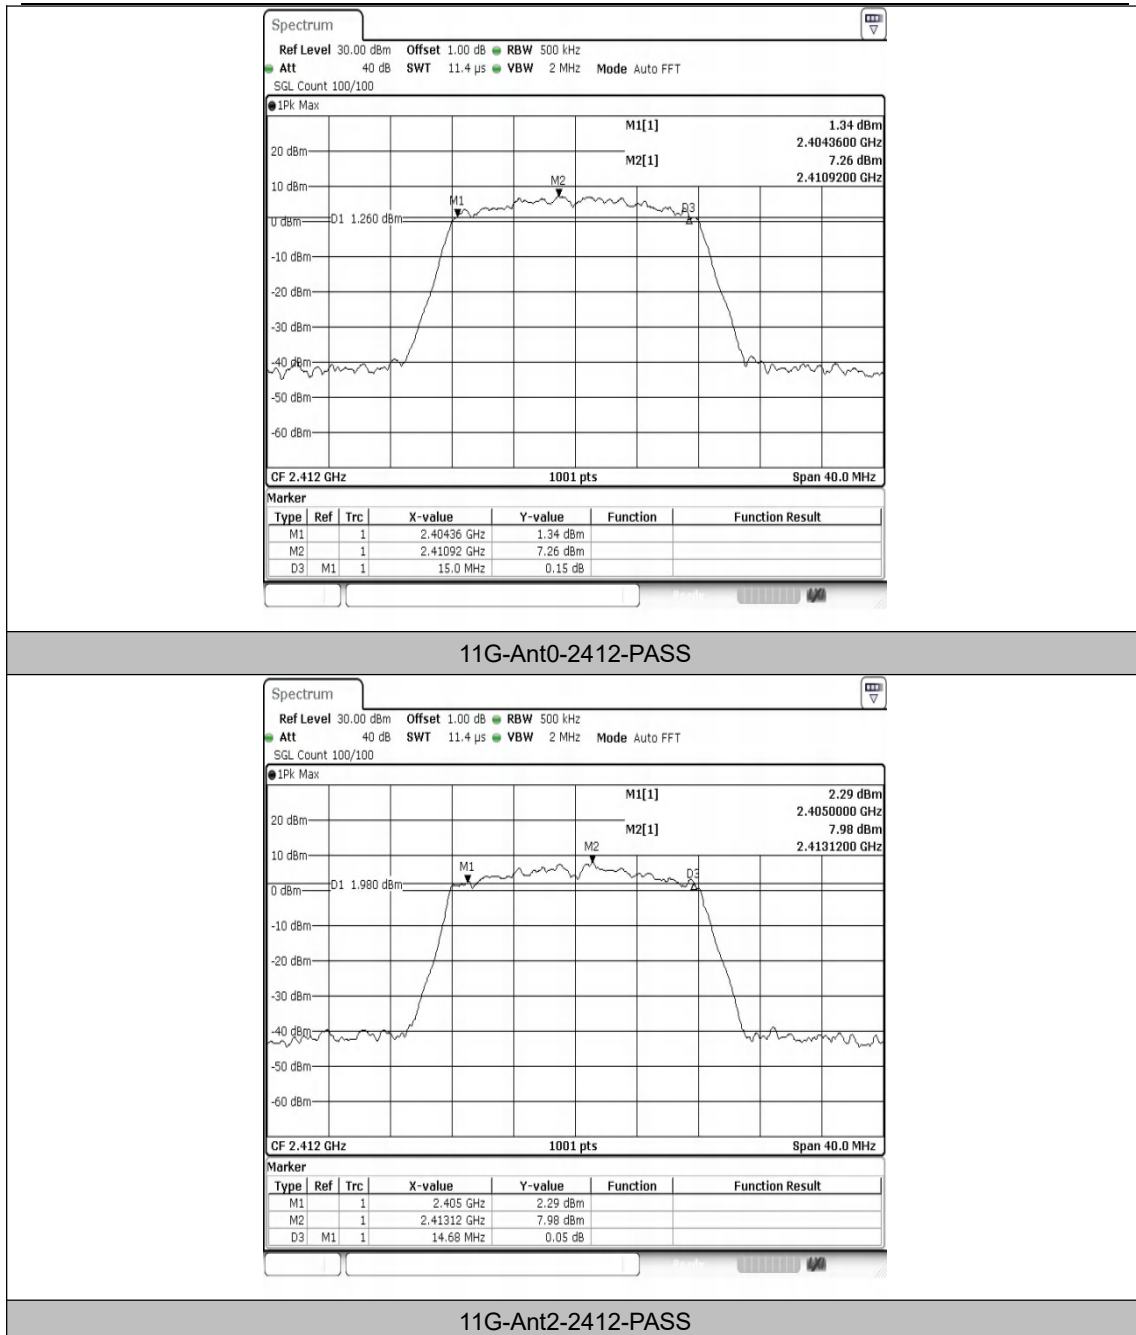

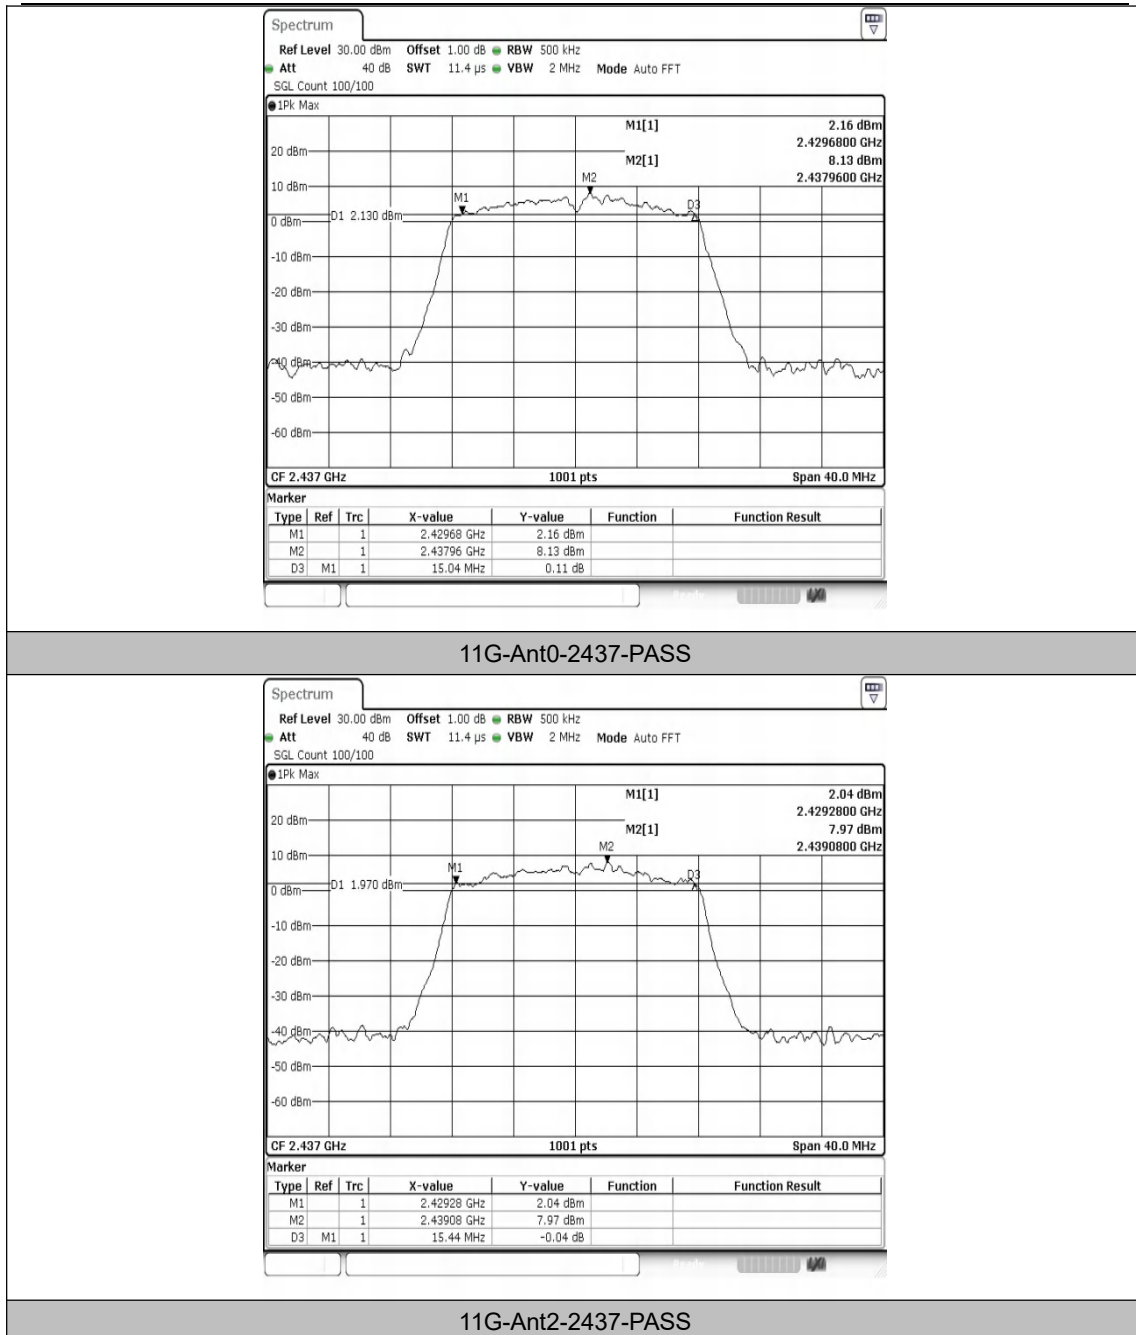


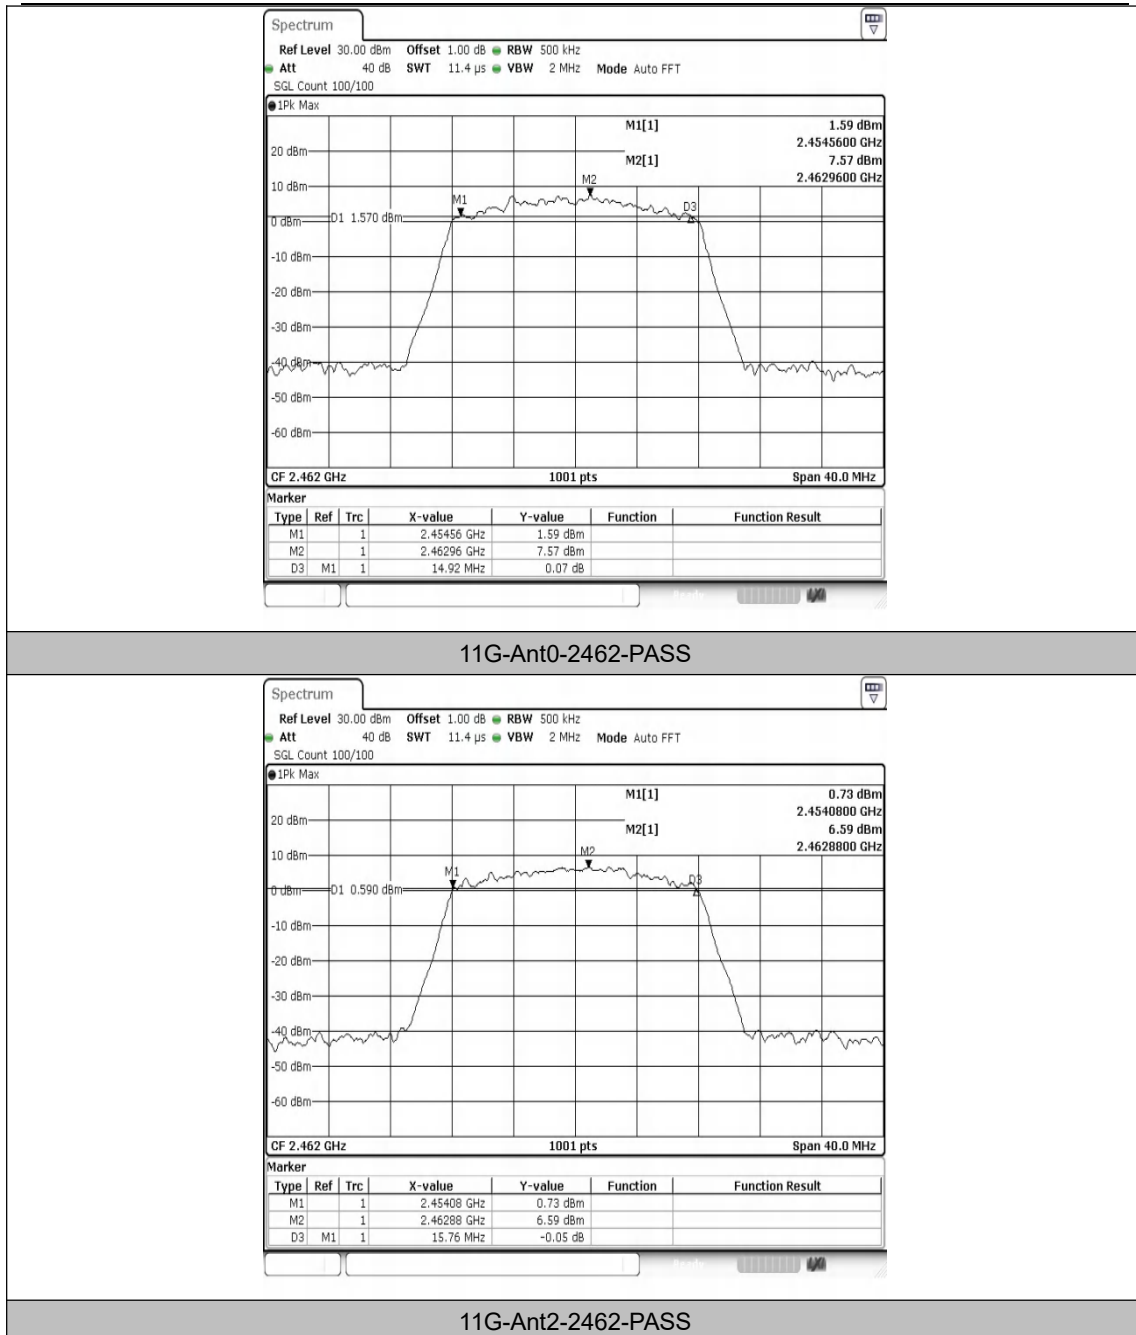

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

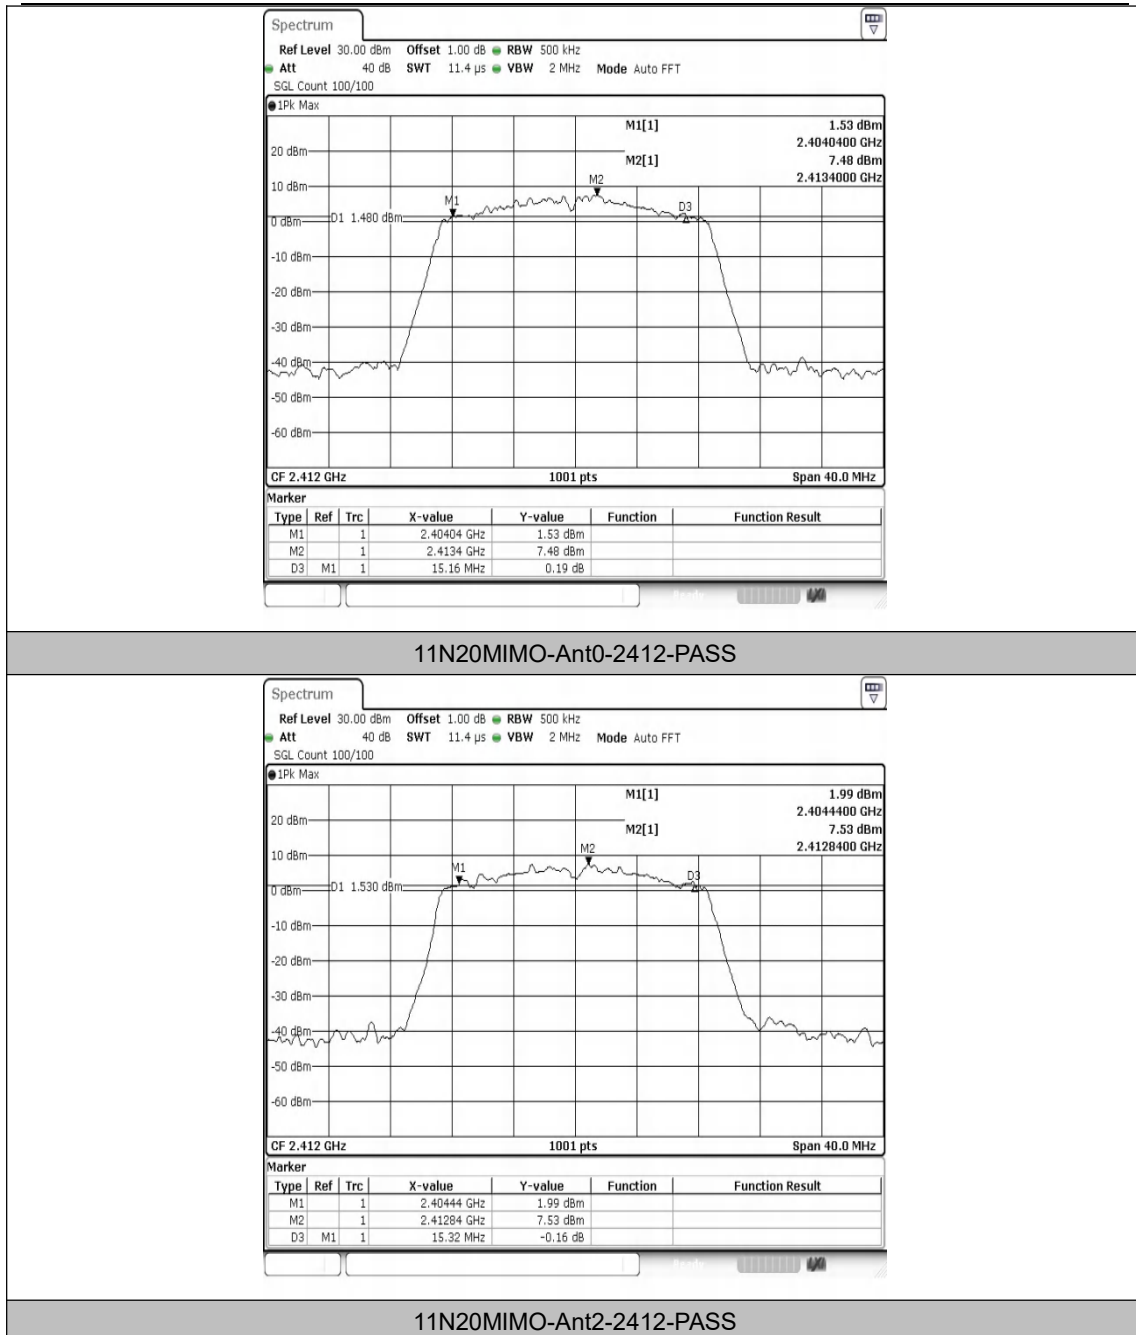


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

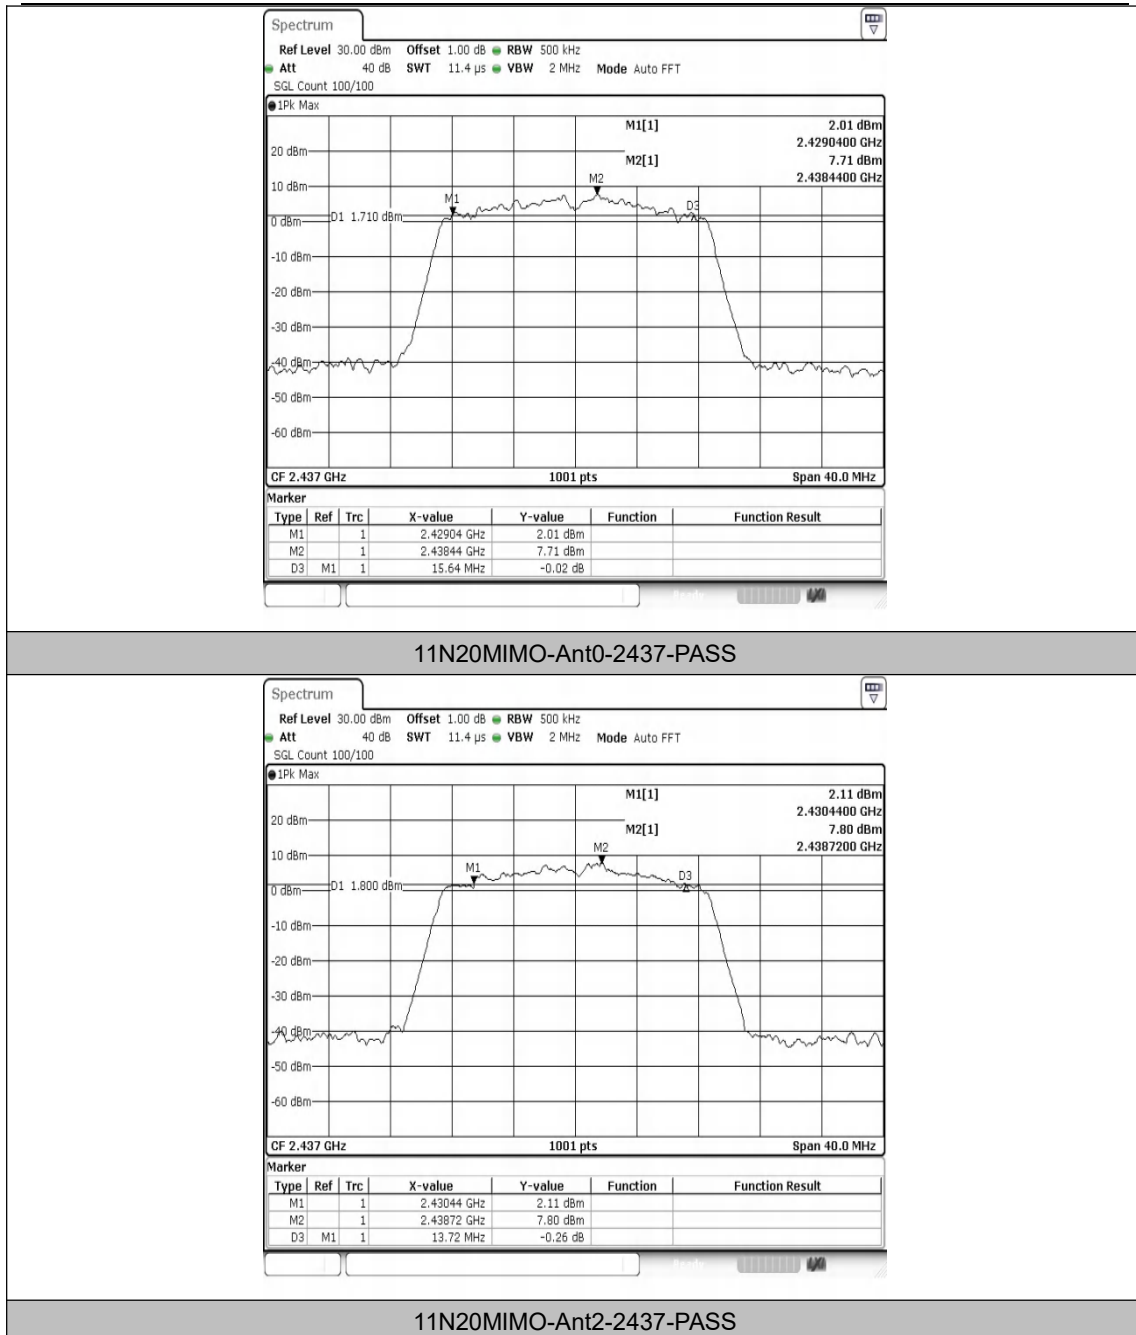


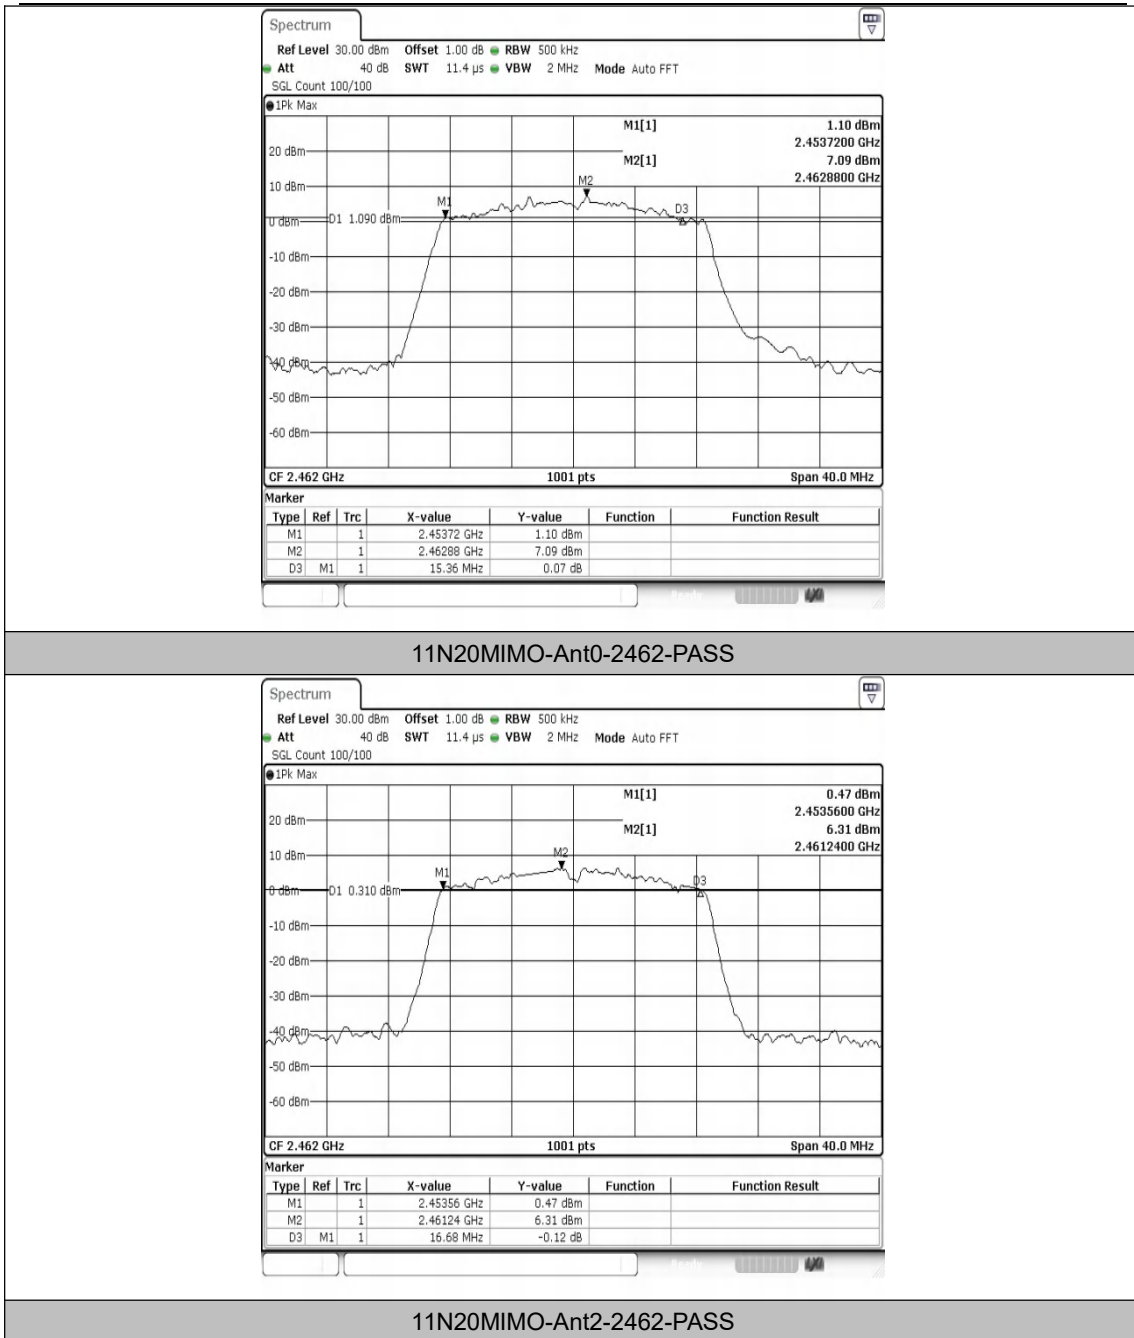

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

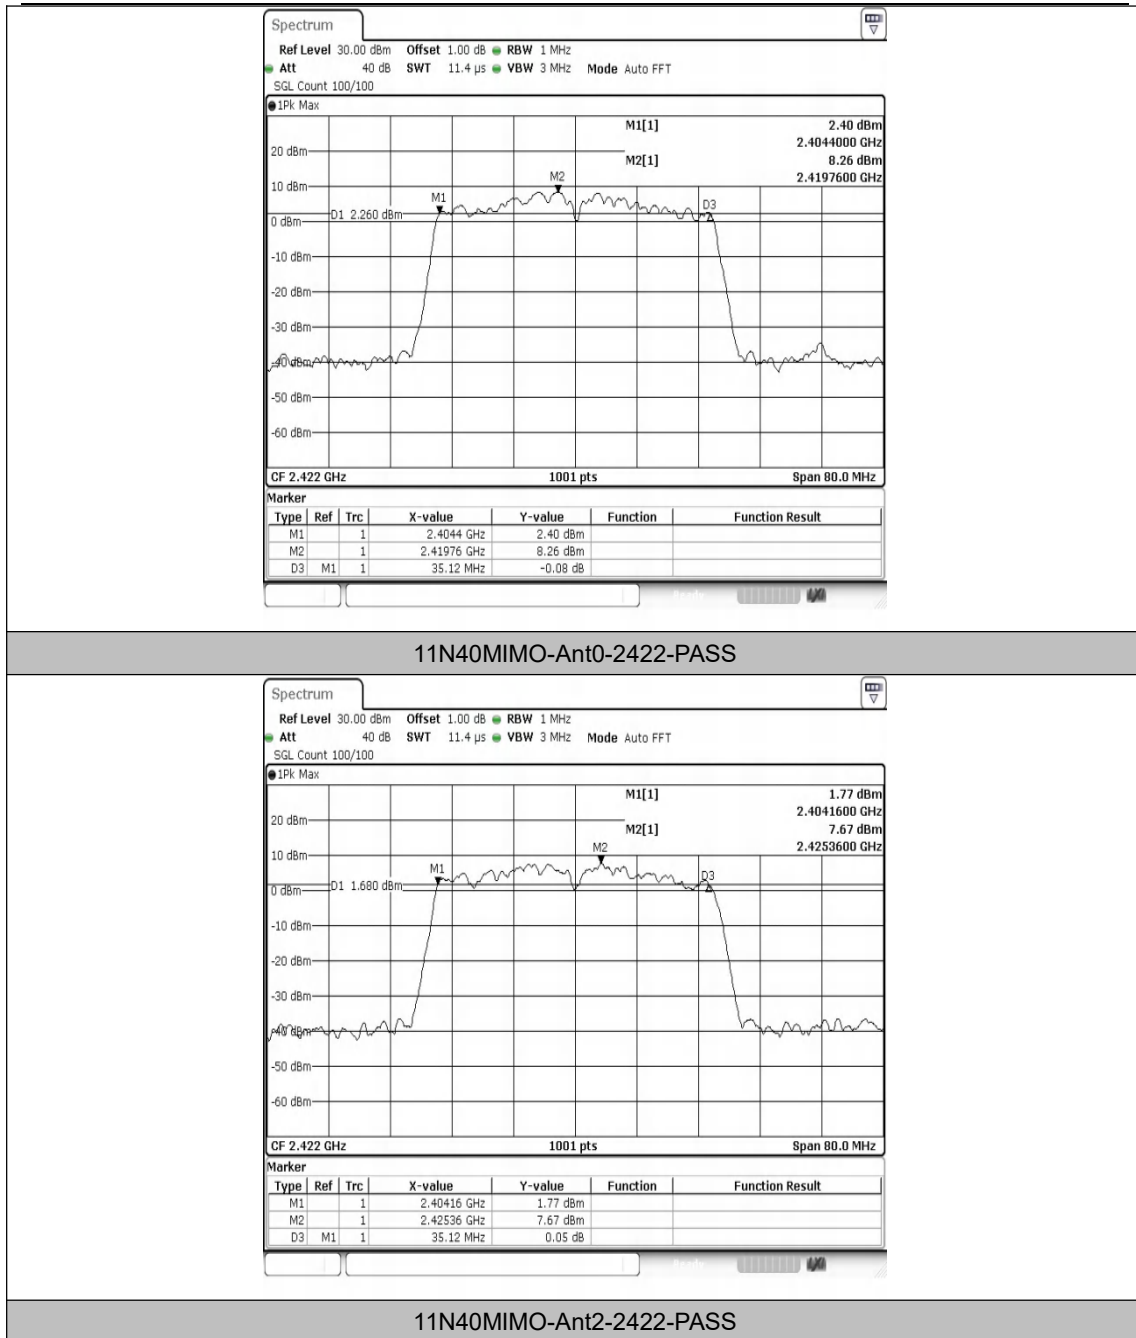



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

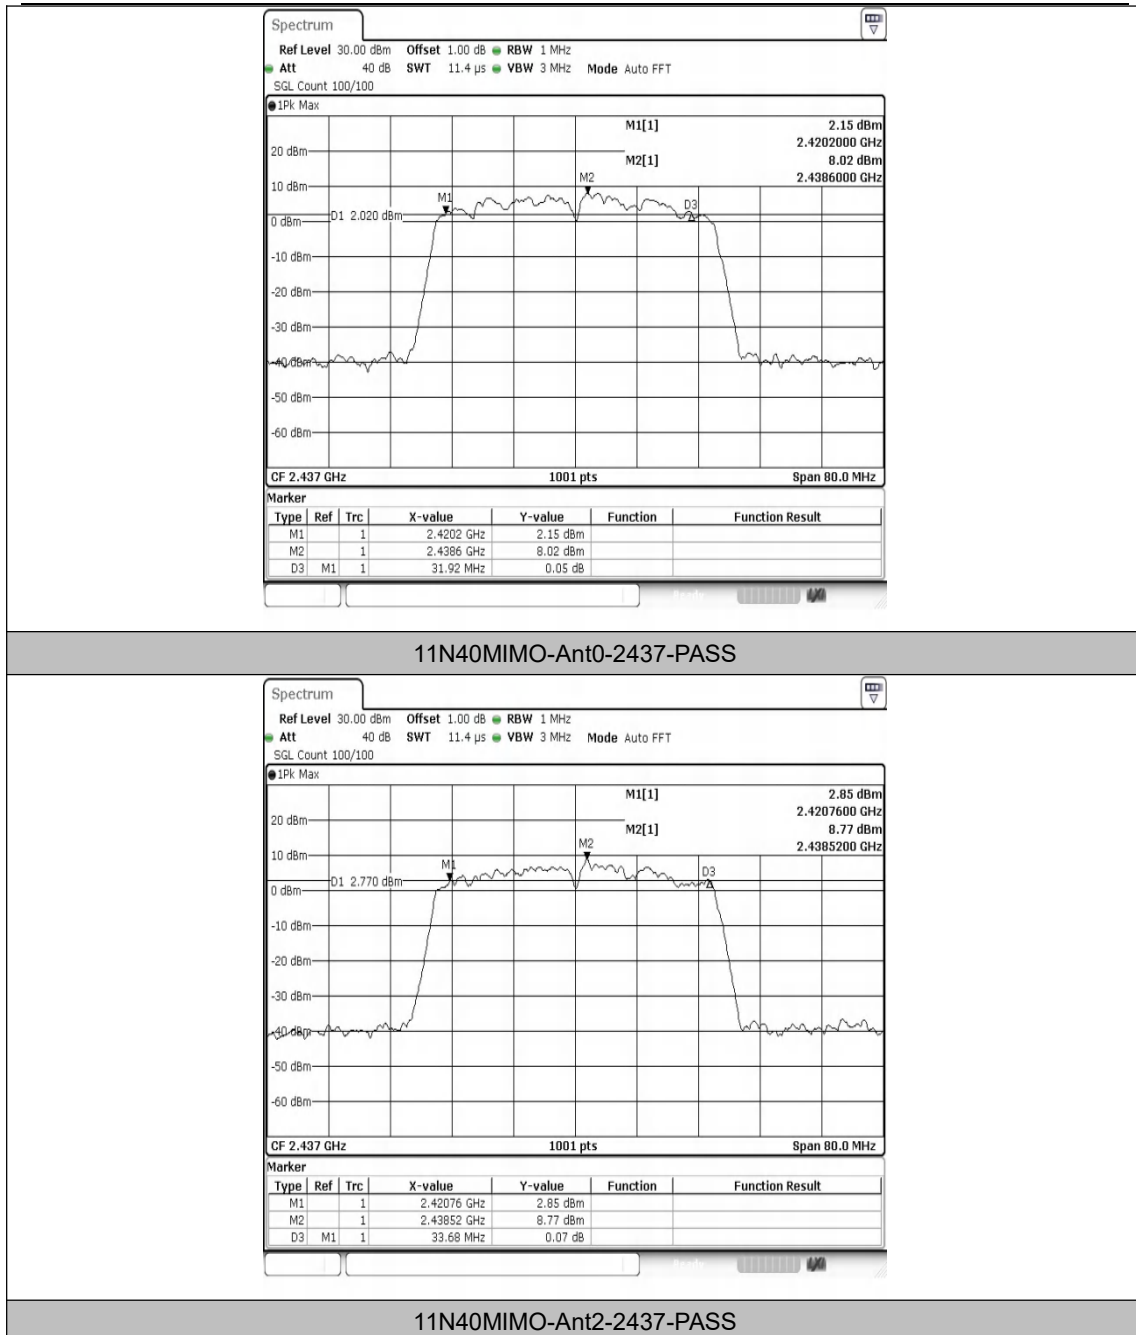


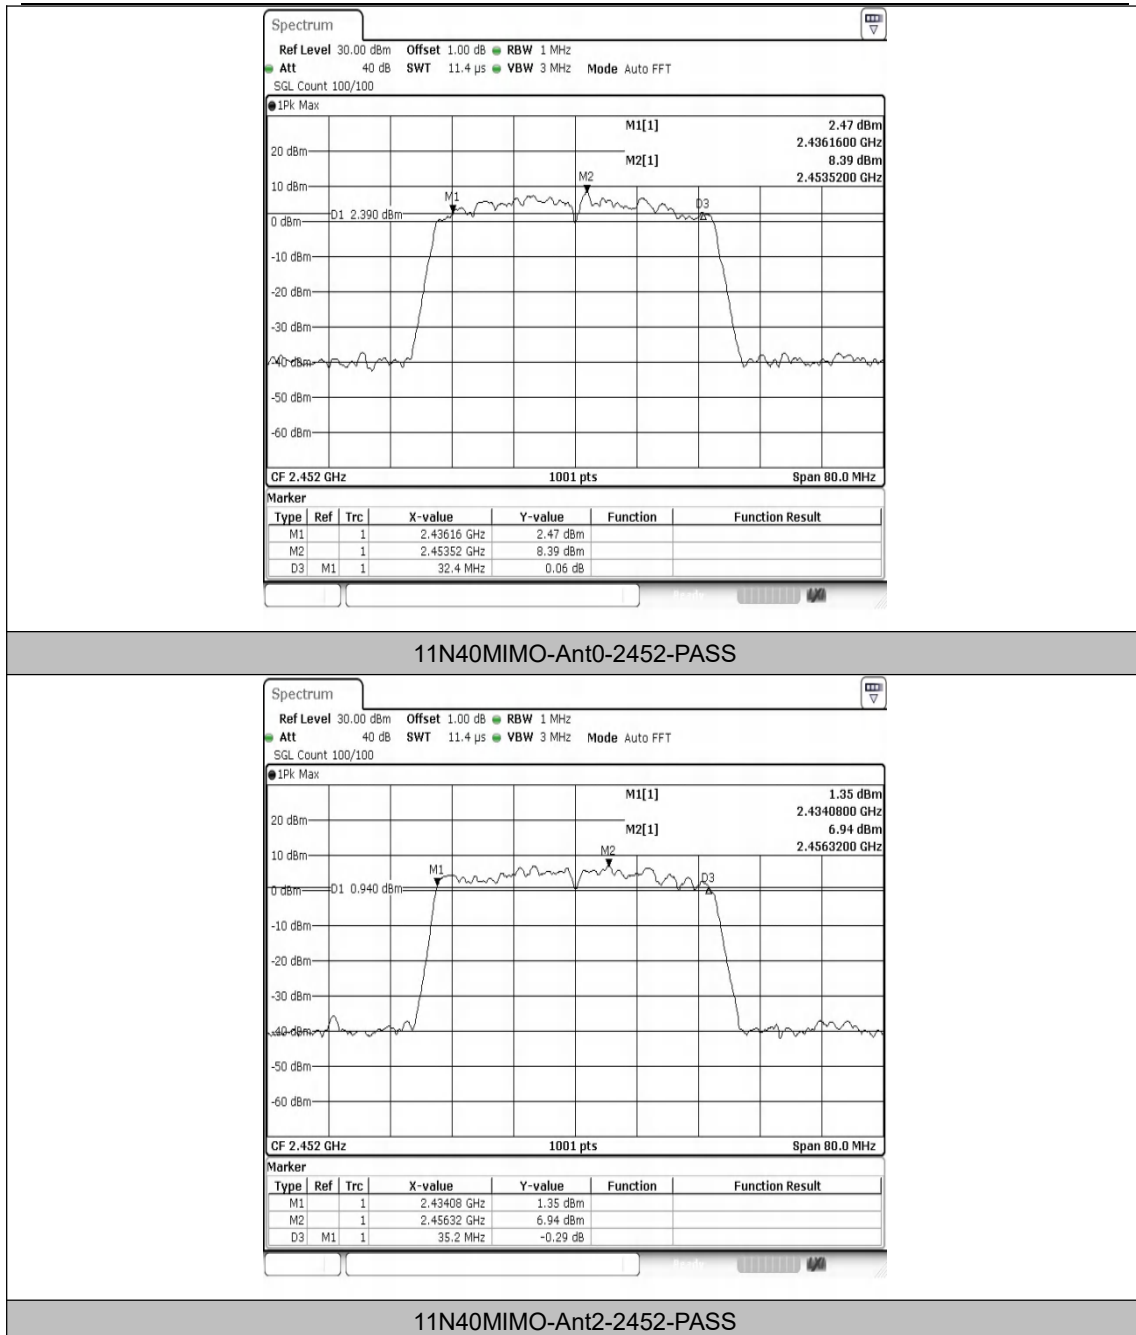


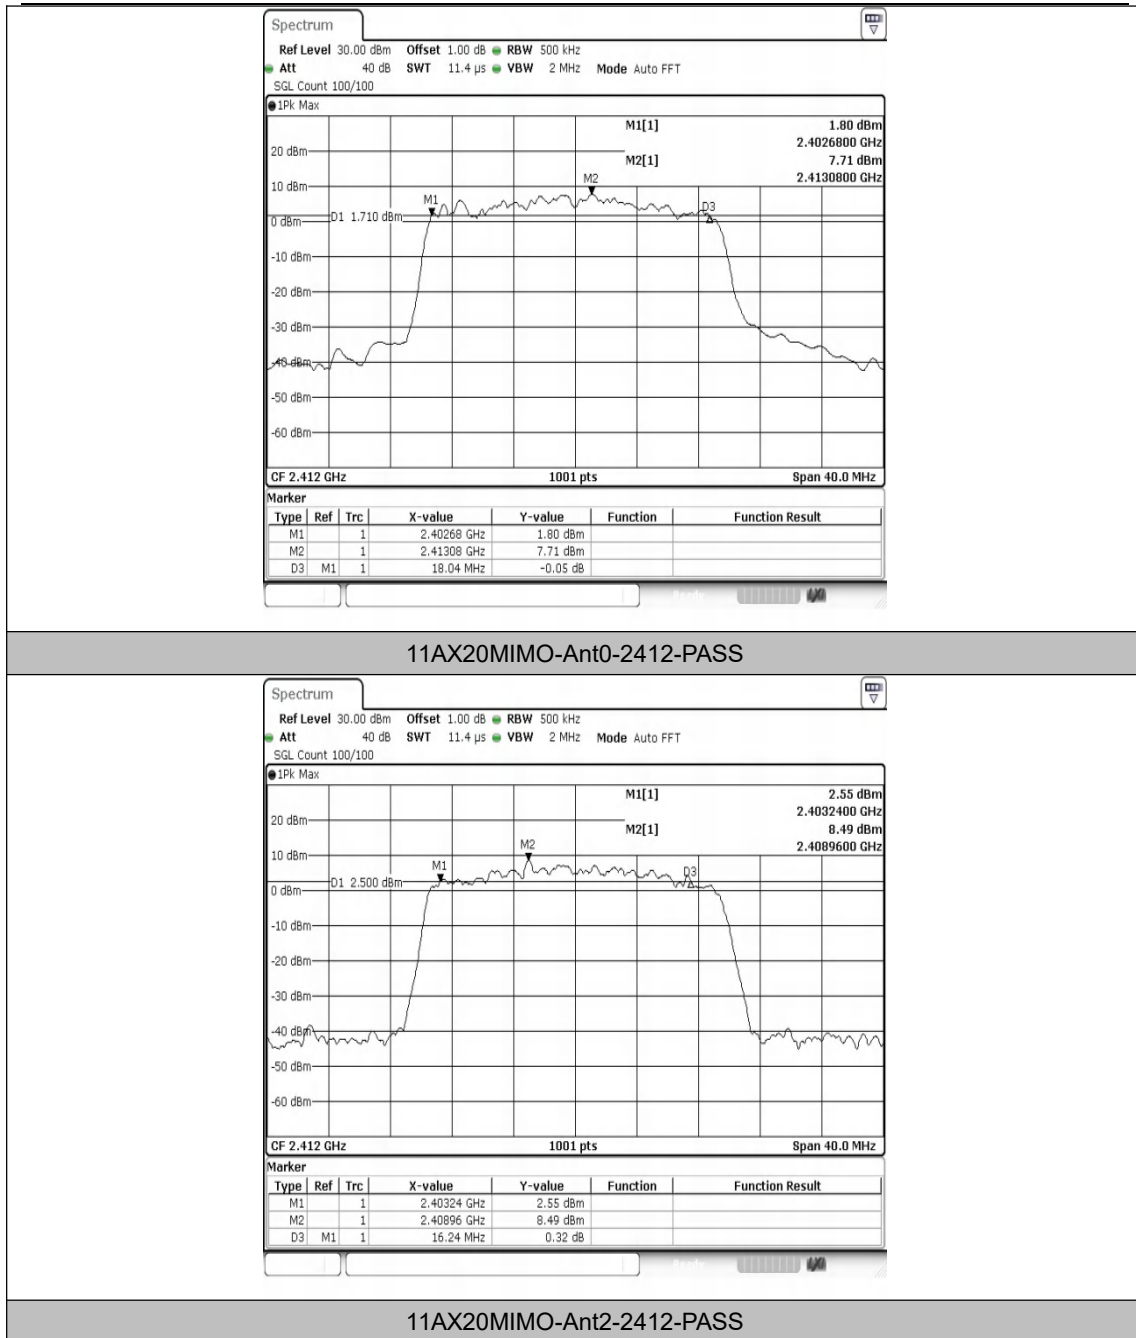


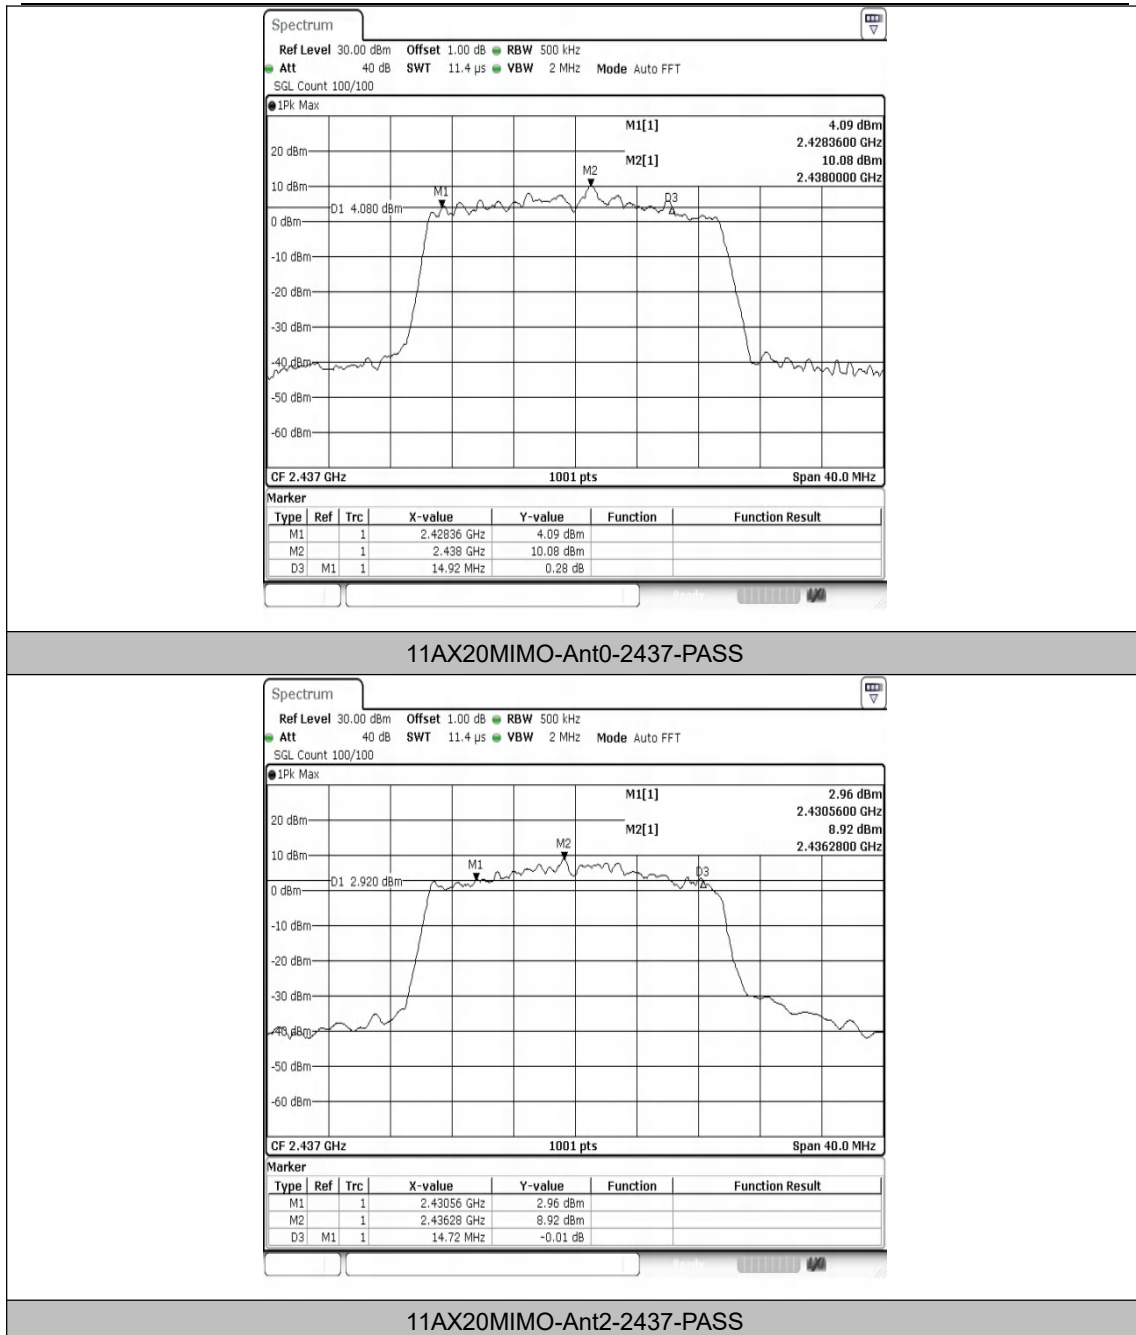

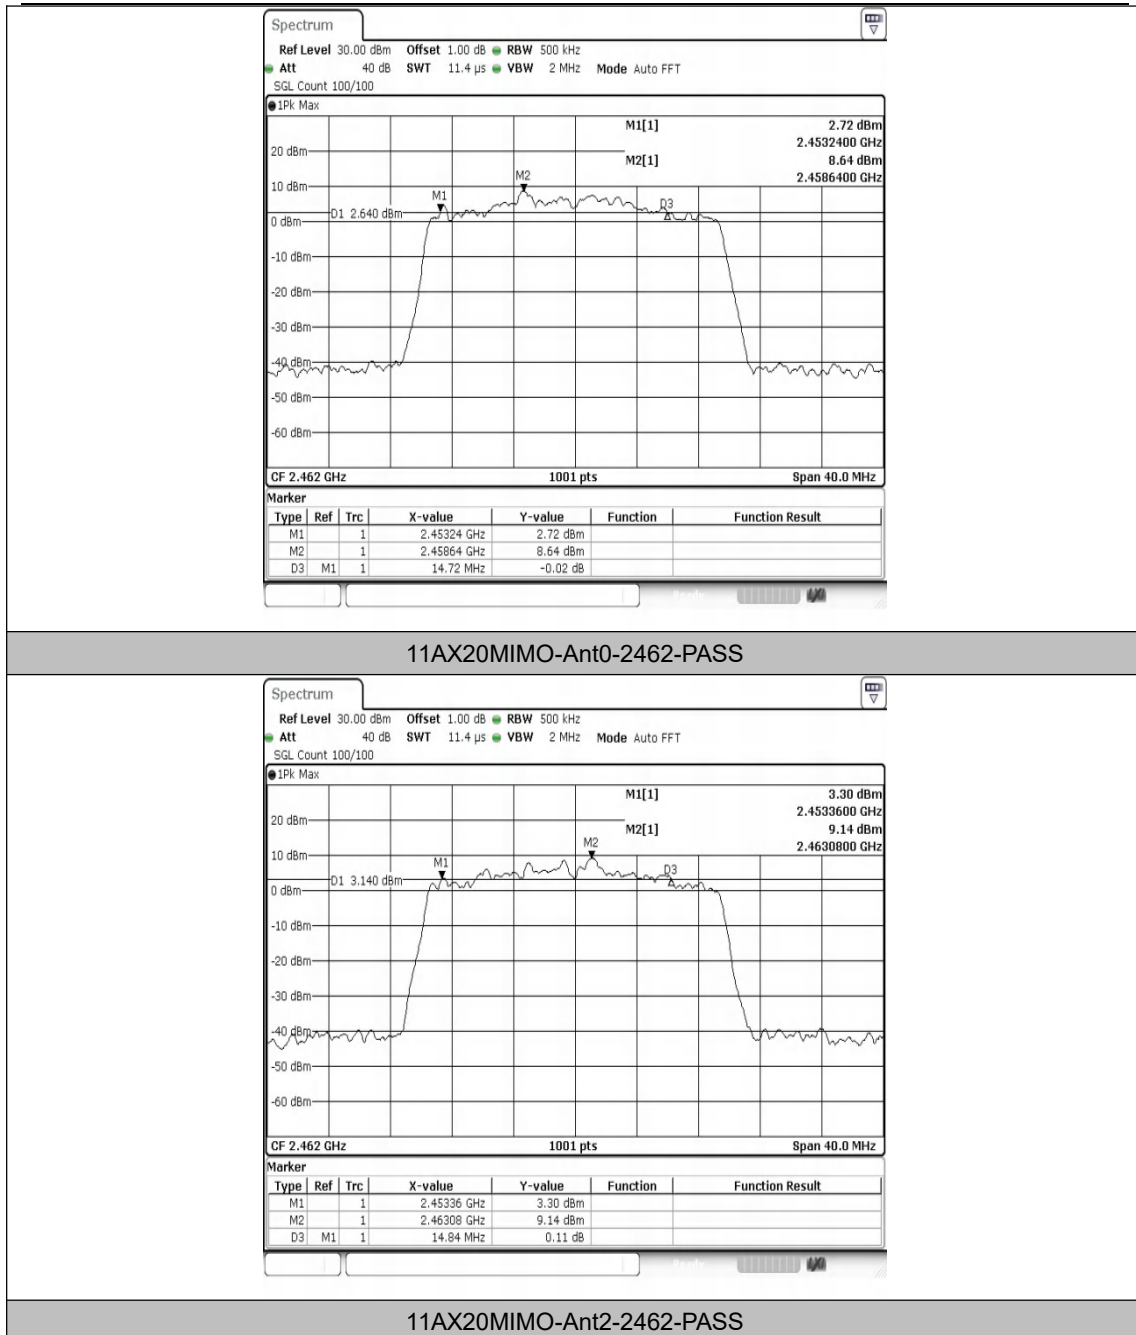

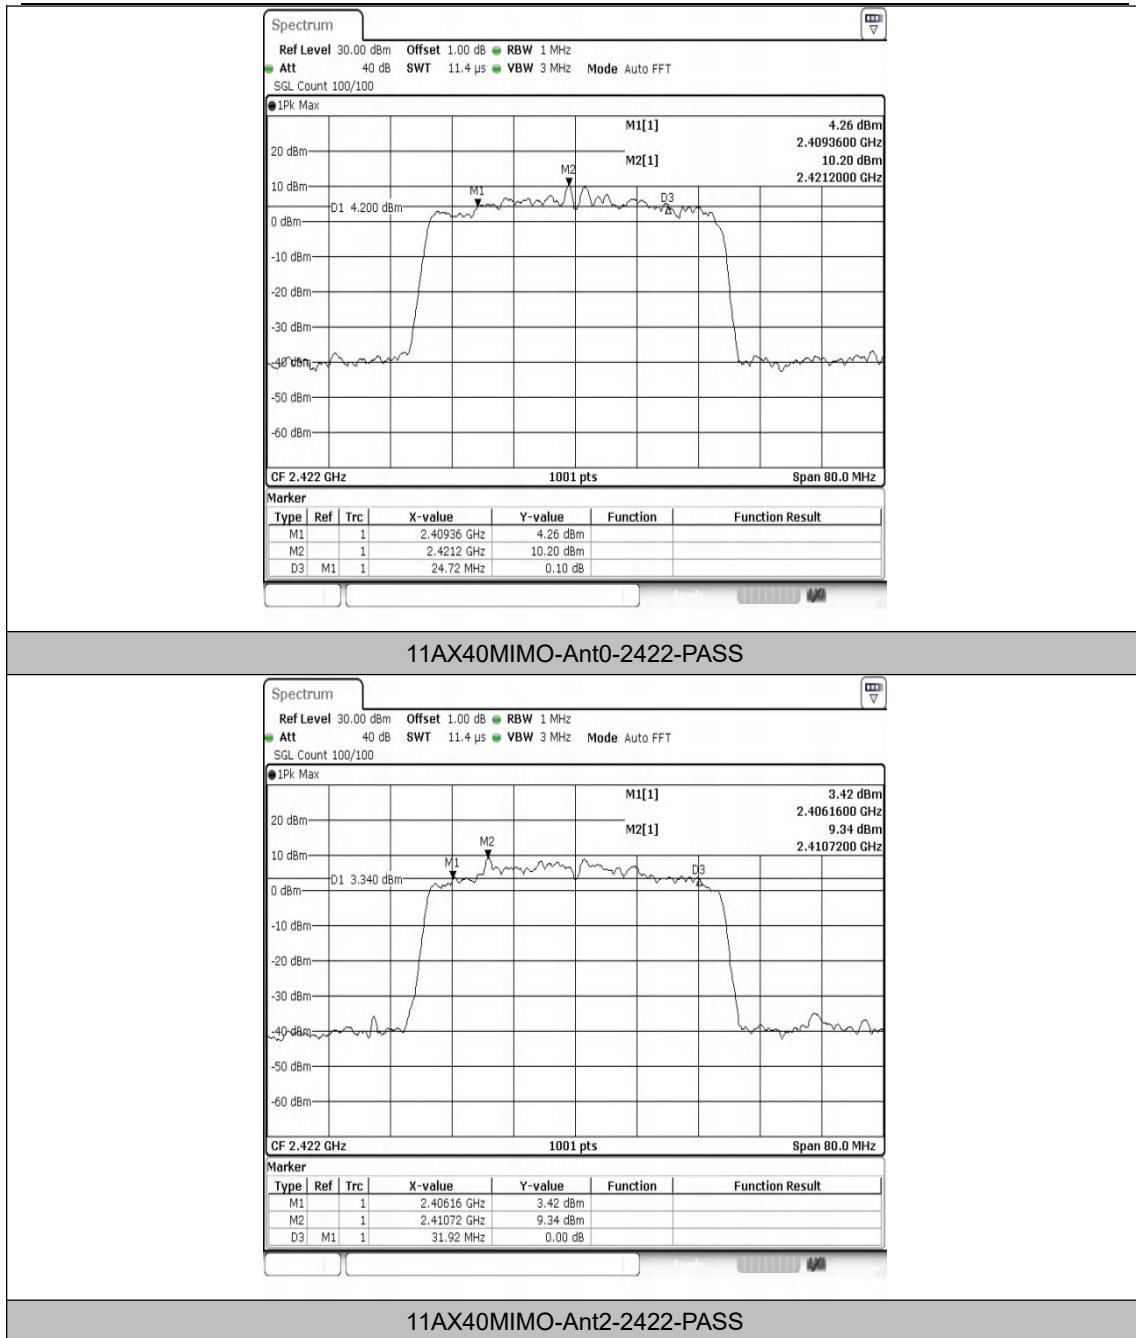

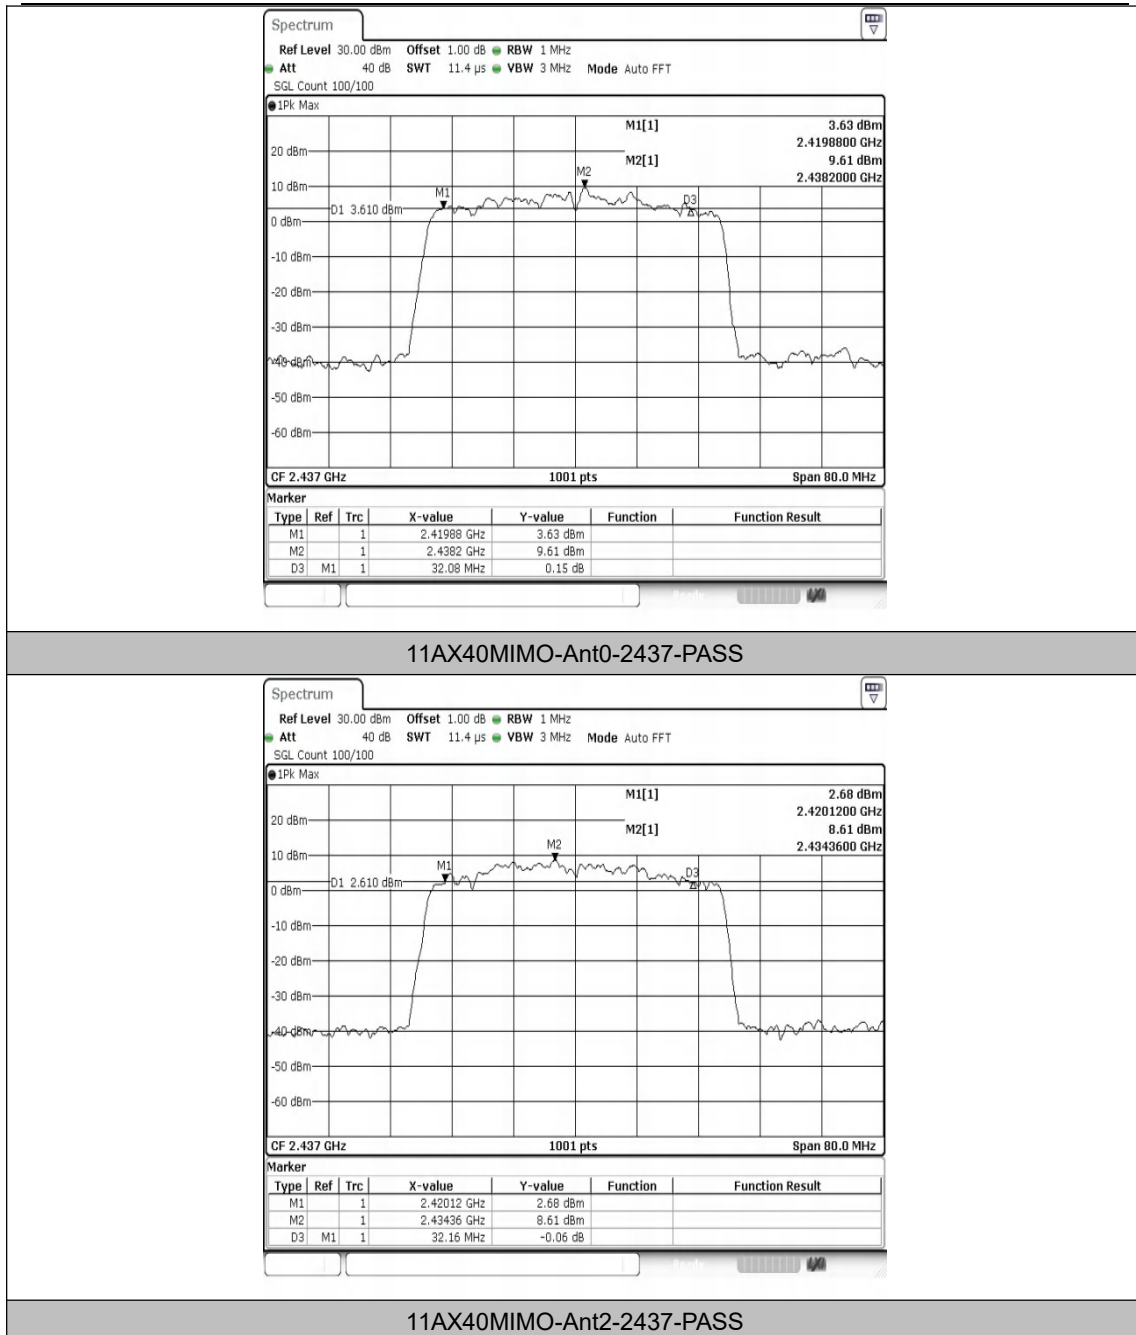

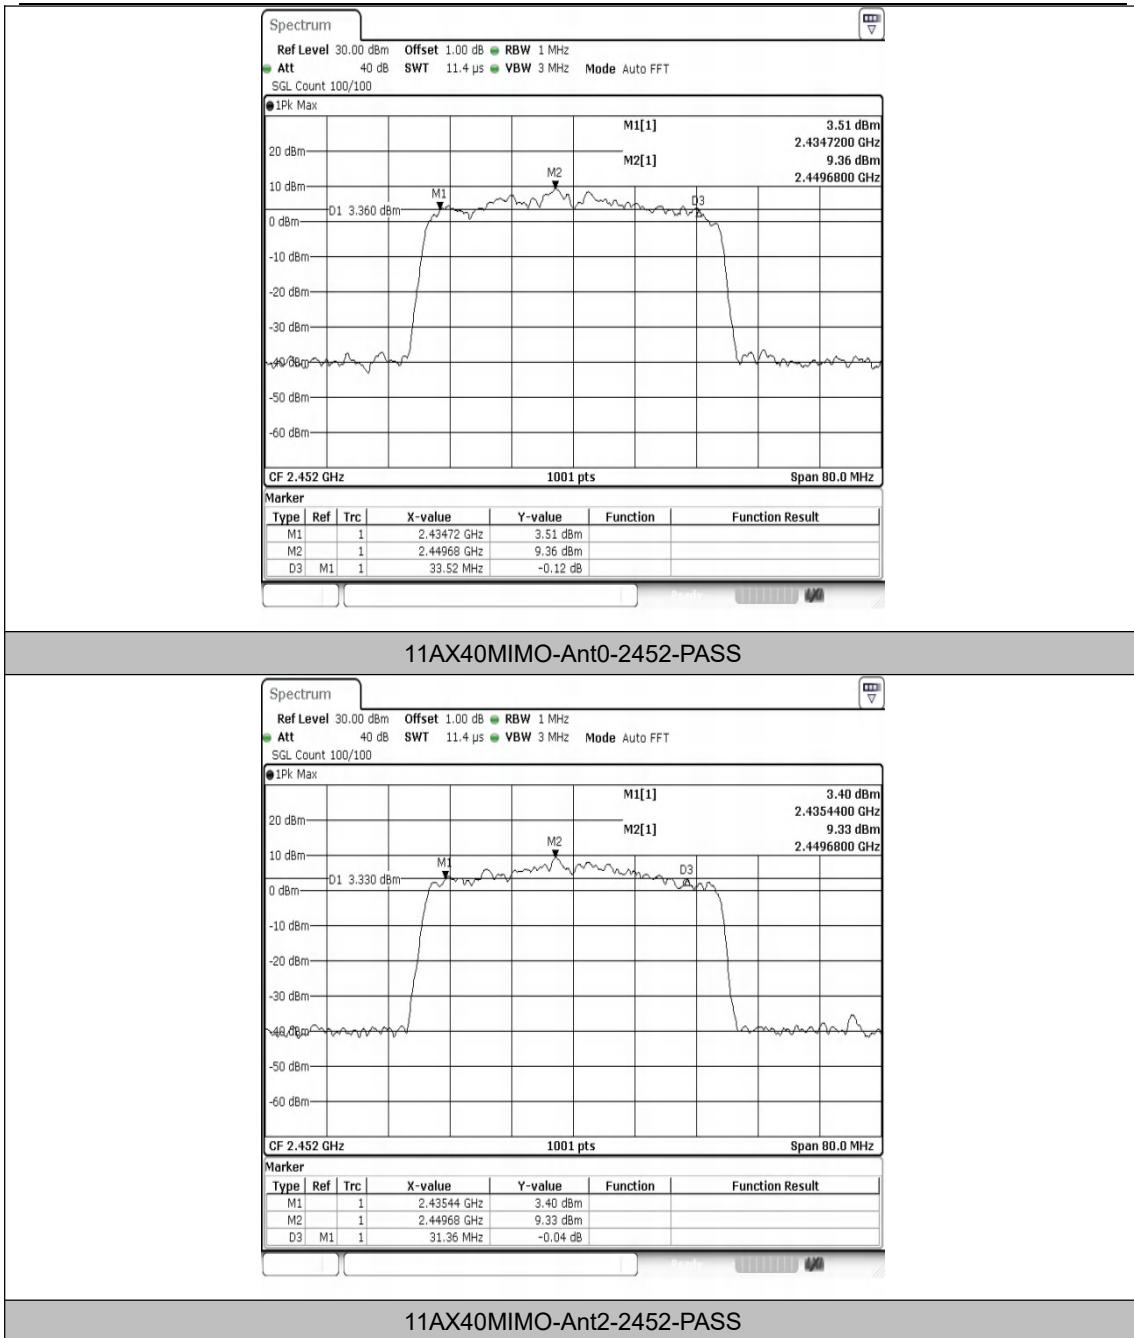


## Appendix B: 99% Occupied Bandwidth

### Test Result

| Test Mode  | Antenna | Channel Frequency[MHz] | OCB [MHz] | FL[MHz]   | FH[MHz]   | Limit[MHz] | Verdict |
|------------|---------|------------------------|-----------|-----------|-----------|------------|---------|
| 11B        | Ant0    | 2412                   | 13.906    | 2405.0470 | 2418.9530 | ---        | ---     |
| 11B        | Ant2    | 2412                   | 13.906    | 2405.0470 | 2418.9530 | ---        | ---     |
| 11B        | Ant0    | 2437                   | 13.946    | 2430.0070 | 2443.9530 | ---        | ---     |
| 11B        | Ant2    | 2437                   | 13.906    | 2430.0070 | 2443.9131 | ---        | ---     |
| 11B        | Ant0    | 2462                   | 13.946    | 2455.0070 | 2468.9530 | ---        | ---     |
| 11B        | Ant2    | 2462                   | 13.906    | 2455.0070 | 2468.9131 | ---        | ---     |
| 11G        | Ant0    | 2412                   | 16.184    | 2403.8881 | 2420.0719 | ---        | ---     |
| 11G        | Ant2    | 2412                   | 16.184    | 2403.8881 | 2420.0719 | ---        | ---     |
| 11G        | Ant0    | 2437                   | 16.264    | 2428.8881 | 2445.1518 | ---        | ---     |
| 11G        | Ant2    | 2437                   | 16.224    | 2428.8881 | 2445.1119 | ---        | ---     |
| 11G        | Ant0    | 2462                   | 16.304    | 2453.8881 | 2470.1918 | ---        | ---     |
| 11G        | Ant2    | 2462                   | 16.224    | 2453.8881 | 2470.1119 | ---        | ---     |
| 11N20MIMO  | Ant0    | 2412                   | 17.303    | 2403.3287 | 2420.6314 | ---        | ---     |
| 11N20MIMO  | Ant2    | 2412                   | 17.343    | 2403.2887 | 2420.6314 | ---        | ---     |
| 11N20MIMO  | Ant0    | 2437                   | 17.343    | 2428.2488 | 2445.5914 | ---        | ---     |
| 11N20MIMO  | Ant2    | 2437                   | 17.343    | 2428.2887 | 2445.6314 | ---        | ---     |
| 11N20MIMO  | Ant0    | 2462                   | 17.263    | 2453.3686 | 2470.6314 | ---        | ---     |
| 11N20MIMO  | Ant2    | 2462                   | 17.383    | 2453.2887 | 2470.6713 | ---        | ---     |
| 11N40MIMO  | Ant0    | 2422                   | 35.724    | 2404.0979 | 2439.8222 | ---        | ---     |
| 11N40MIMO  | Ant2    | 2422                   | 35.724    | 2404.0979 | 2439.8222 | ---        | ---     |
| 11N40MIMO  | Ant0    | 2437                   | 35.804    | 2419.0180 | 2454.8222 | ---        | ---     |
| 11N40MIMO  | Ant2    | 2437                   | 35.804    | 2419.0979 | 2454.9021 | ---        | ---     |
| 11N40MIMO  | Ant0    | 2452                   | 35.724    | 2434.0979 | 2469.8222 | ---        | ---     |
| 11N40MIMO  | Ant2    | 2452                   | 35.884    | 2434.0979 | 2469.9820 | ---        | ---     |
| 11AX20MIMO | Ant0    | 2412                   | 18.621    | 2402.6494 | 2421.2707 | ---        | ---     |
| 11AX20MIMO | Ant2    | 2412                   | 18.581    | 2402.6893 | 2421.2707 | ---        | ---     |
| 11AX20MIMO | Ant0    | 2437                   | 18.701    | 2427.5694 | 2446.2707 | ---        | ---     |
| 11AX20MIMO | Ant2    | 2437                   | 18.701    | 2427.5694 | 2446.2707 | ---        | ---     |
| 11AX20MIMO | Ant0    | 2462                   | 18.741    | 2452.6094 | 2471.3506 | ---        | ---     |
| 11AX20MIMO | Ant2    | 2462                   | 18.661    | 2452.6094 | 2471.2707 | ---        | ---     |
| 11AX40MIMO | Ant0    | 2422                   | 37.003    | 2403.4585 | 2440.4615 | ---        | ---     |
| 11AX40MIMO | Ant2    | 2422                   | 37.323    | 2403.2987 | 2440.6214 | ---        | ---     |
| 11AX40MIMO | Ant0    | 2437                   | 37.403    | 2418.2987 | 2455.7013 | ---        | ---     |
| 11AX40MIMO | Ant2    | 2437                   | 37.403    | 2418.2987 | 2455.7013 | ---        | ---     |
| 11AX40MIMO | Ant0    | 2452                   | 37.243    | 2433.2987 | 2470.5415 | ---        | ---     |
| 11AX40MIMO | Ant2    | 2452                   | 37.163    | 2433.2987 | 2470.4615 | ---        | ---     |


## Test Graphs

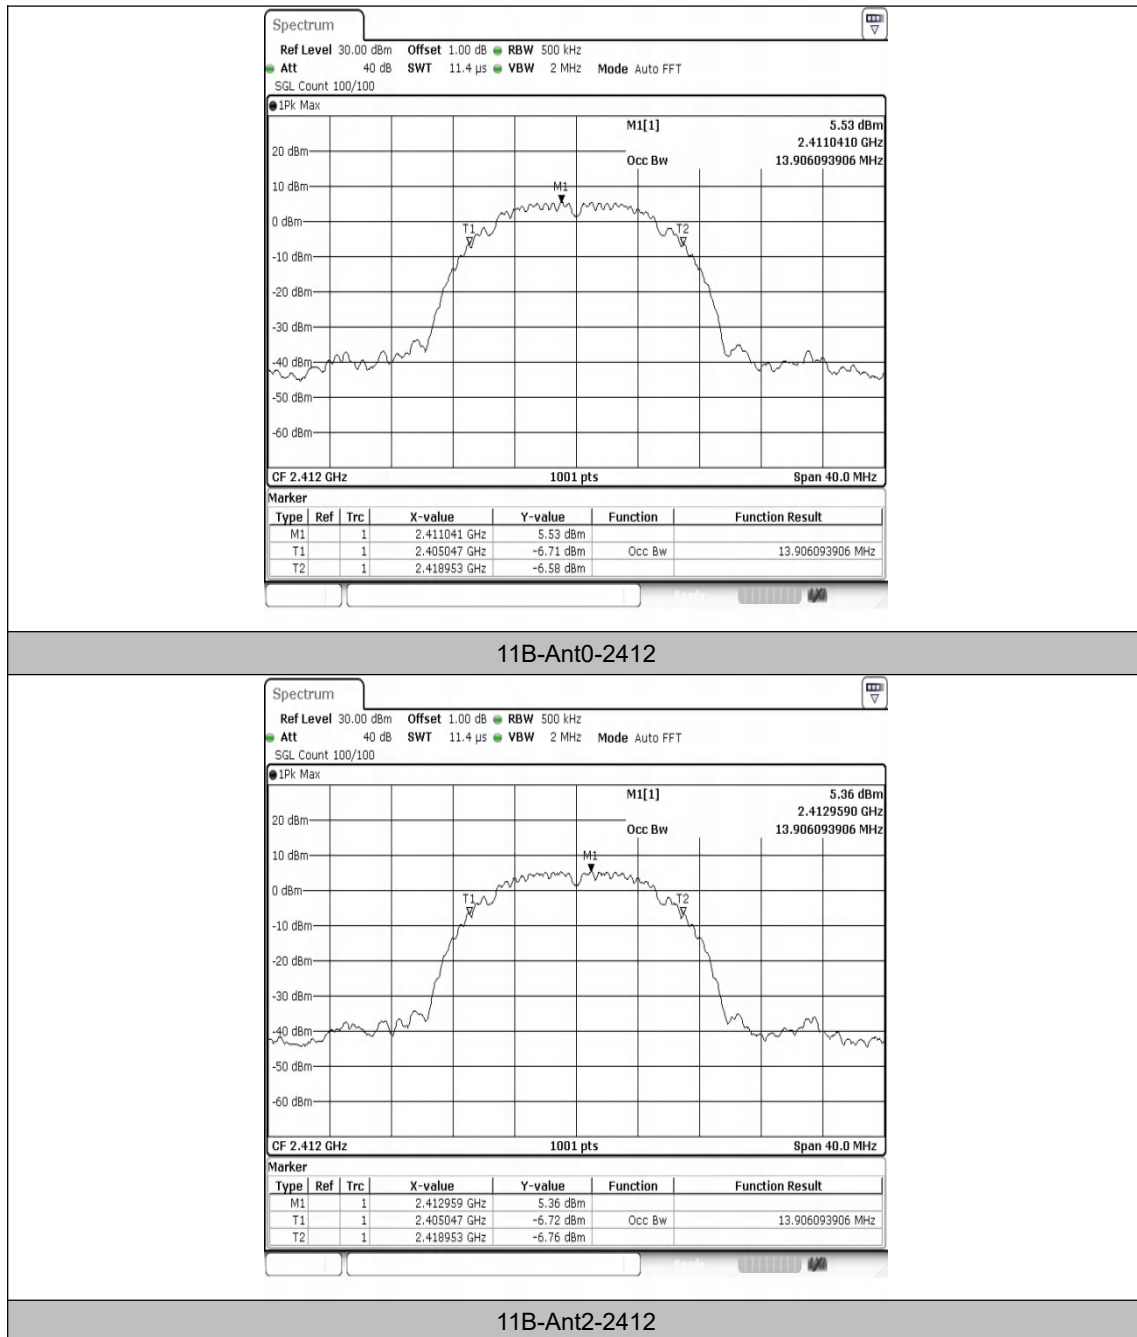


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

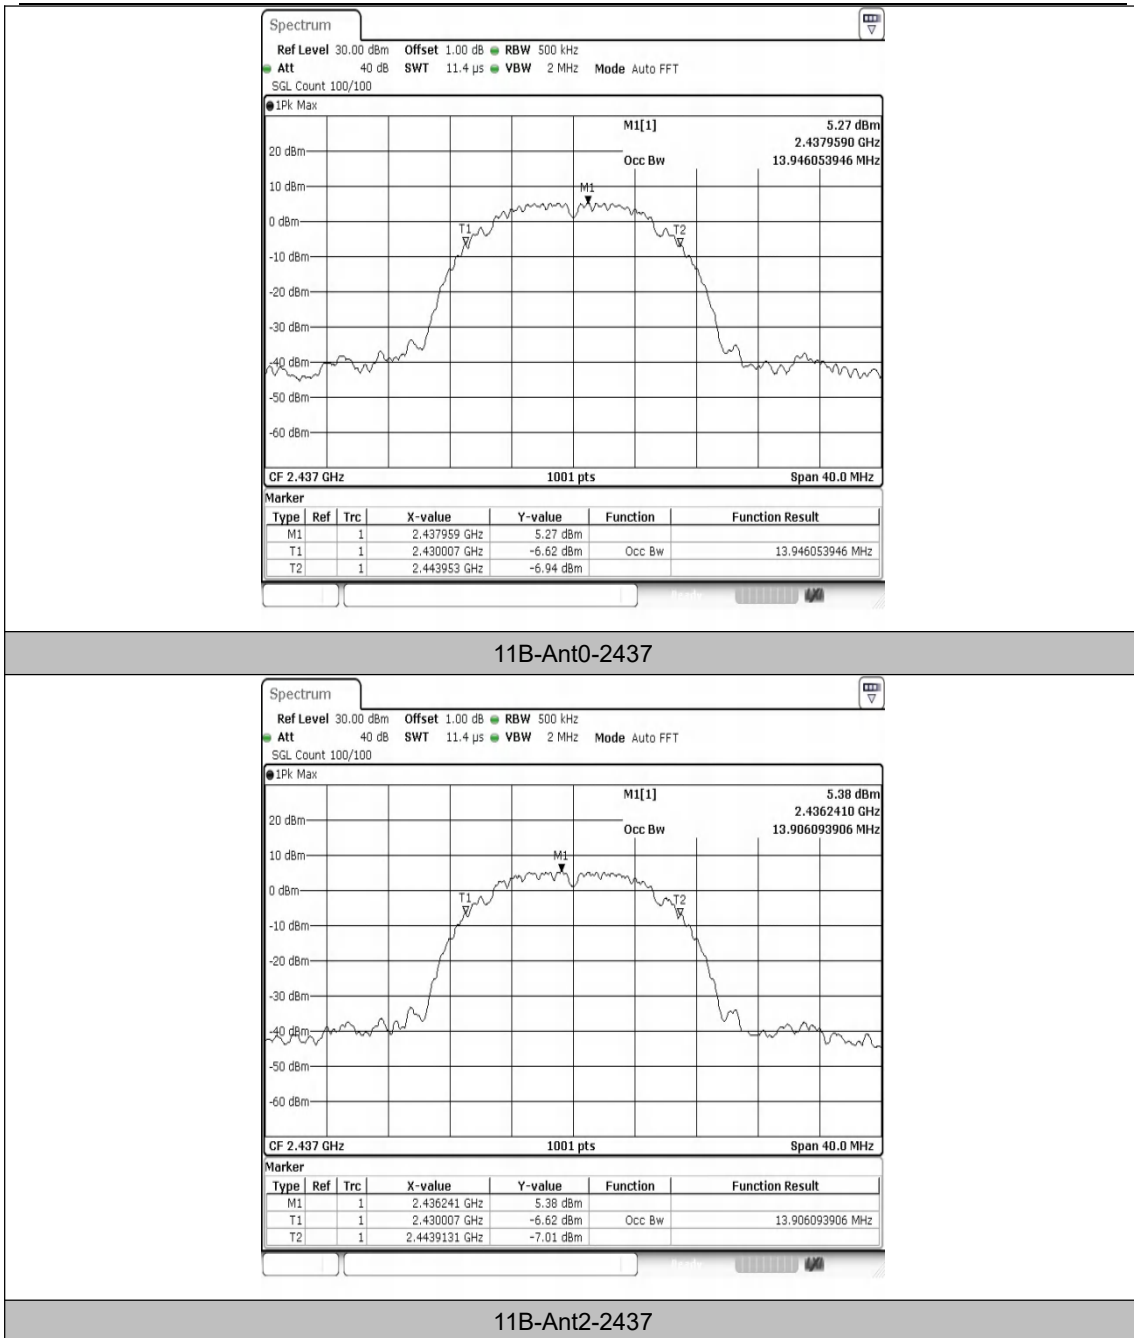


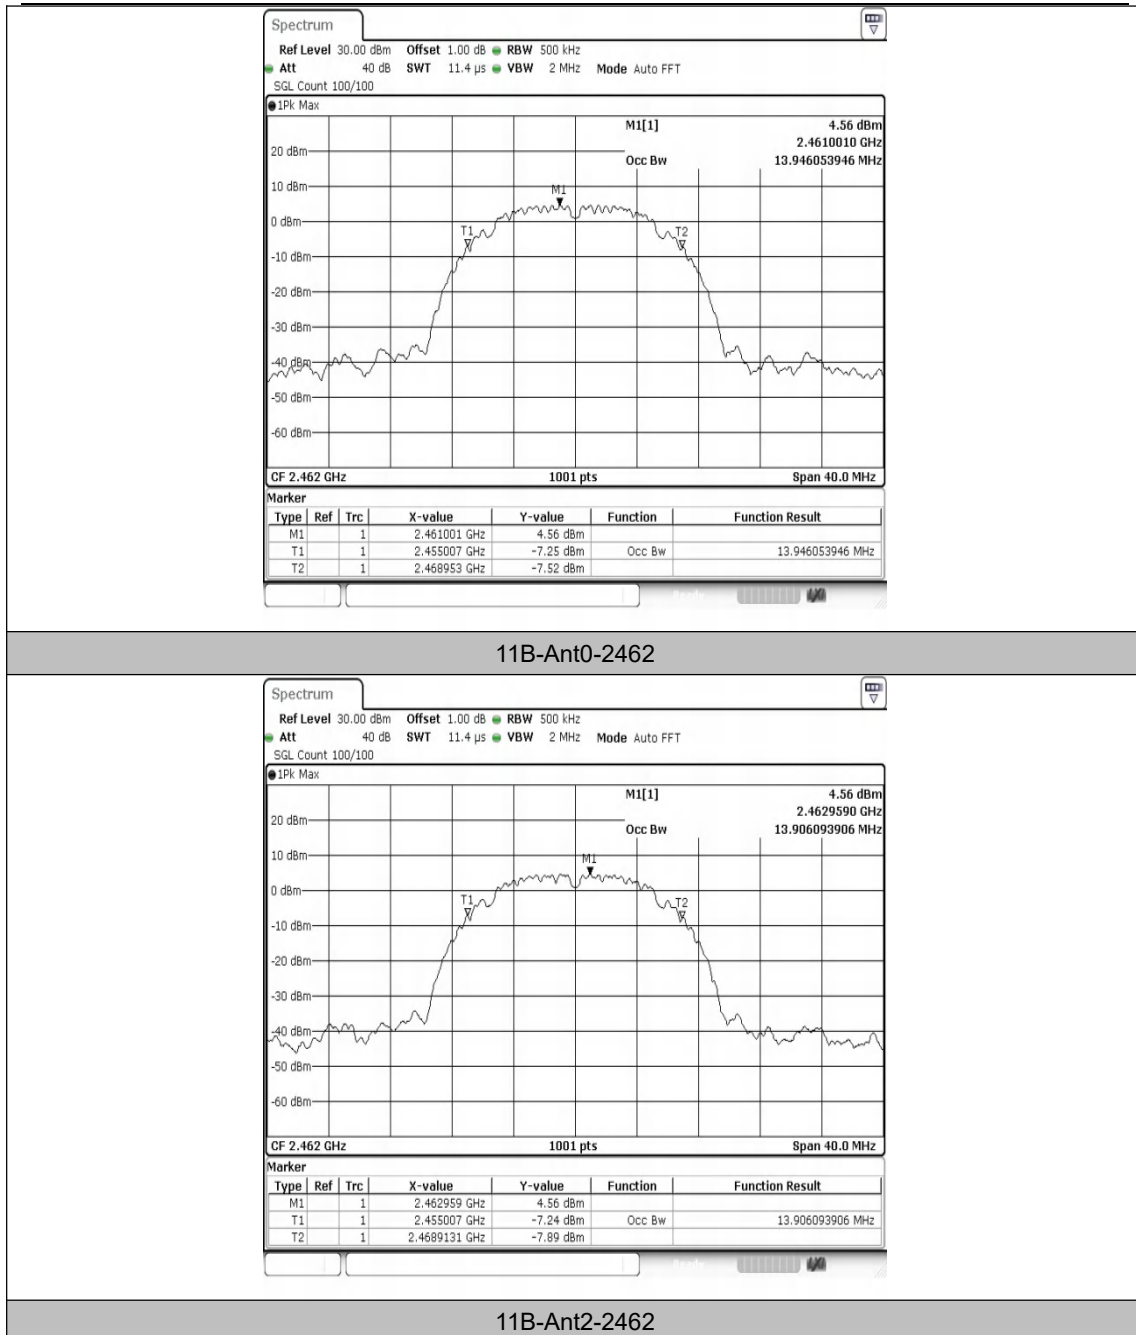



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

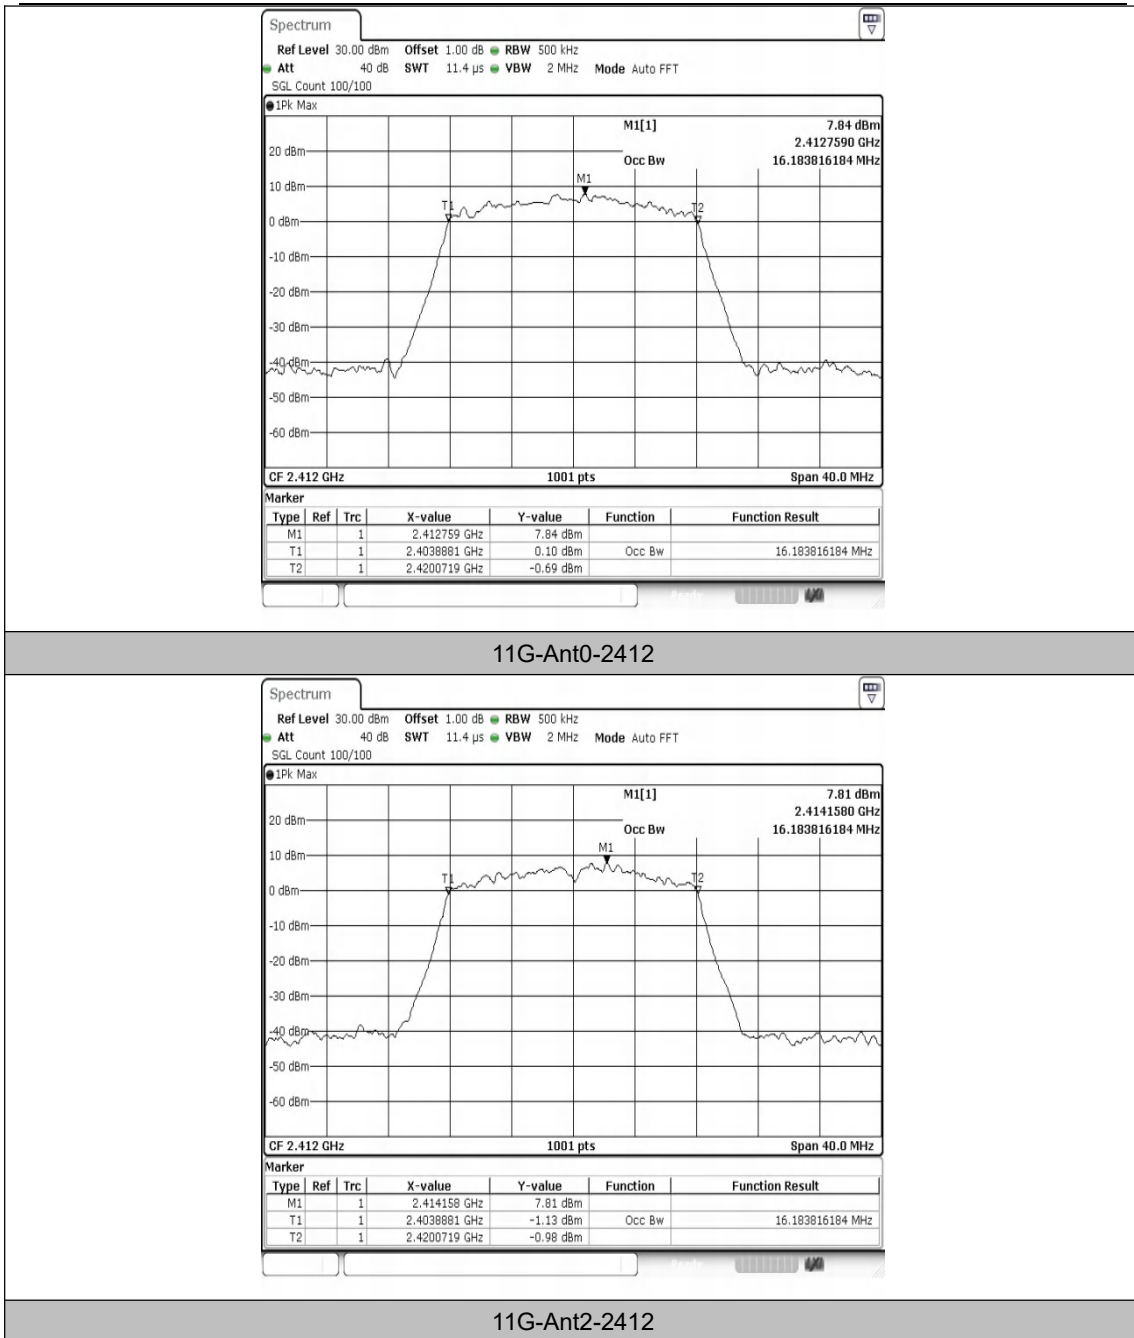

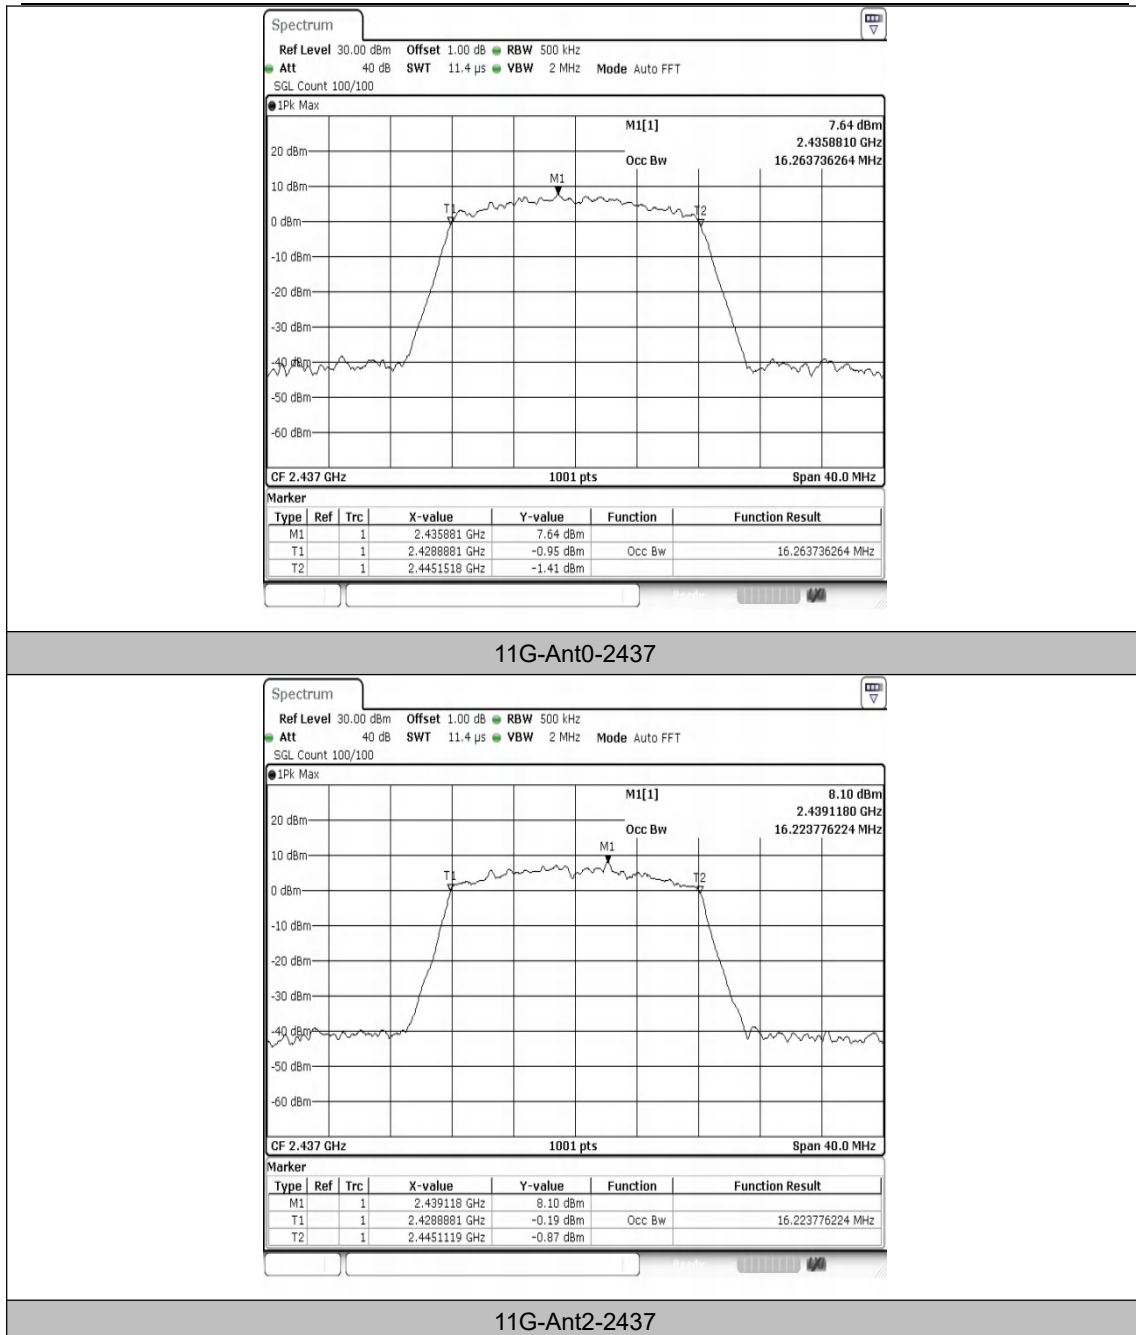


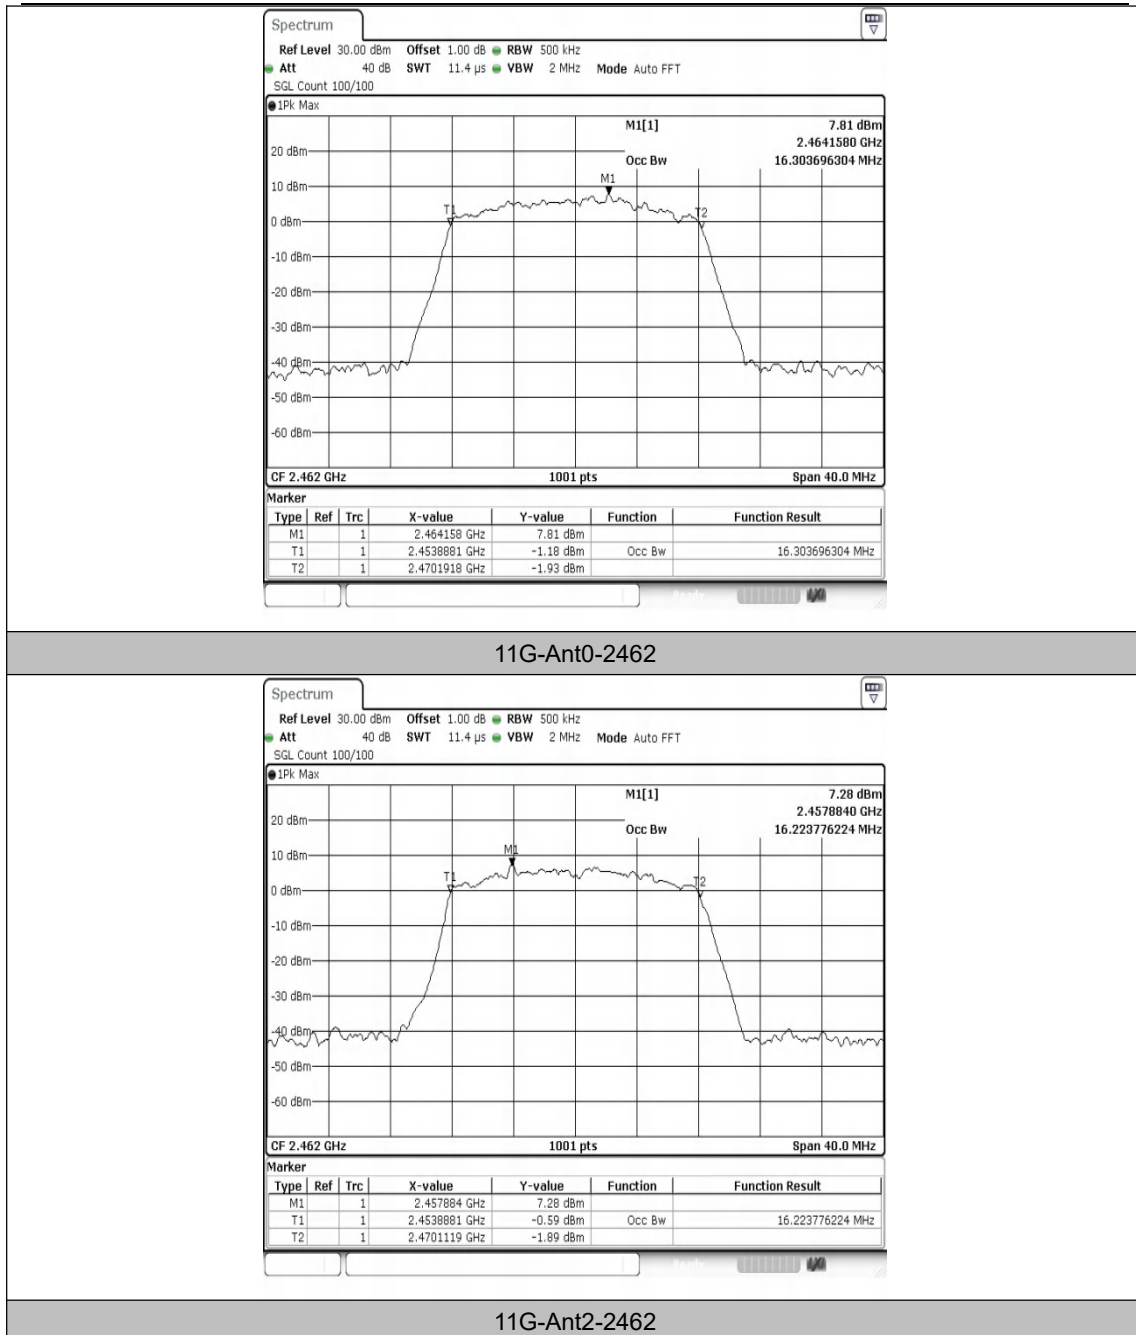


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

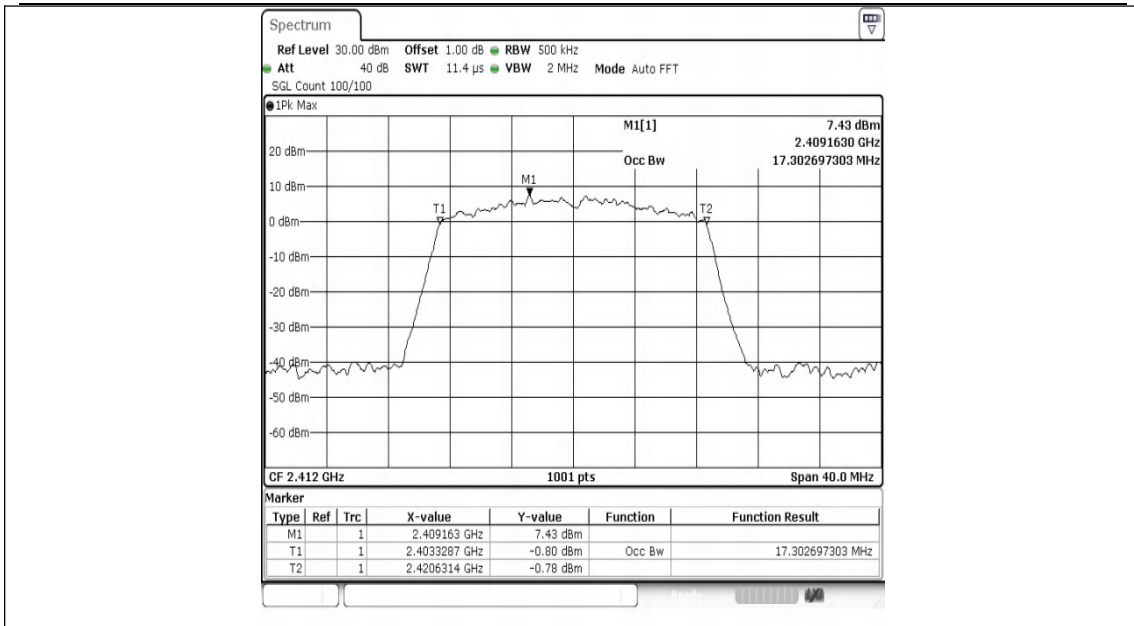

11N20MIMO-Ant0-2412

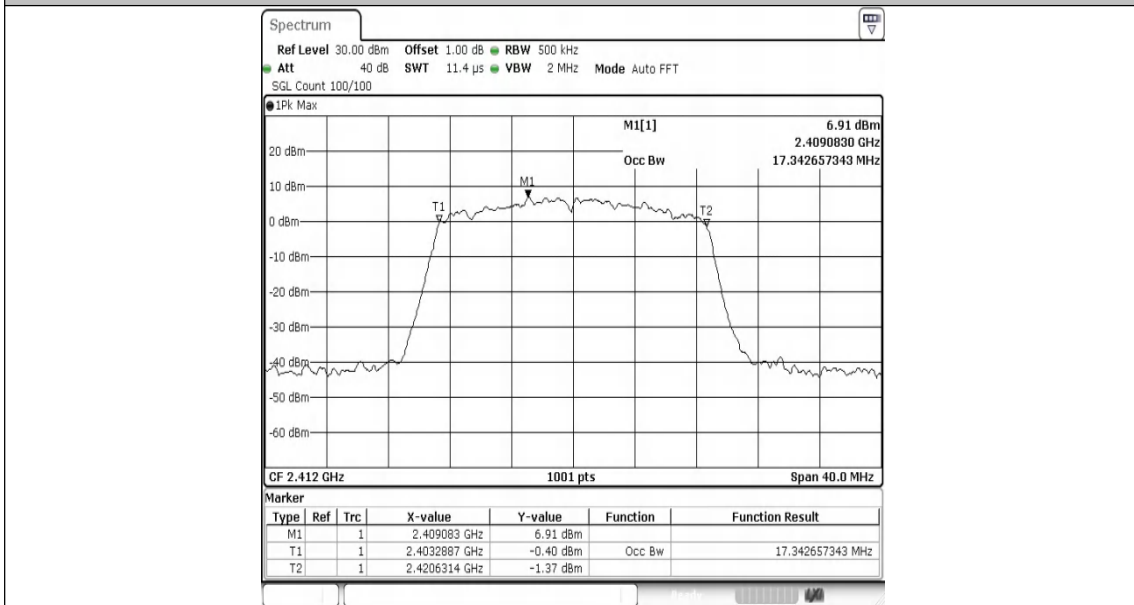


11N20MIMO-Ant2-2412

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

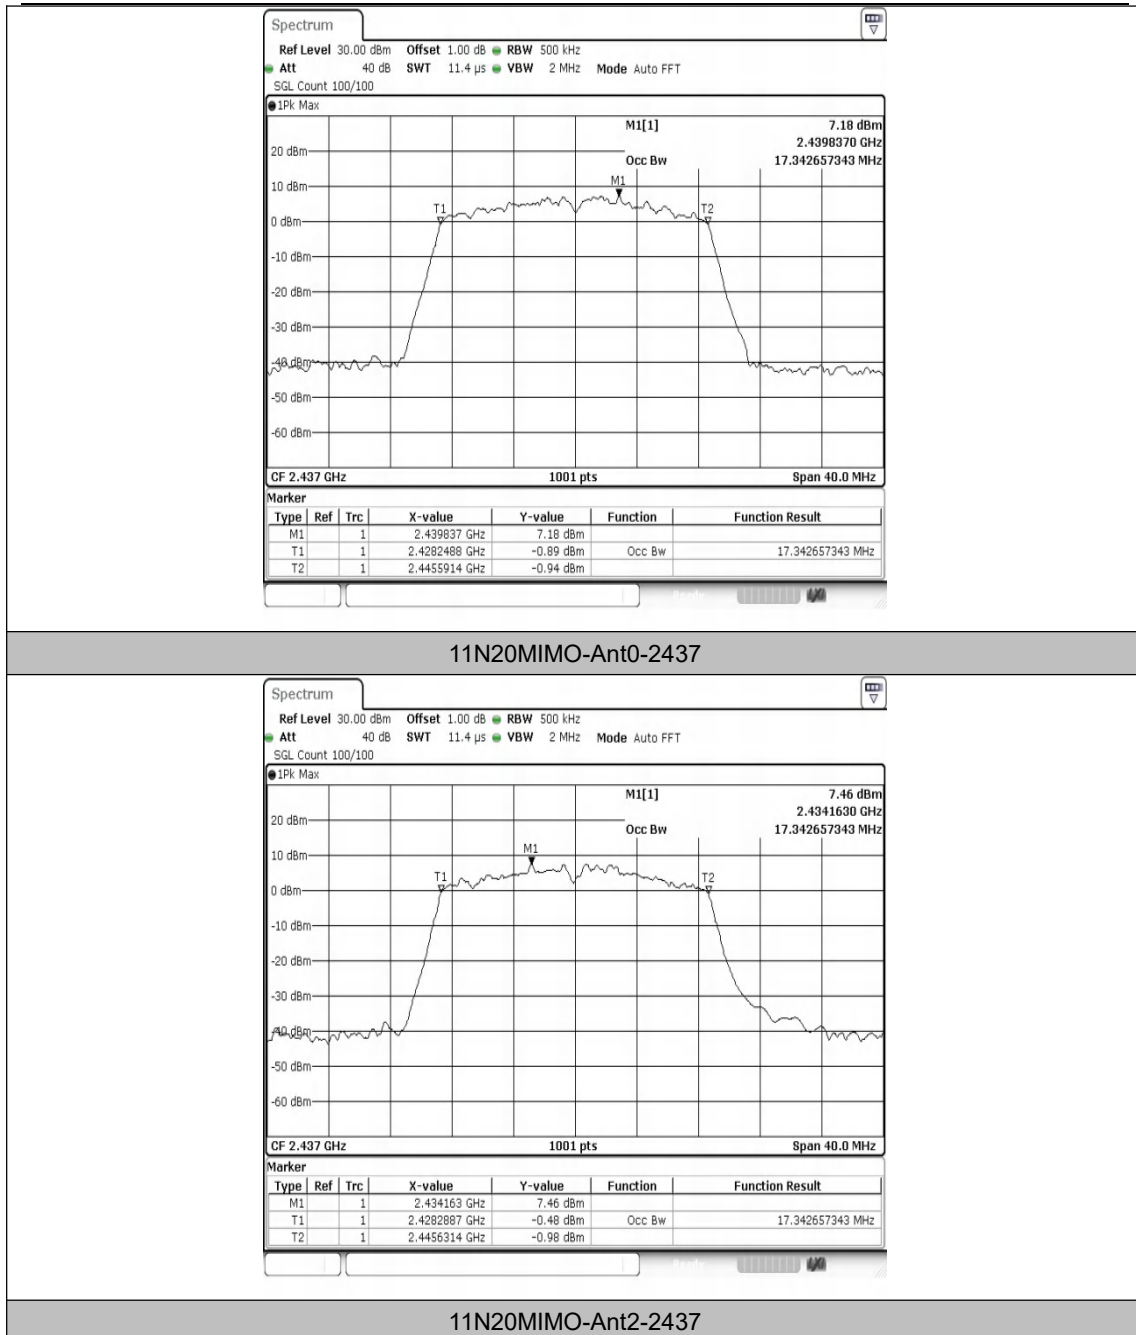


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

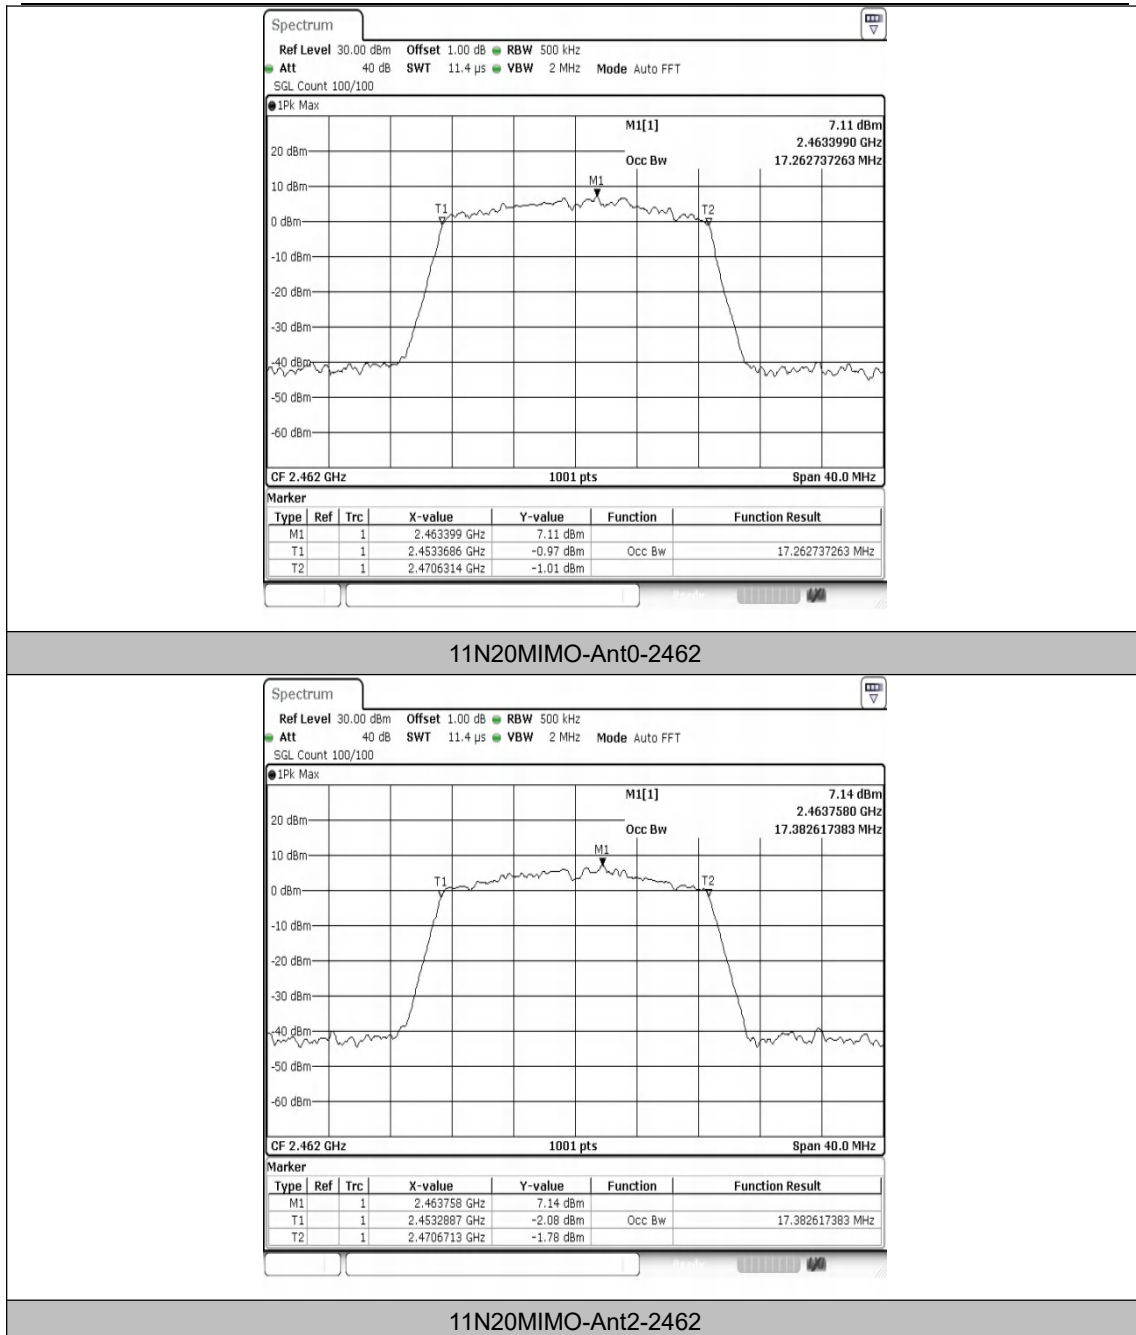


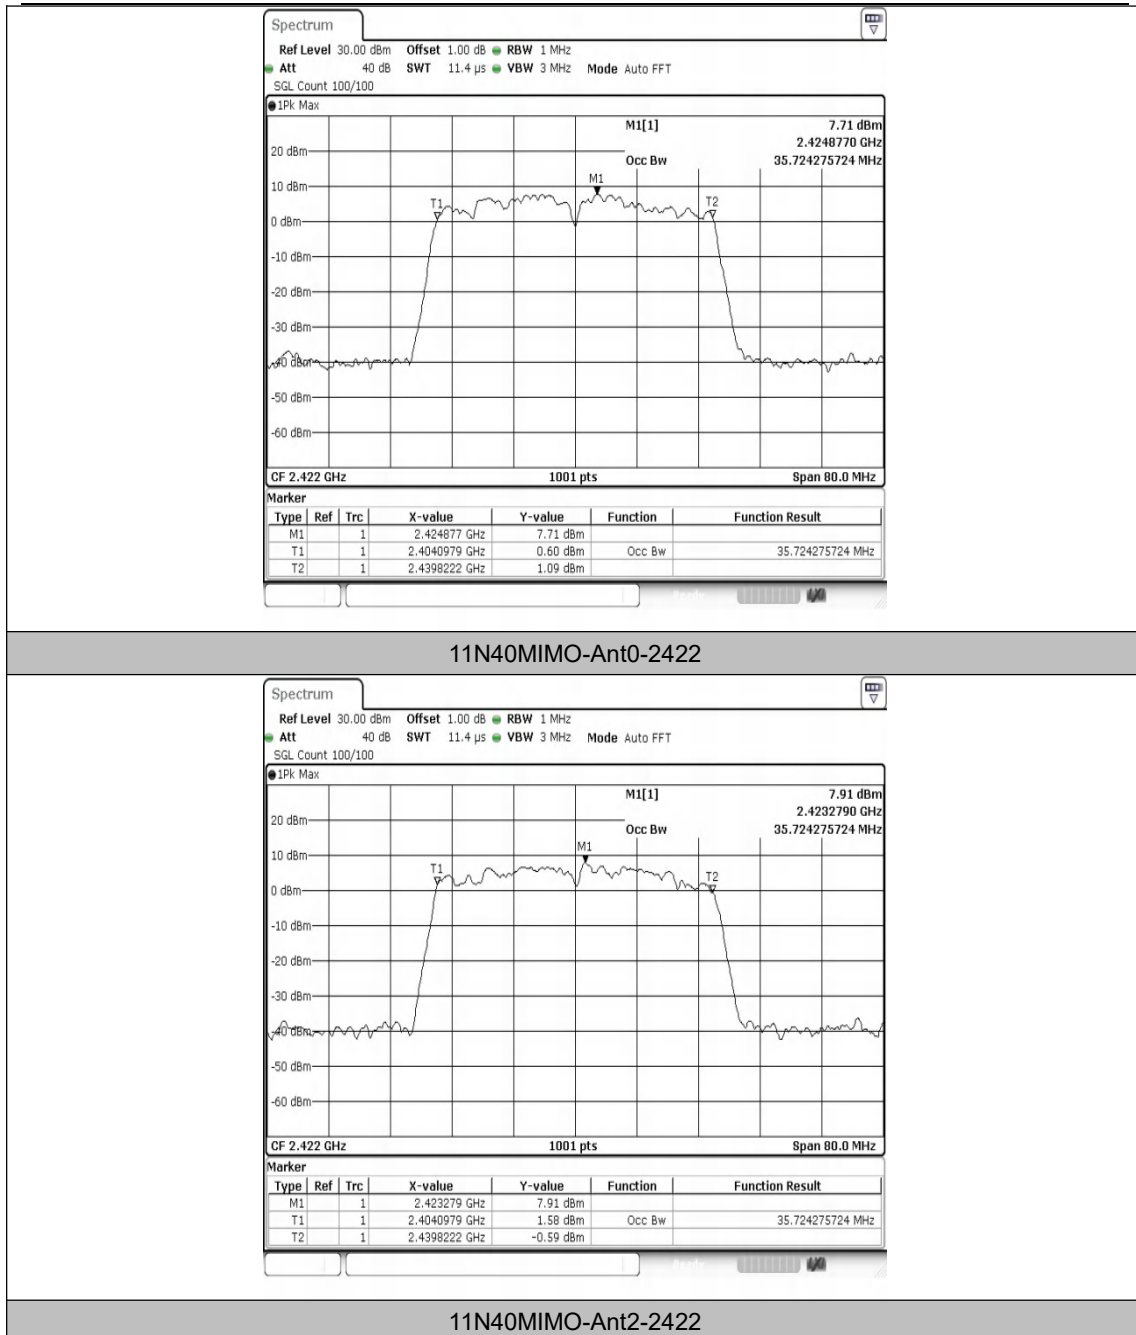

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

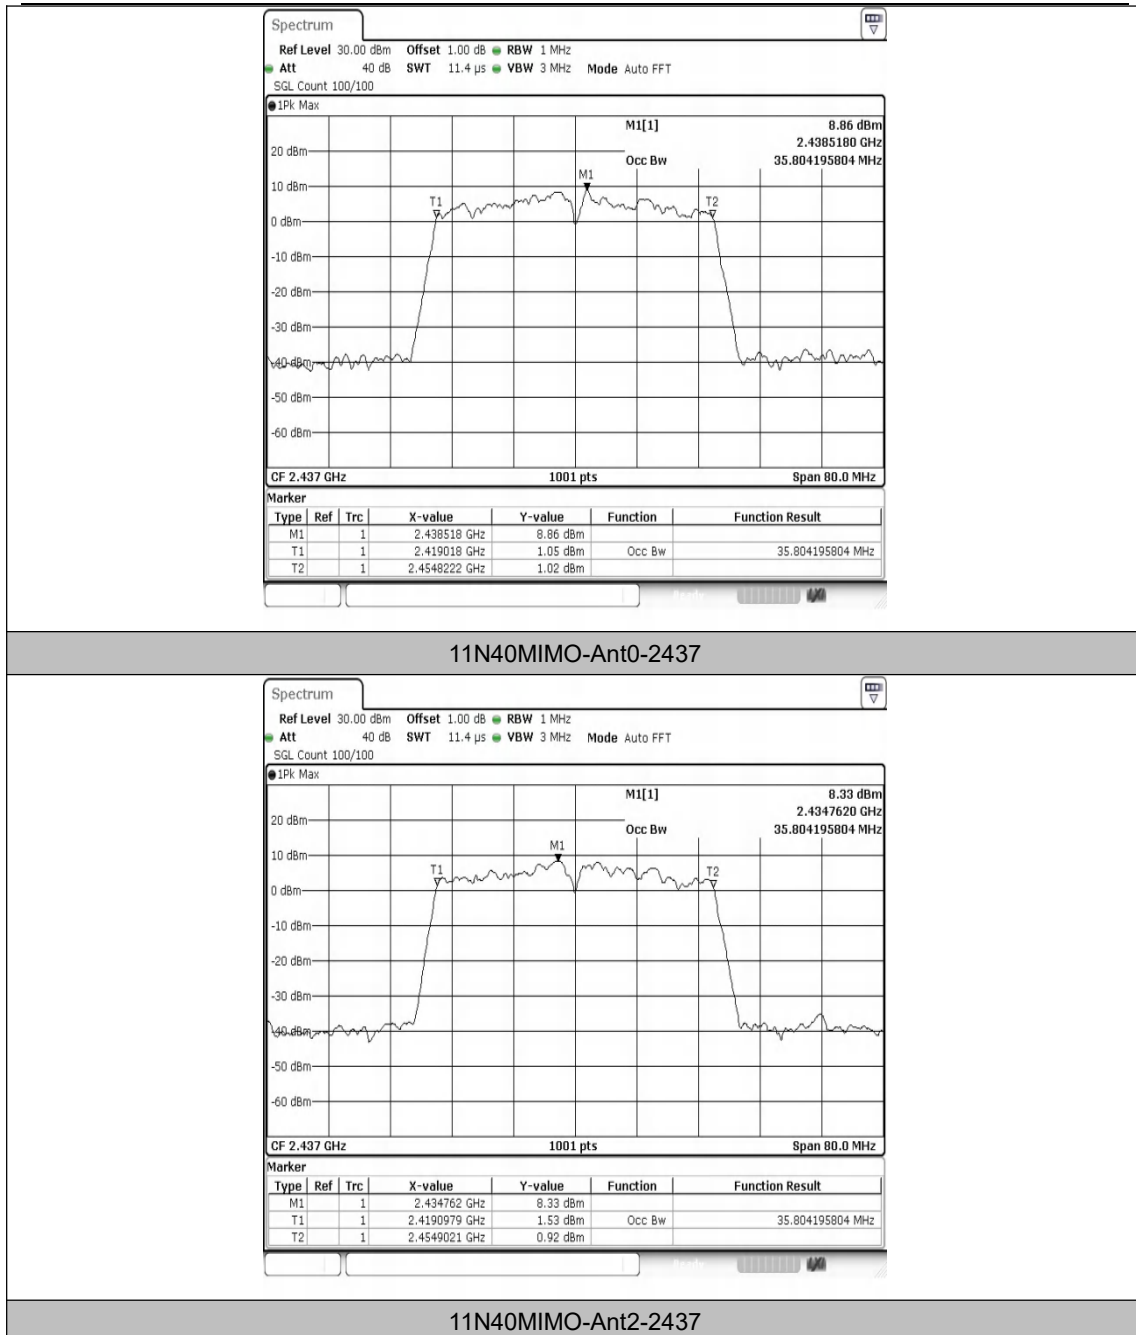



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

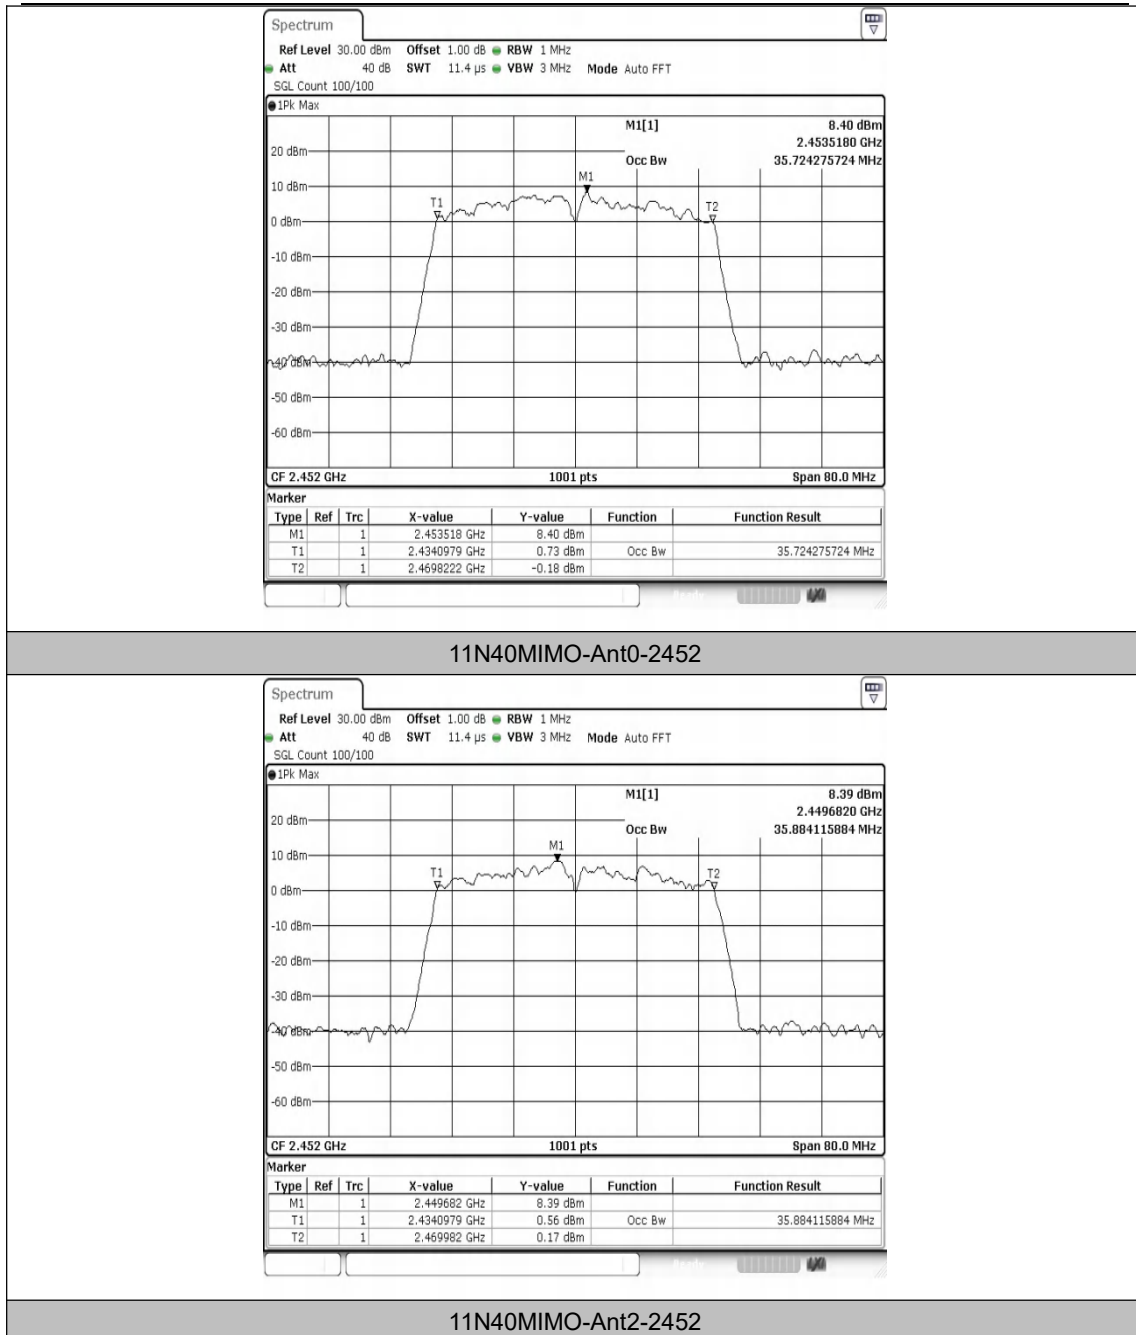


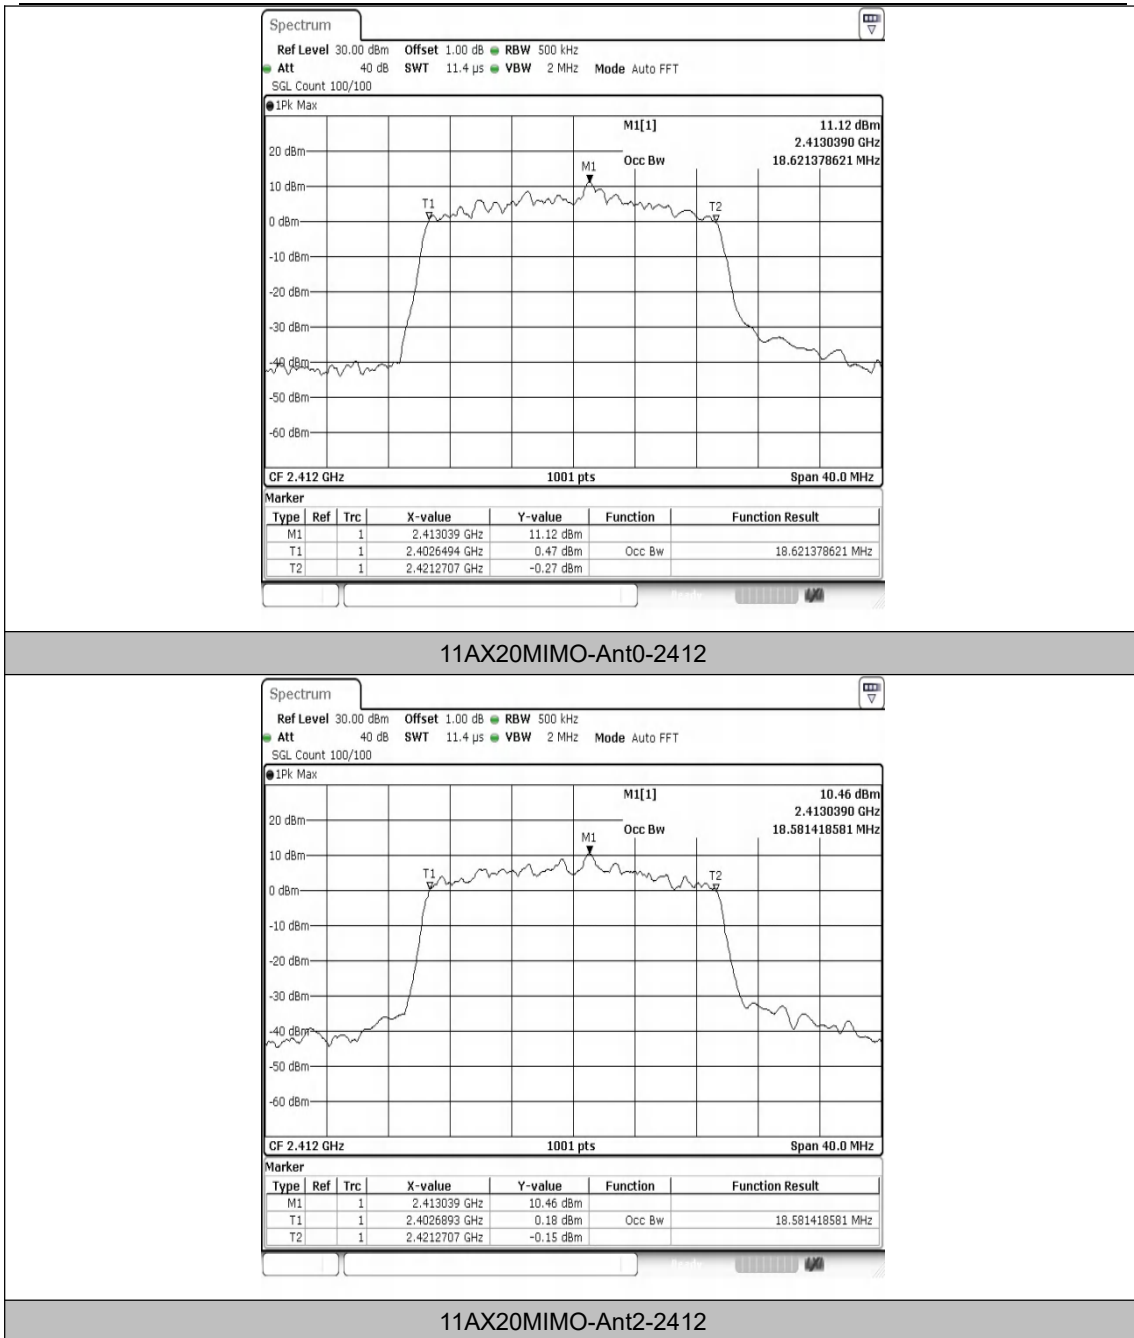

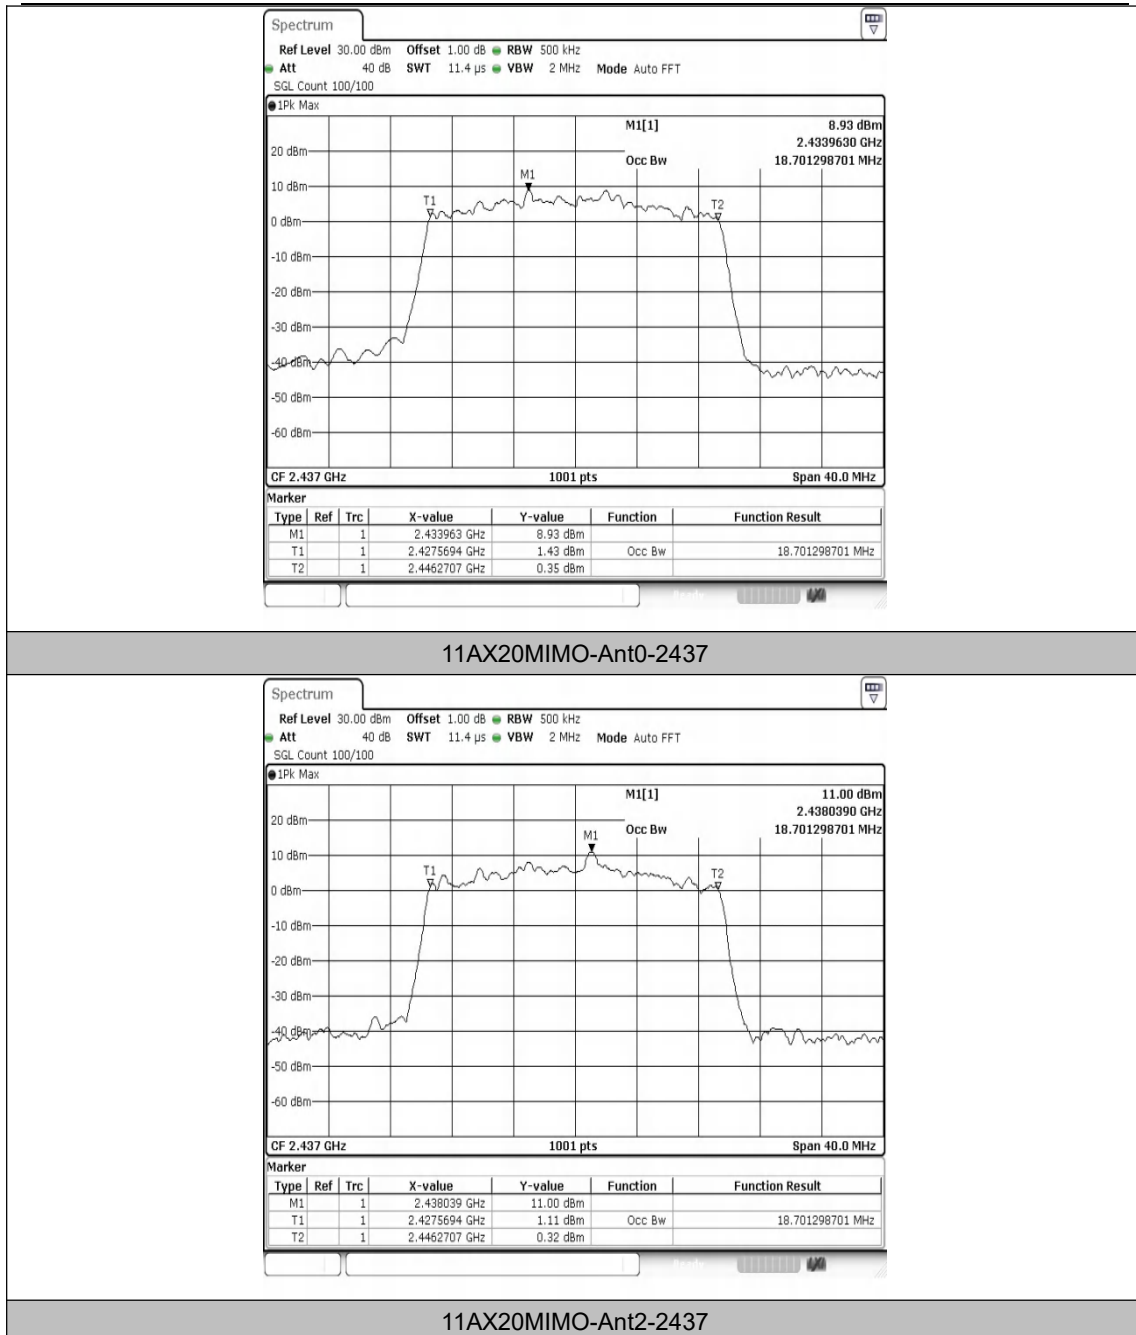

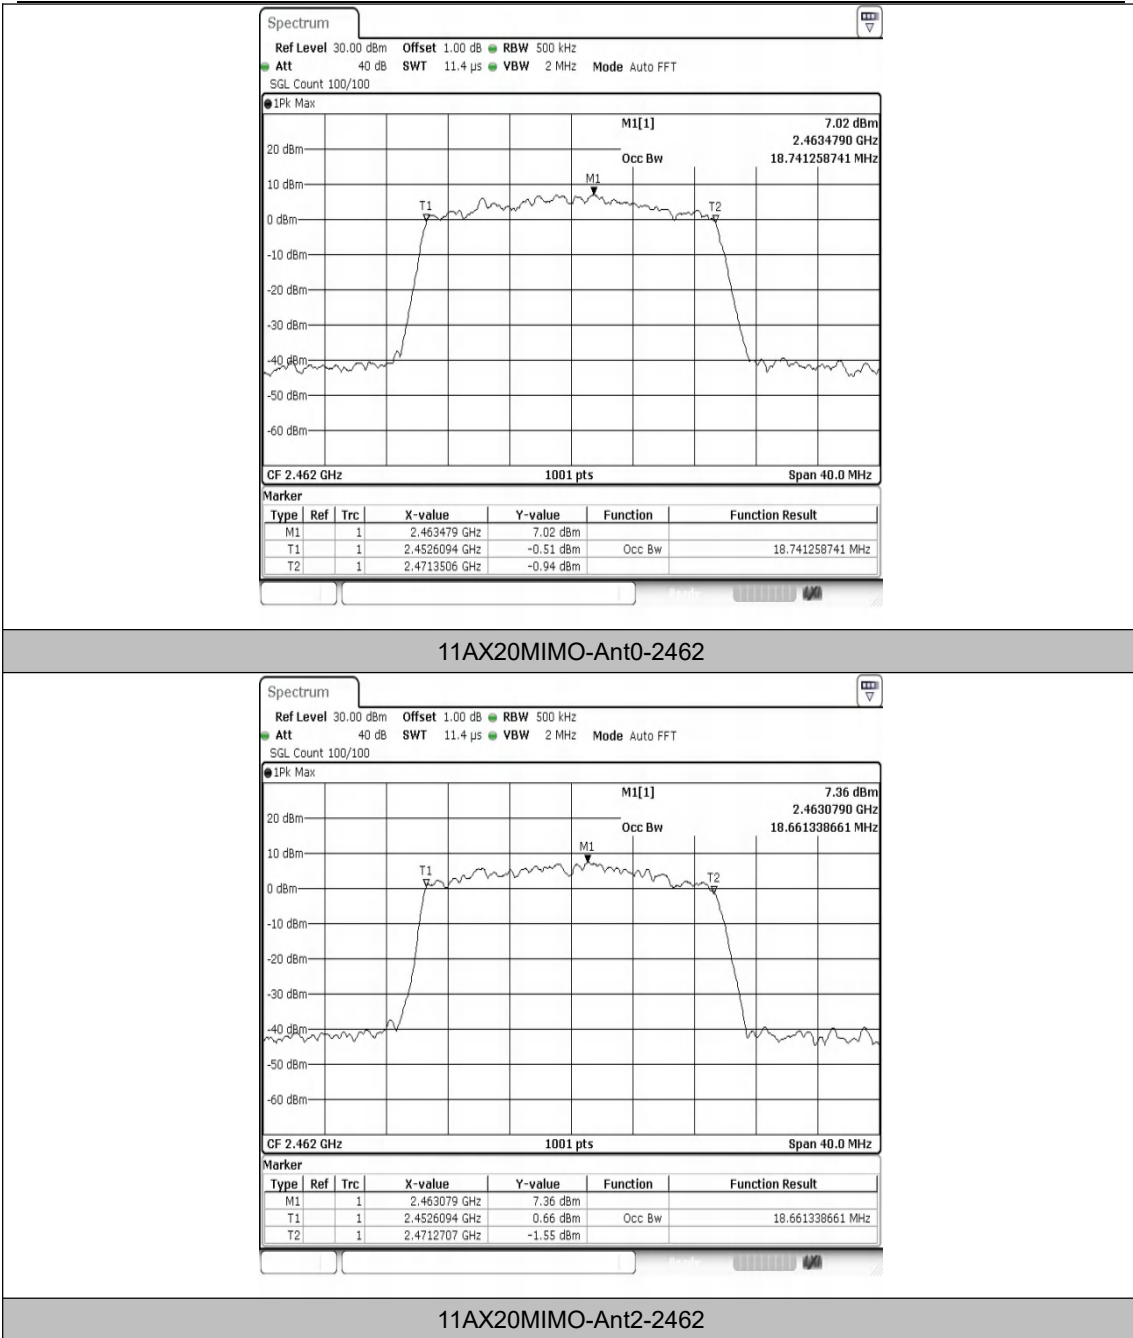

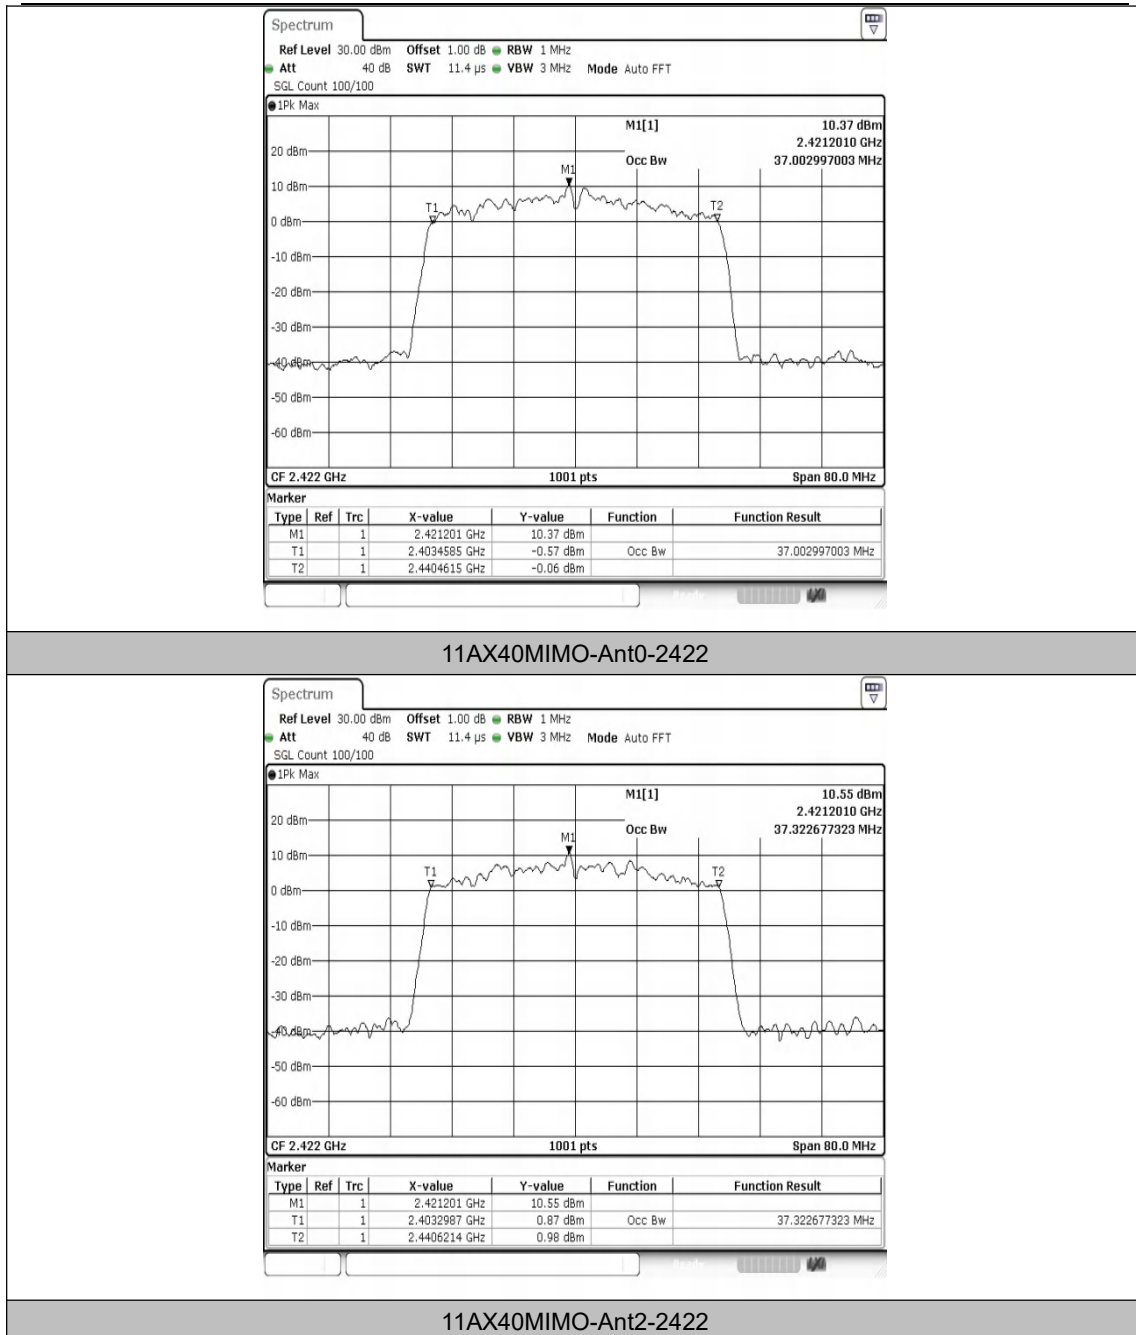


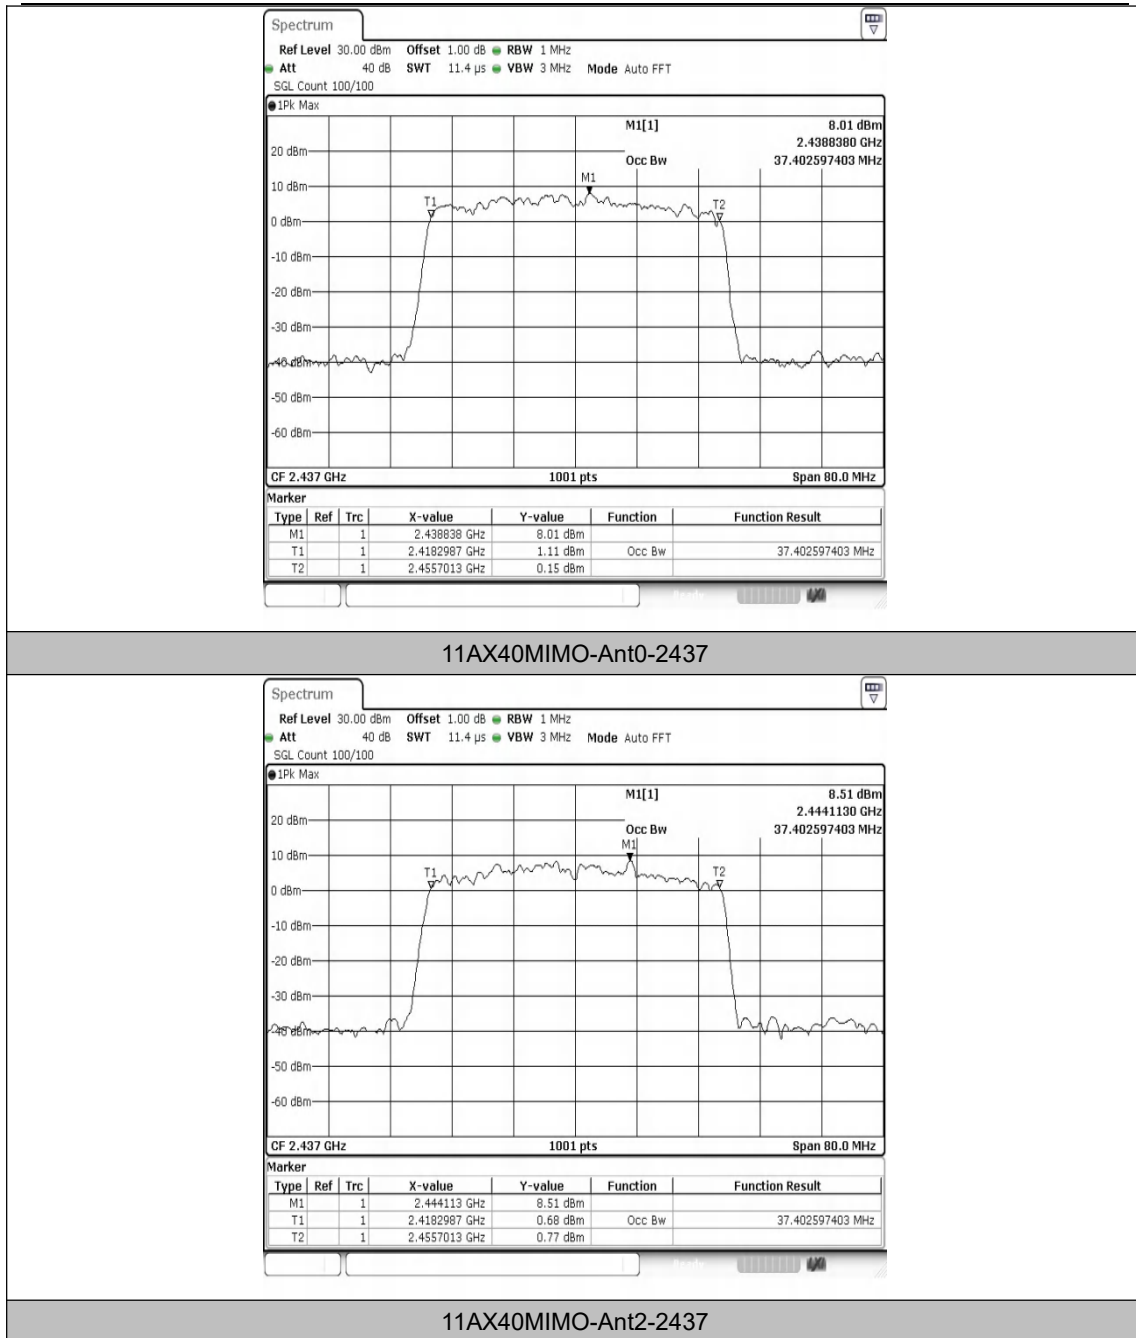

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

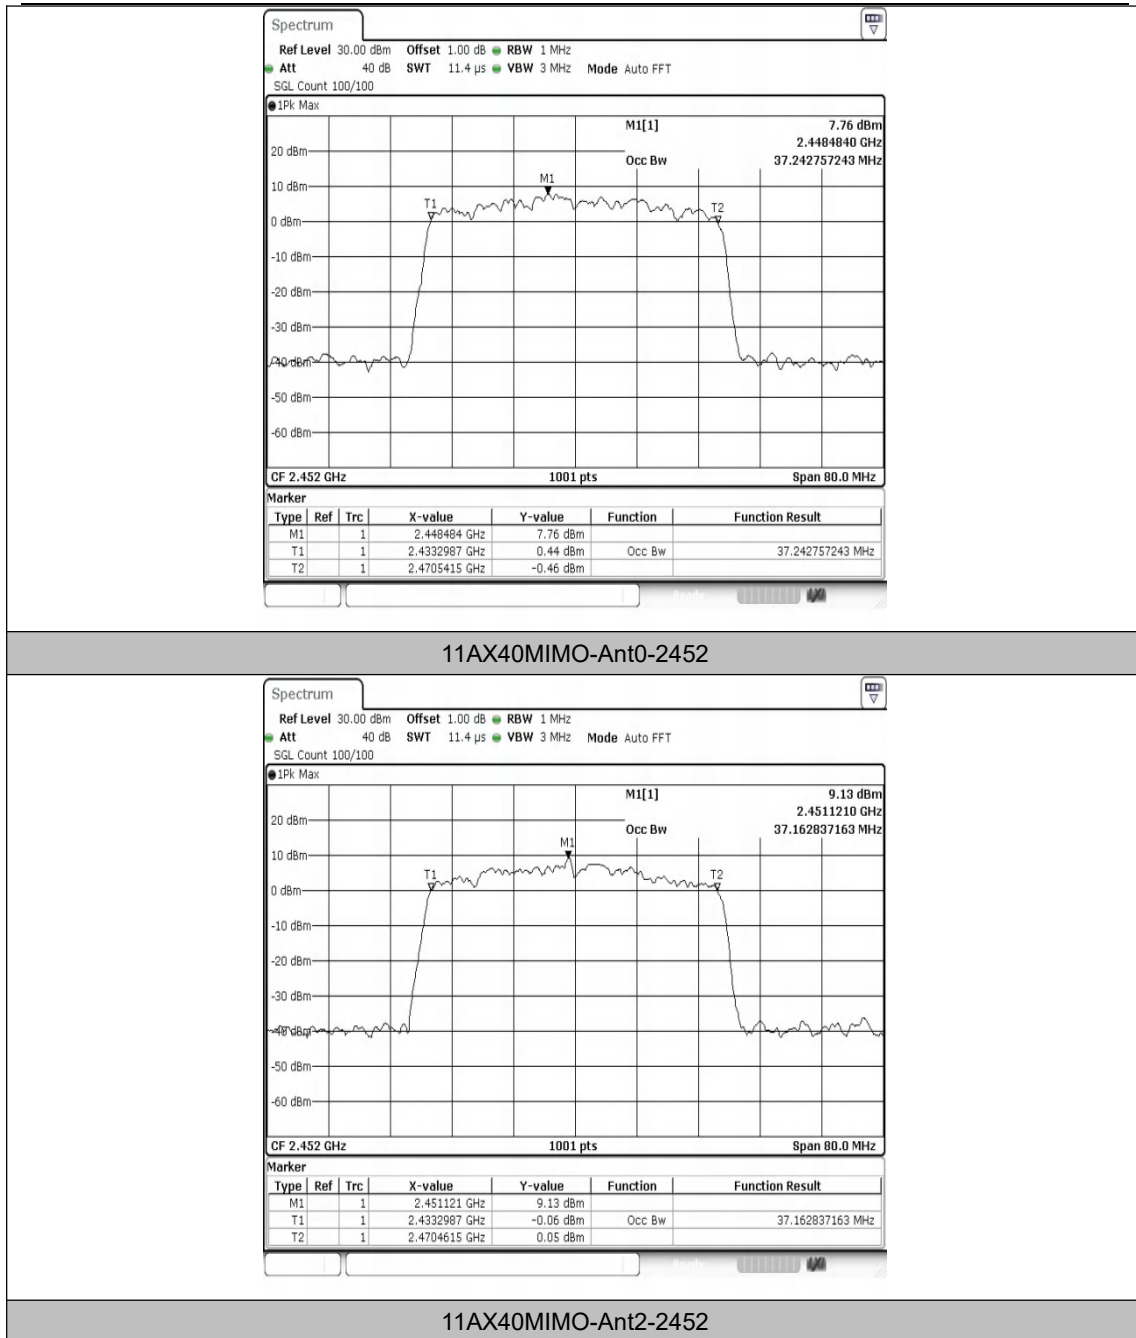

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

## Appendix C: Maximum conducted output power

### Test Result Average

| Test Mode  | Antenna | Frequency [MHz] | Average power [dBm] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|-----------------|---------------------|--------------|-------------|---------|
| 11B        | Ant0    | 2412            | 14.60               | 14.60        | ≤30.00      | PASS    |
| 11B        | Ant2    | 2412            | 14.50               | 14.50        | ≤30.00      | PASS    |
| 11B        | Ant0    | 2437            | 14.47               | 14.47        | ≤30.00      | PASS    |
| 11B        | Ant2    | 2437            | 14.41               | 14.41        | ≤30.00      | PASS    |
| 11B        | Ant0    | 2462            | 13.74               | 13.74        | ≤30.00      | PASS    |
| 11B        | Ant2    | 2462            | 13.72               | 13.72        | ≤30.00      | PASS    |
| 11G        | Ant0    | 2412            | 14.14               | 14.14        | ≤30.00      | PASS    |
| 11G        | Ant2    | 2412            | 14.05               | 14.05        | ≤30.00      | PASS    |
| 11G        | Ant0    | 2437            | 14.18               | 14.18        | ≤30.00      | PASS    |
| 11G        | Ant2    | 2437            | 14.16               | 14.16        | ≤30.00      | PASS    |
| 11G        | Ant0    | 2462            | 13.70               | 13.70        | ≤30.00      | PASS    |
| 11G        | Ant2    | 2462            | 13.64               | 13.64        | ≤30.00      | PASS    |
| 11N20MIMO  | Ant0    | 2412            | 13.92               | 13.92        | ≤30.00      | PASS    |
| 11N20MIMO  | Ant2    | 2412            | 13.91               | 13.91        | ≤30.00      | PASS    |
| 11N20MIMO  | total   | 2412            | ---                 | 16.93        | ≤30.00      | PASS    |
| 11N20MIMO  | Ant0    | 2437            | 13.96               | 13.96        | ≤30.00      | PASS    |
| 11N20MIMO  | Ant2    | 2437            | 13.96               | 13.96        | ≤30.00      | PASS    |
| 11N20MIMO  | total   | 2437            | ---                 | <b>16.97</b> | ≤30.00      | PASS    |
| 11N20MIMO  | Ant0    | 2462            | 13.44               | 13.44        | ≤30.00      | PASS    |
| 11N20MIMO  | Ant2    | 2462            | 13.44               | 13.44        | ≤30.00      | PASS    |
| 11N20MIMO  | total   | 2462            | ---                 | 16.45        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant0    | 2422            | 13.73               | 13.73        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant2    | 2422            | 13.72               | 13.72        | ≤30.00      | PASS    |
| 11N40MIMO  | total   | 2422            | ---                 | 16.74        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant0    | 2437            | 13.85               | 13.85        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant2    | 2437            | 13.85               | 13.85        | ≤30.00      | PASS    |
| 11N40MIMO  | total   | 2437            | ---                 | 16.86        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant0    | 2452            | 13.43               | 13.43        | ≤30.00      | PASS    |
| 11N40MIMO  | Ant2    | 2452            | 13.40               | 13.40        | ≤30.00      | PASS    |
| 11N40MIMO  | total   | 2452            | ---                 | 16.43        | ≤30.00      | PASS    |
| 11AX20MIMO | Ant0    | 2412            | 13.81               | 13.81        | ≤30.00      | PASS    |
| 11AX20MIMO | Ant2    | 2412            | 13.77               | 13.77        | ≤30.00      | PASS    |
| 11AX20MIMO | total   | 2412            | ---                 | 16.80        | ≤30.00      | PASS    |
| 11AX20MIMO | Ant0    | 2437            | 13.83               | 13.83        | ≤30.00      | PASS    |
| 11AX20MIMO | Ant2    | 2437            | 13.82               | 13.82        | ≤30.00      | PASS    |
| 11AX20MIMO | total   | 2437            | ---                 | 16.84        | ≤30.00      | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|            |       |      |       |       |        |      |
|------------|-------|------|-------|-------|--------|------|
| 11AX20MIMO | Ant0  | 2462 | 13.33 | 13.33 | ≤30.00 | PASS |
| 11AX20MIMO | Ant2  | 2462 | 13.34 | 13.34 | ≤30.00 | PASS |
| 11AX20MIMO | total | 2462 | ---   | 16.35 | ≤30.00 | PASS |
| 11AX40MIMO | Ant0  | 2422 | 13.69 | 13.69 | ≤30.00 | PASS |
| 11AX40MIMO | Ant2  | 2422 | 13.69 | 13.69 | ≤30.00 | PASS |
| 11AX40MIMO | total | 2422 | ---   | 16.70 | ≤30.00 | PASS |
| 11AX40MIMO | Ant0  | 2437 | 13.84 | 13.84 | ≤30.00 | PASS |
| 11AX40MIMO | Ant2  | 2437 | 13.84 | 13.84 | ≤30.00 | PASS |
| 11AX40MIMO | total | 2437 | ---   | 16.85 | ≤30.00 | PASS |
| 11AX40MIMO | Ant0  | 2452 | 13.40 | 13.40 | ≤30.00 | PASS |
| 11AX40MIMO | Ant2  | 2452 | 13.40 | 13.40 | ≤30.00 | PASS |
| 11AX40MIMO | total | 2452 | ---   | 16.41 | ≤30.00 | PASS |

Note: 1. The cable loss are compensated in the graph


## Test Graphs Average

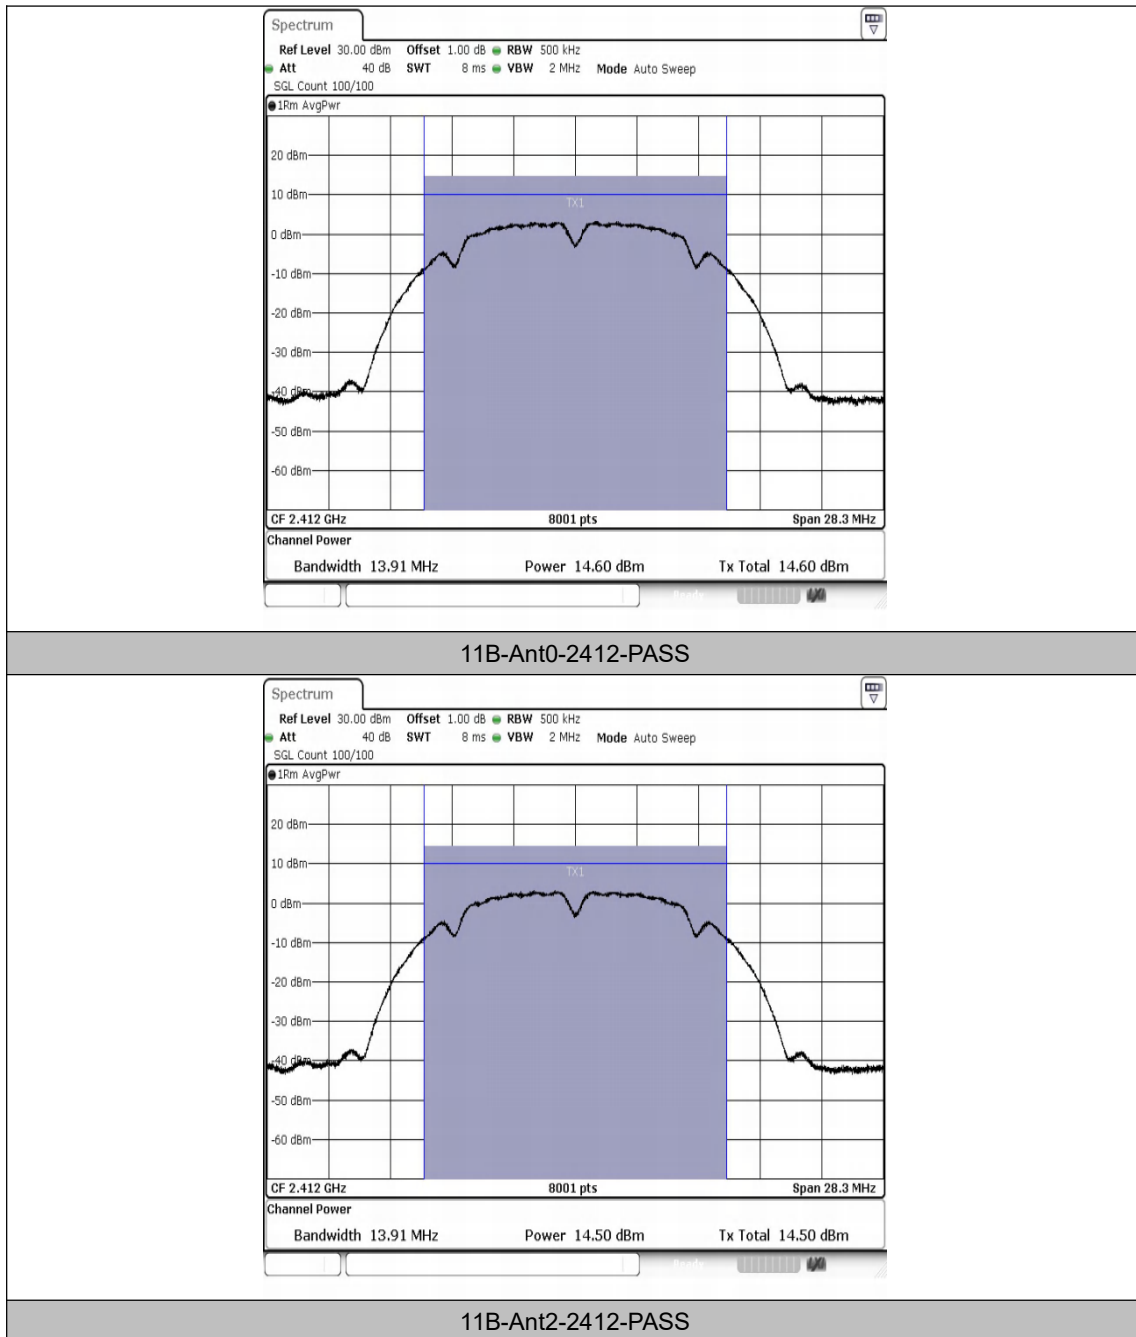

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

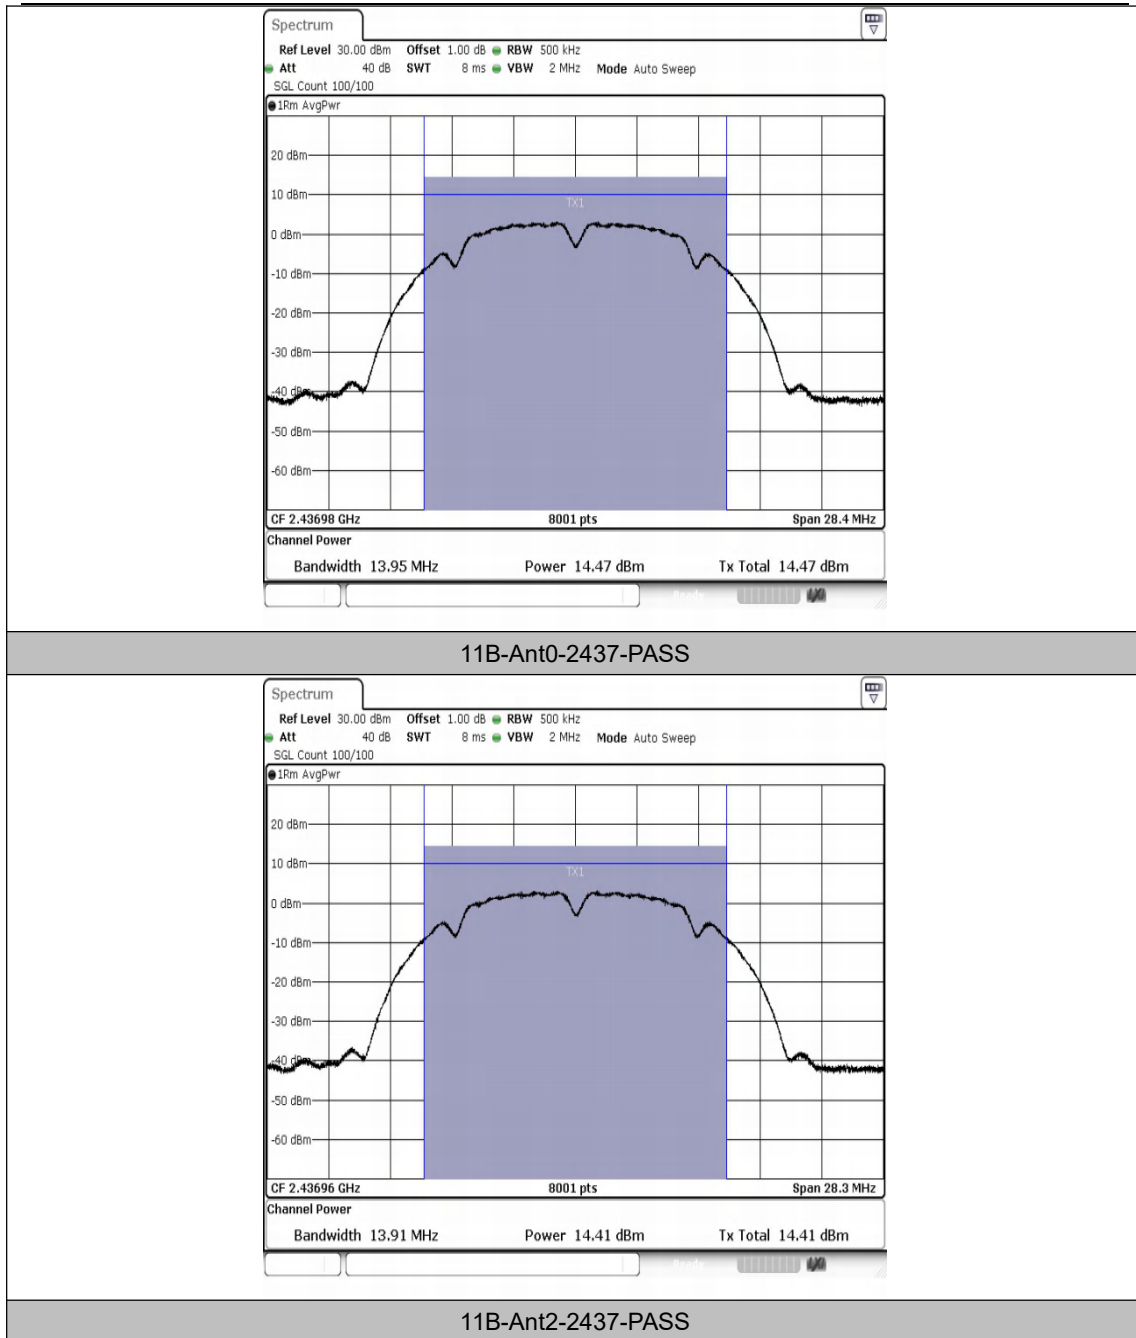

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

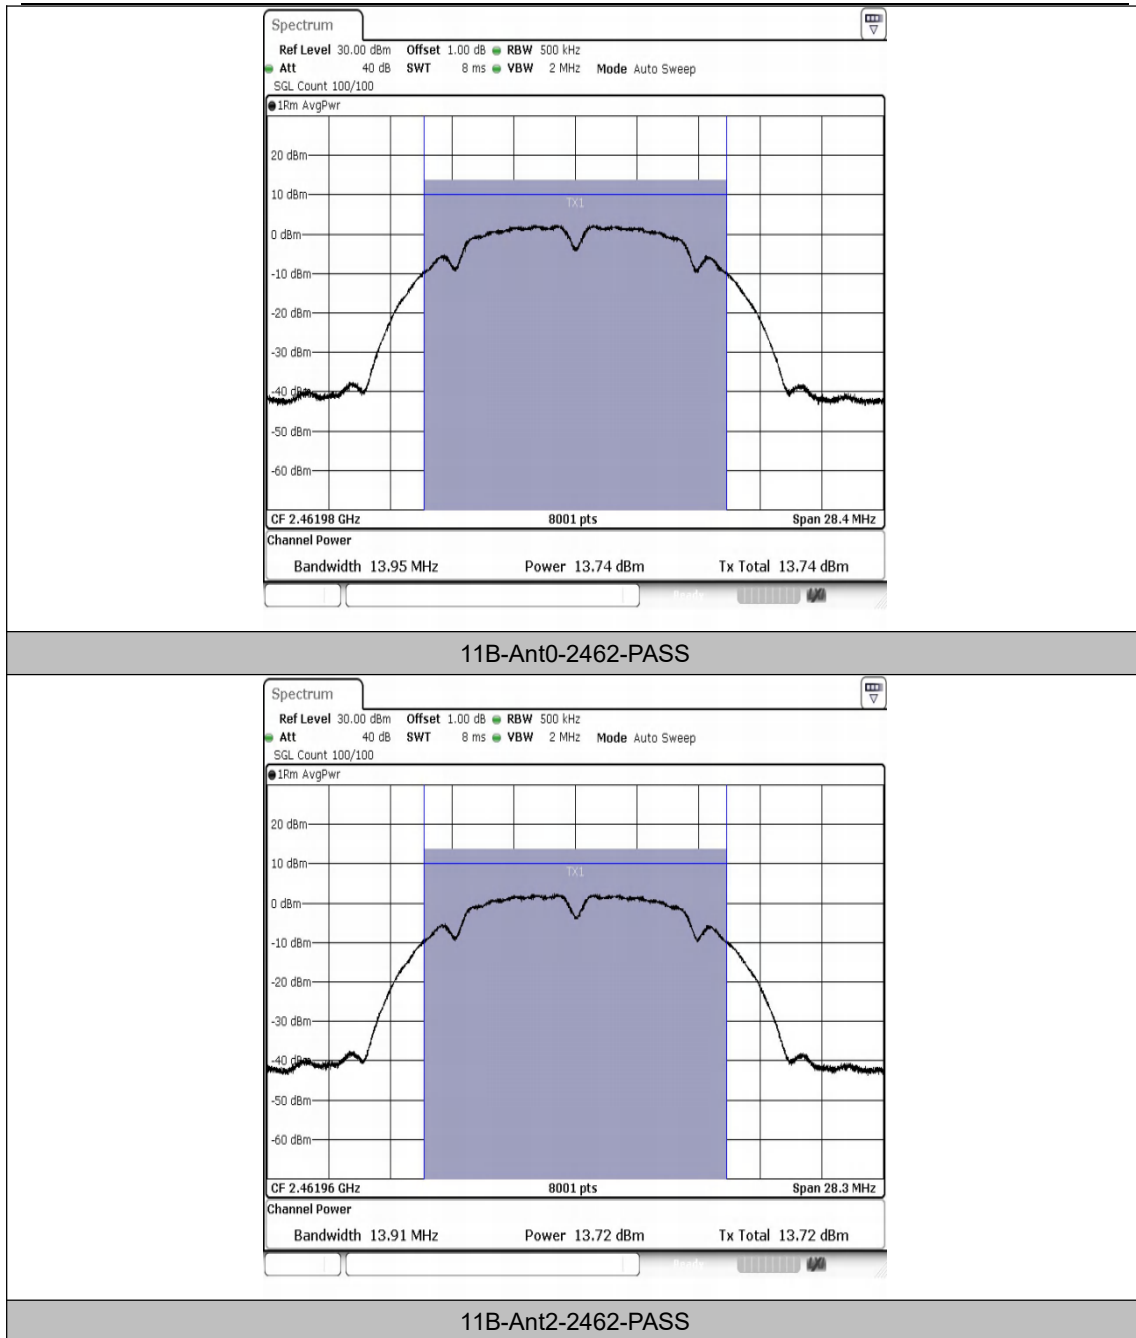

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

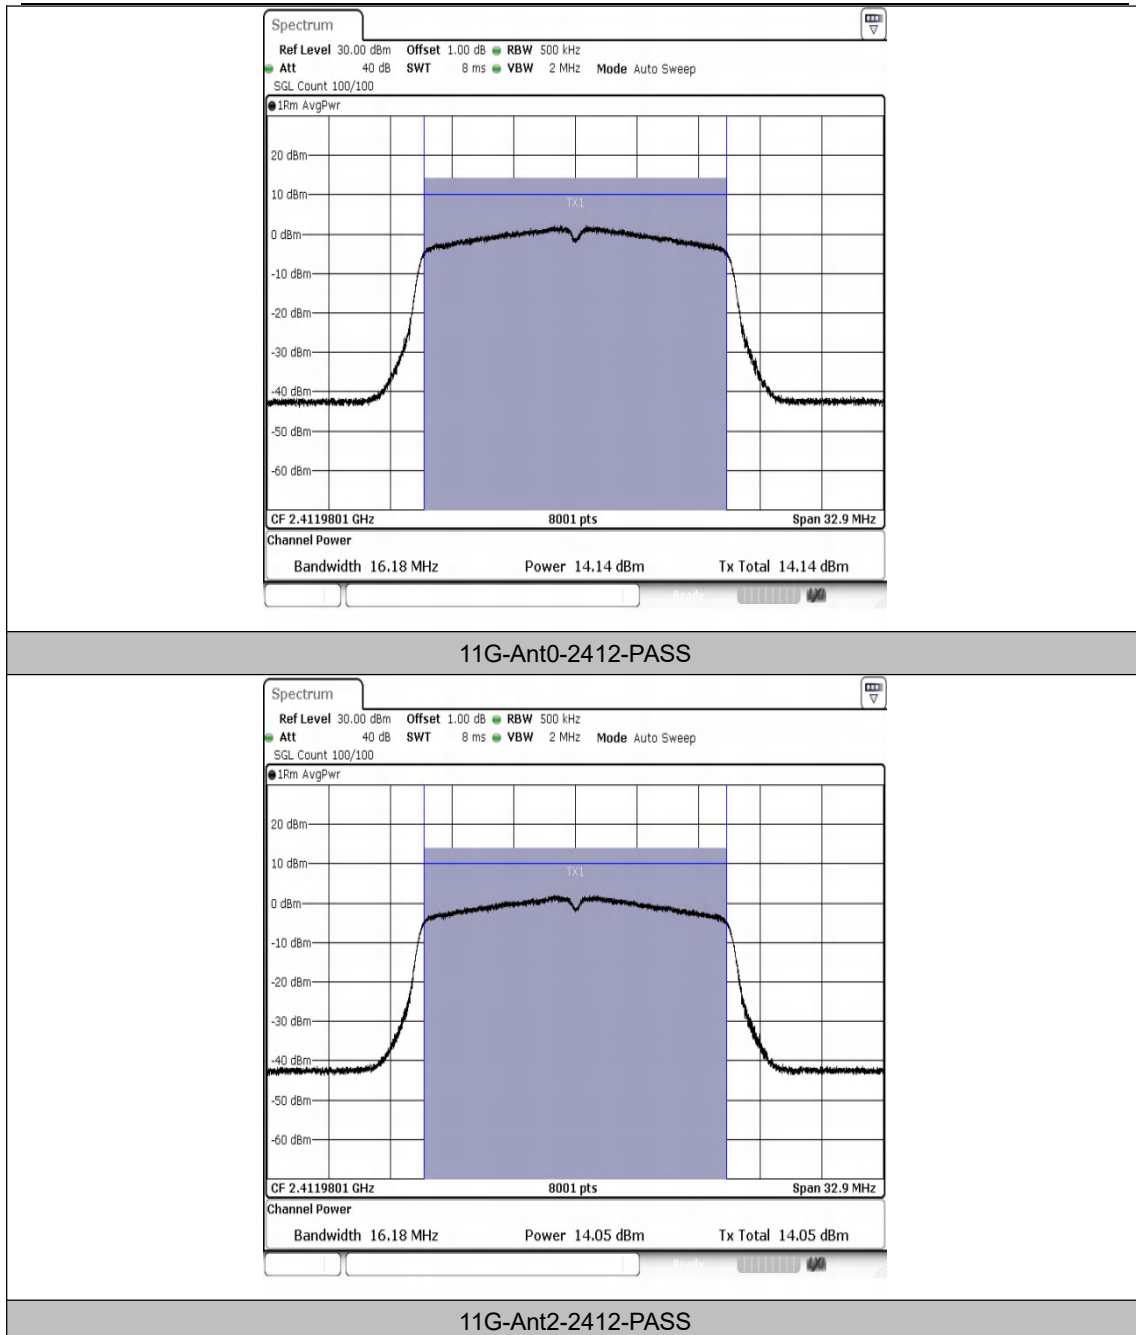

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

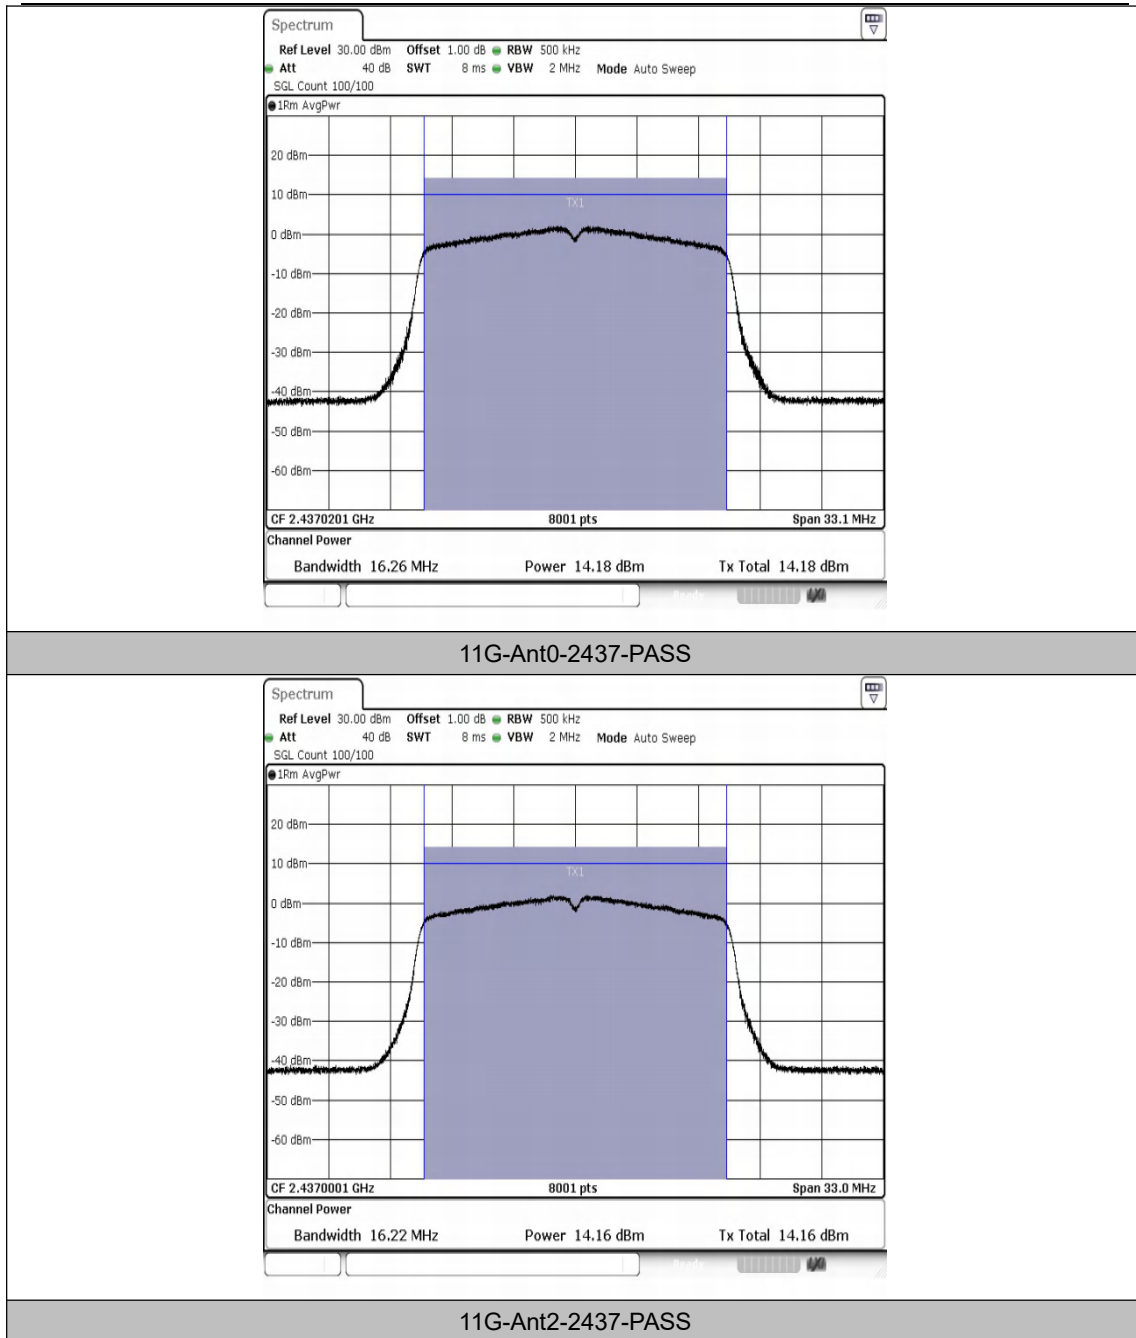

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

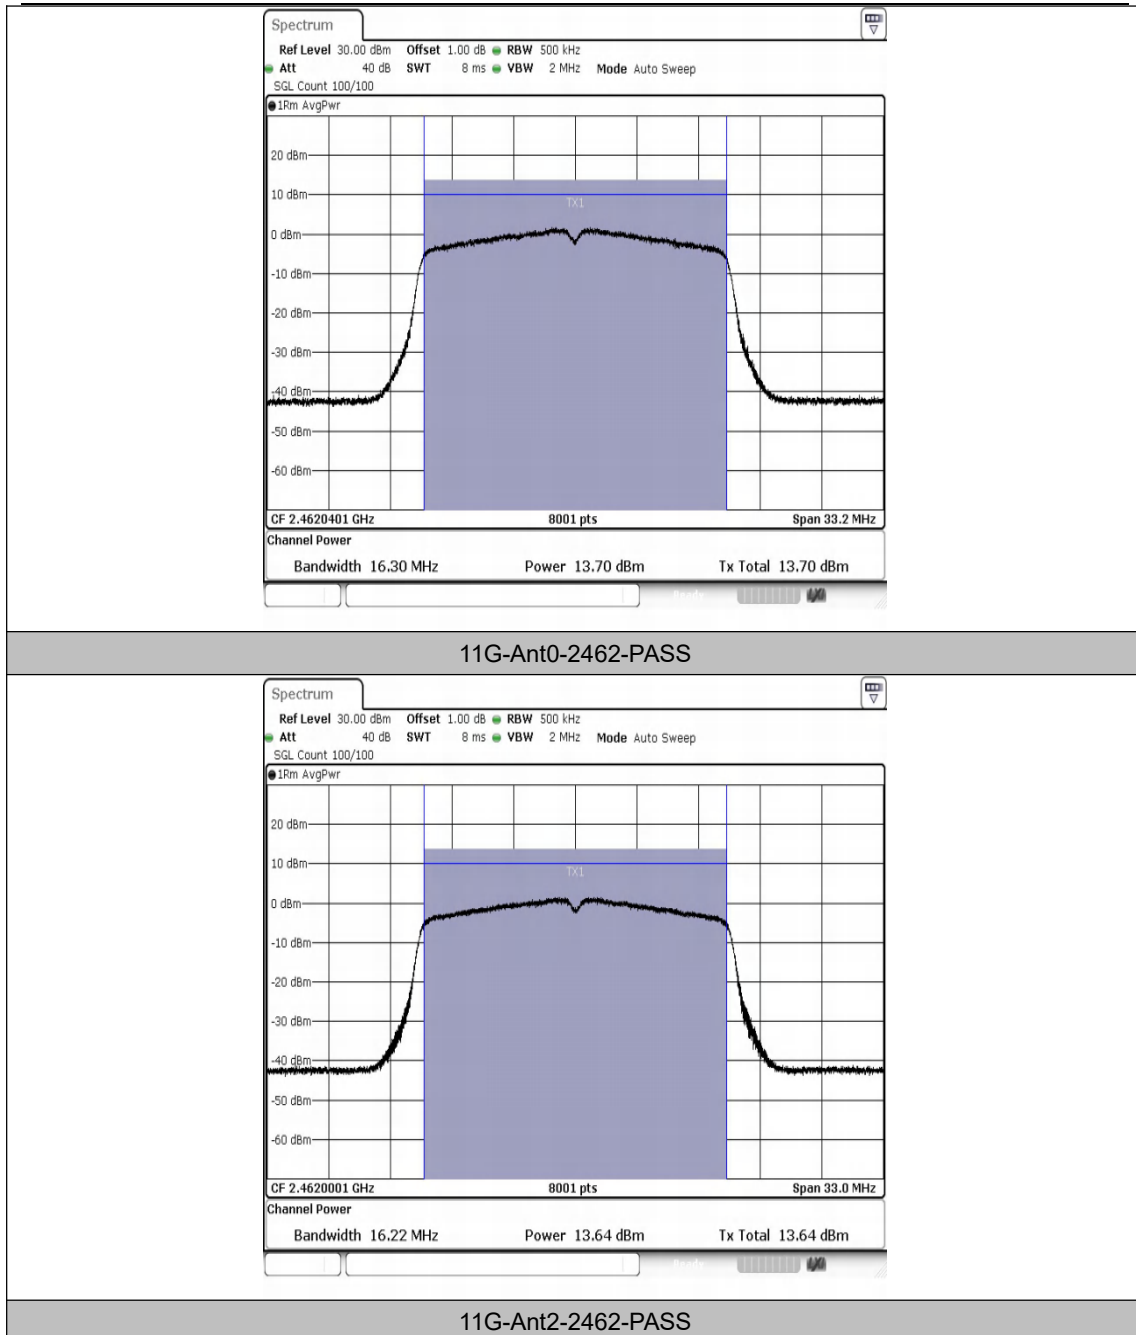

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

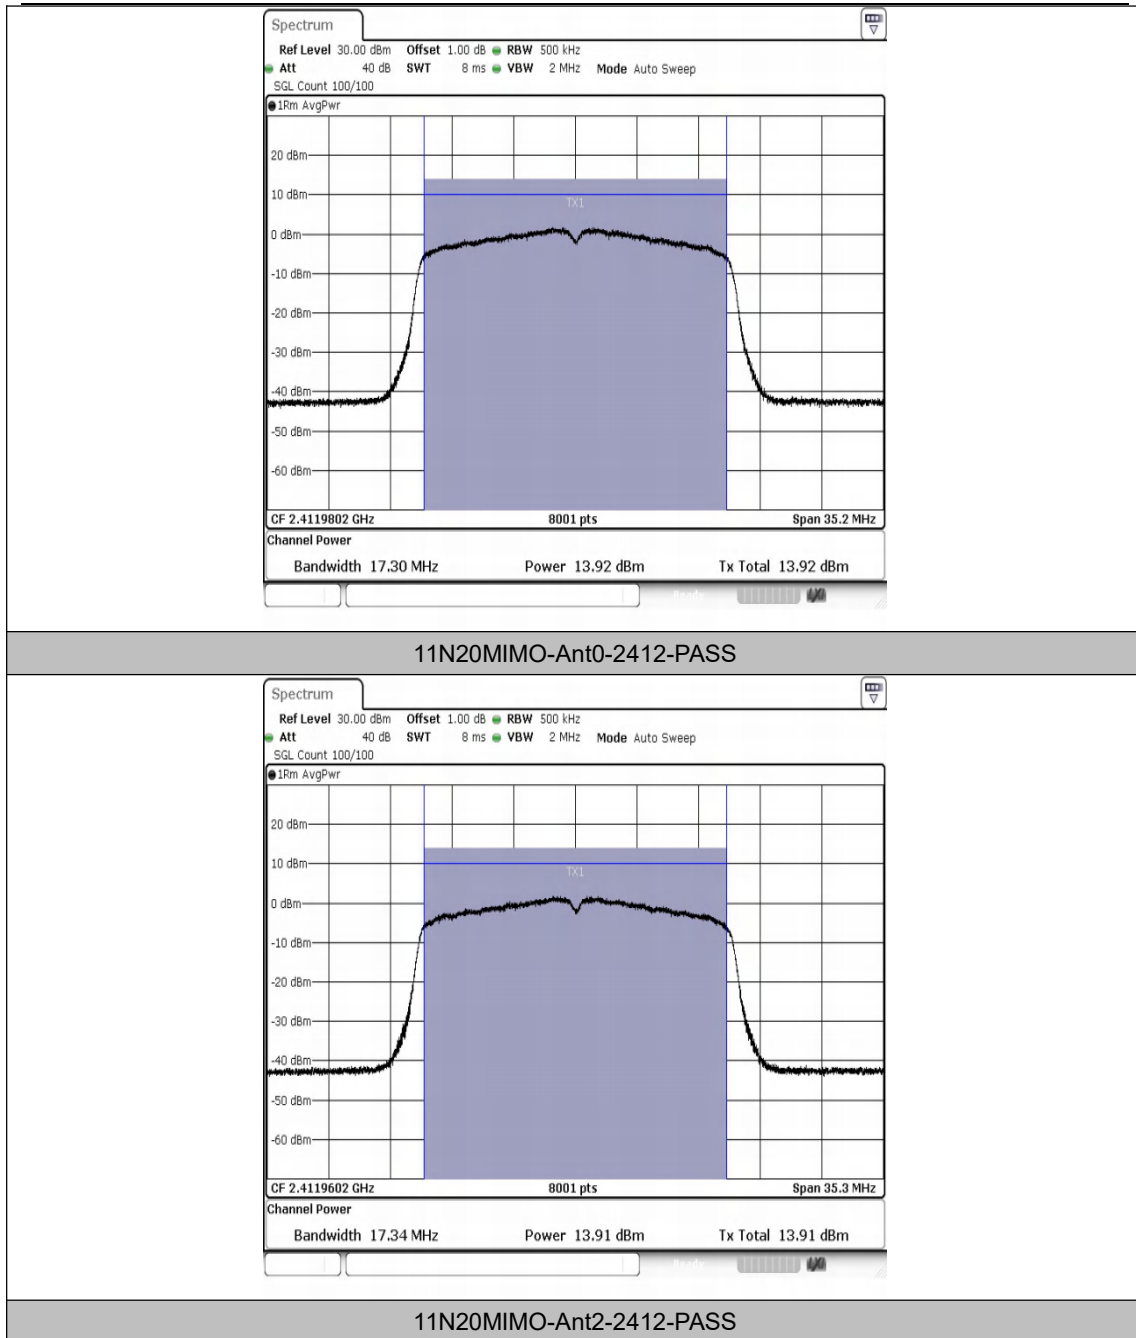

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

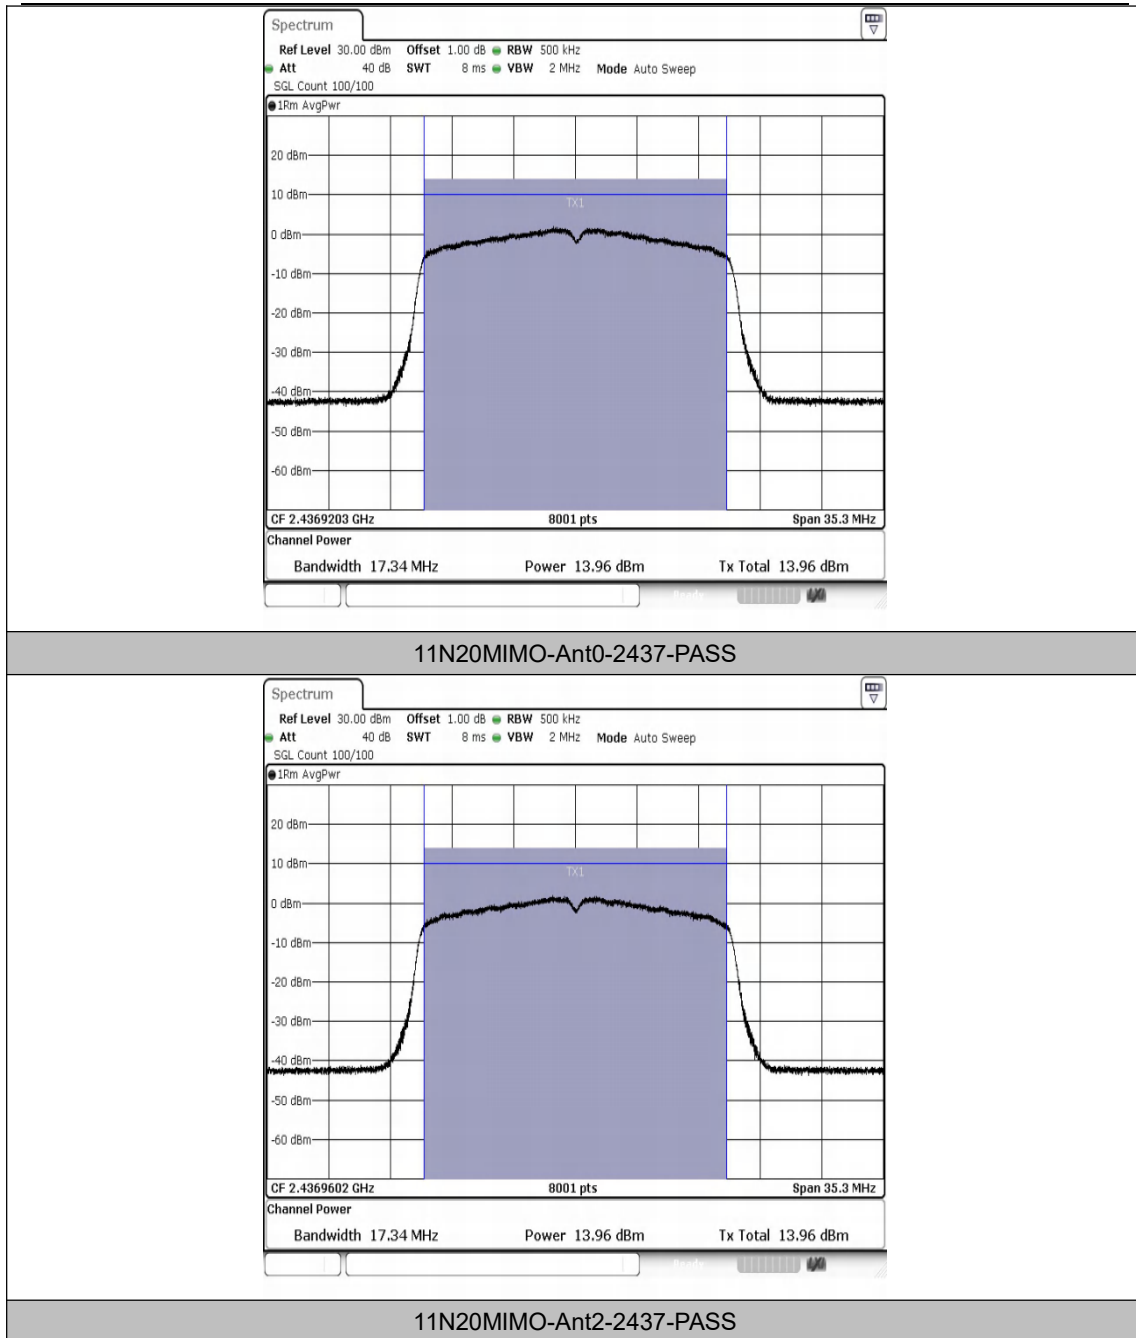

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

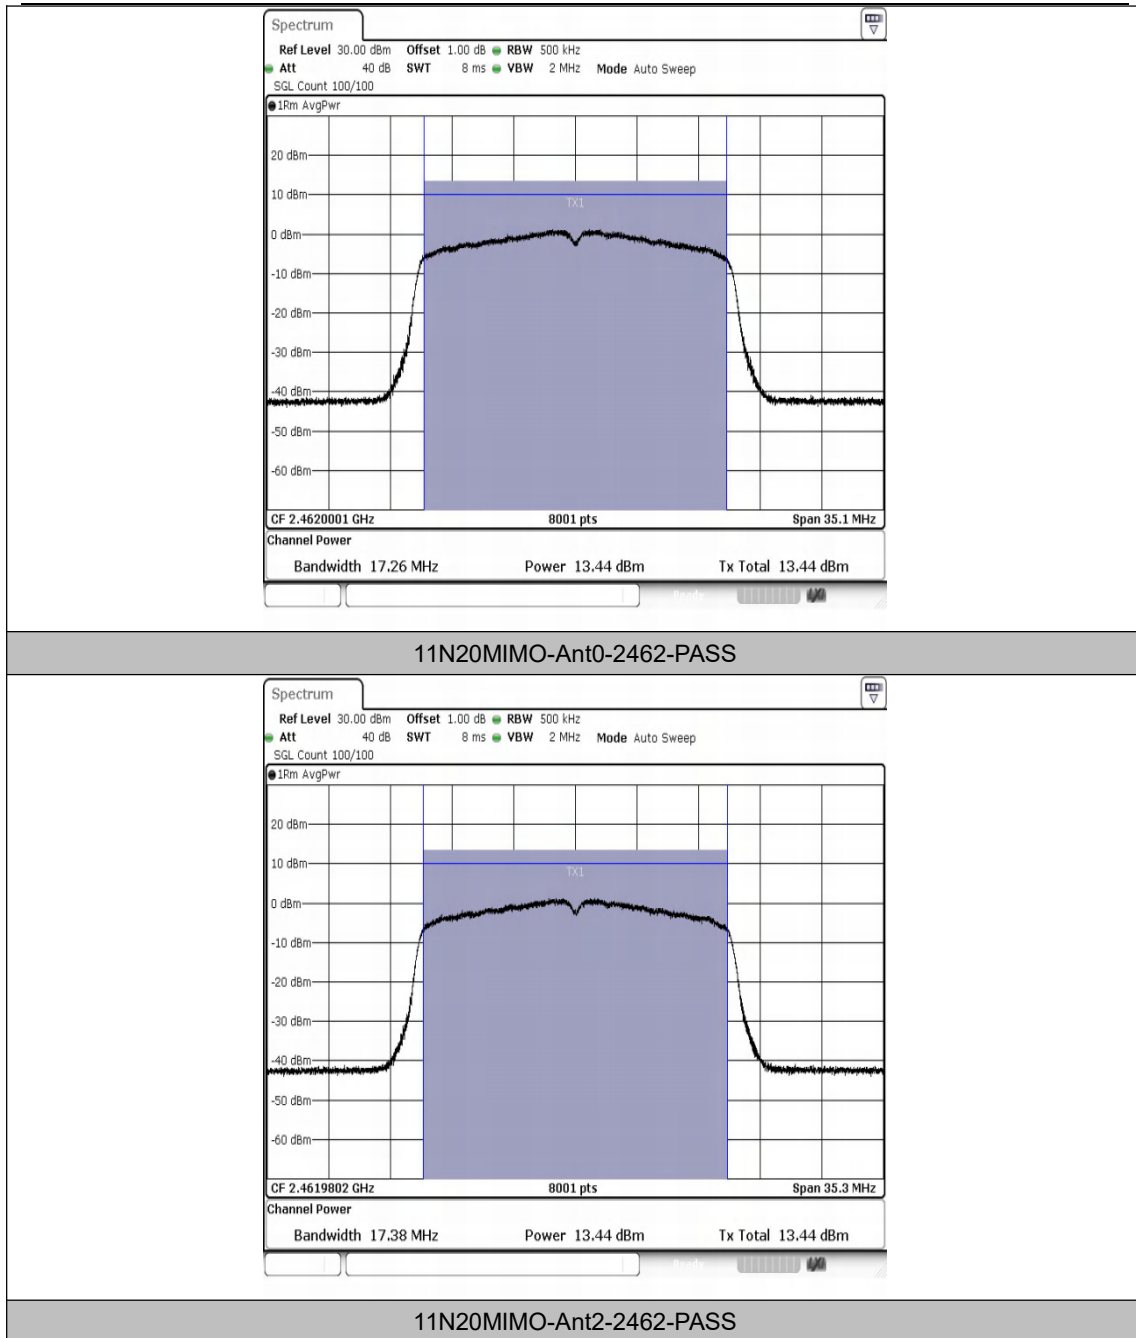

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

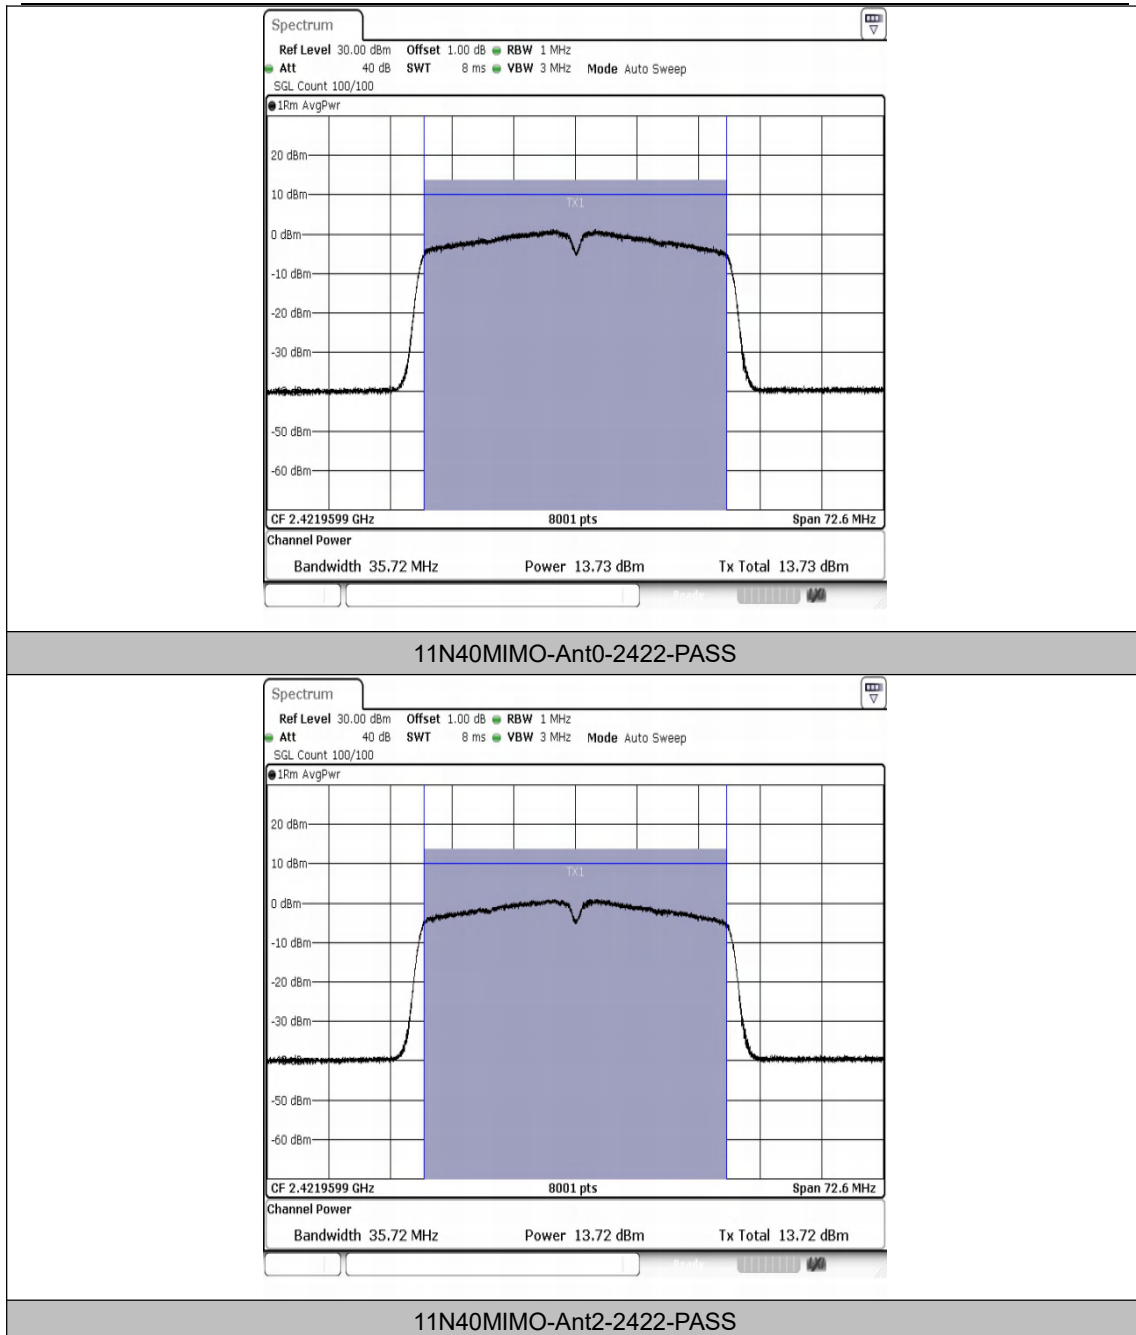

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

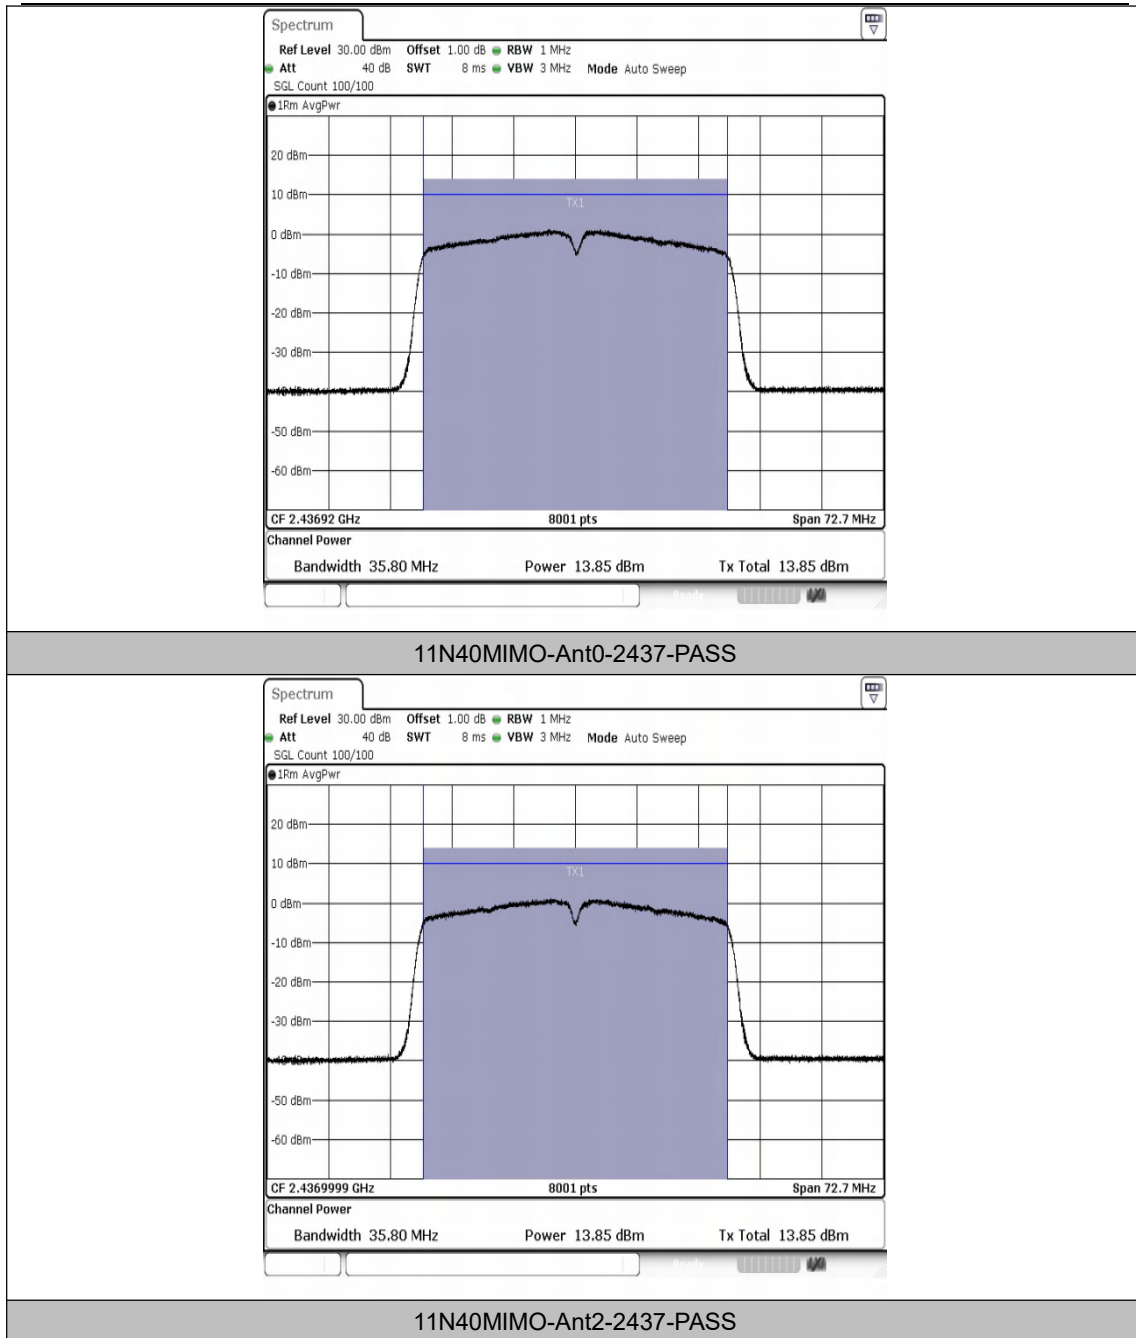

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

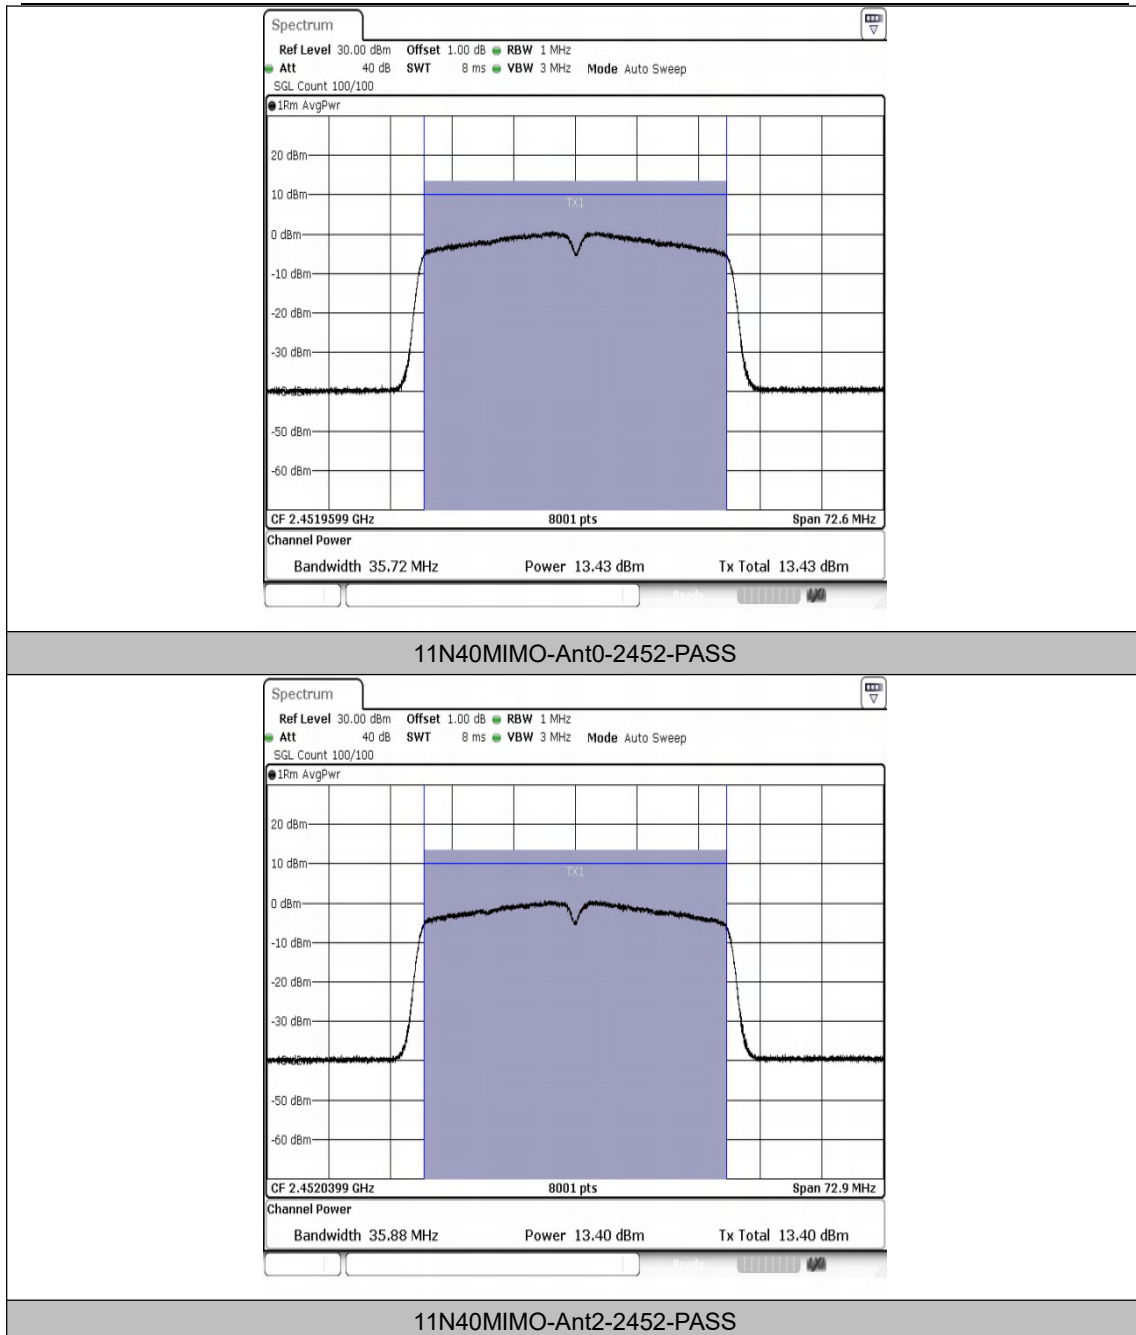


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

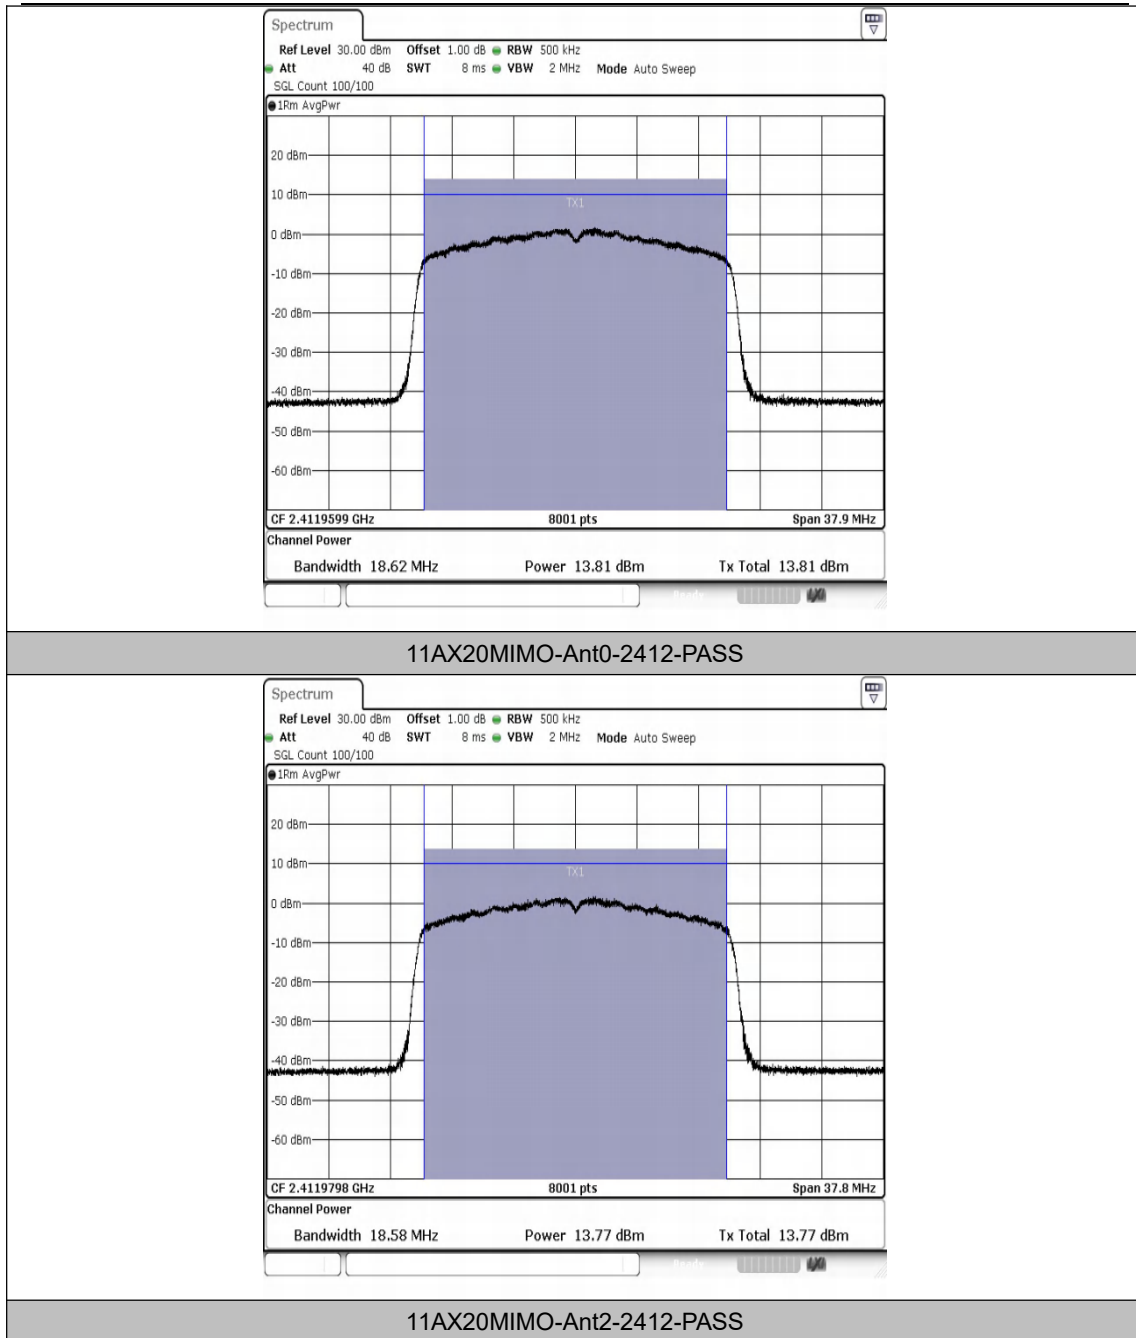


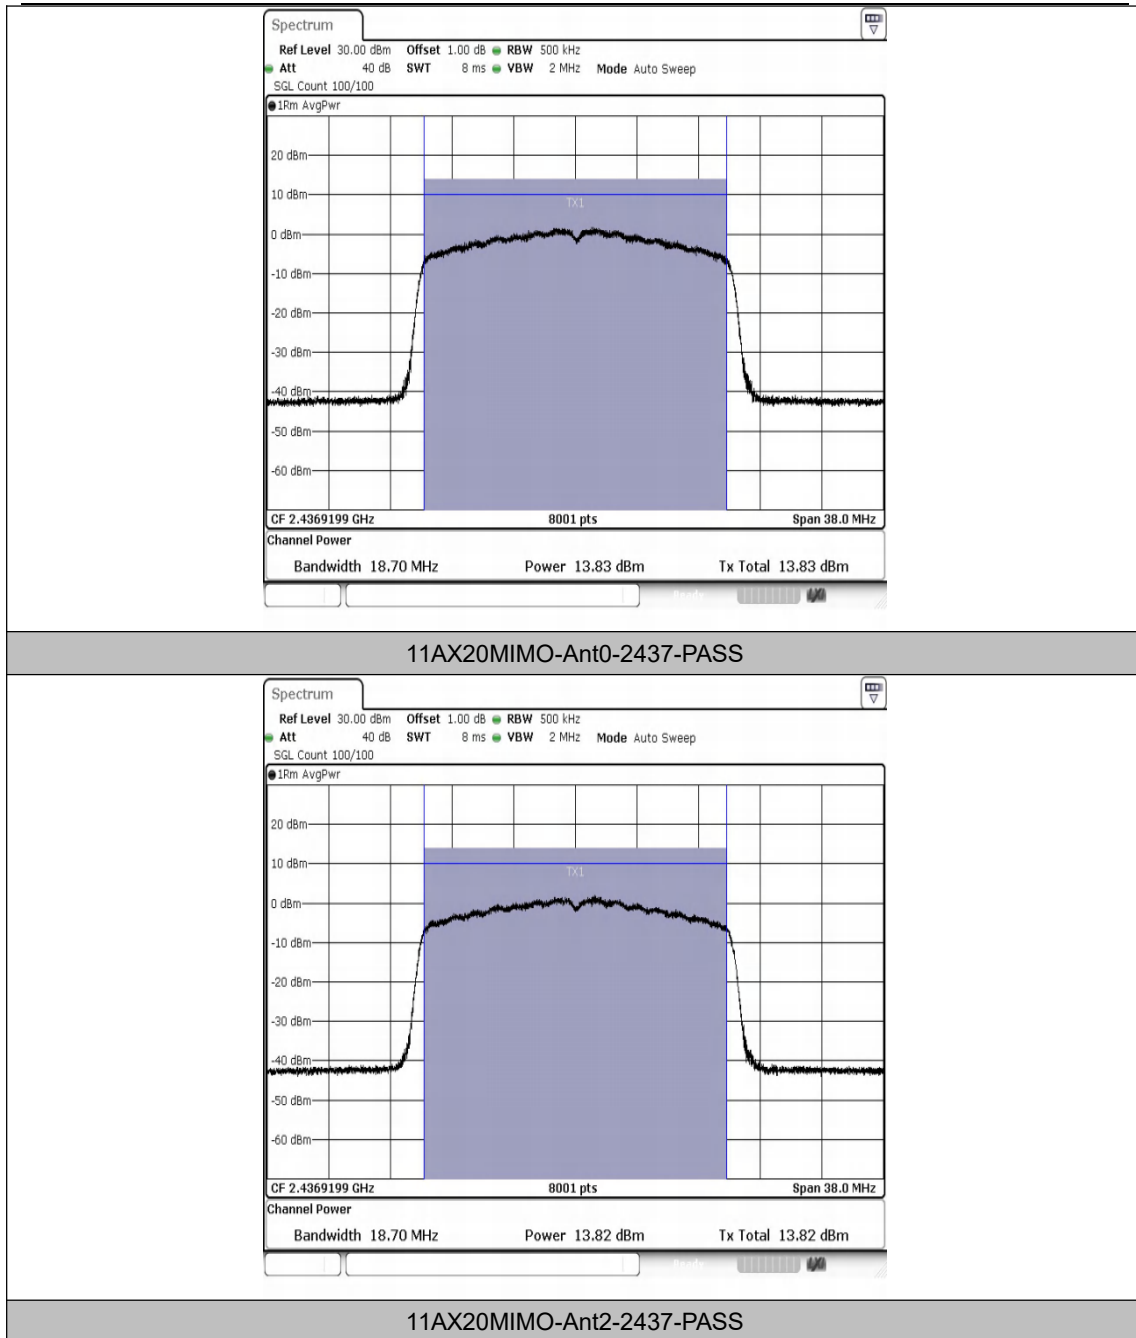

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

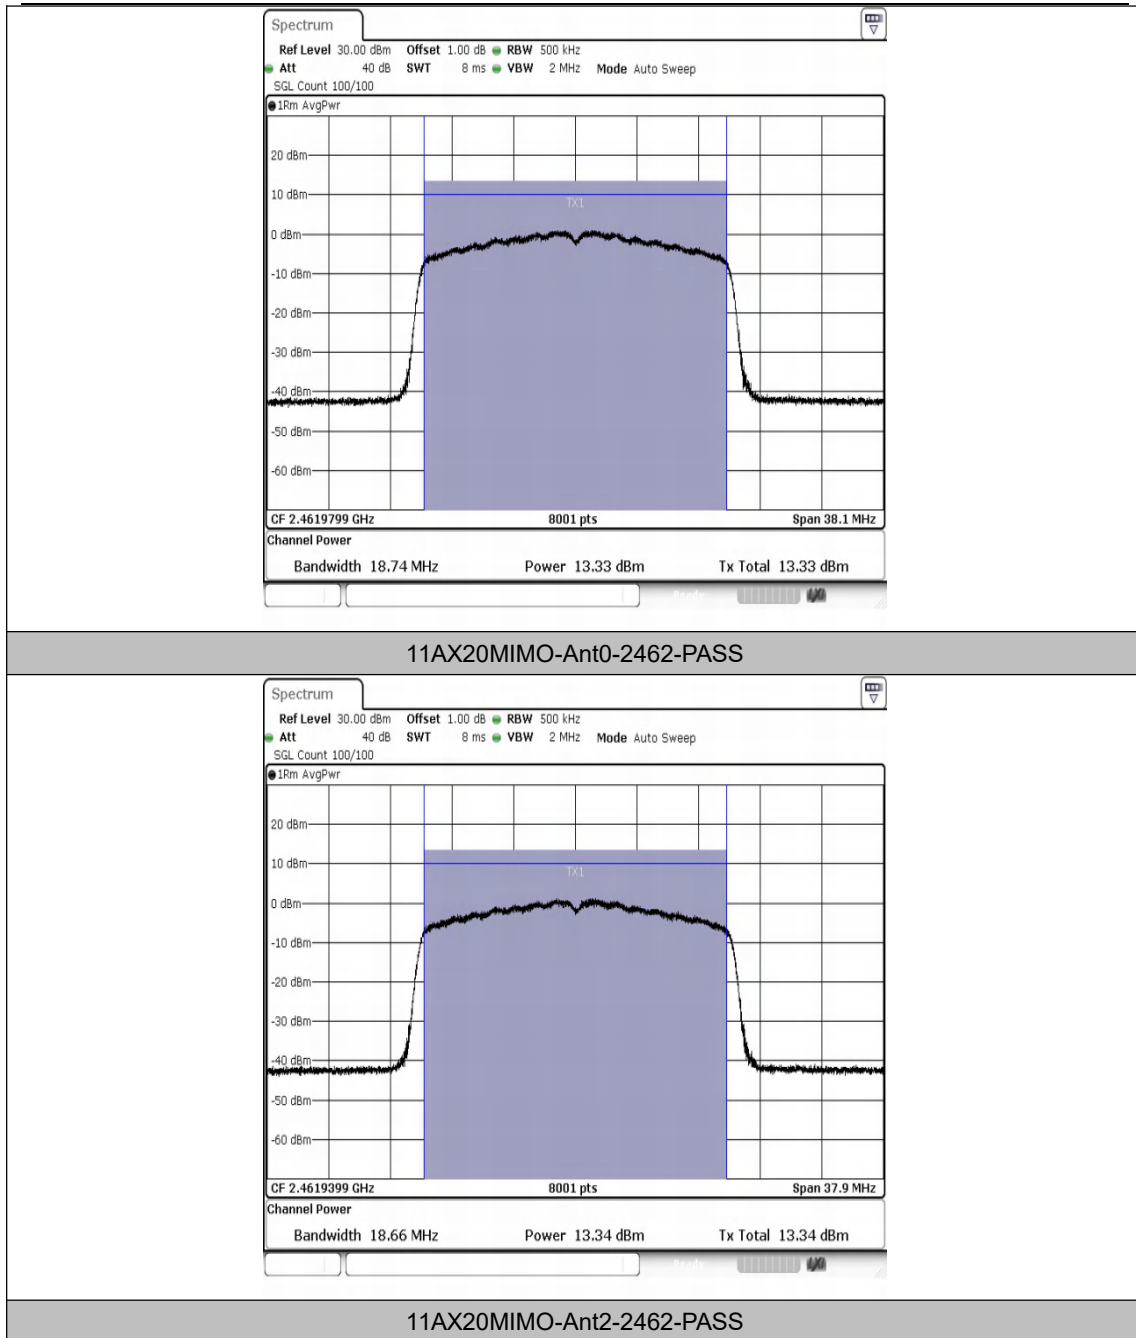

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)