

## Appendix Test Data

|                  |                     |                    |                    |
|------------------|---------------------|--------------------|--------------------|
| Report No:       | 1812C50390312503-08 | Test Sample NO:    | 1-2-2              |
| Start Test Date: | 2025-08-25          | Finish Test Date:  | 2025-09-17         |
| Test Engineer:   | <i>Joker Wang</i>   | Auditor:           | <i>Justin Feng</i> |
| Temperature:     | 23.3°C              | Relative Humidity: | 55%                |
| Pressure:        | 101 kPa             |                    |                    |

## Appendix A: Conducted Output Power

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Power(dBm) | Verdict |
|--------|-----------|------------|---------|------------------|------------|---------|
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 22.96      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#12           | 22.70      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 22.97      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 12RB#0           | 22.21      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 12RB#6           | 22.21      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 12RB#13          | 22.24      | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 22.17      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 21.89      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#12           | 21.68      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 21.94      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 12RB#0           | 21.21      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 12RB#6           | 21.10      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 12RB#13          | 21.27      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 21.25      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 22.88      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#12           | 22.85      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#24           | 23.09      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 12RB#0           | 22.29      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 12RB#6           | 22.30      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 12RB#13          | 22.24      | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | 22.23      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 1RB#0            | 21.82      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 1RB#12           | 21.69      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 1RB#24           | 21.96      | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 12RB#0           | 21.29      | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |         |       |      |
|--------|-------|-------|-------|---------|-------|------|
| Band17 | 5MHz  | 16QAM | 23790 | 12RB#6  | 21.21 | PASS |
| Band17 | 5MHz  | 16QAM | 23790 | 12RB#13 | 21.21 | PASS |
| Band17 | 5MHz  | 16QAM | 23790 | 25RB#0  | 21.32 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 1RB#0   | 22.93 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 1RB#12  | 22.82 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 1RB#24  | 23.17 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 12RB#0  | 22.40 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 12RB#6  | 22.34 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 12RB#13 | 22.42 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0  | 22.43 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#0   | 21.99 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#12  | 21.93 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24  | 22.22 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 12RB#0  | 21.46 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 12RB#6  | 21.39 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 12RB#13 | 21.45 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0  | 21.41 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0   | 22.85 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#24  | 22.88 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49  | 23.03 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 25RB#0  | 22.15 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 25RB#12 | 22.28 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 25RB#25 | 22.14 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0  | 22.26 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0   | 21.89 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#24  | 21.81 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49  | 22.01 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 25RB#0  | 21.15 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 25RB#12 | 21.31 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 25RB#25 | 21.12 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0  | 21.17 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0   | 22.84 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#24  | 22.87 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49  | 23.09 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 25RB#0  | 22.24 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 25RB#12 | 22.30 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 25RB#25 | 22.17 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0  | 22.27 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0   | 21.80 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#24  | 21.95 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49  | 21.87 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 25RB#0  | 21.26 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |         |       |      |
|--------|-------|-------|-------|---------|-------|------|
| Band17 | 10MHz | 16QAM | 23790 | 25RB#12 | 21.32 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 25RB#25 | 21.24 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0  | 21.25 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0   | 22.84 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#24  | 22.85 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49  | 23.06 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 25RB#0  | 22.28 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 25RB#12 | 22.34 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 25RB#25 | 22.30 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0  | 22.37 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0   | 21.58 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#24  | 21.77 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49  | 21.94 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 25RB#0  | 21.31 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 25RB#12 | 21.34 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 25RB#25 | 21.35 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0  | 21.35 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix B: Peak-to-Average Ratio(CCDF)


### Test Result


| Band   | Bandwidth | Modulation | Channel | RB Configuration | Result(dB) | Limit(dB) | Verdict |
|--------|-----------|------------|---------|------------------|------------|-----------|---------|
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 5.32       | 13        | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 5.49       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 5.94       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 6.14       | 13        | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 4.95       | 13        | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | 5.59       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 1RB#0            | 5.54       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 25RB#0           | 6.21       | 13        | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 1RB#0            | 5.28       | 13        | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | 5.66       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 1RB#0            | 5.75       | 13        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | 6.27       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 1RB#0            | 5.17       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | 5.30       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 1RB#0            | 6.31       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | 6.07       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 1RB#0            | 5.19       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 50RB#0           | 5.44       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 1RB#0            | 6.04       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 50RB#0           | 6.18       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 1RB#0            | 5.07       | 13        | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | 5.47       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 1RB#0            | 5.79       | 13        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 50RB#0           | 6.25       | 13        | PASS    |

## Test Graphs

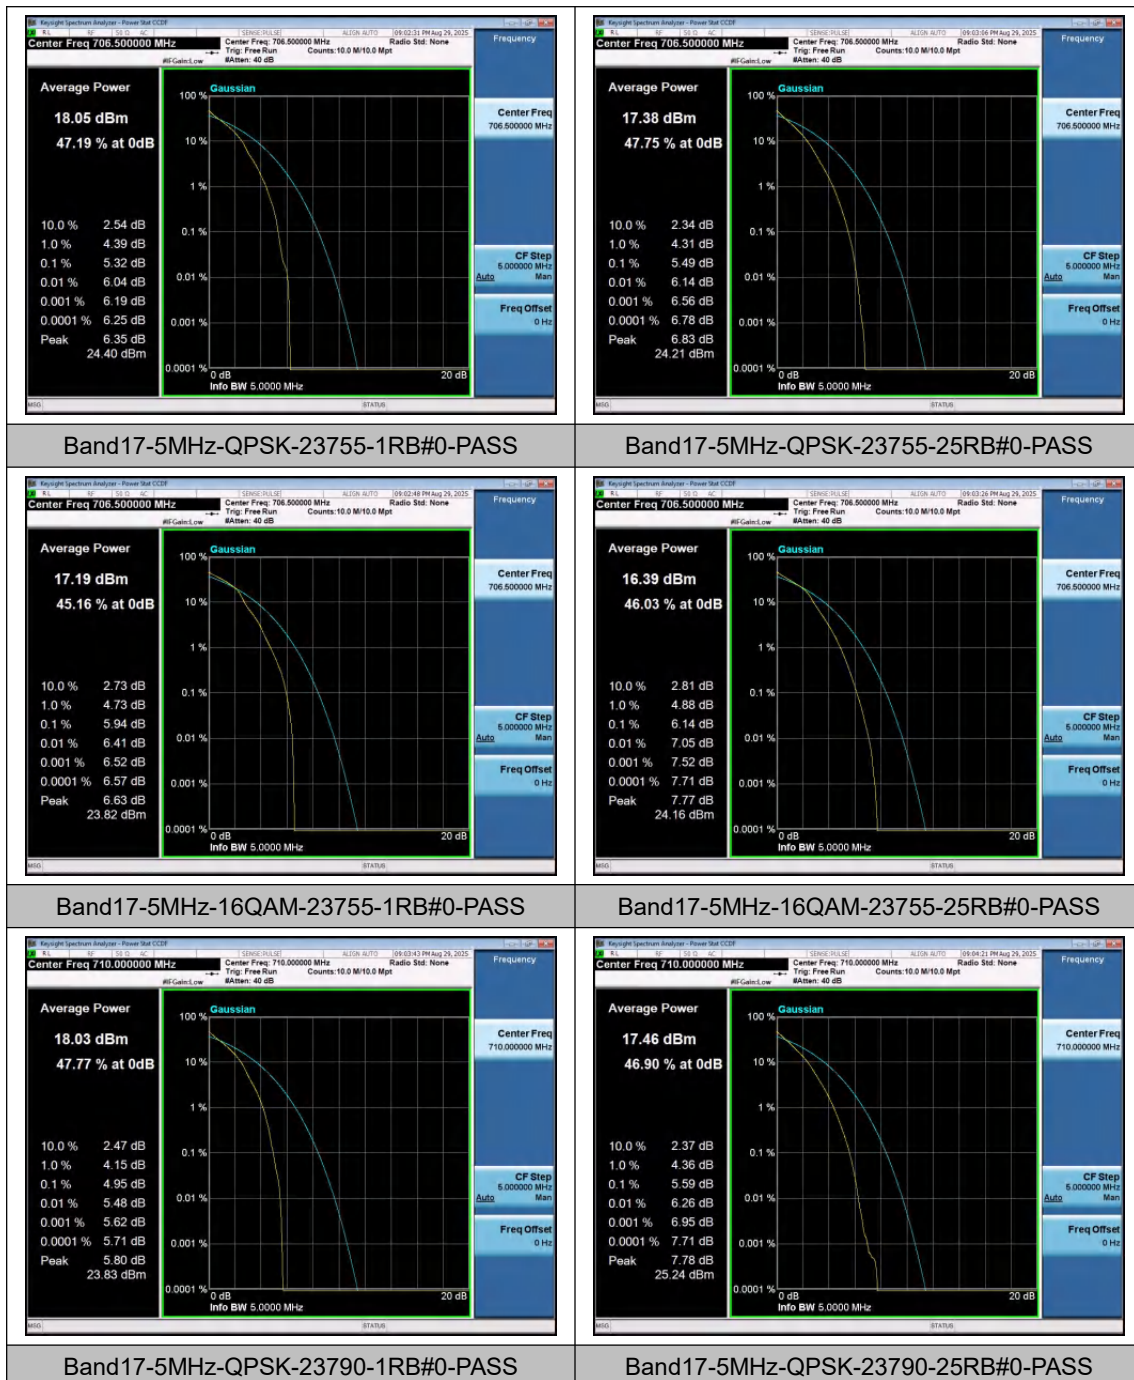

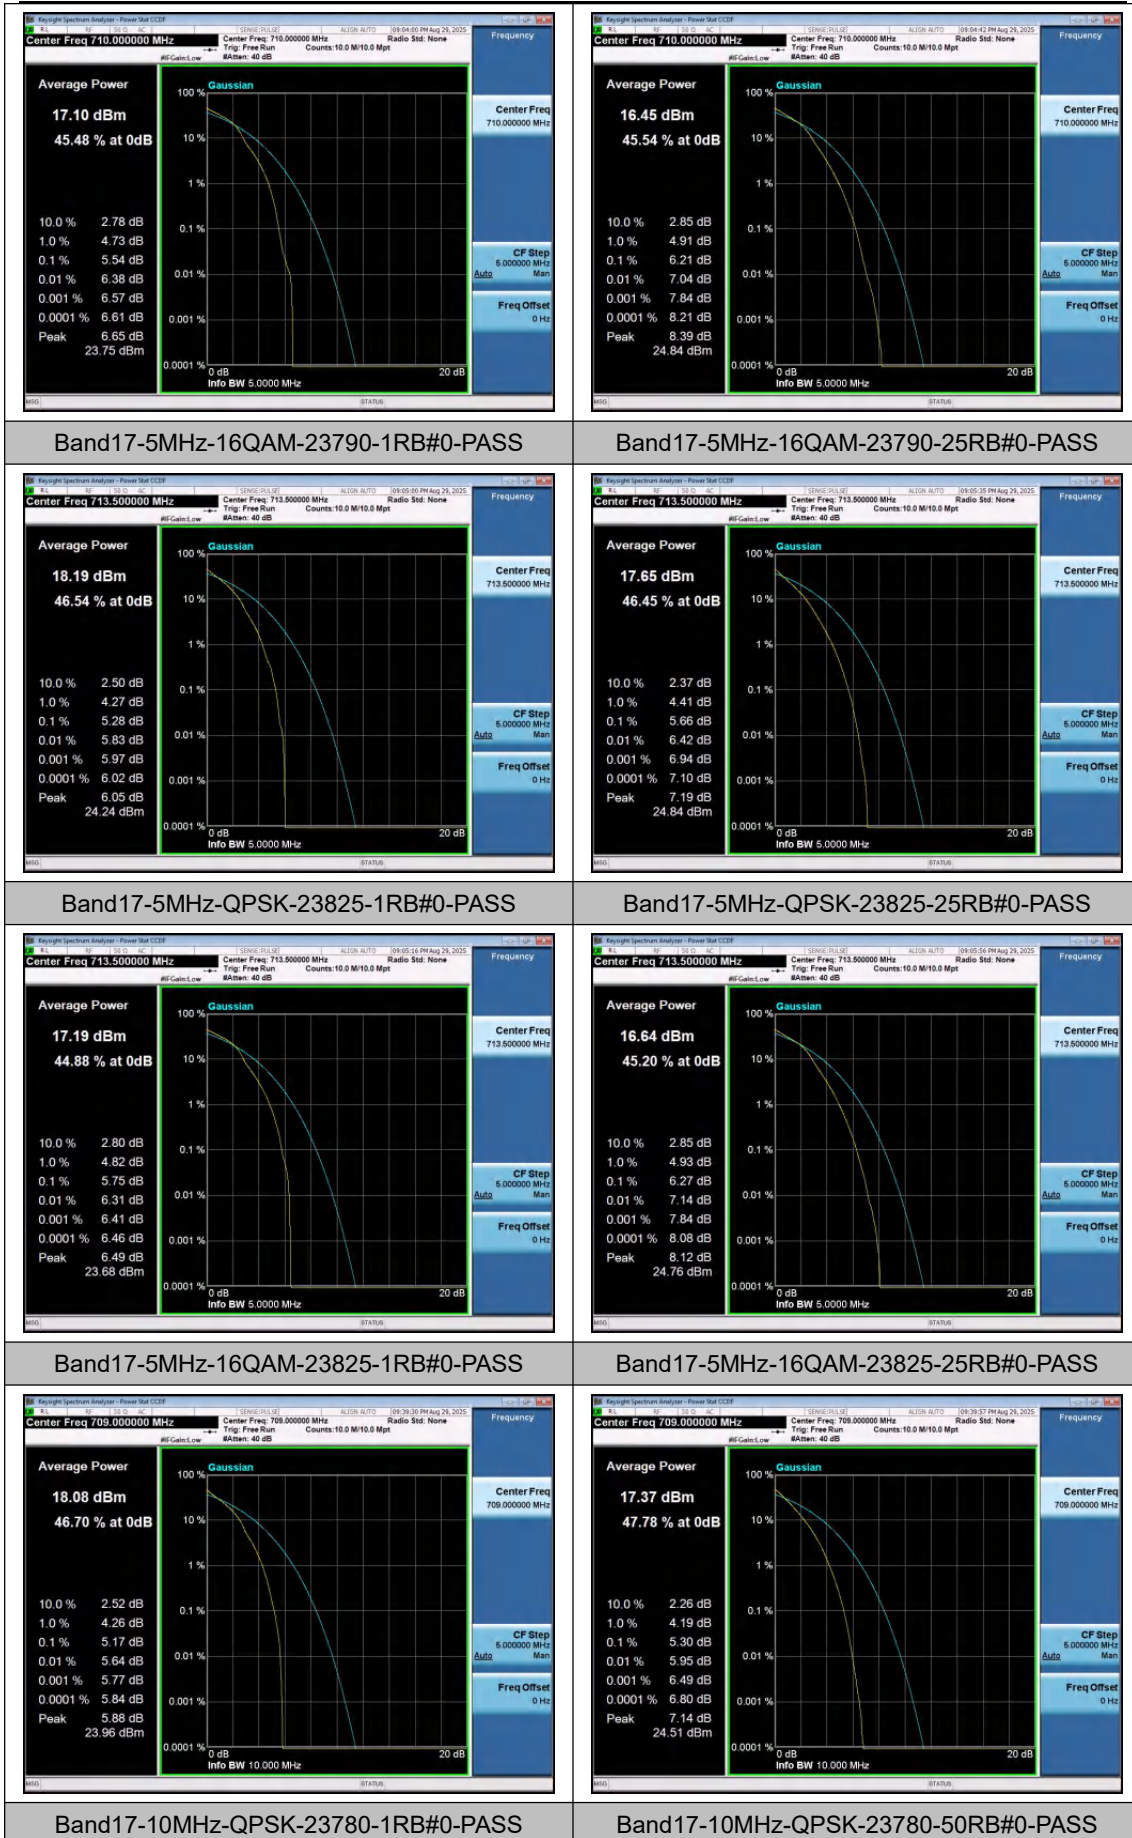

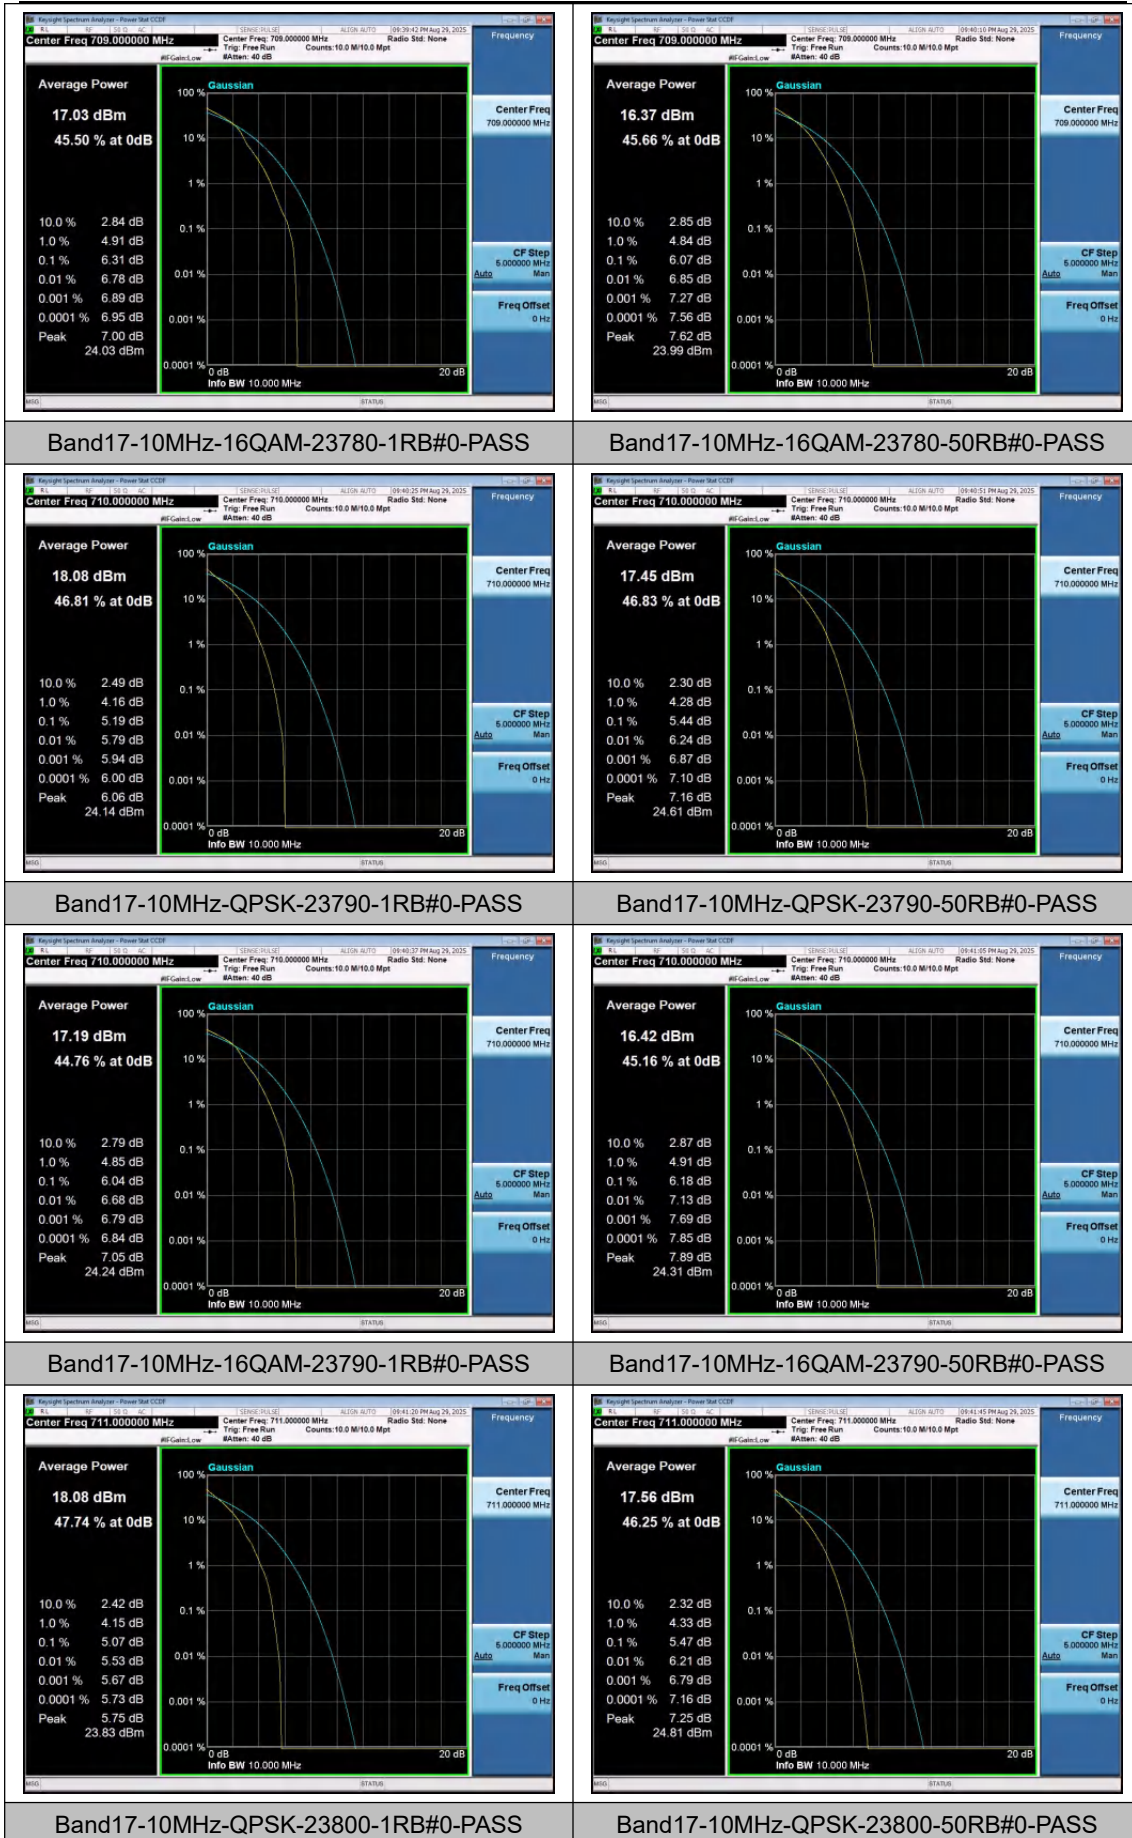

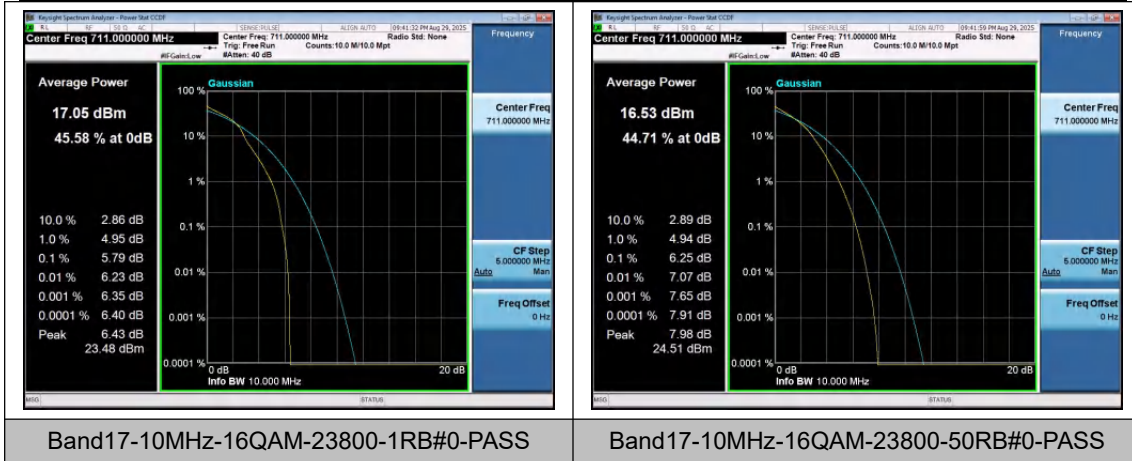

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix C: 26dB Bandwidth and Occupied Bandwidth

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Occupied Bandwidth (MHz) | 26dB Bandwidth (MHz) | Verdict |
|--------|-----------|------------|---------|------------------|--------------------------|----------------------|---------|
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 4.4970                   | 4.964                | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 4.5000                   | 5.007                | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | 4.4979                   | 4.925                | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 25RB#0           | 4.4860                   | 4.927                | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | 4.4974                   | 4.947                | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | 4.5062                   | 4.997                | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | 8.9600                   | 9.774                | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | 8.9470                   | 9.695                | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 50RB#0           | 8.9734                   | 9.804                | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 50RB#0           | 8.9543                   | 9.739                | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | 8.9481                   | 9.691                | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 50RB#0           | 8.9694                   | 9.764                | PASS    |

## Test Graphs

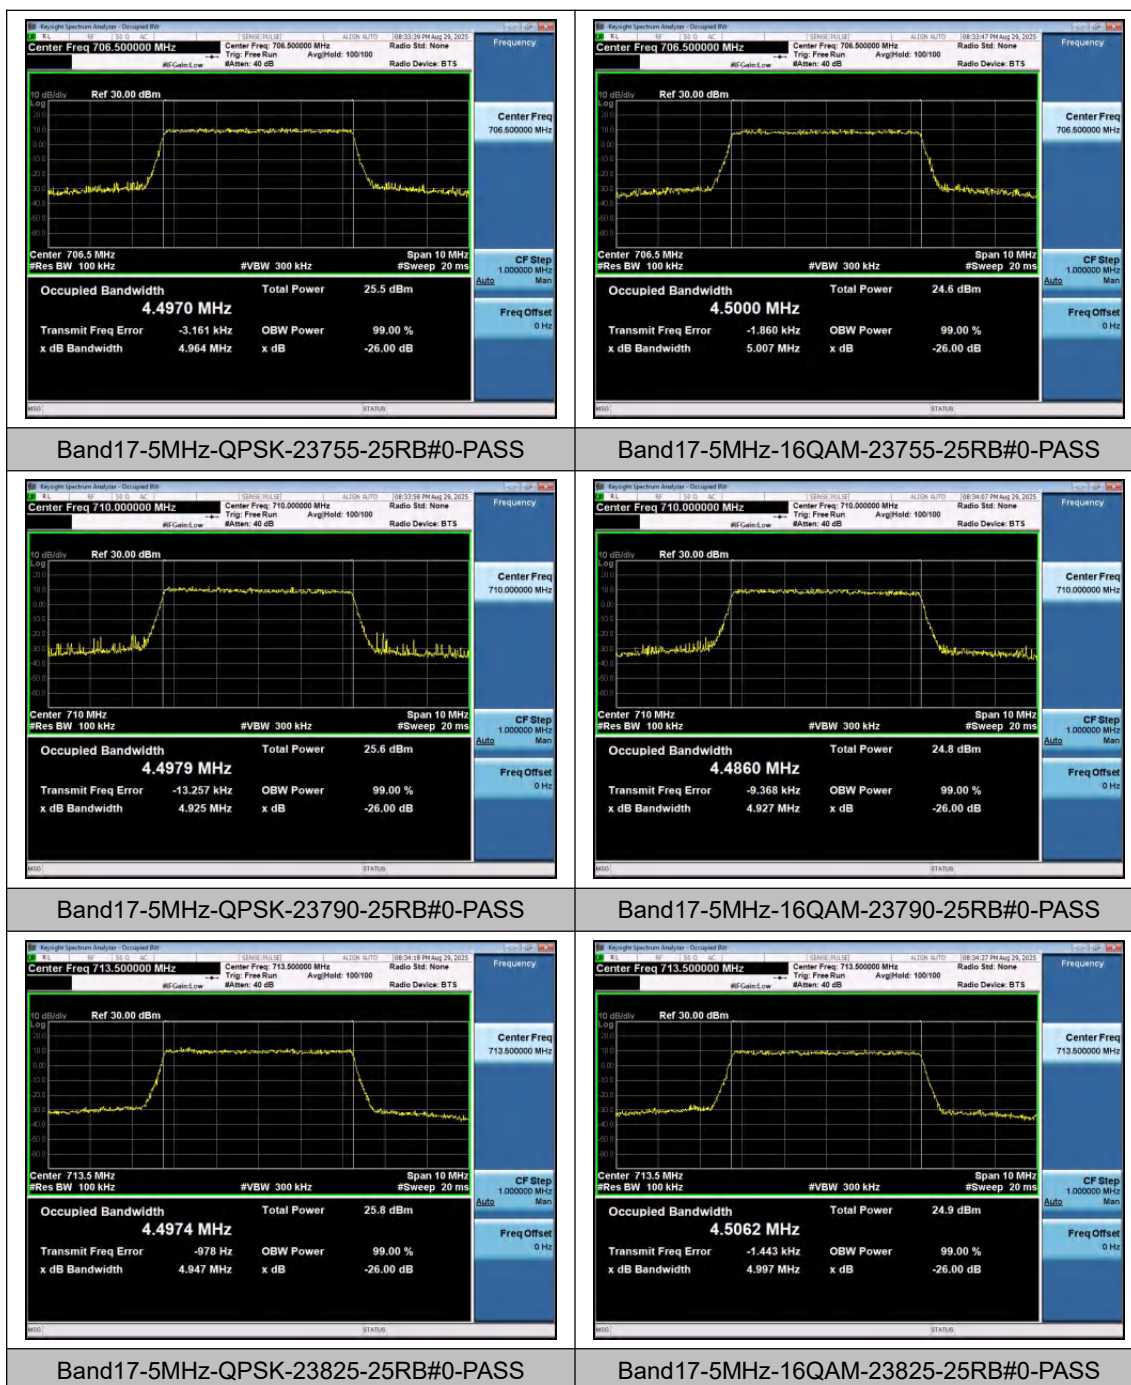

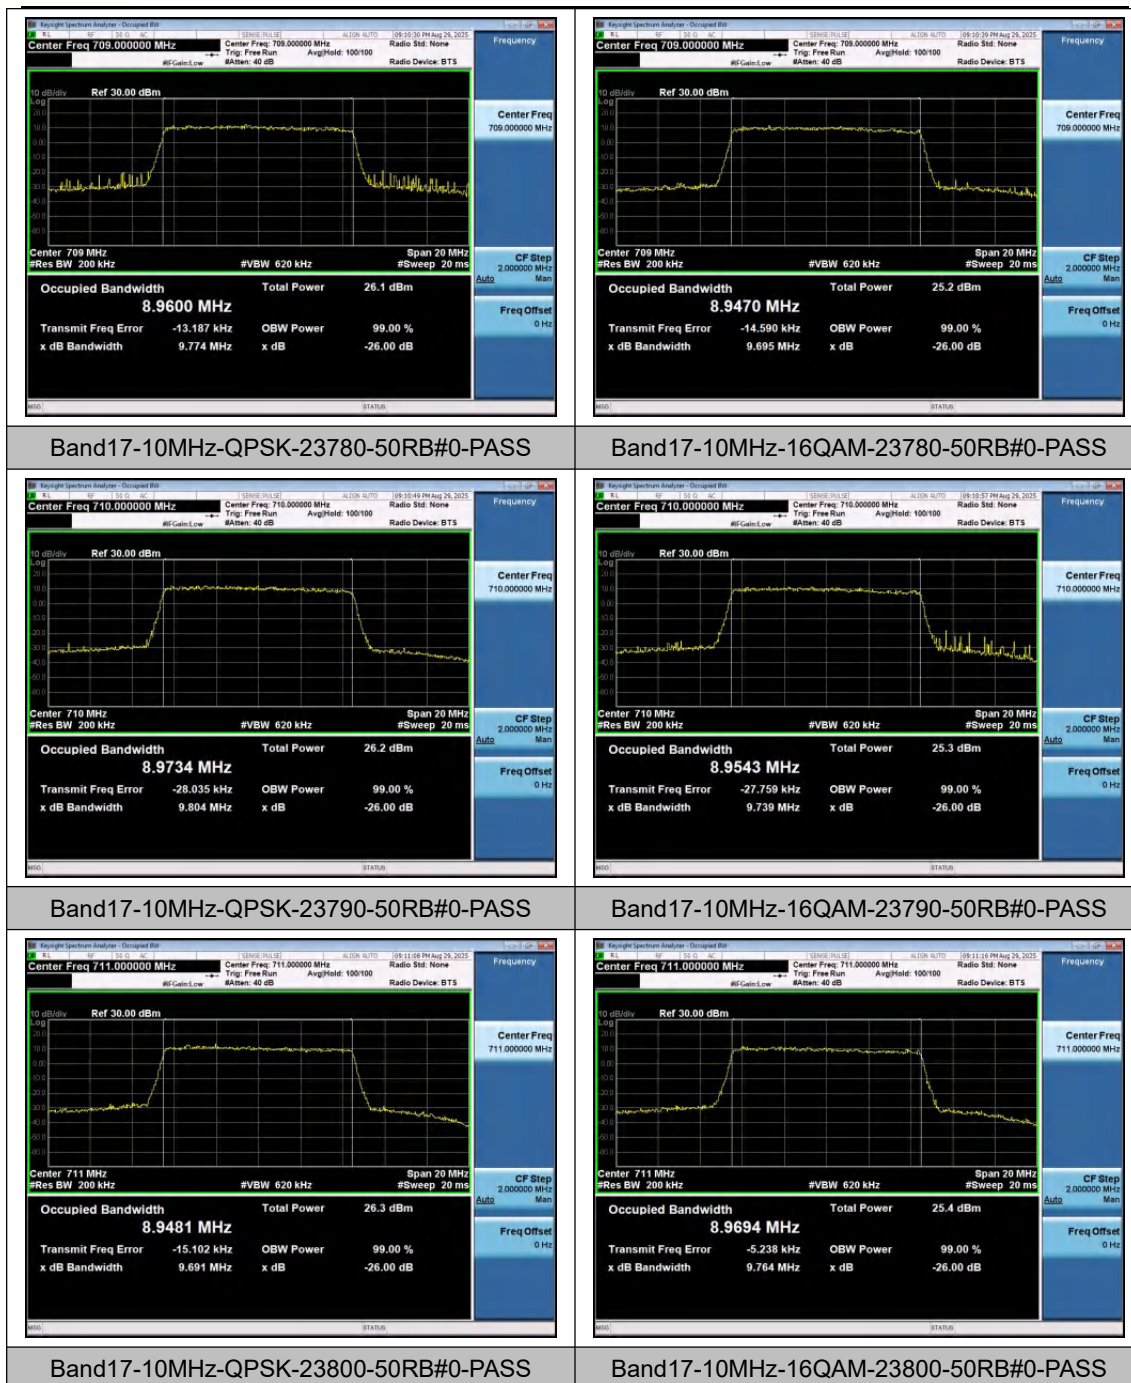


## Appendix D: Band Edge

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Result(dBm) | Margin (dB) | Verdict |
|--------|-----------|------------|---------|------------------|-------------|-------------|---------|
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | -30.91      | 17.91       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | -54.76      | 41.76       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | -39.84      | 26.84       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | -32.63      | 19.63       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | -55.05      | 42.05       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | -41.05      | 28.05       | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 1RB#0            | -54.54      | 41.54       | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 1RB#24           | -29.64      | 16.64       | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | -40.57      | 27.57       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 1RB#0            | -55.04      | 42.04       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 1RB#24           | -32.35      | 19.35       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | -41.21      | 28.21       | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 1RB#0            | -39.31      | 26.31       | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 1RB#49           | -54.53      | 41.53       | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | -42.71      | 29.71       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 1RB#0            | -39.32      | 26.32       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 1RB#49           | -55.05      | 42.05       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | -44.01      | 31.01       | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 1RB#0            | -56.04      | 43.04       | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 1RB#49           | -38.69      | 25.69       | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | -44.29      | 31.29       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 1RB#0            | -56.24      | 43.24       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 1RB#49           | -39.36      | 26.36       | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 50RB#0           | -45.58      | 32.58       | PASS    |


## Test Graphs

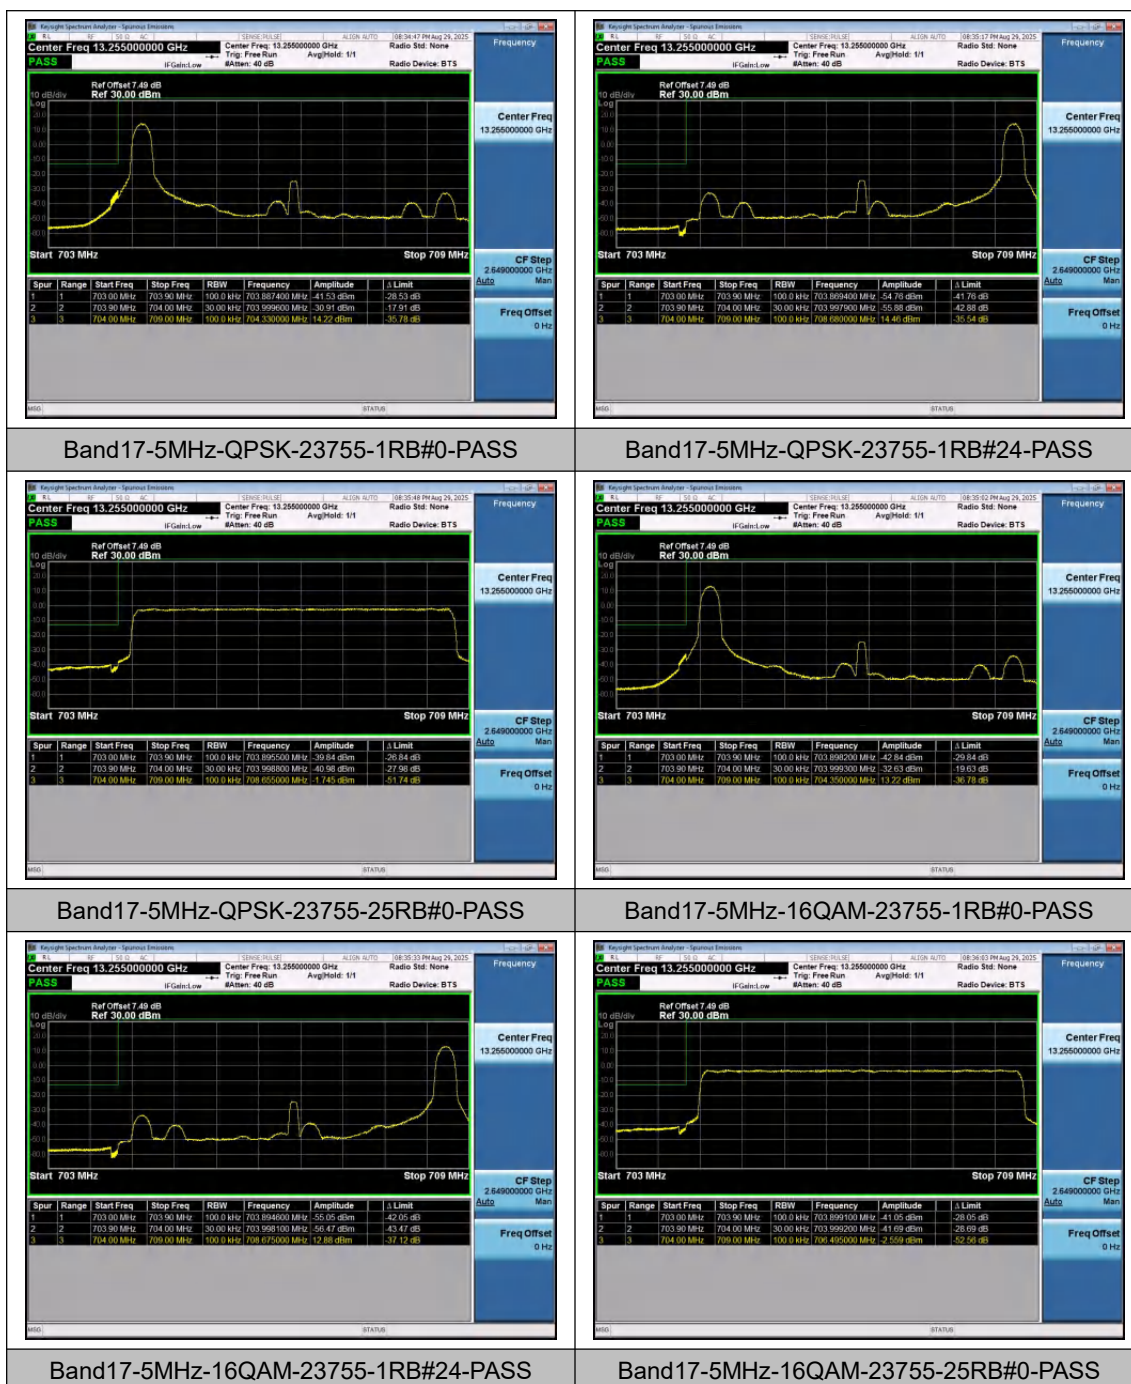



## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

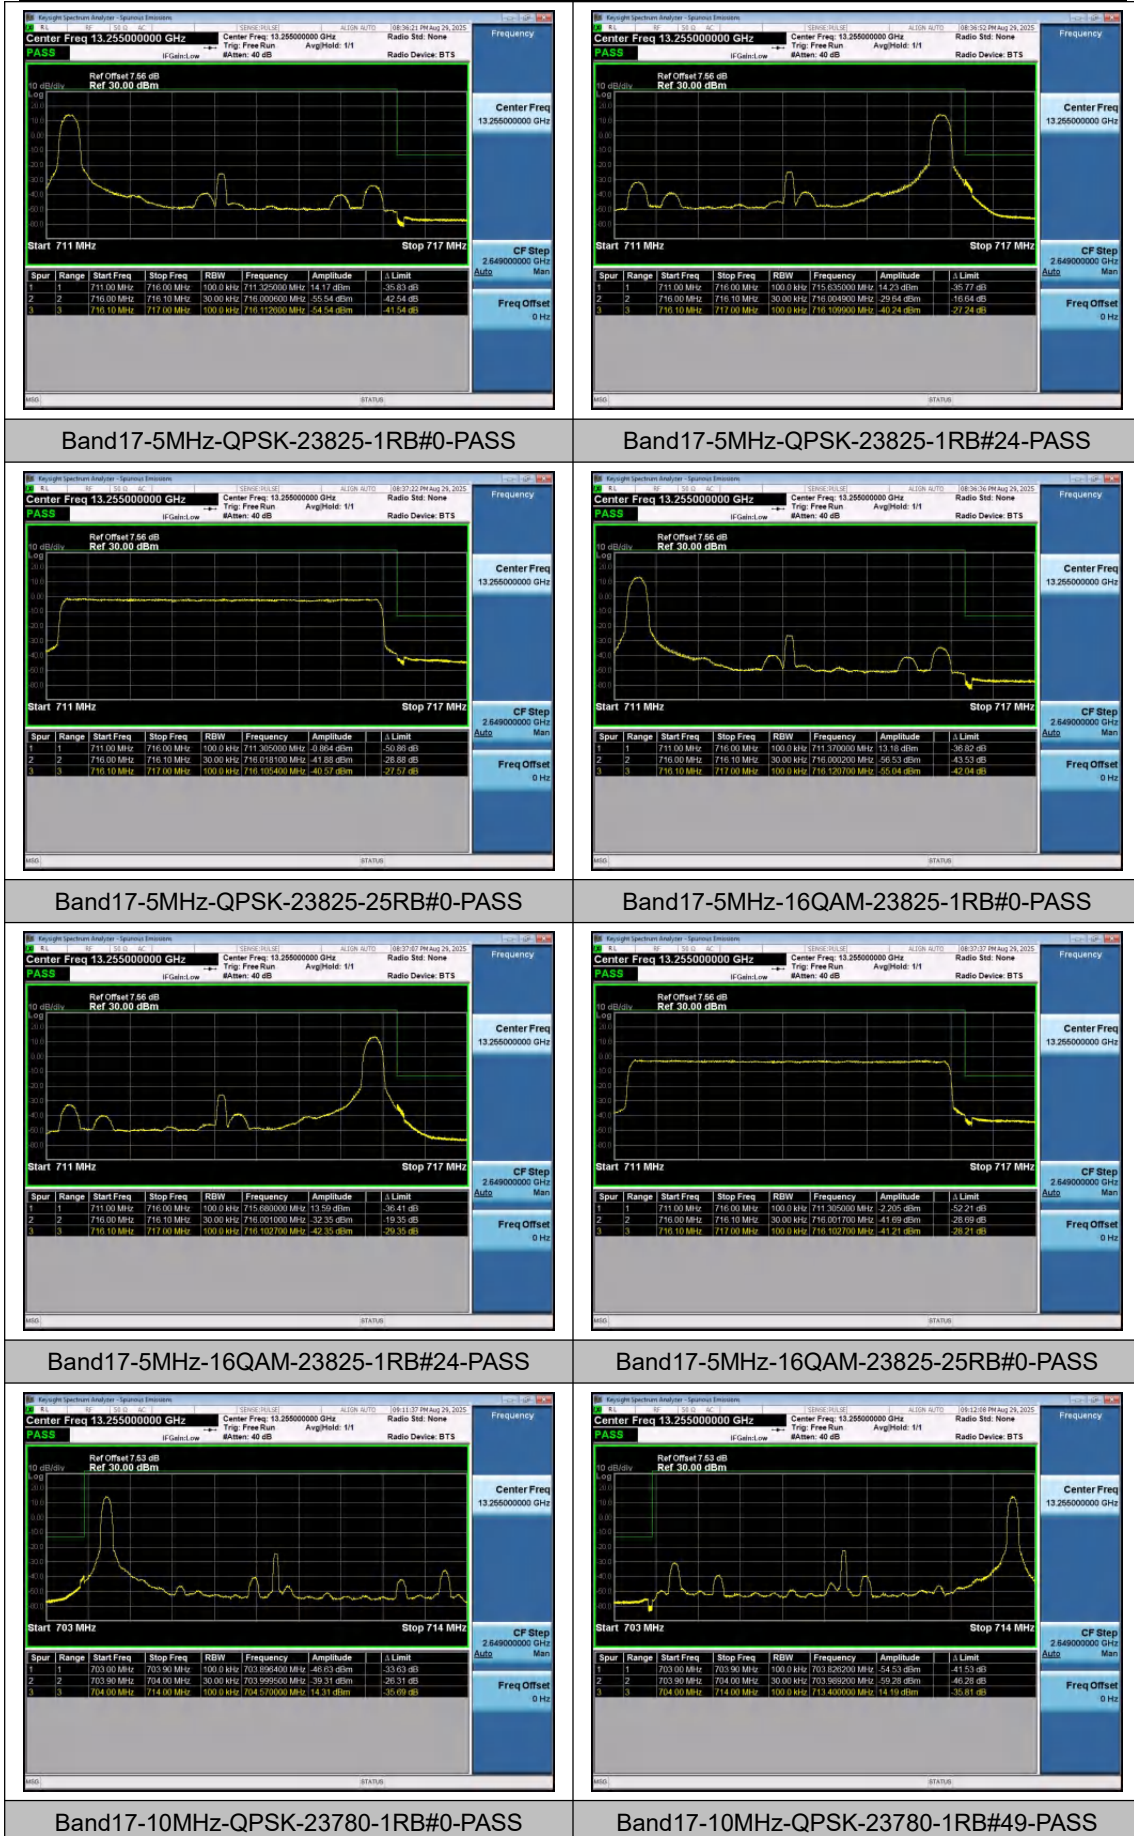

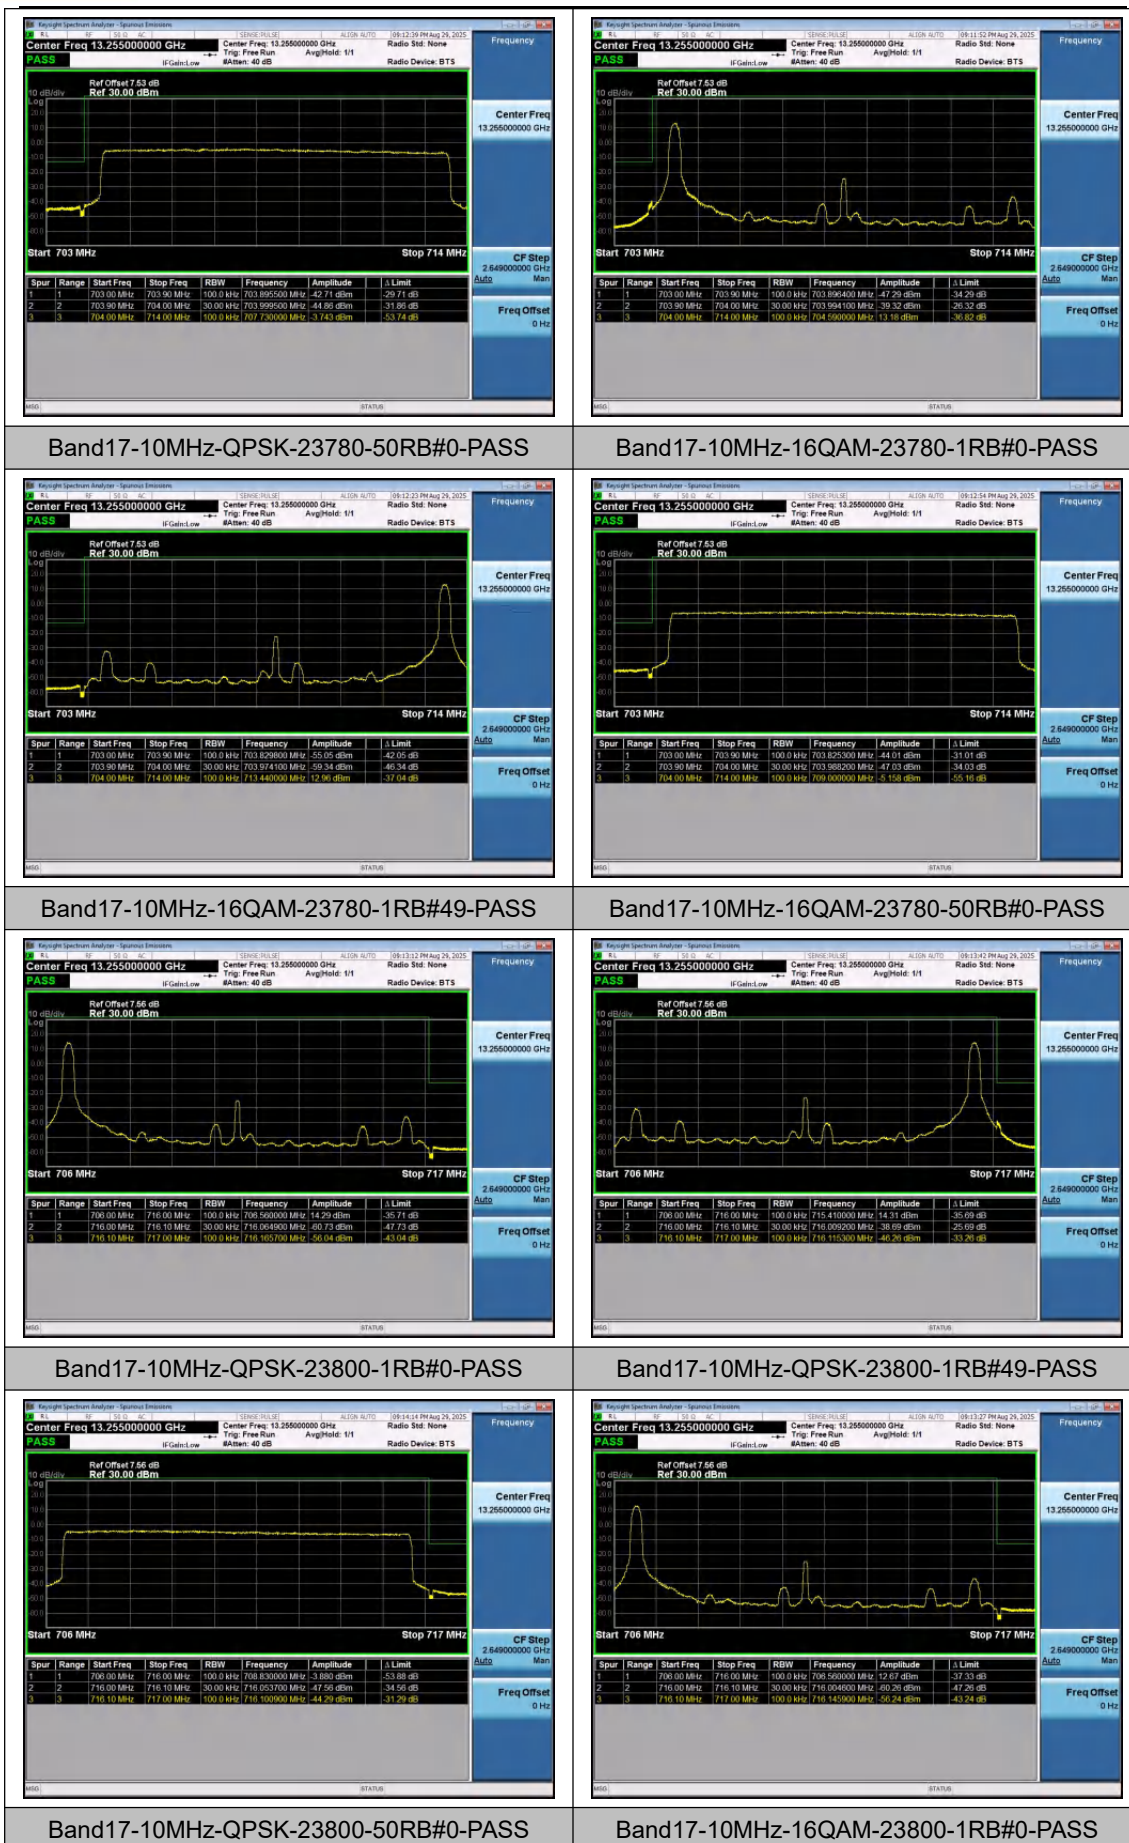

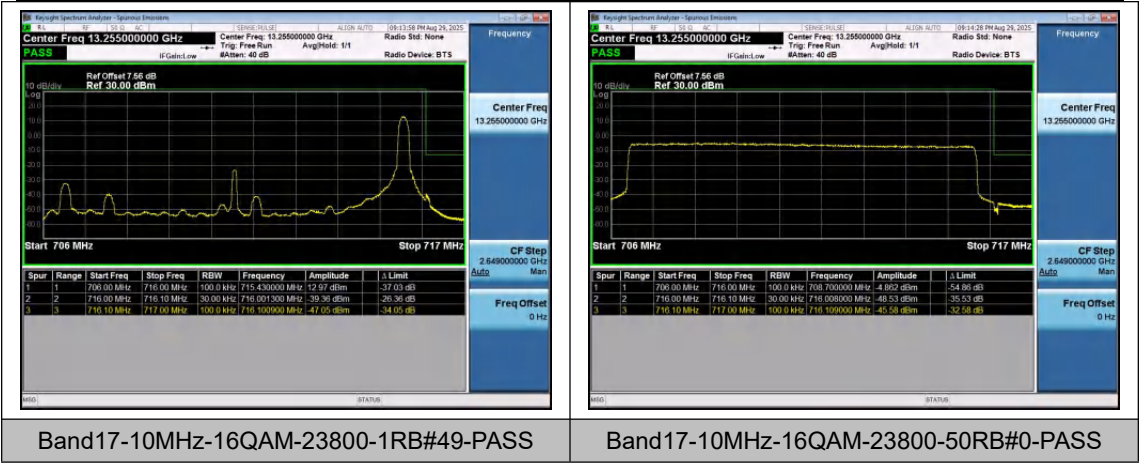

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix E: Conducted Spurious Emission

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Frequency Range | Result (dBm) | Limit (dBm) | Verdict |
|--------|-----------|------------|---------|------------------|-----------------|--------------|-------------|---------|
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 0.009~0.15      | -44.20       | -33.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 0.15~30         | -50.56       | -23.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 30~1000         | -52.40       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 1000~3000       | -45.08       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#0            | 3000~10000      | -44.00       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 0.009~0.15      | -44.00       | -33.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 0.15~30         | -54.22       | -23.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 30~1000         | -53.20       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 1000~3000       | -44.74       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 1RB#24           | 3000~10000      | -43.35       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 0.009~0.15      | -45.27       | -33.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 0.15~30         | -51.71       | -23.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 30~1000         | -35.55       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 1000~3000       | -45.56       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | 3000~10000      | -43.73       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 0.009~0.15      | -44.13       | -33.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 0.15~30         | -50.08       | -23.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 30~1000         | -51.87       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 1000~3000       | -45.68       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#0            | 3000~10000      | -43.91       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 0.009~0.15      | -44.33       | -33.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 0.15~30         | -52.37       | -23.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 30~1000         | -51.45       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 1000~3000       | -45.64       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 1RB#24           | 3000~10000      | -43.78       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 0.009~0.15      | -43.99       | -33.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 0.15~30         | -52.16       | -23.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 30~1000         | -37.98       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 1000~3000       | -45.73       | -13.0       | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | 3000~10000      | -43.69       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 0.009~0.15      | -45.42       | -33.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 0.15~30         | -51.62       | -23.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 30~1000         | -57.02       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 1000~3000       | -45.24       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#0            | 3000~10000      | -43.72       | -13.0       | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 1RB#24           | 0.009~0.15      | -44.70       | -33.0       | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |      |       |       |        |            |        |       |      |
|--------|------|-------|-------|--------|------------|--------|-------|------|
| Band17 | 5MHz | QPSK  | 23790 | 1RB#24 | 0.15~30    | -53.62 | -23.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 1RB#24 | 30~1000    | -55.96 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 1RB#24 | 1000~3000  | -45.50 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 1RB#24 | 3000~10000 | -43.61 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 25RB#0 | 0.009~0.15 | -45.00 | -33.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 25RB#0 | 0.15~30    | -51.22 | -23.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 25RB#0 | 30~1000    | -50.07 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 25RB#0 | 1000~3000  | -44.67 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23790 | 25RB#0 | 3000~10000 | -43.88 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#0  | 0.009~0.15 | -43.70 | -33.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#0  | 0.15~30    | -51.30 | -23.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#0  | 30~1000    | -45.08 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#0  | 1000~3000  | -45.64 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#0  | 3000~10000 | -43.69 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#24 | 0.009~0.15 | -44.78 | -33.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#24 | 0.15~30    | -51.74 | -23.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#24 | 30~1000    | -57.44 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#24 | 1000~3000  | -45.42 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 1RB#24 | 3000~10000 | -44.01 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 25RB#0 | 0.009~0.15 | -43.19 | -33.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 25RB#0 | 0.15~30    | -53.15 | -23.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 25RB#0 | 30~1000    | -51.53 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 25RB#0 | 1000~3000  | -45.71 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23790 | 25RB#0 | 3000~10000 | -43.99 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#0  | 0.009~0.15 | -44.12 | -33.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#0  | 0.15~30    | -51.44 | -23.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#0  | 30~1000    | -54.61 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#0  | 1000~3000  | -45.71 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#0  | 3000~10000 | -43.56 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#24 | 0.009~0.15 | -43.18 | -33.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#24 | 0.15~30    | -51.19 | -23.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#24 | 30~1000    | -52.97 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#24 | 1000~3000  | -45.60 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 1RB#24 | 3000~10000 | -43.60 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 25RB#0 | 0.009~0.15 | -45.09 | -33.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 25RB#0 | 0.15~30    | -51.77 | -23.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 25RB#0 | 30~1000    | -37.98 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 25RB#0 | 1000~3000  | -45.55 | -13.0 | PASS |
| Band17 | 5MHz | QPSK  | 23825 | 25RB#0 | 3000~10000 | -43.64 | -13.0 | PASS |
| Band17 | 5MHz | 16QAM | 23825 | 1RB#0  | 0.009~0.15 | -46.00 | -33.0 | PASS |
| Band17 | 5MHz | 16QAM | 23825 | 1RB#0  | 0.15~30    | -51.29 | -23.0 | PASS |
| Band17 | 5MHz | 16QAM | 23825 | 1RB#0  | 30~1000    | -55.62 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |        |            |        |       |      |
|--------|-------|-------|-------|--------|------------|--------|-------|------|
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#0  | 1000~3000  | -45.74 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#0  | 3000~10000 | -44.04 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24 | 0.009~0.15 | -44.54 | -33.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24 | 0.15~30    | -51.19 | -23.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24 | 30~1000    | -53.45 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24 | 1000~3000  | -45.73 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 1RB#24 | 3000~10000 | -43.36 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | 0.009~0.15 | -44.82 | -33.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | 0.15~30    | -52.26 | -23.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | 30~1000    | -37.72 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | 1000~3000  | -45.63 | -13.0 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | 3000~10000 | -43.65 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0  | 0.009~0.15 | -44.24 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0  | 0.15~30    | -50.49 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0  | 30~1000    | -50.97 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0  | 1000~3000  | -45.73 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#0  | 3000~10000 | -43.80 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49 | 0.009~0.15 | -44.78 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49 | 0.15~30    | -51.36 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49 | 30~1000    | -53.23 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49 | 1000~3000  | -45.52 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 1RB#49 | 3000~10000 | -43.69 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | 0.009~0.15 | -44.13 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | 0.15~30    | -52.51 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | 30~1000    | -39.11 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | 1000~3000  | -45.30 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | 3000~10000 | -43.75 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0  | 0.009~0.15 | -43.96 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0  | 0.15~30    | -50.41 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0  | 30~1000    | -52.50 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0  | 1000~3000  | -45.23 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#0  | 3000~10000 | -43.77 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49 | 0.009~0.15 | -42.68 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49 | 0.15~30    | -51.90 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49 | 30~1000    | -54.45 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49 | 1000~3000  | -43.17 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 1RB#49 | 3000~10000 | -43.65 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | 0.009~0.15 | -44.36 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | 0.15~30    | -53.13 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | 30~1000    | -39.15 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | 1000~3000  | -34.30 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | 3000~10000 | -43.86 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |        |            |        |       |      |
|--------|-------|-------|-------|--------|------------|--------|-------|------|
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0  | 0.009~0.15 | -46.02 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0  | 0.15~30    | -52.65 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0  | 30~1000    | -51.70 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0  | 1000~3000  | -45.86 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#0  | 3000~10000 | -43.92 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49 | 0.009~0.15 | -45.08 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49 | 0.15~30    | -51.85 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49 | 30~1000    | -53.90 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49 | 1000~3000  | -44.67 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 1RB#49 | 3000~10000 | -43.27 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | 0.009~0.15 | -45.19 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | 0.15~30    | -49.42 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | 30~1000    | -40.06 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | 1000~3000  | -42.98 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | 3000~10000 | -44.10 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0  | 0.009~0.15 | -44.66 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0  | 0.15~30    | -52.68 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0  | 30~1000    | -52.10 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0  | 1000~3000  | -34.50 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#0  | 3000~10000 | -43.73 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49 | 0.009~0.15 | -44.75 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49 | 0.15~30    | -53.02 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49 | 30~1000    | -54.21 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49 | 1000~3000  | -45.25 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 1RB#49 | 3000~10000 | -42.80 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | 0.009~0.15 | -44.63 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | 0.15~30    | -50.62 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | 30~1000    | -40.58 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | 1000~3000  | -45.75 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | 3000~10000 | -43.75 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0  | 0.009~0.15 | -45.07 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0  | 0.15~30    | -52.03 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0  | 30~1000    | -51.90 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0  | 1000~3000  | -39.67 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#0  | 3000~10000 | -44.11 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49 | 0.009~0.15 | -44.43 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49 | 0.15~30    | -51.31 | -23.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49 | 30~1000    | -53.74 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49 | 1000~3000  | -45.49 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 1RB#49 | 3000~10000 | -43.57 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | 0.009~0.15 | -44.53 | -33.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | 0.15~30    | -51.93 | -23.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|        |       |       |       |        |            |        |       |      |
|--------|-------|-------|-------|--------|------------|--------|-------|------|
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | 30~1000    | -39.29 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | 1000~3000  | -45.77 | -13.0 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | 3000~10000 | -43.25 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0  | 0.009~0.15 | -44.44 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0  | 0.15~30    | -53.85 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0  | 30~1000    | -54.52 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0  | 1000~3000  | -45.77 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#0  | 3000~10000 | -43.87 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49 | 0.009~0.15 | -44.21 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49 | 0.15~30    | -51.11 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49 | 30~1000    | -53.15 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49 | 1000~3000  | -45.52 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 1RB#49 | 3000~10000 | -37.41 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | 0.009~0.15 | -45.03 | -33.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | 0.15~30    | -51.59 | -23.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | 30~1000    | -41.43 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | 1000~3000  | -35.95 | -13.0 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | 3000~10000 | -43.90 | -13.0 | PASS |


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

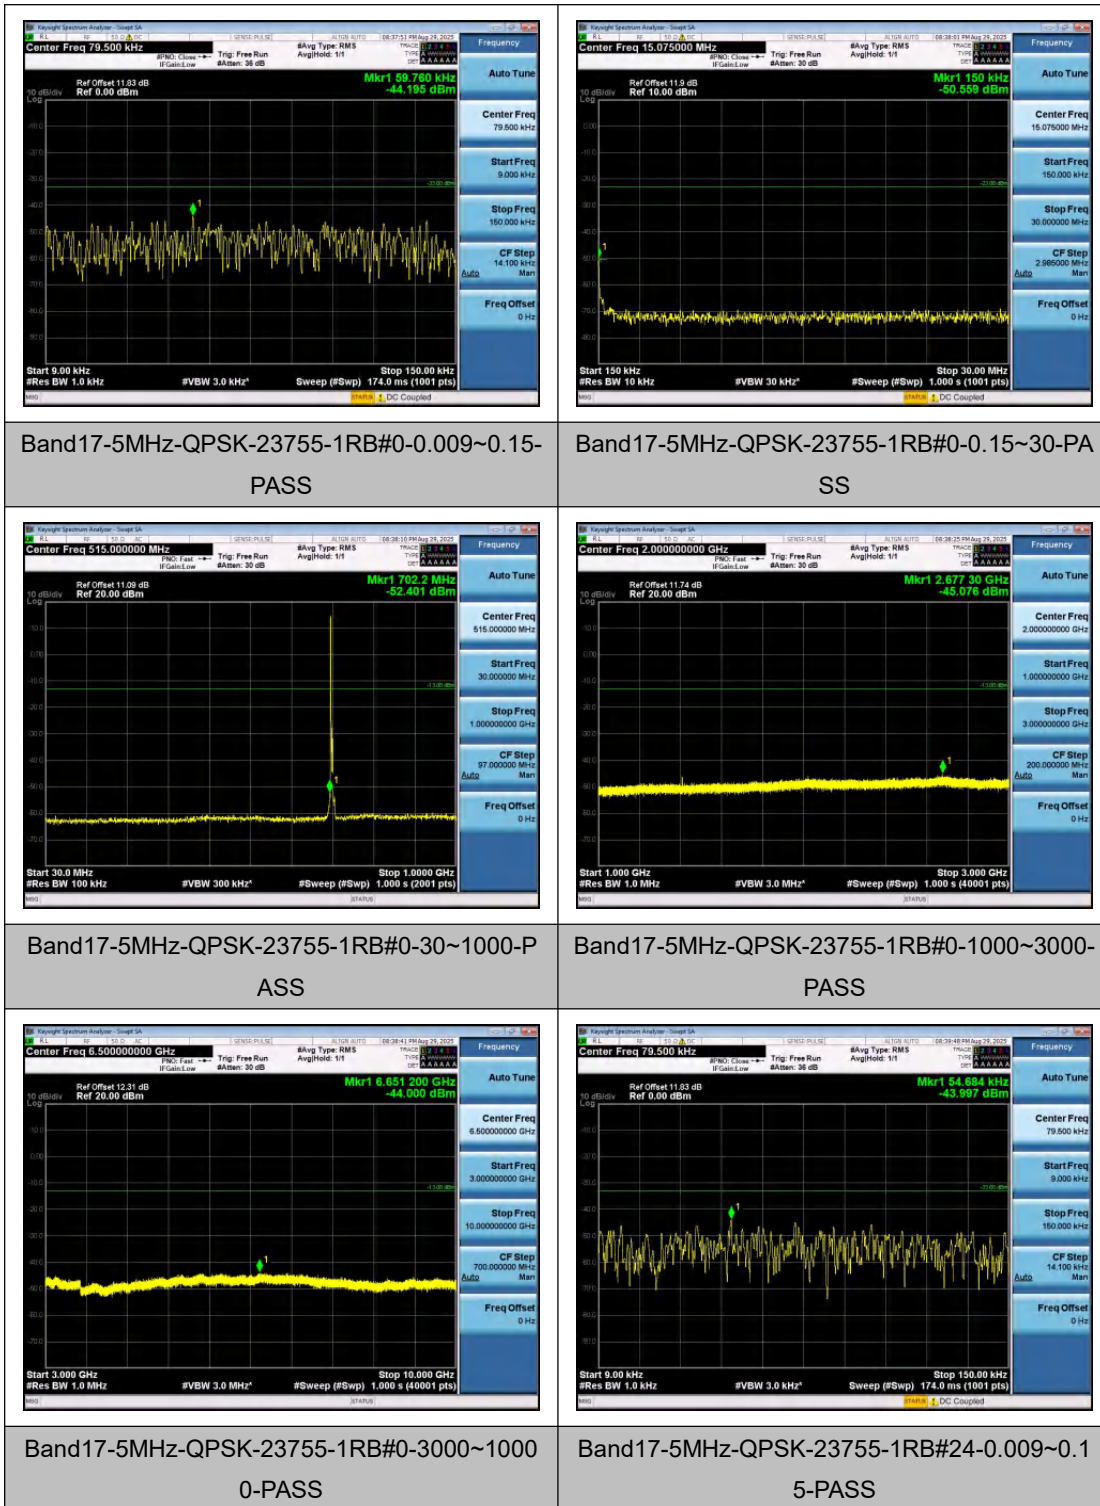


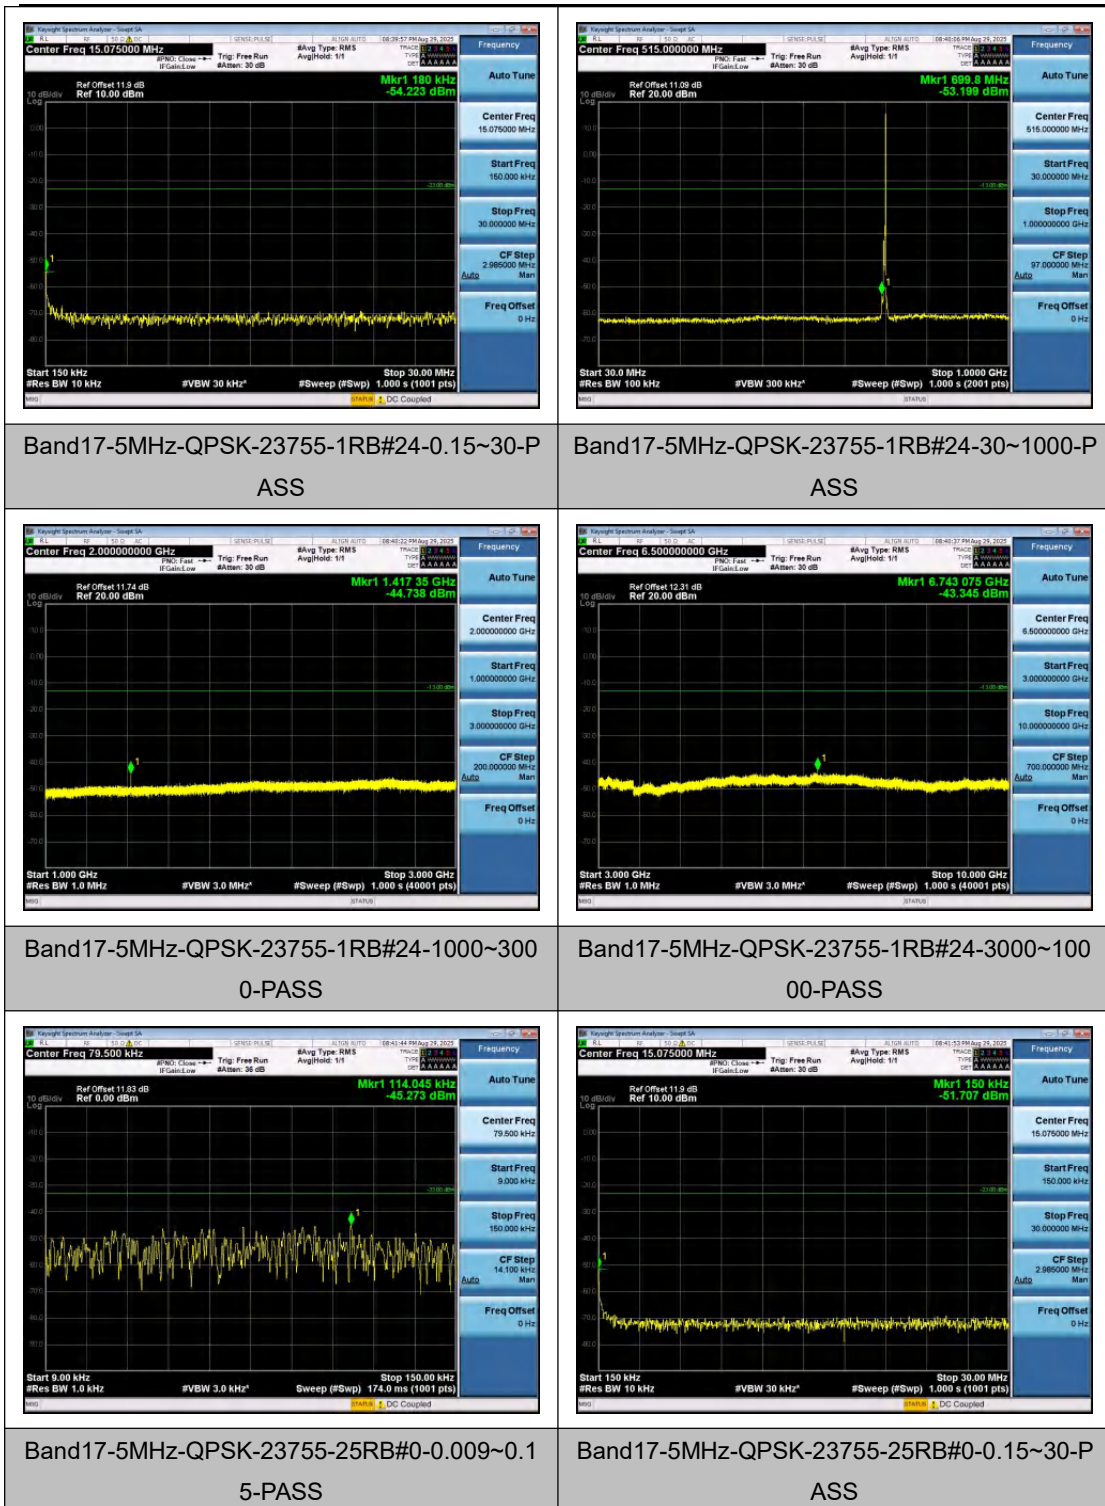


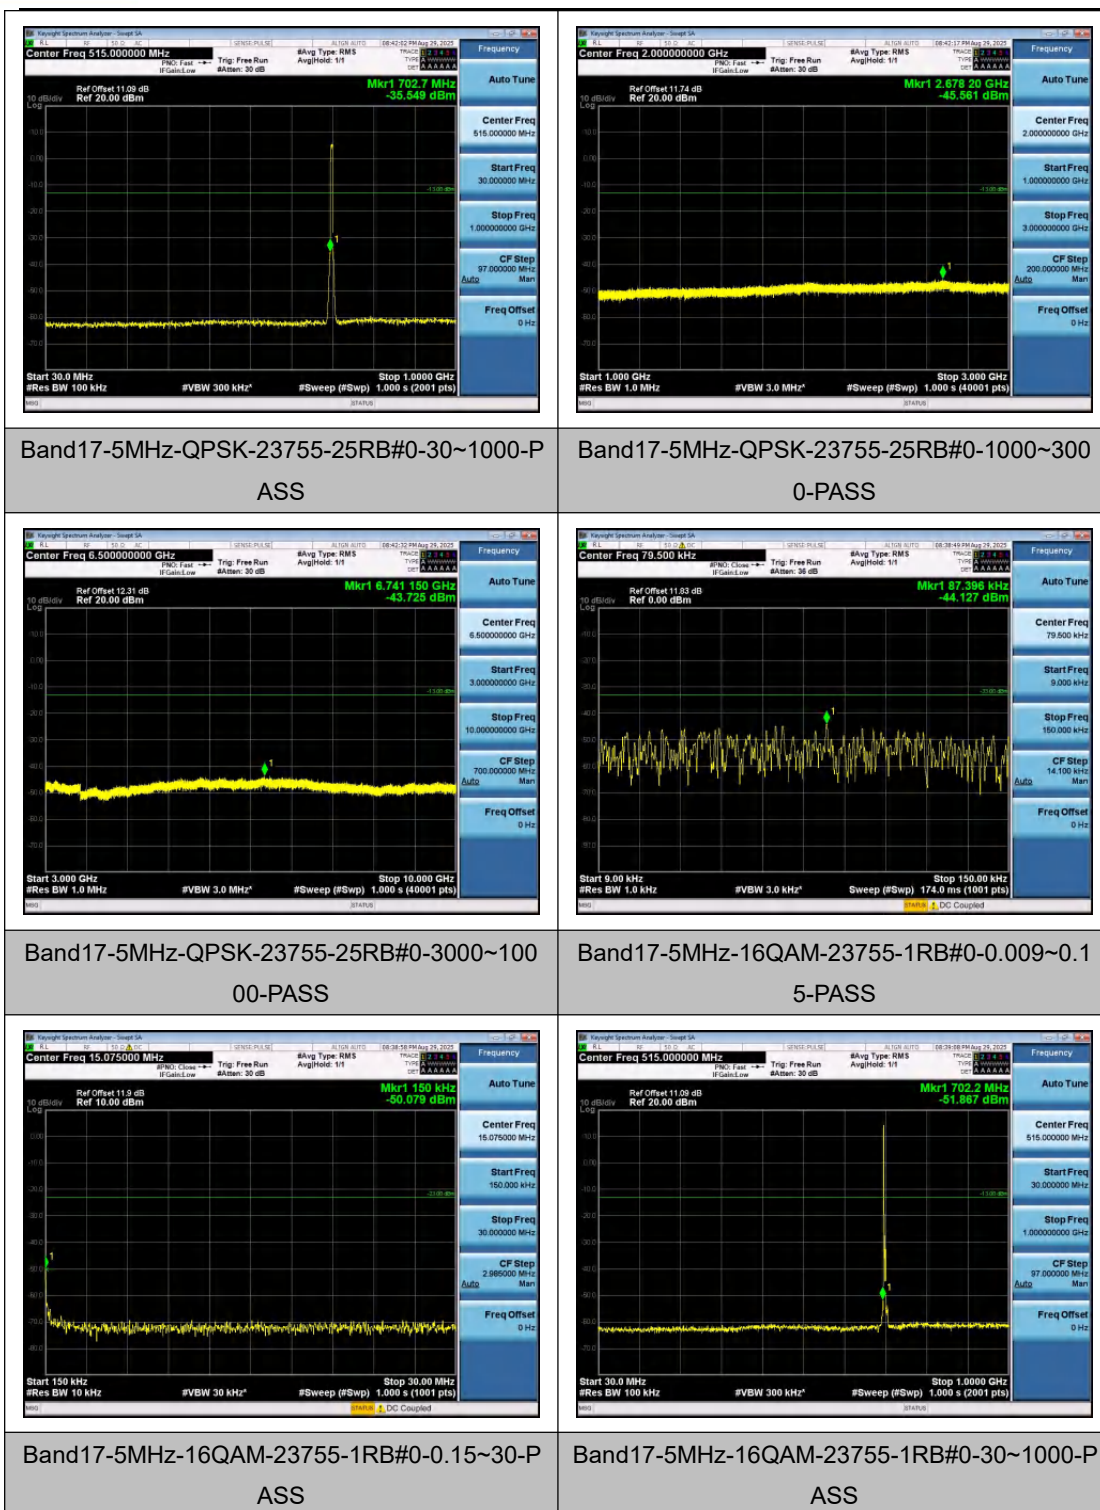


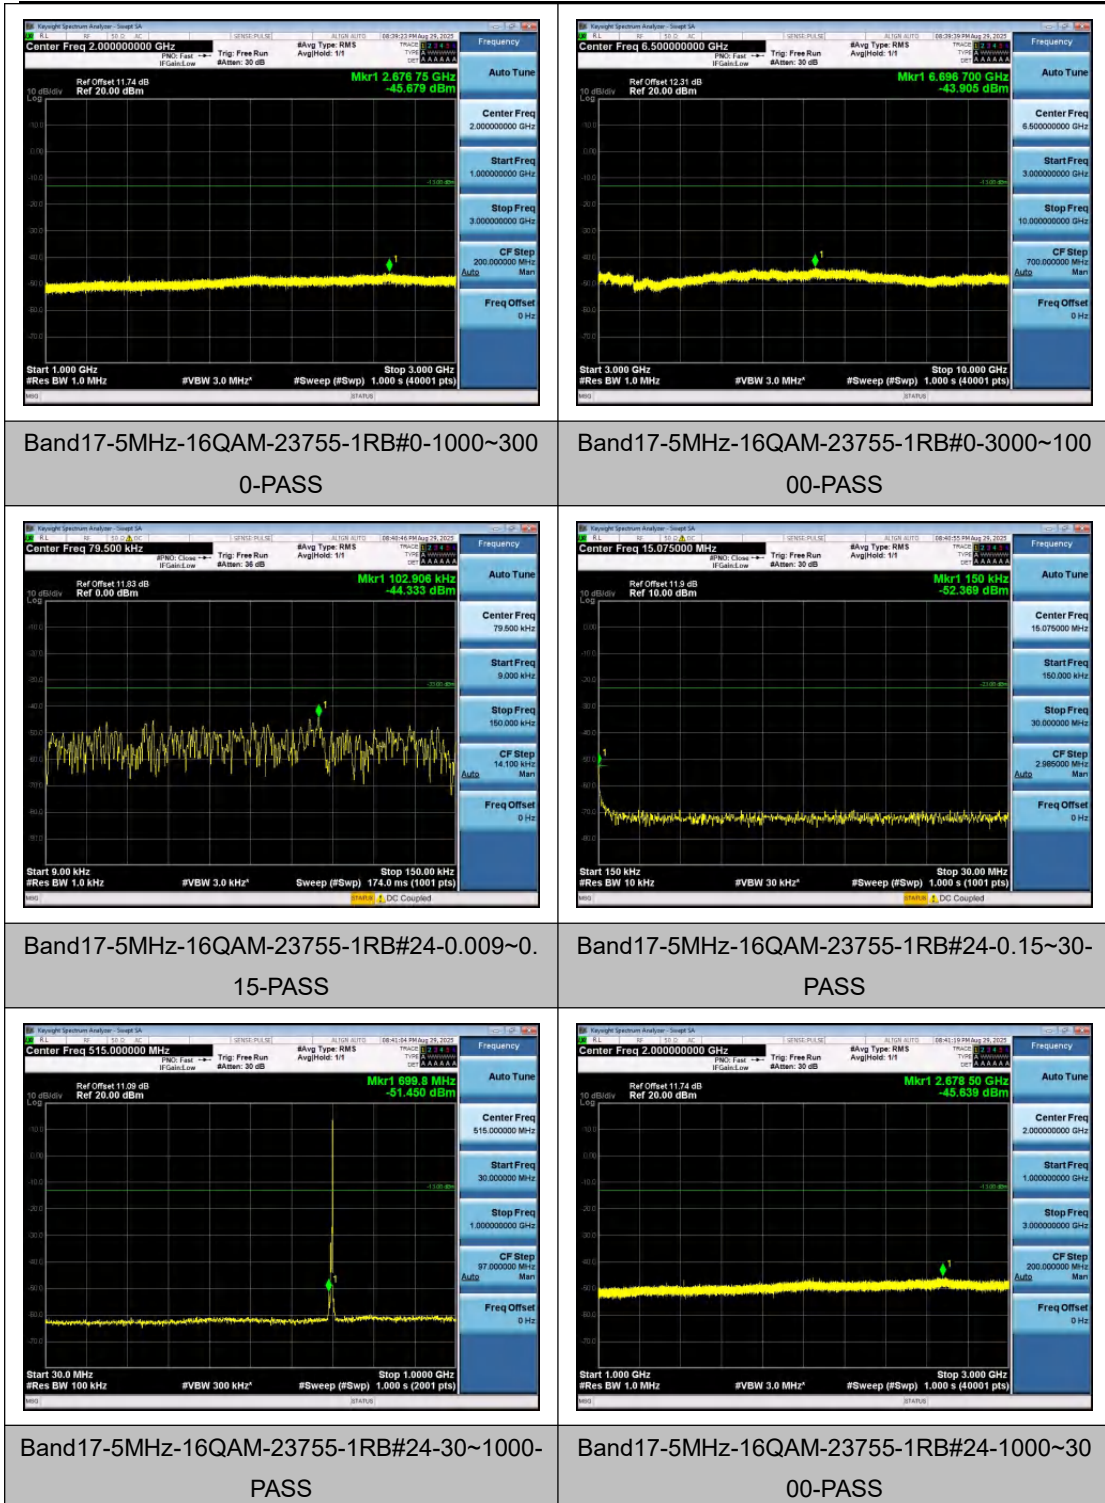


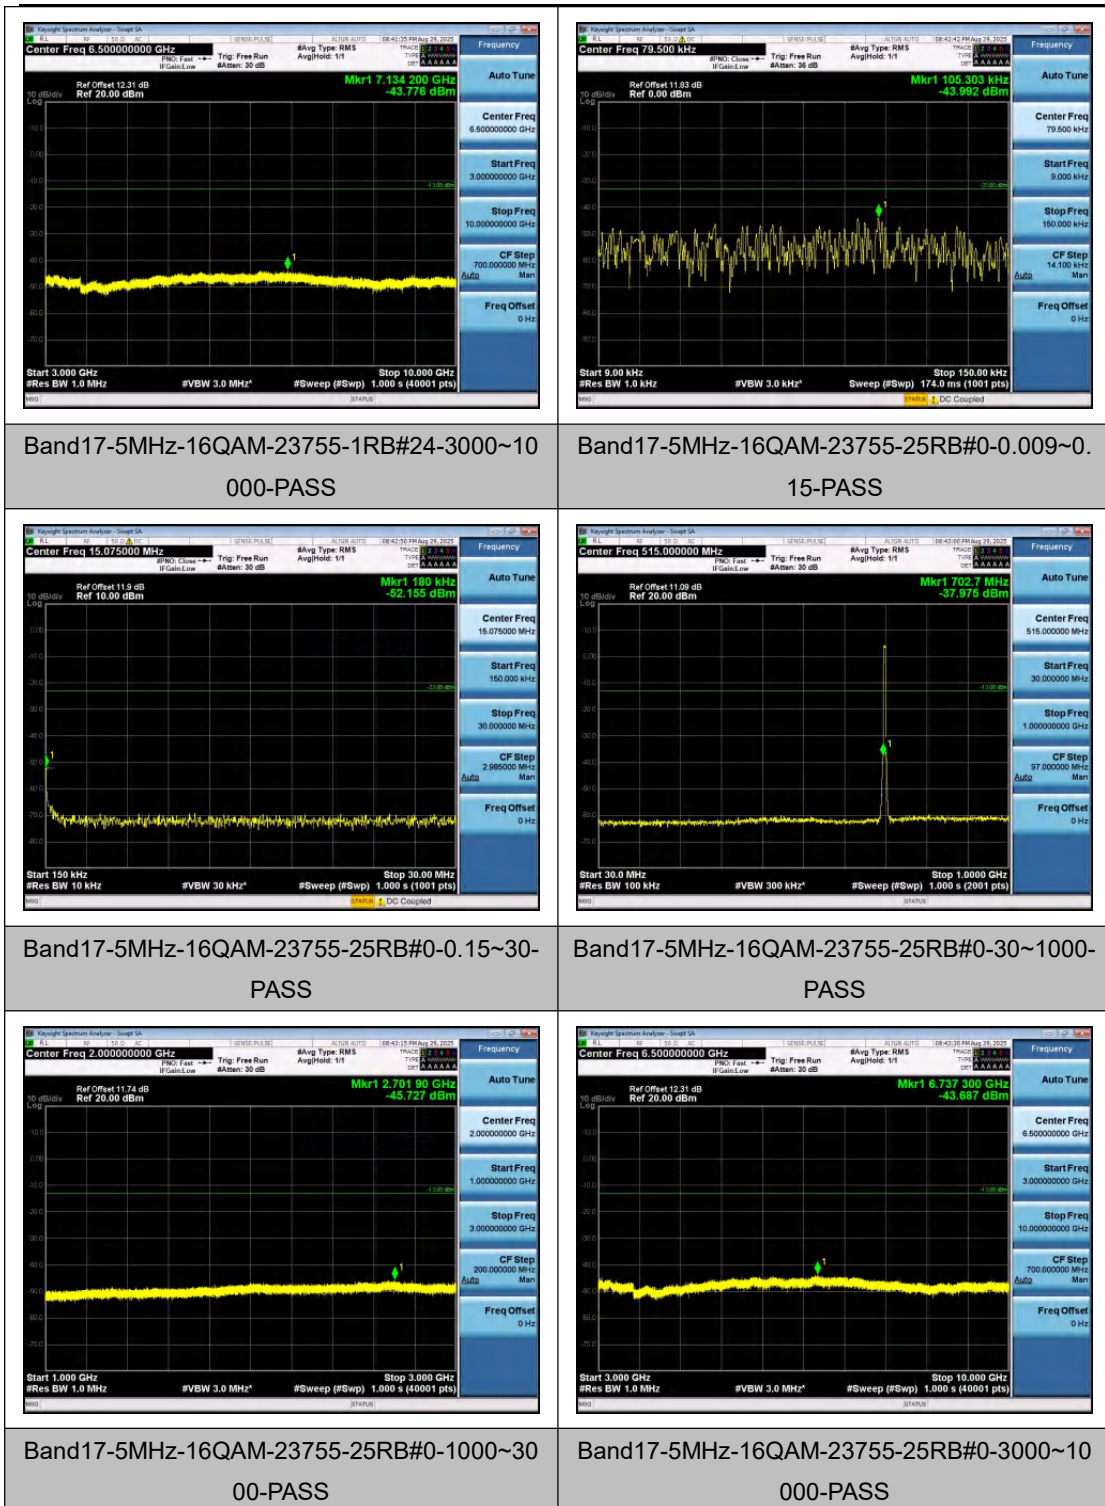


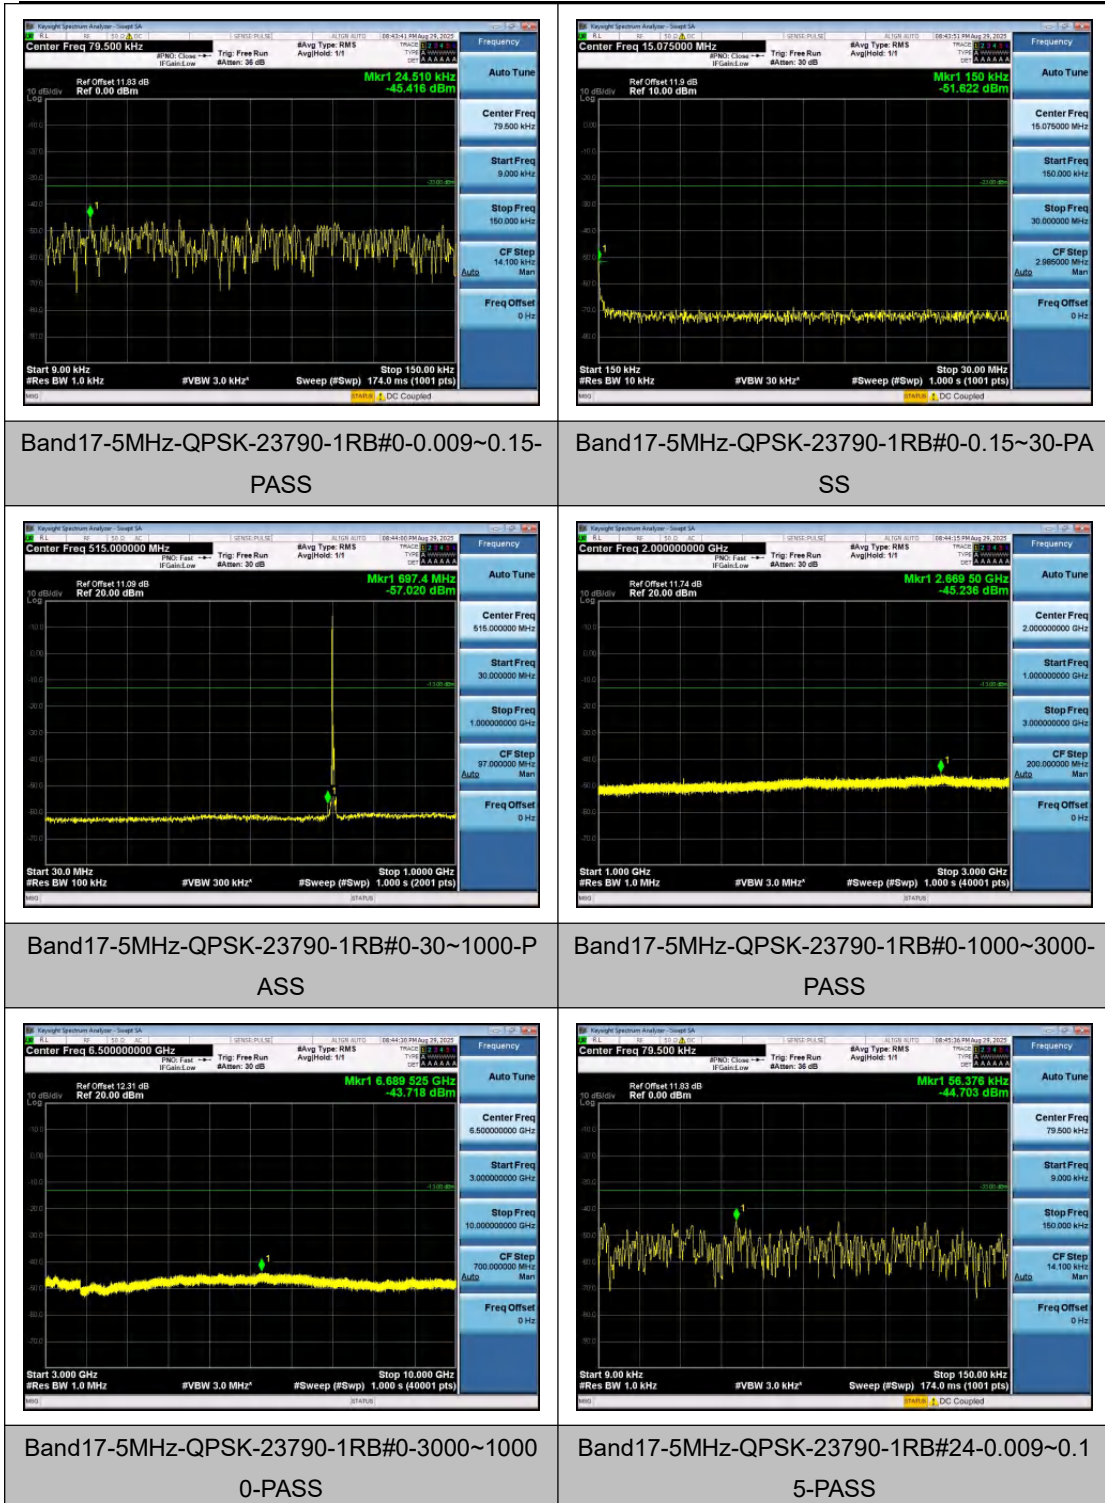

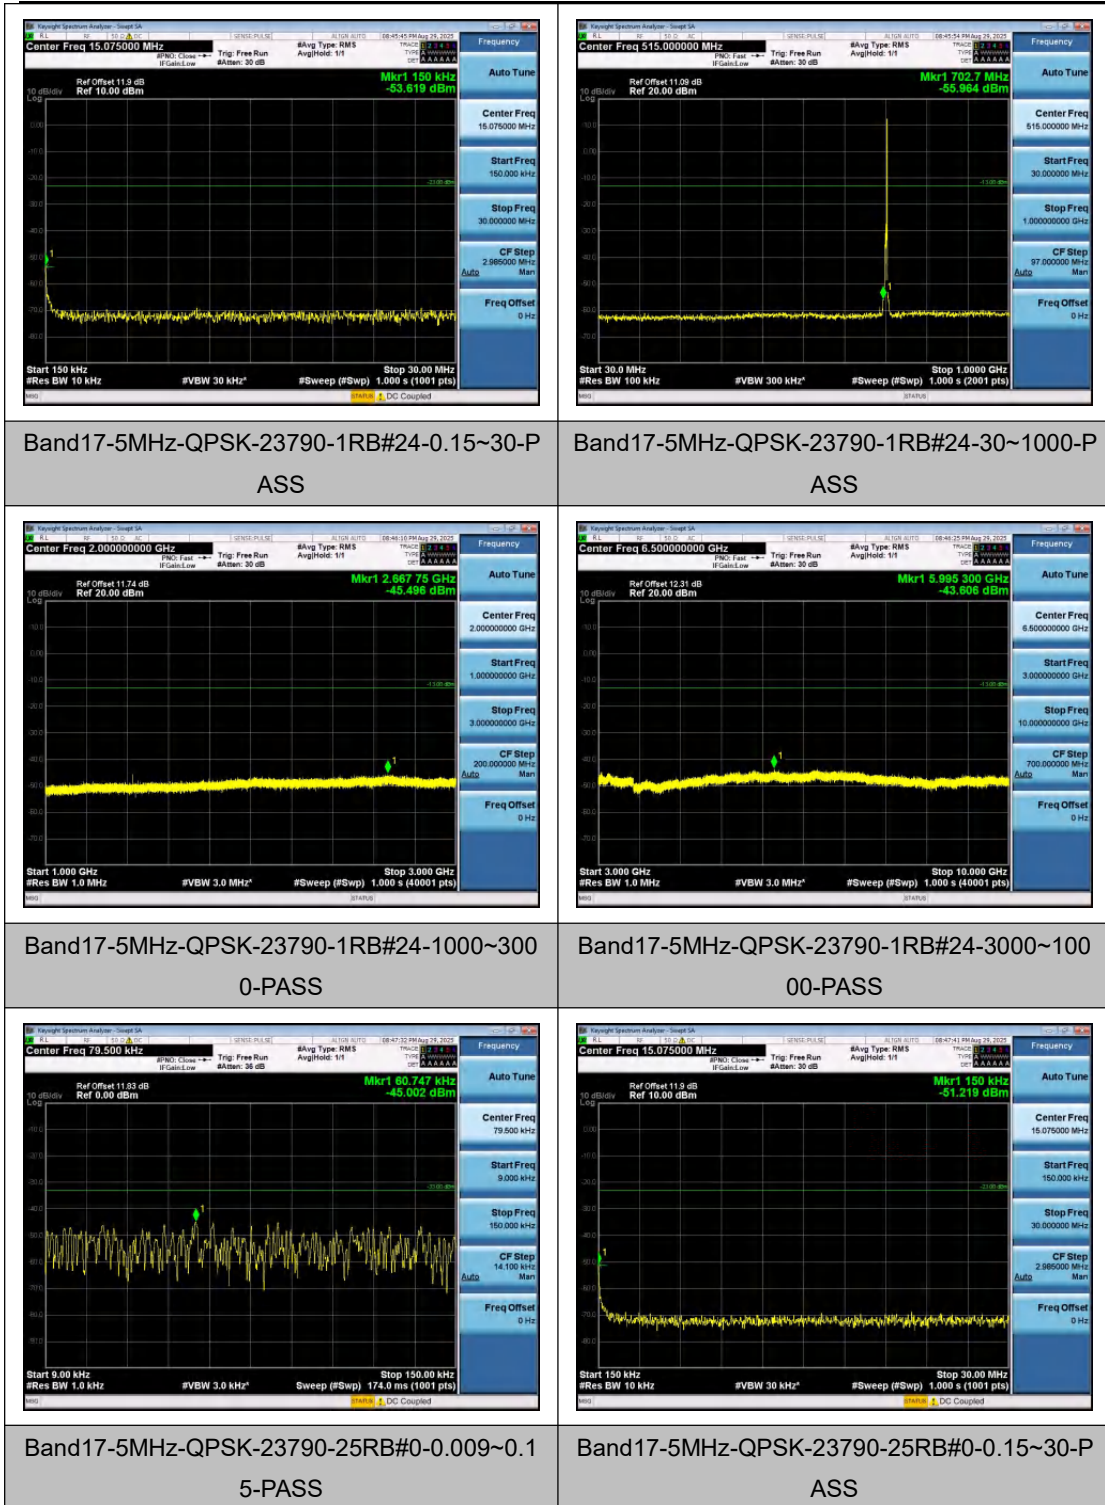


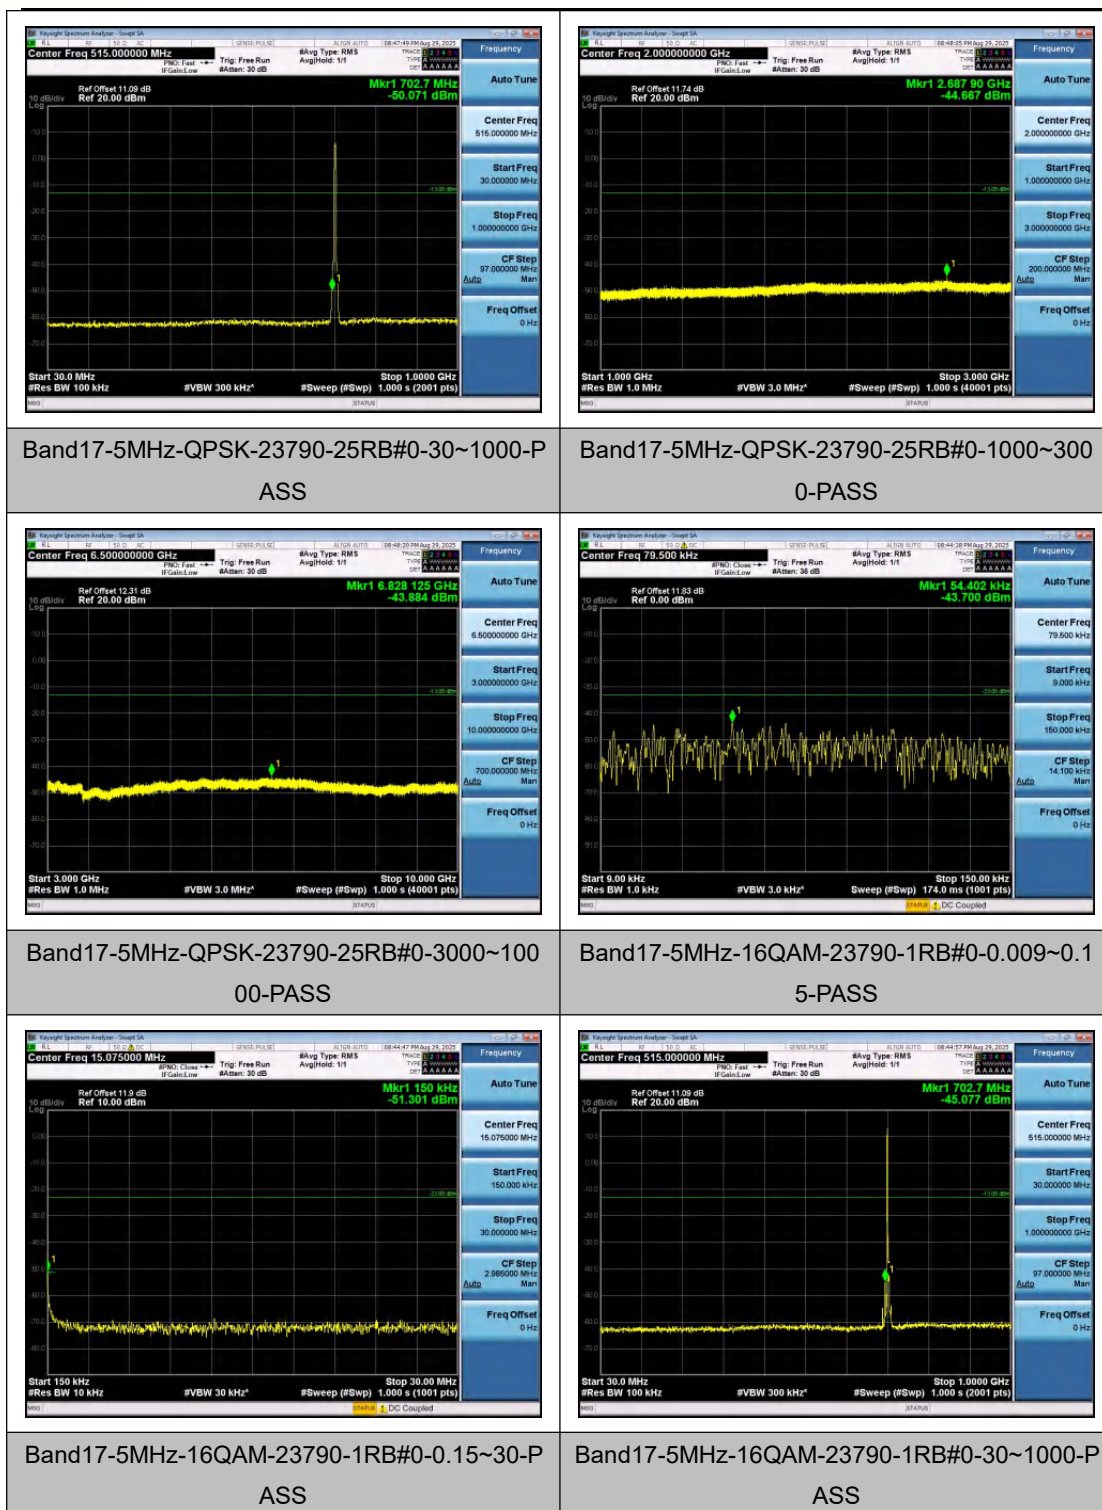


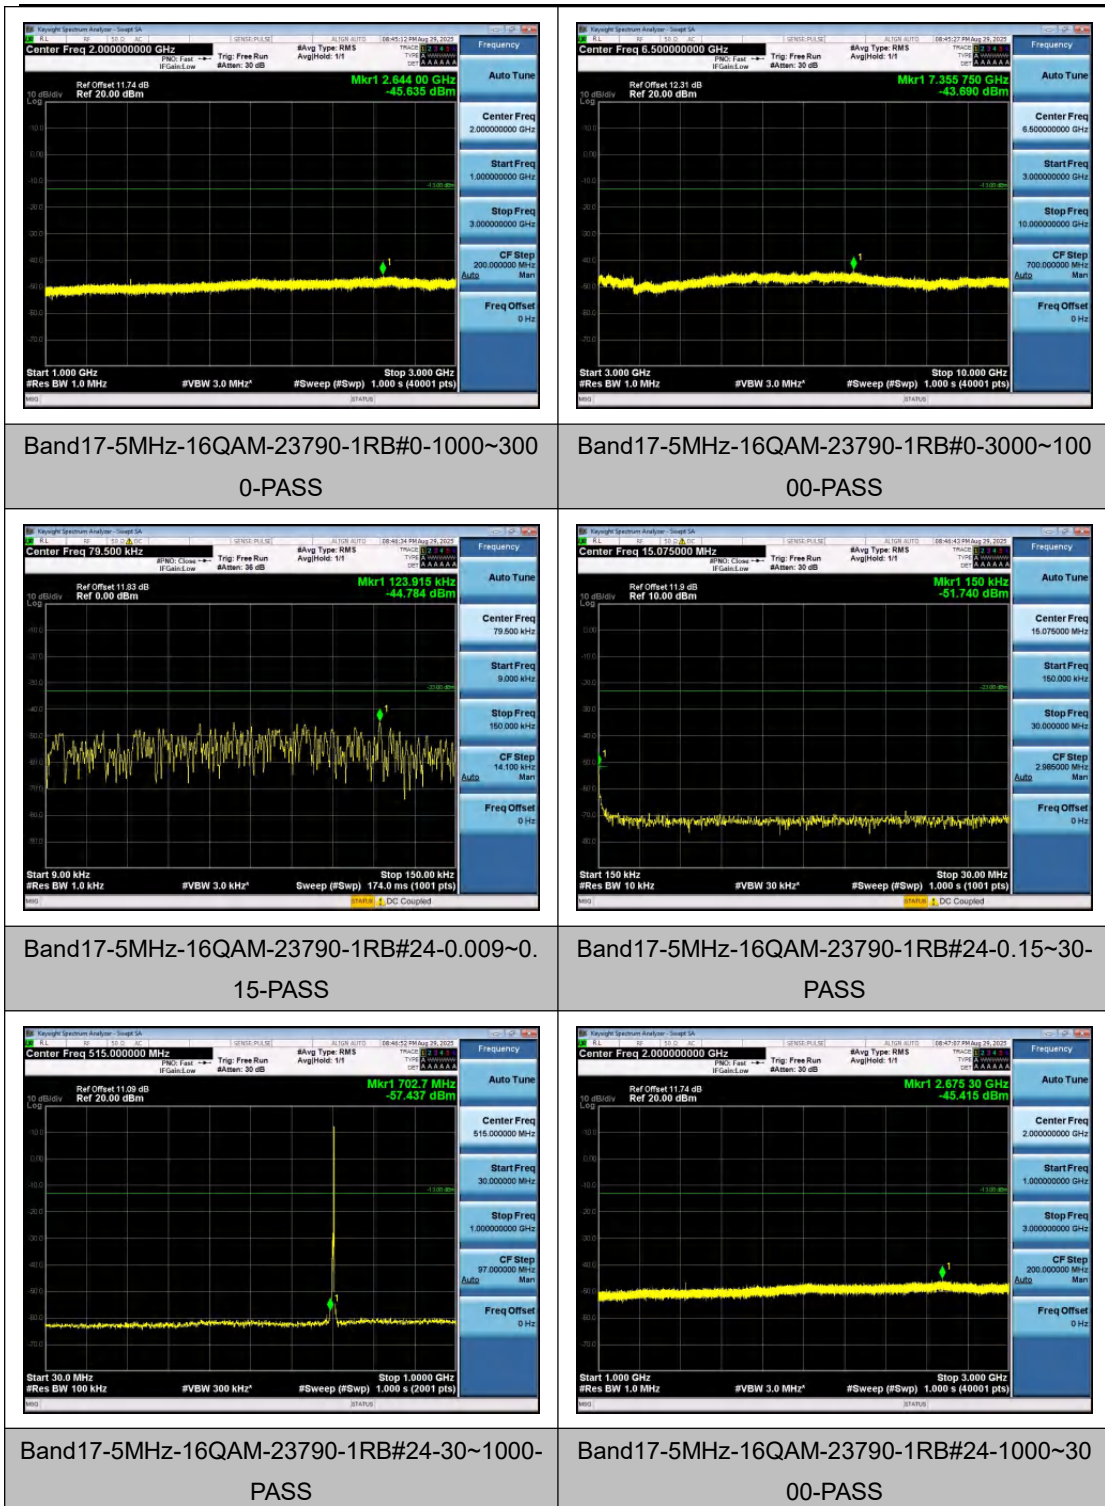


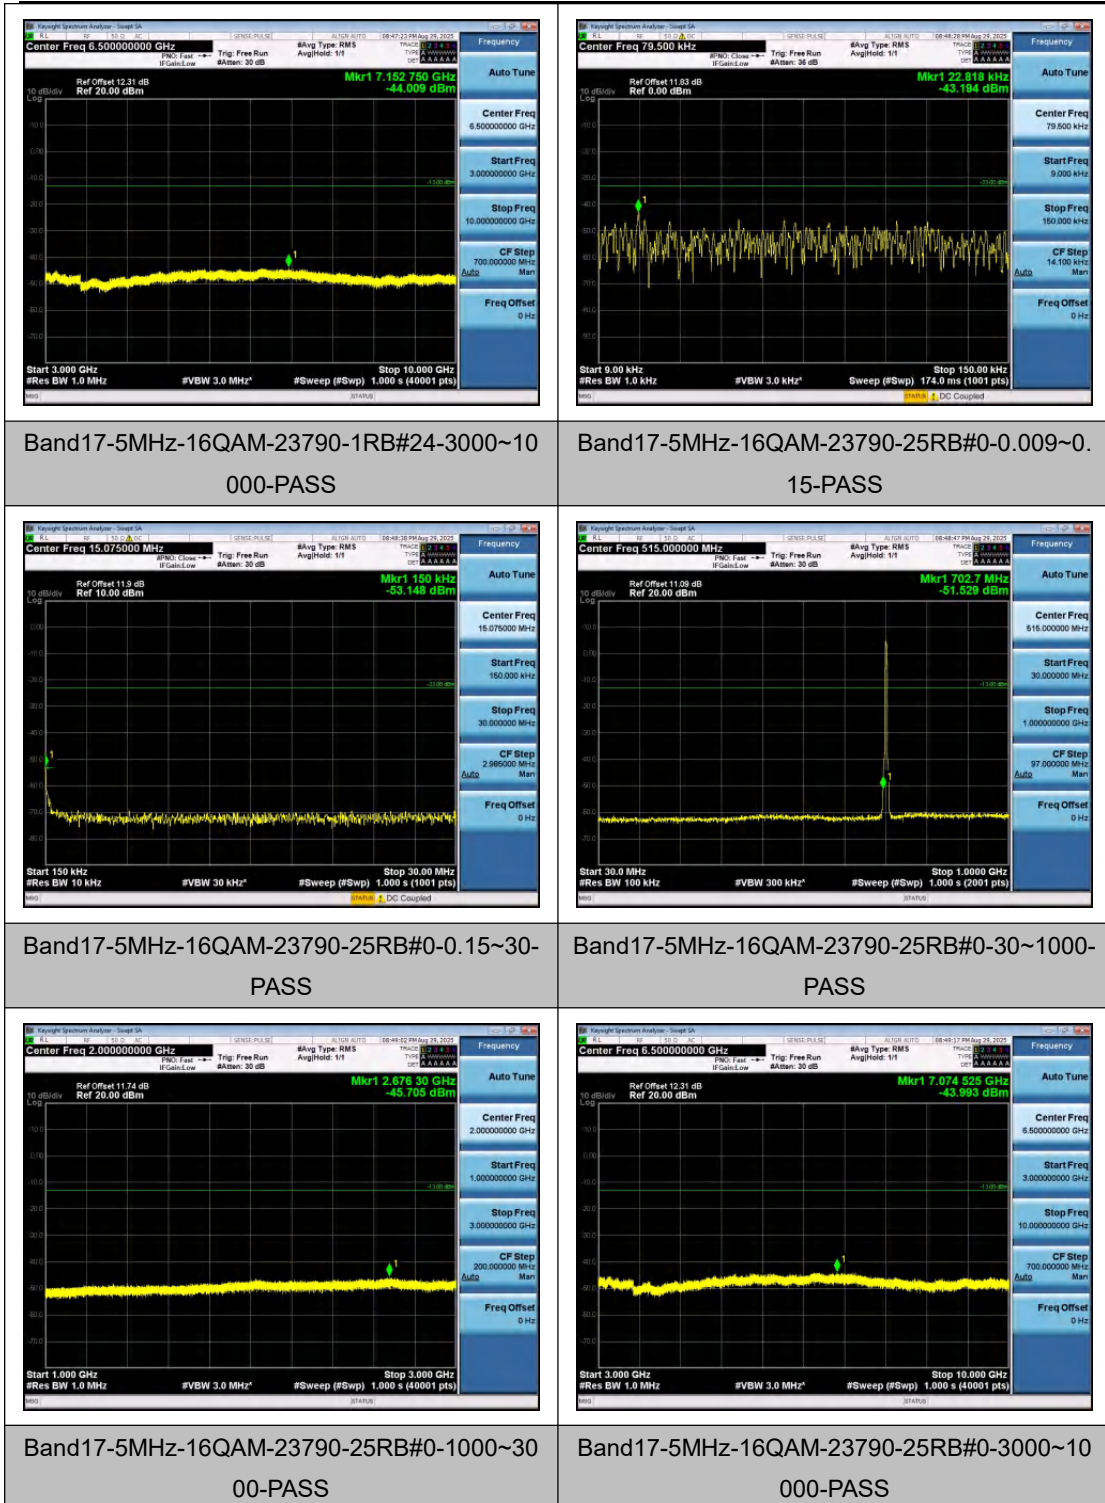



|                                                          |                                                           |
|----------------------------------------------------------|-----------------------------------------------------------|
|                                                          |                                                           |
| <p>Band17-5MHz-QPSK-23825-1RB#0-0.009~0.15-<br/>PASS</p> | <p>Band17-5MHz-QPSK-23825-1RB#0-0.15~30-PA<br/>SS</p>     |
|                                                          |                                                           |
| <p>Band17-5MHz-QPSK-23825-1RB#0-30~1000-P<br/>ASS</p>    | <p>Band17-5MHz-QPSK-23825-1RB#0-1000~3000-<br/>PASS</p>   |
|                                                          |                                                           |
| <p>Band17-5MHz-QPSK-23825-1RB#0-3000~1000<br/>0-PASS</p> | <p>Band17-5MHz-QPSK-23825-1RB#24-0.009~0.1<br/>5-PASS</p> |

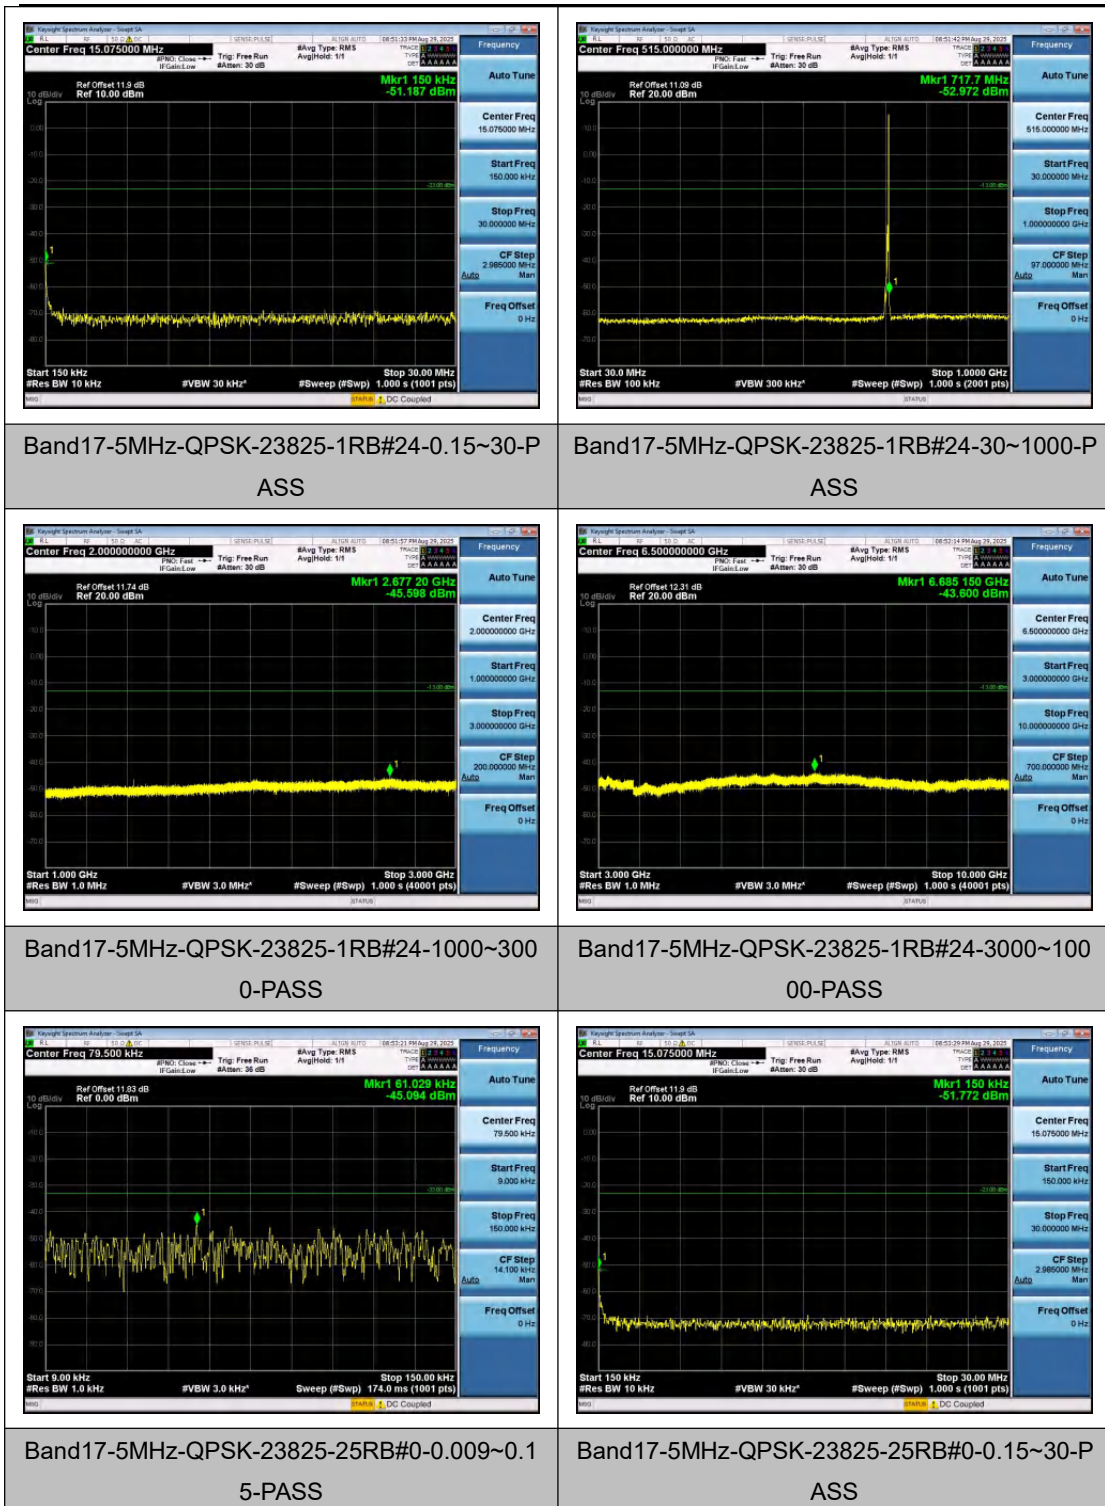


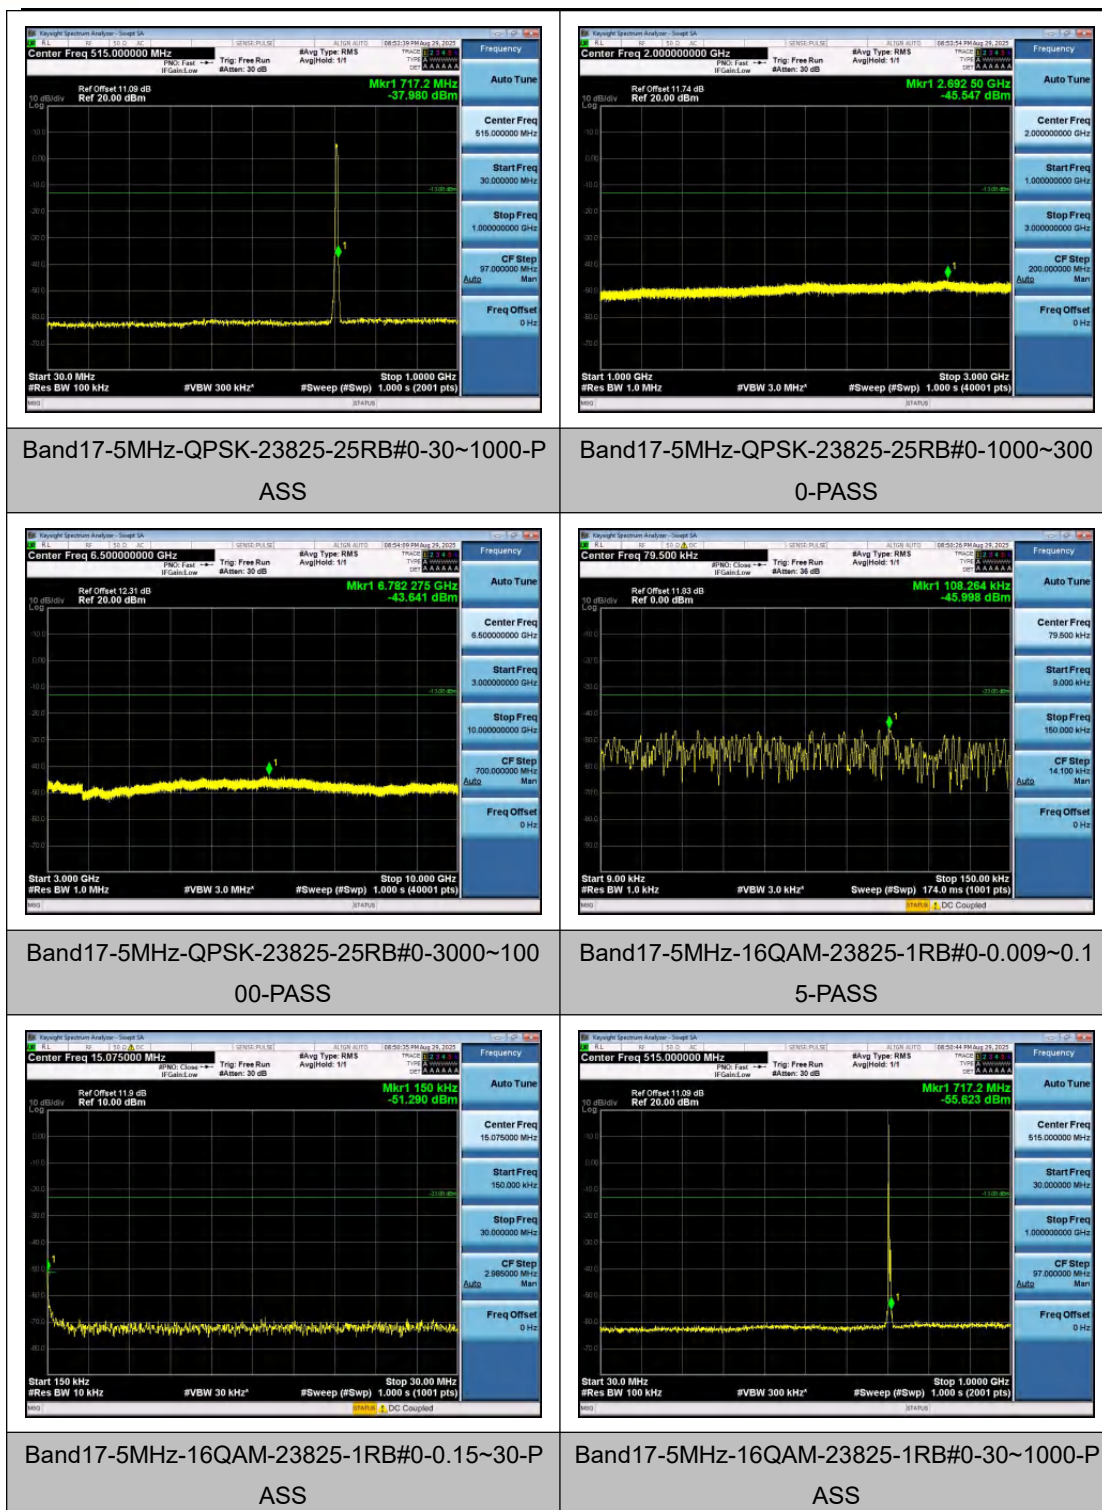


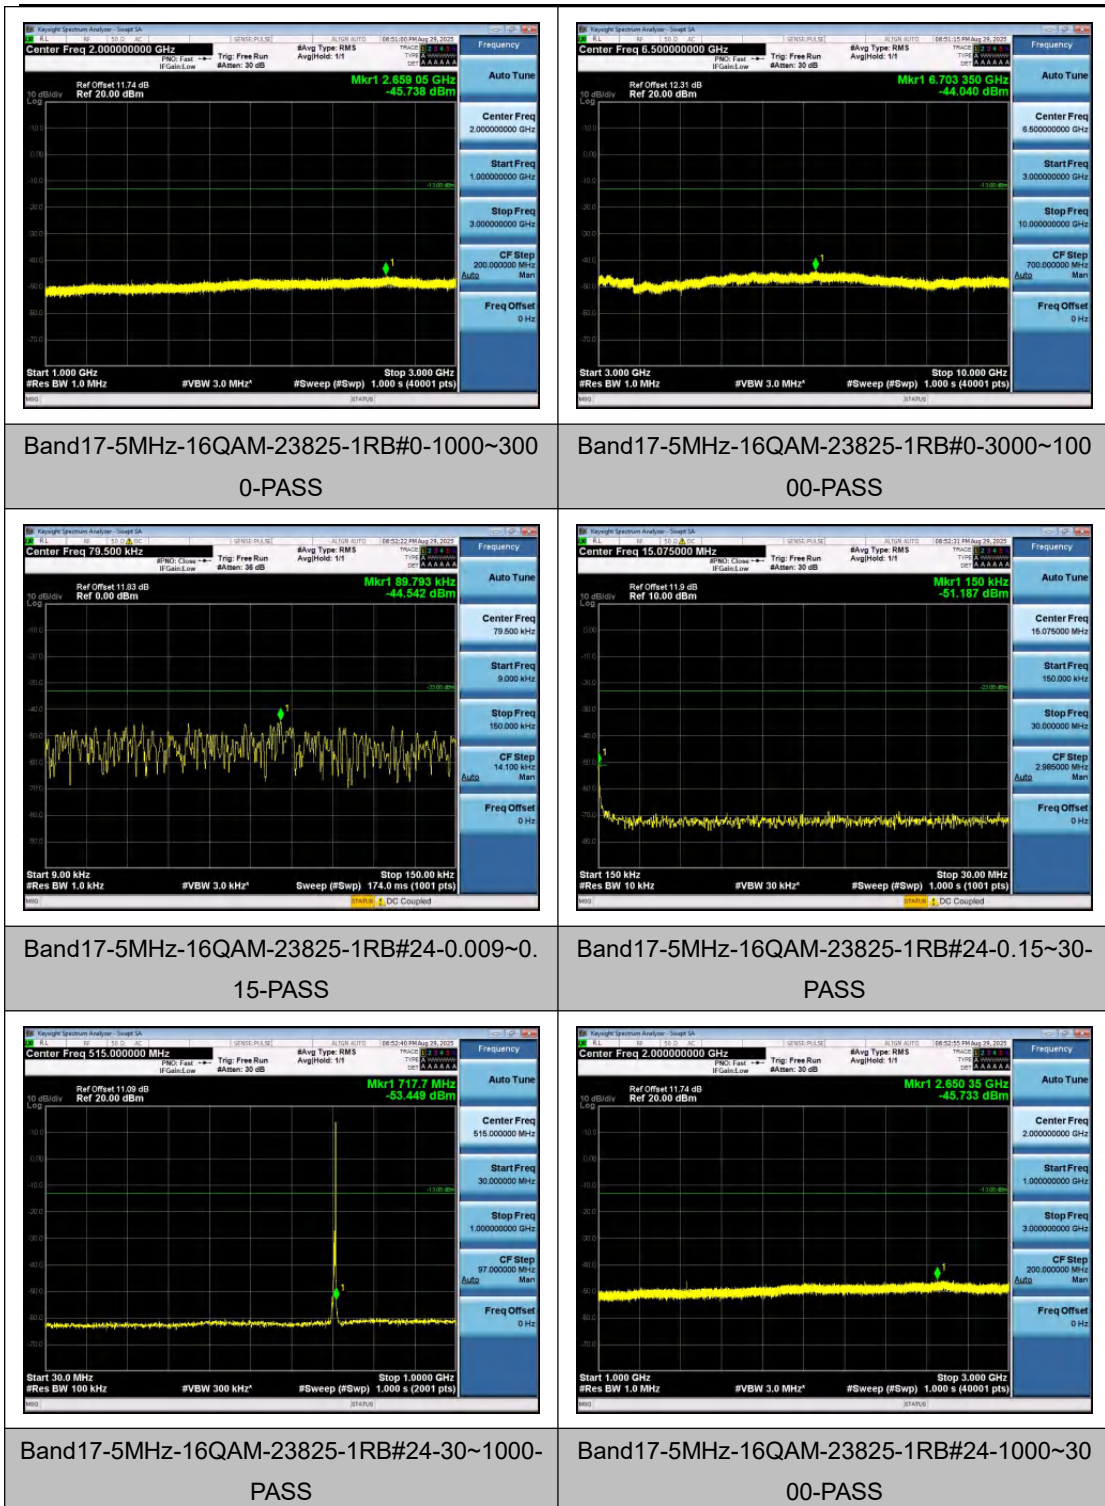


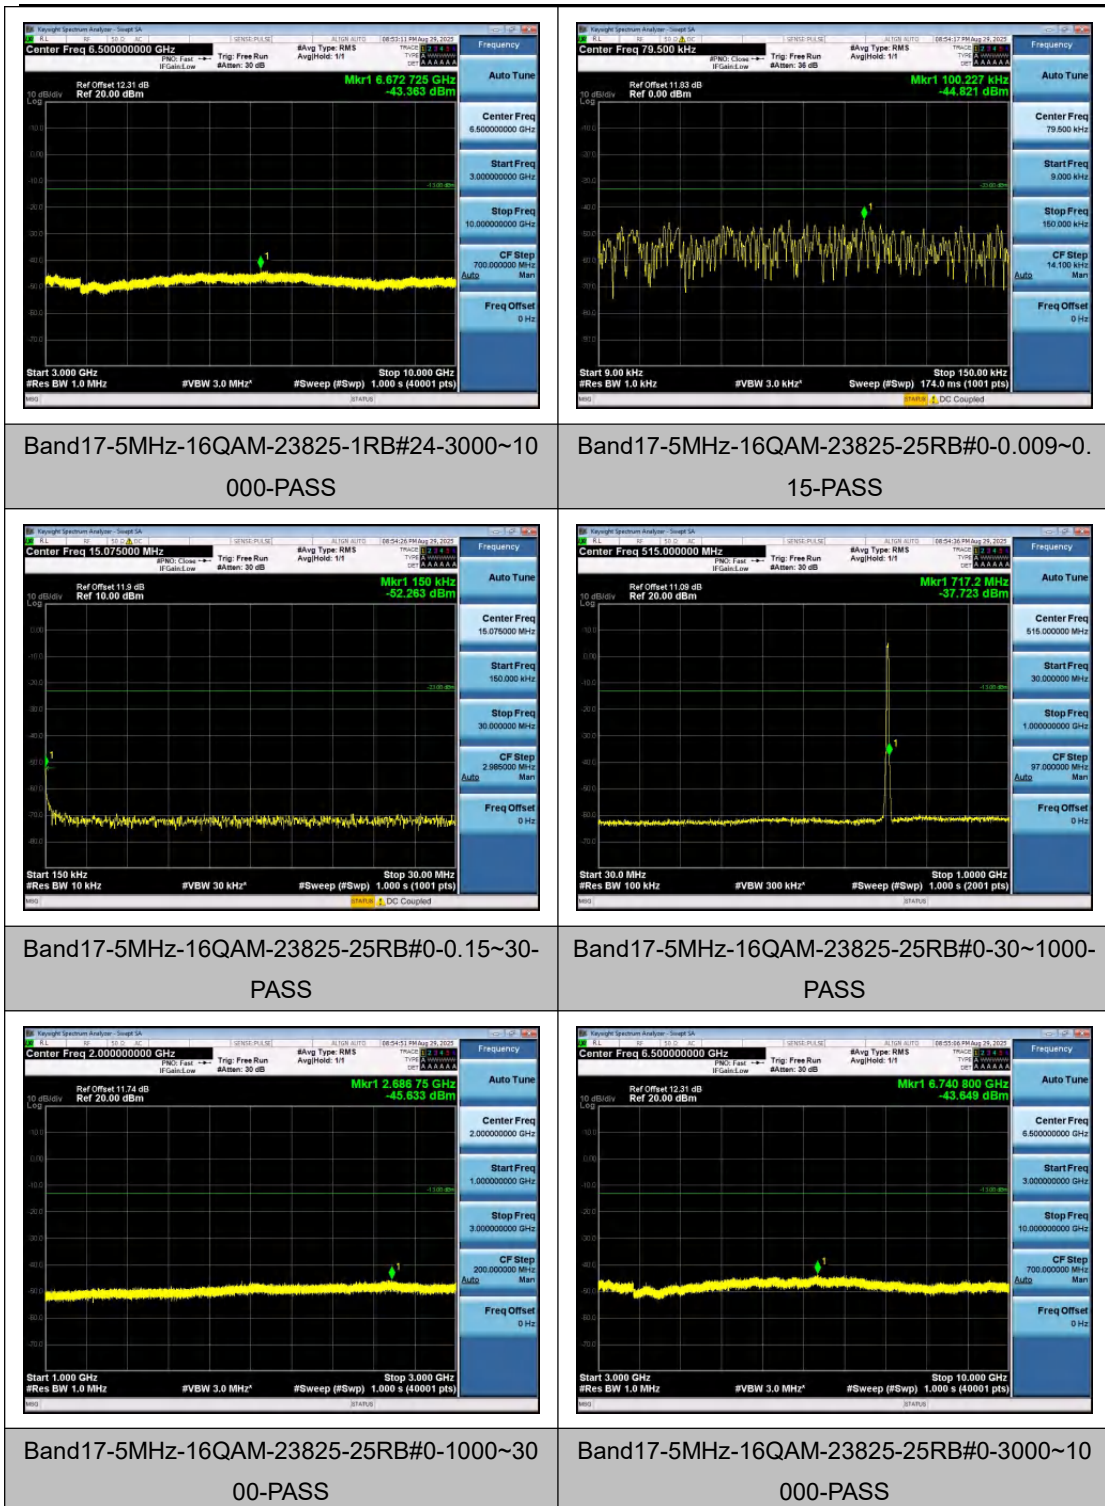


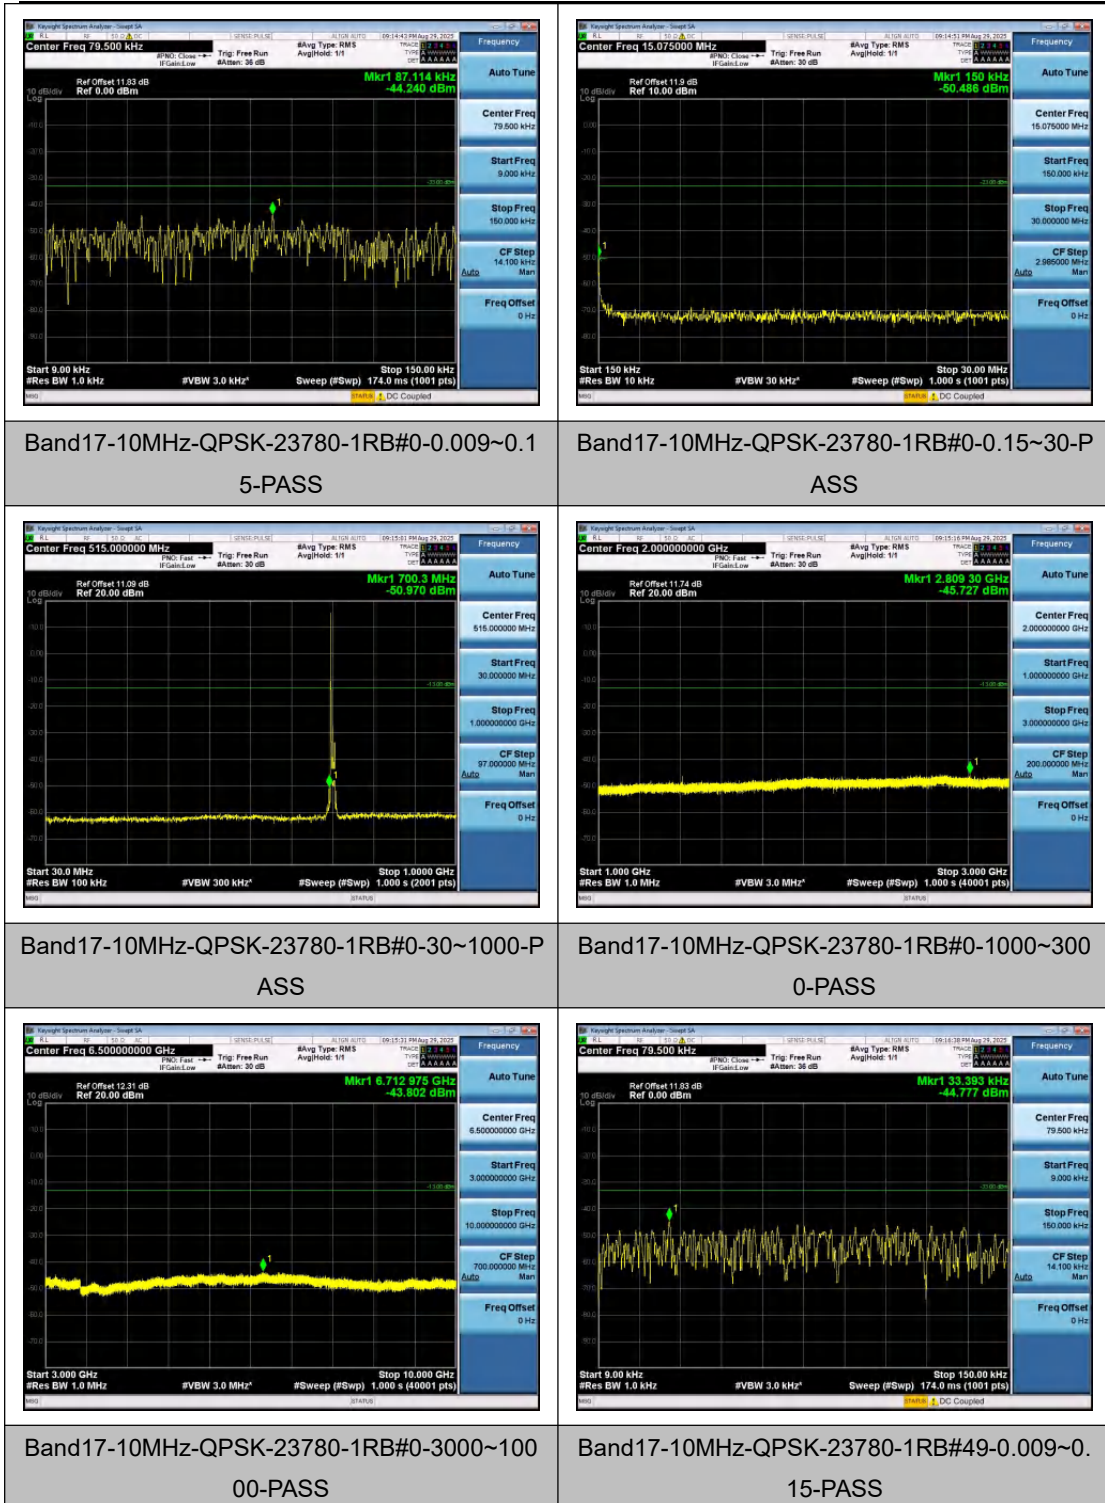


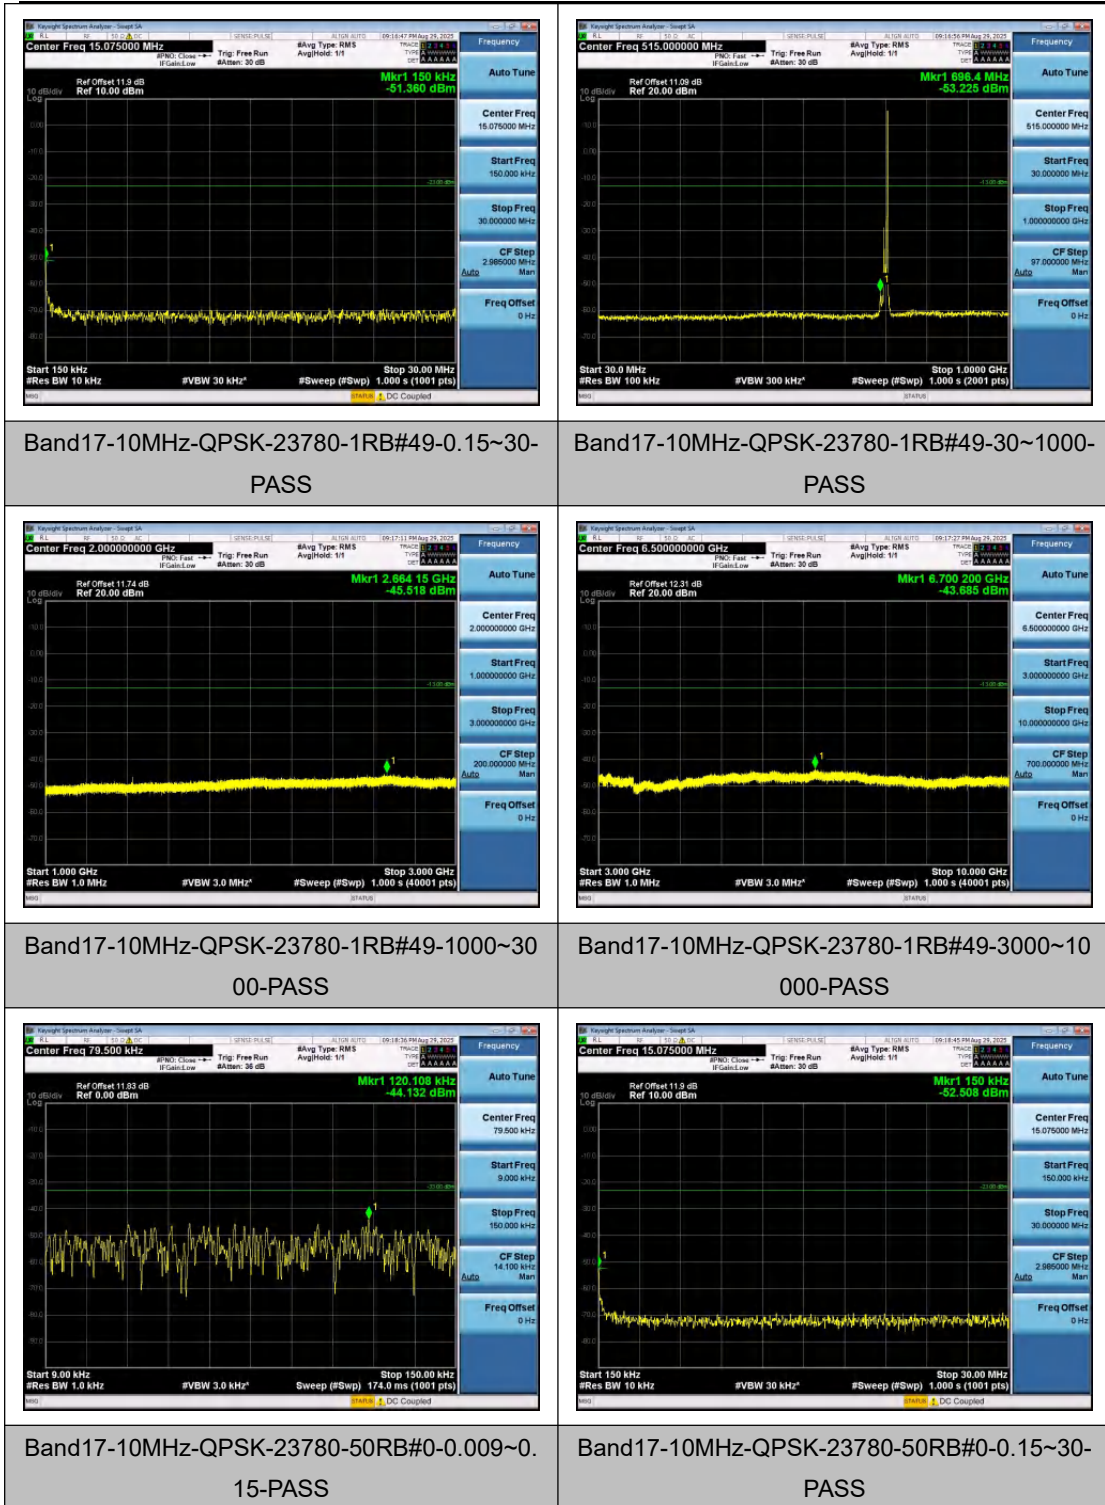


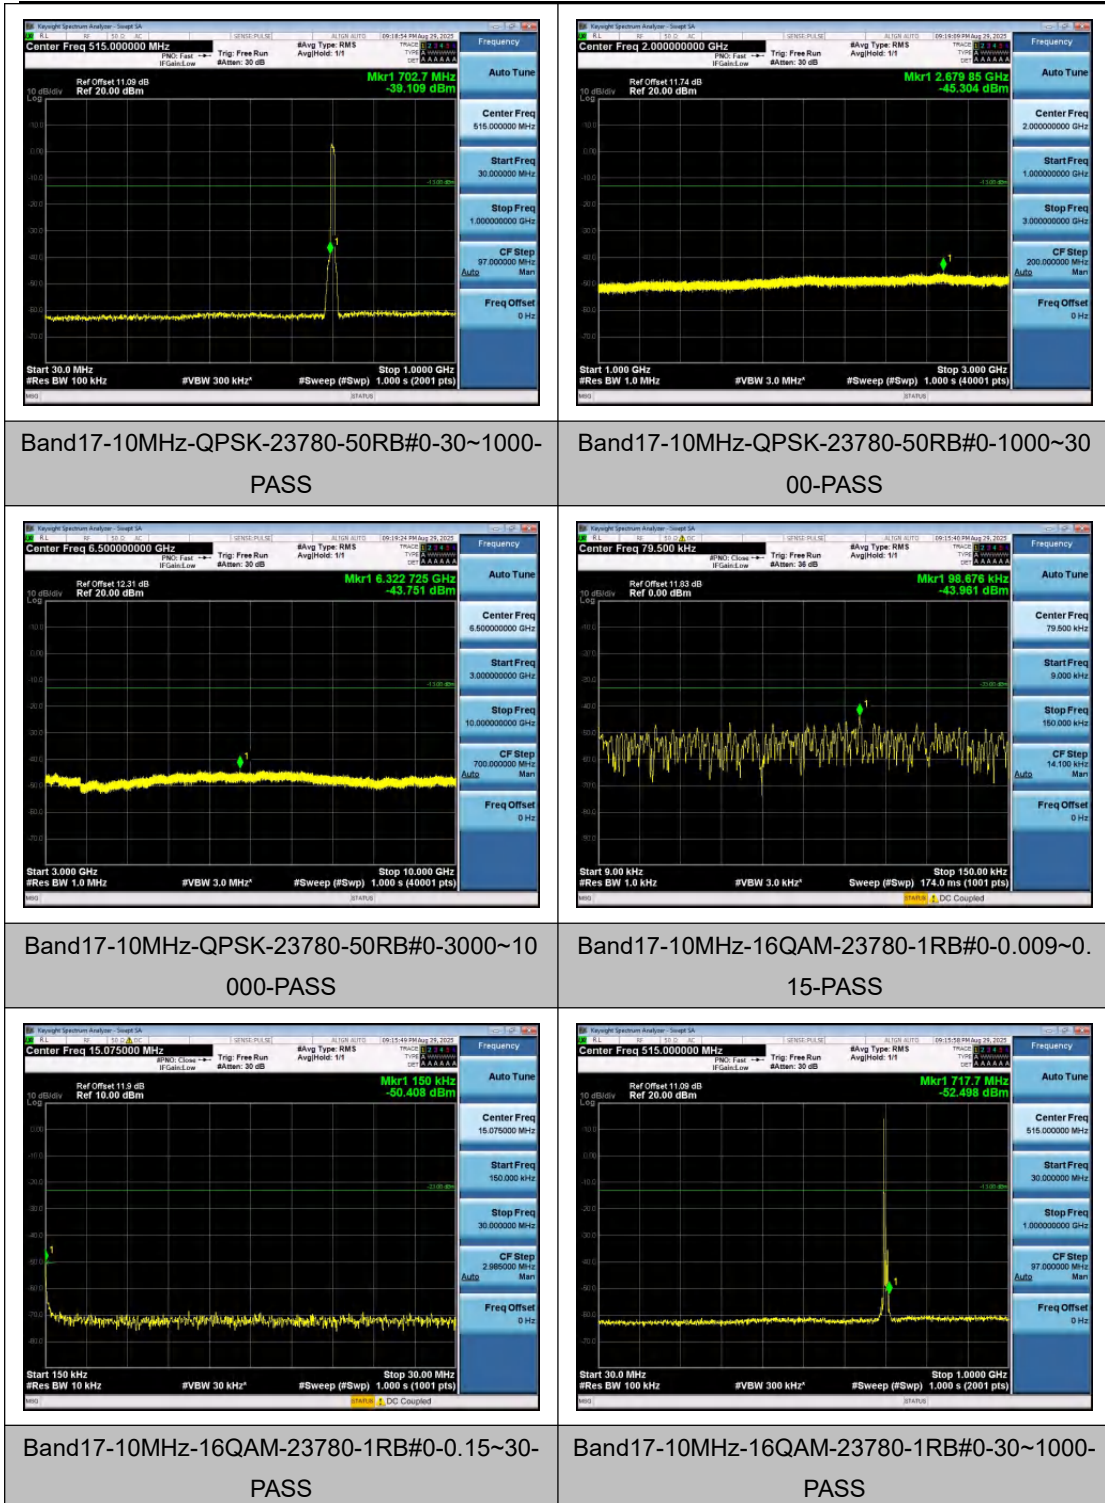


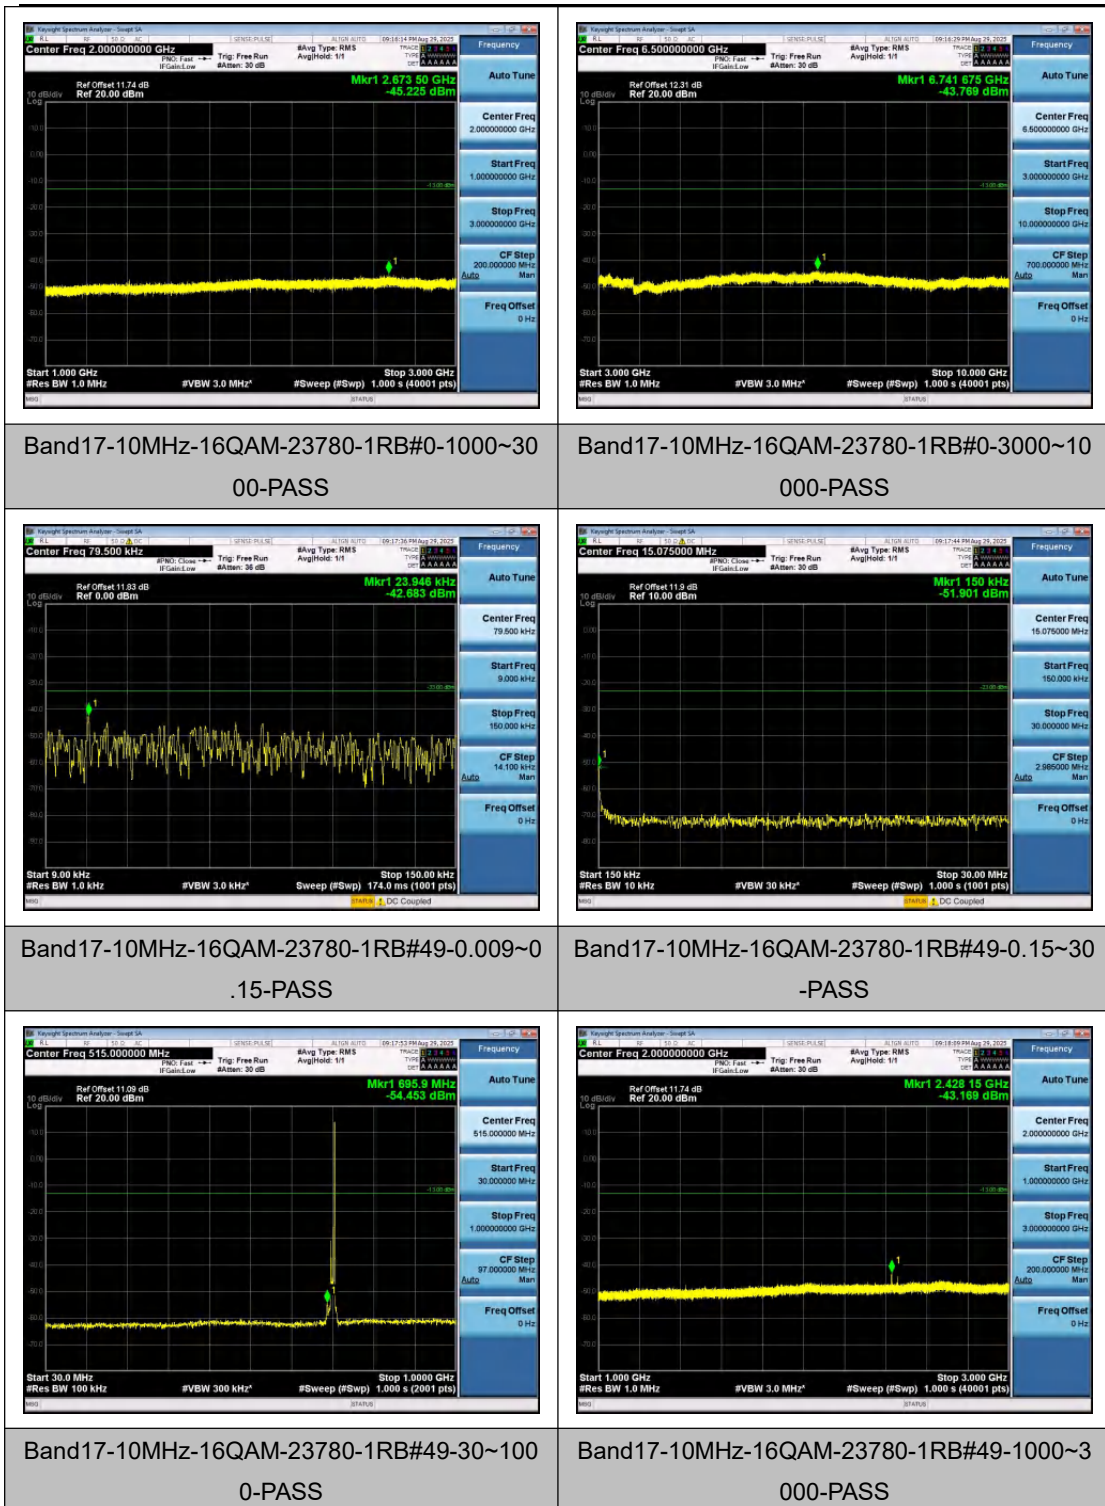


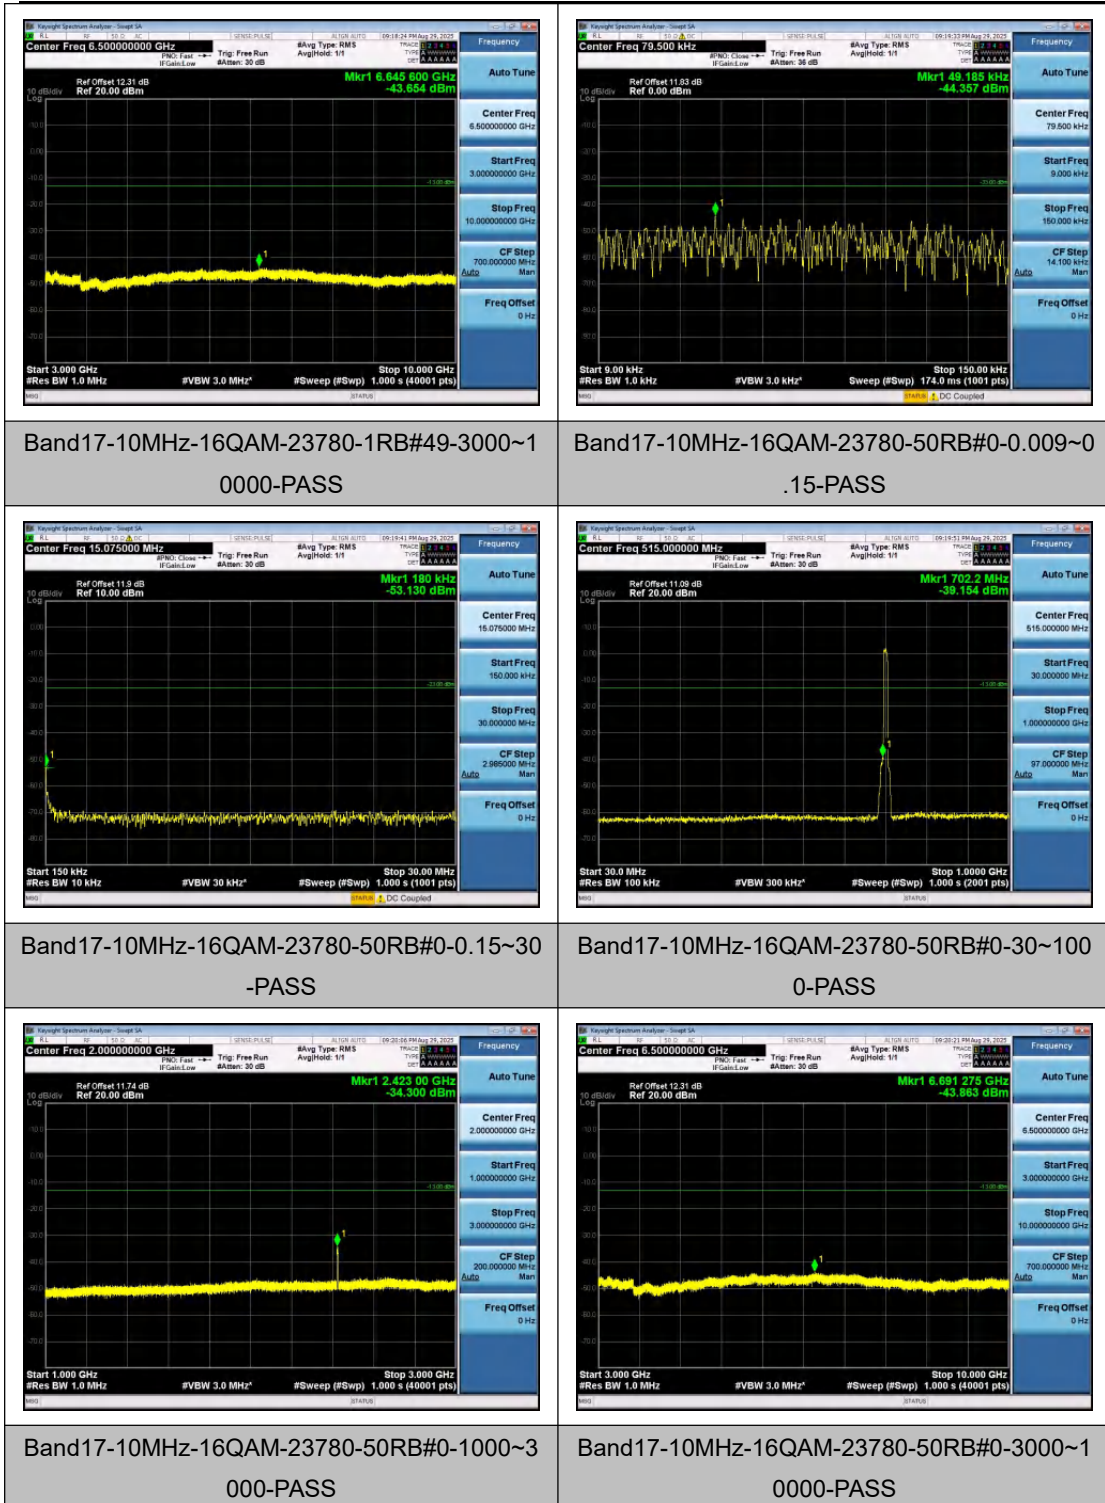


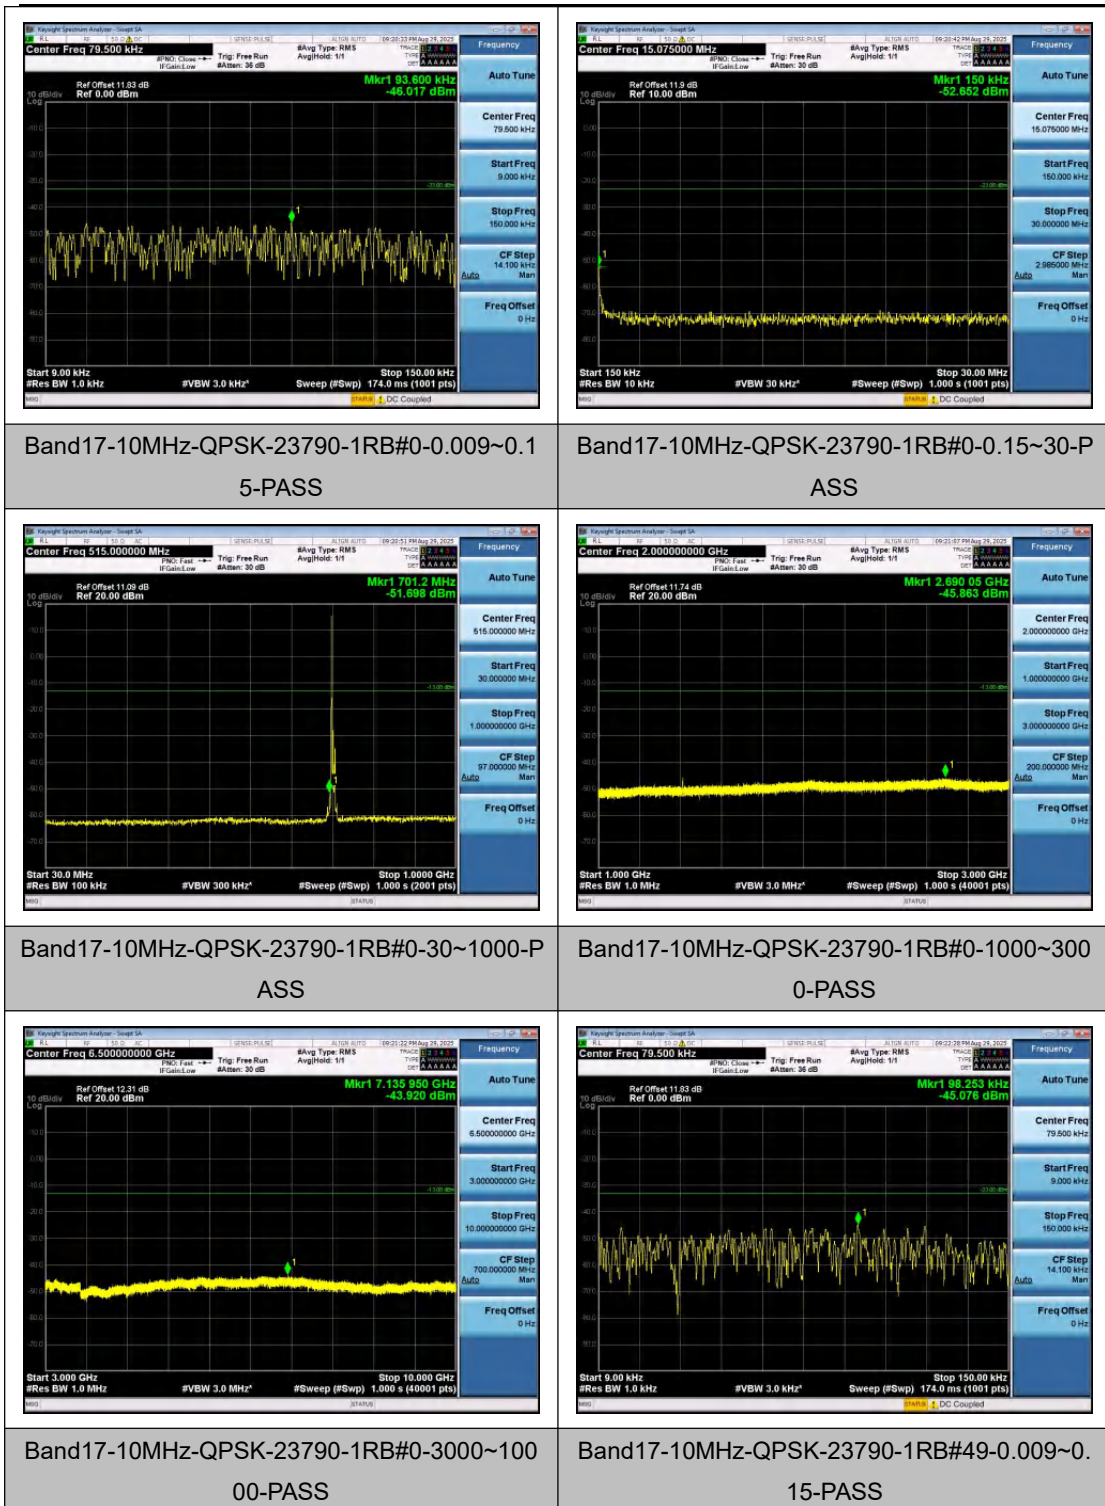


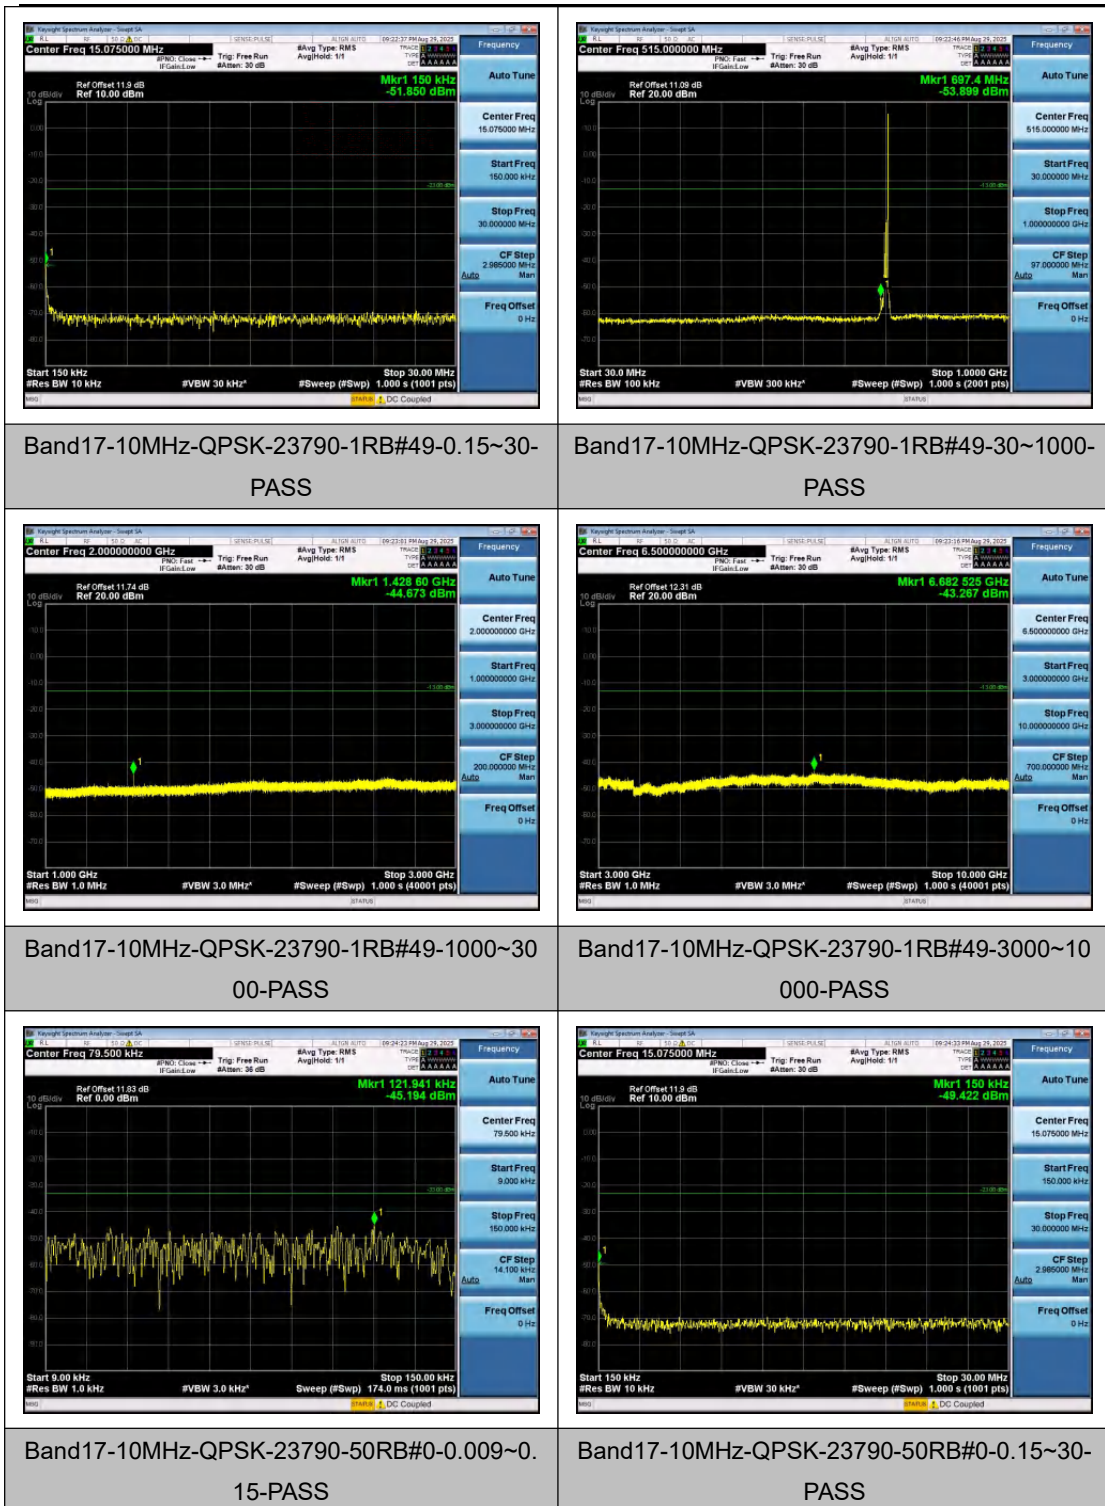


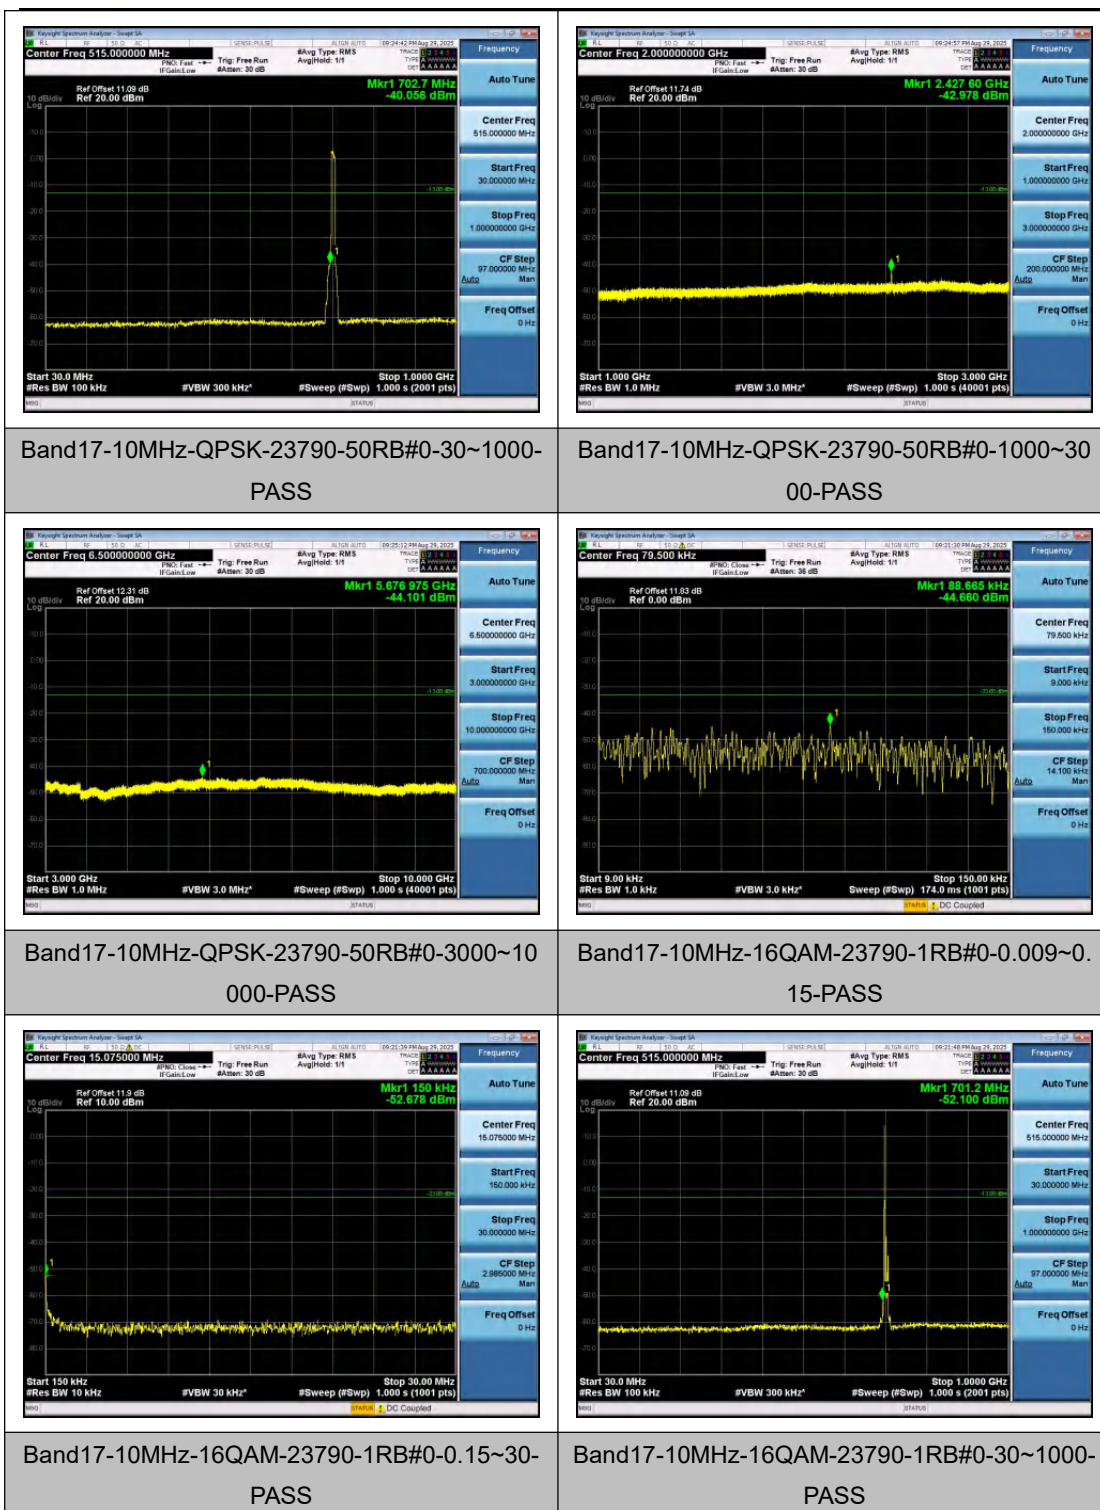


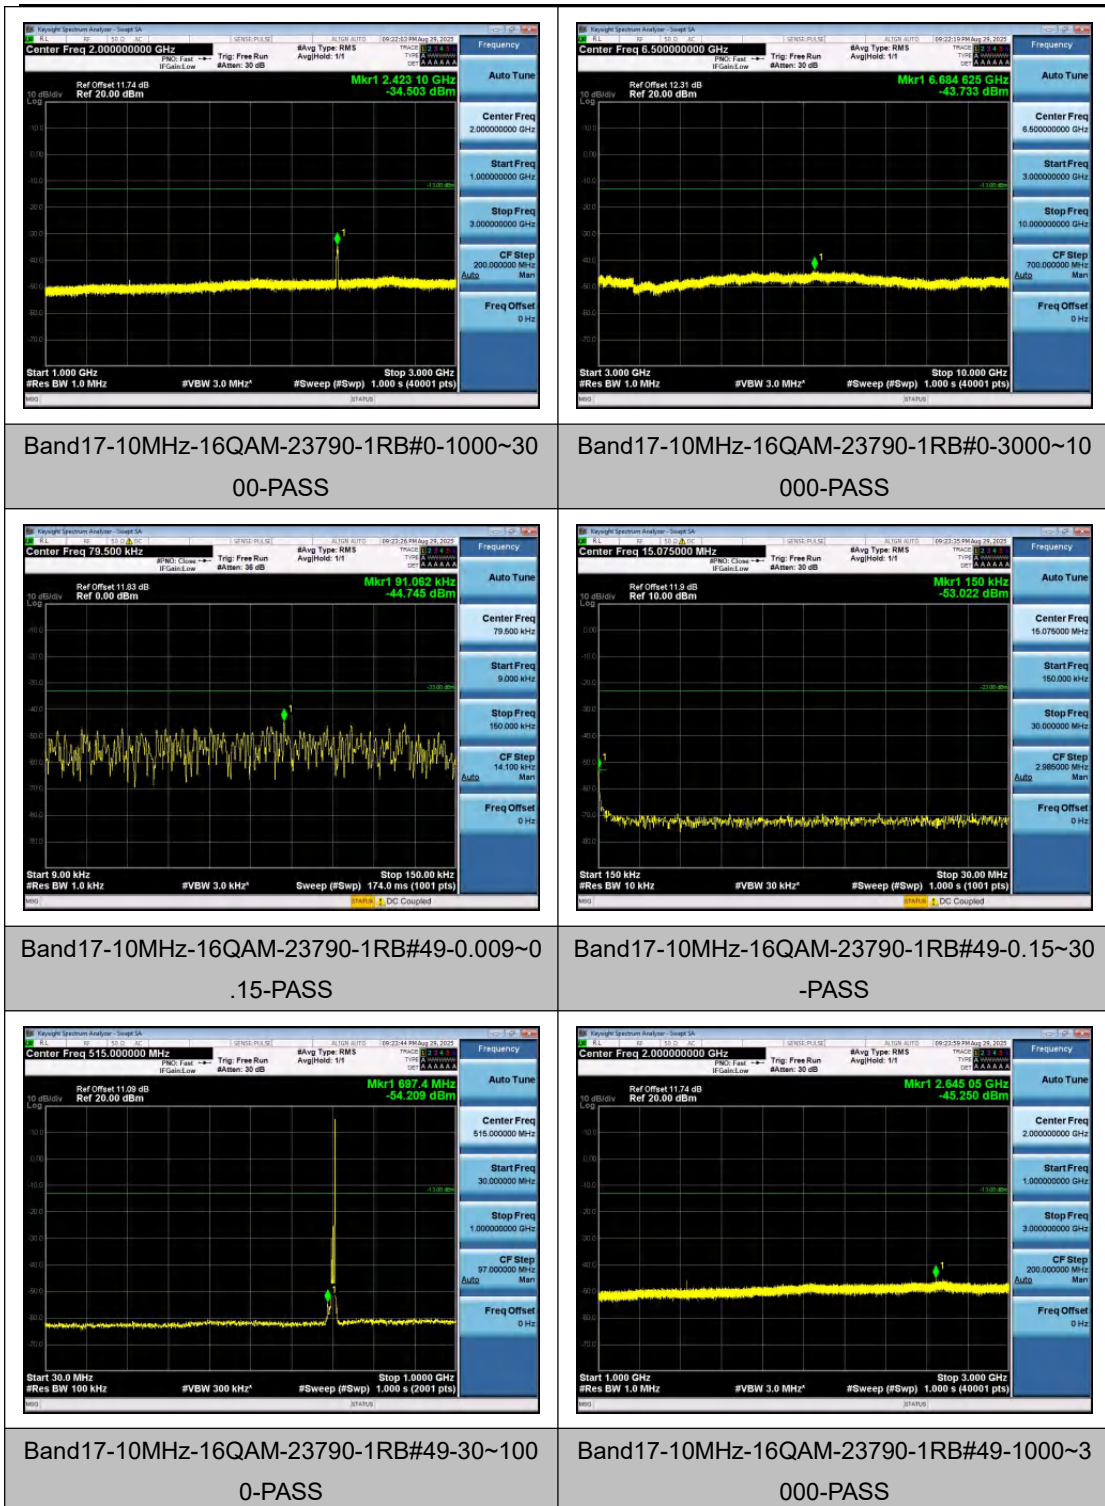


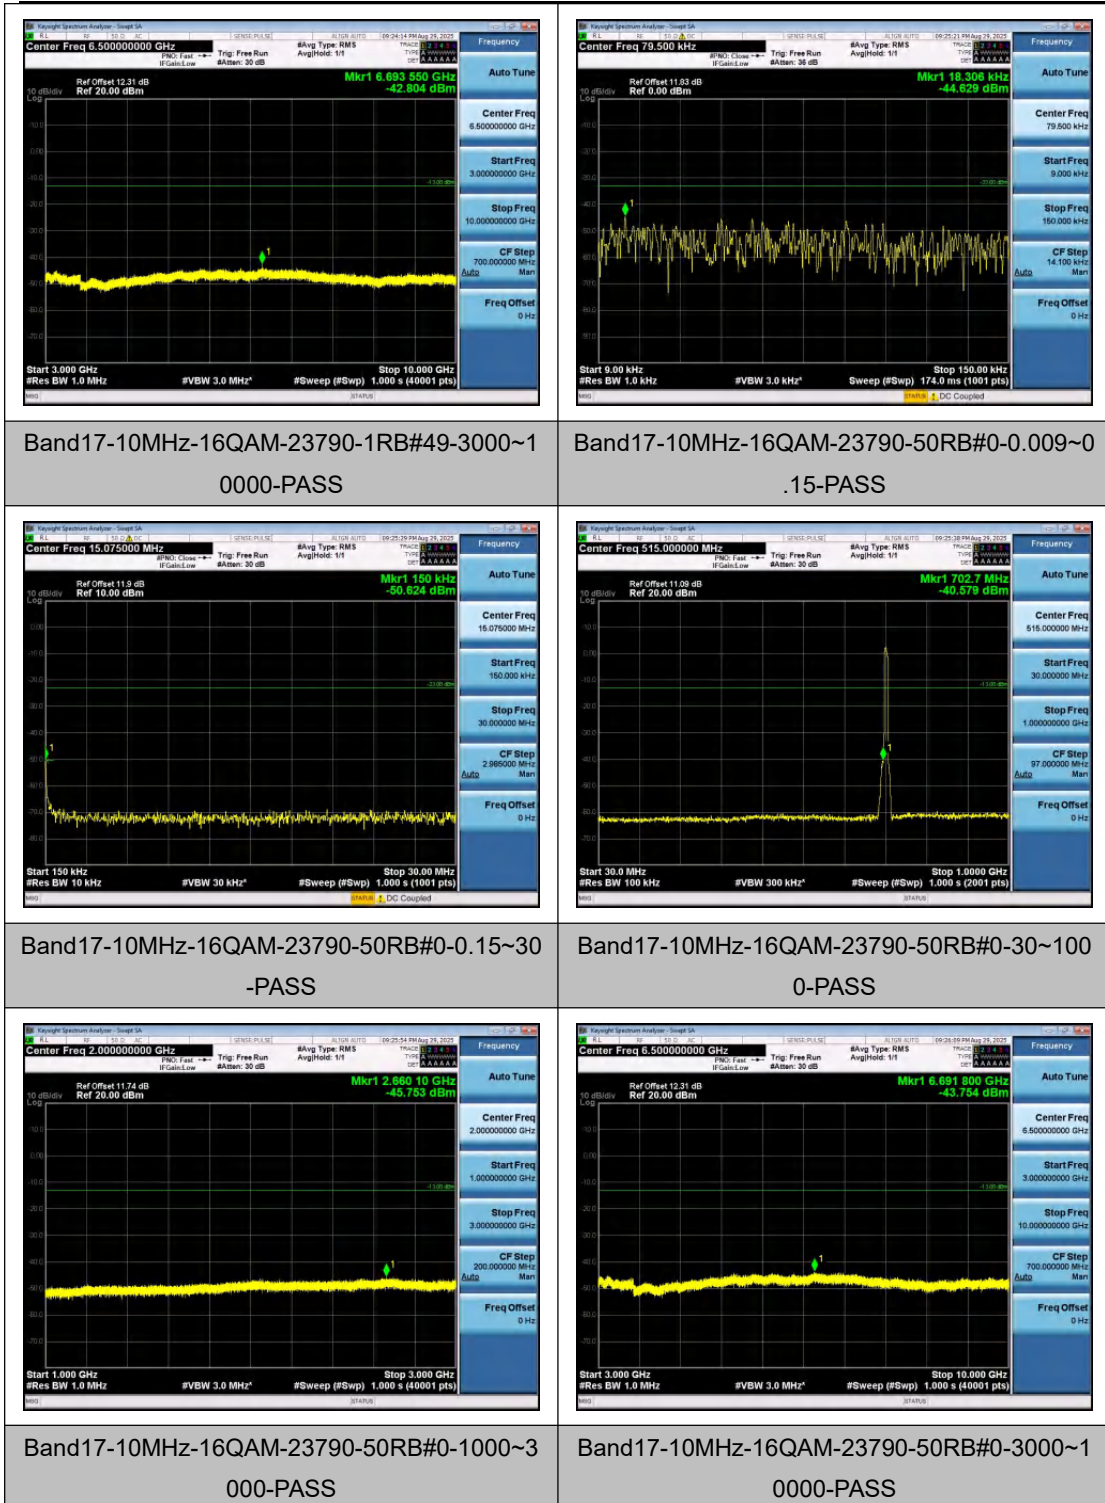


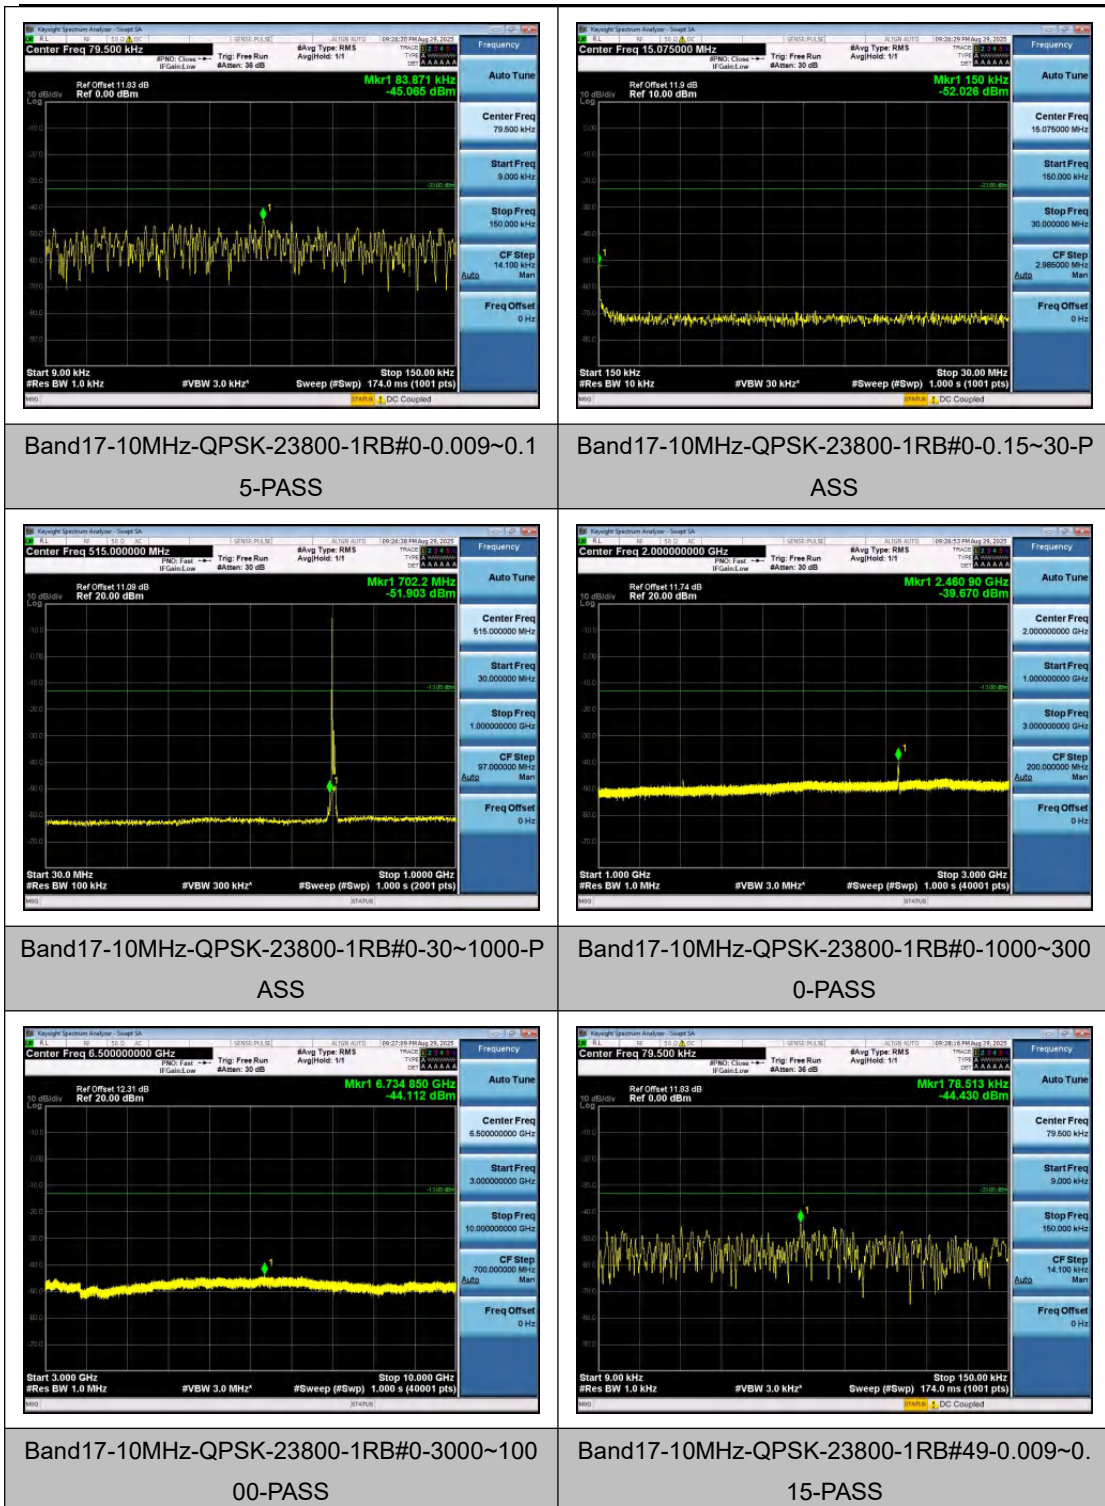

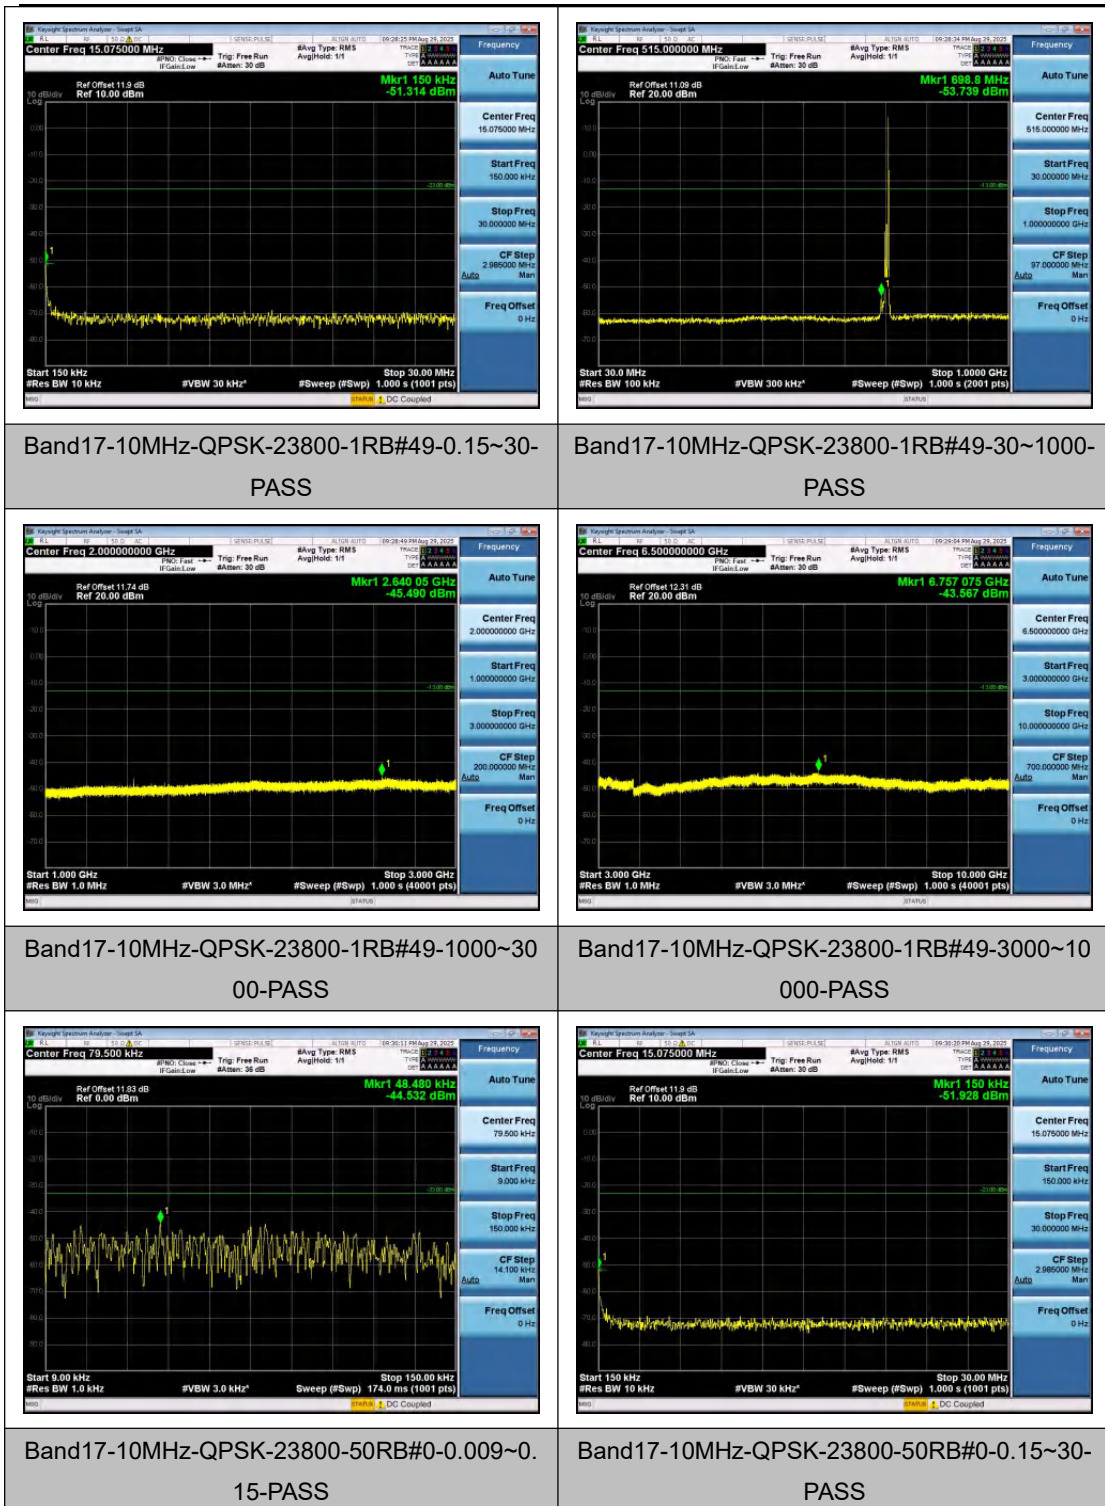

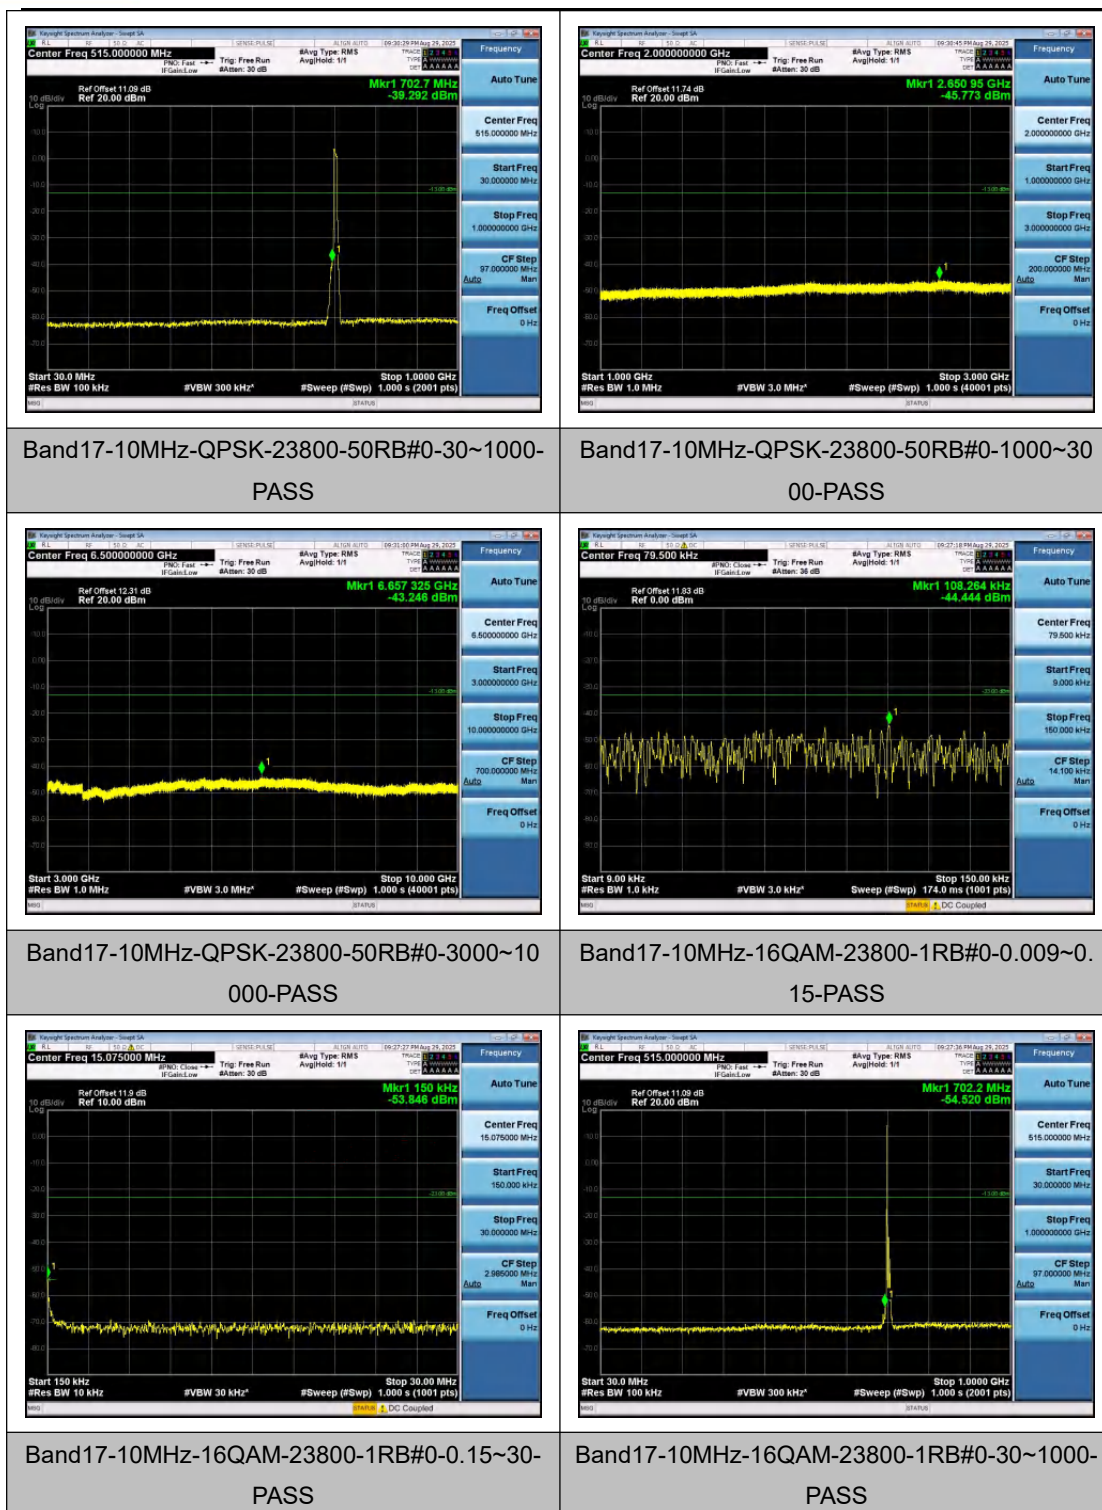

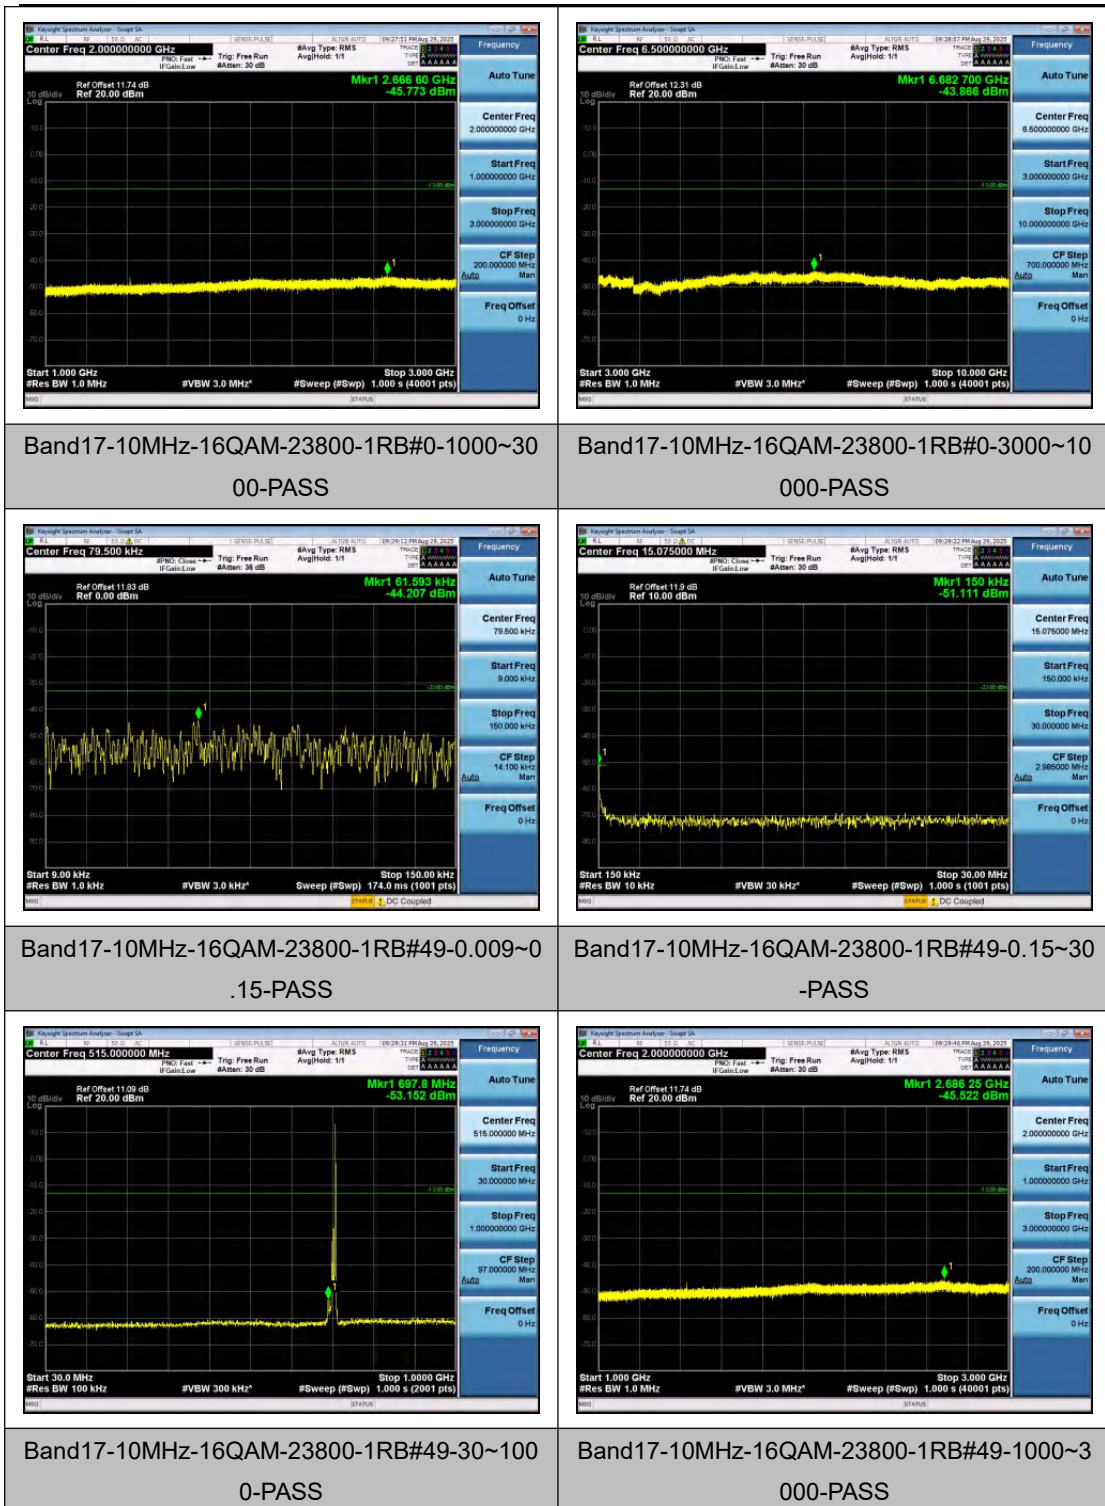

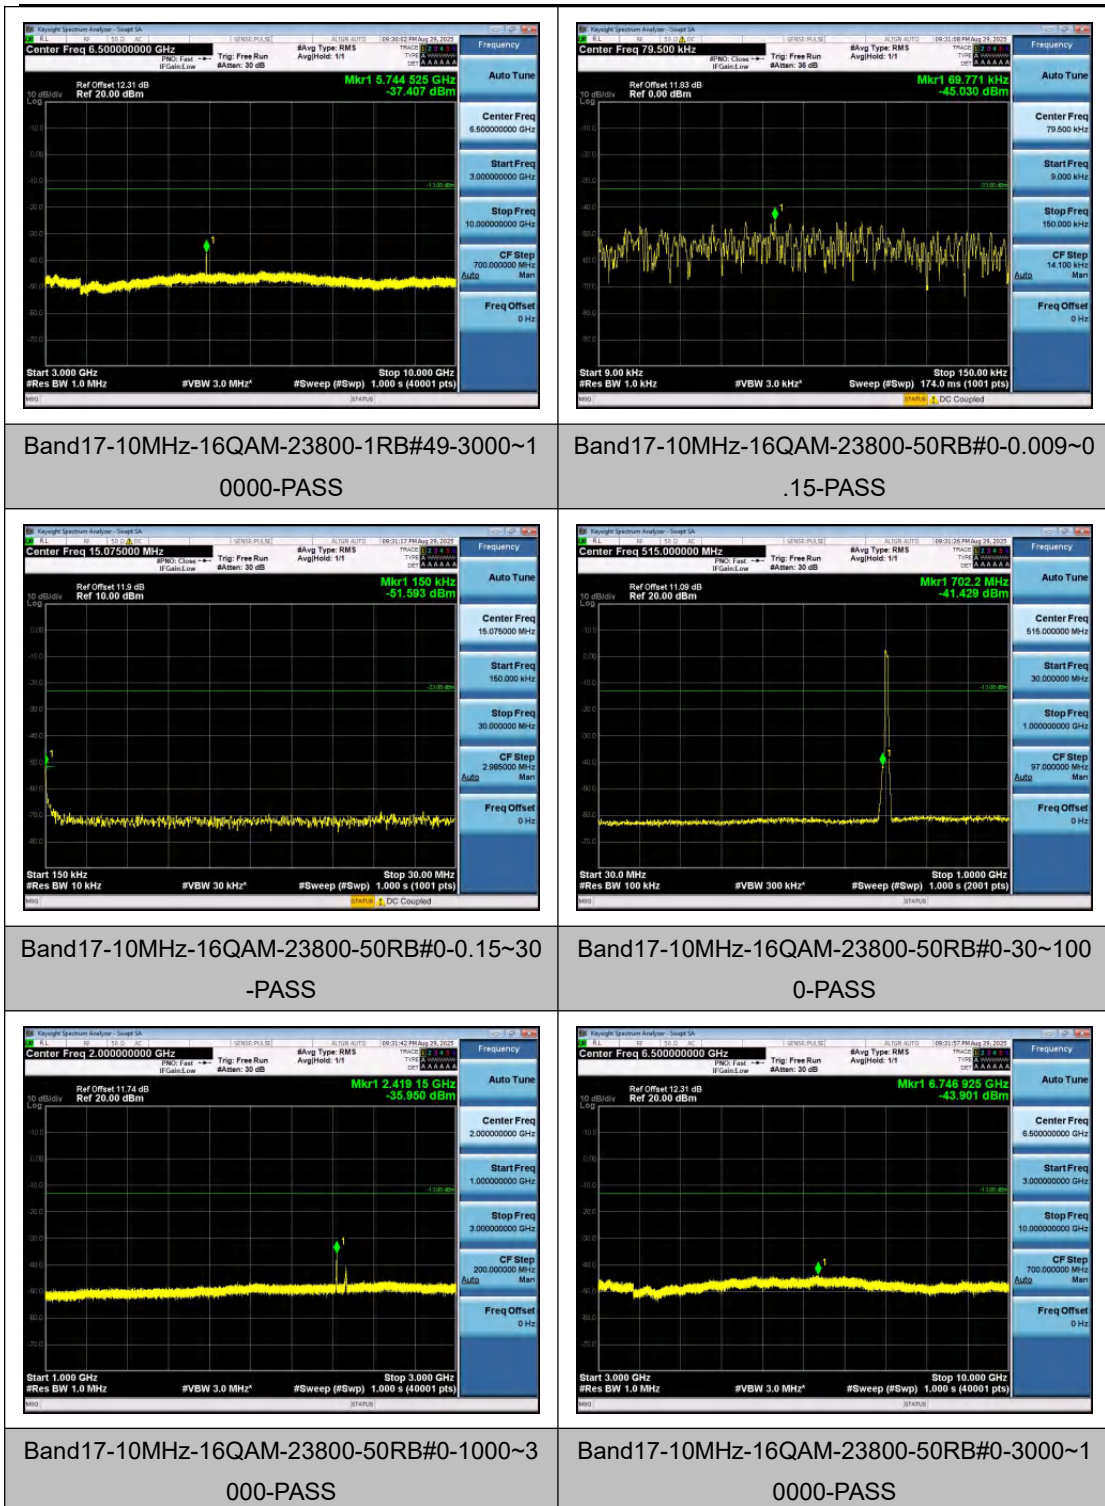

## Appendix F: Frequency Stability

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Voltage       |                  | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|--------|-----------|------------|---------|------------------|---------------|------------------|----------------|-----------------|-------------|---------|
|        |           |            |         |                  | Voltage [Vdc] | Temperature (°C) |                |                 |             |         |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | VN            | NT               | 1920.00        | 2.717622        | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | VL            | NT               | 3360.00        | 4.755839        | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23755   | 25RB#0           | VH            | NT               | 470.00         | 0.665251        | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | VN            | NT               | 2760.00        | 3.906582        | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | VL            | NT               | 4360.00        | 6.171267        | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23755   | 25RB#0           | VH            | NT               | 2770.00        | 3.920736        | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | VN            | NT               | -8570.00       | -12.070423      | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | VL            | NT               | -9810.00       | -13.816901      | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23790   | 25RB#0           | VH            | NT               | -7180.00       | -10.112676      | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 25RB#0           | VN            | NT               | -8300.00       | -11.690141      | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 25RB#0           | VL            | NT               | -7770.00       | -10.943662      | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23790   | 25RB#0           | VH            | NT               | -8140.00       | -11.464789      | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | VN            | NT               | -1850.00       | -2.592852       | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | VL            | NT               | -5460.00       | -7.652418       | ±2.5        | PASS    |
| Band17 | 5MHz      | QPSK       | 23825   | 25RB#0           | VH            | NT               | -5290.00       | -7.414156       | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | VN            | NT               | -3250.00       | -4.555011       | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | VL            | NT               | -3820.00       | -5.353889       | ±2.5        | PASS    |
| Band17 | 5MHz      | 16QAM      | 23825   | 25RB#0           | VH            | NT               | -3780.00       | -5.297828       | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | VN            | NT               | -13550.00      | -19.111425      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | VL            | NT               | -11970.00      | -16.882934      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23780   | 50RB#0           | VH            | NT               | -12210.00      | -17.221439      | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | VN            | NT               | -5700.00       | -8.039492       | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | VL            | NT               | -5870.00       | -8.279267       | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23780   | 50RB#0           | VH            | NT               | -7510.00       | -10.592384      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 50RB#0           | VN            | NT               | -10820.00      | -15.239437      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 50RB#0           | VL            | NT               | -11050.00      | -15.563380      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23790   | 50RB#0           | VH            | NT               | -12100.00      | -17.042254      | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 50RB#0           | VN            | NT               | -7100.00       | -10.000000      | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 50RB#0           | VL            | NT               | -5660.00       | -7.971831       | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23790   | 50RB#0           | VH            | NT               | -8560.00       | -12.056338      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | VN            | NT               | -18950.00      | -26.652602      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | VL            | NT               | -15860.00      | -22.306610      | ±2.5        | PASS    |
| Band17 | 10MHz     | QPSK       | 23800   | 50RB#0           | VH            | NT               | -20450.00      | -28.762307      | ±2.5        | PASS    |
| Band17 | 10MHz     | 16QAM      | 23800   | 50RB#0           | VN            | NT               | -16760.00      | -23.572433      | ±2.5        | PASS    |

|        |       |       |       |        |    |    |           |            |     |      |
|--------|-------|-------|-------|--------|----|----|-----------|------------|-----|------|
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | VL | NT | -12790.00 | -17.988748 | ±NA | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | VH | NT | -21660.00 | -30.464135 | ±NA | PASS |

| Temperature |           |            |         |                  |               |                  |                |                 |             |         |
|-------------|-----------|------------|---------|------------------|---------------|------------------|----------------|-----------------|-------------|---------|
| Band        | Bandwidth | Modulation | Channel | RB Configuration | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | -30              | 1830.00        | 2.590234        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | -20              | 1470.00        | 2.080679        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | -10              | -570.00        | -0.806794       | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 0                | -520.00        | -0.736023       | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 10               | -220.00        | -0.311394       | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 20               | 1700.00        | 2.406228        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 30               | 1100.00        | 1.556971        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 40               | 3760.00        | 5.322010        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23755   | 25RB#0           | NV            | 50               | 1880.00        | 2.661005        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | -30              | -1640.00       | -2.321302       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | -20              | 2280.00        | 3.227176        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | -10              | 2120.00        | 3.000708        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 0                | 4050.00        | 5.732484        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 10               | 2670.00        | 3.779193        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 20               | 3520.00        | 4.982307        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 30               | 1960.00        | 2.774239        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 40               | 4030.00        | 5.704176        | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23755   | 25RB#0           | NV            | 50               | 3250.00        | 4.600142        | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | -30              | -5230.00       | -7.366197       | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | -20              | -9460.00       | -13.323944      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | -10              | -8640.00       | -12.169014      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 0                | -7960.00       | -11.211268      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 10               | -13920.00      | -19.605634      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 20               | -3740.00       | -5.267606       | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 30               | -8930.00       | -12.577465      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 40               | -9860.00       | -13.887324      | ±2.5        | PASS    |
| Band17      | 5MHz      | QPSK       | 23790   | 25RB#0           | NV            | 50               | -12310.00      | -17.338028      | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | -30              | -1970.00       | -2.774648       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | -20              | -5680.00       | -8.000000       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | -10              | -5490.00       | -7.732394       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | 0                | -7190.00       | -10.126761      | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | 10               | -1050.00       | -1.478873       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | 20               | -5780.00       | -8.140845       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | 30               | -5610.00       | -7.901408       | ±2.5        | PASS    |
| Band17      | 5MHz      | 16QAM      | 23790   | 25RB#0           | NV            | 40               | -5860.00       | -8.253521       | ±2.5        | PASS    |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |        |    |     |           |            |      |      |
|--------|-------|-------|-------|--------|----|-----|-----------|------------|------|------|
| Band17 | 5MHz  | 16QAM | 23790 | 25RB#0 | NV | 50  | -5060.00  | -7.126761  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | -30 | -4610.00  | -6.461107  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | -20 | -4710.00  | -6.601261  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | -10 | -7040.00  | -9.866854  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 0   | -2300.00  | -3.223546  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 10  | -6150.00  | -8.619481  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 20  | -2280.00  | -3.195515  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 30  | -4900.00  | -6.867554  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 40  | -1540.00  | -2.158374  | ±2.5 | PASS |
| Band17 | 5MHz  | QPSK  | 23825 | 25RB#0 | NV | 50  | -5690.00  | -7.974772  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | -30 | -3170.00  | -4.442887  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | -20 | -2250.00  | -3.153469  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | -10 | -2620.00  | -3.672039  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 0   | -3160.00  | -4.428872  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 10  | -3060.00  | -4.288718  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 20  | -4750.00  | -6.657323  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 30  | -1660.00  | -2.326559  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 40  | -2190.00  | -3.069376  | ±2.5 | PASS |
| Band17 | 5MHz  | 16QAM | 23825 | 25RB#0 | NV | 50  | -500.00   | -0.700771  | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | -30 | -15730.00 | -22.186178 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | -20 | -7670.00  | -10.818054 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | -10 | -11440.00 | -16.135402 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 0   | -14560.00 | -20.535966 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 10  | -17030.00 | -24.019746 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 20  | -15320.00 | -21.607898 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 30  | -13110.00 | -18.490832 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 40  | -14820.00 | -20.902680 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23780 | 50RB#0 | NV | 50  | -3820.00  | -5.387870  | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | -30 | -10600.00 | -14.950635 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | -20 | -11970.00 | -16.882934 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | -10 | -12200.00 | -17.207334 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 0   | -9440.00  | -13.314528 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 10  | -9930.00  | -14.005642 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 20  | -9610.00  | -13.554302 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 30  | -3780.00  | -5.331453  | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 40  | -12400.00 | -17.489422 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23780 | 50RB#0 | NV | 50  | -7270.00  | -10.253879 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | -30 | -10770.00 | -15.169014 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | -20 | -12580.00 | -17.718310 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | -10 | -11500.00 | -16.197183 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 0   | -8700.00  | -12.253521 | ±2.5 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|        |       |       |       |        |    |     |           |            |      |      |
|--------|-------|-------|-------|--------|----|-----|-----------|------------|------|------|
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 10  | -13410.00 | -18.887324 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 20  | -7250.00  | -10.211268 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 30  | -9510.00  | -13.394366 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 40  | -13140.00 | -18.507042 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23790 | 50RB#0 | NV | 50  | -7880.00  | -11.098592 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | -30 | -14890.00 | -20.971831 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | -20 | -12770.00 | -17.985915 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | -10 | -8860.00  | -12.478873 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 0   | -12140.00 | -17.098592 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 10  | -6610.00  | -9.309859  | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 20  | -16360.00 | -23.042254 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 30  | -15080.00 | -21.239437 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 40  | -8210.00  | -11.563380 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23790 | 50RB#0 | NV | 50  | -11370.00 | -16.014085 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | -30 | -14790.00 | -20.801688 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | -20 | -19690.00 | -27.693390 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | -10 | -13290.00 | -18.691983 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 0   | -17910.00 | -25.189873 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 10  | -13880.00 | -19.521800 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 20  | -15680.00 | -22.053446 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 30  | -18910.00 | -26.596343 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 40  | -14270.00 | -20.070323 | ±2.5 | PASS |
| Band17 | 10MHz | QPSK  | 23800 | 50RB#0 | NV | 50  | -16950.00 | -23.839662 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | -30 | -11770.00 | -16.554149 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | -20 | -18240.00 | -25.654008 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | -10 | -17940.00 | -25.232068 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 0   | -15790.00 | -22.208158 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 10  | -10660.00 | -14.992968 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 20  | -12490.00 | -17.566807 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 30  | -11070.00 | -15.569620 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 40  | -19970.00 | -28.087201 | ±2.5 | PASS |
| Band17 | 10MHz | 16QAM | 23800 | 50RB#0 | NV | 50  | -12070.00 | -16.976090 | ±2.5 | PASS |

---END---