




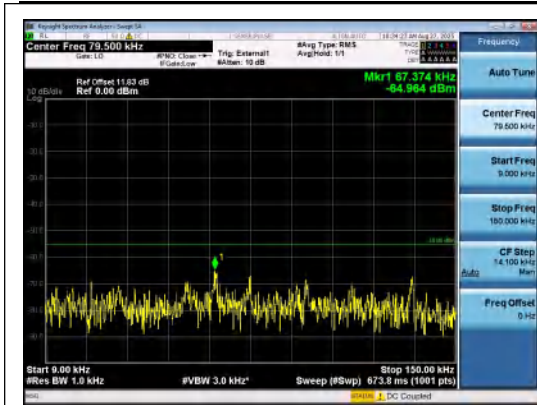


Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-0.009~0.15-PASS

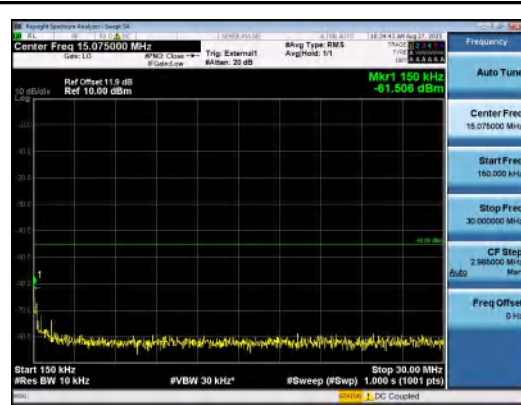

Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-0.15~30-PASS

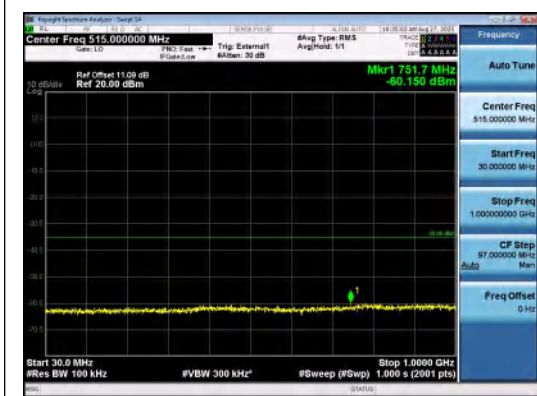

Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-30~1000-PASS

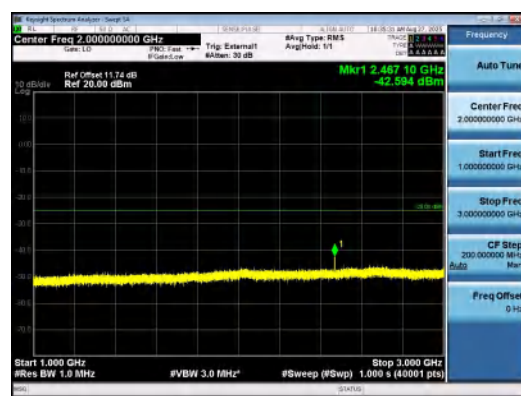


Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-1000~3000-PASS




Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-3000~18000-PASS




Band41(2535-2655)-10MHz-16QAM-40090-50R
B#0-18000~27000-PASS

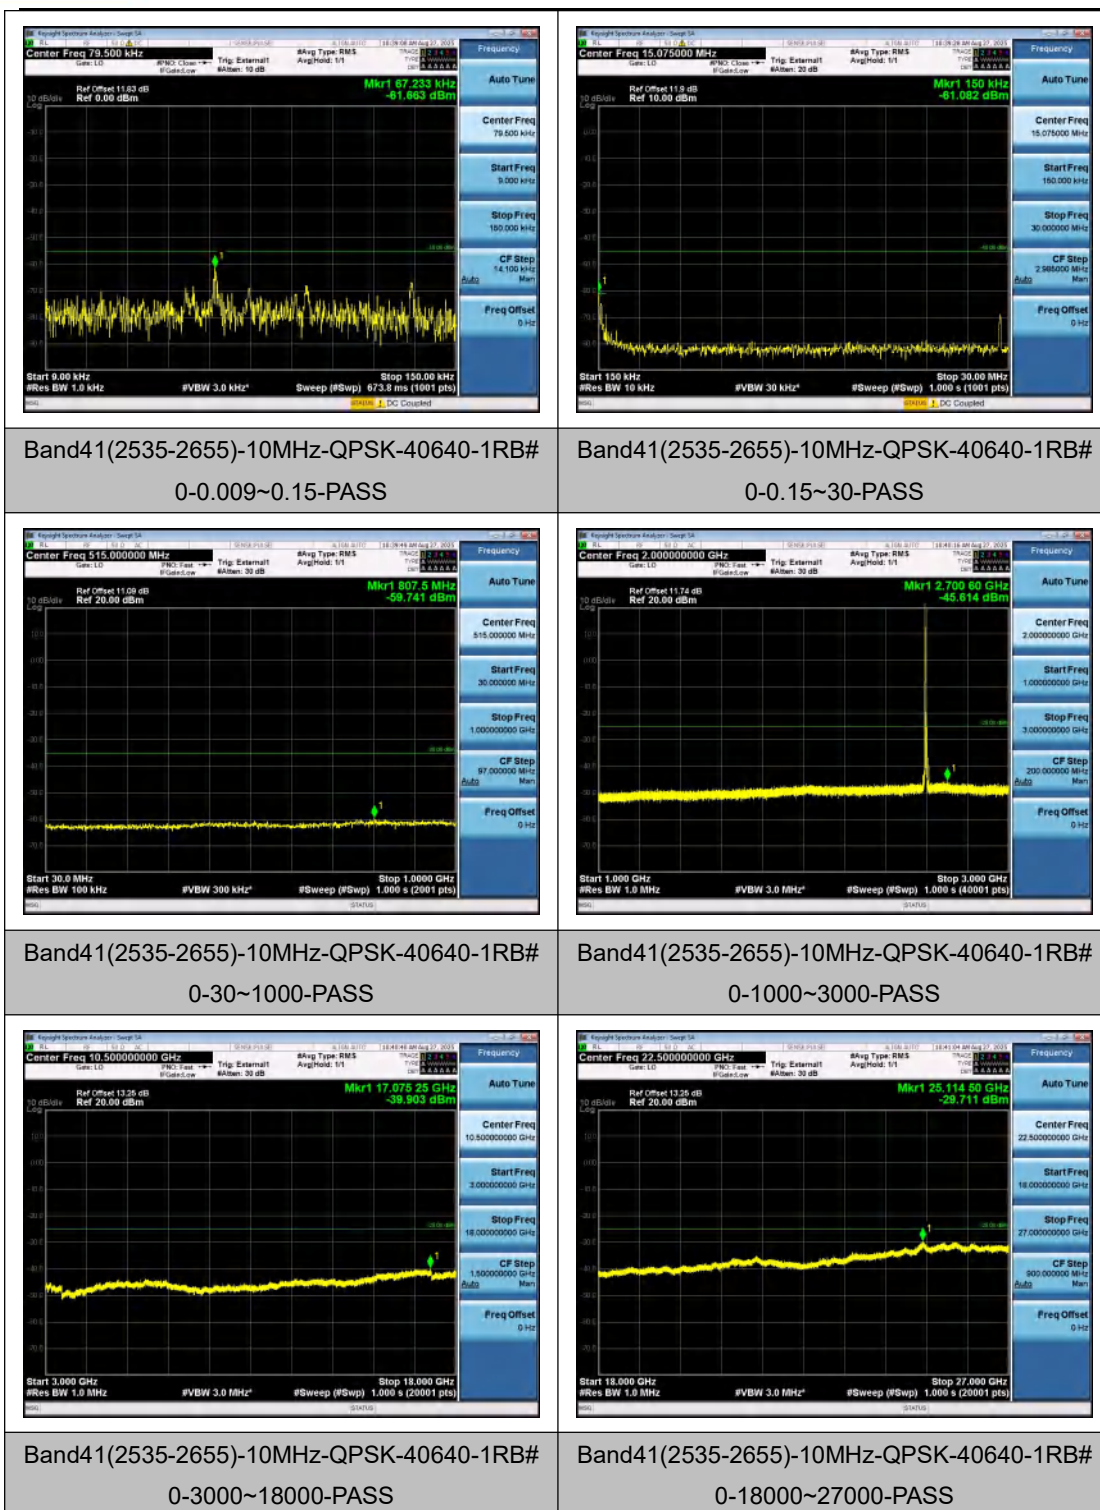


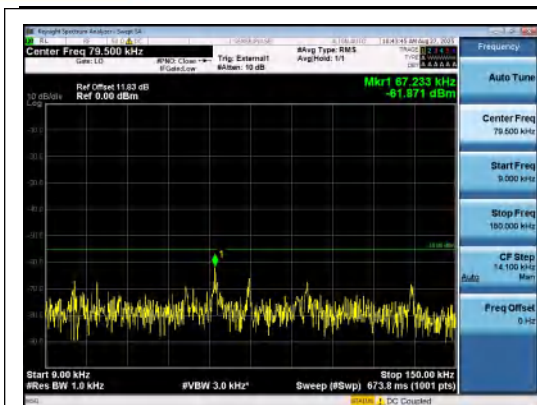


Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-0.009~0.15-PASS

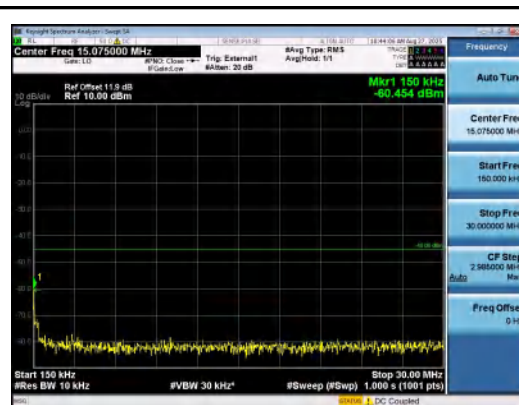


Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-0.15~30-PASS

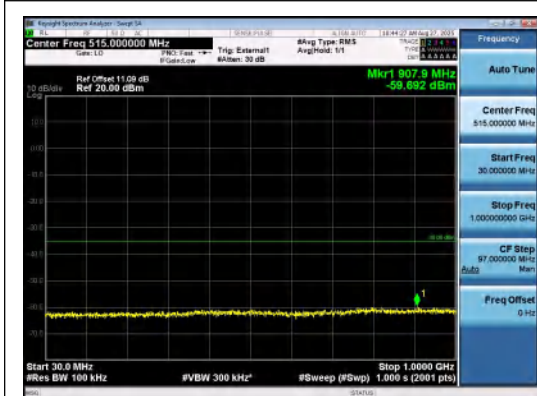

Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-30~1000-PASS

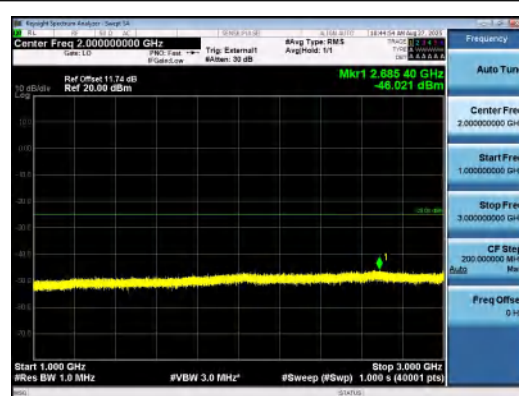


Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-1000~3000-PASS

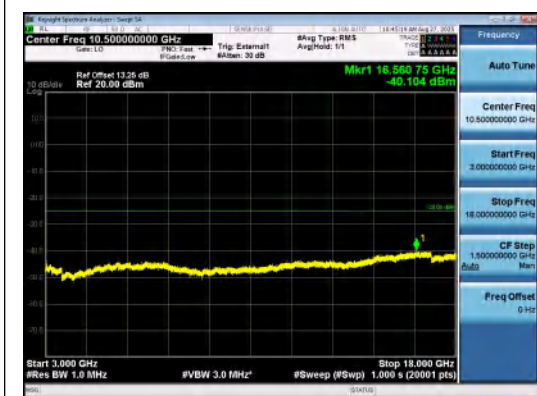



Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-3000~18000-PASS





Band41(2535-2655)-10MHz-QPSK-40640-1RB#
49-18000~27000-PASS

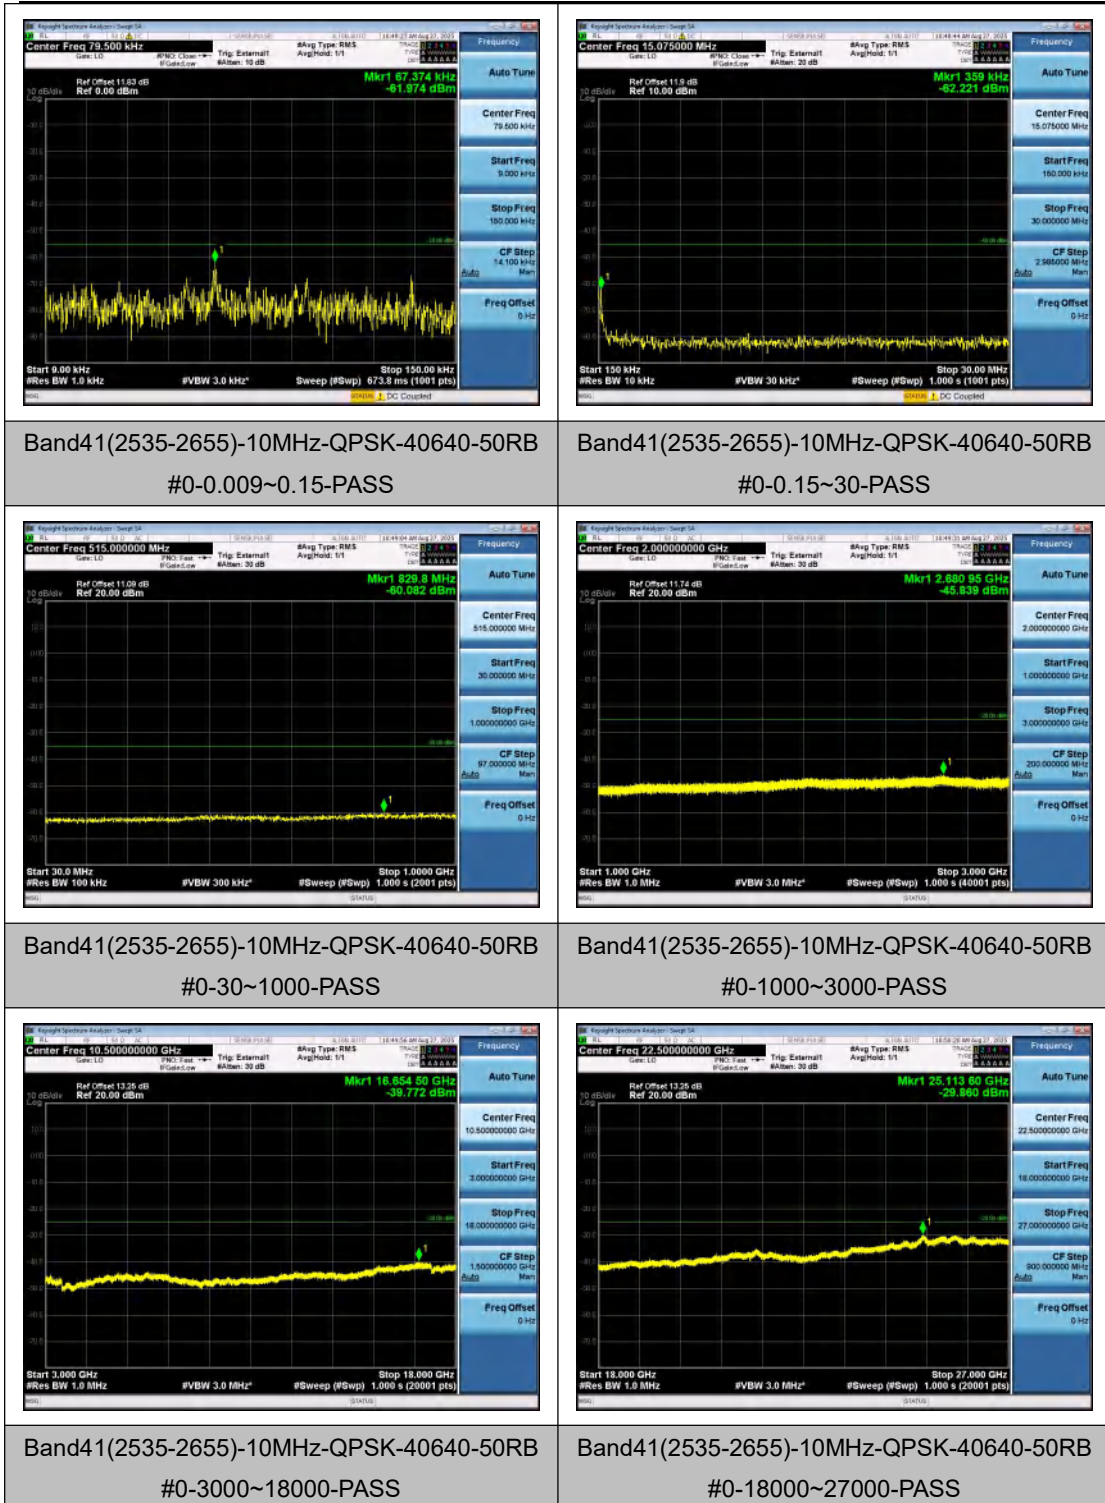


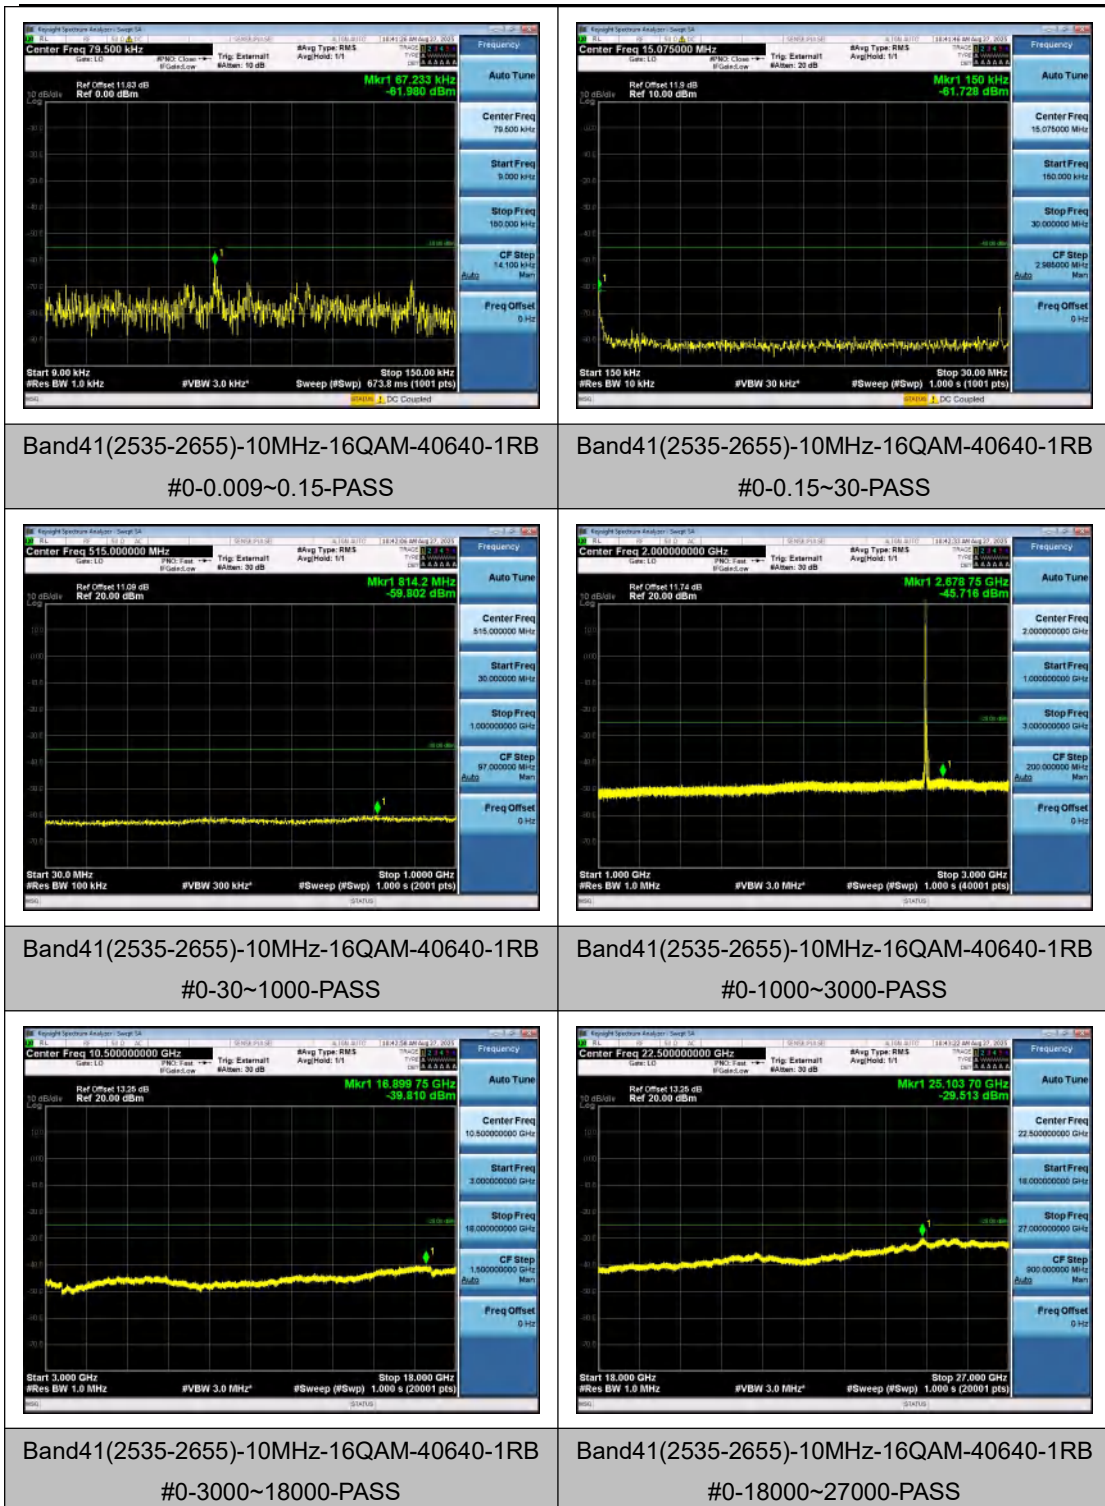


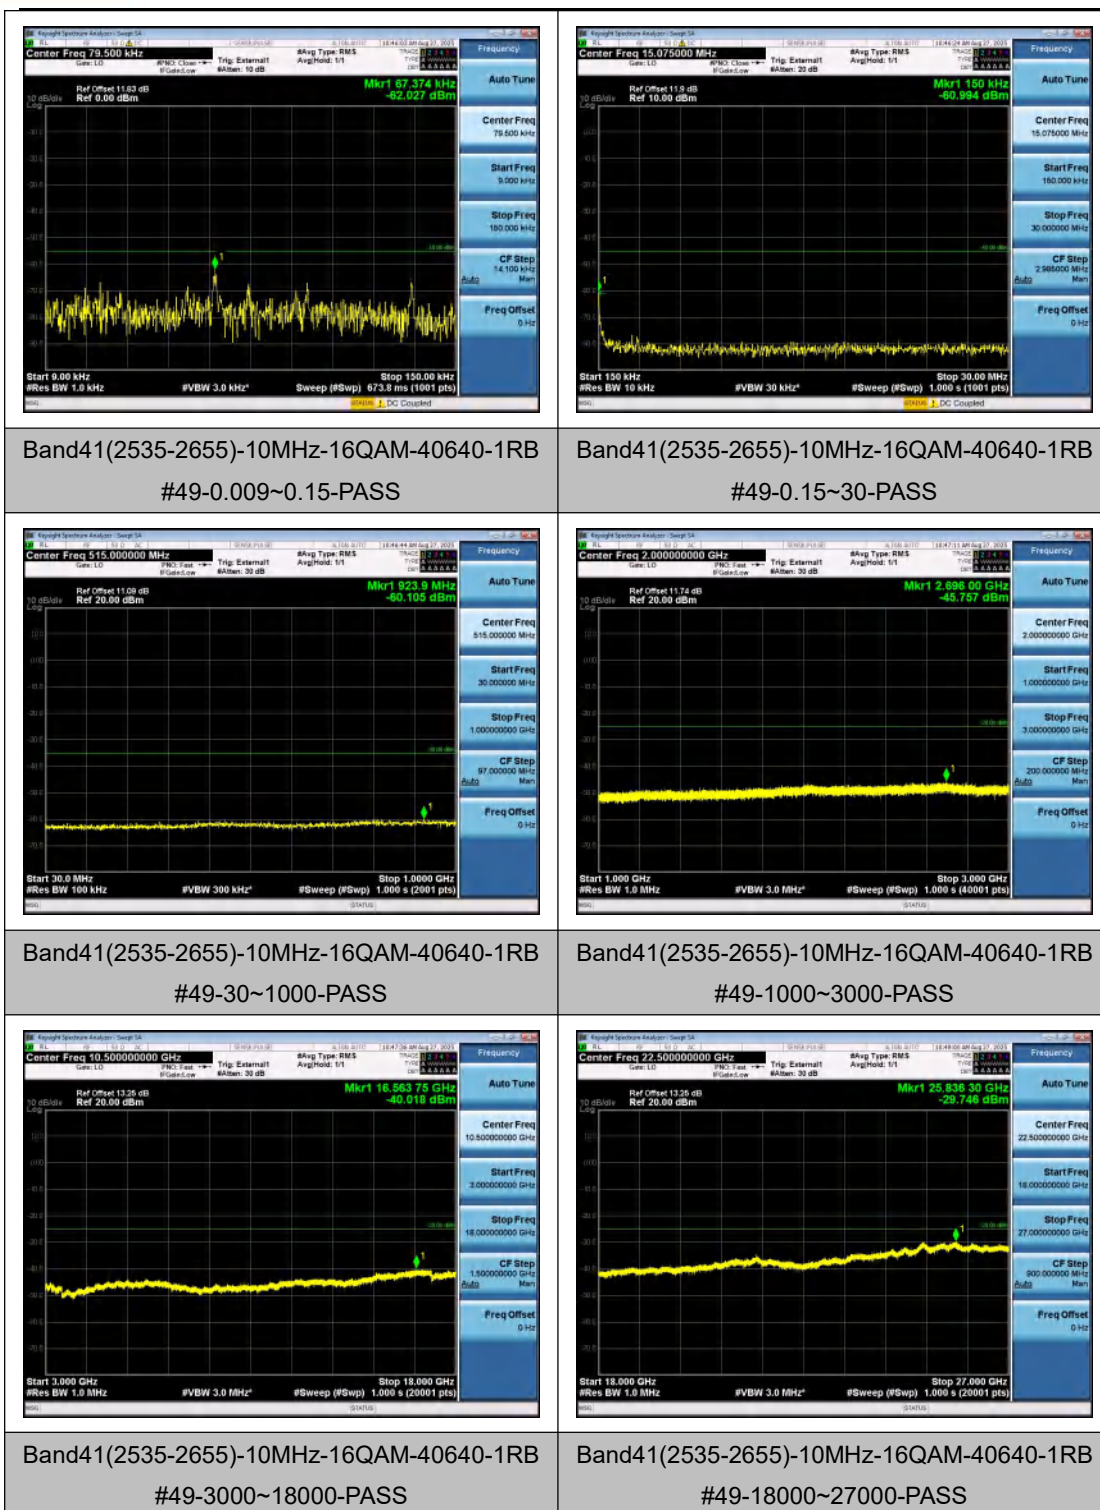


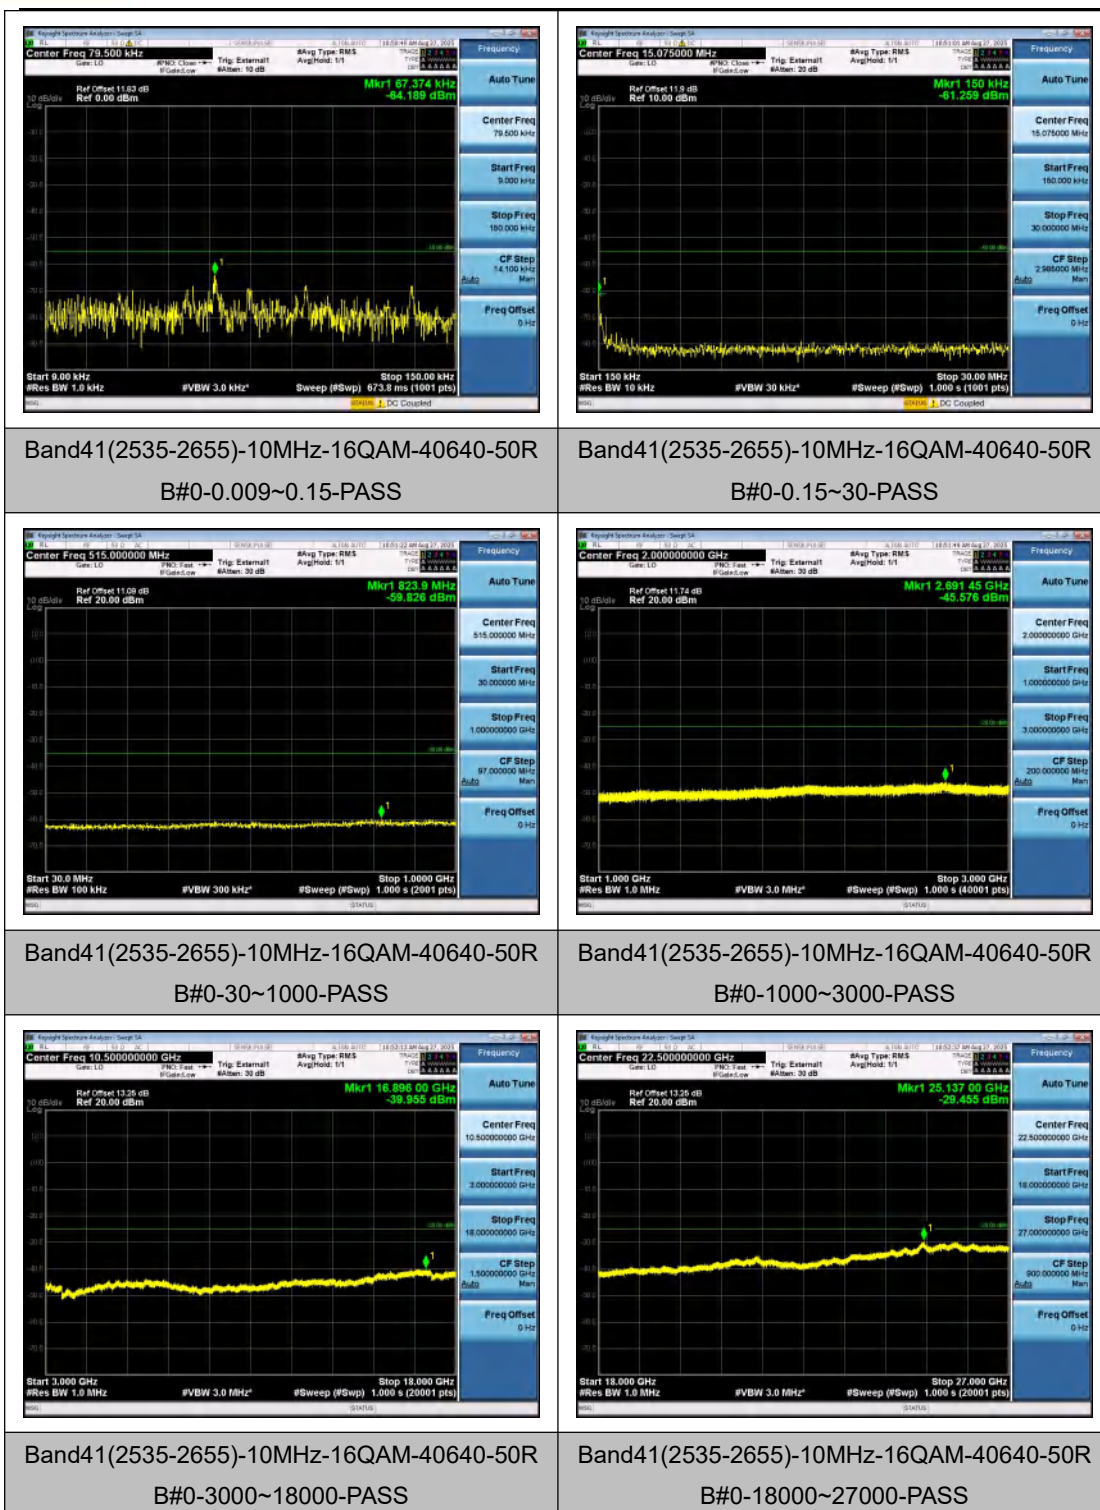


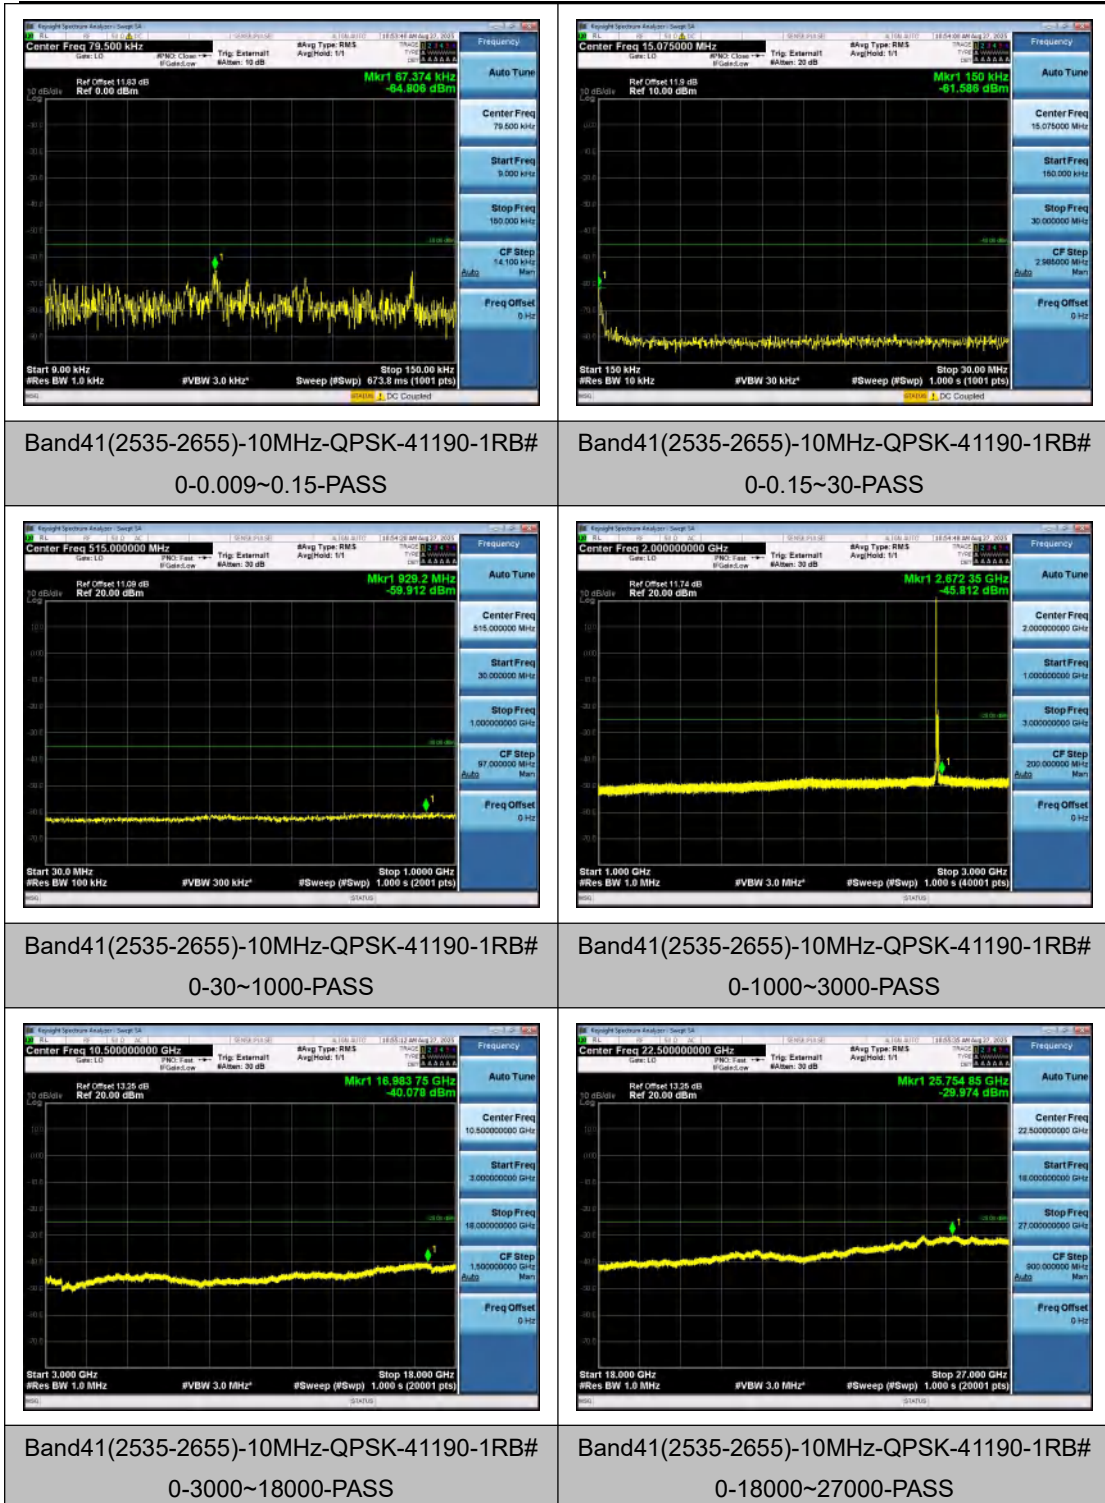


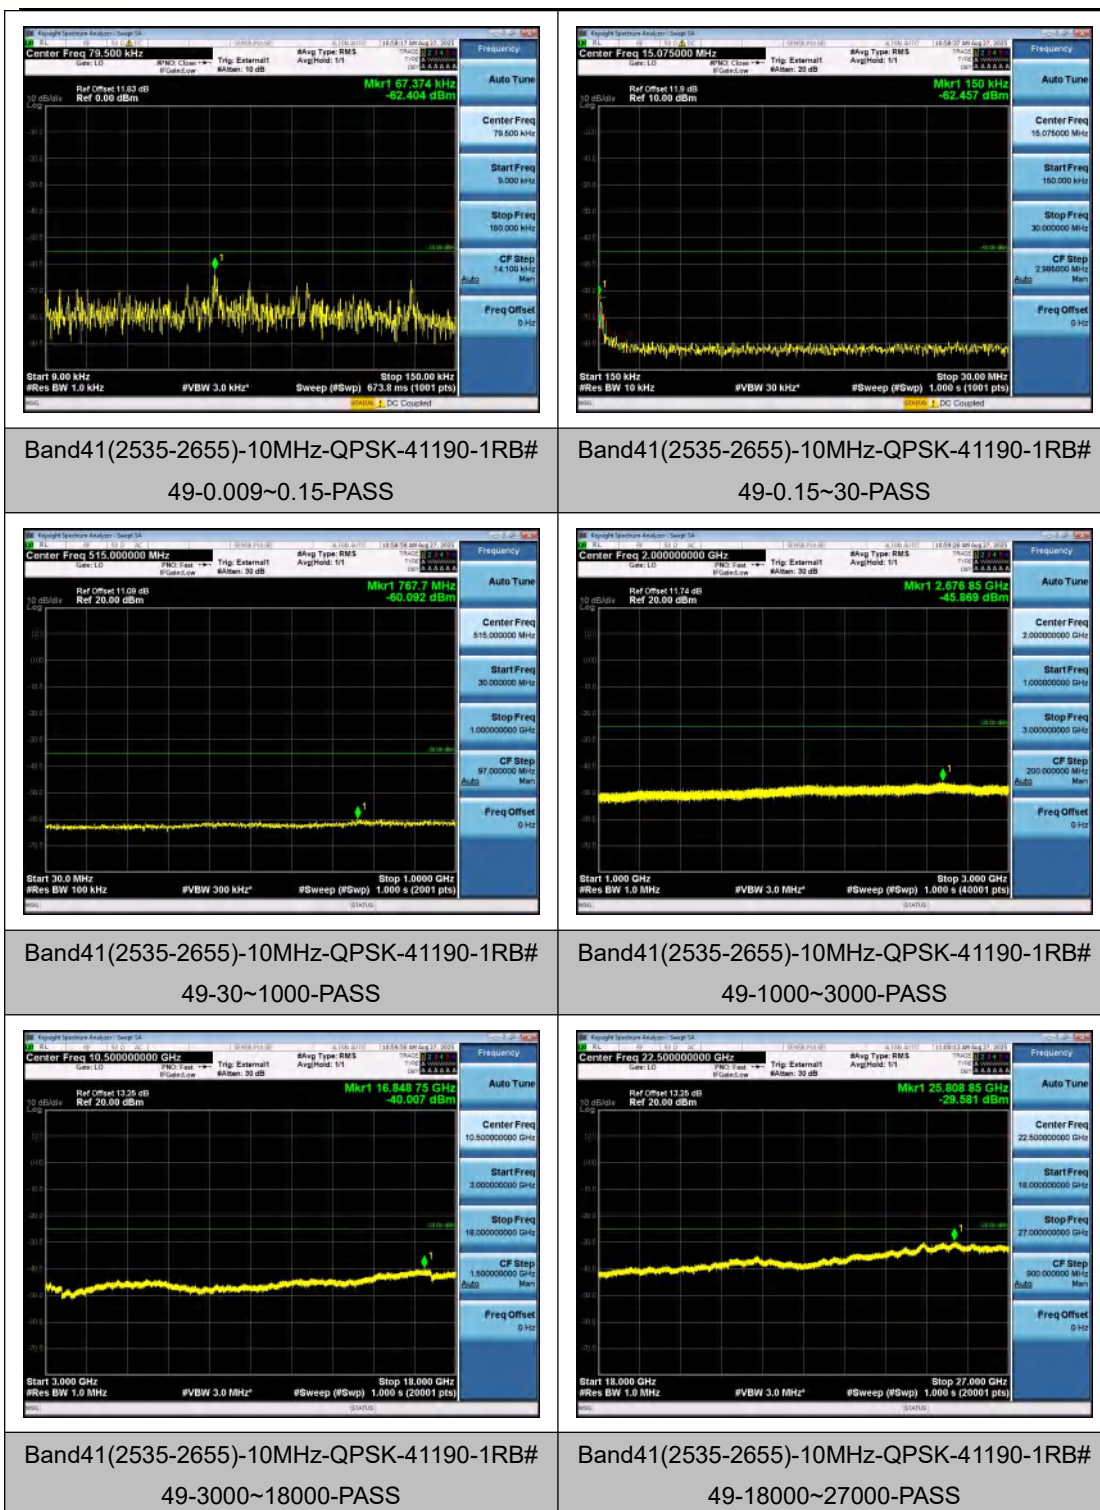


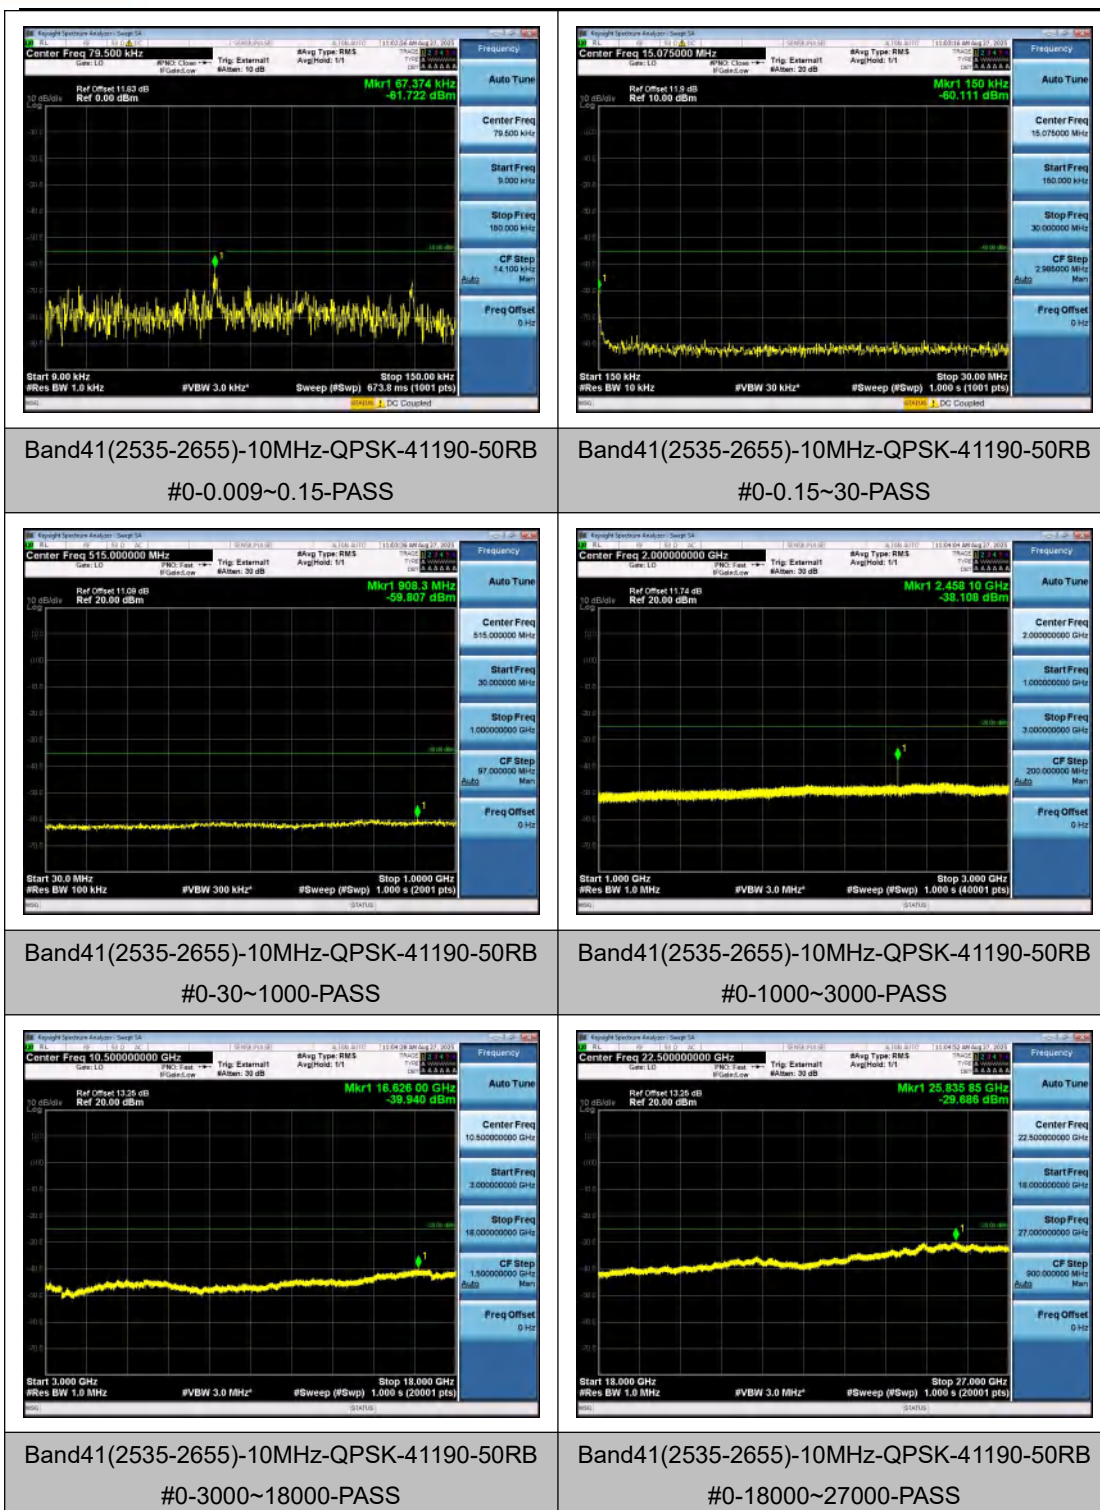


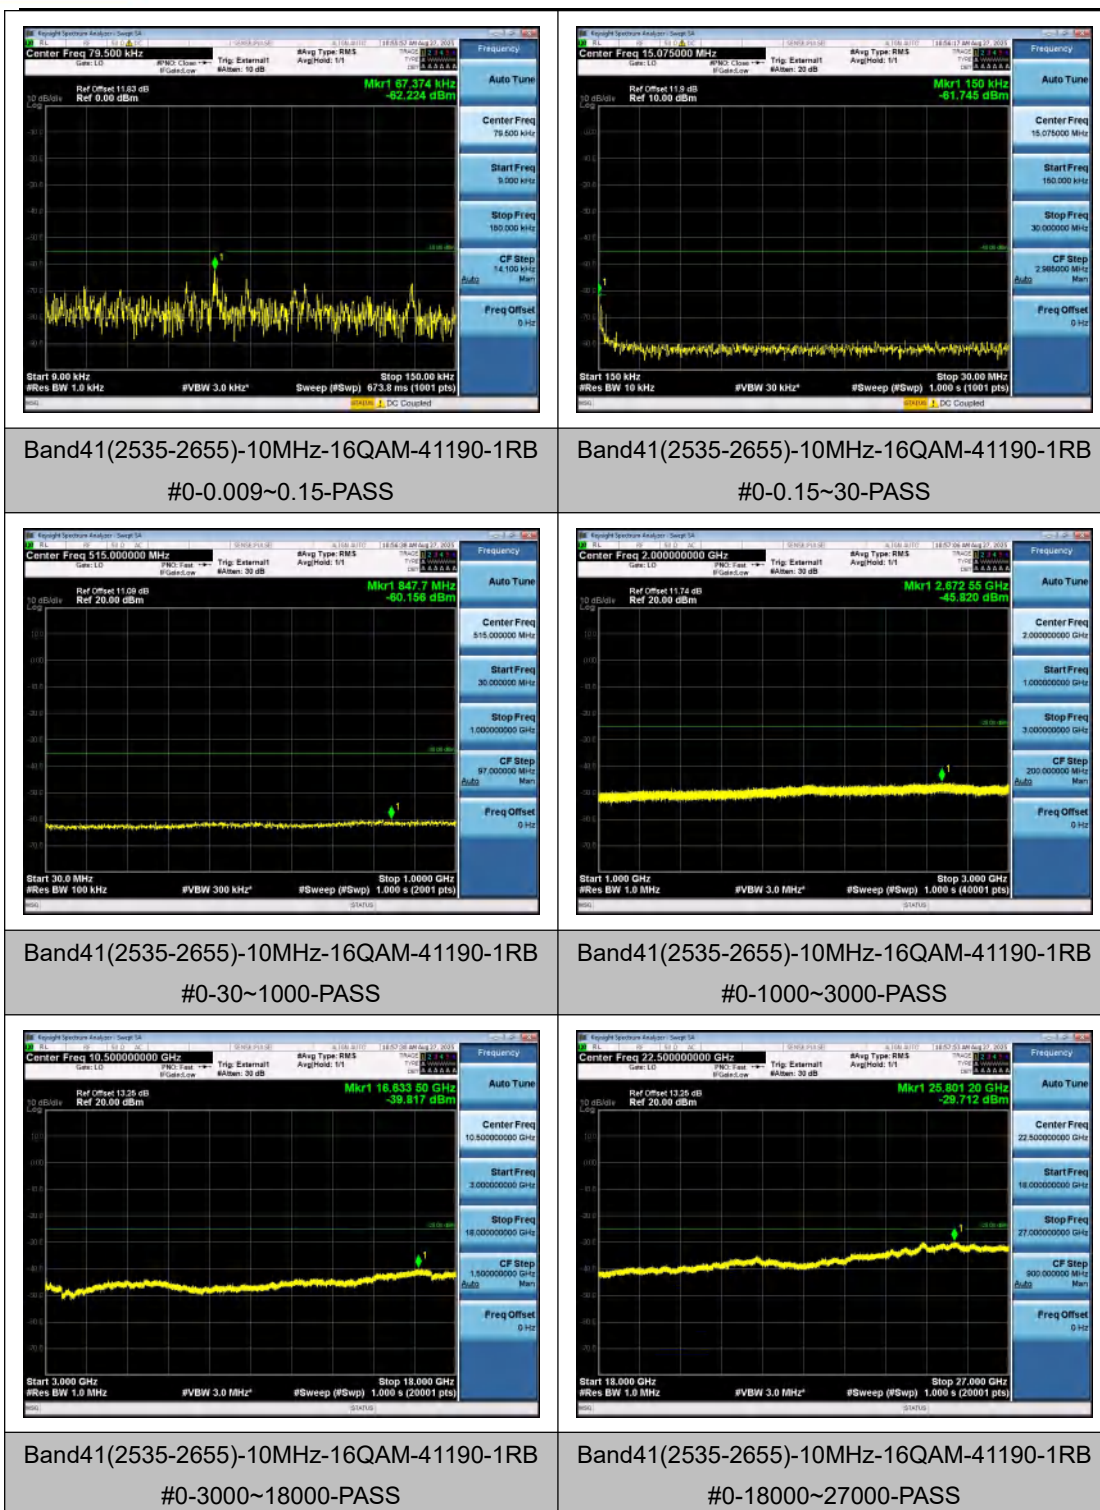


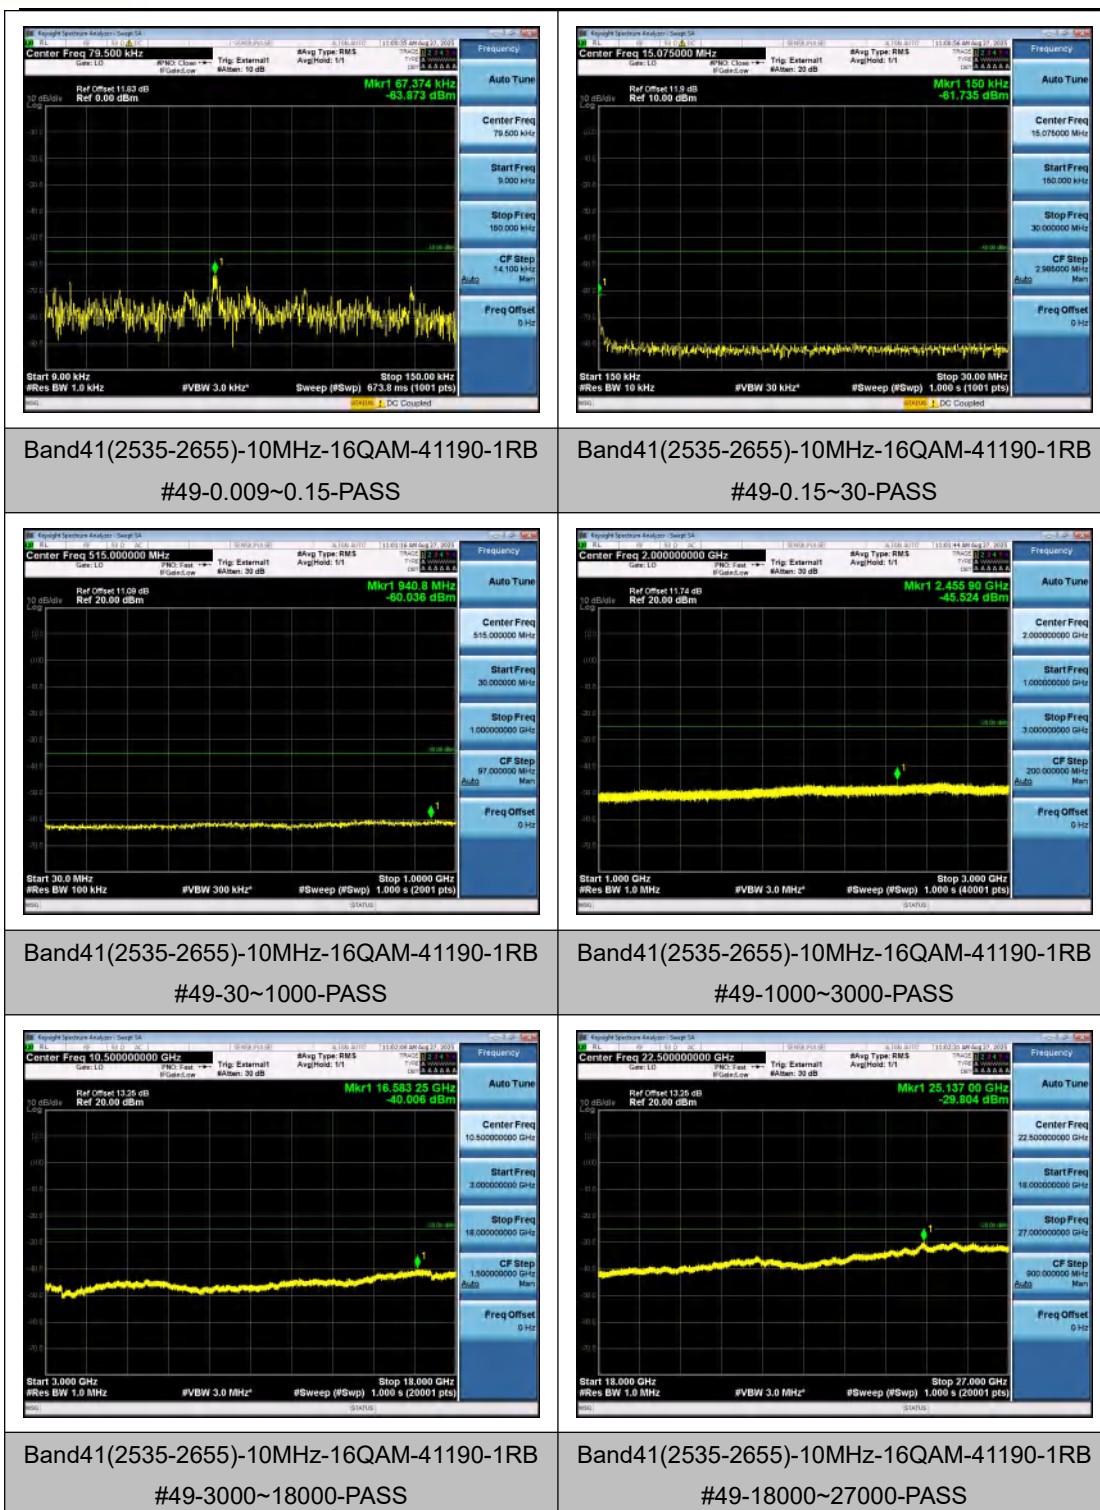


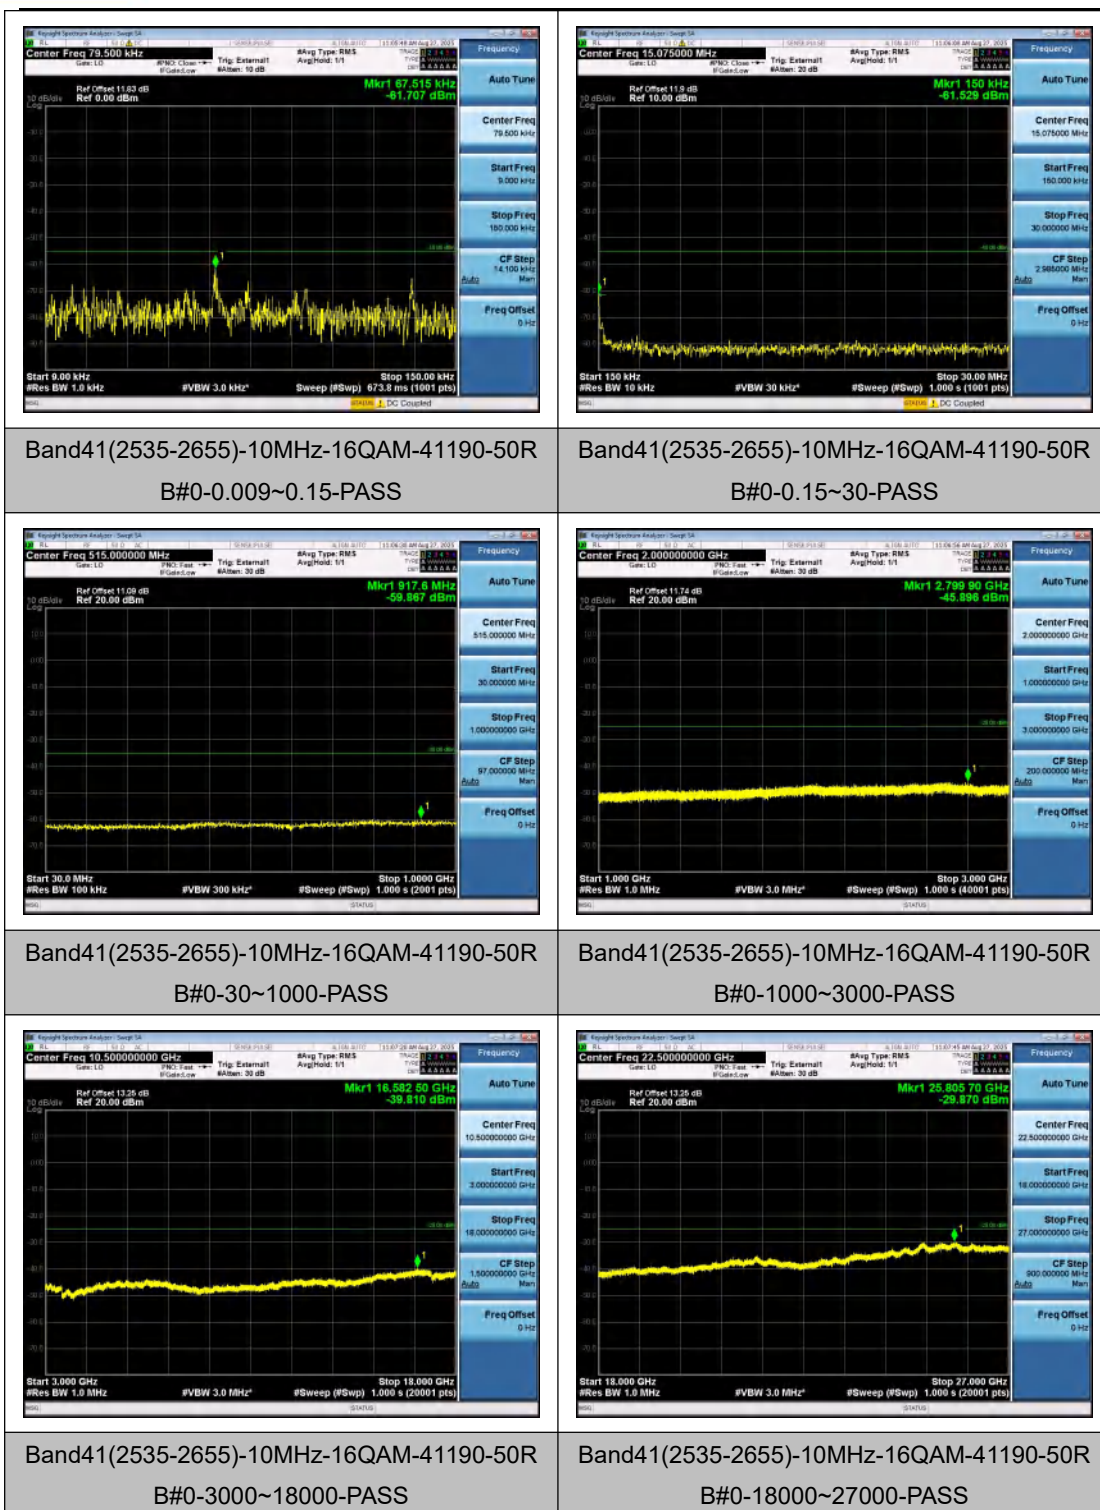


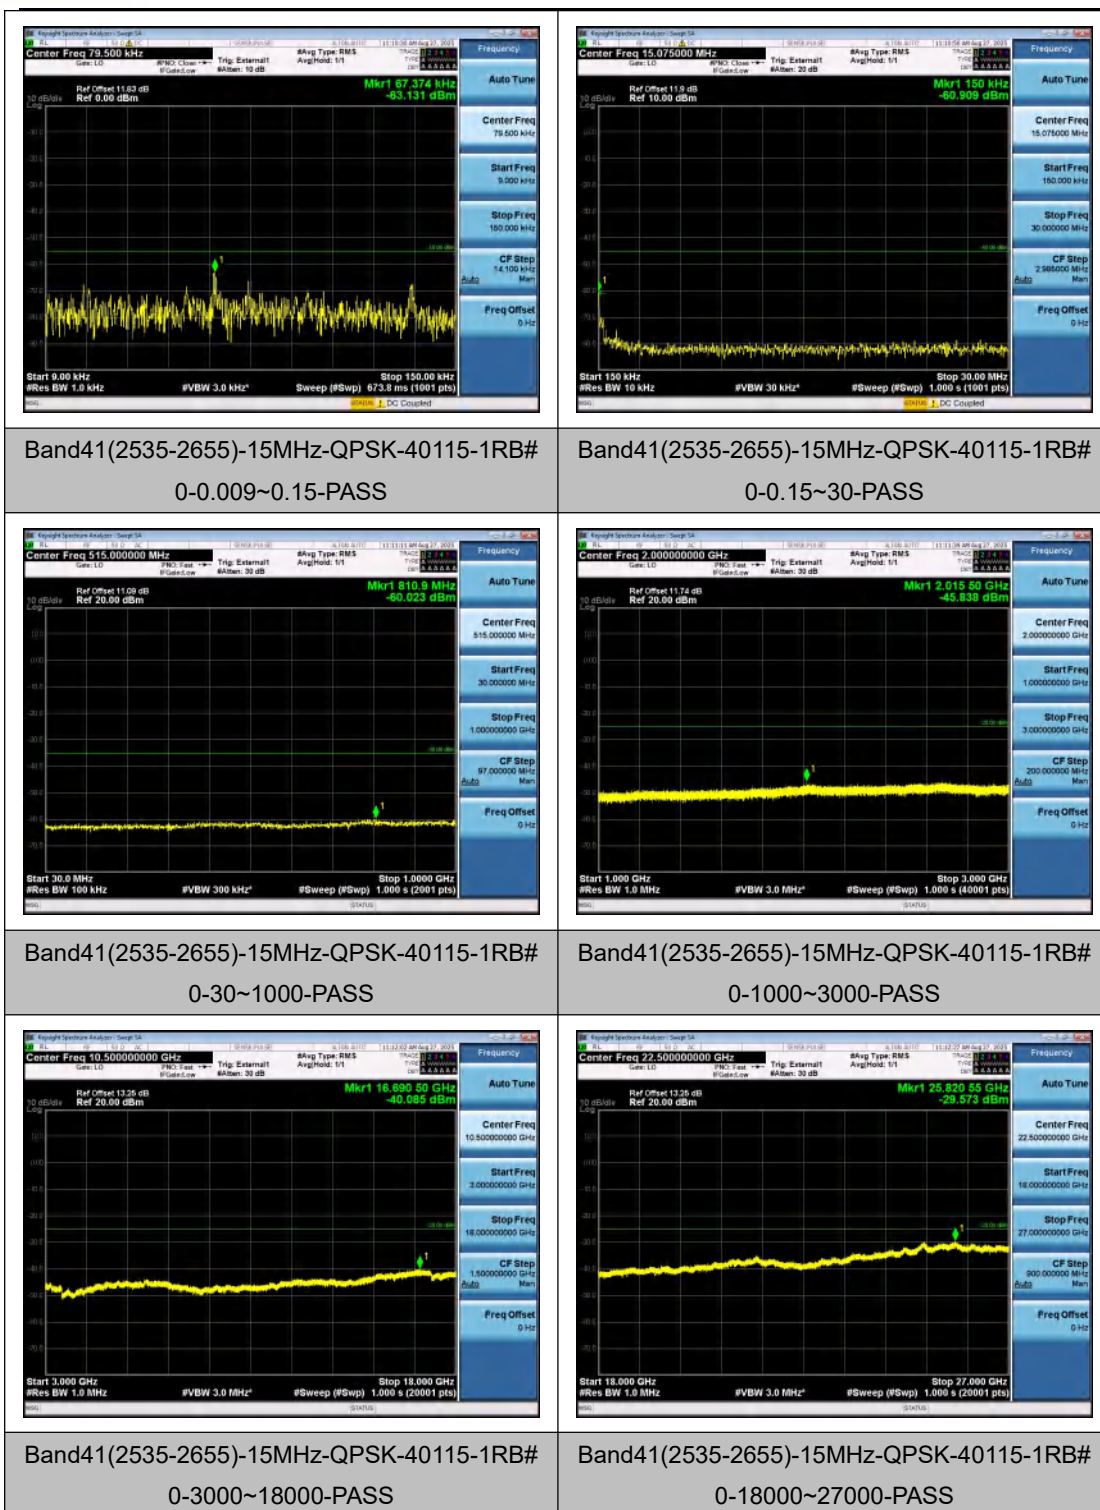


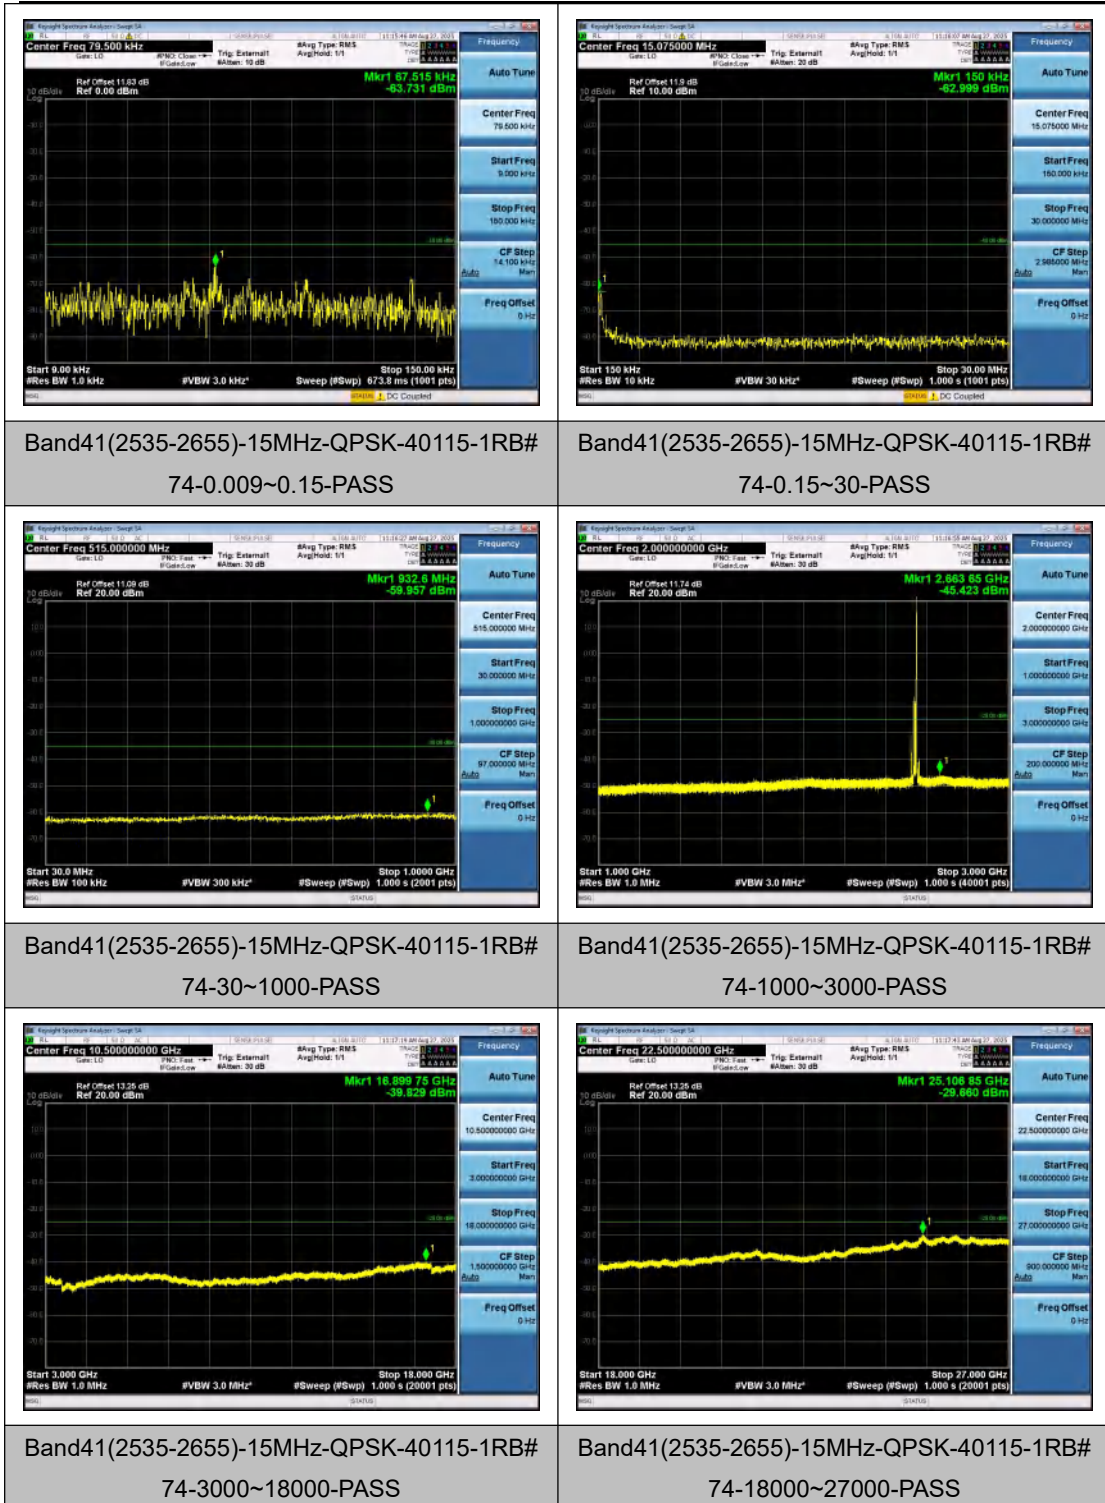

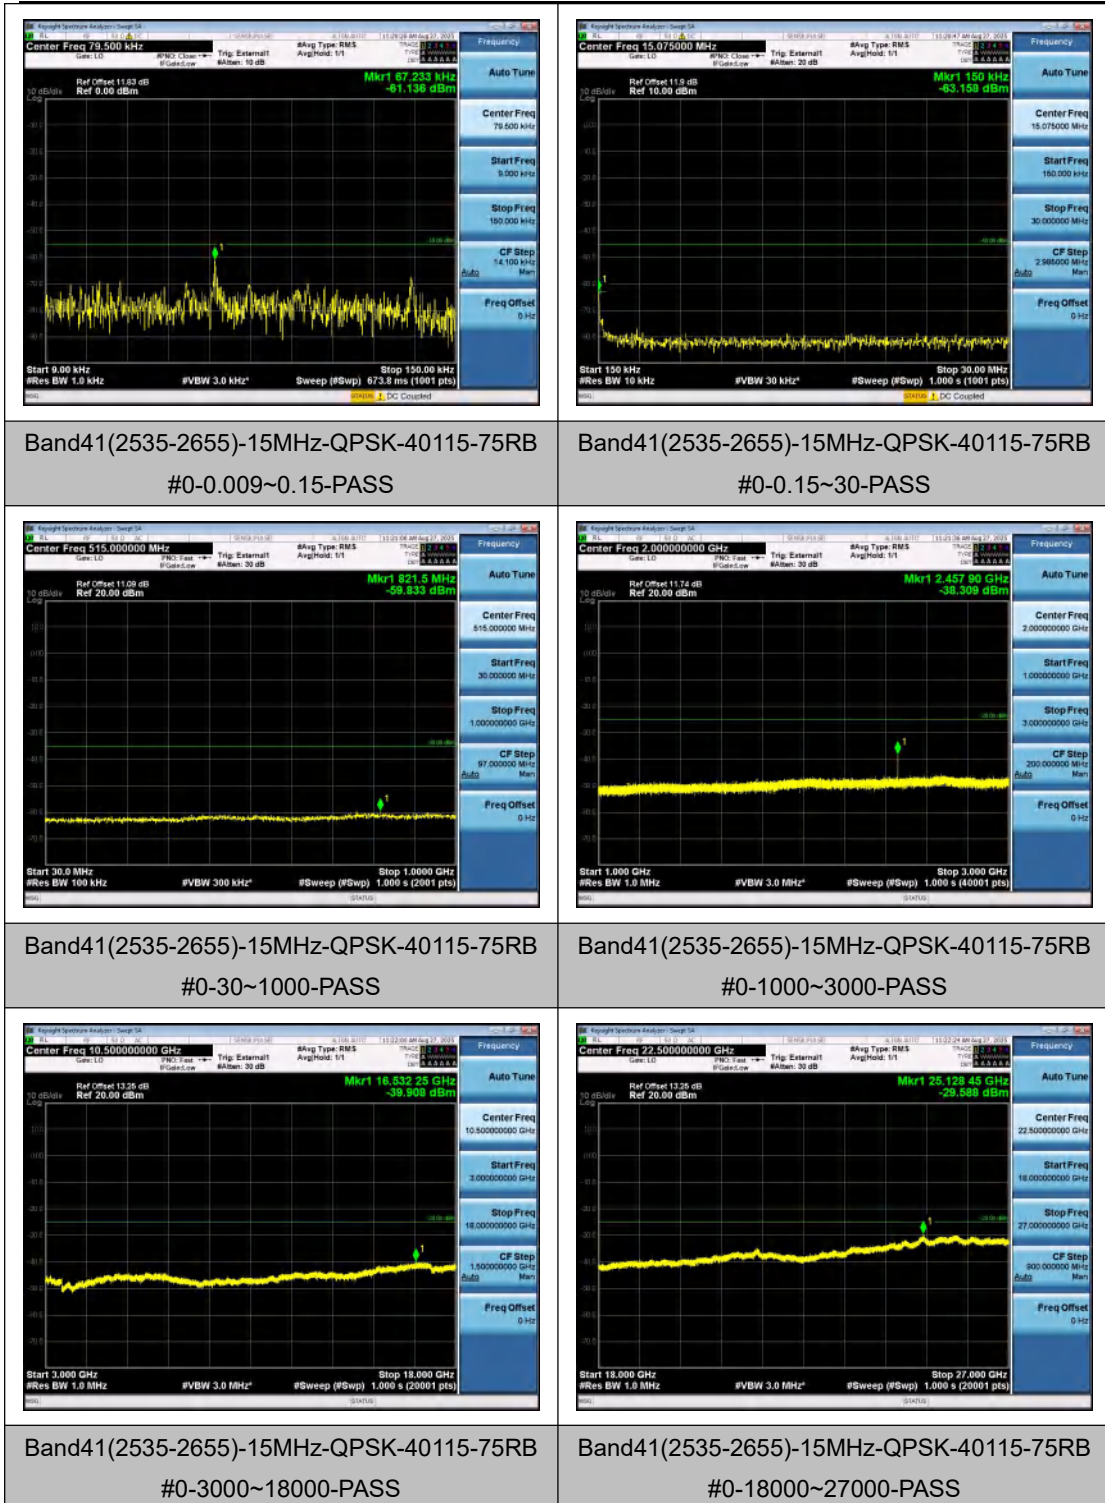


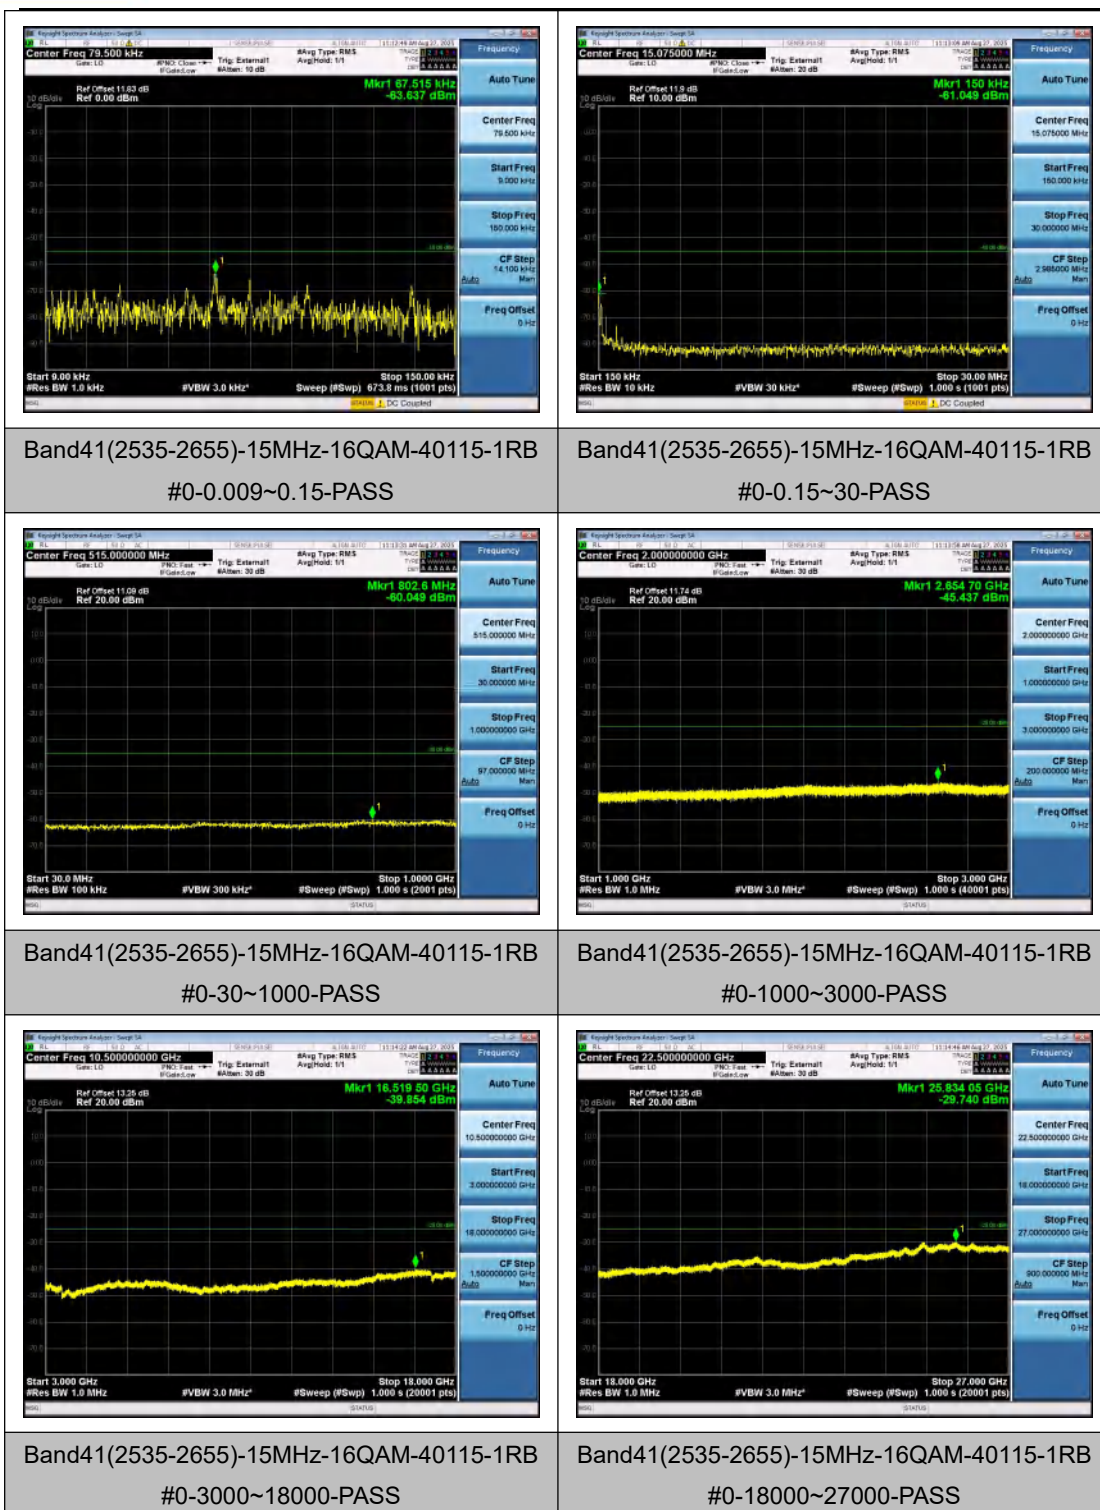

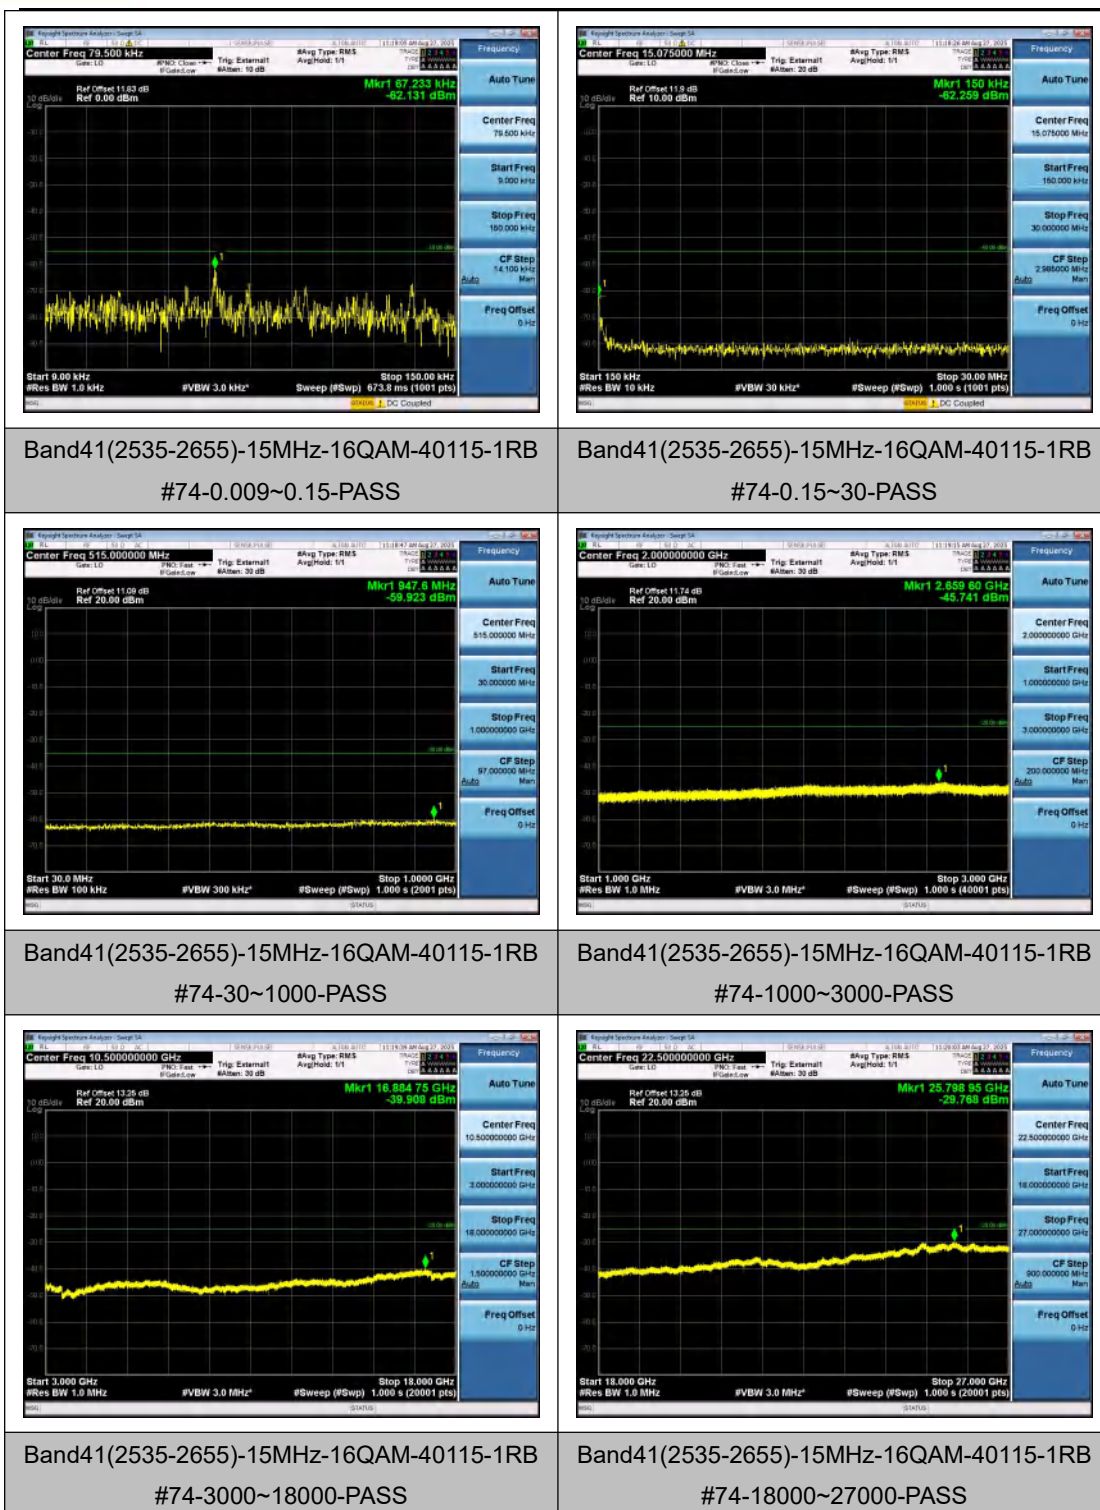


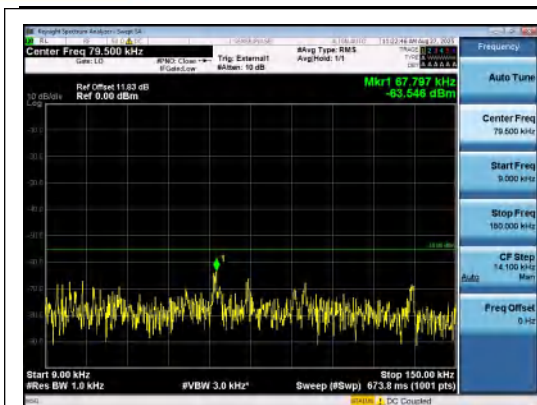


Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-0.009~0.15-PASS

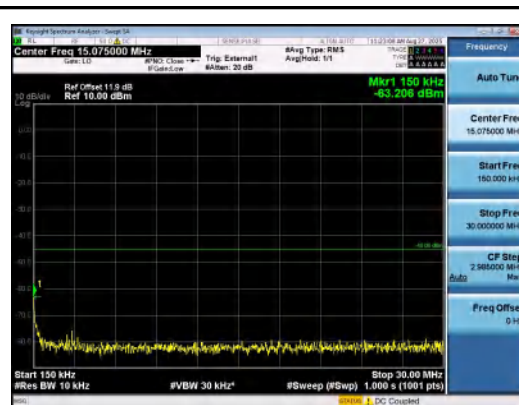


Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-0.15~30-PASS

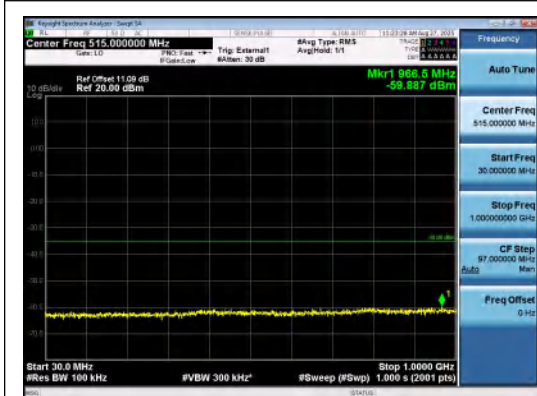

Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-30~1000-PASS

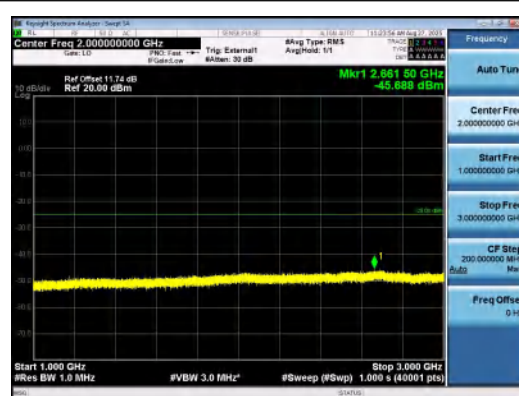


Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-1000~3000-PASS

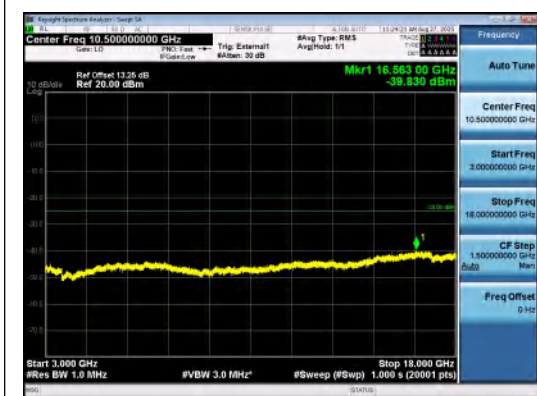



Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-3000~18000-PASS





Band41(2535-2655)-15MHz-16QAM-40115-75R
B#0-18000~27000-PASS

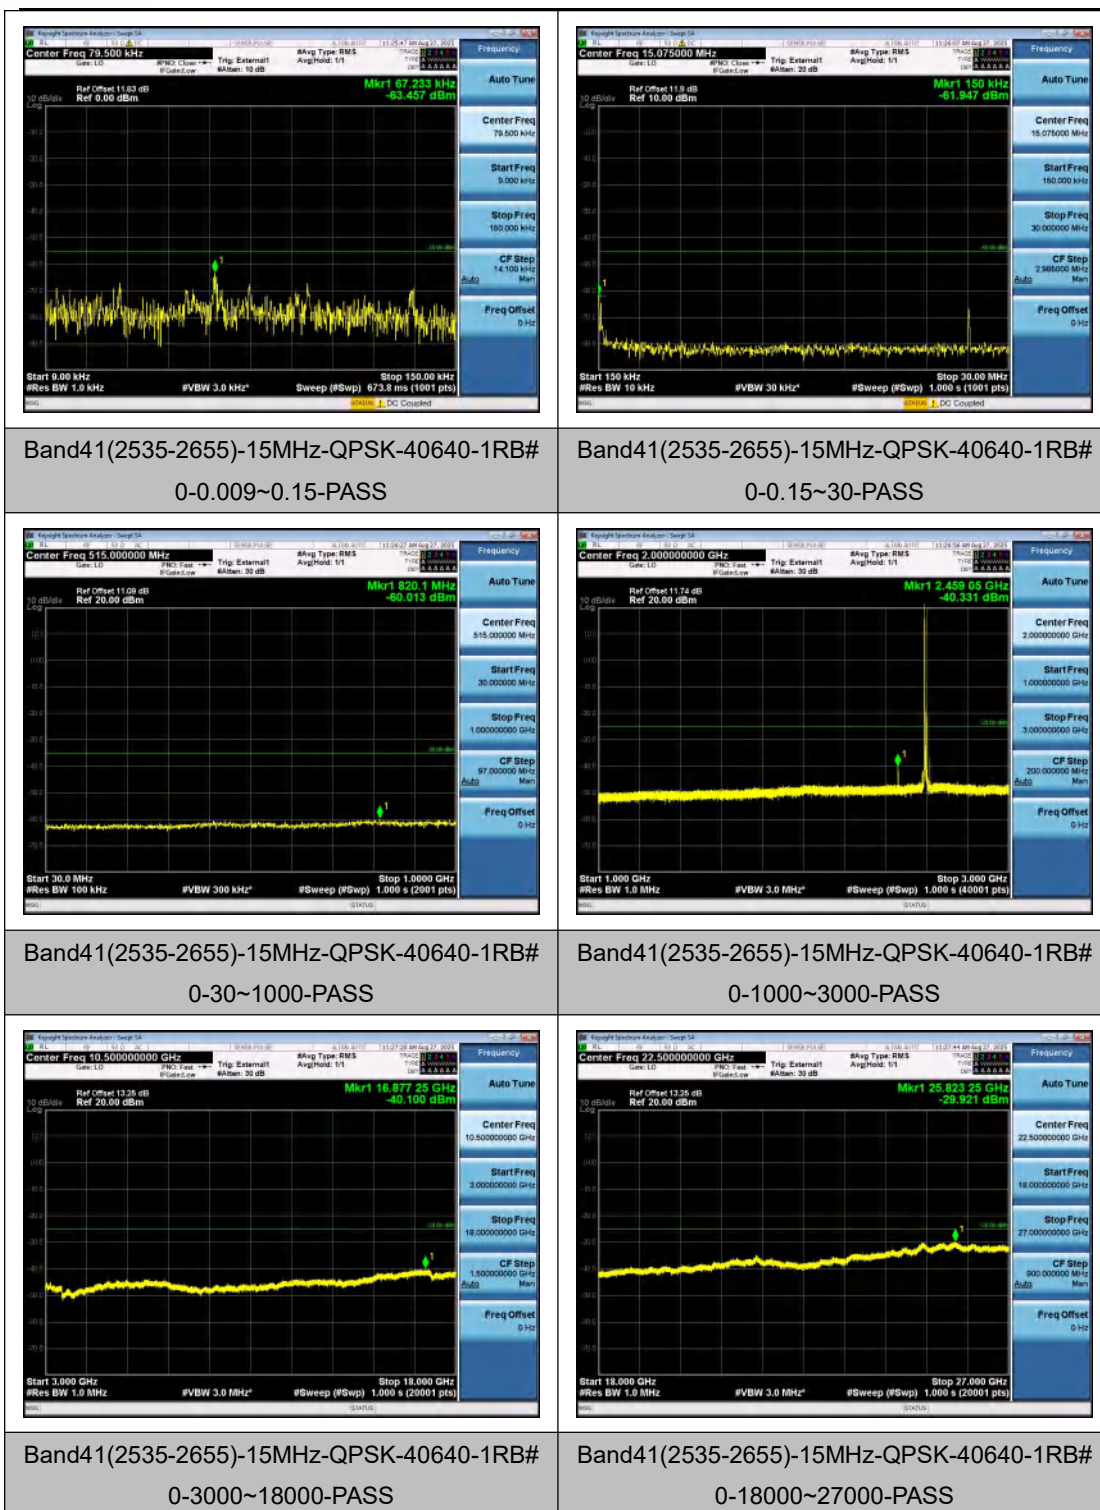


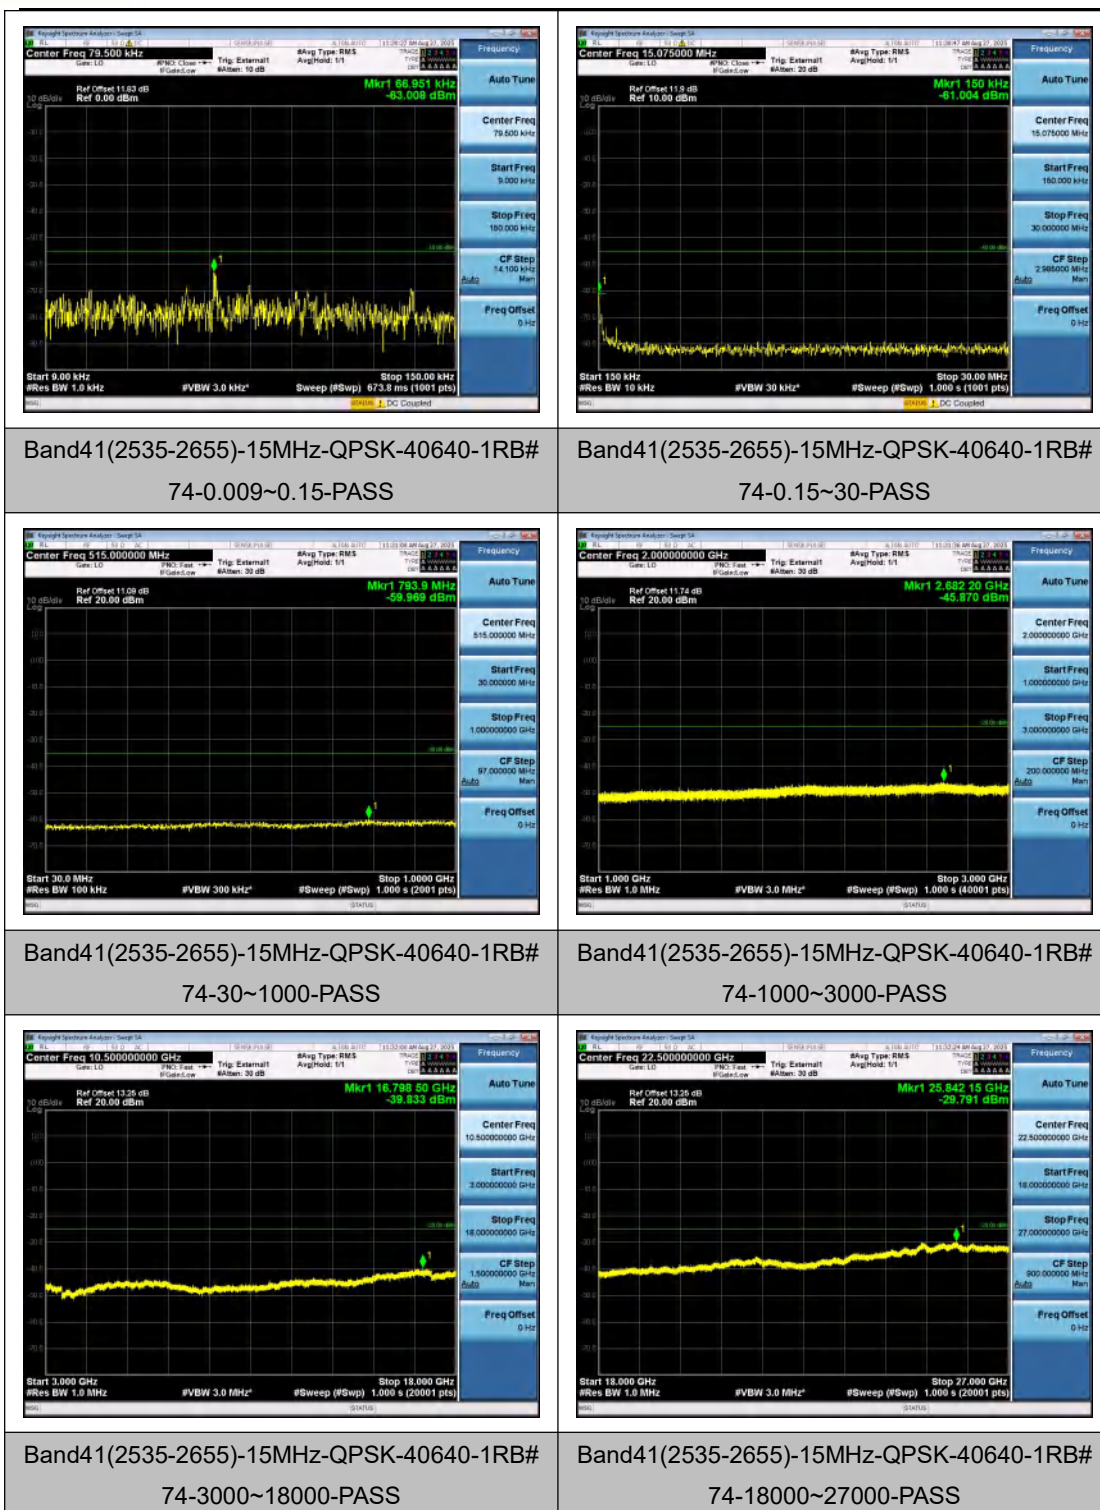


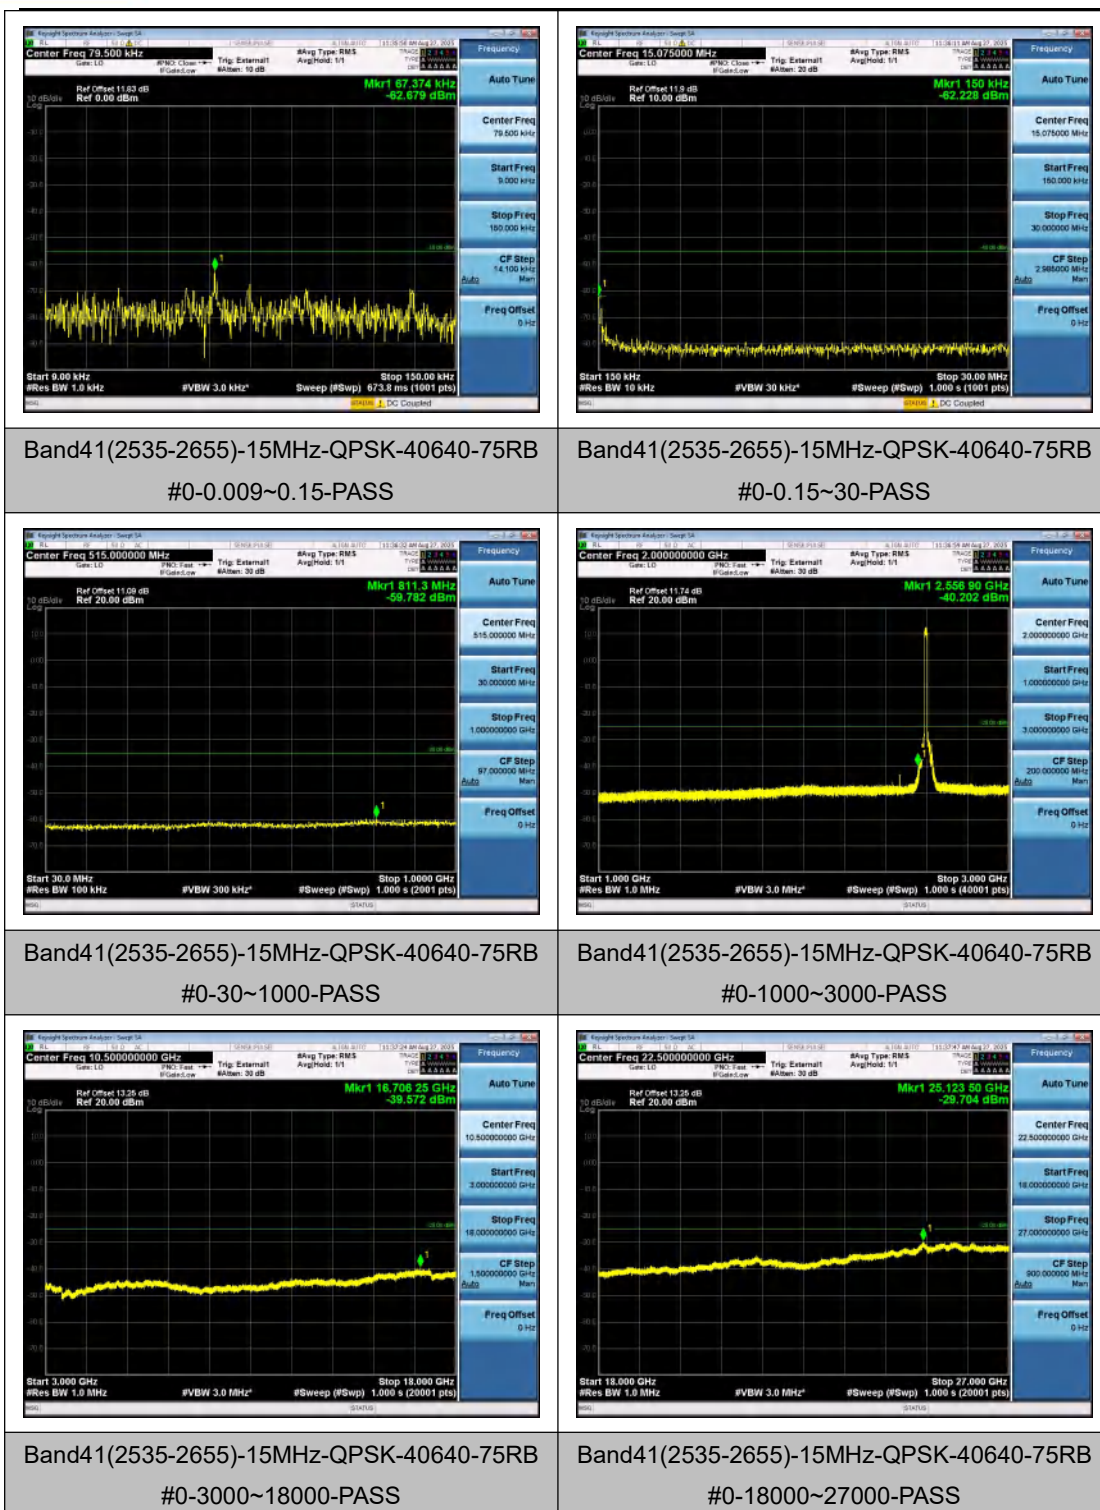


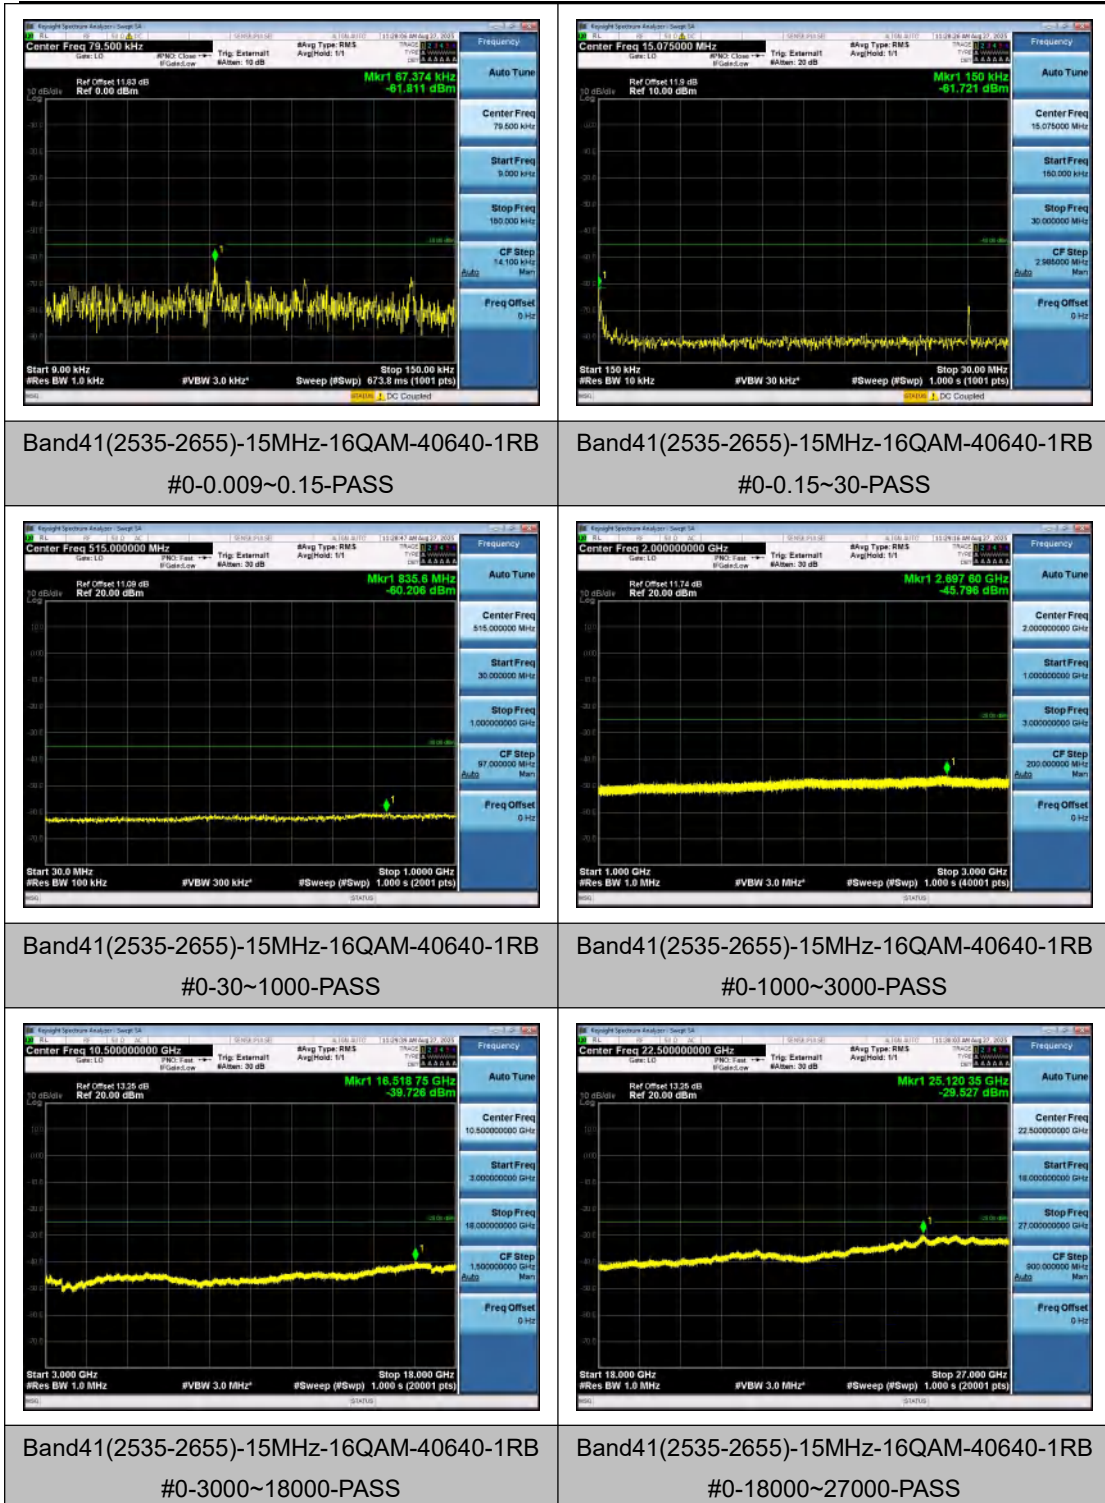


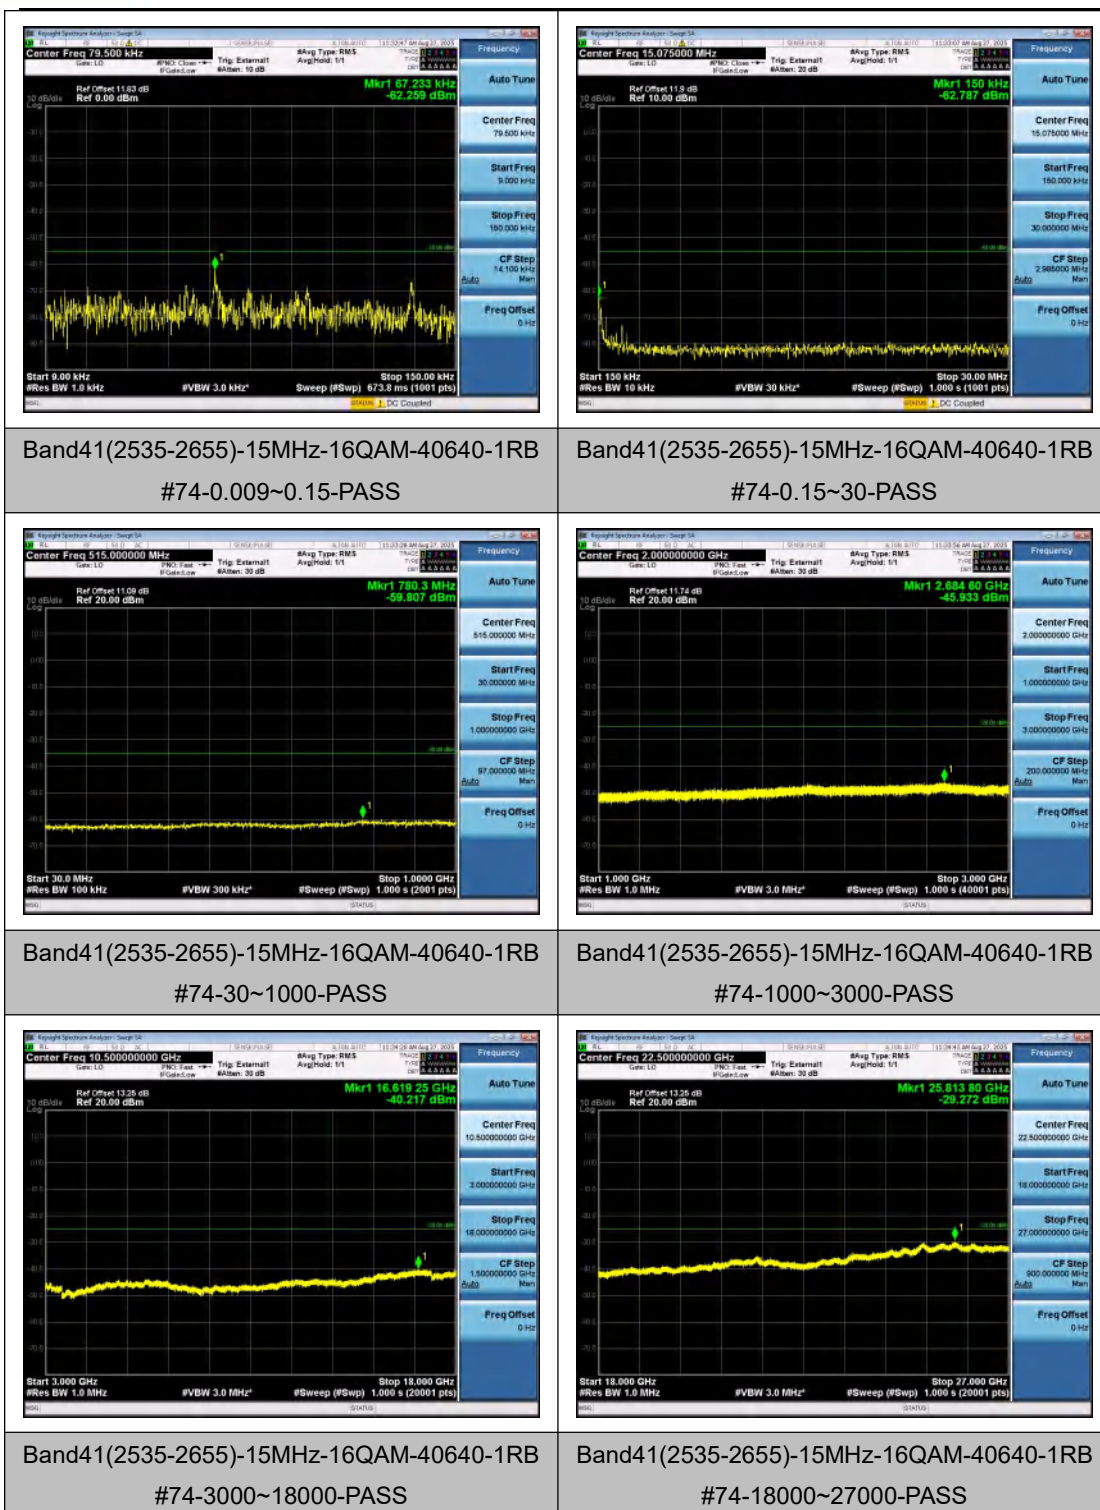


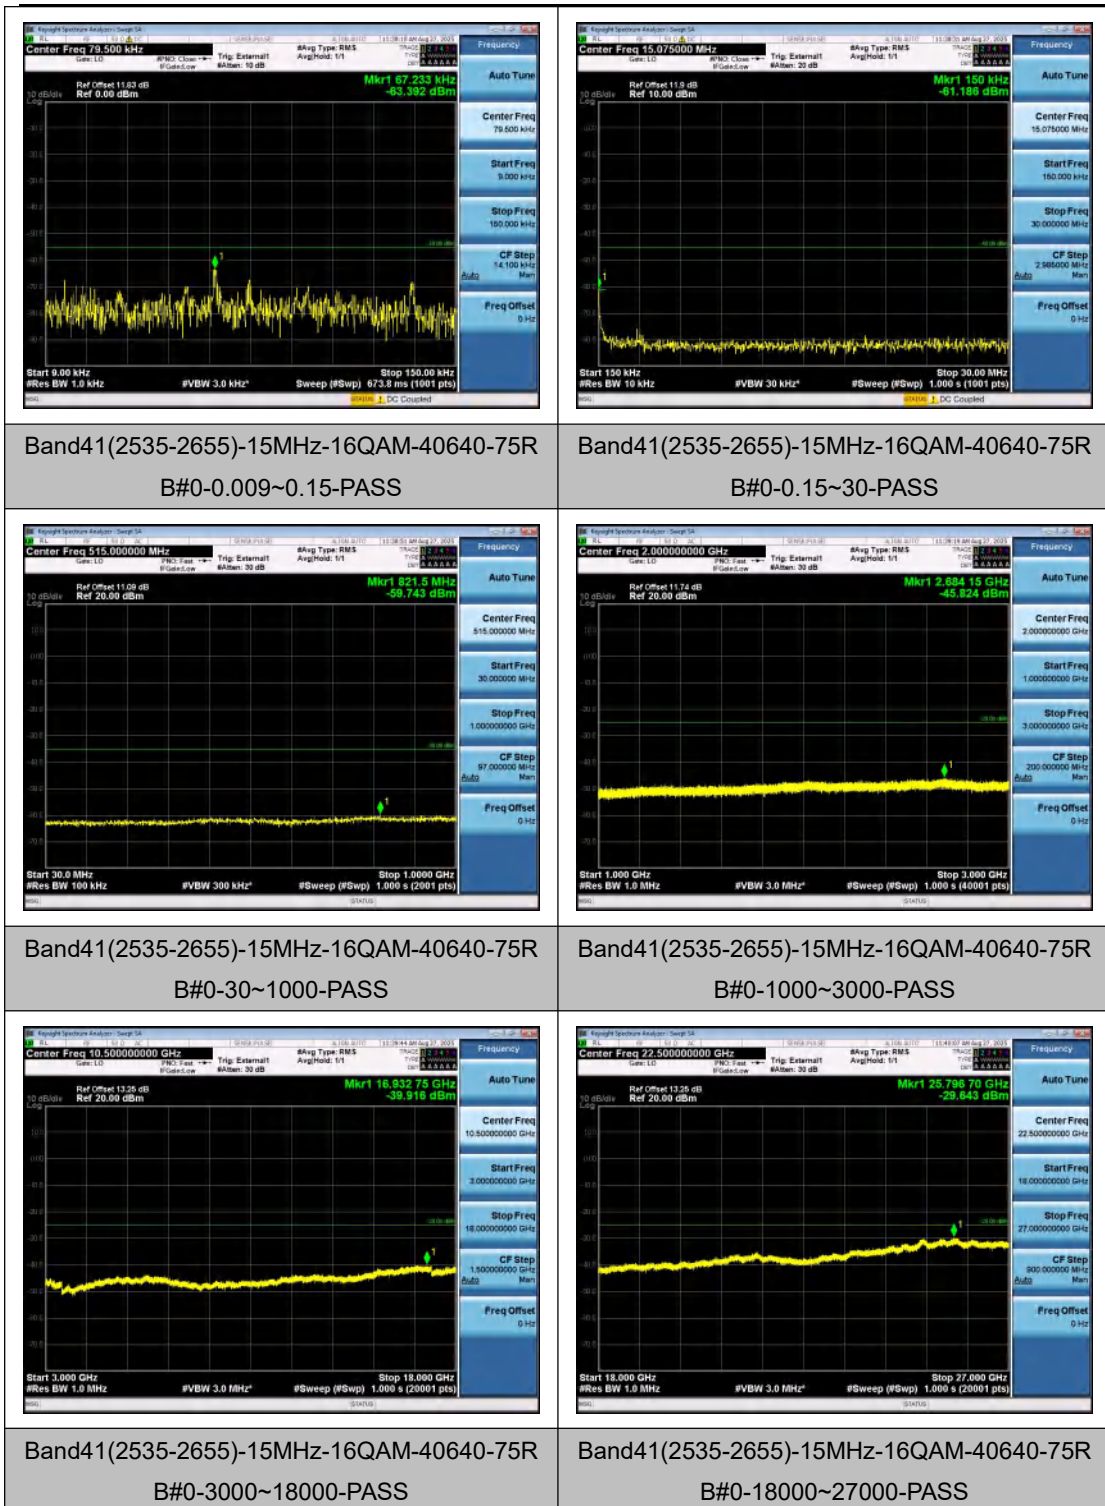


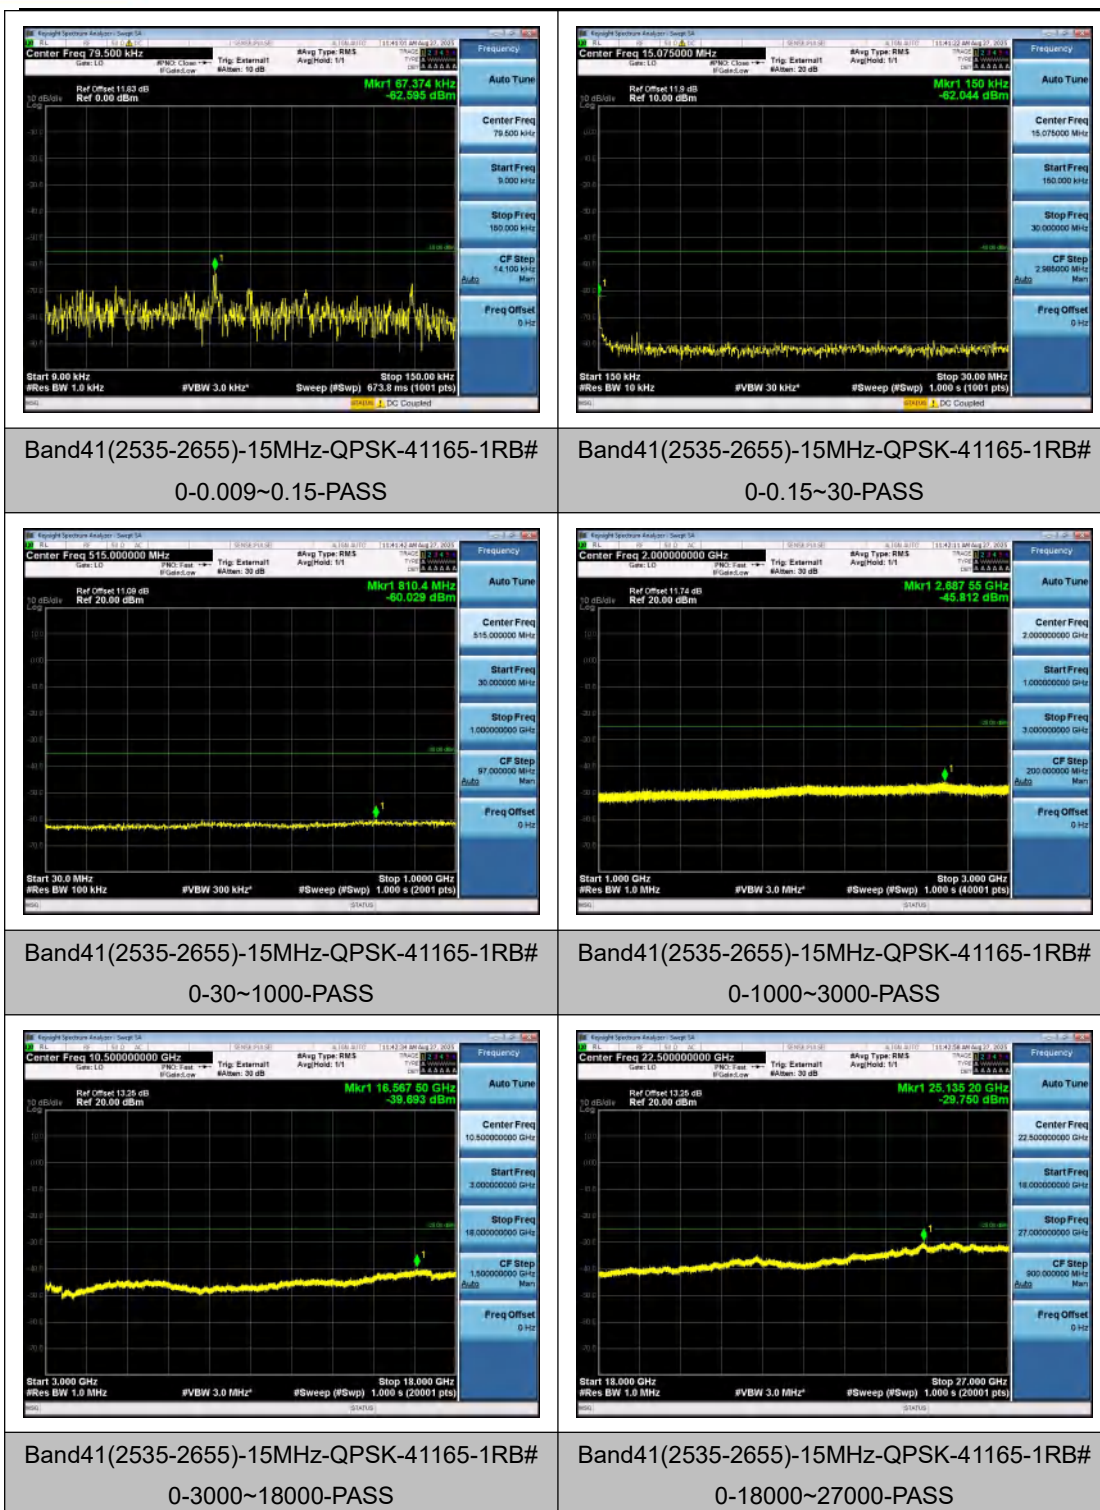

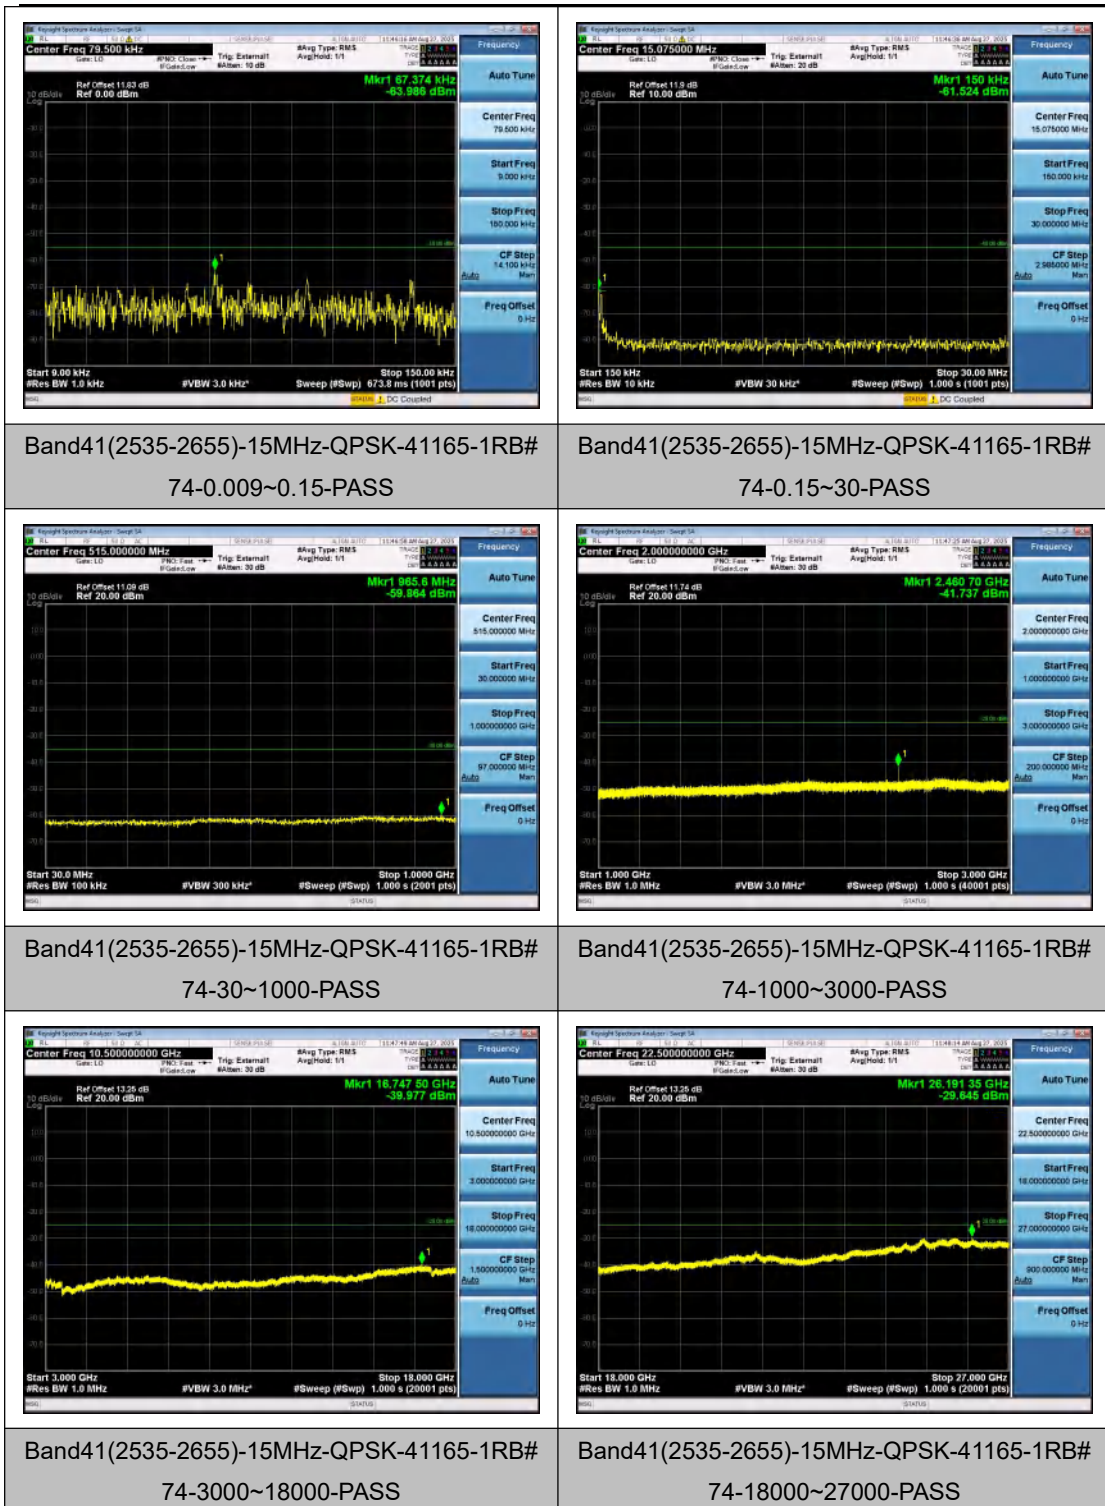


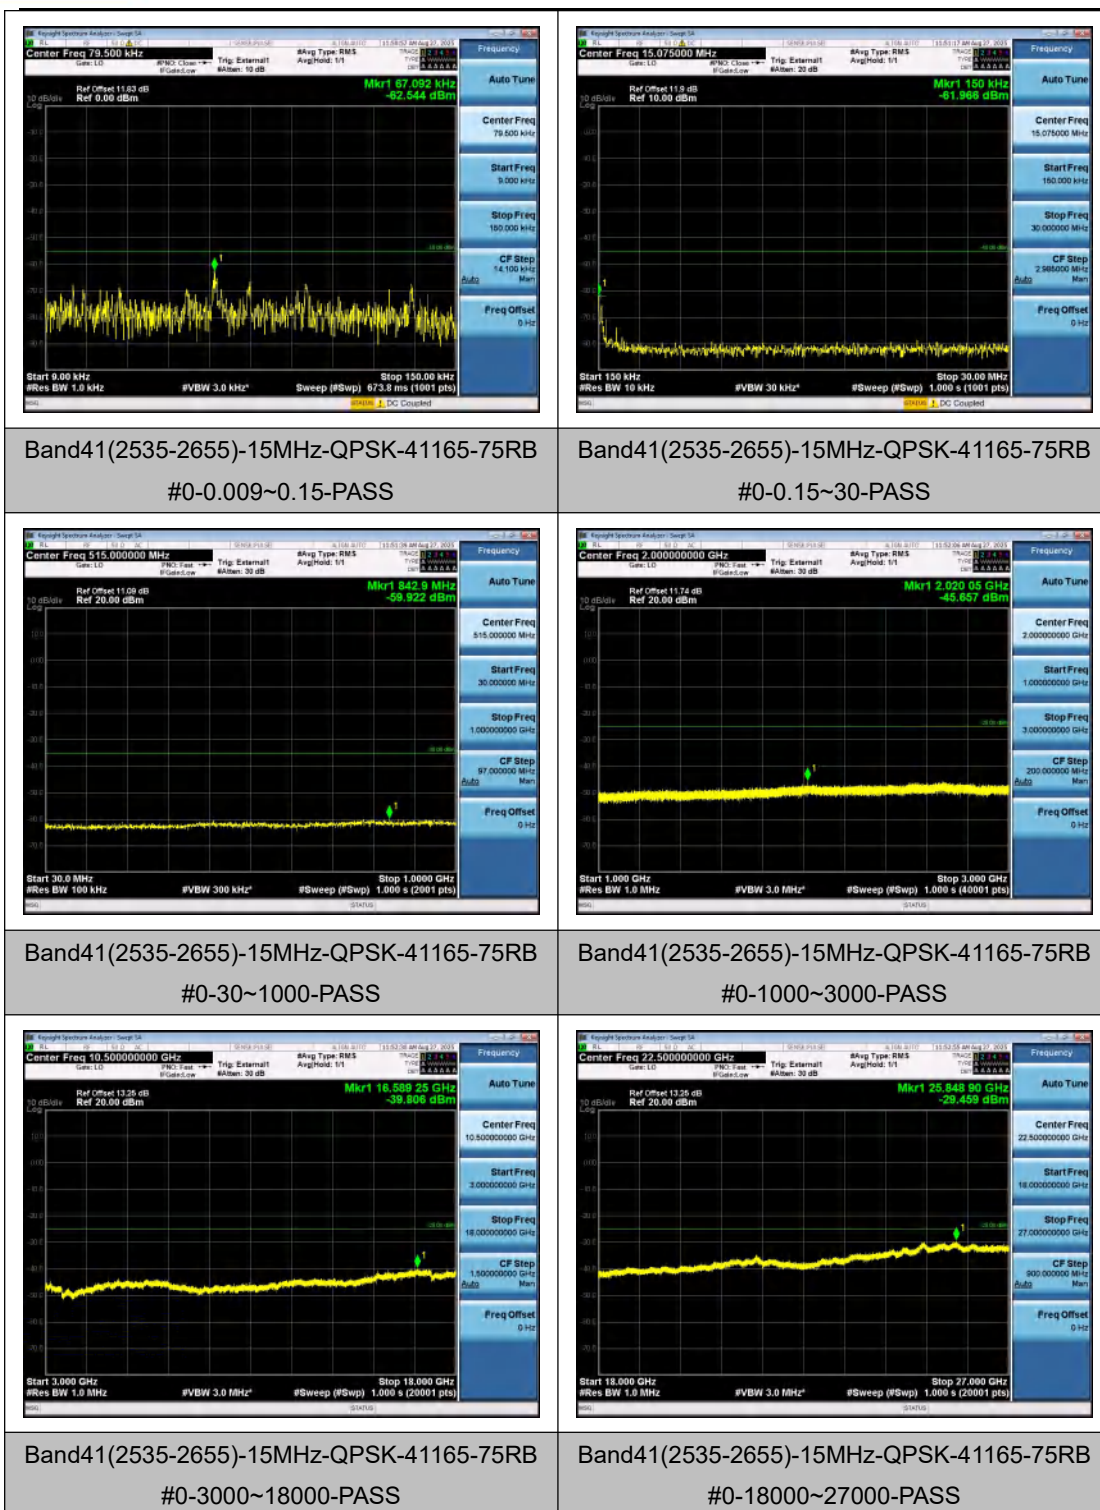

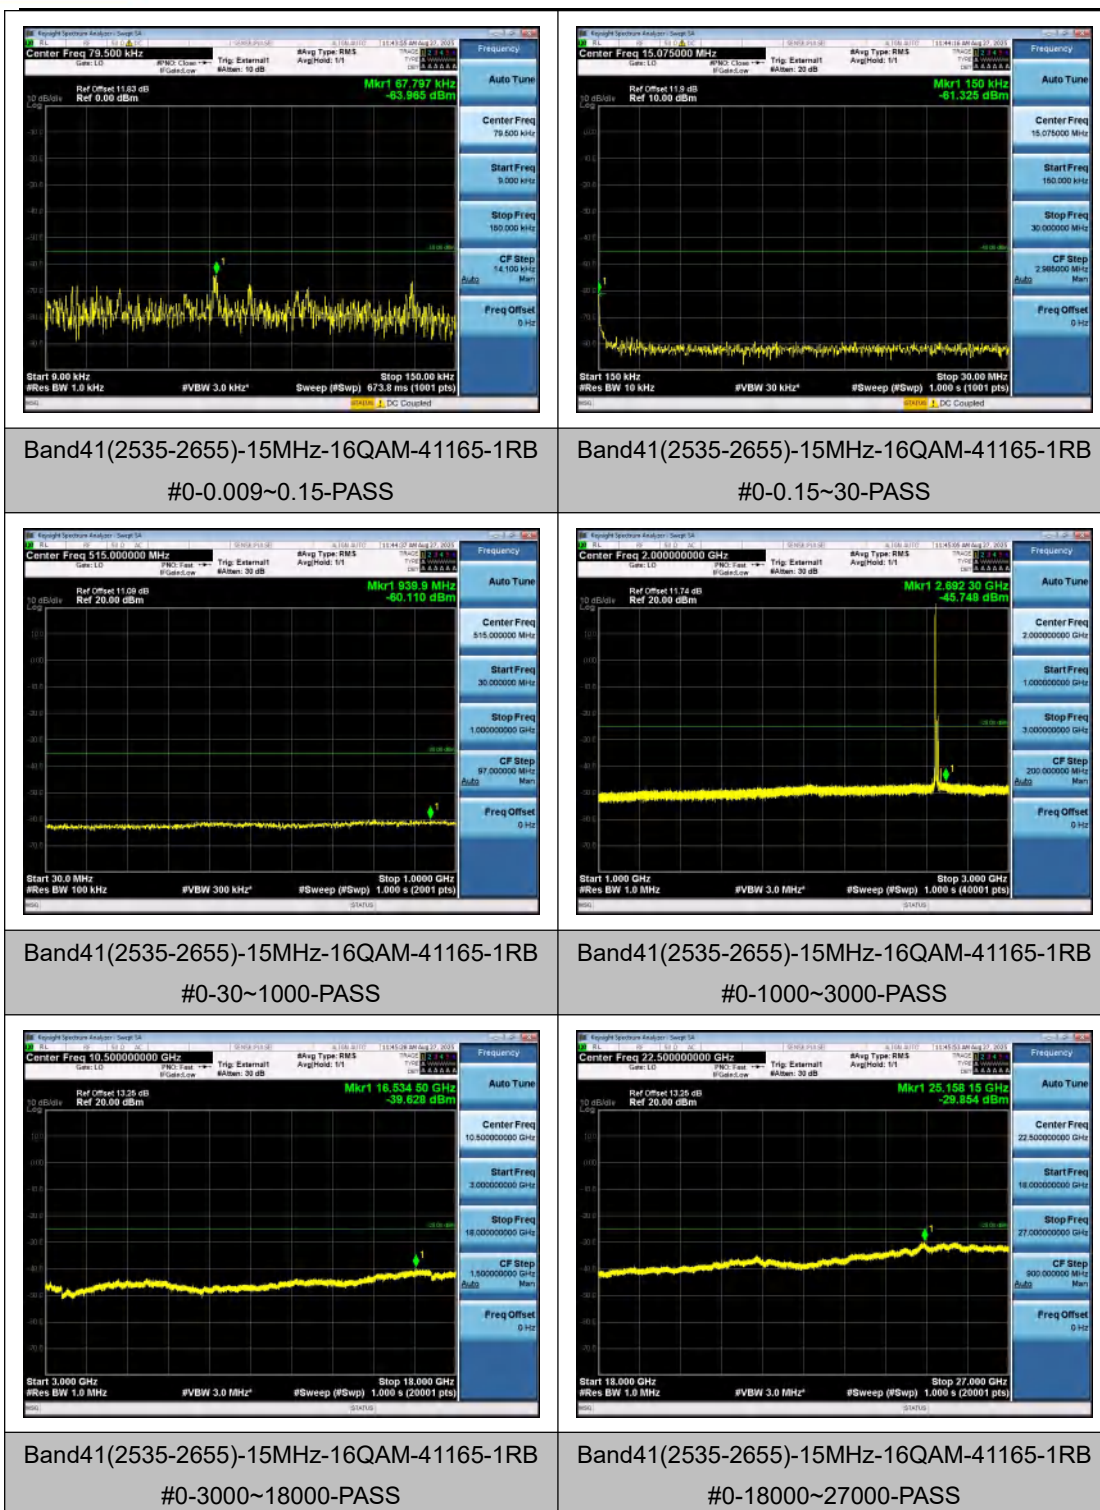


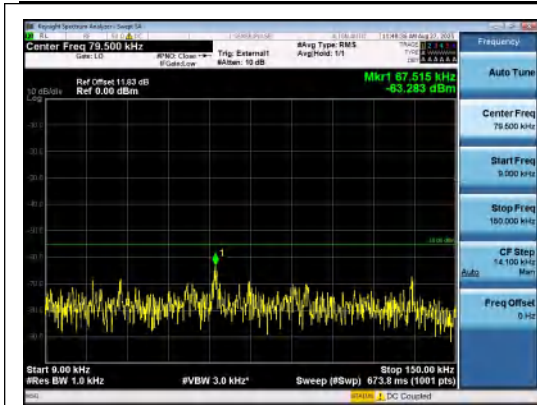


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-0.009~0.15-PASS

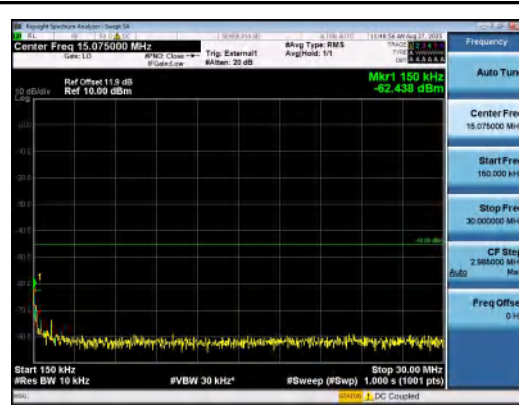


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-0.15~30-PASS

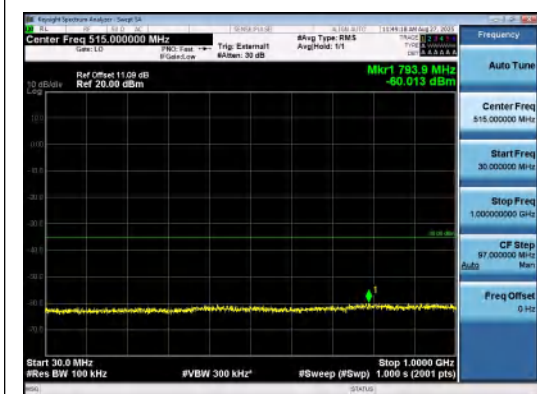


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-30~1000-PASS

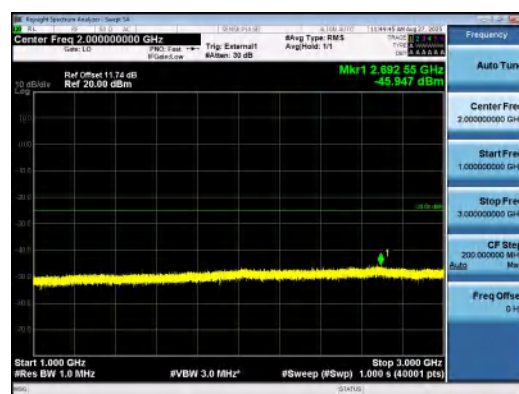


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-1000~3000-PASS

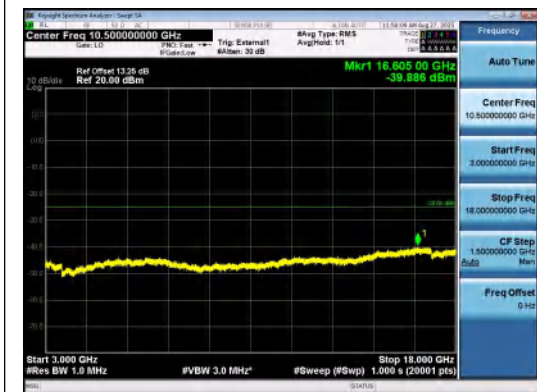


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-3000~18000-PASS

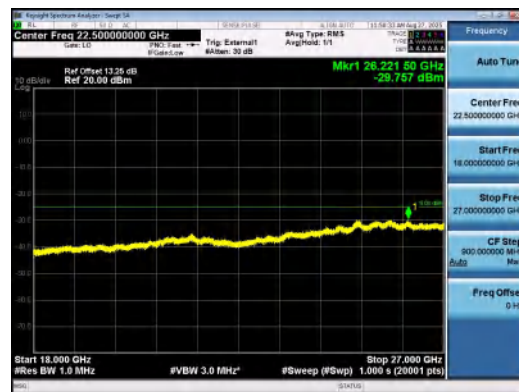


Band41(2535-2655)-15MHz-16QAM-41165-1RB
#74-18000~27000-PASS

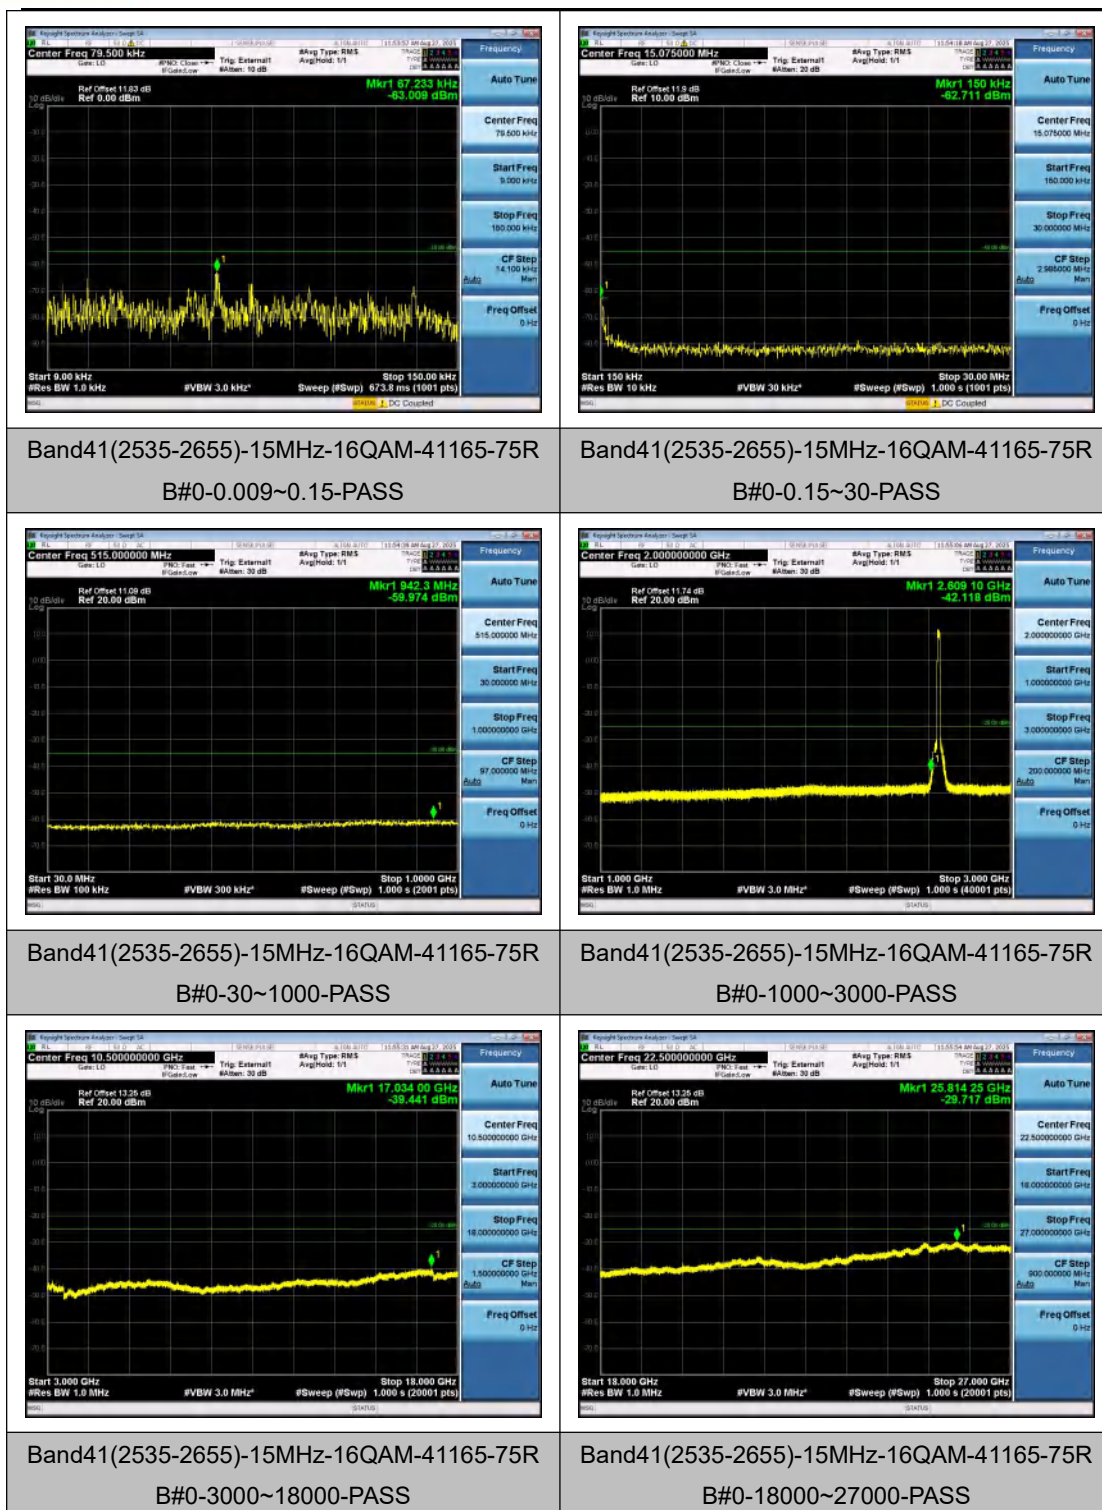


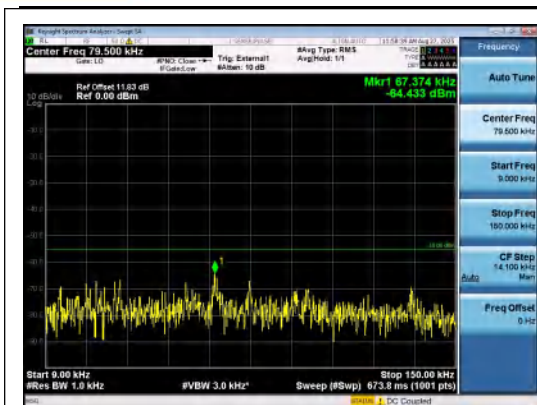


Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-0.009~0.15-PASS

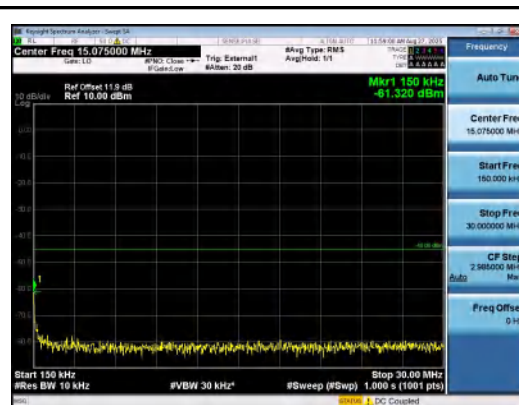


Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-0.15~30-PASS

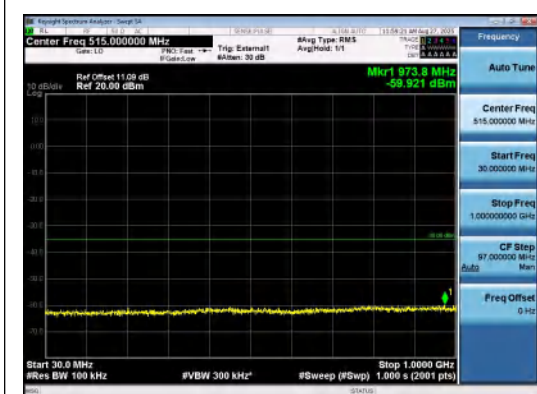


Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-30~1000-PASS

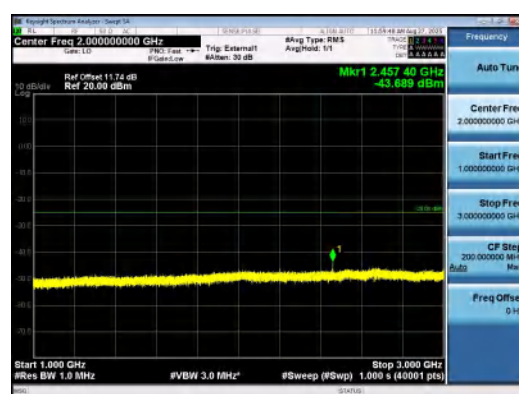


Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-1000~3000-PASS

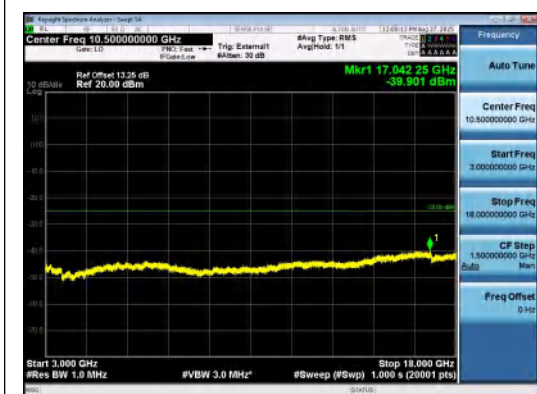



Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-3000~18000-PASS

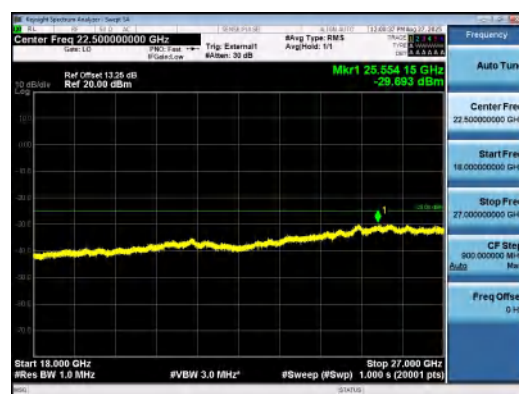


Band41(2535-2655)-20MHz-QPSK-40140-1RB#
0-18000~27000-PASS

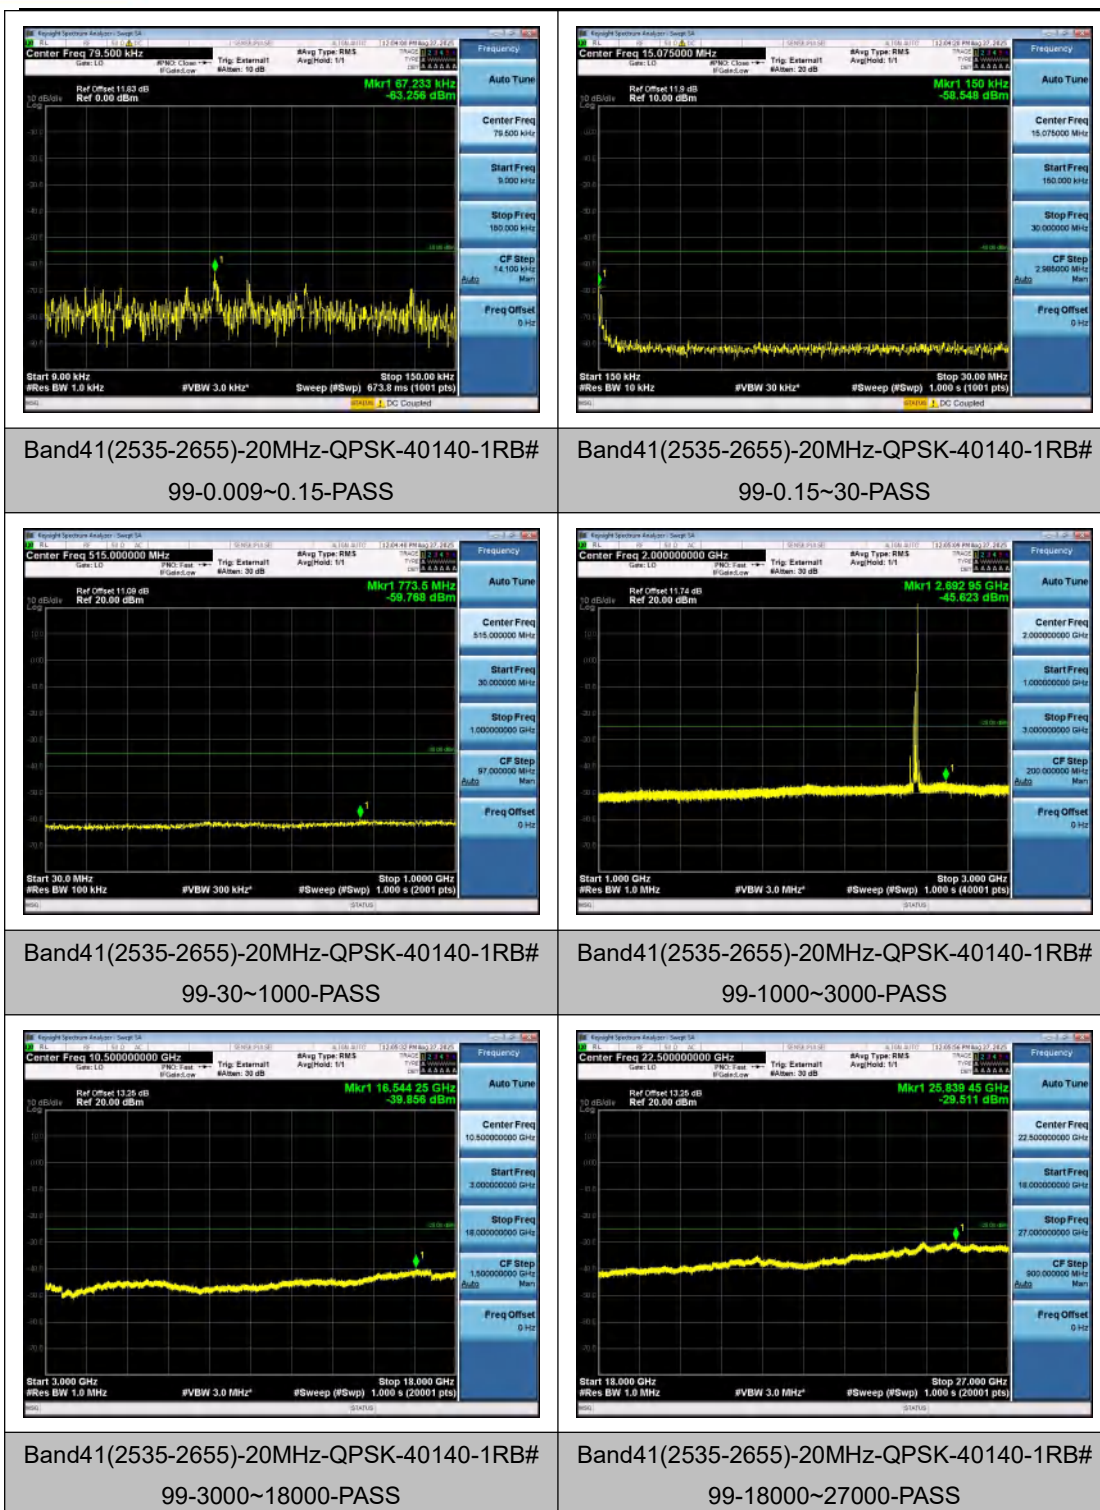

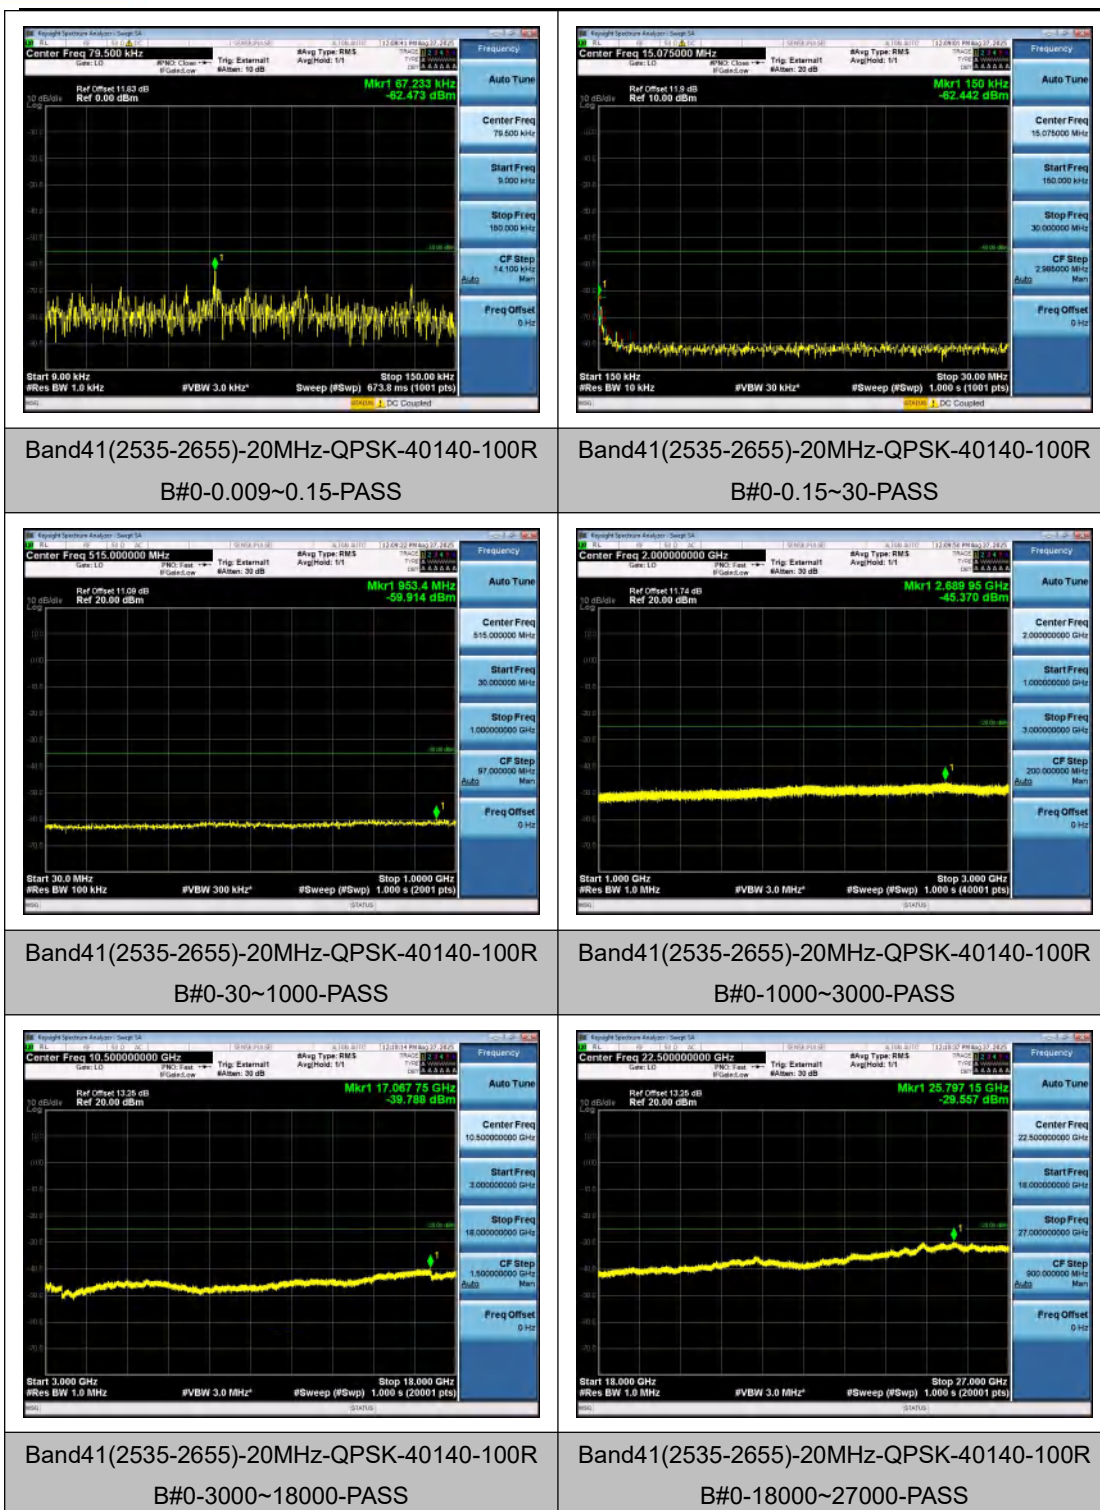

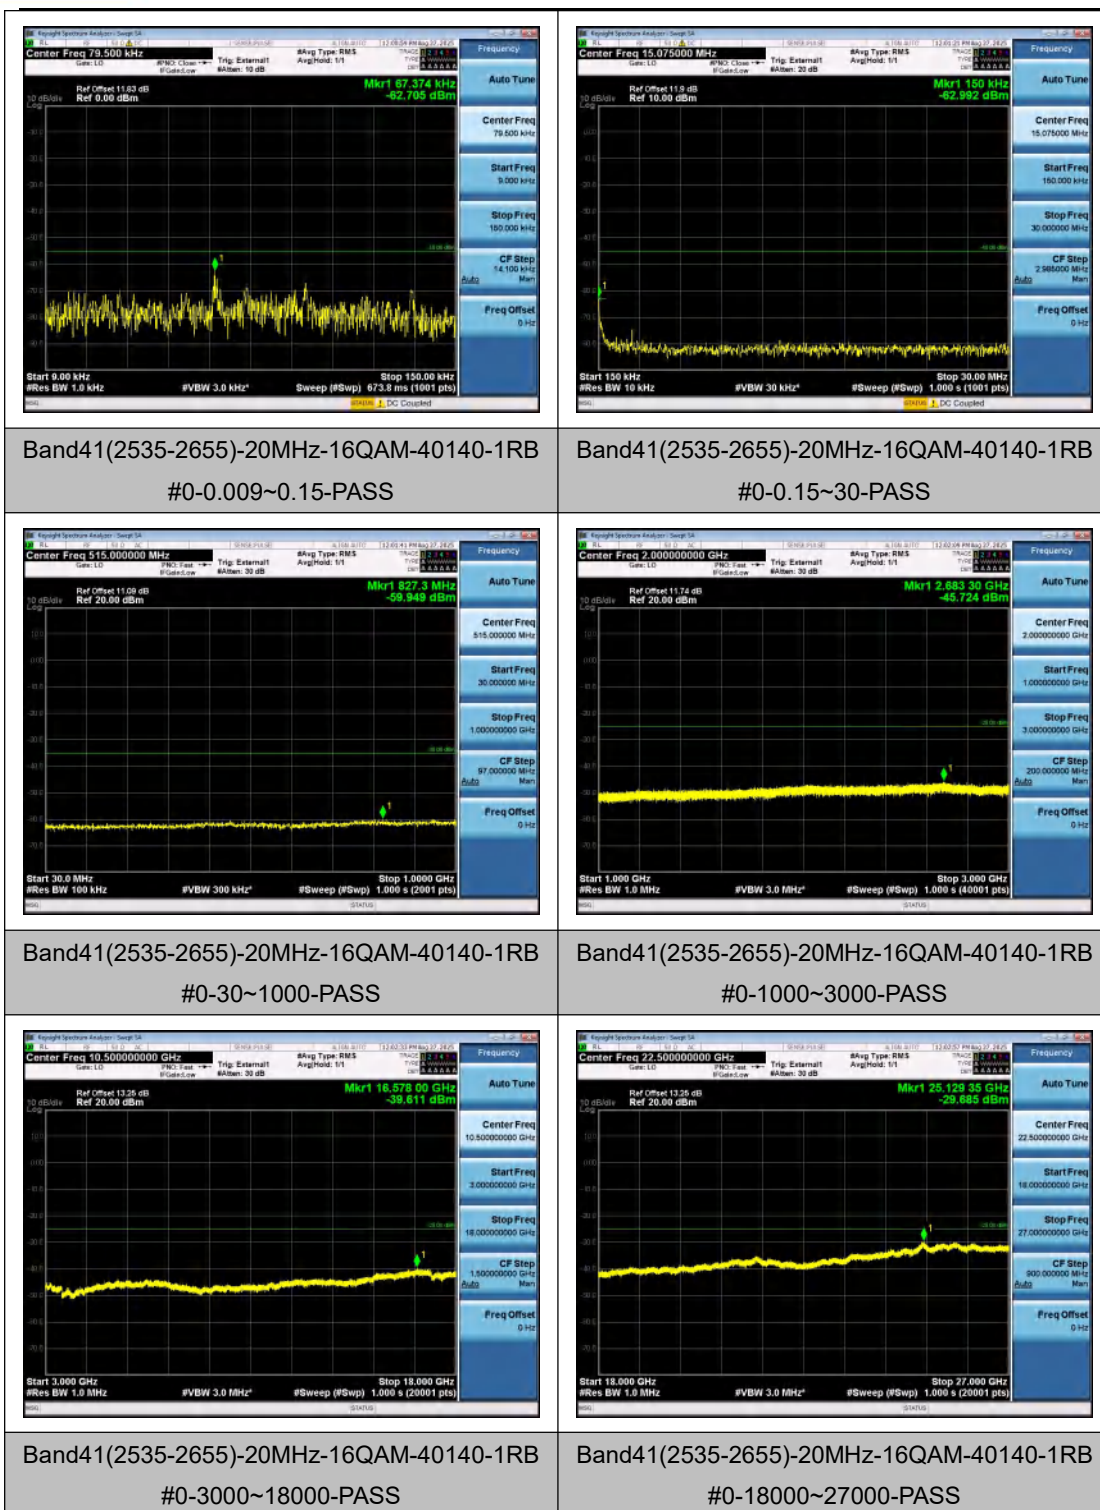


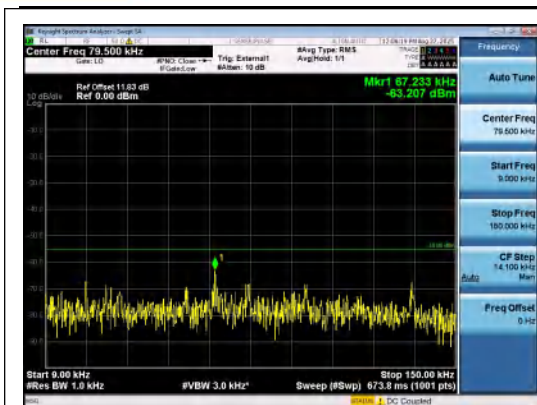


Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-0.009~0.15-PASS




Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-0.15~30-PASS

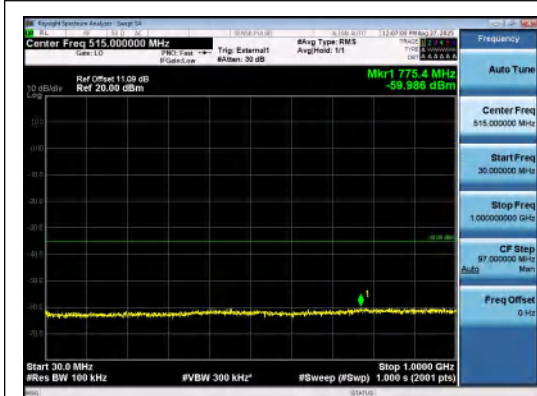


Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-30~1000-PASS

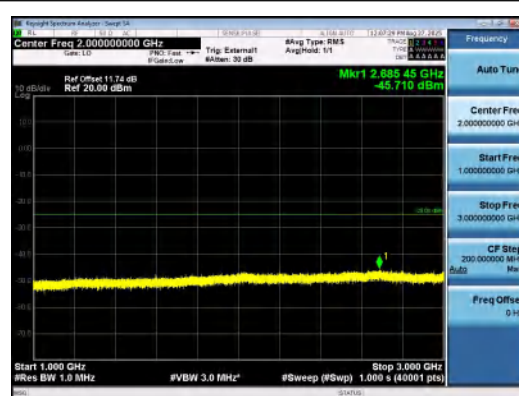


Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-1000~3000-PASS

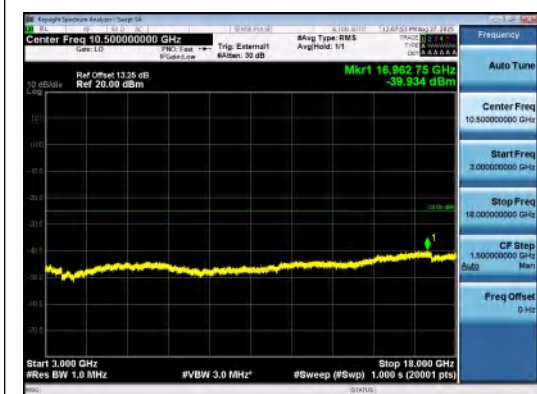



Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-3000~18000-PASS

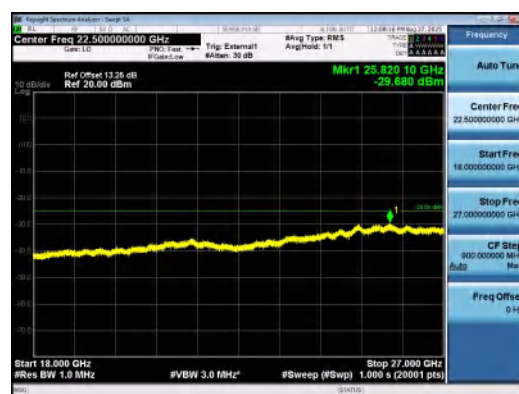



Band41(2535-2655)-20MHz-16QAM-40140-1RB
#99-18000~27000-PASS

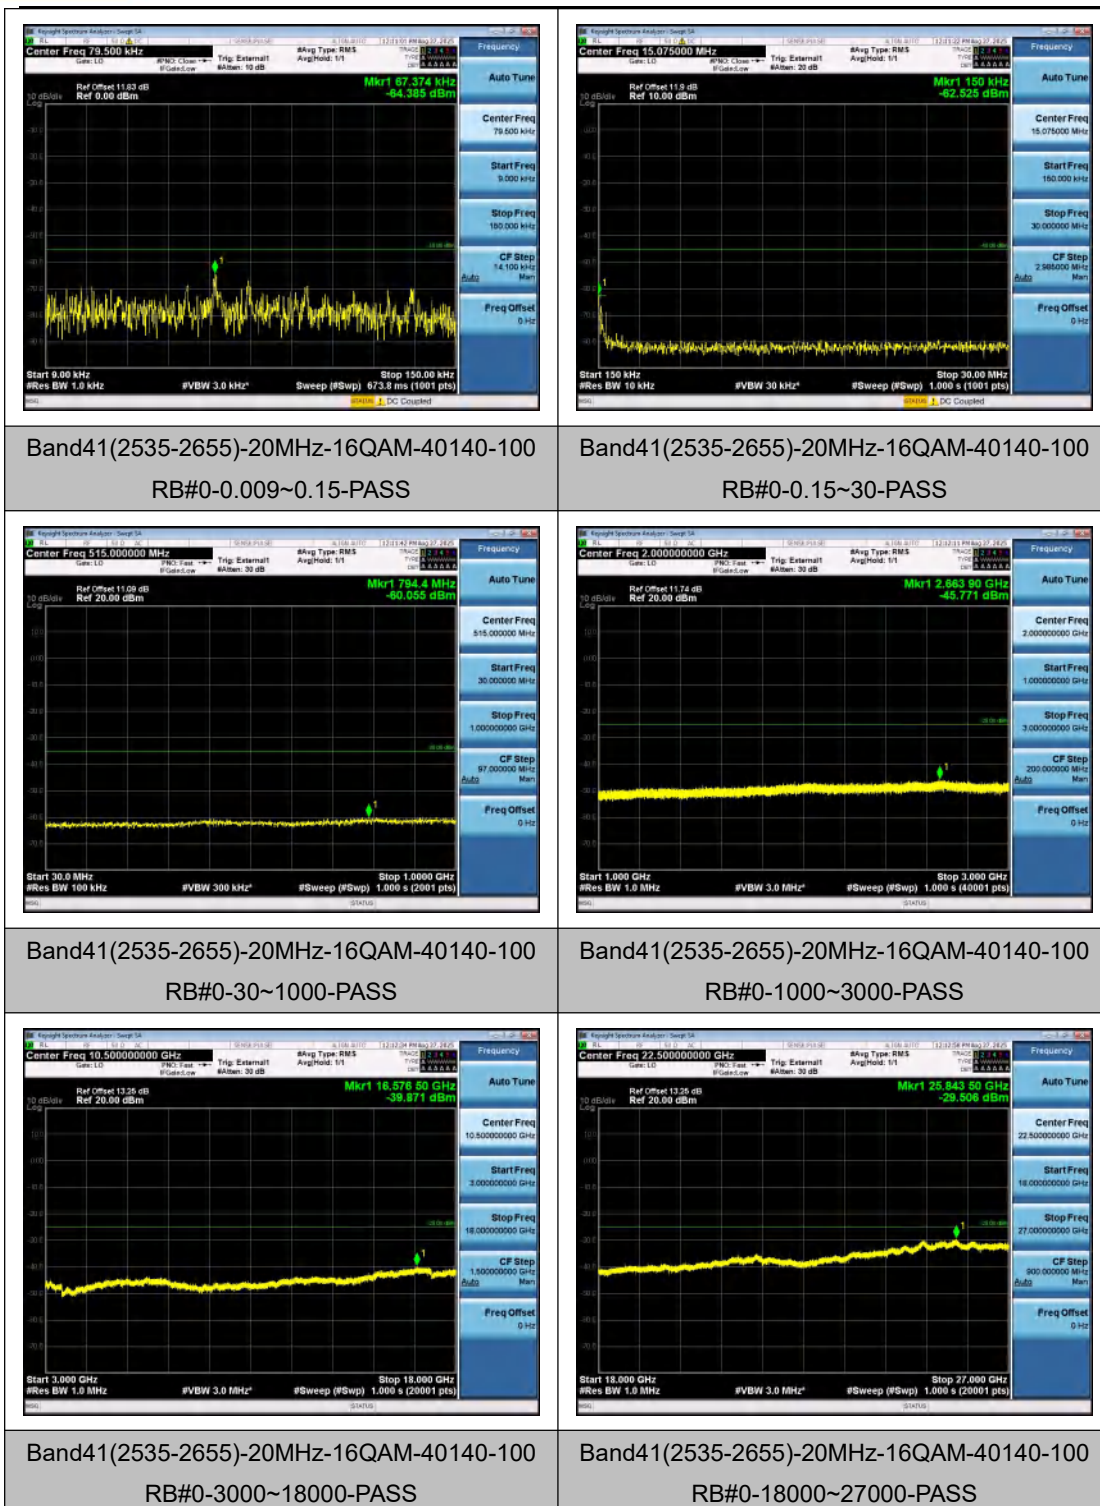


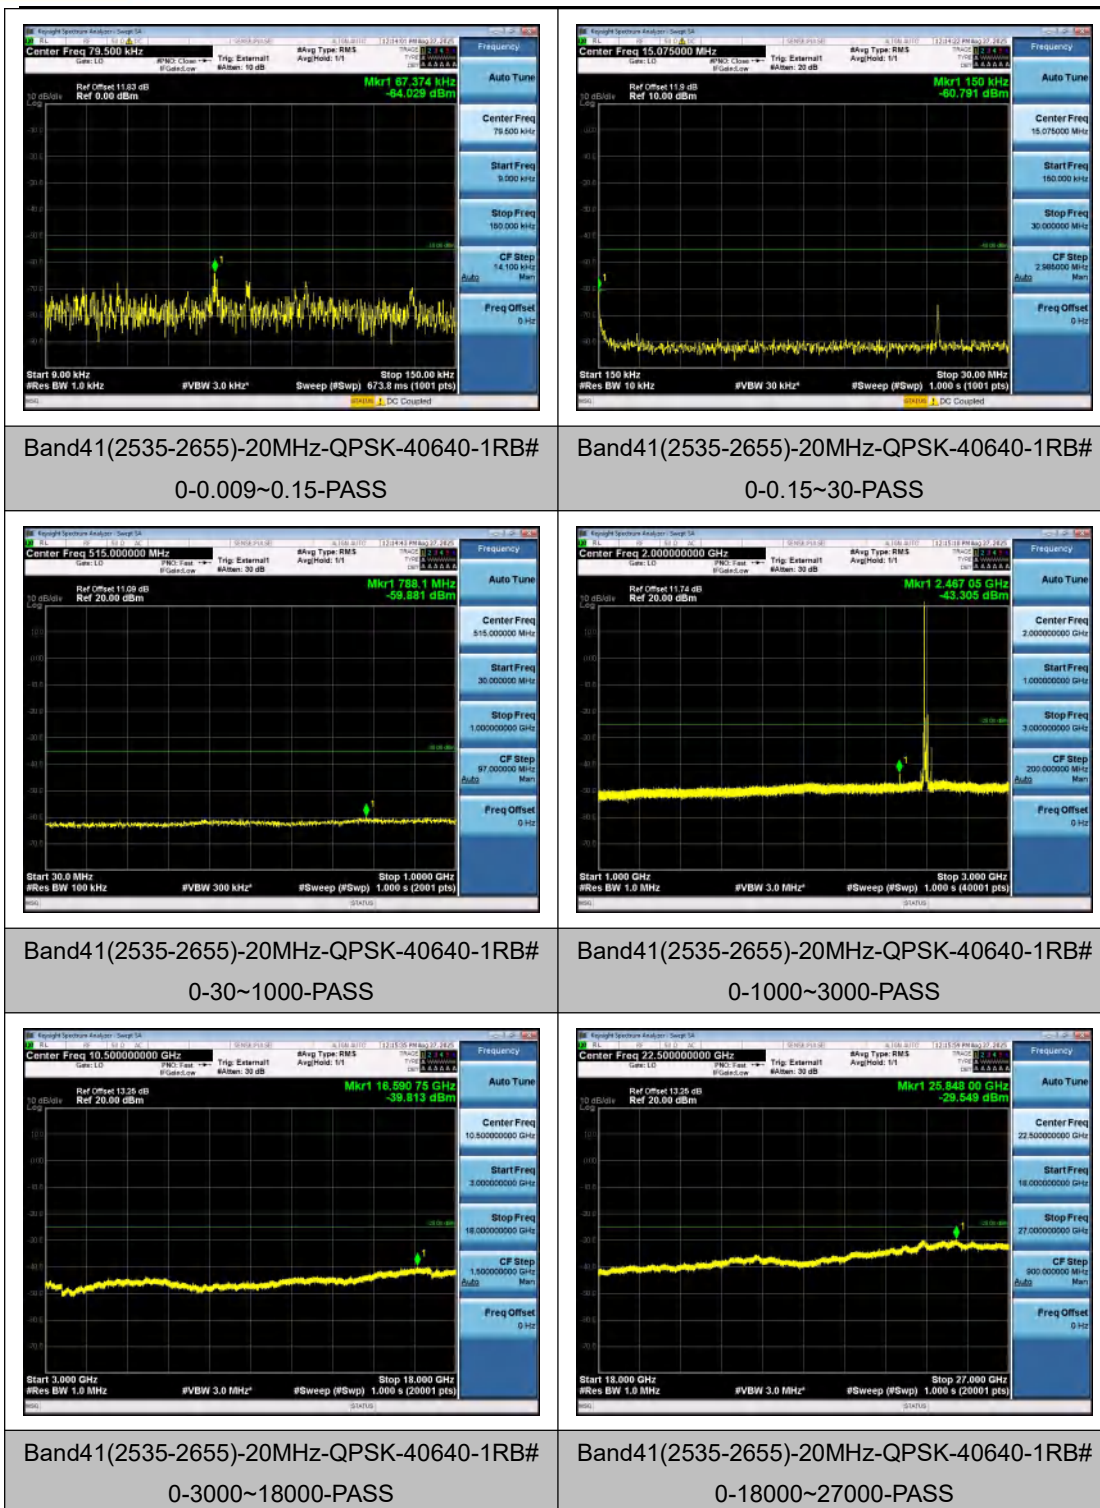

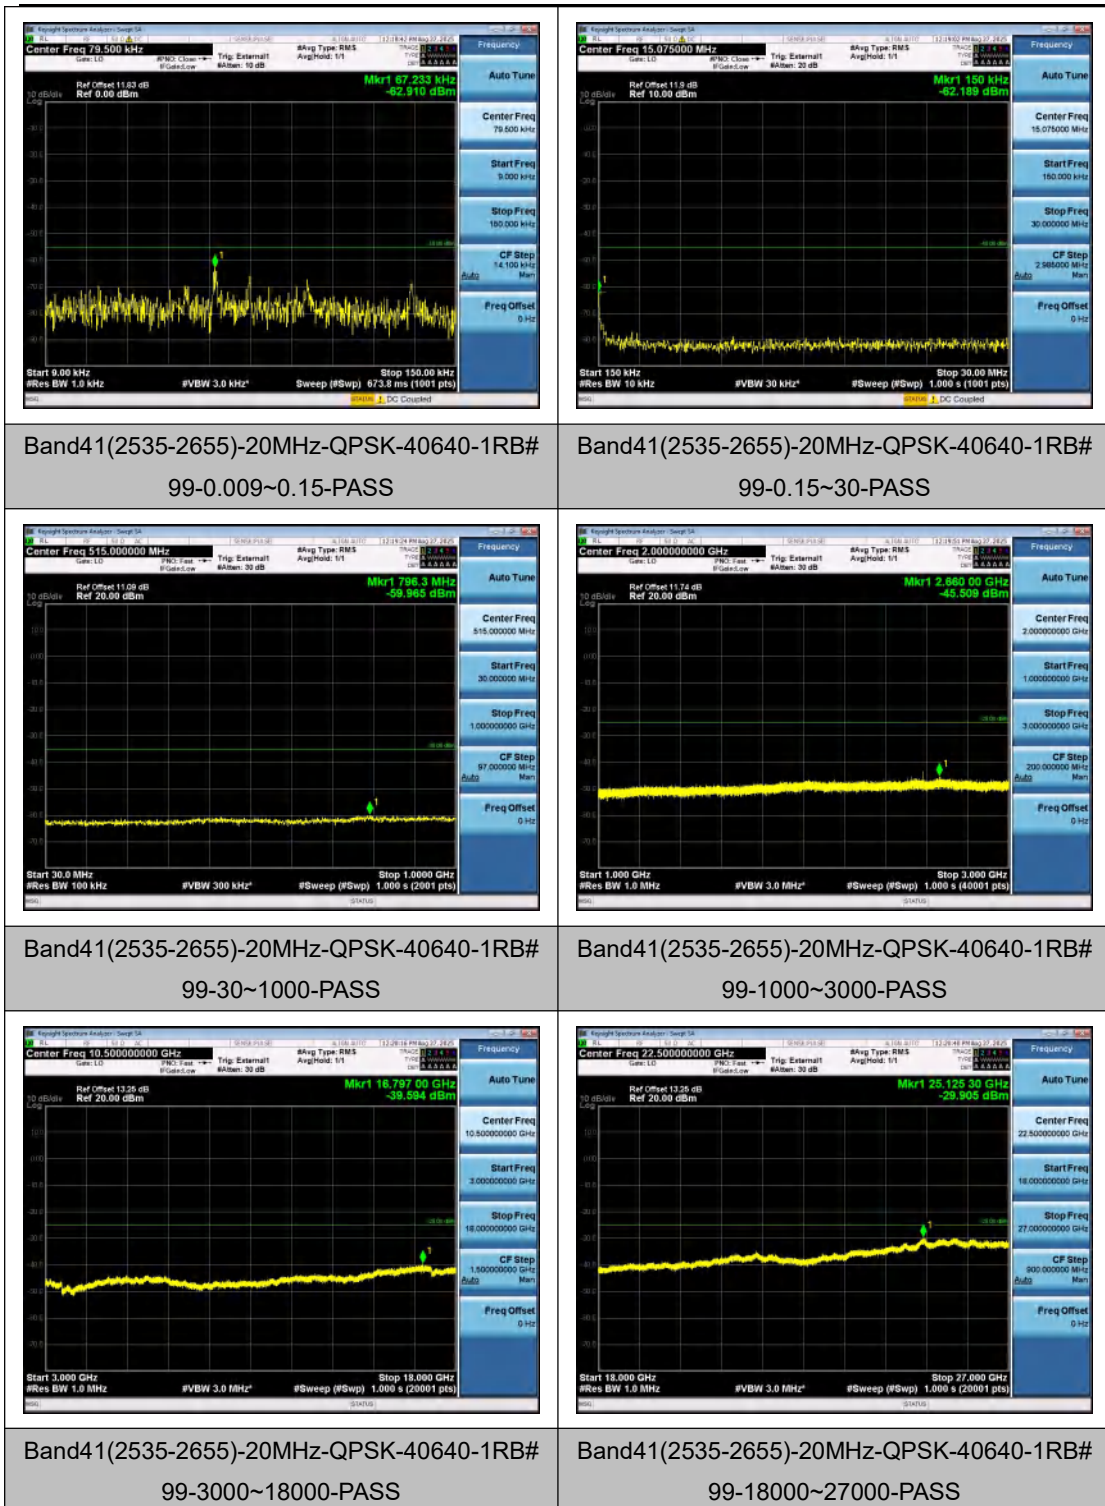

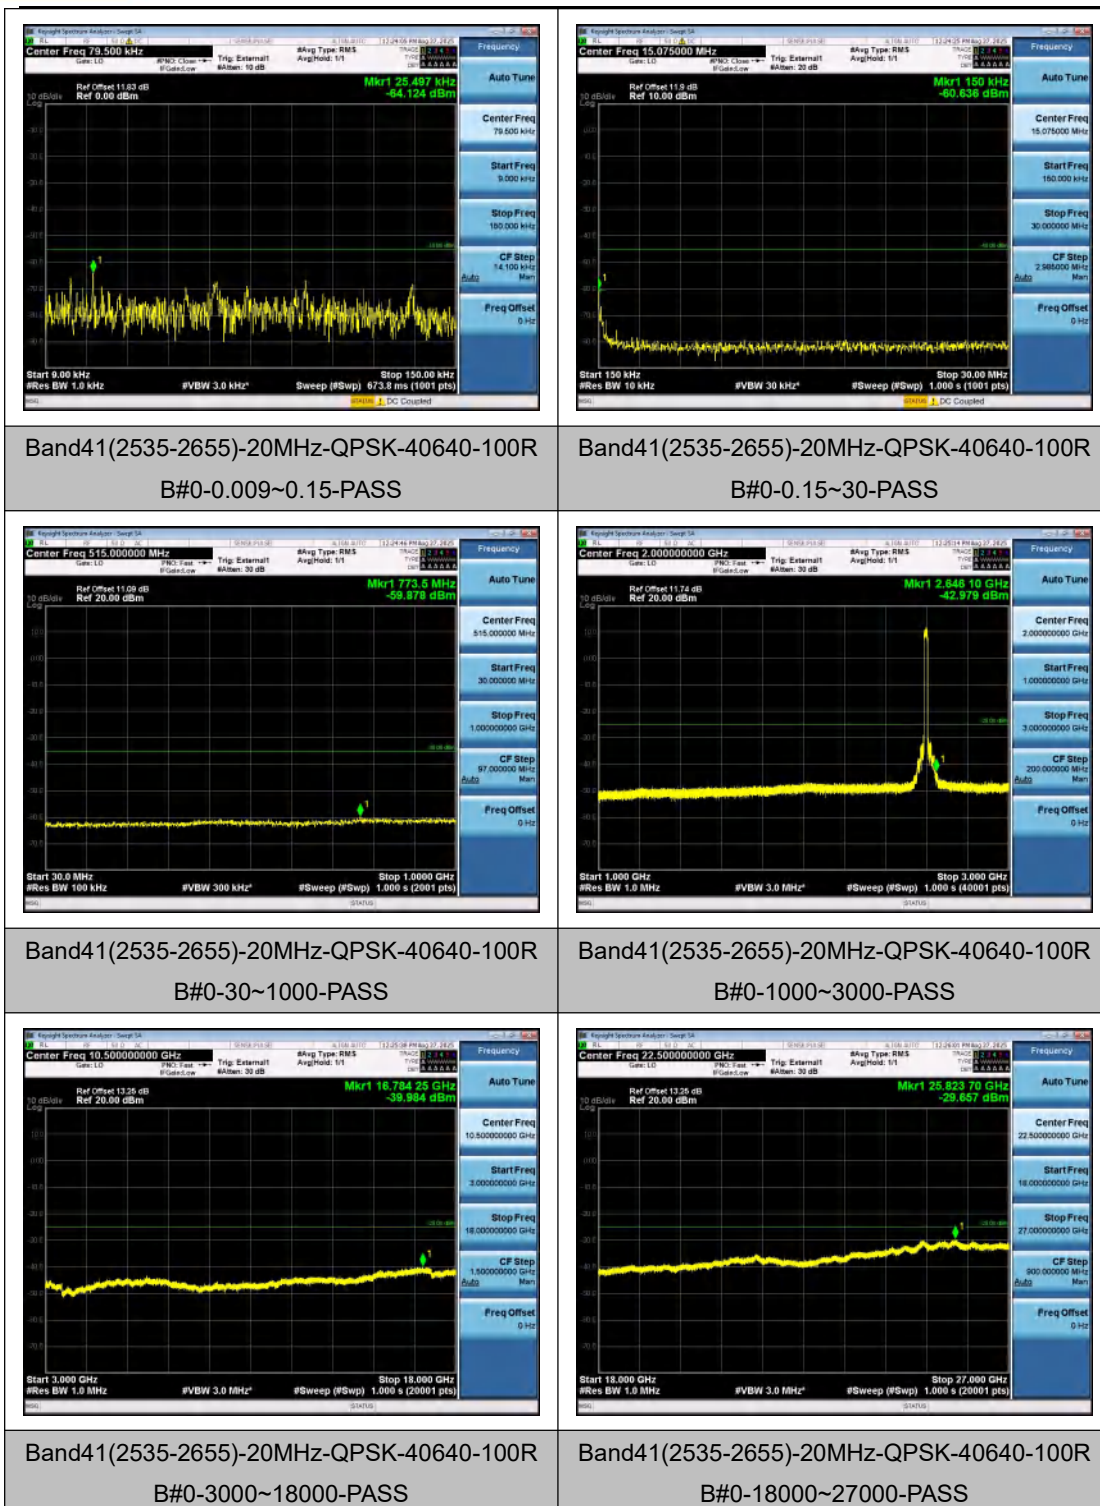

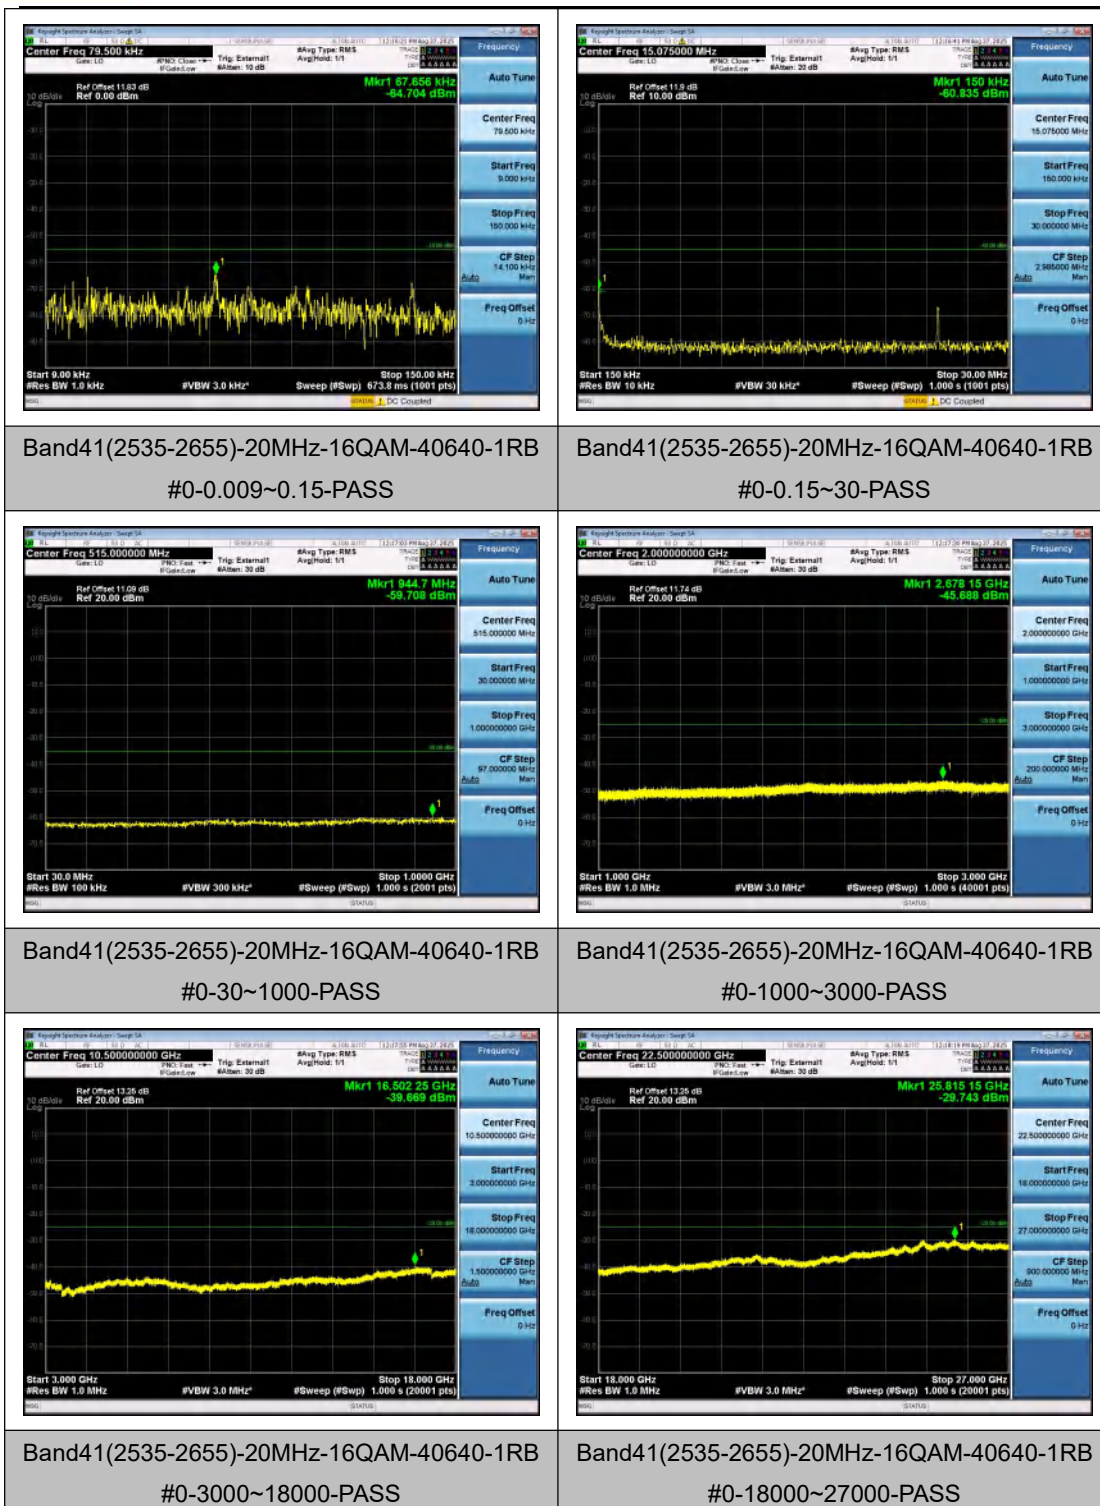


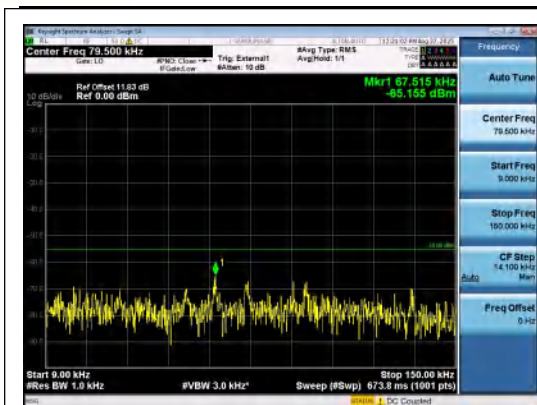


Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-0.009~0.15-PASS




Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-0.15~30-PASS

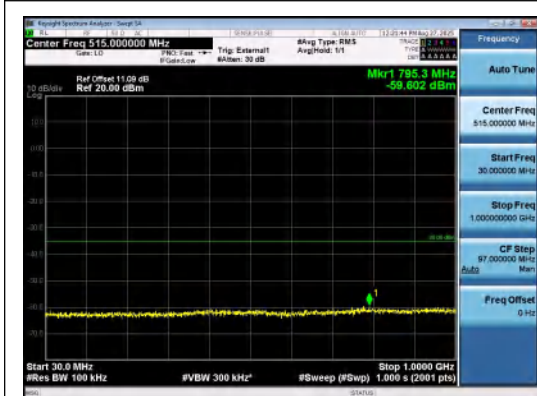

Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-30~1000-PASS

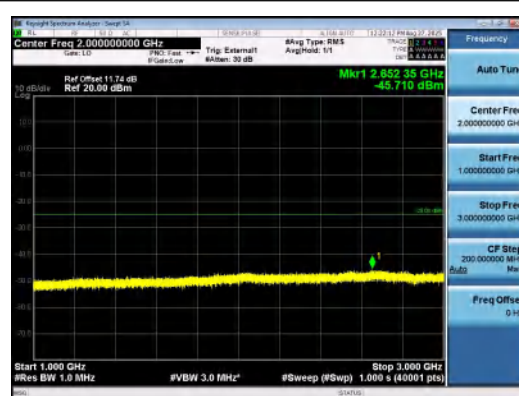


Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-1000~3000-PASS

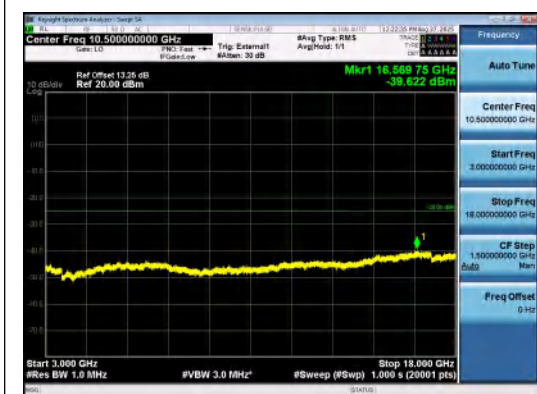


Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-3000~18000-PASS





Band41(2535-2655)-20MHz-16QAM-40640-1RB
#99-18000~27000-PASS

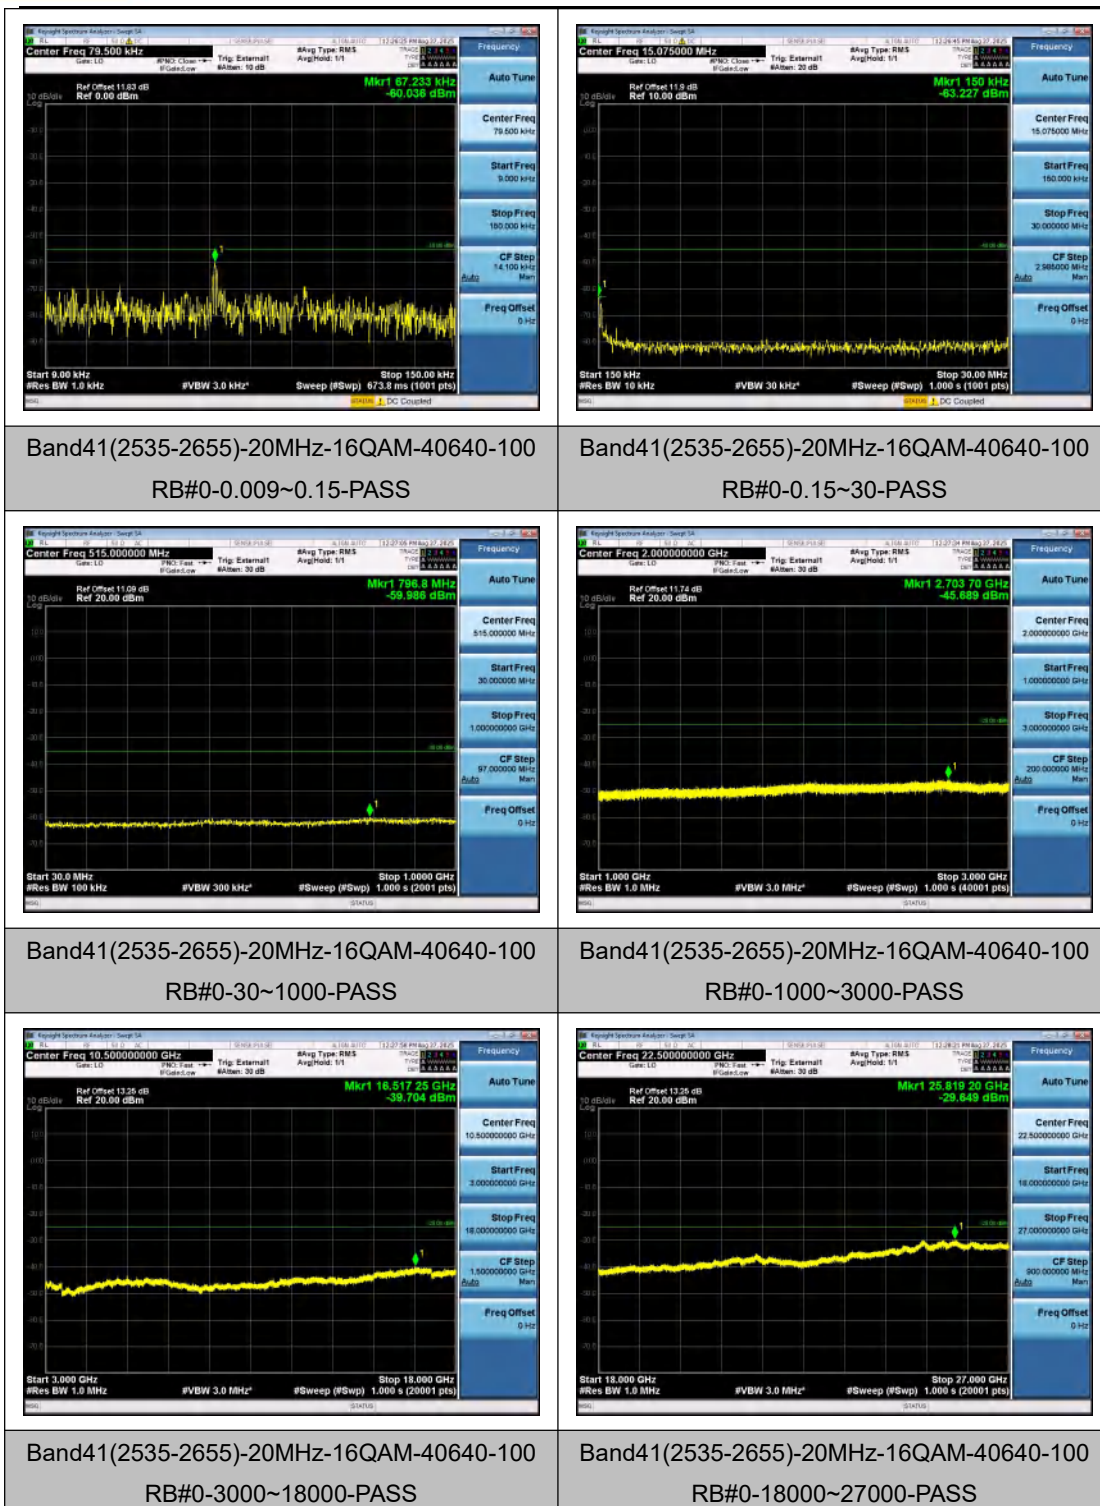


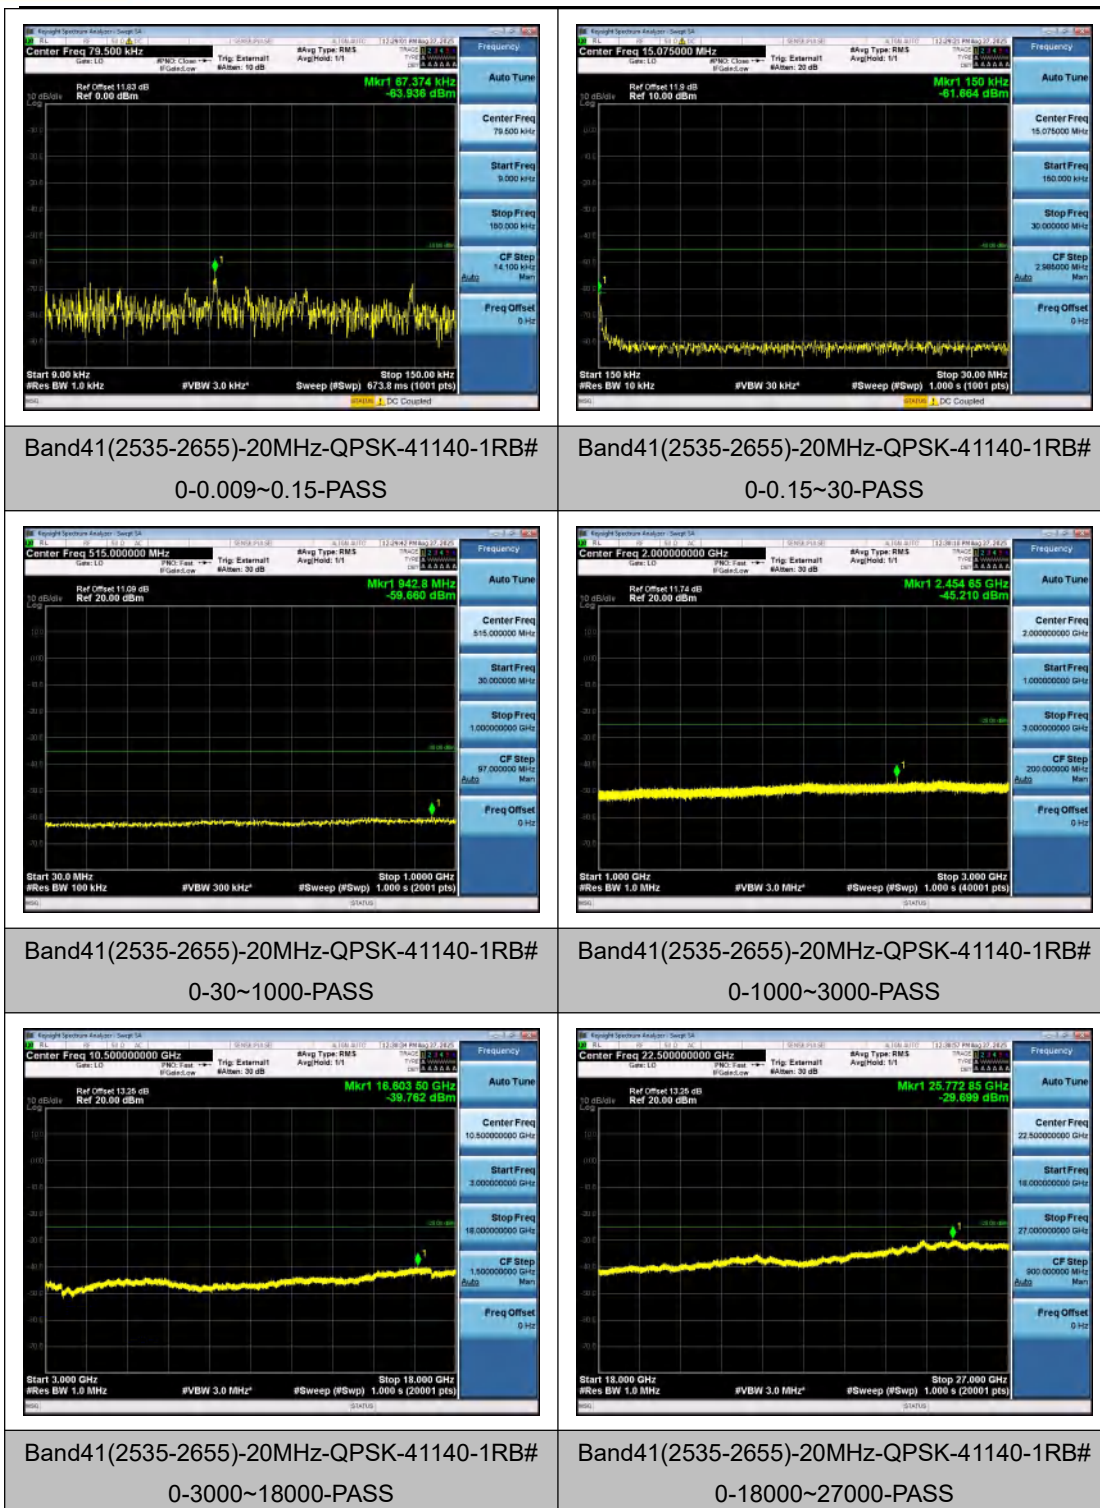


Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-0.009~0.15-PASS	Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-0.15~30-PASS
Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-30~1000-PASS	Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-1000~3000-PASS
Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-3000~18000-PASS	Band41(2535-2655)-20MHz-QPSK-41140-1RB# 99-18000~27000-PASS

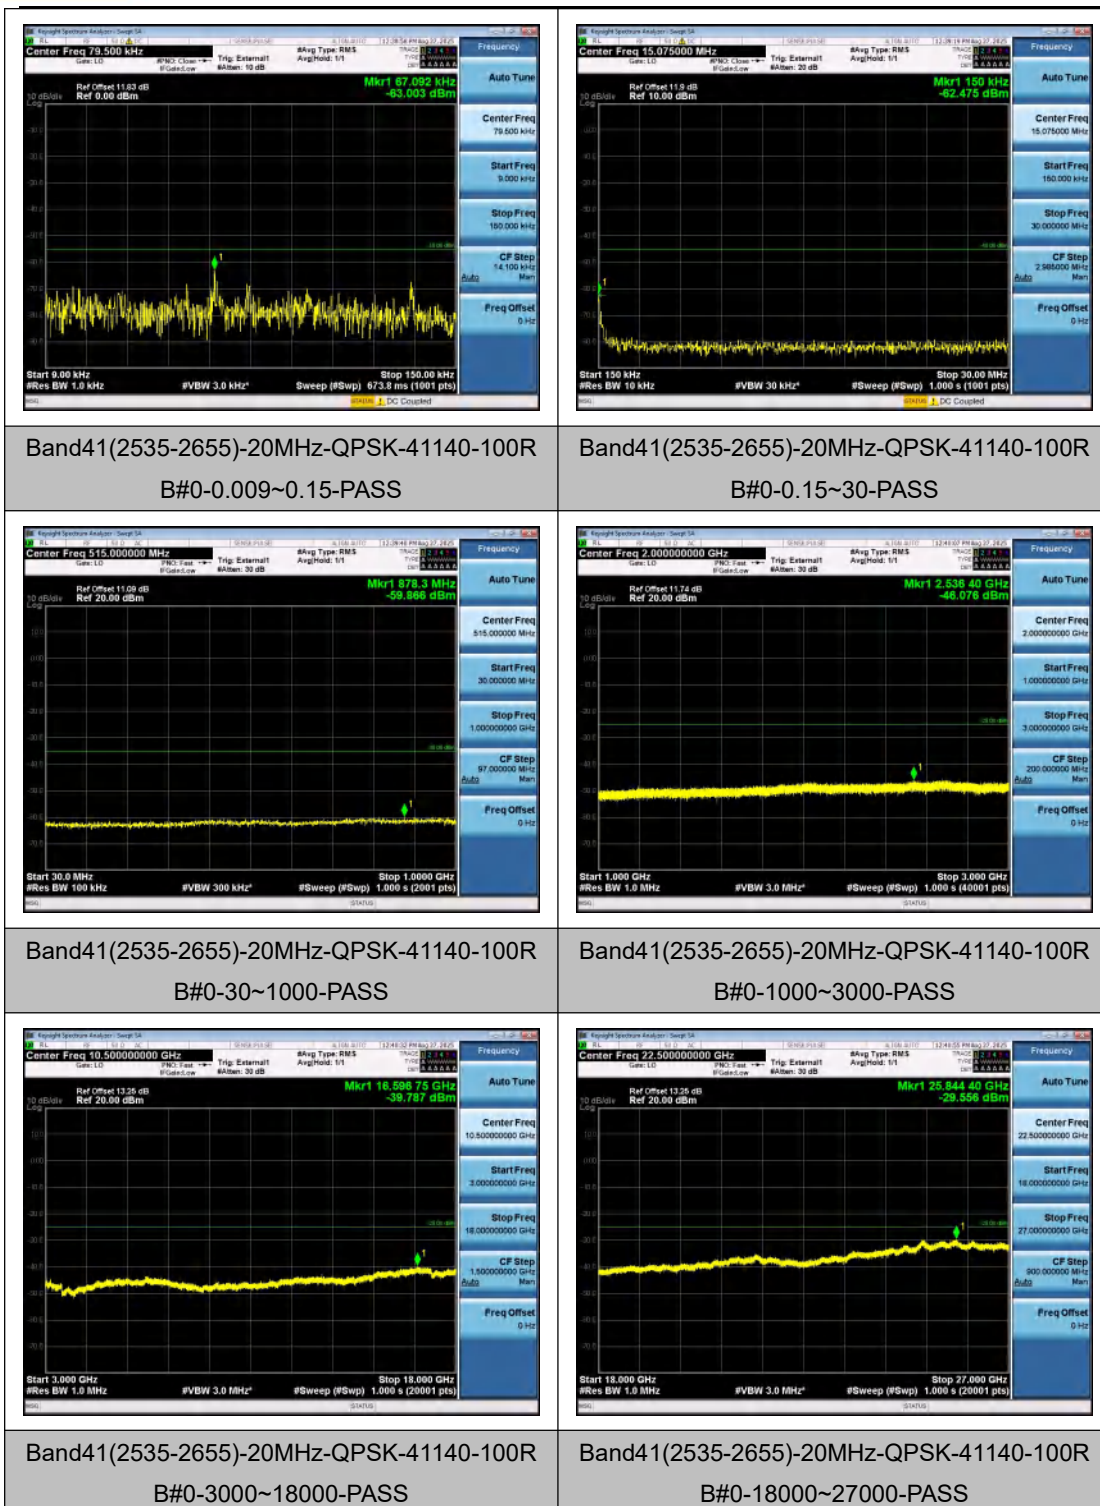

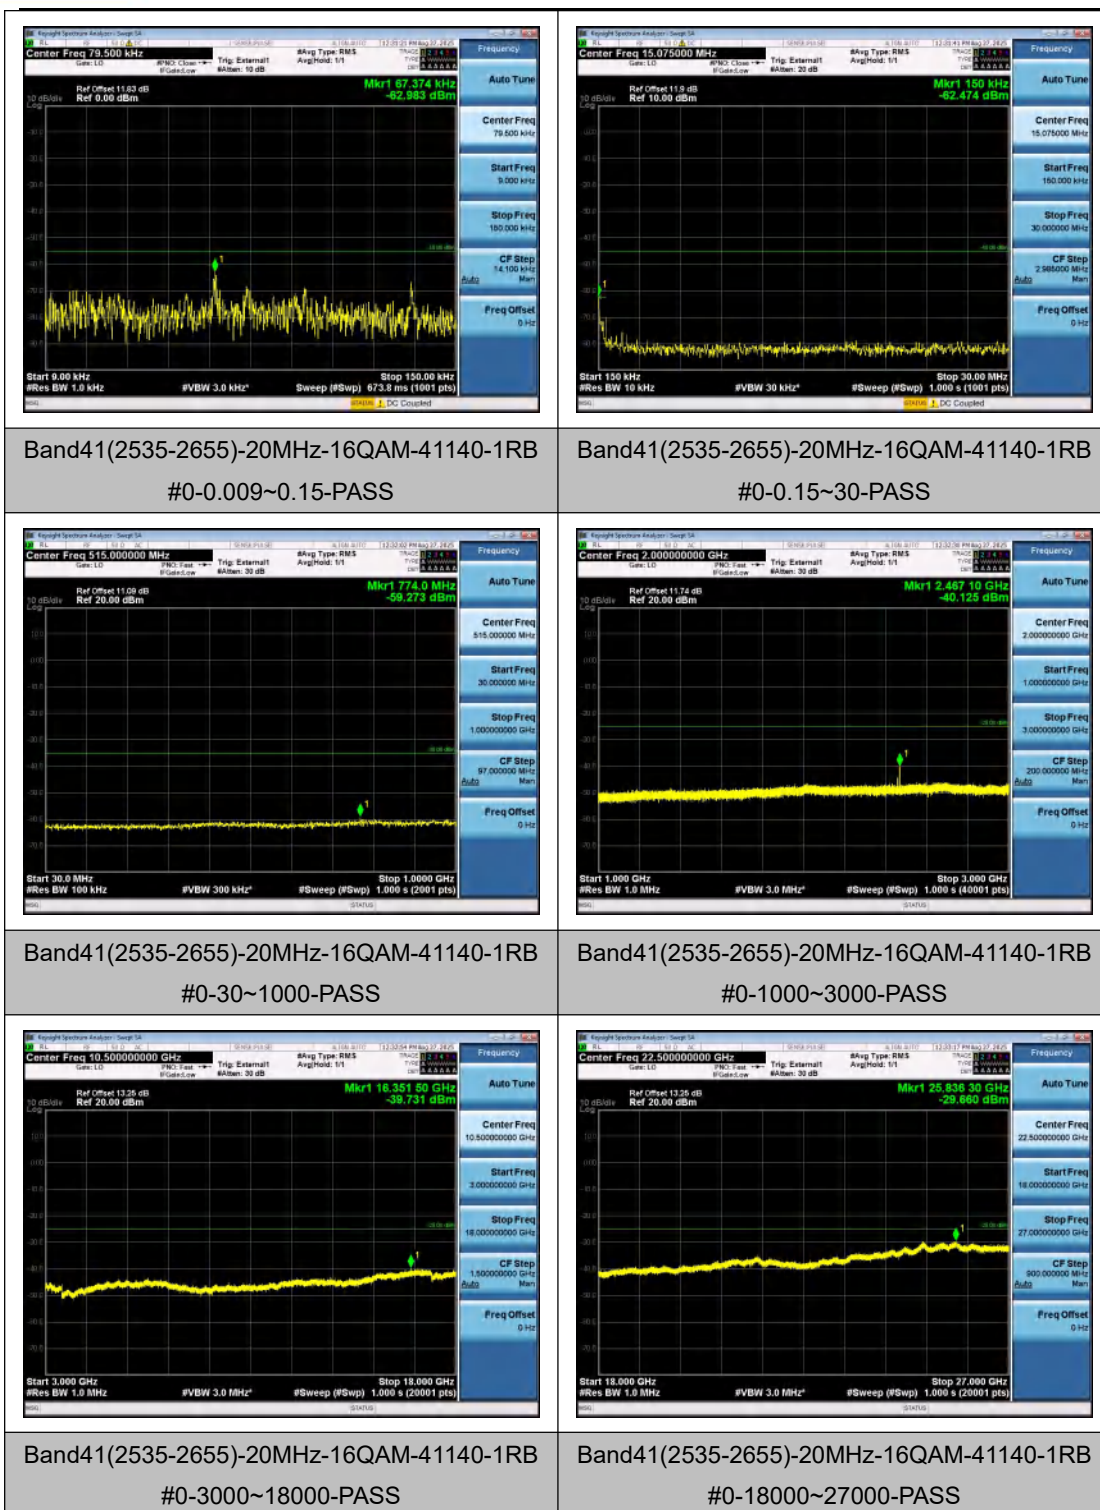


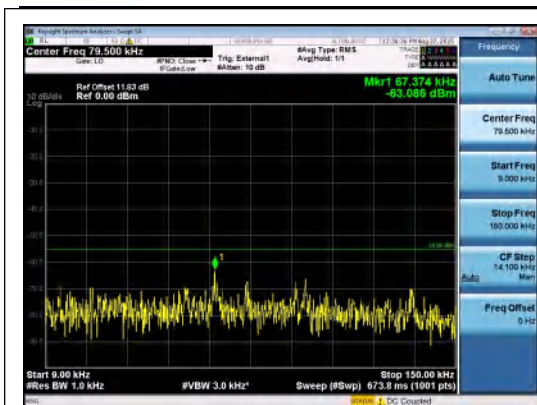


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-0.009~0.15-PASS

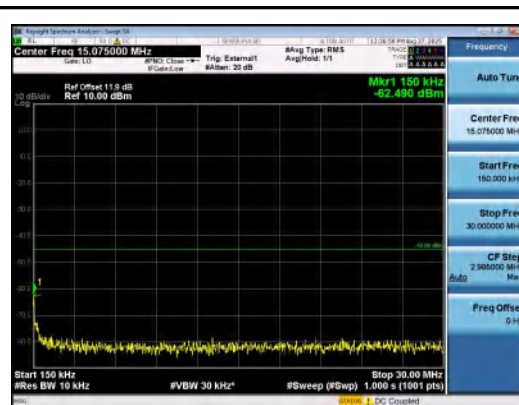


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-0.15~30-PASS

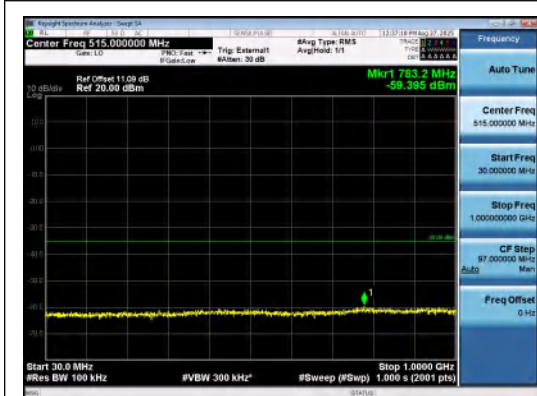

Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-30~1000-PASS

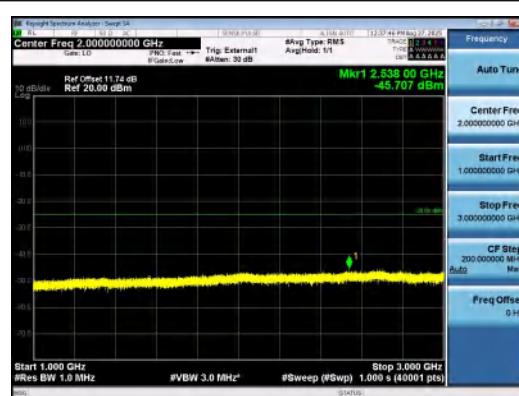


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-1000~3000-PASS

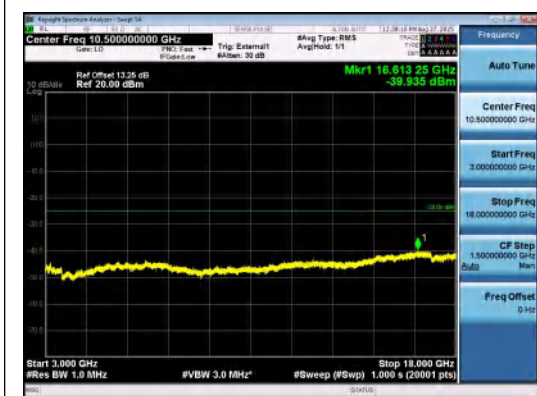

Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-3000~18000-PASS



Band41(2535-2655)-20MHz-16QAM-41140-1RB
#99-18000~27000-PASS

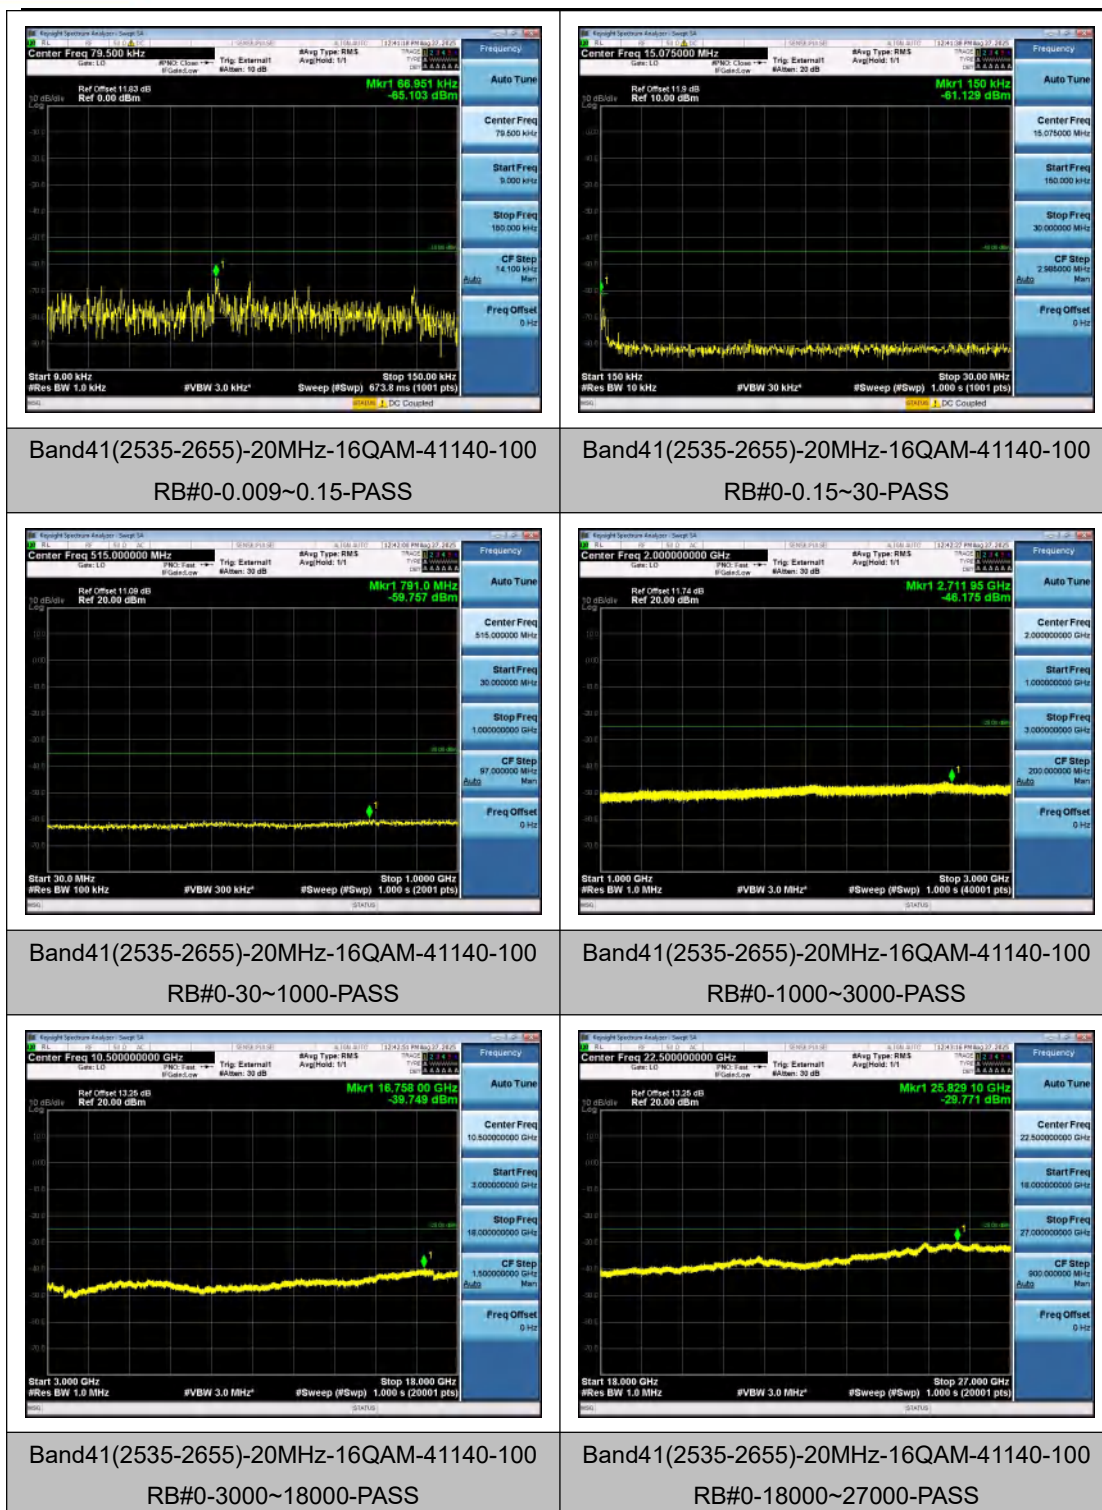

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VN	NT	-120.00	-0.047291	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VL	NT	-130.00	-0.051232	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VH	NT	-120.00	-0.047291	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VN	NT	-6340.00	-2.498522	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VL	NT	-6830.00	-2.691626	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VH	NT	-3800.00	-1.497537	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VN	NT	-6040.00	-2.327553	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VL	NT	-5970.00	-2.300578	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VH	NT	-6160.00	-2.373796	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VN	NT	-6770.00	-2.608863	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VL	NT	-7570.00	-2.917148	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VH	NT	-4070.00	-1.568401	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VN	NT	-4630.00	-1.745523	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VL	NT	-4740.00	-1.786993	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VH	NT	-4710.00	-1.775683	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VN	NT	-5010.00	-1.888784	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VL	NT	-5150.00	-1.941565	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VH	NT	-3500.00	-1.319510	±2.5	PASS

35-2655)										
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	VN	NT	-11730.00	-4.618110	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	VL	NT	-11580.00	-4.559055	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	VH	NT	-11600.00	-4.566929	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	VN	NT	-3040.00	-1.196850	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	VL	NT	-8690.00	-3.421260	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	VH	NT	-4460.00	-1.755906	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	VN	NT	6220.00	2.396917	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	VL	NT	6180.00	2.381503	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	VH	NT	6130.00	2.362235	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	VN	NT	-8450.00	-3.256262	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	VL	NT	-8700.00	-3.352601	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	VH	NT	-8190.00	-3.156069	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	VN	NT	-12240.00	-4.618868	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	VL	NT	-12430.00	-4.690566	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	VH	NT	-12230.00	-4.615094	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	VN	NT	-11000.00	-4.150943	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	VL	NT	-4560.00	-1.720755	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	VH	NT	-9060.00	-3.418868	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	VN	NT	-4140.00	-1.628319	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	VL	NT	-4400.00	-1.730580	±2.5	PASS
Band41(25	15MHz	QPSK	40115	75RB#0	VH	NT	-3710.00	-1.459194	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	VN	NT	-12820.00	-5.042281	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	VL	NT	-13800.00	-5.427729	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	VH	NT	-13570.00	-5.337266	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	VN	NT	-7630.00	-2.940270	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	VL	NT	-8290.00	-3.194605	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	VH	NT	-8360.00	-3.221580	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	VN	NT	-14270.00	-5.499037	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	VL	NT	-14100.00	-5.433526	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	VH	NT	-4800.00	-1.849711	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	VN	NT	-10920.00	-4.124646	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	VL	NT	-11350.00	-4.287063	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	VH	NT	-11420.00	-4.313503	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	VN	NT	-22740.00	-8.589235	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	VL	NT	-14590.00	-5.510859	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	VH	NT	-15300.00	-5.779037	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	VN	NT	-4010.00	-1.575639	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	VL	NT	-9090.00	-3.571709	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	VH	NT	-4060.00	-1.595285	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	VN	NT	-13490.00	-5.300589	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	VL	NT	-1980.00	-0.777996	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	VH	NT	-18290.00	-7.186640	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	VN	NT	-10030.00	-3.865125	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	VL	NT	-14980.00	-5.772640	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	VH	NT	-12080.00	-4.655106	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	VN	NT	-11350.00	-4.373796	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	VL	NT	-550.00	-0.211946	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	VH	NT	-10850.00	-4.181118	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	VN	NT	-11840.00	-4.476371	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	VL	NT	-24560.00	-9.285444	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	VH	NT	-21890.00	-8.275992	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	VN	NT	-15610.00	-5.901701	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	VL	NT	-25070.00	-9.478261	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	VH	NT	-16840.00	-6.366730	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	-230.00	-0.090640	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	-170.00	-0.066995	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	-200.00	-0.078818	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	0	-40.00	-0.015764	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	10	-120.00	-0.047291	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	20	-70.00	-0.027586	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	30	-230.00	-0.090640	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	40	10.00	0.003941	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40065	25RB#0	NV	50	-130.00	-0.051232	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	-5020.00	-1.978325	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	-4770.00	-1.879803	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	-4710.00	-1.856158	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	0	-6590.00	-2.597044	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	10	-6140.00	-2.419704	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	20	-3250.00	-1.280788	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	30	-8780.00	-3.460099	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	40	-3440.00	-1.355665	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40065	25RB#0	NV	50	-4750.00	-1.871921	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	-30	-6000.00	-2.312139	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	-20	-5500.00	-2.119461	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	-10	-6190.00	-2.385356	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	0	-6040.00	-2.327553	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	10	-5170.00	-1.992293	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	20	-6130.00	-2.362235	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	30	-6330.00	-2.439306	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	40	-6110.00	-2.354528	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	40640	25RB#0	NV	50	-6110.00	-2.354528	±2.5	PASS
Band41(25	5MHz	16QAM	40640	25RB#0	NV	-30	-6070.00	-2.339114	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	-20	-4760.00	-1.834297	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	-10	-4740.00	-1.826590	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	0	-7150.00	-2.755299	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	10	-6790.00	-2.616570	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	20	-4300.00	-1.657033	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	30	-6650.00	-2.562620	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	40	-8560.00	-3.298651	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	40640	25RB#0	NV	50	-8900.00	-3.429672	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	-4760.00	-1.794533	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	-4620.00	-1.741753	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	-4710.00	-1.775683	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	0	-4700.00	-1.771913	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	10	-4730.00	-1.783223	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	20	-4560.00	-1.719133	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	30	-4760.00	-1.794533	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	40	-4700.00	-1.771913	±2.5	PASS
Band41(25 35-2655)	5MHz	QPSK	41215	25RB#0	NV	50	-4810.00	-1.813384	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	-2550.00	-0.961357	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	-4490.00	-1.692743	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	-5330.00	-2.009425	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	0	-5180.00	-1.952875	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	10	-3740.00	-1.409991	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	20	-4650.00	-1.753063	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	30	-4600.00	-1.734213	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	40	-2620.00	-0.987747	±2.5	PASS
Band41(25 35-2655)	5MHz	16QAM	41215	25RB#0	NV	50	-5040.00	-1.900094	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	-11710.00	-4.610236	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	-11670.00	-4.594488	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	-11800.00	-4.645669	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	0	-11600.00	-4.566929	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	10	-11760.00	-4.629921	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	20	-11820.00	-4.653543	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	30	-11650.00	-4.586614	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	40	-11670.00	-4.594488	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40090	50RB#0	NV	50	-11670.00	-4.594488	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	-30	-9360.00	-3.685039	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	-20	-9110.00	-3.586614	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	-10	-8840.00	-3.480315	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	0	-4750.00	-1.870079	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	10	-10670.00	-4.200787	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	20	-9390.00	-3.696850	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	30	-4030.00	-1.586614	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	40	-9890.00	-3.893701	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40090	50RB#0	NV	50	-6890.00	-2.712598	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	-30	6150.00	2.369942	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	-20	6140.00	2.366089	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	-10	5930.00	2.285164	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	0	6070.00	2.339114	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	10	5940.00	2.289017	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	20	6100.00	2.350674	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	30	6200.00	2.389210	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	40	6250.00	2.408478	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	40640	50RB#0	NV	50	6270.00	2.416185	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	-30	-7550.00	-2.909441	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	-20	-4300.00	-1.657033	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	-10	-6710.00	-2.585742	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	0	-3550.00	-1.368015	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	10	-7740.00	-2.982659	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	20	-6420.00	-2.473988	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	30	-7270.00	-2.801541	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	40	-4460.00	-1.718690	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	40640	50RB#0	NV	50	-9420.00	-3.630058	±2.5	PASS
Band41(25	10MHz	QPSK	41190	50RB#0	NV	-30	-12240.00	-4.618868	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	-12050.00	-4.547170	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	-12250.00	-4.622642	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	0	-12330.00	-4.652830	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	10	-12240.00	-4.618868	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	20	-12390.00	-4.675472	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	30	-12260.00	-4.626415	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	40	-12270.00	-4.630189	±2.5	PASS
Band41(25 35-2655)	10MHz	QPSK	41190	50RB#0	NV	50	-12490.00	-4.713208	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	-30	-8320.00	-3.139623	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	-20	-9360.00	-3.532075	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	-10	-11660.00	-4.400000	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	0	-8780.00	-3.313208	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	10	-8430.00	-3.181132	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	20	-10110.00	-3.815094	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	30	-10480.00	-3.954717	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	40	-8880.00	-3.350943	±2.5	PASS
Band41(25 35-2655)	10MHz	16QAM	41190	50RB#0	NV	50	-12190.00	-4.600000	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	-3040.00	-1.195674	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	-3850.00	-1.514258	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	-4010.00	-1.577188	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	0	-3590.00	-1.411996	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	10	-3840.00	-1.510324	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	20	-3730.00	-1.467060	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	30	-3290.00	-1.294002	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	40	-3480.00	-1.368732	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40115	75RB#0	NV	50	-3760.00	-1.478859	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	-30	-15220.00	-5.986234	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	-20	-8850.00	-3.480826	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	-10	-11170.00	-4.393314	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	0	-10300.00	-4.051131	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	10	-11310.00	-4.448378	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	20	-16000.00	-6.293019	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	30	-9030.00	-3.551622	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	40	-8400.00	-3.303835	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40115	75RB#0	NV	50	-4410.00	-1.734513	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	-30	-8000.00	-3.082852	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	-20	-7960.00	-3.067437	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	-10	-8110.00	-3.125241	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	0	-8490.00	-3.271676	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	10	-8570.00	-3.302505	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	20	-8640.00	-3.329480	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	30	-8230.00	-3.171484	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	40	-8270.00	-3.186898	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	40640	75RB#0	NV	50	-8060.00	-3.105973	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	-30	-18600.00	-7.167630	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	-20	-9960.00	-3.838150	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	-10	-8640.00	-3.329480	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	0	-8580.00	-3.306358	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	10	-13580.00	-5.233141	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	20	-12950.00	-4.990366	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	30	-17350.00	-6.685934	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	40	-11730.00	-4.520231	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	40640	75RB#0	NV	50	-7660.00	-2.951830	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	-10940.00	-4.132200	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	-10610.00	-4.007554	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	-11400.00	-4.305949	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	0	-11290.00	-4.264400	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	10	-10760.00	-4.064212	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	20	-11180.00	-4.222852	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	30	-10990.00	-4.151086	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	40	-11250.00	-4.249292	±2.5	PASS
Band41(25 35-2655)	15MHz	QPSK	41165	75RB#0	NV	50	-11020.00	-4.162417	±2.5	PASS
Band41(25	15MHz	16QAM	41165	75RB#0	NV	-30	-14710.00	-5.556185	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	-20	-17770.00	-6.711992	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	-10	-14020.00	-5.295562	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	0	-15170.00	-5.729934	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	10	-15130.00	-5.714825	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	20	-19530.00	-7.376771	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	30	-19830.00	-7.490085	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	40	-21900.00	-8.271955	±2.5	PASS
Band41(25 35-2655)	15MHz	16QAM	41165	75RB#0	NV	50	-12640.00	-4.774315	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	-2290.00	-0.899804	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	-3840.00	-1.508841	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	-2610.00	-1.025540	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	0	-4010.00	-1.575639	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	10	-1910.00	-0.750491	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	20	-1140.00	-0.447937	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	30	-10810.00	-4.247544	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	40	-3140.00	-1.233792	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40140	100RB#0	NV	50	-4790.00	-1.882122	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	-30	-10390.00	-4.082515	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	-20	-15960.00	-6.271120	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	-10	-2640.00	-1.037328	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	0	-14570.00	-5.724951	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	10	-6640.00	-2.609037	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	20	-18190.00	-7.147348	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	30	-16200.00	-6.365422	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	40	-540.00	-0.212181	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40140	100RB#0	NV	50	-21920.00	-8.612967	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	-30	-11020.00	-4.246628	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	-20	-13530.00	-5.213873	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	-10	-11870.00	-4.574181	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	0	-16110.00	-6.208092	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	10	-11970.00	-4.612717	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	20	-12280.00	-4.732177	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	30	-11600.00	-4.470135	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	40	-11240.00	-4.331407	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	40640	100RB#0	NV	50	-14030.00	-5.406551	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	-30	-10470.00	-4.034682	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	-20	-7080.00	-2.728324	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	-10	-11940.00	-4.601156	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	0	-5130.00	-1.976879	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	10	-5270.00	-2.030829	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	20	-10700.00	-4.123314	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	30	-11720.00	-4.516378	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

35-2655)										
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	40	-9110.00	-3.510597	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	40640	100RB#0	NV	50	-12450.00	-4.797688	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	-30	-14950.00	-5.652174	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	-20	-23780.00	-8.990548	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	-10	-19050.00	-7.202268	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	0	-24210.00	-9.153119	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	10	-21380.00	-8.083176	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	20	-23120.00	-8.741021	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	30	-16850.00	-6.370510	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	40	-26030.00	-9.841210	±2.5	PASS
Band41(25 35-2655)	20MHz	QPSK	41140	100RB#0	NV	50	-24960.00	-9.436673	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	-30	-16540.00	-6.253308	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	-20	-20240.00	-7.652174	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	-10	-19960.00	-7.546314	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	0	-26160.00	-9.890359	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	10	-18830.00	-7.119093	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	20	-33730.00	-12.752363	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	30	-26610.00	-10.060491	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	40	-17240.00	-6.517958	±2.5	PASS
Band41(25 35-2655)	20MHz	16QAM	41140	100RB#0	NV	50	-16600.00	-6.275992	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com