



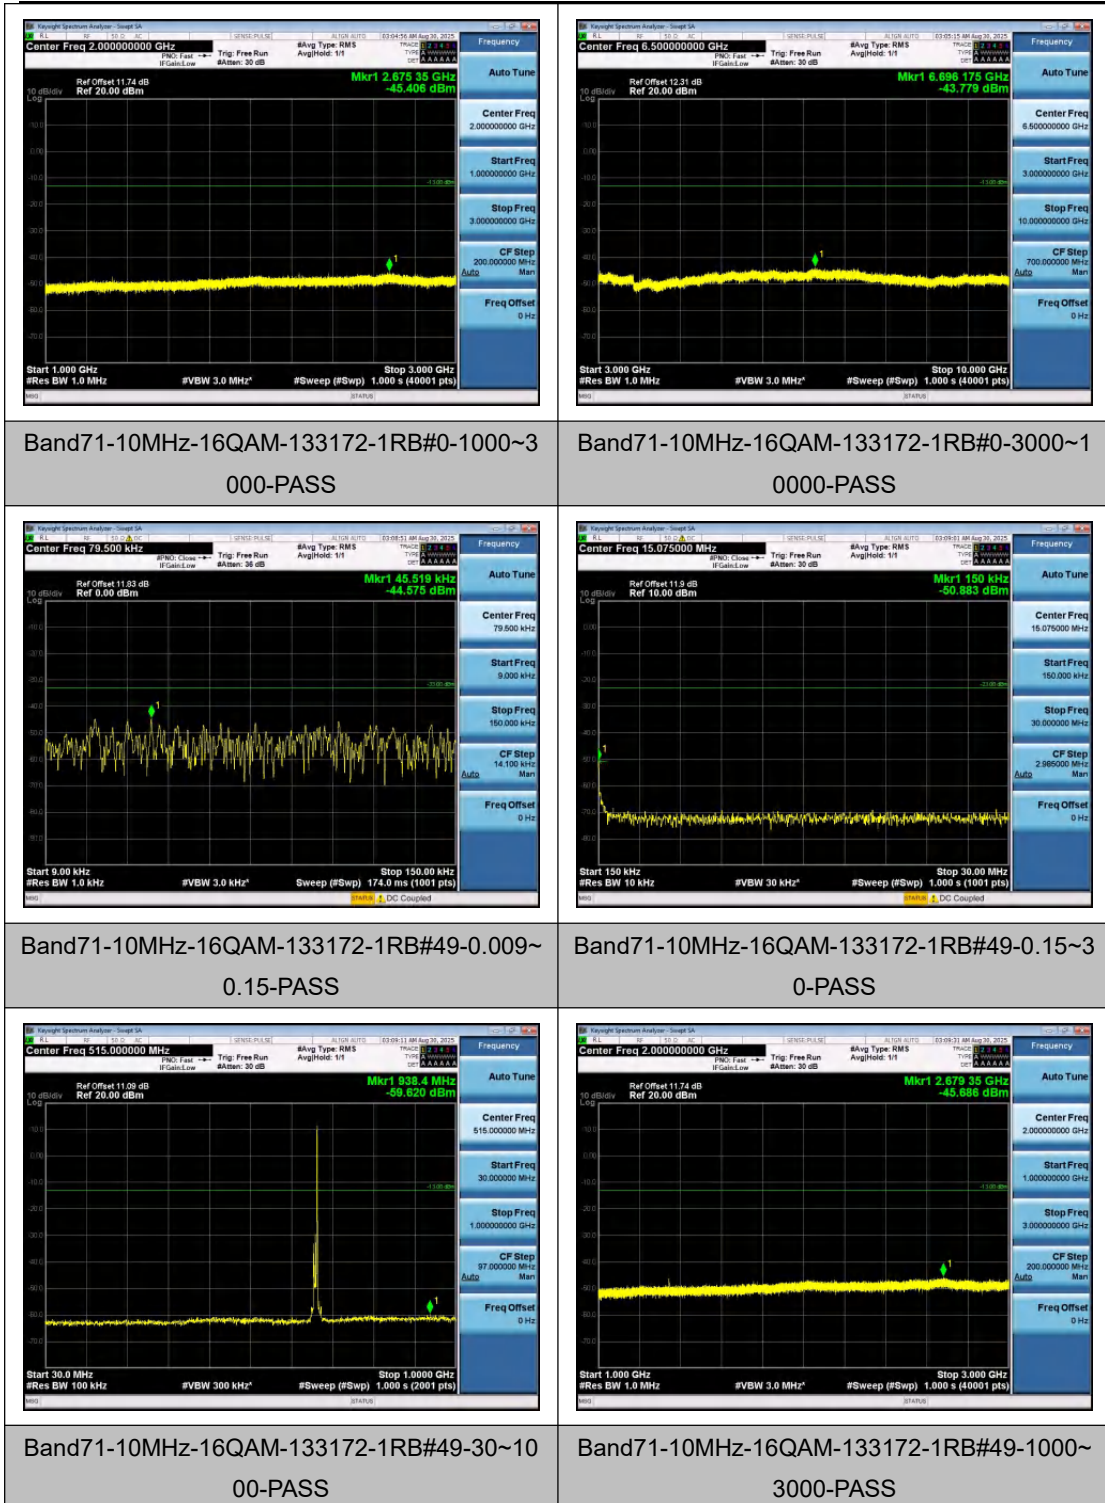

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

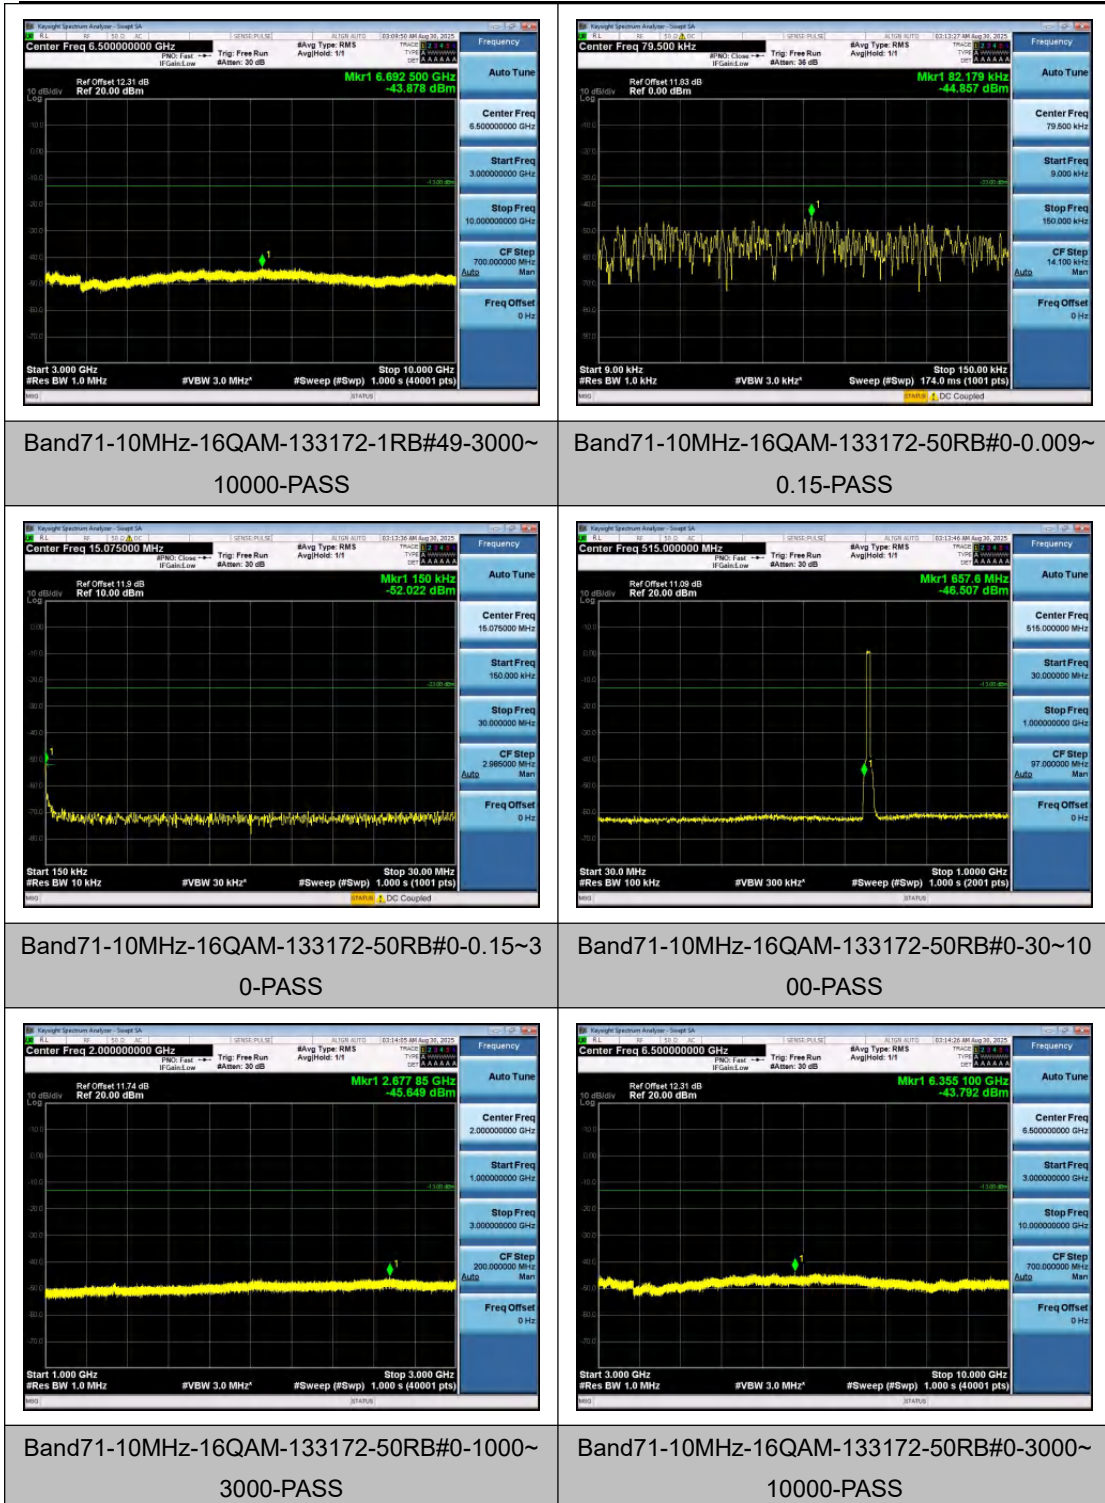

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

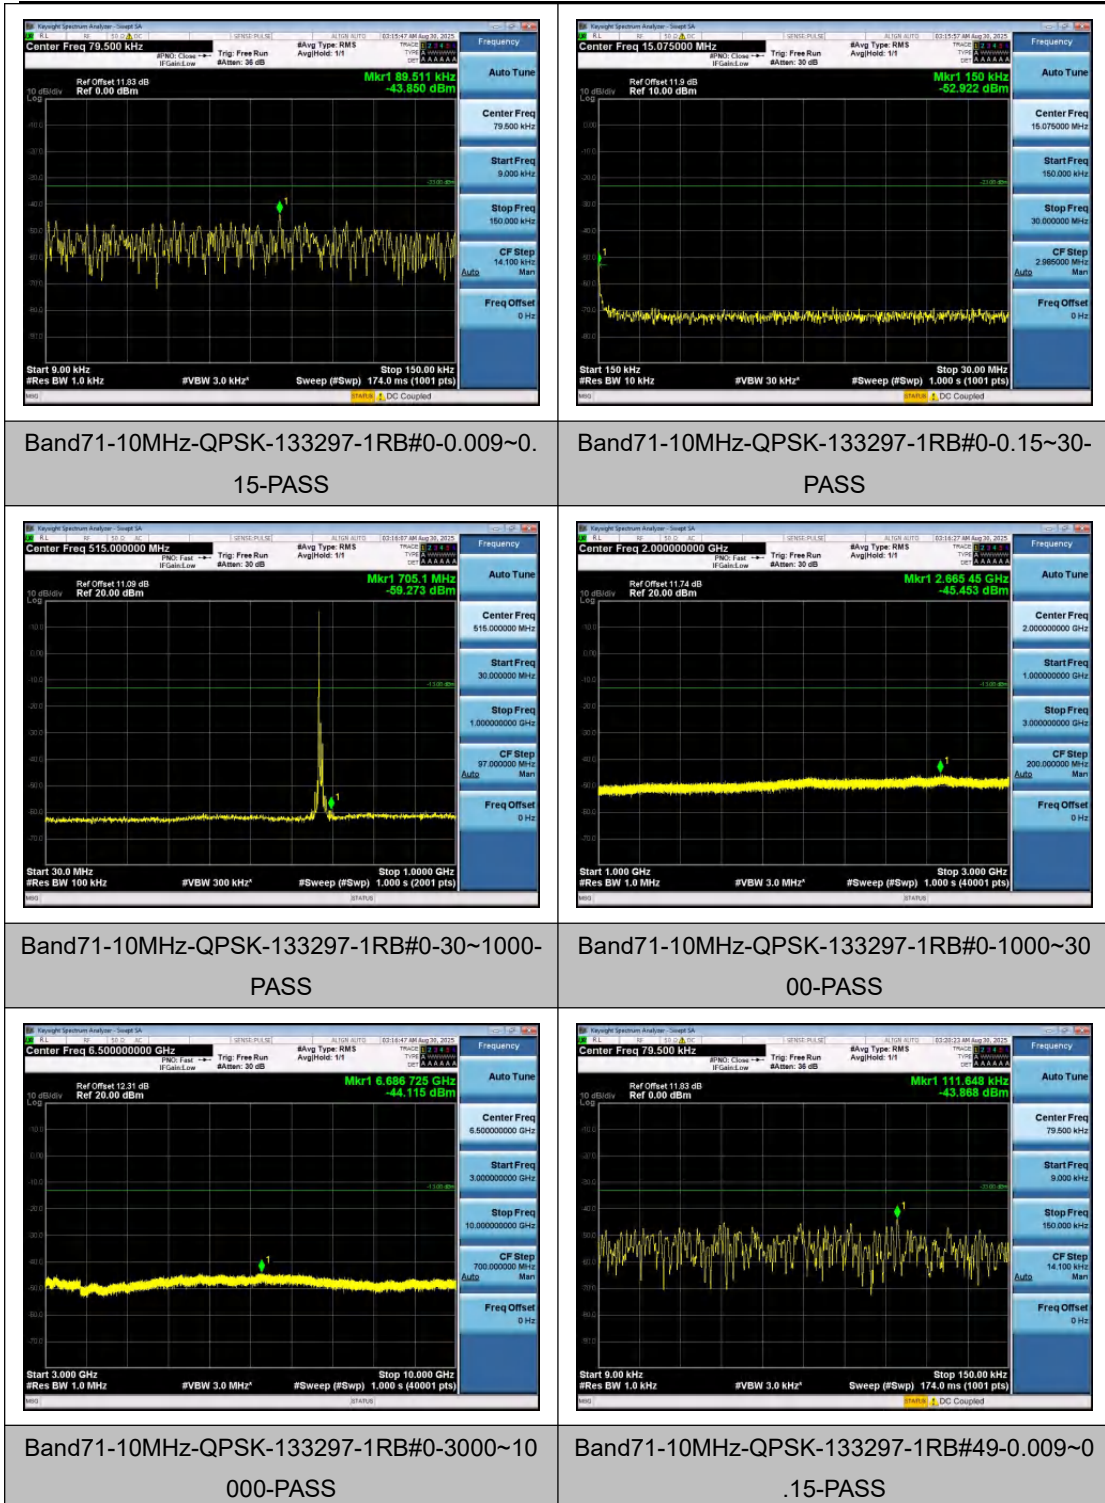

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

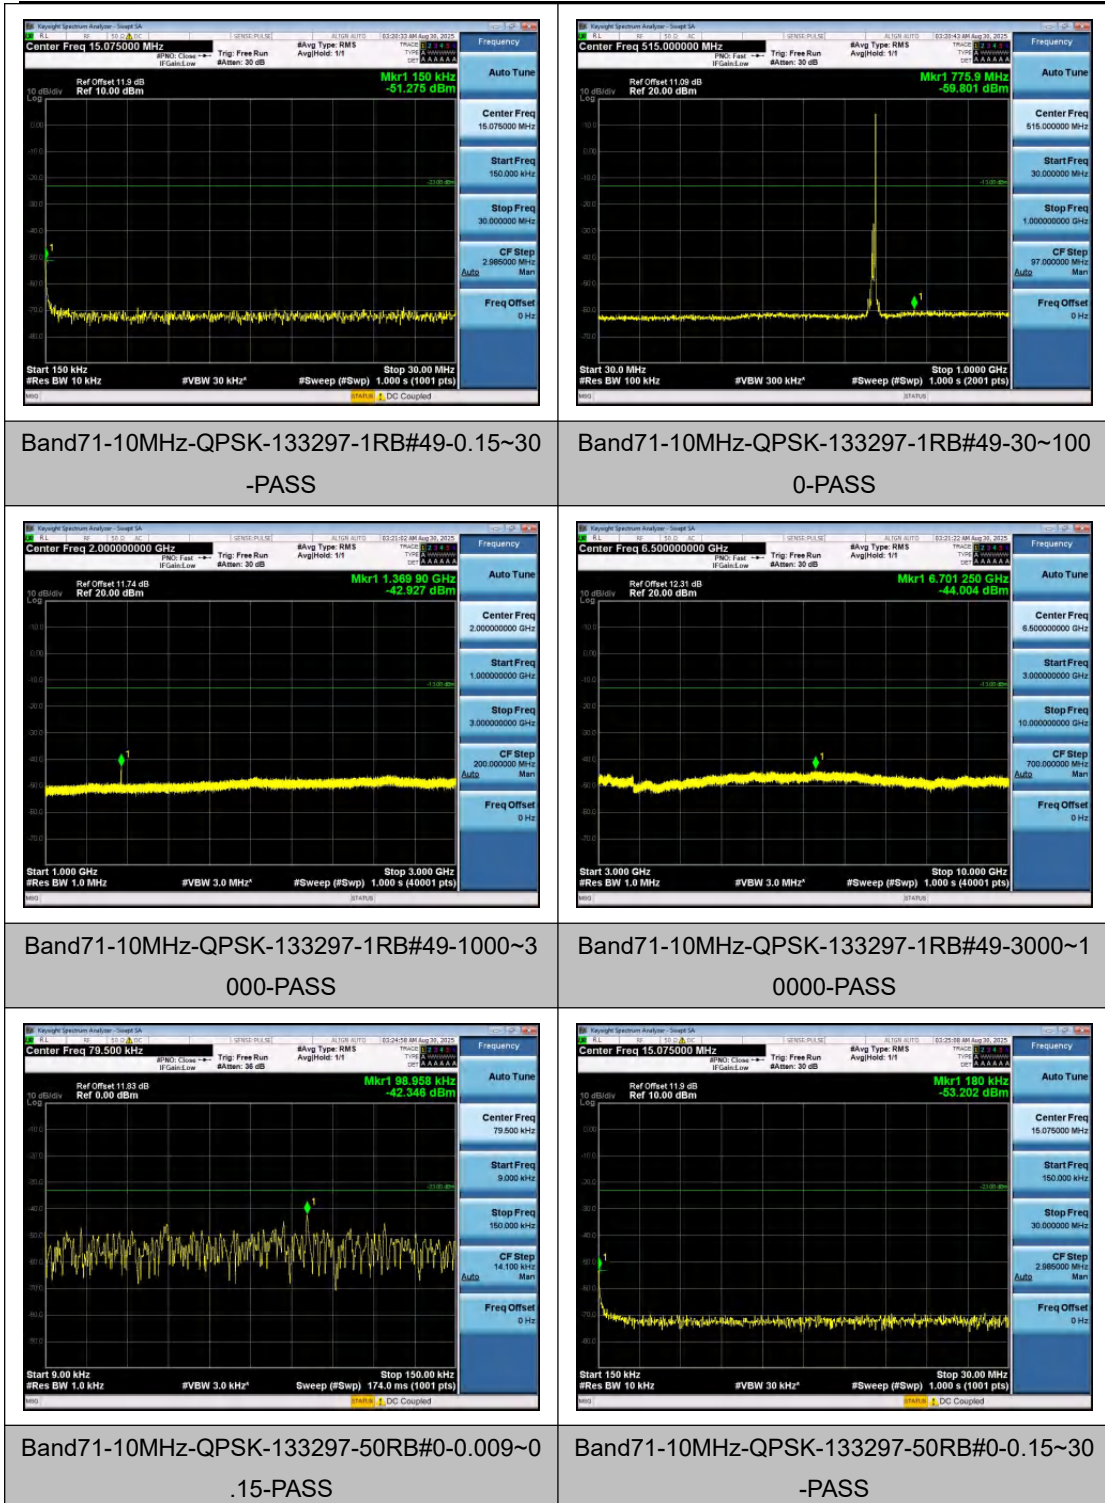

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

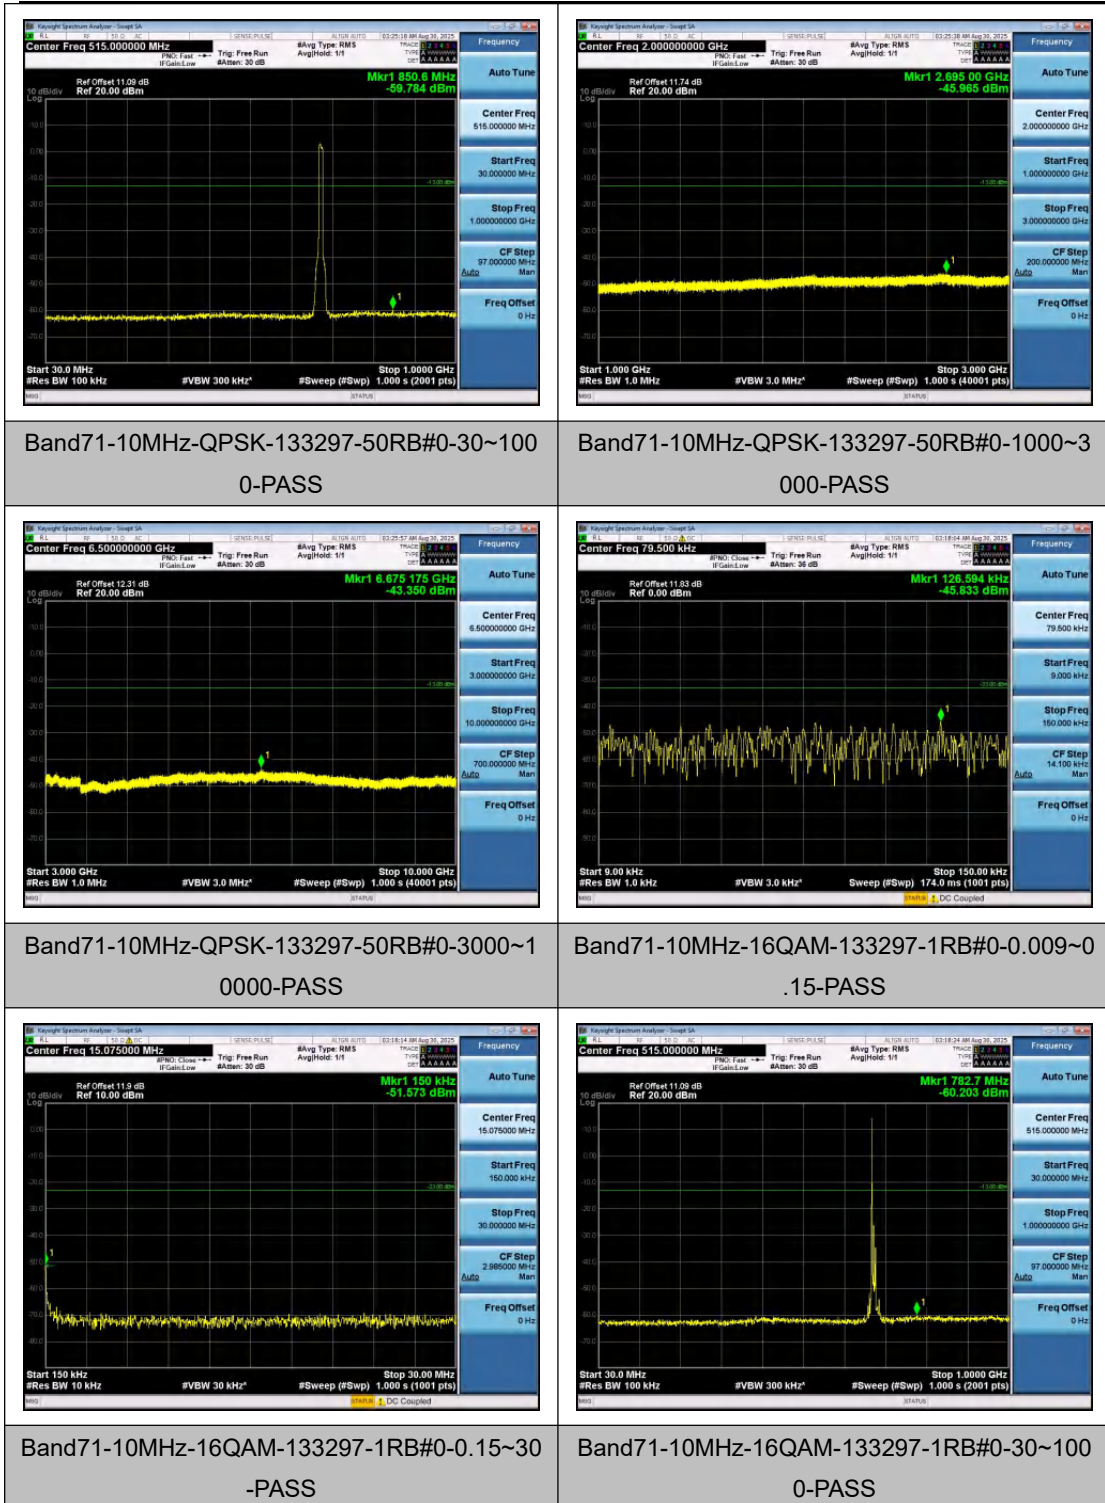

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

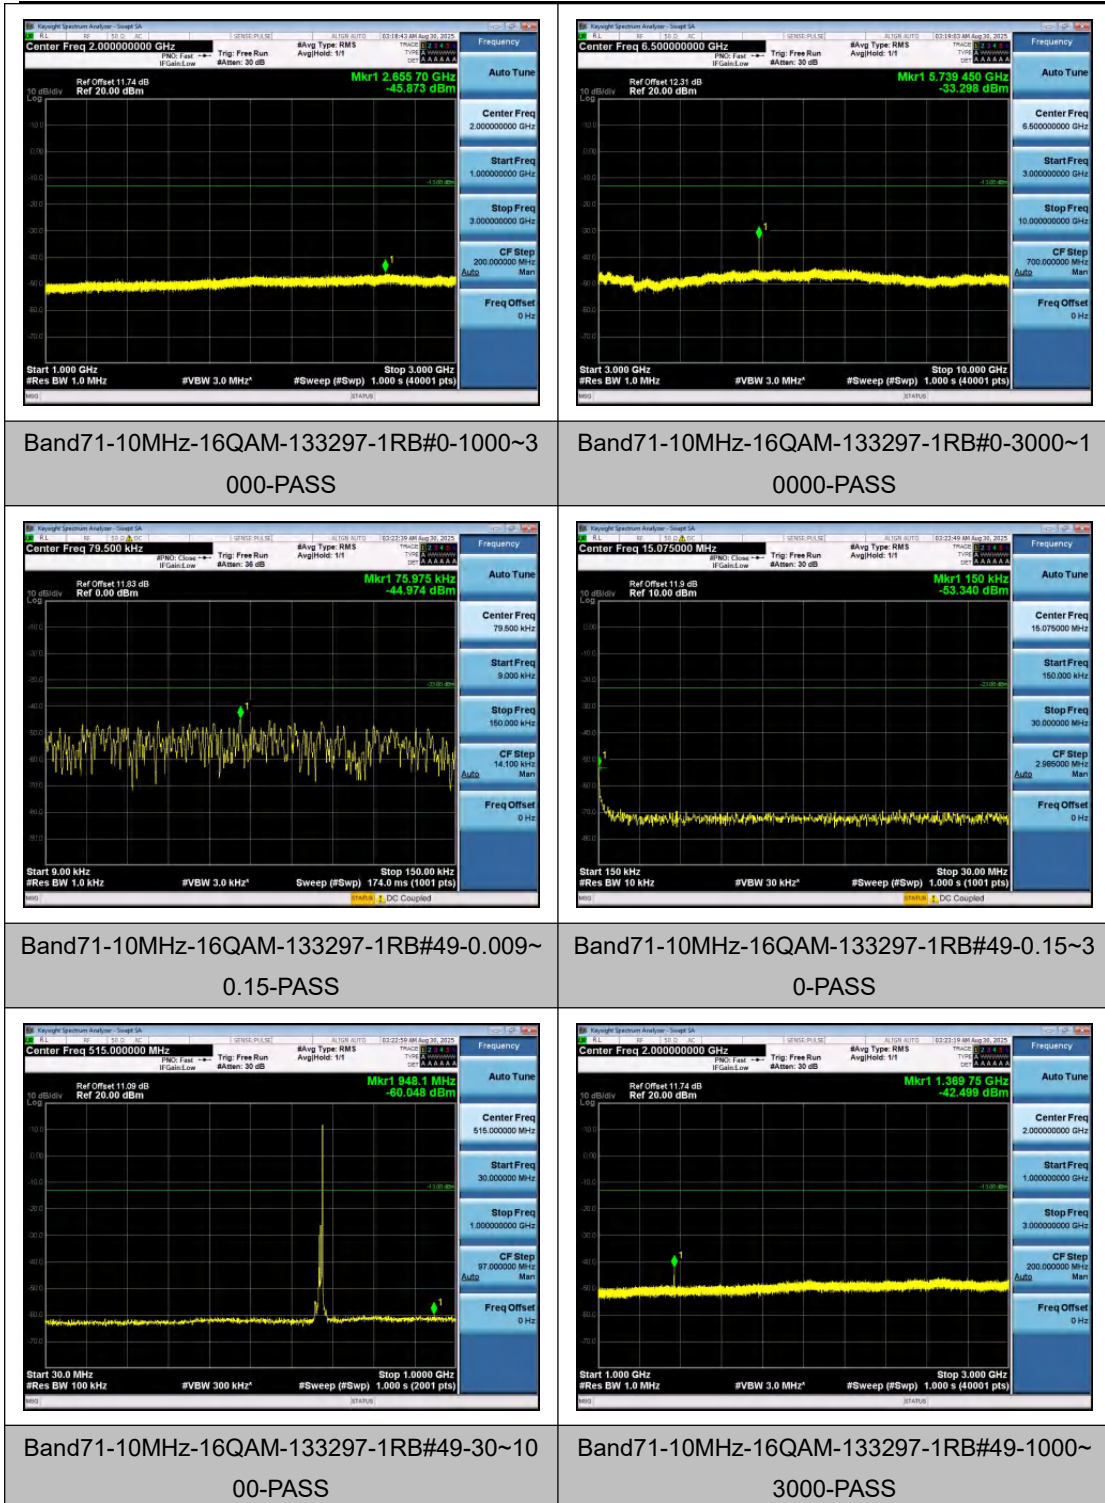

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

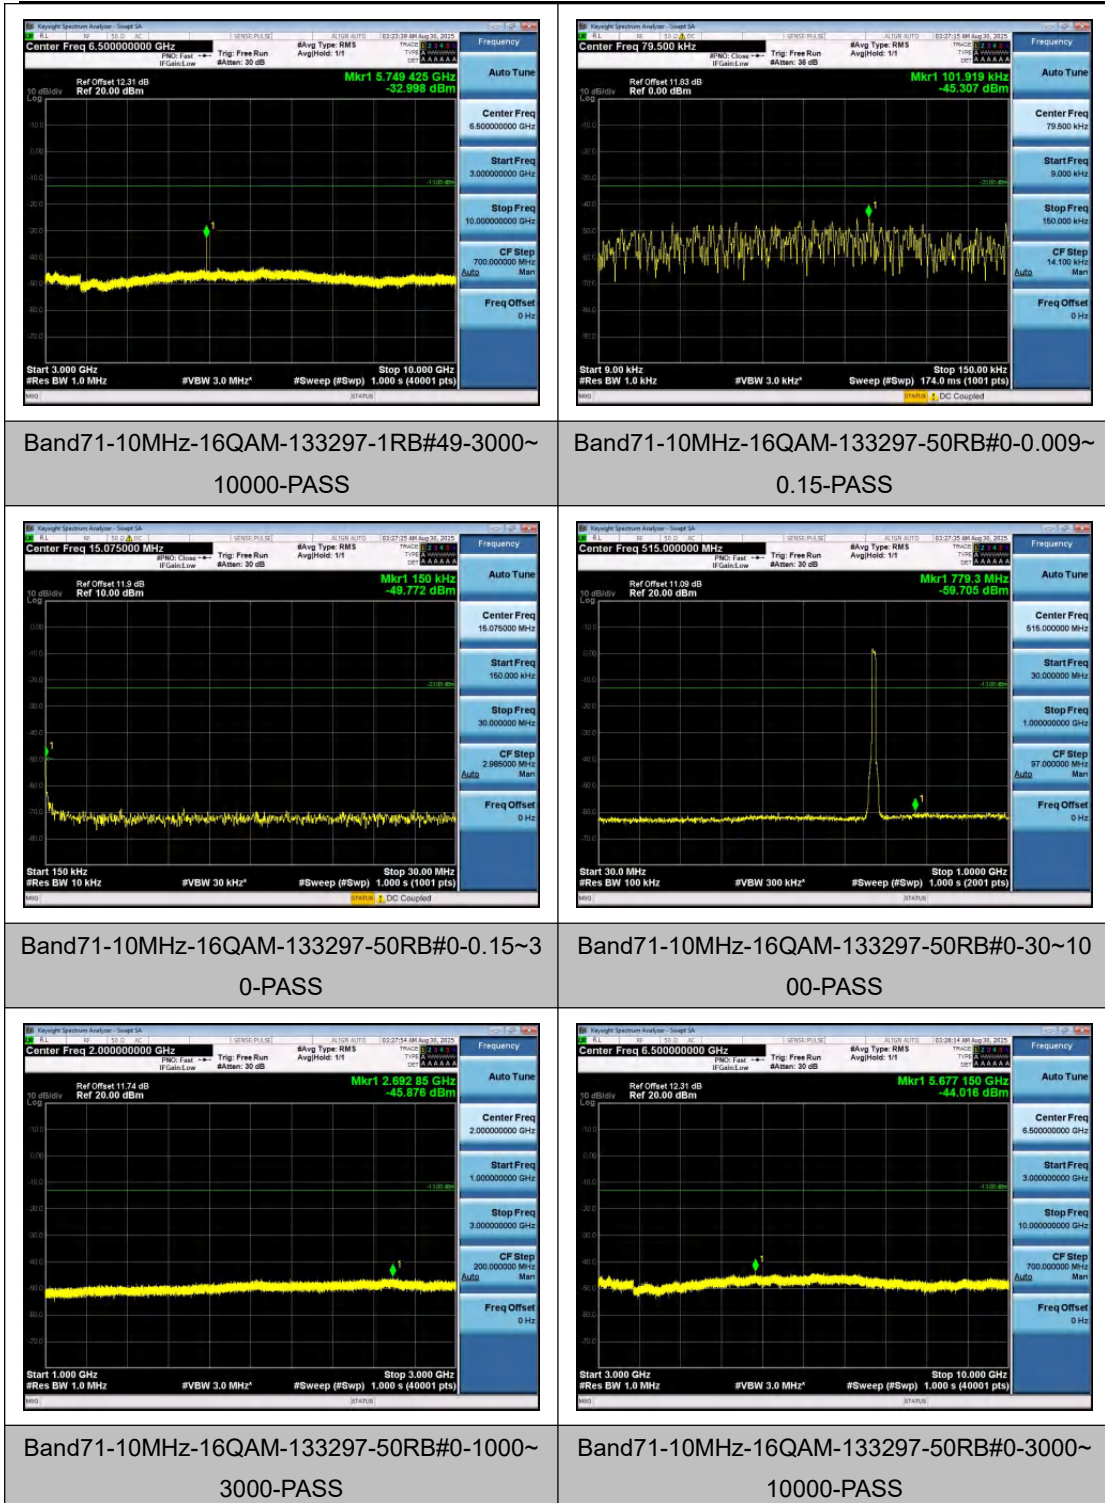



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

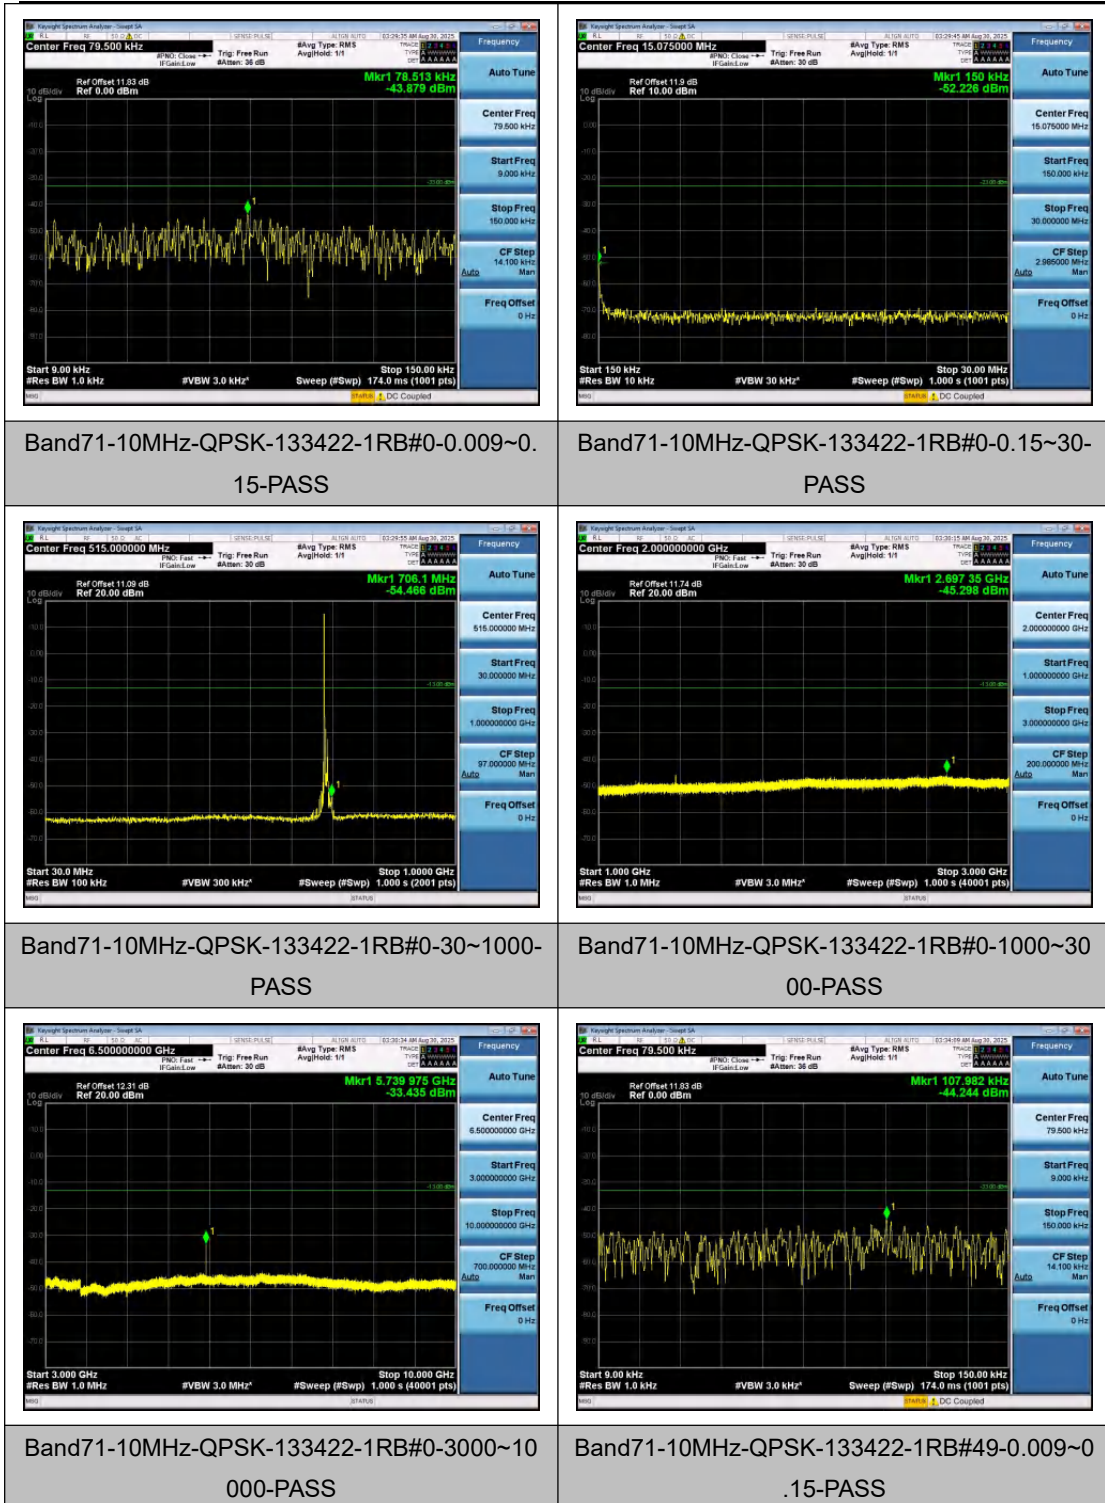


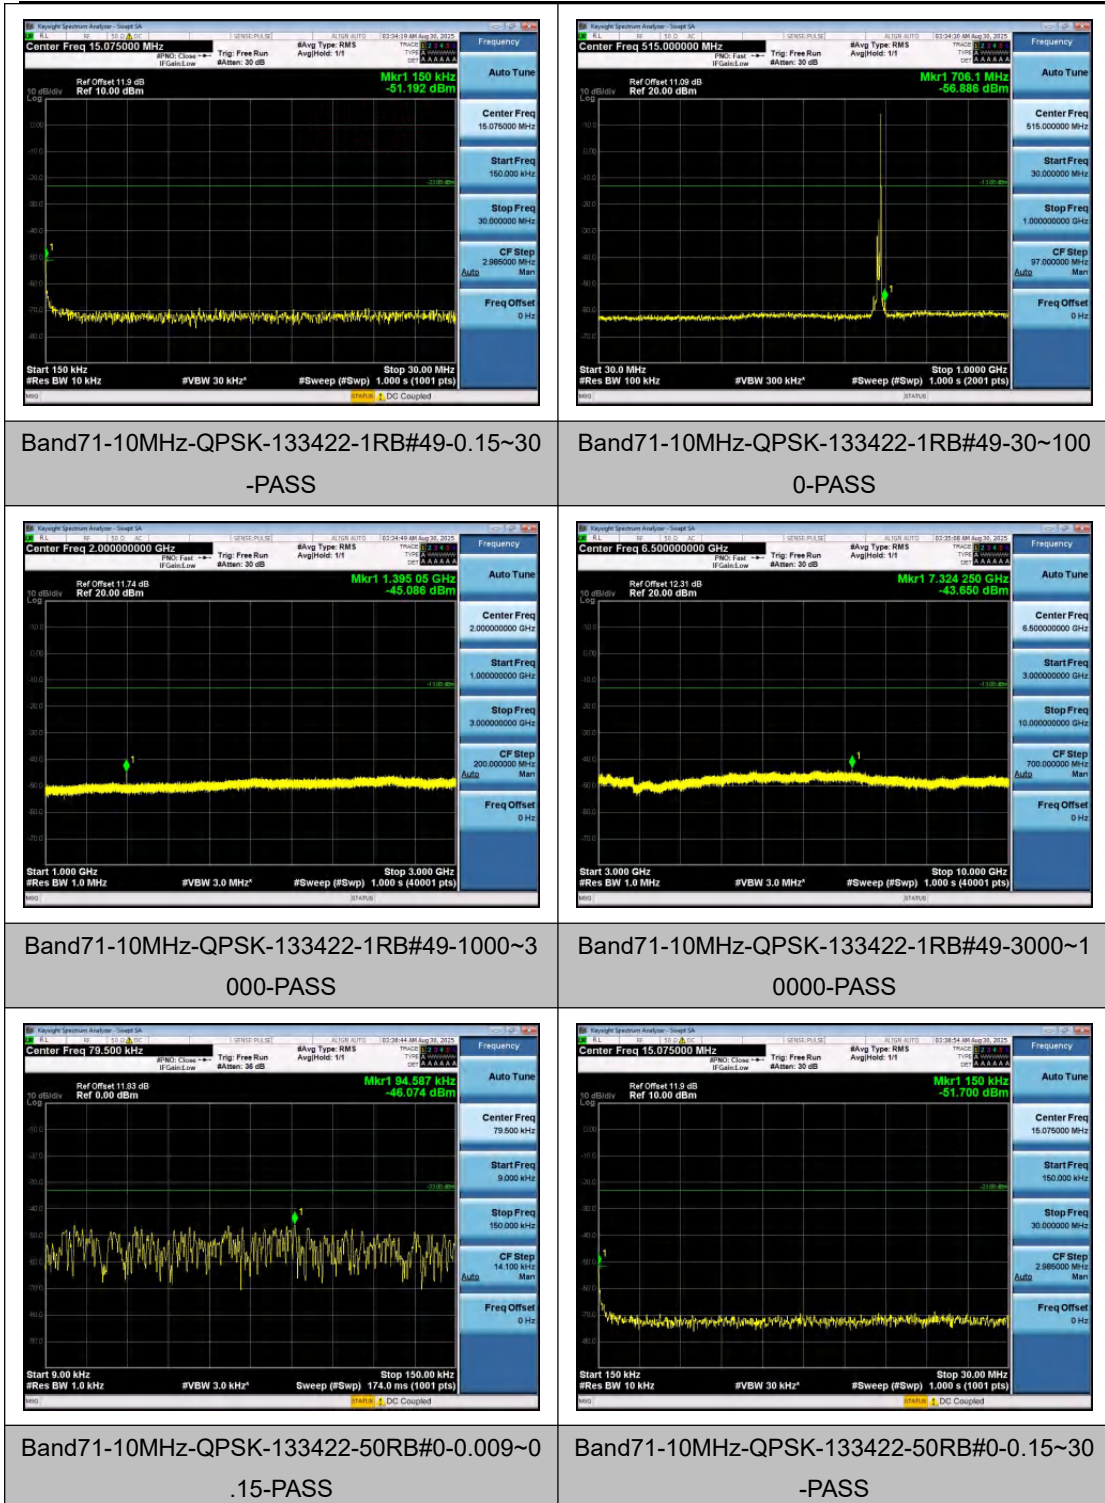


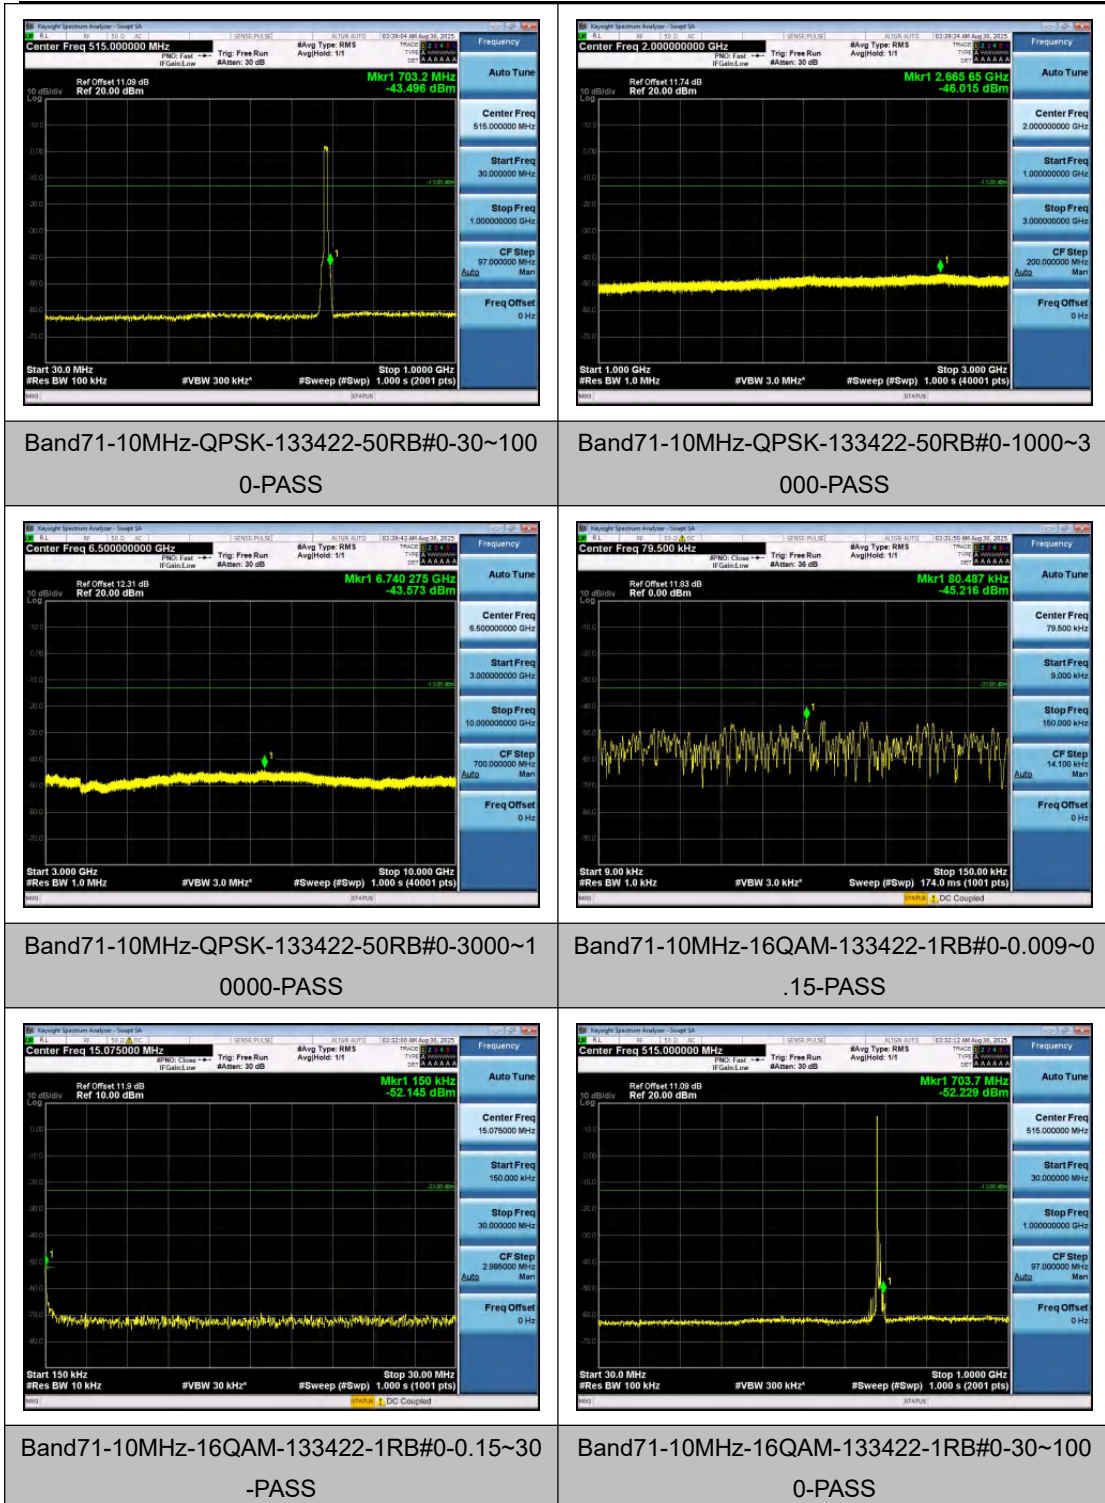

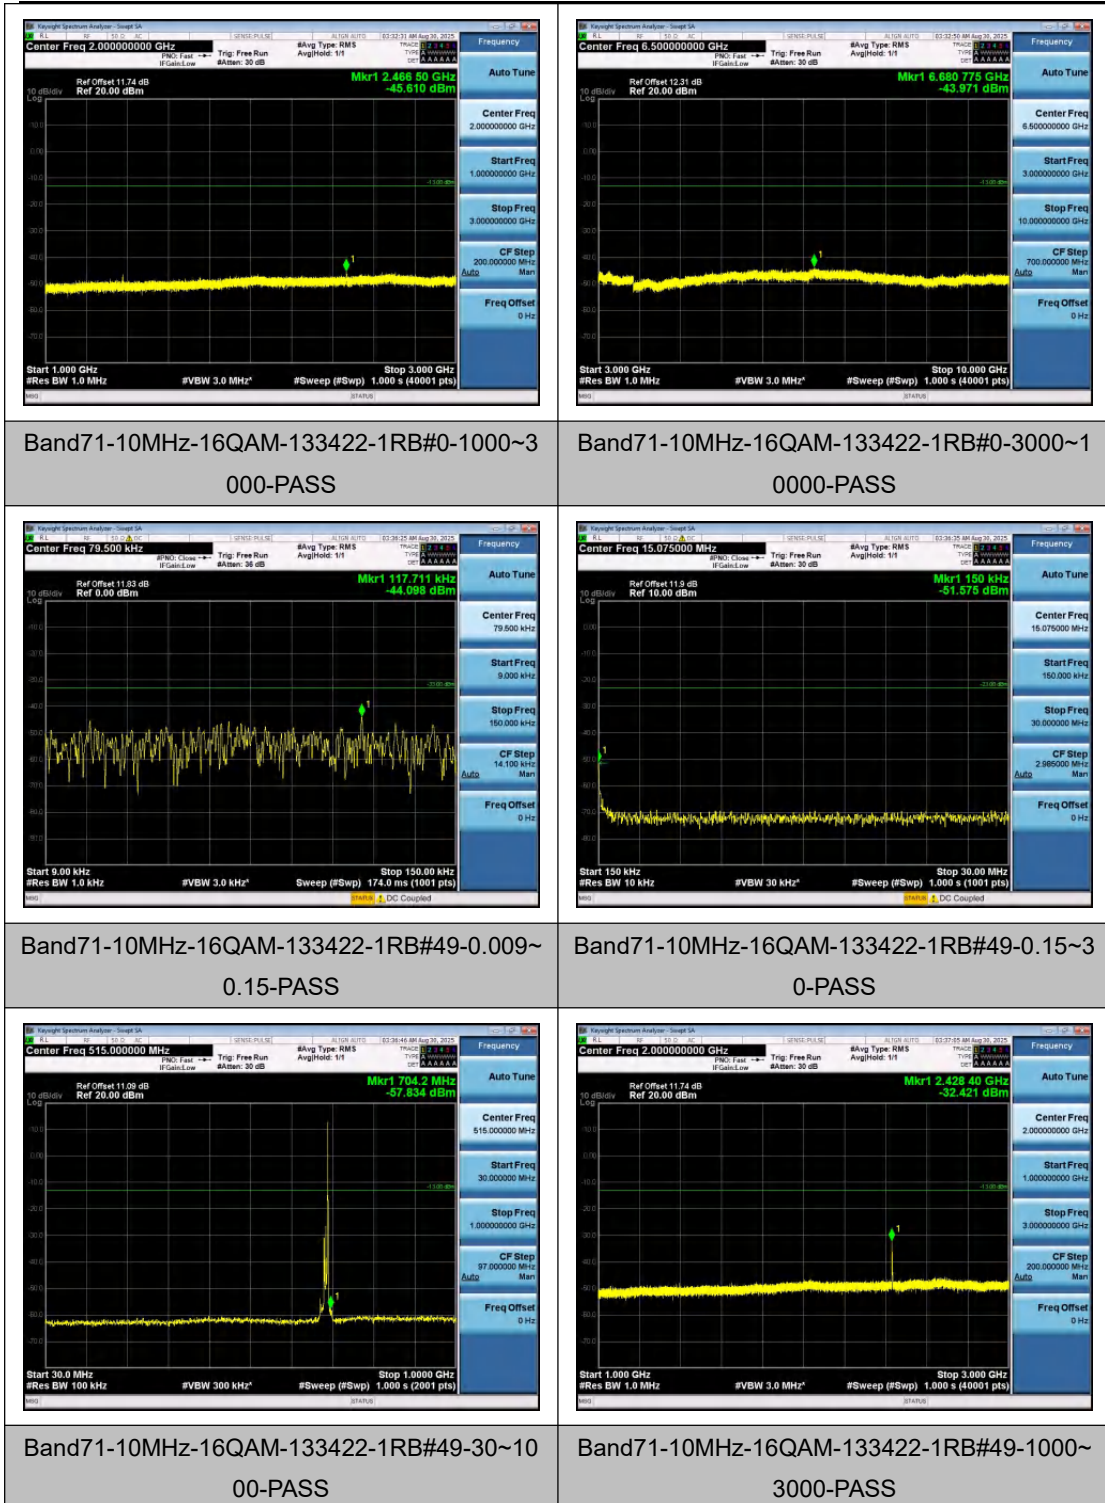

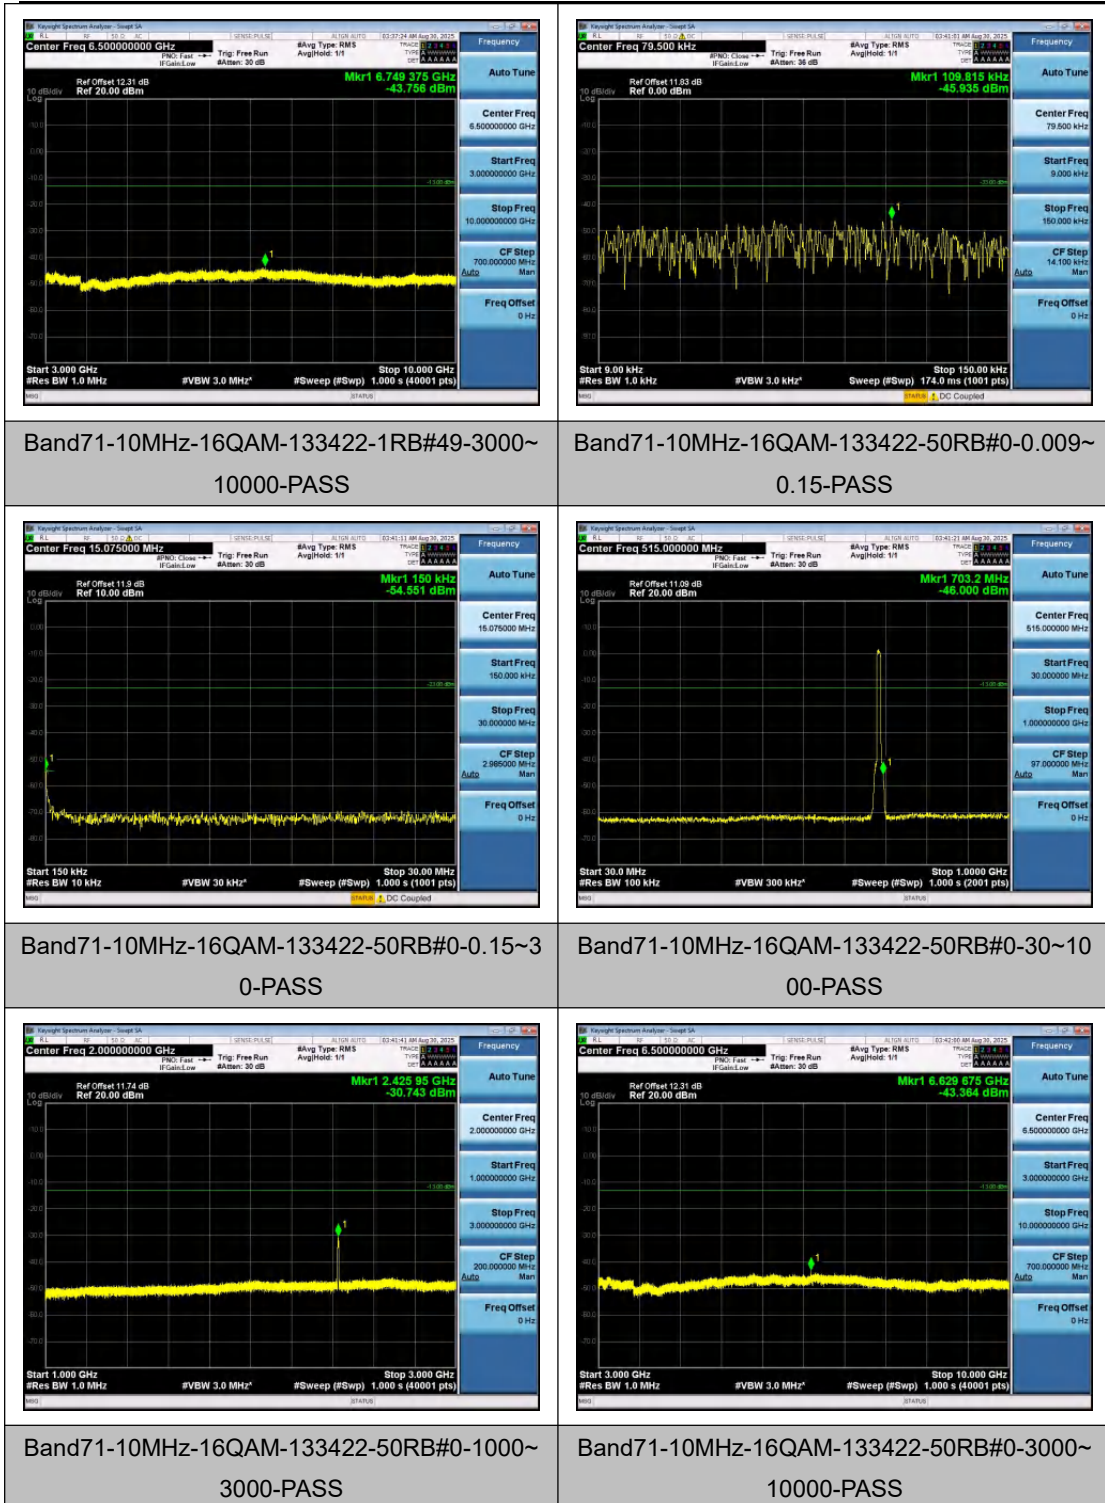

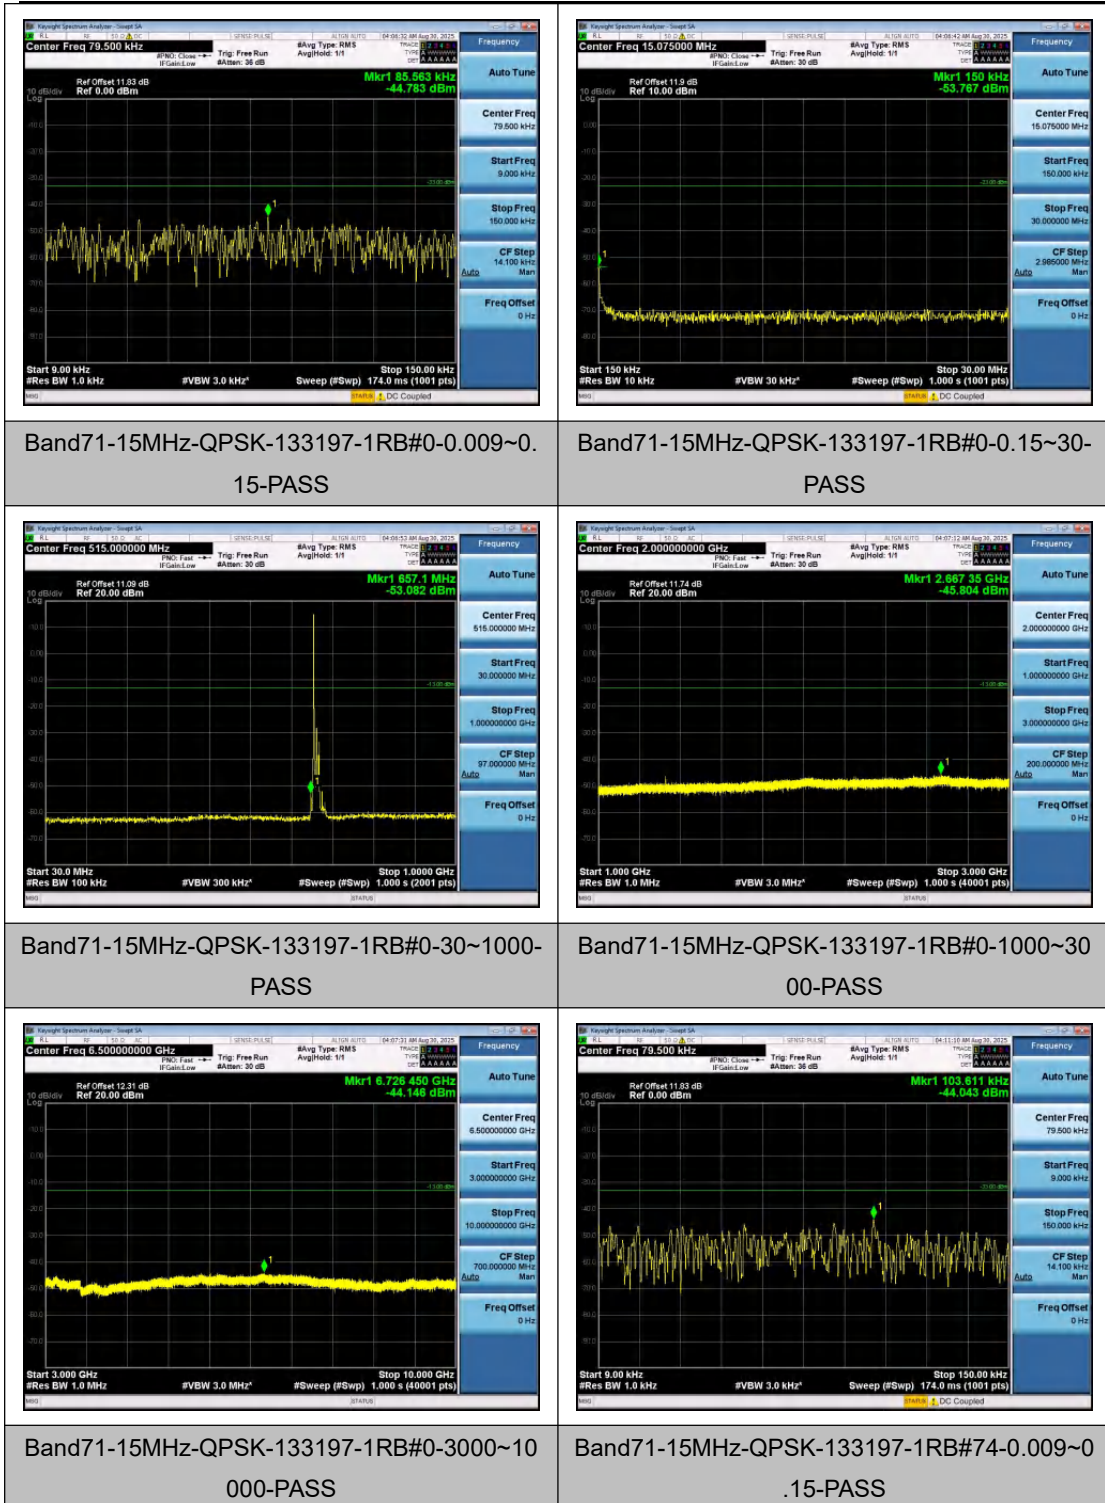


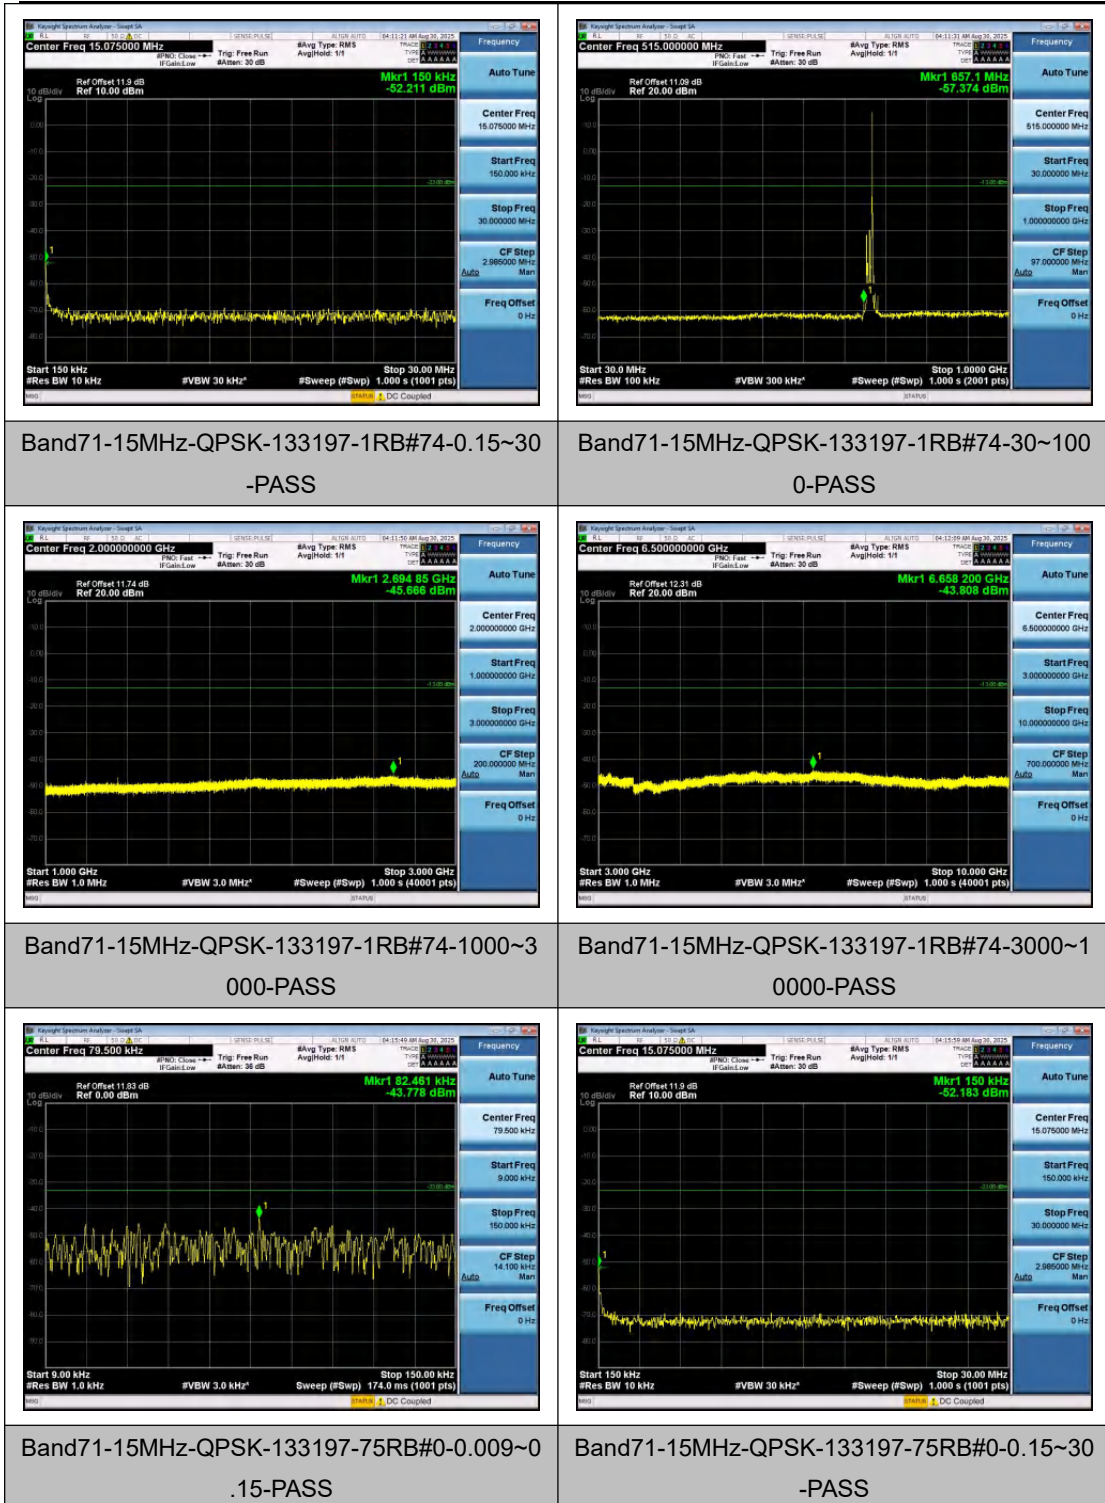


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

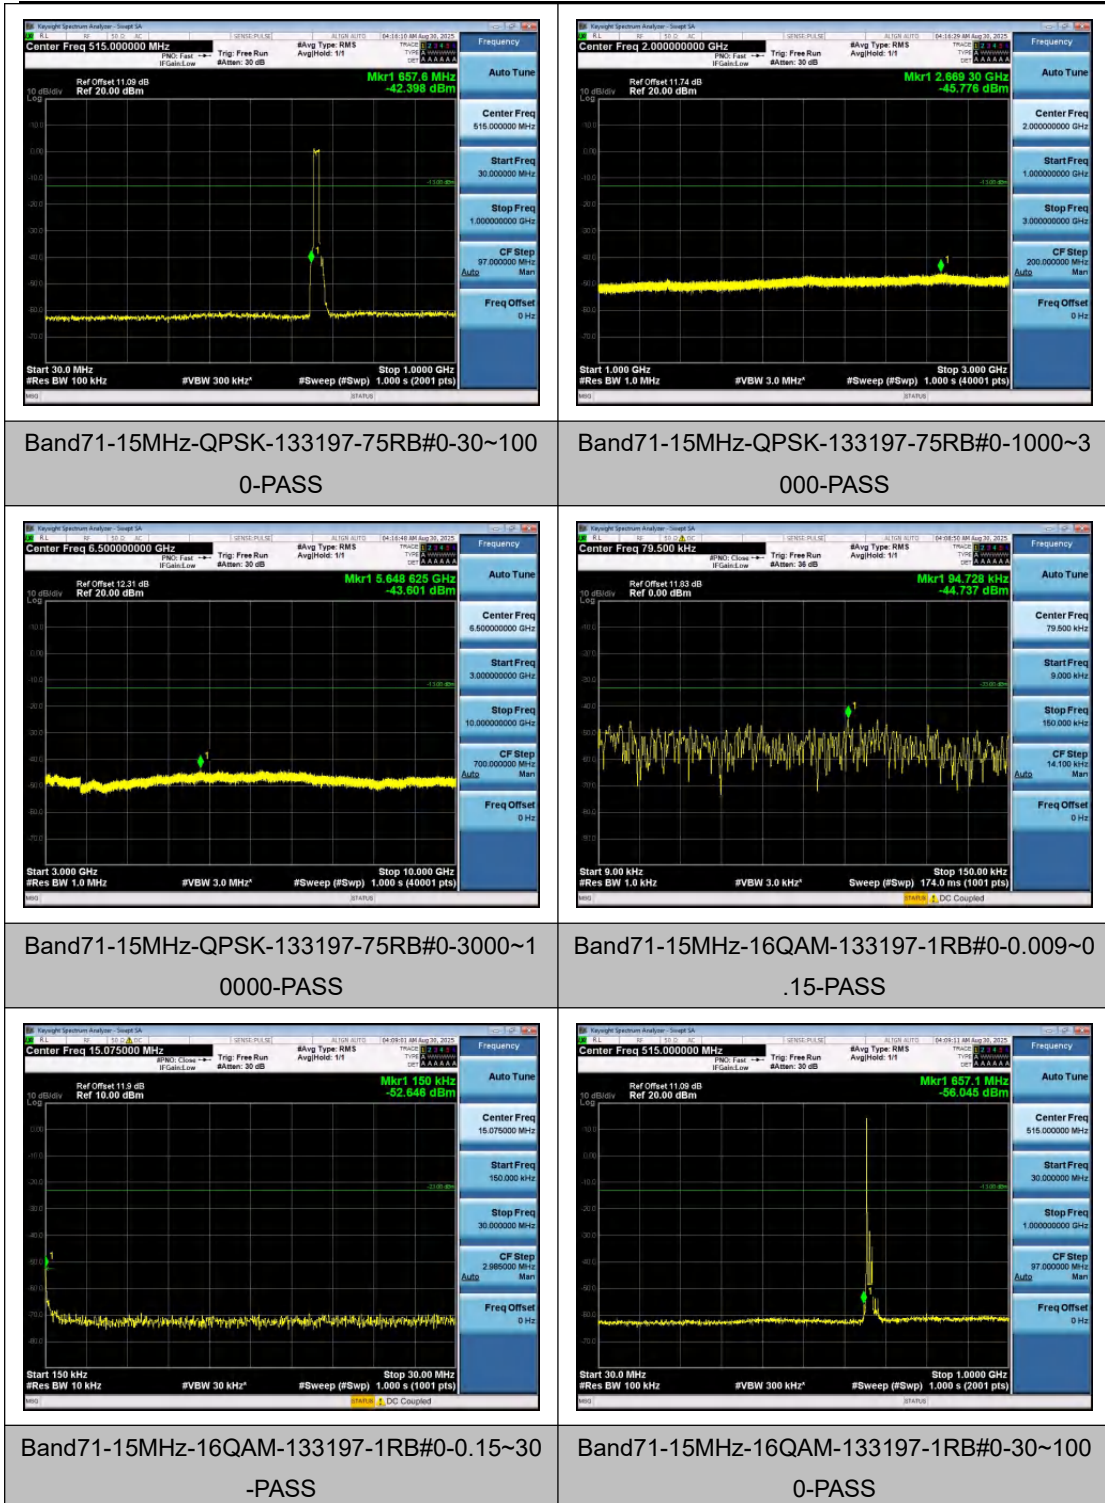


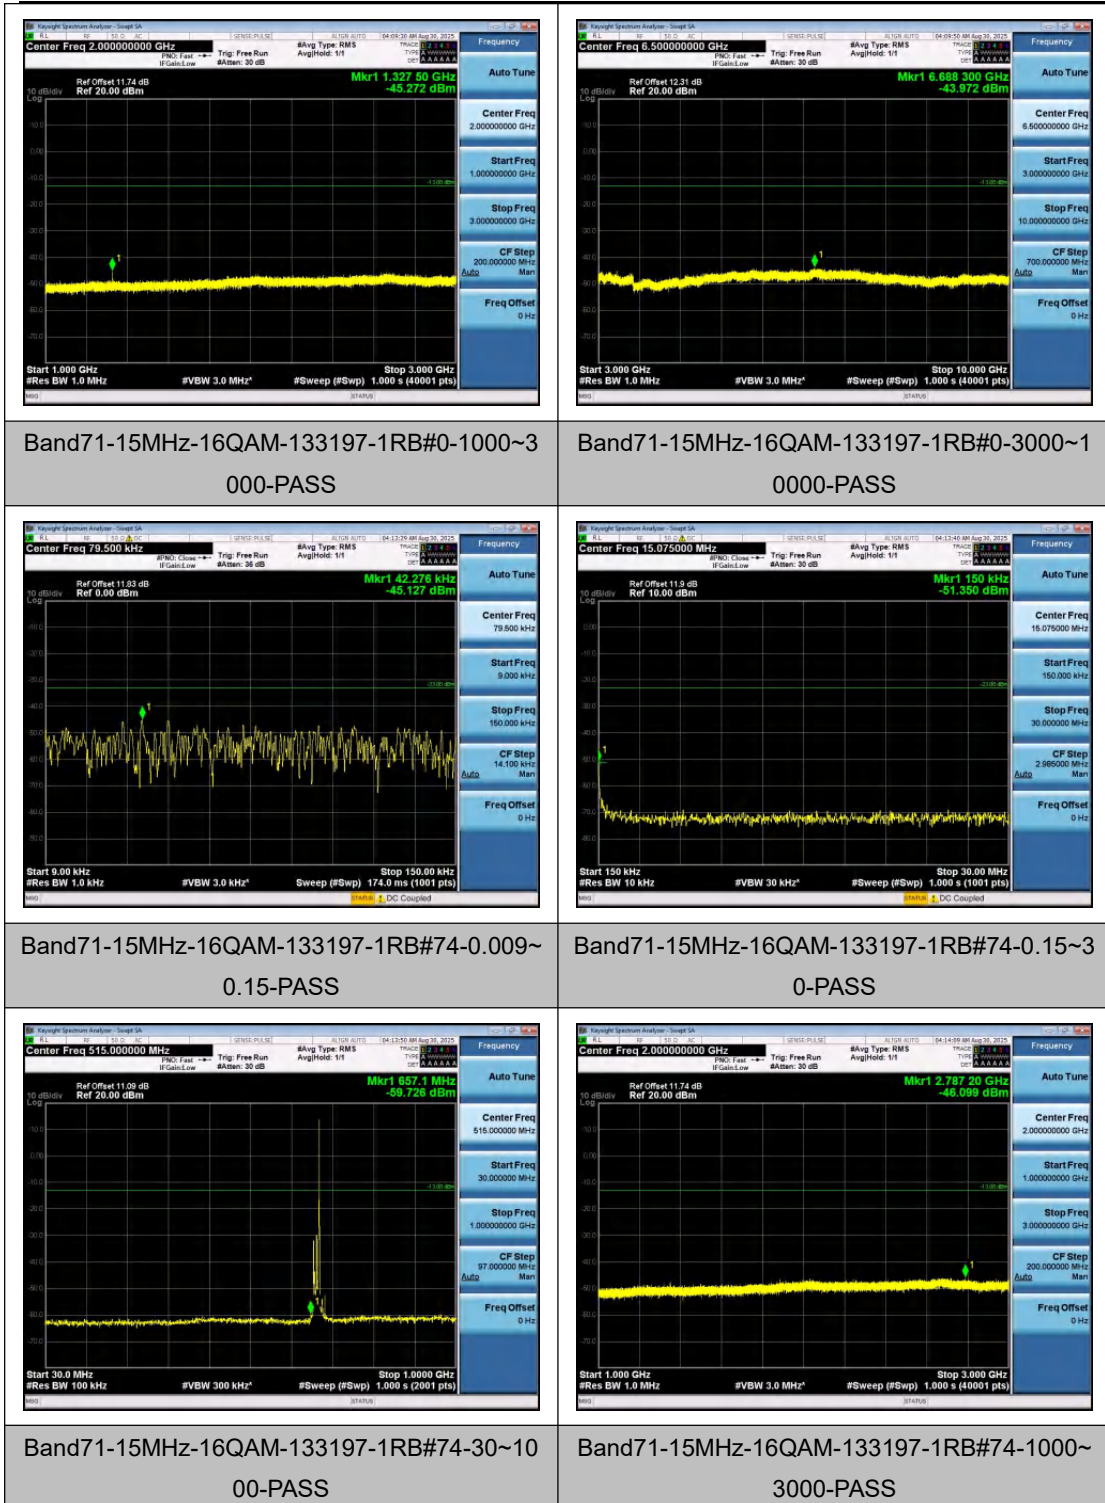


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

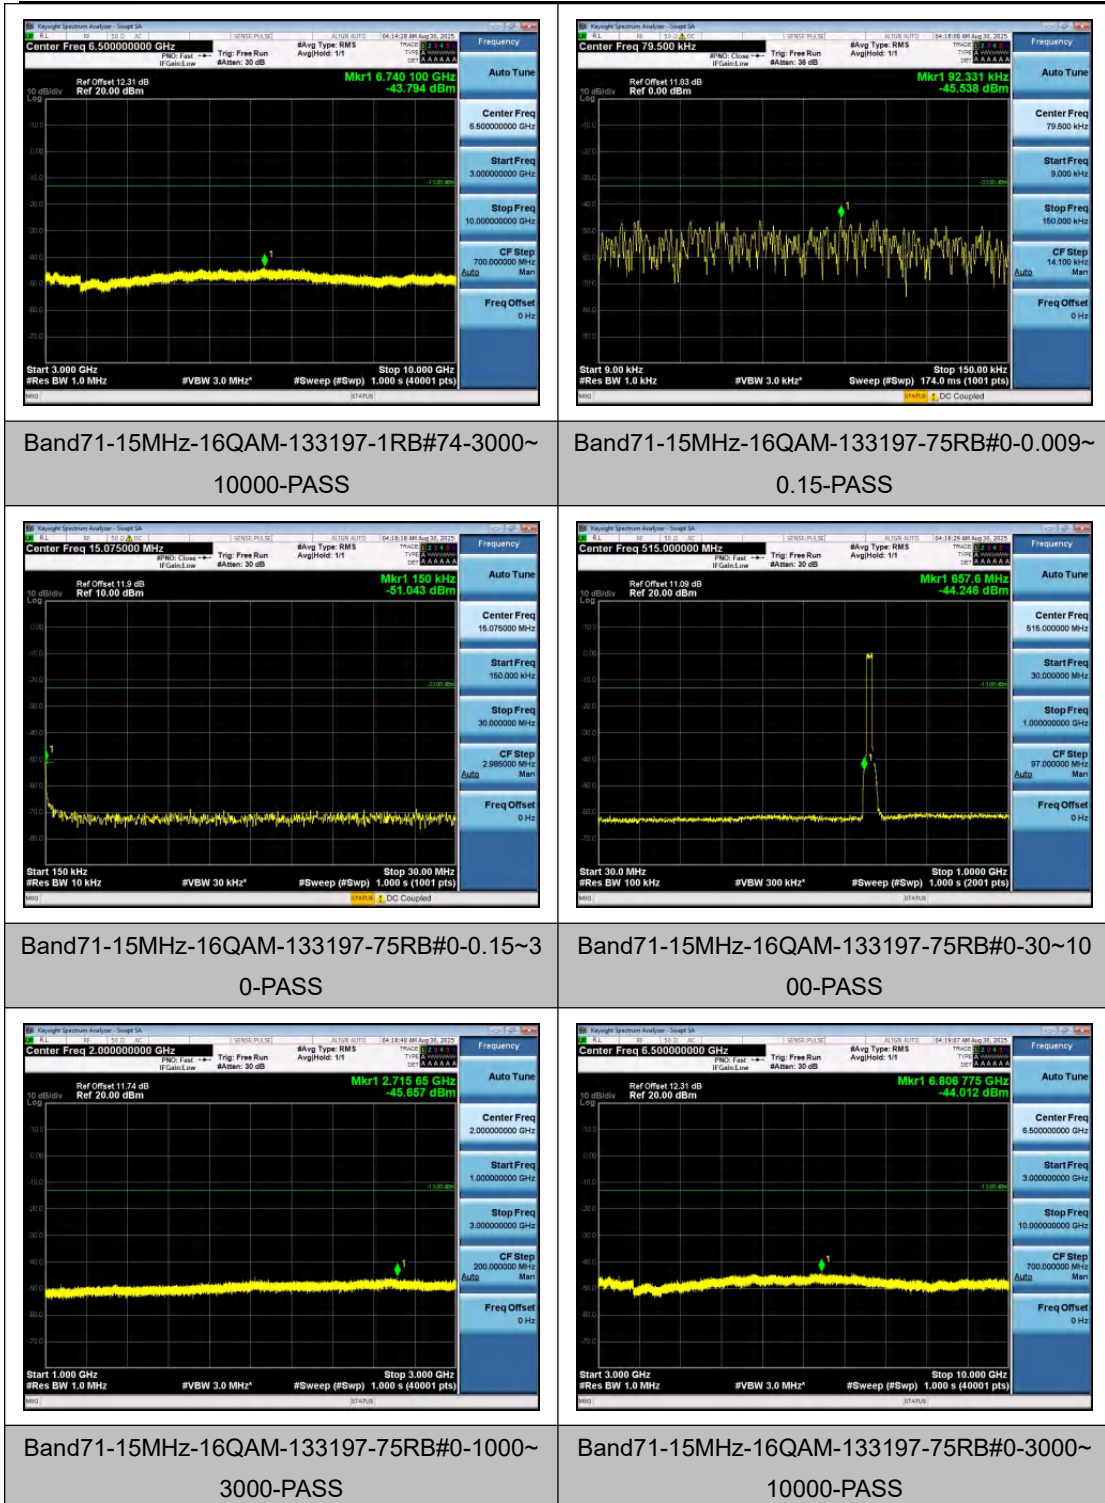


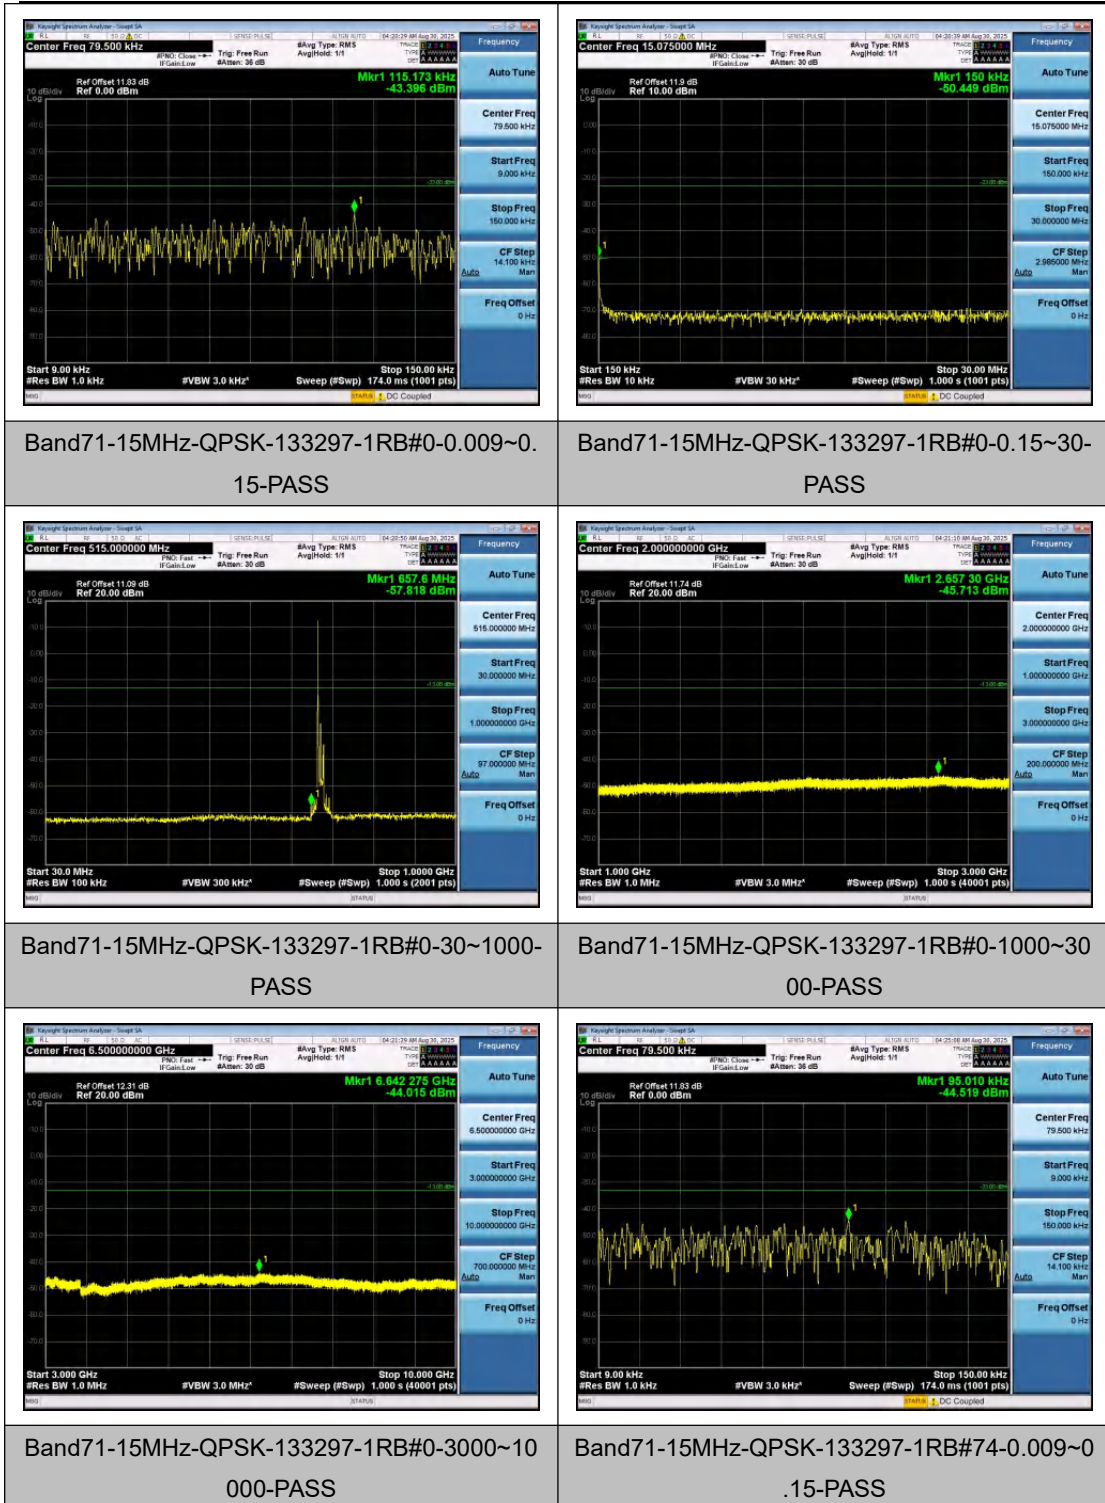



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

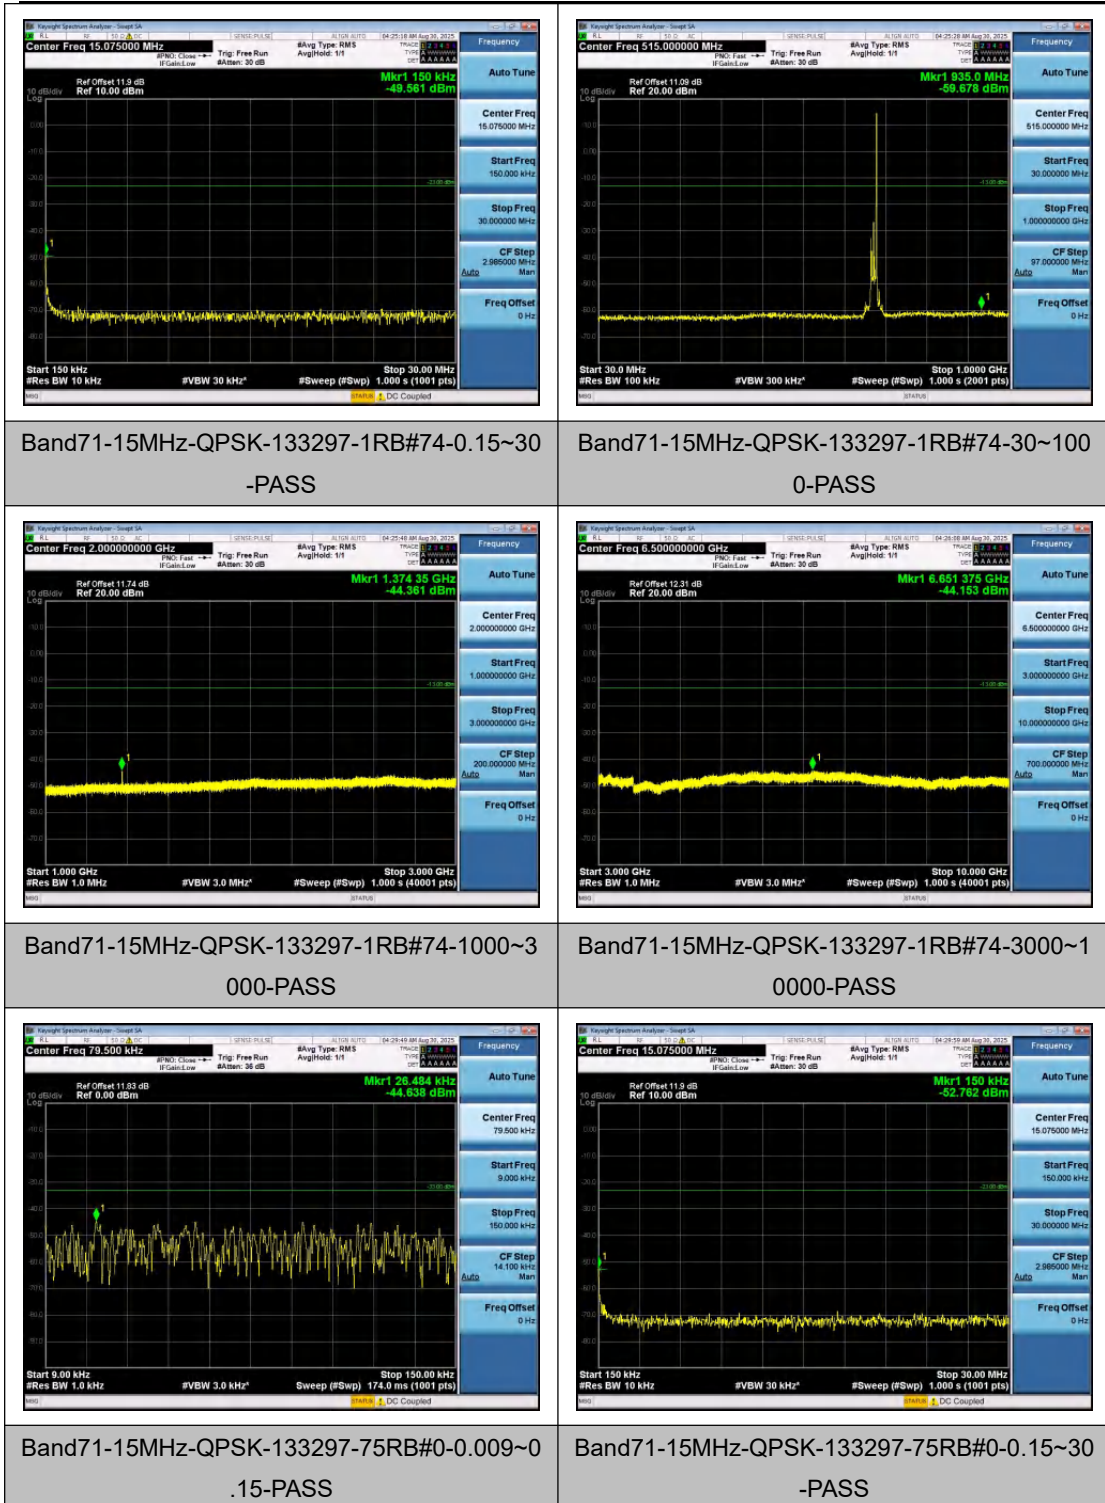

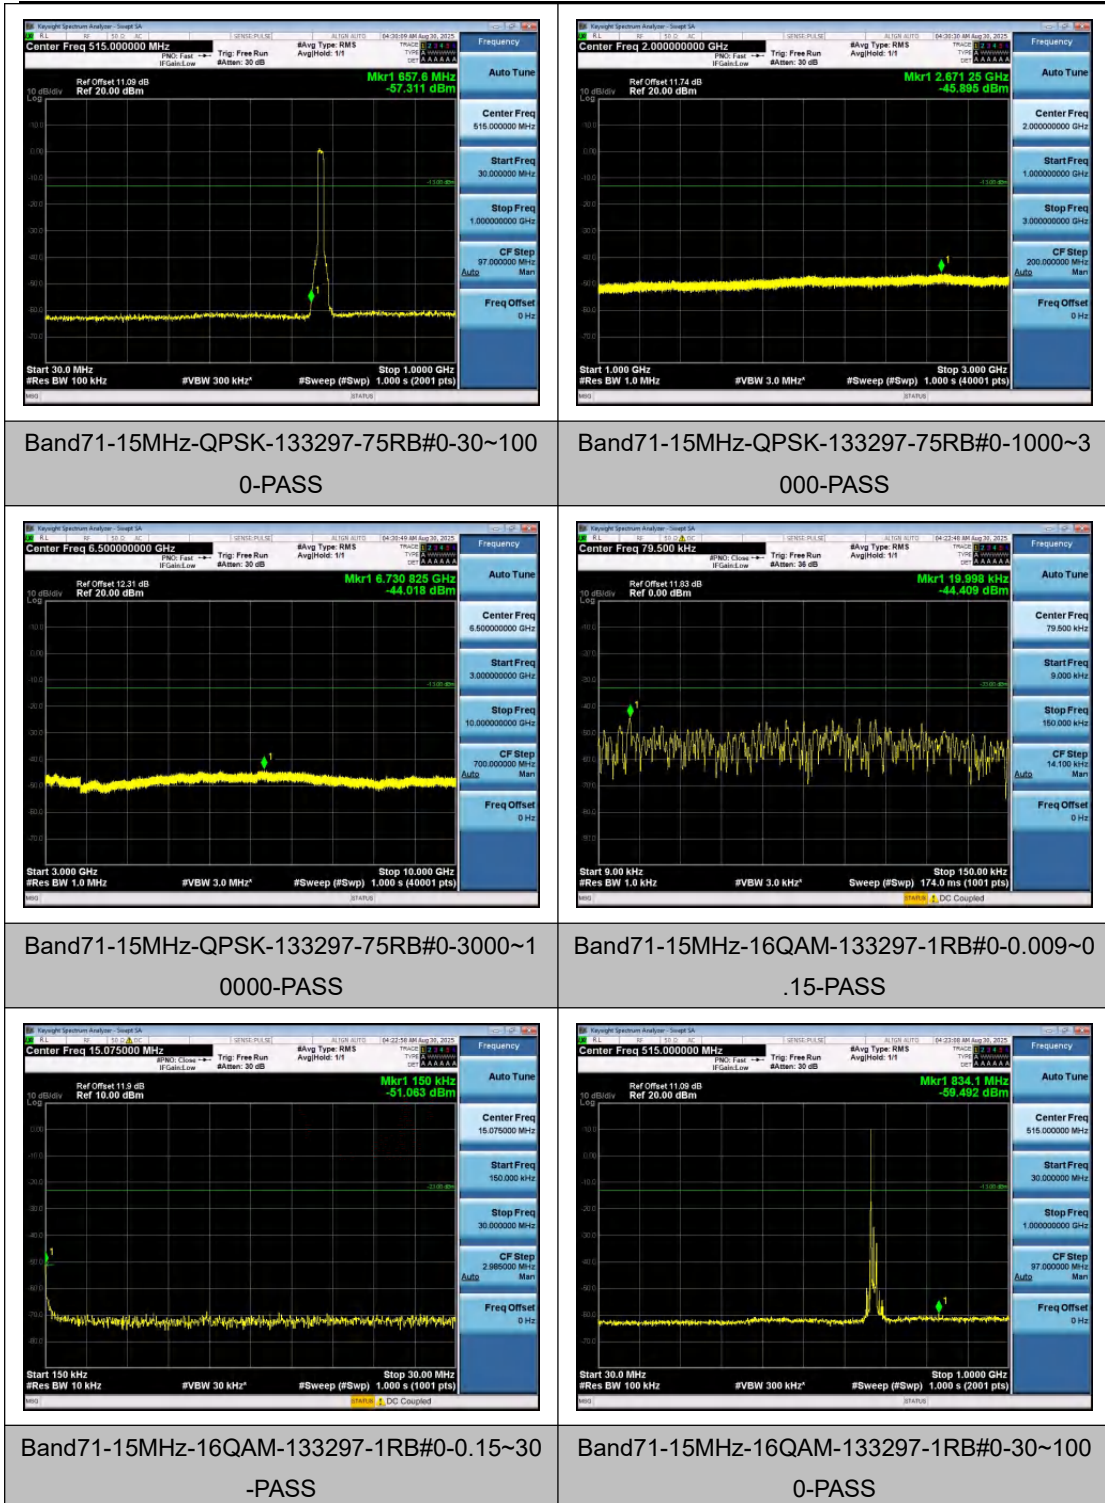


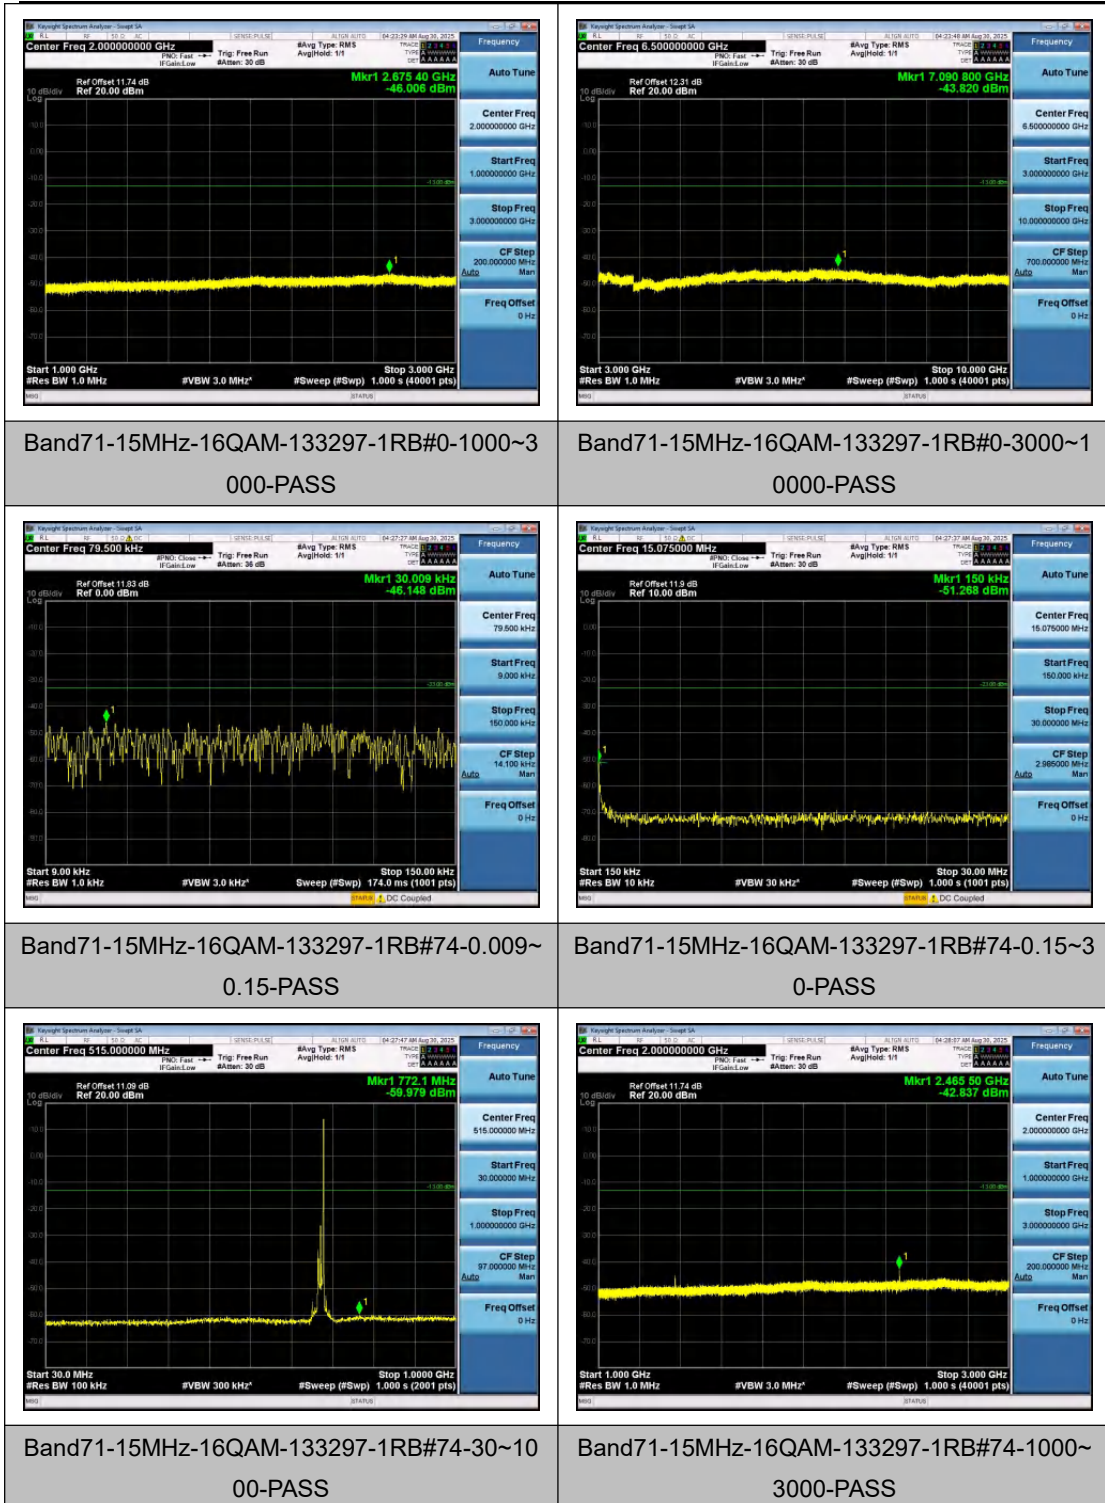

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

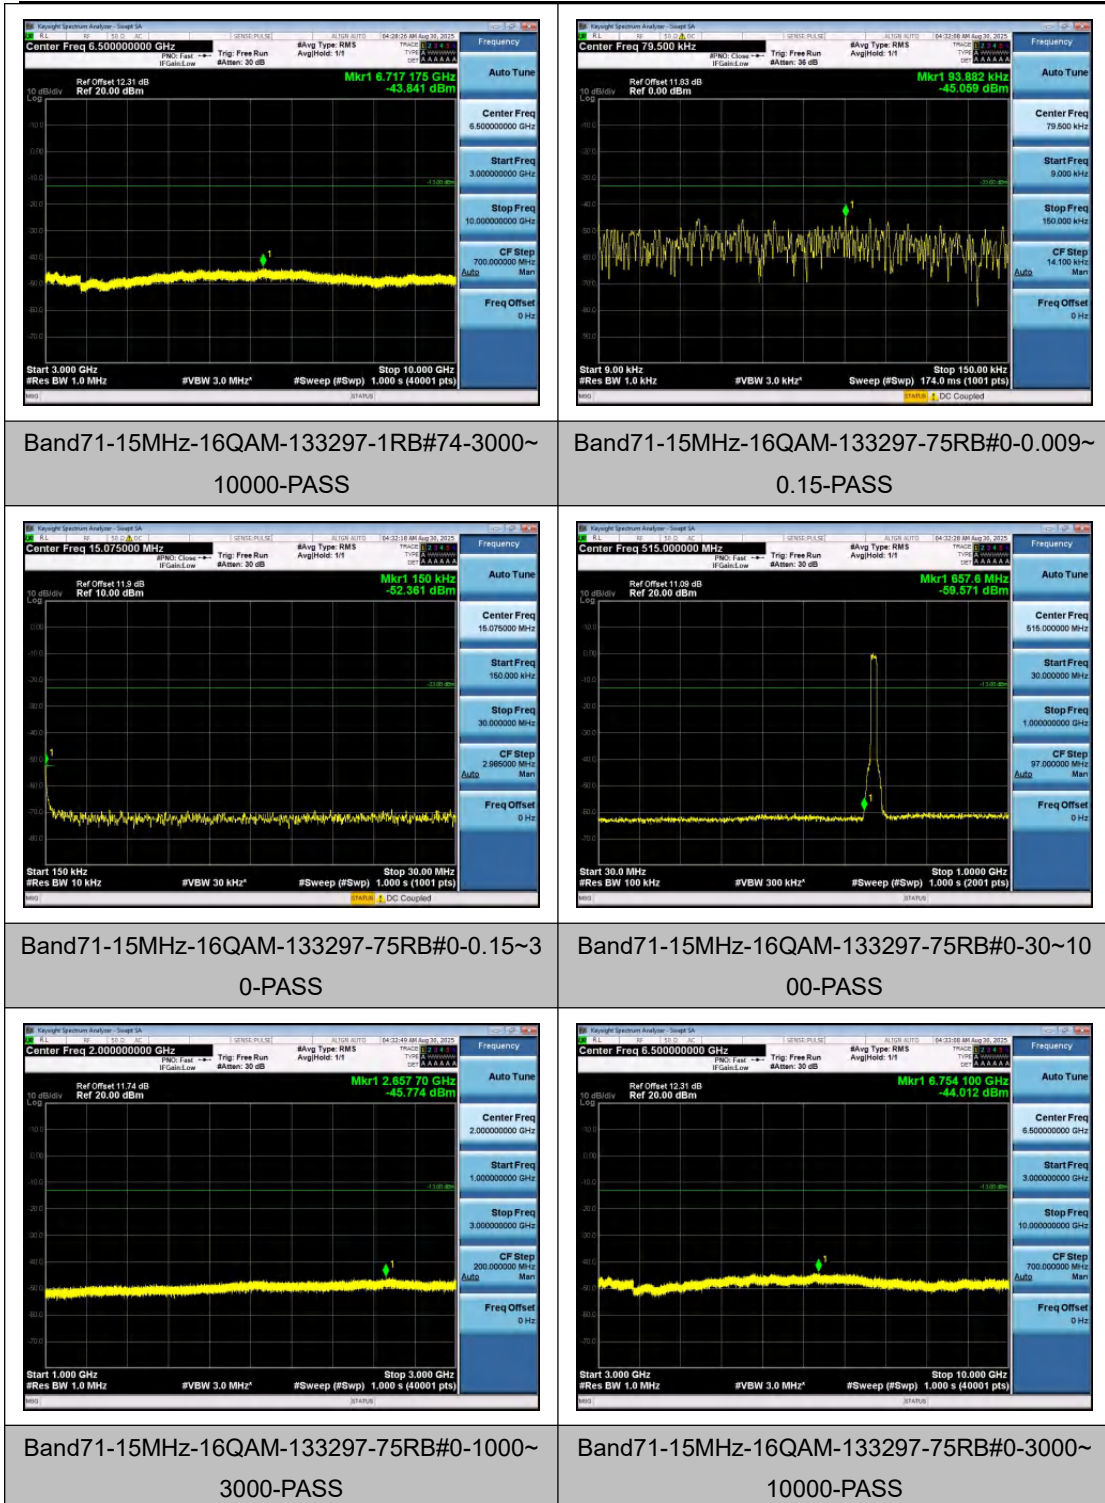

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

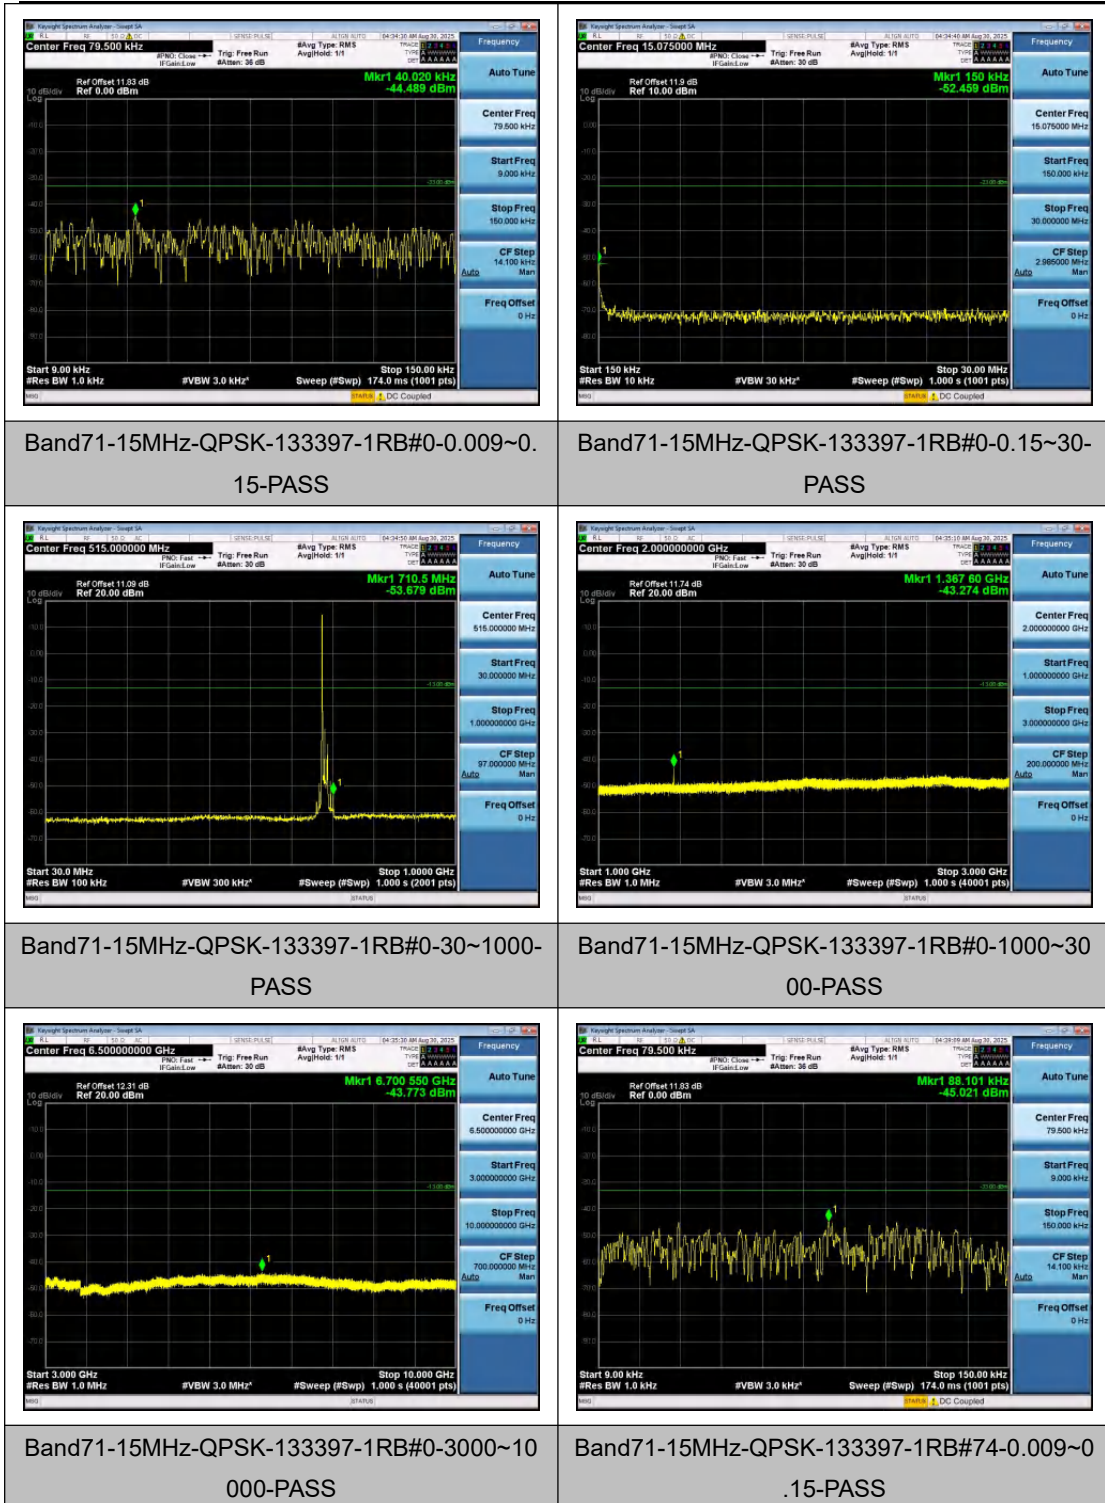



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

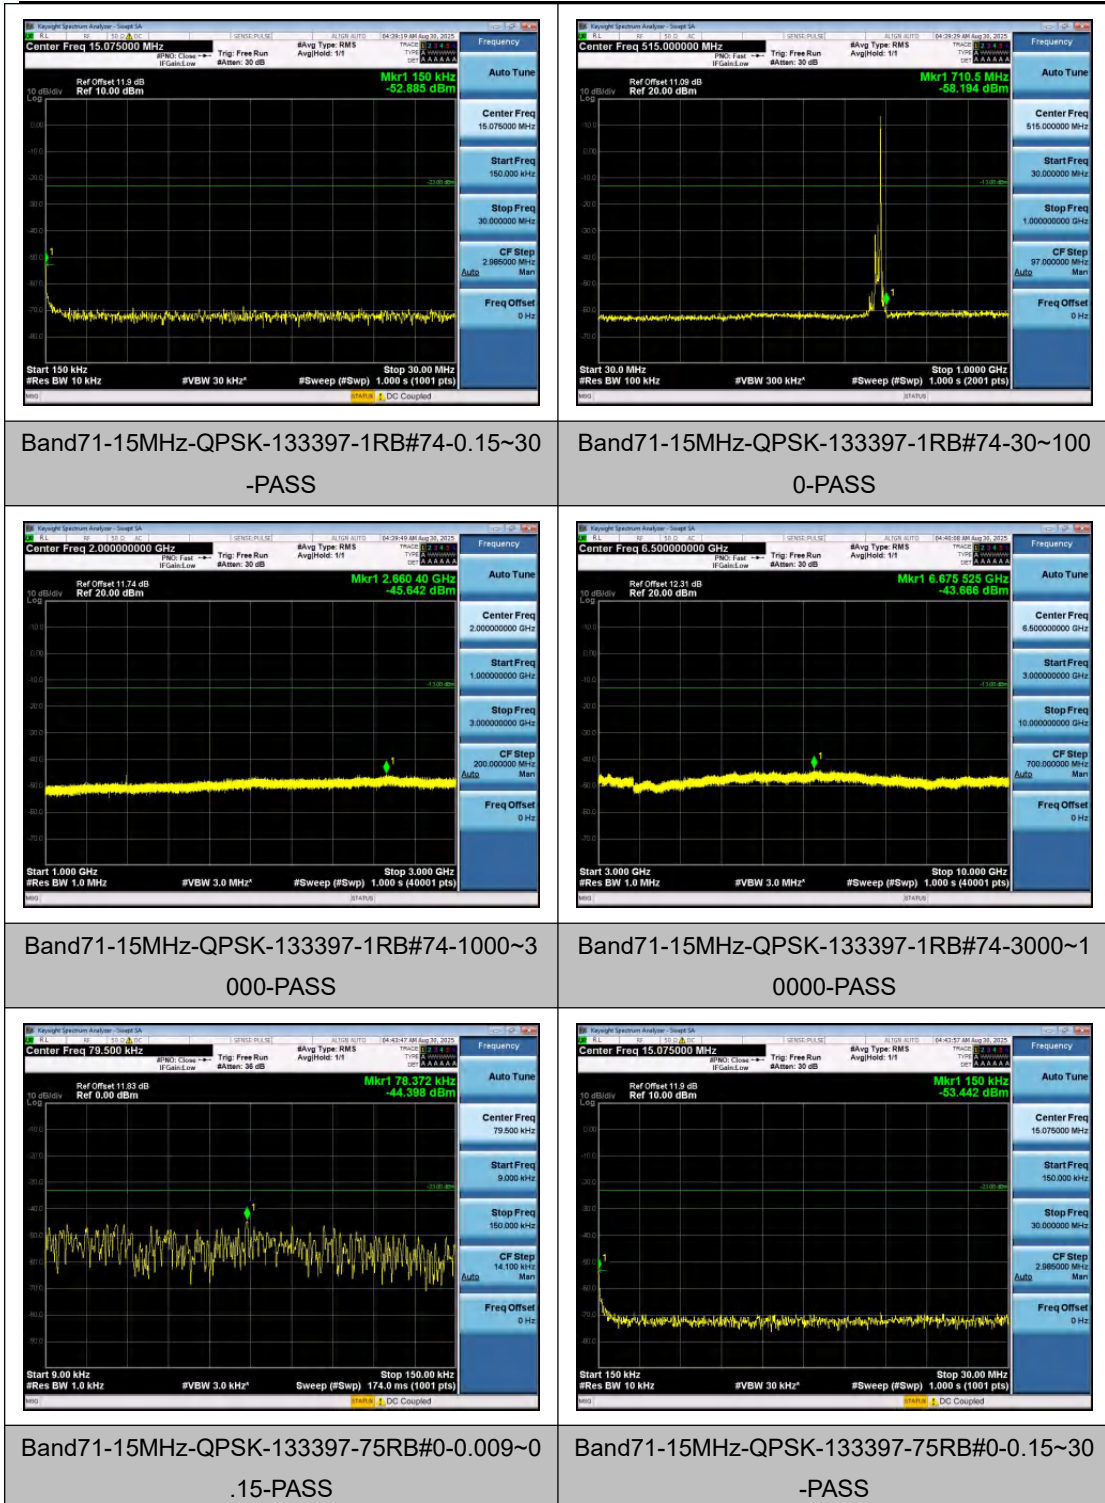

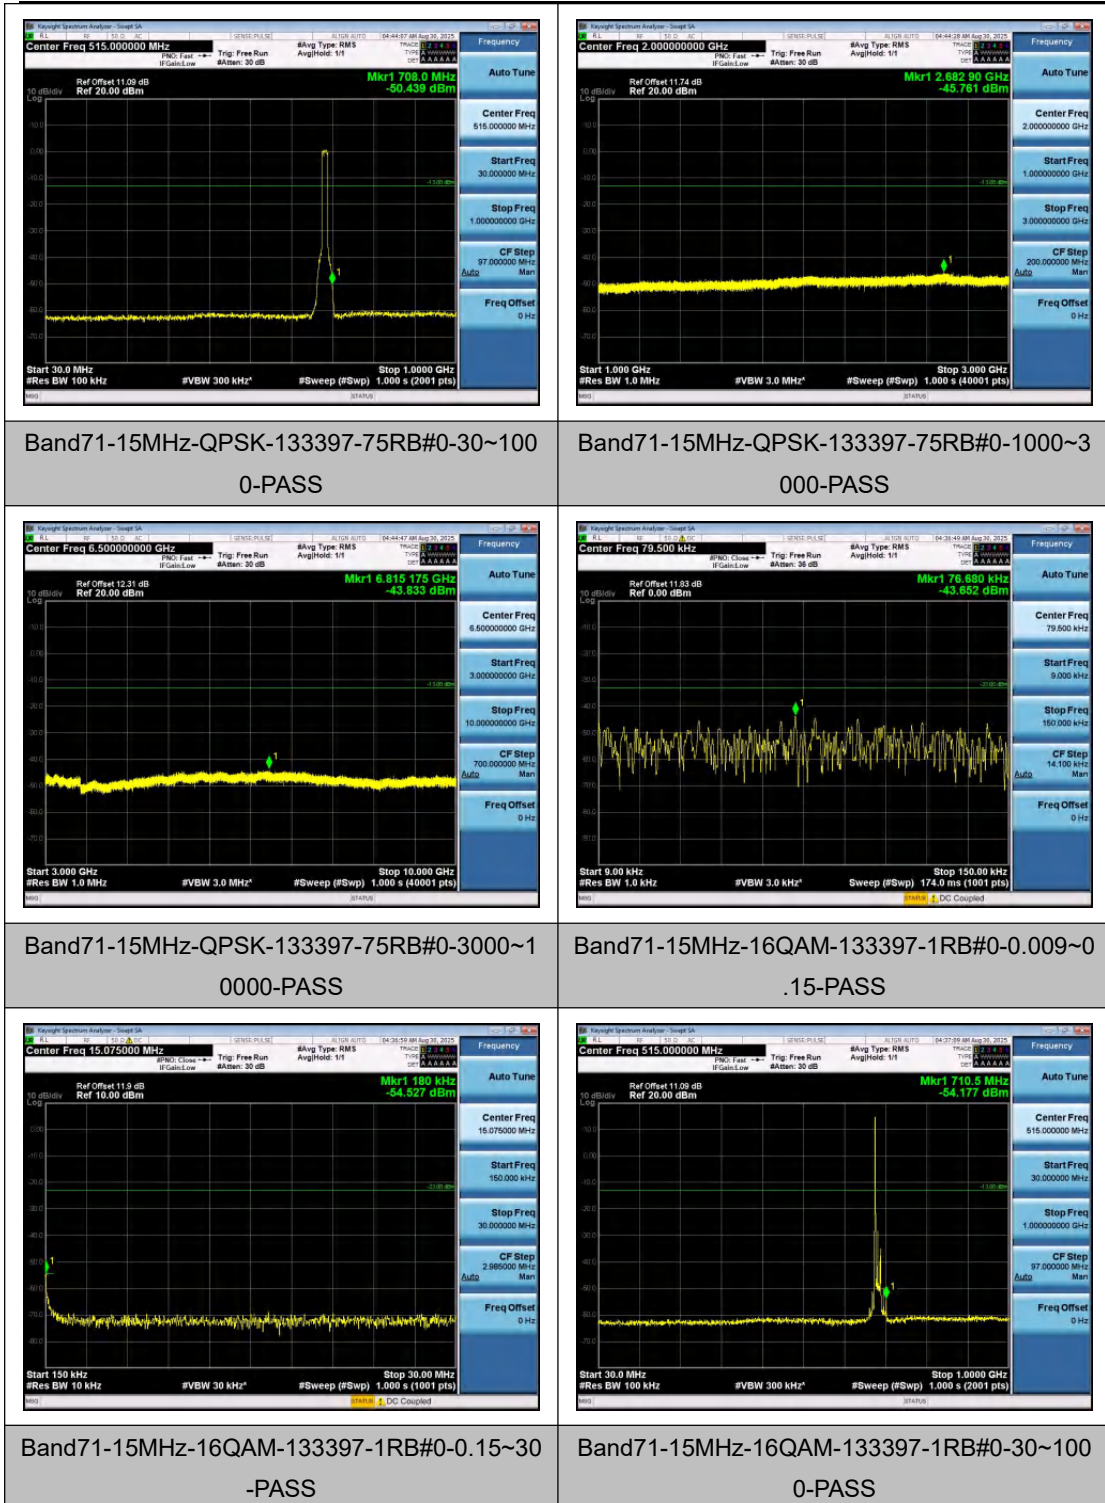


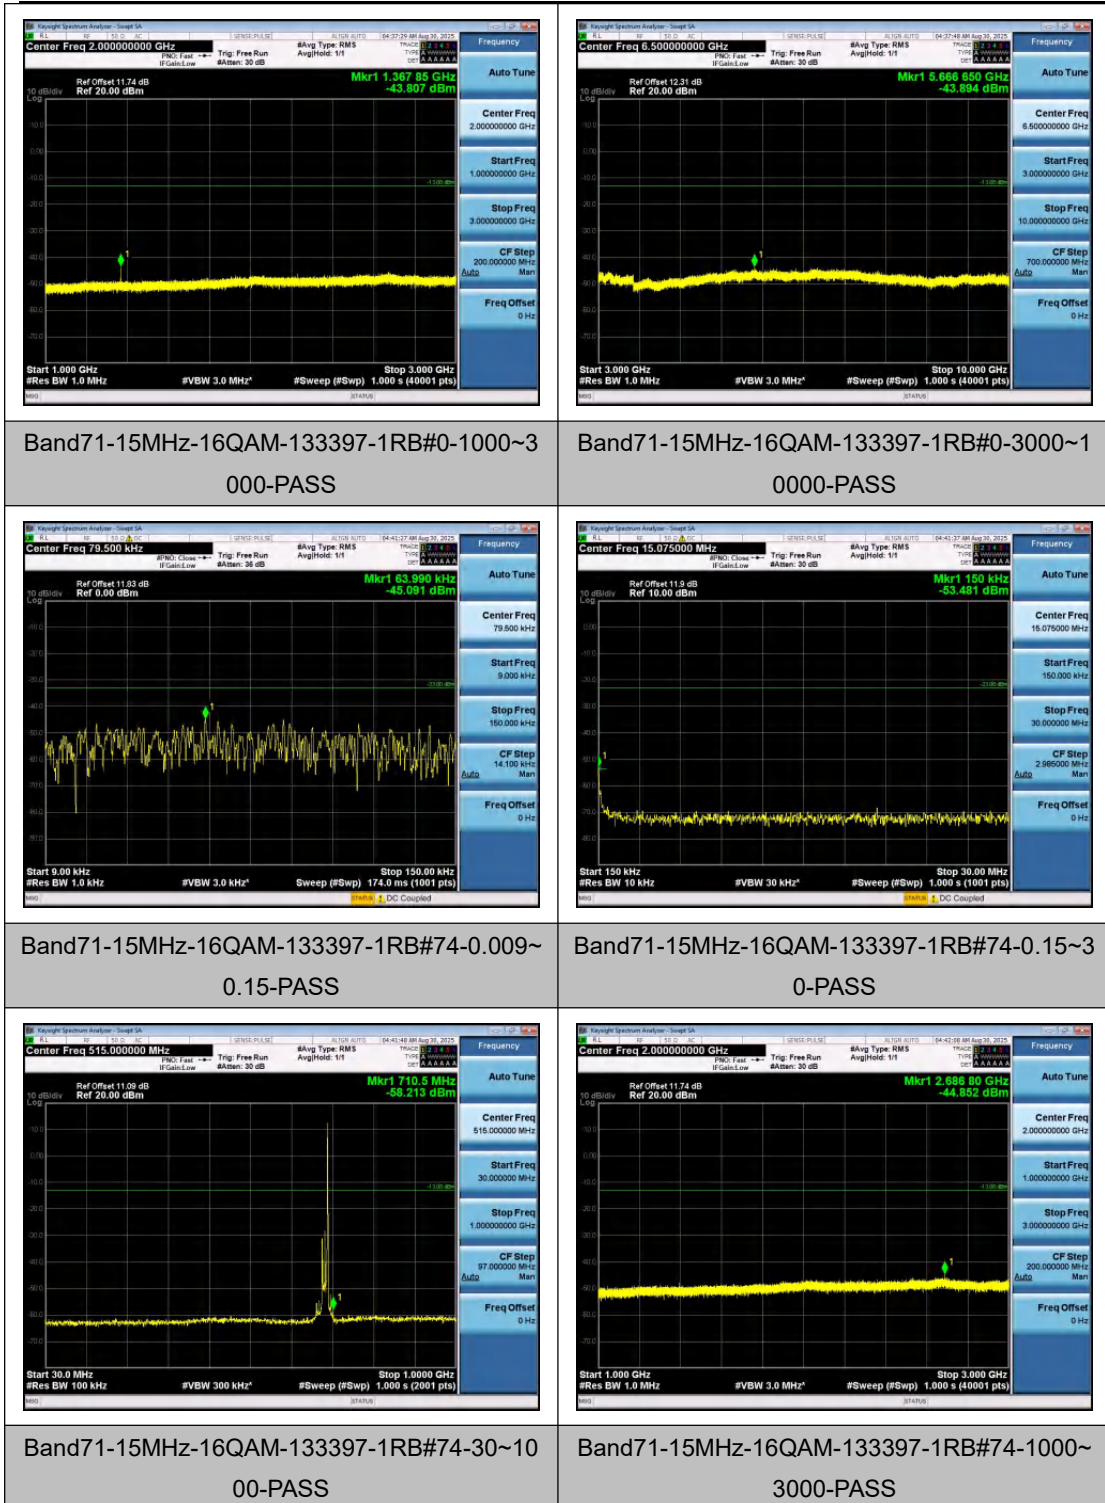

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

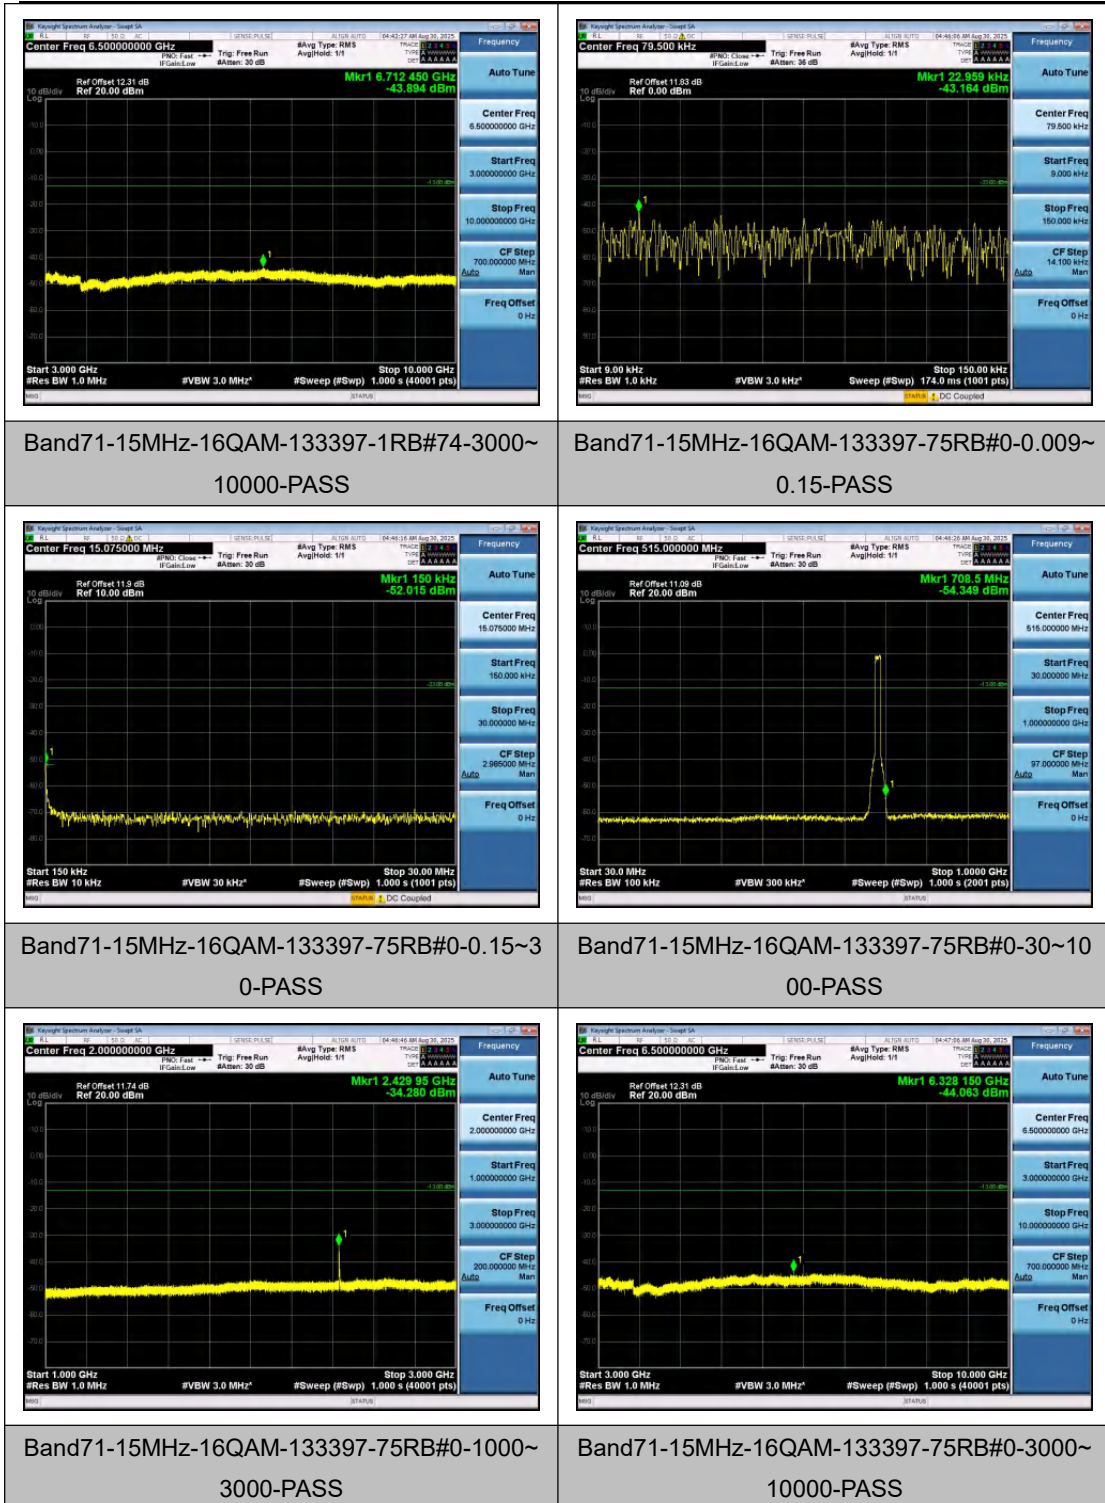



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

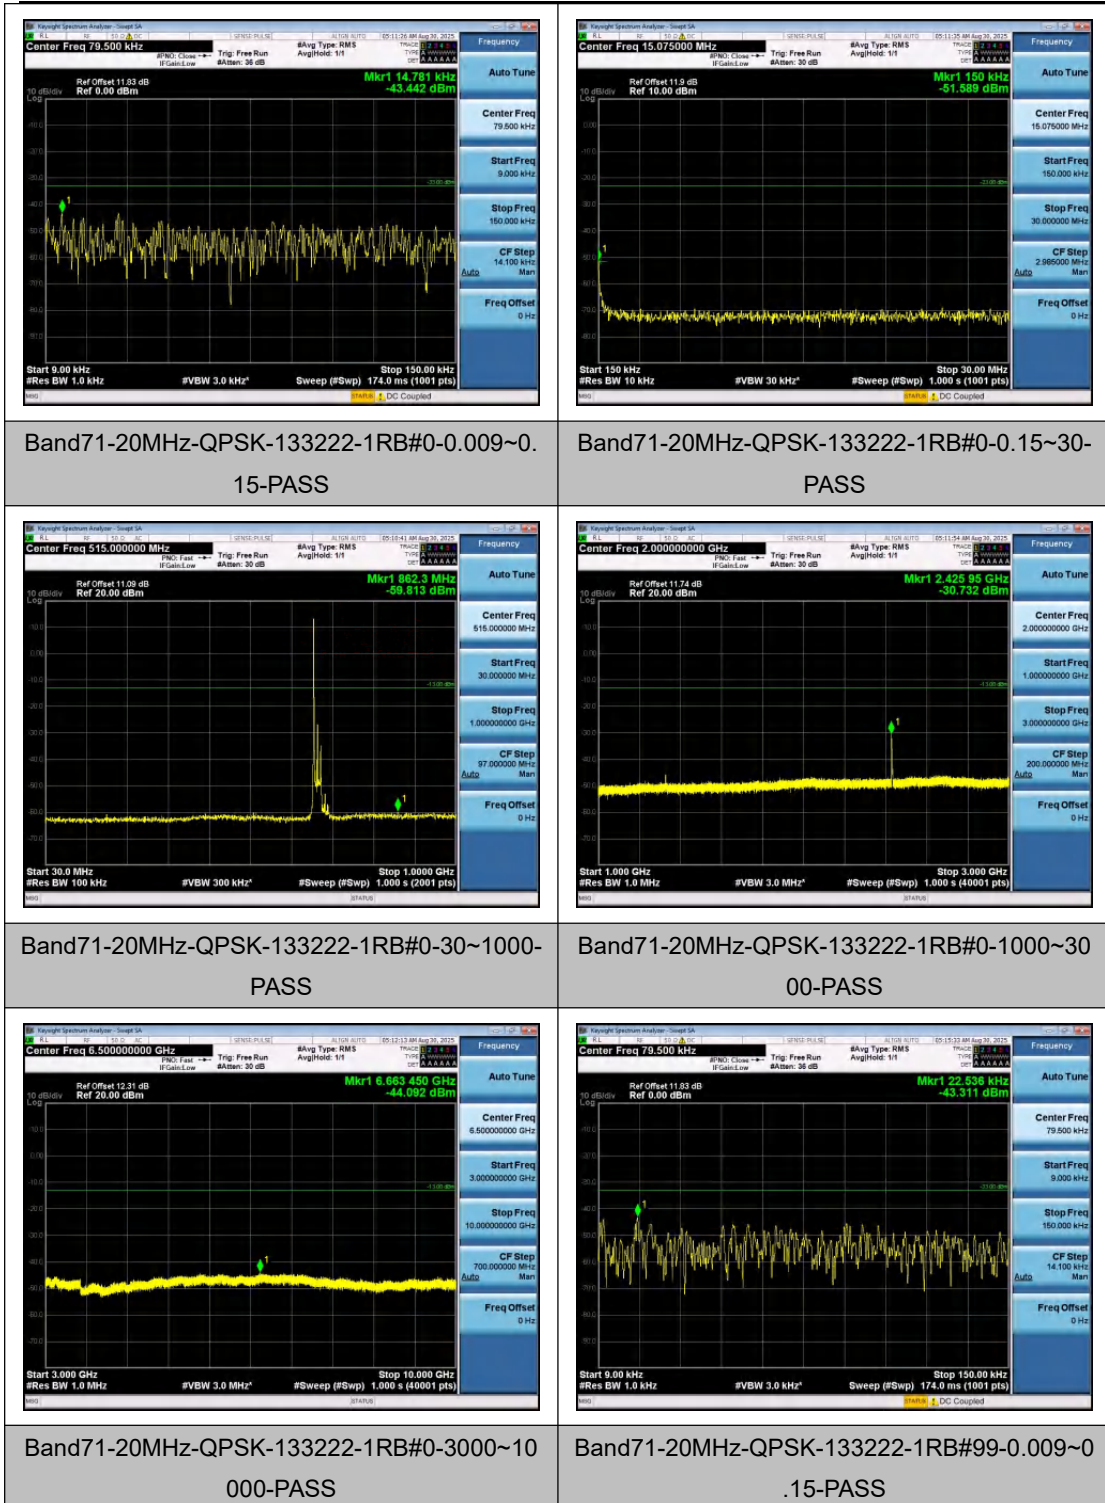

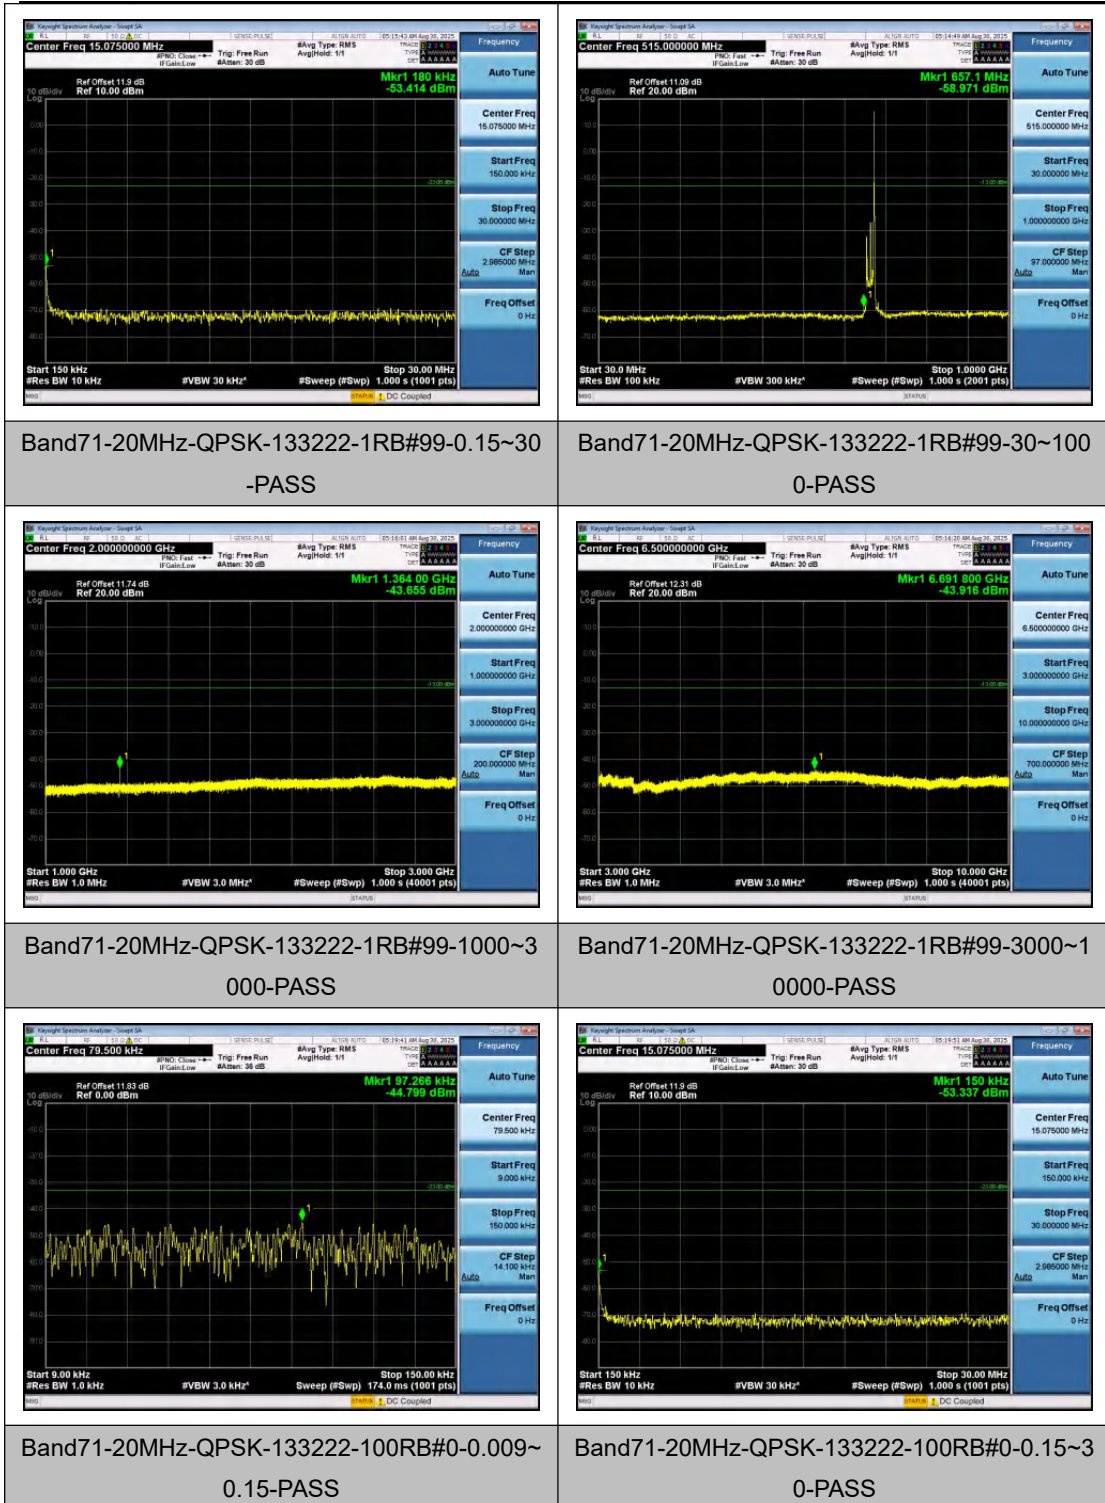





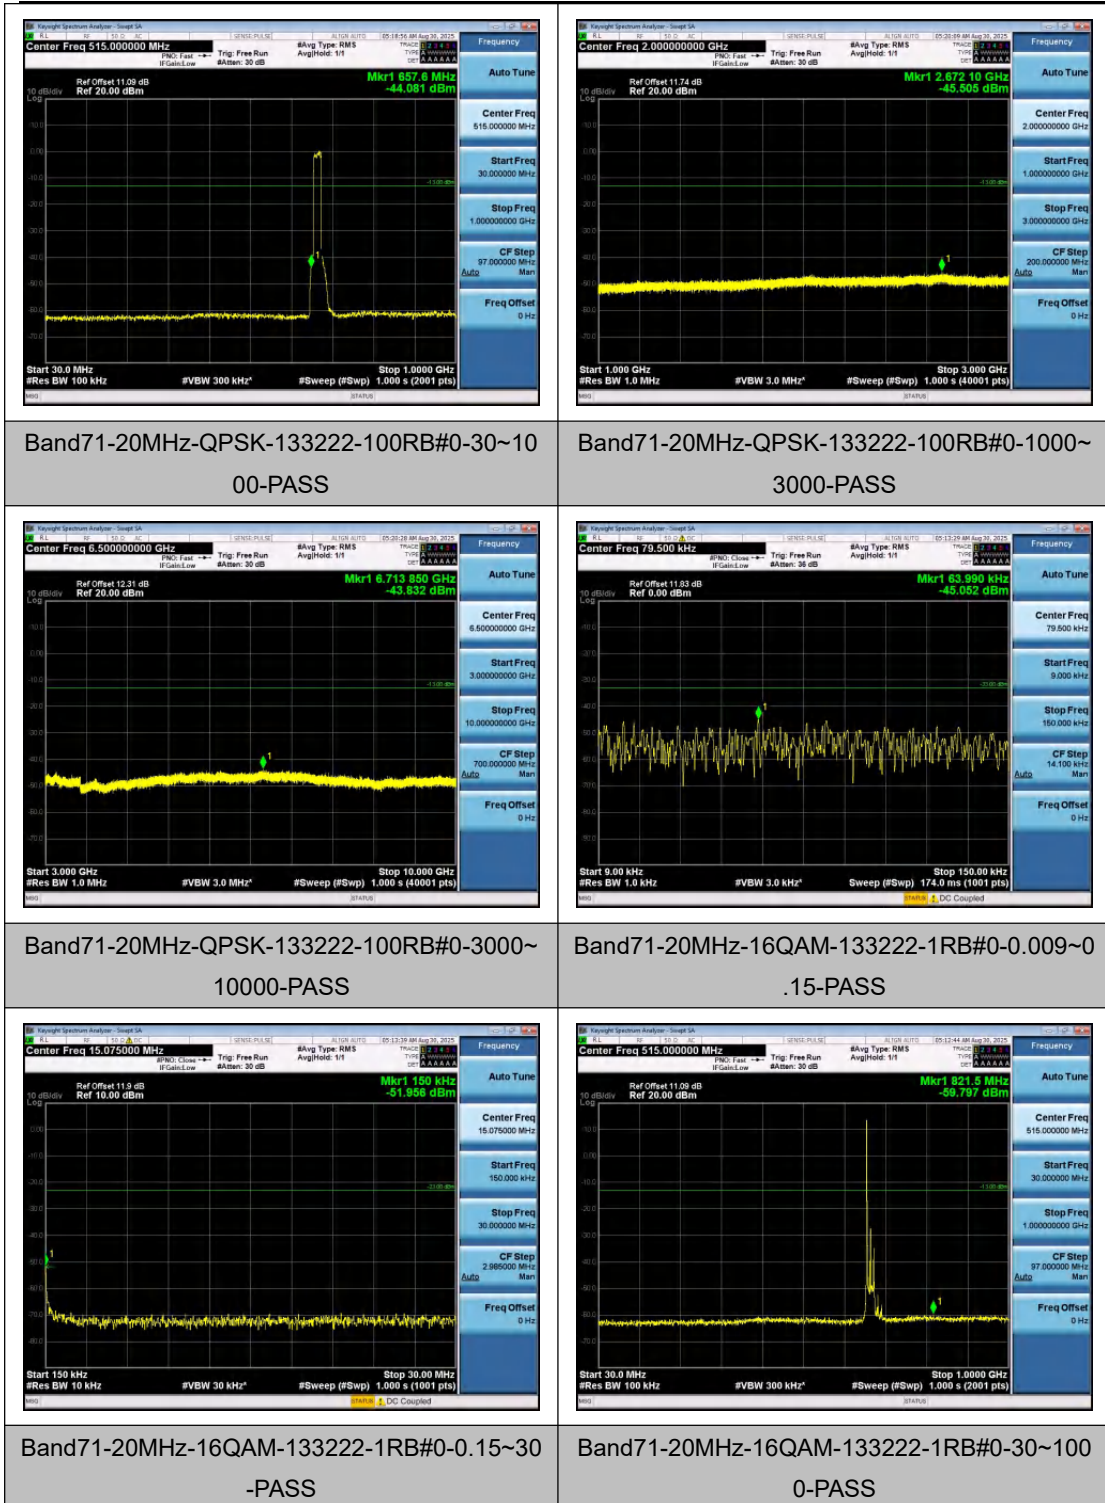


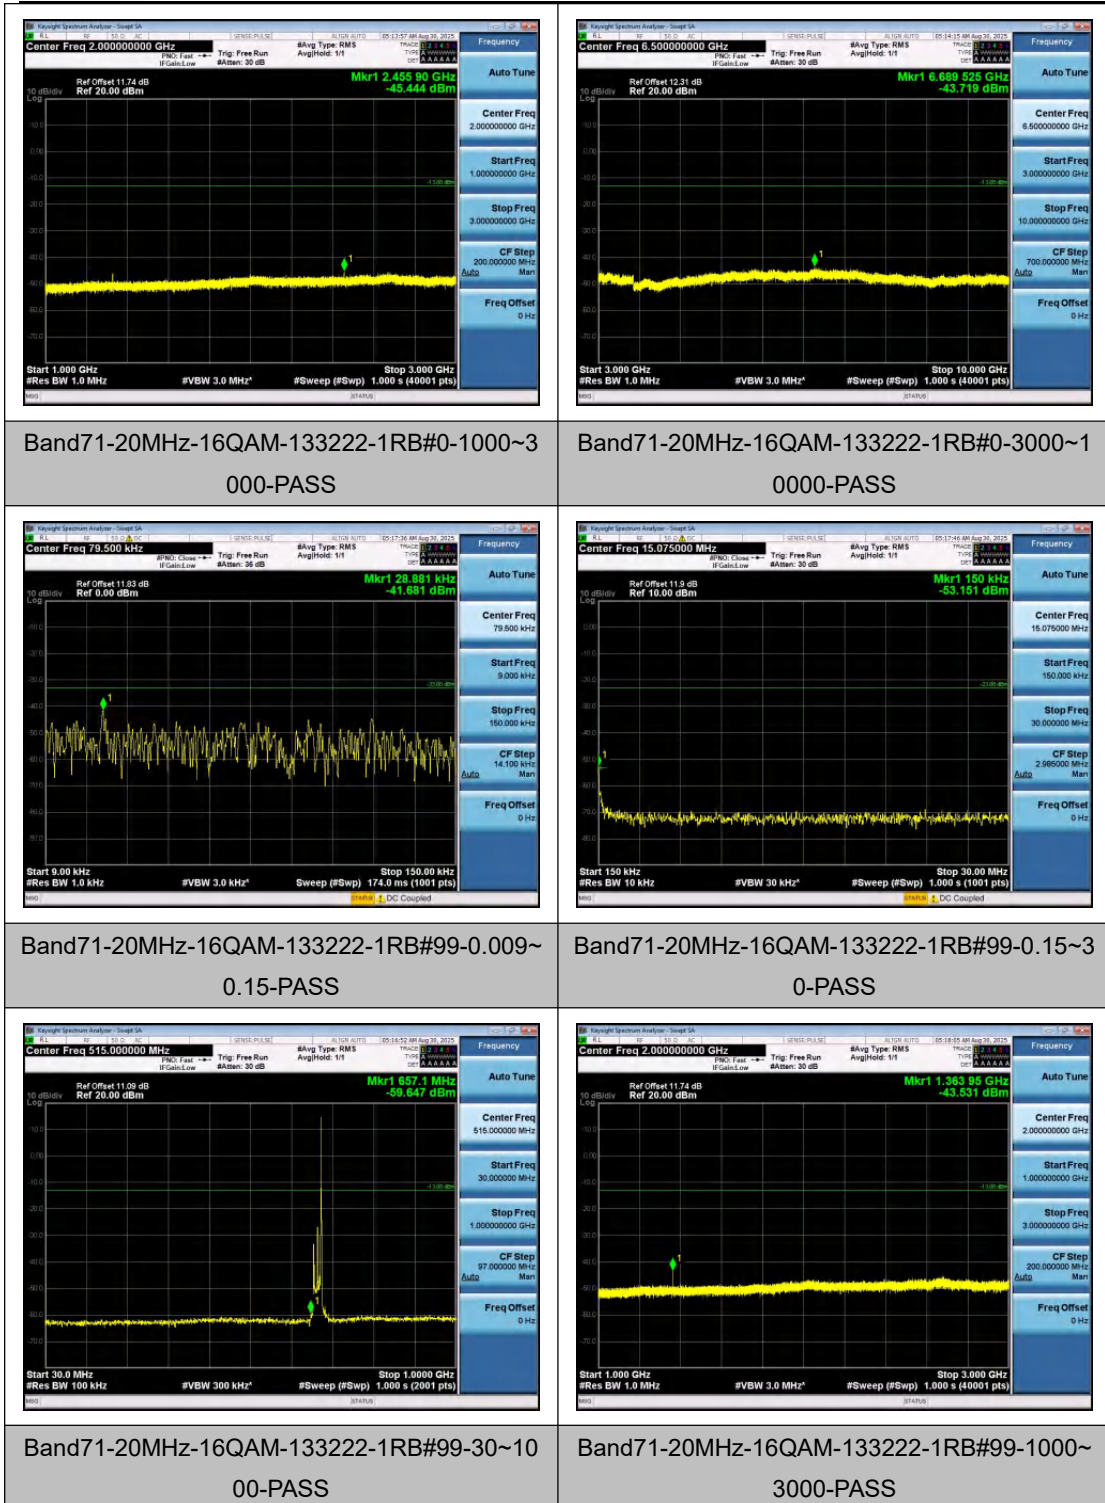



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

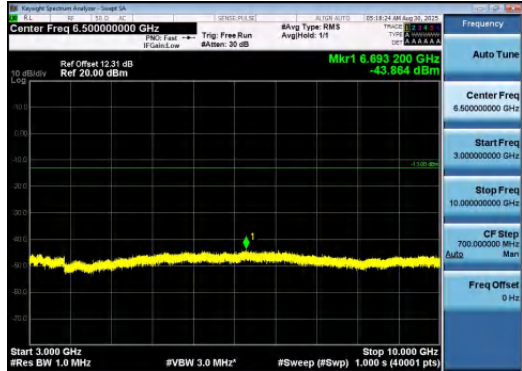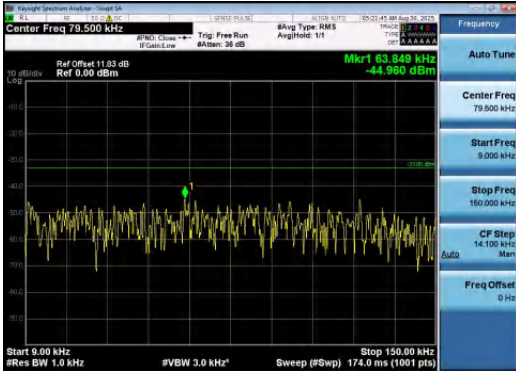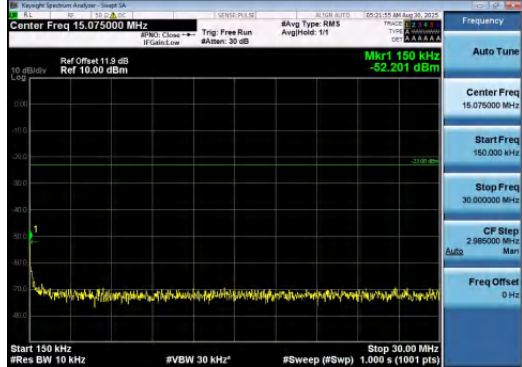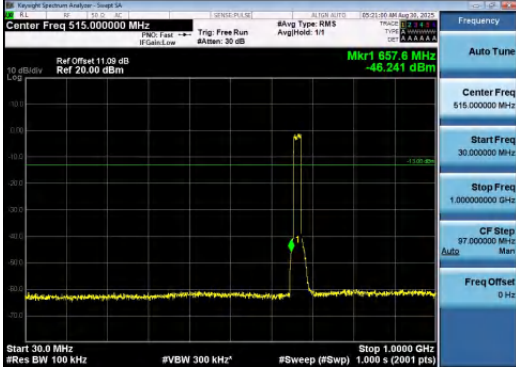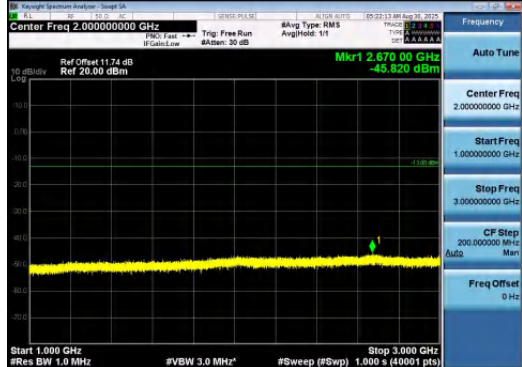	
Band71-20MHz-16QAM-133222-1RB#99-3000~ 10000-PASS	Band71-20MHz-16QAM-133222-100RB#0-0.009 ~0.15-PASS
	
Band71-20MHz-16QAM-133222-100RB#0-0.15~ 30-PASS	Band71-20MHz-16QAM-133222-100RB#0-30~1 000-PASS
	
Band71-20MHz-16QAM-133222-100RB#0-1000 ~3000-PASS	Band71-20MHz-16QAM-133222-100RB#0-3000 ~10000-PASS

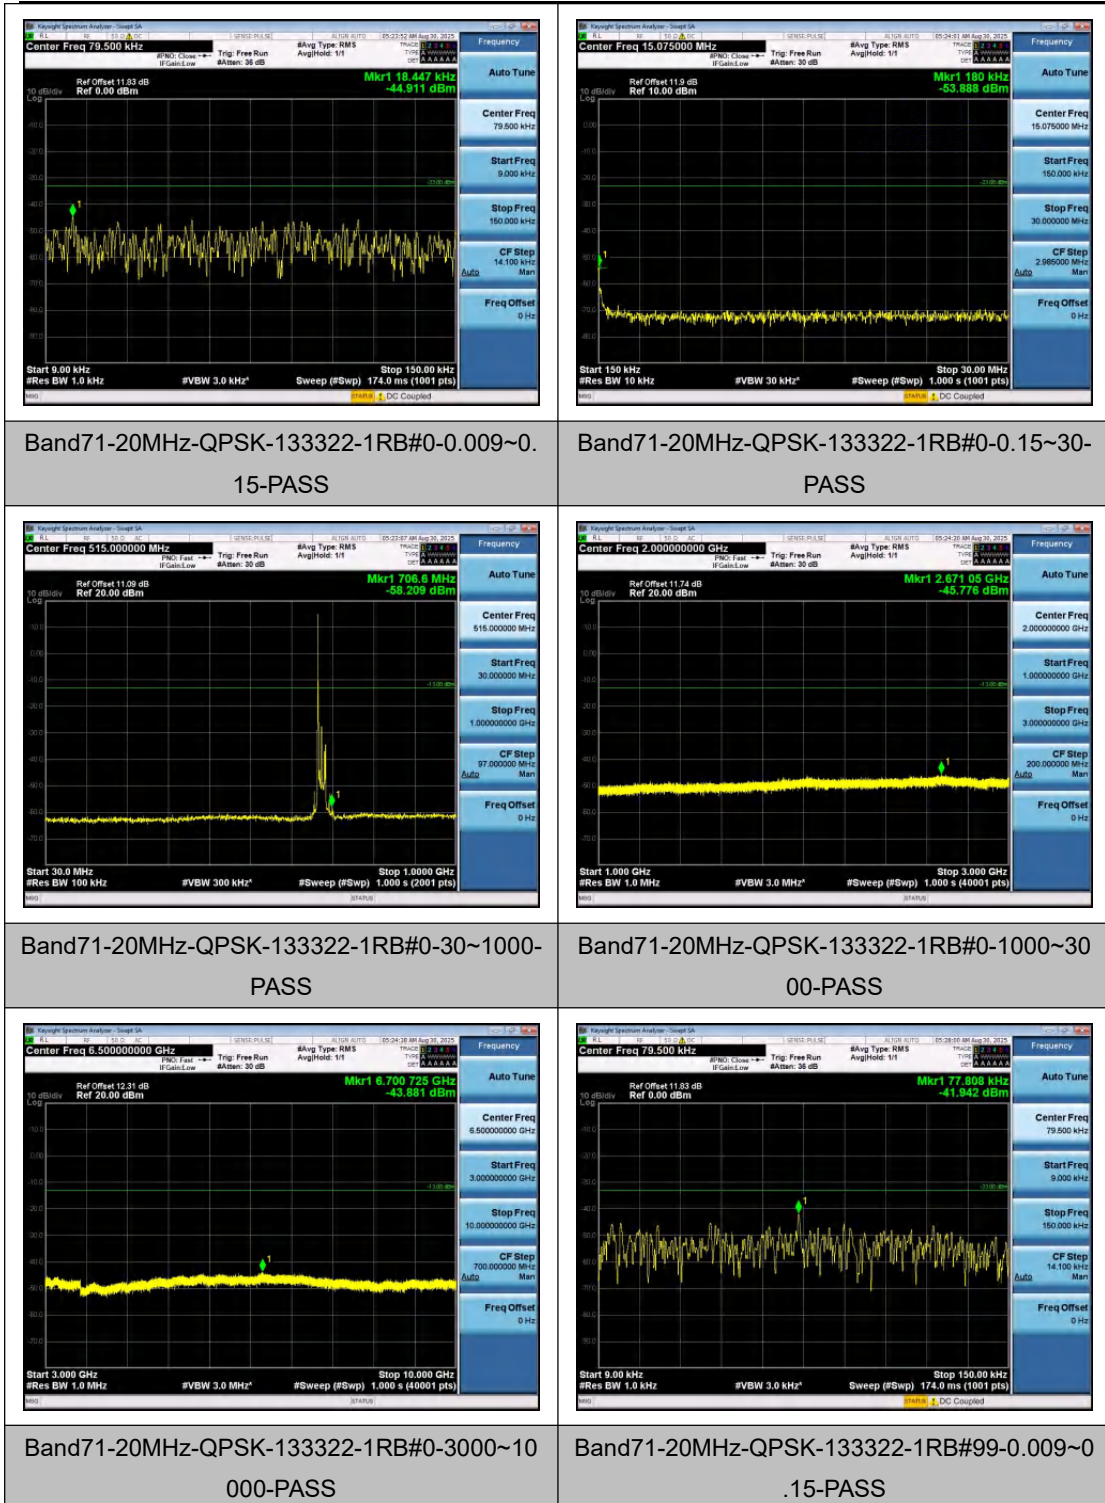


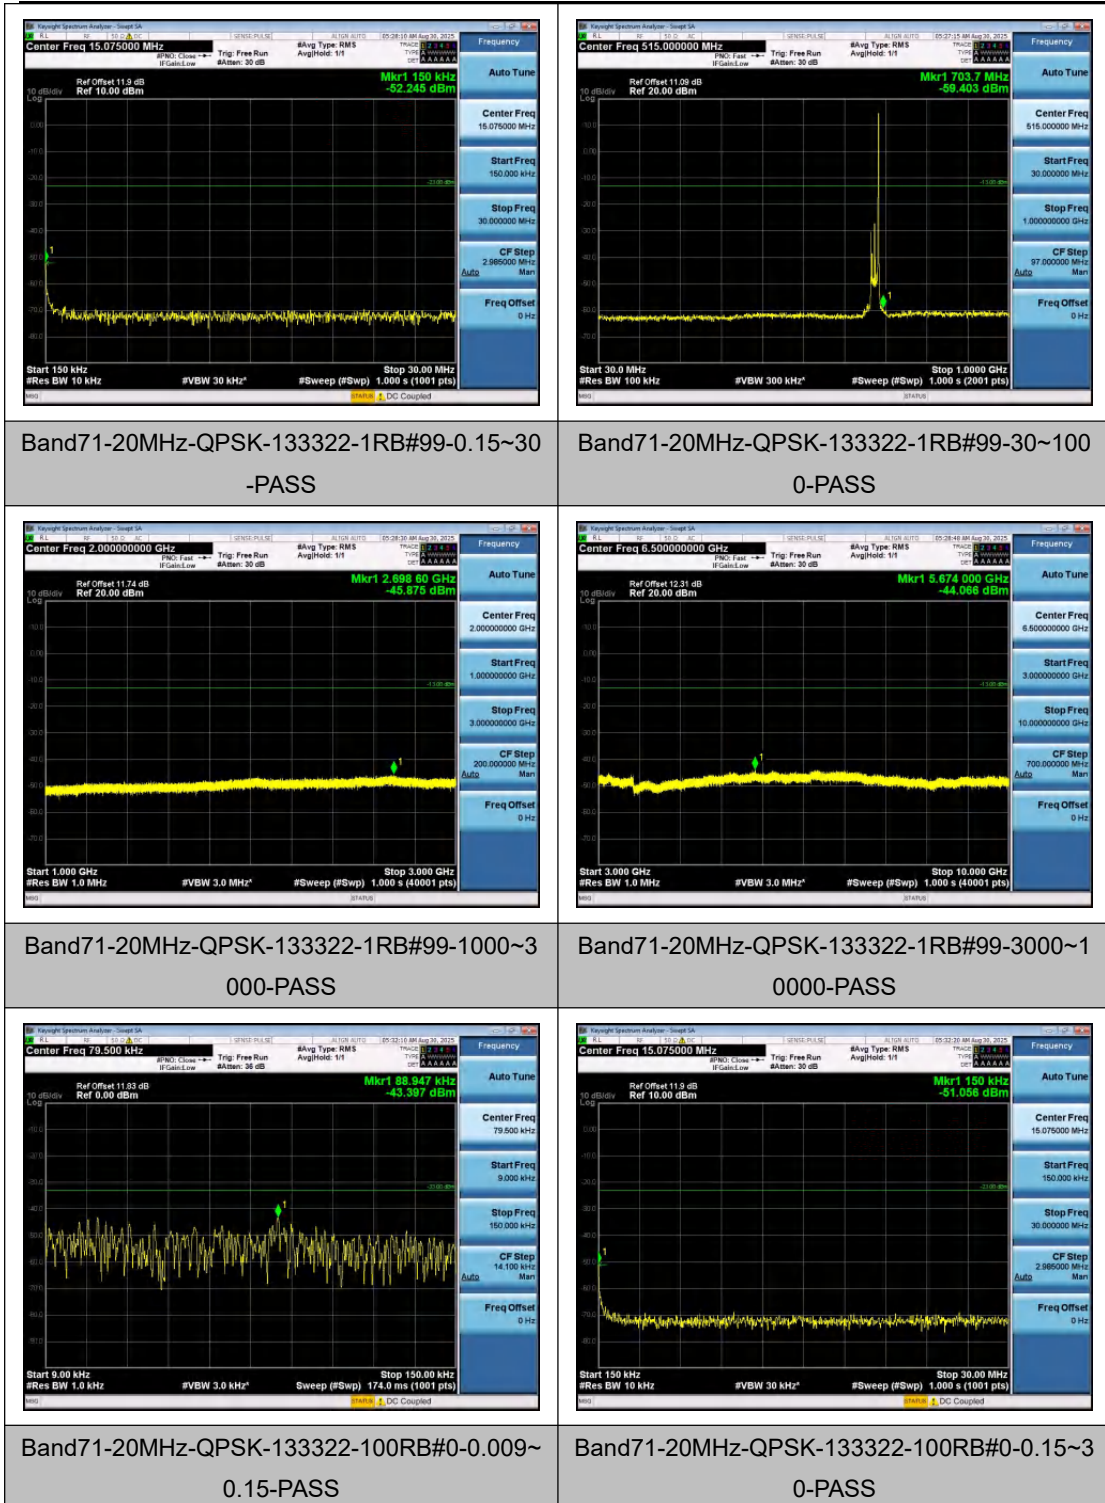



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

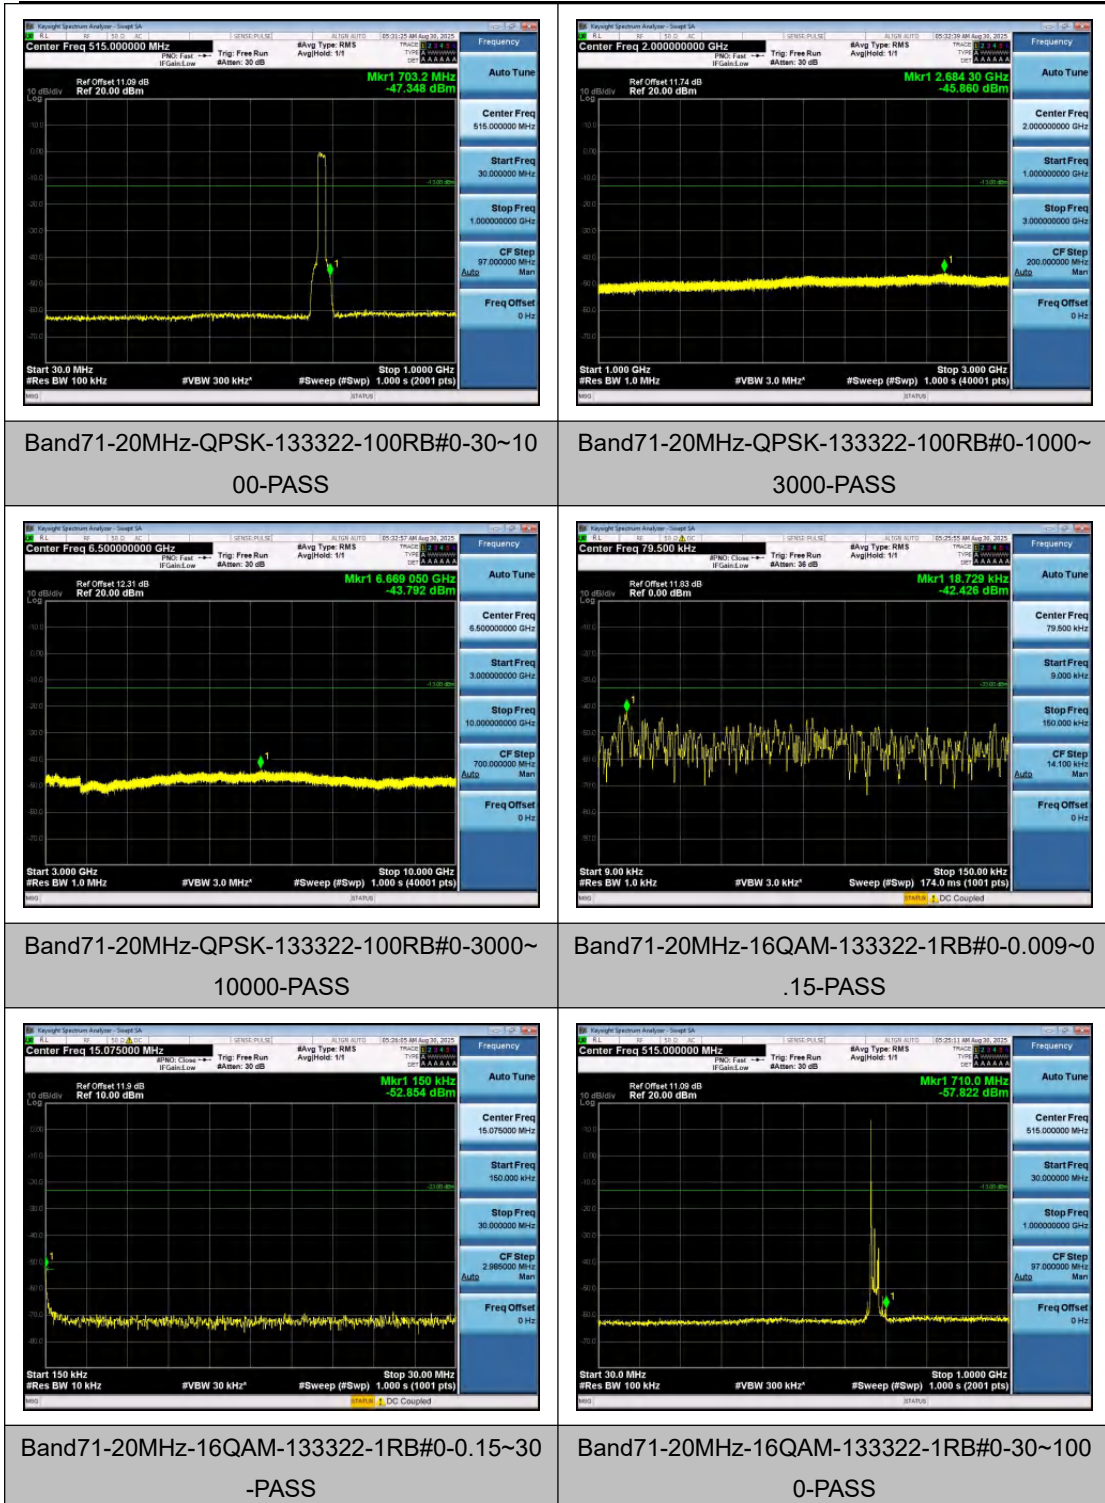

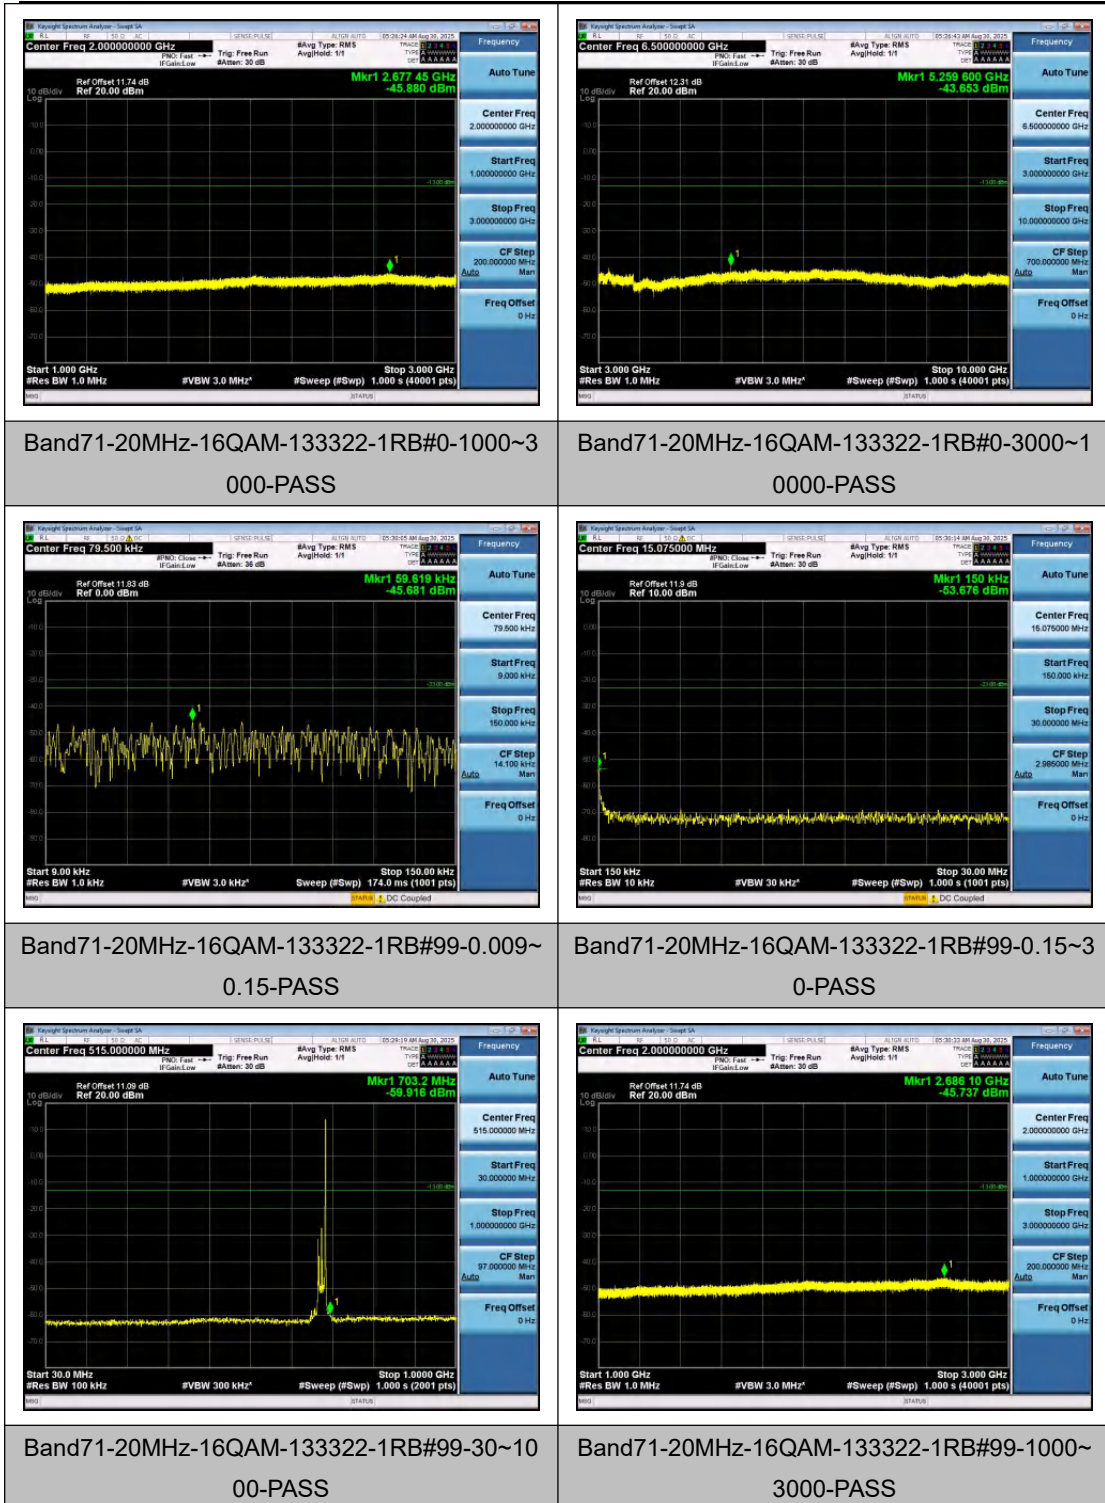


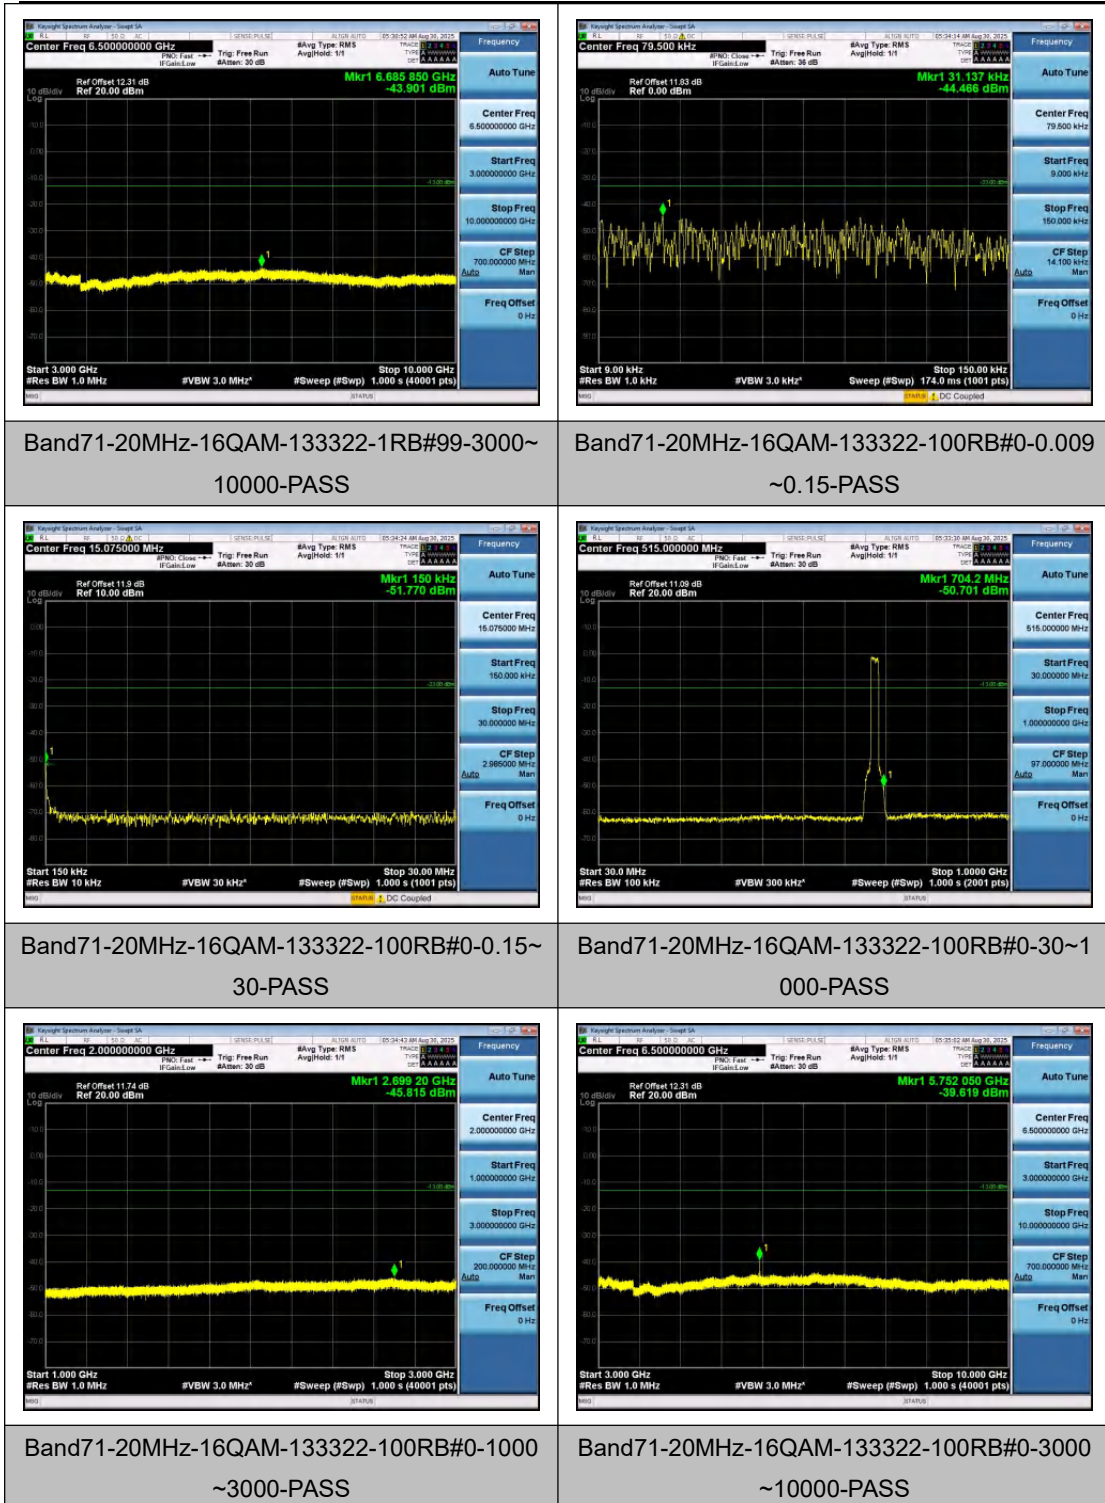



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

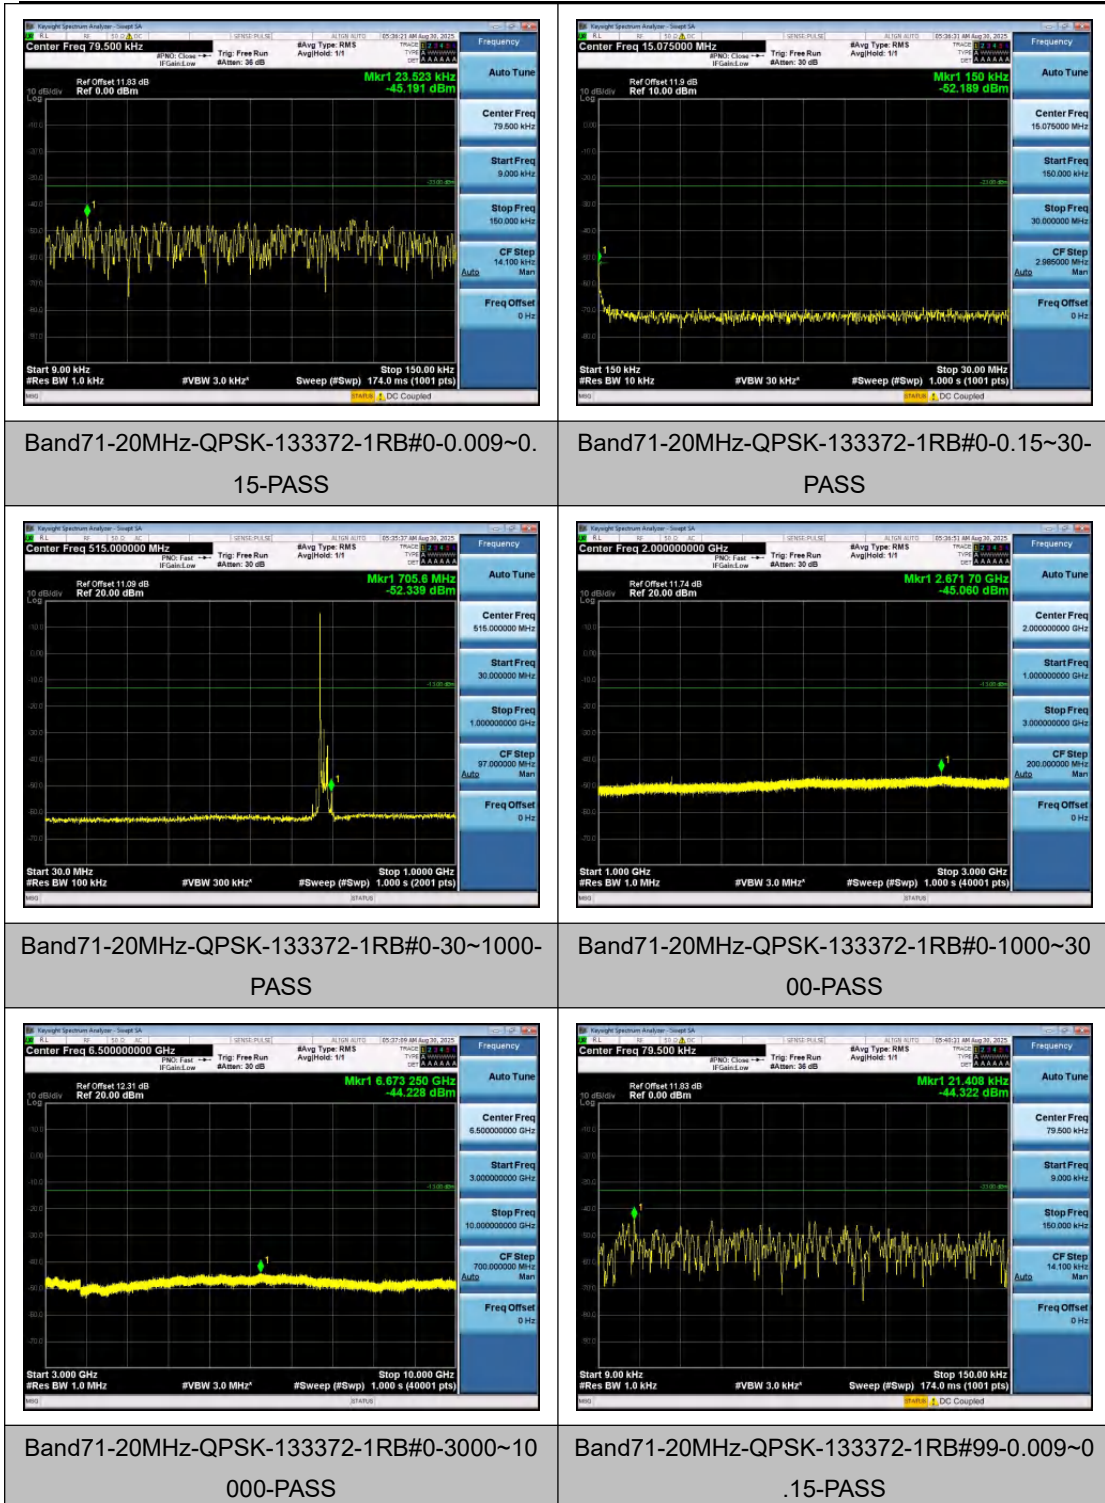

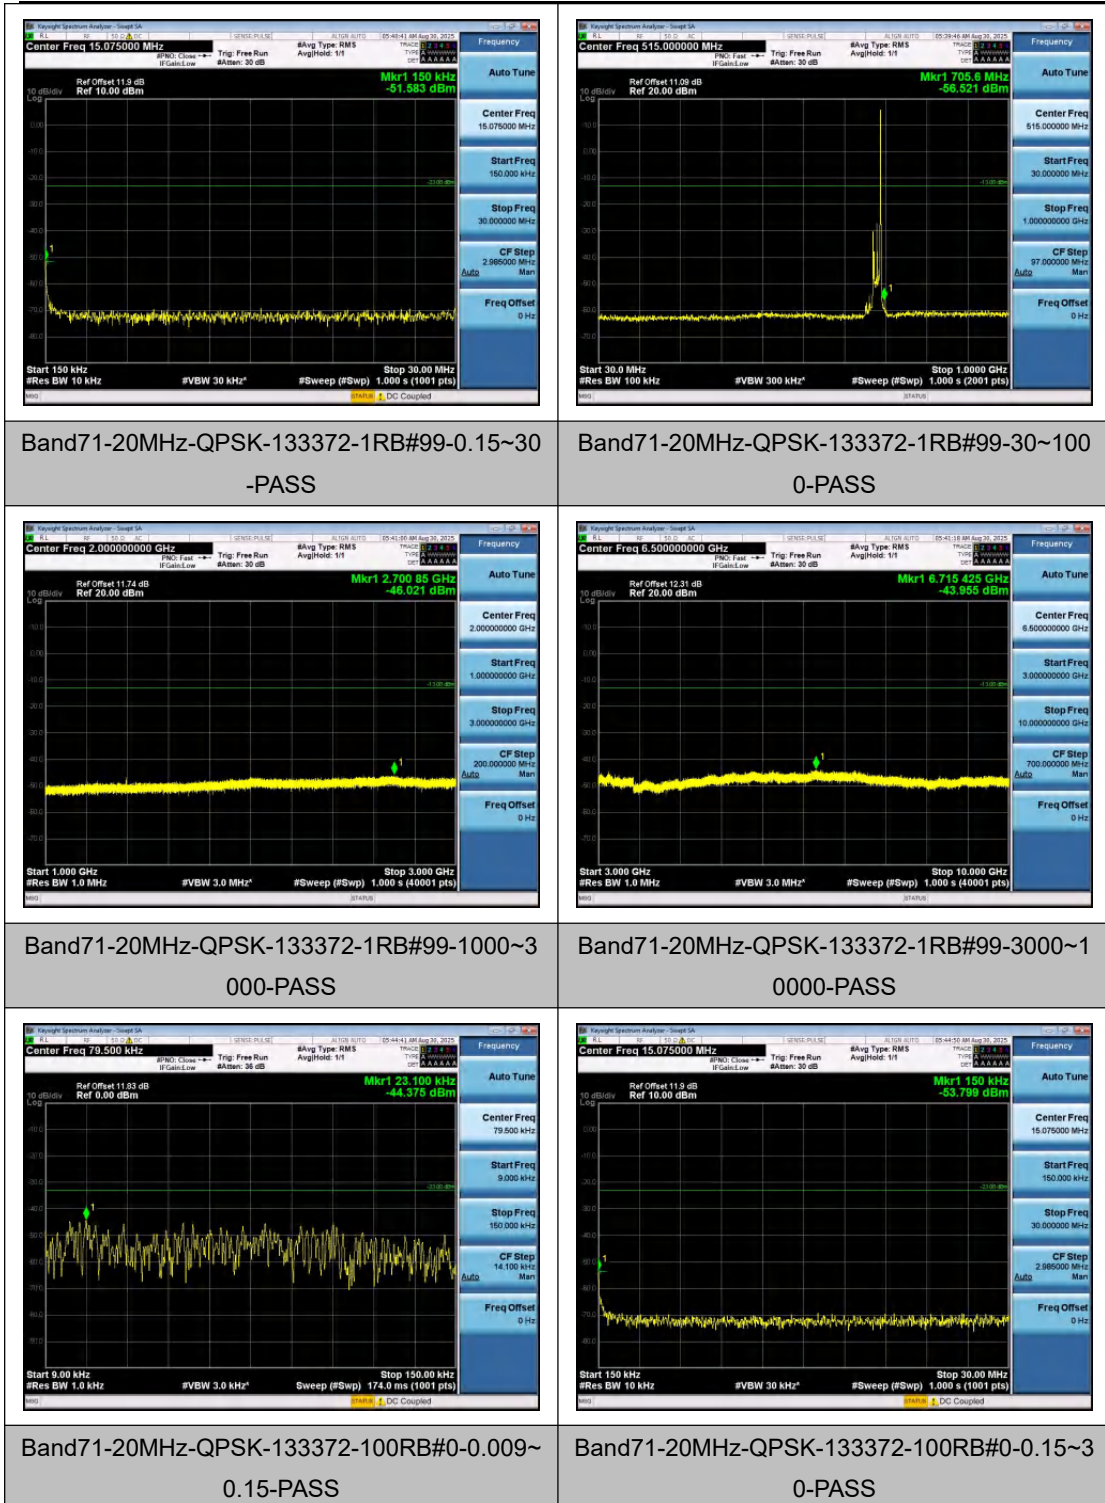

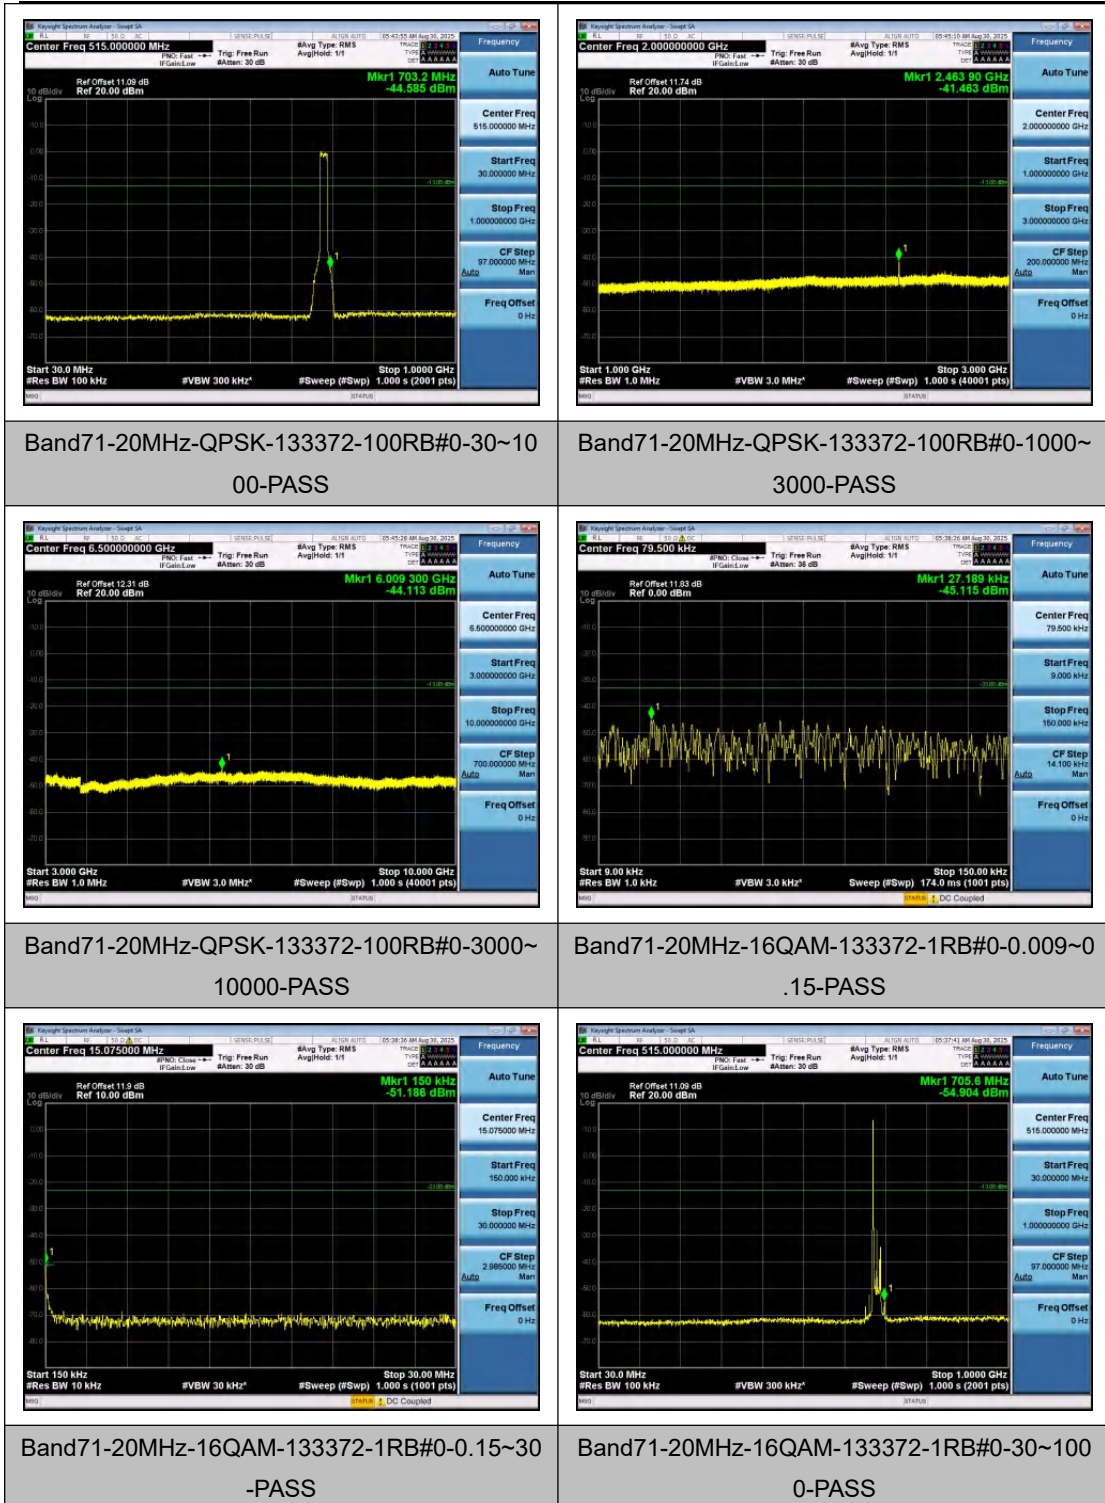

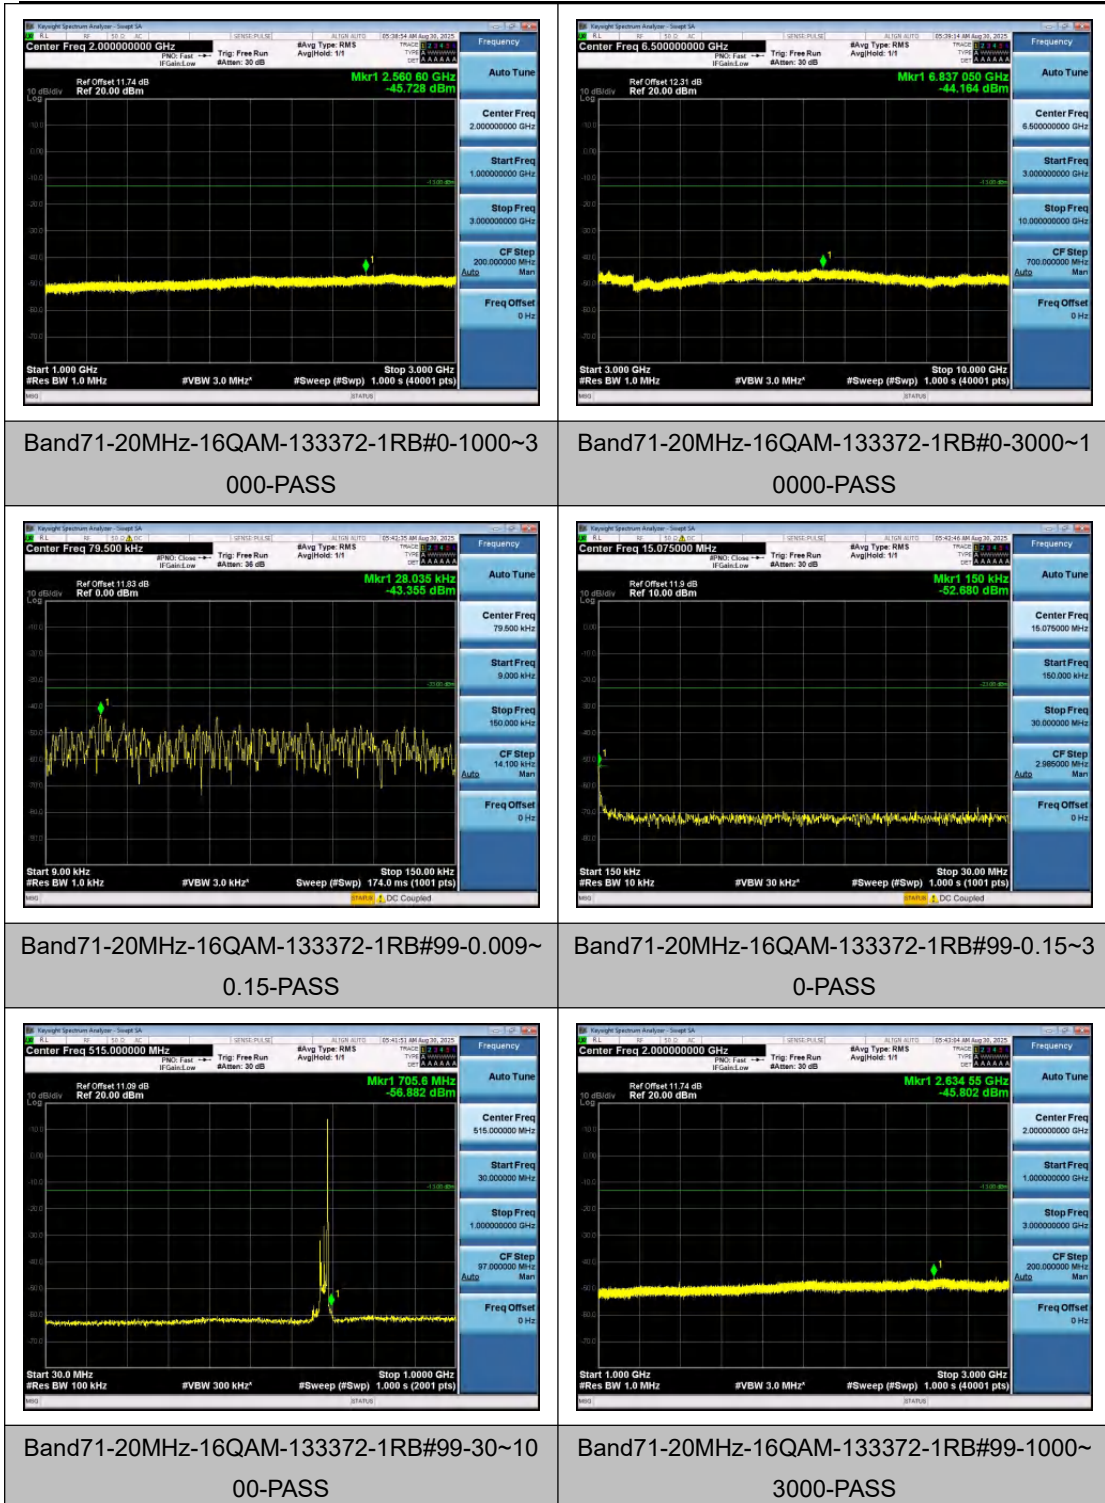

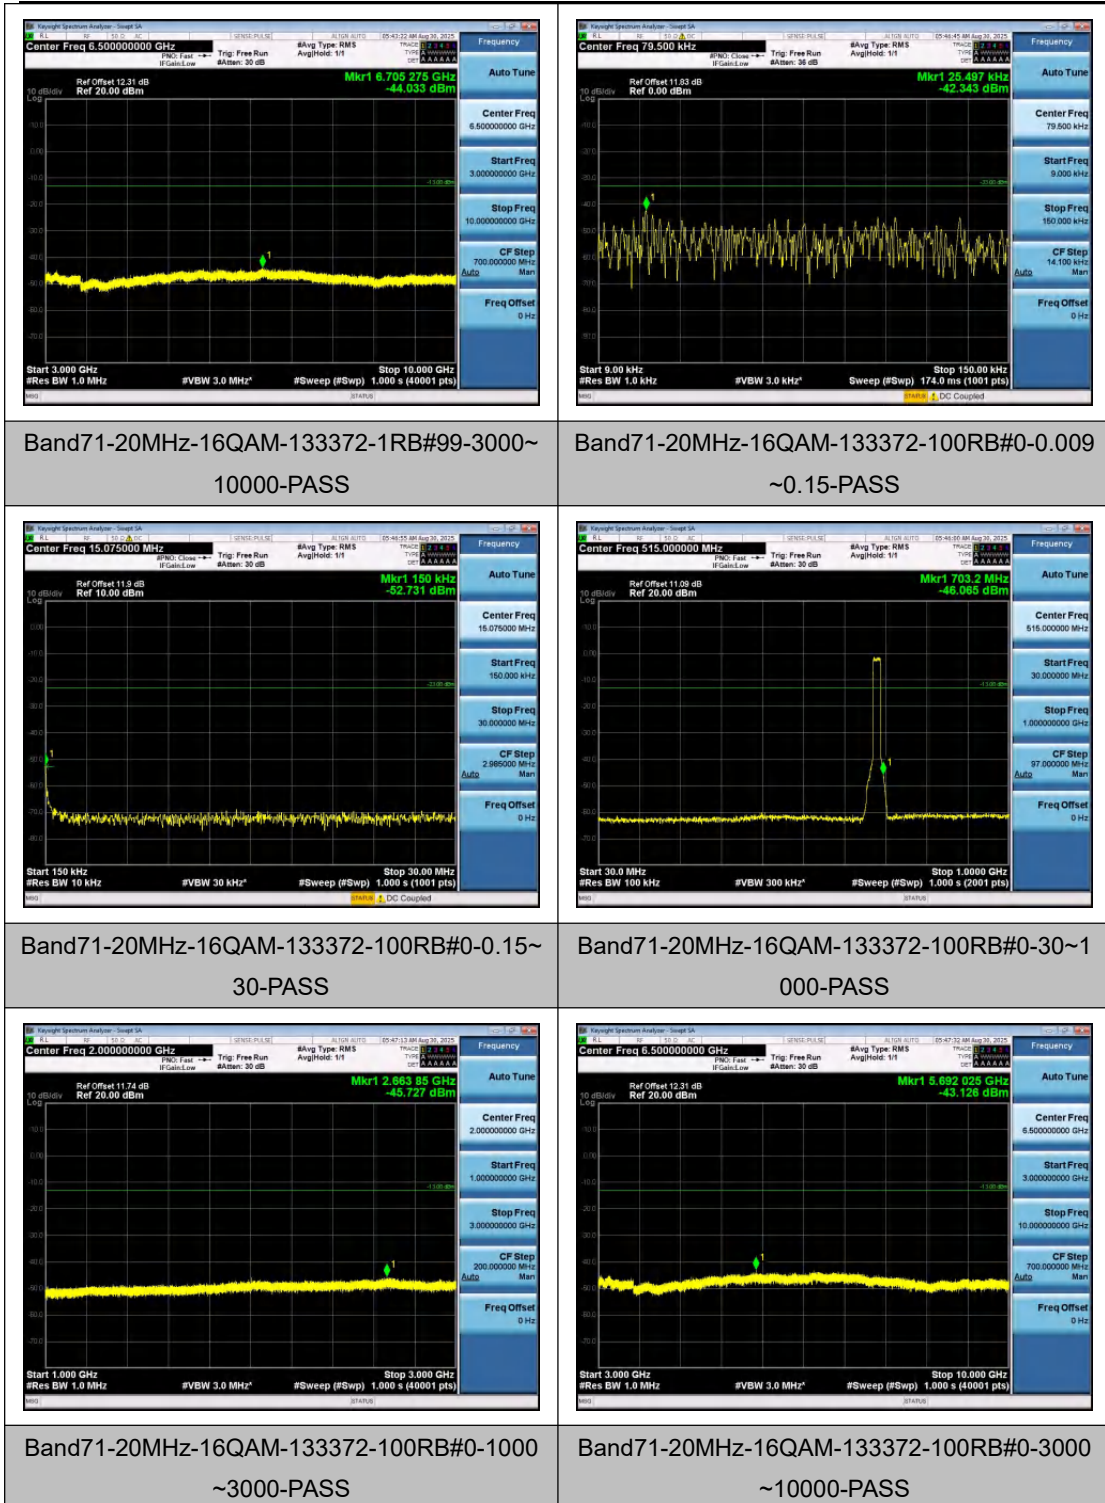

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltag	Tempe				
Band71	5MHz	QPSK	133147	25RB#0	VN	NT	-5410.00	-8.129226	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VL	NT	-5610.00	-8.429752	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VH	NT	-1690.00	-2.539444	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VN	NT	-3770.00	-5.664914	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VL	NT	-2380.00	-3.576258	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VH	NT	-2960.00	-4.447784	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VN	NT	480.00	0.705364	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VL	NT	1510.00	2.218957	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VH	NT	700.00	1.028655	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VN	NT	690.00	1.013960	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VL	NT	-390.00	-0.573108	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VH	NT	180.00	0.264511	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VN	NT	-3170.00	-4.557872	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VL	NT	-5250.00	-7.548526	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VH	NT	-3580.00	-5.147376	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VN	NT	-2550.00	-3.666427	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VL	NT	-3350.00	-4.816679	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VH	NT	200.00	0.287563	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VN	NT	350.00	0.523952	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VL	NT	1630.00	2.440120	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VH	NT	-2580.00	-3.862275	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VN	NT	-920.00	-1.377246	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VL	NT	-900.00	-1.347305	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VH	NT	-820.00	-1.227545	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VN	NT	-13000.00	-19.103600	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VL	NT	-11830.00	-17.384276	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VH	NT	-12700.00	-18.662748	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VN	NT	-10880.00	-15.988244	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VL	NT	-7800.00	-11.462160	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VH	NT	-16080.00	-23.629684	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VN	NT	1710.00	2.467532	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VL	NT	2510.00	3.621934	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VH	NT	-2660.00	-3.838384	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VN	NT	1110.00	1.601732	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	10MHz	16QAM	133422	50RB#0	VL	NT	4140.00	5.974026	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VH	NT	2300.00	3.318903	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VN	NT	15400.00	22.967934	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VL	NT	11670.00	17.404922	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VH	NT	1120.00	1.670395	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VN	NT	3100.00	4.623415	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VL	NT	490.00	0.730798	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VH	NT	4490.00	6.696495	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VN	NT	-11810.00	-17.354886	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VL	NT	-90.00	-0.132256	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VH	NT	-3480.00	-5.113887	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VN	NT	-8770.00	-12.887583	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VL	NT	2050.00	3.012491	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VH	NT	-3350.00	-4.922851	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VN	NT	1040.00	1.506155	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VL	NT	-10080.00	-14.598117	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VH	NT	-2100.00	-3.041274	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VN	NT	8240.00	11.933382	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VL	NT	-1080.00	-1.564084	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VH	NT	-250.00	-0.362056	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VN	NT	10730.00	15.943536	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VL	NT	-8980.00	-13.343239	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VH	NT	-5460.00	-8.112927	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VN	NT	-1430.00	-2.124814	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VL	NT	9920.00	14.739970	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VH	NT	-3180.00	-4.725111	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VN	NT	-20240.00	-29.633968	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VL	NT	-12340.00	-18.067350	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VH	NT	-2480.00	-3.631040	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VN	NT	4470.00	6.544656	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VL	NT	5100.00	7.467057	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VH	NT	6030.00	8.828697	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VN	NT	-6750.00	-9.811047	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VL	NT	-3540.00	-5.145349	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VH	NT	-5880.00	-8.546512	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VN	NT	-7950.00	-11.555233	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VL	NT	-3380.00	-4.912791	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VH	NT	-17550.00	-25.508721	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band71	5MHz	QPSK	133147	25RB#0	NV	-30	-1830.00	-2.749812	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-20	-5330.00	-8.009016	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-10	-5230.00	-7.858753	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	0	-1930.00	-2.900075	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	10	-1860.00	-2.794891	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	20	-2760.00	-4.147258	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	30	-5090.00	-7.648385	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	40	-6130.00	-9.211119	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	50	-5230.00	-7.858753	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-30	-2240.00	-3.365890	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-20	-1870.00	-2.809917	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-10	-3250.00	-4.883546	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	0	-1650.00	-2.479339	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	10	-2610.00	-3.921863	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	20	-1640.00	-2.464313	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	30	-3980.00	-5.980466	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	40	-630.00	-0.946657	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	50	-2770.00	-4.162284	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-30	-3950.00	-5.804555	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-20	-580.00	-0.852314	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-10	-440.00	-0.646583	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	0	-100.00	-0.146951	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	10	-3890.00	-5.716385	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	20	-610.00	-0.896400	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	30	-1290.00	-1.895665	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	40	-3160.00	-4.643644	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	50	40.00	0.058780	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-30	-1740.00	-2.556943	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-20	60.00	0.088170	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-10	-500.00	-0.734754	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	0	-620.00	-0.911095	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	10	-3770.00	-5.540044	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	20	-1130.00	-1.660544	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	30	-2550.00	-3.747245	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	40	-2770.00	-4.070536	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	50	-1520.00	-2.233652	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-30	-2070.00	-2.976276	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-20	-2630.00	-3.781452	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	5MHz	QPSK	133447	25RB#0	NV	-10	-1850.00	-2.659957	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	0	-3180.00	-4.572250	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	10	-1940.00	-2.789360	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	20	-5880.00	-8.454349	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	30	-4170.00	-5.995687	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	40	-3600.00	-5.176132	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	50	-3780.00	-5.434939	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-30	-3800.00	-5.463695	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-20	-680.00	-0.977714	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-10	-2210.00	-3.177570	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	0	-2550.00	-3.666427	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	10	-2280.00	-3.278217	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	20	-2840.00	-4.083393	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	30	-480.00	-0.690151	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	40	-4910.00	-7.059669	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	50	-3170.00	-4.557872	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-30	380.00	0.568862	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-20	2570.00	3.847305	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-10	5220.00	7.814371	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	0	3770.00	5.643713	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	10	3740.00	5.598802	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	20	920.00	1.377246	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	30	2100.00	3.143713	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	40	1360.00	2.035928	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	50	1820.00	2.724551	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-30	-3240.00	-4.850299	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-20	1710.00	2.559880	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-10	2580.00	3.862275	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	0	3110.00	4.655689	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	10	2510.00	3.757485	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	20	2720.00	4.071856	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	30	-3740.00	-5.598802	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	40	4250.00	6.362275	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	50	1520.00	2.275449	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-30	-11430.00	-16.796473	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-20	-13450.00	-19.764879	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-10	-15330.00	-22.527553	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	0	-9130.00	-13.416605	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	10	-14510.00	-21.322557	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	20	-12420.00	-18.251286	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	30	-10120.00	-14.871418	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	10MHz	QPSK	133297	50RB#0	NV	40	-13020.00	-19.132990	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	50	-12120.00	-17.810434	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-30	-10330.00	-15.180015	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-20	-10590.00	-15.562087	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-10	-11340.00	-16.664217	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	0	-10060.00	-14.783248	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	10	-14950.00	-21.969140	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	20	-5590.00	-8.214548	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	30	-12250.00	-18.001470	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	40	-13410.00	-19.706098	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	50	-14100.00	-20.720059	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-30	-1750.00	-2.525253	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-20	820.00	1.183261	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-10	-5400.00	-7.792208	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	0	-370.00	-0.533911	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	10	3860.00	5.569986	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	20	-2090.00	-3.015873	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	30	1670.00	2.409812	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	40	2060.00	2.972583	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	50	-1150.00	-1.659452	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-30	180.00	0.259740	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-20	-1390.00	-2.005772	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-10	3530.00	5.093795	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	0	-1480.00	-2.135642	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	10	1570.00	2.265512	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	20	2450.00	3.535354	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	30	-760.00	-1.096681	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	40	-560.00	-0.808081	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	50	1500.00	2.164502	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-30	4450.00	6.636838	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-20	8810.00	13.139448	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-10	9430.00	14.064131	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	0	820.00	1.222968	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	10	5340.00	7.964206	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	20	7270.00	10.842655	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	30	7640.00	11.394482	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	40	11320.00	16.882923	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	50	-280.00	-0.417599	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-30	6250.00	9.321402	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-20	3610.00	5.384042	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-10	-1860.00	-2.774049	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	15MHz	16QAM	133197	75RB#0	NV	0	4870.00	7.263236	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	10	9960.00	14.854586	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	20	-800.00	-1.193139	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	30	12580.00	18.762118	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	40	80.00	0.119314	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	50	-2360.00	-3.519761	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-30	-1930.00	-2.836150	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-20	-8360.00	-12.285084	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-10	-7610.00	-11.182954	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	0	-12600.00	-18.515797	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	10	-6420.00	-9.434240	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	20	-7570.00	-11.124173	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	30	-6970.00	-10.242469	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	40	-4250.00	-6.245408	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	50	-14140.00	-20.778839	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-30	-14100.00	-20.720059	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-20	-1440.00	-2.116091	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-10	-4610.00	-6.774431	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	0	-3160.00	-4.643644	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	10	-6740.00	-9.904482	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	20	-7230.00	-10.624541	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	30	-4680.00	-6.877296	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	40	-1940.00	-2.850845	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	50	1480.00	2.174871	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-30	-4100.00	-5.937726	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-20	1900.00	2.751629	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-10	-6200.00	-8.979001	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	0	800.00	1.158581	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	10	-850.00	-1.230992	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	20	-4080.00	-5.908762	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	30	-6430.00	-9.312093	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	40	-6610.00	-9.572773	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	50	-3050.00	-4.417089	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-30	-1360.00	-1.969587	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-20	-6510.00	-9.427951	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-10	-320.00	-0.463432	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	0	-2820.00	-4.083997	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	10	-530.00	-0.767560	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	20	1150.00	1.665460	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	30	-3780.00	-5.474294	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	40	2890.00	4.185373	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	15MHz	16QAM	133397	75RB#0	NV	50	10880.00	15.756698	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-30	-520.00	-0.772660	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-20	-8270.00	-12.288262	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-10	8370.00	12.436850	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	0	-1160.00	-1.723626	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	10	-11980.00	-17.800892	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	20	-5340.00	-7.934621	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	30	5940.00	8.826152	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	40	-9600.00	-14.264487	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	50	2550.00	3.789004	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-30	8680.00	12.897474	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-20	14480.00	21.515602	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-10	-4480.00	-6.656761	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	0	18030.00	26.790490	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	10	-13280.00	-19.732541	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	20	21750.00	32.317979	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	30	3760.00	5.586924	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	40	22060.00	32.778603	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	50	11260.00	16.731055	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-30	-7740.00	-11.332357	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-20	-13360.00	-19.560761	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-10	-9320.00	-13.645681	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	0	-14100.00	-20.644217	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	10	-20870.00	-30.556369	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	20	-12500.00	-18.301611	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	30	-16200.00	-23.718887	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	40	-19540.00	-28.609078	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	50	-17510.00	-25.636896	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-30	4910.00	7.188873	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-20	9950.00	14.568082	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-10	-4190.00	-6.134700	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	0	6640.00	9.721816	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	10	-6320.00	-9.253294	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	20	6110.00	8.945827	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	30	-740.00	-1.083455	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	40	-4030.00	-5.900439	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	50	1440.00	2.108346	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-30	-2940.00	-4.273256	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-20	4890.00	7.107558	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-10	2820.00	4.098837	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	0	-3380.00	-4.912791	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band71	20MHz	QPSK	133372	100RB#0	NV	10	-3820.00	-5.552326	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	20	-980.00	-1.424419	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	30	-8670.00	-12.601744	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	40	-1000.00	-1.453488	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	50	-5010.00	-7.281977	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-30	-14940.00	-21.715116	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-20	-15550.00	-22.601744	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-10	-5770.00	-8.386628	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	0	-10250.00	-14.898256	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	10	6850.00	9.956395	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	20	-14950.00	-21.729651	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	30	-10100.00	-14.680233	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	40	-4560.00	-6.627907	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	50	-19910.00	-28.938953	±2.5	PASS

---END---