# Appendix Test Data

| | | | |
|---|---|---|---|
| Report No: | 1812C60448212503-01 | Test Sample NO: | 1-2-2 |
| Start Test Date: | 2026-09-02 | Finish Test Date: | 2026-09-29 |
| Test Engineer: | Alex Feng | Auditor: | Justin Feng |
| Temperature: | 23.5℃ | Relative Humidity: | 61% |
| Pressure: | 100.5kPa | | |

## Appendix A: Conducted Output Power

### Test Result

| Band | Bandwidth | Modulation | Channel | RB Configuration | Power(dBm) | Verdict |
|---|---|---|---|---|---|---|
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#0 | 13.52 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#2 | 13.10 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#5 | 12.96 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 3RB#0 | 12.84 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 3RB#1 | 12.64 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 3RB#3 | 12.54 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 6RB#0 | 12.47 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#0 | 13.32 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#2 | 13.08 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#5 | 12.82 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 3RB#0 | 12.60 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 3RB#1 | 12.55 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 3RB#3 | 12.33 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 6RB#0 | 12.44 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 1RB#0 | 13.60 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 1RB#2 | 12.96 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 1RB#5 | 12.73 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 3RB#0 | 12.76 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 3RB#1 | 12.61 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 3RB#3 | 12.44 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 6RB#0 | 12.54 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 13.18 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#2 | 12.92 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 12.59 | PASS |


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | |
|---|---|---|---|---|---|---|
| Band2 | 1.4MHz | 16QAM | 18900 | 3RB#0 | 12.53 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 3RB#1 | 12.56 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 3RB#3 | 12.30 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 12.56 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#0 | 13.10 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#2 | 13.07 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#5 | 13.27 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 3RB#0 | 13.76 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 3RB#1 | 13.64 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 3RB#3 | 15.54 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 6RB#0 | 15.18 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 12.84 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#2 | 13.18 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5 | 14.06 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 3RB#0 | 13.51 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 3RB#1 | 15.75 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 3RB#3 | 15.18 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0 | 15.07 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#0 | 14.66 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#8 | 14.04 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#14 | 13.77 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 8RB#0 | 13.48 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 8RB#4 | 13.25 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 8RB#7 | 13.14 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 15RB#0 | 12.98 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#0 | 14.25 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#8 | 13.80 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#14 | 13.48 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 8RB#0 | 13.35 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 8RB#4 | 13.10 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 8RB#7 | 13.07 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 15RB#0 | 12.88 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 1RB#0 | 13.92 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 1RB#8 | 13.25 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 1RB#14 | 12.95 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 8RB#0 | 13.30 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 8RB#4 | 13.09 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 8RB#7 | 13.00 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 15RB#0 | 13.16 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0 | 13.70 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#8 | 13.20 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | |
|---|---|---|---|---|---|---|
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 12.91 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 8RB#0 | 13.30 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 8RB#4 | 13.14 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 8RB#7 | 13.04 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 13.20 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 1RB#0 | 13.90 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 1RB#8 | 14.69 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 1RB#14 | 14.43 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 8RB#0 | 14.14 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 8RB#4 | 13.99 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 8RB#7 | 13.93 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 15RB#0 | 13.83 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0 | 13.65 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#8 | 14.37 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 14.35 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 8RB#0 | 14.12 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 8RB#4 | 13.94 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 8RB#7 | 13.92 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 13.81 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#0 | 14.23 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#12 | 13.77 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#24 | 13.89 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 12RB#0 | 13.32 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 12RB#6 | 13.72 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 12RB#13 | 13.61 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 25RB#0 | 13.35 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0 | 14.05 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#12 | 13.74 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 13.84 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 12RB#0 | 13.98 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 12RB#6 | 13.58 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 12RB#13 | 13.54 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 13.30 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 1RB#0 | 14.47 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 1RB#12 | 13.54 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 1RB#24 | 13.07 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 12RB#0 | 13.62 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 12RB#6 | 13.26 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 12RB#13 | 12.95 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 25RB#0 | 13.13 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0 | 14.32 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | |
|---|---|---|---|---|---|---|
| Band2 | 5MHz | 16QAM | 18900 | 1RB#12 | 13.58 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 13.05 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 12RB#0 | 13.65 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 12RB#6 | 13.30 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 12RB#13 | 12.97 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 13.09 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#0 | 14.36 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#12 | 13.47 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#24 | 13.73 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 12RB#0 | 13.88 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 12RB#6 | 13.63 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 12RB#13 | 13.59 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 25RB#0 | 14.67 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#0 | 14.15 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#12 | 13.42 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#24 | 13.66 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 12RB#0 | 13.93 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 12RB#6 | 13.62 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 12RB#13 | 14.77 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 25RB#0 | 14.54 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 1RB#0 | 14.54 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 1RB#24 | 14.50 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 1RB#49 | 15.85 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 27RB#0 | 14.18 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 27RB#12 | 14.05 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 27RB#25 | 14.61 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 50RB#0 | 14.25 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0 | 14.07 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#24 | 14.31 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 16.43 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 27RB#0 | 13.80 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 27RB#12 | 13.96 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 27RB#25 | 14.56 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 1RB#0 | 16.09 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 1RB#24 | 14.20 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 1RB#49 | 13.32 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 27RB#0 | 14.33 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 27RB#12 | 13.67 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 27RB#25 | 13.17 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 50RB#0 | 14.60 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0 | 15.67 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | |
|---|---|---|---|---|---|---|
| Band2 | 10MHz | 16QAM | 18900 | 1RB#24 | 14.10 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 13.07 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 27RB#0 | 14.33 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 27RB#12 | 13.65 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 27RB#25 | 13.16 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#0 | 18.41 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#24 | 15.75 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#49 | 14.52 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 27RB#0 | 16.43 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 27RB#12 | 15.21 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 27RB#25 | 14.27 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 50RB#0 | 7.49 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0 | 18.23 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#24 | 15.59 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 14.44 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 27RB#0 | 16.34 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 27RB#12 | 15.13 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 27RB#25 | 14.19 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 1RB#0 | 14.28 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 1RB#38 | 15.30 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 1RB#74 | 17.93 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 36RB#0 | 14.02 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 36RB#18 | 14.84 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 36RB#39 | 16.38 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 75RB#0 | 15.10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0 | 13.98 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#38 | 15.11 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 17.87 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 1RB#0 | 17.10 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 1RB#38 | 14.23 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 1RB#74 | 13.30 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 36RB#0 | 15.24 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 36RB#18 | 14.02 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 36RB#39 | 13.36 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 75RB#0 | 14.07 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0 | 16.92 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#38 | 14.08 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 13.34 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#0 | 17.34 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#38 | 16.92 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#74 | 14.24 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | |
|---|---|---|---|---|---|---|
| Band2 | 15MHz | QPSK | 19125 | 36RB#0 | 17.29 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 36RB#18 | 16.46 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 36RB#39 | 14.71 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 75RB#0 | 15.99 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0 | 17.27 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#38 | 16.78 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 14.26 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#0 | 14.09 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#49 | 16.31 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#99 | 18.47 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 50RB#0 | 14.54 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 50RB#25 | 16.26 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 50RB#50 | 17.77 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 100RB#0 | 16.19 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0 | 13.72 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#49 | 16.14 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99 | 18.28 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 1RB#0 | 18.20 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 1RB#49 | 14.38 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 1RB#99 | 13.73 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 50RB#0 | 15.68 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 50RB#25 | 14.09 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 50RB#50 | 13.40 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 100RB#0 | 14.40 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0 | 17.82 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#49 | 14.16 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99 | 13.54 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#0 | 14.95 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#49 | 18.05 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#99 | 14.22 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 50RB#0 | 16.56 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 50RB#25 | 16.95 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 50RB#50 | 15.47 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 100RB#0 | 15.89 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0 | 14.63 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#49 | 17.91 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99 | 13.99 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

# Appendix B: Peak-to-Average Ratio(CCDF)

## Test Result

| Band | Bandwidth | Modulation | Channel | RB Configuration | Result(dB) | Limit(dB) | Verdict |
|---|---|---|---|---|---|---|---|
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#0 | 5.76 | 13 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 6RB#0 | 5.36 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#0 | 5.64 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 6RB#0 | 5.89 | 13 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 1RB#0 | 5.00 | 13 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 6RB#0 | 5.26 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 5.52 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 5.67 | 13 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#0 | 8.40 | 13 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 6RB#0 | 4.83 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 4.79 | 13 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0 | 5.25 | 13 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#0 | 4.61 | 13 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 15RB#0 | 5.24 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#0 | 8.75 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 15RB#0 | 6.07 | 13 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 1RB#0 | 4.45 | 13 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 15RB#0 | 5.20 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0 | 5.34 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 6.03 | 13 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 1RB#0 | 4.64 | 13 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 15RB#0 | 5.31 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0 | 5.66 | 13 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 6.12 | 13 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#0 | 4.57 | 13 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 25RB#0 | 5.26 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0 | 5.51 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 7.76 | 13 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 1RB#0 | 4.40 | 13 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 25RB#0 | 5.20 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0 | 5.37 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 6.00 | 13 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#0 | 4.52 | 13 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 25RB#0 | 5.24 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#0 | 5.46 | 13 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 25RB#0 | 6.04 | 13 | PASS |


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | | |
|---|---|---|---|---|---|---|---|
| Band2 | 10MHz | QPSK | 18650 | 1RB#0 | 4.53 | 13 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 50RB#0 | 5.22 | 13 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0 | 5.54 | 13 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 1RB#0 | 4.41 | 13 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 50RB#0 | 5.11 | 13 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0 | 5.31 | 13 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#0 | 4.53 | 13 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 50RB#0 | 5.14 | 13 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0 | 5.42 | 13 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 75RB#0 | 5.43 | 13 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0 | 5.42 | 13 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 1RB#0 | 4.56 | 13 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 75RB#0 | 5.20 | 13 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0 | 5.43 | 13 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#0 | 4.69 | 13 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 75RB#0 | 5.21 | 13 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0 | 5.66 | 13 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#0 | 4.53 | 13 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 100RB#0 | 5.26 | 13 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 1RB#0 | 4.79 | 13 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 100RB#0 | 5.00 | 13 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#0 | 8.40 | 13 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 100RB#0 | 5.19 | 13 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

## Test Graphs




Band2-1.4MHz-QPSK-18607-1RB#0-PASS




Band2-1.4MHz-QPSK-18607-6RB#0-PASS

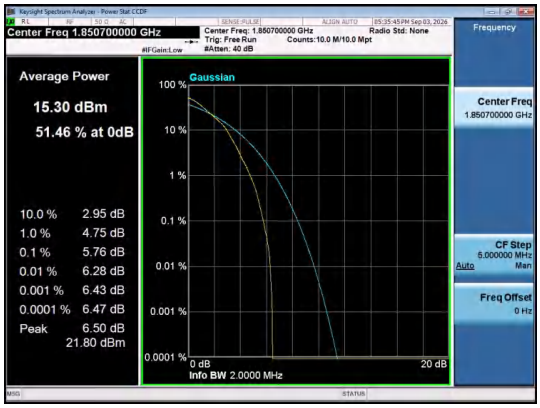


Band2-1.4MHz-16QAM-18607-1RB#0-PASS

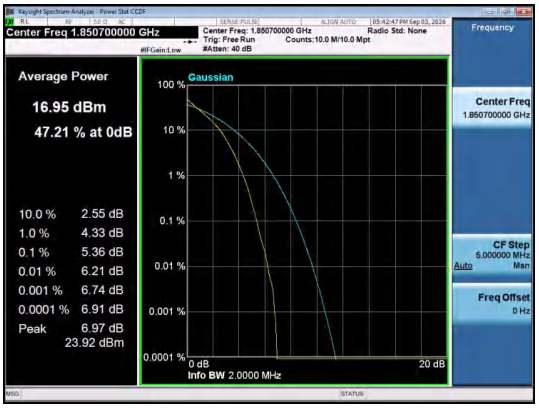


Band2-1.4MHz-16QAM-18607-6RB#0-PASS

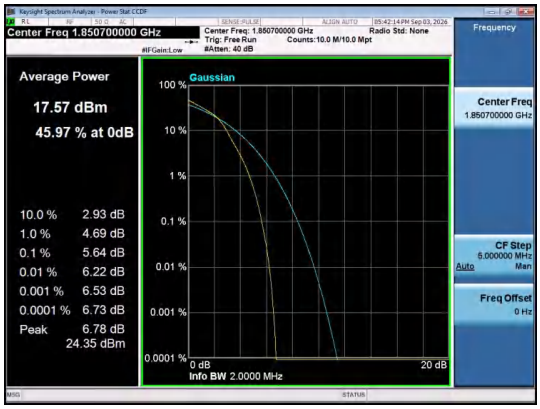


Band2-1.4MHz-QPSK-18900-1RB#0-PASS

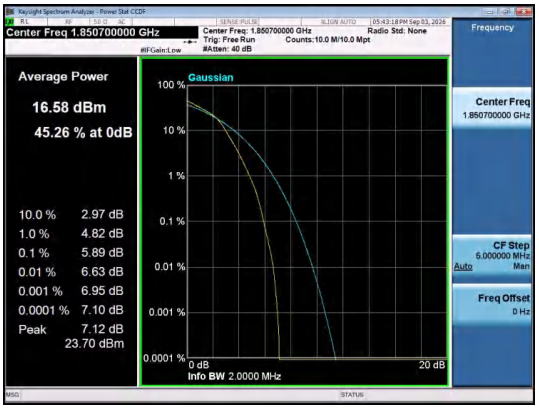


Band2-1.4MHz-QPSK-18900-6RB#0-PASS

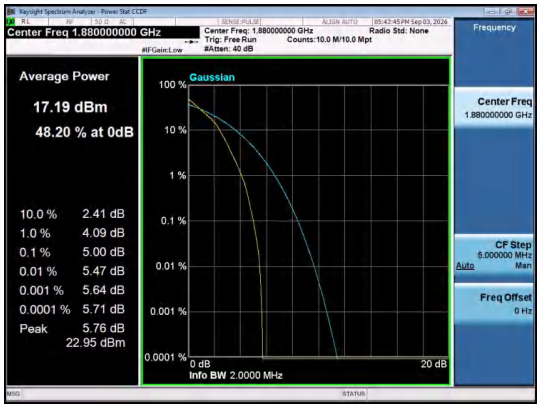

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

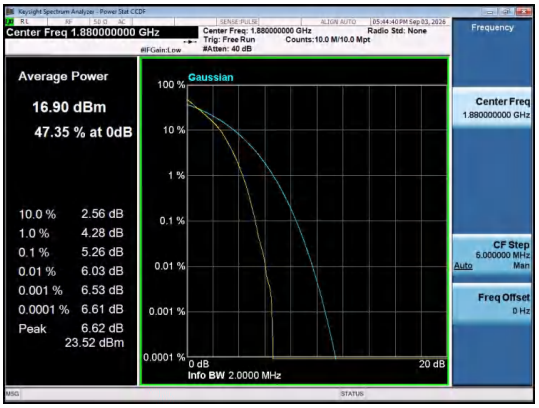


Band2-1.4MHz-16QAM-18900-1RB#0-PASS




Band2-1.4MHz-16QAM-18900-6RB#0-PASS

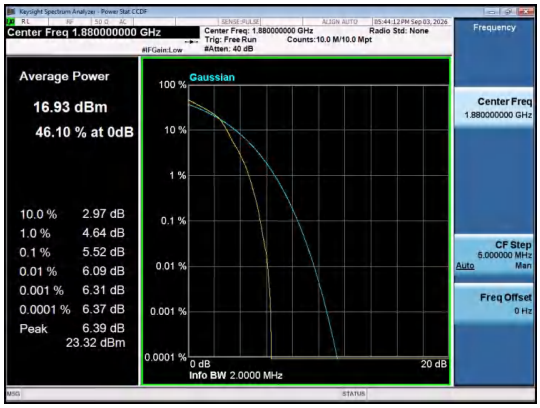


Band2-1.4MHz-QPSK-19193-1RB#0-PASS

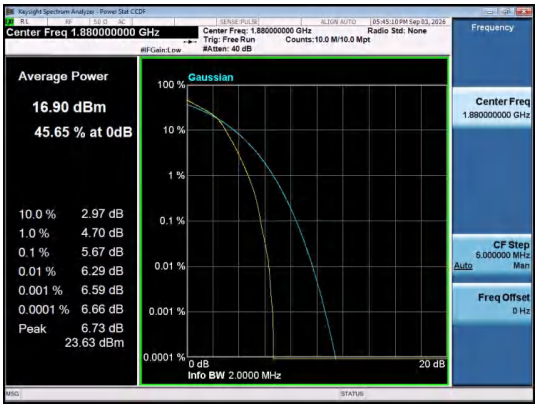


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

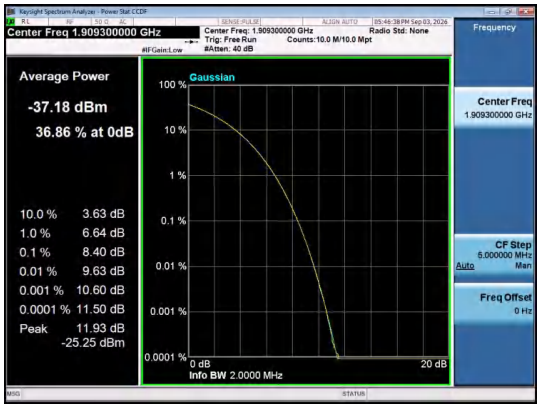


Band2-1.4MHz-16QAM-19193-1RB#0-PASS

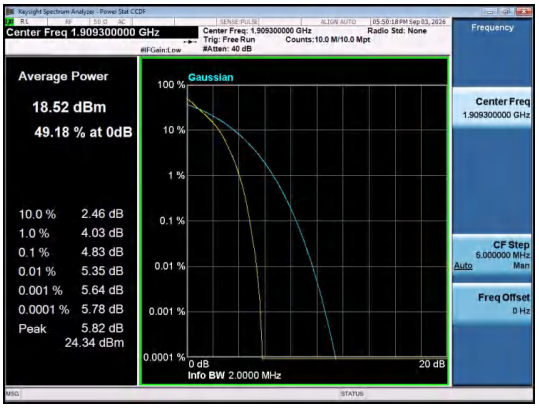


Band2-1.4MHz-16QAM-19193-6RB#0-PASS

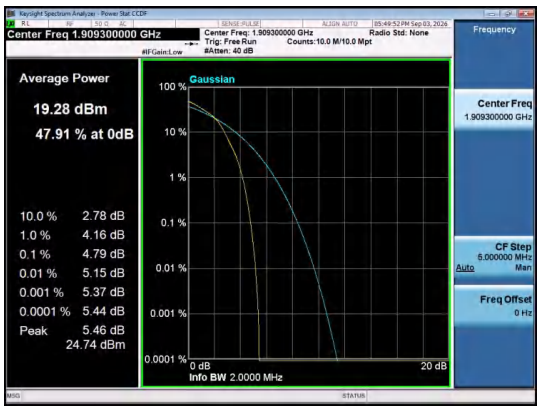

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

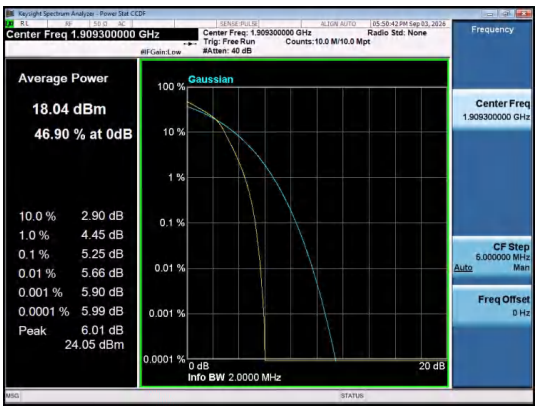


Band2-3MHz-QPSK-18615-1RB#0-PASS




Band2-3MHz-QPSK-18615-15RB#0-PASS

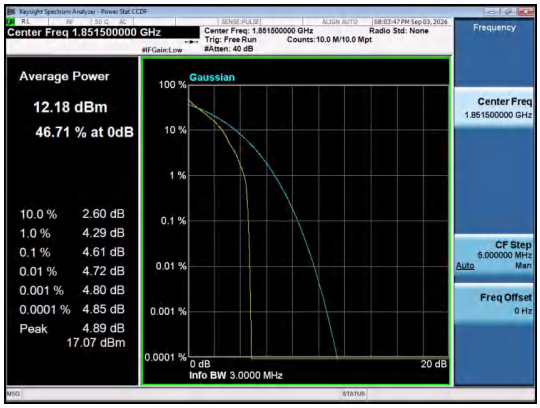


Band2-3MHz-16QAM-18615-1RB#0-PASS

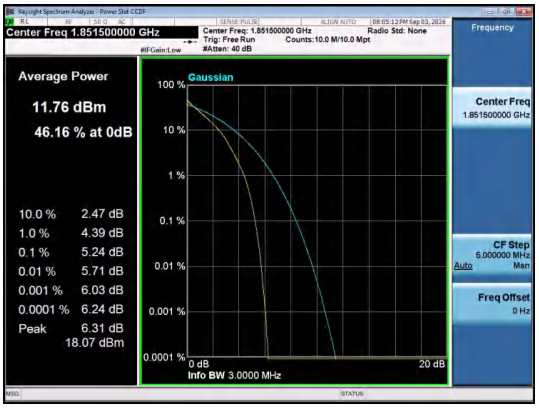


Band2-3MHz-16QAM-18615-15RB#0-PASS

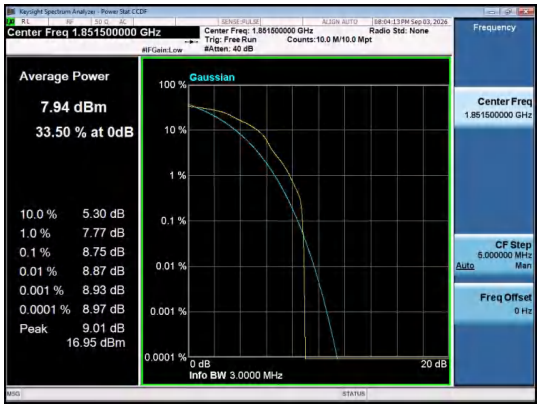


Band2-3MHz-QPSK-18900-1RB#0-PASS

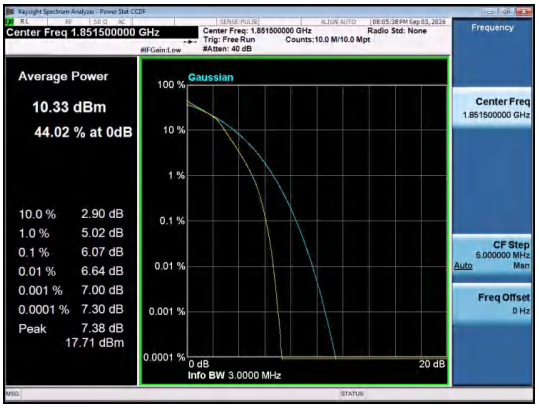


Band2-3MHz-QPSK-18900-15RB#0-PASS

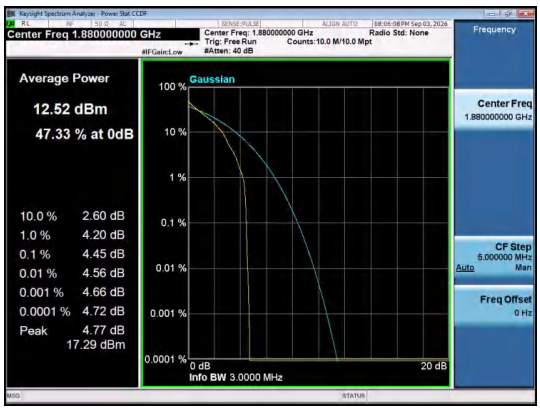

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

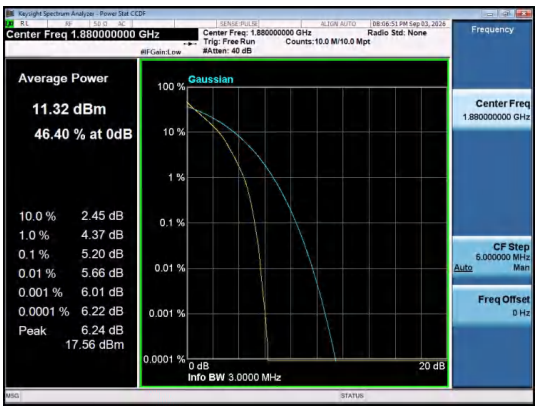


Band2-3MHz-16QAM-18900-1RB#0-PASS




Band2-3MHz-16QAM-18900-15RB#0-PASS

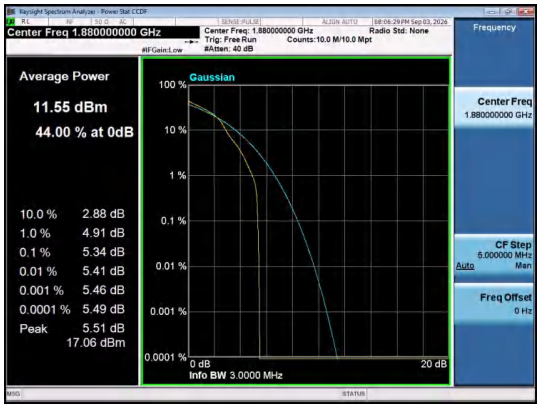


Band2-3MHz-QPSK-19185-1RB#0-PASS

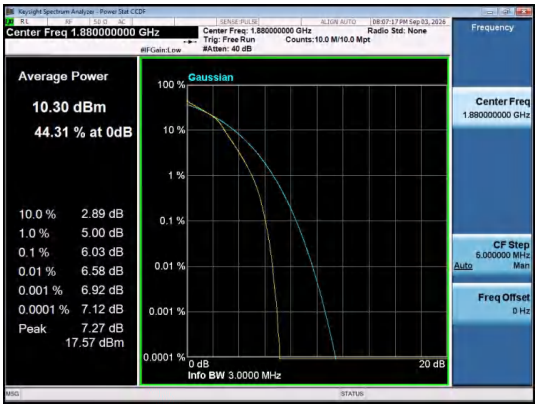


Band2-3MHz-QPSK-19185-15RB#0-PASS

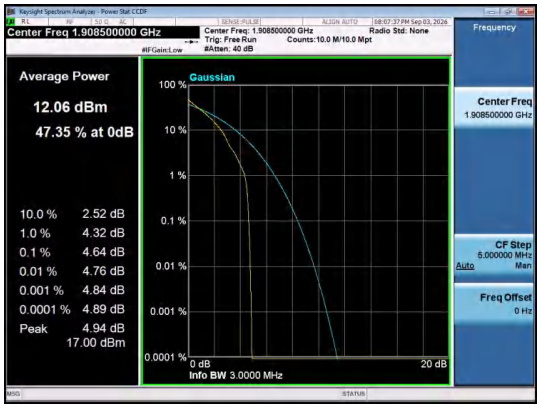


Band2-3MHz-16QAM-19185-1RB#0-PASS

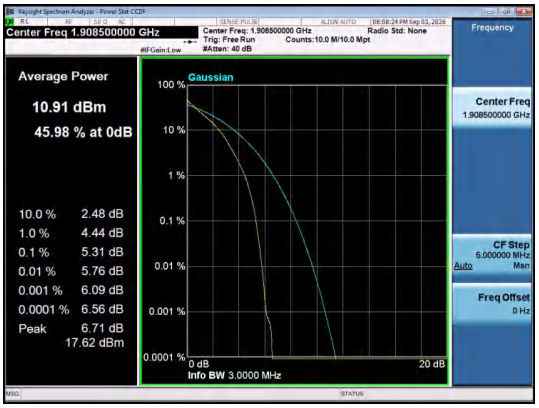


Band2-3MHz-16QAM-19185-15RB#0-PASS

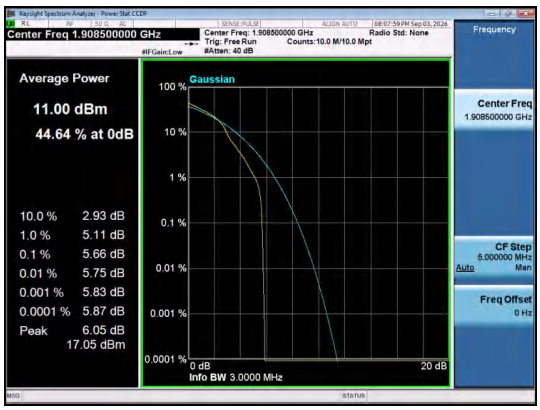

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

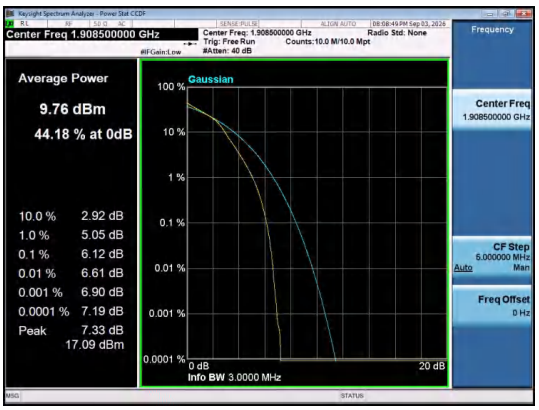


Band2-5MHz-QPSK-18625-1RB#0-PASS




Band2-5MHz-QPSK-18625-25RB#0-PASS

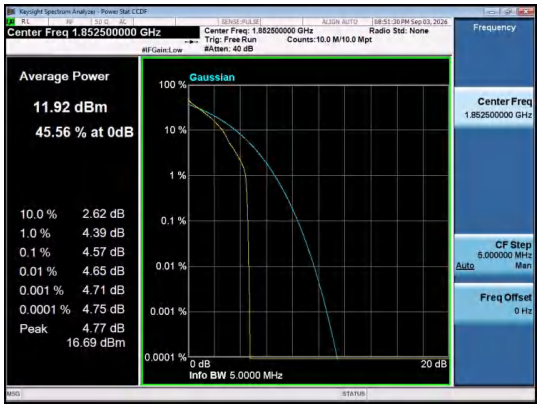


Band2-5MHz-16QAM-18625-1RB#0-PASS

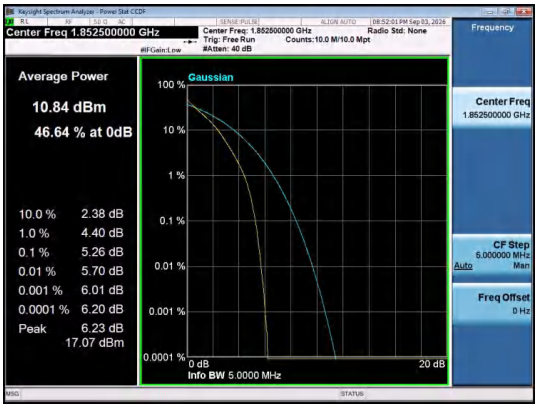


Band2-5MHz-16QAM-18625-25RB#0-PASS

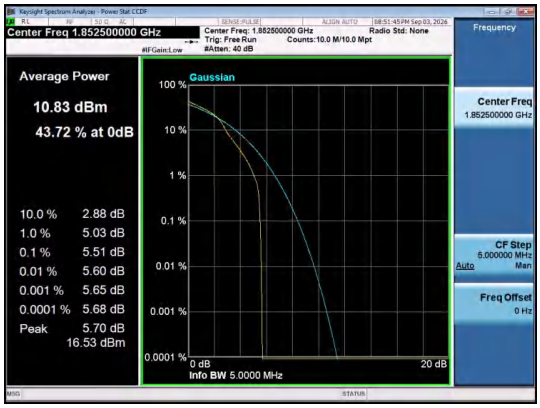


Band2-5MHz-QPSK-18900-1RB#0-PASS

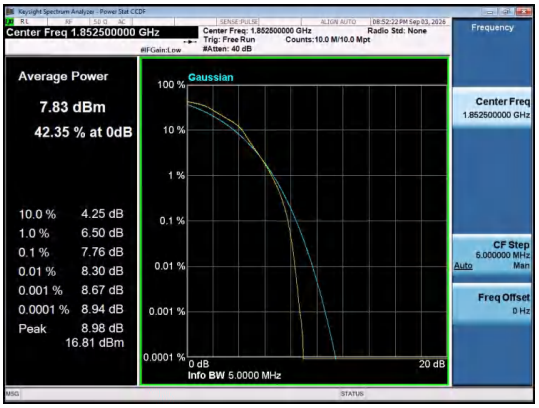


Band2-5MHz-QPSK-18900-25RB#0-PASS

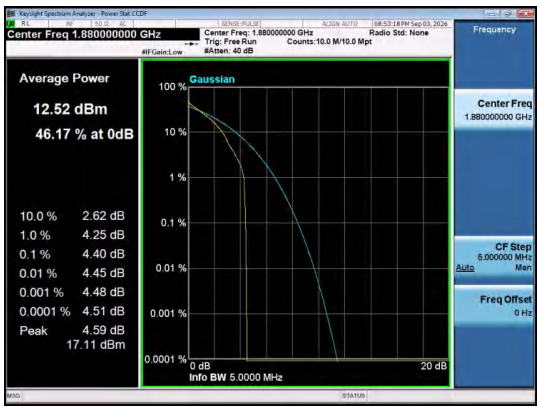

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

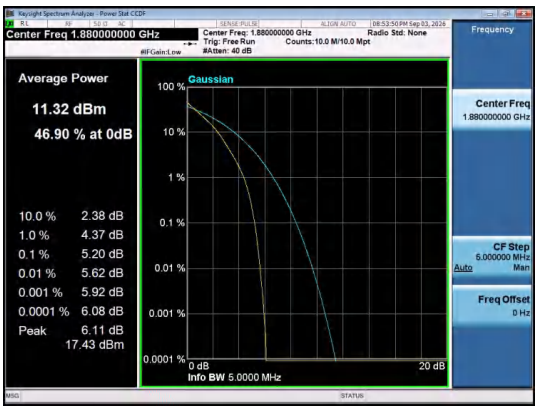


Band2-5MHz-16QAM-18900-1RB#0-PASS




Band2-5MHz-16QAM-18900-25RB#0-PASS

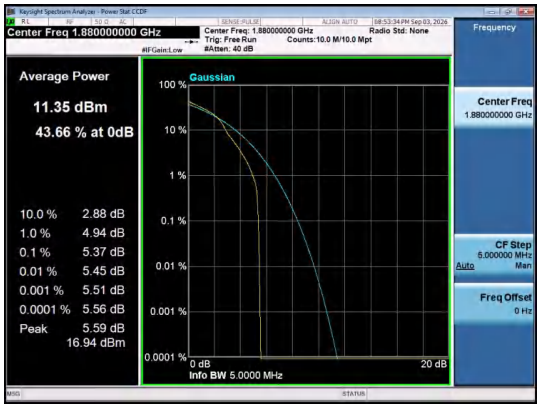


Band2-5MHz-QPSK-19175-1RB#0-PASS

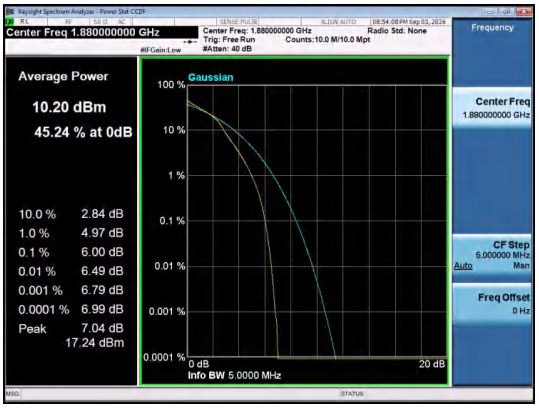


Band2-5MHz-QPSK-19175-25RB#0-PASS

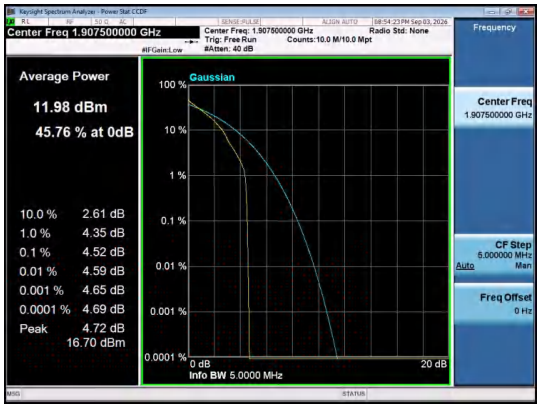


Band2-5MHz-16QAM-19175-1RB#0-PASS

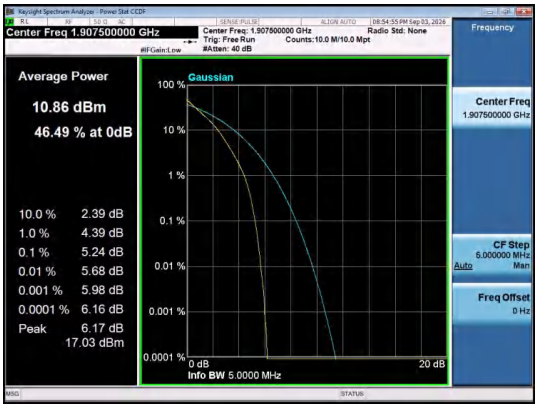


Band2-5MHz-16QAM-19175-25RB#0-PASS

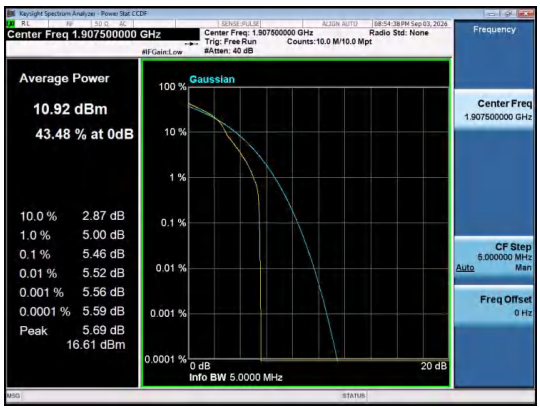

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

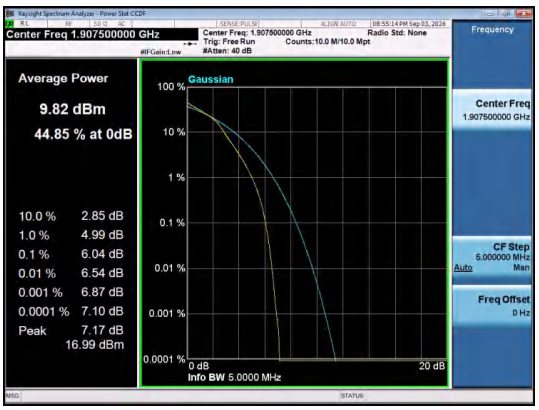


Band2-10MHz-QPSK-18650-1RB#0-PASS




Band2-10MHz-QPSK-18650-50RB#0-PASS

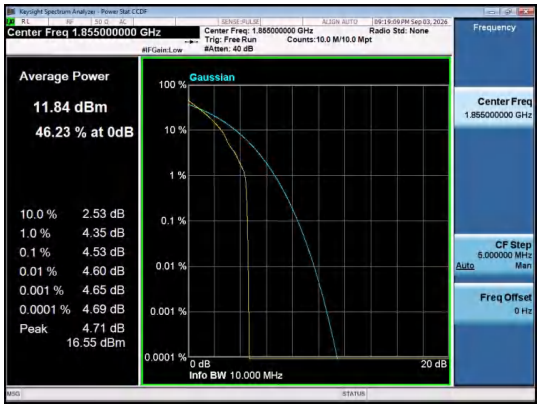


Band2-10MHz-16QAM-18650-1RB#0-PASS

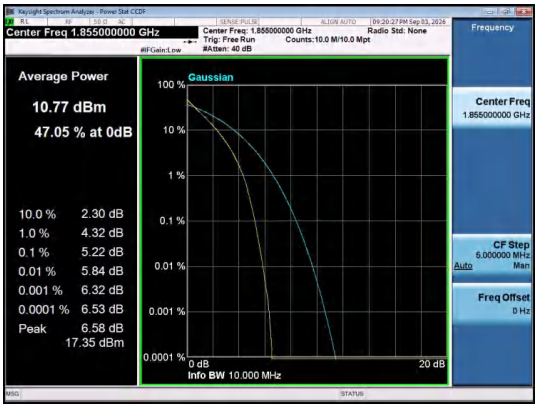


Band2-10MHz-QPSK-18900-1RB#0-PASS

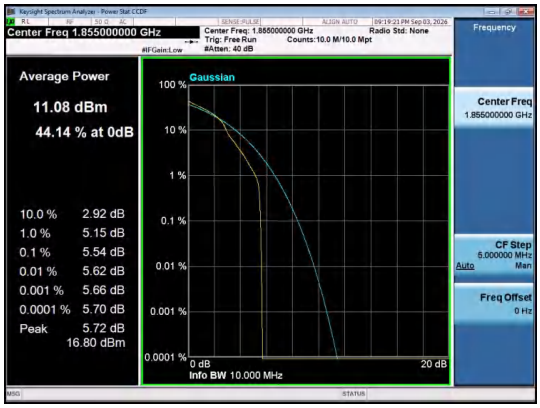


Band2-10MHz-QPSK-18900-50RB#0-PASS

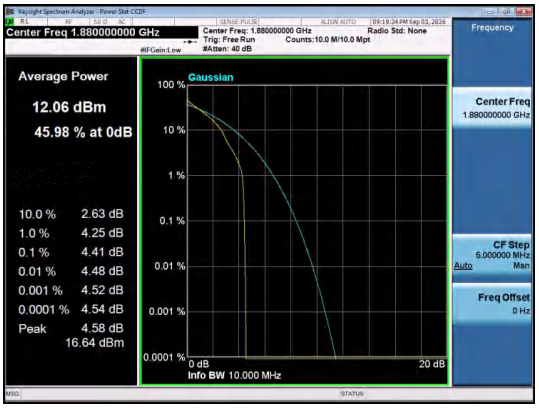


Band2-10MHz-16QAM-18900-1RB#0-PASS

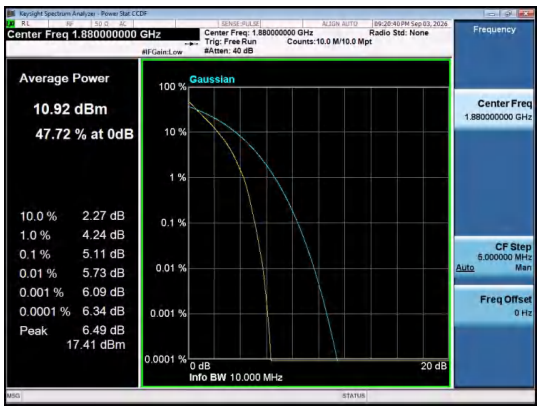

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

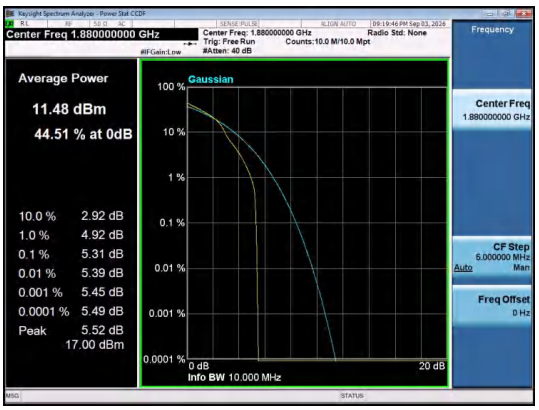


Band2-10MHz-QPSK-19150-1RB#0-PASS




Band2-10MHz-QPSK-19150-50RB#0-PASS

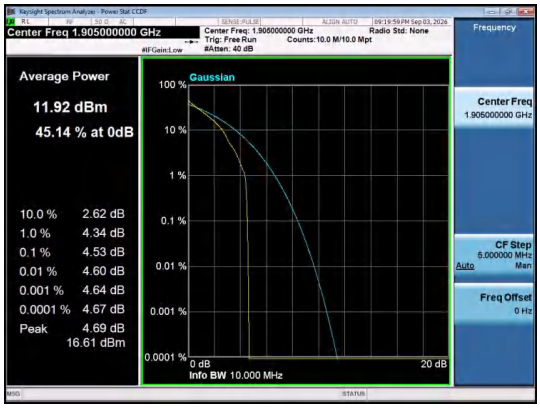


Band2-10MHz-16QAM-19150-1RB#0-PASS

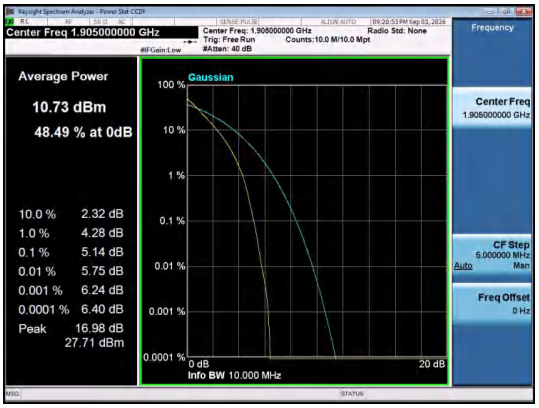


Band2-15MHz-16QAM-18675-1RB#0-PASS

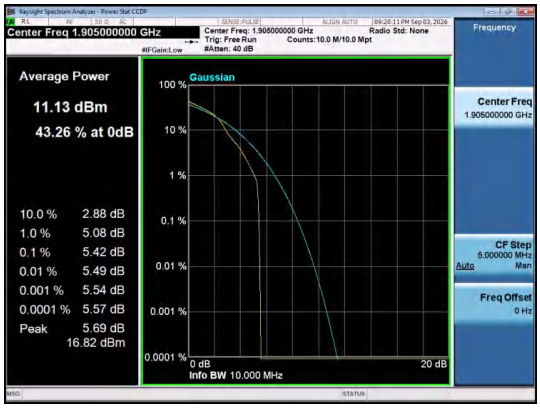


Band2-15MHz-QPSK-18675-75RB#0-PASS

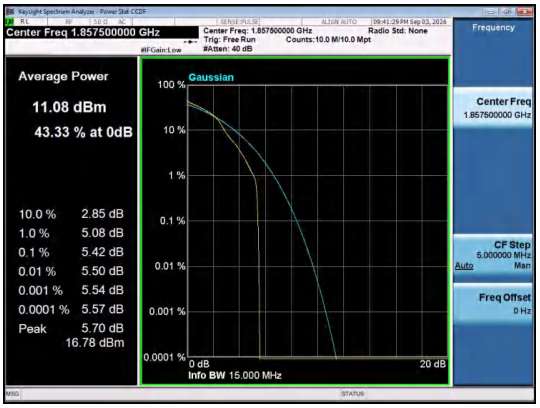


Band2-15MHz-QPSK-18900-75RB#0-PASS

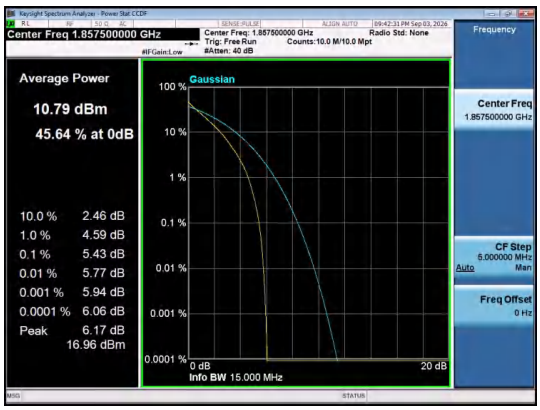

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

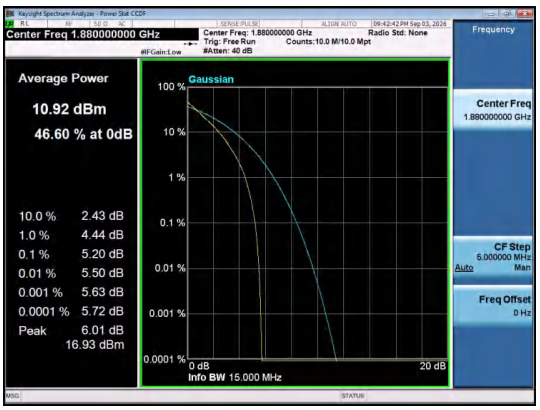


Band2-15MHz-QPSK-18900-1RB#0-PASS




Band2-15MHz-QPSK-19125-1RB#0-PASS

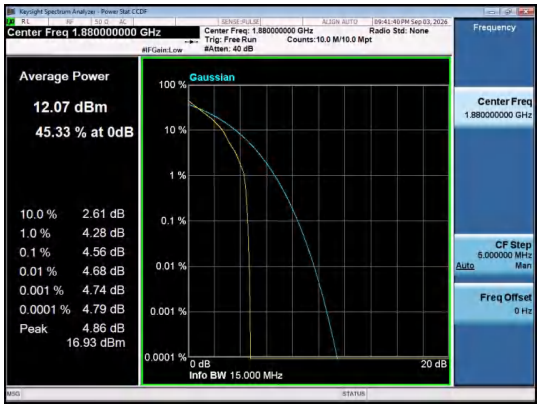


Band2-15MHz-16QAM-18900-1RB#0-PASS

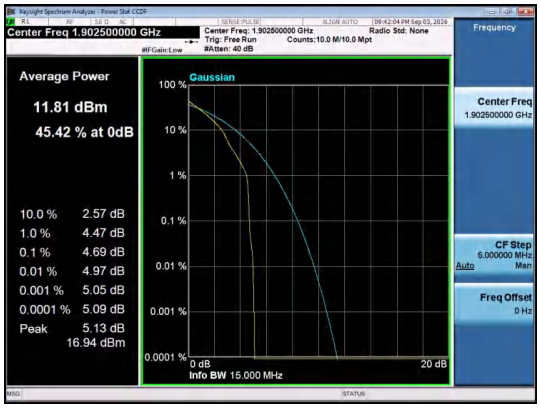


Band2-15MHz-16QAM-19125-1RB#0-PASS

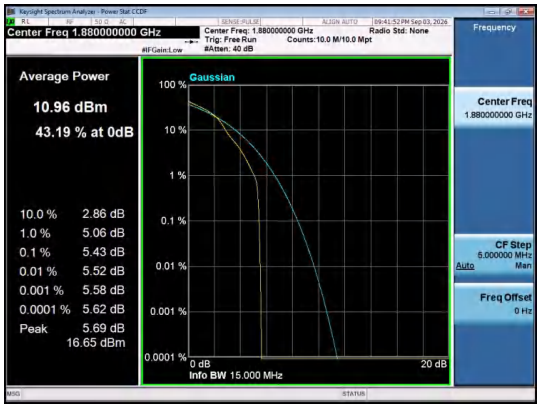


Band2-15MHz-QPSK-19125-75RB#0-PASS

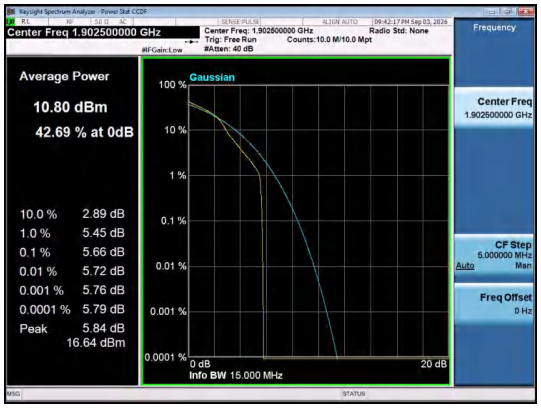


Band2-20MHz-QPSK-18700-100RB#0-PASS

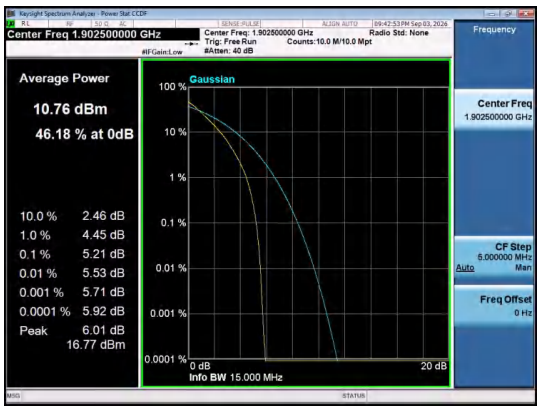

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

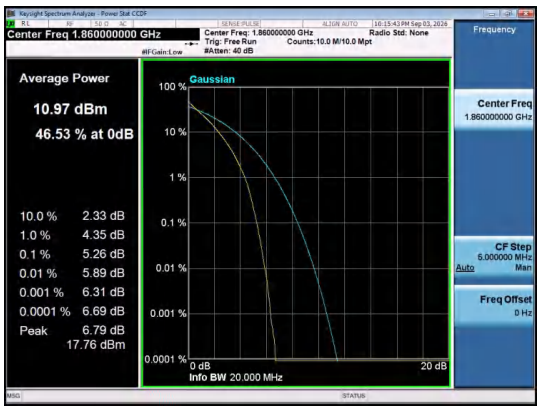


Band2-20MHz-QPSK-18700-1RB#0-PASS




Band2-20MHz-QPSK-18900-100RB#0-PASS

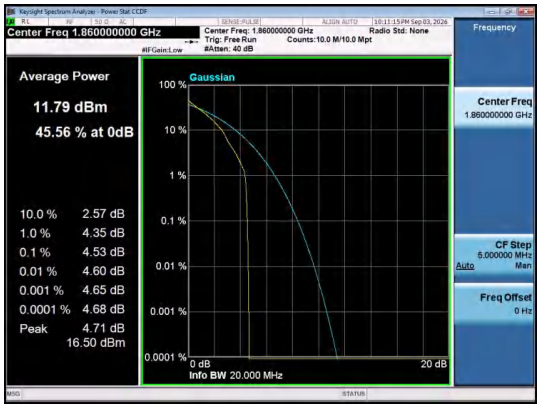


Band2-20MHz-QPSK-18900-1RB#0-PASS

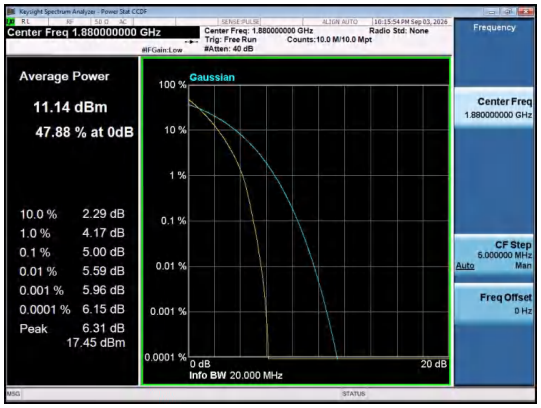


Band2-20MHz-QPSK-19100-100RB#0-PASS

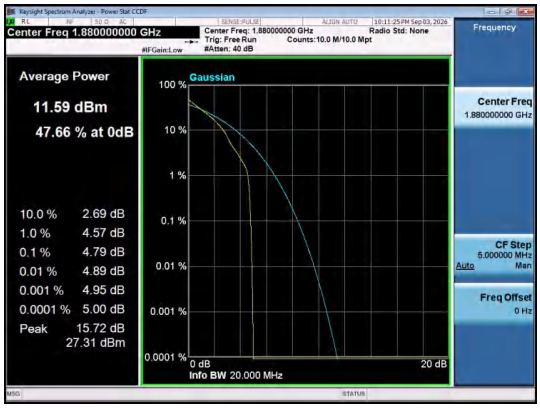


Band2-20MHz-QPSK-19100-1RB#0-PASS

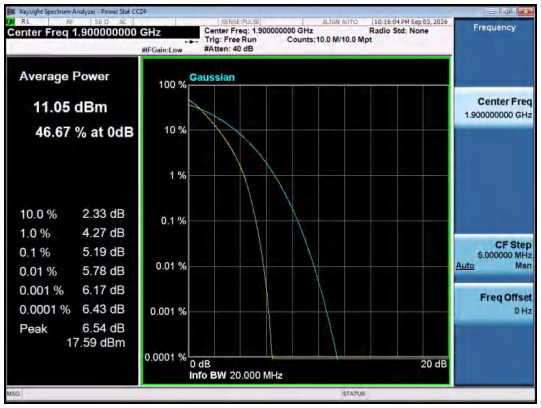

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com
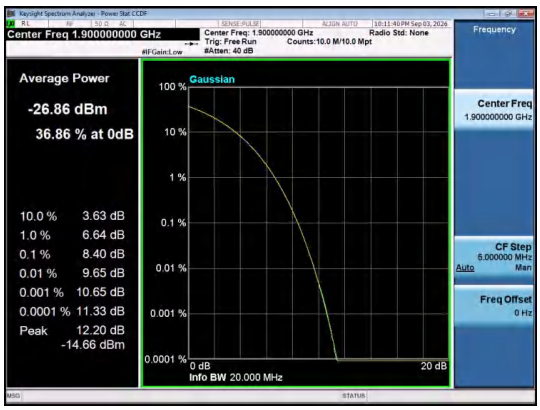
# Appendix C: 26dB Bandwidth and Occupied Bandwidth

## Test Result

| Band | Bandwidth | Modulation | Channel | RB Configuration | Occupied Bandwidth (MHz) | 26dB Bandwidth (MHz) | Verdict |
|---|---|---|---|---|---|---|---|
| Band2 | 1.4MHz | QPSK | 18607 | 6RB#0 | 1.0935 | 1.273 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 6RB#0 | 1.1004 | 1.280 | PASS |
| Band2 | 1.4MHz | QPSK | 18900 | 6RB#0 | 1.0925 | 1.293 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 1.0969 | 1.288 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 6RB#0 | 1.0944 | 1.279 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0 | 1.0997 | 1.287 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 15RB#0 | 2.6947 | 2.919 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 15RB#0 | 2.6905 | 2.937 | PASS |
| Band2 | 3MHz | QPSK | 18900 | 15RB#0 | 2.7026 | 2.924 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 2.6935 | 2.938 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 15RB#0 | 2.6948 | 2.928 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 2.6923 | 2.956 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 25RB#0 | 4.5064 | 5.020 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 4.5043 | 4.954 | PASS |
| Band2 | 5MHz | QPSK | 18900 | 25RB#0 | 4.5080 | 5.017 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 4.5049 | 4.953 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 25RB#0 | 4.4986 | 4.994 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 25RB#0 | 4.5090 | 4.993 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 50RB#0 | 8.9743 | 9.884 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 27RB#0 | 4.9866 | 5.758 | PASS |
| Band2 | 10MHz | QPSK | 18900 | 50RB#0 | 8.9625 | 9.842 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 27RB#0 | 4.9797 | 5.845 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 50RB#0 | 8.9265 | 9.878 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 27RB#0 | 4.9615 | 5.769 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 75RB#0 | 13.467 | 14.78 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 27RB#0 | 5.1087 | 6.106 | PASS |
| Band2 | 15MHz | QPSK | 18900 | 75RB#0 | 13.421 | 14.67 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 27RB#0 | 5.0748 | 5.988 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 75RB#0 | 13.407 | 14.61 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 27RB#0 | 5.1318 | 7.240 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 100RB#0 | 17.918 | 19.52 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 27RB#0 | 5.2533 | 6.530 | PASS |
| Band2 | 20MHz | QPSK | 18900 | 100RB#0 | 17.858 | 19.43 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 27RB#0 | 5.2910 | 6.471 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 100RB#0 | 17.866 | 19.26 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | | |
|---|---|---|---|---|---|---|---|
| Band2 | 20MHz | 16QAM | 19100 | 27RB#0 | 5.2374 | 6.447 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

## Test Graphs




Band2-1.4MHz-QPSK-18607-6RB#0-PASS




Band2-1.4MHz-16QAM-18607-6RB#0-PASS

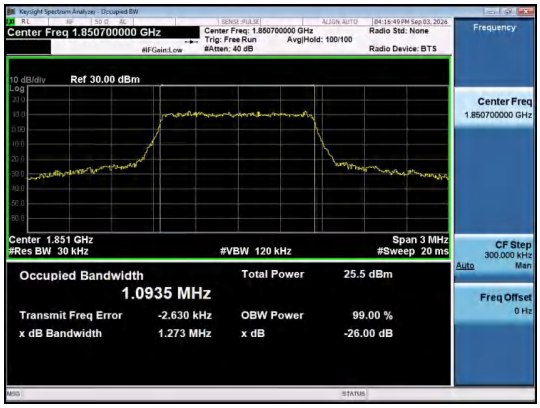


Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

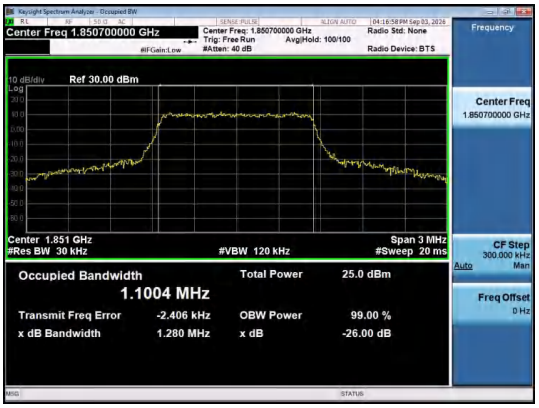


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

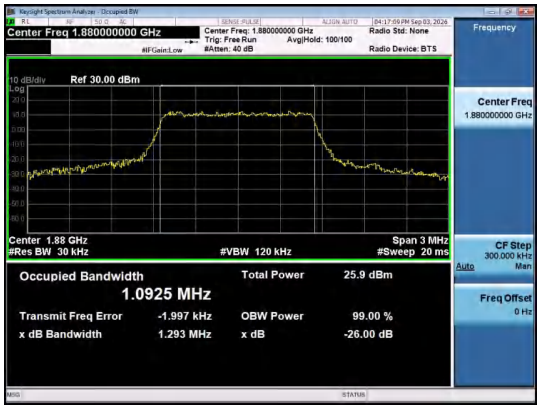Band2-1.4MHz-16QAM-19193-6RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

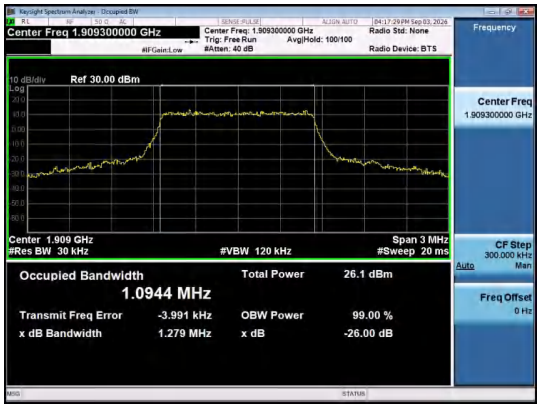Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2-3MHz-QPSK-18615-15RB#0-PASS

Band2-3MHz-16QAM-18615-15RB#0-PASS




Band2-3MHz-QPSK-18900-15RB#0-PASS




Band2-3MHz-16QAM-18900-15RB#0-PASS

Band2-3MHz-QPSK-19185-15RB#0-PASS

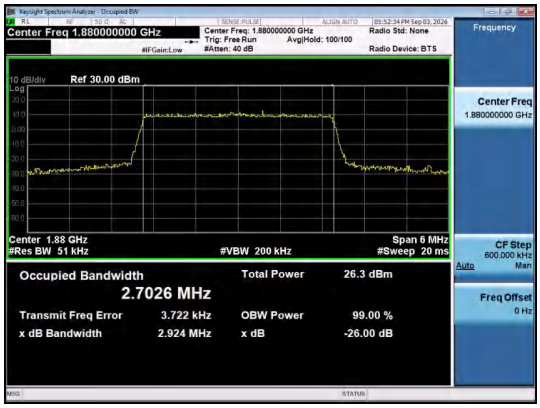Band2-3MHz-16QAM-19185-15RB#0-PASS

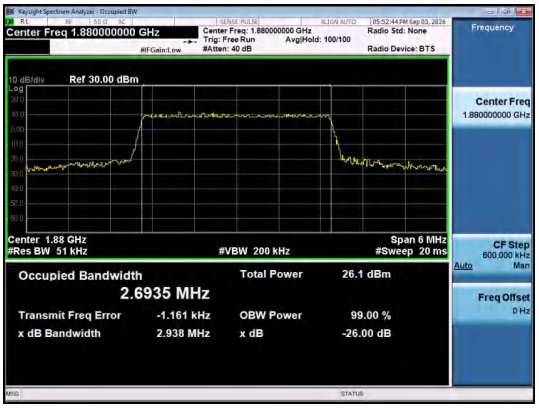

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Band2-5MHz-QPSK-18625-25RB#0-PASS




Band2-5MHz-16QAM-18625-25RB#0-PASS

Band2-5MHz-QPSK-18900-25RB#0-PASS

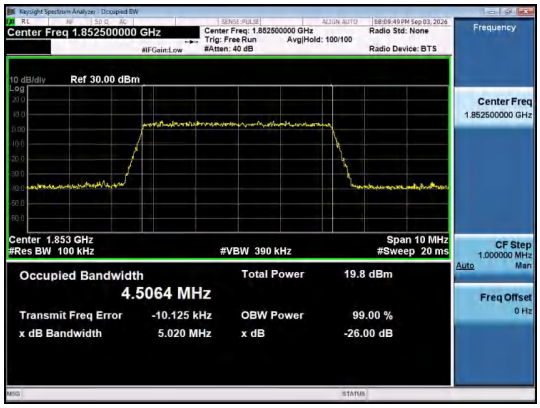Band2-5MHz-16QAM-18900-25RB#0-PASS

Band2-5MHz-QPSK-19175-25RB#0-PASS

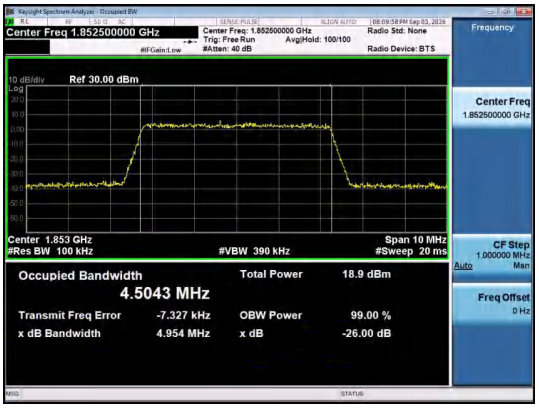Band2-5MHz-16QAM-19175-25RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2-10MHz-QPSK-18650-50RB#0-PASS

Band2-10MHz-16QAM-18650-27RB#0-PASS

Band2-10MHz-QPSK-18900-50RB#0-PASS

Band2-10MHz-16QAM-18900-27RB#0-PASS

Band2-10MHz-QPSK-19150-50RB#0-PASS

Band2-10MHz-16QAM-19150-27RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Band2-15MHz-QPSK-18675-75RB#0-PASS




Band2-15MHz-16QAM-18675-27RB#0-PASS

Band2-15MHz-QPSK-18900-75RB#0-PASS

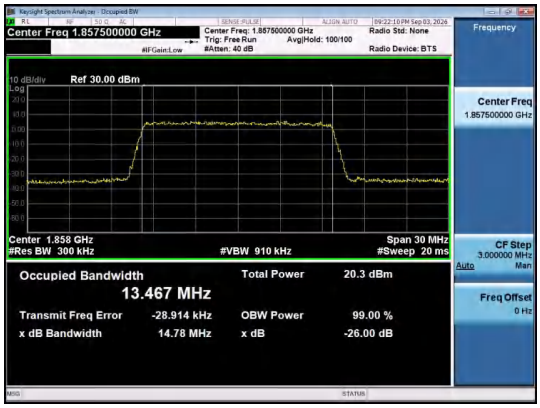Band2-15MHz-16QAM-18900-27RB#0-PASS

Band2-15MHz-QPSK-19125-75RB#0-PASS

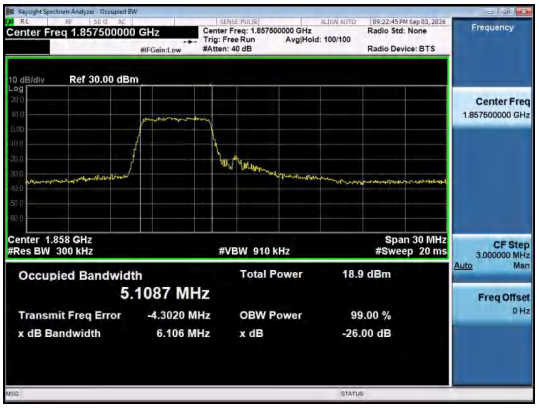Band2-15MHz-16QAM-19125-27RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Band2-20MHz-QPSK-18700-100RB#0-PASS

Band2-20MHz-16QAM-18700-27RB#0-PASS




Band2-20MHz-QPSK-18900-100RB#0-PASS

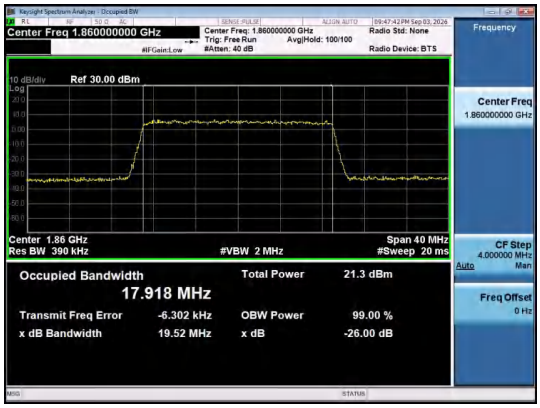Band2-20MHz-16QAM-18900-27RB#0-PASS

Band2-20MHz-QPSK-19100-100RB#0-PASS

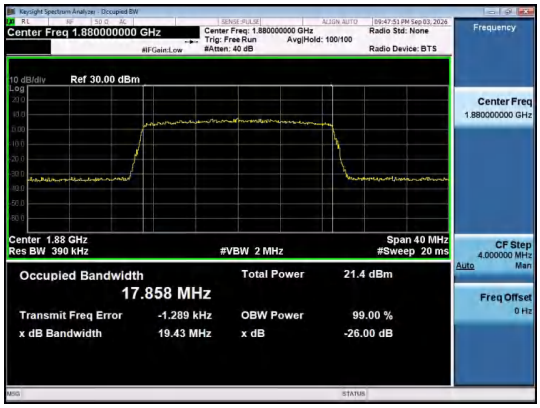


Band2-20MHz-16QAM-19100-27RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com
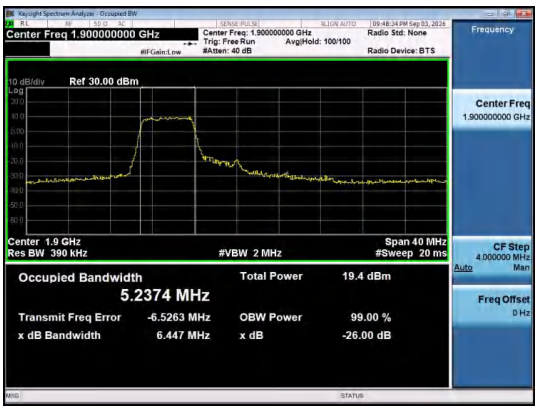
# Appendix D: Band Edge

## Test Result

| Band | Bandwidth | Modulation | Channel | RB Configuration | Result(dBm) | Margin (dB) | Verdict |
|---|---|---|---|---|---|---|---|
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#0 | -32.47 | 19.47 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 1RB#5 | -46.59 | 33.59 | PASS |
| Band2 | 1.4MHz | QPSK | 18607 | 6RB#0 | -35.60 | 22.60 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#0 | -34.04 | 21.04 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 1RB#5 | -45.66 | 32.66 | PASS |
| Band2 | 1.4MHz | 16QAM | 18607 | 6RB#0 | -32.30 | 19.30 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#0 | -45.25 | 32.25 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 1RB#5 | -28.97 | 15.97 | PASS |
| Band2 | 1.4MHz | QPSK | 19193 | 6RB#0 | -28.63 | 15.63 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | -45.06 | 32.06 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5 | -30.34 | 17.34 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0 | -30.90 | 17.90 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#0 | -30.68 | 17.68 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 1RB#14 | -49.42 | 36.42 | PASS |
| Band2 | 3MHz | QPSK | 18615 | 15RB#0 | -37.52 | 24.52 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#0 | -30.76 | 17.76 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 1RB#14 | -49.63 | 36.63 | PASS |
| Band2 | 3MHz | 16QAM | 18615 | 15RB#0 | -37.12 | 24.12 | PASS |
| Band2 | 3MHz | QPSK | 19185 | 15RB#0 | -32.99 | 19.99 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0 | -48.12 | 35.12 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | -26.53 | 13.53 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | -32.05 | 19.05 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#0 | -39.30 | 26.30 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 1RB#24 | -54.50 | 41.50 | PASS |
| Band2 | 5MHz | QPSK | 18625 | 25RB#0 | -45.51 | 32.51 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0 | -40.59 | 27.59 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | -54.53 | 41.53 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | -46.77 | 33.77 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#0 | -54.02 | 41.02 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 1RB#24 | -39.69 | 26.69 | PASS |
| Band2 | 5MHz | QPSK | 19175 | 25RB#0 | -45.91 | 32.91 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#0 | -54.23 | 41.23 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 1RB#24 | -40.99 | 27.99 | PASS |
| Band2 | 5MHz | 16QAM | 19175 | 25RB#0 | -45.90 | 32.90 | PASS |
| Band2 | 10MHz | QPSK | 18650 | 1RB#0 | -46.91 | 33.91 | PASS |


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

| | | | | | | | |
|---|---|---|---|---|---|---|---|
| Band2 | 10MHz | QPSK | 18650 | 1RB#49 | -51.88 | 38.88 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | -52.09 | 39.09 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#0 | -51.55 | 38.55 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 1RB#49 | -47.34 | 34.34 | PASS |
| Band2 | 10MHz | QPSK | 19150 | 50RB#0 | -47.10 | 34.10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0 | -51.60 | 38.60 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | -48.44 | 35.44 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 1RB#0 | -46.66 | 33.66 | PASS |
| Band2 | 15MHz | QPSK | 18675 | 1RB#74 | -50.43 | 37.43 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | -50.36 | 37.36 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#0 | -50.05 | 37.05 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 1RB#74 | -46.63 | 33.63 | PASS |
| Band2 | 15MHz | QPSK | 19125 | 75RB#0 | -47.43 | 34.43 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0 | -49.94 | 36.94 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | -47.33 | 34.33 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#0 | -46.48 | 33.48 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 1RB#99 | -49.35 | 36.35 | PASS |
| Band2 | 20MHz | QPSK | 18700 | 100RB#0 | -47.17 | 34.17 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0 | -46.77 | 33.77 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99 | -49.17 | 36.17 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#0 | -48.65 | 35.65 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 1RB#99 | -46.45 | 33.45 | PASS |
| Band2 | 20MHz | QPSK | 19100 | 100RB#0 | -46.91 | 33.91 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0 | -48.57 | 35.57 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99 | -46.74 | 33.74 | PASS |



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

## Test Graphs




Band2-1.4MHz-QPSK-18607-1RB#0-PASS




Band2-1.4MHz-QPSK-18607-1RB#5-PASS

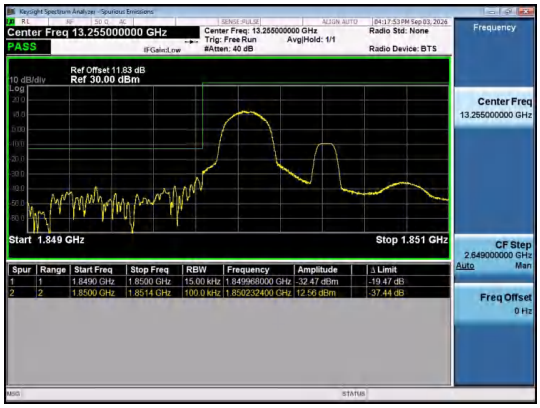


Band2-1.4MHz-QPSK-18607-6RB#0-PASS

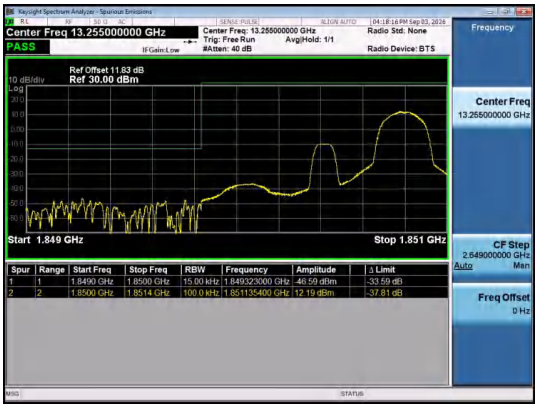


Band2-1.4MHz-16QAM-18607-1RB#0-PASS

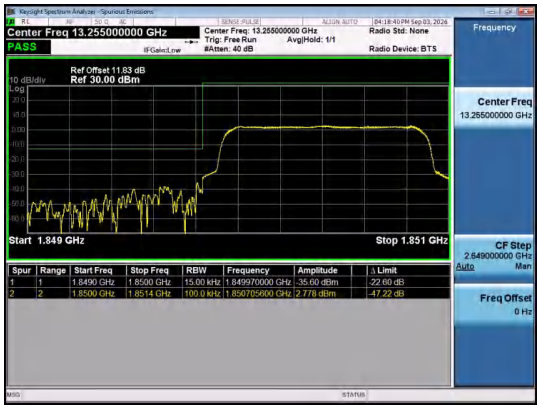


Band2-1.4MHz-16QAM-18607-1RB#5-PASS

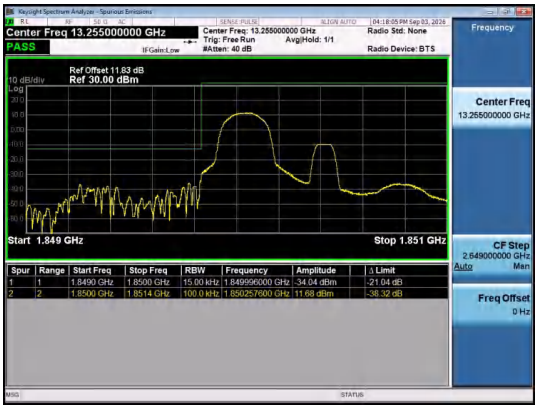


Band2-1.4MHz-16QAM-18607-6RB#0-PASS

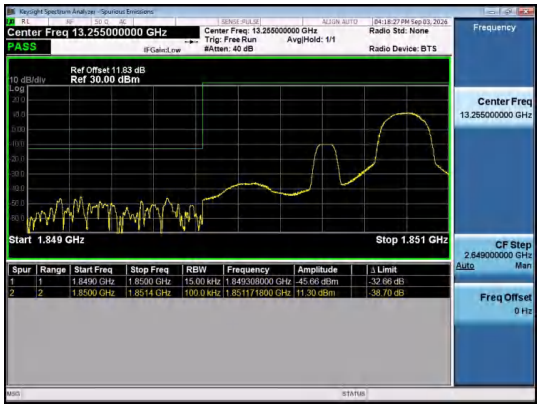

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

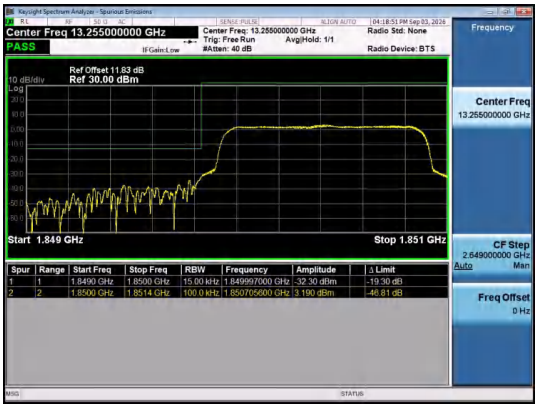Band2-1.4MHz-QPSK-19193-1RB#0-PASS




Band2-1.4MHz-QPSK-19193-1RB#5-PASS




Band2-1.4MHz-QPSK-19193-6RB#0-PASS

Band2-1.4MHz-16QAM-19193-1RB#0-PASS

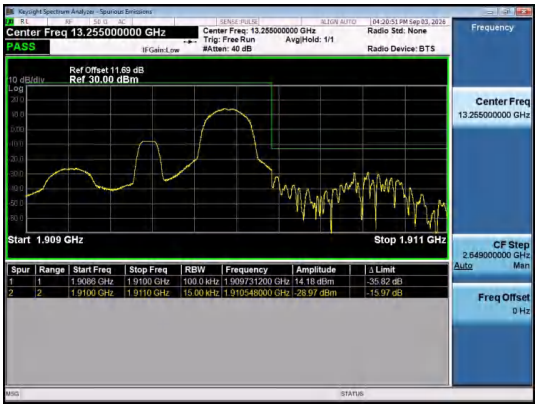


Band2-1.4MHz-16QAM-19193-1RB#5-PASS

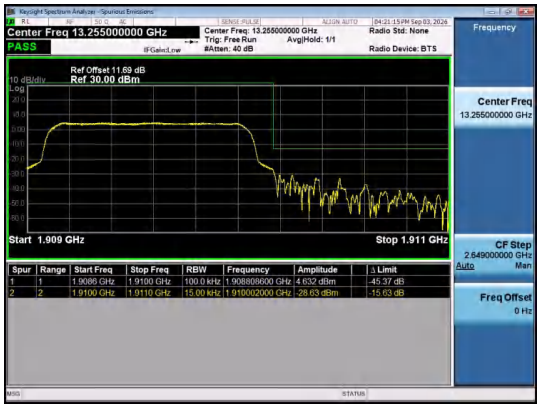Band2-1.4MHz-16QAM-19193-6RB#0-PASS



Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

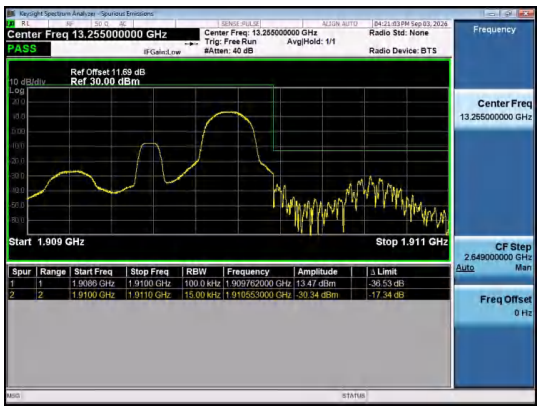Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Band2-3MHz-QPSK-18615-1RB#0-PASS




Band2-3MHz-QPSK-18615-1RB#14-PASS

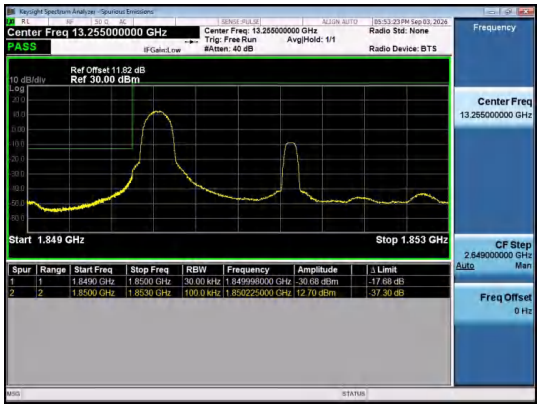


Band2-3MHz-QPSK-18615-15RB#0-PASS

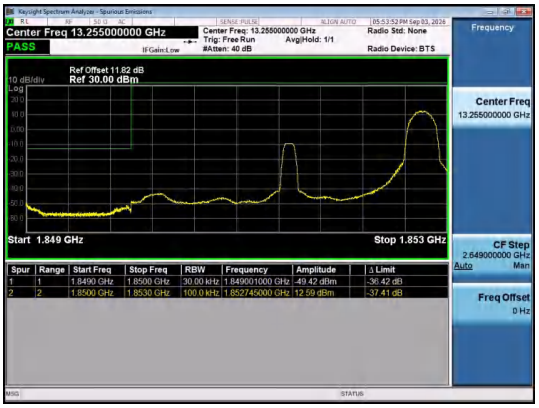


Band2-3MHz-16QAM-18615-1RB#0-PASS

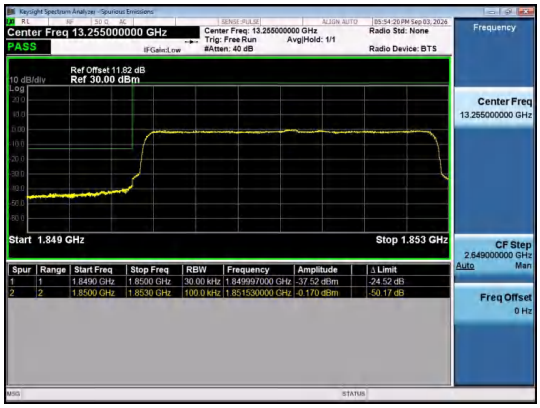


Band2-3MHz-16QAM-18615-1RB#14-PASS

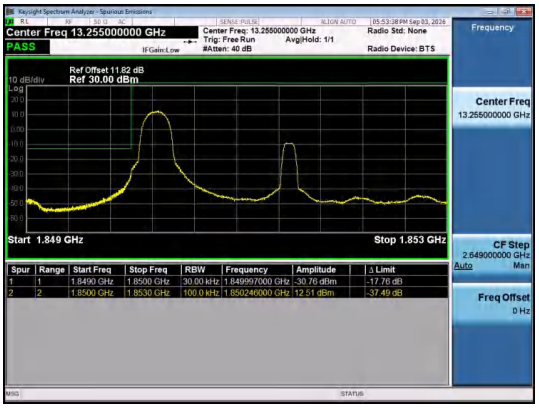


Band2-3MHz-16QAM-18615-15RB#0-PASS

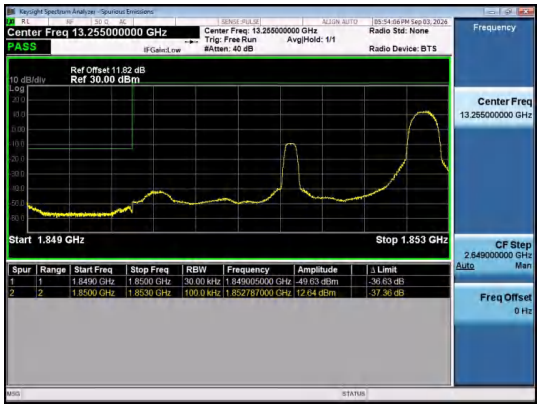

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

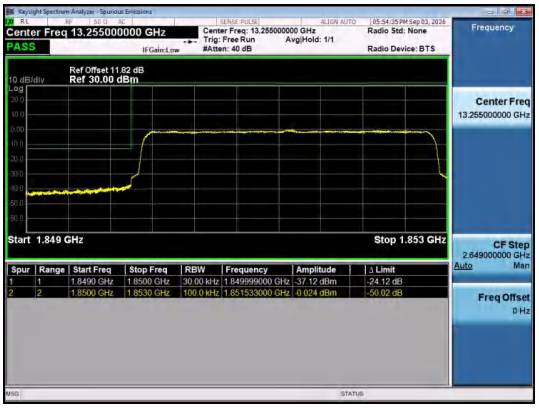Band2-3MHz-QPSK-19185-15RB#0-PASS




Band2-3MHz-16QAM-19185-1RB#0-PASS




Band2-3MHz-16QAM-19185-1RB#14-PASS

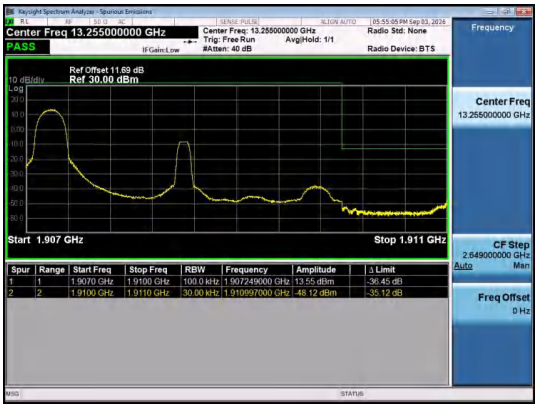


Band2-3MHz-16QAM-19185-15RB#0-PASS

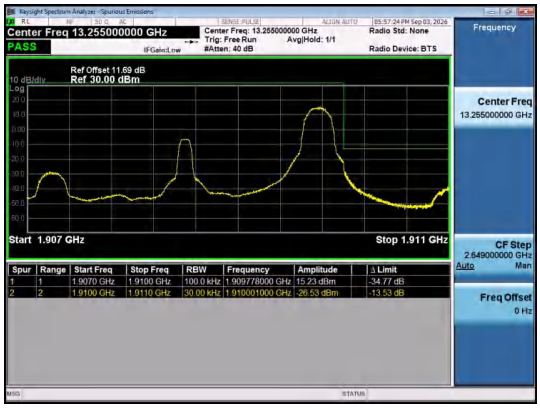


Band2-5MHz-QPSK-18625-1RB#0-PASS

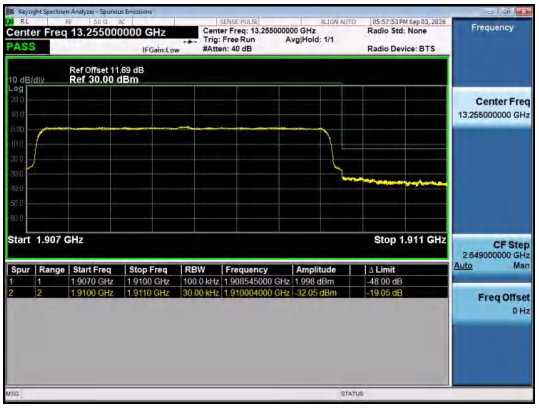


Band2-5MHz-QPSK-18625-1RB#24-PASS

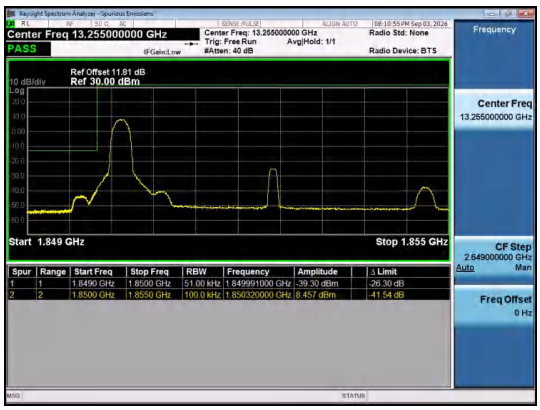

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

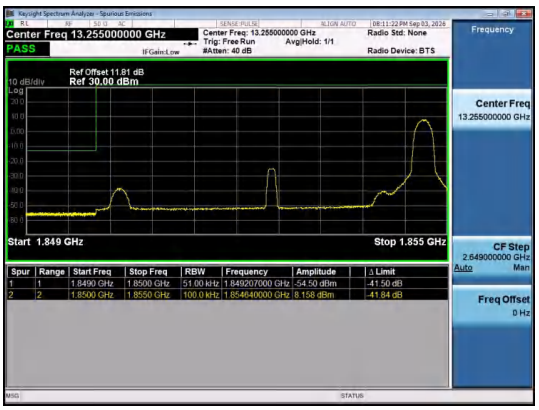


Band2-5MHz-QPSK-18625-25RB#0-PASS




Band2-5MHz-16QAM-18625-1RB#0-PASS

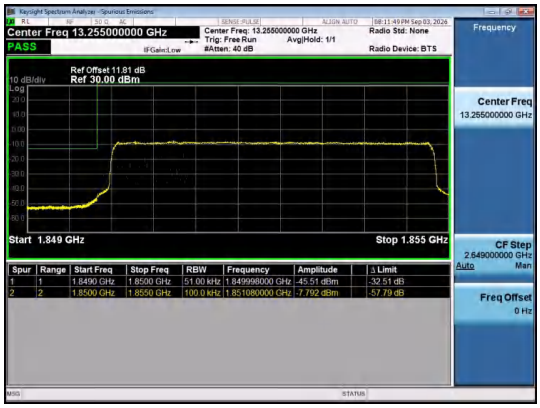


Band2-5MHz-16QAM-18625-1RB#24-PASS

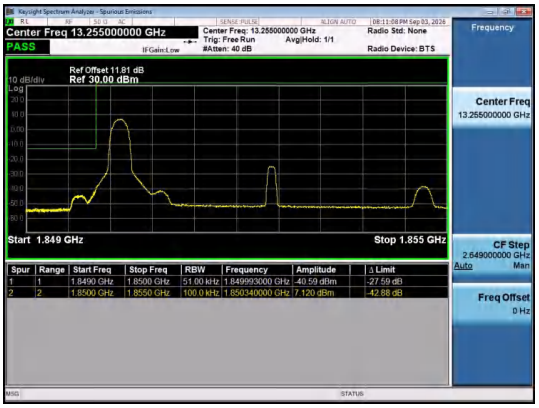


Band2-5MHz-16QAM-18625-25RB#0-PASS

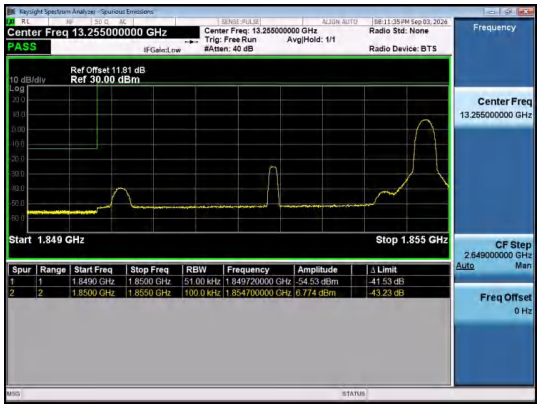


Band2-5MHz-QPSK-19175-1RB#0-PASS

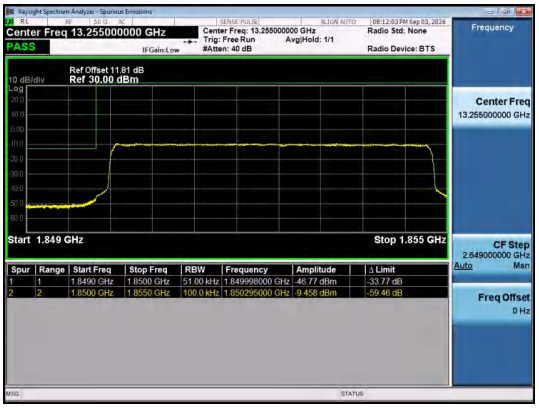


Band2-5MHz-QPSK-19175-1RB#24-PASS

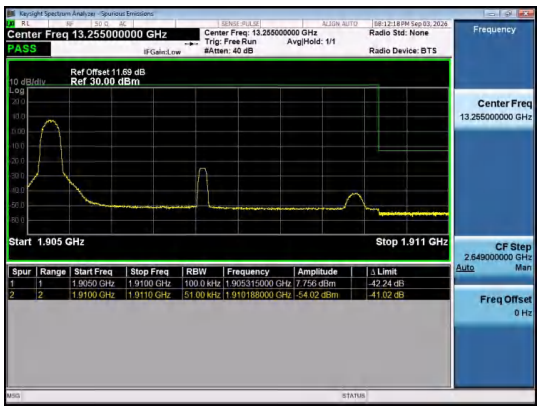

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

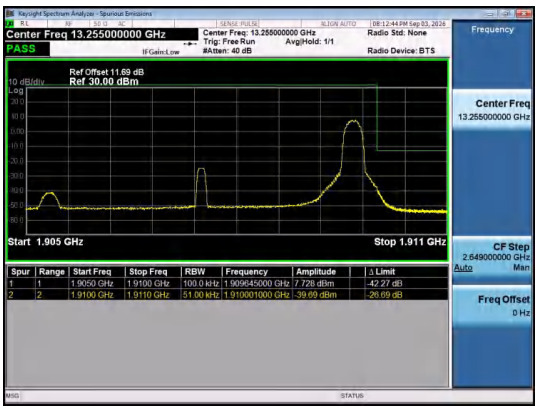


Band2-5MHz-QPSK-19175-25RB#0-PASS




Band2-5MHz-16QAM-19175-1RB#0-PASS

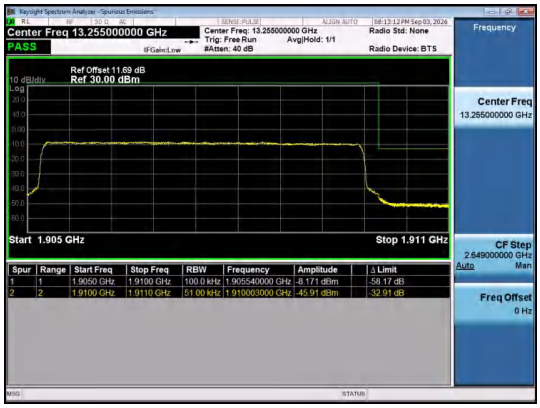


Band2-5MHz-16QAM-19175-1RB#24-PASS

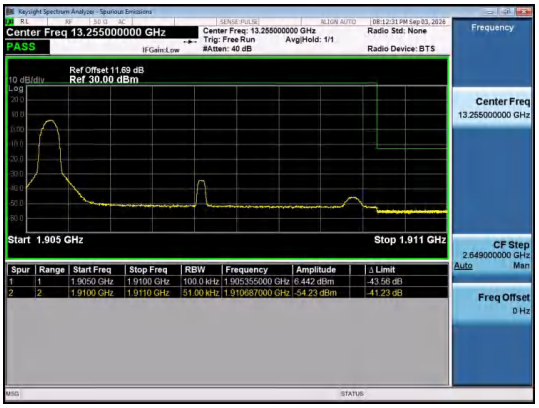


Band2-5MHz-16QAM-19175-25RB#0-PASS

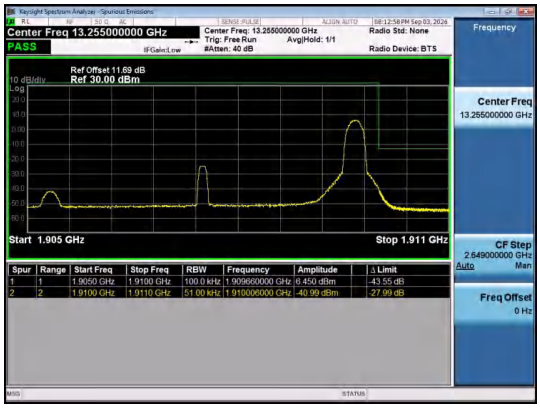


Band2-10MHz-QPSK-18650-1RB#0-PASS

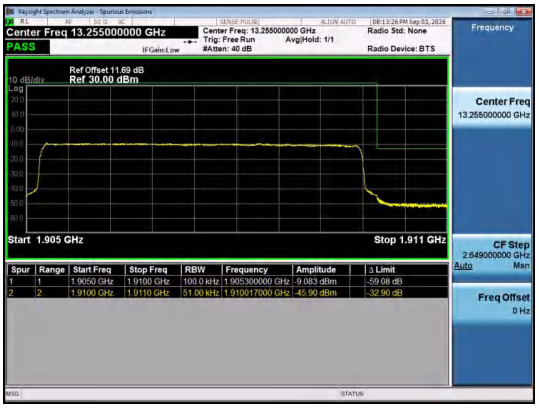


Band2-10MHz-QPSK-18650-1RB#49-PASS

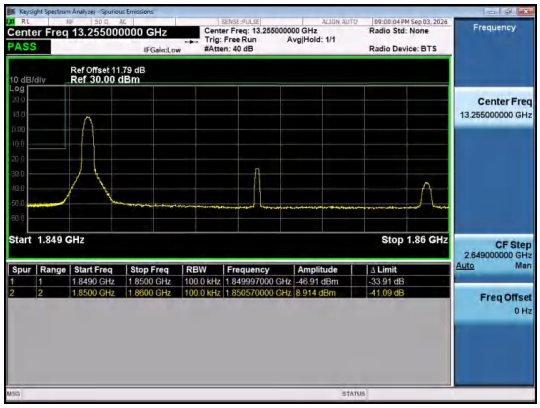

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

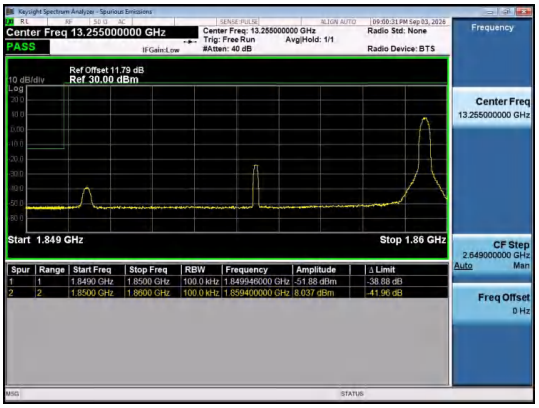


Band2-10MHz-16QAM-18650-1RB#49-PASS




Band2-10MHz-QPSK-19150-1RB#0-PASS

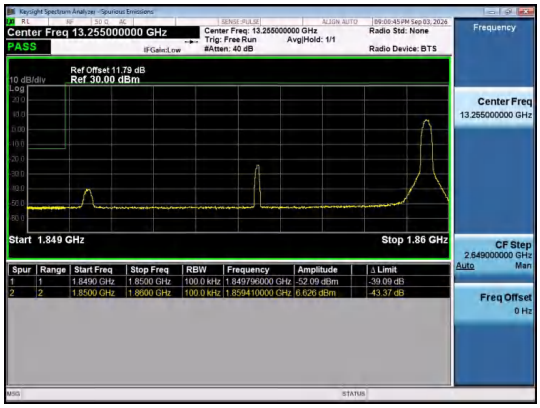


Band2-10MHz-QPSK-19150-1RB#49-PASS

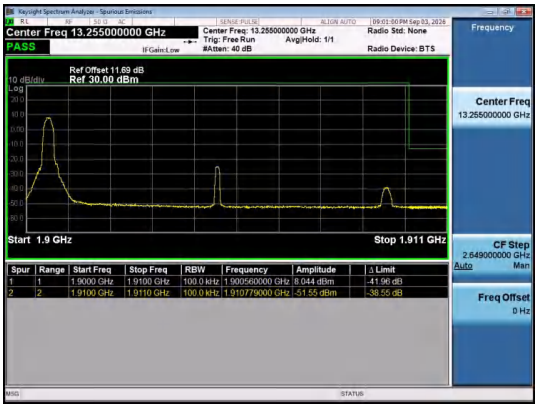


Band2-10MHz-QPSK-19150-50RB#0-PASS

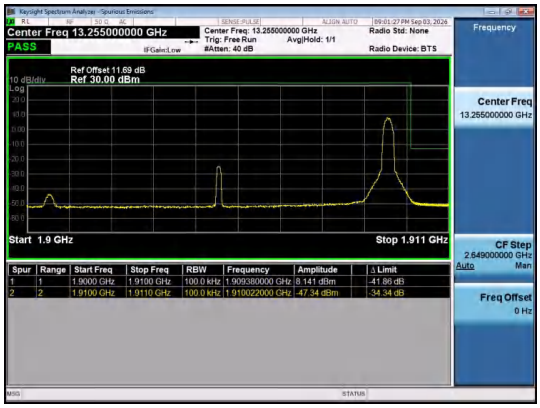


Band2-10MHz-16QAM-19150-1RB#0-PASS

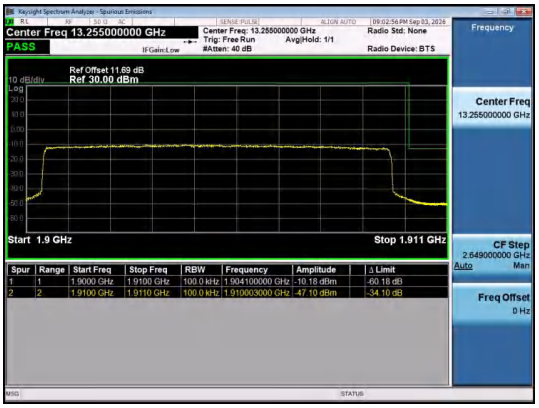


Band2-10MHz-16QAM-19150-1RB#49-PASS

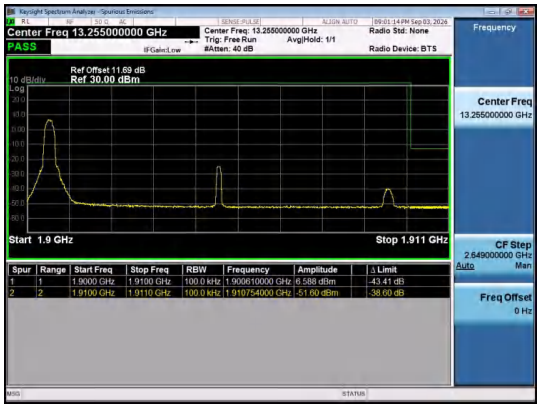

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

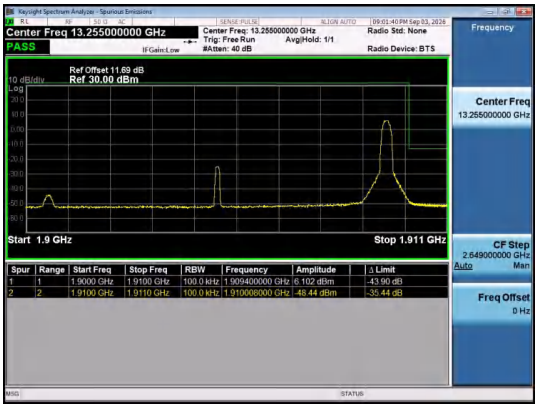


Band2-15MHz-QPSK-18675-1RB#0-PASS




Band2-15MHz-QPSK-18675-1RB#74-PASS

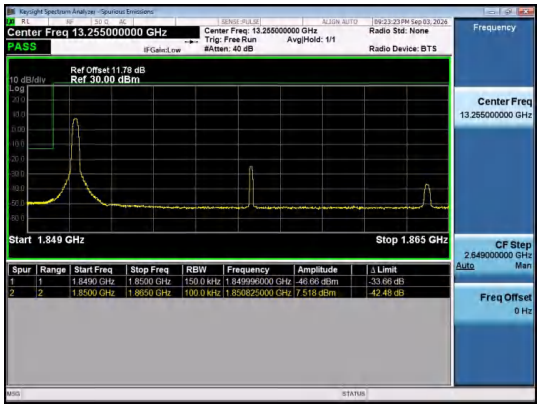


Band2-15MHz-16QAM-18675-1RB#74-PASS

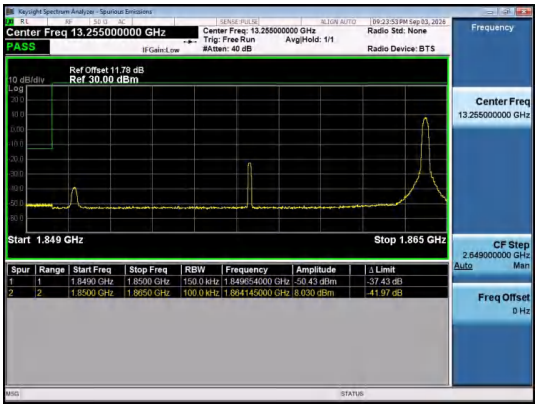


Band2-15MHz-QPSK-19125-1RB#0-PASS

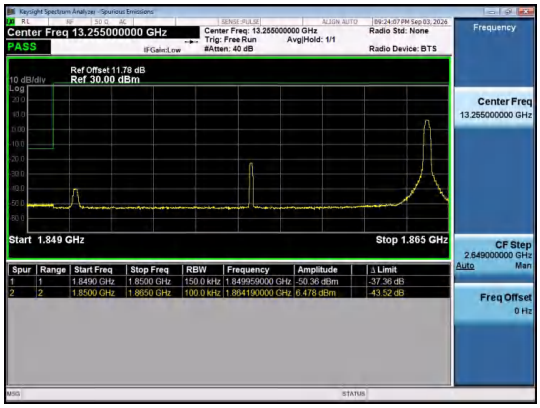


Band2-15MHz-QPSK-19125-1RB#74-PASS

Band2-15MHz-QPSK-19125-75RB#0-PASS

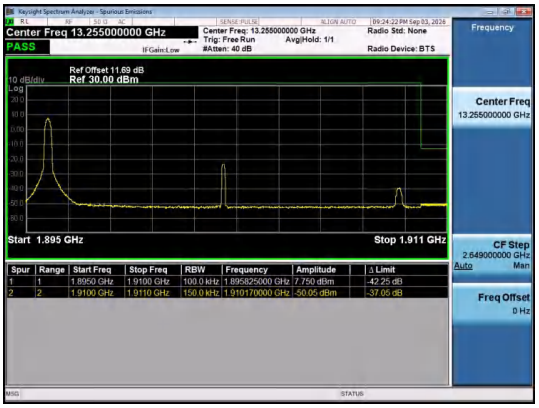

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

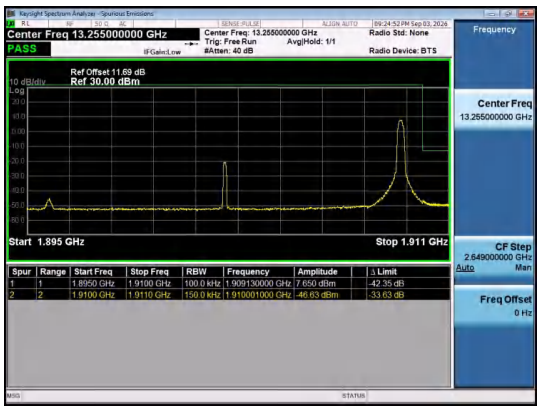Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com