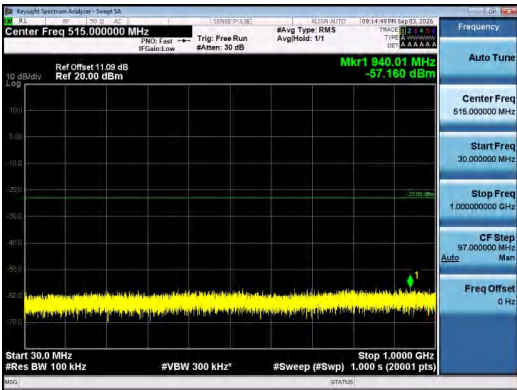
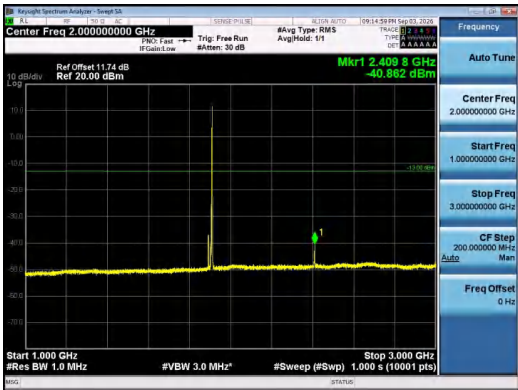
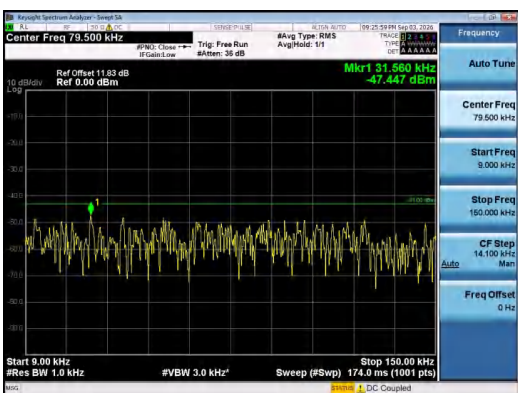
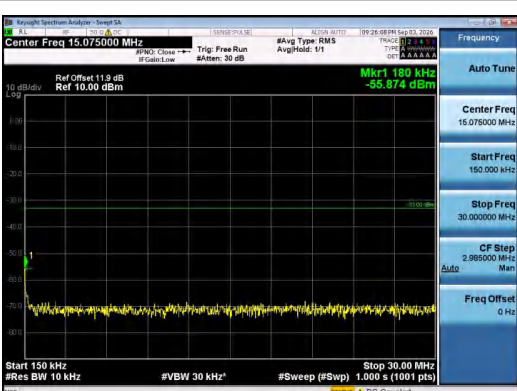
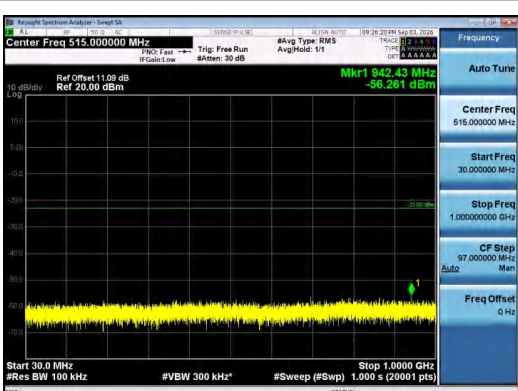
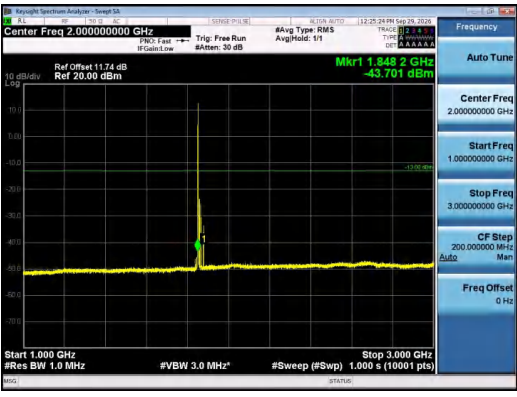
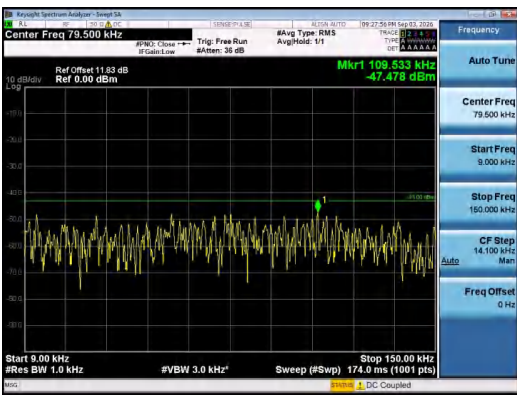
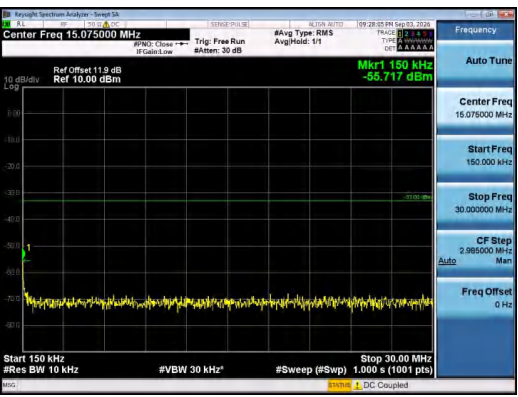
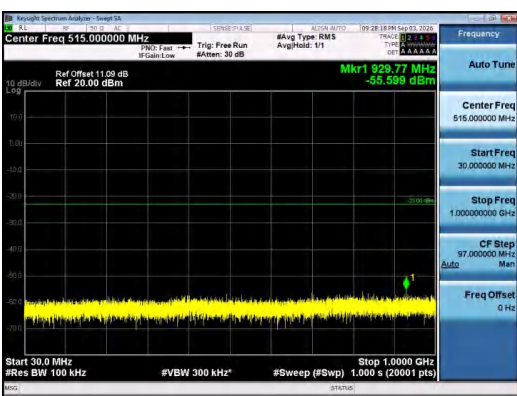
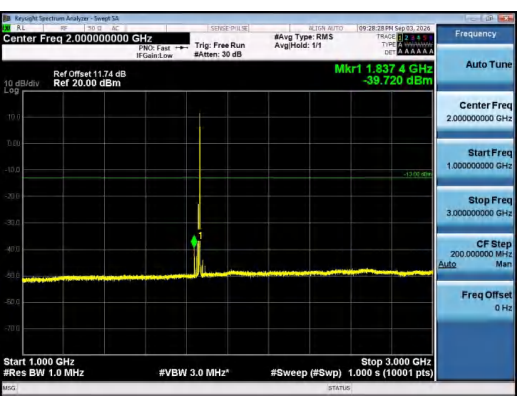
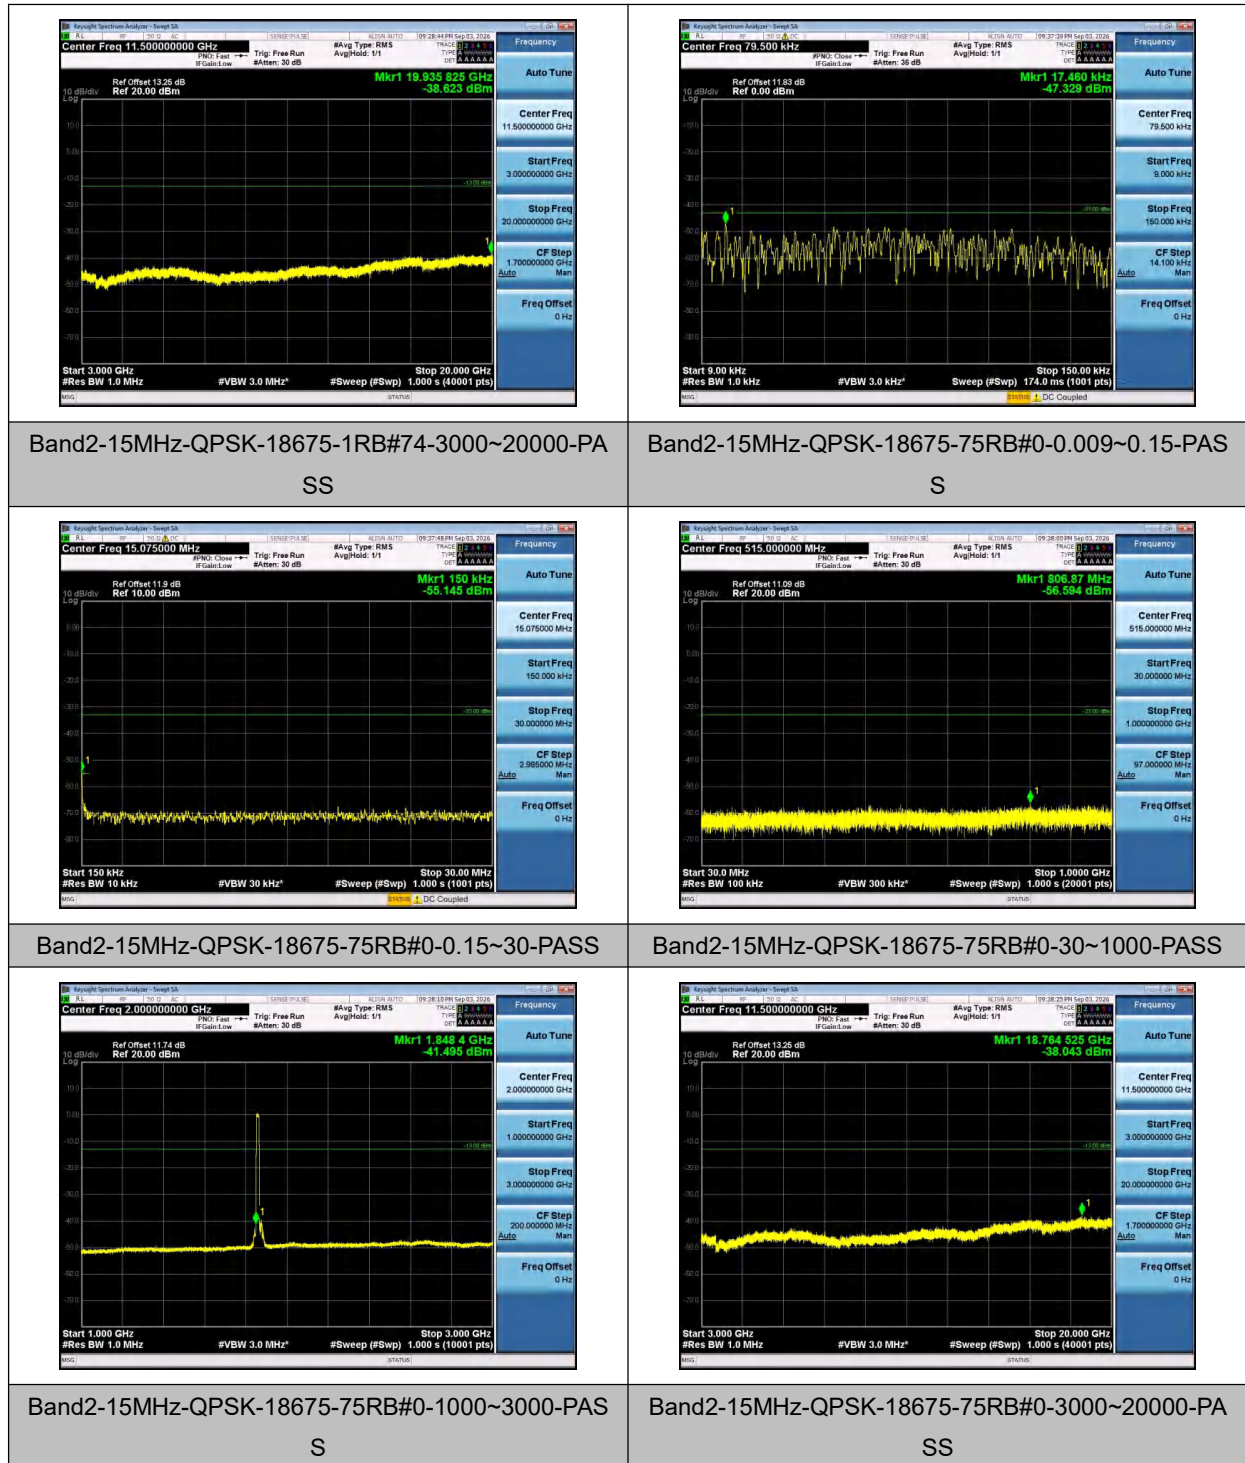
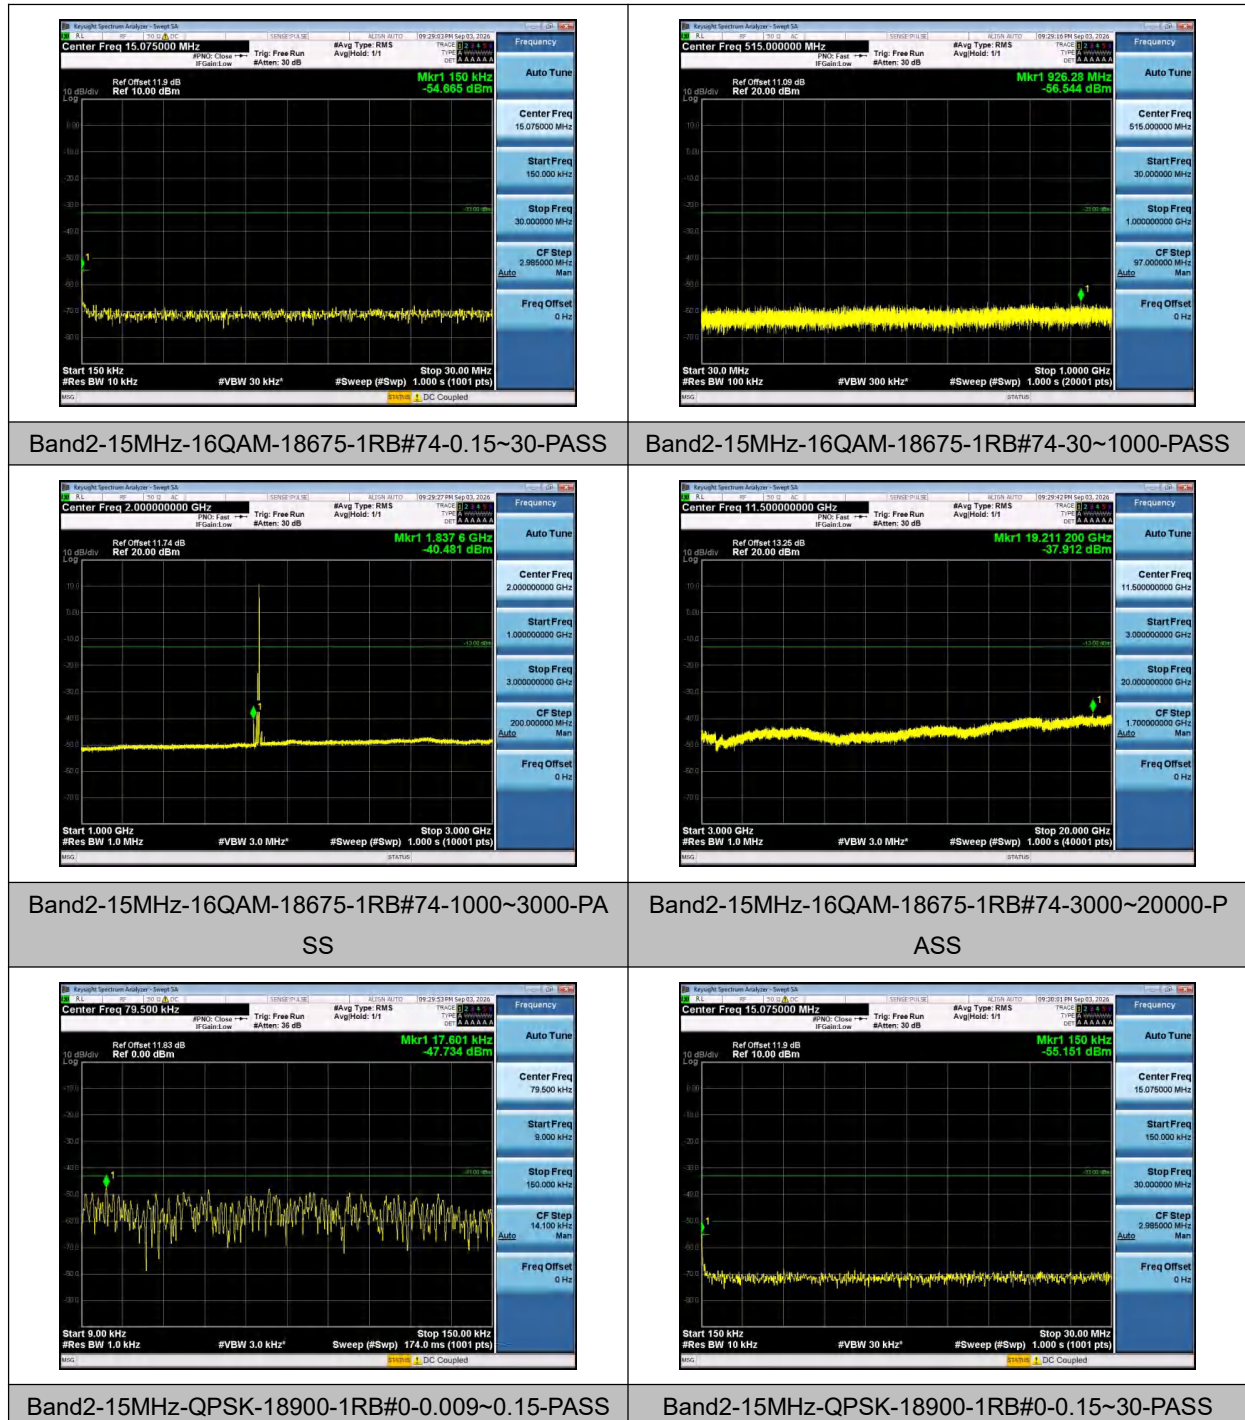


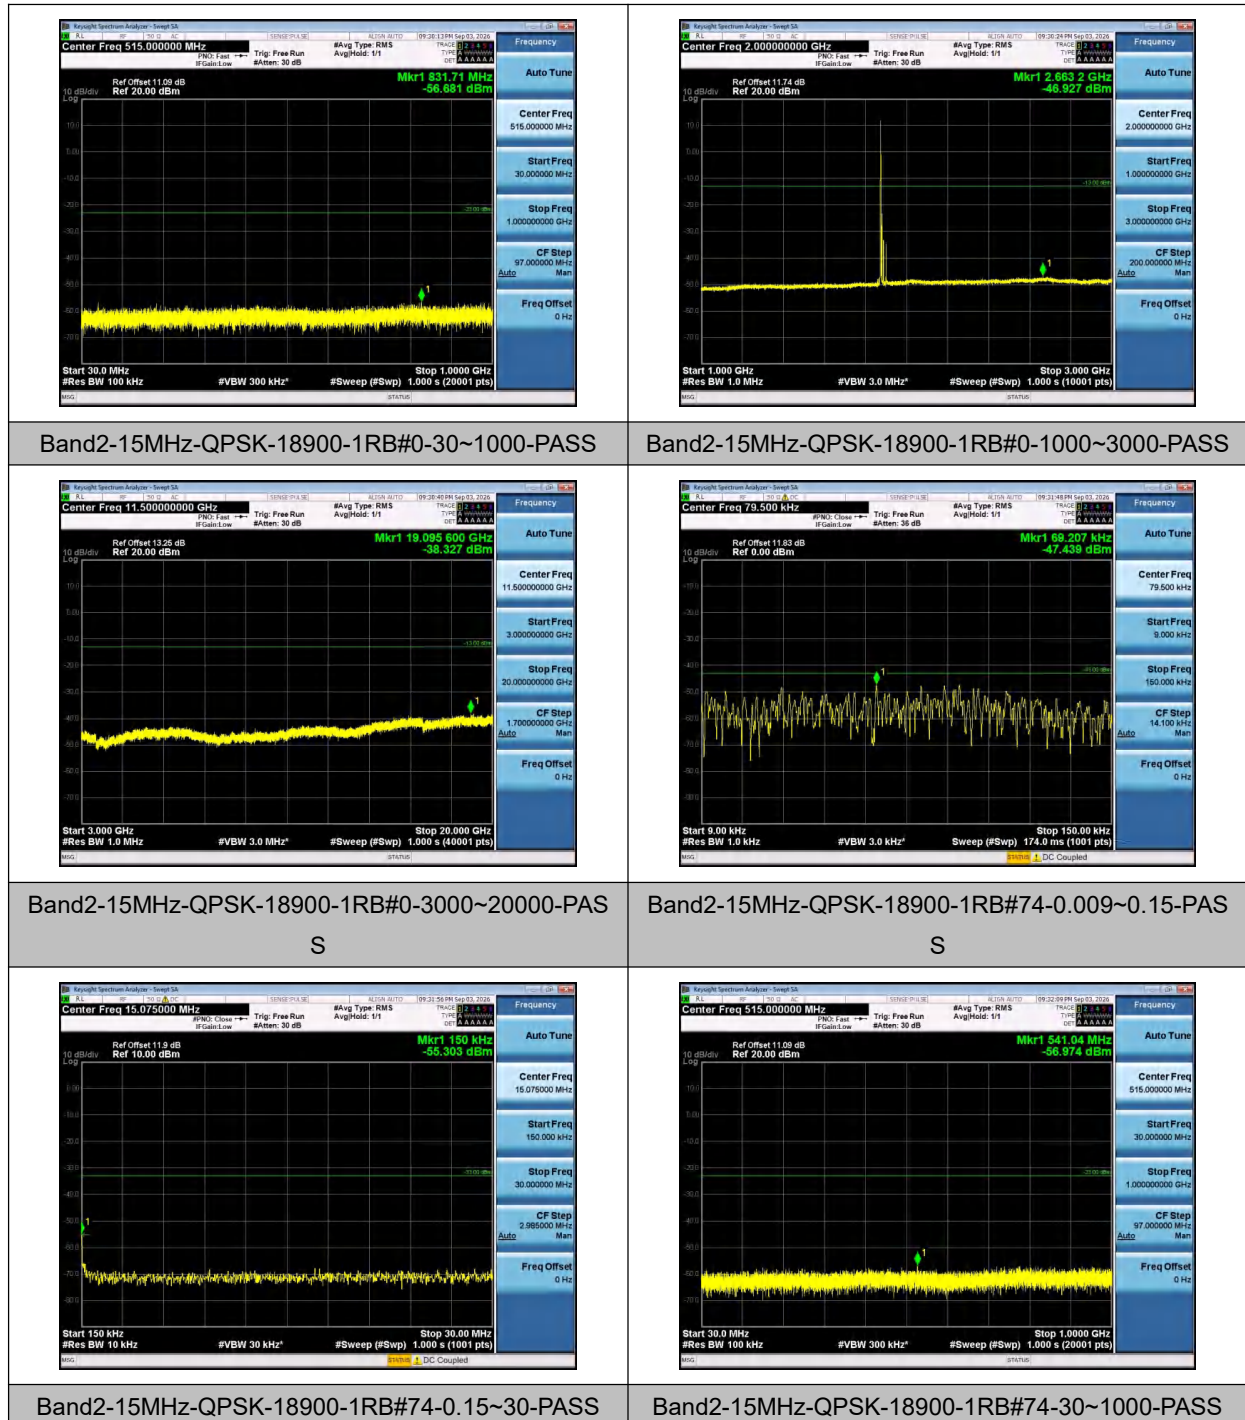
	
Band2-10MHz-16QAM-19150-1RB#49-30~1000-PASS	Band2-10MHz-16QAM-19150-1RB#49-1000~3000-PASS
	
Band2-10MHz-16QAM-19150-1RB#49-3000~20000-PASS	Band2-15MHz-QPSK-18675-1RB#0-0.009~0.15-PASS
	
Band2-15MHz-QPSK-18675-1RB#0-0.15~30-PASS	Band2-15MHz-QPSK-18675-1RB#0-30~1000-PASS

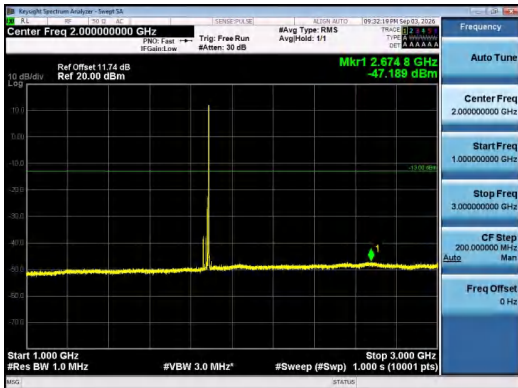
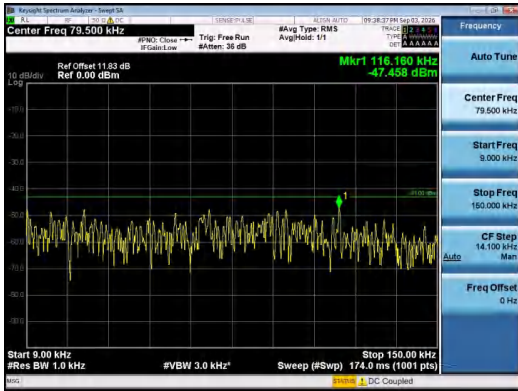
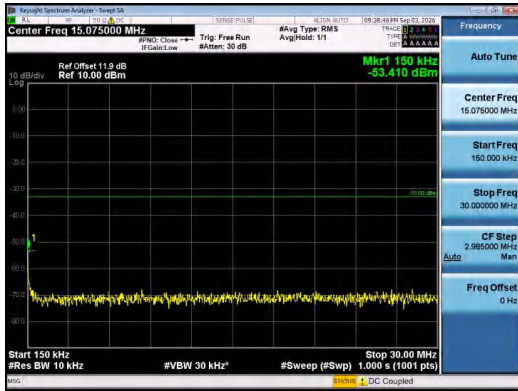
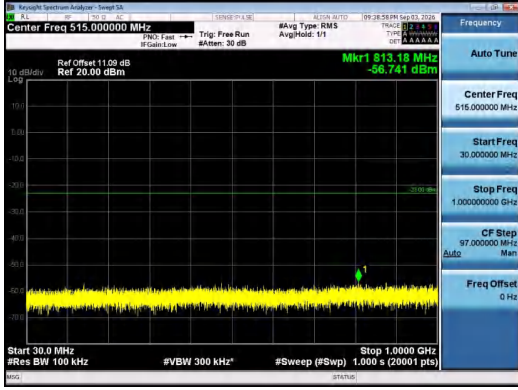
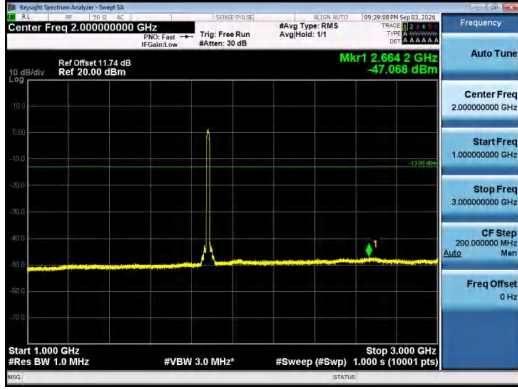
	
Band2-15MHz-QPSK-18675-1RB#0-1000~3000-PASS	Band2-15MHz-QPSK-18675-1RB#0-3000~20000-PASS S
	
Band2-15MHz-QPSK-18675-1RB#74-0.009~0.15-PASS S	Band2-15MHz-QPSK-18675-1RB#74-0.15~30-PASS
	
Band2-15MHz-QPSK-18675-1RB#74-30~1000-PASS	Band2-15MHz-QPSK-18675-1RB#74-1000~3000-PASS S

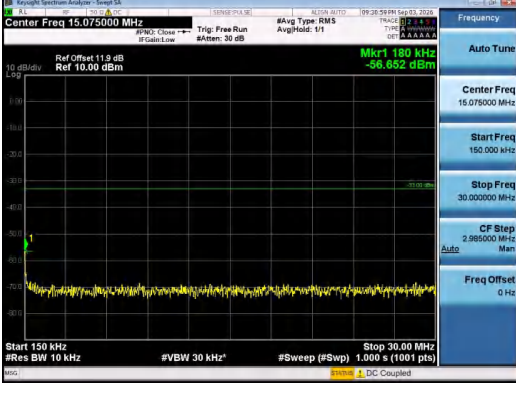
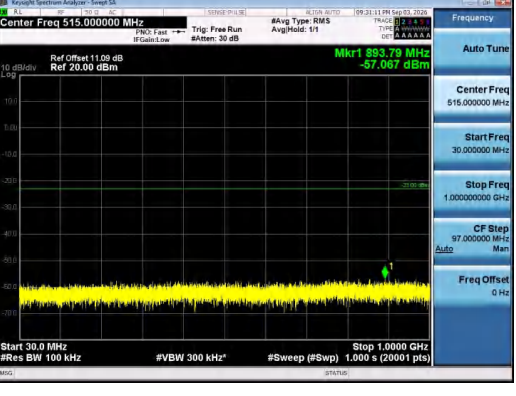
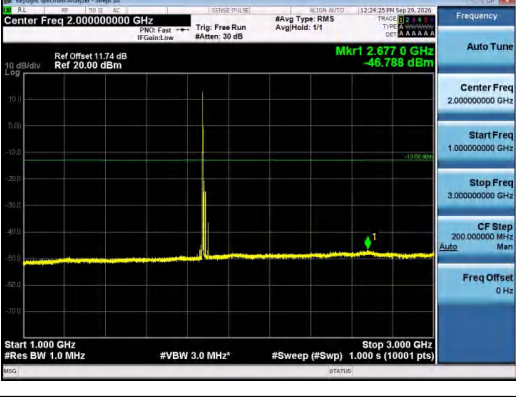


Band2-15MHz-16QAM-18675-1RB#0-0.009~0.15-PAS S	Band2-15MHz-16QAM-18675-1RB#0-0.15~30-PASS
Band2-15MHz-16QAM-18675-1RB#0-30~1000-PASS	Band2-15MHz-16QAM-18675-1RB#0-1000~3000-PAS S
Band2-15MHz-16QAM-18675-1RB#0-3000~20000-PA SS	Band2-15MHz-16QAM-18675-1RB#74-0.009~0.15-PA SS

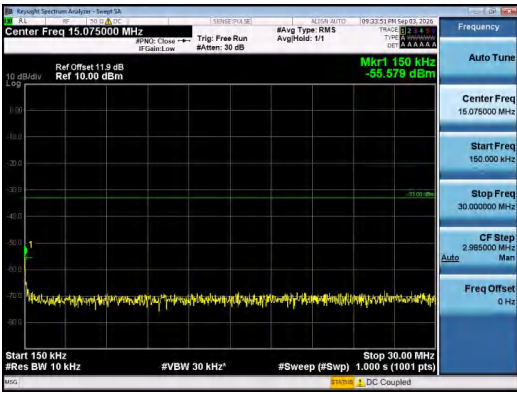
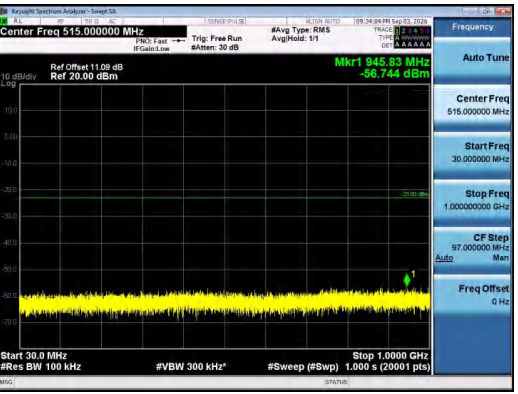
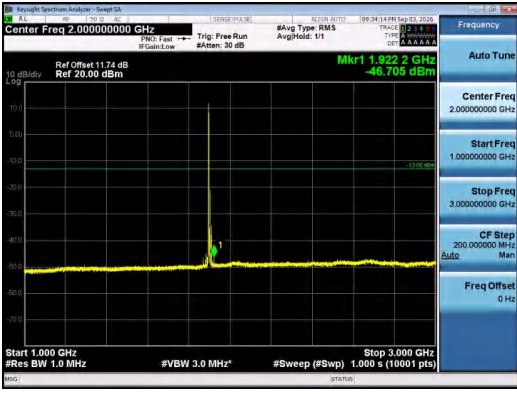
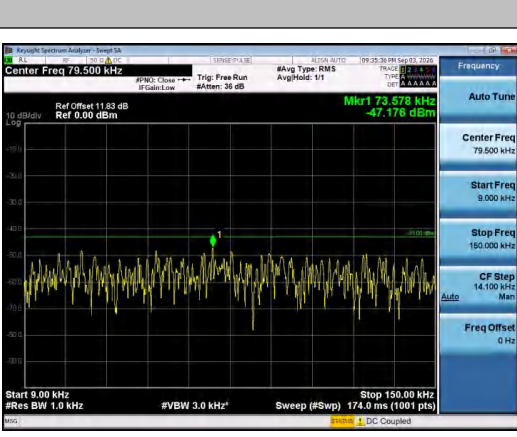
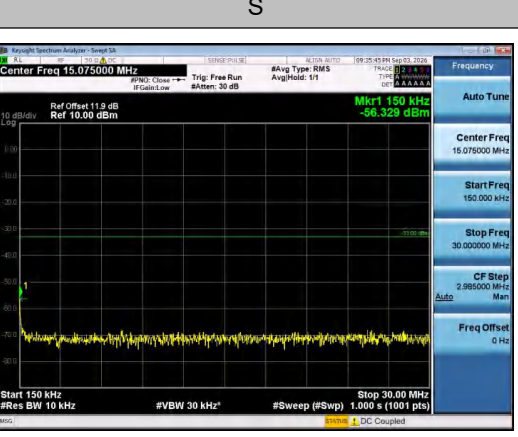


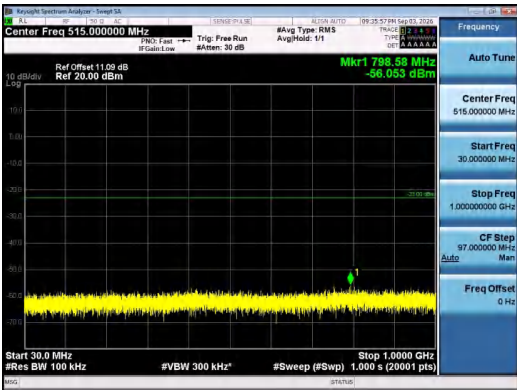
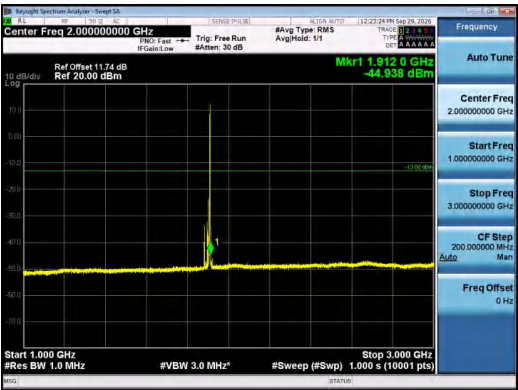
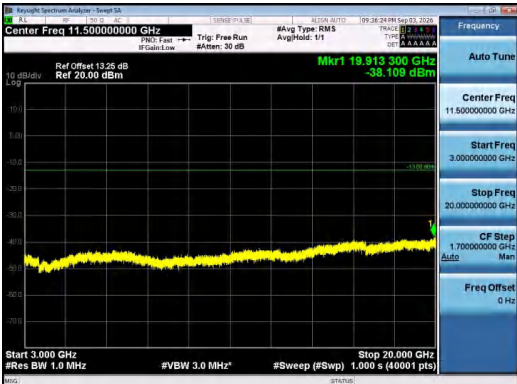
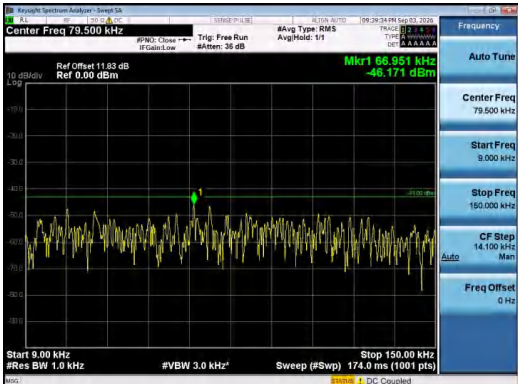
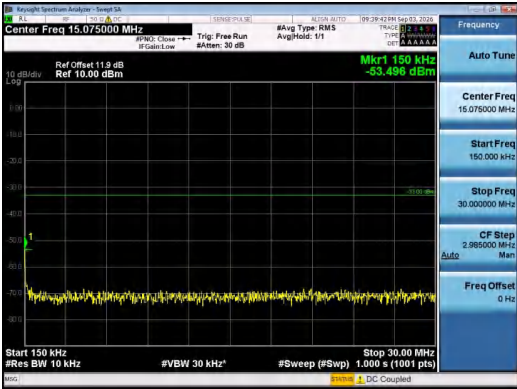
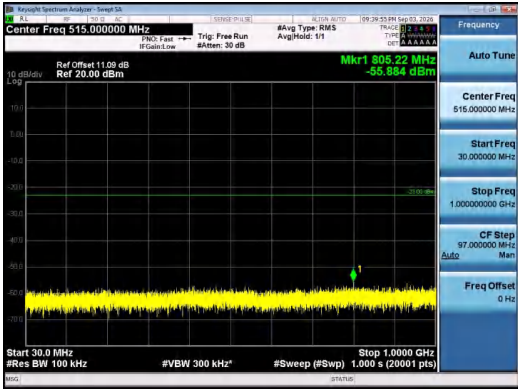


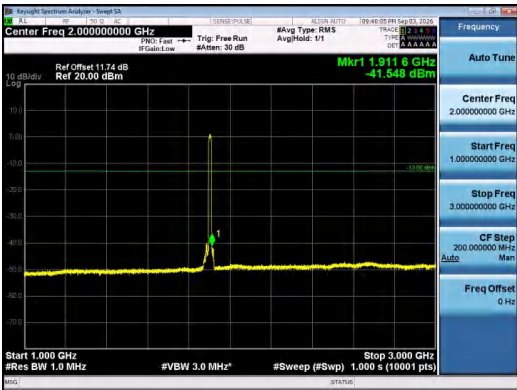
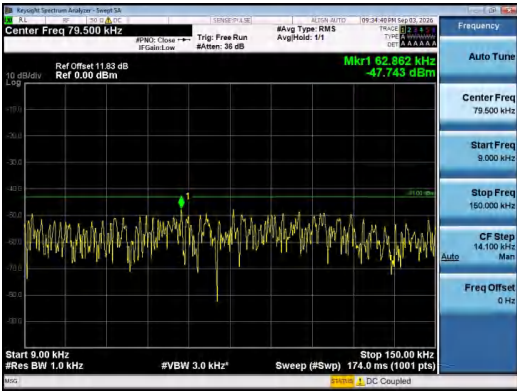
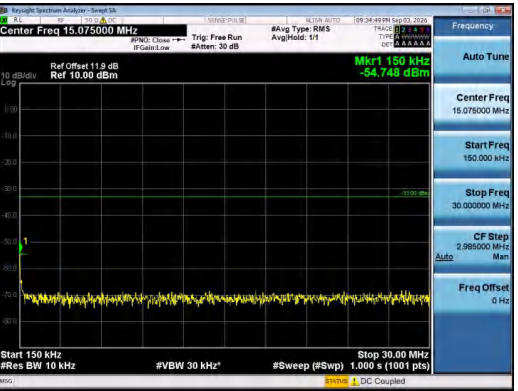
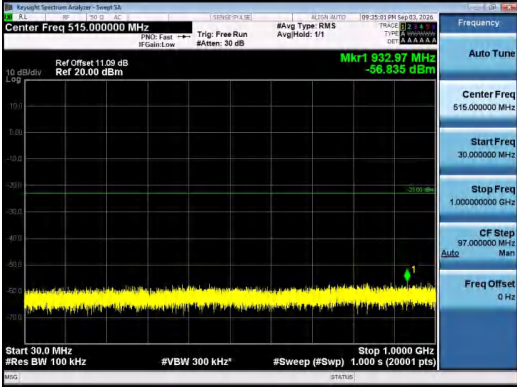
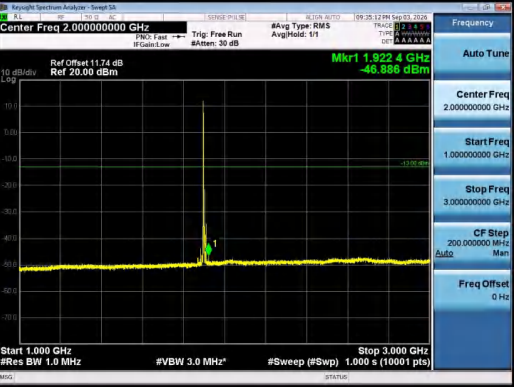
	
Band2-15MHz-QPSK-18900-1RB#74-1000~3000-PAS S	Band2-15MHz-QPSK-18900-1RB#74-3000~20000-PA SS
	
Band2-15MHz-QPSK-18900-75RB#0-0.009~0.15-PAS S	Band2-15MHz-QPSK-18900-75RB#0-0.15~30-PASS
	
Band2-15MHz-QPSK-18900-75RB#0-30~1000-PASS	Band2-15MHz-QPSK-18900-75RB#0-1000~3000-PAS S

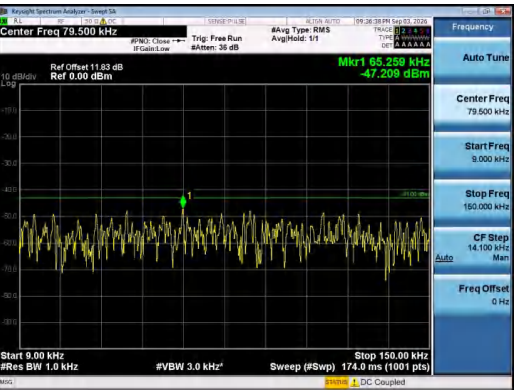
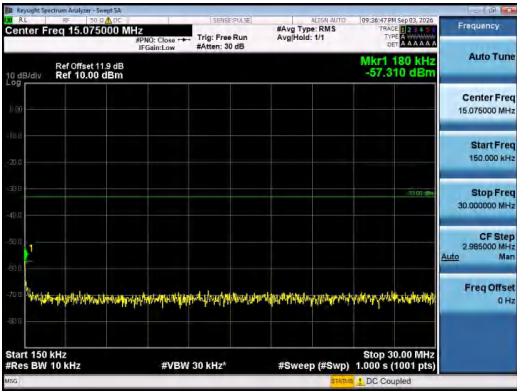
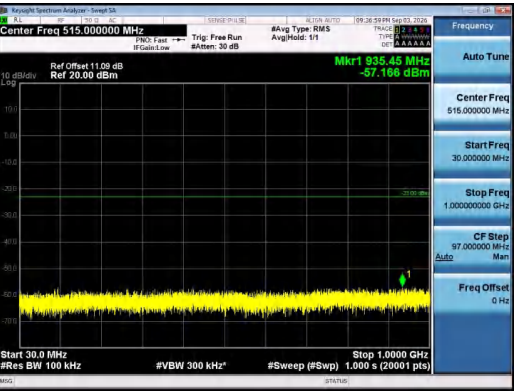
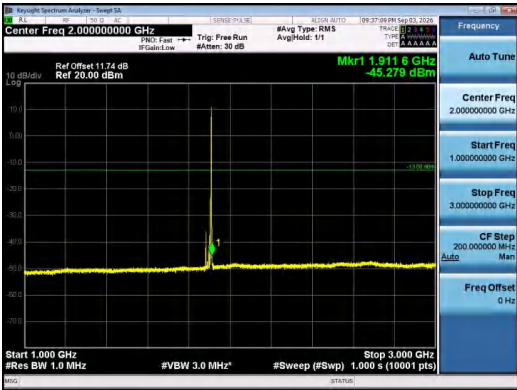
	
Band2-15MHz-QPSK-18900-75RB#0-3000~20000-PA SS	Band2-15MHz-16QAM-18900-1RB#0-0.009~0.15-PAS S
	
Band2-15MHz-16QAM-18900-1RB#0-0.15~30-PASS	Band2-15MHz-16QAM-18900-1RB#0-30~1000-PASS
	
Band2-15MHz-16QAM-18900-1RB#0-1000~3000-PAS S	Band2-15MHz-16QAM-18900-1RB#0-3000~20000-PA SS

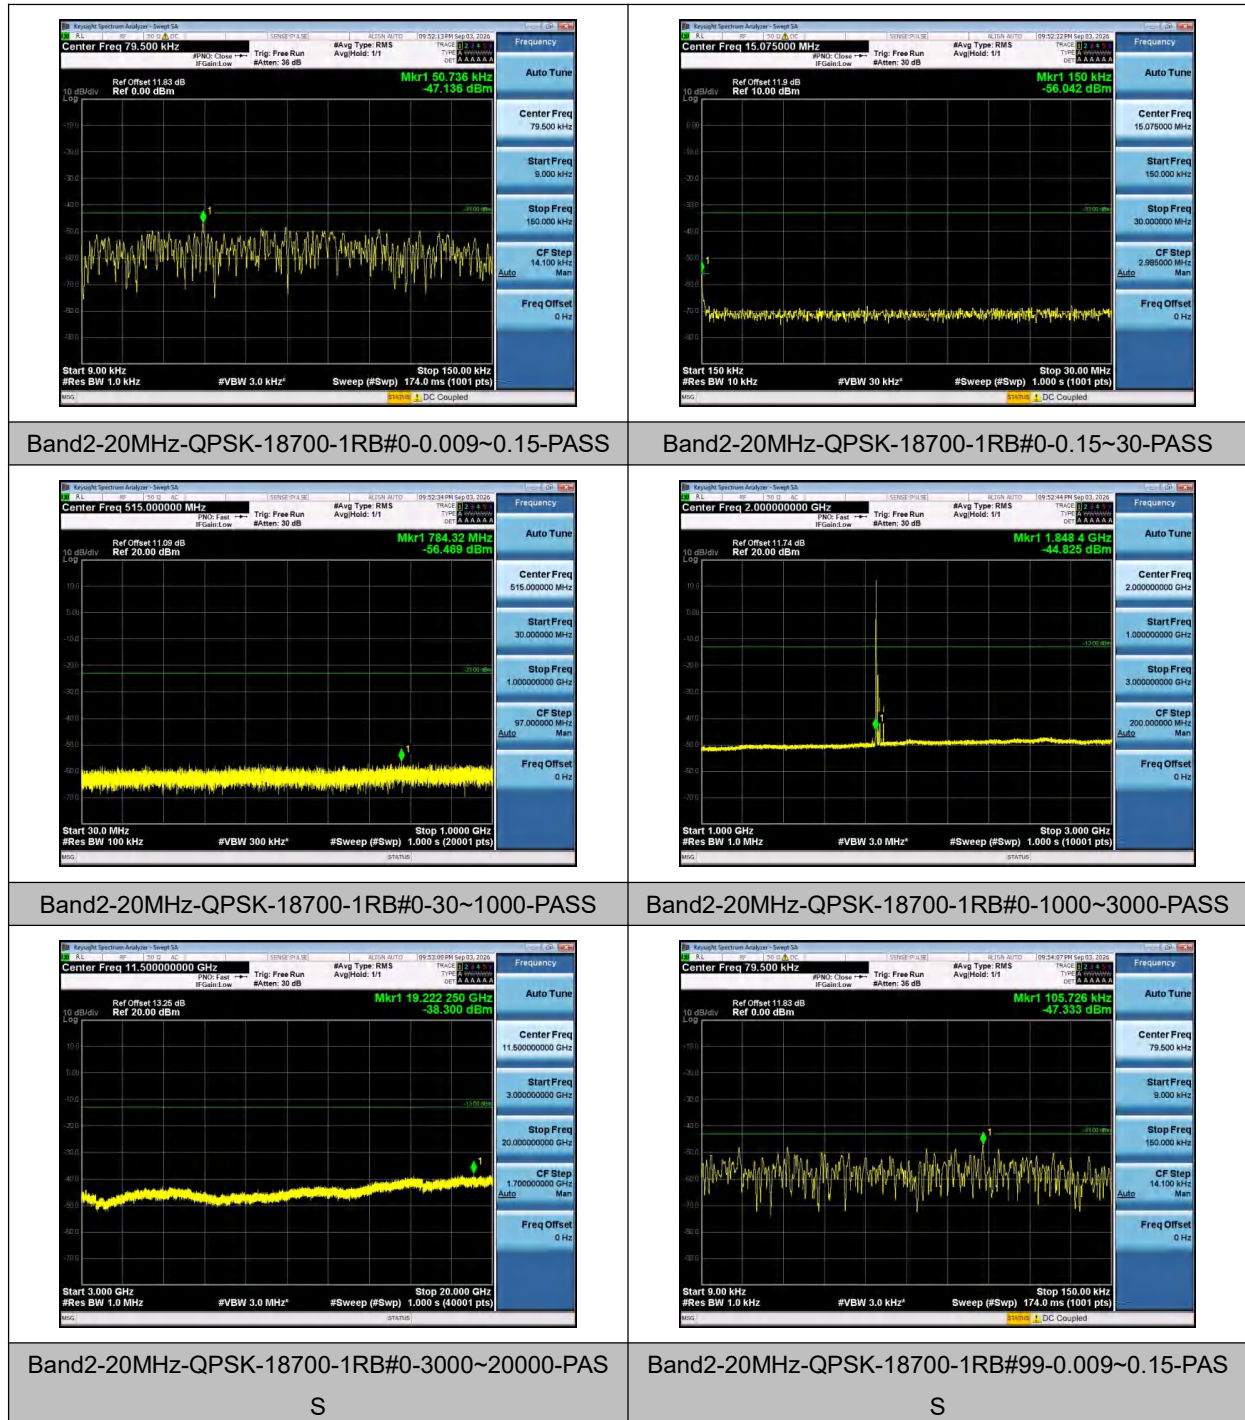
Band2-15MHz-16QAM-18900-1RB#74-0.009~0.15-PA SS	Band2-15MHz-16QAM-18900-1RB#74-0.15~30-PASS
Band2-15MHz-16QAM-18900-1RB#74-30~1000-PASS	Band2-15MHz-16QAM-18900-1RB#74-1000~3000-PA SS
Band2-15MHz-16QAM-18900-1RB#74-3000~20000-P ASS	Band2-15MHz-QPSK-19125-1RB#0-0.009~0.15-PASS

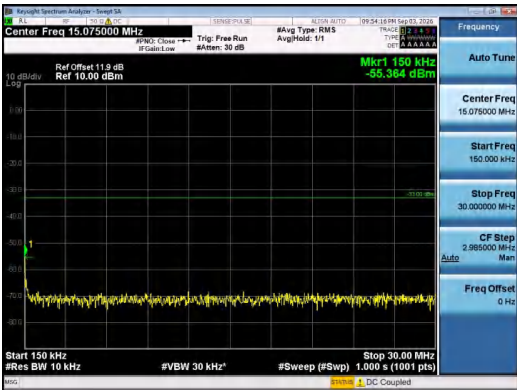
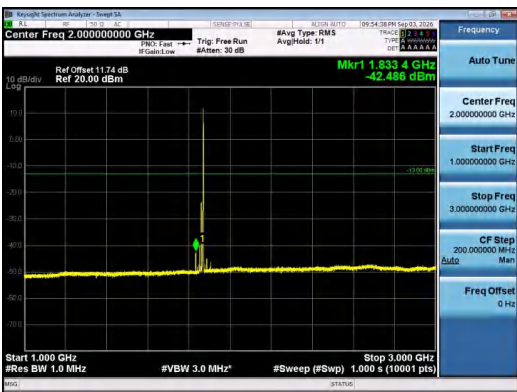
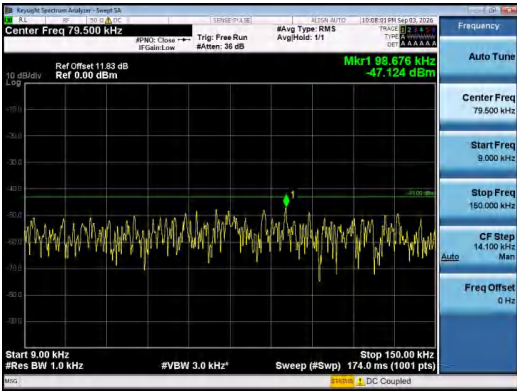
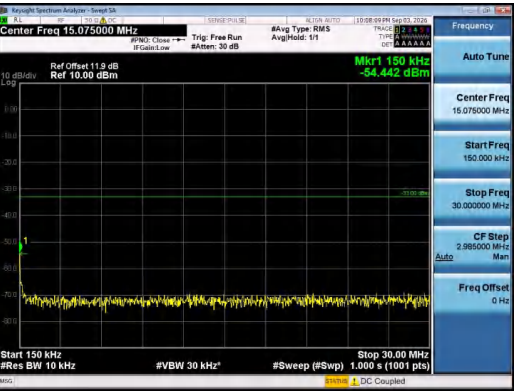
	
Band2-15MHz-QPSK-19125-1RB#0-0.15~30-PASS	Band2-15MHz-QPSK-19125-1RB#0-30~1000-PASS
	
Band2-15MHz-QPSK-19125-1RB#0-1000~3000-PASS	Band2-15MHz-QPSK-19125-1RB#0-3000~20000-PASS
	
Band2-15MHz-QPSK-19125-1RB#74-0.009~0.15-PASS	Band2-15MHz-QPSK-19125-1RB#74-0.15~30-PASS

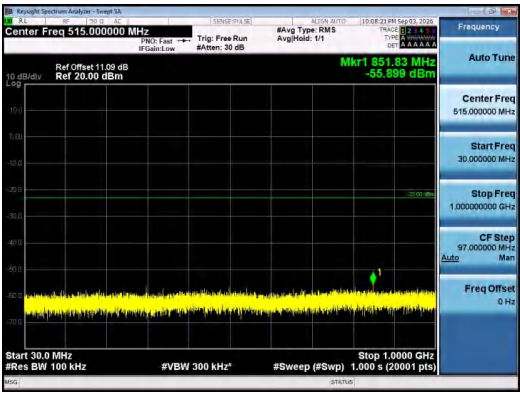
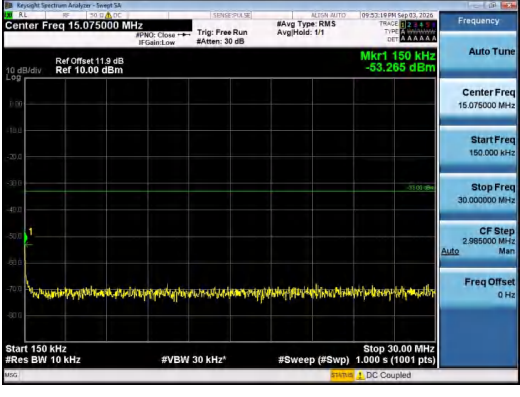
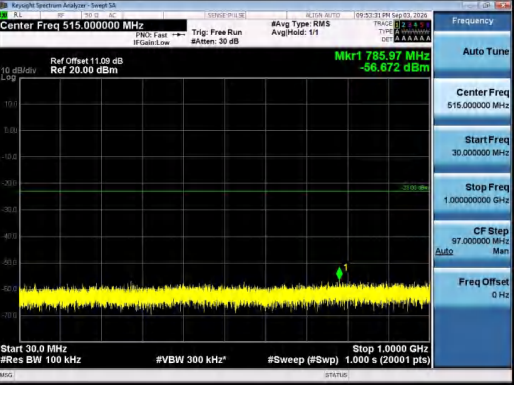
	
Band2-15MHz-QPSK-19125-1RB#74-30~1000-PASS	Band2-15MHz-QPSK-19125-1RB#74-1000~3000-PASS
	
Band2-15MHz-QPSK-19125-1RB#74-3000~20000-PASS	Band2-15MHz-QPSK-19125-75RB#0-0.009~0.15-PASS
	
Band2-15MHz-QPSK-19125-75RB#0-0.15~30-PASS	Band2-15MHz-QPSK-19125-75RB#0-30~1000-PASS

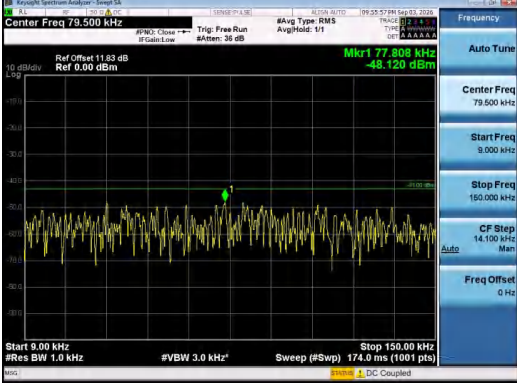
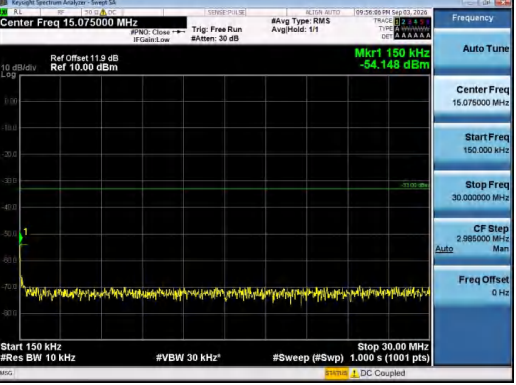
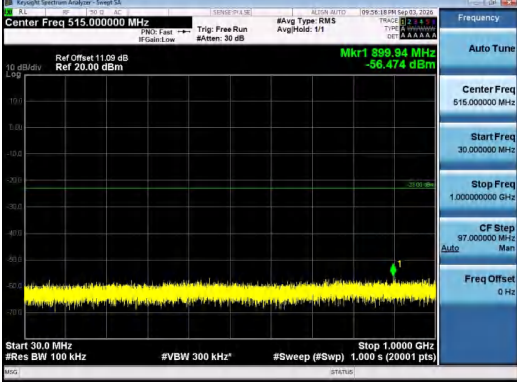
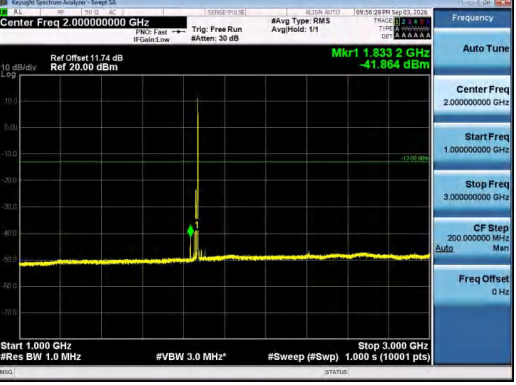
	
Band2-15MHz-QPSK-19125-75RB#0-1000~3000-PAS S	Band2-15MHz-QPSK-19125-75RB#0-3000~20000-PA SS
	
Band2-15MHz-16QAM-19125-1RB#0-0.009~0.15-PAS S	Band2-15MHz-16QAM-19125-1RB#0-0.15~30-PASS
	
Band2-15MHz-16QAM-19125-1RB#0-30~1000-PASS	Band2-15MHz-16QAM-19125-1RB#0-1000~3000-PAS S

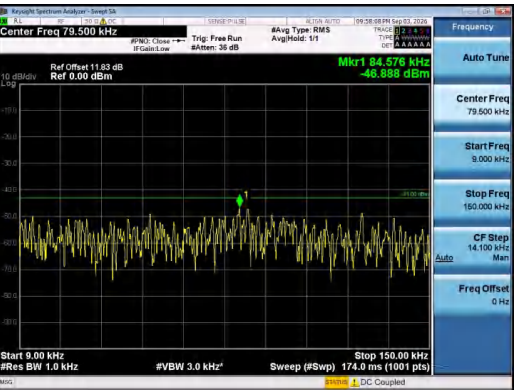
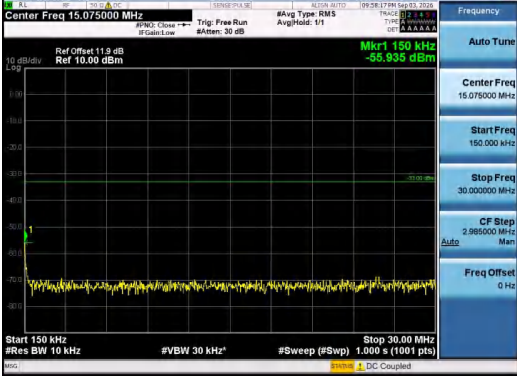
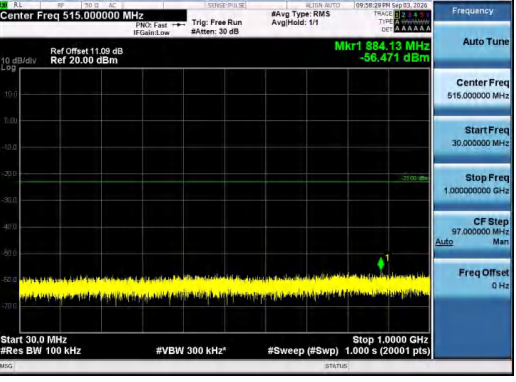
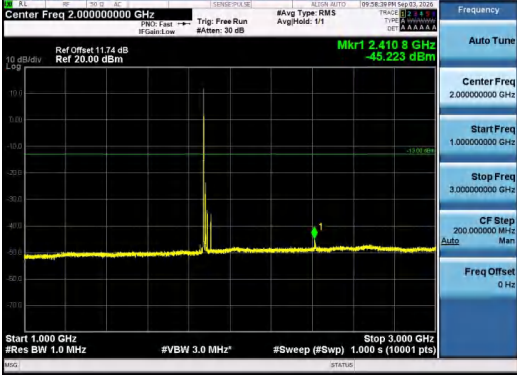
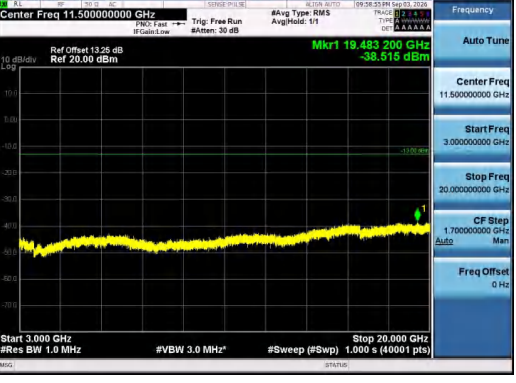
	
Band2-15MHz-16QAM-19125-1RB#0-3000~20000-PA SS	Band2-15MHz-16QAM-19125-1RB#74-0.009~0.15-PA SS
	
Band2-15MHz-16QAM-19125-1RB#74-0.15~30-PASS	Band2-15MHz-16QAM-19125-1RB#74-30~1000-PASS
	
Band2-15MHz-16QAM-19125-1RB#74-1000~3000-PA SS	Band2-15MHz-16QAM-19125-1RB#74-3000~20000-P ASS



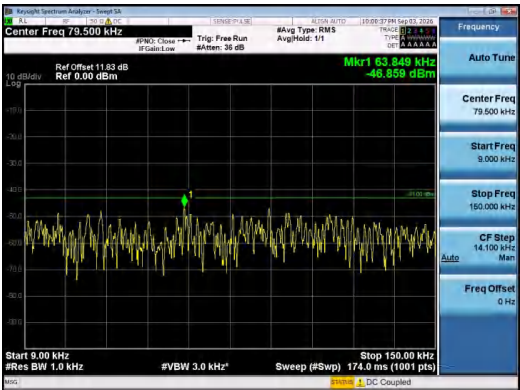
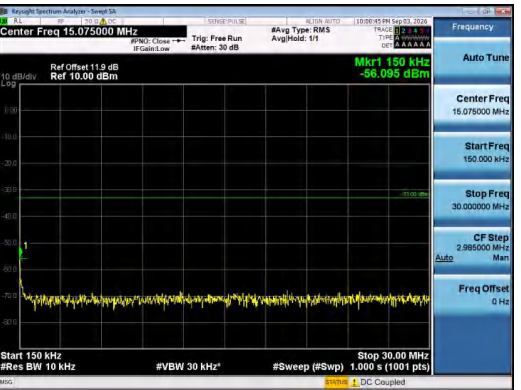
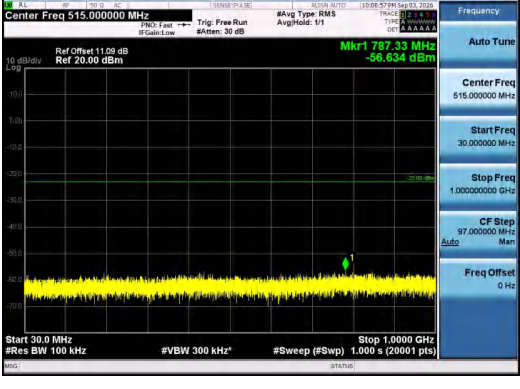
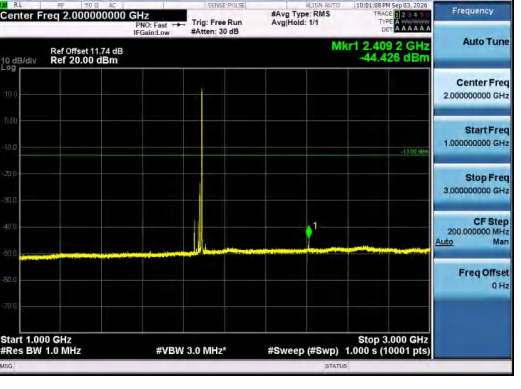
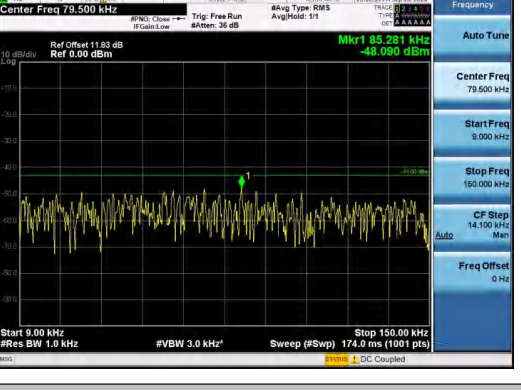
	
Band2-20MHz-QPSK-18700-1RB#99-0.15~30-PASS	Band2-20MHz-QPSK-18700-1RB#99-30~1000-PASS
	
Band2-20MHz-QPSK-18700-1RB#99-1000~3000-PAS S	Band2-20MHz-QPSK-18700-1RB#99-3000~20000-PA SS
	
Band2-20MHz-QPSK-18700-100RB#0-0.009~0.15-PA SS	Band2-20MHz-QPSK-18700-100RB#0-0.15~30-PASS

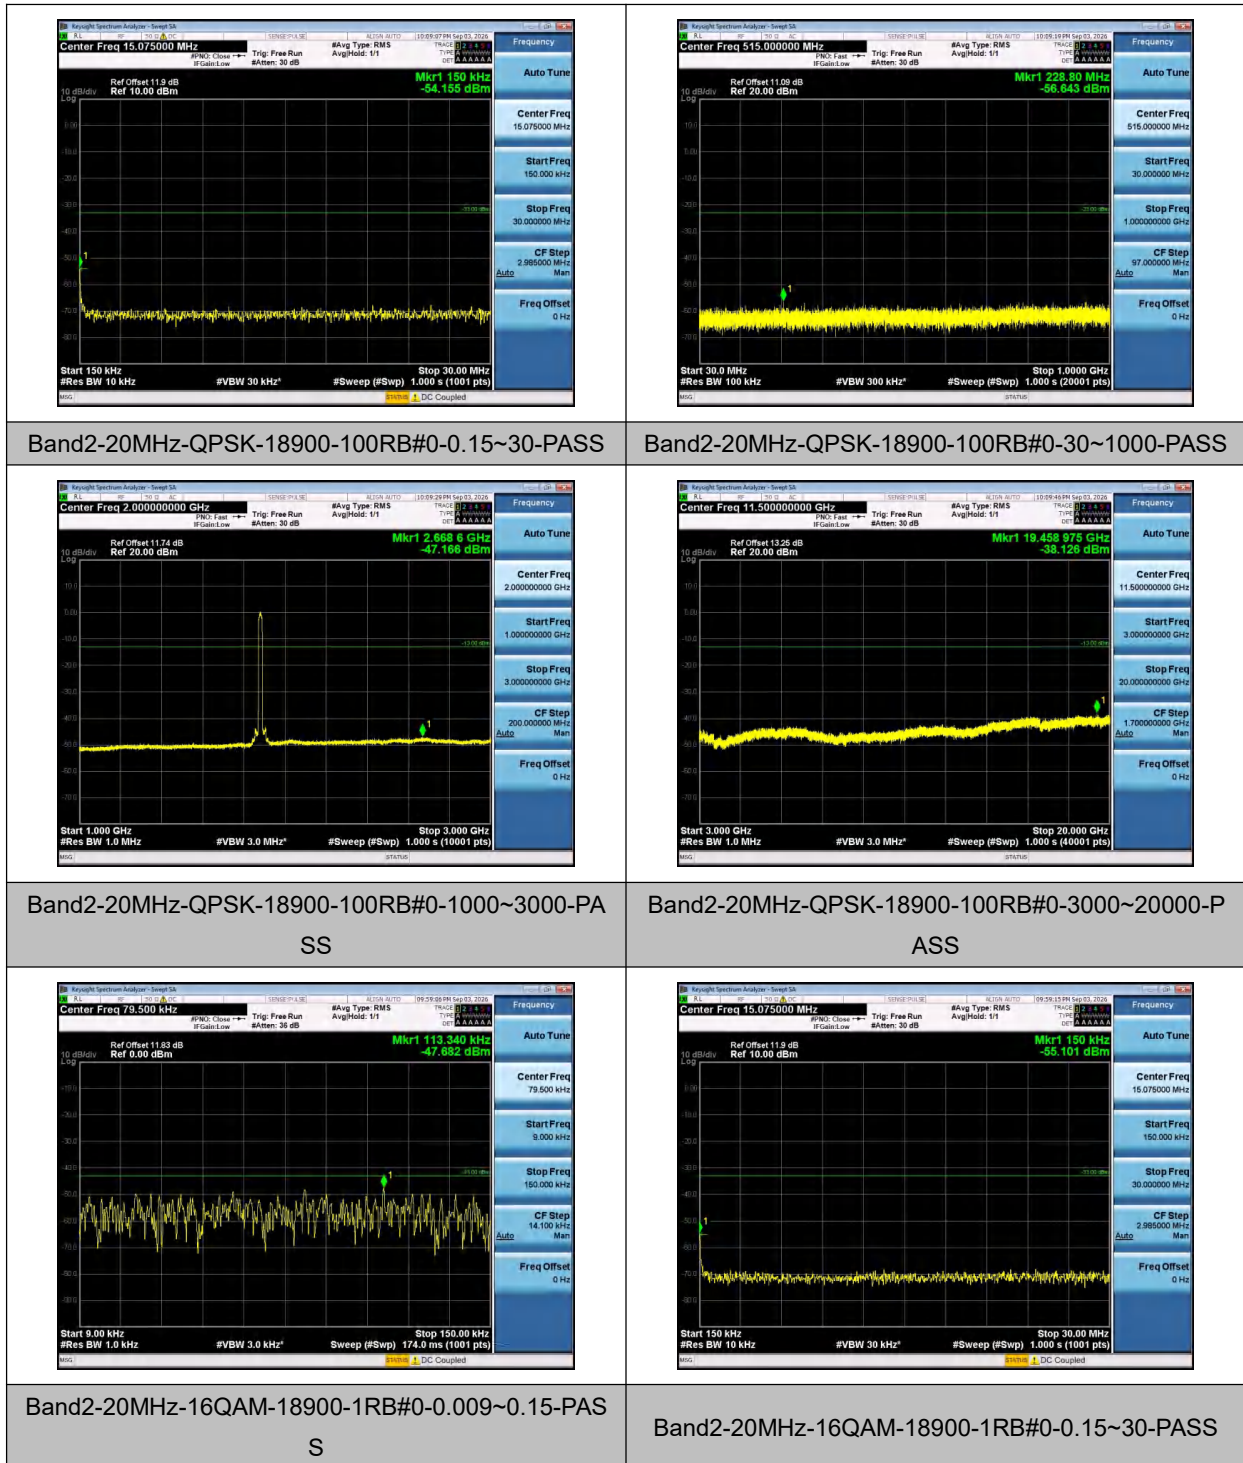
	
Band2-20MHz-QPSK-18700-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-18700-100RB#0-1000~3000-PA SS
	
Band2-20MHz-QPSK-18700-100RB#0-3000~20000-P ASS	Band2-20MHz-16QAM-18700-1RB#0-0.009~0.15-PAS S
	
Band2-20MHz-16QAM-18700-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-18700-1RB#0-30~1000-PASS

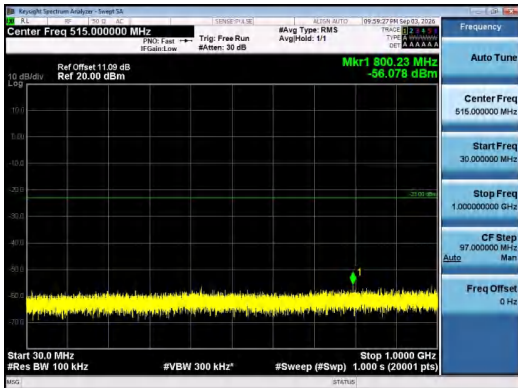
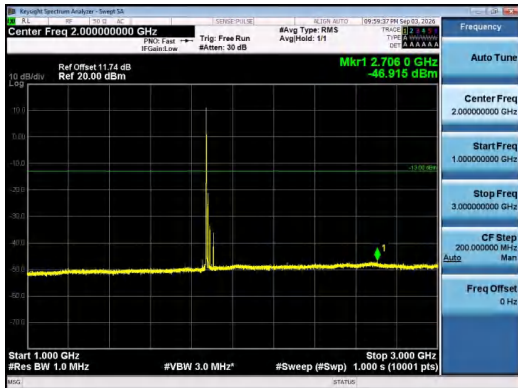
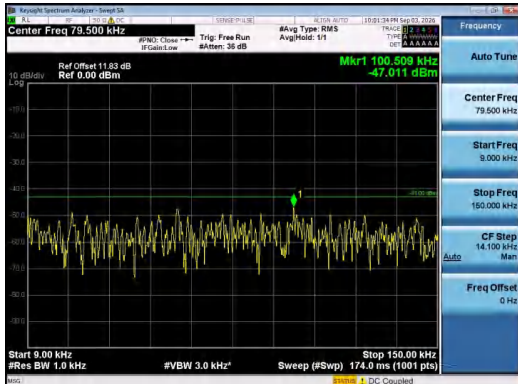
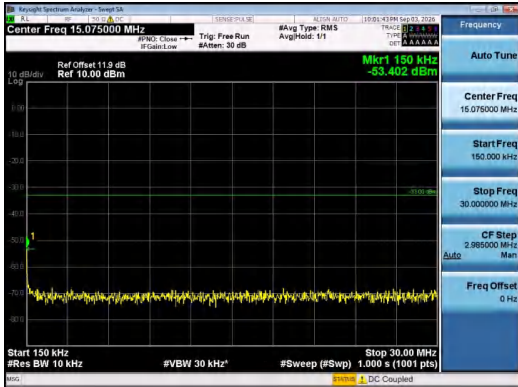
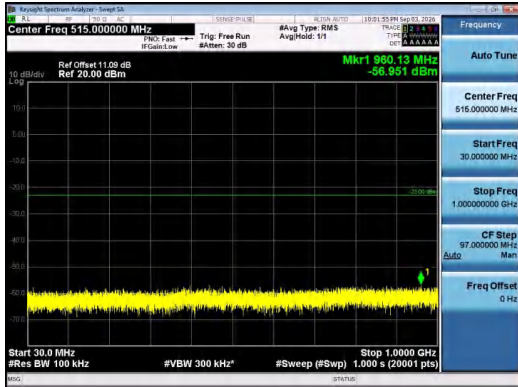
	
Band2-20MHz-16QAM-18700-1RB#0-1000~3000-PAS S	Band2-20MHz-16QAM-18700-1RB#0-3000~20000-PA SS
	
Band2-20MHz-16QAM-18700-1RB#99-0.009~0.15-PA SS	Band2-20MHz-16QAM-18700-1RB#99-0.15~30-PASS
	
Band2-20MHz-16QAM-18700-1RB#99-30~1000-PASS	Band2-20MHz-16QAM-18700-1RB#99-1000~3000-PA SS

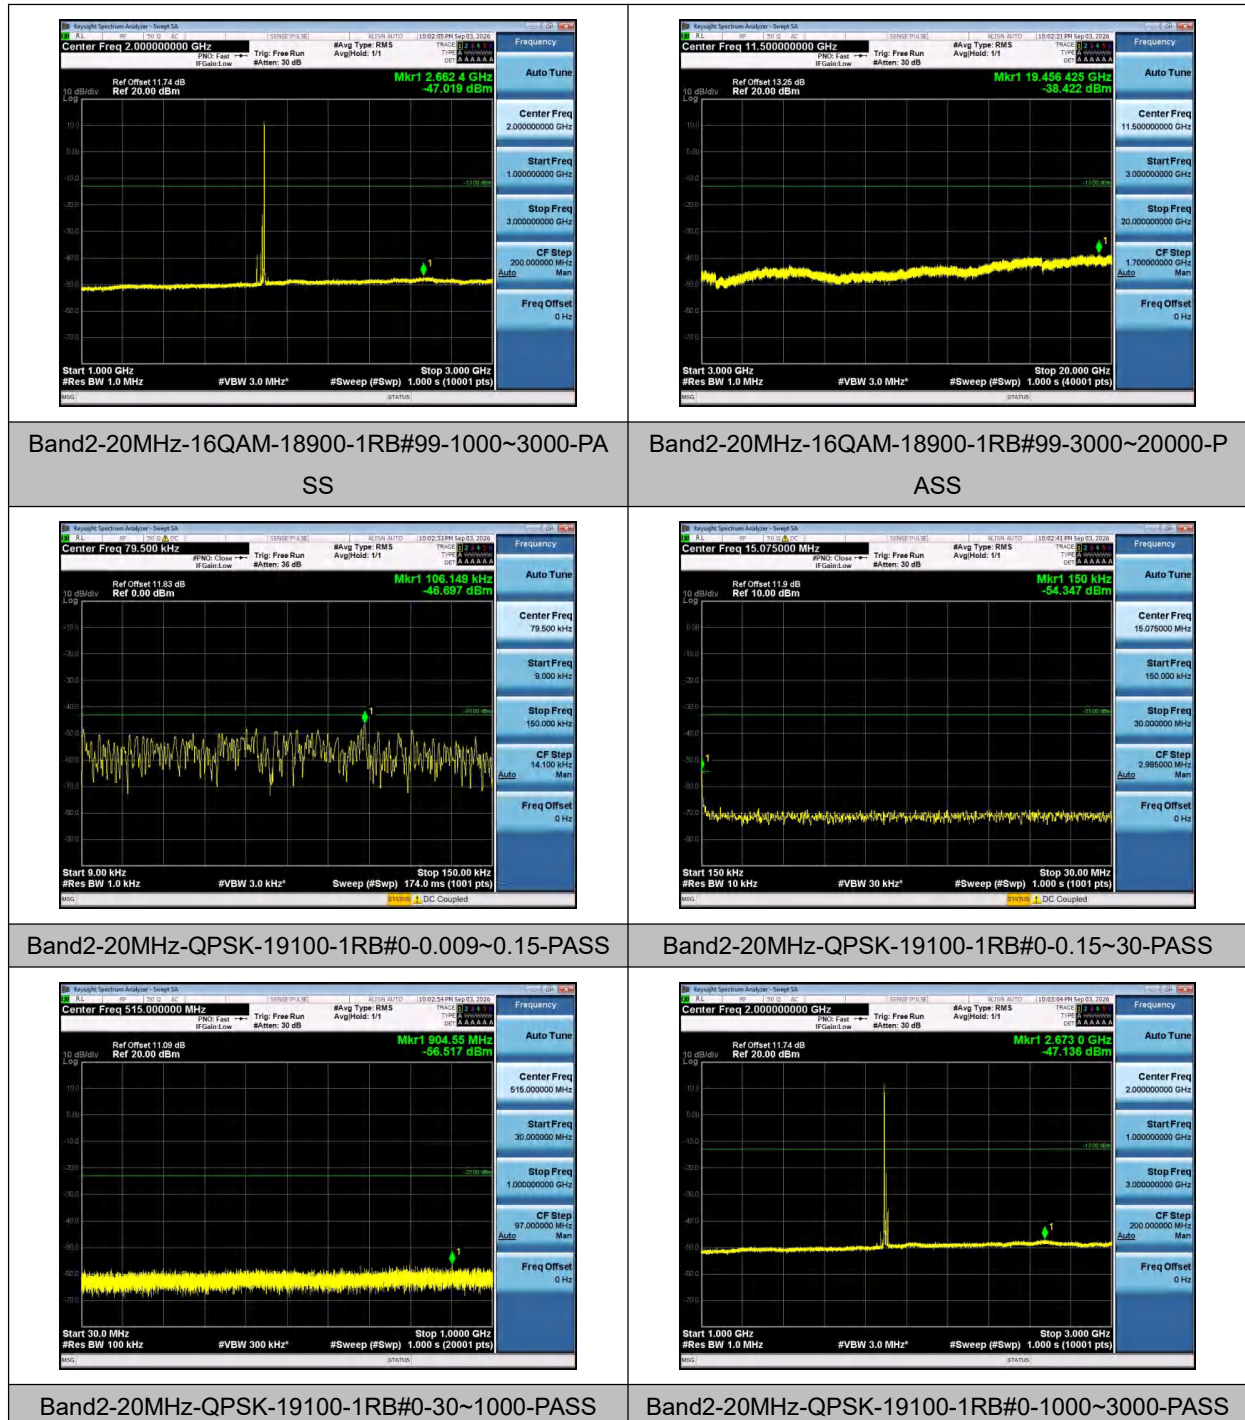
	
Band2-20MHz-16QAM-18700-1RB#99-3000~20000-P ASS	Band2-20MHz-QPSK-18900-1RB#0-0.009~0.15-PASS
	
Band2-20MHz-QPSK-18900-1RB#0-0.15~30-PASS	Band2-20MHz-QPSK-18900-1RB#0-30~1000-PASS
	
Band2-20MHz-QPSK-18900-1RB#0-1000~3000-PASS	Band2-20MHz-QPSK-18900-1RB#0-3000~20000-PASS

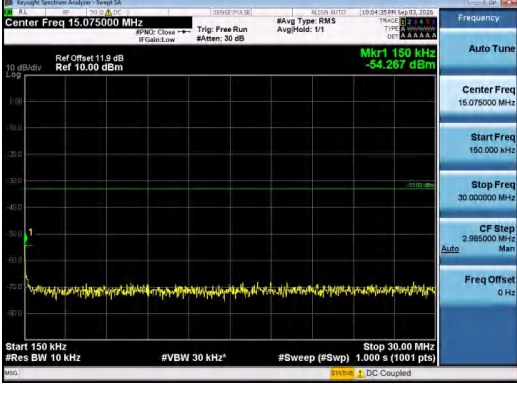
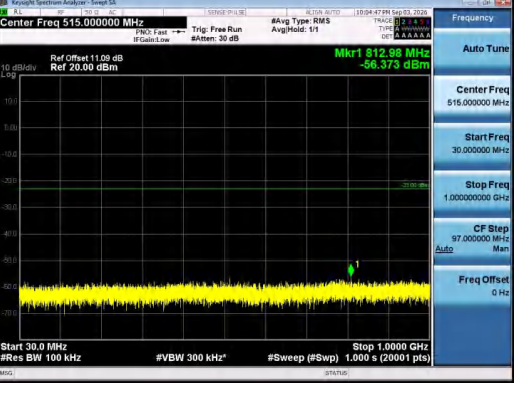
S

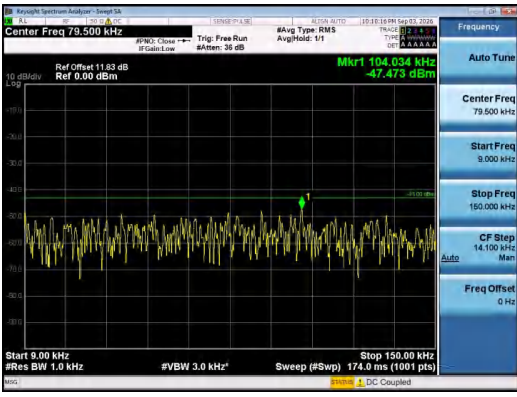
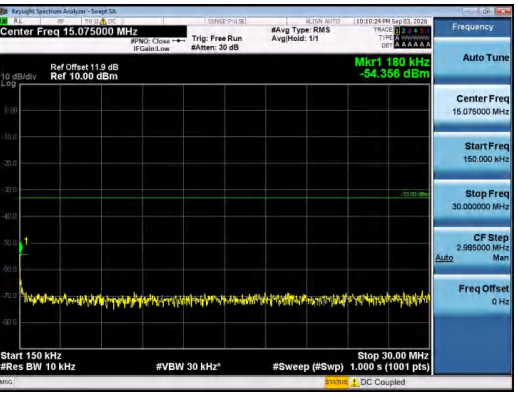
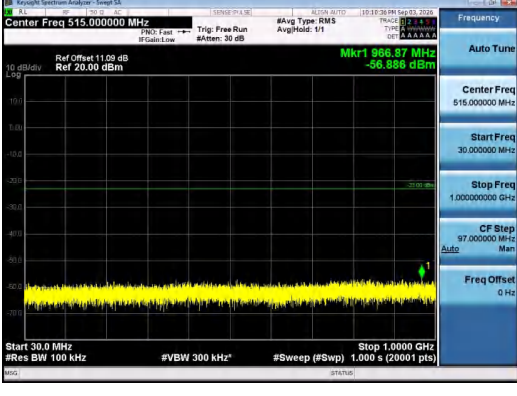
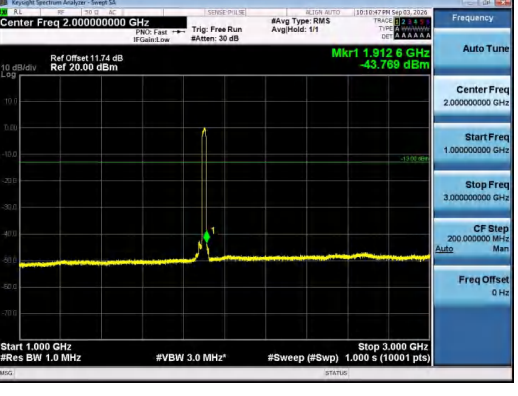
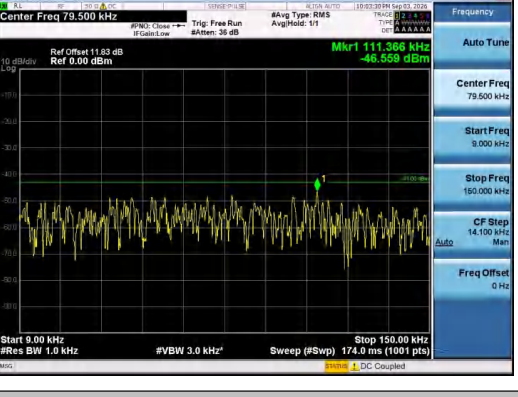
	
Band2-20MHz-QPSK-18900-1RB#99-0.009~0.15-PAS S	Band2-20MHz-QPSK-18900-1RB#99-0.15~30-PASS
	
Band2-20MHz-QPSK-18900-1RB#99-30~1000-PASS	Band2-20MHz-QPSK-18900-1RB#99-1000~3000-PAS S
	
Band2-20MHz-QPSK-18900-1RB#99-3000~20000-PA SS	Band2-20MHz-QPSK-18900-100RB#0-0.009~0.15-PA SS

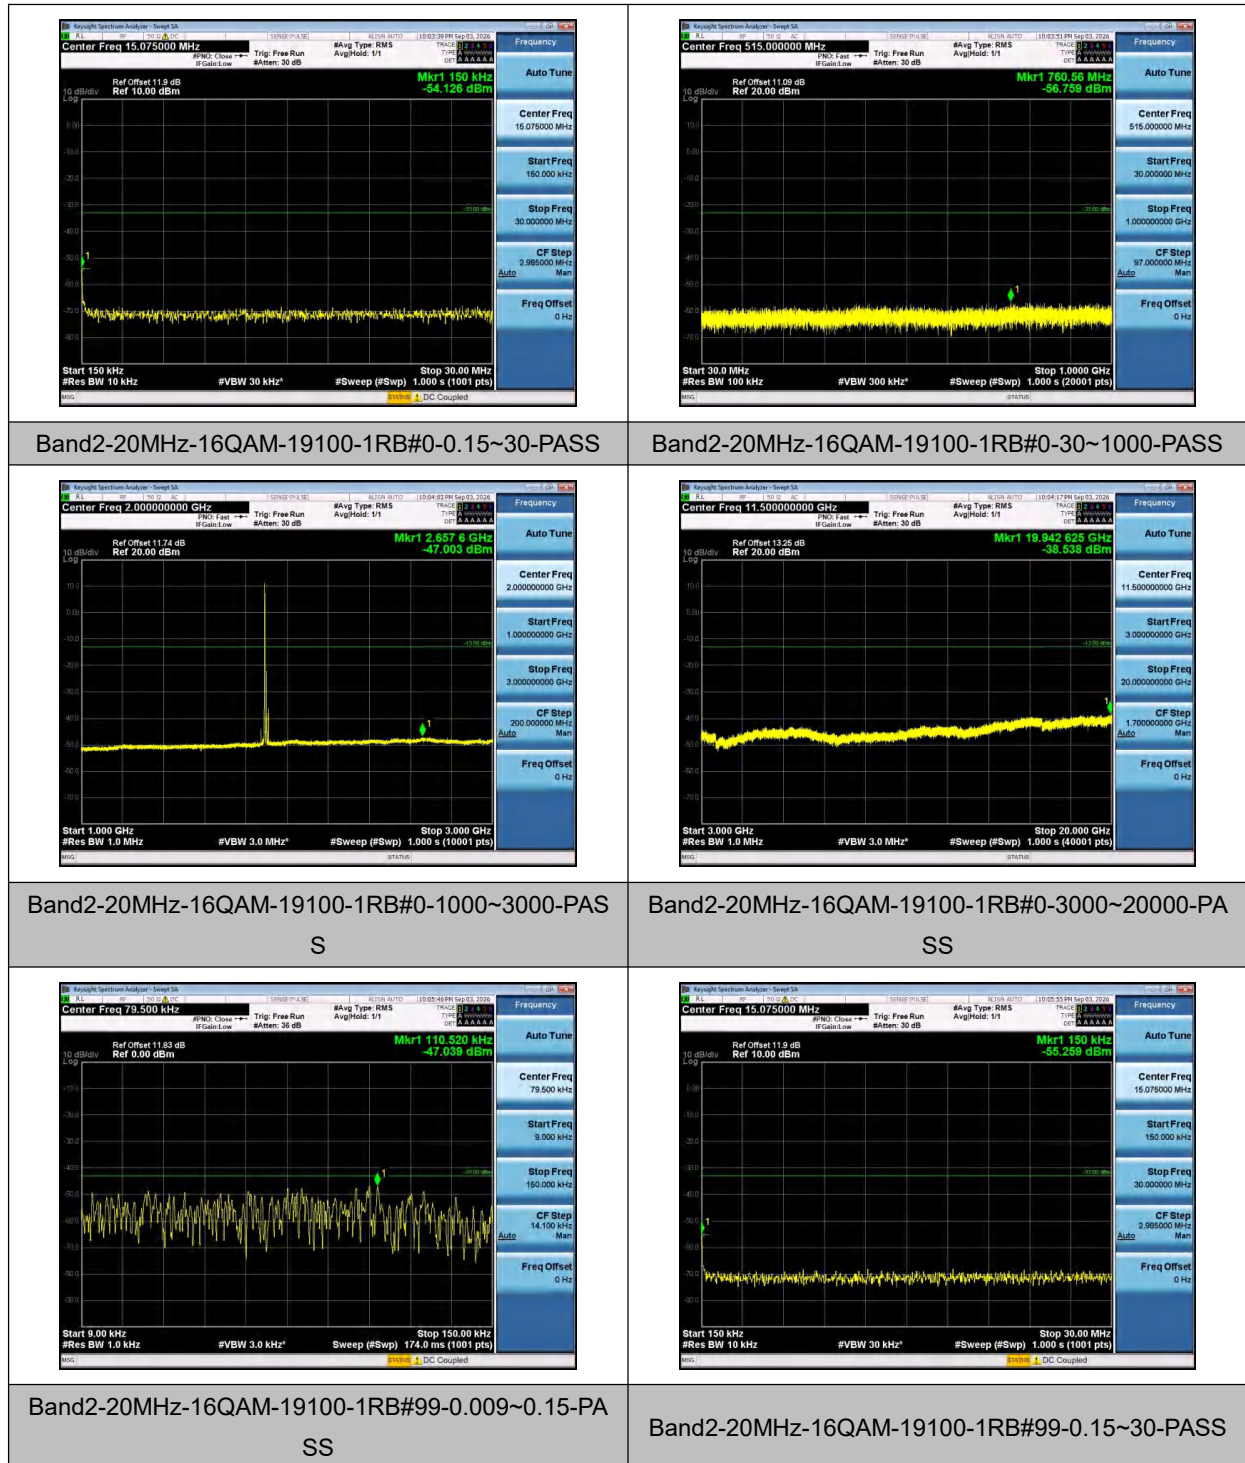


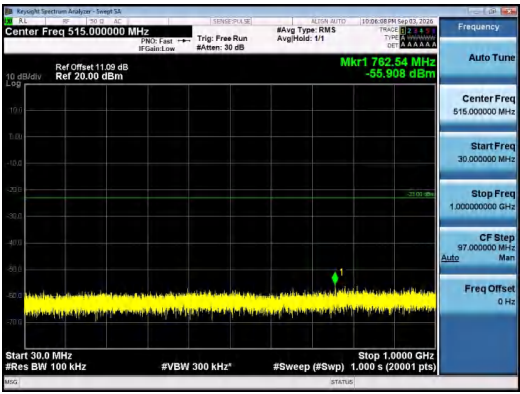
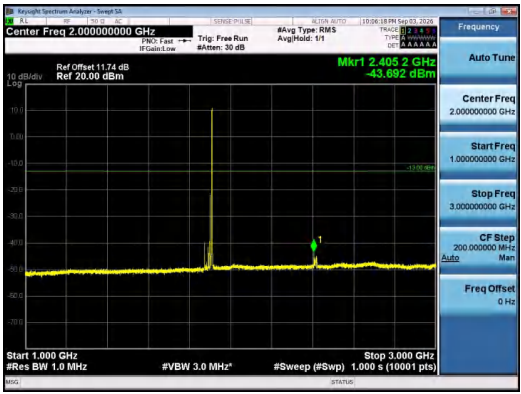
	
Band2-20MHz-16QAM-18900-1RB#0-30~1000-PASS	Band2-20MHz-16QAM-18900-1RB#0-1000~3000-PASS
	
Band2-20MHz-16QAM-18900-1RB#0-3000~20000-PASS	Band2-20MHz-16QAM-18900-1RB#99-0.009~0.15-PASS
	
Band2-20MHz-16QAM-18900-1RB#99-0.15~30-PASS	Band2-20MHz-16QAM-18900-1RB#99-30~1000-PASS



	
Band2-20MHz-QPSK-19100-1RB#0-3000~20000-PAS S	Band2-20MHz-QPSK-19100-1RB#99-0.009~0.15-PAS S
	
Band2-20MHz-QPSK-19100-1RB#99-0.15~30-PASS	Band2-20MHz-QPSK-19100-1RB#99-30~1000-PASS
	
Band2-20MHz-QPSK-19100-1RB#99-1000~3000-PAS S	Band2-20MHz-QPSK-19100-1RB#99-3000~20000-PA SS

	
Band2-20MHz-QPSK-19100-100RB#0-0.009~0.15-PA SS	Band2-20MHz-QPSK-19100-100RB#0-0.15~30-PASS
	
Band2-20MHz-QPSK-19100-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-19100-100RB#0-1000~3000-PA SS
	
Band2-20MHz-QPSK-19100-100RB#0-3000~20000-P ASS	Band2-20MHz-16QAM-19100-1RB#0-0.009~0.15-PAS S



	
Band2-20MHz-16QAM-19100-1RB#99-30~1000-PASS	Band2-20MHz-16QAM-19100-1RB#99-1000~3000-PASS
	
Band2-20MHz-16QAM-19100-1RB#99-3000~20000-PASS	

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-3240.00	-1.750689	whole band	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-2880.00	-1.556168	whole band	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-2920.00	-1.577781	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-2550.00	-1.377857	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-2040.00	-1.102286	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-2500.00	-1.350840	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-2810.00	-1.494681	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-2400.00	-1.276596	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-1490.00	-0.792553	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-2100.00	-1.117021	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-2590.00	-1.377660	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-2700.00	-1.436170	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-2120.00	-1.110355	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-1500.00	-0.785628	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-2030.00	-1.063217	whole band	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-2240.00	-1.173205	whole band	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-2750.00	-1.440318	whole band	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-2660.00	-1.393181	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

									band	
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-530.00	-0.286254	whole band	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-910.00	-0.491493	whole band	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-1090.00	-0.588712	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-2190.00	-1.182825	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-2710.00	-1.463678	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-790.00	-0.426681	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-2000.00	-1.063830	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1740.00	0.925532	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-660.00	-0.351064	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-2210.00	-1.175532	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-1390.00	-0.739362	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-1960.00	-1.042553	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	650.00	0.340582	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	550.00	0.288184	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1660.00	0.869793	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-3610.00	-1.891538	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-1760.00	-0.922190	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-1800.00	-0.943149	whole band	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-2190.00	-1.182186	whole band	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-2210.00	-1.192982	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-2860.00	-1.543860	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-3670.00	-1.981107	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-2560.00	-1.381916	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-1530.00	-0.825911	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-2340.00	-1.244681	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-3290.00	-1.750000	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-3330.00	-1.771277	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-1750.00	-0.930851	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-4990.00	-2.654255	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-2630.00	-1.398936	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-4580.00	-2.401048	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-3940.00	-2.065531	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-4110.00	-2.154653	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-1870.00	-0.980341	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-2660.00	-1.394495	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-2940.00	-1.541284	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-2950.00	-1.590296	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-1690.00	-0.911051	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-1450.00	-0.781671	whole band	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-7700.00	-4.095745	whole band	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-7200.00	-3.829787	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

									band	
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-7570.00	-4.026596	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	-1820.00	-0.955381	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-5720.00	-3.002625	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-5240.00	-2.750656	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	2850.00	1.534320	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-3110.00	-1.674293	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-400.00	-0.215343	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-280.00	-0.148936	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-2970.00	-1.579787	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-1210.00	-0.643617	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-10760.00	-5.655716	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-9050.00	-4.756899	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-7700.00	-4.047306	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	2330.00	1.252688	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	2350.00	1.263441	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3250.00	1.747312	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1910.00	1.015957	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	7460.00	3.968085	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	2490.00	1.324468	whole band	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-11000.00	-5.789474	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-7500.00	-3.947368	whole band	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-14340.00	-7.547368	whole band	PASS

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-3240.00	-1.750689	whole band	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-2880.00	-1.556168	whole band	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-2920.00	-1.577781	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-2550.00	-1.377857	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-2040.00	-1.102286	whole band	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-2500.00	-1.350840	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-2810.00	-1.494681	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-2400.00	-1.276596	whole band	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-1490.00	-0.792553	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-2100.00	-1.117021	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-2590.00	-1.377660	whole band	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-2700.00	-1.436170	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-2120.00	-1.110355	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-1500.00	-0.785628	whole band	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-2030.00	-1.063217	whole band	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-2240.00	-1.173205	whole band	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-2750.00	-1.440318	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

									band	
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-2660.00	-1.393181	whole band	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-530.00	-0.286254	whole band	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-910.00	-0.491493	whole band	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-1090.00	-0.588712	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-2190.00	-1.182825	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-2710.00	-1.463678	whole band	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-790.00	-0.426681	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-2000.00	-1.063830	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1740.00	0.925532	whole band	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-660.00	-0.351064	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-2210.00	-1.175532	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-1390.00	-0.739362	whole band	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-1960.00	-1.042553	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	650.00	0.340582	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	550.00	0.288184	whole band	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1660.00	0.869793	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-3610.00	-1.891538	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-1760.00	-0.922190	whole band	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-1800.00	-0.943149	whole band	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-2190.00	-1.182186	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-2210.00	-1.192982	whole band	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-2860.00	-1.543860	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-3670.00	-1.981107	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-2560.00	-1.381916	whole band	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-1530.00	-0.825911	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-2340.00	-1.244681	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-3290.00	-1.750000	whole band	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-3330.00	-1.771277	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-1750.00	-0.930851	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-4990.00	-2.654255	whole band	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-2630.00	-1.398936	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-4580.00	-2.401048	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-3940.00	-2.065531	whole band	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-4110.00	-2.154653	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-1870.00	-0.980341	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-2660.00	-1.394495	whole band	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-2940.00	-1.541284	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-2950.00	-1.590296	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-1690.00	-0.911051	whole band	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-1450.00	-0.781671	whole band	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-7700.00	-4.095745	whole	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

									band	
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-7200.00	-3.829787	whole band	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-7570.00	-4.026596	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	-1820.00	-0.955381	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-5720.00	-3.002625	whole band	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-5240.00	-2.750656	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	2850.00	1.534320	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-3110.00	-1.674293	whole band	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-400.00	-0.215343	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-280.00	-0.148936	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-2970.00	-1.579787	whole band	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-1210.00	-0.643617	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-10760.00	-5.655716	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-9050.00	-4.756899	whole band	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-7700.00	-4.047306	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	2330.00	1.252688	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	2350.00	1.263441	whole band	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3250.00	1.747312	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1910.00	1.015957	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	7460.00	3.968085	whole band	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	2490.00	1.324468	whole band	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-11000.00	-5.789474	whole band	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-7500.00	-3.947368	whole band	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-14340.00	-7.547368	whole band	PASS

---END---