

Appendix Test Data

Report No:	1812C60448212503-04	Test Sample NO:	1-2-2
Start Test Date:	2026-09-02	Finish Test Date:	2026-09-29
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	23.5°C	Relative Humidity:	61%
Pressure:	100.5 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	19.36	PASS
Band66	1.4MHz	QPSK	131979	1RB#2	18.84	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	18.51	PASS
Band66	1.4MHz	QPSK	131979	3RB#0	19.66	PASS
Band66	1.4MHz	QPSK	131979	3RB#1	18.87	PASS
Band66	1.4MHz	QPSK	131979	3RB#3	18.51	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	18.28	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	19.07	PASS
Band66	1.4MHz	16QAM	131979	1RB#2	18.66	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	18.39	PASS
Band66	1.4MHz	16QAM	131979	3RB#0	19.00	PASS
Band66	1.4MHz	16QAM	131979	3RB#1	18.63	PASS
Band66	1.4MHz	16QAM	131979	3RB#3	18.23	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	18.04	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	17.19	PASS
Band66	1.4MHz	QPSK	132322	1RB#2	16.89	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	16.92	PASS
Band66	1.4MHz	QPSK	132322	3RB#0	16.68	PASS
Band66	1.4MHz	QPSK	132322	3RB#1	16.60	PASS
Band66	1.4MHz	QPSK	132322	3RB#3	16.59	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	16.52	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	16.90	PASS
Band66	1.4MHz	16QAM	132322	1RB#2	16.90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	16QAM	132322	1RB#5	16.80	PASS
Band66	1.4MHz	16QAM	132322	3RB#0	16.47	PASS
Band66	1.4MHz	16QAM	132322	3RB#1	16.56	PASS
Band66	1.4MHz	16QAM	132322	3RB#3	16.40	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	16.50	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	15.14	PASS
Band66	1.4MHz	QPSK	132665	1RB#2	15.12	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	15.30	PASS
Band66	1.4MHz	QPSK	132665	3RB#0	15.08	PASS
Band66	1.4MHz	QPSK	132665	3RB#1	15.10	PASS
Band66	1.4MHz	QPSK	132665	3RB#3	16.19	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	15.72	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	14.85	PASS
Band66	1.4MHz	16QAM	132665	1RB#2	15.23	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	15.16	PASS
Band66	1.4MHz	16QAM	132665	3RB#0	14.92	PASS
Band66	1.4MHz	16QAM	132665	3RB#1	15.06	PASS
Band66	1.4MHz	16QAM	132665	3RB#3	15.68	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	15.64	PASS
Band66	3MHz	QPSK	131987	1RB#0	18.19	PASS
Band66	3MHz	QPSK	131987	1RB#8	17.67	PASS
Band66	3MHz	QPSK	131987	1RB#14	17.25	PASS
Band66	3MHz	QPSK	131987	8RB#0	17.38	PASS
Band66	3MHz	QPSK	131987	8RB#4	17.14	PASS
Band66	3MHz	QPSK	131987	8RB#7	16.91	PASS
Band66	3MHz	QPSK	131987	15RB#0	16.94	PASS
Band66	3MHz	16QAM	131987	1RB#0	17.86	PASS
Band66	3MHz	16QAM	131987	1RB#8	17.63	PASS
Band66	3MHz	16QAM	131987	1RB#14	16.98	PASS
Band66	3MHz	16QAM	131987	8RB#0	17.32	PASS
Band66	3MHz	16QAM	131987	8RB#4	17.01	PASS
Band66	3MHz	16QAM	131987	8RB#7	16.88	PASS
Band66	3MHz	16QAM	131987	15RB#0	16.85	PASS
Band66	3MHz	QPSK	132322	1RB#0	16.35	PASS
Band66	3MHz	QPSK	132322	1RB#8	16.42	PASS
Band66	3MHz	QPSK	132322	1RB#14	16.71	PASS
Band66	3MHz	QPSK	132322	8RB#0	16.36	PASS
Band66	3MHz	QPSK	132322	8RB#4	16.47	PASS
Band66	3MHz	QPSK	132322	8RB#7	17.83	PASS
Band66	3MHz	QPSK	132322	15RB#0	17.16	PASS
Band66	3MHz	16QAM	132322	1RB#0	15.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	16QAM	132322	1RB#8	16.44	PASS
Band66	3MHz	16QAM	132322	1RB#14	16.54	PASS
Band66	3MHz	16QAM	132322	8RB#0	16.35	PASS
Band66	3MHz	16QAM	132322	8RB#4	16.42	PASS
Band66	3MHz	16QAM	132322	8RB#7	17.44	PASS
Band66	3MHz	16QAM	132322	15RB#0	17.01	PASS
Band66	3MHz	QPSK	132657	1RB#0	14.94	PASS
Band66	3MHz	QPSK	132657	1RB#8	15.20	PASS
Band66	3MHz	QPSK	132657	1RB#14	15.41	PASS
Band66	3MHz	QPSK	132657	8RB#0	14.87	PASS
Band66	3MHz	QPSK	132657	8RB#4	14.93	PASS
Band66	3MHz	QPSK	132657	8RB#7	15.02	PASS
Band66	3MHz	QPSK	132657	15RB#0	14.81	PASS
Band66	3MHz	16QAM	132657	1RB#0	14.60	PASS
Band66	3MHz	16QAM	132657	1RB#8	15.15	PASS
Band66	3MHz	16QAM	132657	1RB#14	15.19	PASS
Band66	3MHz	16QAM	132657	8RB#0	14.80	PASS
Band66	3MHz	16QAM	132657	8RB#4	14.83	PASS
Band66	3MHz	16QAM	132657	8RB#7	15.00	PASS
Band66	3MHz	16QAM	132657	15RB#0	14.75	PASS
Band66	5MHz	QPSK	131997	1RB#0	17.05	PASS
Band66	5MHz	QPSK	131997	1RB#12	16.53	PASS
Band66	5MHz	QPSK	131997	1RB#24	16.17	PASS
Band66	5MHz	QPSK	131997	12RB#0	16.85	PASS
Band66	5MHz	QPSK	131997	12RB#6	16.69	PASS
Band66	5MHz	QPSK	131997	12RB#13	16.46	PASS
Band66	5MHz	QPSK	131997	25RB#0	18.10	PASS
Band66	5MHz	16QAM	131997	1RB#0	17.05	PASS
Band66	5MHz	16QAM	131997	1RB#12	16.66	PASS
Band66	5MHz	16QAM	131997	1RB#24	16.23	PASS
Band66	5MHz	16QAM	131997	12RB#0	16.94	PASS
Band66	5MHz	16QAM	131997	12RB#6	16.78	PASS
Band66	5MHz	16QAM	131997	12RB#13	18.42	PASS
Band66	5MHz	16QAM	131997	25RB#0	17.90	PASS
Band66	5MHz	QPSK	132322	1RB#0	16.97	PASS
Band66	5MHz	QPSK	132322	1RB#12	16.96	PASS
Band66	5MHz	QPSK	132322	1RB#24	17.32	PASS
Band66	5MHz	QPSK	132322	12RB#0	16.46	PASS
Band66	5MHz	QPSK	132322	12RB#6	16.58	PASS
Band66	5MHz	QPSK	132322	12RB#13	16.74	PASS
Band66	5MHz	QPSK	132322	25RB#0	16.44	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	132322	1RB#0	16.62	PASS
Band66	5MHz	16QAM	132322	1RB#12	16.80	PASS
Band66	5MHz	16QAM	132322	1RB#24	17.20	PASS
Band66	5MHz	16QAM	132322	12RB#0	16.41	PASS
Band66	5MHz	16QAM	132322	12RB#6	16.56	PASS
Band66	5MHz	16QAM	132322	12RB#13	16.72	PASS
Band66	5MHz	16QAM	132322	25RB#0	16.43	PASS
Band66	5MHz	QPSK	132647	1RB#0	13.86	PASS
Band66	5MHz	QPSK	132647	1RB#12	14.55	PASS
Band66	5MHz	QPSK	132647	1RB#24	15.04	PASS
Band66	5MHz	QPSK	132647	12RB#0	14.17	PASS
Band66	5MHz	QPSK	132647	12RB#6	14.53	PASS
Band66	5MHz	QPSK	132647	12RB#13	14.87	PASS
Band66	5MHz	QPSK	132647	25RB#0	14.55	PASS
Band66	5MHz	16QAM	132647	1RB#0	13.78	PASS
Band66	5MHz	16QAM	132647	1RB#12	14.64	PASS
Band66	5MHz	16QAM	132647	1RB#24	15.11	PASS
Band66	5MHz	16QAM	132647	12RB#0	14.19	PASS
Band66	5MHz	16QAM	132647	12RB#6	14.60	PASS
Band66	5MHz	16QAM	132647	12RB#13	14.94	PASS
Band66	5MHz	16QAM	132647	25RB#0	14.53	PASS
Band66	10MHz	QPSK	132022	1RB#0	18.39	PASS
Band66	10MHz	QPSK	132022	1RB#24	17.23	PASS
Band66	10MHz	QPSK	132022	1RB#49	16.05	PASS
Band66	10MHz	QPSK	132022	27RB#0	17.17	PASS
Band66	10MHz	QPSK	132022	27RB#12	16.57	PASS
Band66	10MHz	QPSK	132022	27RB#25	15.96	PASS
Band66	10MHz	QPSK	132022	50RB#0	17.45	PASS
Band66	10MHz	16QAM	132022	1RB#0	17.98	PASS
Band66	10MHz	16QAM	132022	1RB#24	17.07	PASS
Band66	10MHz	16QAM	132022	1RB#49	15.72	PASS
Band66	10MHz	16QAM	132022	27RB#0	17.12	PASS
Band66	10MHz	16QAM	132022	27RB#12	16.50	PASS
Band66	10MHz	16QAM	132022	27RB#25	15.92	PASS
Band66	10MHz	QPSK	132322	1RB#0	16.53	PASS
Band66	10MHz	QPSK	132322	1RB#24	16.95	PASS
Band66	10MHz	QPSK	132322	1RB#49	17.52	PASS
Band66	10MHz	QPSK	132322	27RB#0	16.29	PASS
Band66	10MHz	QPSK	132322	27RB#12	16.65	PASS
Band66	10MHz	QPSK	132322	27RB#25	17.02	PASS
Band66	10MHz	QPSK	132322	50RB#0	17.46	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	16QAM	132322	1RB#0	16.02	PASS
Band66	10MHz	16QAM	132322	1RB#24	16.84	PASS
Band66	10MHz	16QAM	132322	1RB#49	17.29	PASS
Band66	10MHz	16QAM	132322	27RB#0	16.26	PASS
Band66	10MHz	16QAM	132322	27RB#12	16.63	PASS
Band66	10MHz	16QAM	132322	27RB#25	17.04	PASS
Band66	10MHz	QPSK	132622	1RB#0	15.45	PASS
Band66	10MHz	QPSK	132622	1RB#24	14.92	PASS
Band66	10MHz	QPSK	132622	1RB#49	15.53	PASS
Band66	10MHz	QPSK	132622	27RB#0	14.46	PASS
Band66	10MHz	QPSK	132622	27RB#12	14.38	PASS
Band66	10MHz	QPSK	132622	27RB#25	14.63	PASS
Band66	10MHz	QPSK	132622	50RB#0	12.54	PASS
Band66	10MHz	16QAM	132622	1RB#0	14.87	PASS
Band66	10MHz	16QAM	132622	1RB#24	14.78	PASS
Band66	10MHz	16QAM	132622	1RB#49	15.28	PASS
Band66	10MHz	16QAM	132622	27RB#0	14.40	PASS
Band66	10MHz	16QAM	132622	27RB#12	14.33	PASS
Band66	10MHz	16QAM	132622	27RB#25	14.64	PASS
Band66	15MHz	QPSK	132047	1RB#0	17.66	PASS
Band66	15MHz	QPSK	132047	1RB#38	16.29	PASS
Band66	15MHz	QPSK	132047	1RB#74	15.06	PASS
Band66	15MHz	QPSK	132047	36RB#0	16.94	PASS
Band66	15MHz	QPSK	132047	36RB#18	16.28	PASS
Band66	15MHz	QPSK	132047	36RB#39	15.49	PASS
Band66	15MHz	QPSK	132047	75RB#0	16.09	PASS
Band66	15MHz	16QAM	132047	1RB#0	17.68	PASS
Band66	15MHz	16QAM	132047	1RB#38	16.24	PASS
Band66	15MHz	16QAM	132047	1RB#74	15.14	PASS
Band66	15MHz	QPSK	132322	1RB#0	15.60	PASS
Band66	15MHz	QPSK	132322	1RB#38	17.28	PASS
Band66	15MHz	QPSK	132322	1RB#74	18.41	PASS
Band66	15MHz	QPSK	132322	36RB#0	16.13	PASS
Band66	15MHz	QPSK	132322	36RB#18	16.59	PASS
Band66	15MHz	QPSK	132322	36RB#39	17.15	PASS
Band66	15MHz	QPSK	132322	75RB#0	16.57	PASS
Band66	15MHz	16QAM	132322	1RB#0	16.31	PASS
Band66	15MHz	16QAM	132322	1RB#38	17.93	PASS
Band66	15MHz	16QAM	132322	1RB#74	18.35	PASS
Band66	15MHz	QPSK	132597	1RB#0	16.40	PASS
Band66	15MHz	QPSK	132597	1RB#38	14.83	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	QPSK	132597	1RB#74	15.29	PASS
Band66	15MHz	QPSK	132597	36RB#0	14.48	PASS
Band66	15MHz	QPSK	132597	36RB#18	14.22	PASS
Band66	15MHz	QPSK	132597	36RB#39	15.56	PASS
Band66	15MHz	QPSK	132597	75RB#0	15.27	PASS
Band66	15MHz	16QAM	132597	1RB#0	15.94	PASS
Band66	15MHz	16QAM	132597	1RB#38	14.66	PASS
Band66	15MHz	16QAM	132597	1RB#74	15.27	PASS
Band66	20MHz	QPSK	132072	1RB#0	17.00	PASS
Band66	20MHz	QPSK	132072	1RB#49	15.62	PASS
Band66	20MHz	QPSK	132072	1RB#99	14.45	PASS
Band66	20MHz	QPSK	132072	50RB#0	18.51	PASS
Band66	20MHz	QPSK	132072	50RB#25	17.34	PASS
Band66	20MHz	QPSK	132072	50RB#50	16.27	PASS
Band66	20MHz	QPSK	132072	100RB#0	16.83	PASS
Band66	20MHz	16QAM	132072	1RB#0	17.05	PASS
Band66	20MHz	16QAM	132072	1RB#49	15.61	PASS
Band66	20MHz	16QAM	132072	1RB#99	14.57	PASS
Band66	20MHz	QPSK	132322	1RB#0	14.92	PASS
Band66	20MHz	QPSK	132322	1RB#49	17.64	PASS
Band66	20MHz	QPSK	132322	1RB#99	18.51	PASS
Band66	20MHz	QPSK	132322	50RB#0	16.60	PASS
Band66	20MHz	QPSK	132322	50RB#25	17.20	PASS
Band66	20MHz	QPSK	132322	50RB#50	17.73	PASS
Band66	20MHz	QPSK	132322	100RB#0	16.92	PASS
Band66	20MHz	16QAM	132322	1RB#0	14.66	PASS
Band66	20MHz	16QAM	132322	1RB#49	17.83	PASS
Band66	20MHz	16QAM	132322	1RB#99	18.16	PASS
Band66	20MHz	QPSK	132572	1RB#0	17.63	PASS
Band66	20MHz	QPSK	132572	1RB#49	15.16	PASS
Band66	20MHz	QPSK	132572	1RB#99	15.05	PASS
Band66	20MHz	QPSK	132572	50RB#0	15.49	PASS
Band66	20MHz	QPSK	132572	50RB#25	14.66	PASS
Band66	20MHz	QPSK	132572	50RB#50	14.42	PASS
Band66	20MHz	QPSK	132572	100RB#0	14.69	PASS
Band66	20MHz	16QAM	132572	1RB#0	17.25	PASS
Band66	20MHz	16QAM	132572	1RB#49	14.98	PASS
Band66	20MHz	16QAM	132572	1RB#99	15.16	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	4.64	13	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	5.23	13	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	5.68	13	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	11.07	13	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	4.57	13	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	5.22	13	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	5.56	13	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	6.11	13	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	4.48	13	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	5.15	13	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	5.56	13	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	6.05	13	PASS
Band66	3MHz	QPSK	131987	1RB#0	4.66	13	PASS
Band66	3MHz	QPSK	131987	15RB#0	5.28	13	PASS
Band66	3MHz	16QAM	131987	1RB#0	5.56	13	PASS
Band66	3MHz	16QAM	131987	15RB#0	6.89	13	PASS
Band66	3MHz	QPSK	132322	1RB#0	4.67	13	PASS
Band66	3MHz	QPSK	132322	15RB#0	5.28	13	PASS
Band66	3MHz	16QAM	132322	1RB#0	5.54	13	PASS
Band66	3MHz	16QAM	132322	15RB#0	6.09	13	PASS
Band66	3MHz	QPSK	132657	1RB#0	4.61	13	PASS
Band66	3MHz	QPSK	132657	15RB#0	5.27	13	PASS
Band66	3MHz	16QAM	132657	1RB#0	5.62	13	PASS
Band66	3MHz	16QAM	132657	15RB#0	6.07	13	PASS
Band66	5MHz	QPSK	131997	1RB#0	4.67	13	PASS
Band66	5MHz	QPSK	131997	25RB#0	5.28	13	PASS
Band66	5MHz	16QAM	131997	1RB#0	5.50	13	PASS
Band66	5MHz	16QAM	131997	25RB#0	6.05	13	PASS
Band66	5MHz	QPSK	132322	1RB#0	4.60	13	PASS
Band66	5MHz	QPSK	132322	25RB#0	5.26	13	PASS
Band66	5MHz	16QAM	132322	1RB#0	5.57	13	PASS
Band66	5MHz	16QAM	132322	25RB#0	6.05	13	PASS
Band66	5MHz	QPSK	132647	1RB#0	4.54	13	PASS
Band66	5MHz	QPSK	132647	25RB#0	5.24	13	PASS
Band66	5MHz	16QAM	132647	1RB#0	5.34	13	PASS
Band66	5MHz	16QAM	132647	25RB#0	7.43	13	PASS


Band66	10MHz	QPSK	132022	1RB#0	4.59	13	PASS
Band66	10MHz	QPSK	132022	50RB#0	5.19	13	PASS
Band66	10MHz	16QAM	132022	1RB#0	8.40	13	PASS
Band66	10MHz	QPSK	132322	1RB#0	4.57	13	PASS
Band66	10MHz	QPSK	132322	50RB#0	5.16	13	PASS
Band66	10MHz	16QAM	132322	1RB#0	5.47	13	PASS
Band66	10MHz	QPSK	132622	1RB#0	4.55	13	PASS
Band66	10MHz	QPSK	132622	50RB#0	5.16	13	PASS
Band66	10MHz	16QAM	132622	1RB#0	5.63	13	PASS
Band66	15MHz	QPSK	132047	1RB#0	5.30	13	PASS
Band66	15MHz	QPSK	132047	75RB#0	5.90	13	PASS
Band66	15MHz	16QAM	132047	1RB#0	8.40	13	PASS
Band66	15MHz	QPSK	132322	1RB#0	5.29	13	PASS
Band66	15MHz	QPSK	132322	75RB#0	5.91	13	PASS
Band66	15MHz	16QAM	132322	1RB#0	6.04	13	PASS
Band66	15MHz	QPSK	132597	1RB#0	5.21	13	PASS
Band66	15MHz	QPSK	132597	75RB#0	5.98	13	PASS
Band66	15MHz	16QAM	132597	1RB#0	5.89	13	PASS
Band66	20MHz	QPSK	132072	1RB#0	5.17	13	PASS
Band66	20MHz	QPSK	132072	100RB#0	5.60	13	PASS
Band66	20MHz	QPSK	132322	1RB#0	5.38	13	PASS
Band66	20MHz	QPSK	132322	100RB#0	8.39	13	PASS
Band66	20MHz	QPSK	132572	1RB#0	5.22	13	PASS
Band66	20MHz	QPSK	132572	100RB#0	5.69	13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

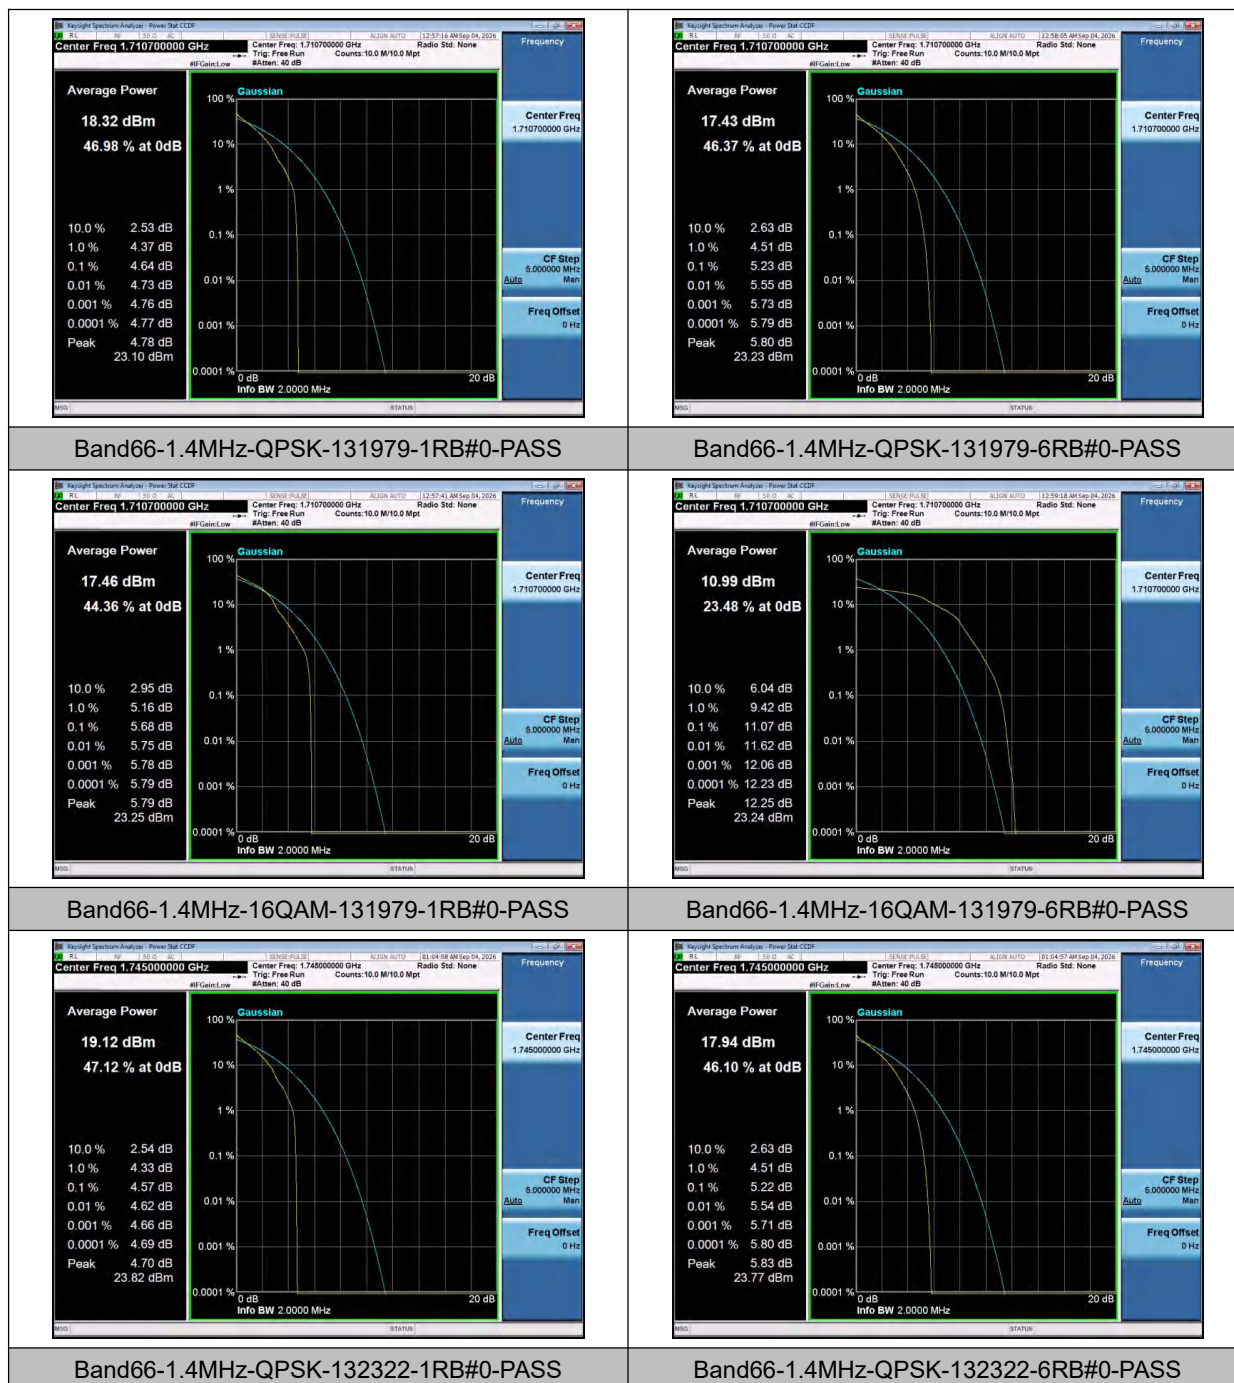


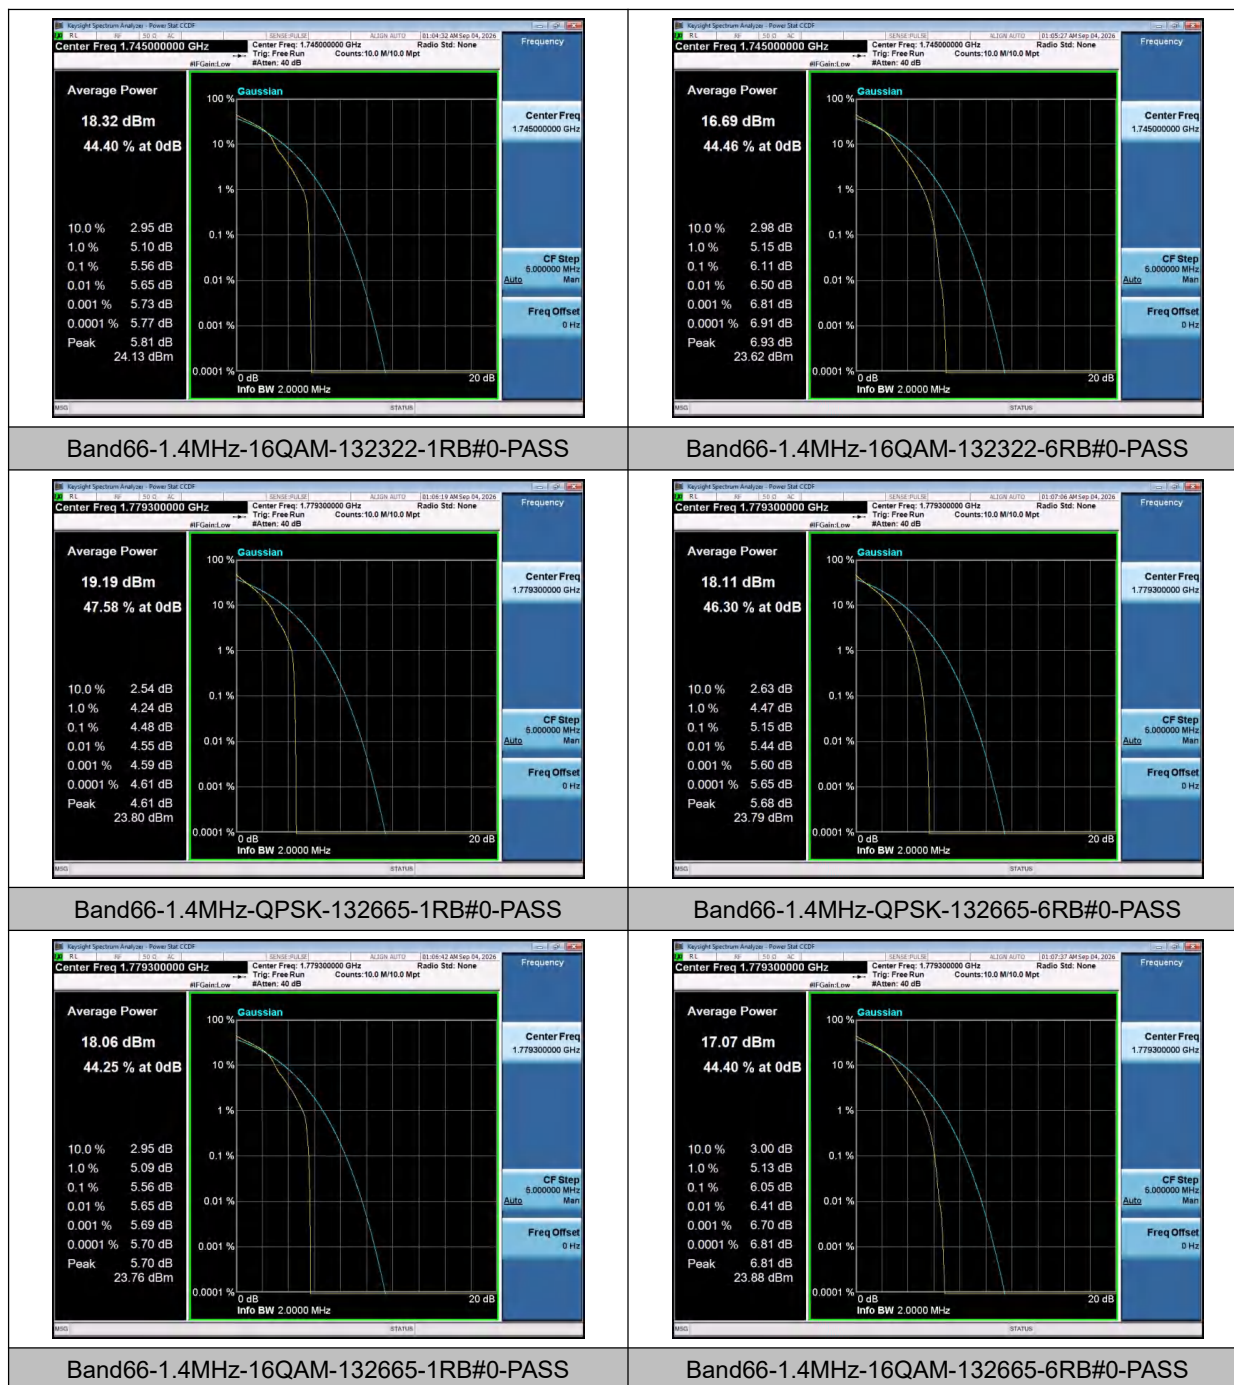


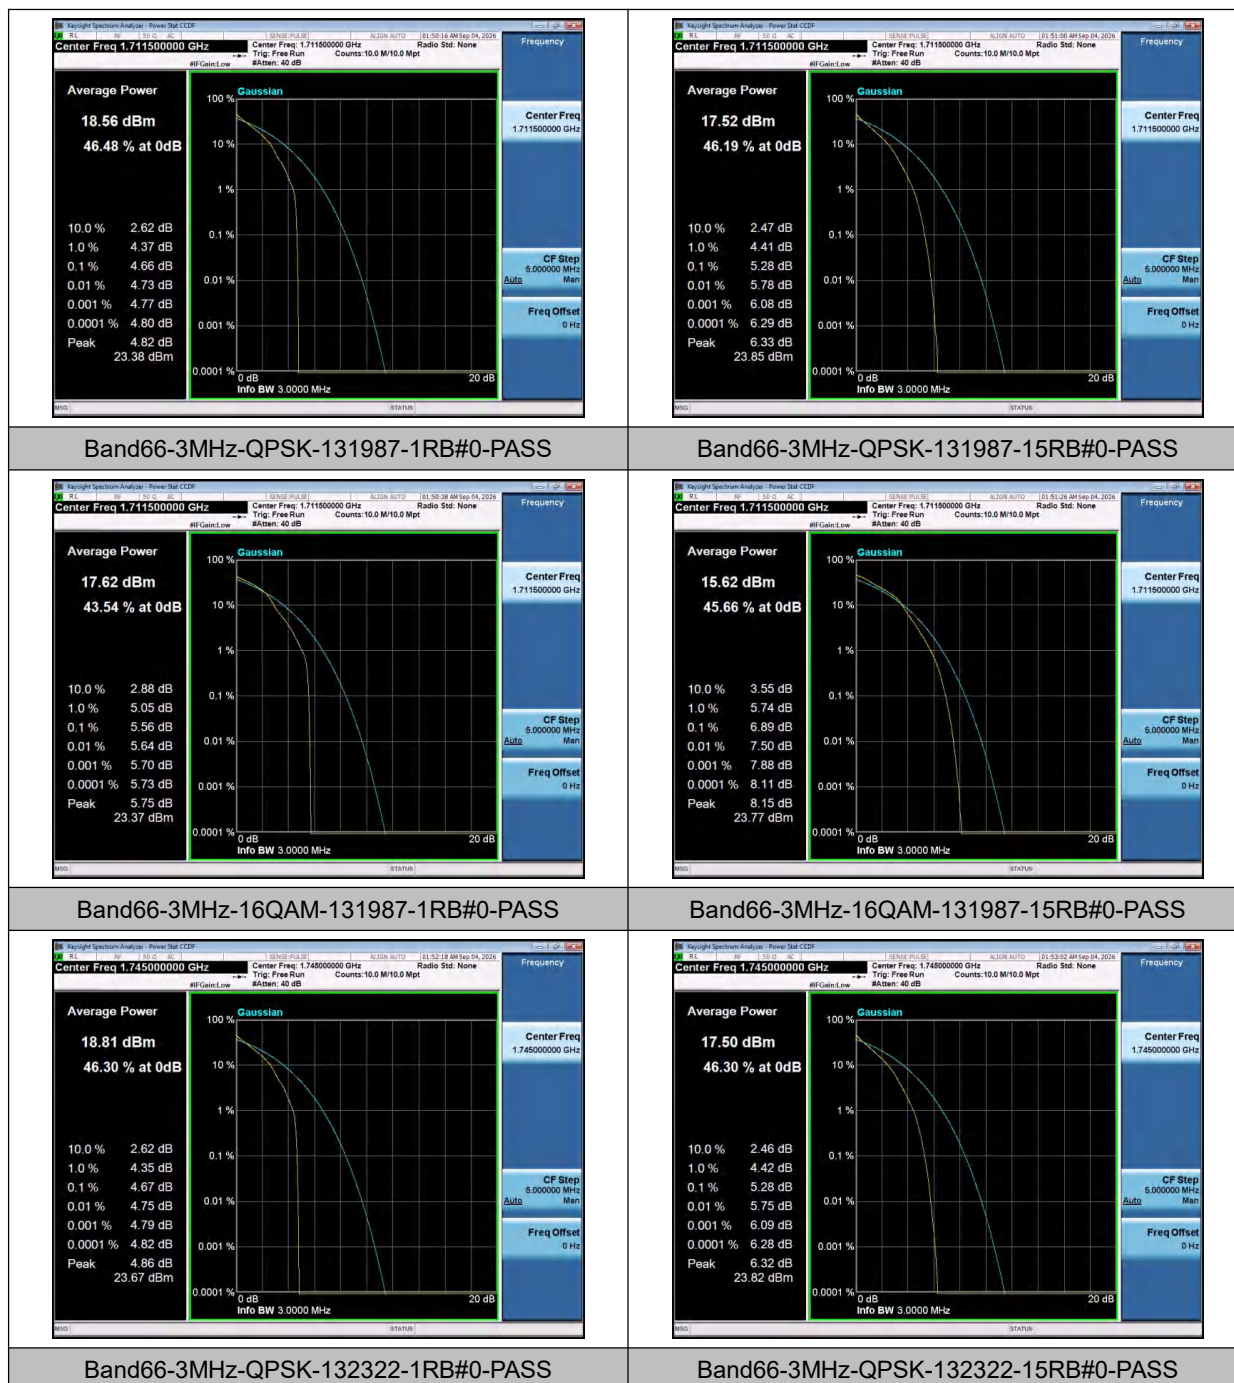


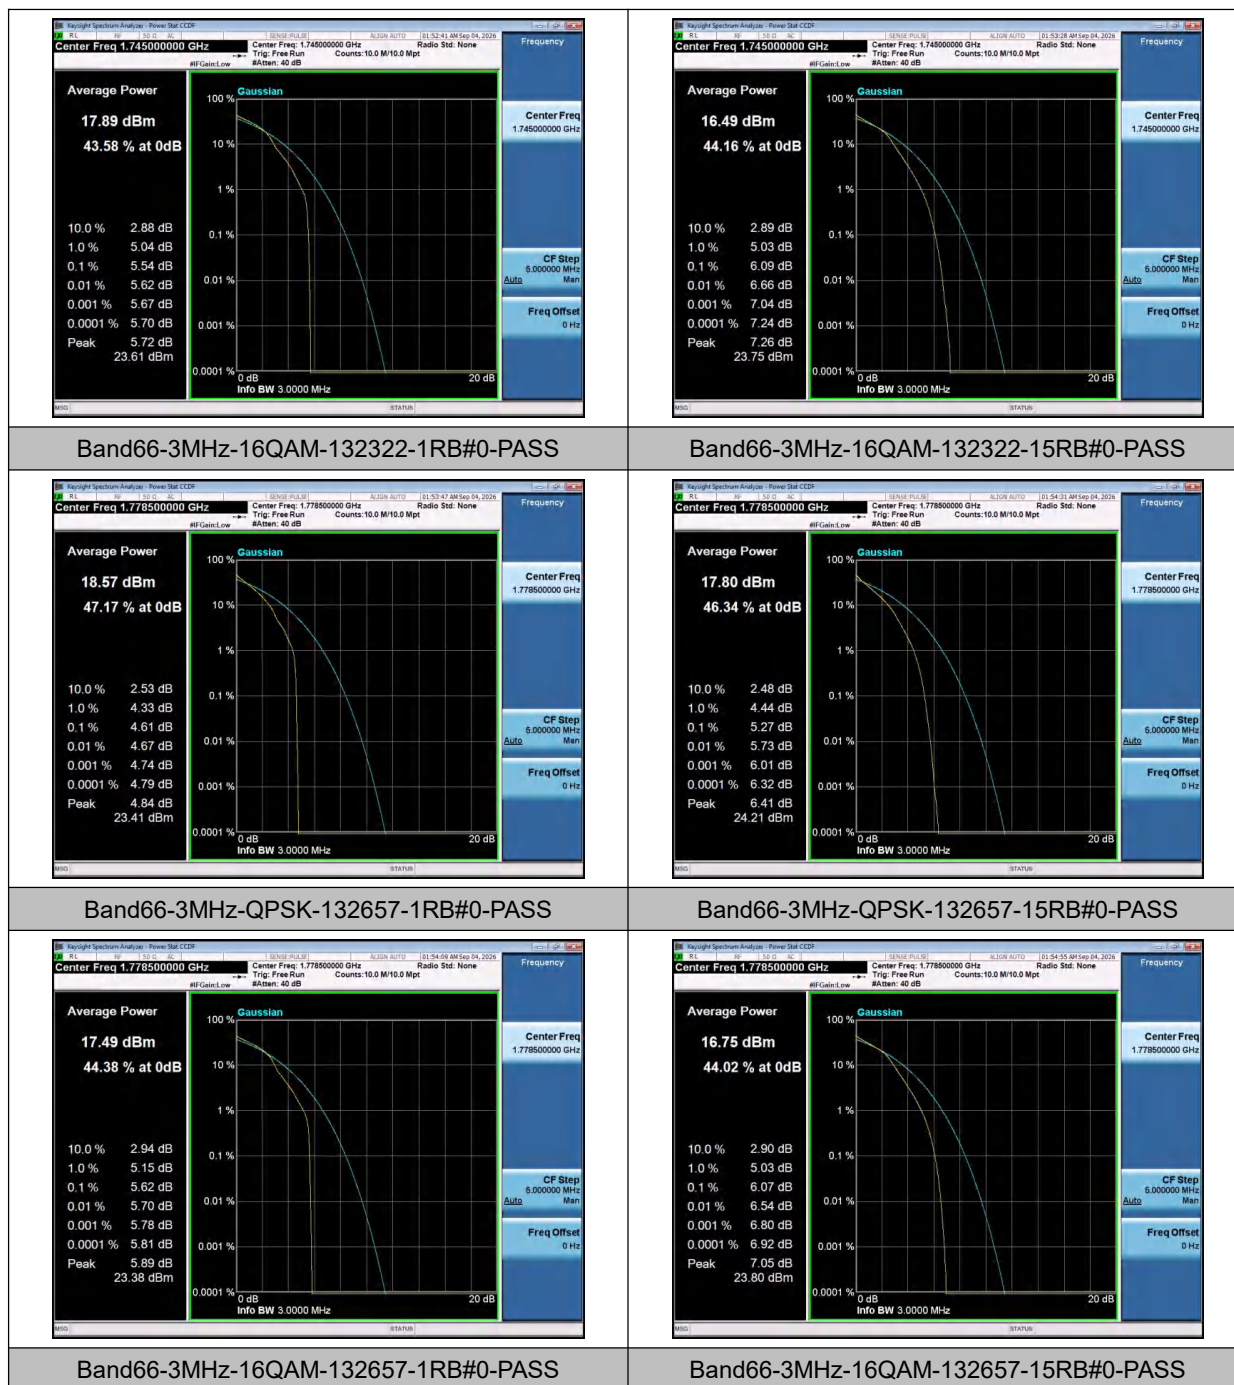


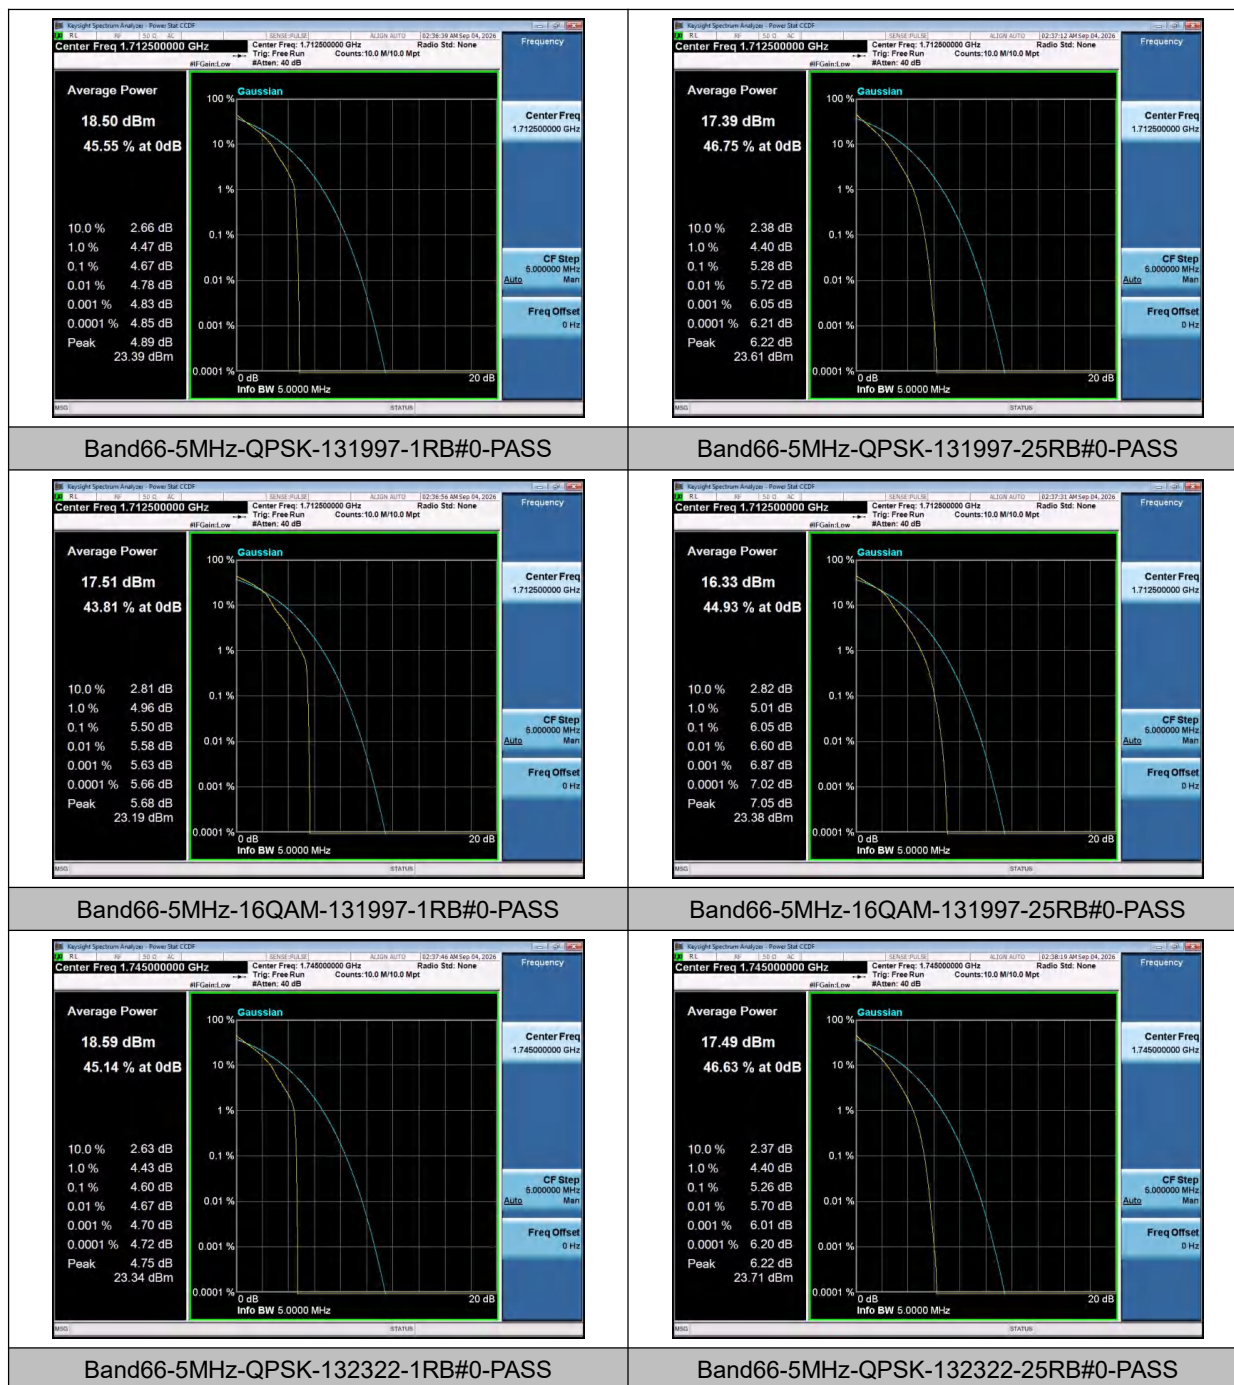


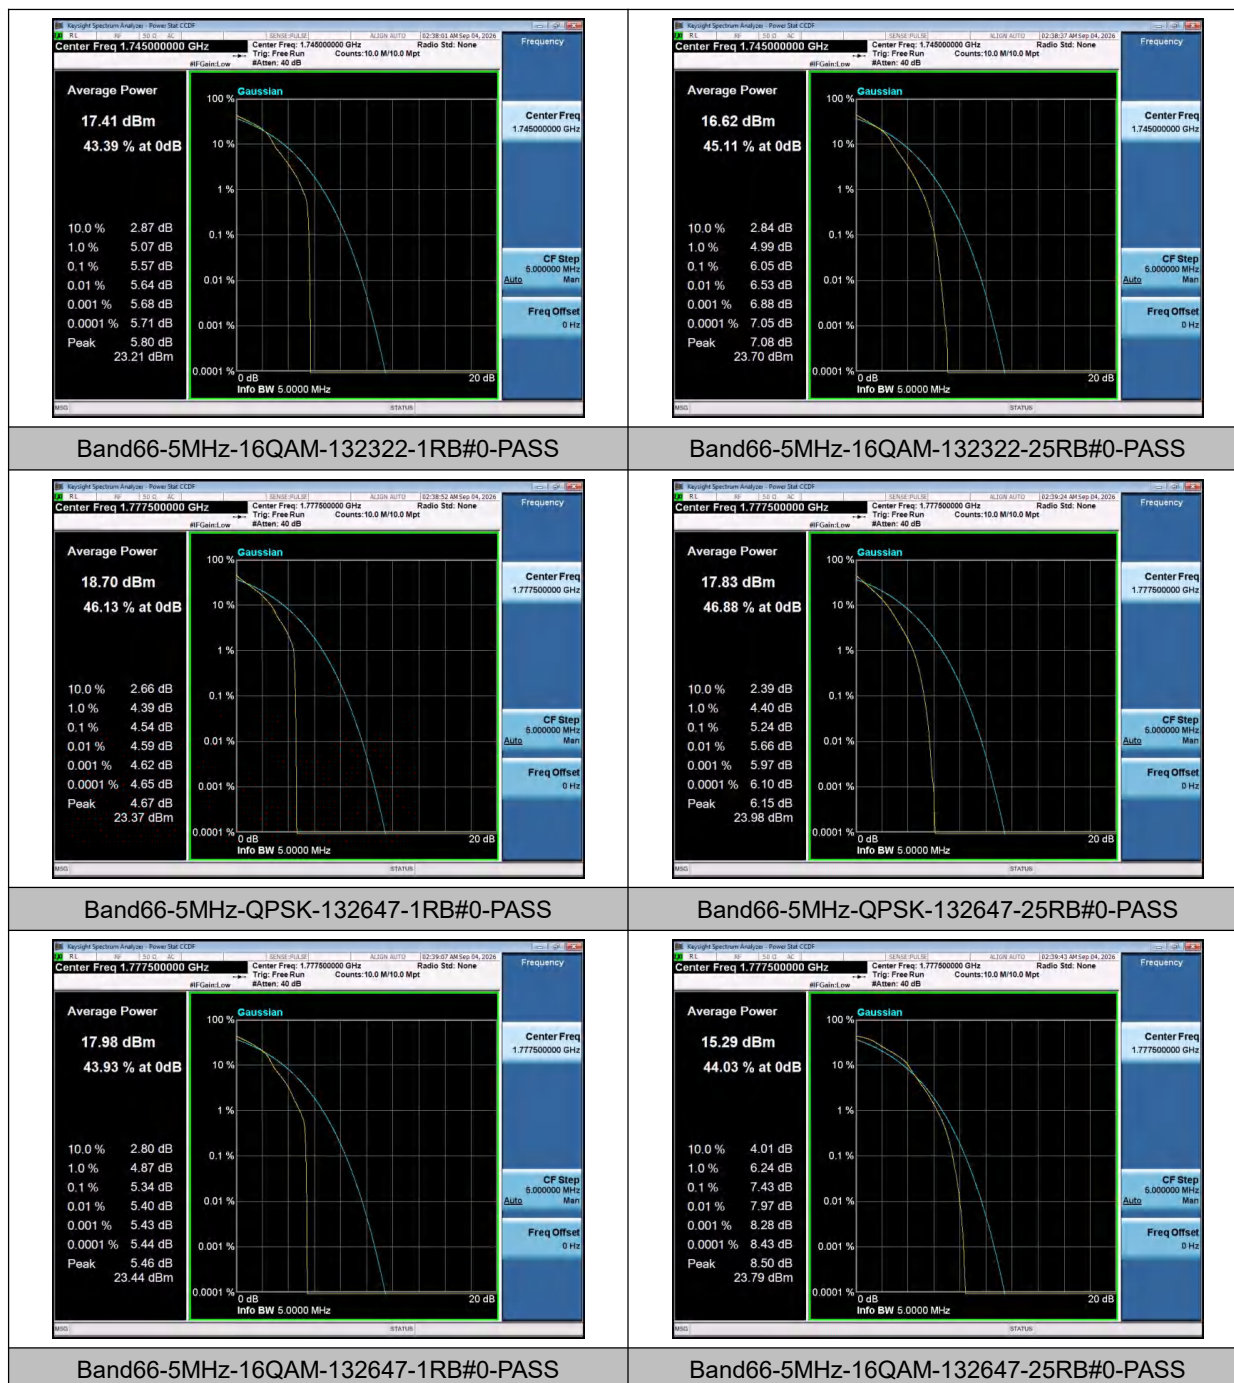

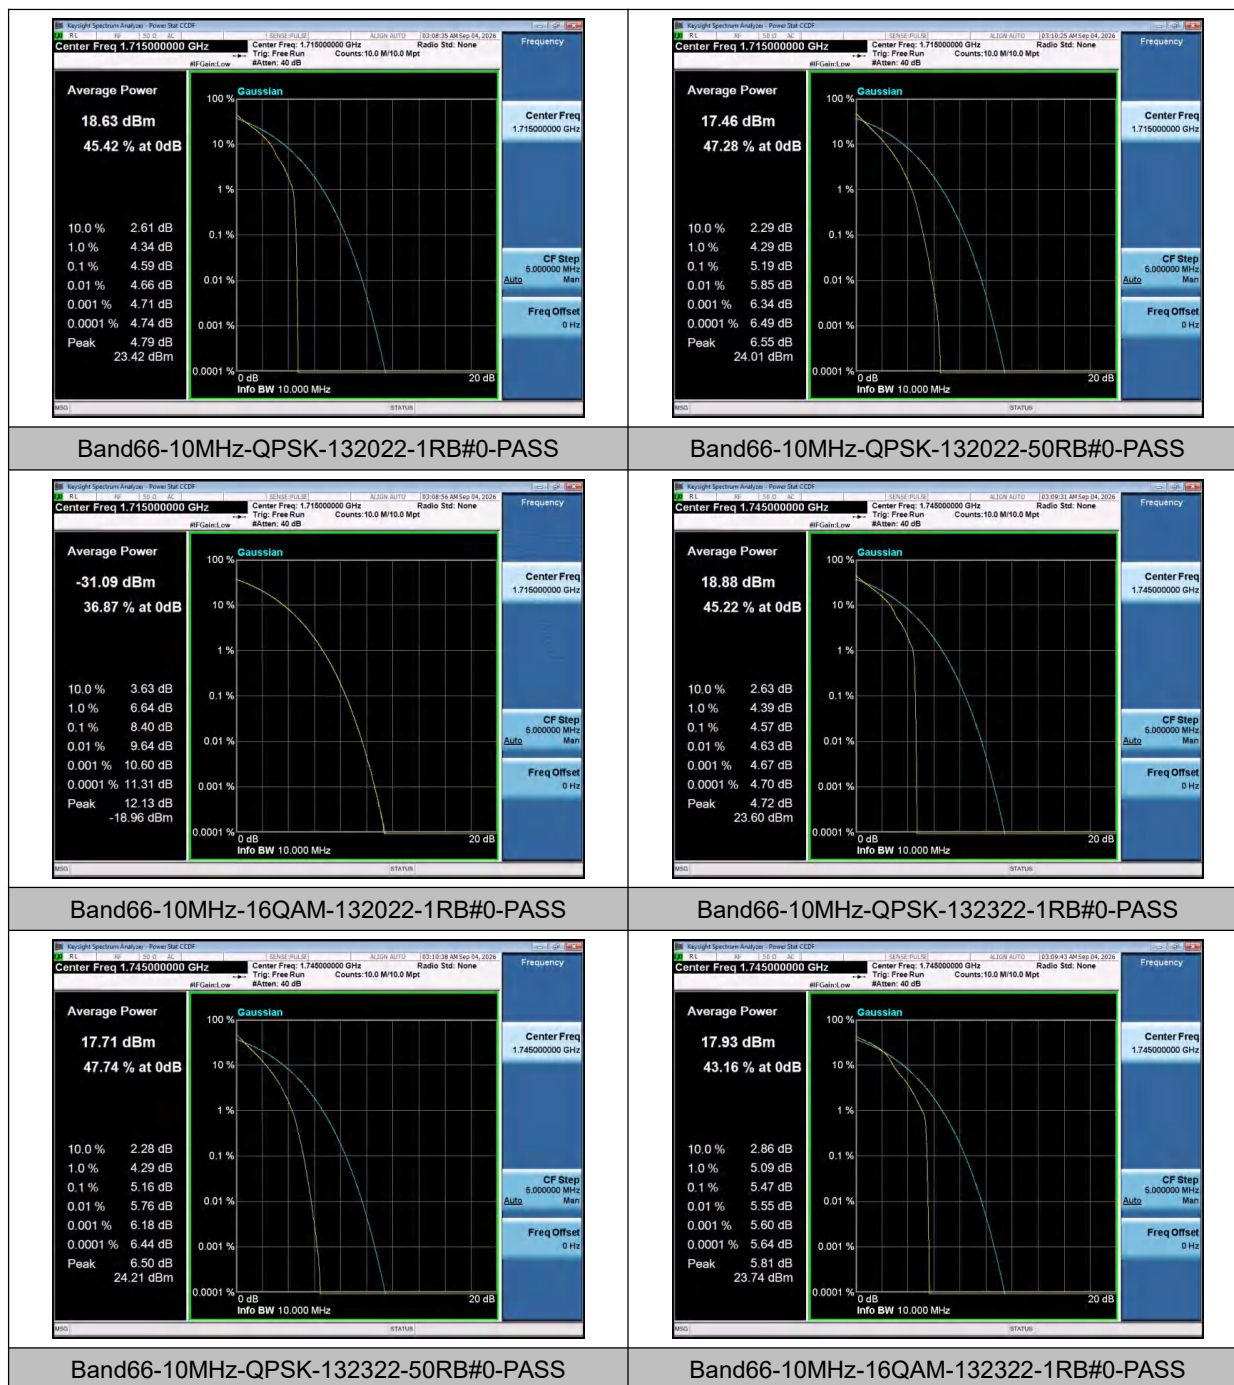

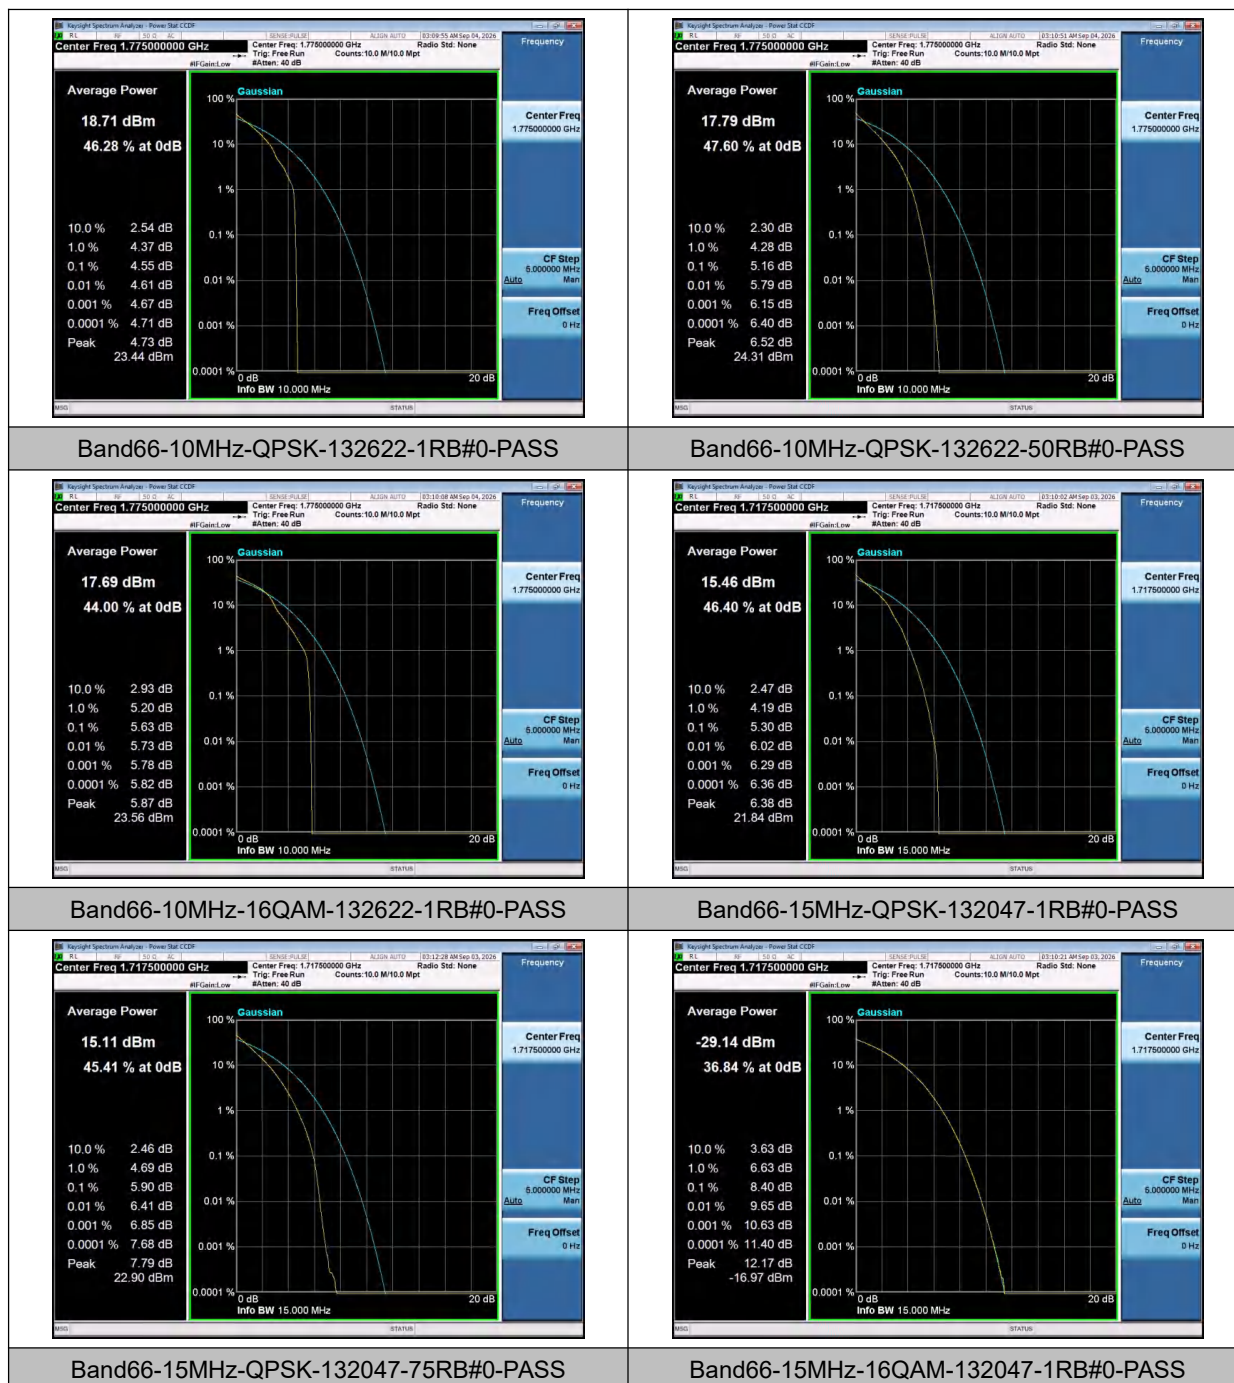

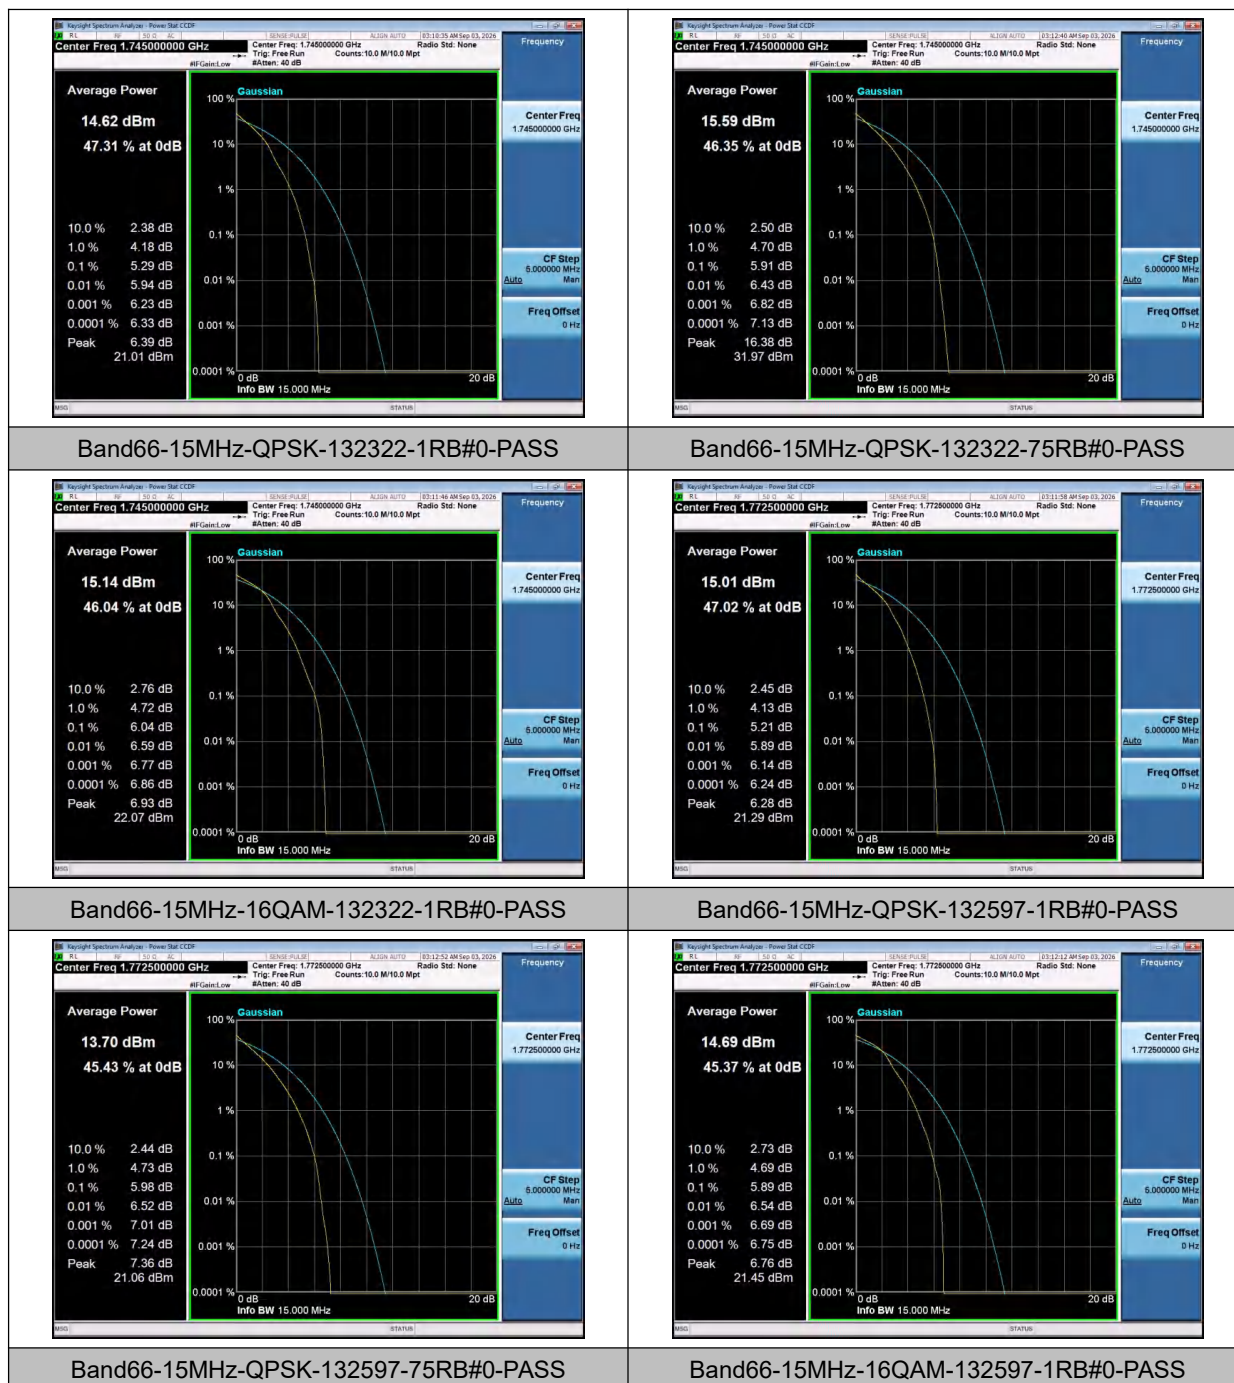

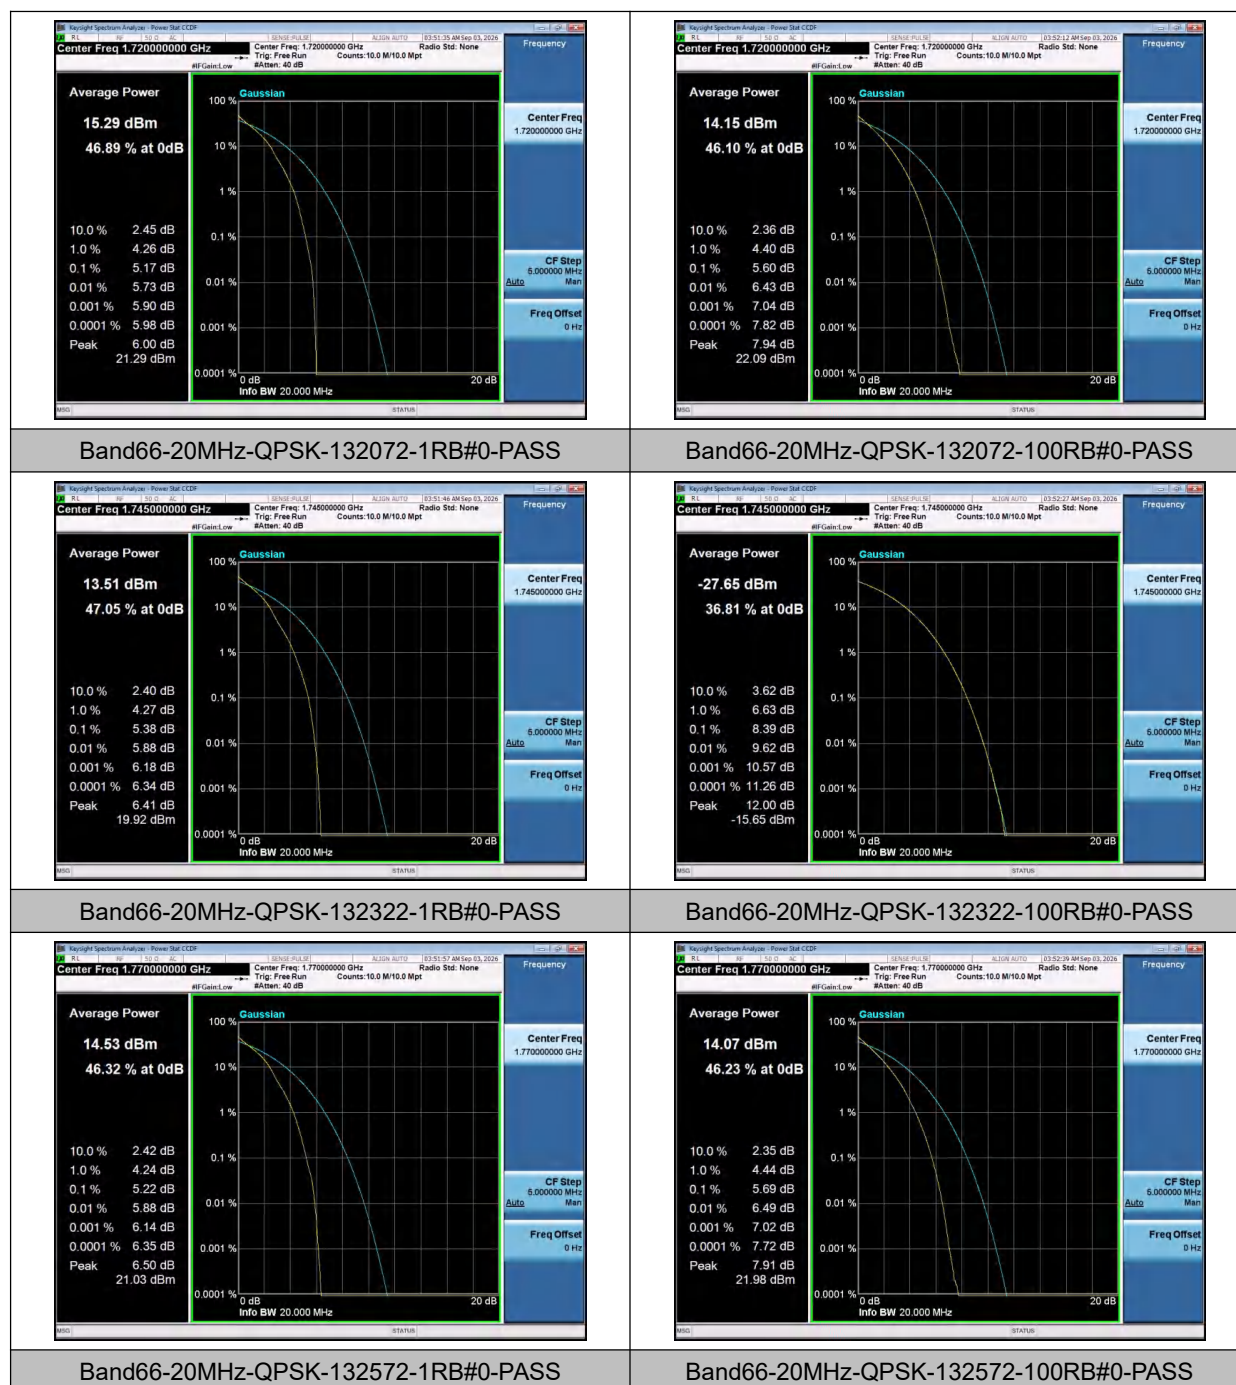



Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	1.0978	1.282	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	1.0984	1.298	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	1.0939	1.285	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	1.1006	1.290	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	1.0919	1.286	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	1.0963	1.275	PASS
Band66	3MHz	QPSK	131987	15RB#0	2.7032	2.971	PASS
Band66	3MHz	16QAM	131987	15RB#0	2.6898	2.981	PASS
Band66	3MHz	QPSK	132322	15RB#0	2.6944	2.955	PASS
Band66	3MHz	16QAM	132322	15RB#0	2.6905	2.946	PASS
Band66	3MHz	QPSK	132657	15RB#0	2.6989	2.972	PASS
Band66	3MHz	16QAM	132657	15RB#0	2.6927	2.964	PASS
Band66	5MHz	QPSK	131997	25RB#0	4.5006	5.004	PASS
Band66	5MHz	16QAM	131997	25RB#0	4.5045	4.952	PASS
Band66	5MHz	QPSK	132322	25RB#0	4.5005	5.024	PASS
Band66	5MHz	16QAM	132322	25RB#0	4.5055	4.963	PASS
Band66	10MHz	QPSK	132022	50RB#0	8.9616	9.902	PASS
Band66	10MHz	16QAM	132022	27RB#0	4.9825	5.777	PASS
Band66	10MHz	QPSK	132322	50RB#0	8.9614	9.911	PASS
Band66	10MHz	16QAM	132322	27RB#0	4.9702	5.828	PASS
Band66	10MHz	QPSK	132622	50RB#0	8.9587	9.824	PASS
Band66	10MHz	16QAM	132622	27RB#0	4.9866	5.857	PASS
Band66	15MHz	QPSK	132047	75RB#0	13.457	14.57	PASS
Band66	15MHz	16QAM	132047	27RB#0	5.0859	5.942	PASS
Band66	15MHz	QPSK	132322	75RB#0	13.469	14.60	PASS
Band66	15MHz	16QAM	132322	27RB#0	5.0535	5.884	PASS
Band66	15MHz	QPSK	132597	75RB#0	13.480	14.66	PASS
Band66	15MHz	16QAM	132597	27RB#0	5.0620	5.914	PASS
Band66	20MHz	QPSK	132072	100RB#0	17.973	19.20	PASS
Band66	20MHz	16QAM	132072	27RB#0	5.1531	6.092	PASS
Band66	20MHz	QPSK	132322	100RB#0	17.893	19.12	PASS
Band66	20MHz	16QAM	132322	27RB#0	5.1642	6.140	PASS
Band66	20MHz	QPSK	132572	100RB#0	17.987	19.34	PASS
Band66	20MHz	16QAM	132572	27RB#0	5.1690	6.114	PASS


Test Graphs

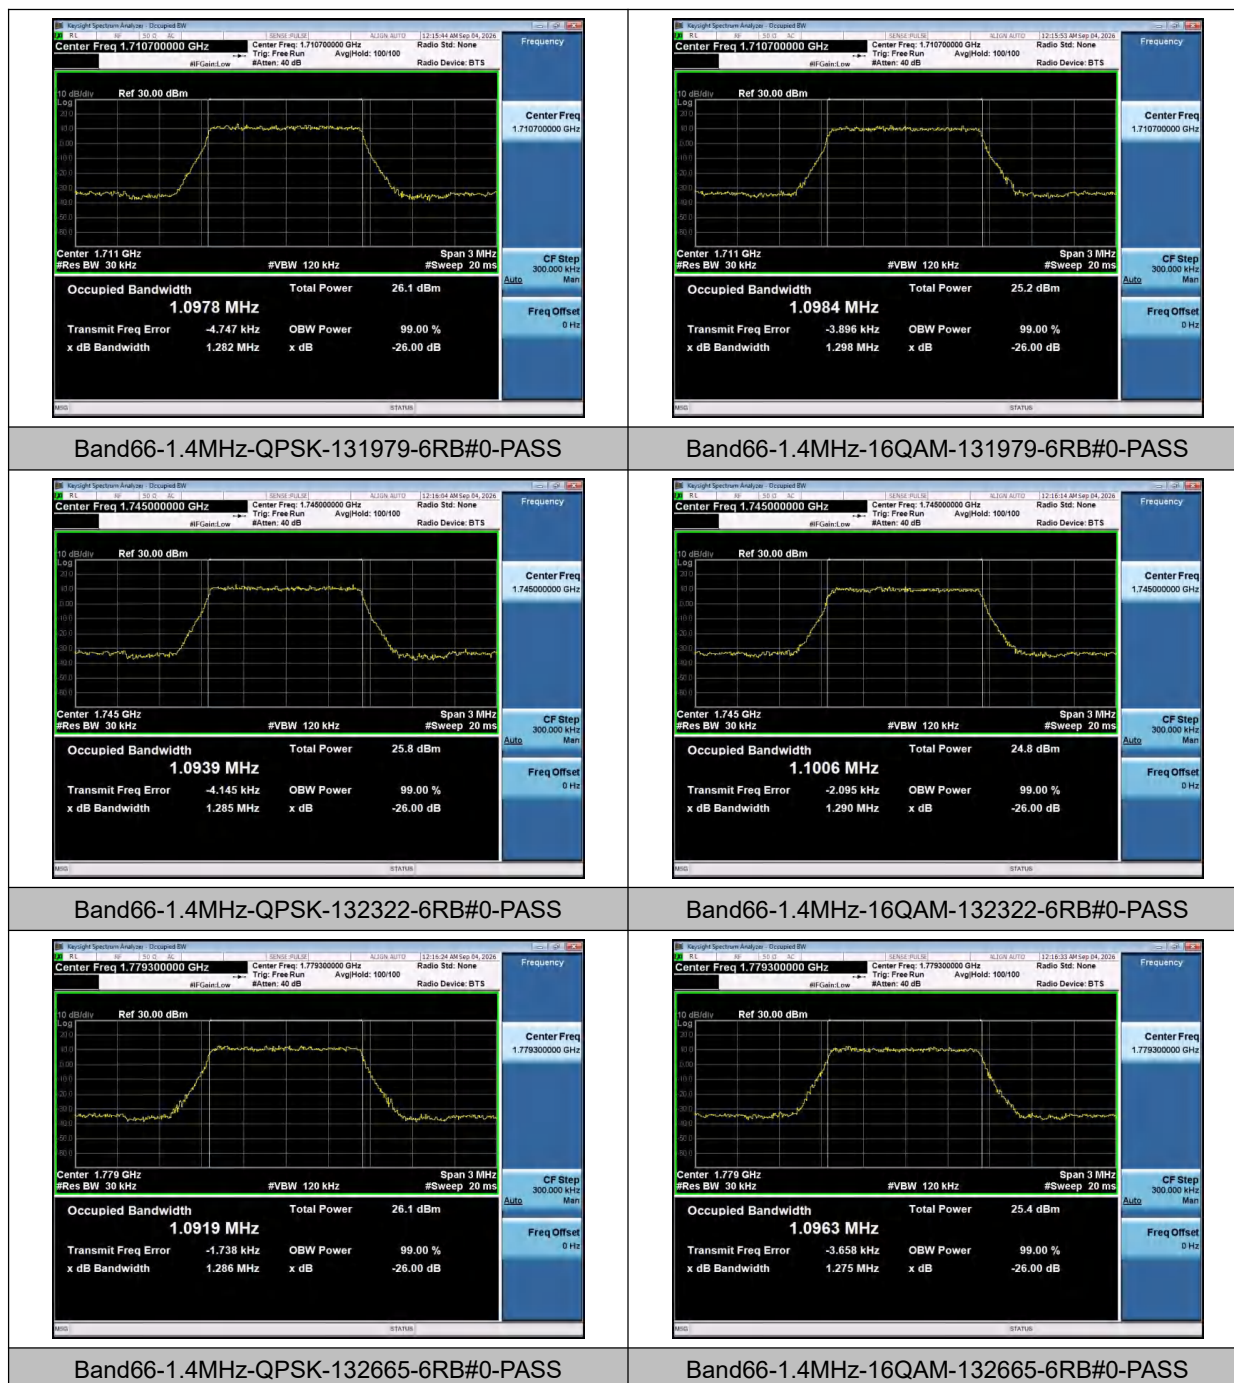


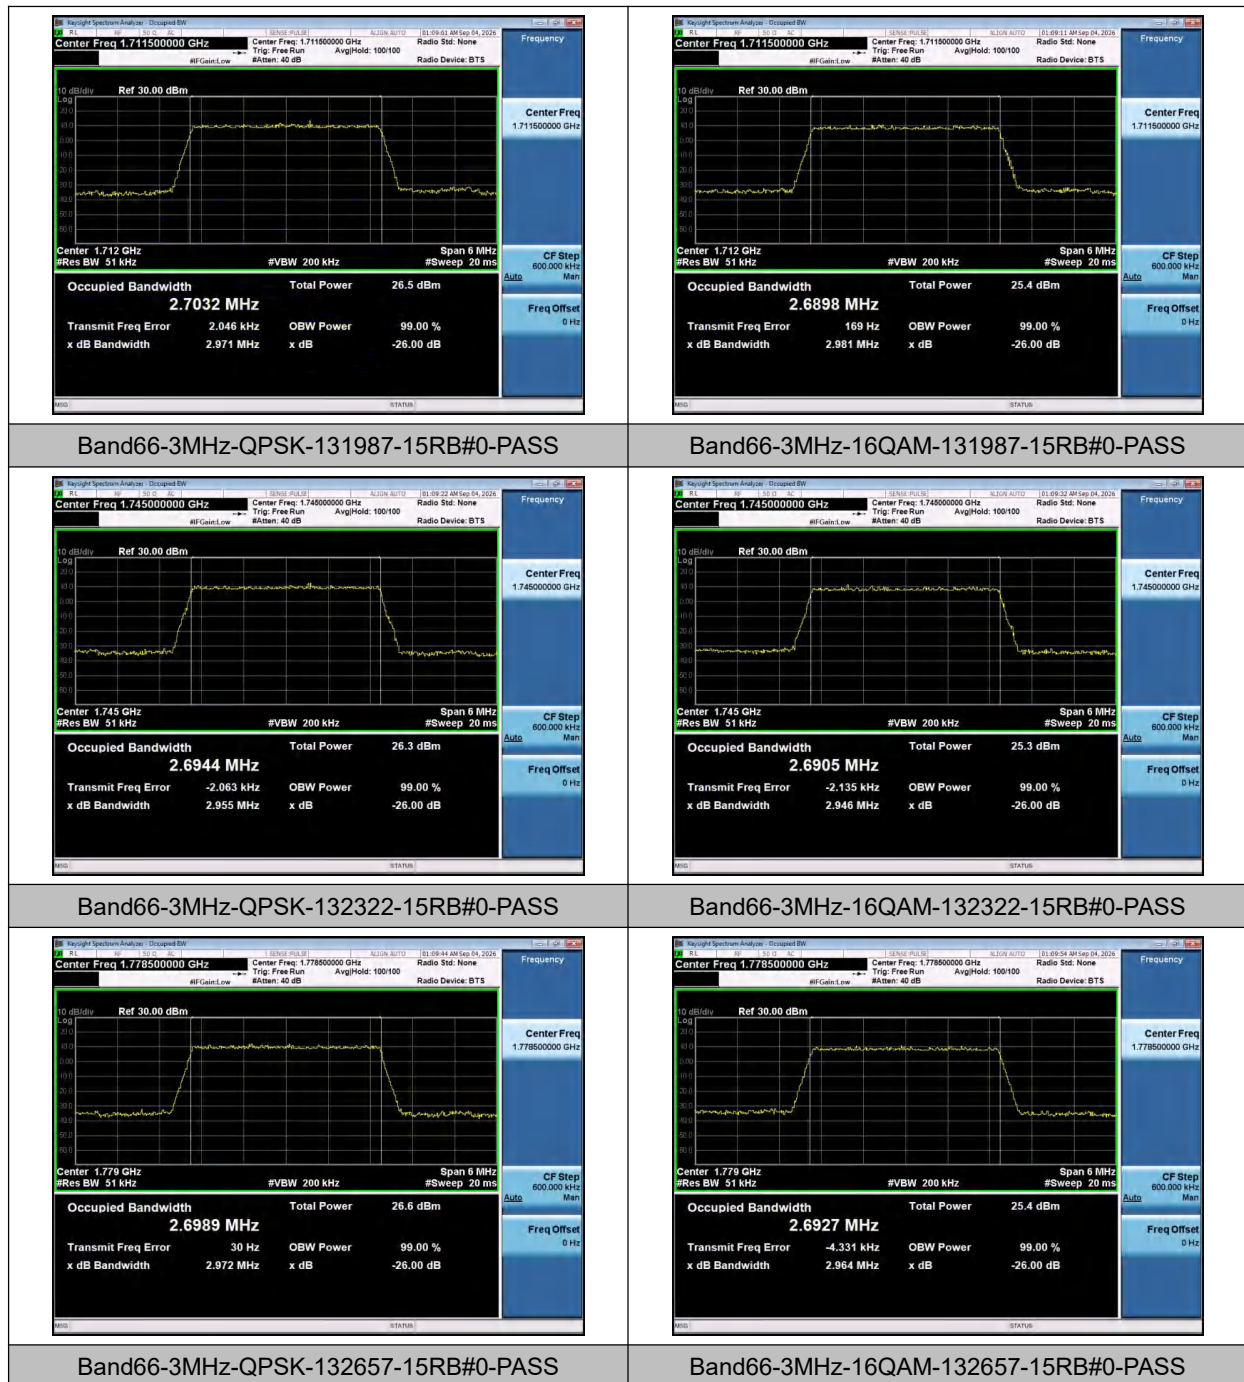



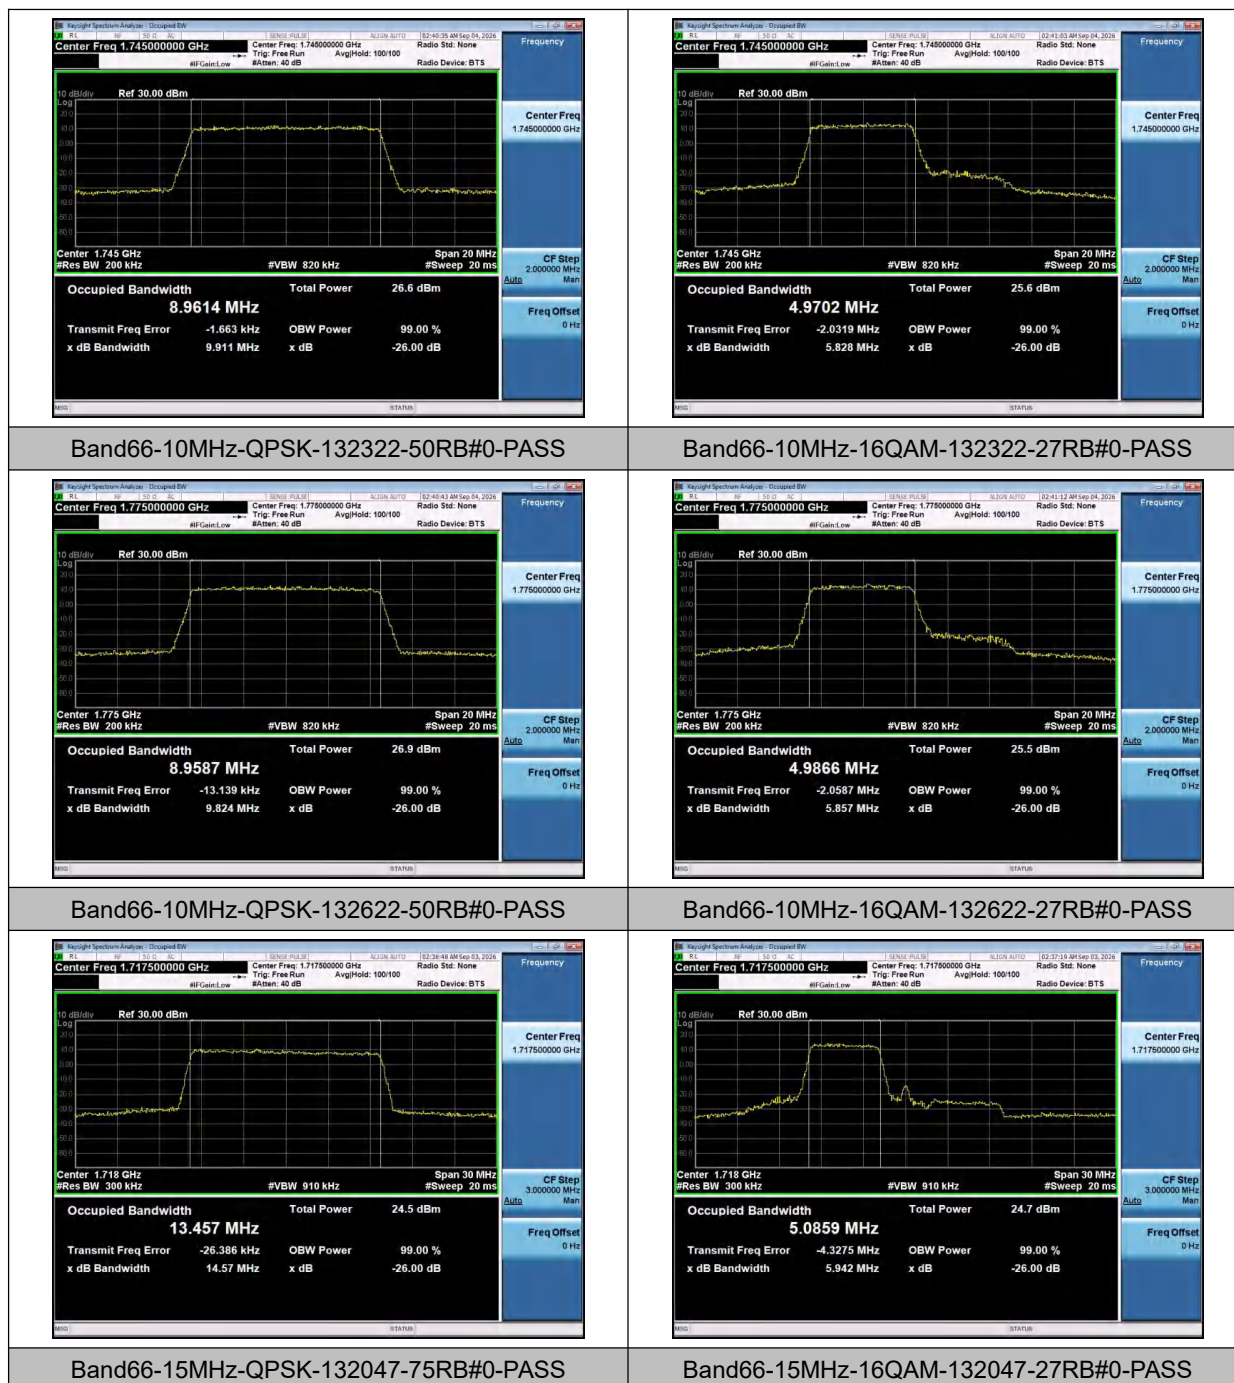

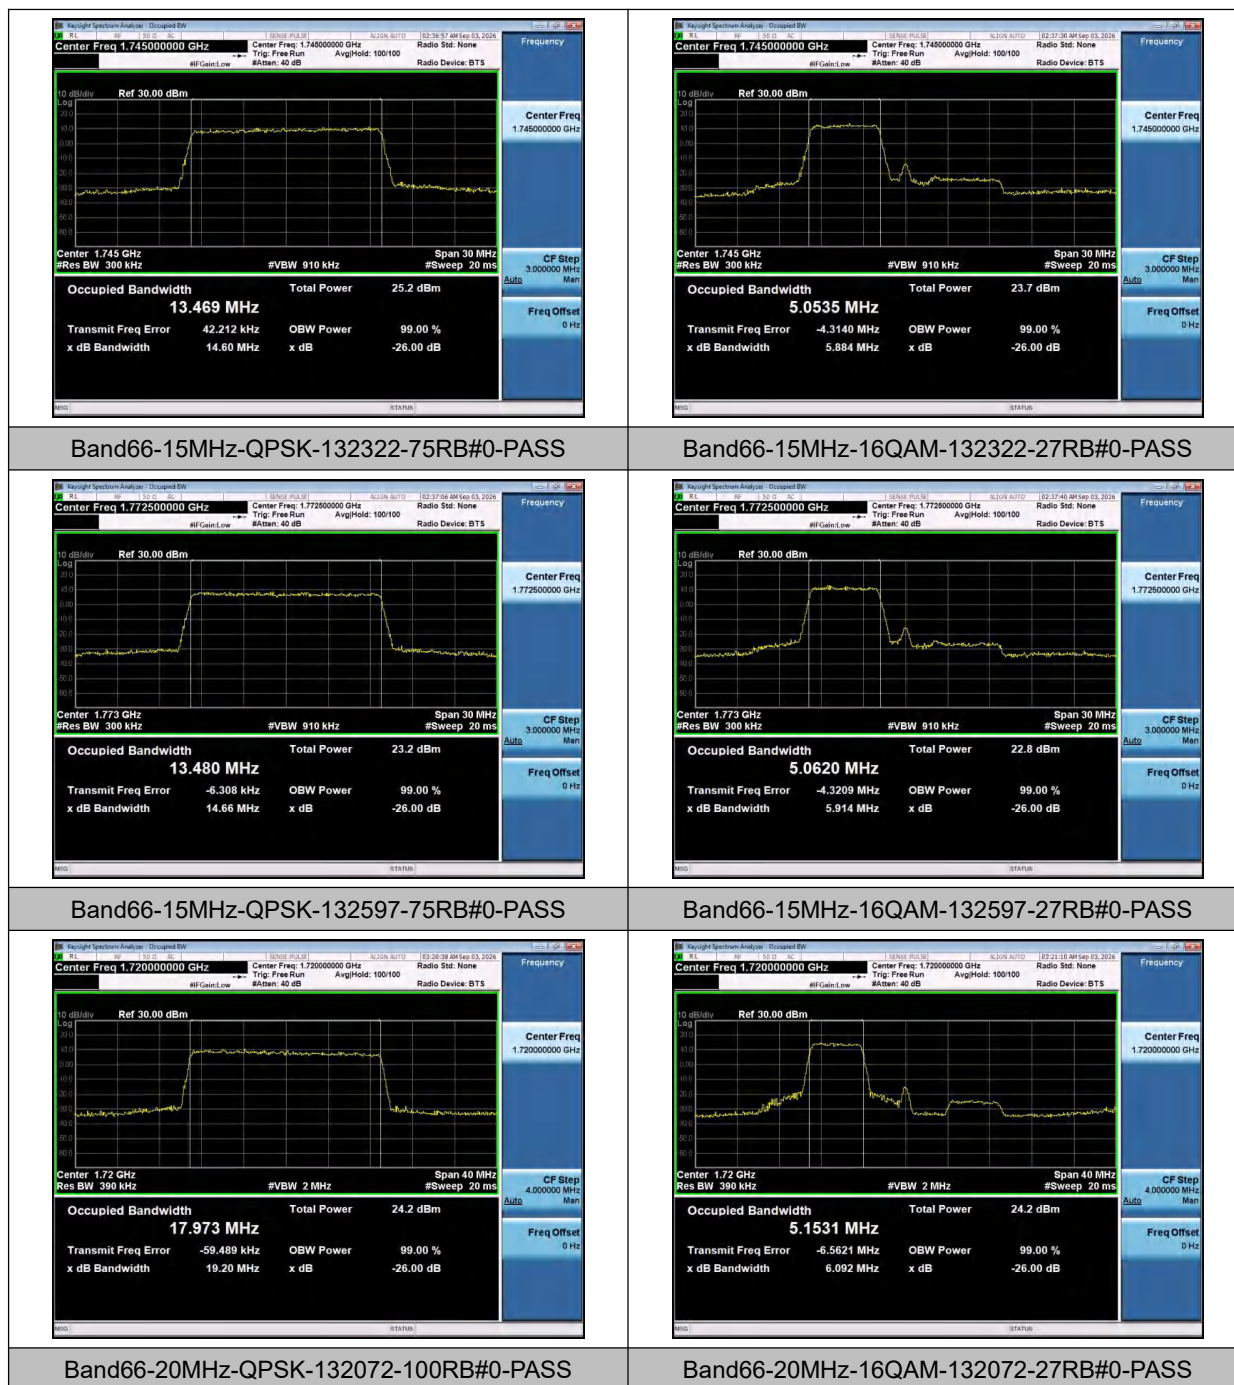

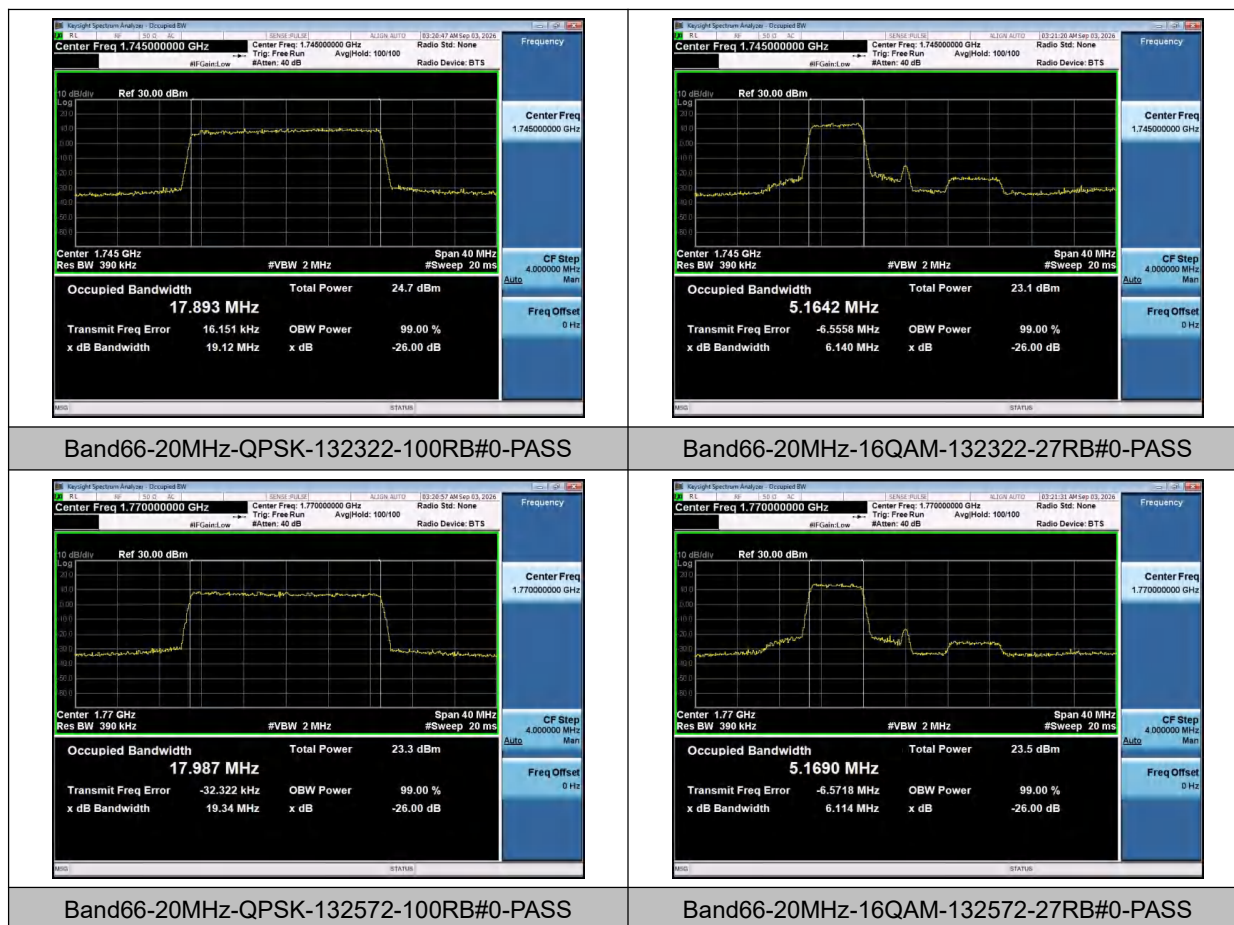

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Margin (dB)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	-33.55	20.55	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	-37.87	24.87	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	-40.19	27.19	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	-39.48	26.48	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	-38.25	25.25	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	-36.77	23.77	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	-38.53	25.53	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	-33.29	20.29	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	-38.65	25.65	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	-41.28	28.28	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	-37.76	24.76	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	-40.02	27.02	PASS
Band66	3MHz	QPSK	131987	1RB#0	-30.35	17.35	PASS
Band66	3MHz	QPSK	131987	1RB#14	-49.77	36.77	PASS
Band66	3MHz	QPSK	131987	15RB#0	-37.32	24.32	PASS
Band66	3MHz	16QAM	131987	1RB#0	-31.57	18.57	PASS
Band66	3MHz	16QAM	131987	1RB#14	-51.34	38.34	PASS
Band66	3MHz	16QAM	131987	15RB#0	-38.42	25.42	PASS
Band66	3MHz	QPSK	132657	1RB#0	-50.50	37.50	PASS
Band66	3MHz	QPSK	132657	1RB#14	-30.82	17.82	PASS
Band66	3MHz	QPSK	132657	15RB#0	-38.79	25.79	PASS
Band66	3MHz	16QAM	132657	1RB#0	-51.57	38.57	PASS
Band66	3MHz	16QAM	132657	1RB#14	-32.60	19.60	PASS
Band66	3MHz	16QAM	132657	15RB#0	-39.70	26.70	PASS
Band66	5MHz	QPSK	131997	1RB#0	-32.81	19.81	PASS
Band66	5MHz	QPSK	131997	1RB#24	-55.15	42.15	PASS
Band66	5MHz	QPSK	131997	25RB#0	-40.18	27.18	PASS
Band66	5MHz	16QAM	131997	1RB#0	-34.36	21.36	PASS
Band66	5MHz	16QAM	131997	1RB#24	-55.04	42.04	PASS
Band66	5MHz	16QAM	131997	25RB#0	-41.08	28.08	PASS
Band66	5MHz	QPSK	132647	1RB#0	-54.30	41.30	PASS
Band66	5MHz	QPSK	132647	1RB#24	-32.52	19.52	PASS
Band66	5MHz	QPSK	132647	25RB#0	-39.59	26.59	PASS
Band66	5MHz	16QAM	132647	1RB#0	-54.56	41.56	PASS
Band66	5MHz	16QAM	132647	1RB#24	-34.67	21.67	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band66	5MHz	16QAM	132647	25RB#0	-41.21	28.21	PASS
Band66	10MHz	QPSK	132022	1RB#0	-43.58	30.58	PASS
Band66	10MHz	QPSK	132022	1RB#49	-52.36	39.36	PASS
Band66	10MHz	QPSK	132022	50RB#0	-41.84	28.84	PASS
Band66	10MHz	16QAM	132022	1RB#0	-44.50	31.50	PASS
Band66	10MHz	16QAM	132022	1RB#49	-52.23	39.23	PASS
Band66	10MHz	QPSK	132622	1RB#0	-51.68	38.68	PASS
Band66	10MHz	QPSK	132622	1RB#49	-43.15	30.15	PASS
Band66	10MHz	QPSK	132622	50RB#0	-43.02	30.02	PASS
Band66	10MHz	16QAM	132622	1RB#0	-51.60	38.60	PASS
Band66	10MHz	16QAM	132622	1RB#49	-44.27	31.27	PASS
Band66	15MHz	QPSK	132047	1RB#0	-44.77	31.77	PASS
Band66	15MHz	QPSK	132047	1RB#74	-50.38	37.38	PASS
Band66	15MHz	QPSK	132047	75RB#0	-44.82	31.82	PASS
Band66	15MHz	16QAM	132047	1RB#0	-44.88	31.88	PASS
Band66	15MHz	16QAM	132047	1RB#74	-50.43	37.43	PASS
Band66	15MHz	QPSK	132597	1RB#0	-50.00	37.00	PASS
Band66	15MHz	QPSK	132597	1RB#74	-45.51	32.51	PASS
Band66	15MHz	QPSK	132597	75RB#0	-45.34	32.34	PASS
Band66	15MHz	16QAM	132597	1RB#0	-50.00	37.00	PASS
Band66	15MHz	16QAM	132597	1RB#74	-45.63	32.63	PASS
Band66	20MHz	QPSK	132072	100RB#0	-44.21	31.21	PASS
Band66	20MHz	16QAM	132072	1RB#0	-46.41	33.41	PASS
Band66	20MHz	16QAM	132072	1RB#99	-46.80	33.80	PASS
Band66	20MHz	QPSK	132572	1RB#0	-47.86	34.86	PASS
Band66	20MHz	QPSK	132572	1RB#99	-47.18	34.18	PASS
Band66	20MHz	QPSK	132572	100RB#0	-44.14	31.14	PASS
Band66	20MHz	16QAM	132572	1RB#0	-47.60	34.60	PASS
Band66	20MHz	16QAM	132572	1RB#99	-47.50	34.50	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

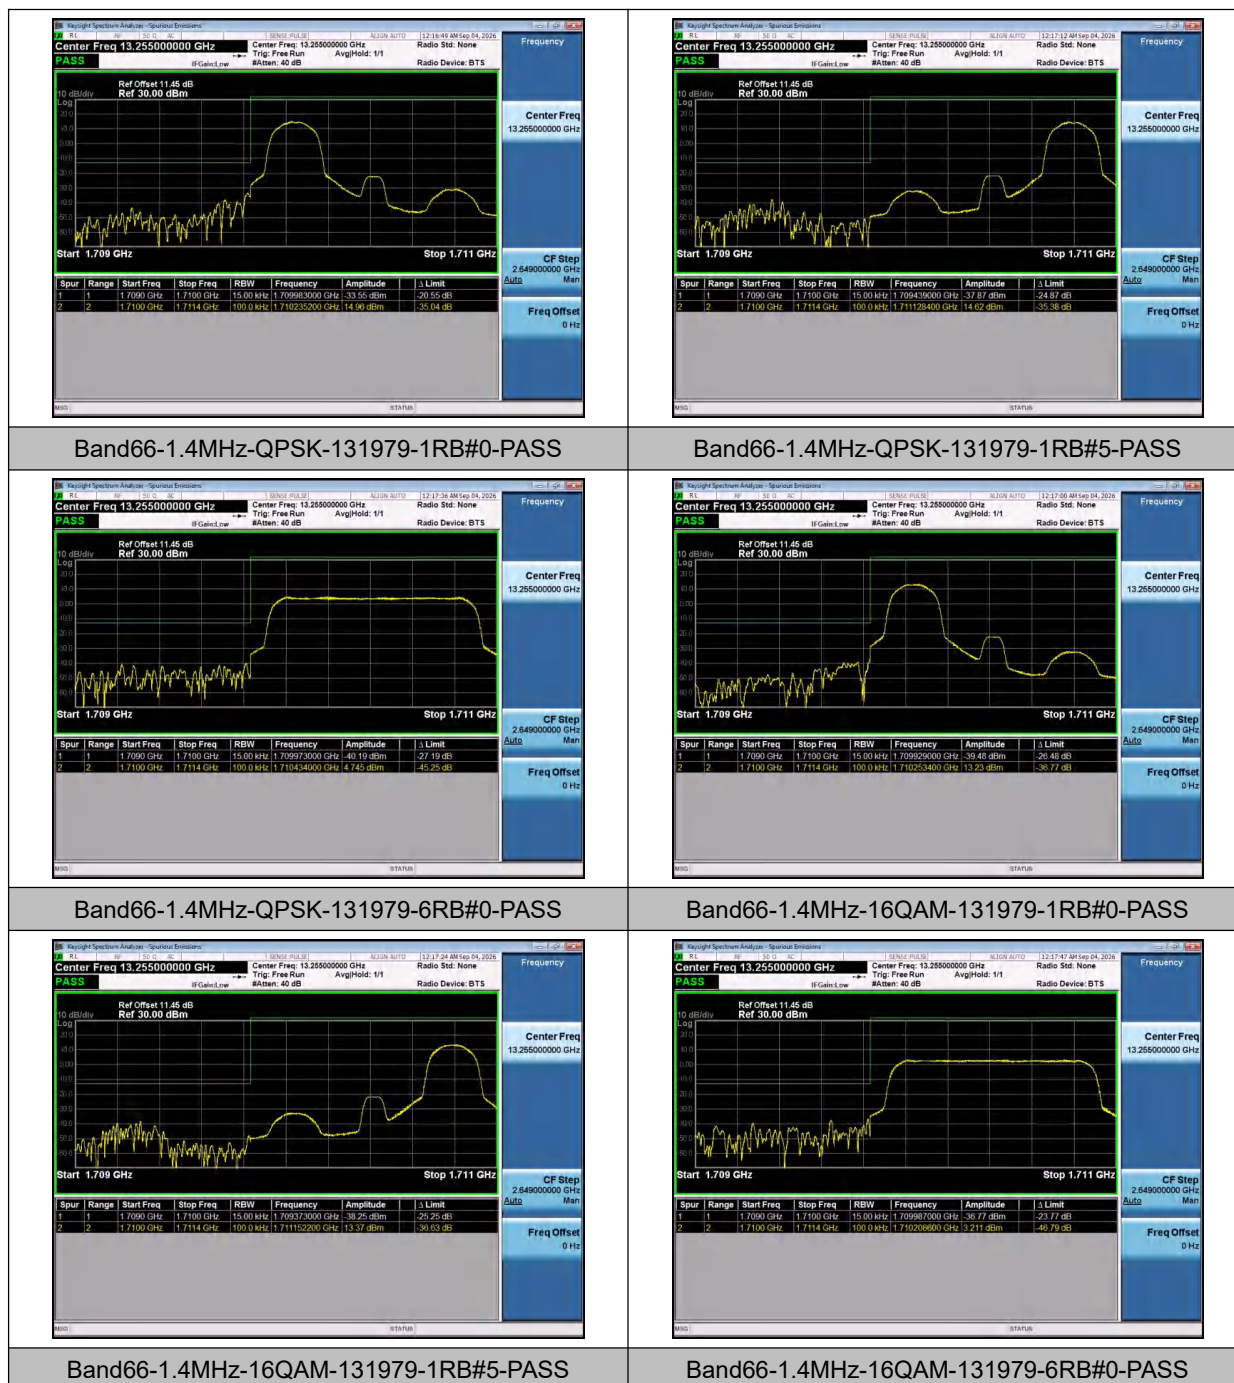


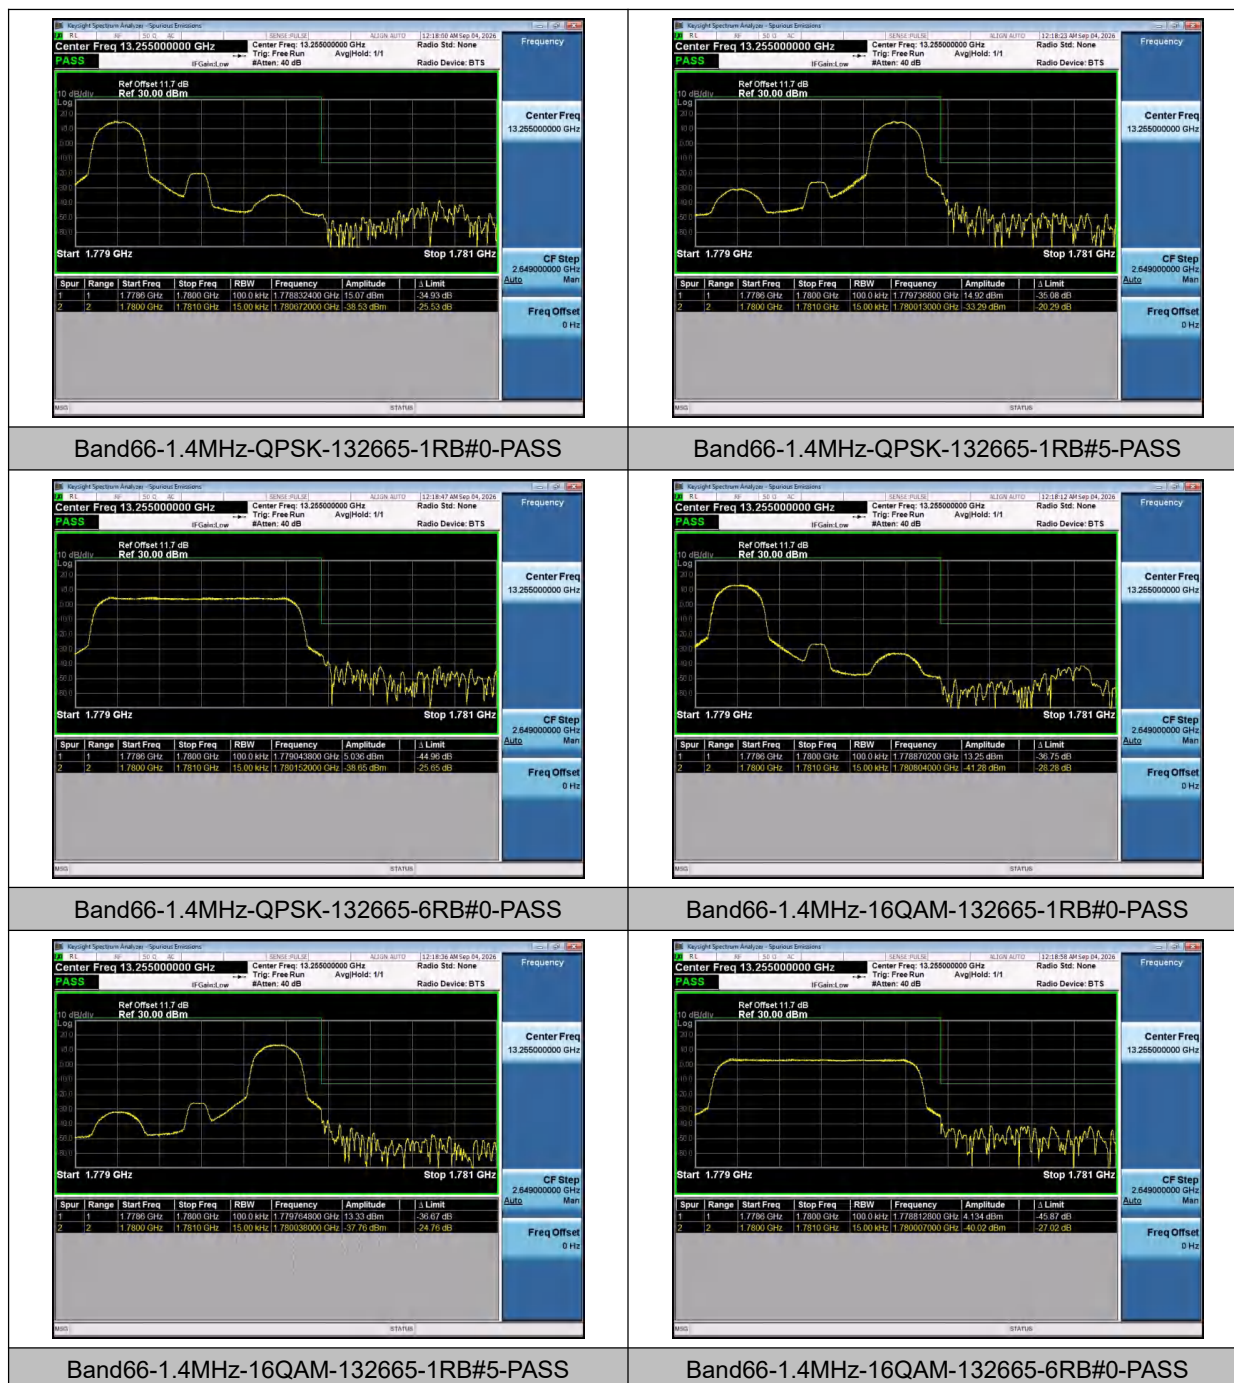


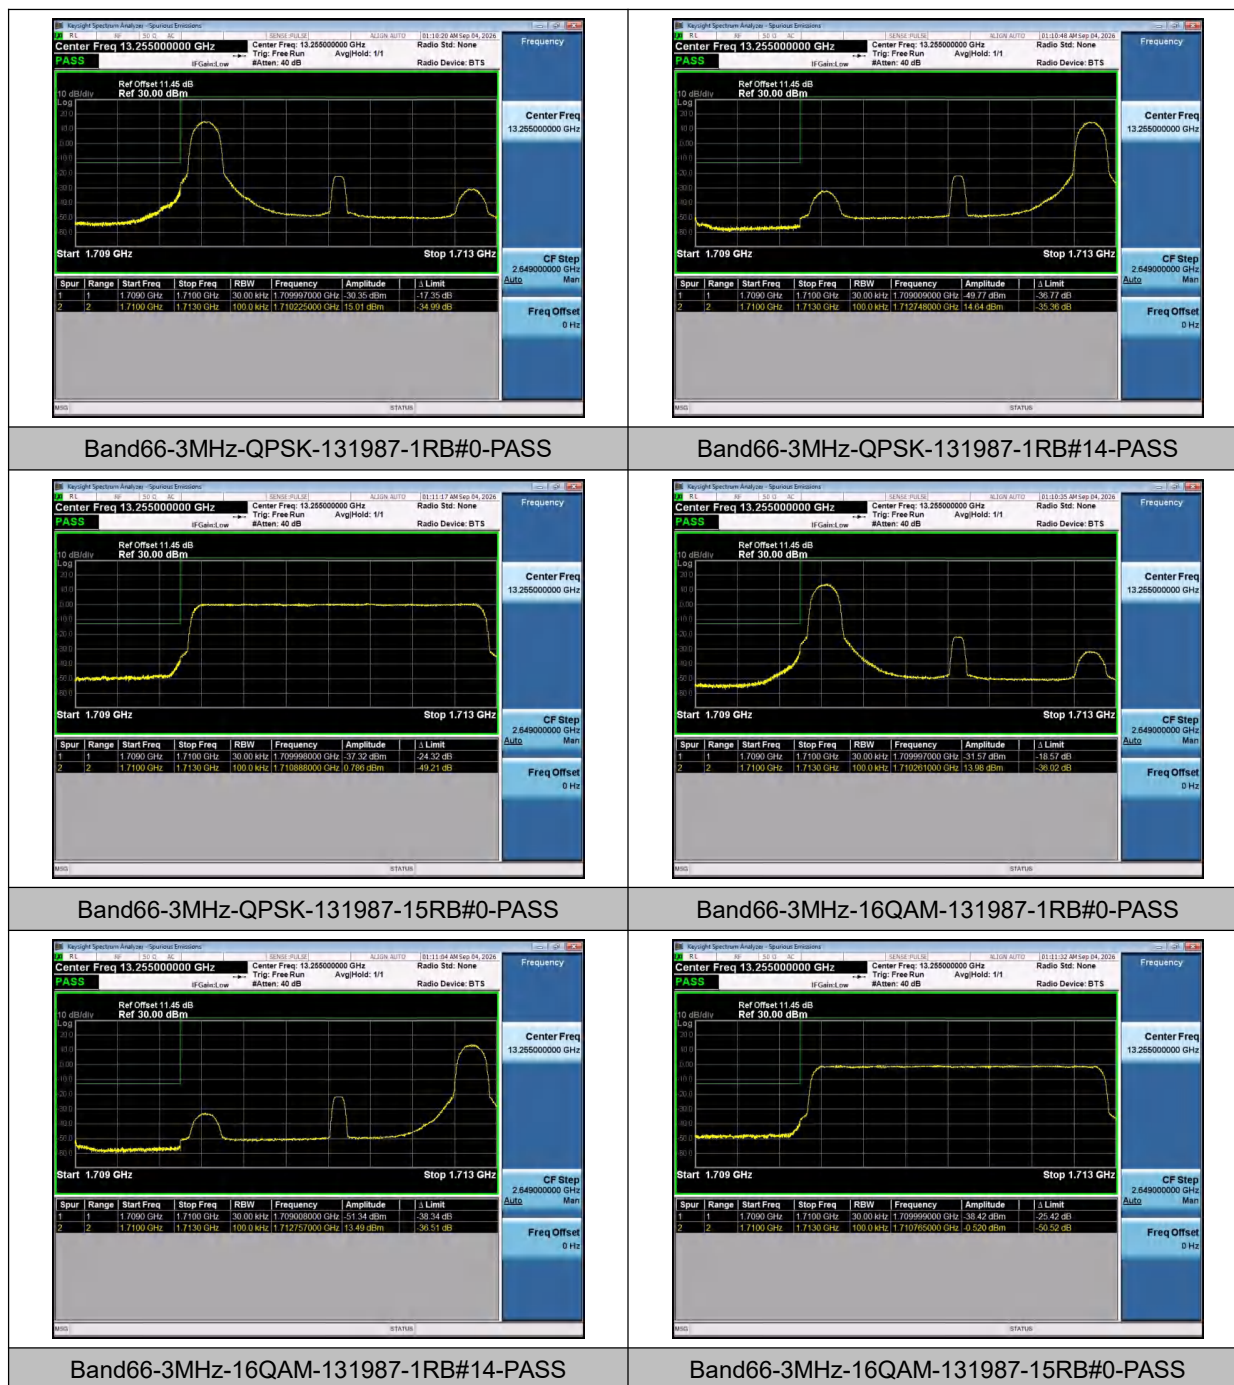


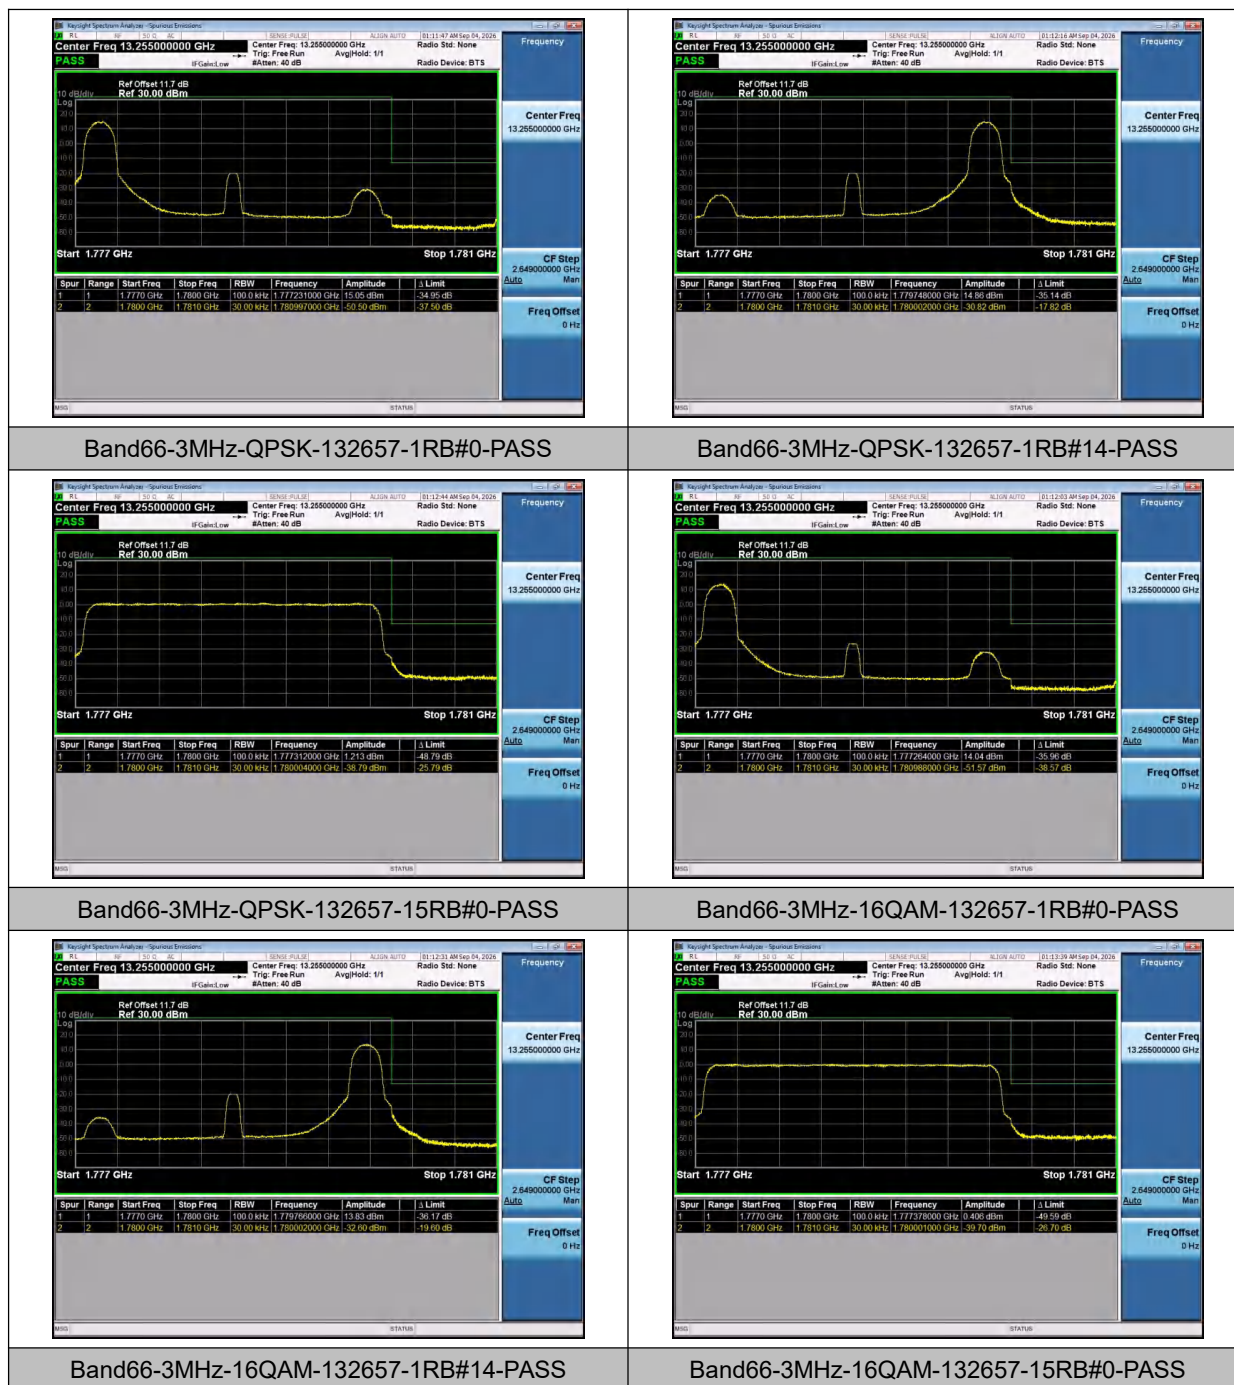


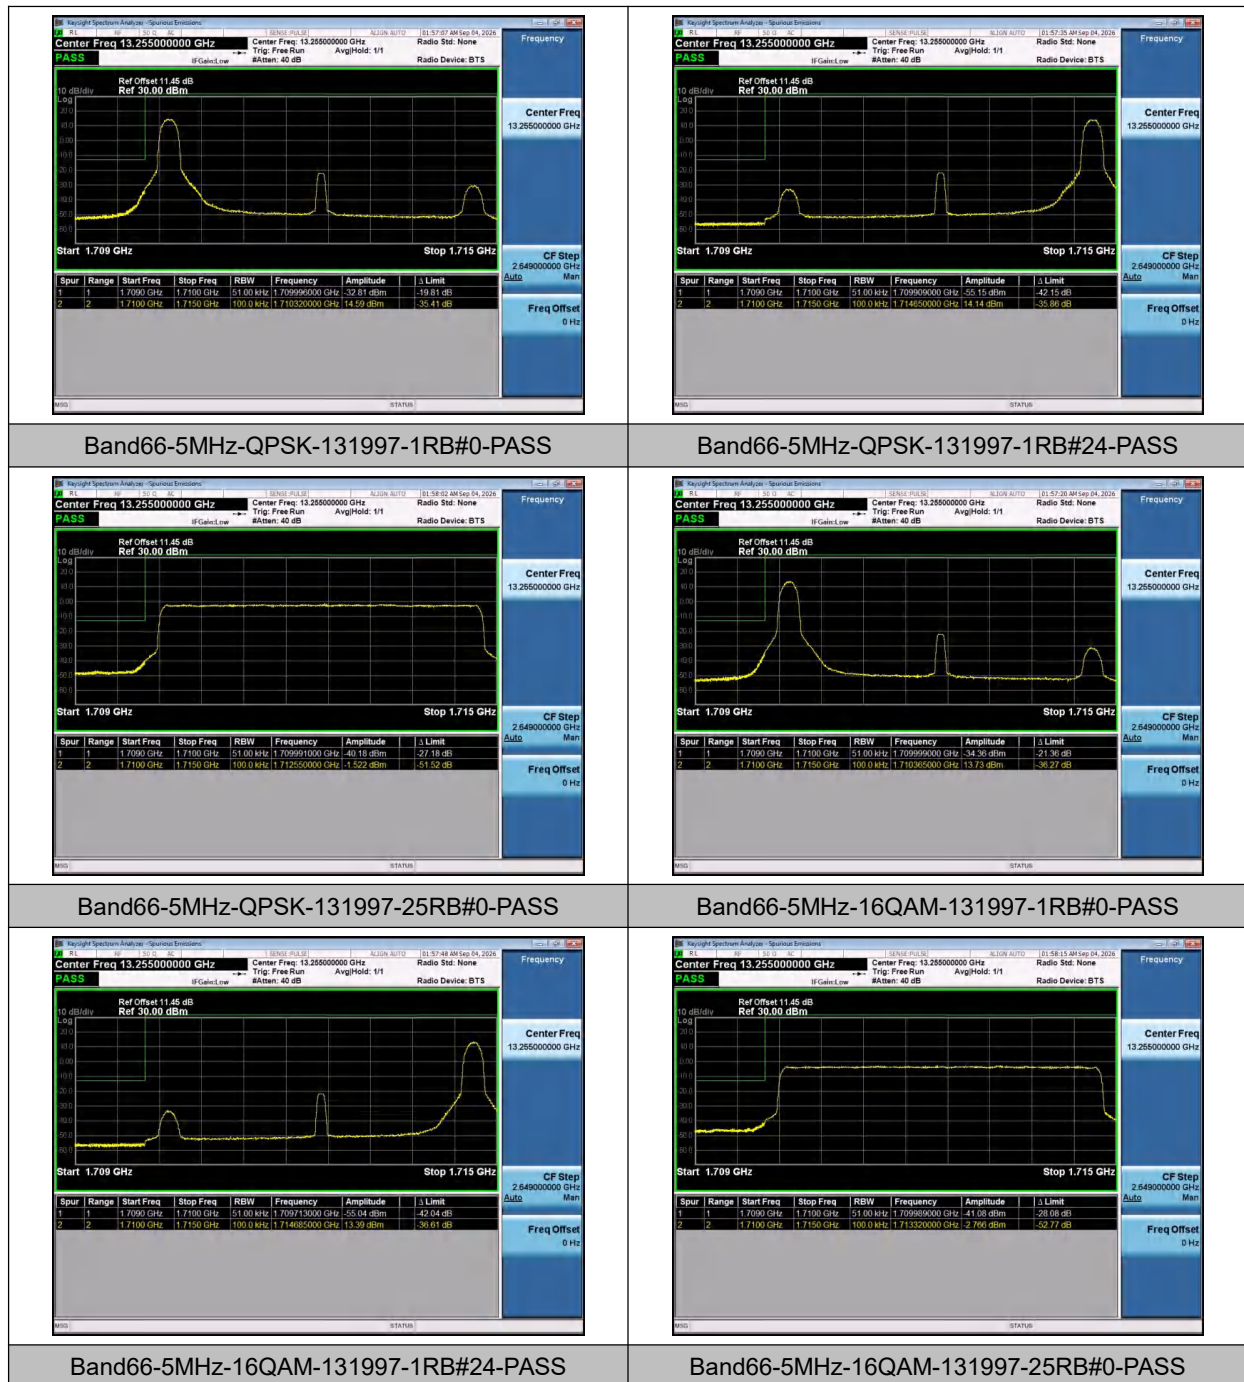


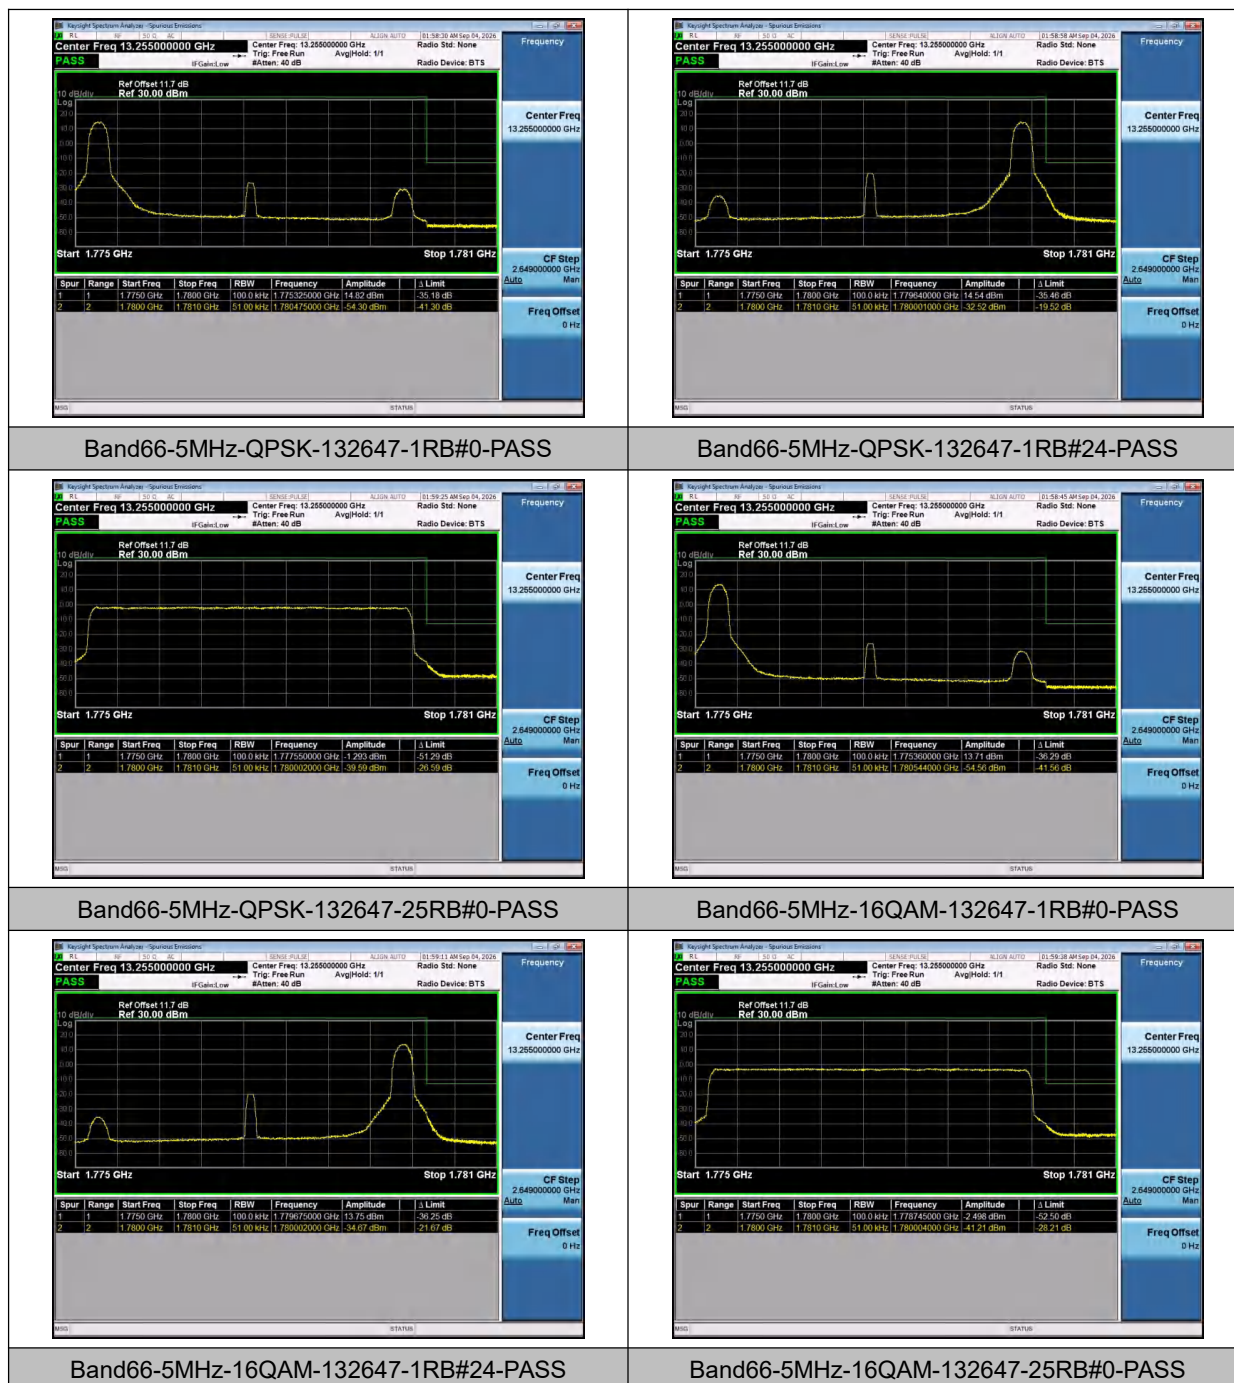


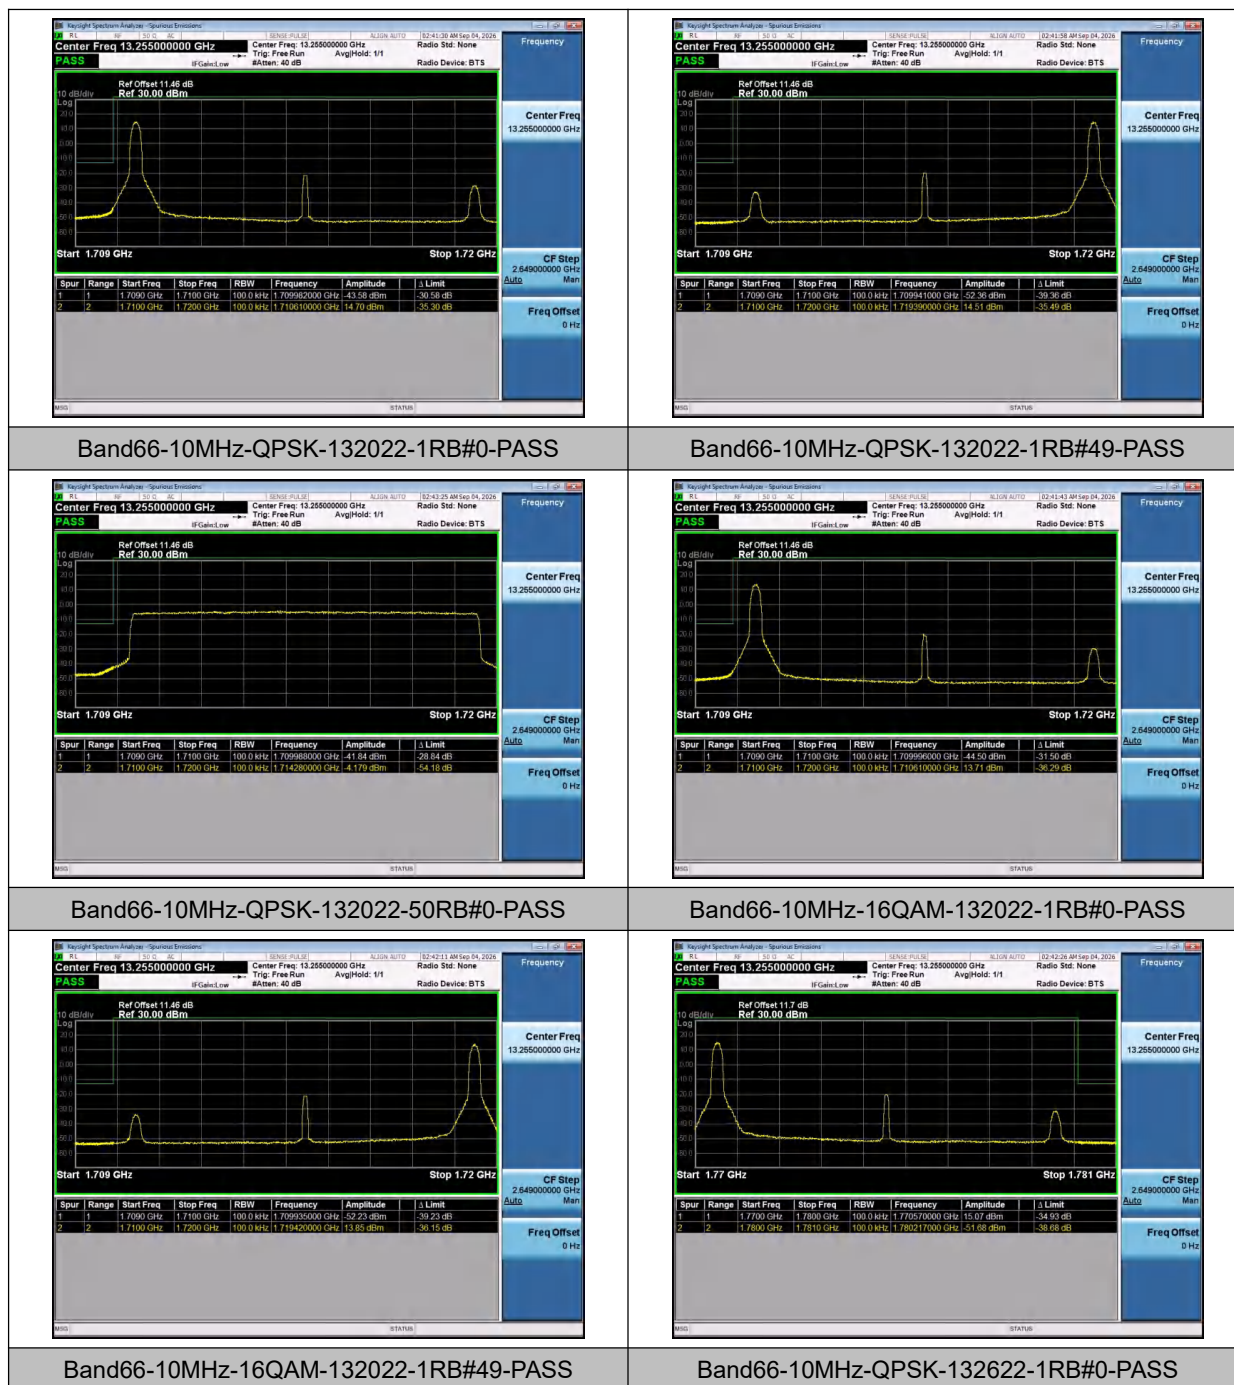

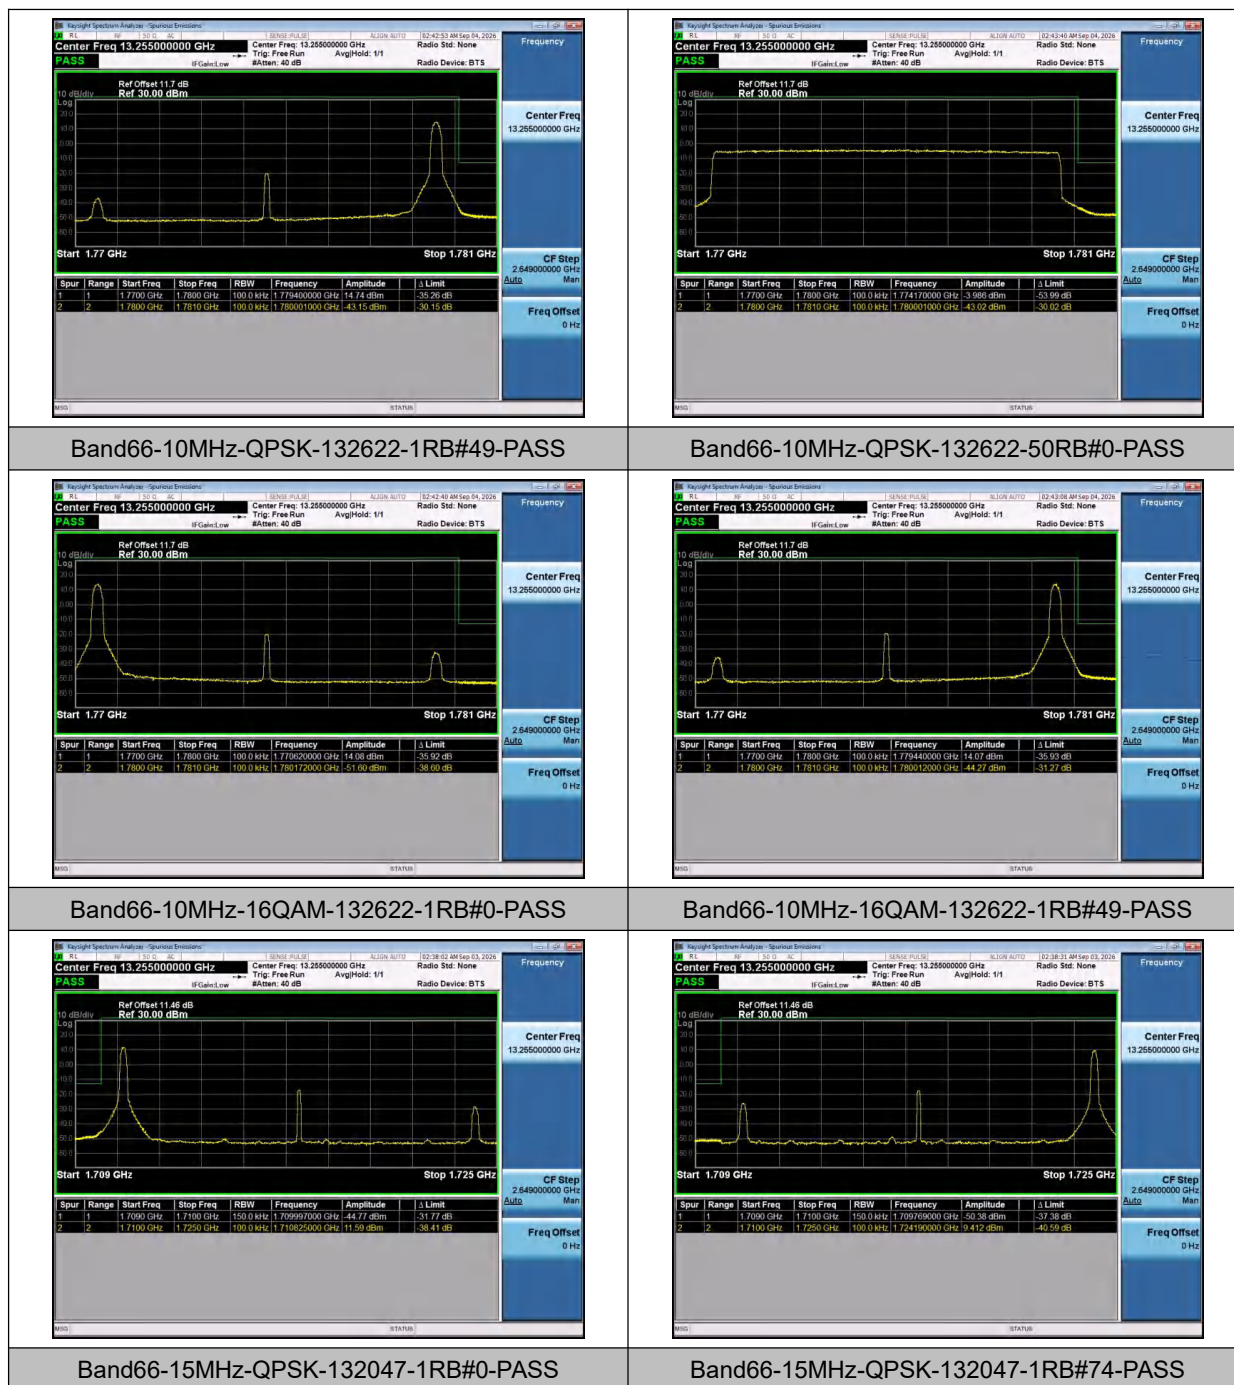

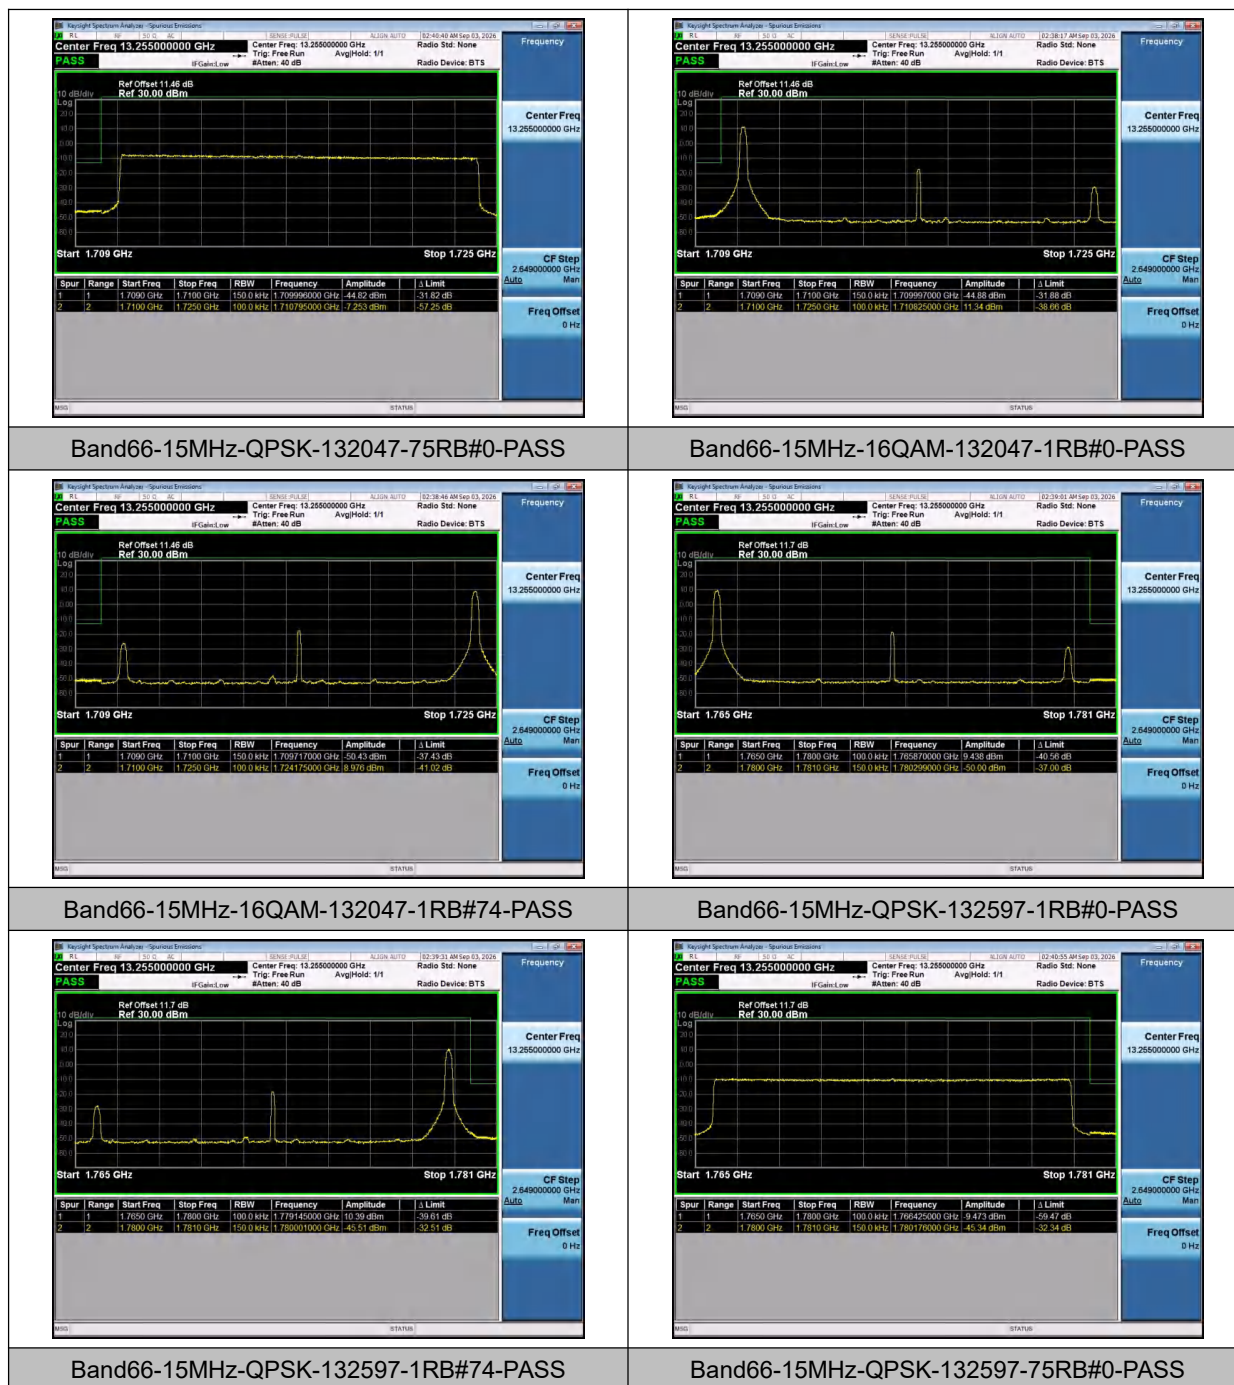

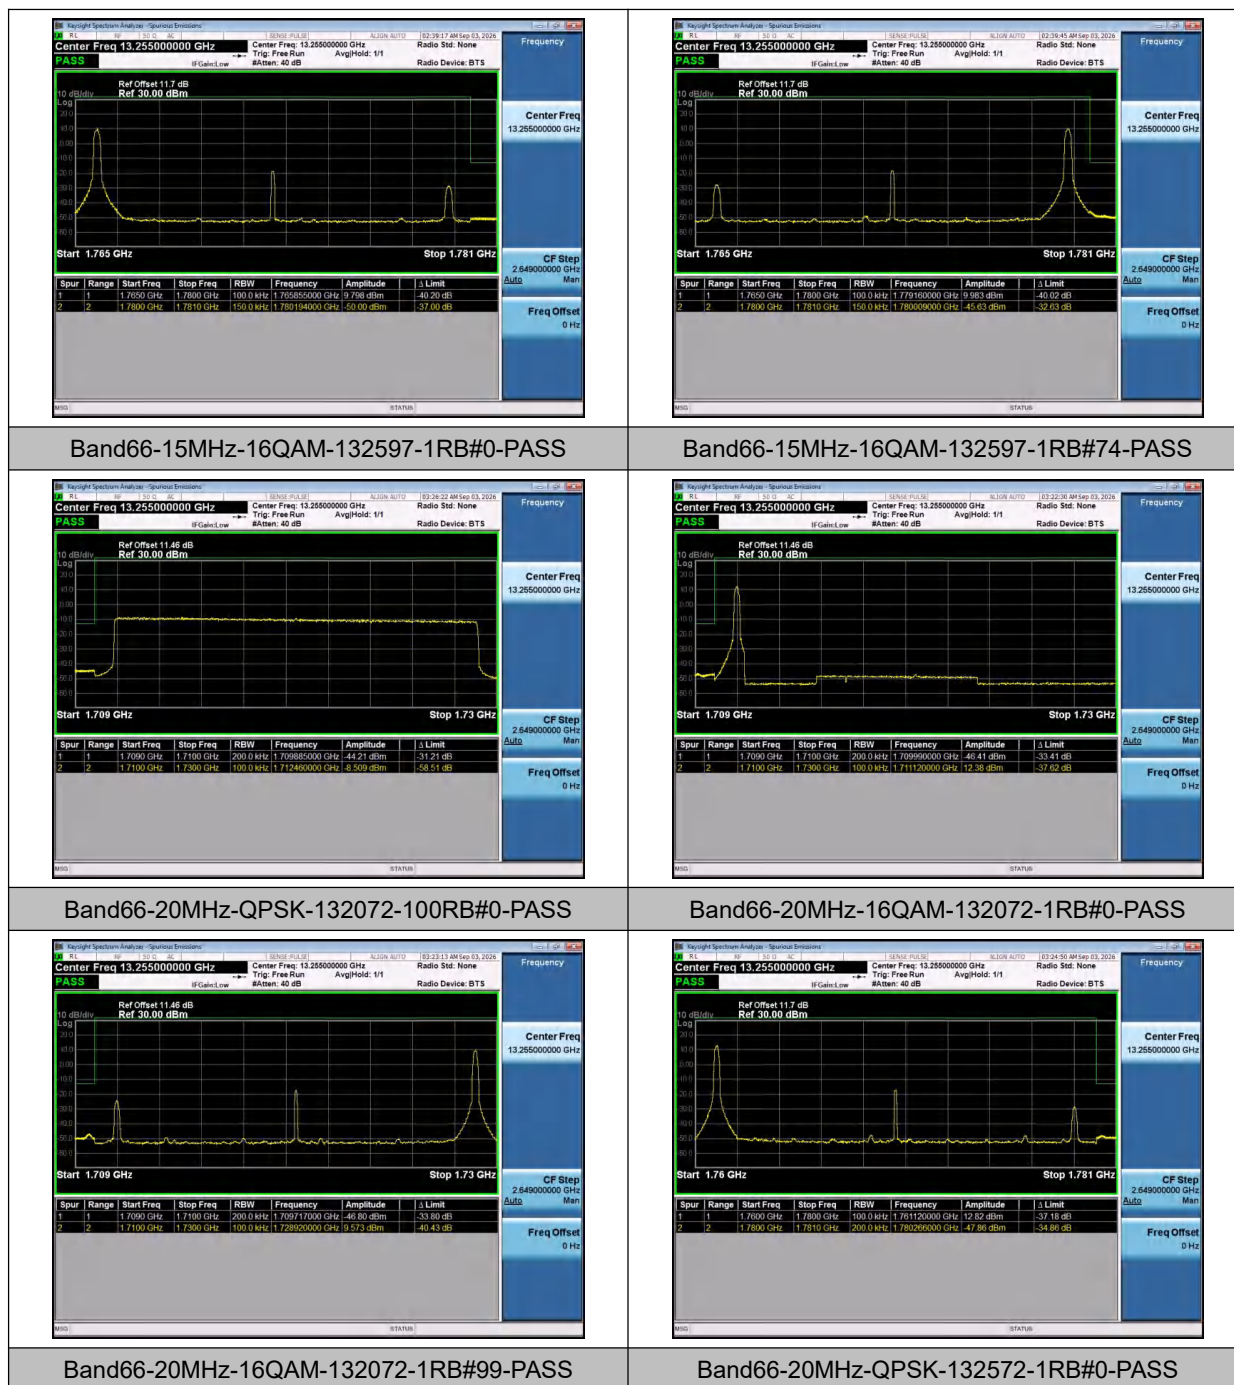

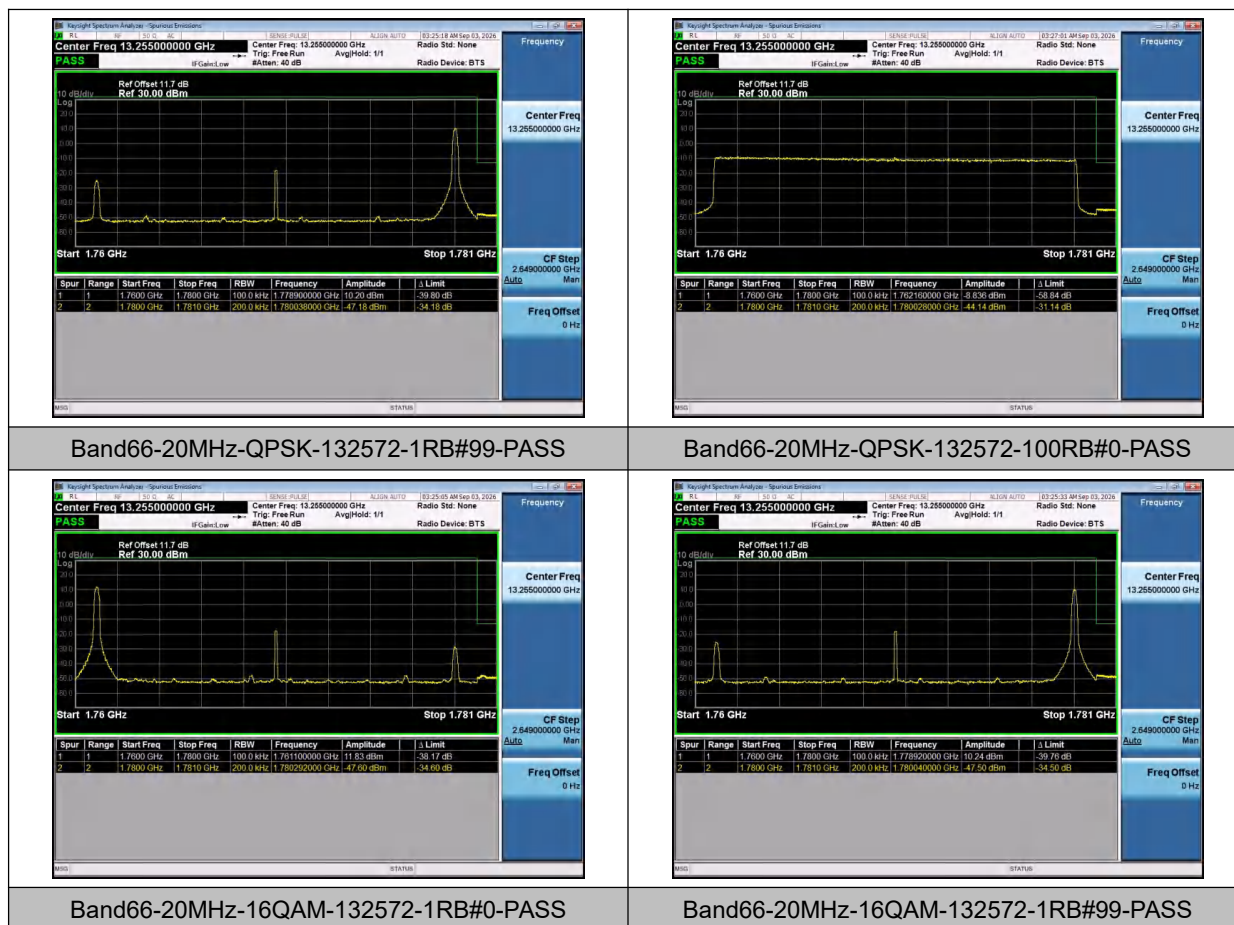

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com