




8DPSK_3DH3_HOPP_Ant1_NTNV

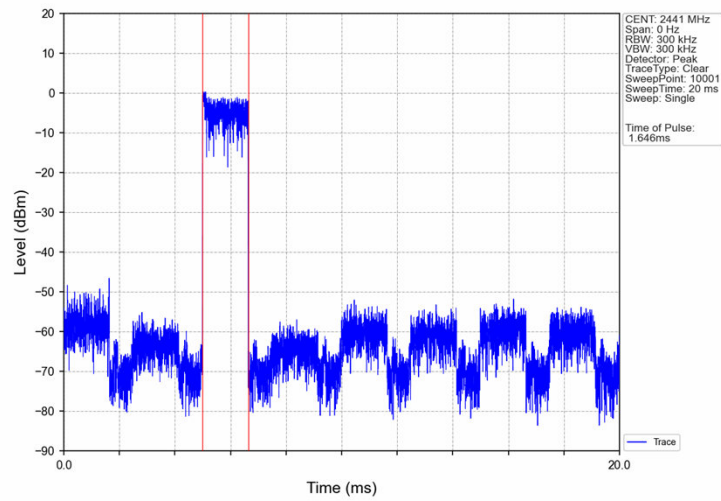


8DPSK_3DH3_HOPP_Ant1_NTNV

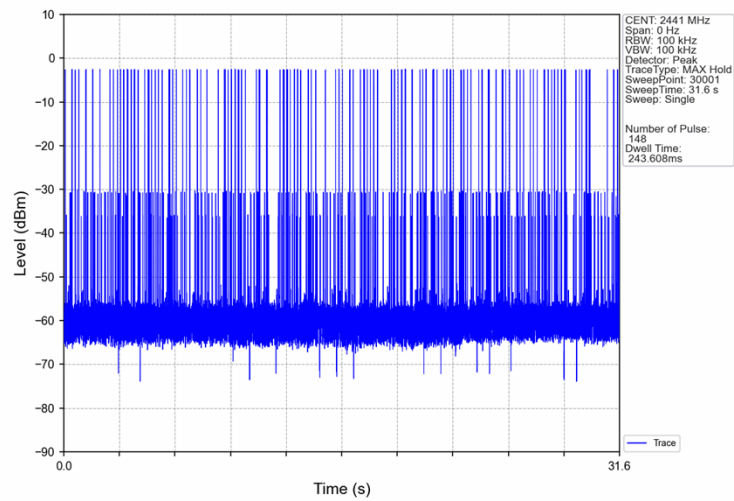

8DPSK_3DH5_HOPP_Ant1_NTNV

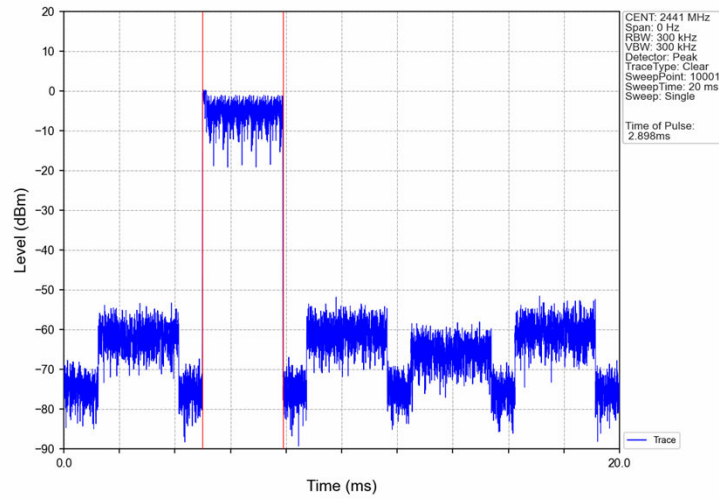

8DPSK_3DH5_HOPP_Ant1_NTNV

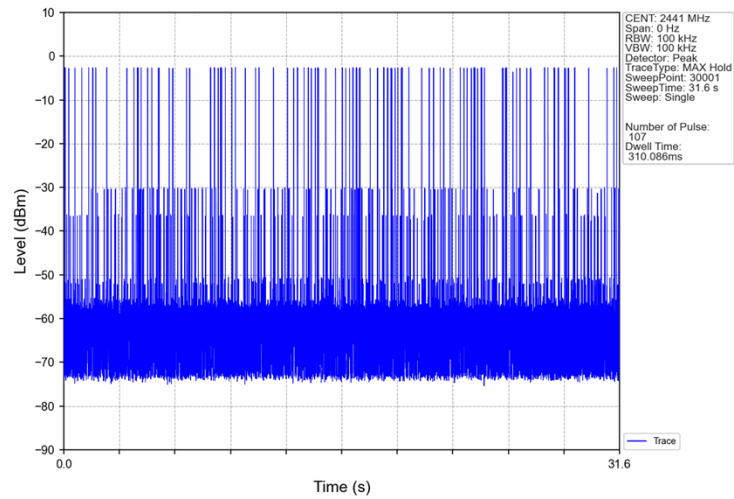

6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Test Result

6.1.1 Ref


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	0.63
		2441	DH5	1	0.50
		2480	DH5	1	0.56
		HOPP	DH5	1	0.64
					0.64
Pi/4DQPSK	SISO	2402	2DH5	1	0.62
		2441	2DH5	1	0.43
		2480	2DH5	1	0.59
		HOPP	2DH5	1	0.63
					0.63
8DPSK	SISO	2402	3DH5	1	0.58
		2441	3DH5	1	0.24
		2480	3DH5	1	0.40
		HOPP	3DH5	1	0.63
					0.63

6.1.2 CSE


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	0.63	-19.37	Pass
		2441	DH5	1	0.50	-19.50	Pass
		2480	DH5	1	0.56	-19.44	Pass
		HOPP	DH5	1	0.64	-19.36	Pass
					0.64	-19.36	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	0.62	-19.38	Pass
		2441	2DH5	1	0.43	-19.57	Pass
		2480	2DH5	1	0.59	-19.41	Pass
		HOPP	2DH5	1	0.63	-19.37	Pass
					0.63	-19.37	Pass
8DPSK	SISO	2402	3DH5	1	0.58	-19.42	Pass
		2441	3DH5	1	0.24	-19.76	Pass
		2480	3DH5	1	0.40	-19.60	Pass
		HOPP	3DH5	1	0.63	-19.37	Pass
					0.63	-19.37	Pass

6.2 Test Graph


6.2.1 Ref

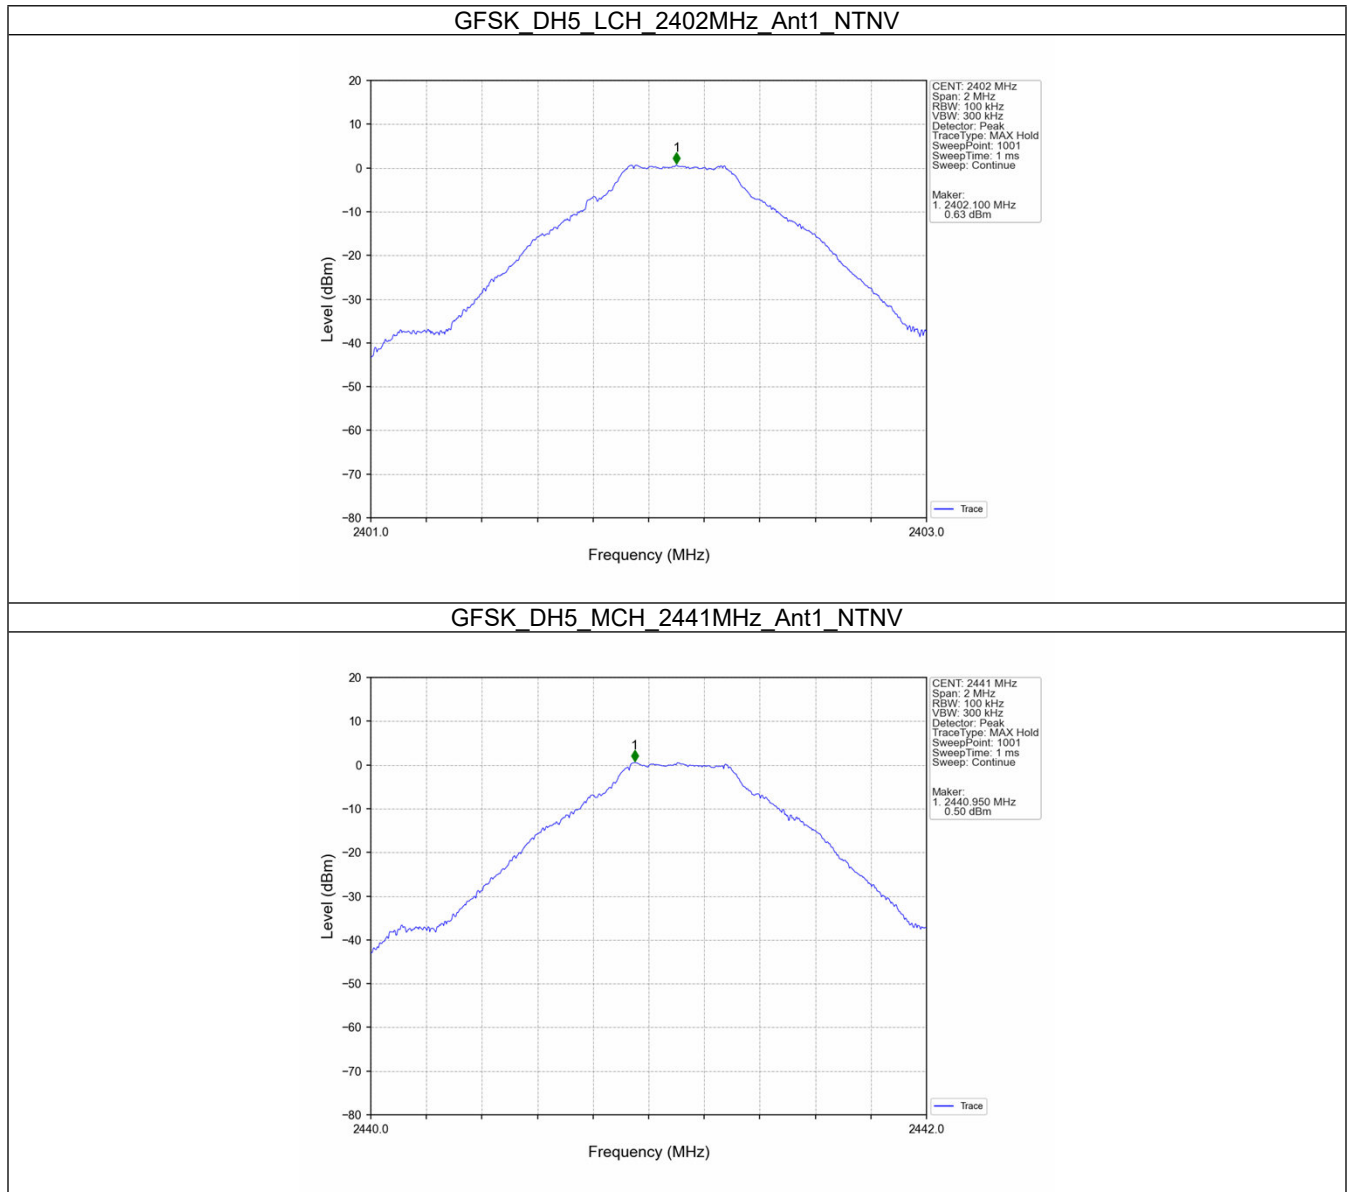


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

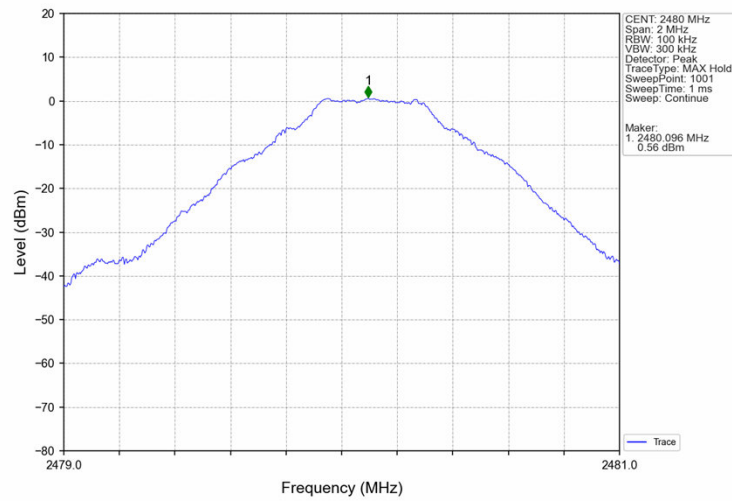


GFSK_DH5_HOPP_2480MHz_Ant1_NTNV

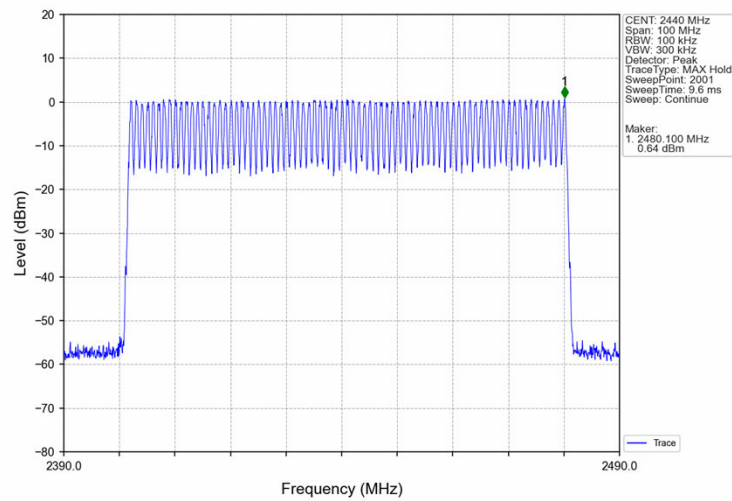


GFSK_DH5_HOPP_Ant1_NTNV

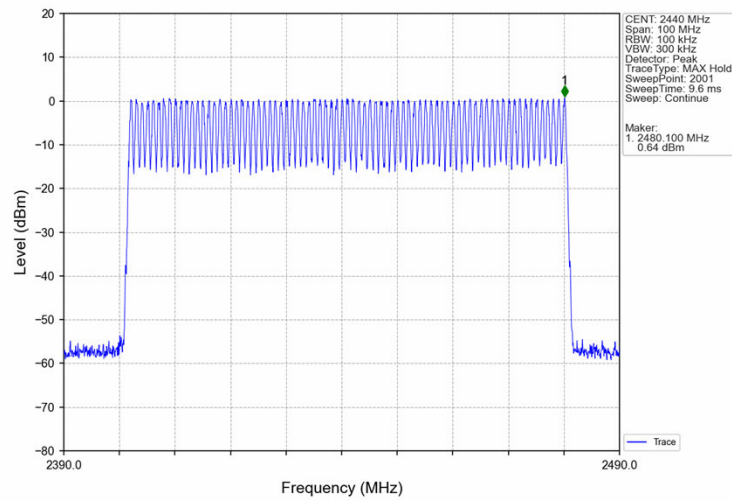


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

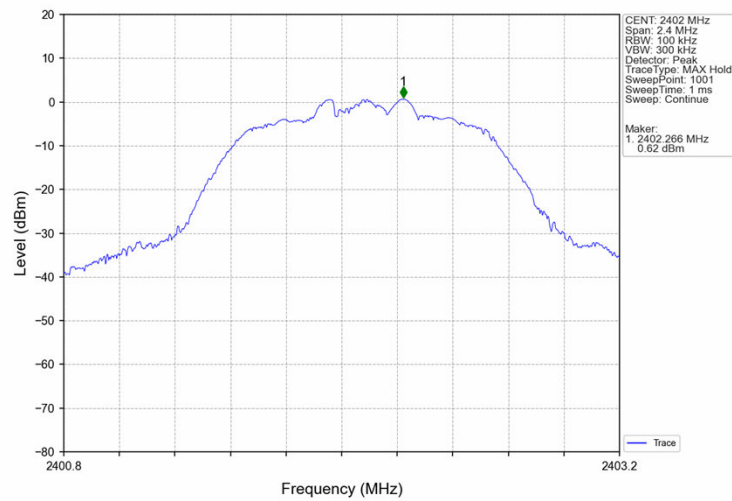


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

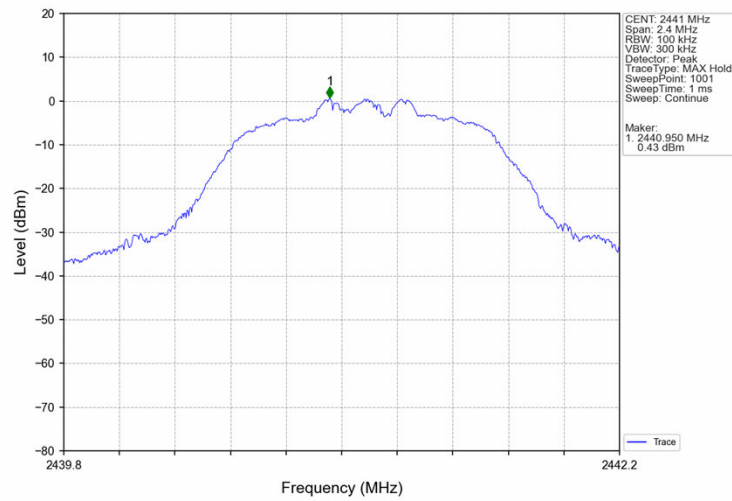


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

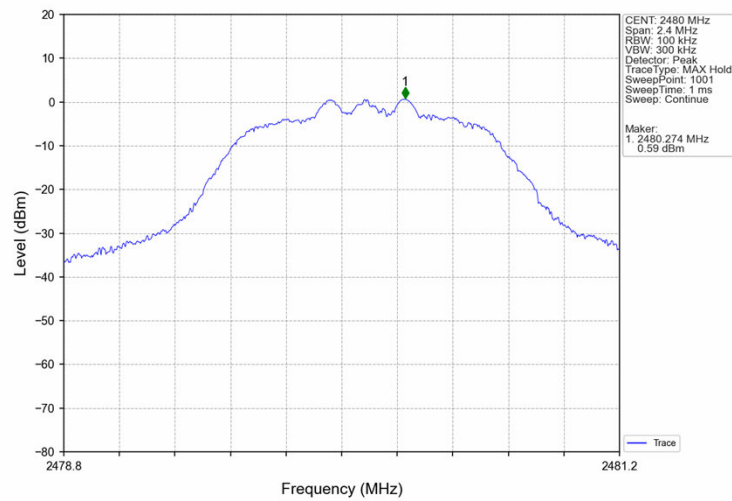


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

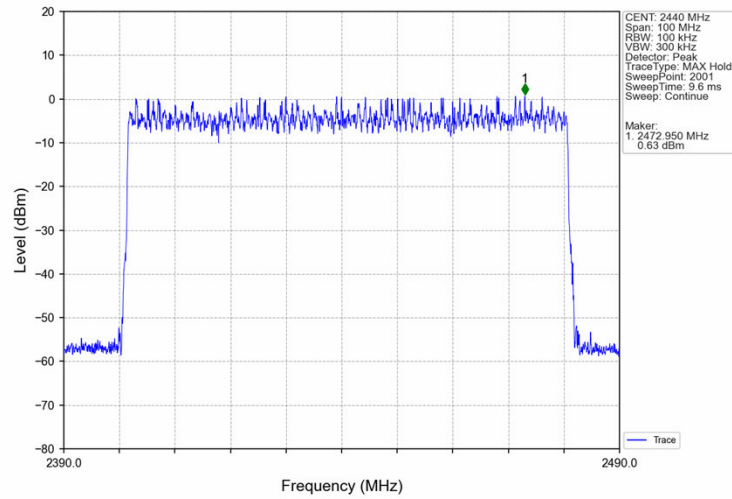


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

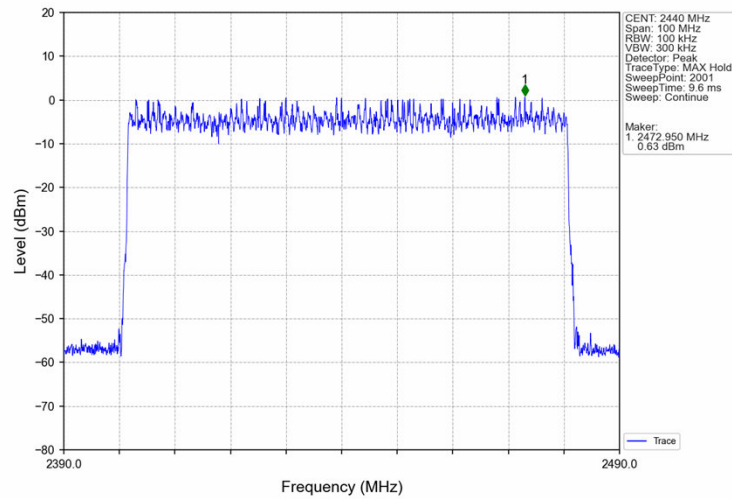


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

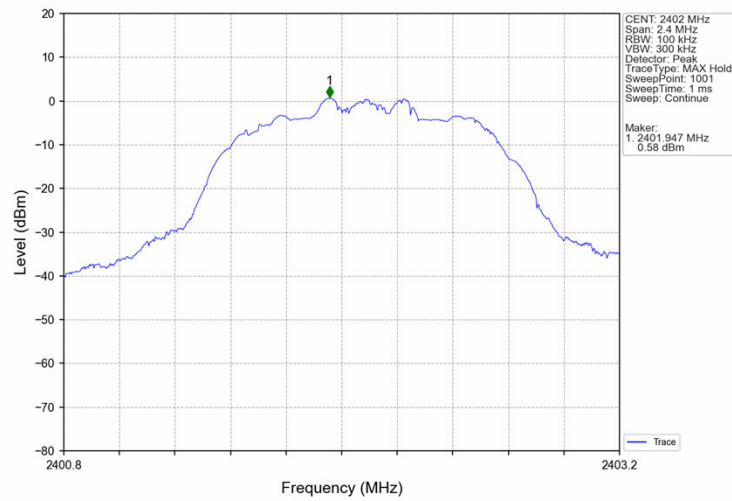


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

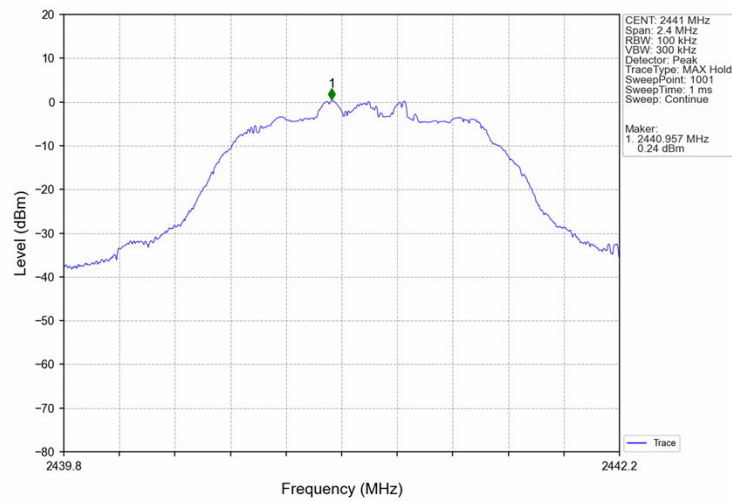


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

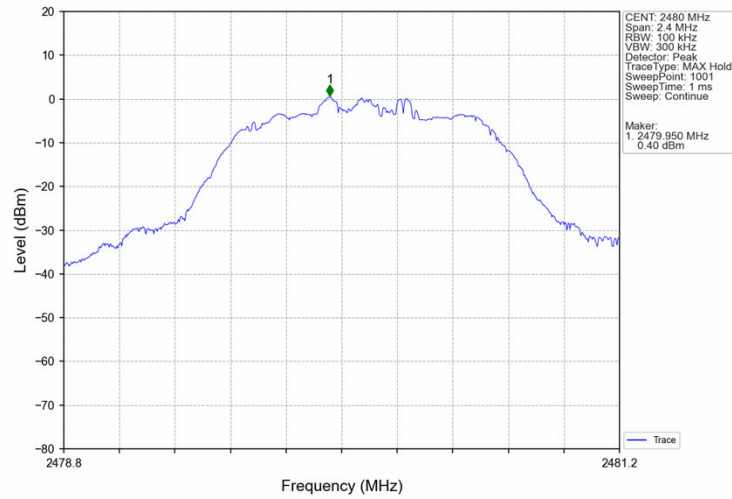

8DPSK_3DH5_HOPP_Ant1_NTNV

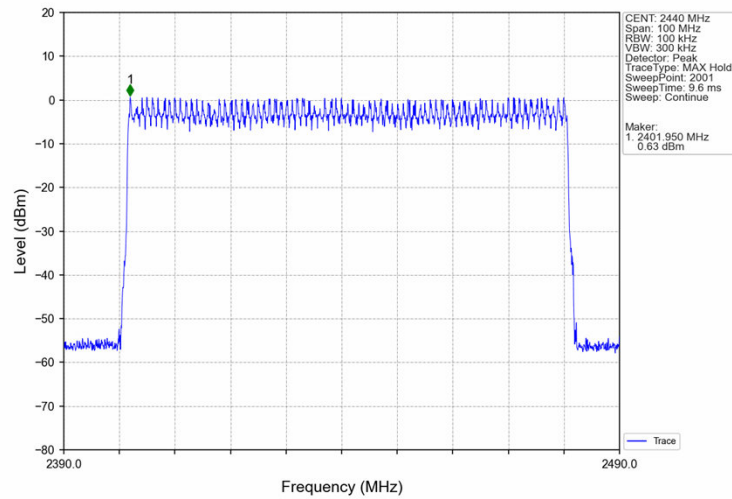


8DPSK_3DH5_HOPP_Ant1_NTNV

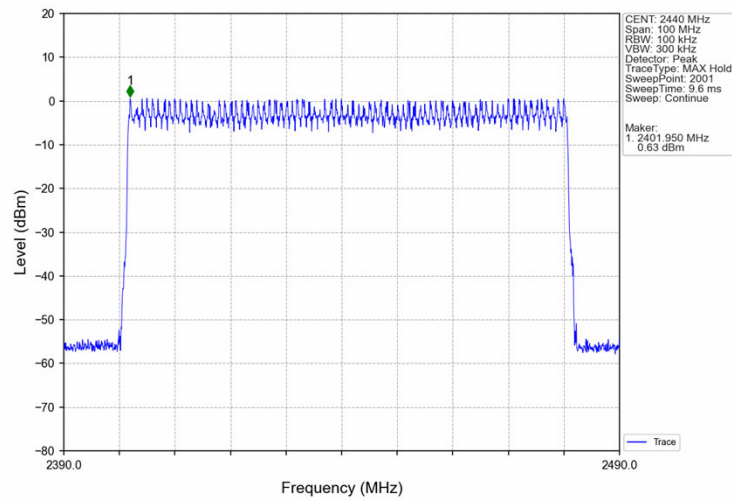


6.2.2 CSE


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

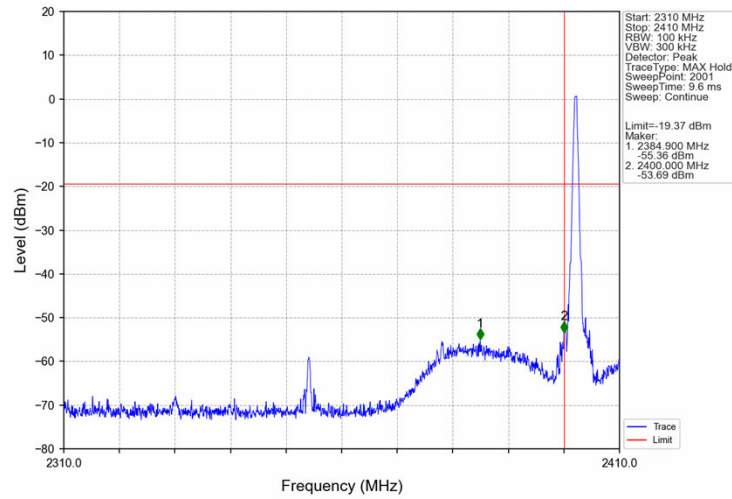


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

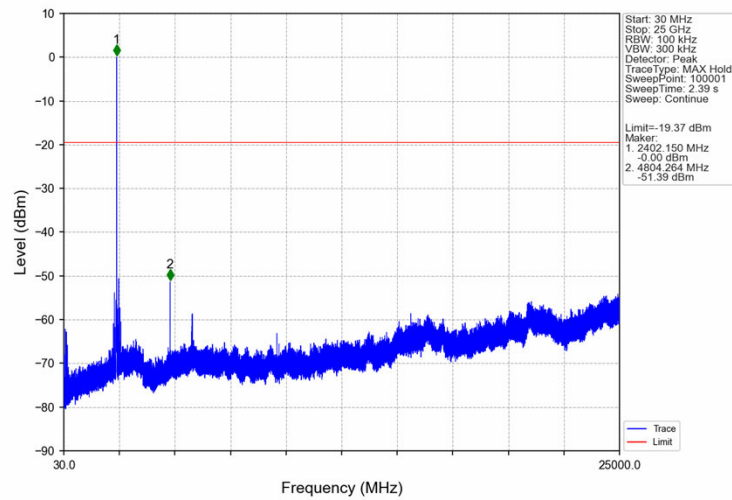


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

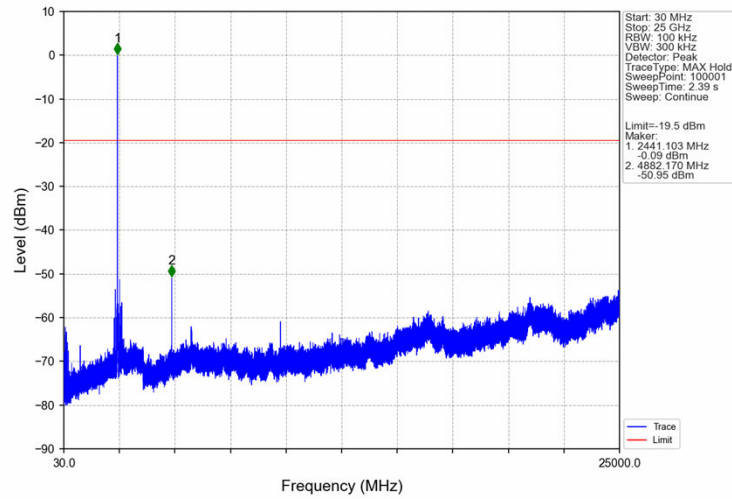


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

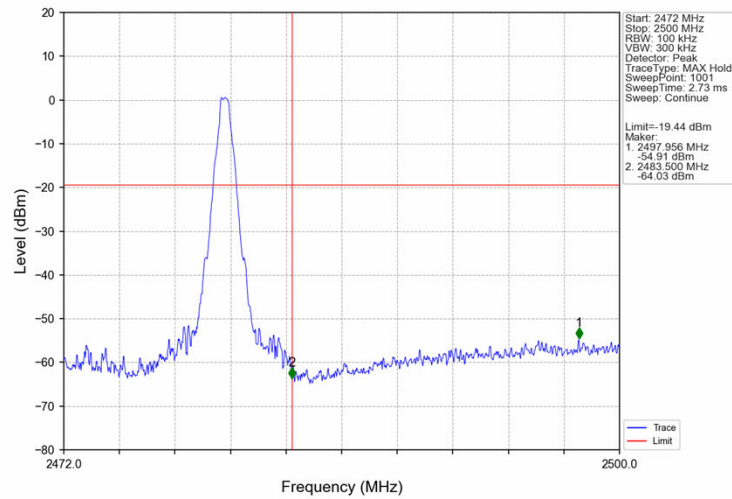


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

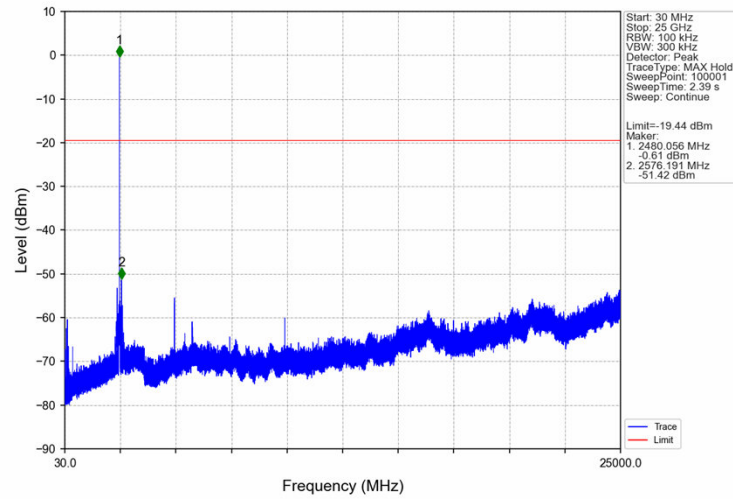


GFSK_DH5_HOPP_2410MHz_Ant1_NTNV

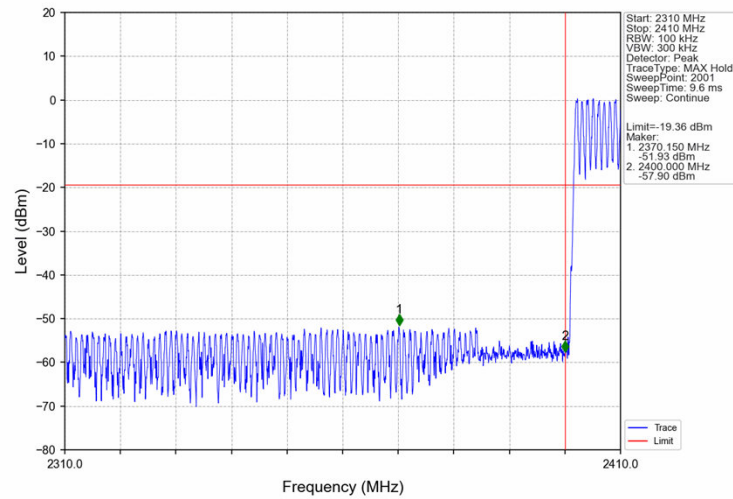


GFSK_DH5_HOPP_Ant1_NTNV

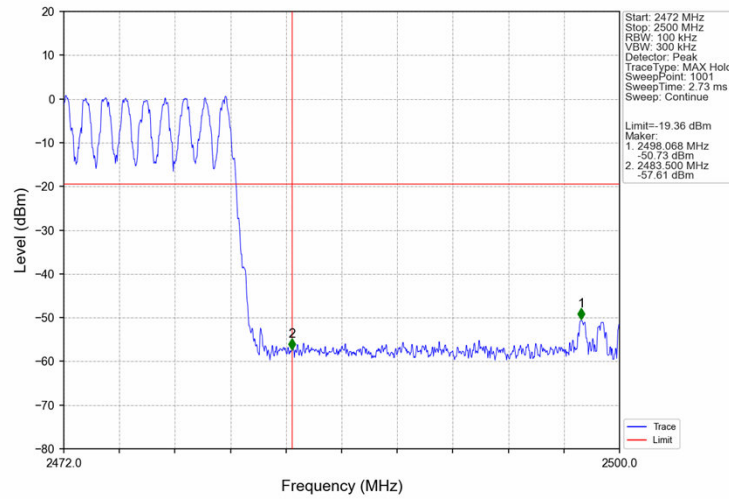


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

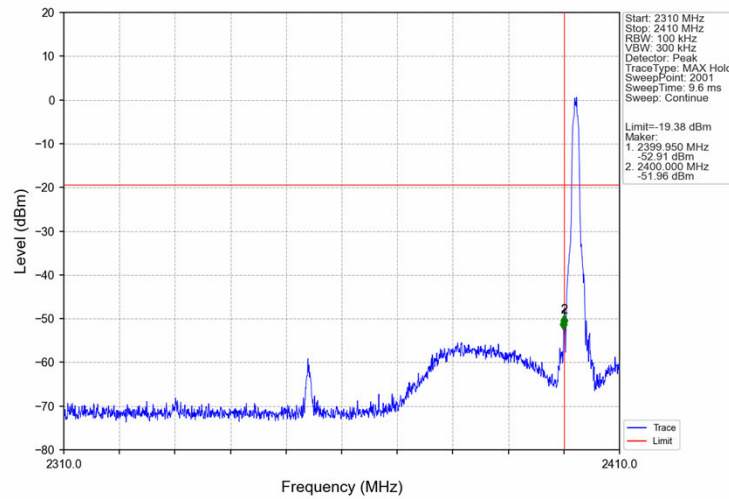


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

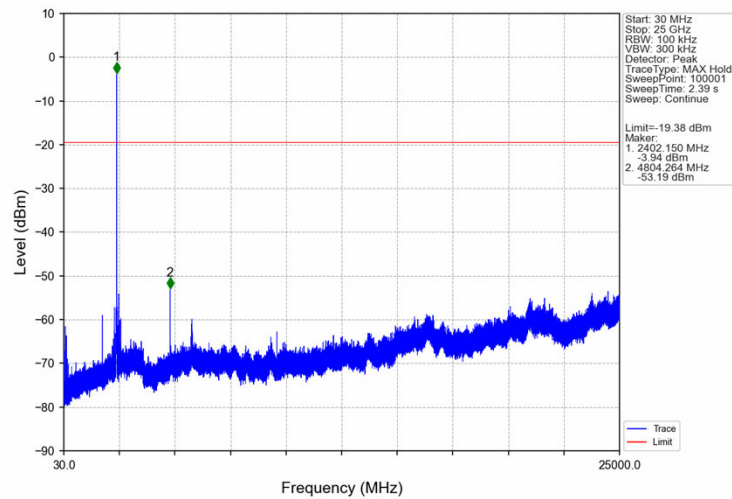


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

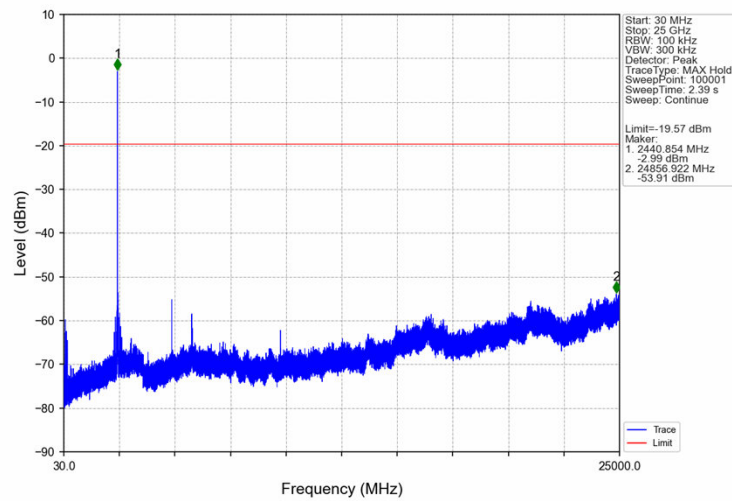


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

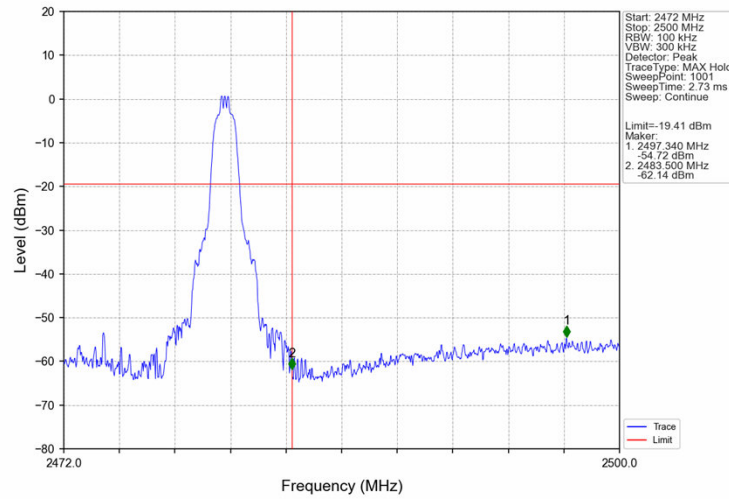


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

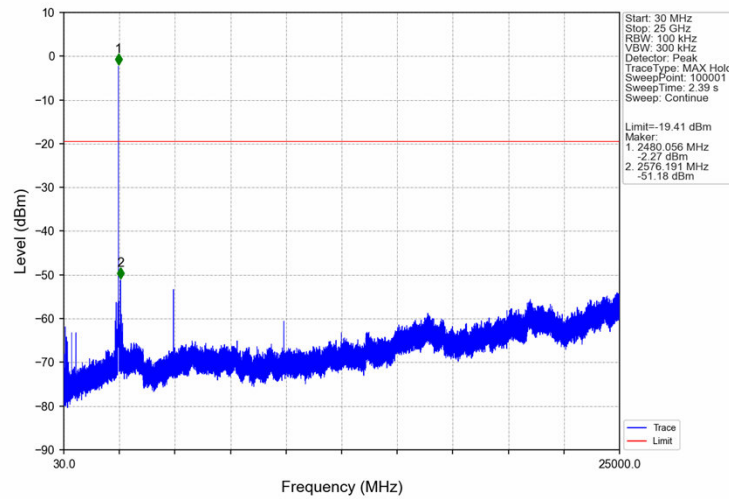


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

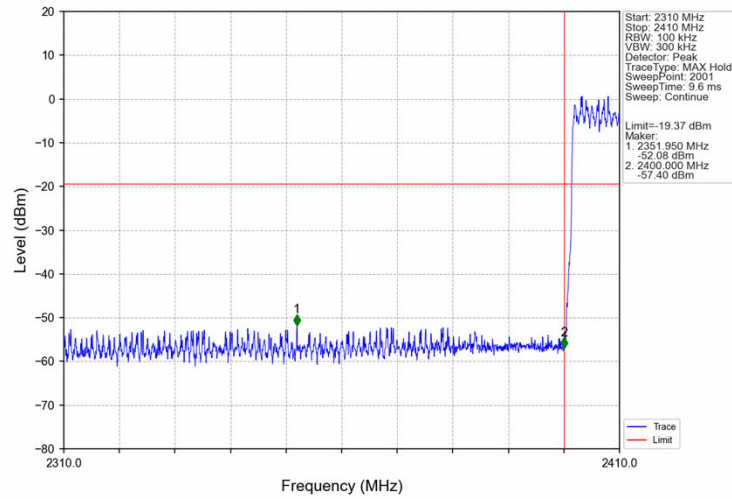


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

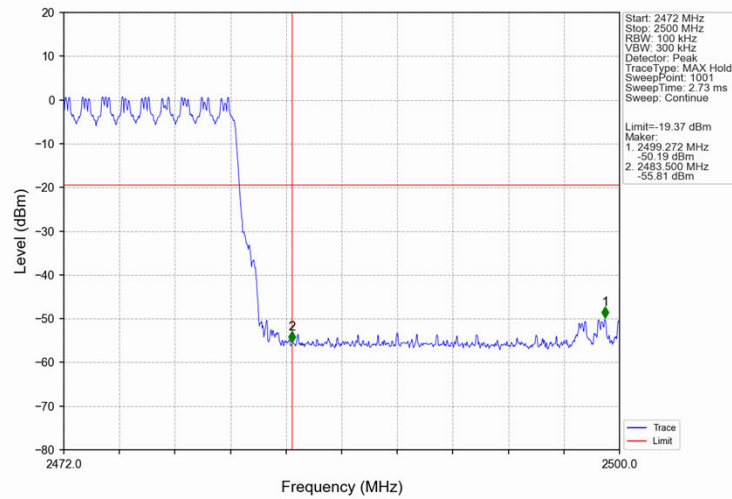


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

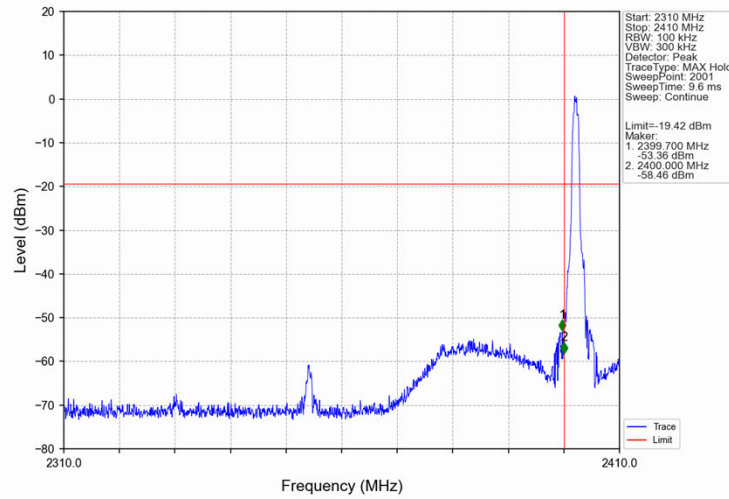


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

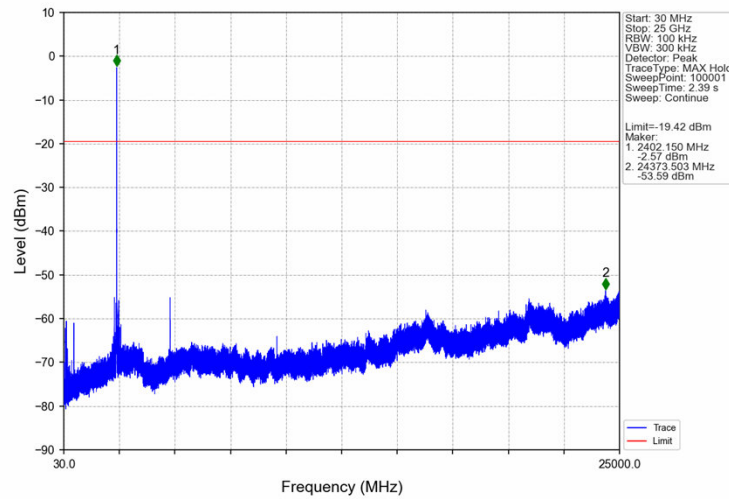


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

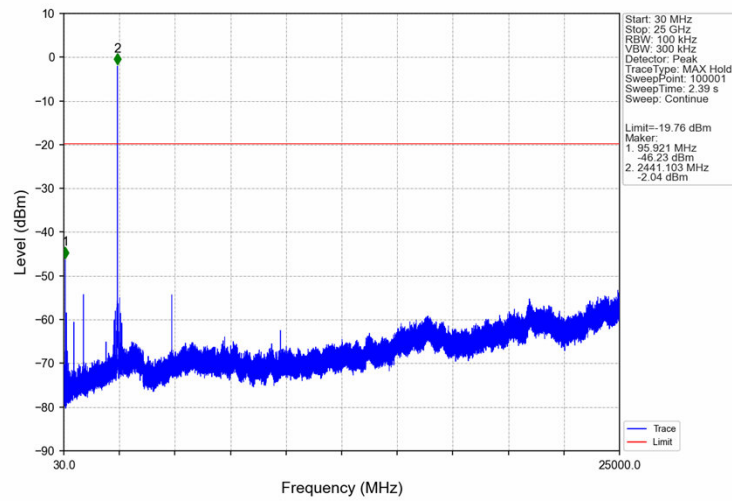


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

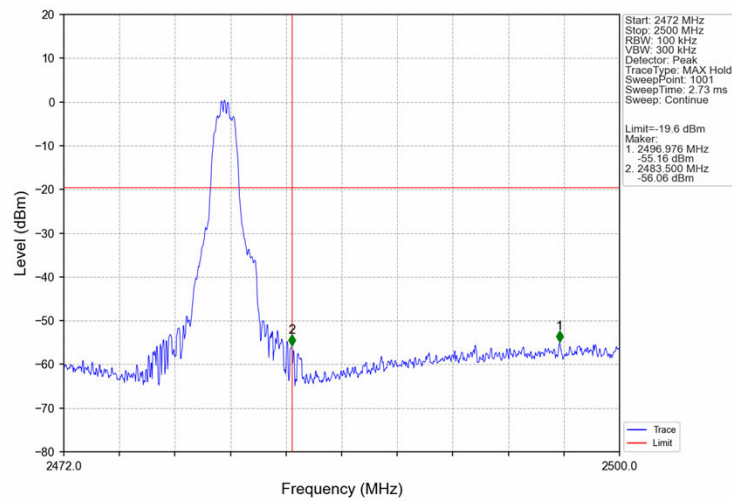

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

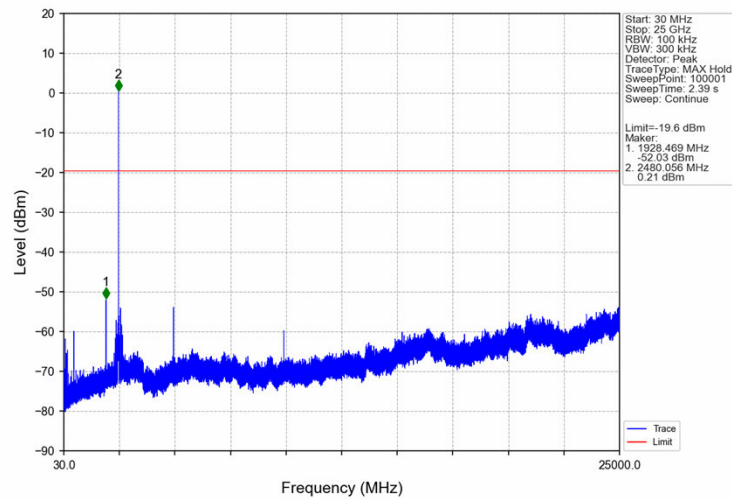

8DPSK_3DH5_HOPP_Ant1_NTNV

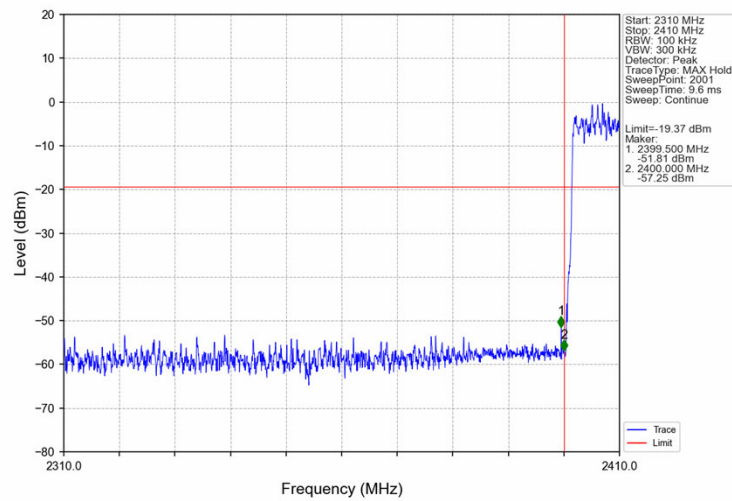

8DPSK_3DH5_HOPP_Ant1_NTNV

