

PSD NVNT a 5785MHz Ant2



PSD NVNT a 5825MHz Ant2



PSD NVNT n20 5745MHz Ant1



PSD NVNT n20 5785MHz Ant1



PSD NVNT n20 5825MHz Ant1



PSD NVNT n20 5745MHz Ant2



PSD NVNT n20 5785MHz Ant2



PSD NVNT n20 5825MHz Ant2



PSD NVNT n20 5745MHz Ant1



PSD NVNT n20 5745MHz Ant2



PSD NVNT n20 5785MHz Ant1




PSD NVNT n20 5785MHz Ant2




PSD NVNT n20 5825MHz Ant1




PSD NVNT n20 5825MHz Ant2

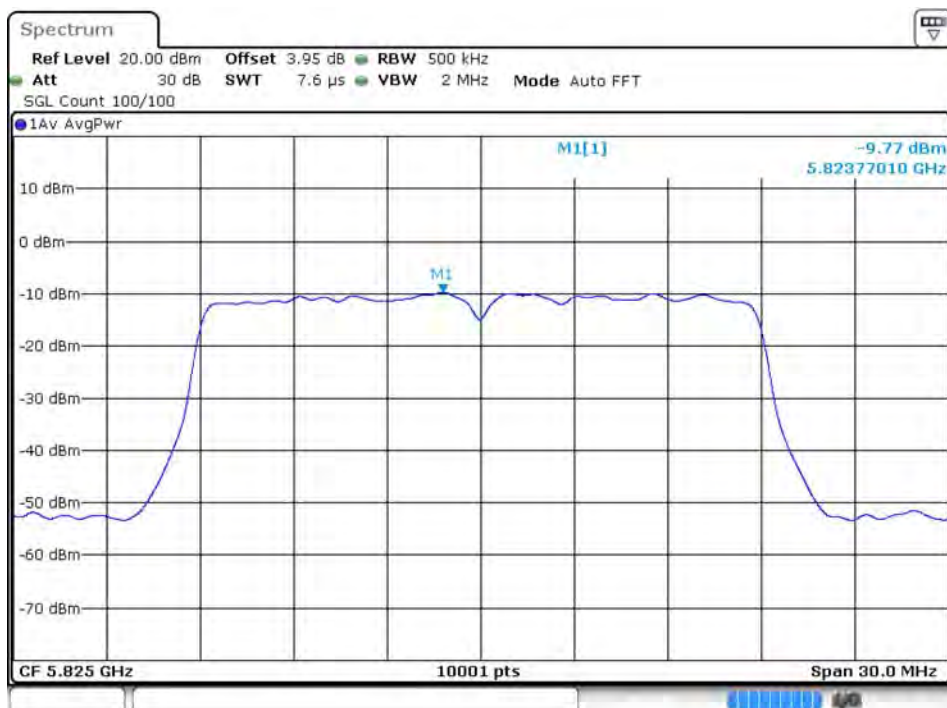


PSD NVNT n40 5755MHz Ant1

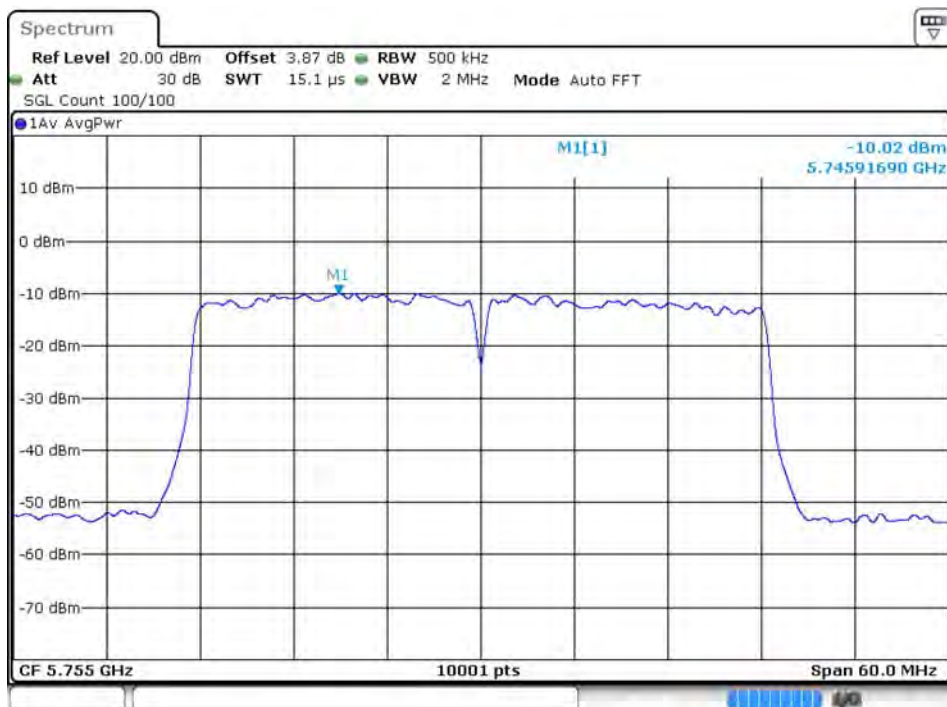


PSD NVNT n40 5795MHz Ant1

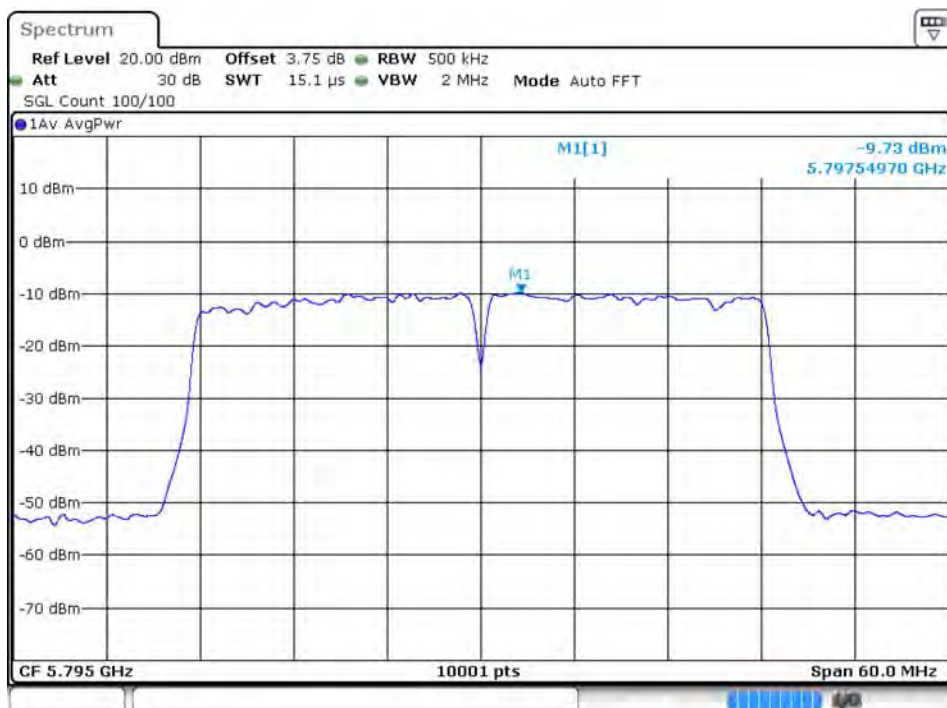

PSD NVNT n40 5755MHz Ant2

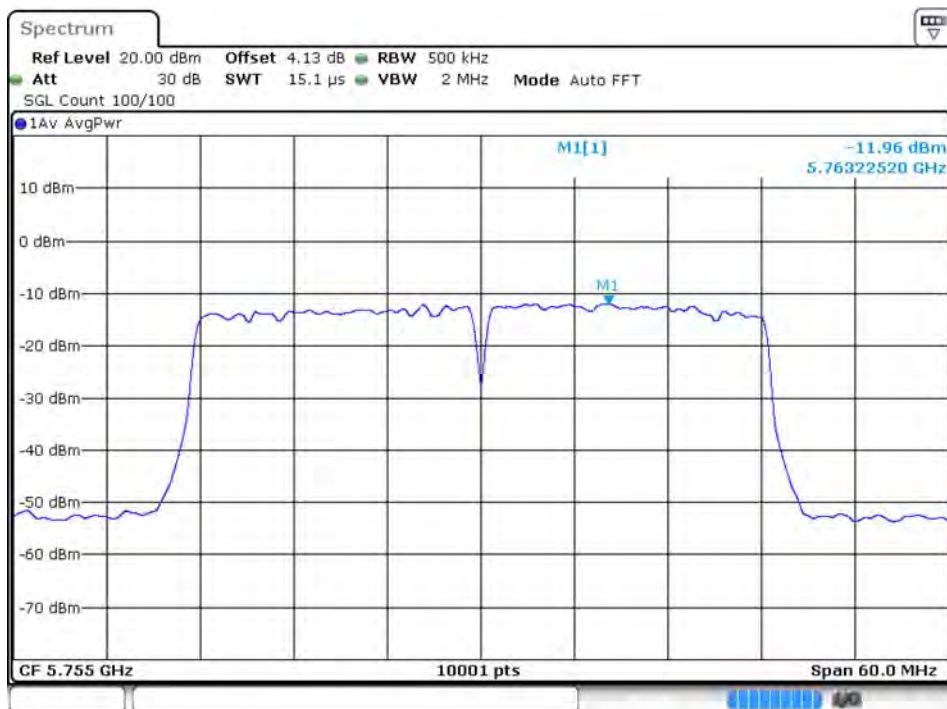


PSD NVNT n40 5795MHz Ant2

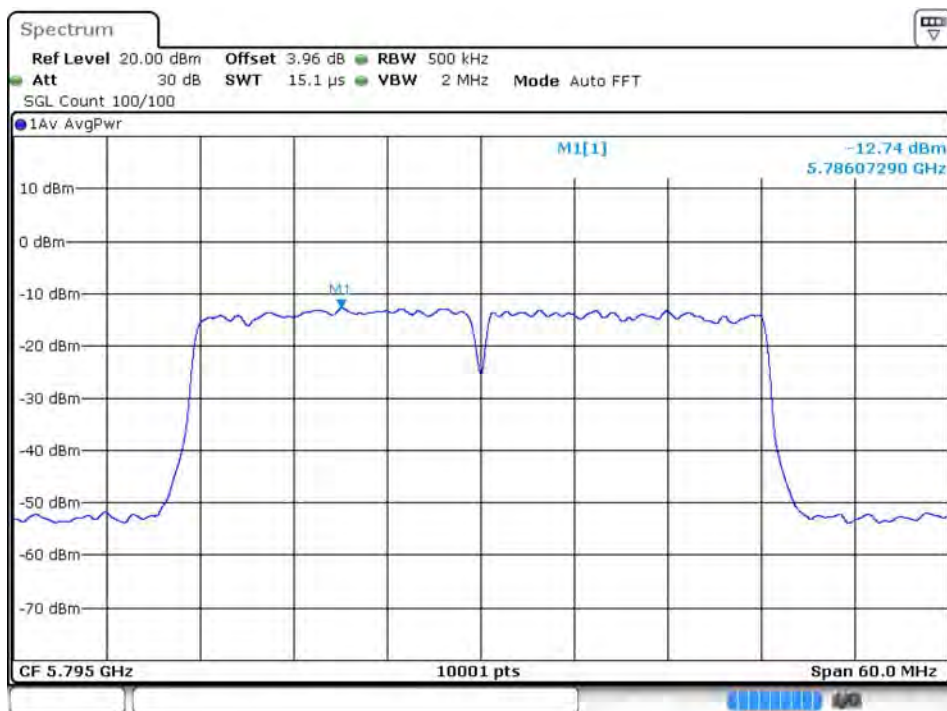


PSD NVNT n40 5755MHz Ant1




PSD NVNT n40 5755MHz Ant2

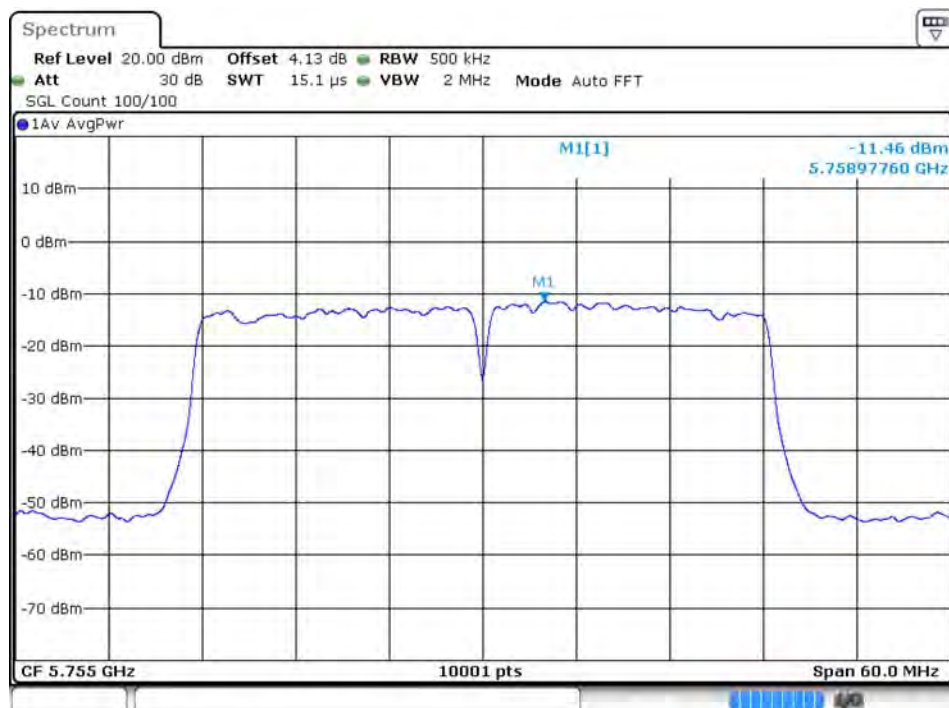

PSD NVNT n40 5795MHz Ant1

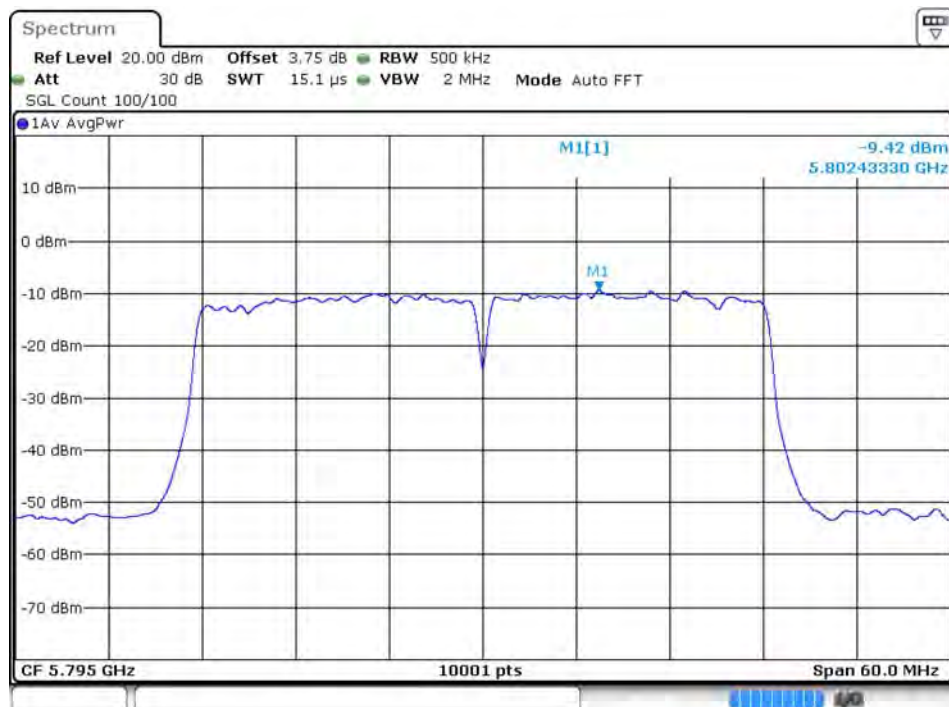

PSD NVNT n40 5795MHz Ant2

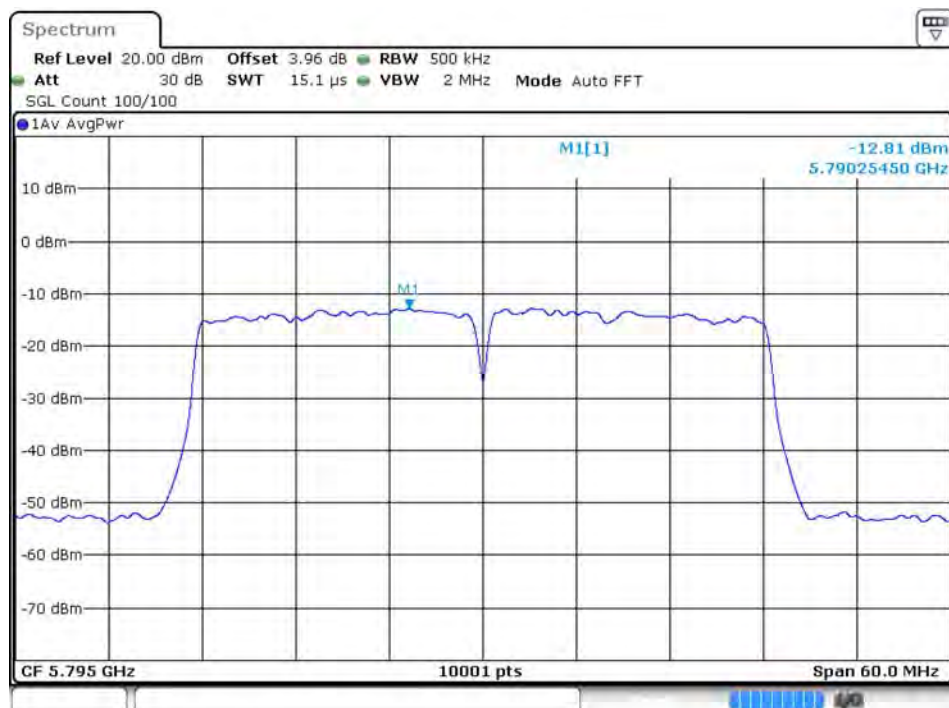

PSD NVNT ac20 5745MHz Ant1



PSD NVNT ac20 5785MHz Ant1



PSD NVNT ac20 5825MHz Ant1



PSD NVNT ac20 5745MHz Ant2



PSD NVNT ac20 5785MHz Ant2




PSD NVNT ac20 5825MHz Ant2




PSD NVNT ac20 5745MHz Ant1



PSD NVNT ac20 5745MHz Ant2

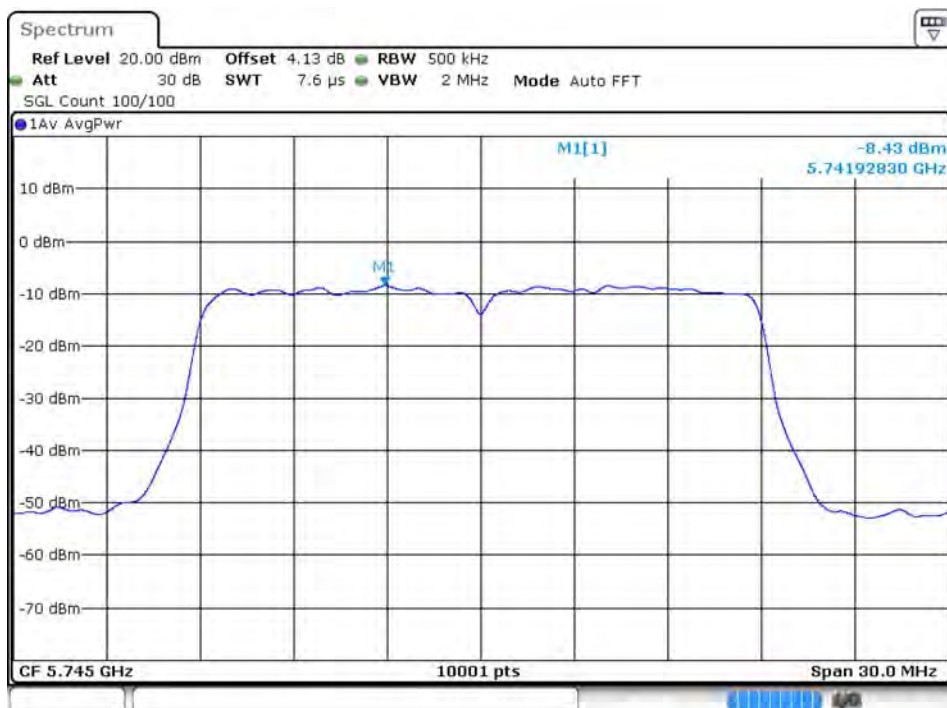


PSD NVNT ac20 5785MHz Ant1

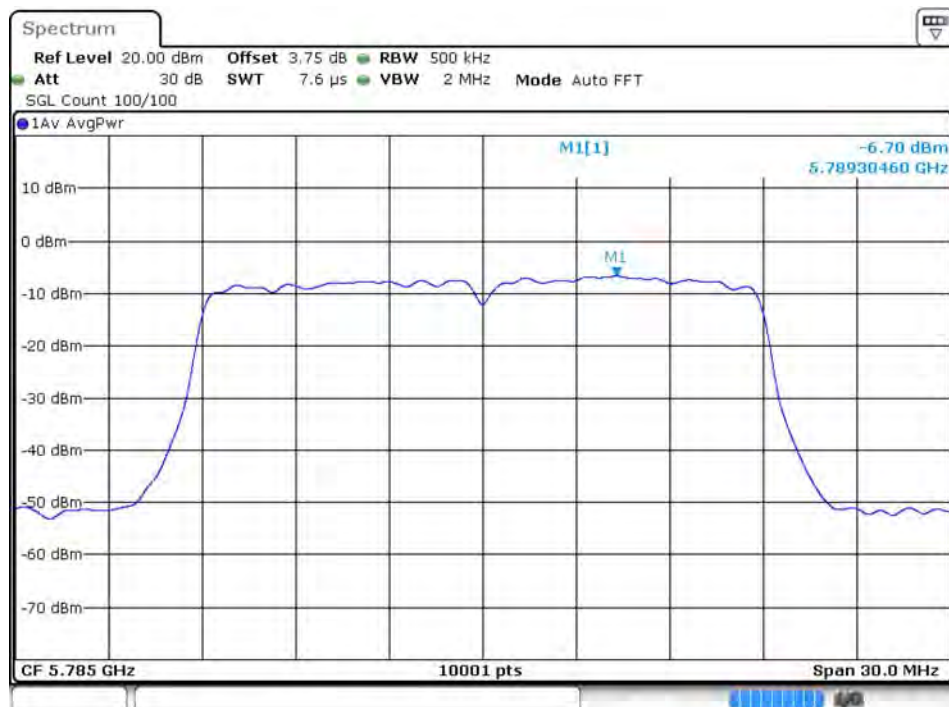

PSD NVNT ac20 5785MHz Ant2




PSD NVNT ac20 5825MHz Ant1

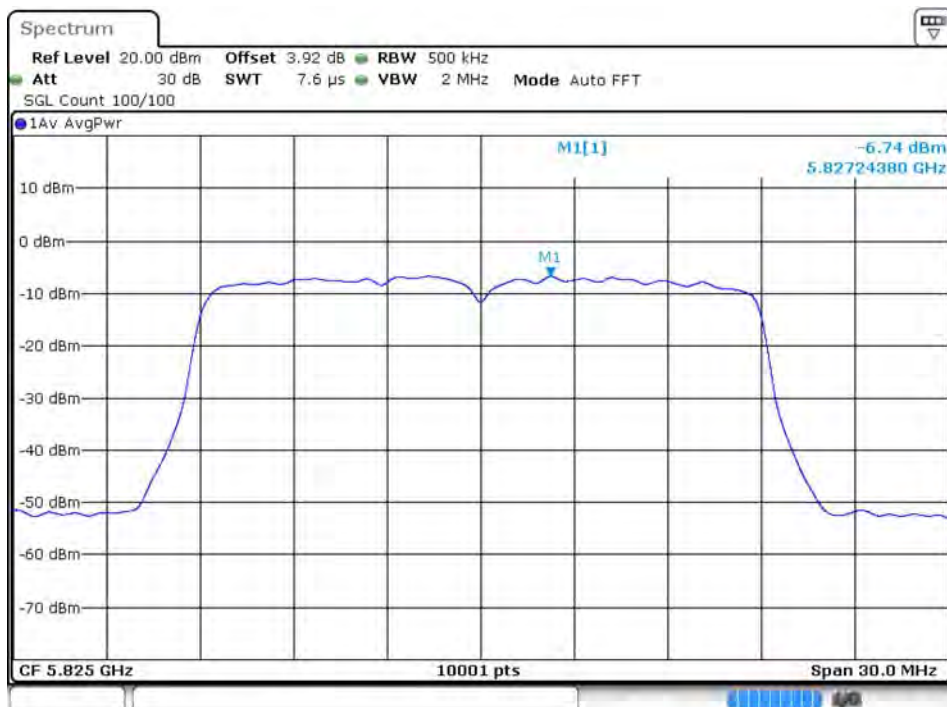


PSD NVNT ac20 5825MHz Ant2




PSD NVNT ac40 5755MHz Ant1

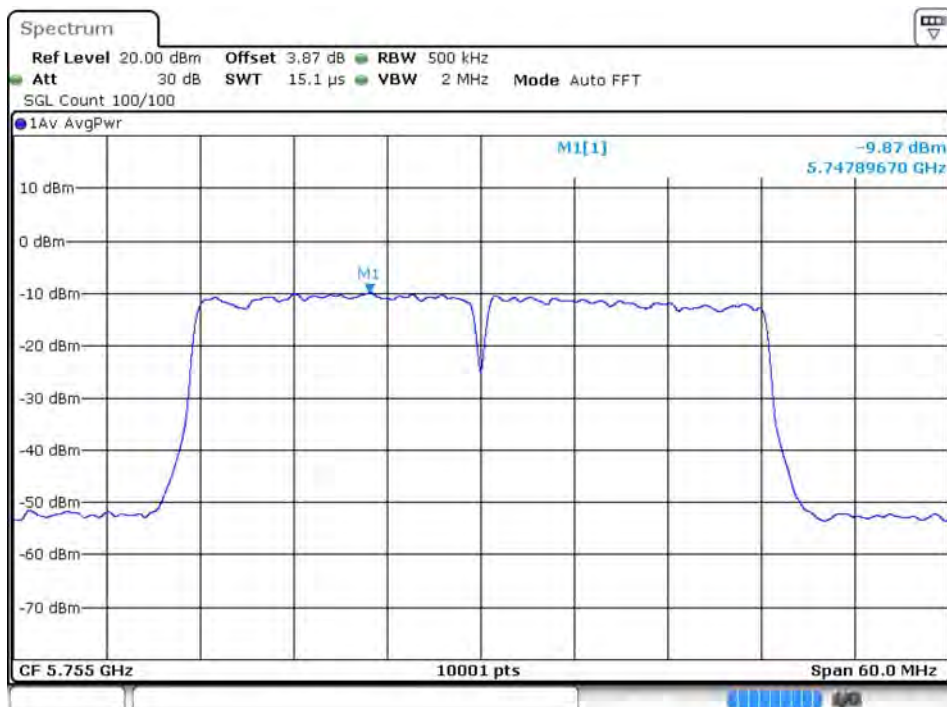


PSD NVNT ac40 5795MHz Ant1

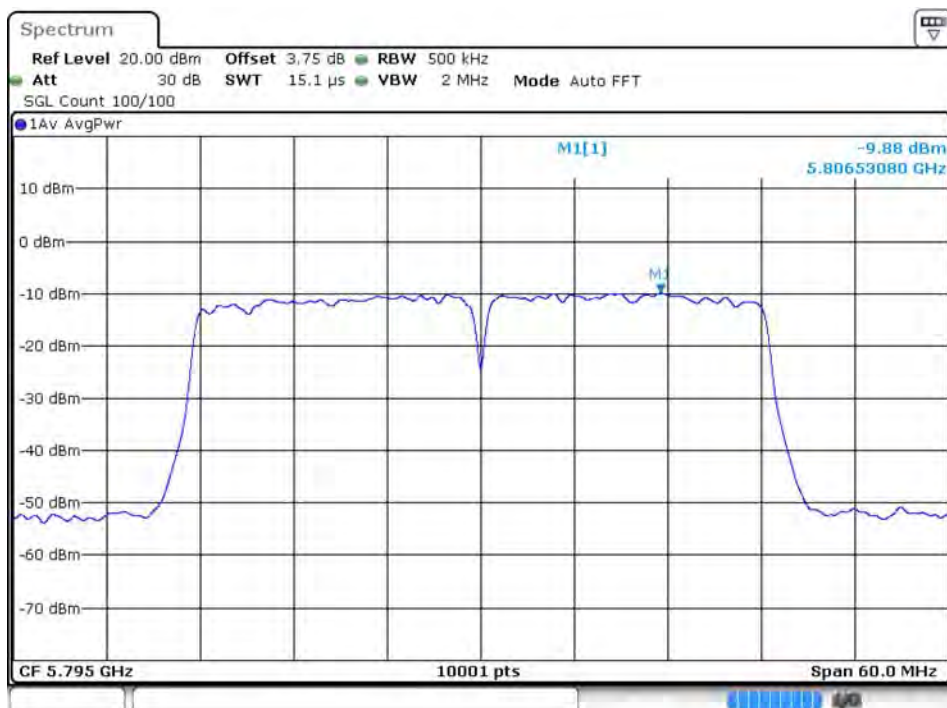


PSD NVNT ac40 5755MHz Ant2

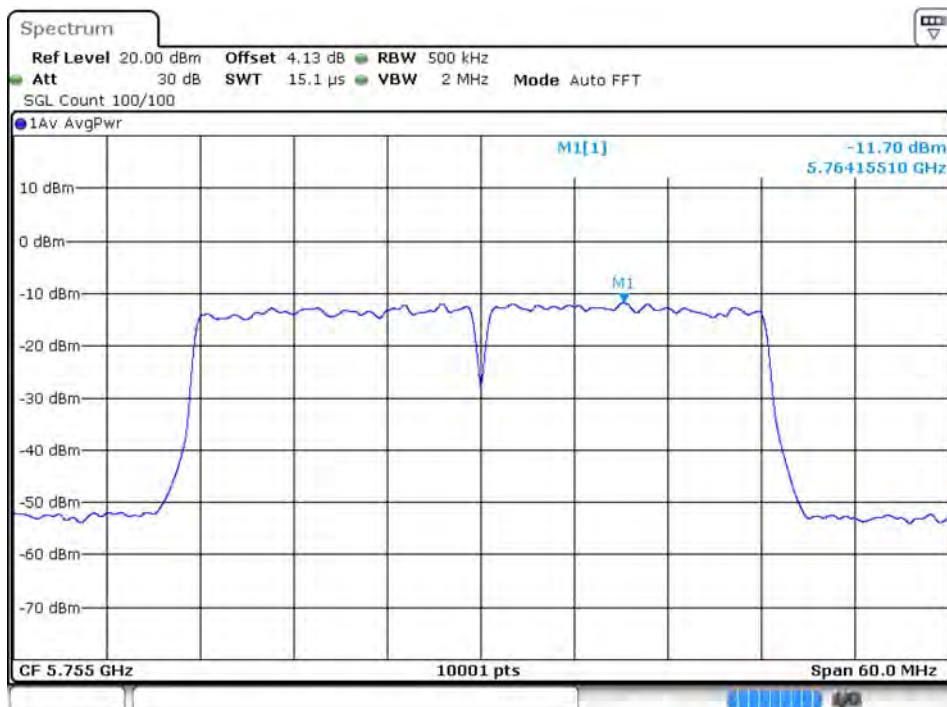

PSD NVNT ac40 5795MHz Ant2

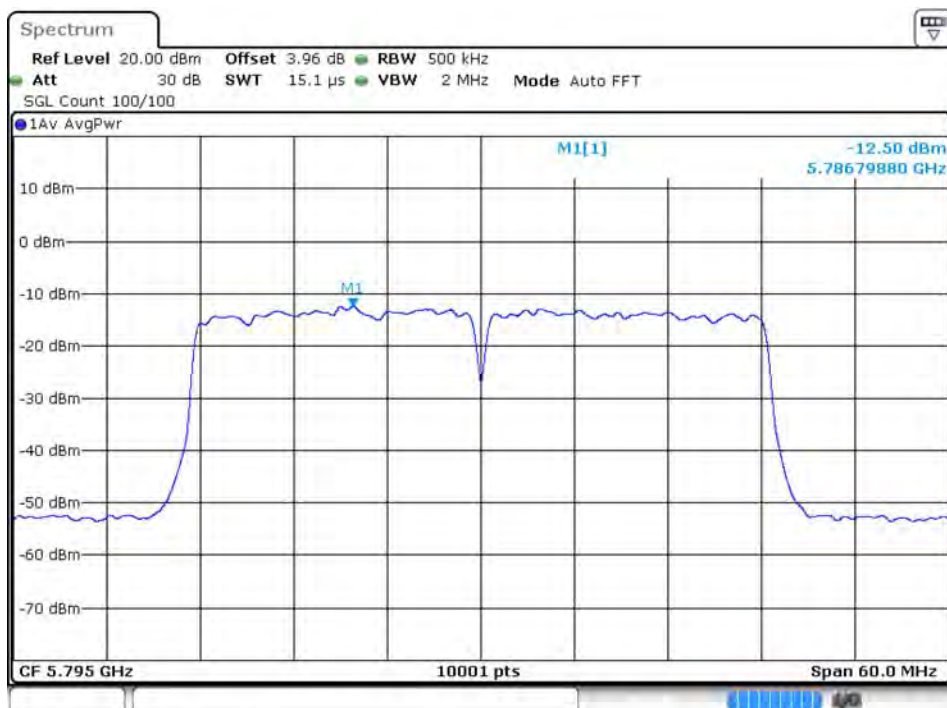


PSD NVNT ac40 5755MHz Ant1

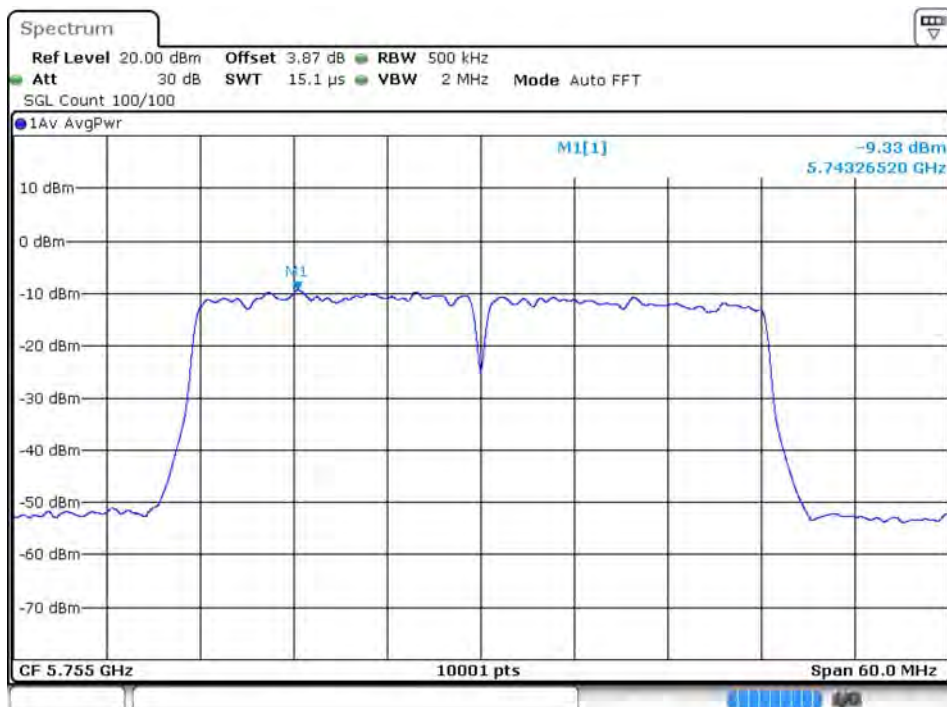


PSD NVNT ac40 5755MHz Ant2




PSD NVNT ac40 5795MHz Ant1

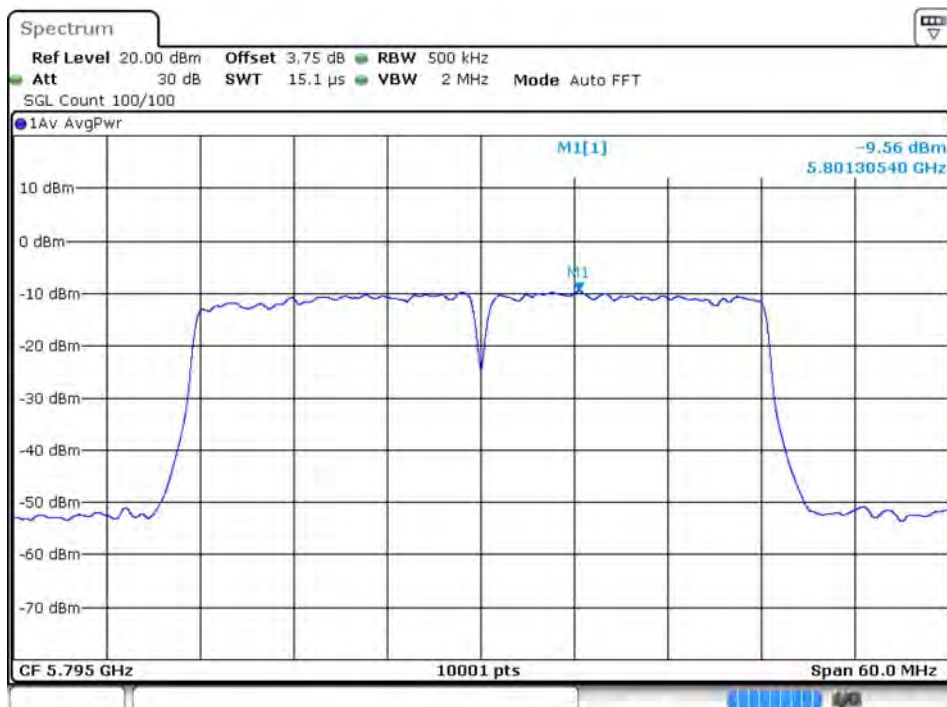


PSD NVNT ac40 5795MHz Ant2

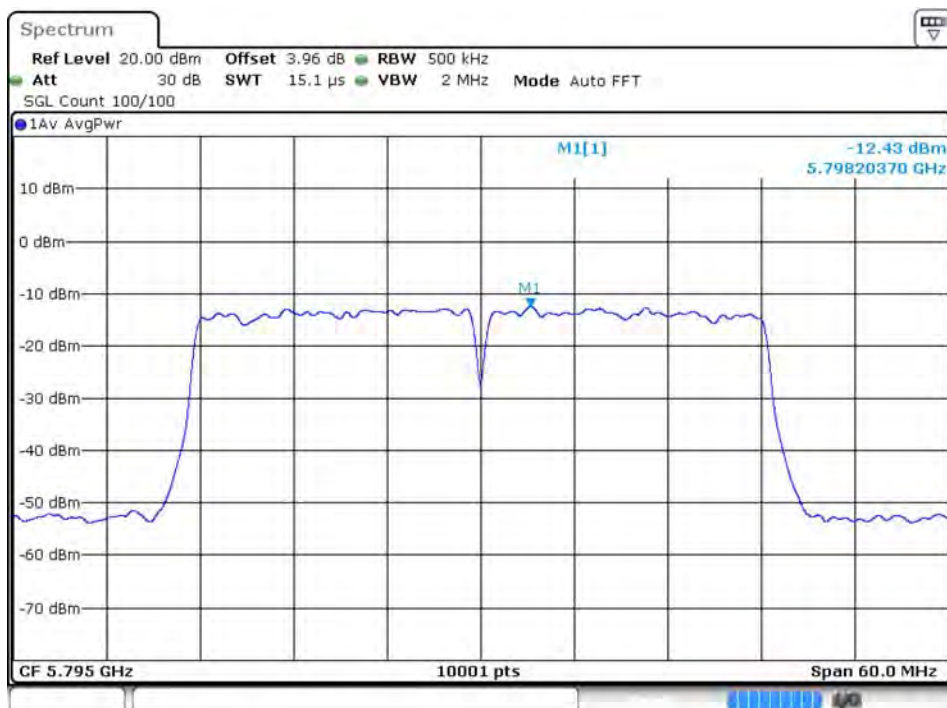


PSD NVNT ac80 5775MHz Ant1

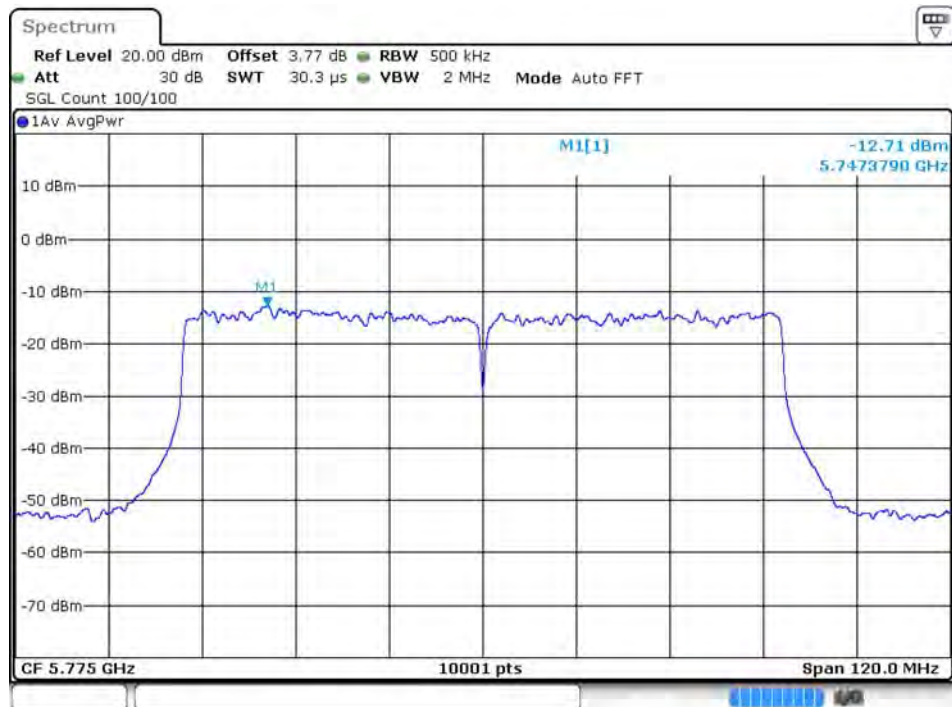


PSD NVNT ac80 5775MHz Ant2

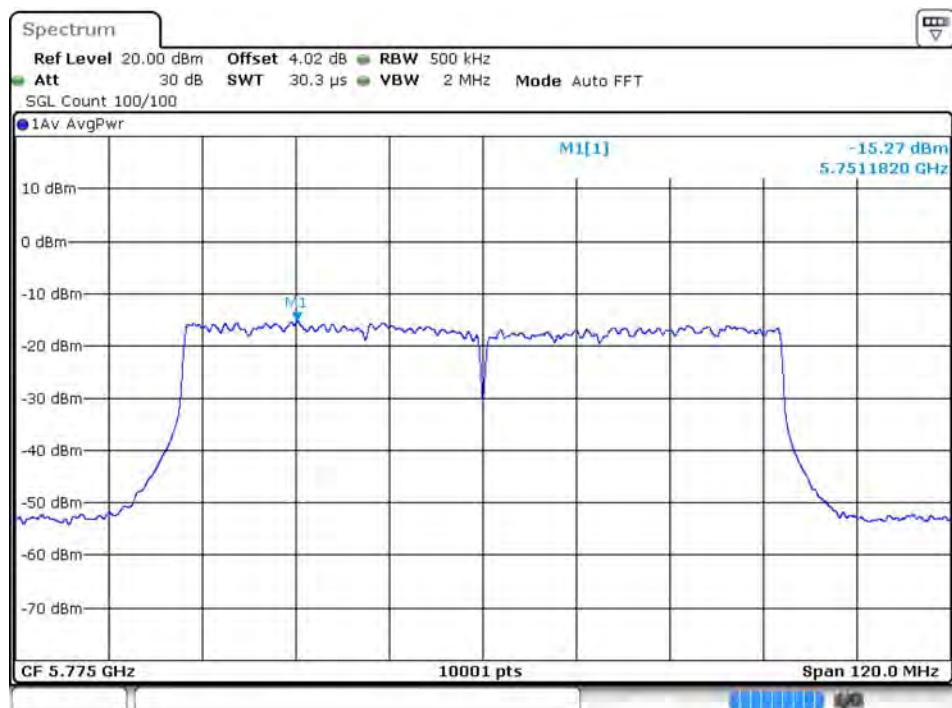

PSD NVNT ac80 5775MHz Ant1

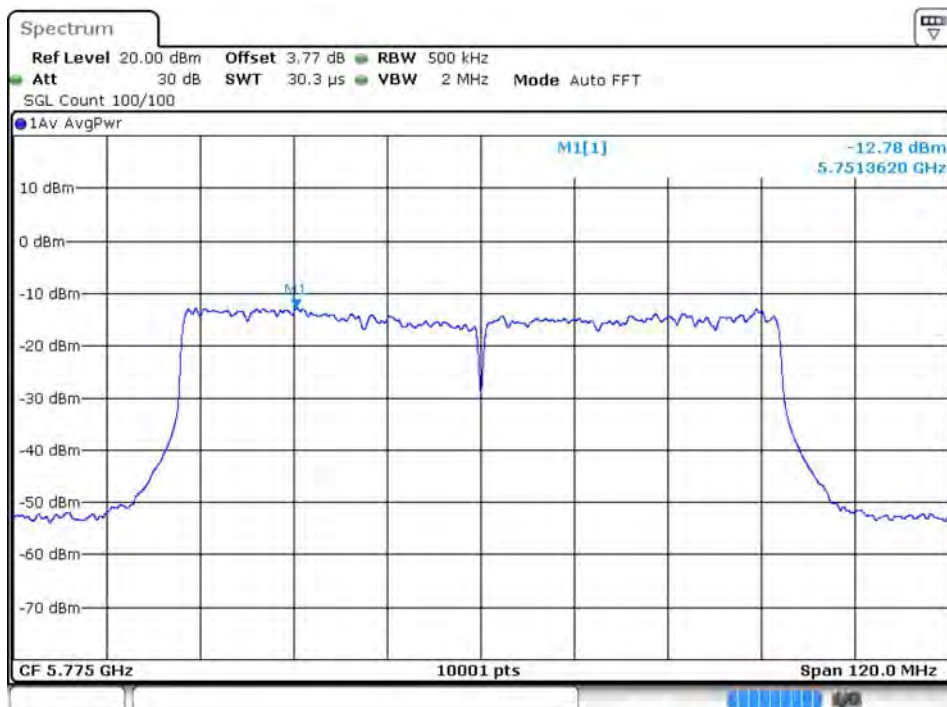


PSD NVNT ac80 5775MHz Ant2

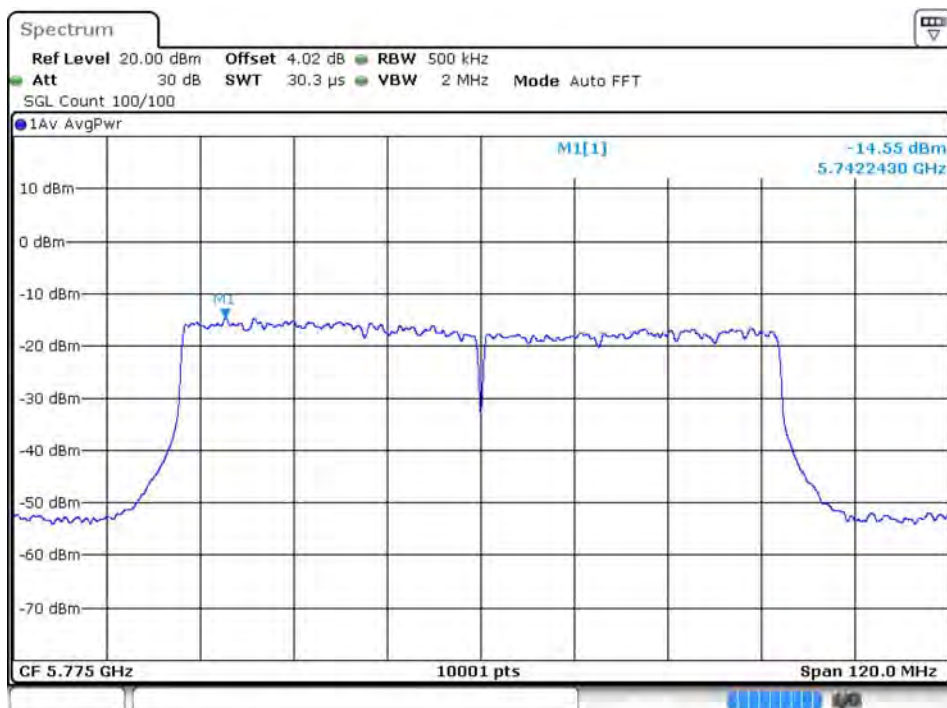


PSD NVNT ax20 5745MHz Ant1



PSD NVNT ax20 5785MHz Ant1

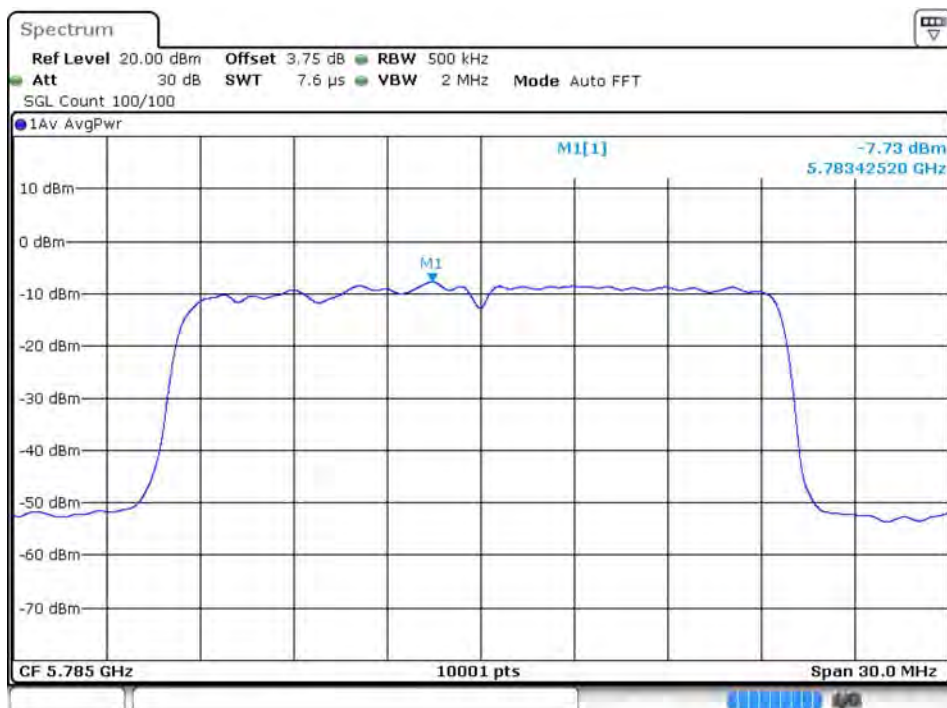


PSD NVNT ax20 5825MHz Ant1

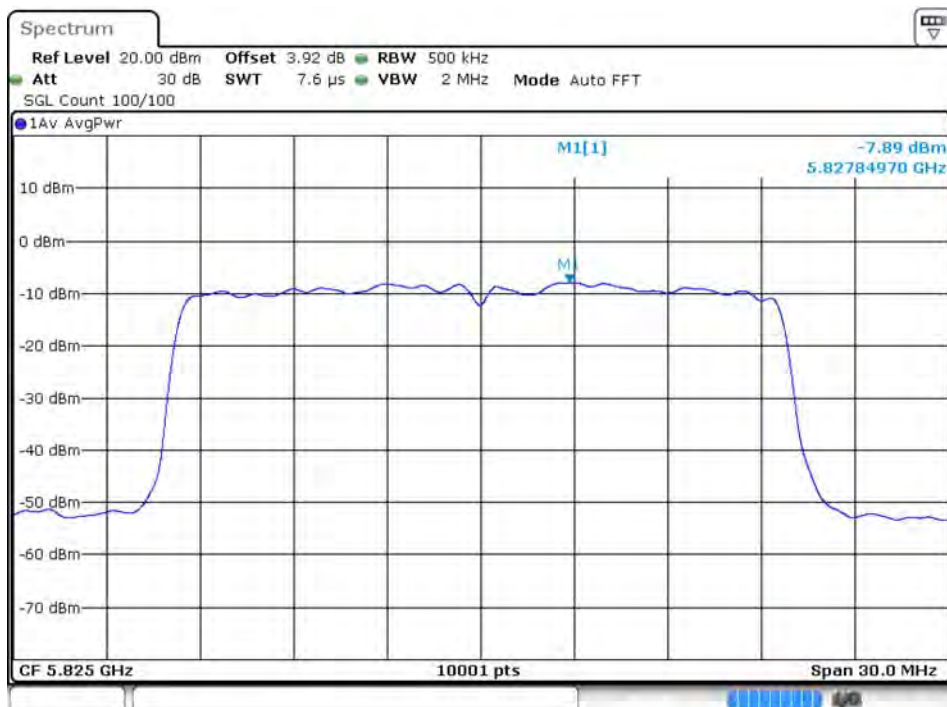


PSD NVNT ax20 5745MHz Ant2




PSD NVNT ax20 5785MHz Ant2

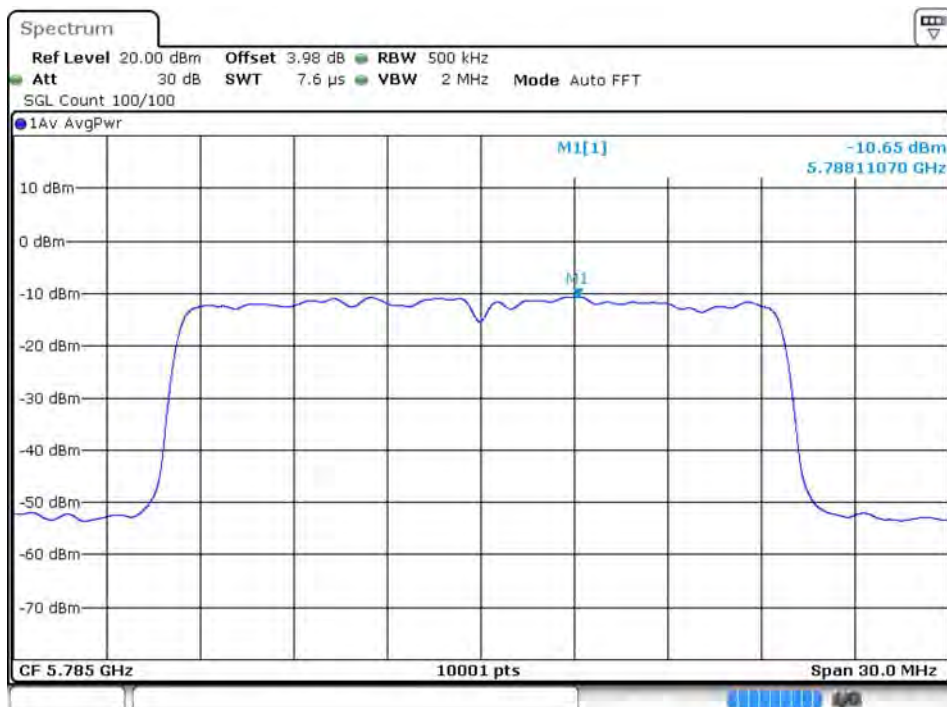

PSD NVNT ax20 5825MHz Ant2

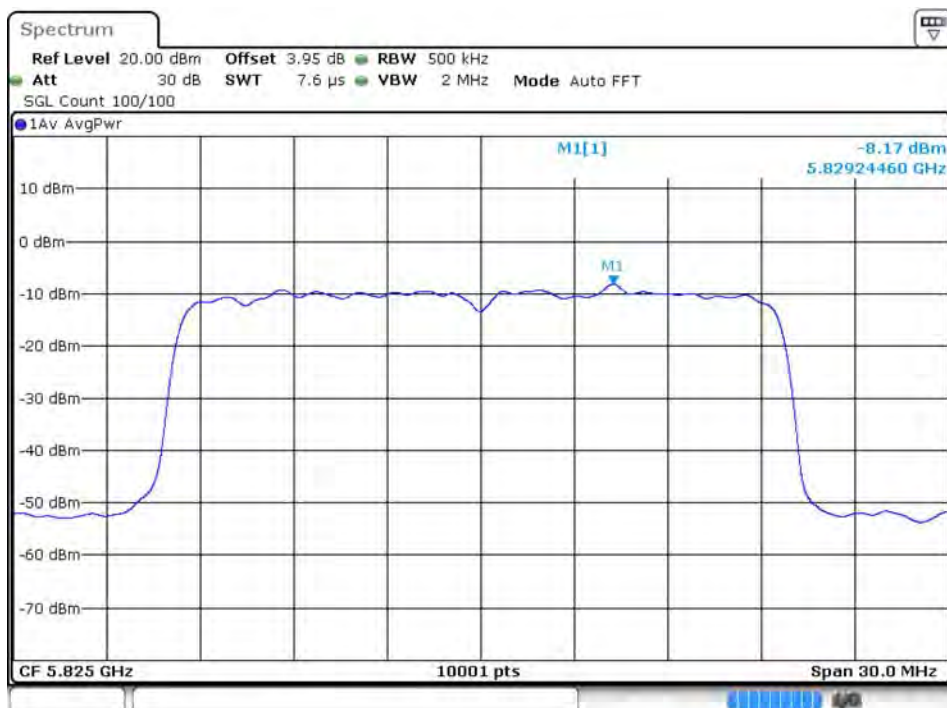


PSD NVNT ax20 5745MHz Ant1

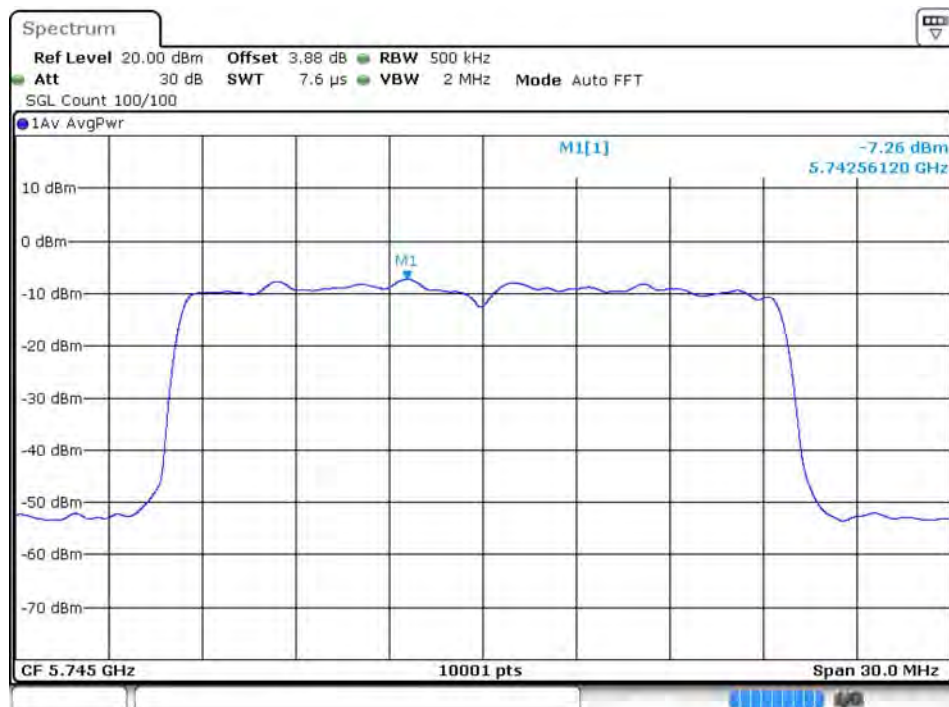


PSD NVNT ax20 5745MHz Ant2



PSD NVNT ax20 5785MHz Ant1

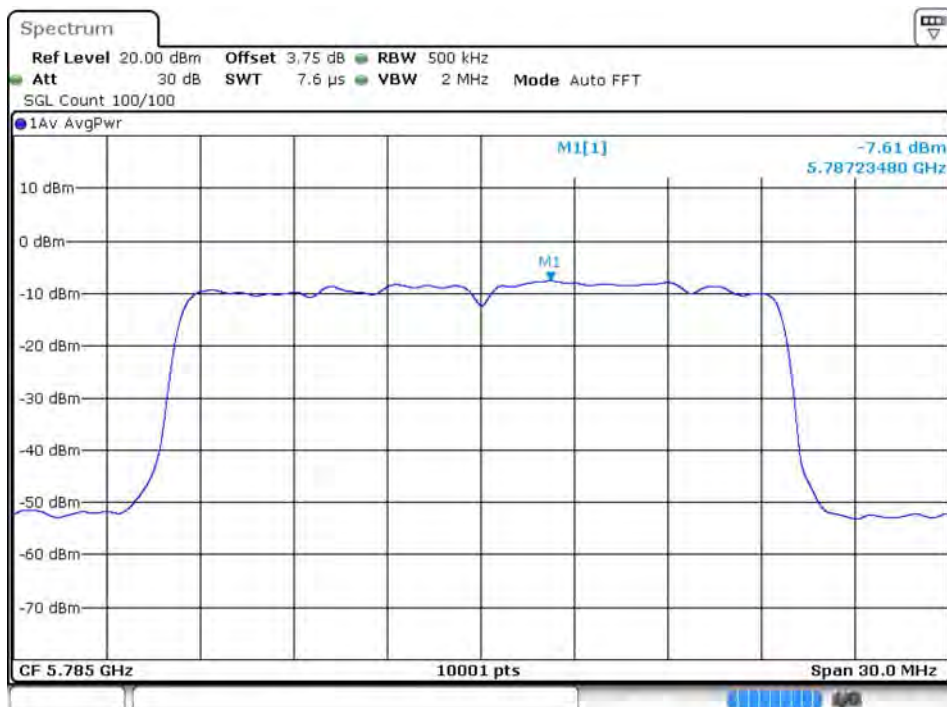

PSD NVNT ax20 5785MHz Ant2

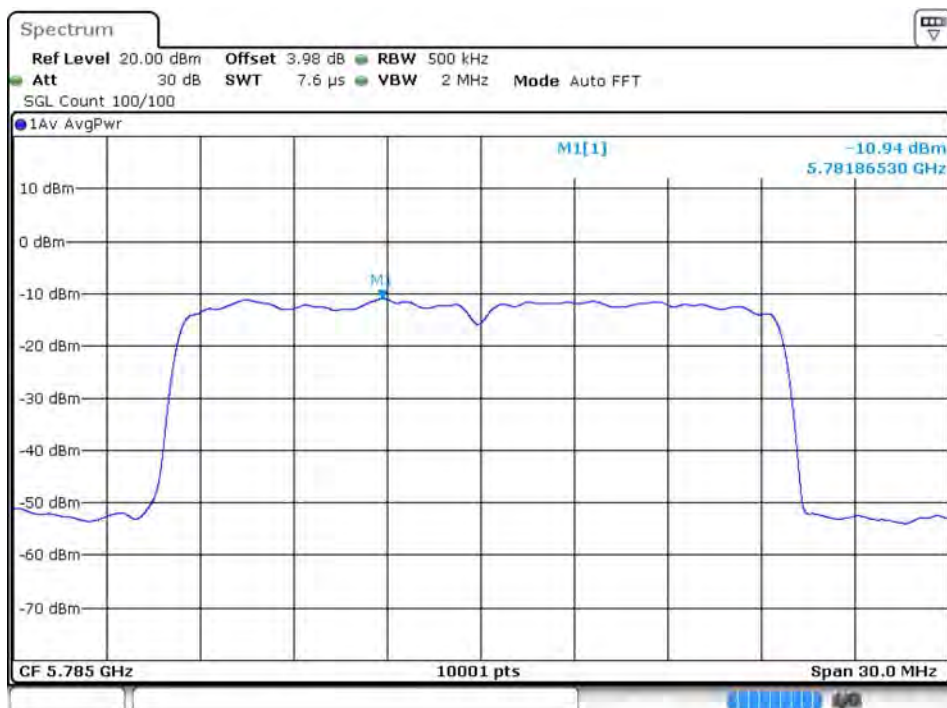


PSD NVNT ax20 5825MHz Ant1




PSD NVNT ax20 5825MHz Ant2




PSD NVNT ax40 5755MHz Ant1

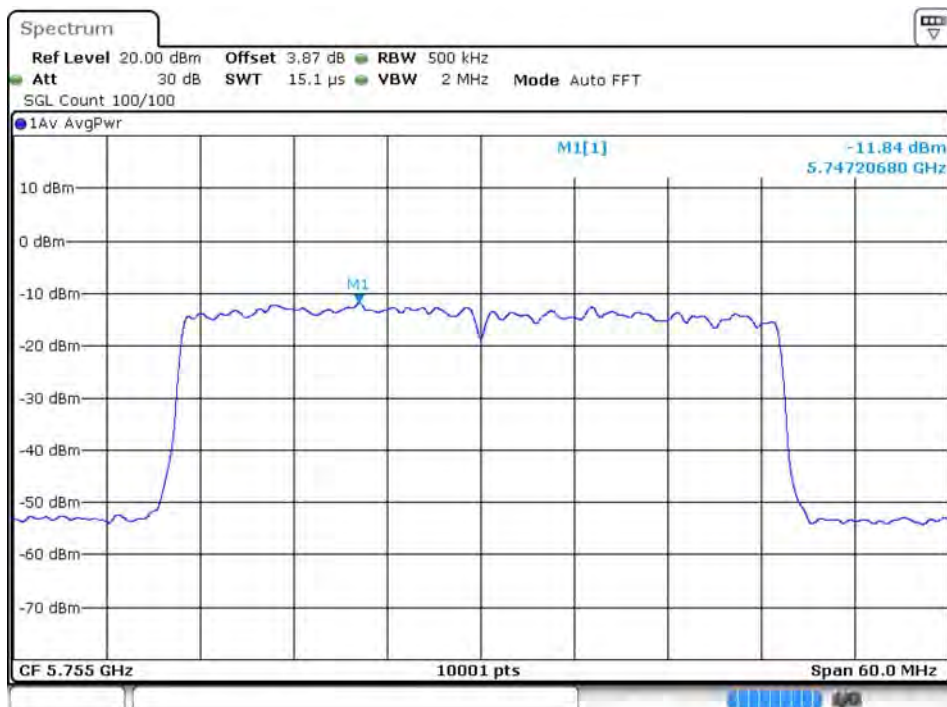


PSD NVNT ax40 5795MHz Ant1

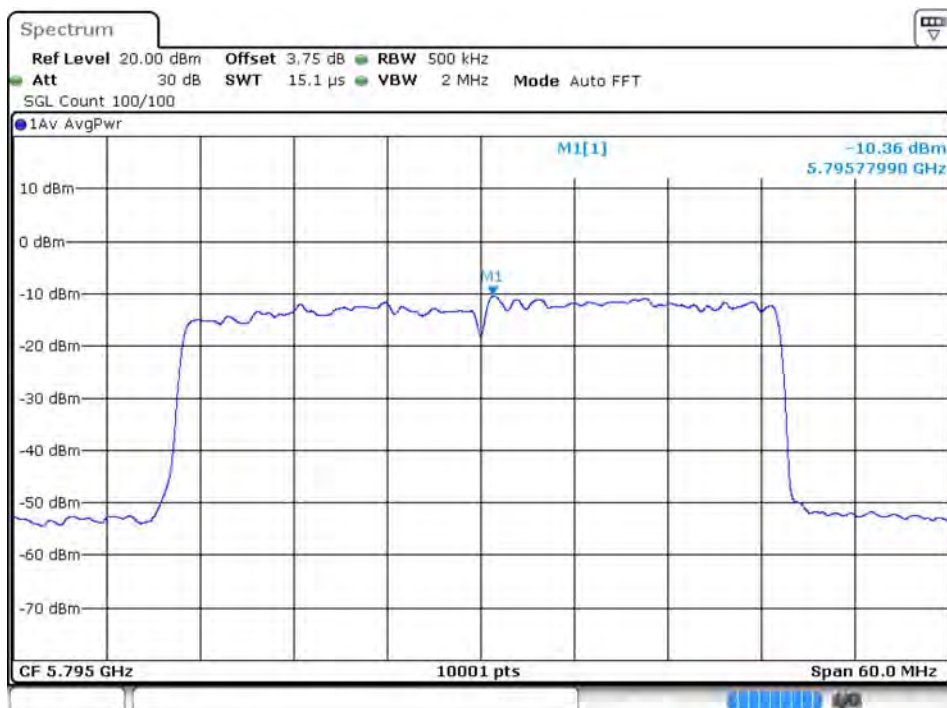


PSD NVNT ax40 5755MHz Ant2

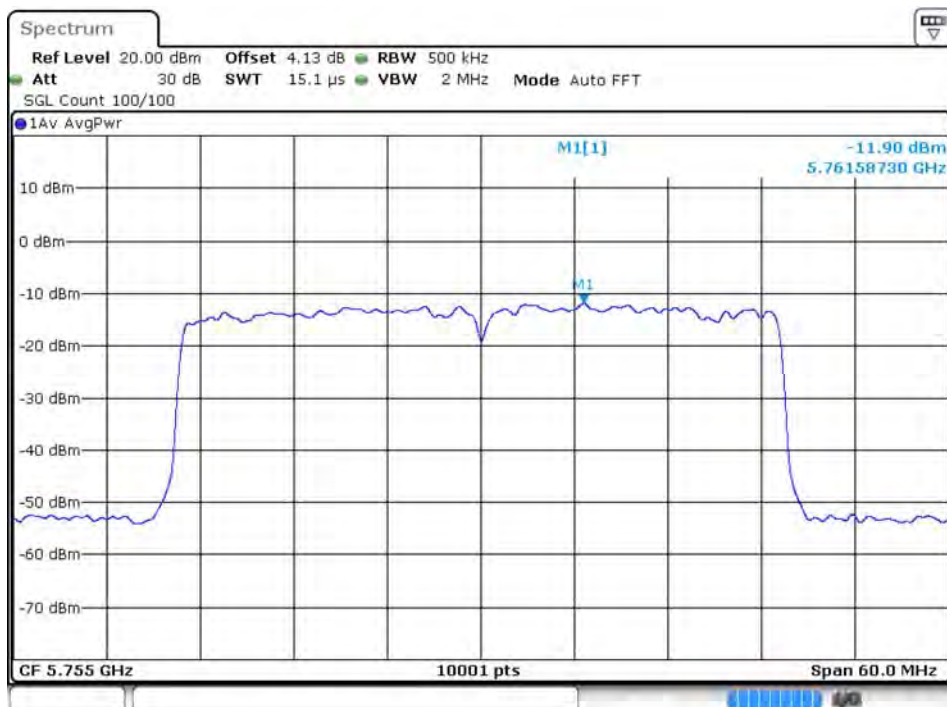


PSD NVNT ax40 5795MHz Ant2

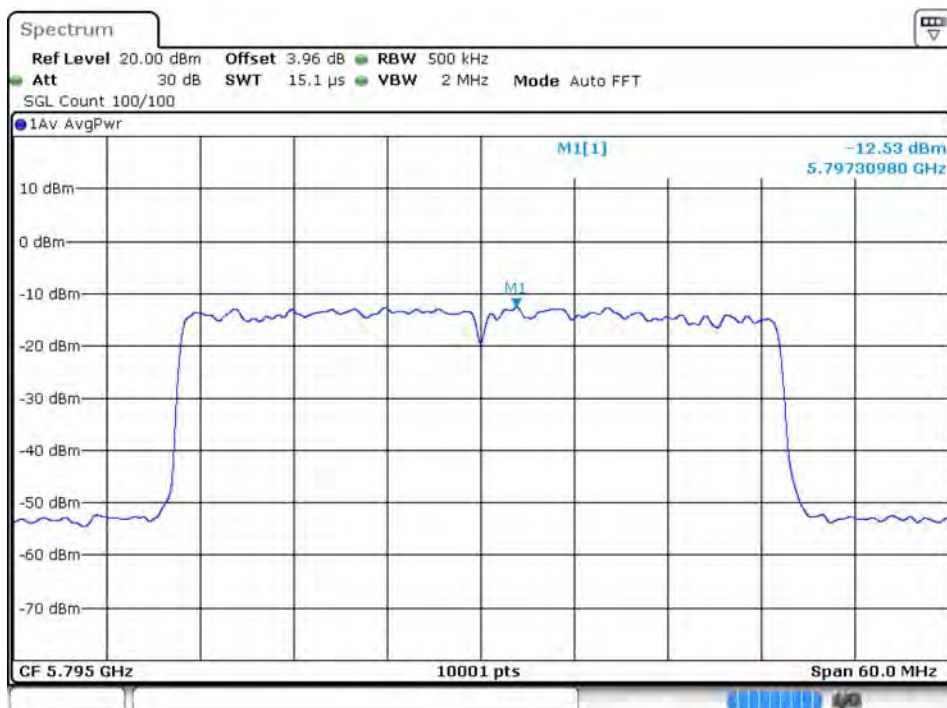


PSD NVNT ax40 5755MHz Ant1

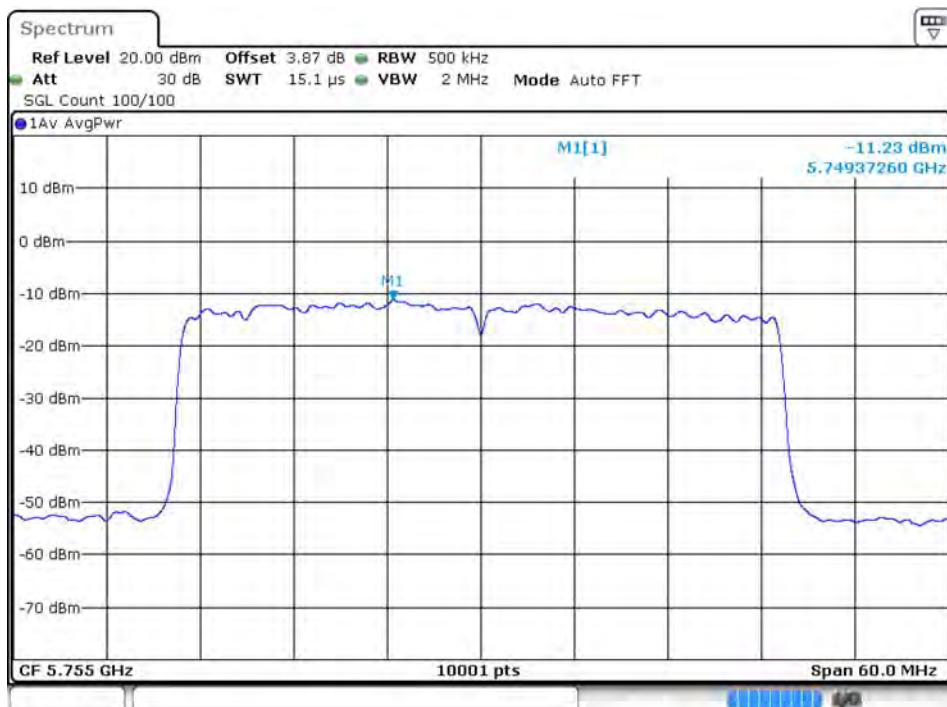


PSD NVNT ax40 5755MHz Ant2

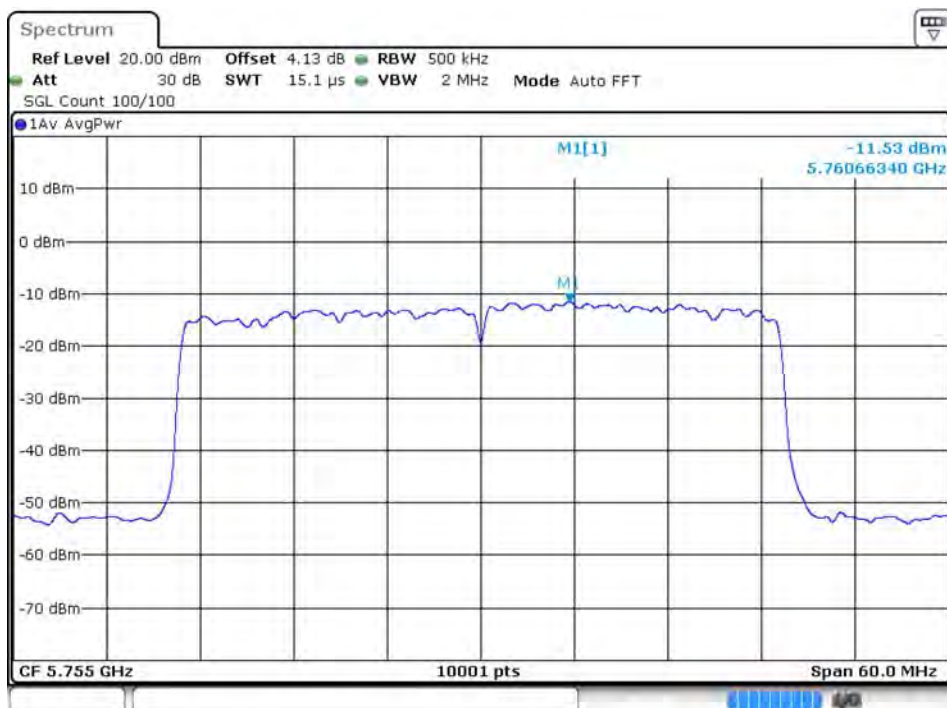


PSD NVNT ax40 5795MHz Ant1

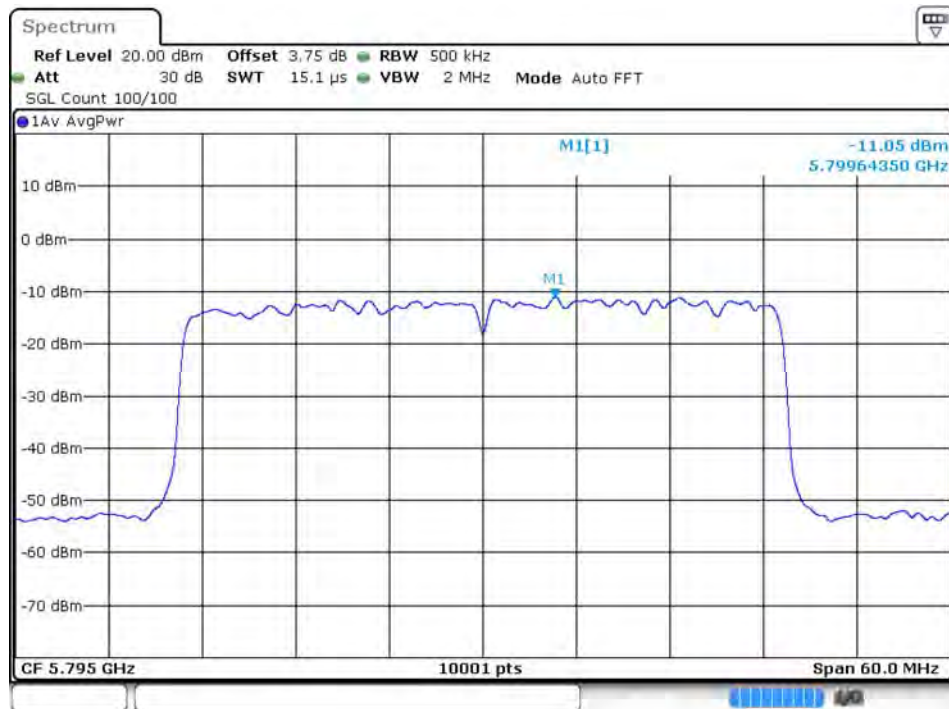


PSD NVNT ax40 5795MHz Ant2

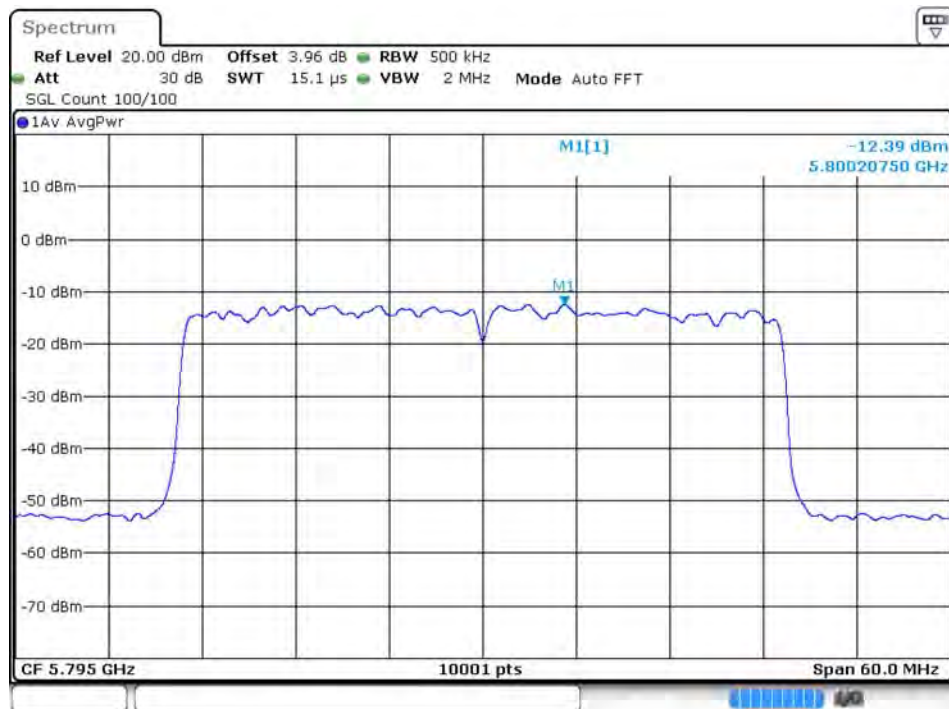


PSD NVNT ax80 5775MHz Ant1

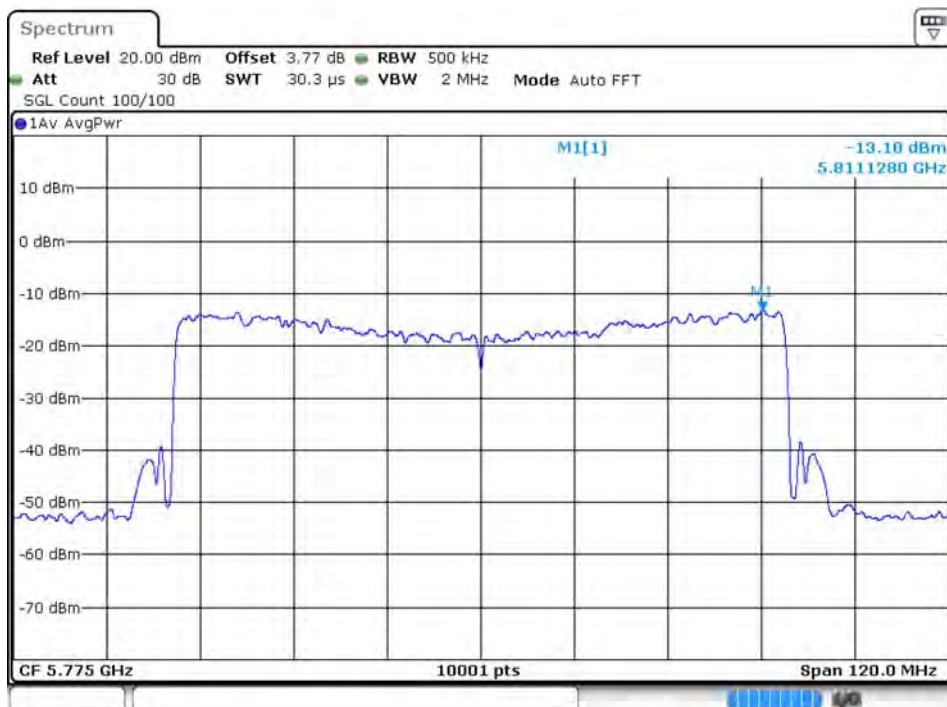


PSD NVNT ax80 5775MHz Ant2

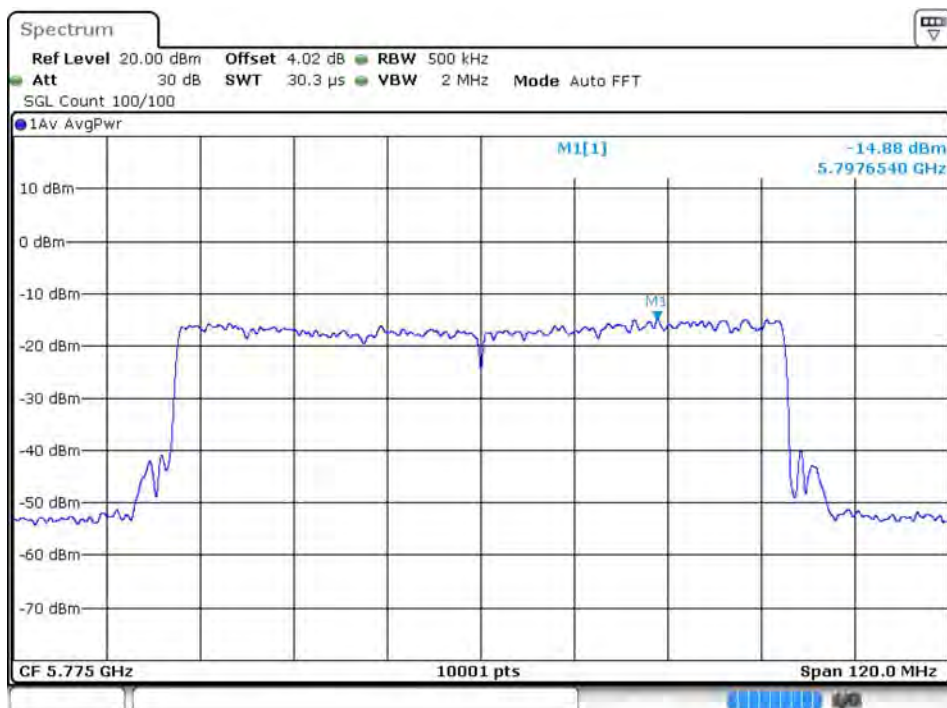

PSD NVNT ax80 5775MHz Ant1

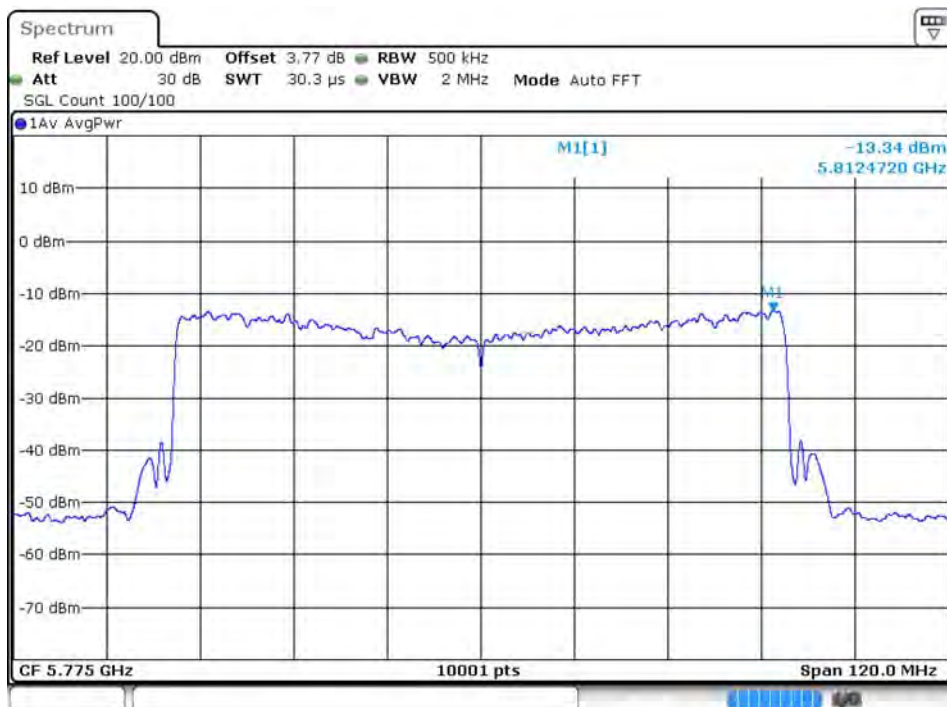

PSD NVNT ax80 5775MHz Ant2

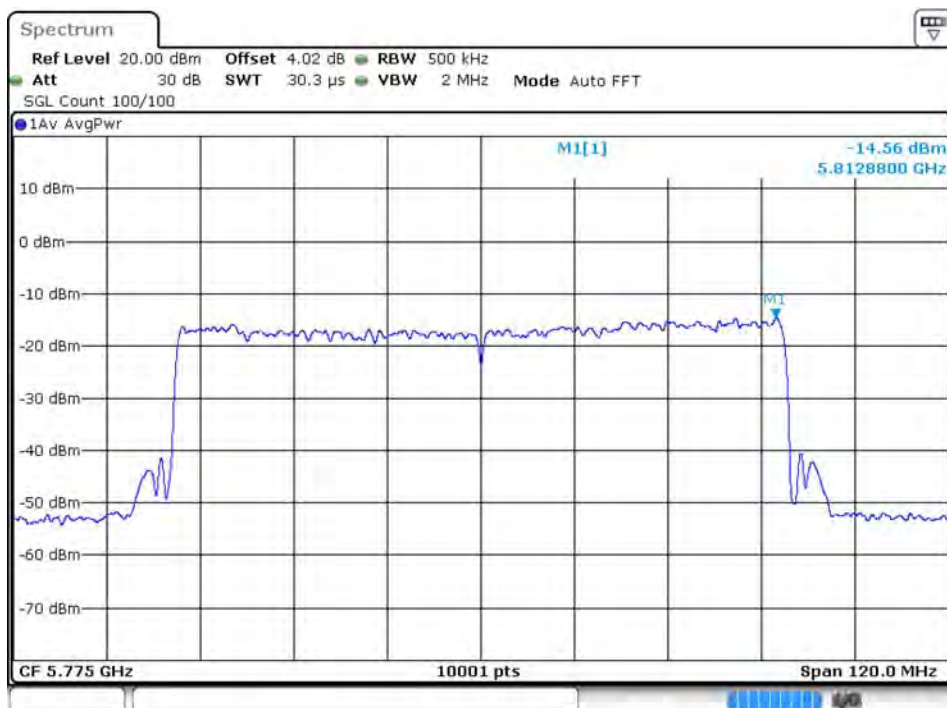




Band Edge


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBm)	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	-39.45	Refer to the test plot	Pass
NVNT	a	5825	Ant1	-39.26	Refer to the test plot	Pass
NVNT	a	5745	Ant2	-36.37	Refer to the test plot	Pass
NVNT	a	5825	Ant2	-37.34	Refer to the test plot	Pass
NVNT	n20	5745	Ant1	-39.53	Refer to the test plot	Pass
NVNT	n20	5825	Ant1	-38.98	Refer to the test plot	Pass
NVNT	n20	5745	Ant2	-37.72	Refer to the test plot	Pass
NVNT	n20	5825	Ant2	-36.38	Refer to the test plot	Pass
NVNT	n40	5755	Ant1	-39.92	Refer to the test plot	Pass
NVNT	n40	5795	Ant1	-38.16	Refer to the test plot	Pass
NVNT	n40	5755	Ant2	-37.32	Refer to the test plot	Pass
NVNT	n40	5795	Ant2	-35.34	Refer to the test plot	Pass
NVNT	ac20	5745	Ant1	-38.95	Refer to the test plot	Pass
NVNT	ac20	5825	Ant1	-38.91	Refer to the test plot	Pass
NVNT	ac20	5745	Ant2	-37.18	Refer to the test plot	Pass
NVNT	ac20	5825	Ant2	-36.12	Refer to the test plot	Pass
NVNT	ac40	5755	Ant1	-38.93	Refer to the test plot	Pass
NVNT	ac40	5795	Ant1	-38.04	Refer to the test plot	Pass
NVNT	ac40	5755	Ant2	-36.64	Refer to the test plot	Pass
NVNT	ac40	5795	Ant2	-35.91	Refer to the test plot	Pass
NVNT	ac80	5775	Ant1	-39.33	Refer to the test plot	Pass
NVNT	ac80	5775	Ant1	-39.8	Refer to the test plot	Pass
NVNT	ac80	5775	Ant1	-40.35	Refer to the test plot	Pass
NVNT	ac80	5775	Ant2	-37.57	Refer to the test plot	Pass
NVNT	ac80	5775	Ant2	-37.89	Refer to the test plot	Pass
NVNT	ax20	5745	Ant1	-39.94	Refer to the test plot	Pass
NVNT	ax20	5825	Ant1	-39.65	Refer to the test plot	Pass
NVNT	ax20	5745	Ant2	-37.53	Refer to the test plot	Pass
NVNT	ax20	5825	Ant2	-37.49	Refer to the test plot	Pass
NVNT	ax40	5755	Ant1	-39.9	Refer to the test plot	Pass
NVNT	ax40	5795	Ant1	-39	Refer to the test plot	Pass
NVNT	ax40	5755	Ant2	-36.84	Refer to the test plot	Pass
NVNT	ax40	5795	Ant2	-36.07	Refer to the test plot	Pass
NVNT	ax80	5775	Ant1	-39.63	Refer to the test plot	Pass
NVNT	ax80	5775	Ant1	-39.86	Refer to the test plot	Pass
NVNT	ax80	5775	Ant2	-37.19	Refer to the test plot	Pass
NVNT	ax80	5775	Ant2	-37.14	Refer to the test plot	Pass

Test Graphs


Band Edge NVNT a 5745MHz Low Ant1

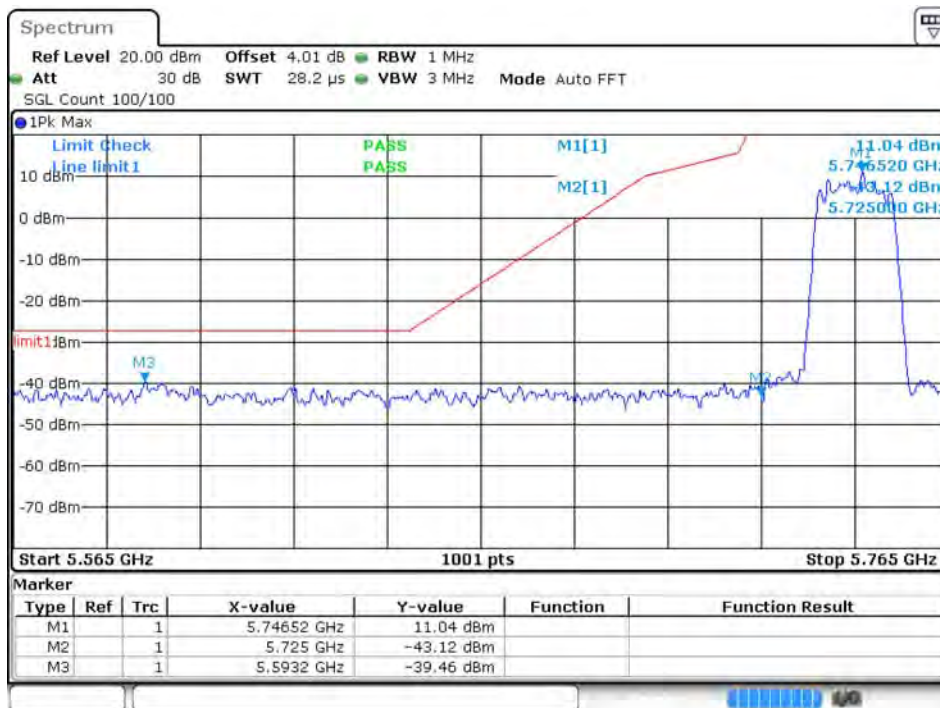


Band Edge NVNT a 5825MHz High Ant1

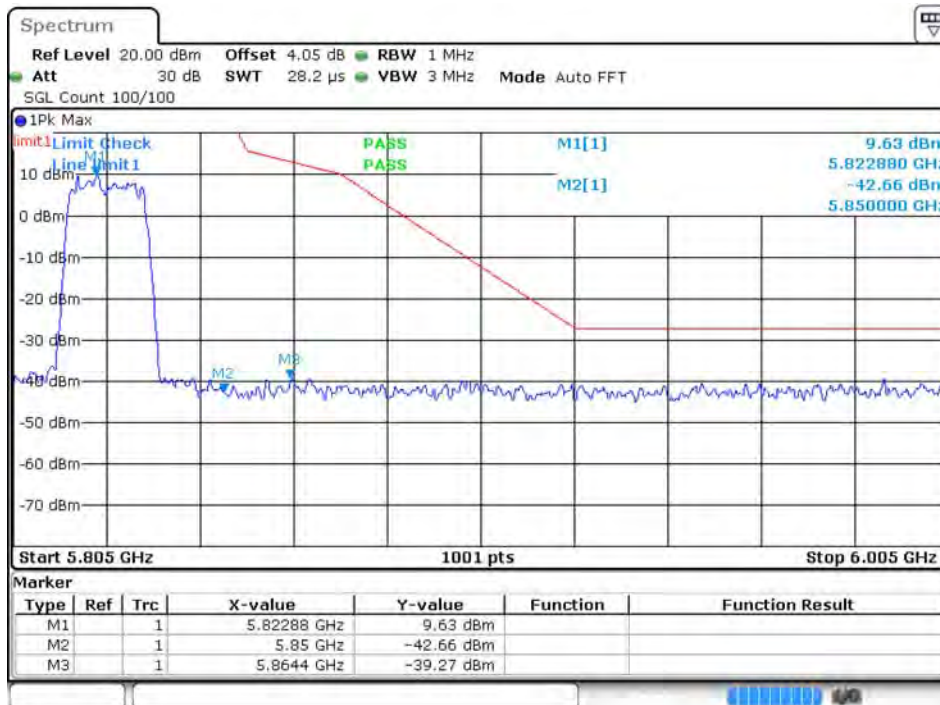


Band Edge NVNT a 5745MHz Low Ant2

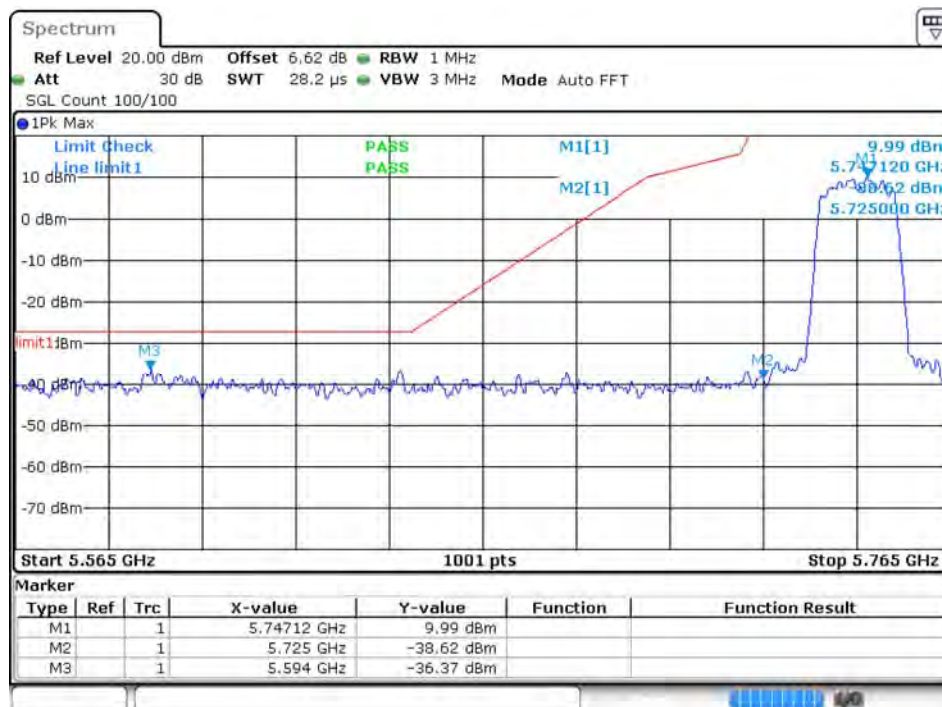

Band Edge NVNT a 5825MHz High Ant2

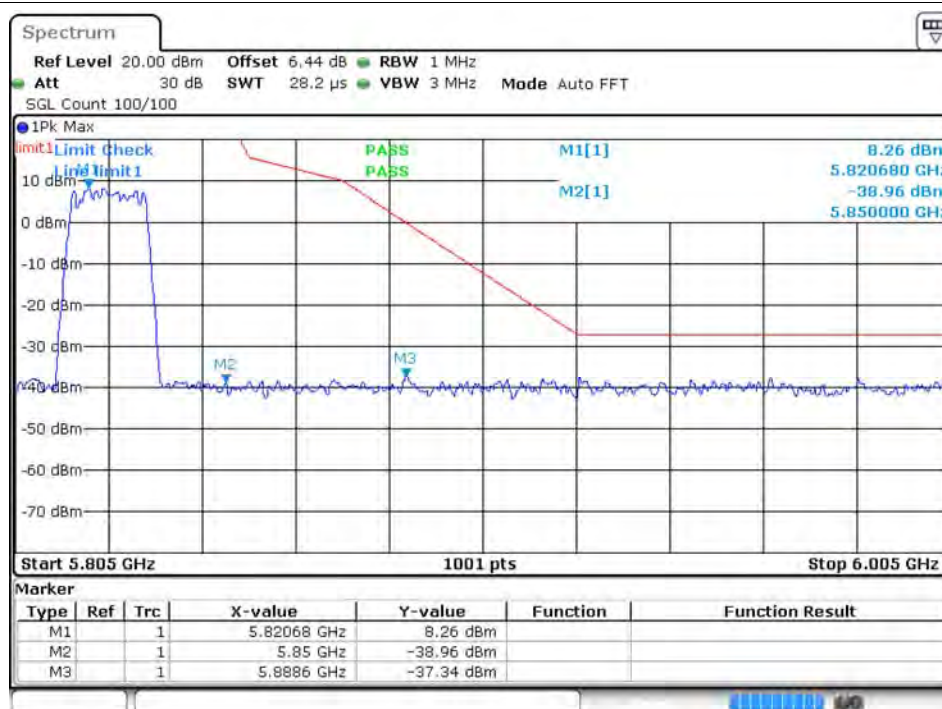


Band Edge NVNT n20 5745MHz Low Ant1

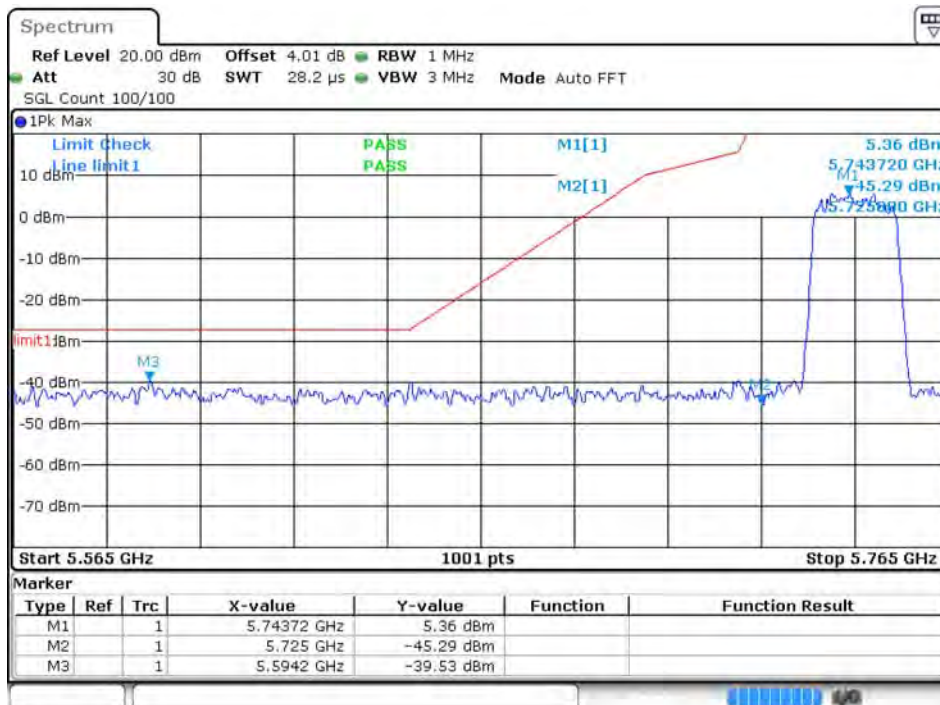


Band Edge NVNT n20 5825MHz High Ant1



Band Edge NVNT n20 5745MHz Low Ant2

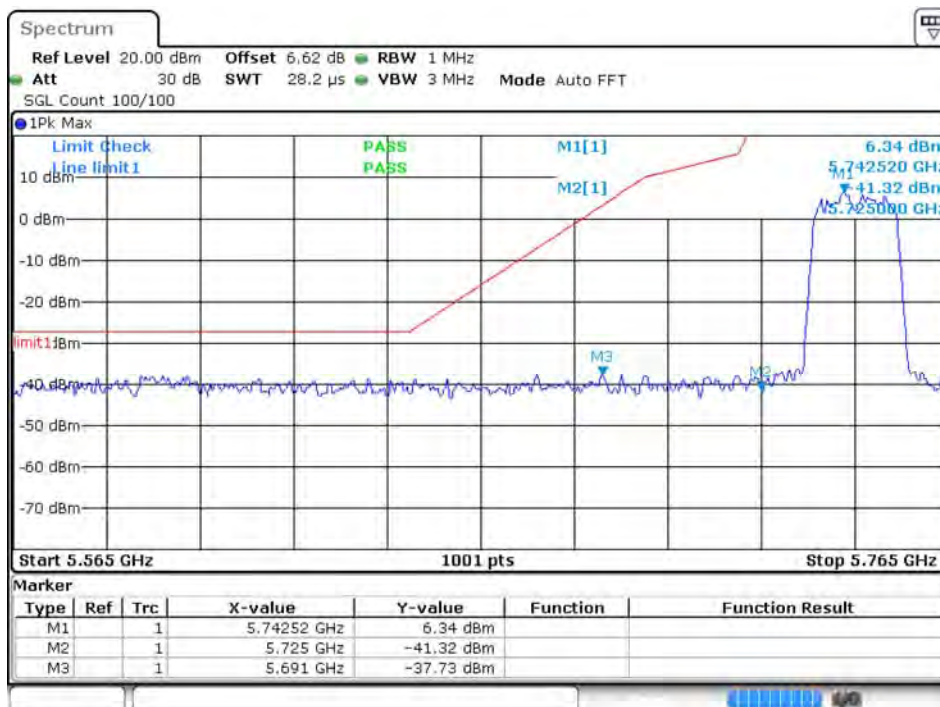


Band Edge NVNT n20 5825MHz High Ant2

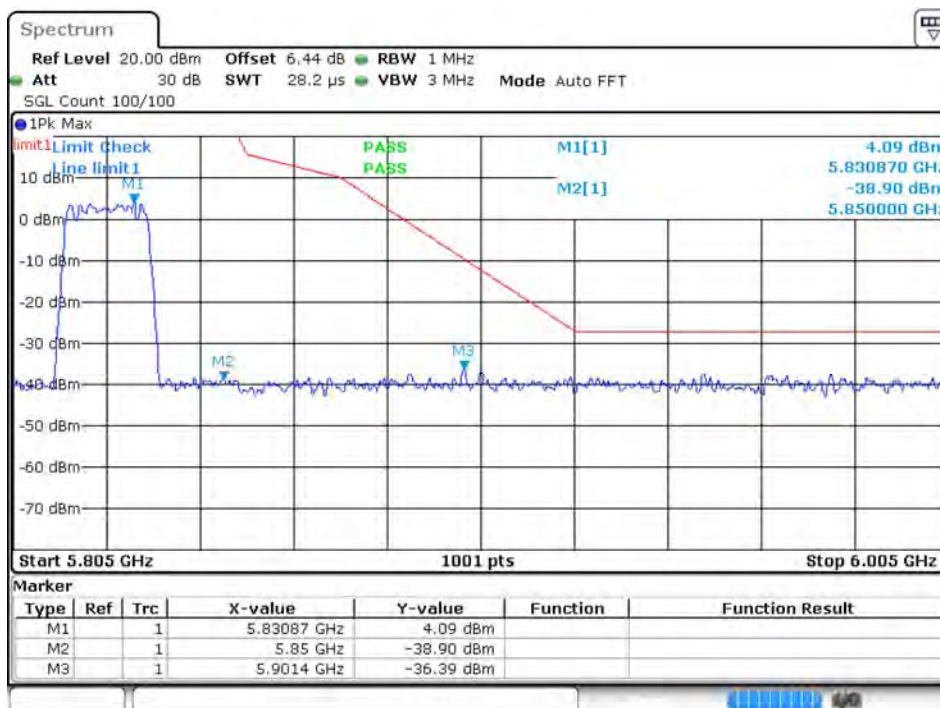


Band Edge NVNT n40 5755MHz Low Ant1




Band Edge NVNT n40 5795MHz High Ant1

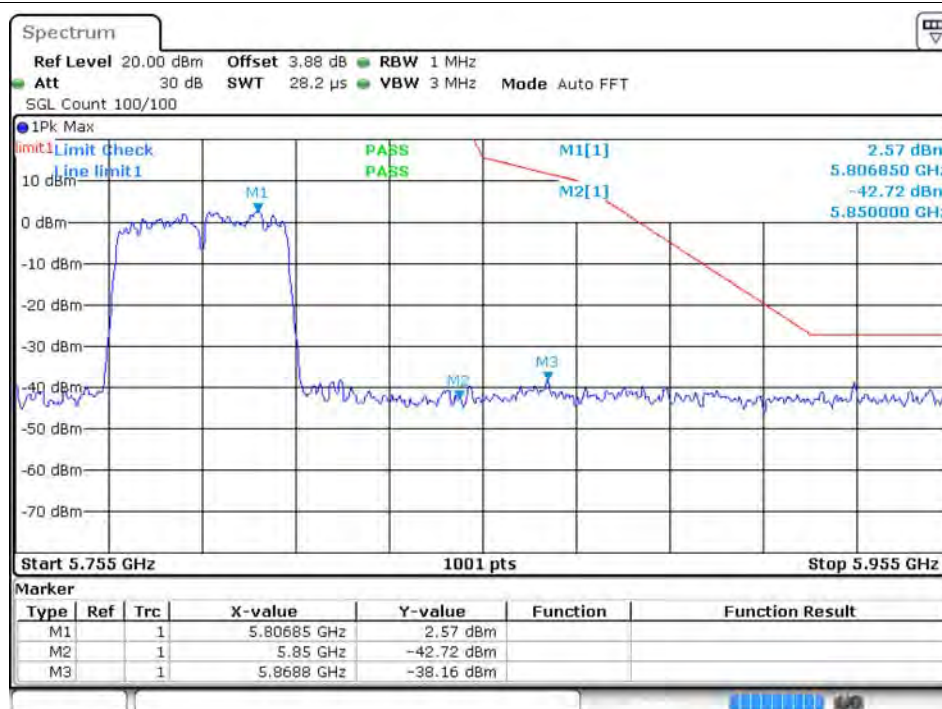


Band Edge NVNT n40 5755MHz Low Ant2

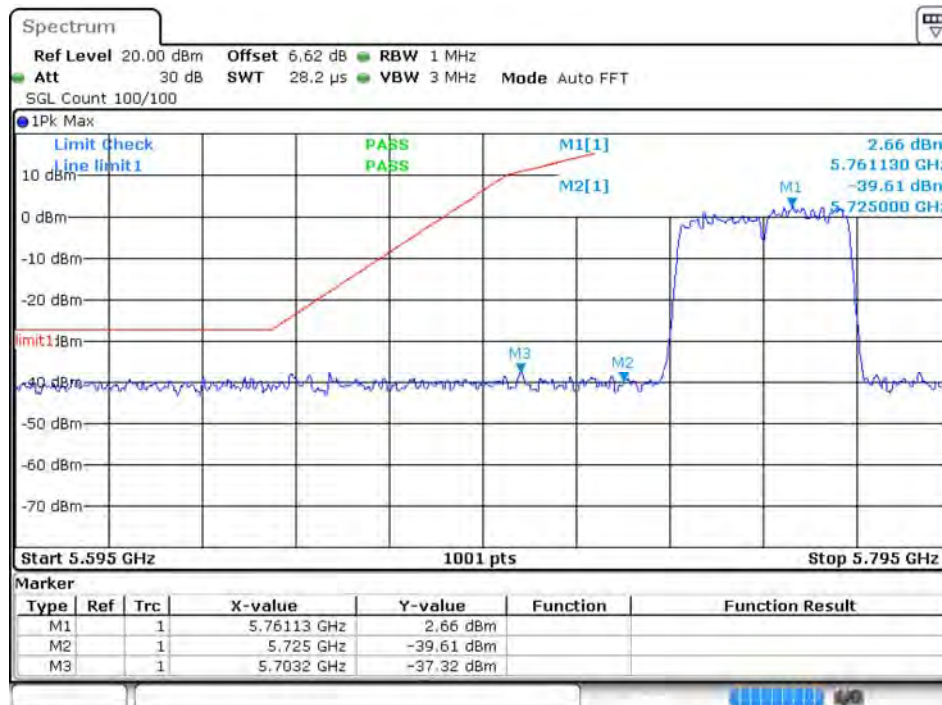


Band Edge NVNT n40 5795MHz High Ant2

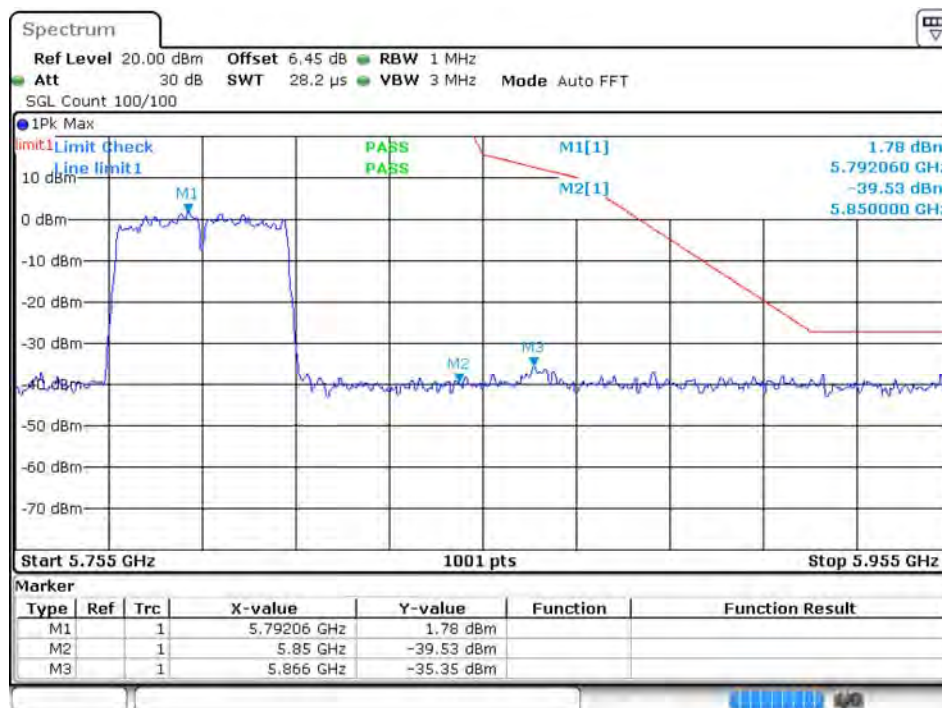


Band Edge NVNT ac20 5745MHz Low Ant1

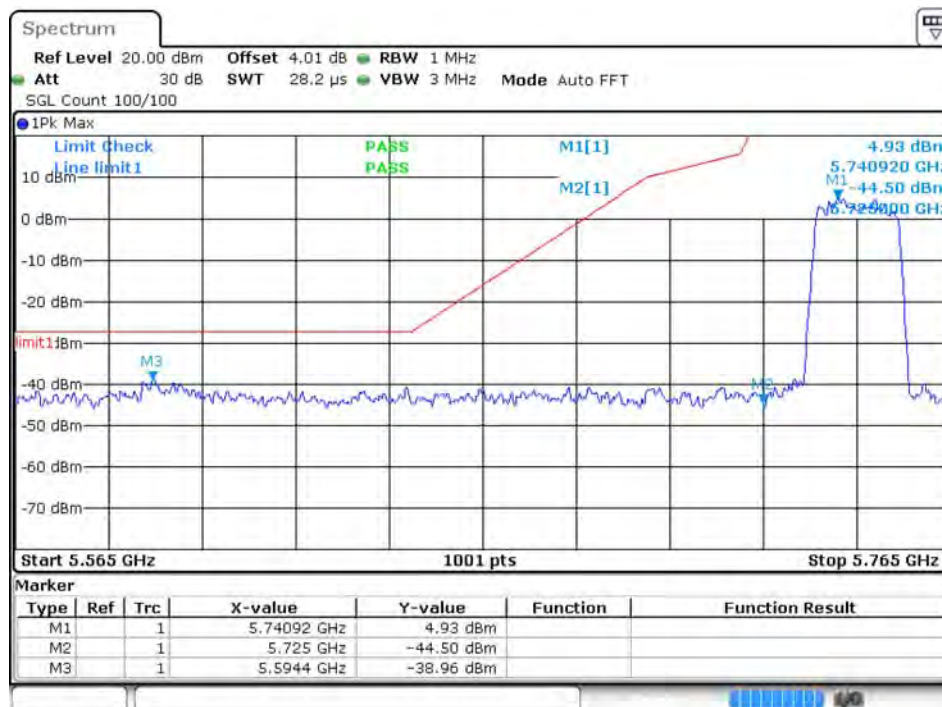


Band Edge NVNT ac20 5825MHz High Ant1

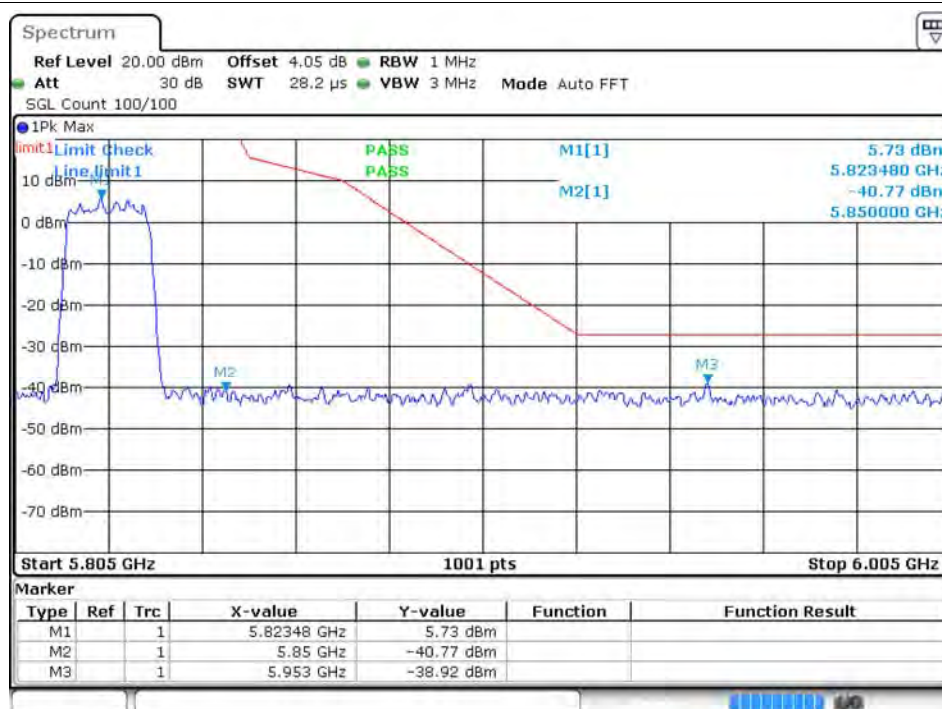


Band Edge NVNT ac20 5745MHz Low Ant2

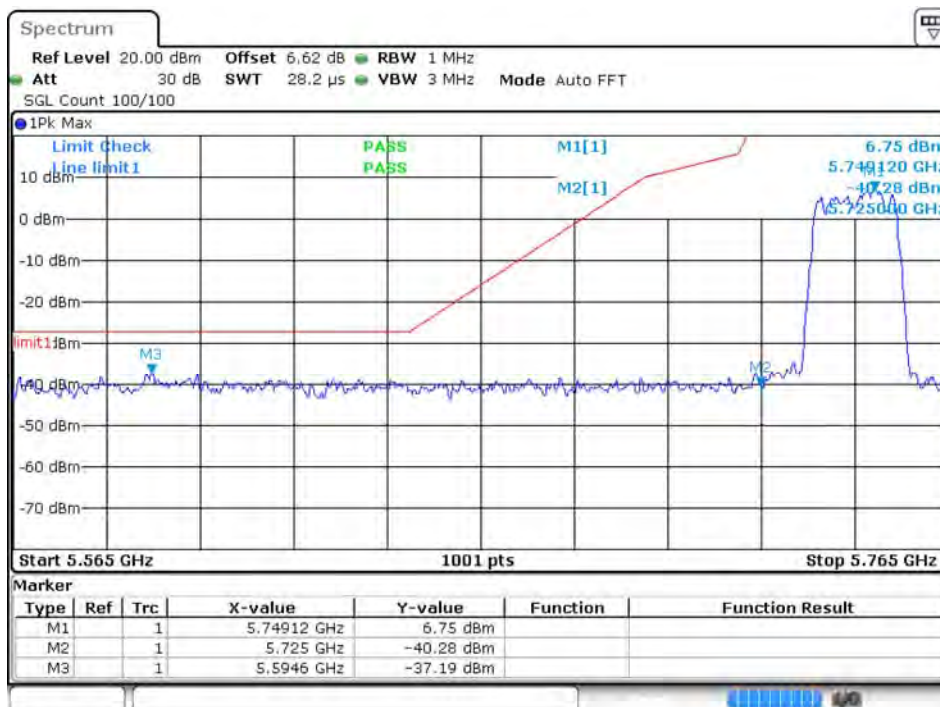


Band Edge NVNT ac20 5825MHz High Ant2

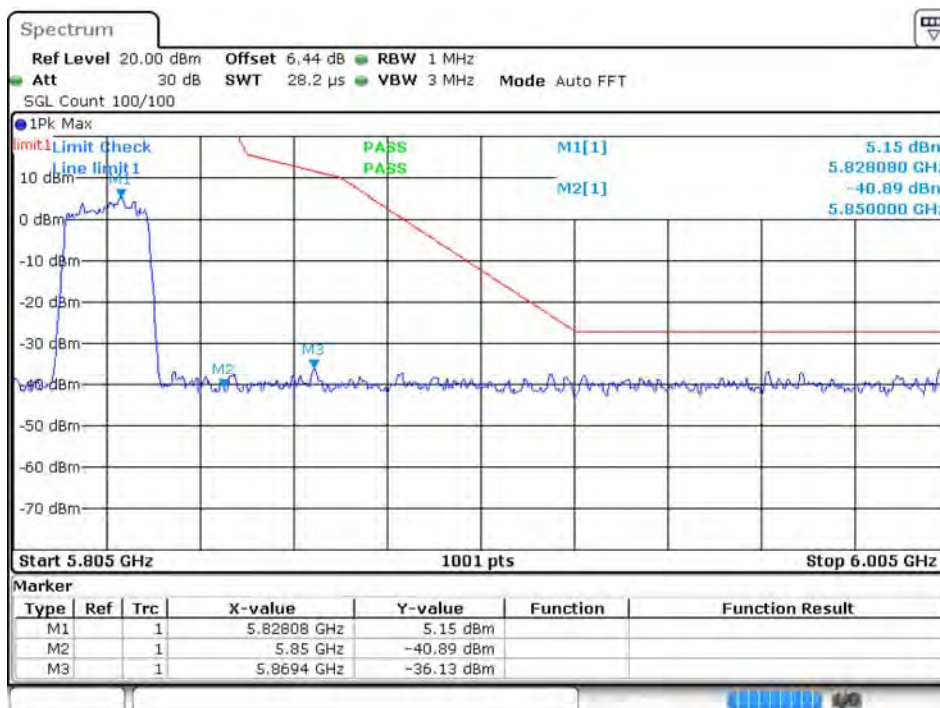


Band Edge NVNT ac40 5755MHz Low Ant1

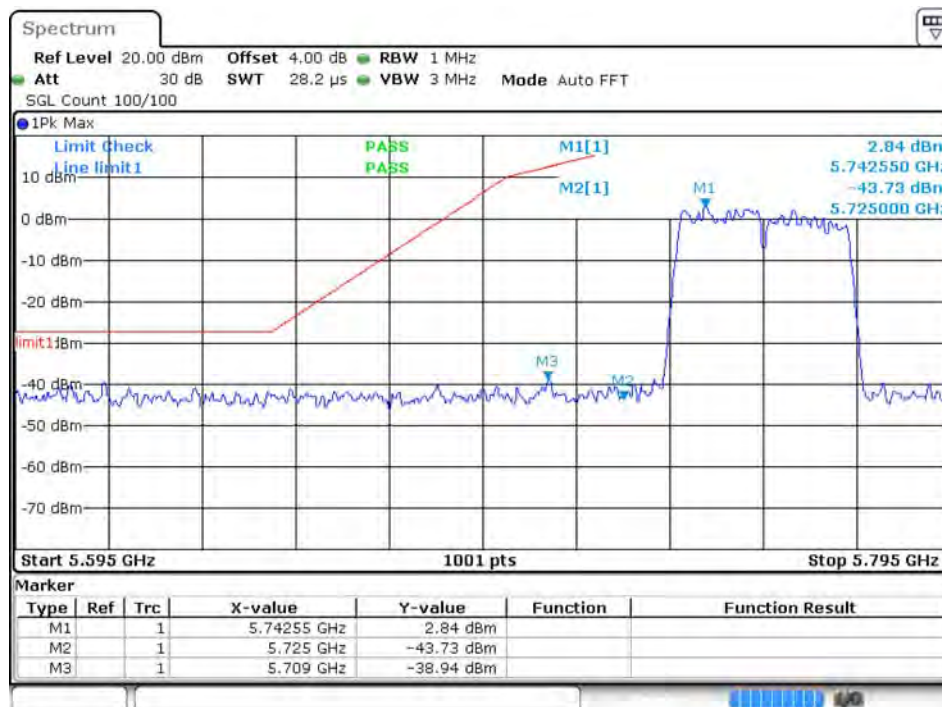


Band Edge NVNT ac40 5795MHz High Ant1

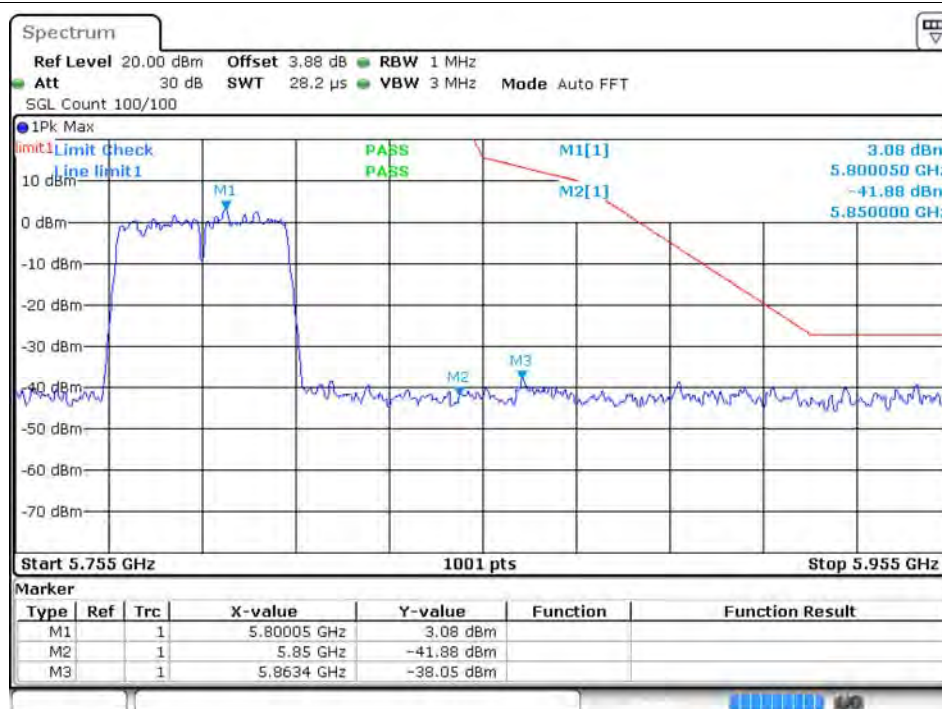


Band Edge NVNT ac40 5755MHz Low Ant2

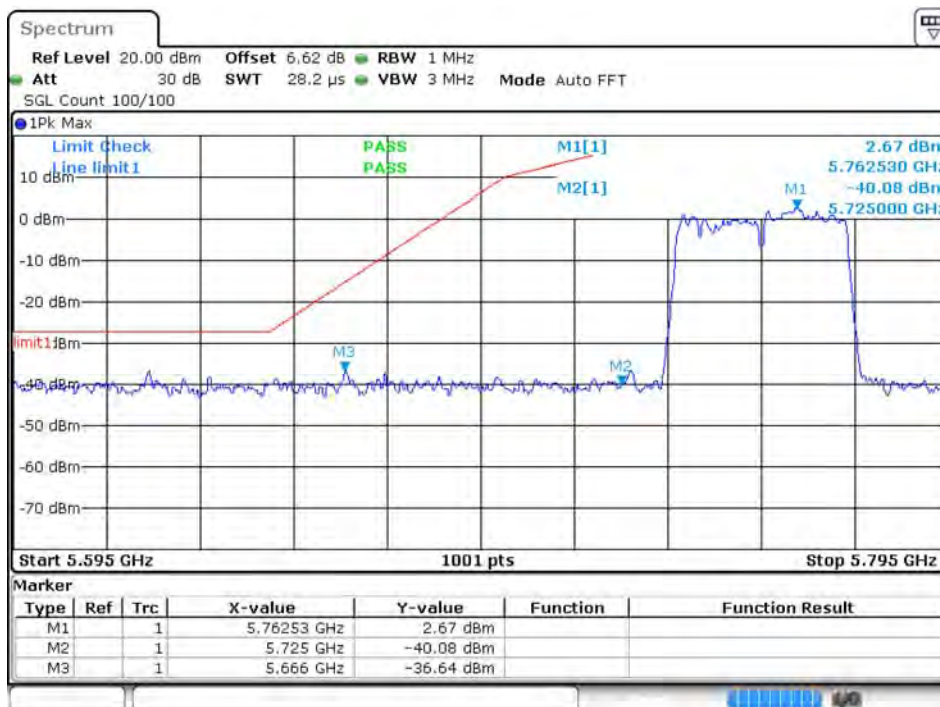


Band Edge NVNT ac40 5795MHz High Ant2

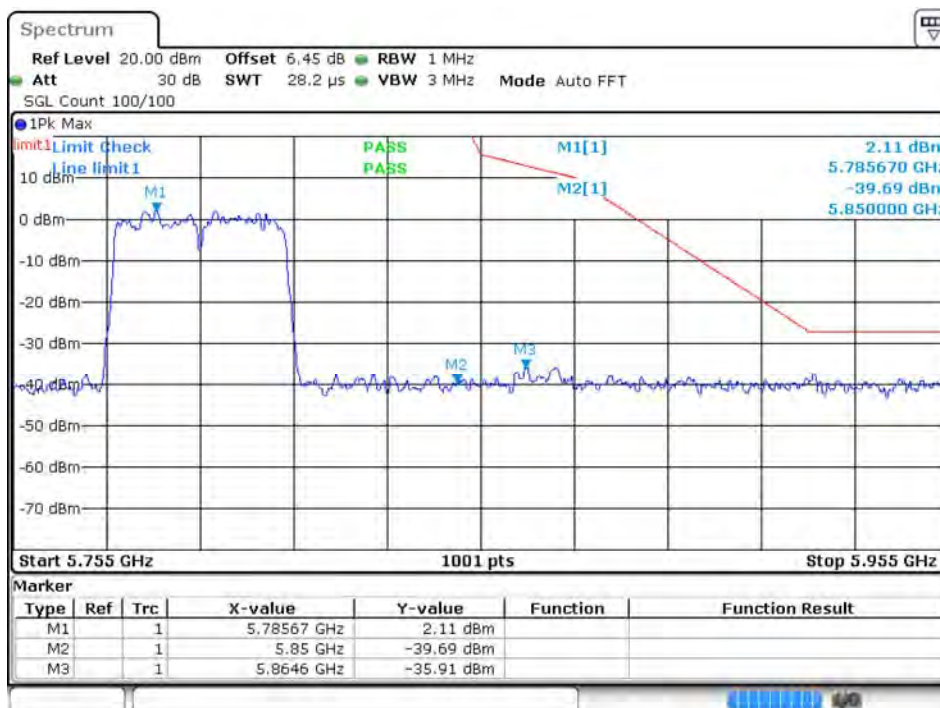


Band Edge NVNT ac80 5775MHz High Ant1

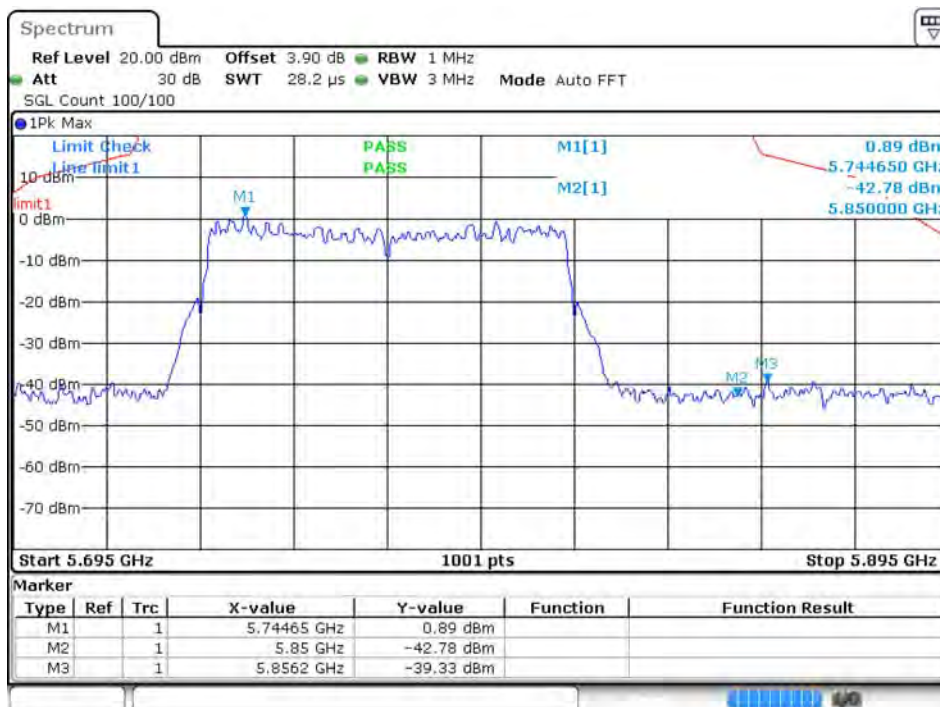


Band Edge NVNT ac80 5775MHz High Ant1

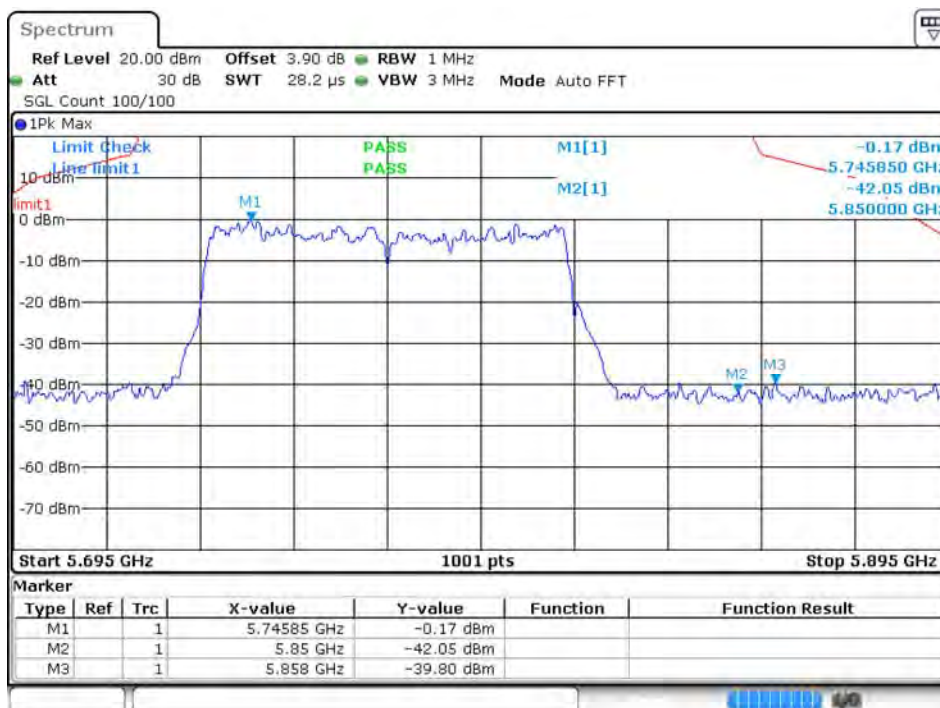


Band Edge NVNT ac80 5775MHz Low Ant1

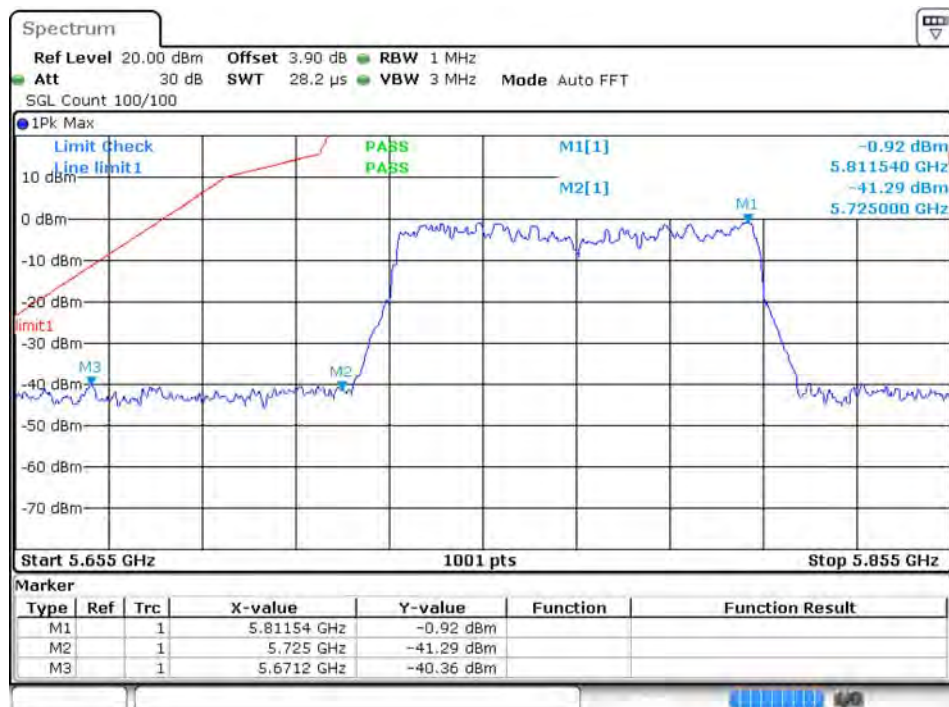


Band Edge NVNT ac80 5775MHz High Ant2

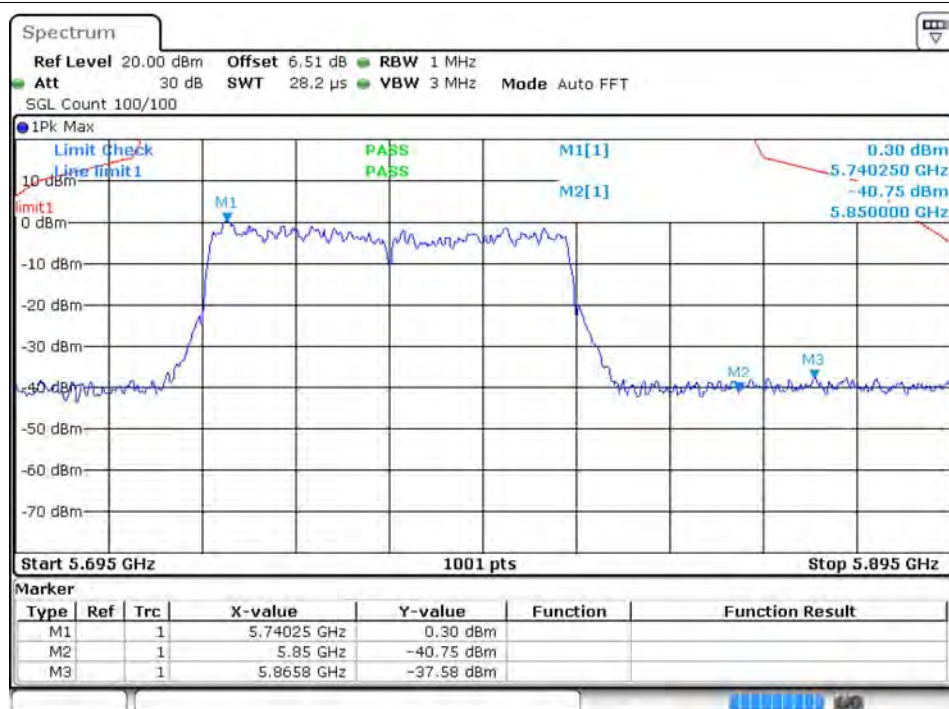


Band Edge NVNT ac80 5775MHz Low Ant2

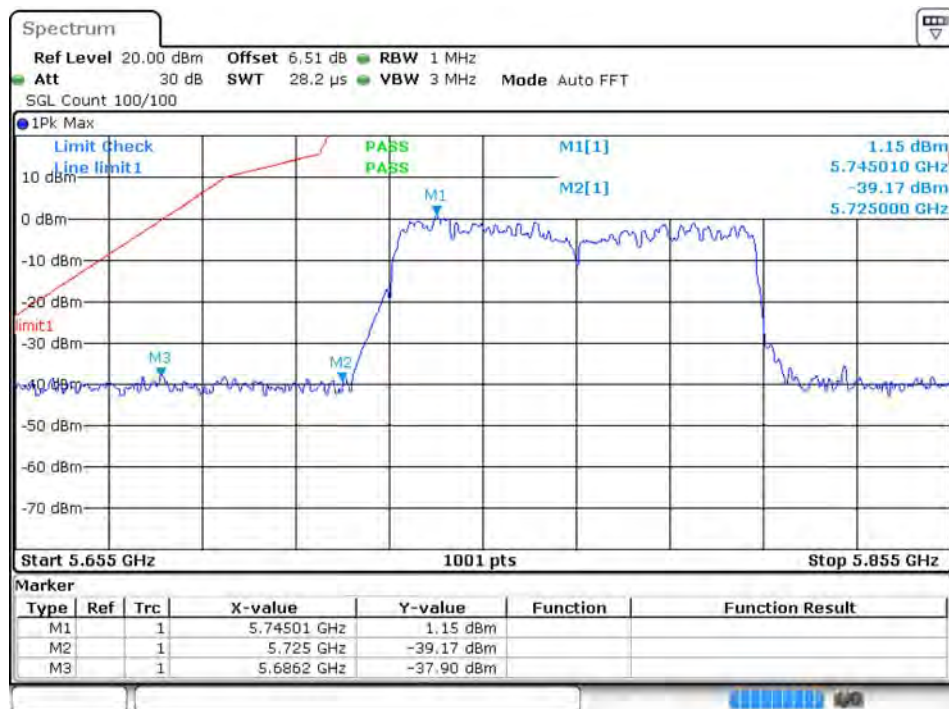


Band Edge NVNT ax20 5745MHz Low Ant1

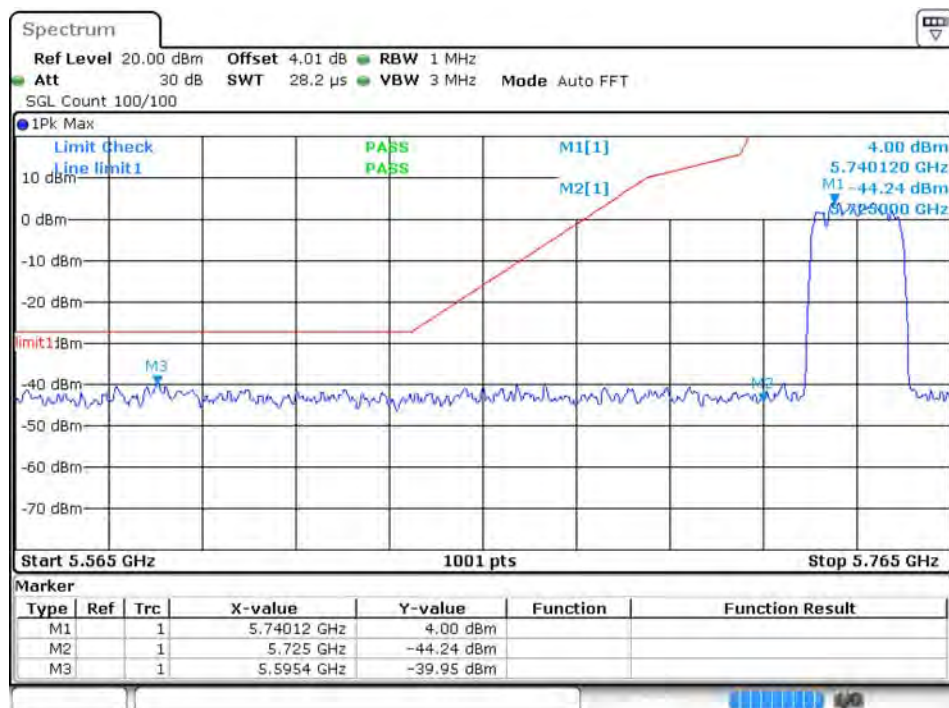


Band Edge NVNT ax20 5825MHz High Ant1

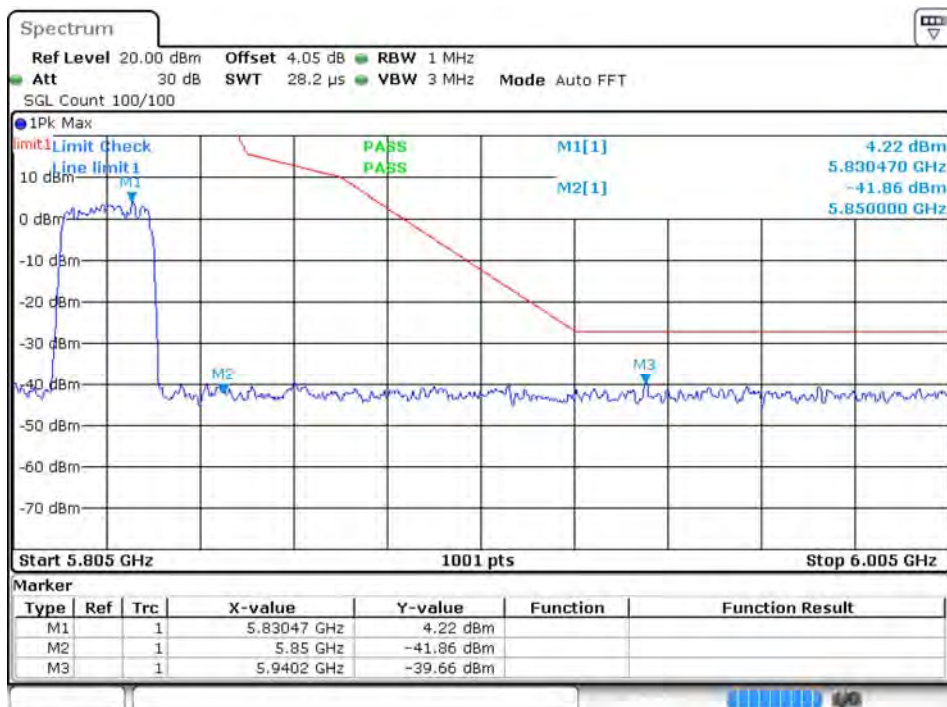

Band Edge NVNT ax20 5745MHz Low Ant2

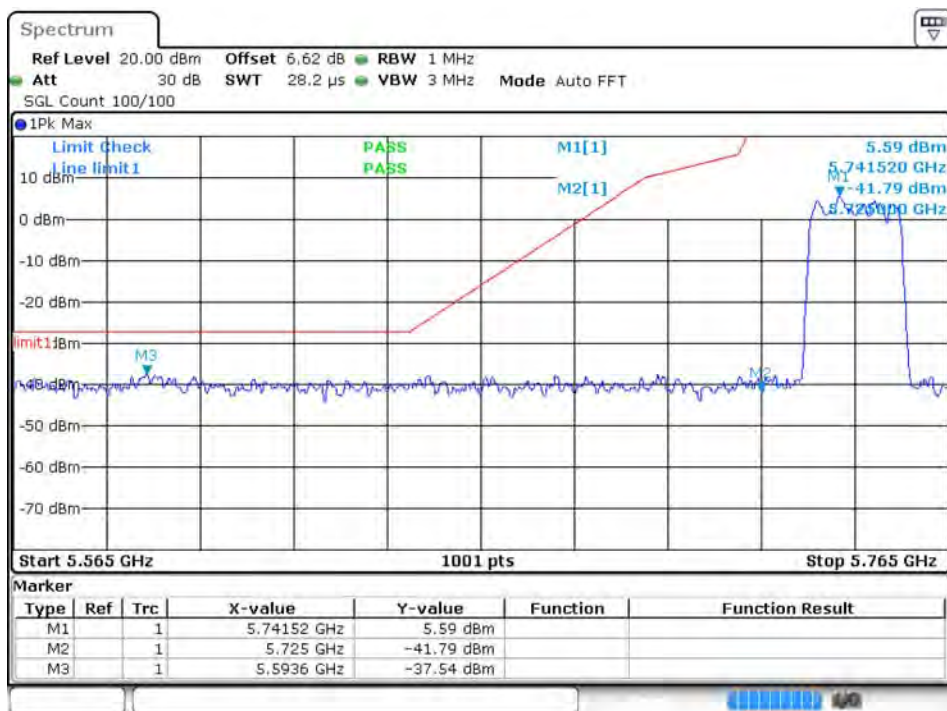


Band Edge NVNT ax20 5825MHz High Ant2

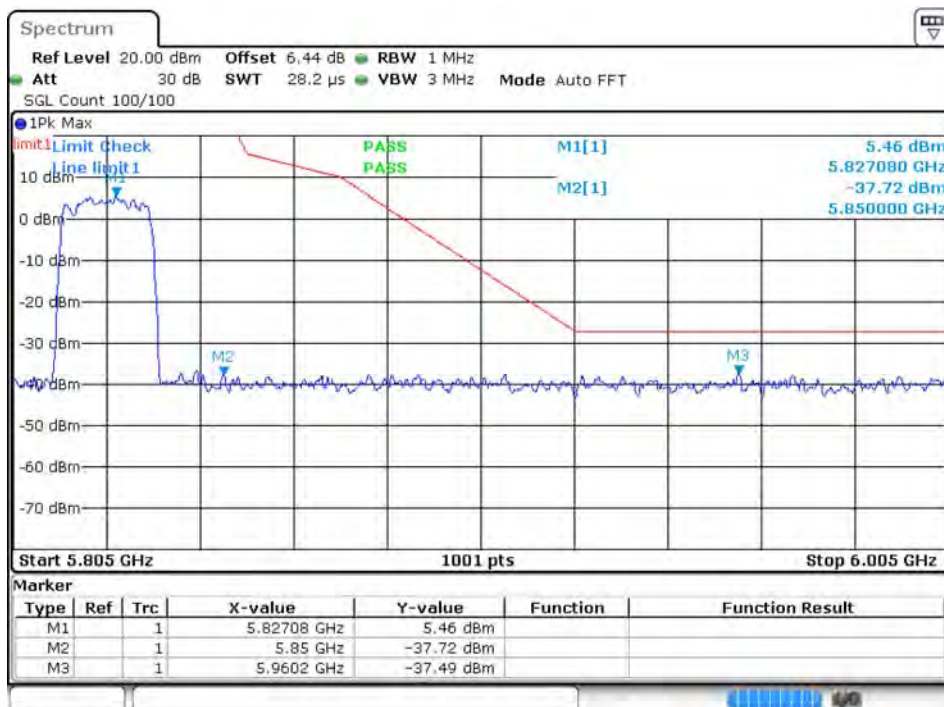


Band Edge NVNT ax40 5755MHz Low Ant1




Band Edge NVNT ax40 5795MHz High Ant1

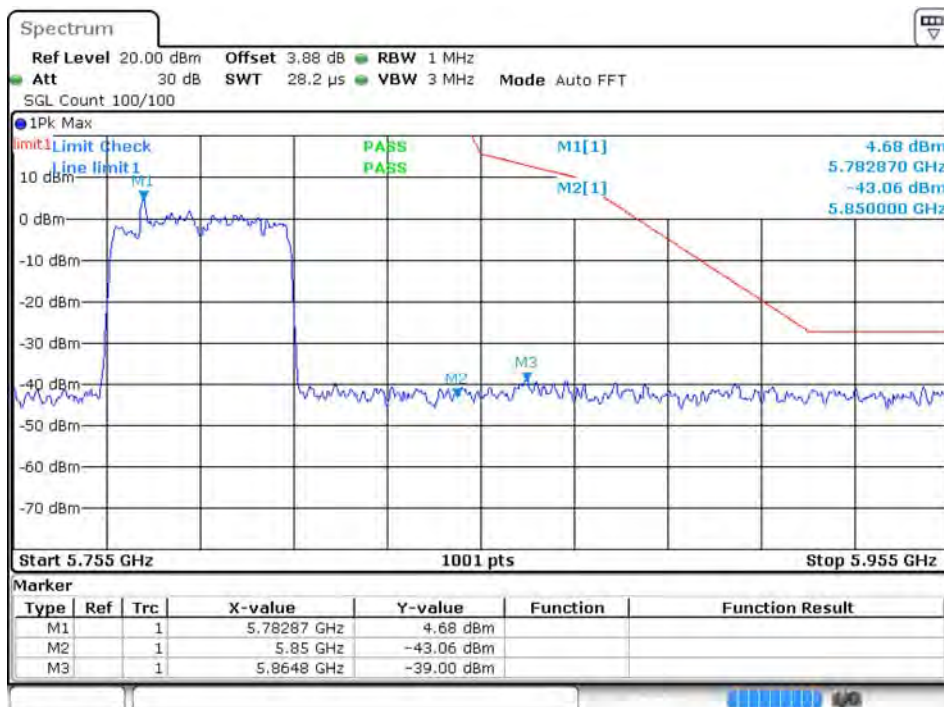


Band Edge NVNT ax40 5755MHz Low Ant2

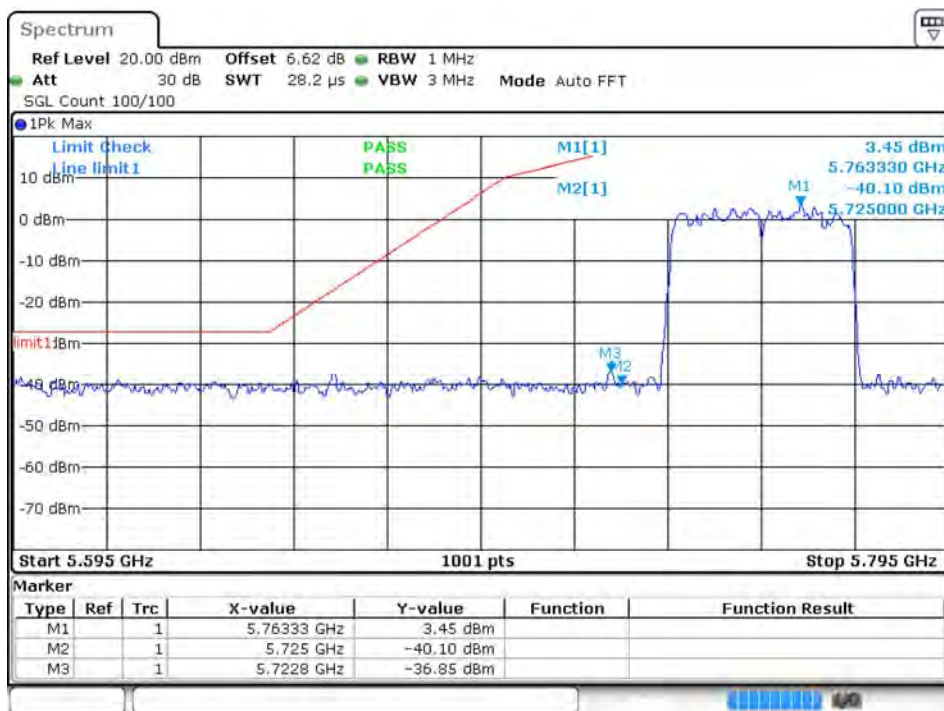


Band Edge NVNT ax40 5795MHz High Ant2

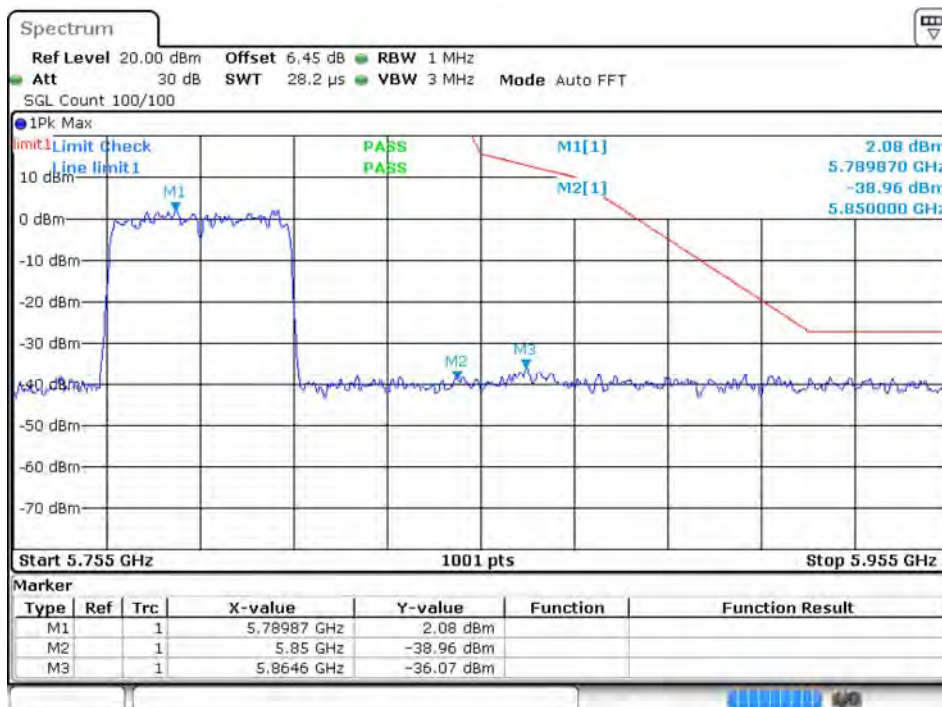


Band Edge NVNT ax80 5775MHz High Ant1

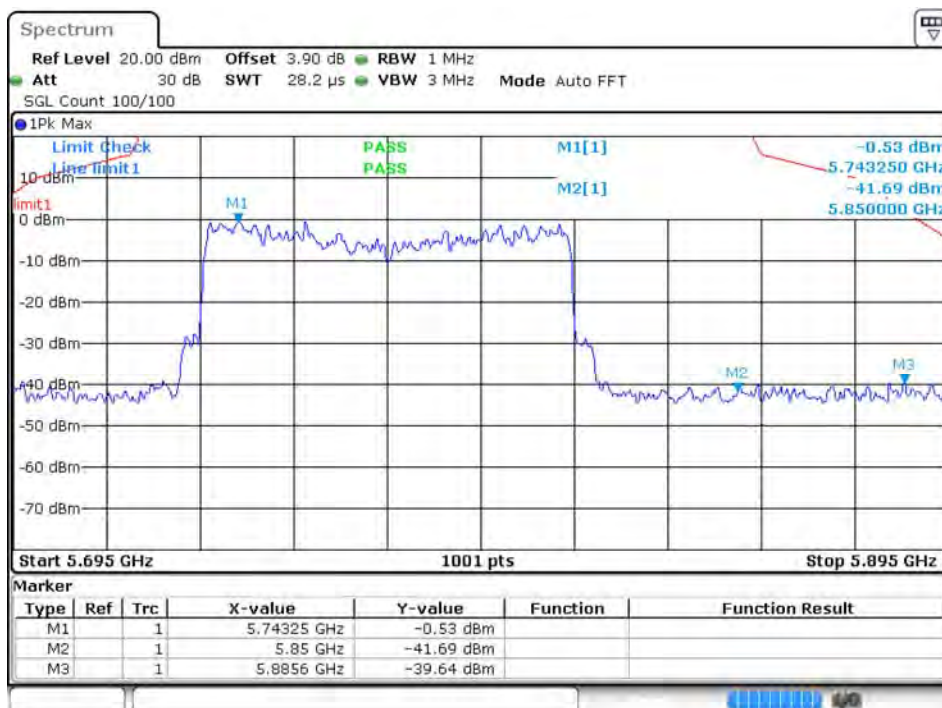


Band Edge NVNT ax80 5775MHz Low Ant1

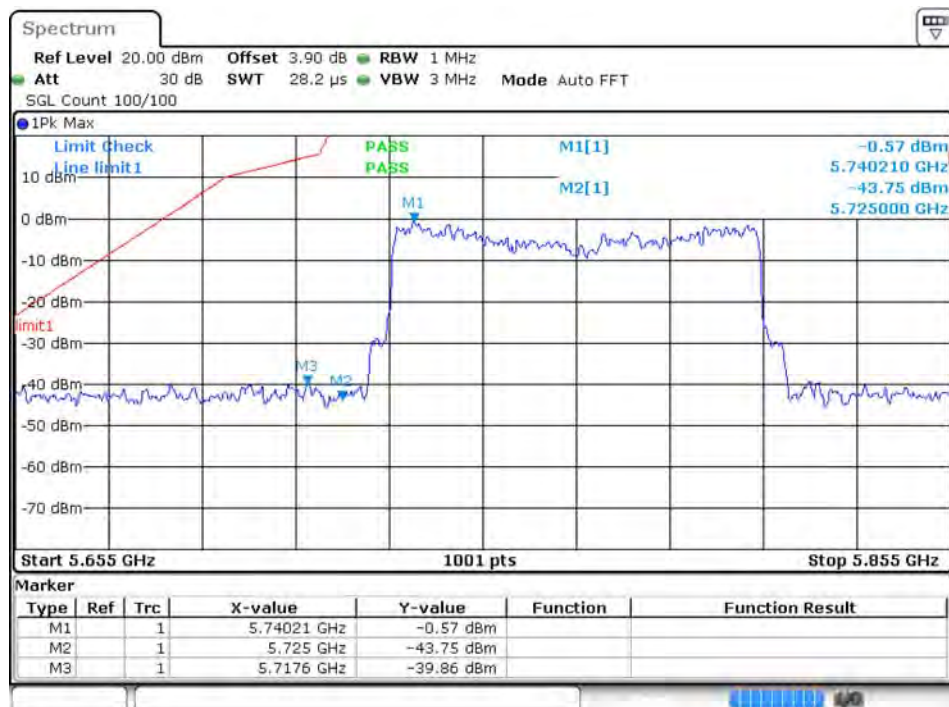

Band Edge NVNT ax80 5775MHz High Ant2

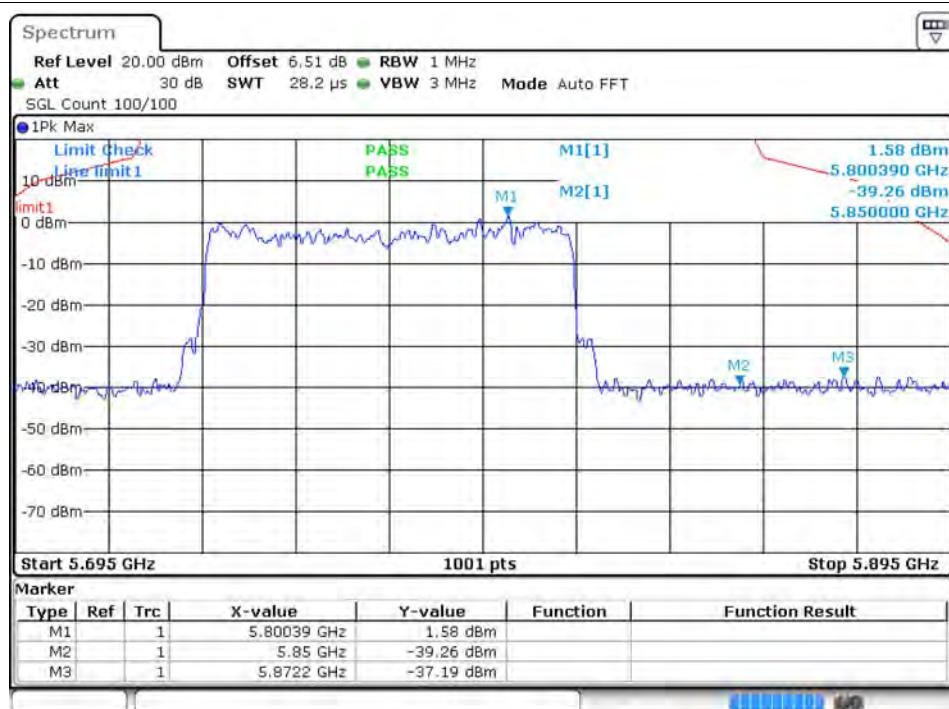

Band Edge NVNT ax80 5775MHz Low Ant2

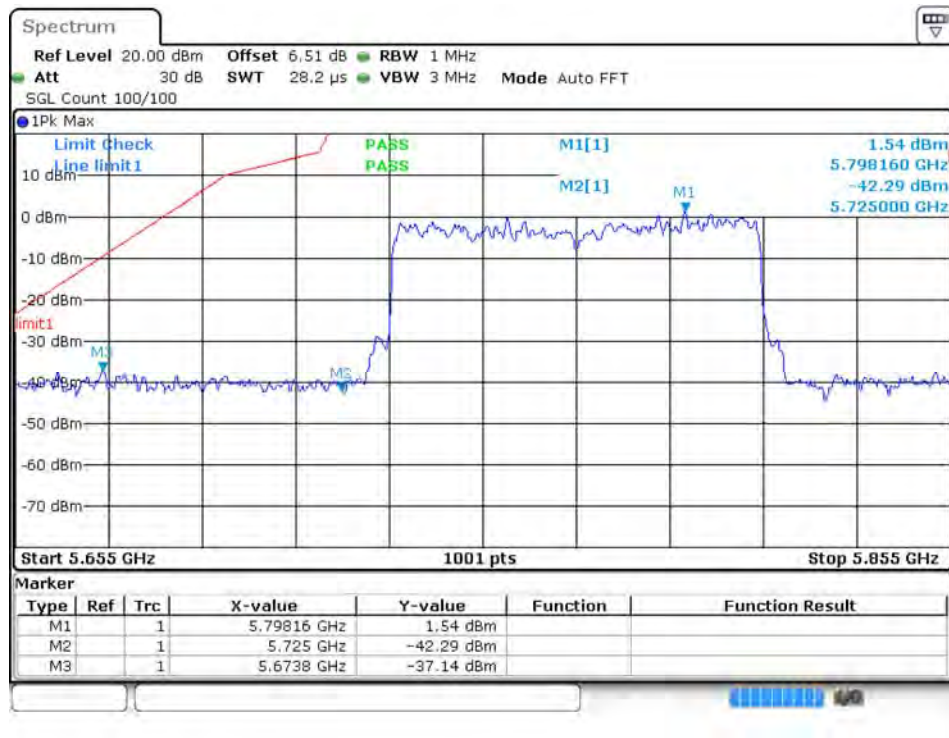



Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	a	5825	Ant1	5825	0	0	25	Pass
30C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	a	5825	Ant1	5825	0	0	25	Pass
20C 102V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	a	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 138V	a	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-20C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass



40C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 138V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-20C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 120V	a	5785	Ant2	5785	0	0	25	Pass
30C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
50C 120V	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
10C 120V	a	5825	Ant2	5825	0	0	25	Pass
30C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	a	5825	Ant2	5825	0	0	25	Pass
50C 120V	a	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 102V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
0C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	n20	5785	Ant1	5785	0	0	25	Pass
50C 120V	n20	5785	Ant1	5785	0	0	25	Pass



20C 102V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	n20	5825	Ant1	5825	0	0	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
30C 120V	n20	5825	Ant1	5825	0	0	25	Pass
40C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 102V	n20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 120V	n20	5745	Ant2	5745	0	0	25	Pass
0C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant2	5745	0	0	25	Pass
40C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 138V	n20	5785	Ant2	5785	0	0	25	Pass
-20C 120V	n20	5785	Ant2	5785	0	0	25	Pass
-10C 120V	n20	5785	Ant2	5785	0	0	25	Pass
0C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
30C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
50C 120V	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	n20	5825	Ant2	5825	0	0	25	Pass
20C 120V	n20	5825	Ant2	5825	0	0	25	Pass
20C 138V	n20	5825	Ant2	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
0C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
10C 120V	n20	5825	Ant2	5825	0	0	25	Pass
30C 120V	n20	5825	Ant2	5825	0	0	25	Pass
40C 120V	n20	5825	Ant2	5825	0	0	25	Pass
50C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass



20C 138V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795	0	0	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795	0	0	25	Pass
50C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 102V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant2	5755	0	0	25	Pass
20C 138V	n40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	5755	Ant2	5755	0	0	25	Pass
10C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant2	5755	0	0	25	Pass
40C 120V	n40	5755	Ant2	5755	0	0	25	Pass
50C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 138V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant2	5795	0	0	25	Pass
0C 120V	n40	5795	Ant2	5795	0	0	25	Pass
10C 120V	n40	5795	Ant2	5795	0	0	25	Pass
30C 120V	n40	5795	Ant2	5795	0	0	25	Pass
40C 120V	n40	5795	Ant2	5795	0	0	25	Pass
50C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	ac20	5745	Ant1	5745	0	0	25	Pass



-10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
50C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-10C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
10C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 138V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
10C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
30C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
40C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
50C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
20C 138V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-20C 120V	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
-10C 120V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass



10C 120V	ac20	5785	Ant2	5785	0	0	25	Pass
30C 120V	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
40C 120V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
50C 120V	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	ac20	5825	Ant2	5825	0	0	25	Pass
20C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
10C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant2	5825	0	0	25	Pass
20C 102V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant2	5755	0	0	25	Pass



40C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-20C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
0C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 102V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 138V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-20C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-10C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
0C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
10C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 102V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	ax20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	ax20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ax20	5745	Ant1	5745	0	0	25	Pass
40C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass



20C 102V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	ax20	5785	Ant1	5785	0	0	25	Pass
-20C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
-10C 120V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
10C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
30C 120V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
50C 120V	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	ax20	5825	Ant1	5825	0	0	25	Pass
10C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	ax20	5825	Ant1	5825	0	0	25	Pass
40C 120V	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 120V	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 120V	ax20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 102V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 138V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-20C 120V	ax20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
-10C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
30C 120V	ax20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
40C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
50C 120V	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 102V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 120V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass




20C 138V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-20C 120V	ax20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
-10C 120V	ax20	5825	Ant2	5825	0	0	25	Pass
0C 120V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
10C 120V	ax20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
30C 120V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
50C 120V	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	ax40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
20C 138V	ax40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
50C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ax40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
20C 138V	ax40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	ax40	5795	Ant1	5795.12	120000	20.71	25	Pass
0C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ax40	5755	Ant2	5755	0	0	25	Pass
20C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
20C 138V	ax40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
-10C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
0C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
10C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
30C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
40C 120V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
50C 120V	ax40	5755	Ant2	5755	0	0	25	Pass
20C 102V	ax40	5795	Ant2	5794.32	-680000	-117.34	25	Fail
20C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 138V	ax40	5795	Ant2	5795	0	0	25	Pass
-20C 120V	ax40	5795	Ant2	5795	0	0	25	Pass




-10C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
0C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
10C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
30C 120V	ax40	5795	Ant2	5795.64	640000	110.44	25	Fail
40C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
50C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 138V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
50C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 102V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 138V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
0C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
30C 120V	ax80	5775	Ant2	5775	0	0	25	Pass
40C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
50C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass

Test Graphs


Freq. Stability 20C 102V a 5745MHz Ant1

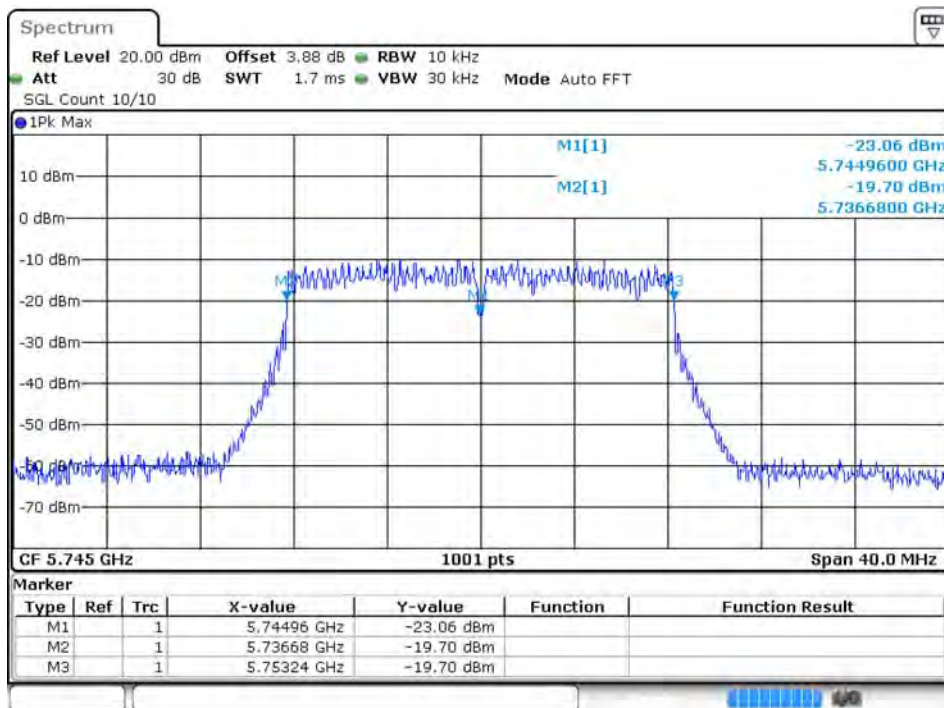


Freq. Stability 20C 120V a 5745MHz Ant1

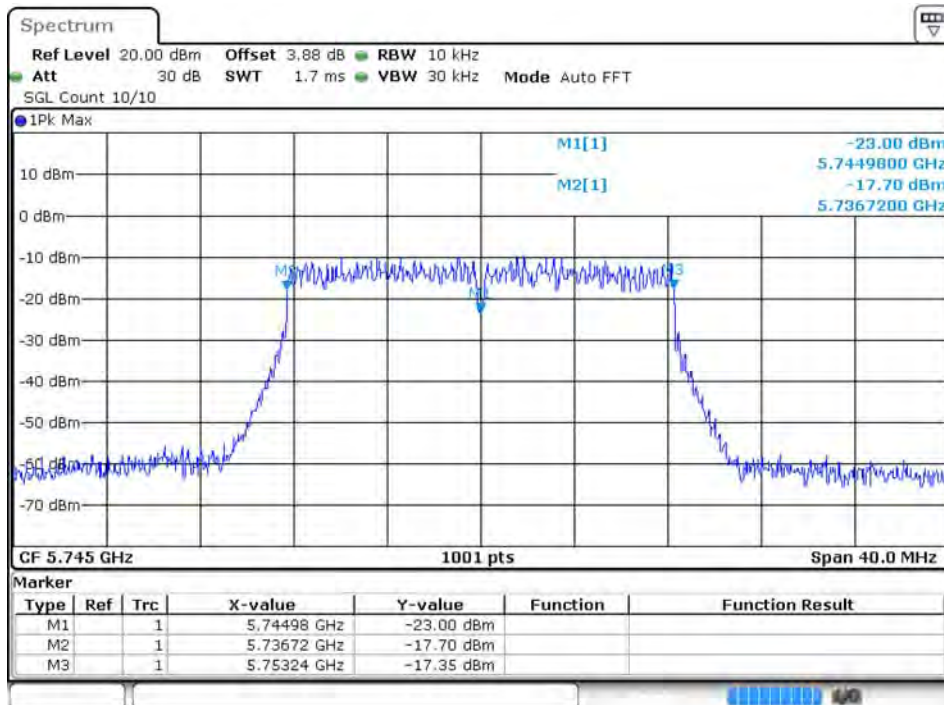


Freq. Stability 20C 138V a 5745MHz Ant1

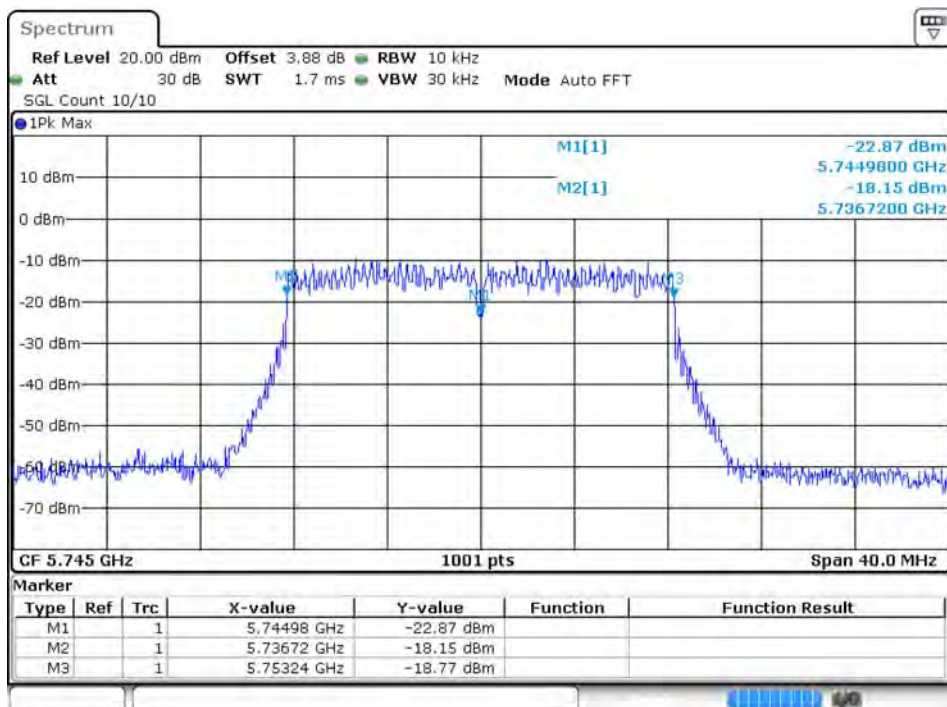


Freq. Stability -20C 120V a 5745MHz Ant1

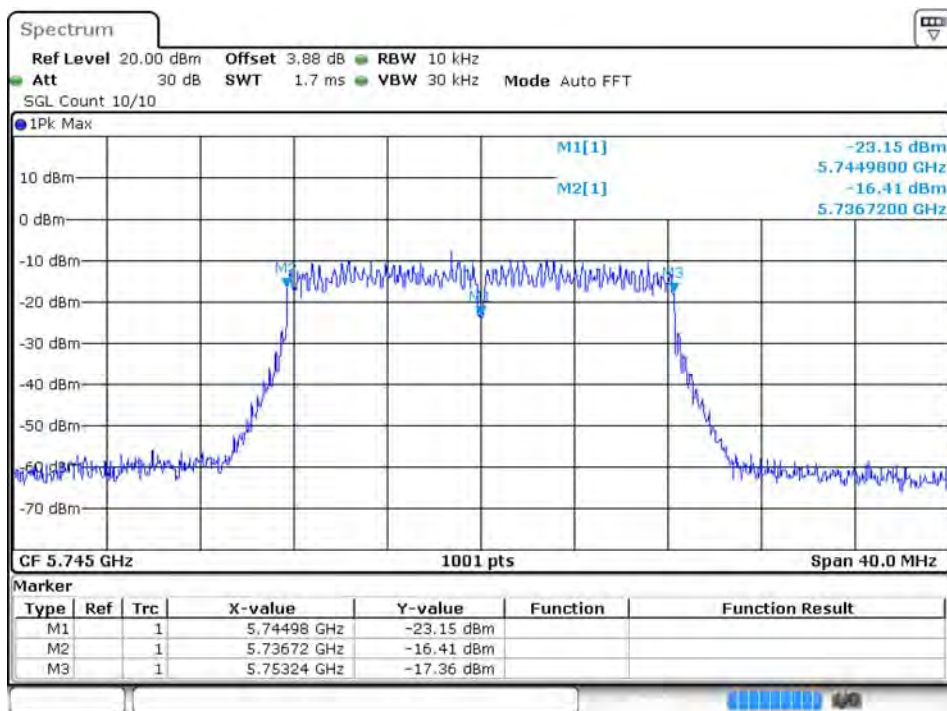


Freq. Stability -10C 120V a 5745MHz Ant1

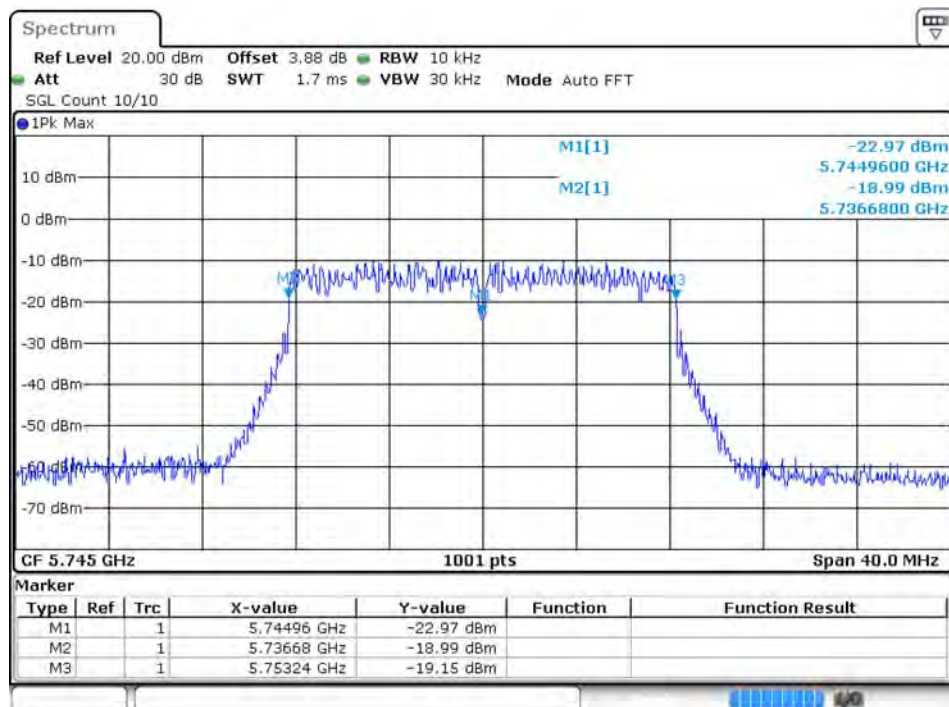


Freq. Stability 0C 120V a 5745MHz Ant1

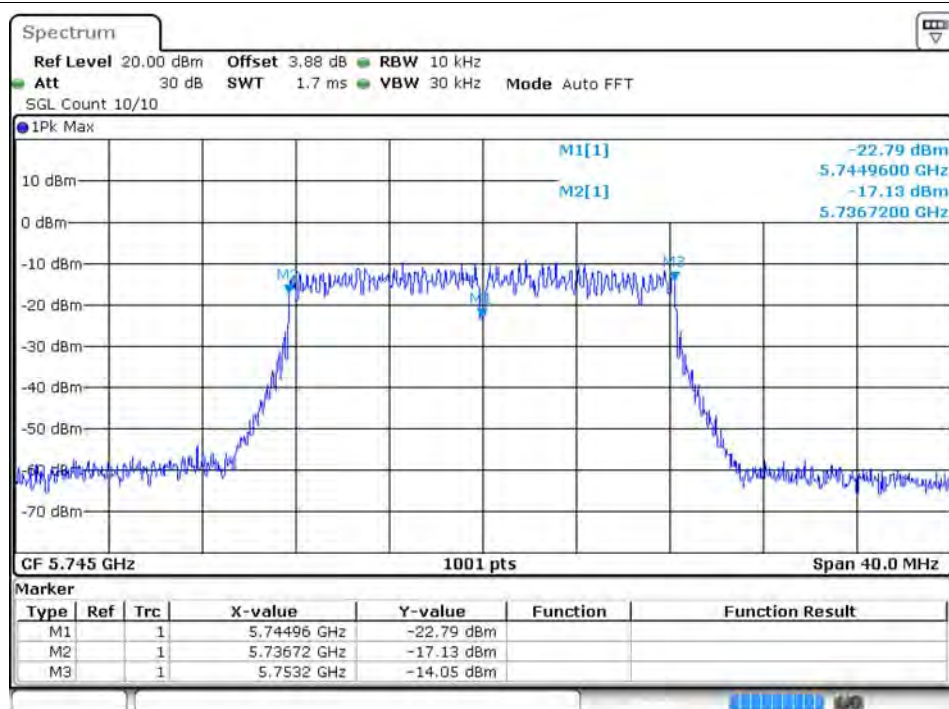


Freq. Stability 10C 120V a 5745MHz Ant1

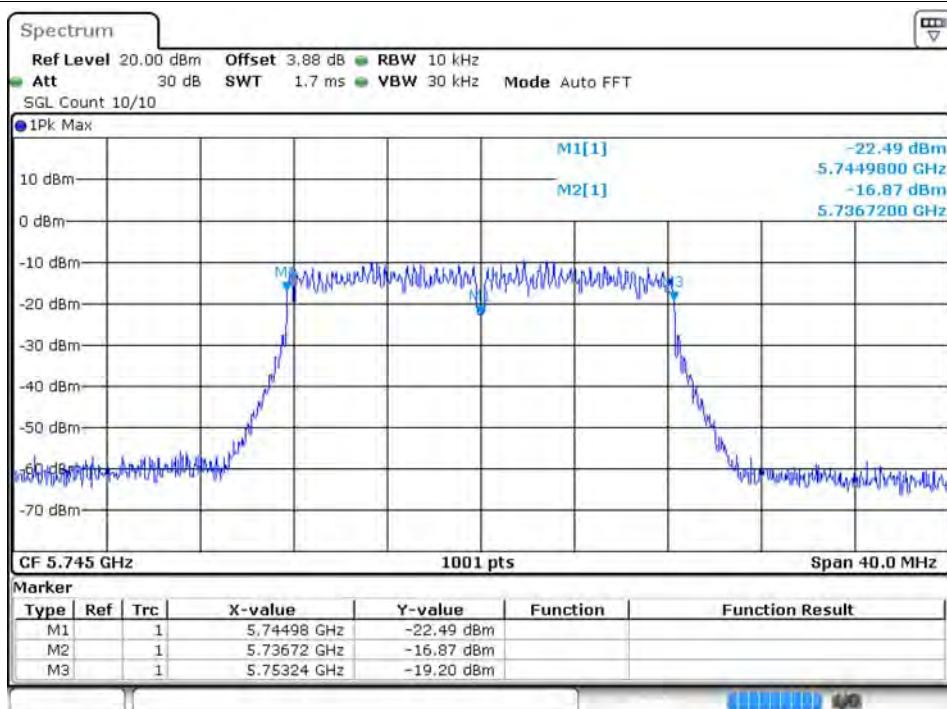


Freq. Stability 30C 120V a 5745MHz Ant1

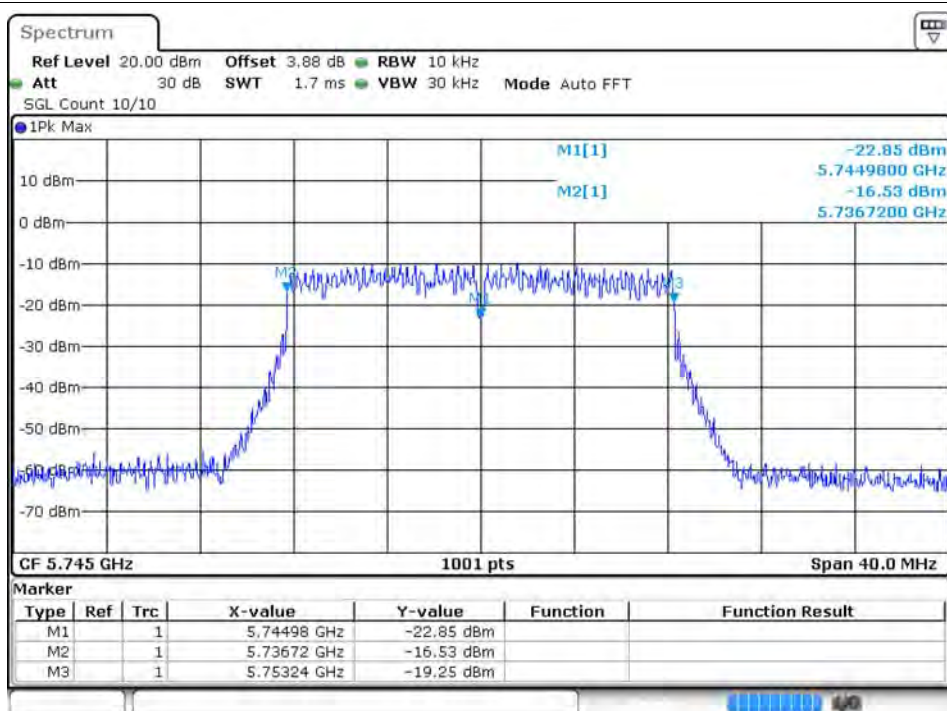


Freq. Stability 40C 120V a 5745MHz Ant1

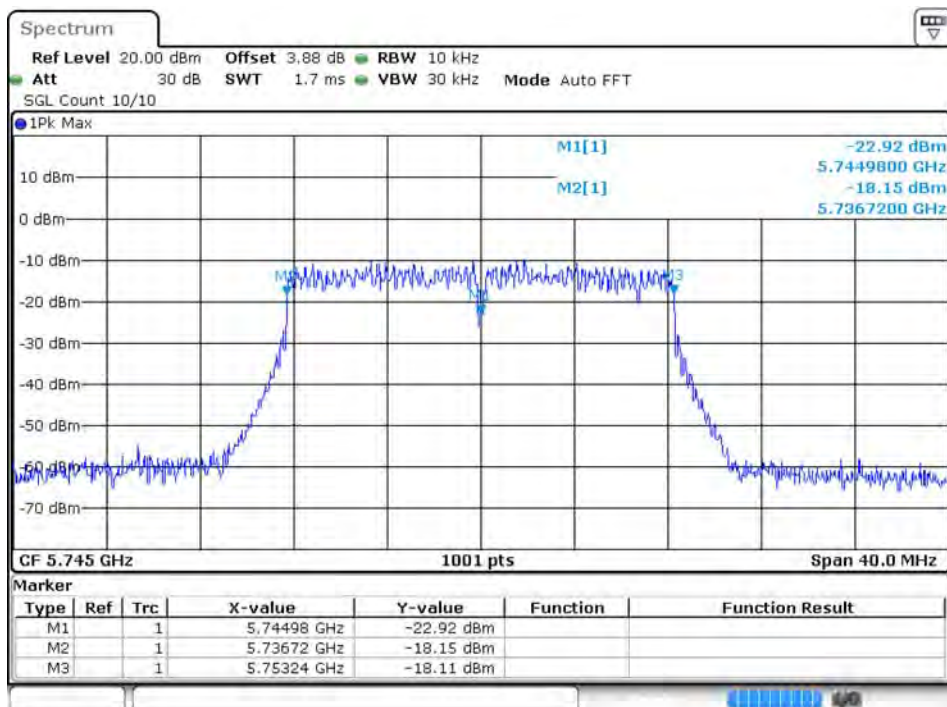


Freq. Stability 50C 120V a 5745MHz Ant1

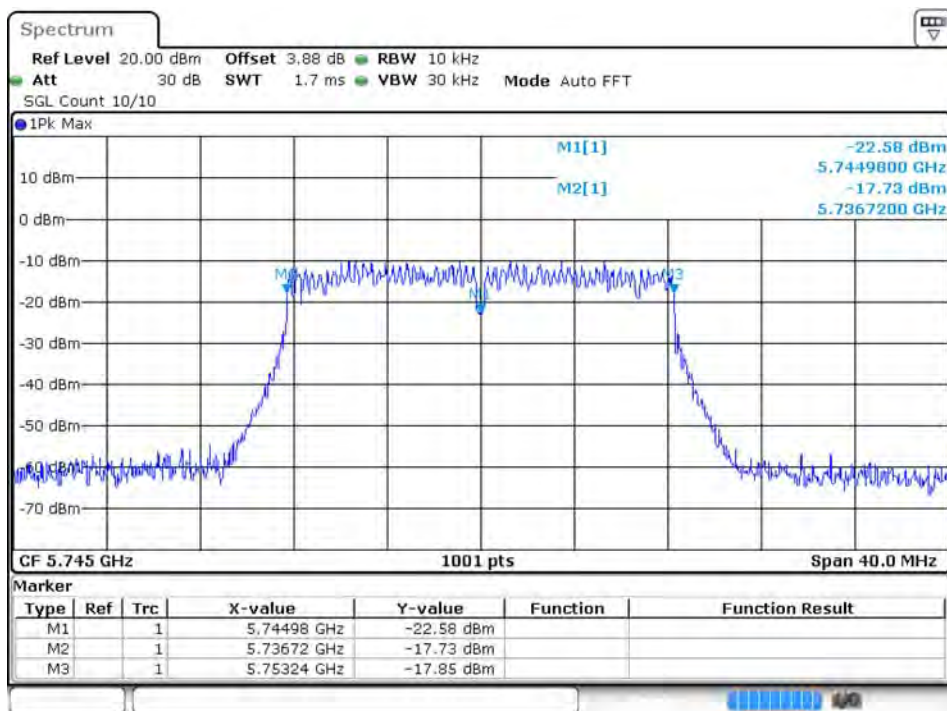


Freq. Stability 20C 102V a 5785MHz Ant1

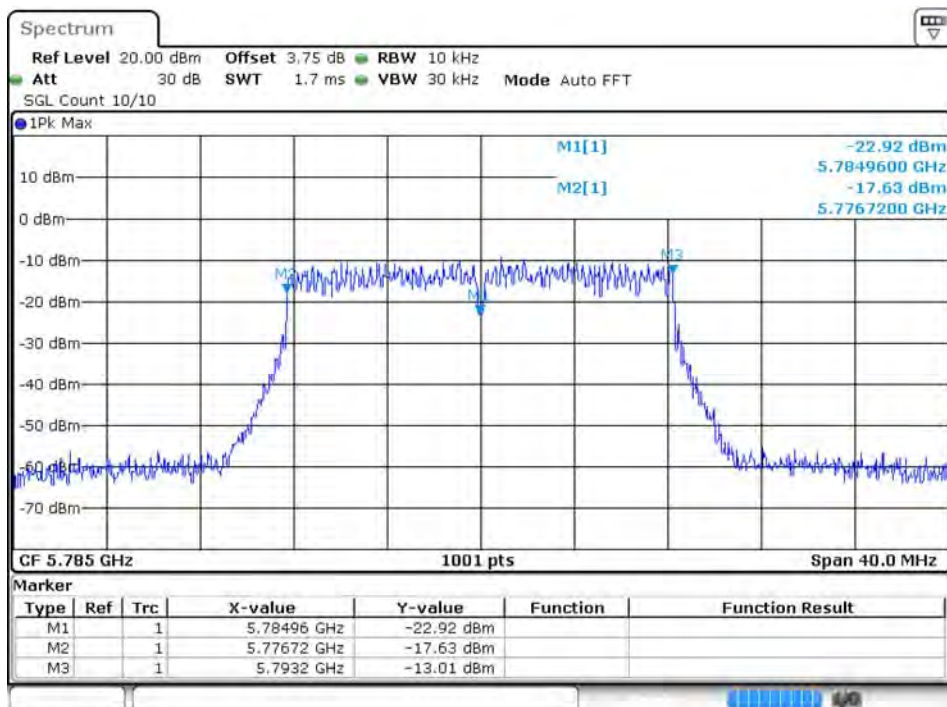


Freq. Stability 20C 120V a 5785MHz Ant1

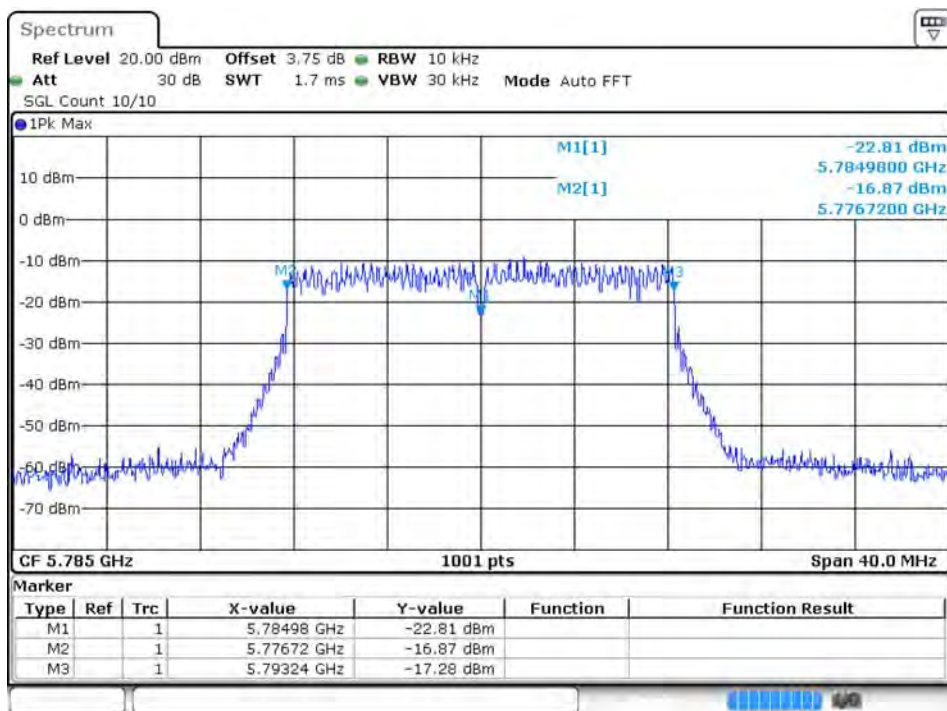


Freq. Stability 20C 138V a 5785MHz Ant1

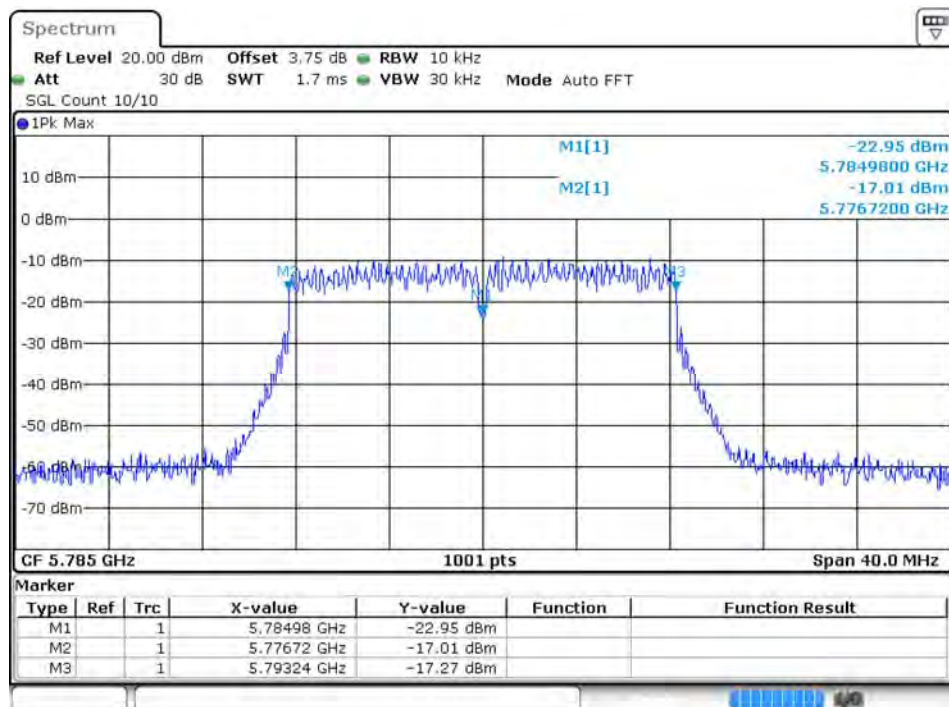


Freq. Stability -20C 120V a 5785MHz Ant1

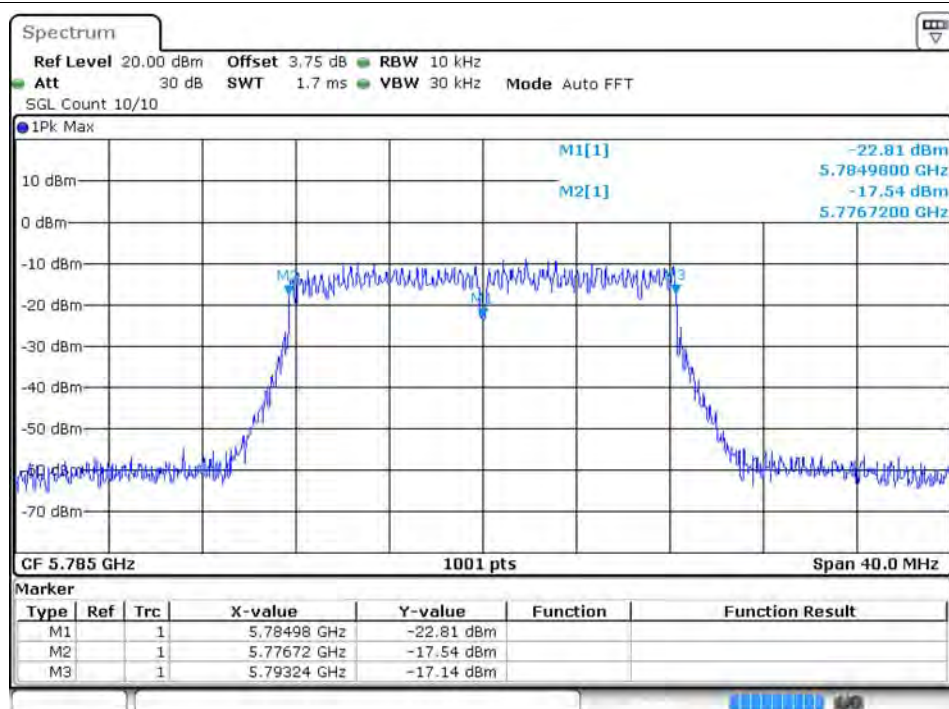


Freq. Stability -10C 120V a 5785MHz Ant1

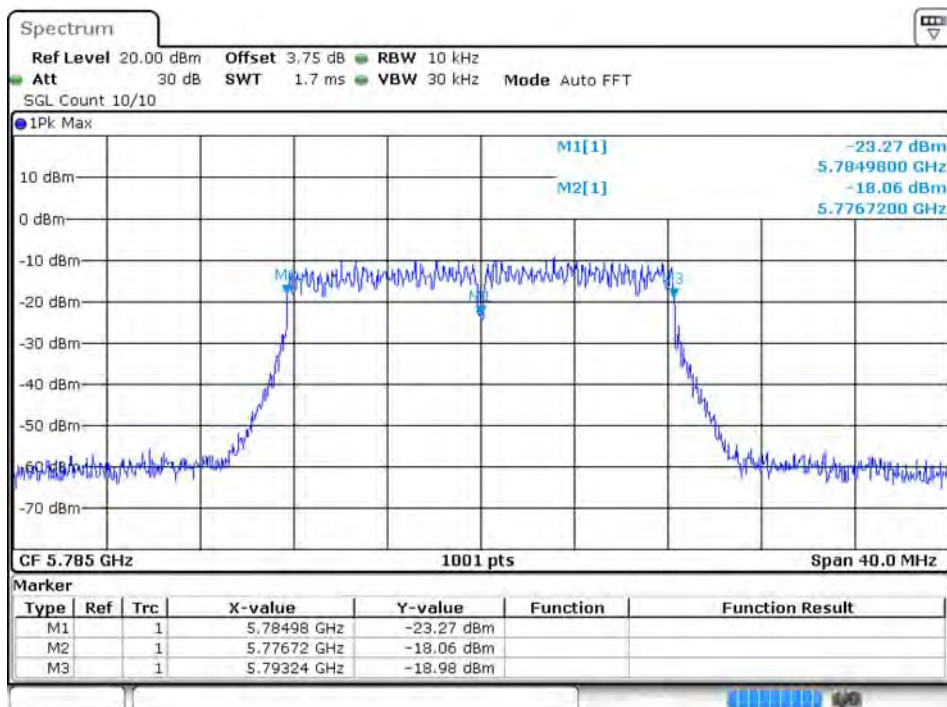


Freq. Stability 0C 120V a 5785MHz Ant1

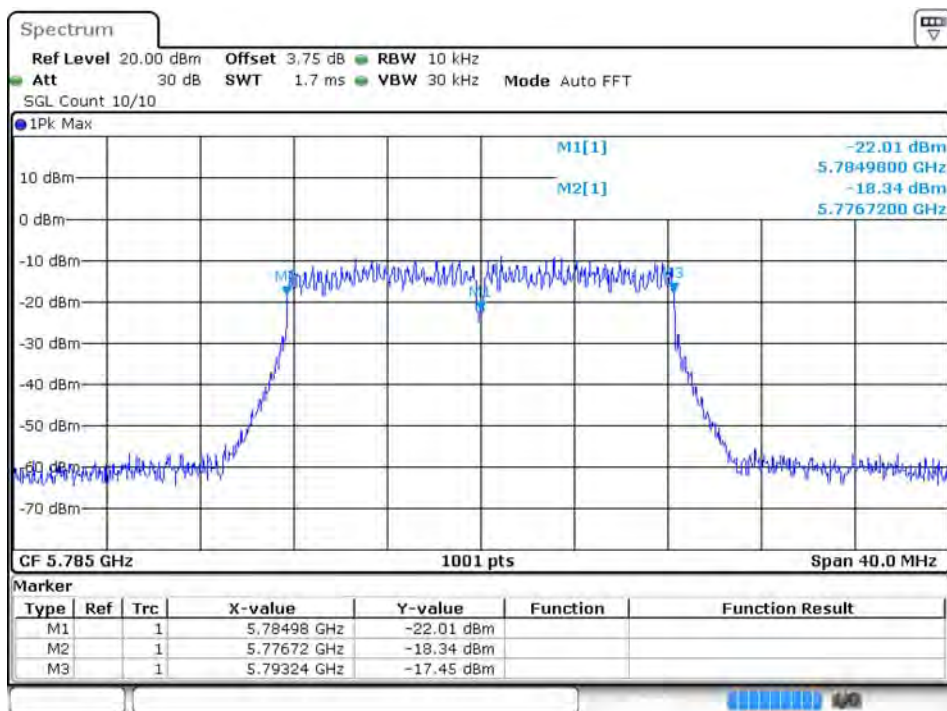


Freq. Stability 10C 120V a 5785MHz Ant1

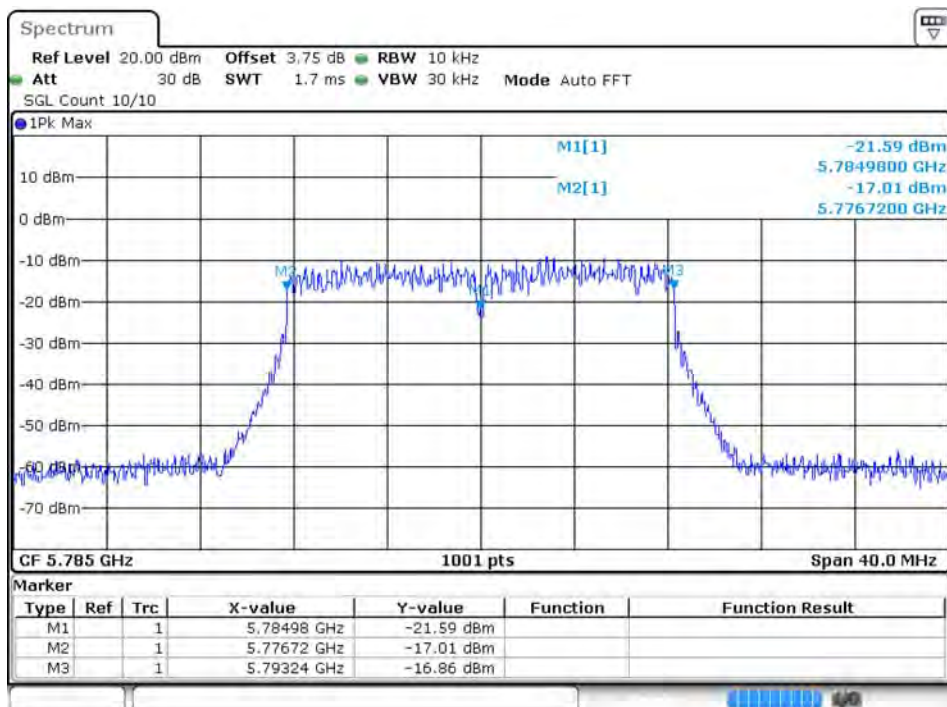


Freq. Stability 30C 120V a 5785MHz Ant1

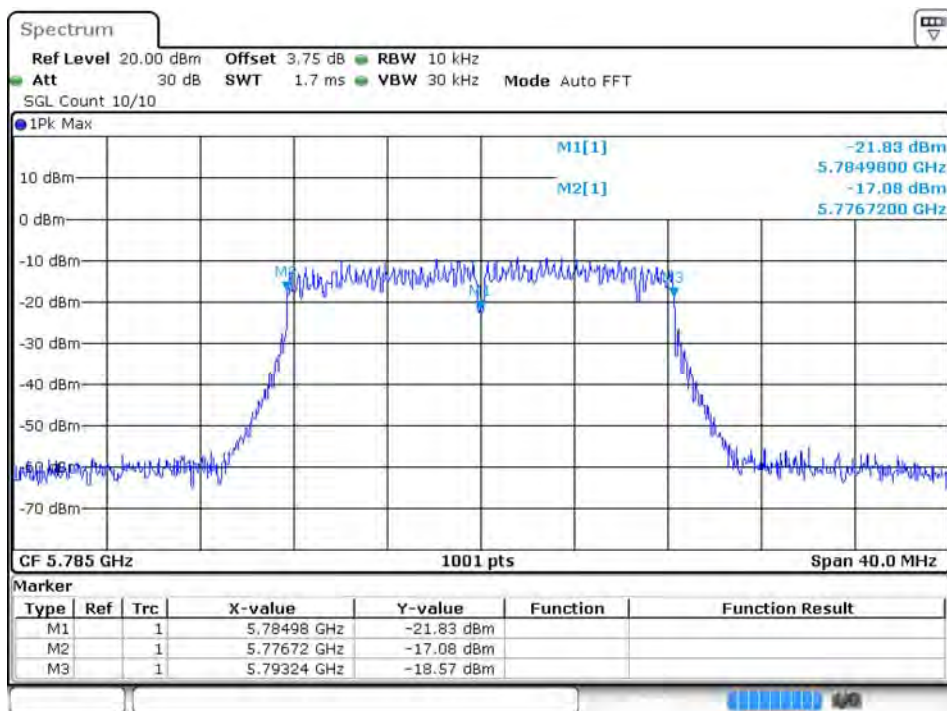


Freq. Stability 40C 120V a 5785MHz Ant1

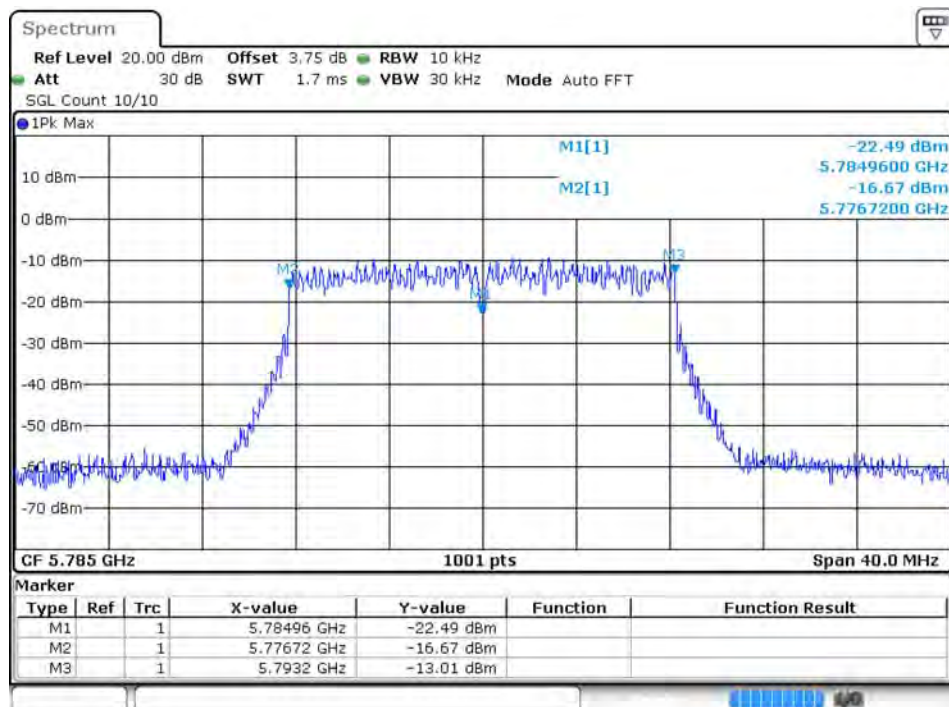


Freq. Stability 50C 120V a 5785MHz Ant1

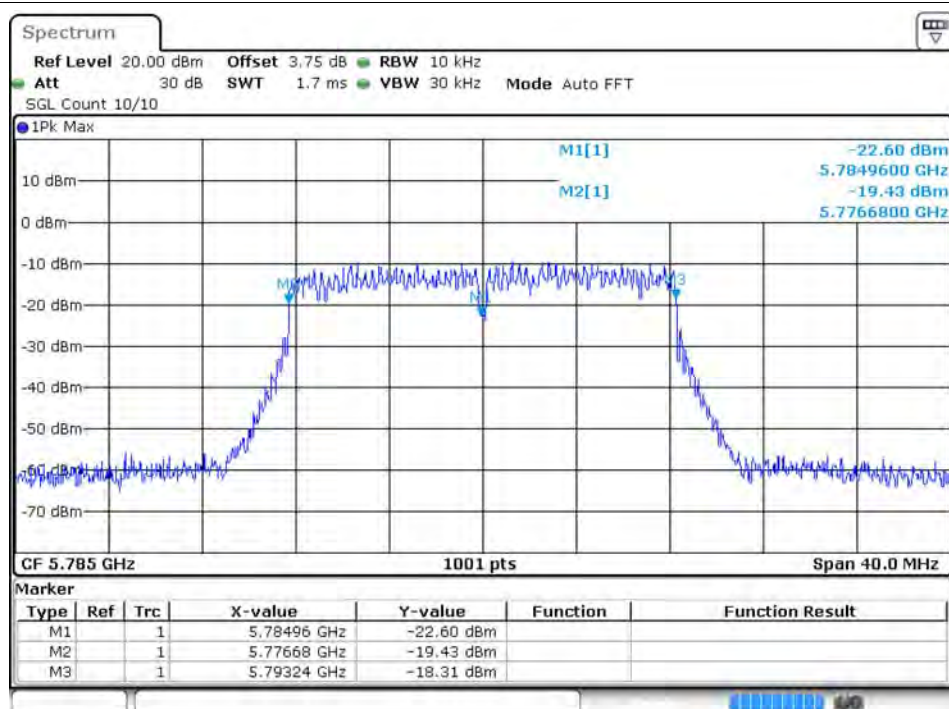


Freq. Stability 20C 102V a 5825MHz Ant1

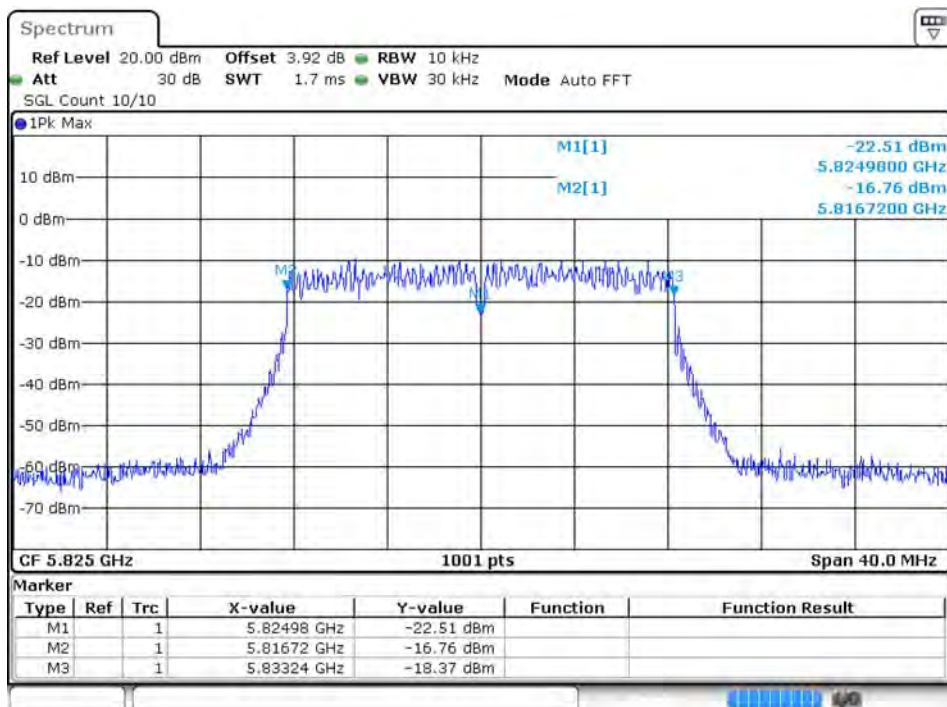


Freq. Stability 20C 120V a 5825MHz Ant1

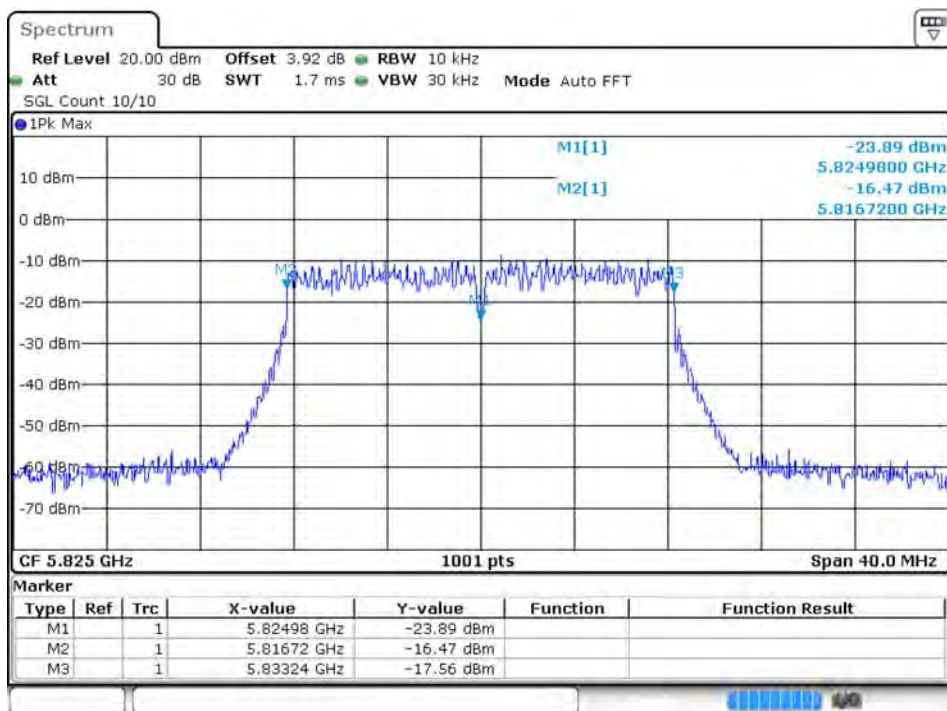


Freq. Stability 20C 138V a 5825MHz Ant1

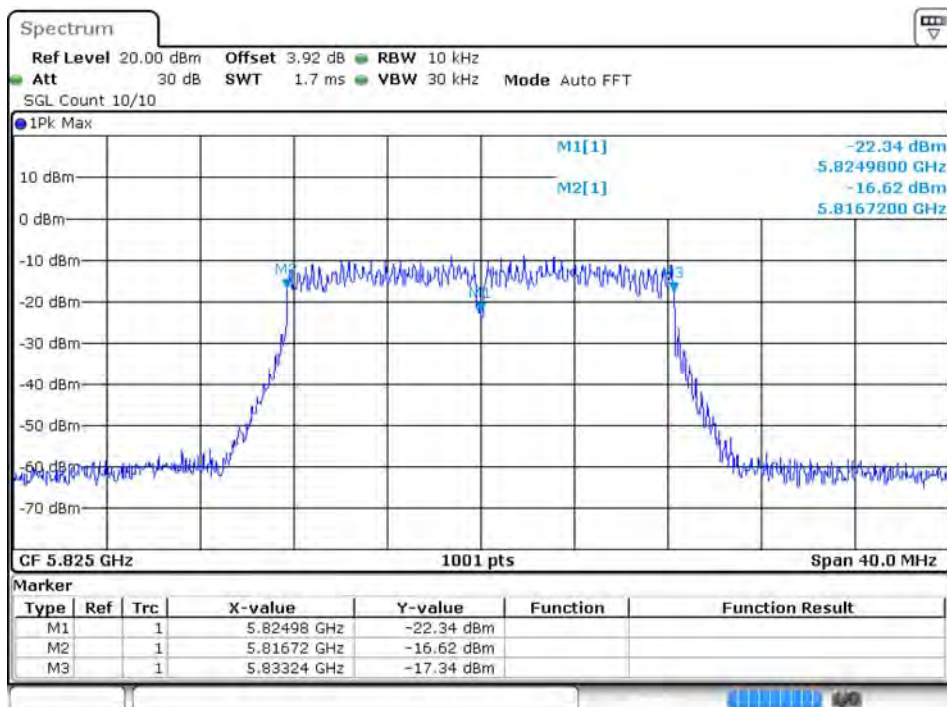


Freq. Stability -20C 120V a 5825MHz Ant1

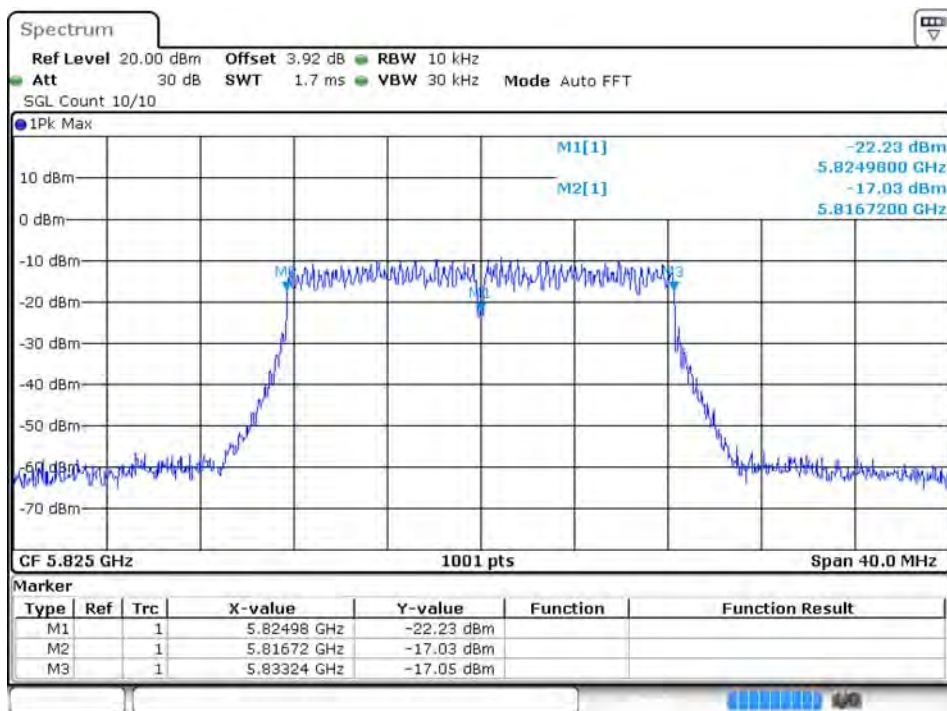


Freq. Stability -10C 120V a 5825MHz Ant1

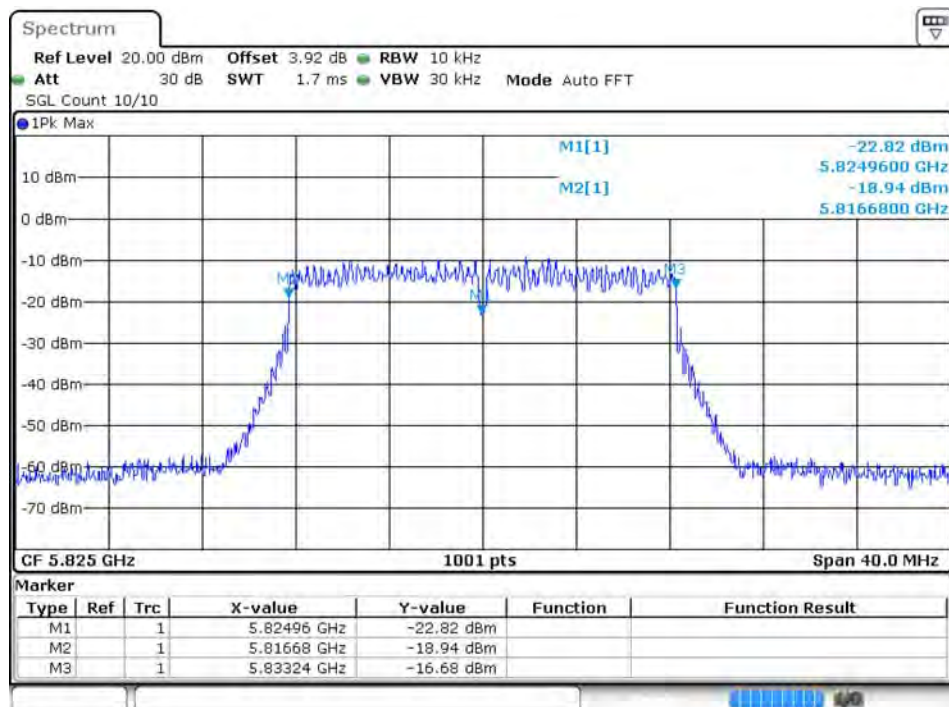


Freq. Stability 0C 120V a 5825MHz Ant1

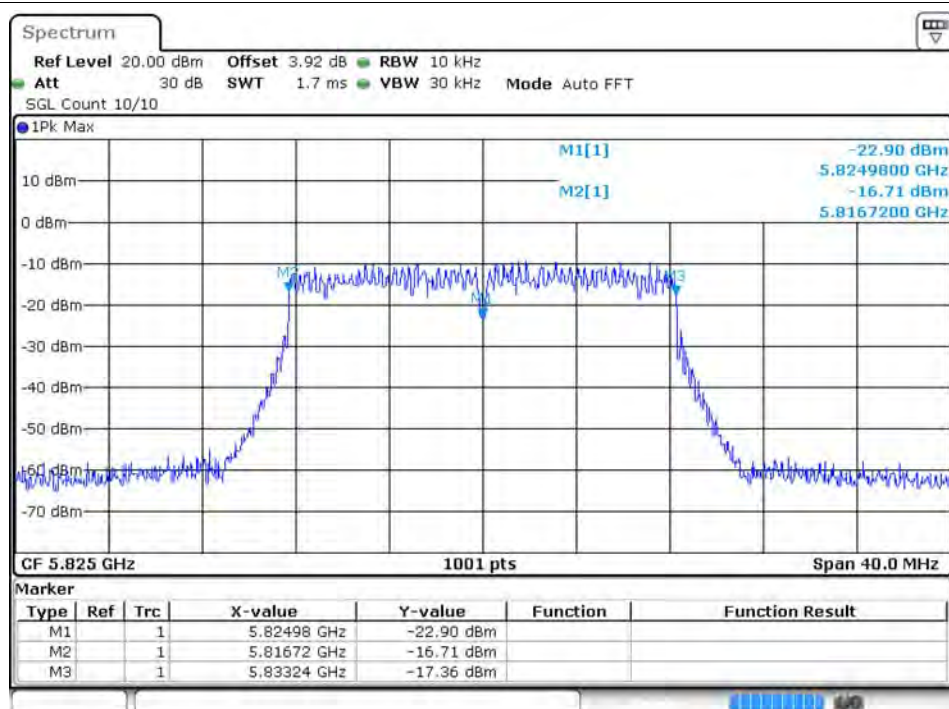


Freq. Stability 10C 120V a 5825MHz Ant1

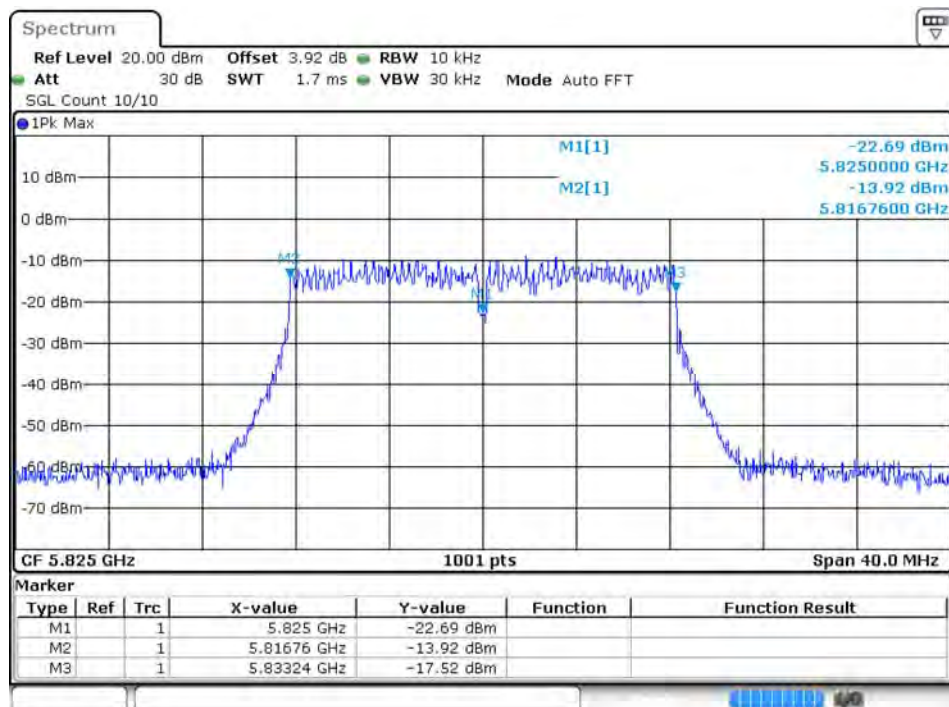


Freq. Stability 30C 120V a 5825MHz Ant1

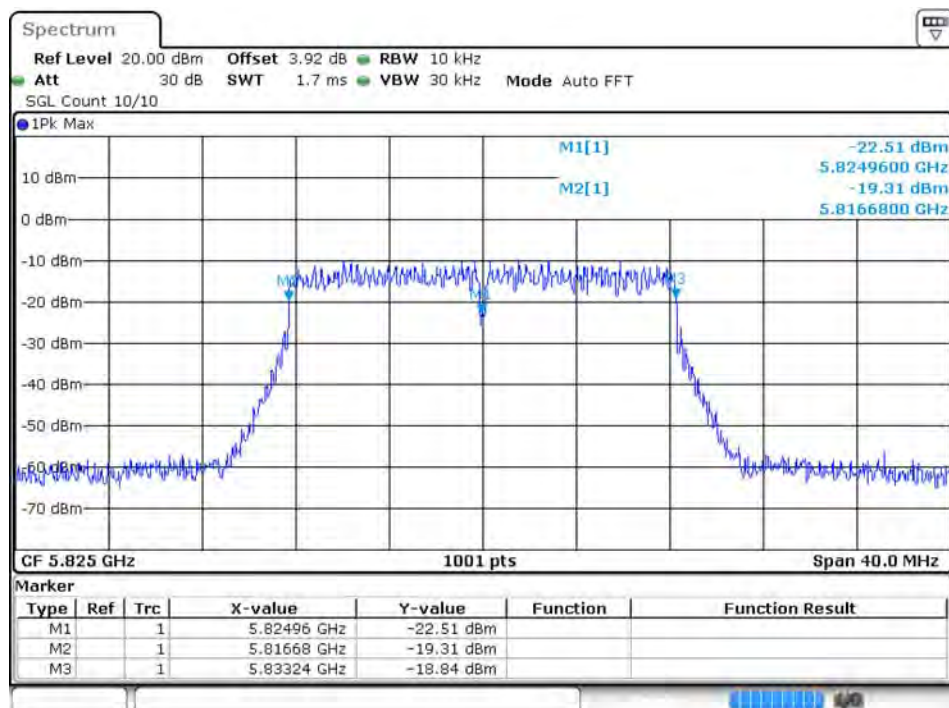


Freq. Stability 40C 120V a 5825MHz Ant1

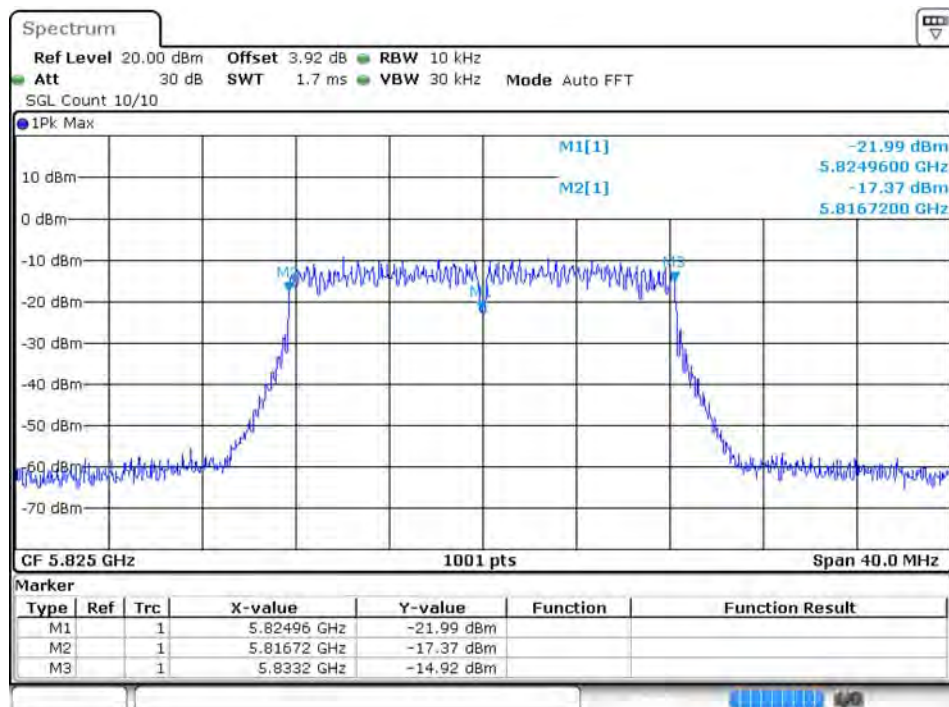


Freq. Stability 50C 120V a 5825MHz Ant1

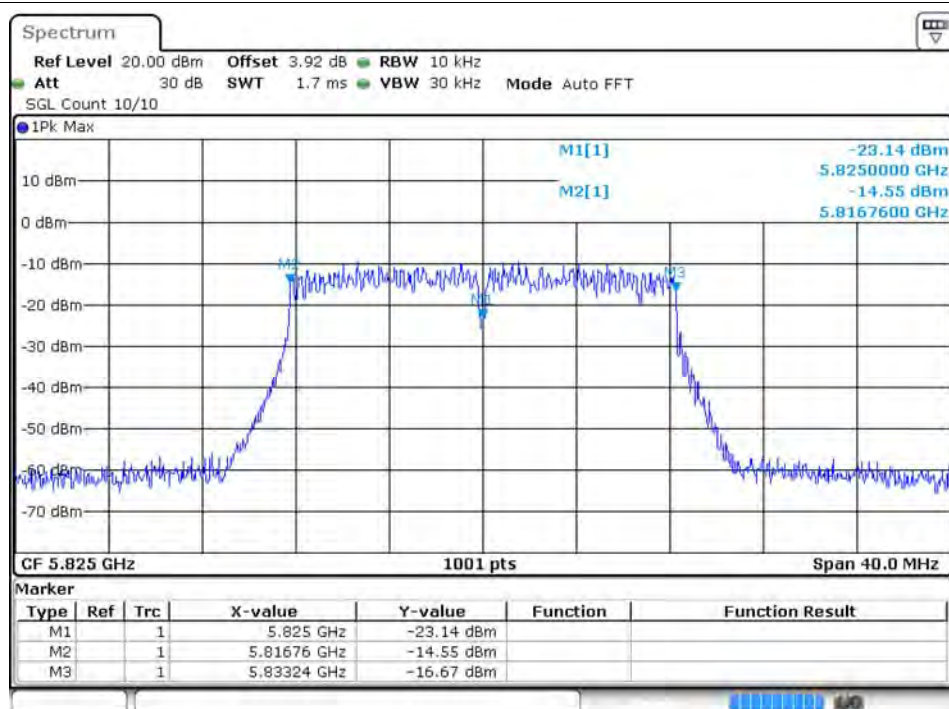


Freq. Stability 20C 102V a 5745MHz Ant2

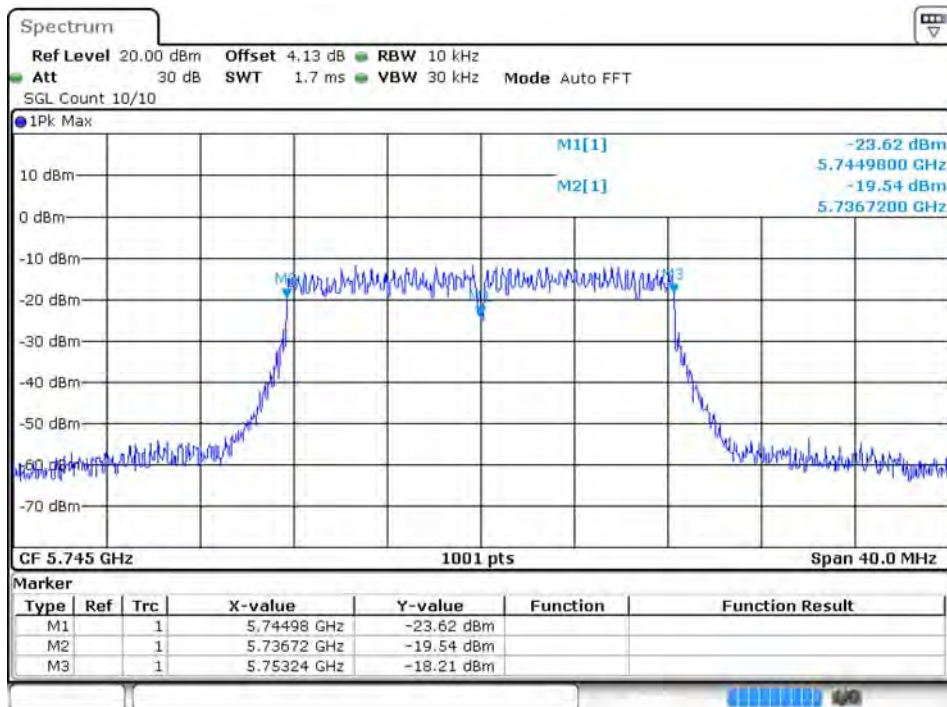


Freq. Stability 20C 120V a 5745MHz Ant2

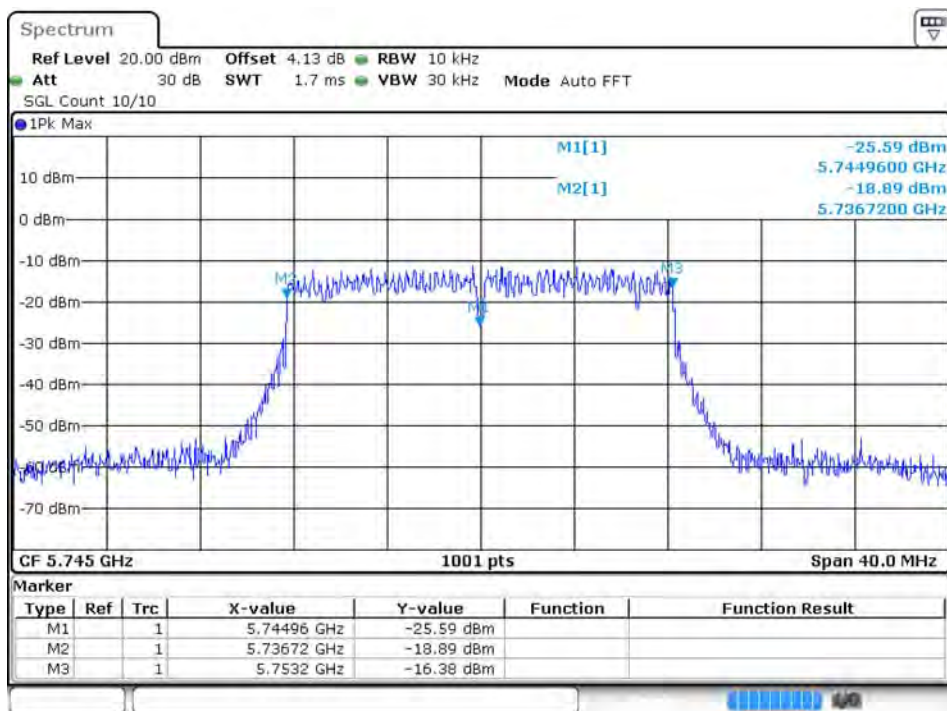

Freq. Stability 20C 138V a 5745MHz Ant2

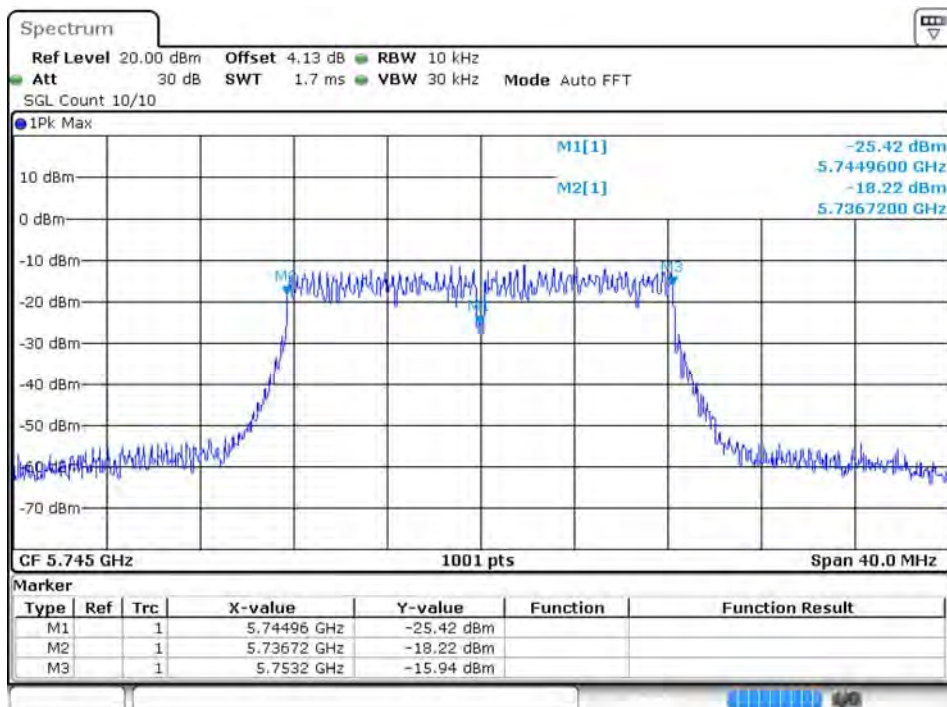


Freq. Stability -20C 120V a 5745MHz Ant2

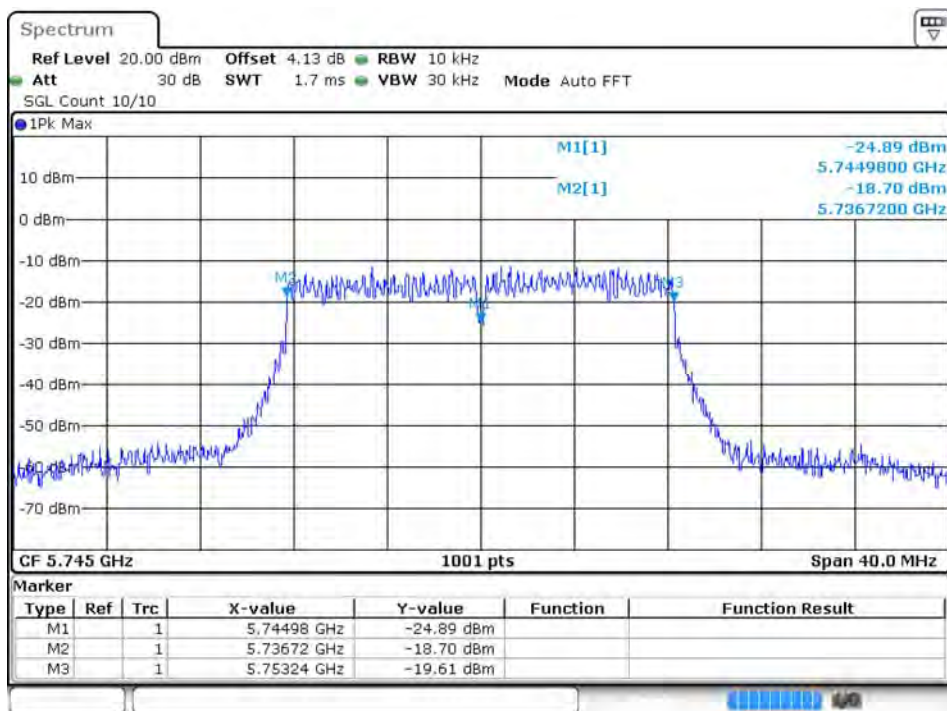





Freq. Stability -10C 120V a 5745MHz Ant2

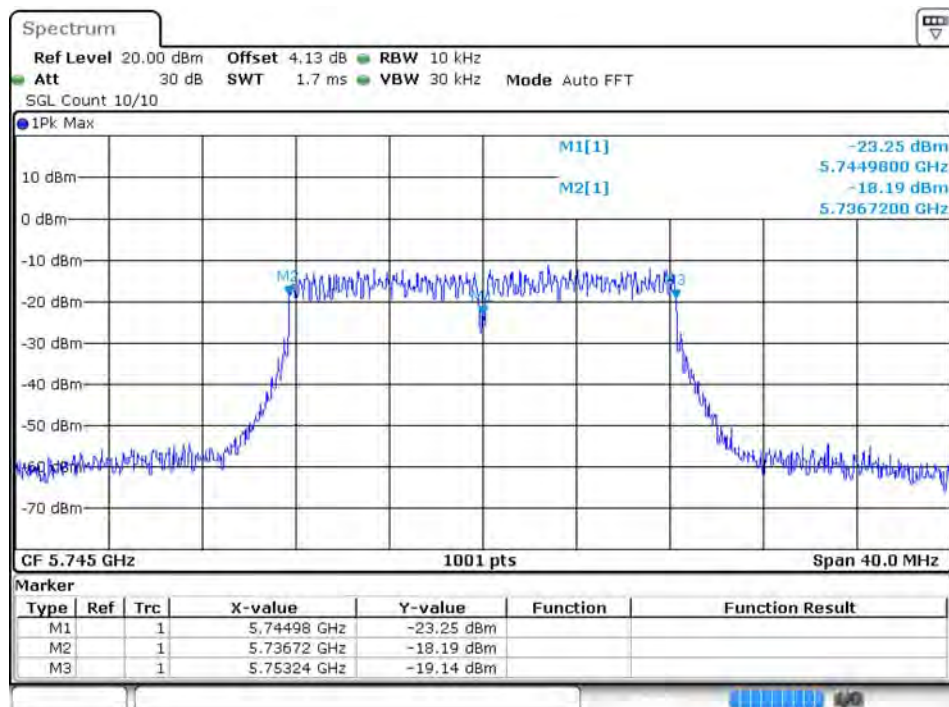


Freq. Stability 0C 120V a 5745MHz Ant2

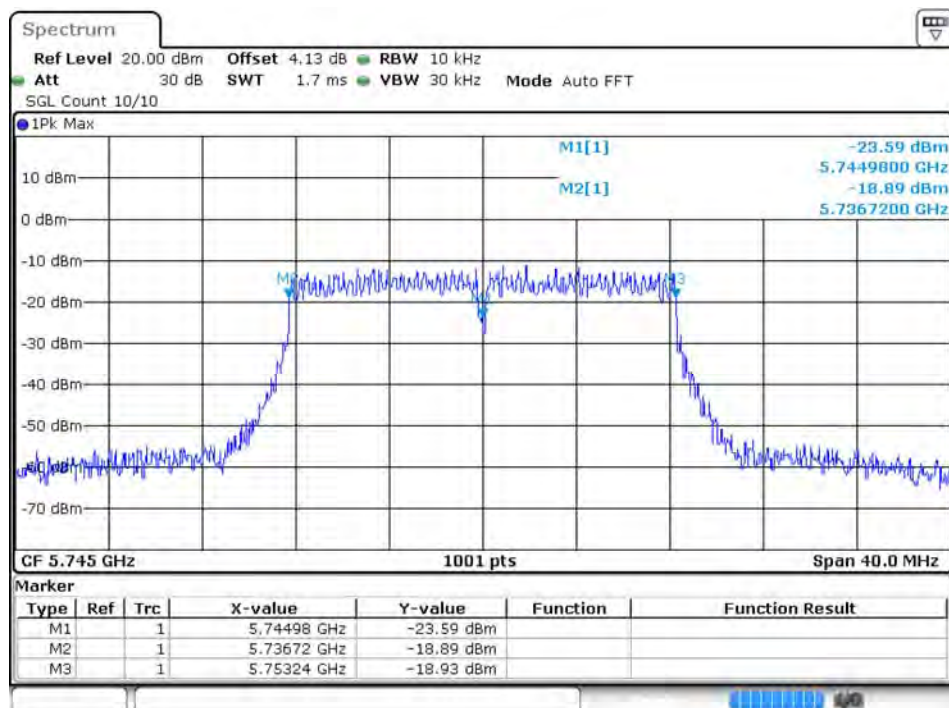


Freq. Stability 10C 120V a 5745MHz Ant2

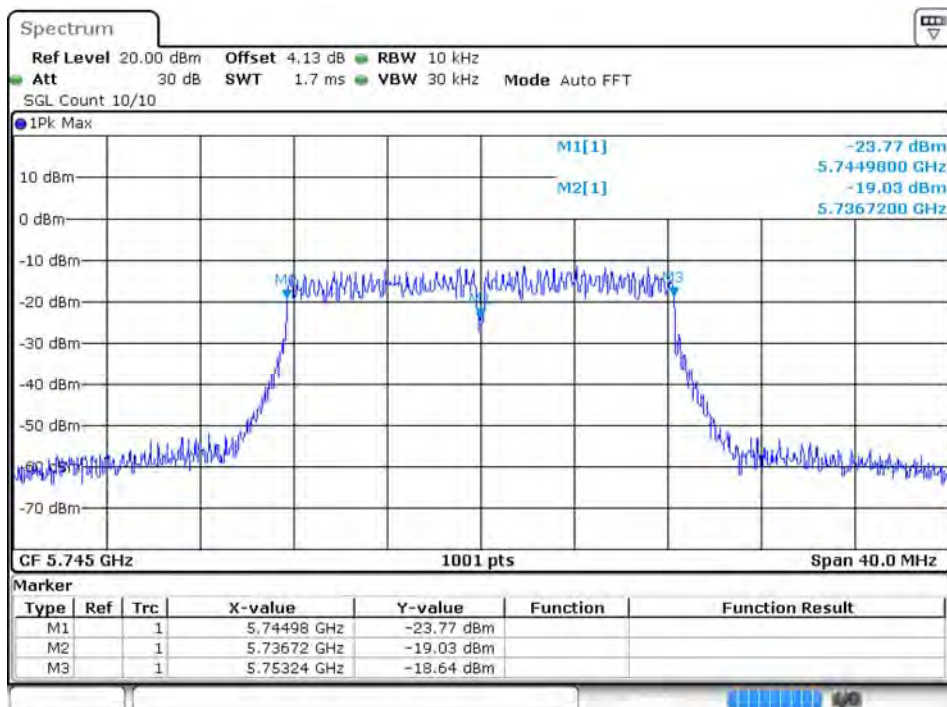


Freq. Stability 30C 120V a 5745MHz Ant2

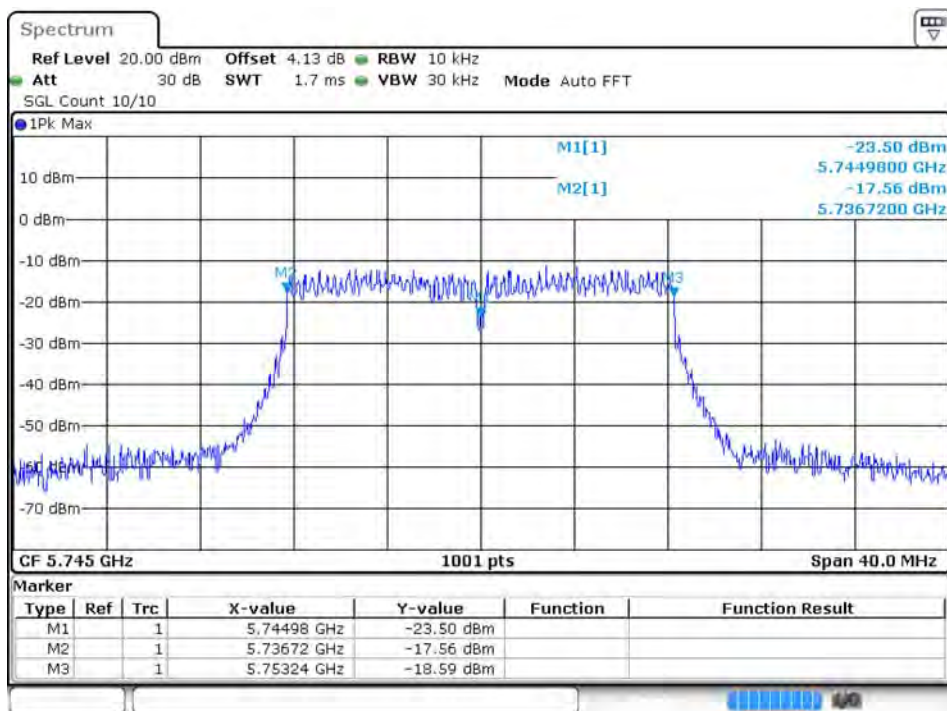


Freq. Stability 40C 120V a 5745MHz Ant2

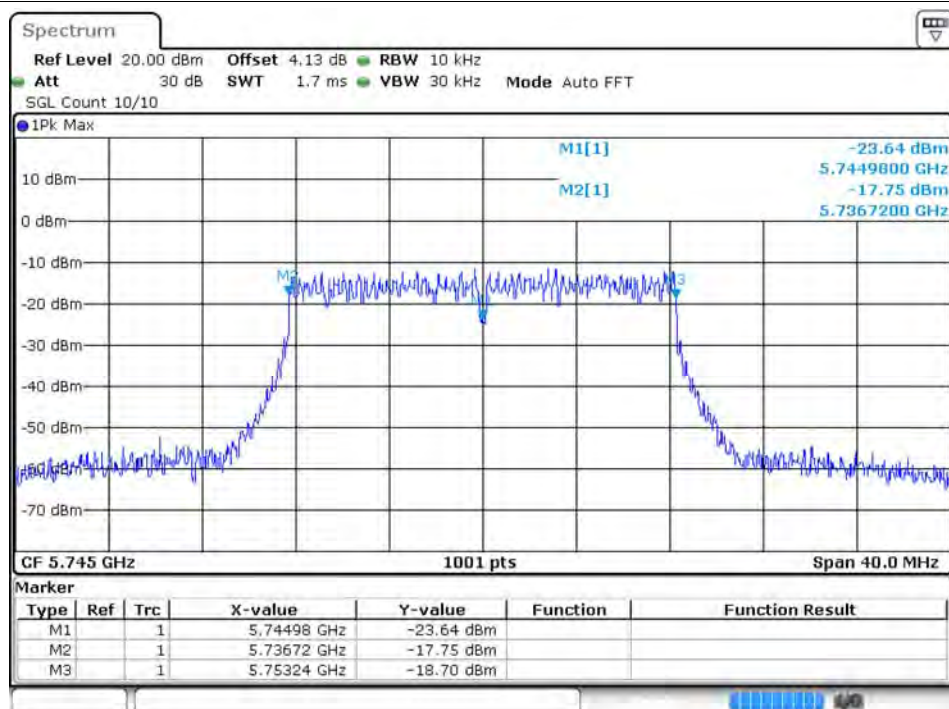


Freq. Stability 50C 120V a 5745MHz Ant2

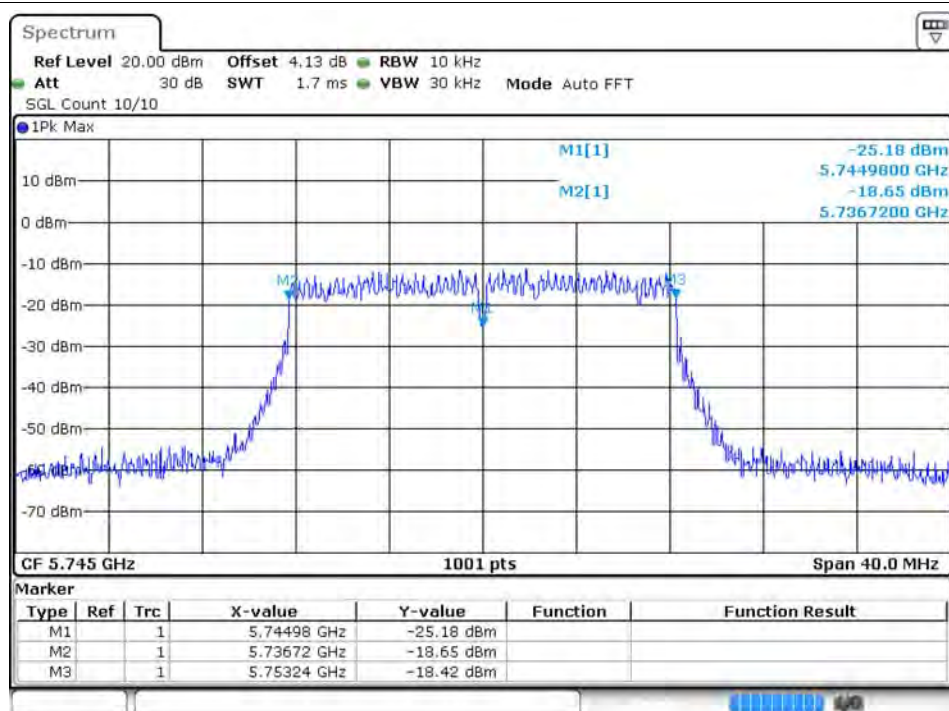


Freq. Stability 20C 102V a 5785MHz Ant2

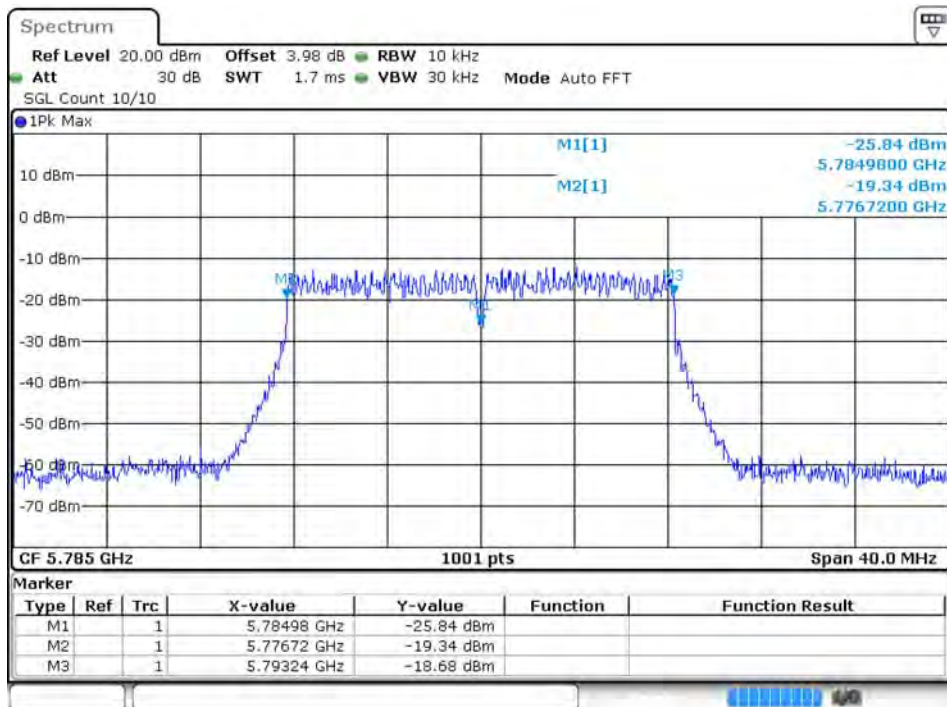


Freq. Stability 20C 120V a 5785MHz Ant2

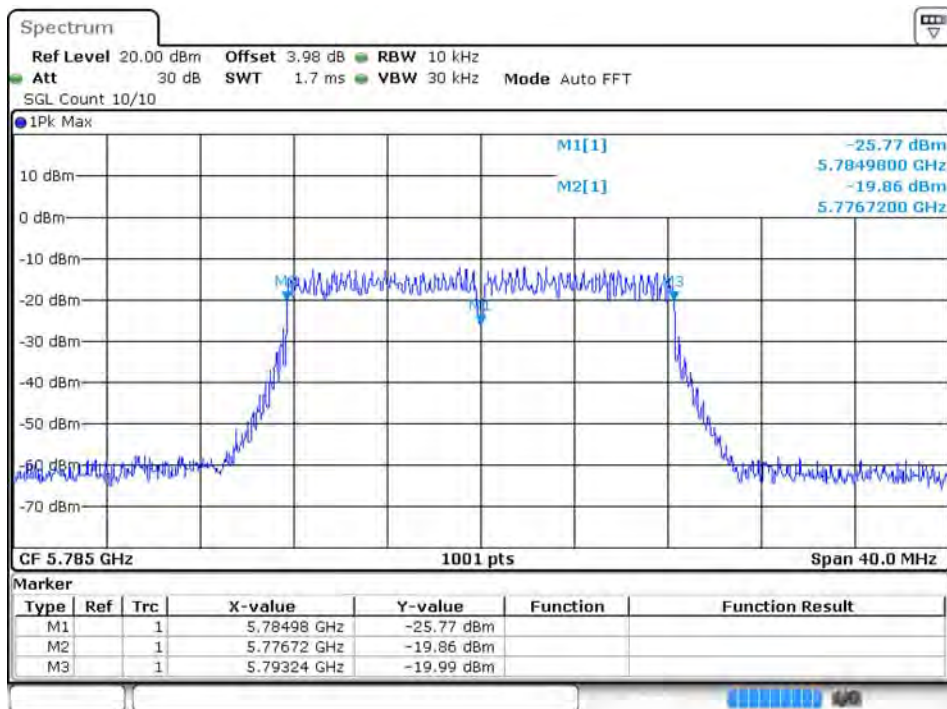


Freq. Stability 20C 138V a 5785MHz Ant2

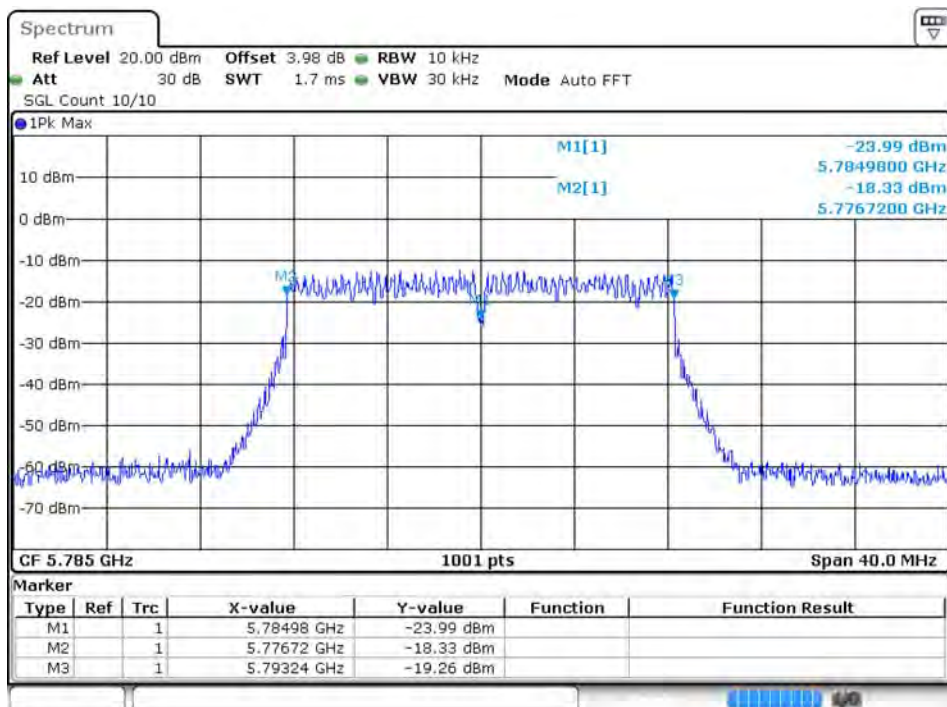


Freq. Stability -20C 120V a 5785MHz Ant2

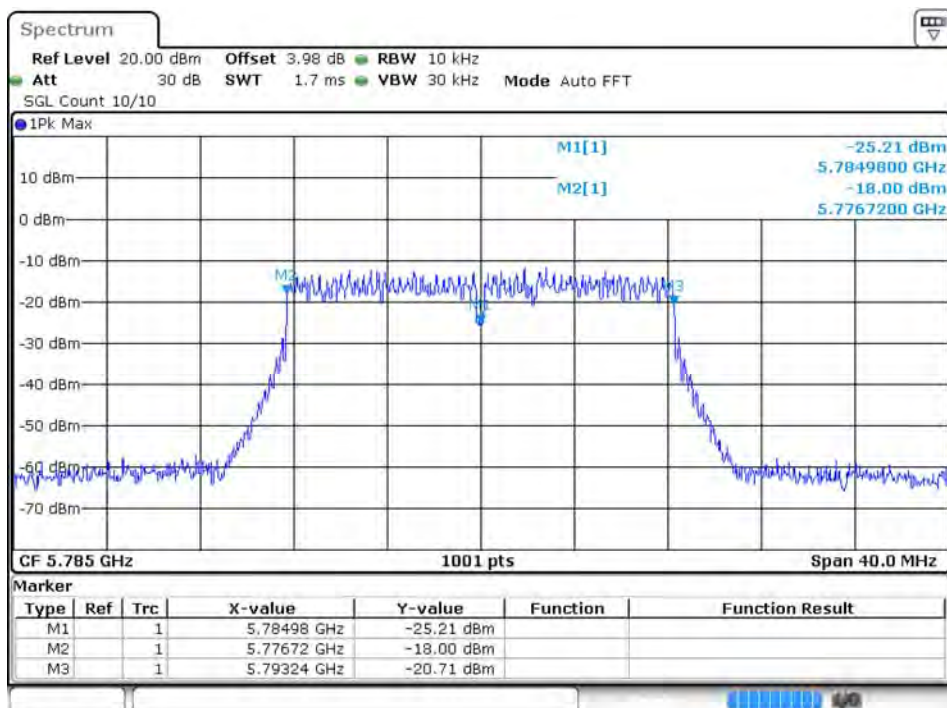


Freq. Stability -10C 120V a 5785MHz Ant2

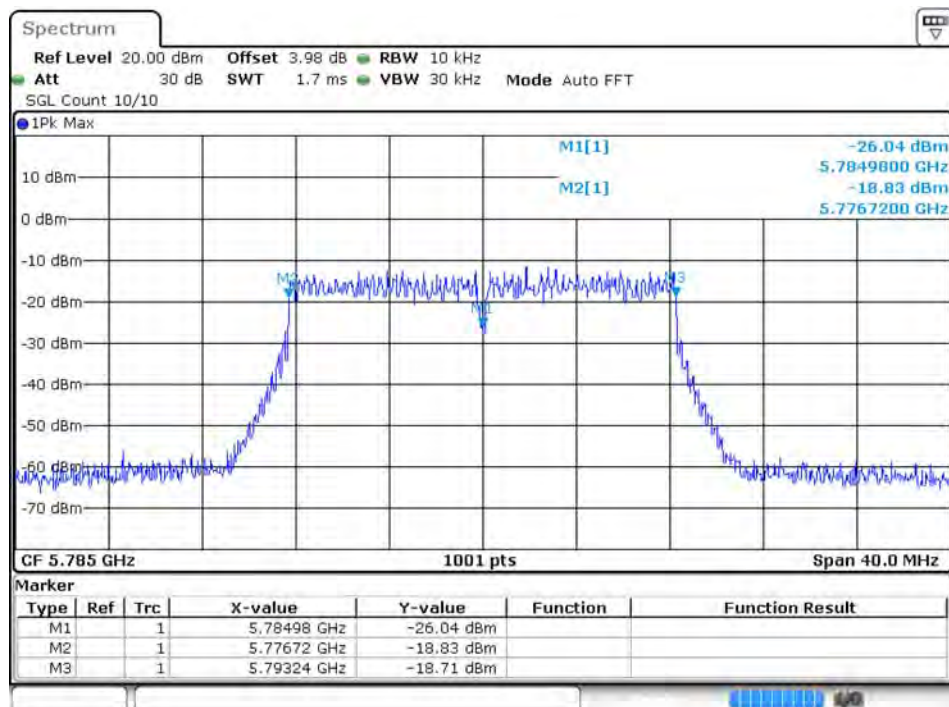


Freq. Stability 0C 120V a 5785MHz Ant2

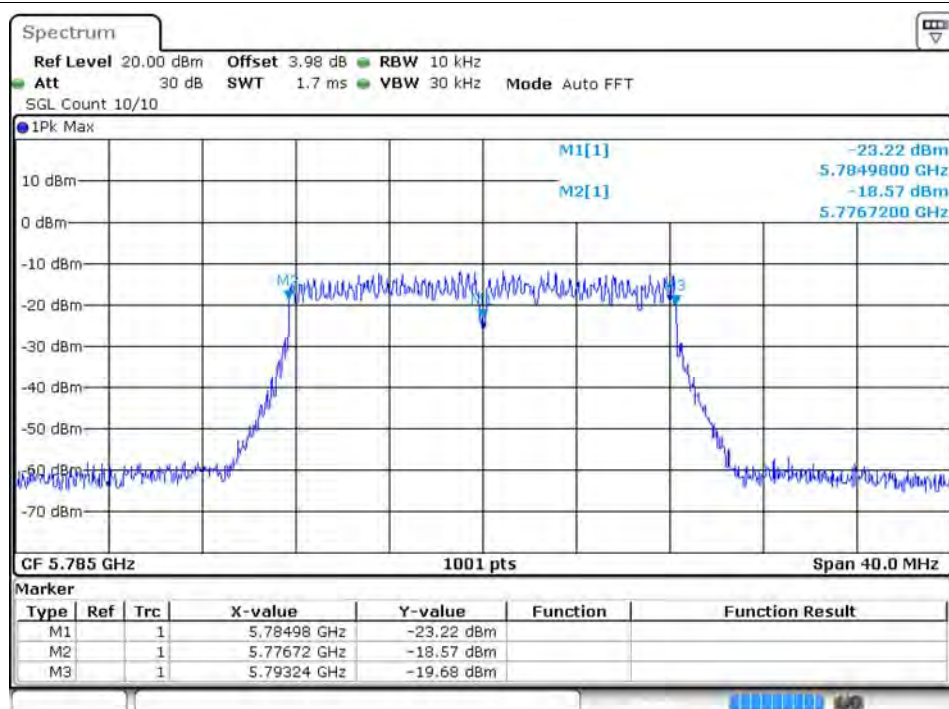


Freq. Stability 10C 120V a 5785MHz Ant2

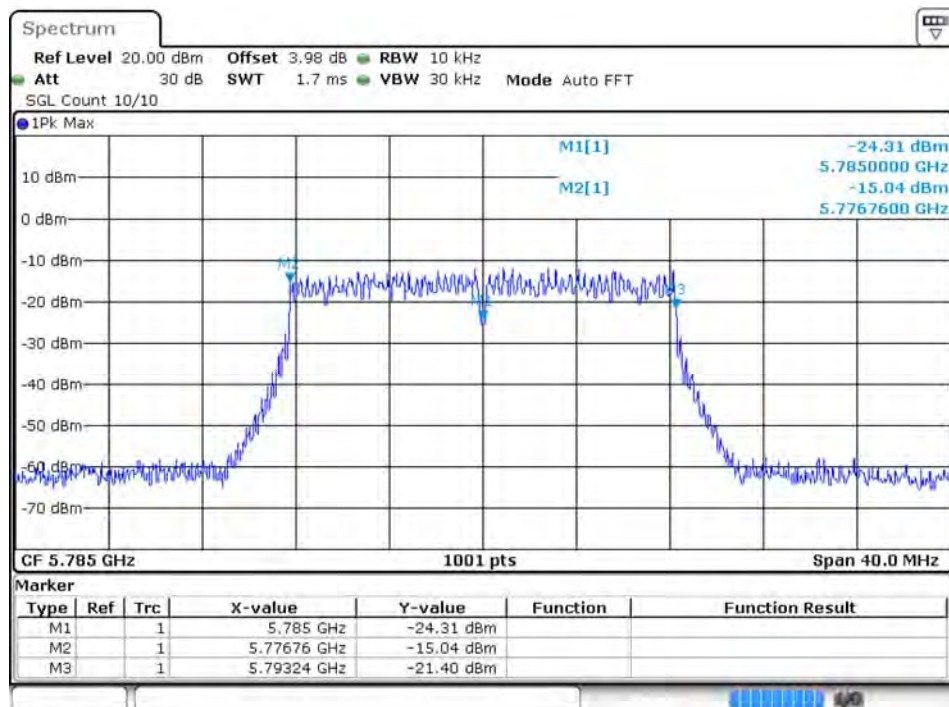


Freq. Stability 30C 120V a 5785MHz Ant2

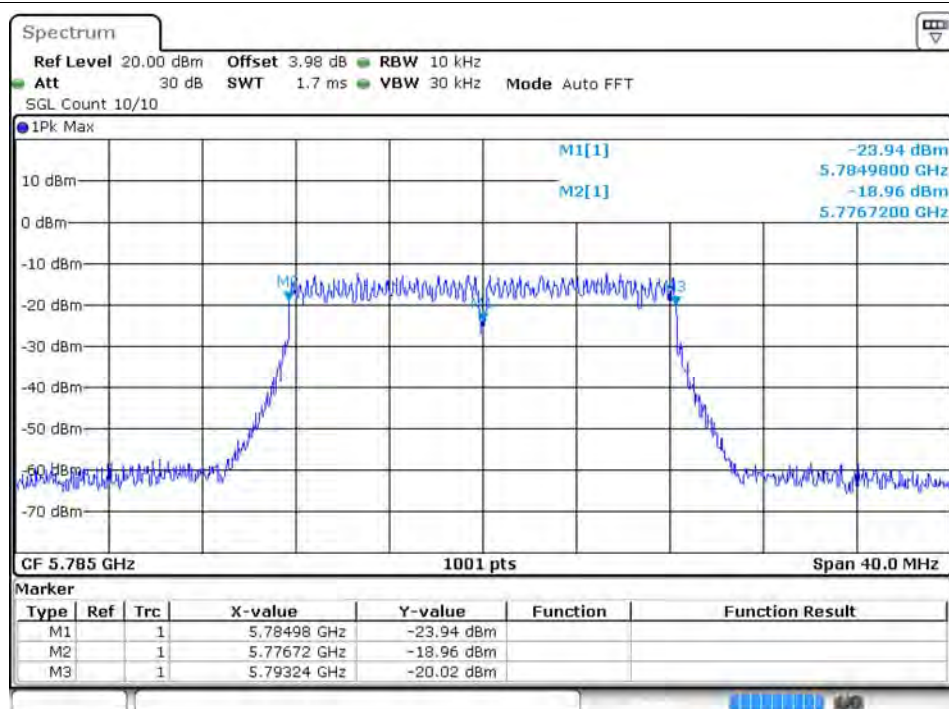


Freq. Stability 40C 120V a 5785MHz Ant2

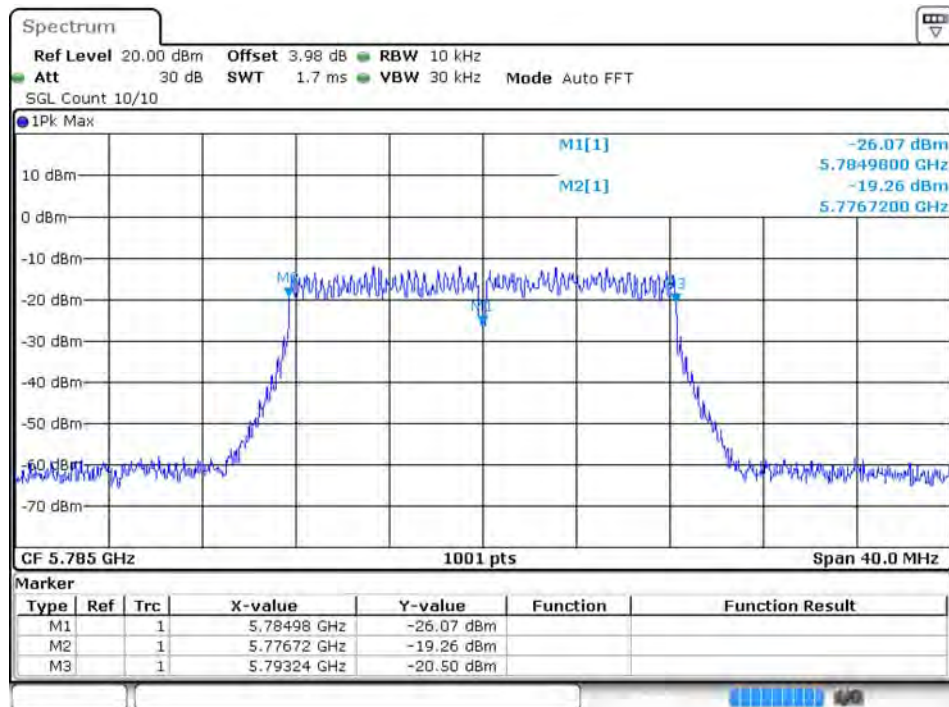


Freq. Stability 50C 120V a 5785MHz Ant2

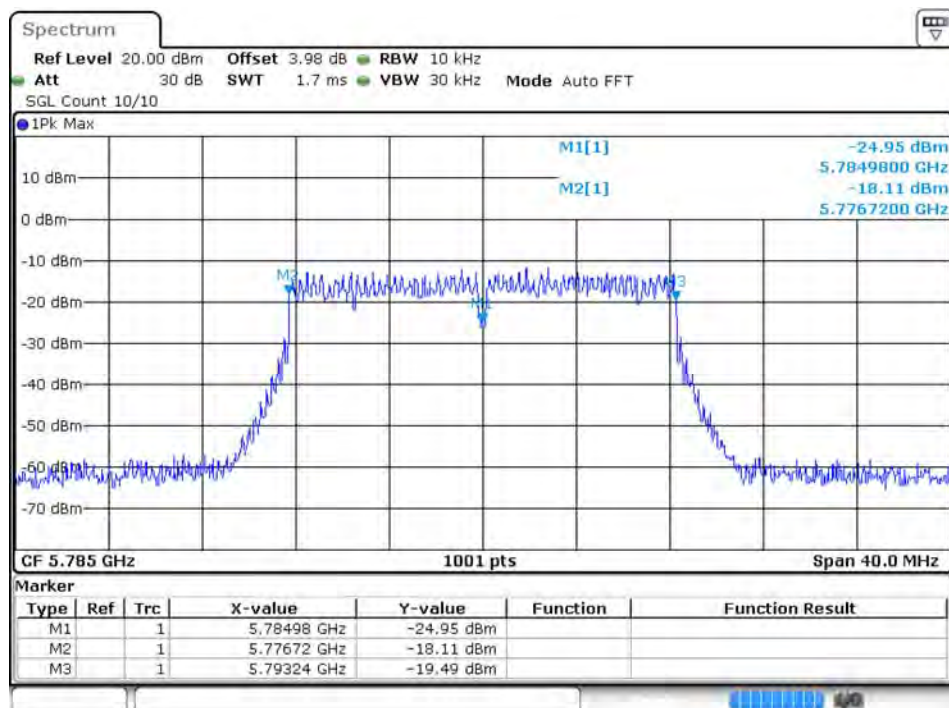


Freq. Stability 20C 102V a 5825MHz Ant2

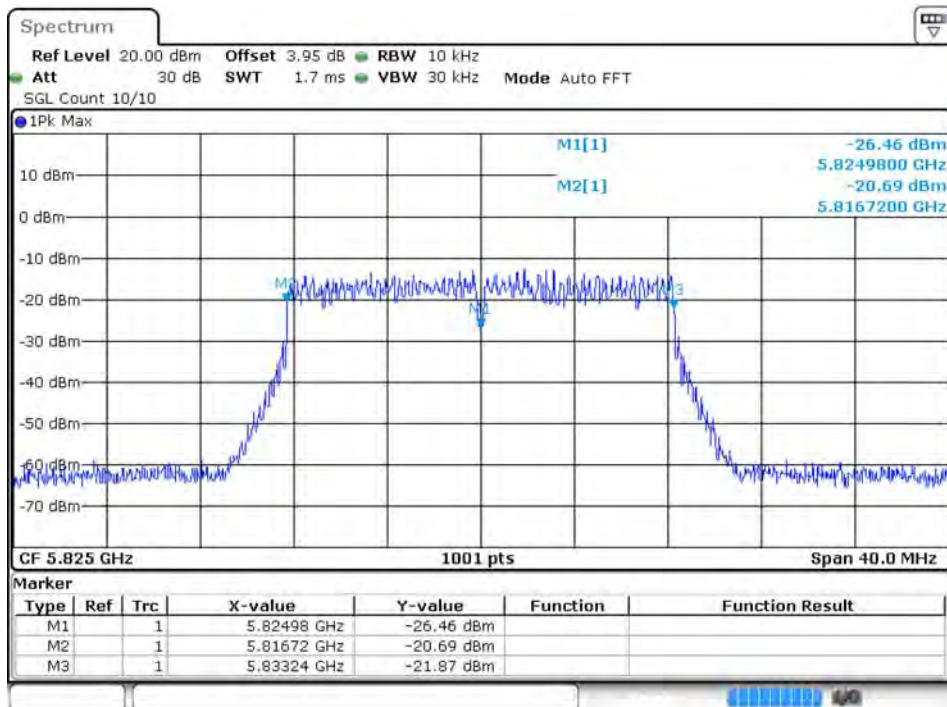


Freq. Stability 20C 120V a 5825MHz Ant2

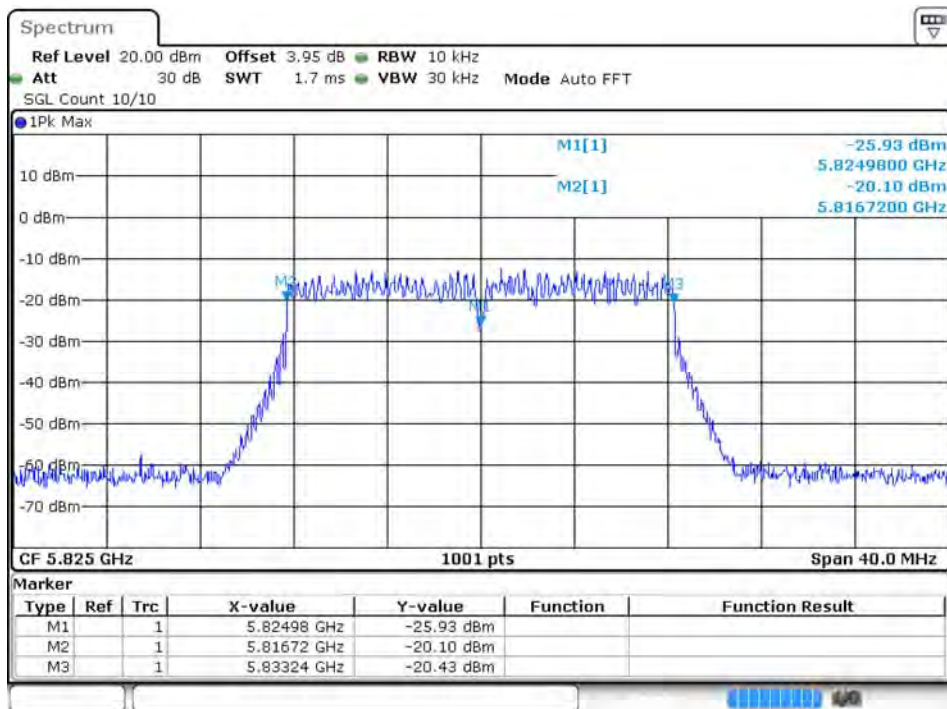


Freq. Stability 20C 138V a 5825MHz Ant2

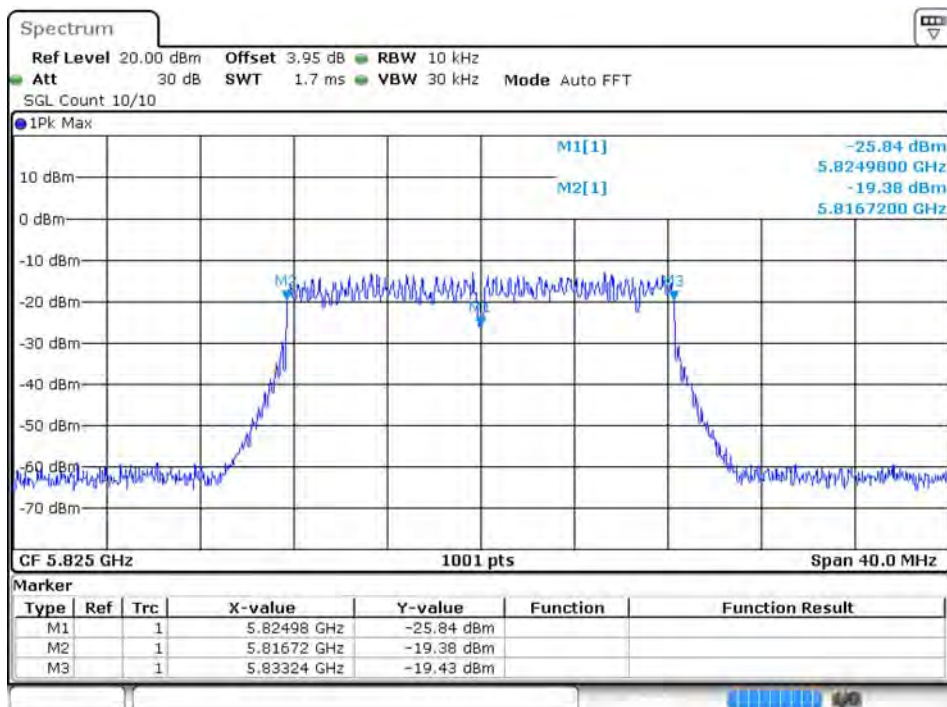


Freq. Stability -20C 120V a 5825MHz Ant2

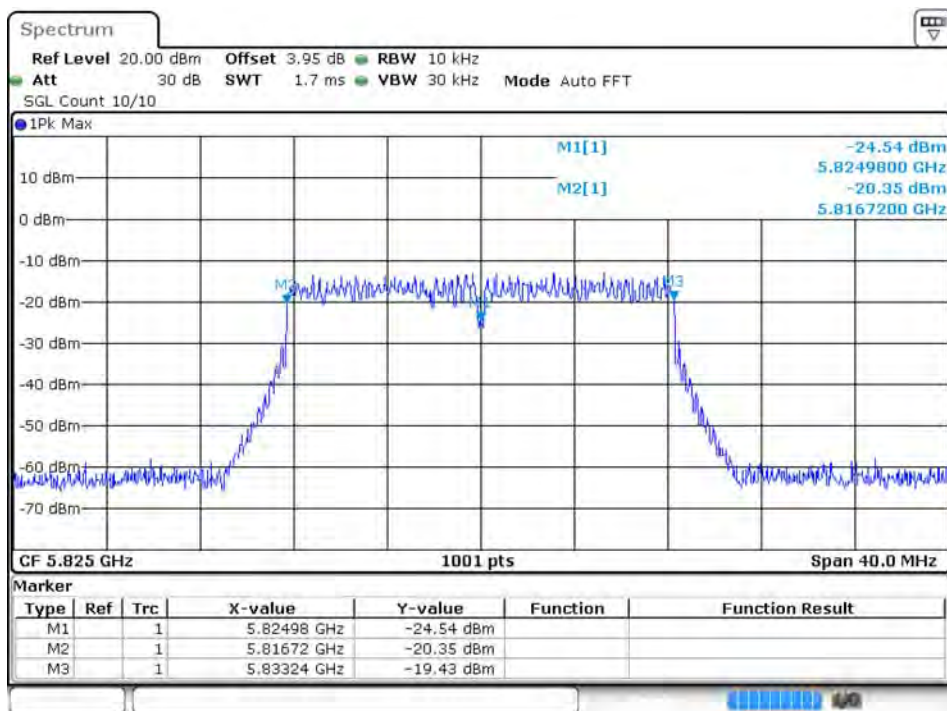


Freq. Stability -10C 120V a 5825MHz Ant2

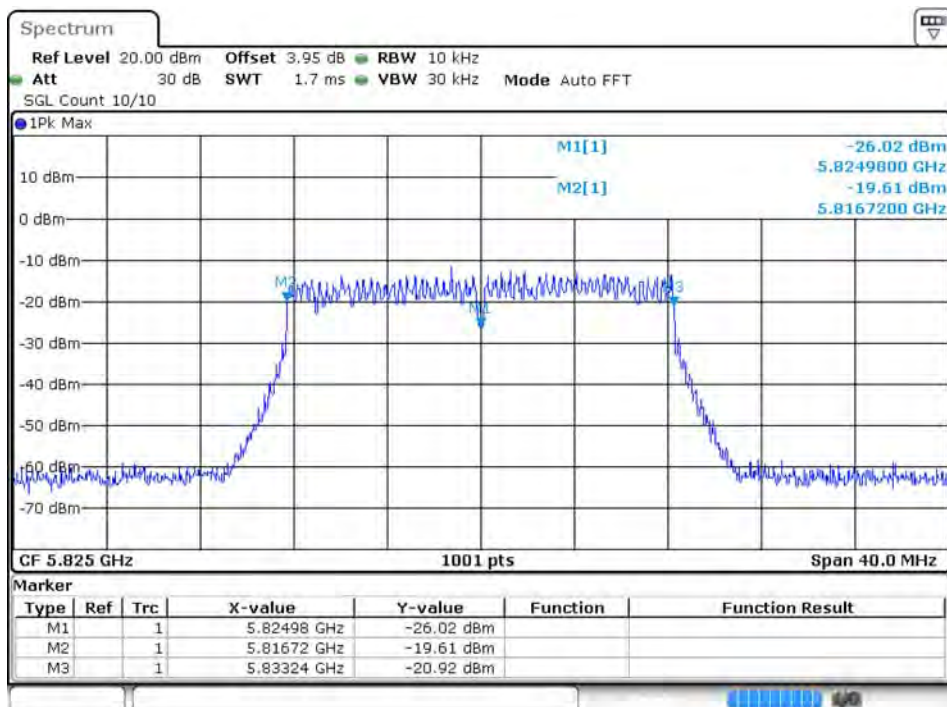


Freq. Stability 0C 120V a 5825MHz Ant2

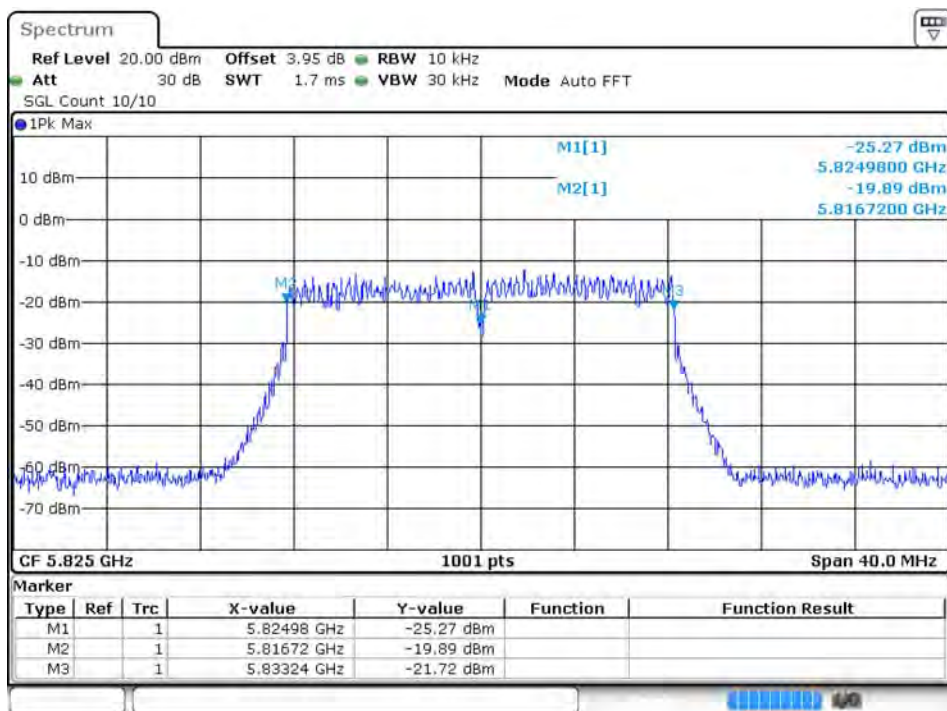


Freq. Stability 10C 120V a 5825MHz Ant2

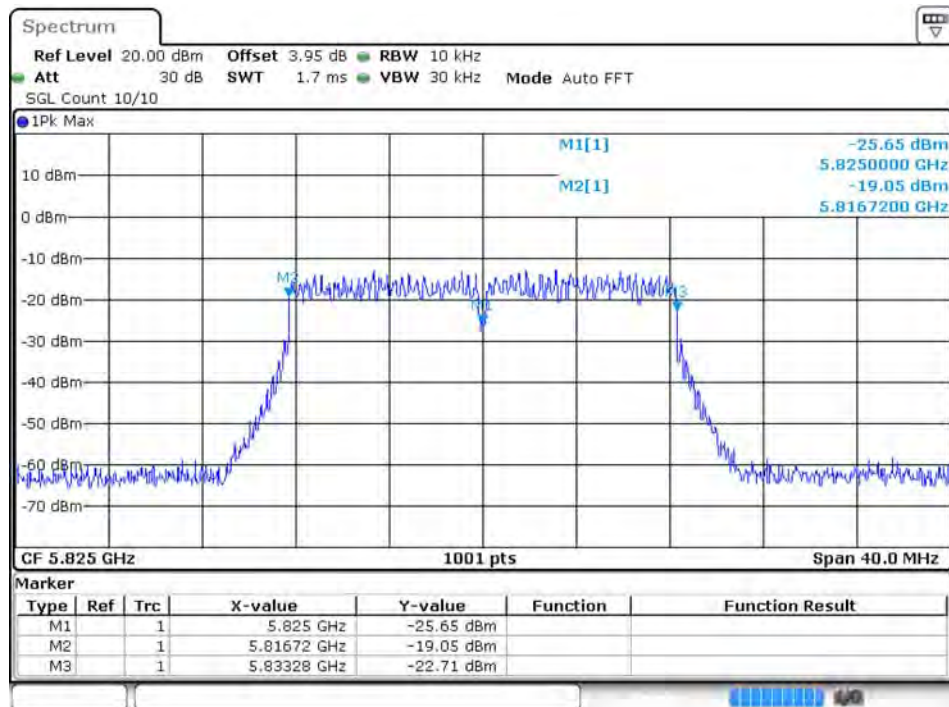


Freq. Stability 30C 120V a 5825MHz Ant2

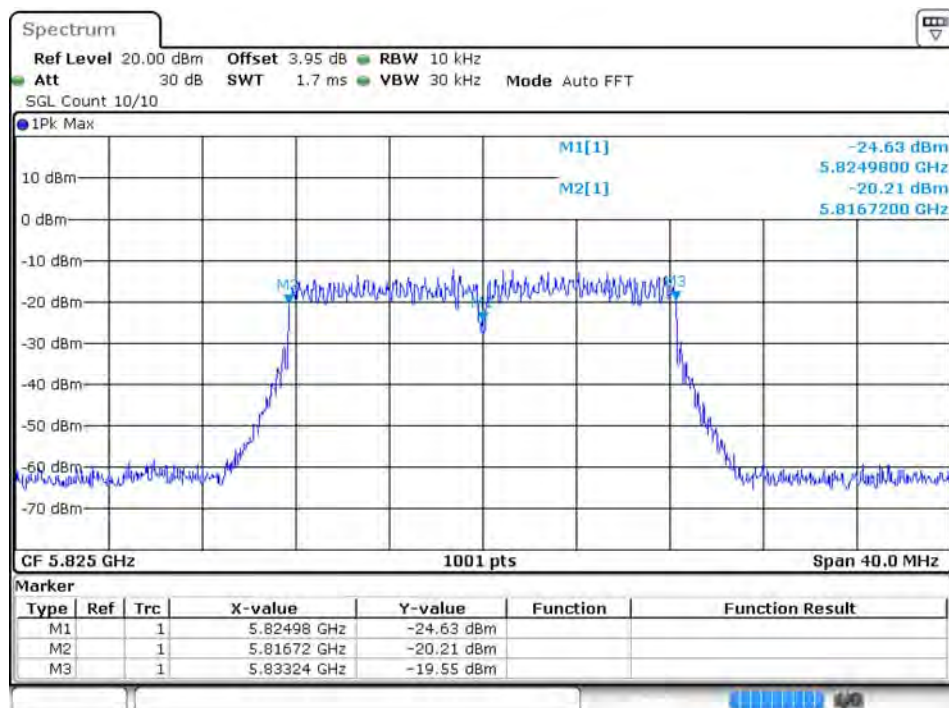


Freq. Stability 40C 120V a 5825MHz Ant2

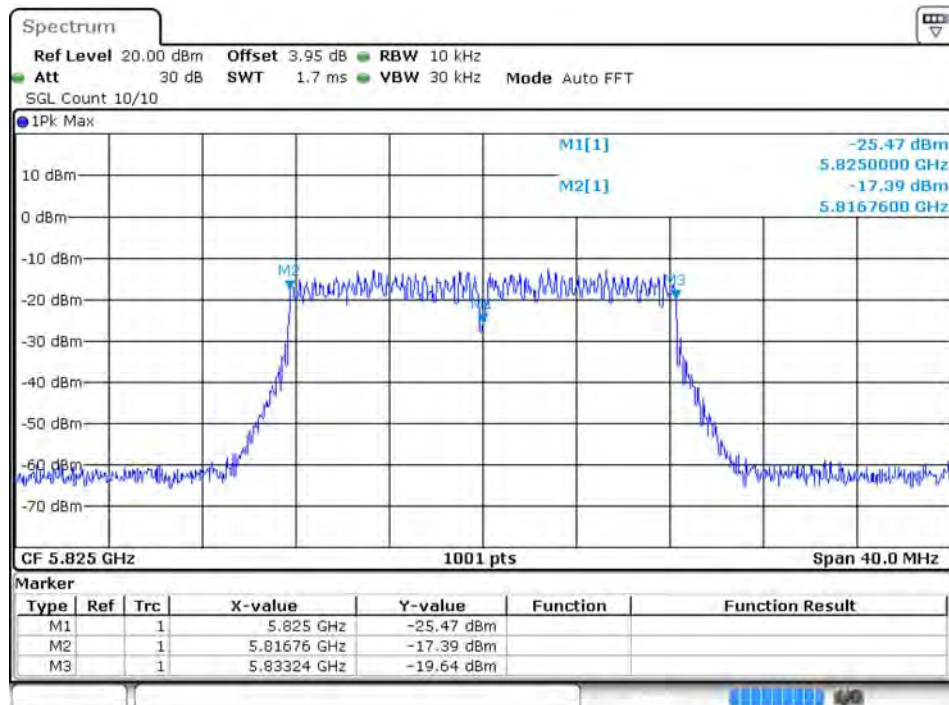


Freq. Stability 50C 120V a 5825MHz Ant2

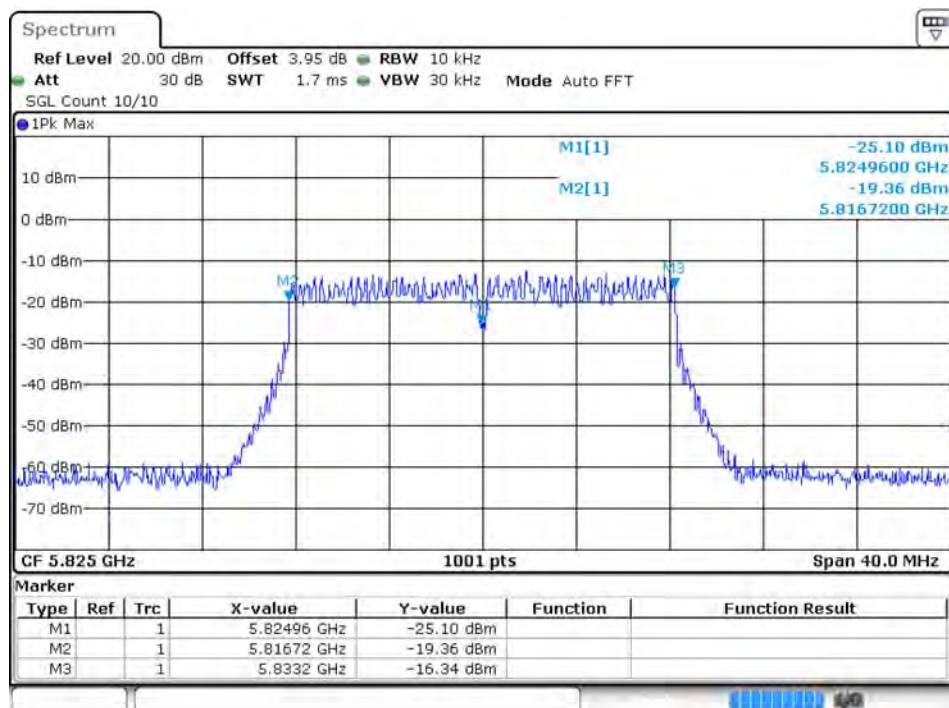


Freq. Stability 20C 102V n20 5745MHz Ant1

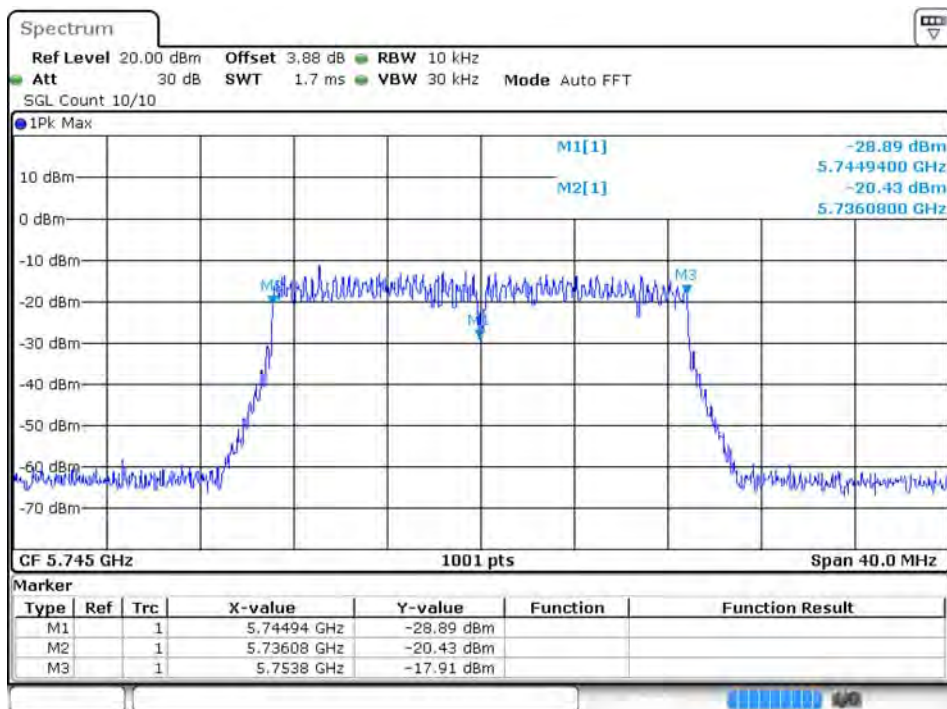


Freq. Stability 20C 120V n20 5745MHz Ant1

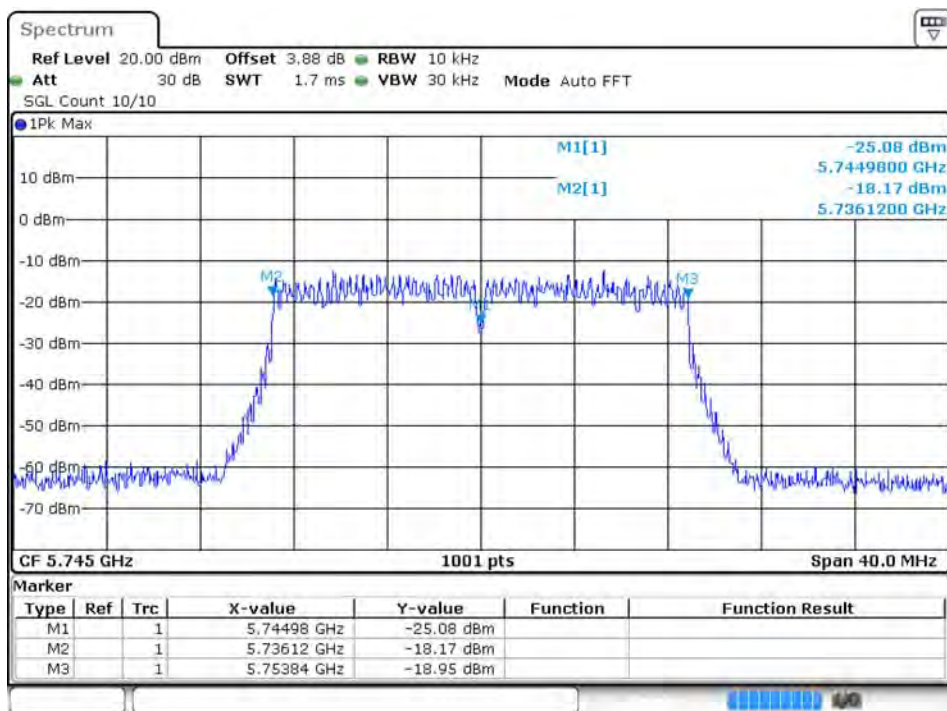


Freq. Stability 20C 138V n20 5745MHz Ant1

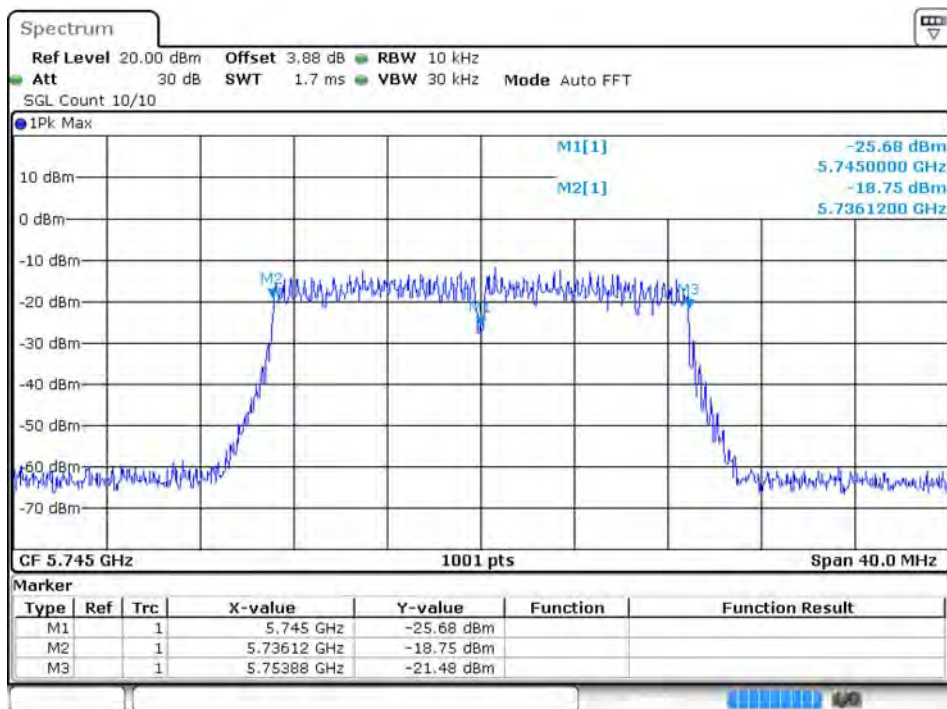


Freq. Stability -20C 120V n20 5745MHz Ant1

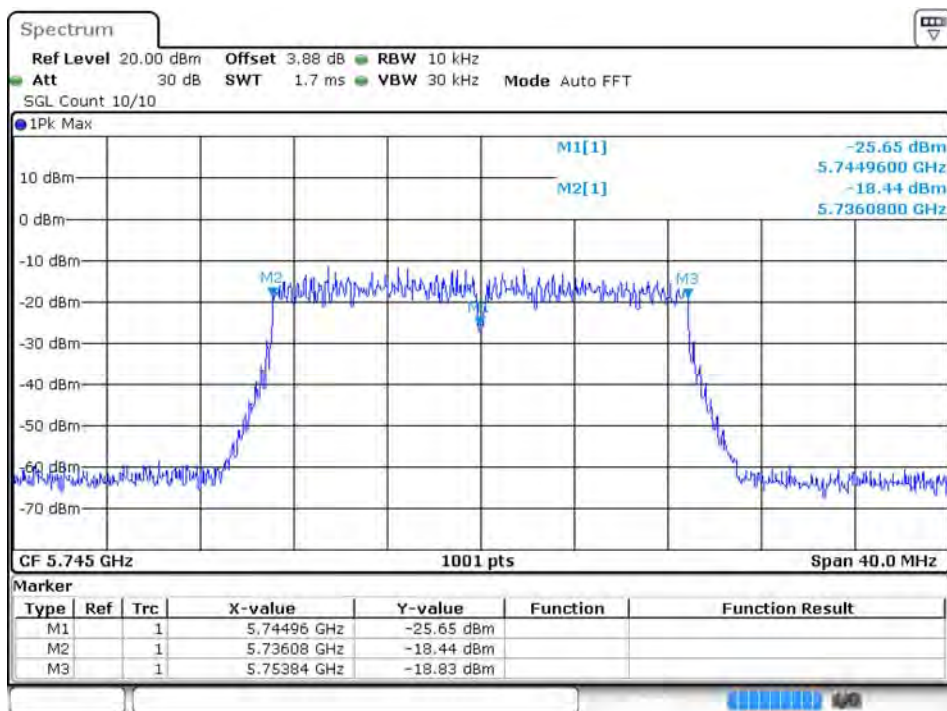


Freq. Stability -10C 120V n20 5745MHz Ant1

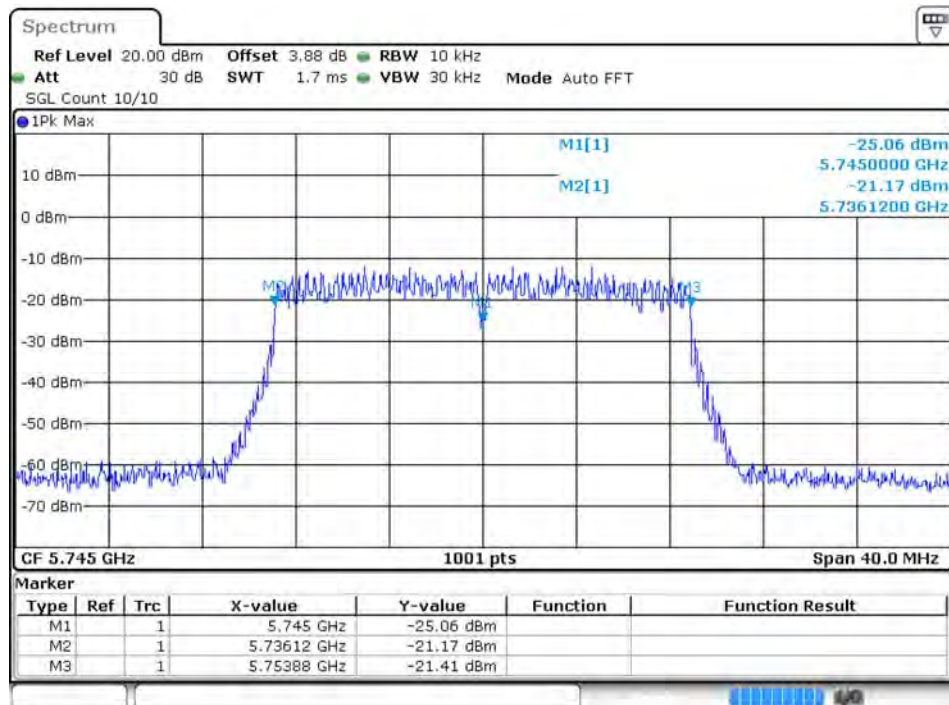


Freq. Stability 0C 120V n20 5745MHz Ant1

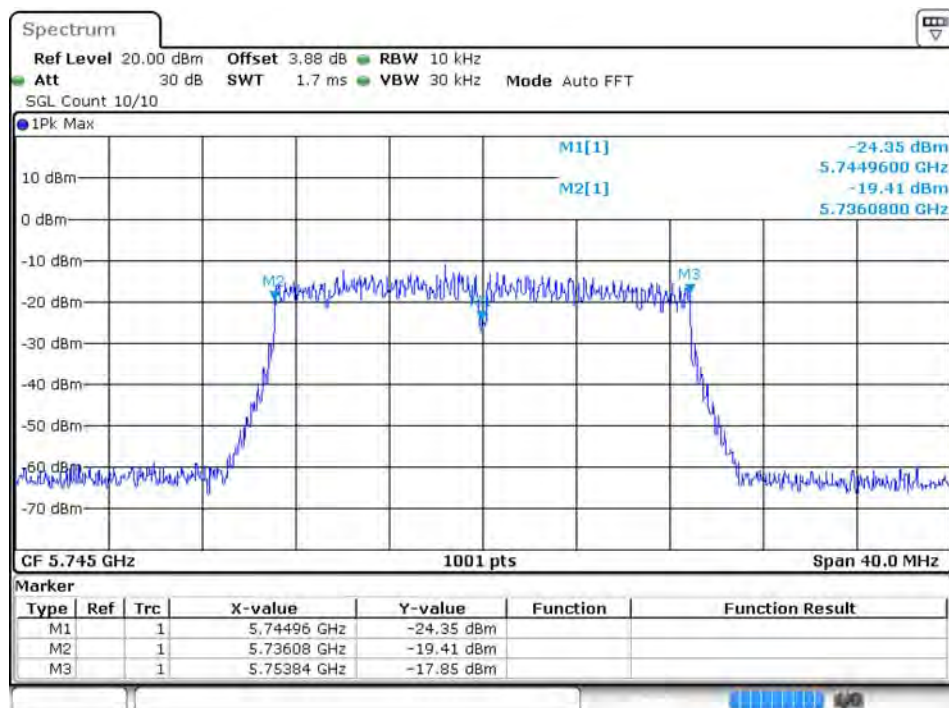


Freq. Stability 10C 120V n20 5745MHz Ant1

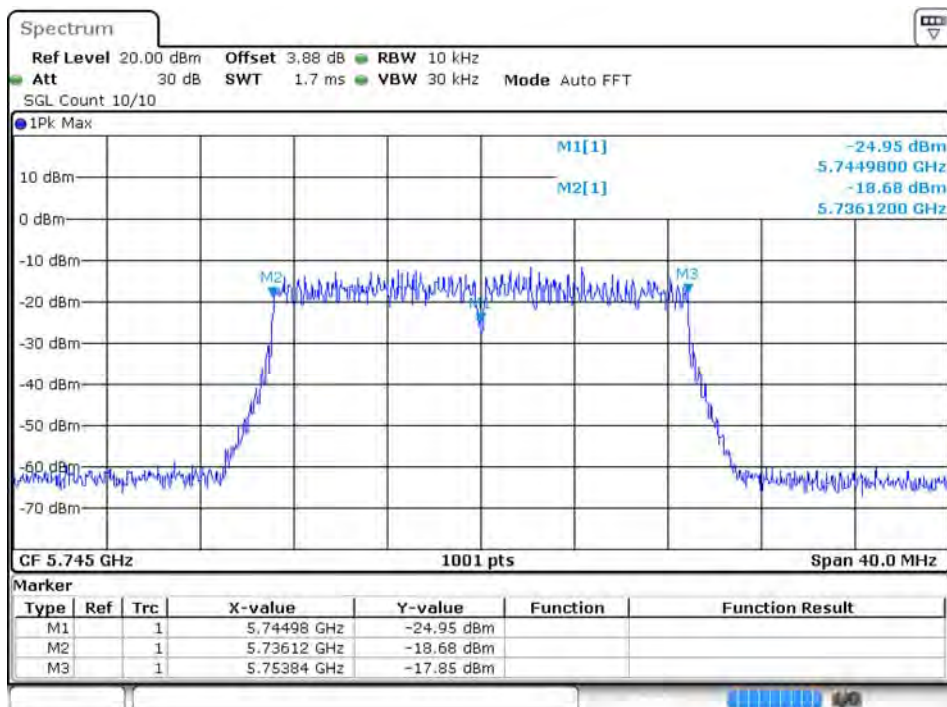


Freq. Stability 30C 120V n20 5745MHz Ant1

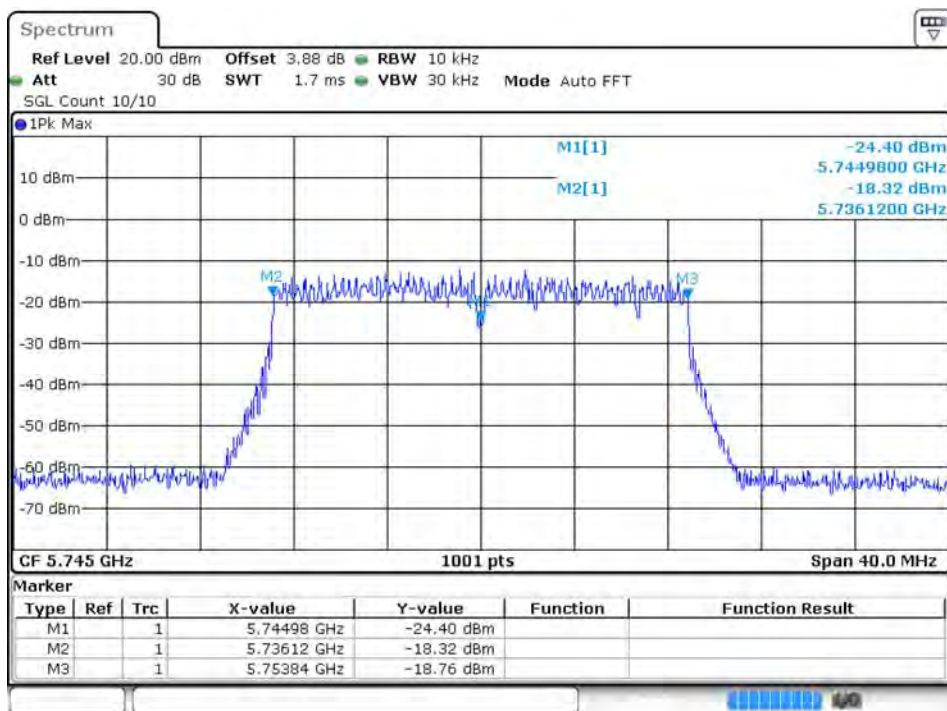


Freq. Stability 40C 120V n20 5745MHz Ant1

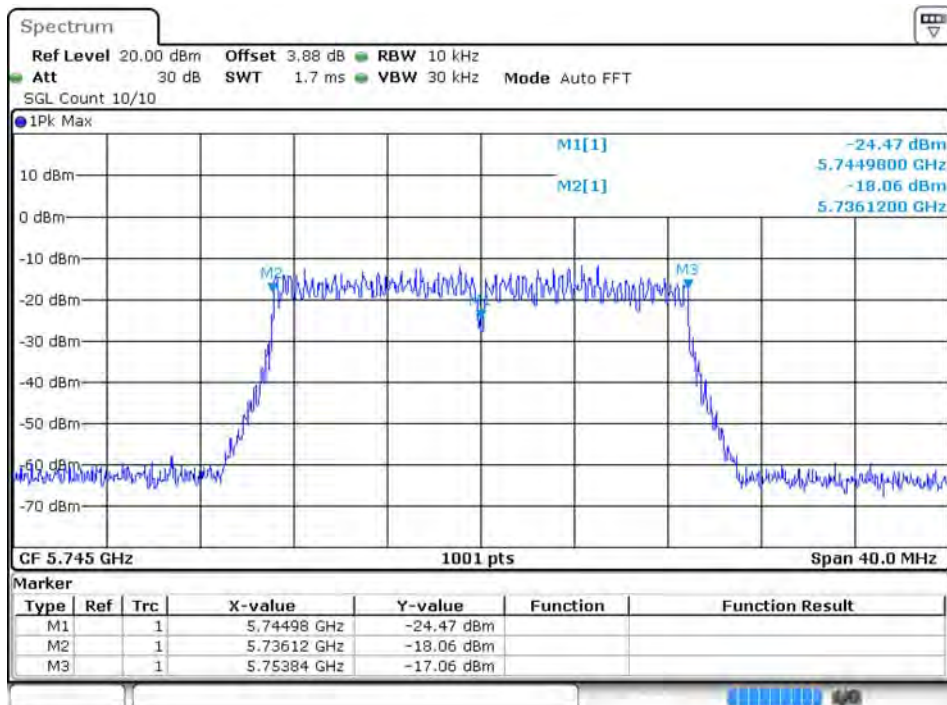


Freq. Stability 50C 120V n20 5745MHz Ant1

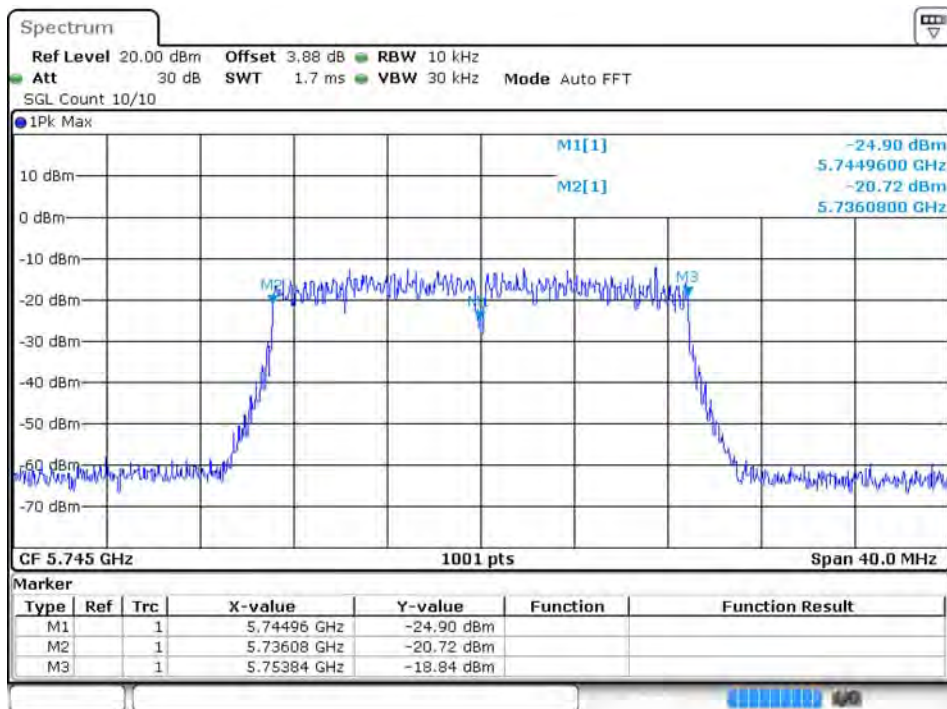


Freq. Stability 20C 102V n20 5785MHz Ant1

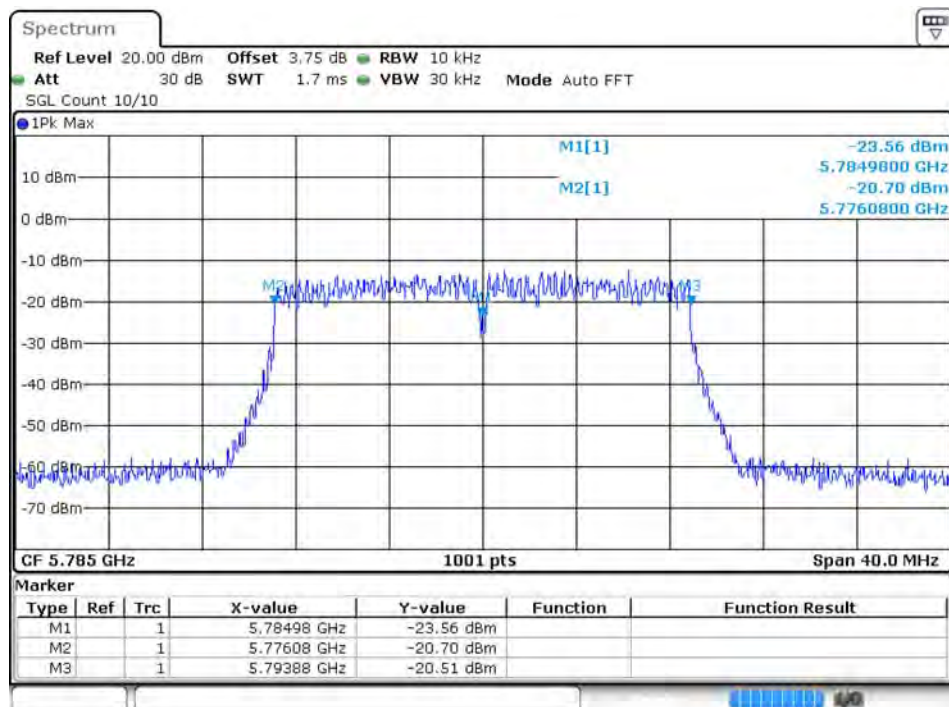


Freq. Stability 20C 120V n20 5785MHz Ant1

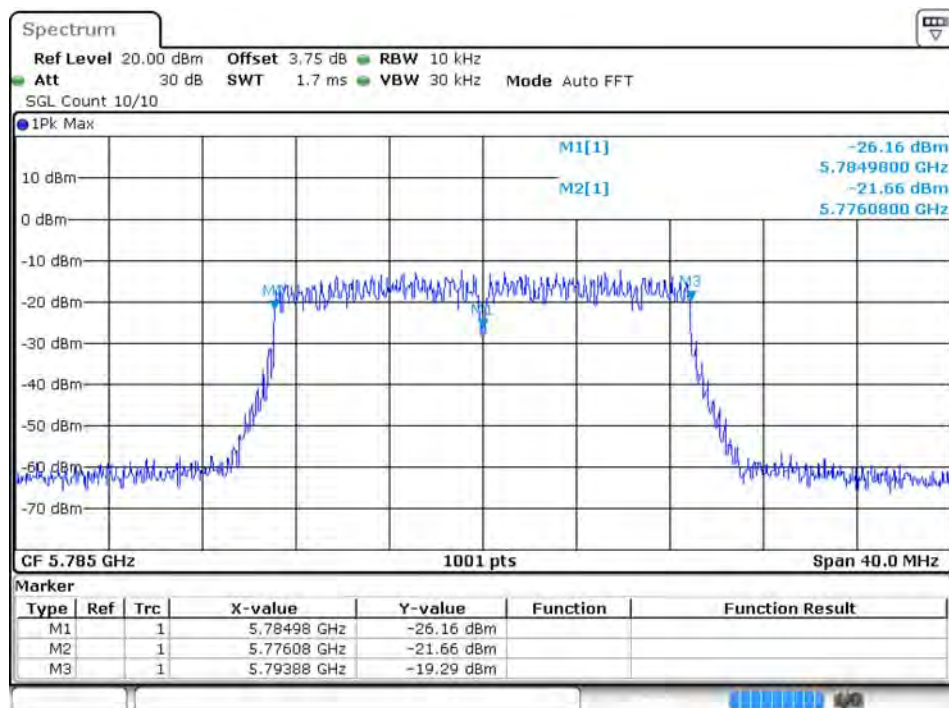


Freq. Stability 20C 138V n20 5785MHz Ant1

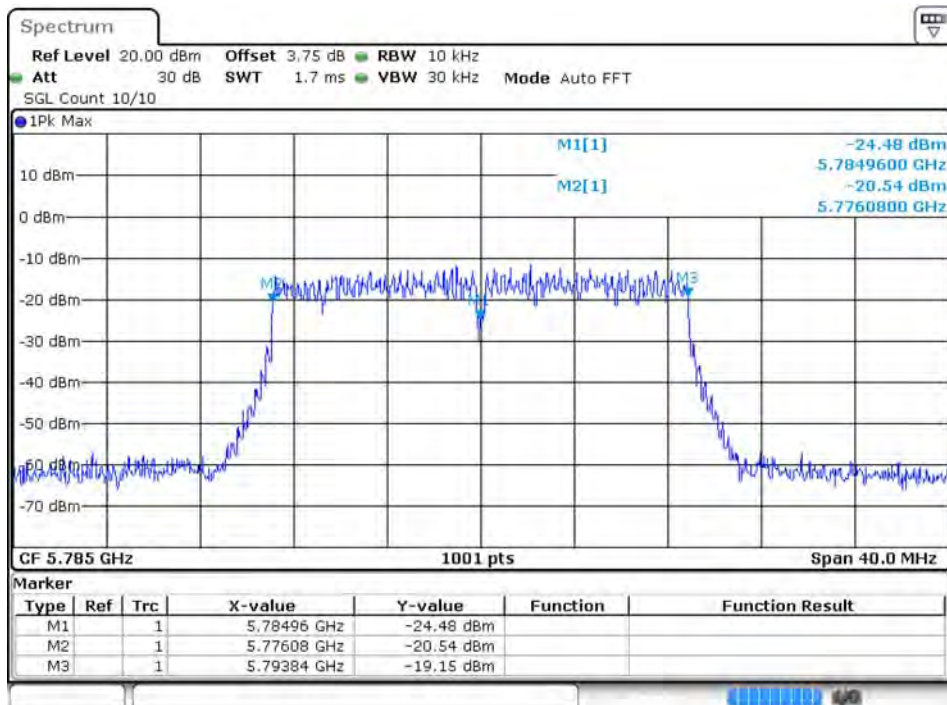


Freq. Stability -20C 120V n20 5785MHz Ant1

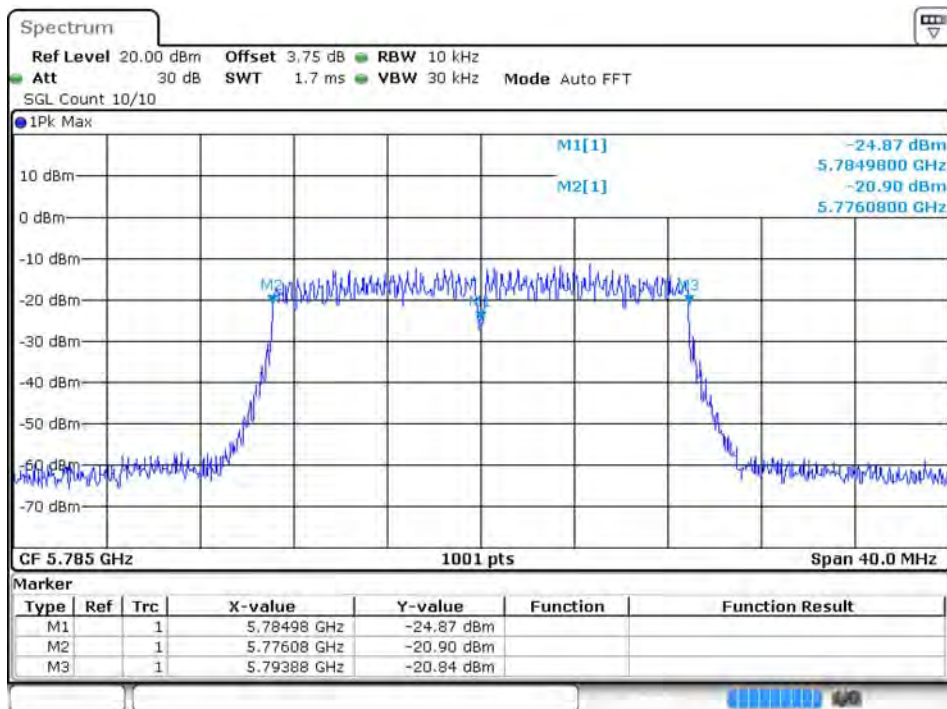


Freq. Stability -10C 120V n20 5785MHz Ant1

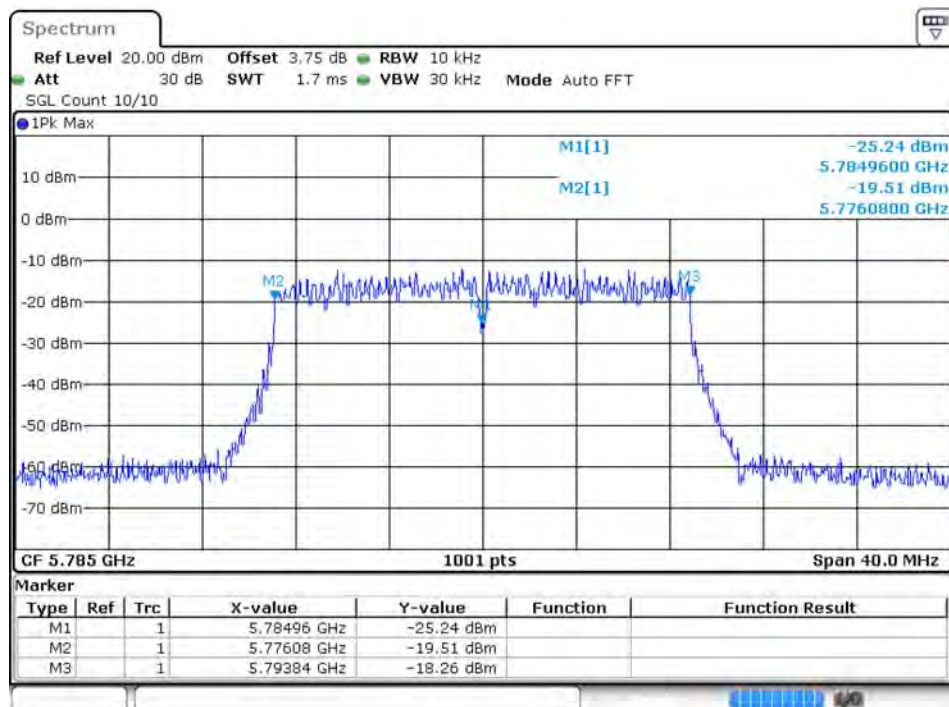


Freq. Stability 0C 120V n20 5785MHz Ant1

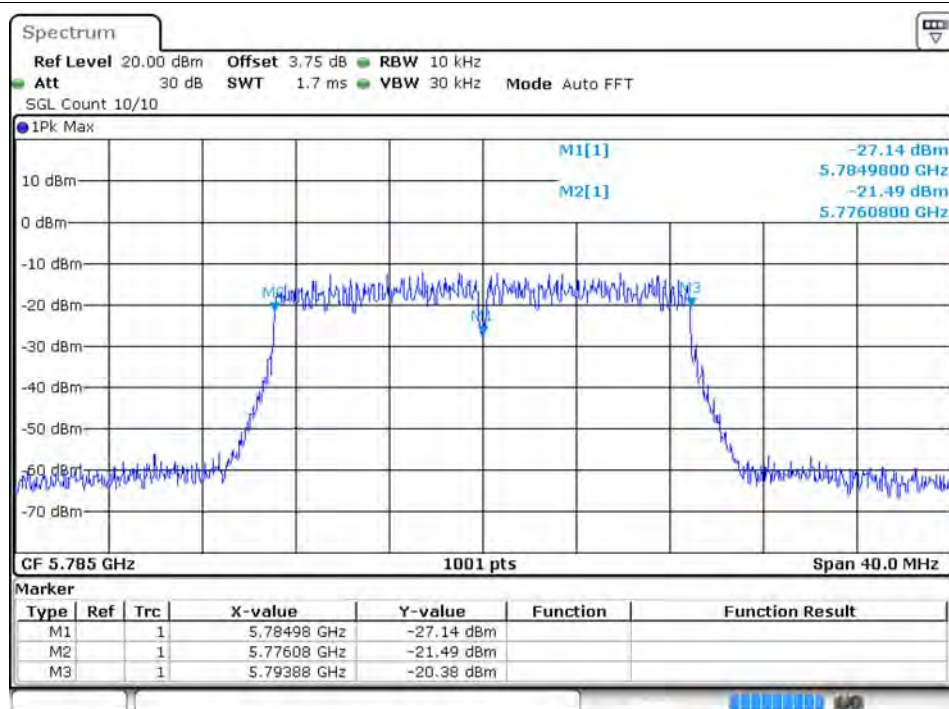


Freq. Stability 10C 120V n20 5785MHz Ant1

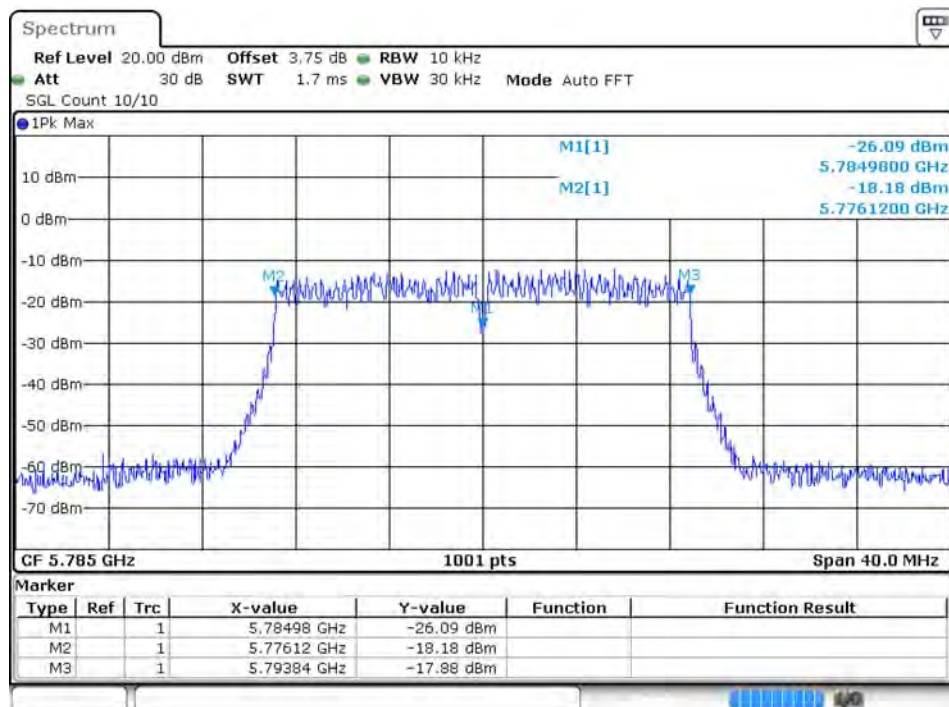


Freq. Stability 30C 120V n20 5785MHz Ant1

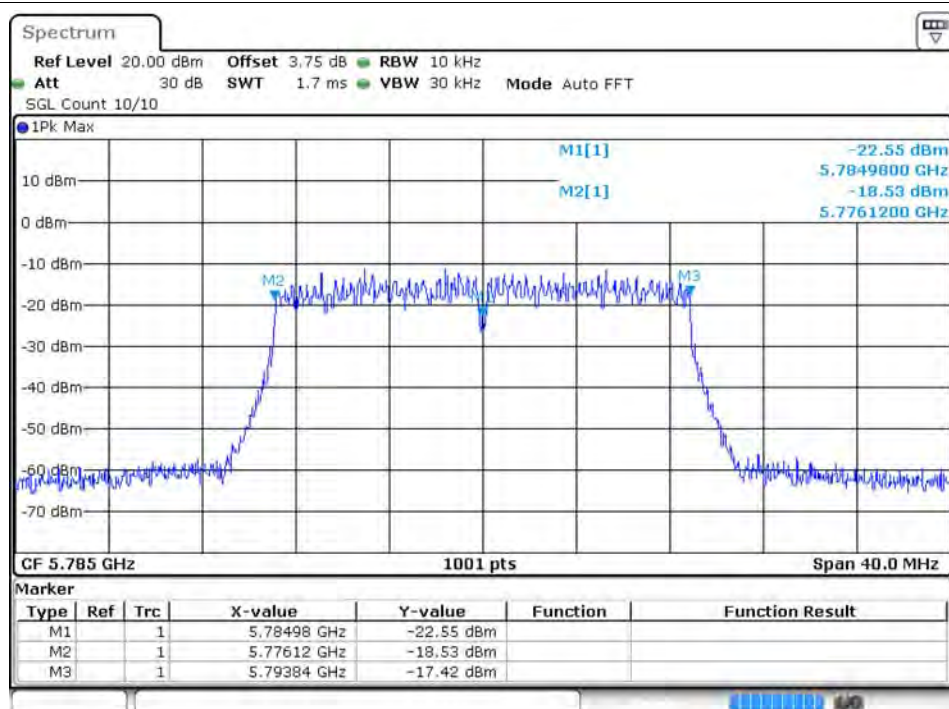


Freq. Stability 40C 120V n20 5785MHz Ant1

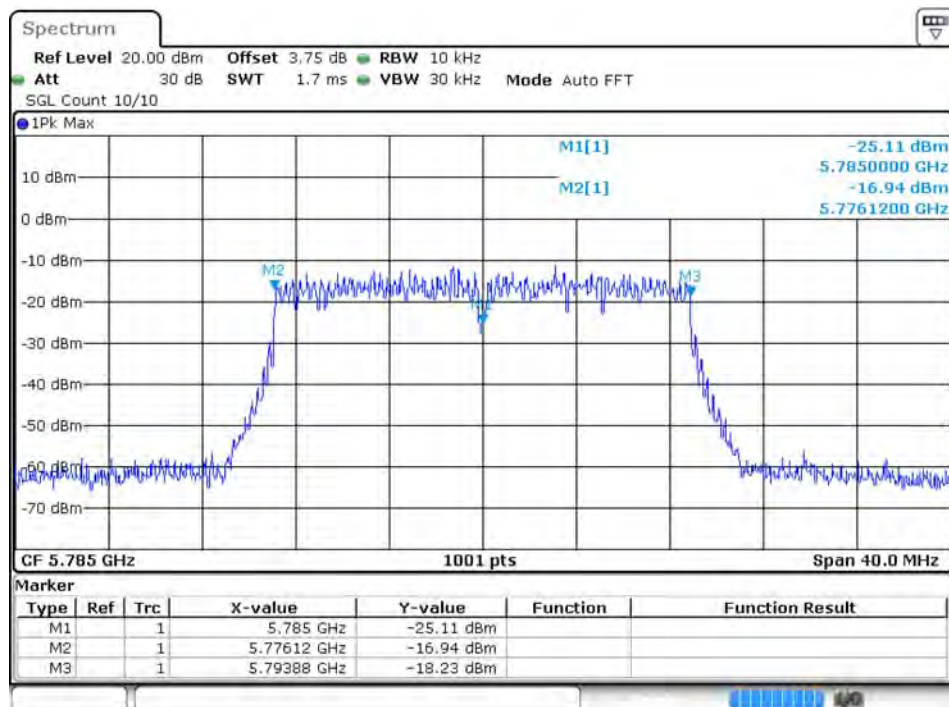


Freq. Stability 50C 120V n20 5785MHz Ant1

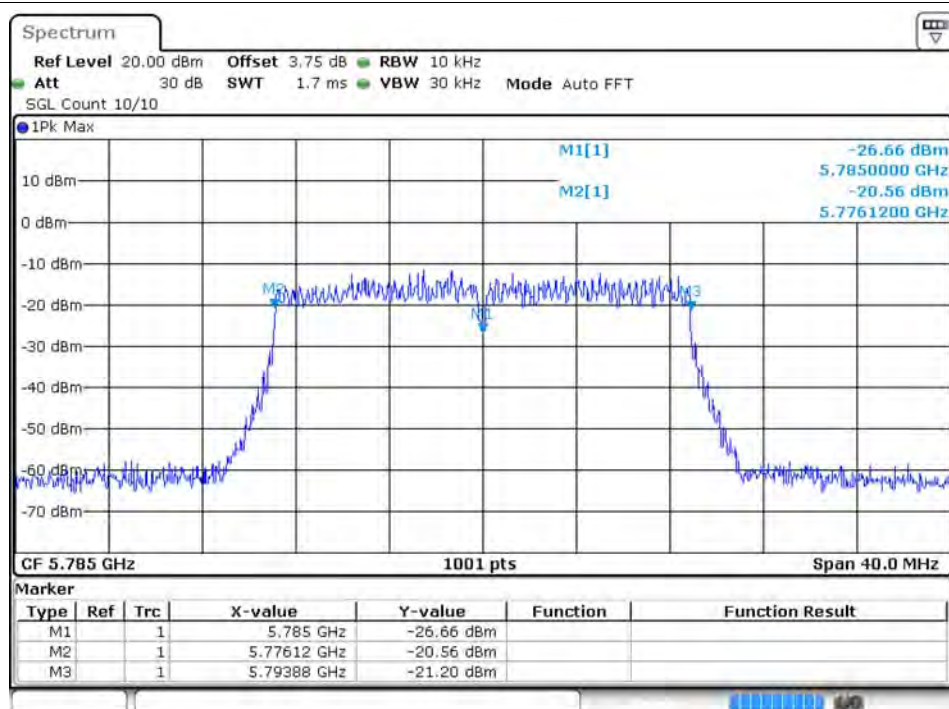


Freq. Stability 20C 102V n20 5825MHz Ant1

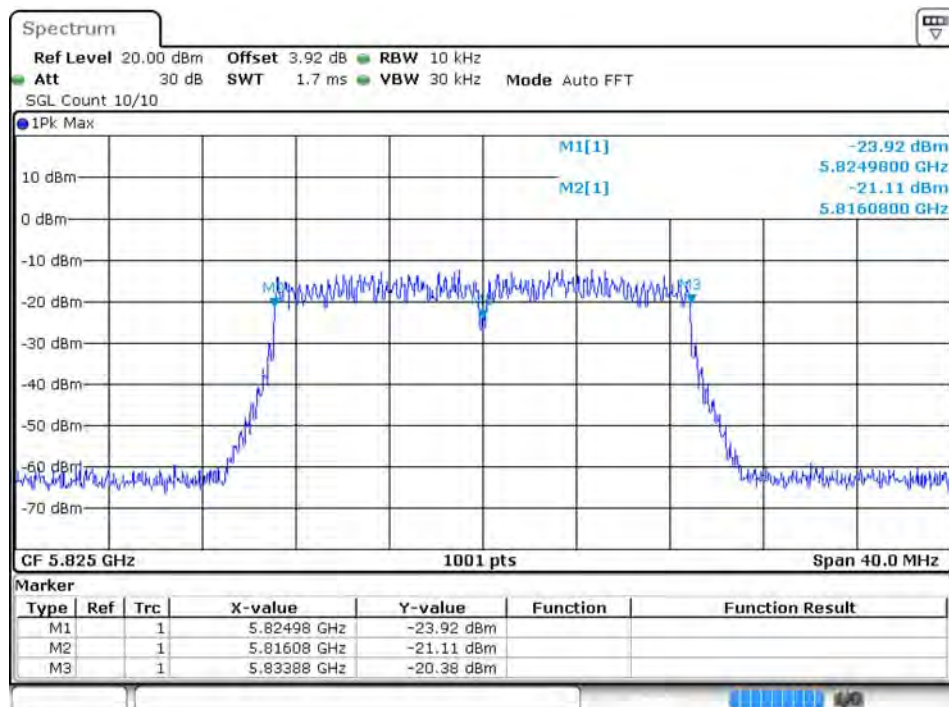


Freq. Stability 20C 120V n20 5825MHz Ant1

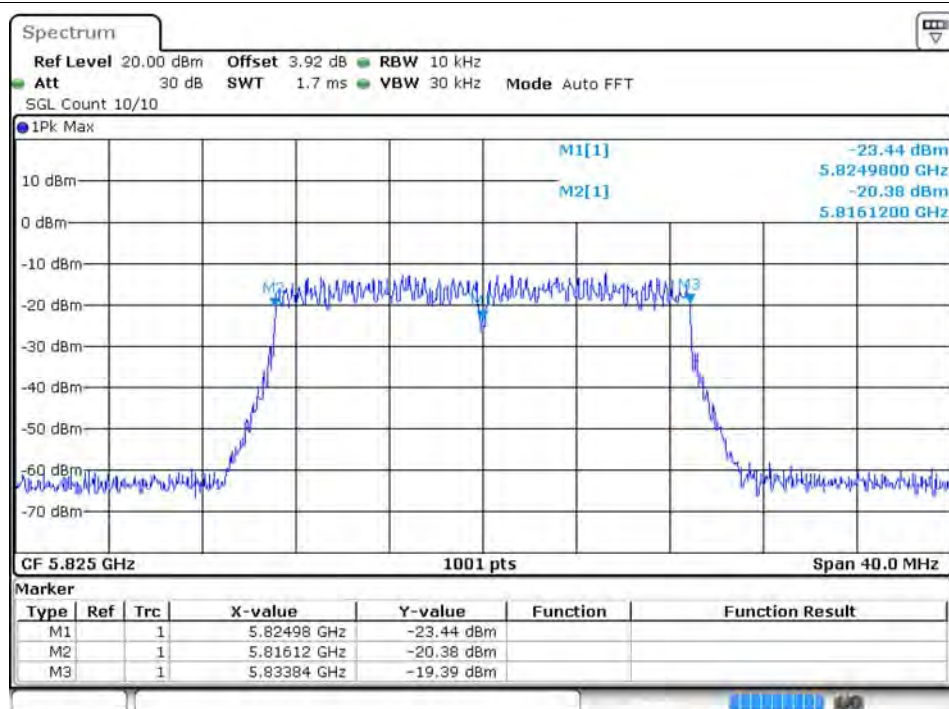


Freq. Stability 20C 138V n20 5825MHz Ant1

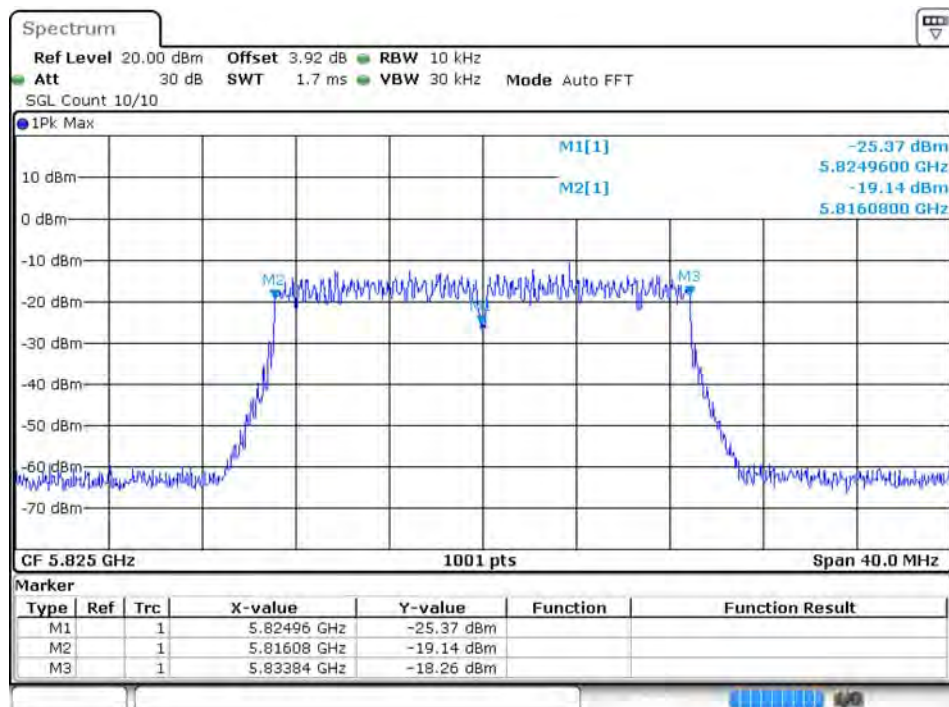


Freq. Stability -20C 120V n20 5825MHz Ant1

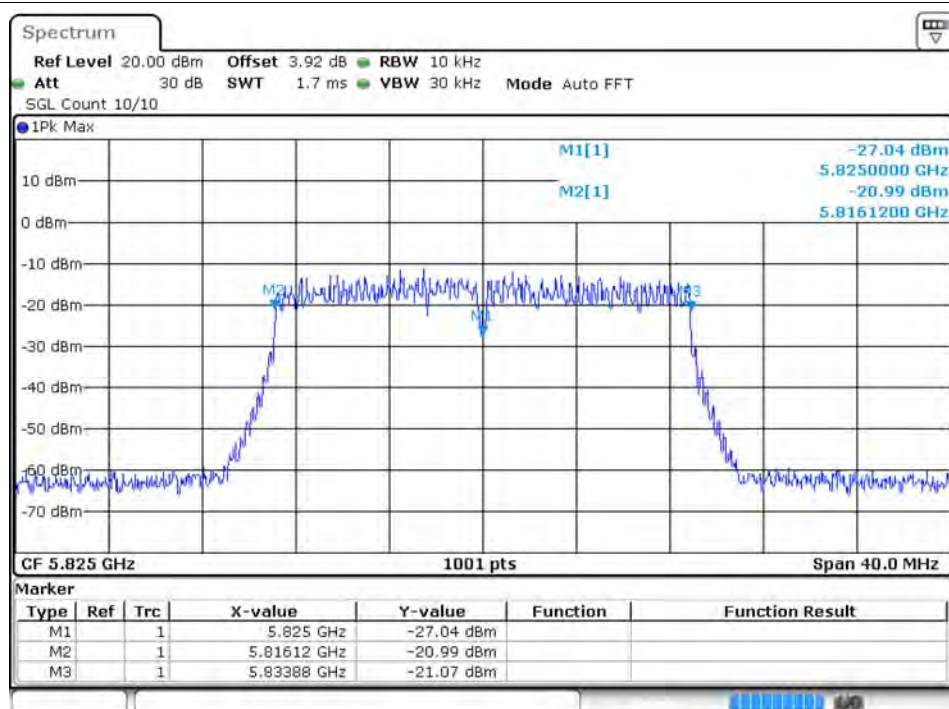


Freq. Stability -10C 120V n20 5825MHz Ant1

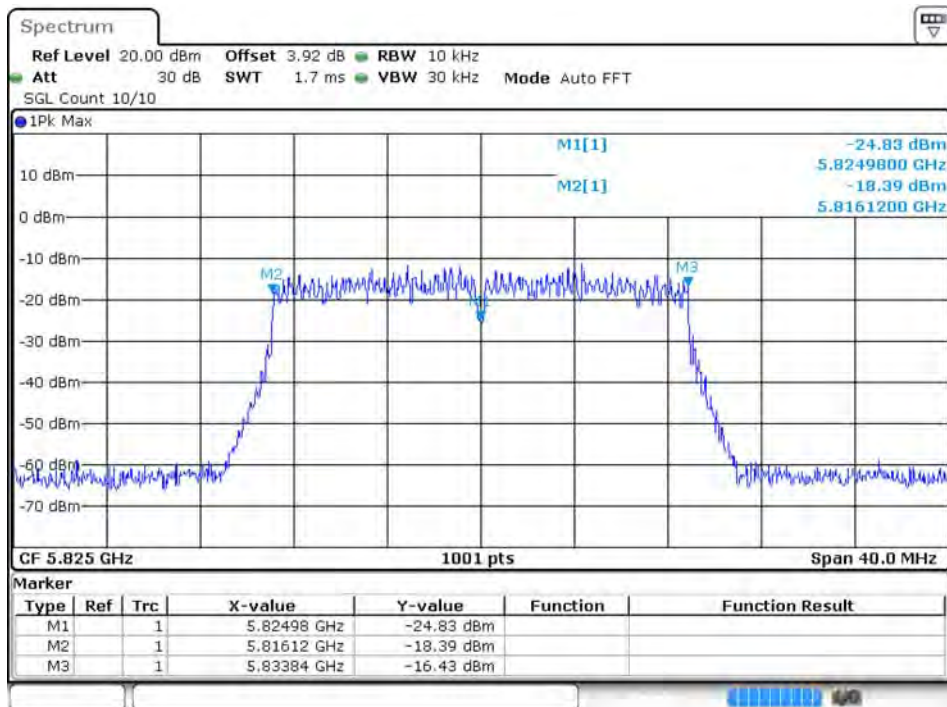


Freq. Stability 0C 120V n20 5825MHz Ant1

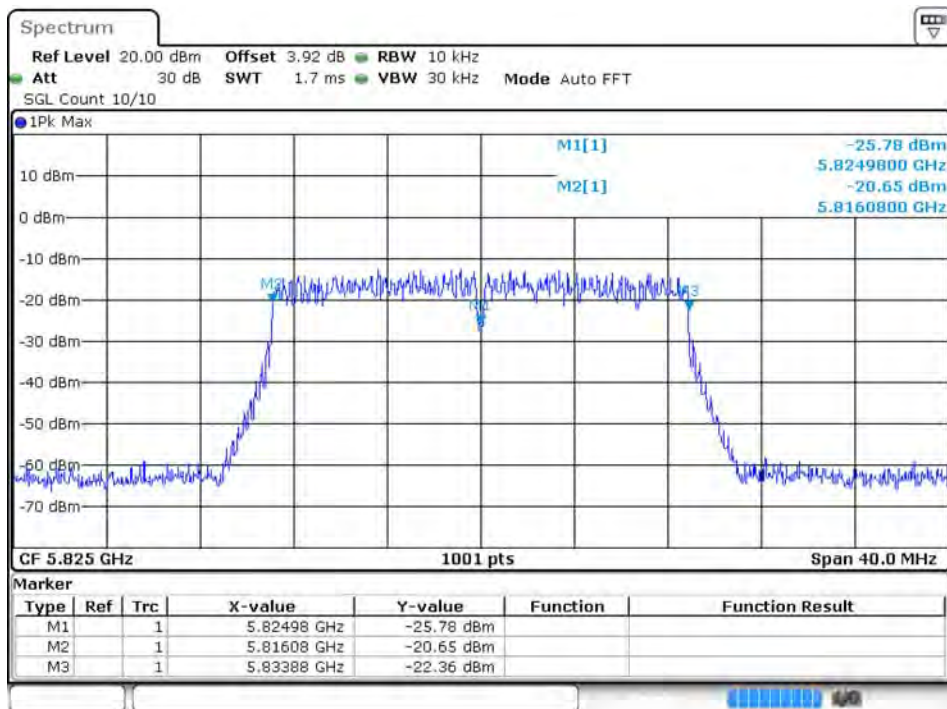


Freq. Stability 10C 120V n20 5825MHz Ant1

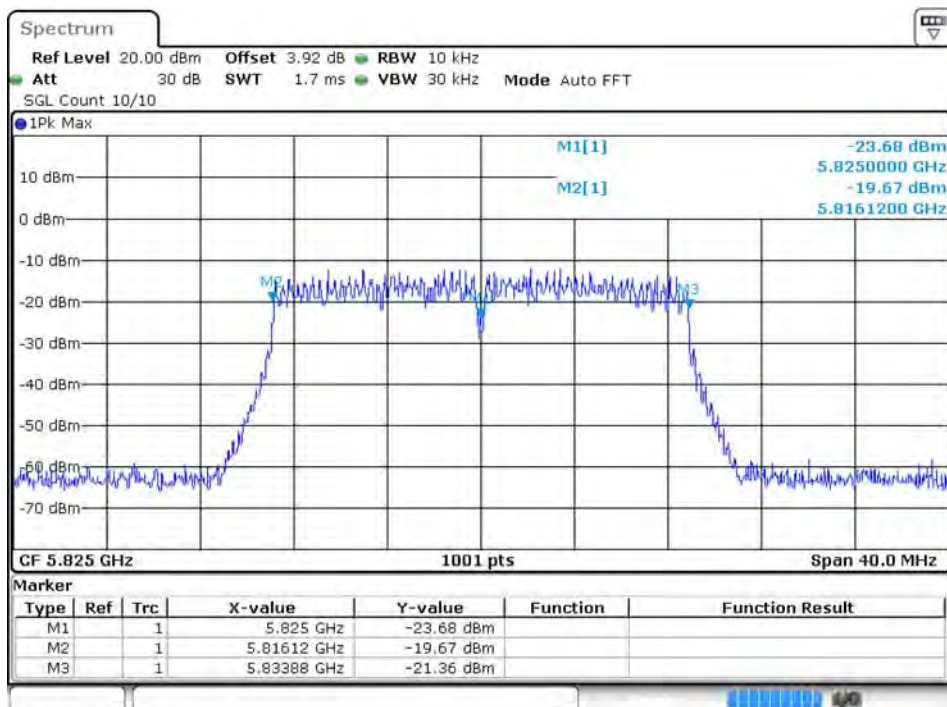

Freq. Stability 30C 120V n20 5825MHz Ant1

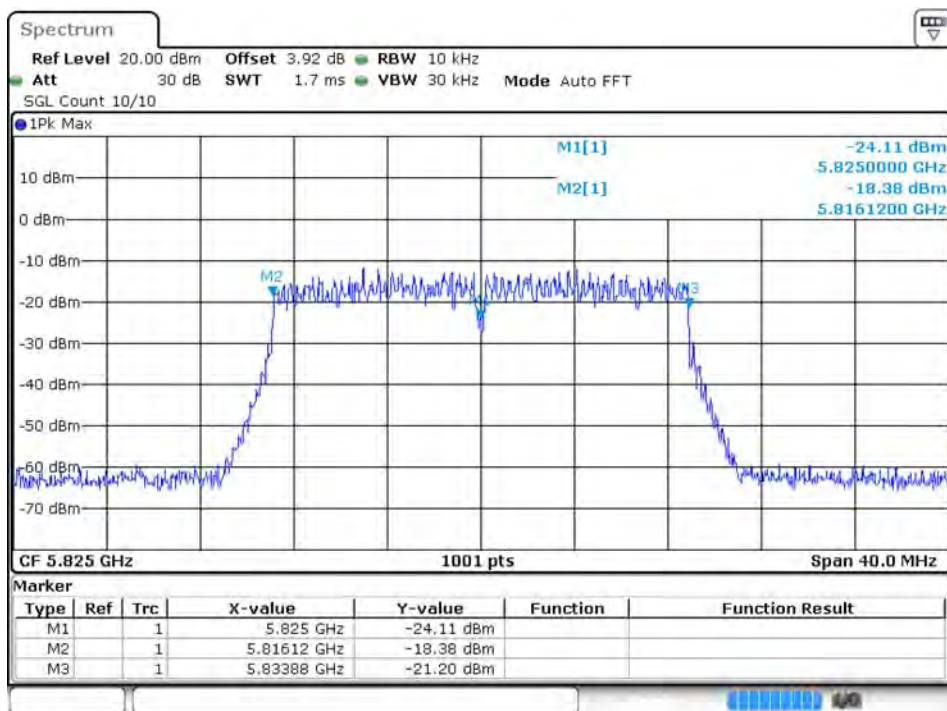

Freq. Stability 40C 120V n20 5825MHz Ant1

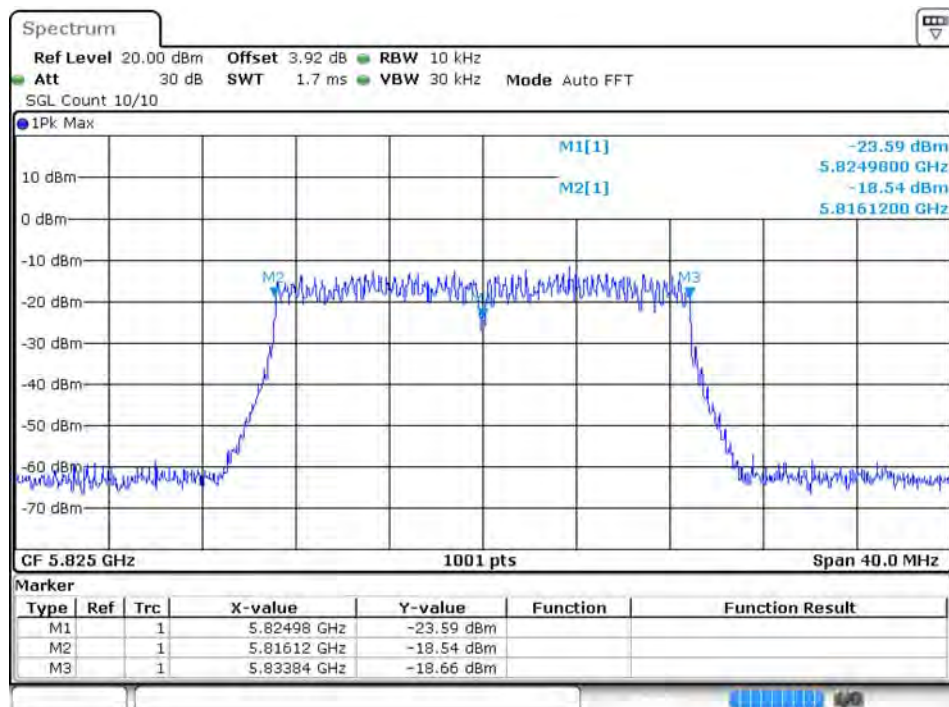

Freq. Stability 50C 120V n20 5825MHz Ant1

