




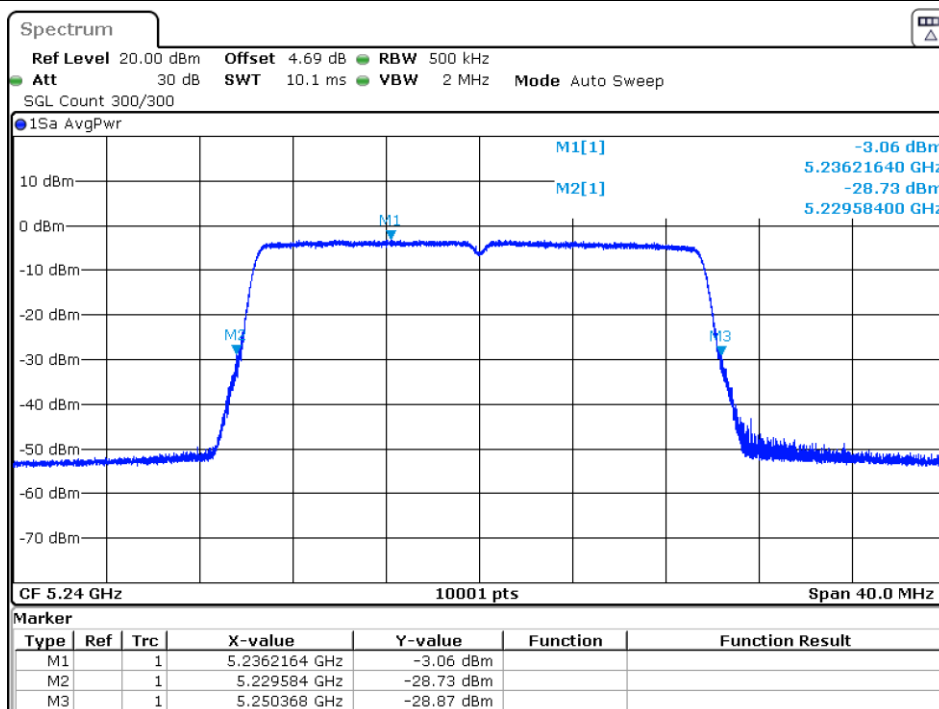


-26dB Bandwidth NVNT ax20 5240MHz Ant1

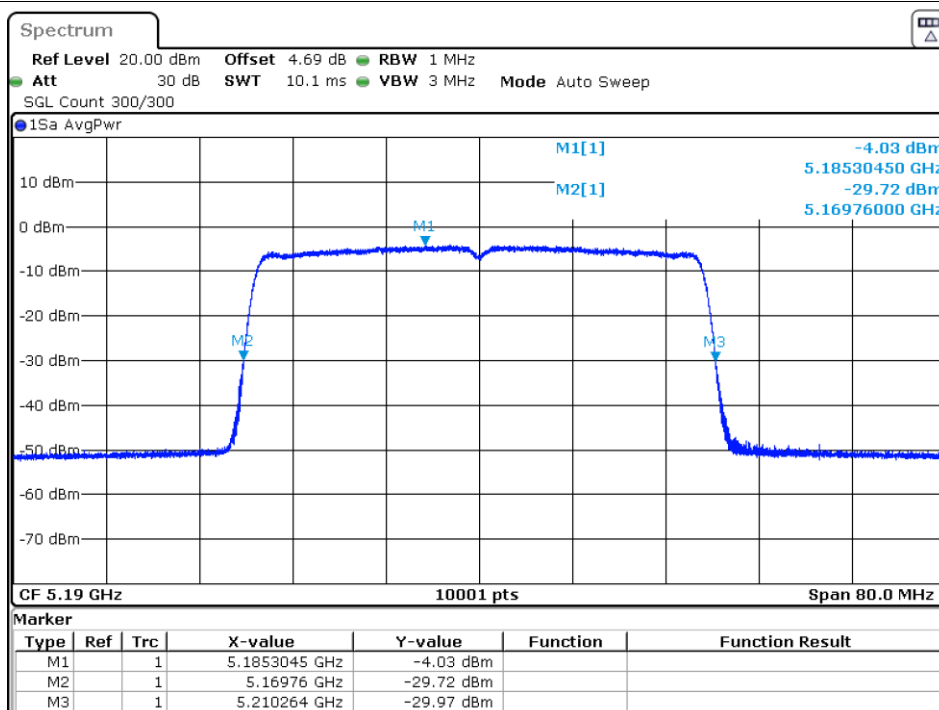

-26dB Bandwidth NVNT ax40 5190MHz Ant1

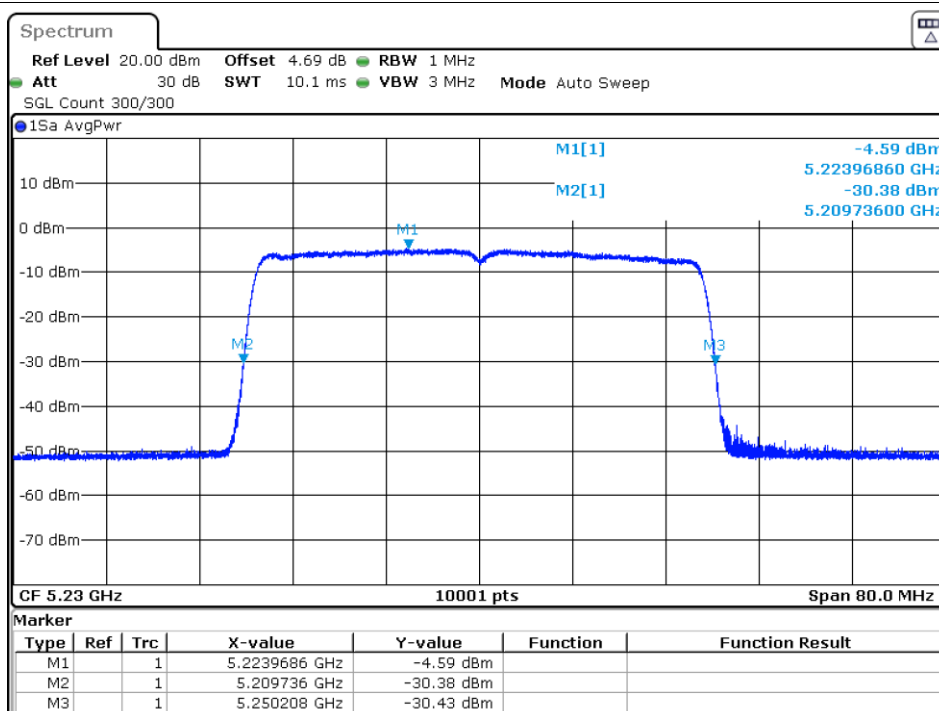


-26dB Bandwidth NVNT ax40 5230MHz Ant1

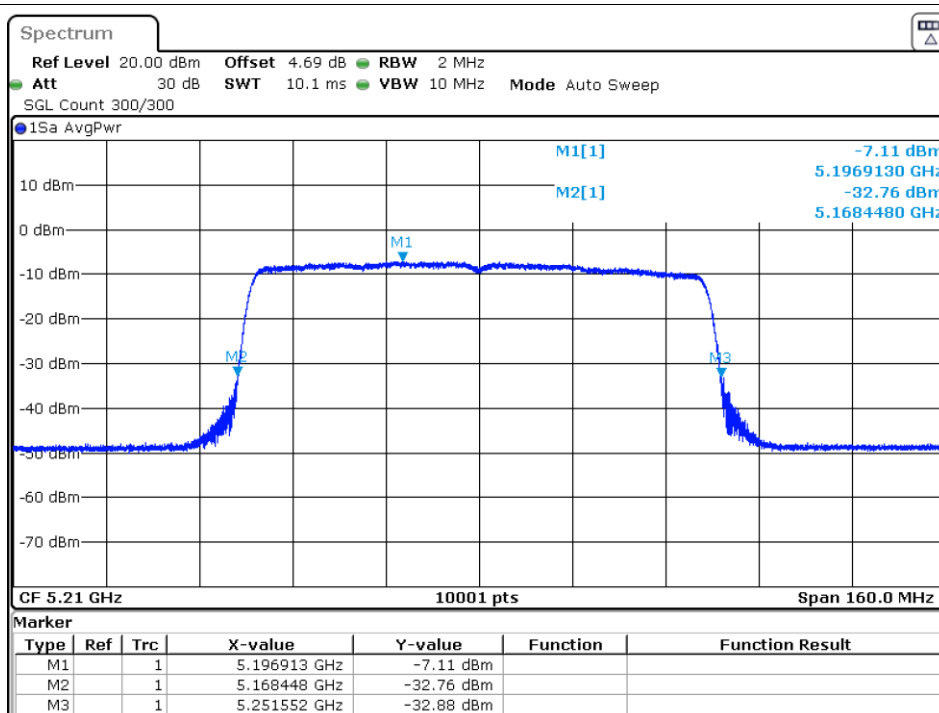


-26dB Bandwidth NVNT ax80 5210MHz Ant1

Occupied Channel Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
NVNT	a	5180	Ant1	16.594
NVNT	a	5200	Ant1	16.618
NVNT	a	5240	Ant1	16.542
NVNT	a	5745	Ant1	16.662
NVNT	a	5785	Ant1	16.606
NVNT	a	5825	Ant1	16.614
NVNT	n20	5180	Ant1	17.678
NVNT	n20	5200	Ant1	17.782
NVNT	n20	5240	Ant1	17.694
NVNT	n20	5745	Ant1	17.702
NVNT	n20	5785	Ant1	17.758
NVNT	n20	5825	Ant1	17.918
NVNT	n40	5190	Ant1	36.316
NVNT	n40	5230	Ant1	36.404
NVNT	n40	5755	Ant1	36.436
NVNT	n40	5795	Ant1	36.284
NVNT	ac20	5180	Ant1	17.798
NVNT	ac20	5200	Ant1	17.786
NVNT	ac20	5240	Ant1	17.75
NVNT	ac20	5745	Ant1	17.886
NVNT	ac20	5785	Ant1	17.838
NVNT	ac20	5825	Ant1	17.686
NVNT	ac40	5190	Ant1	36.396
NVNT	ac40	5230	Ant1	36.404
NVNT	ac40	5755	Ant1	36.34
NVNT	ac40	5795	Ant1	36.356
NVNT	ac80	5210	Ant1	75.688
NVNT	ac80	5775	Ant1	75.832
NVNT	ax20	5180	Ant1	18.994
NVNT	ax20	5200	Ant1	19.162
NVNT	ax20	5240	Ant1	18.93
NVNT	ax20	5745	Ant1	19.014
NVNT	ax20	5785	Ant1	19.03
NVNT	ax20	5825	Ant1	18.974
NVNT	ax40	5190	Ant1	37.724
NVNT	ax40	5230	Ant1	37.692
NVNT	ax40	5755	Ant1	37.732
NVNT	ax40	5795	Ant1	37.652
NVNT	ax80	5210	Ant1	77.384
NVNT	ax80	5775	Ant1	77.432

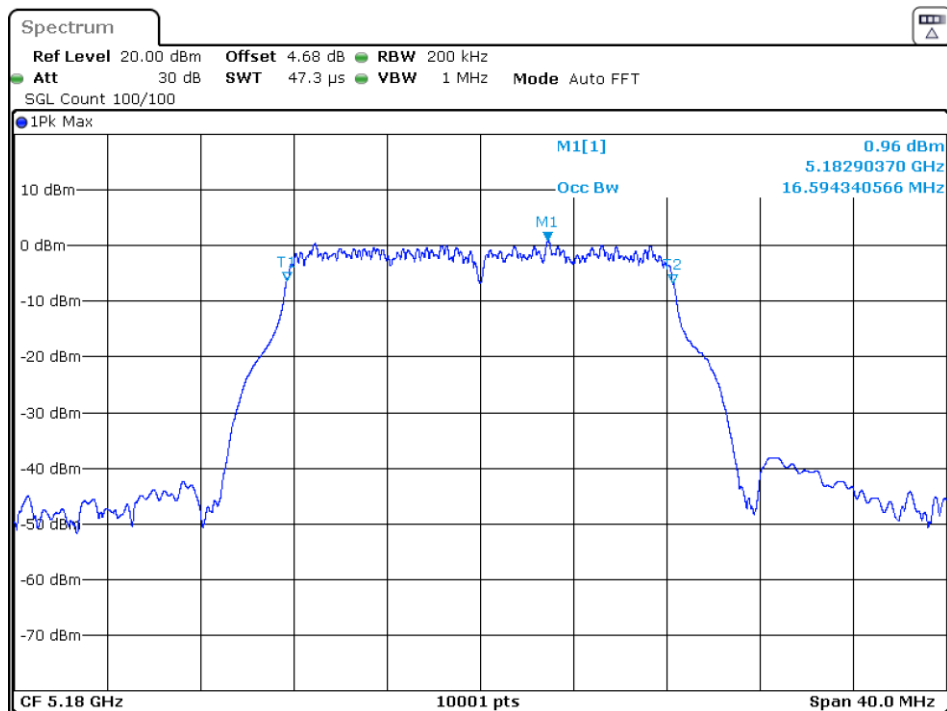


OBW NVNT a 5180MHz Ant1

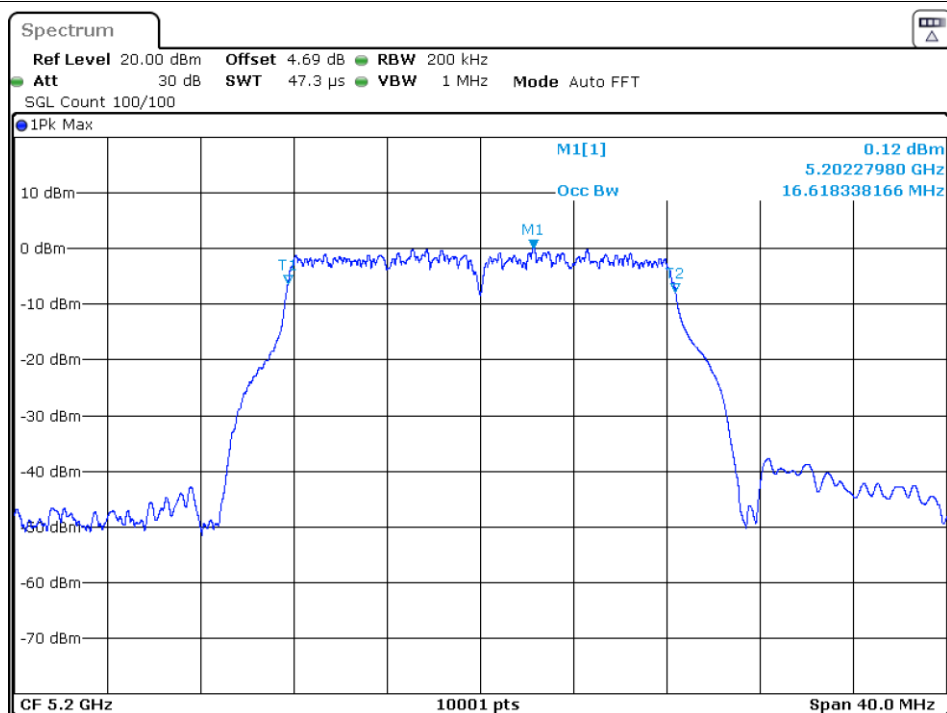


OBW NVNT a 5200MHz Ant1

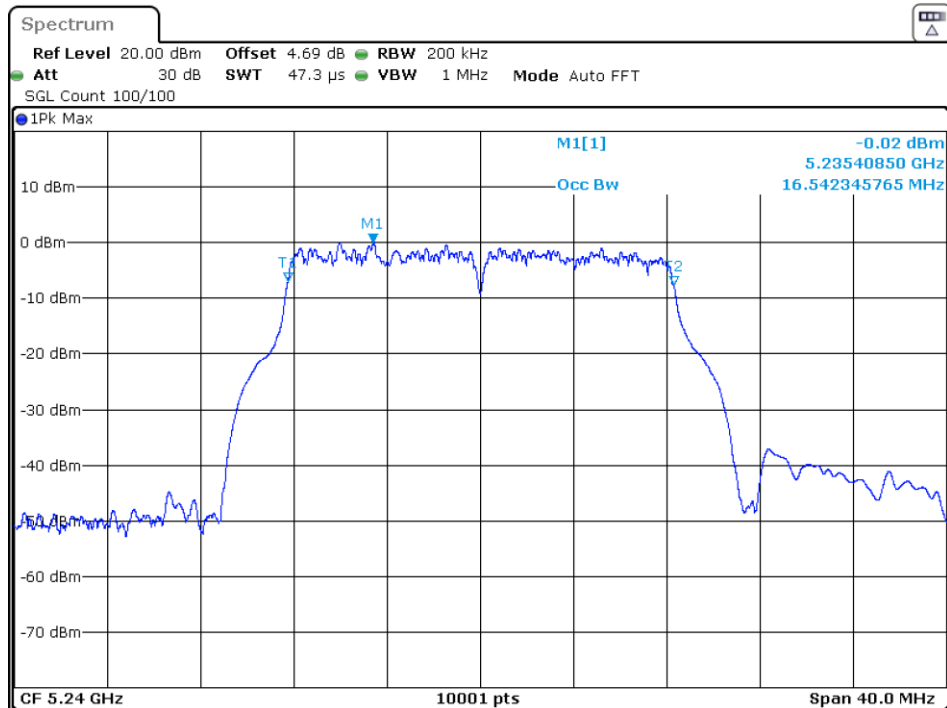


OBW NVNT a 5240MHz Ant1

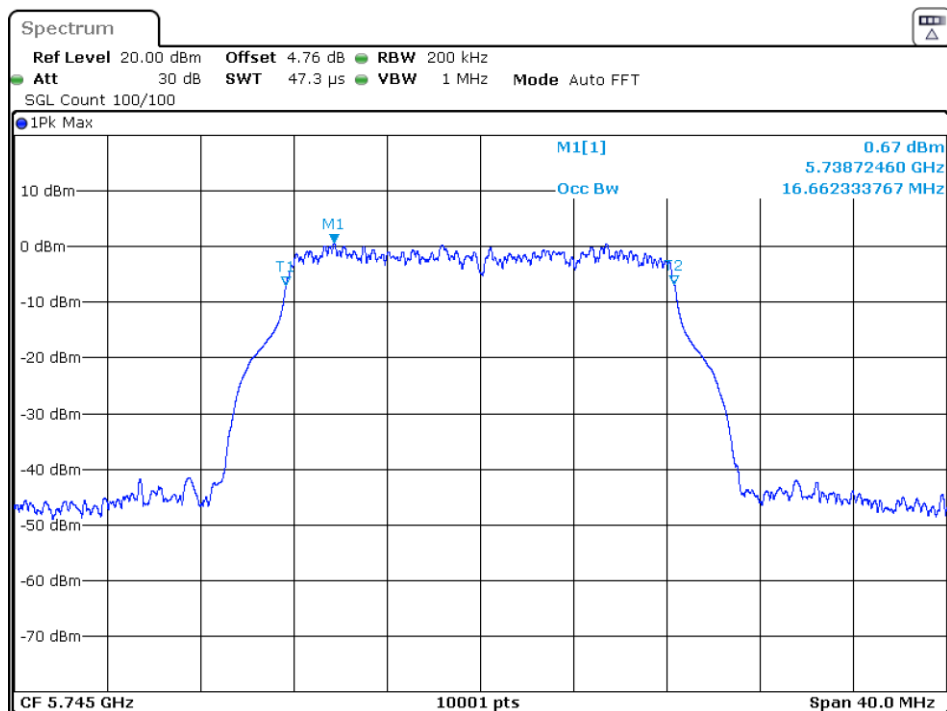


OBW NVNT a 5745MHz Ant1

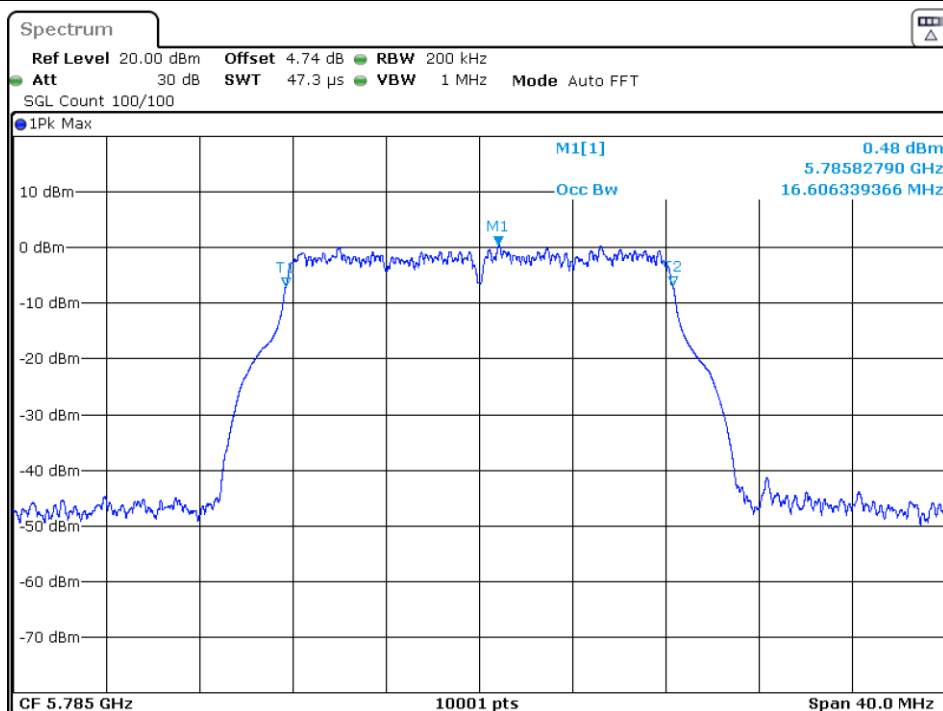


OBW NVNT a 5785MHz Ant1

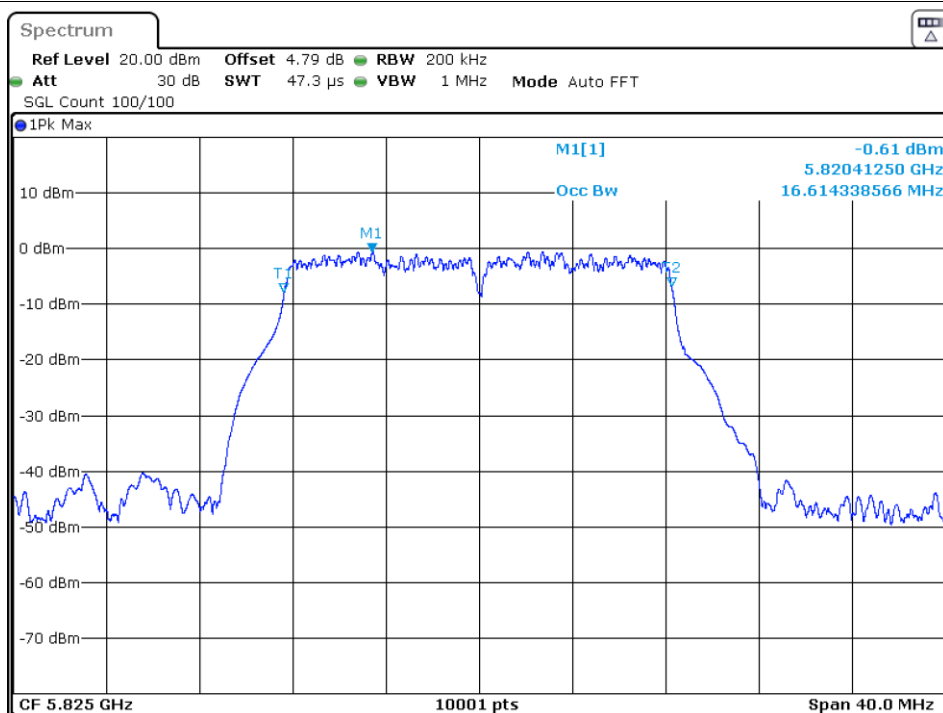


OBW NVNT a 5825MHz Ant1

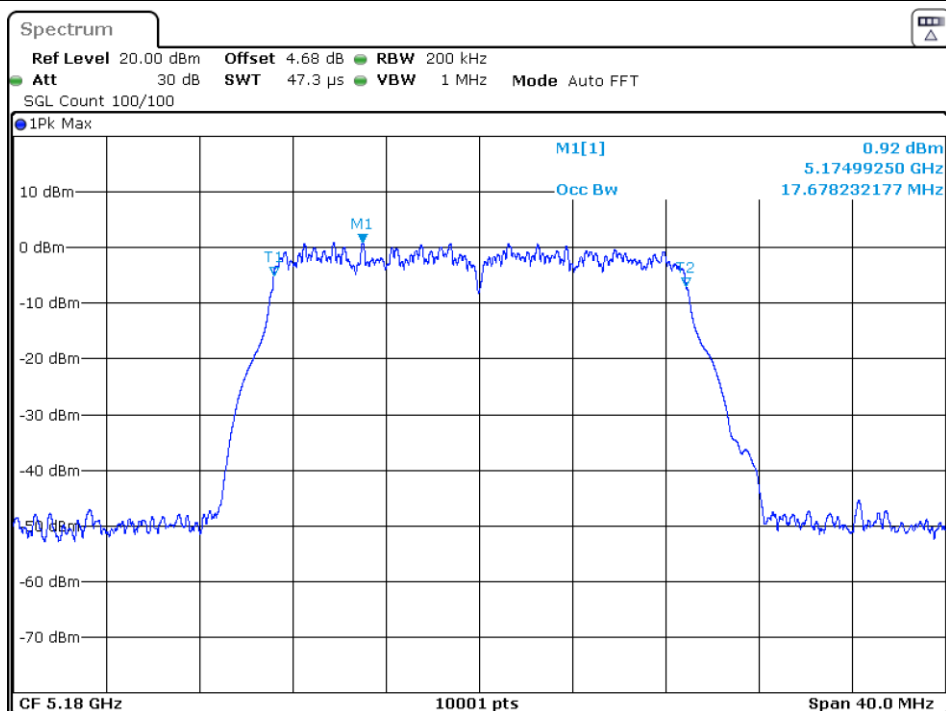


OBW NVNT n20 5180MHz Ant1

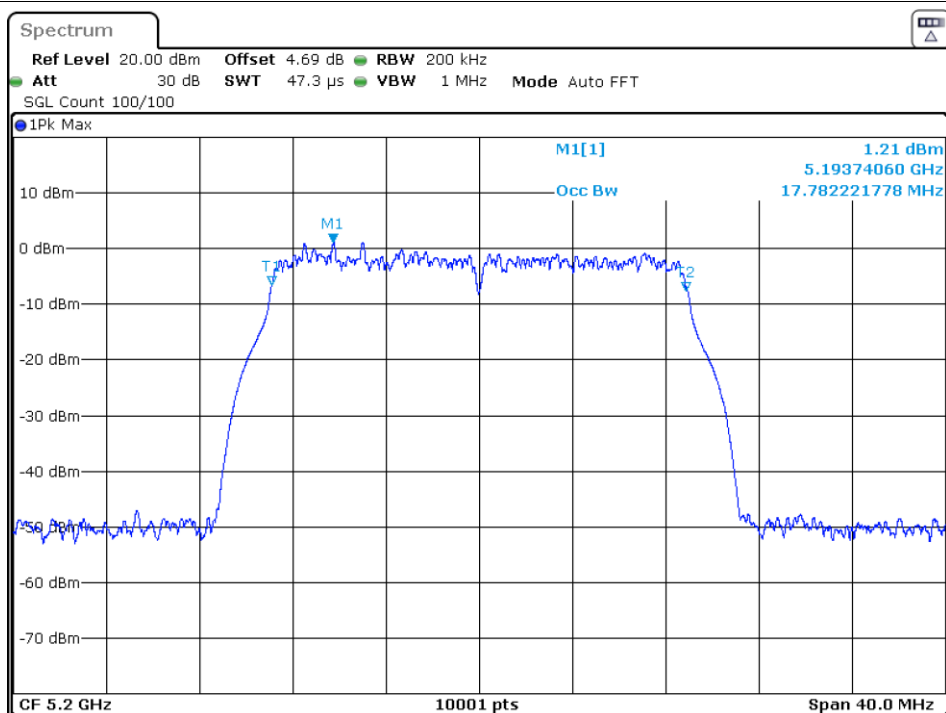


OBW NVNT n20 5200MHz Ant1

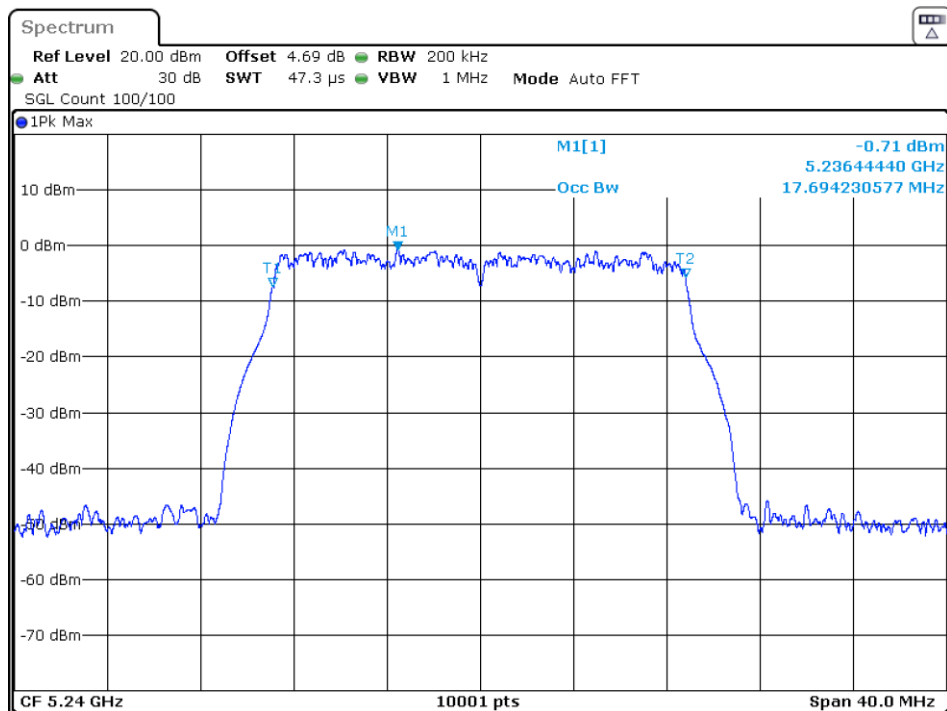


OBW NVNT n20 5240MHz Ant1

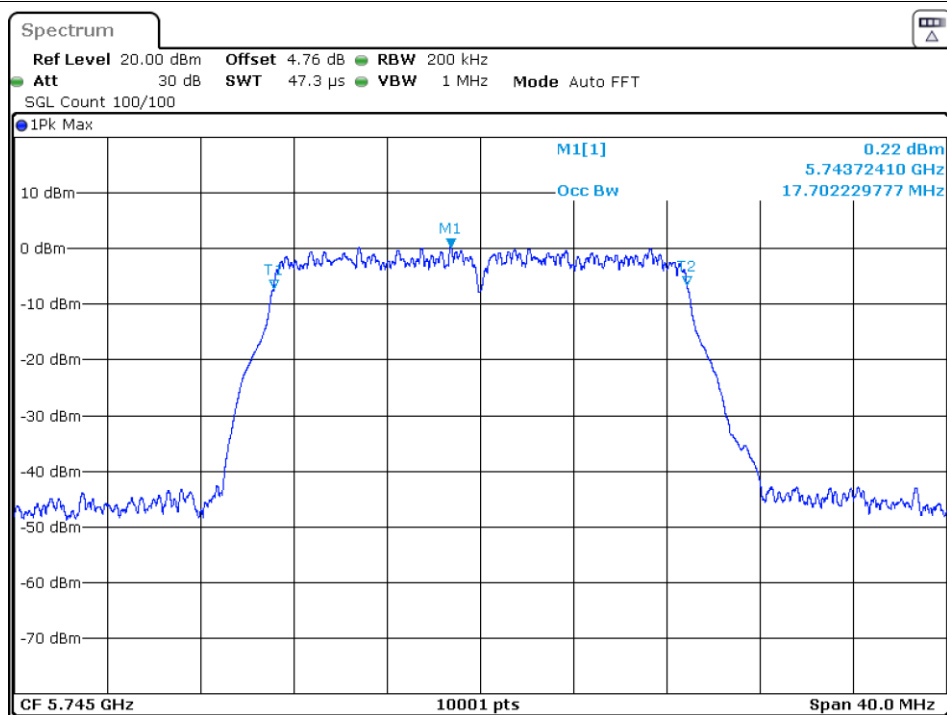


OBW NVNT n20 5745MHz Ant1

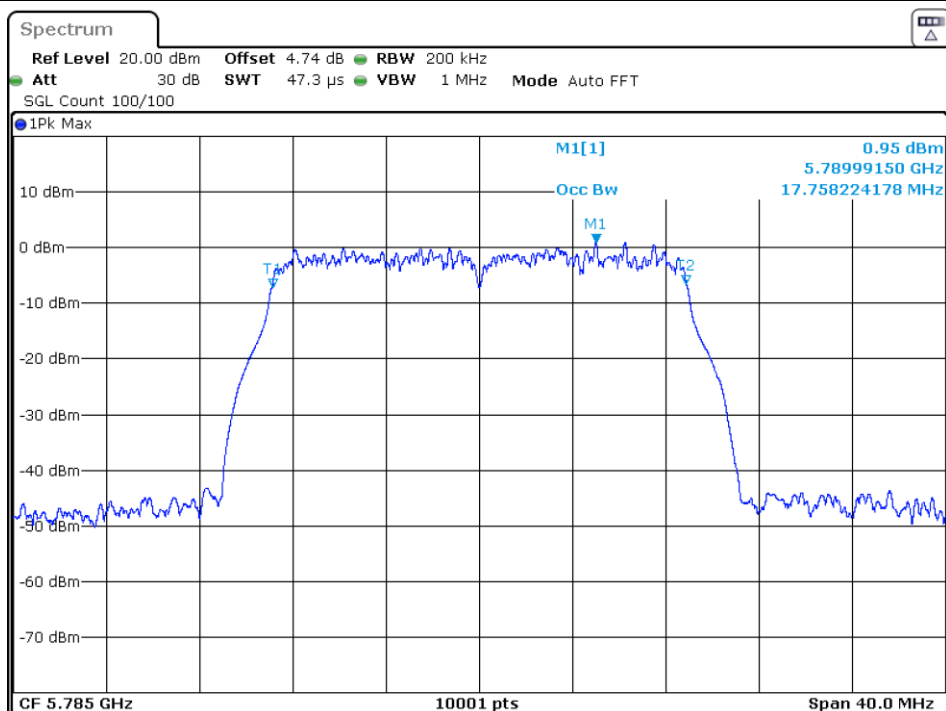


OBW NVNT n20 5785MHz Ant1

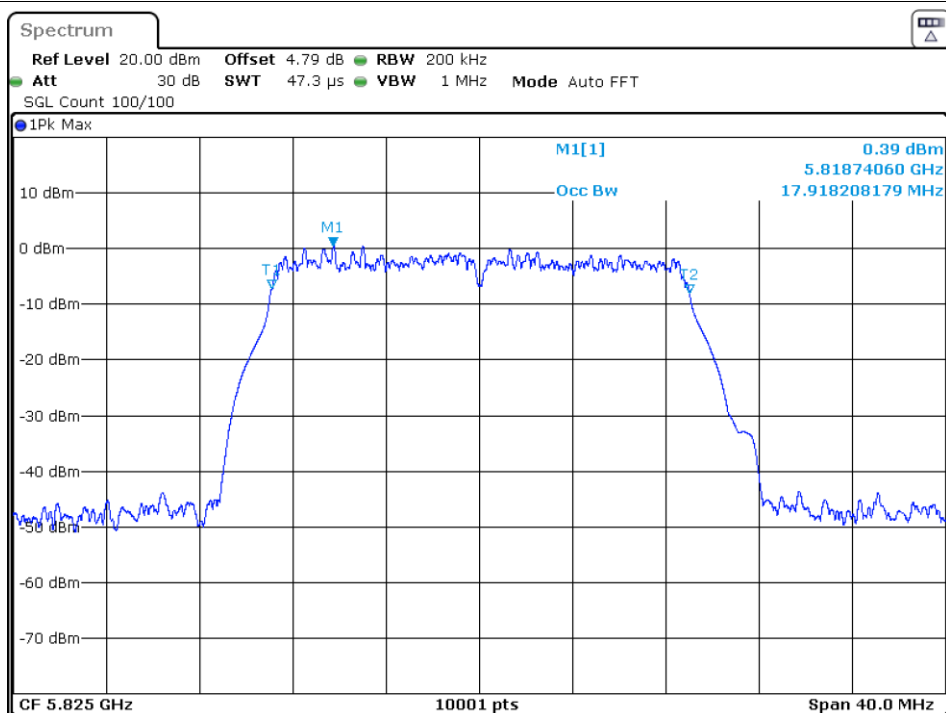


OBW NVNT n20 5825MHz Ant1

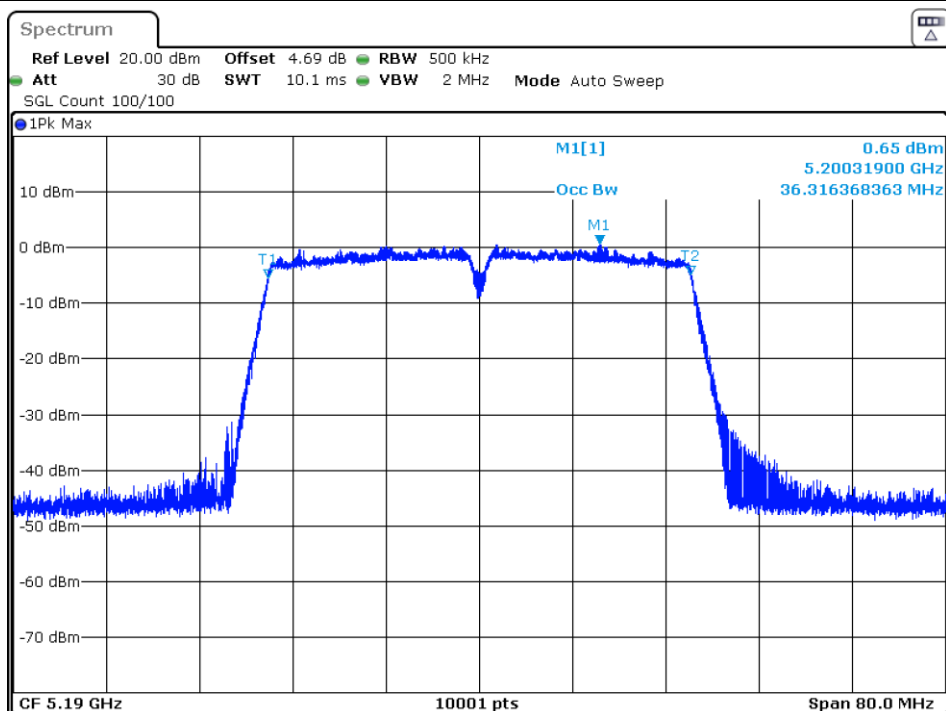


OBW NVNT n40 5190MHz Ant1

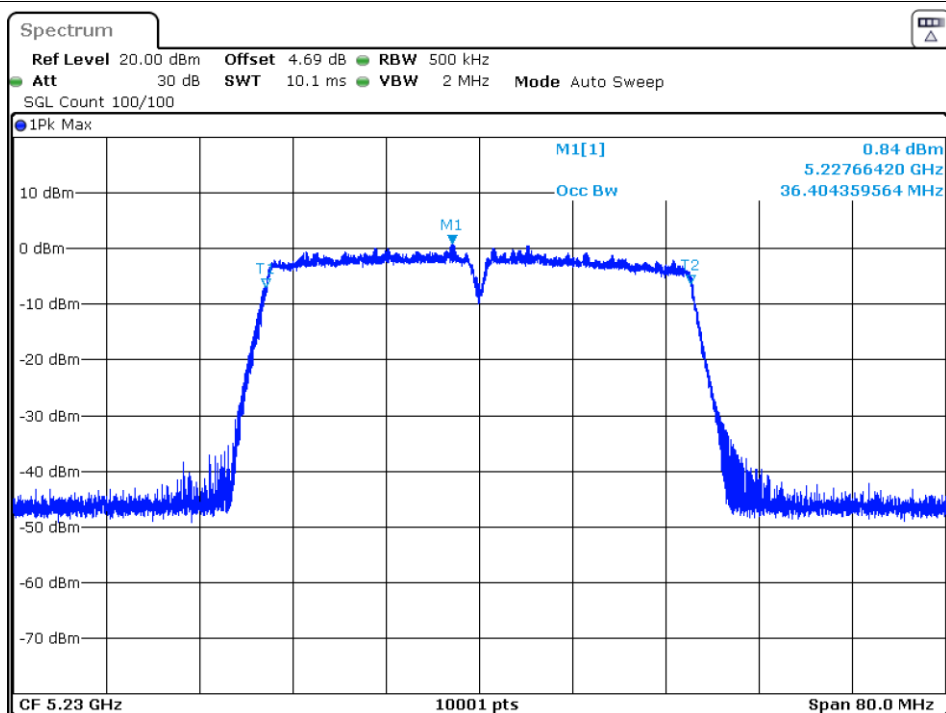


OBW NVNT n40 5230MHz Ant1

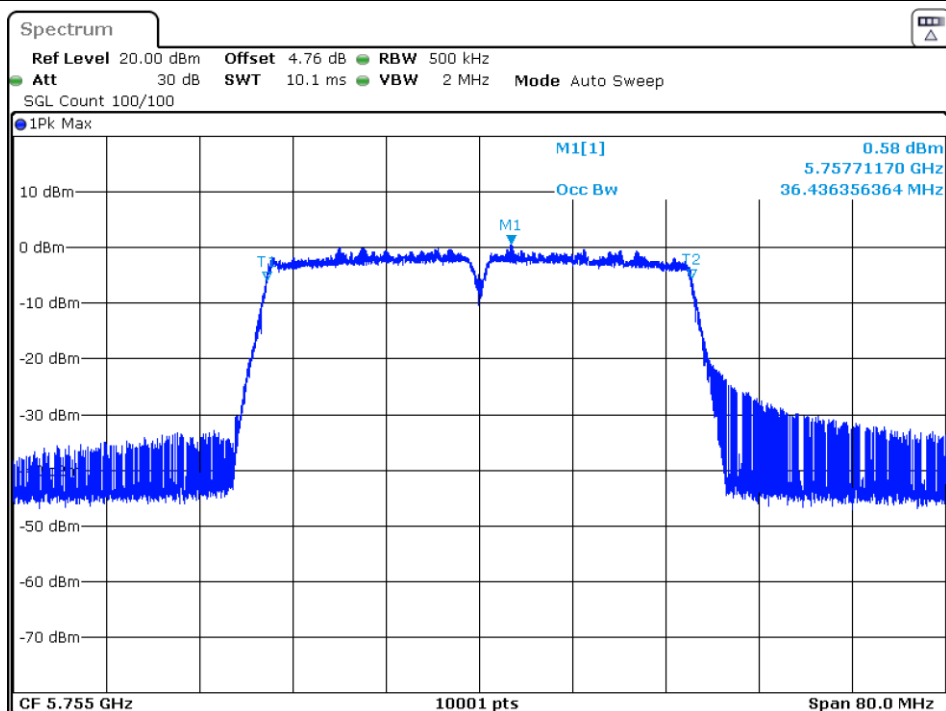


OBW NVNT n40 5755MHz Ant1

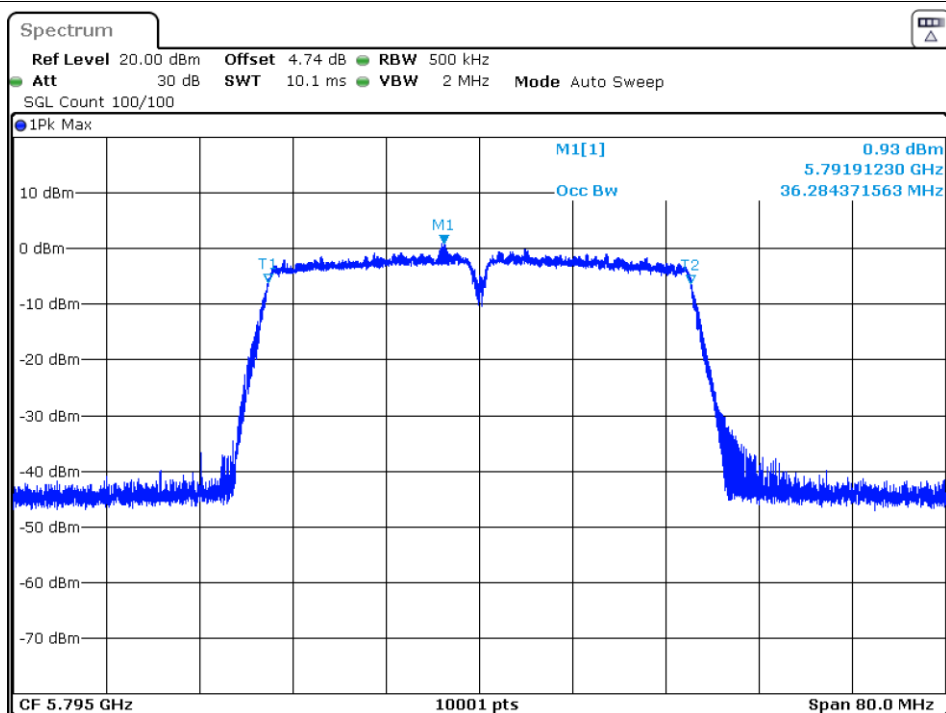


OBW NVNT n40 5795MHz Ant1

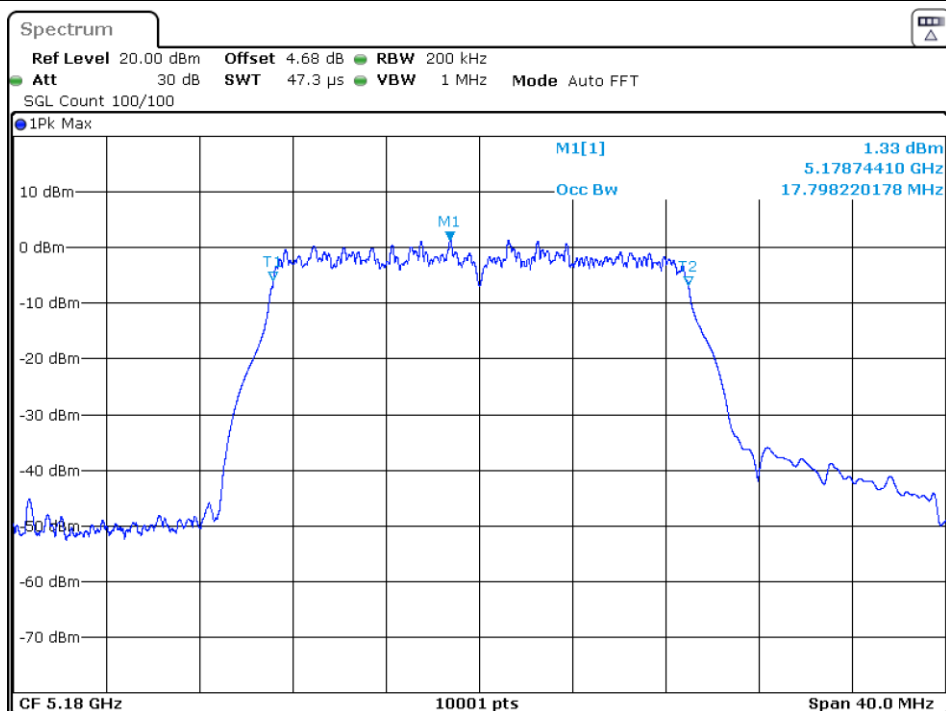


OBW NVNT ac20 5180MHz Ant1

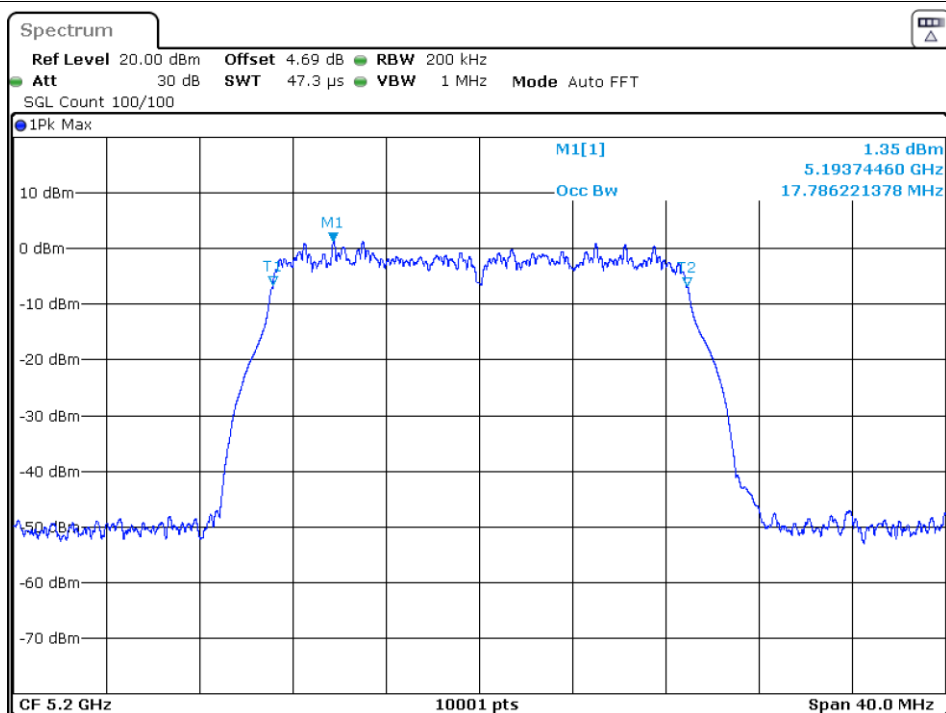


OBW NVNT ac20 5200MHz Ant1

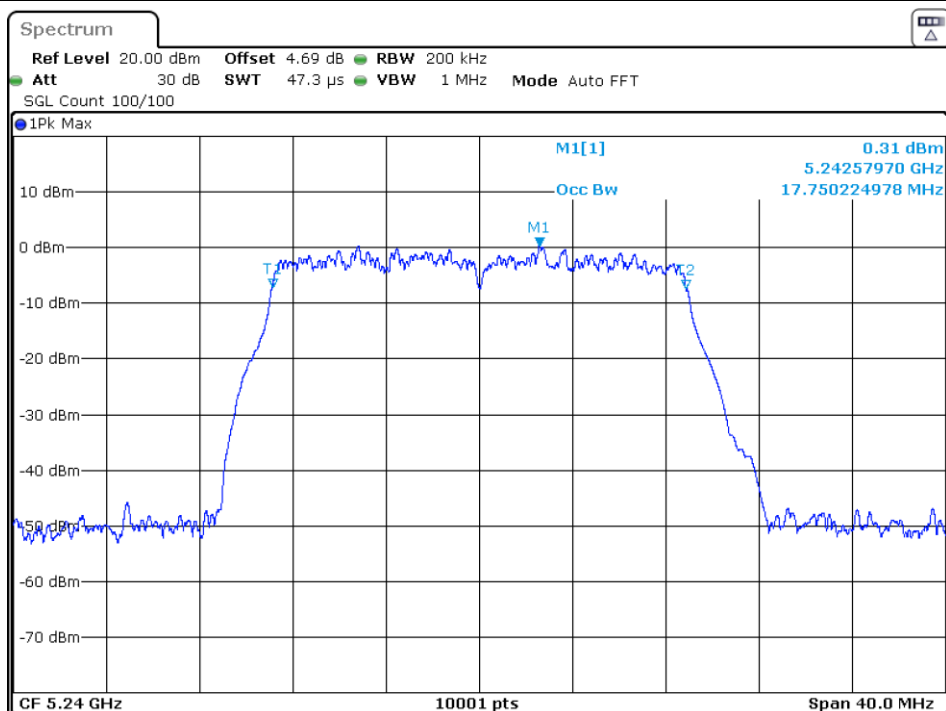


OBW NVNT ac20 5240MHz Ant1

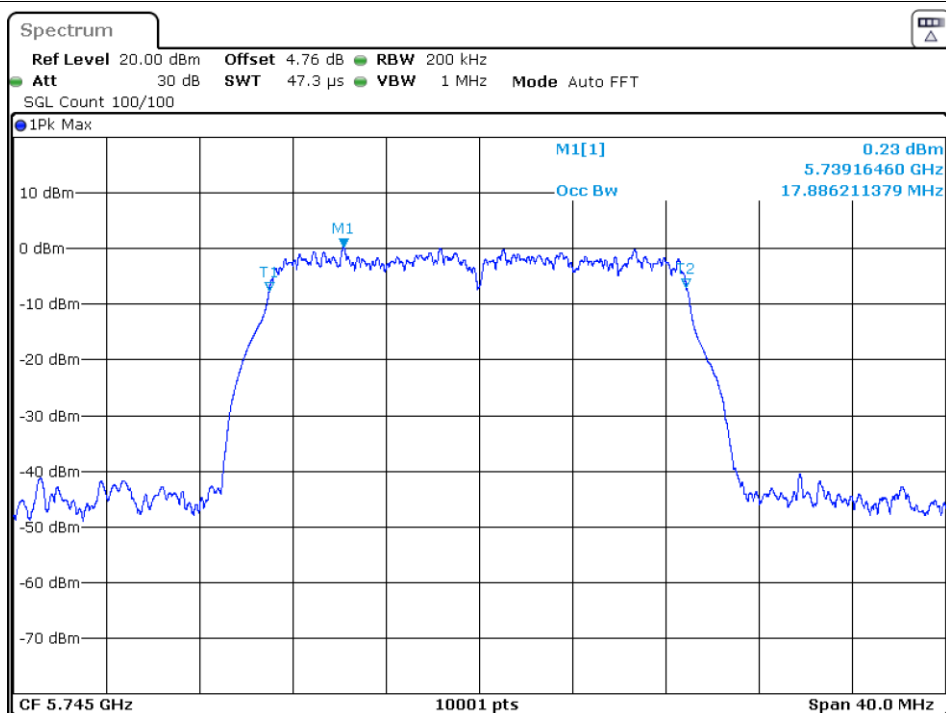


OBW NVNT ac20 5745MHz Ant1

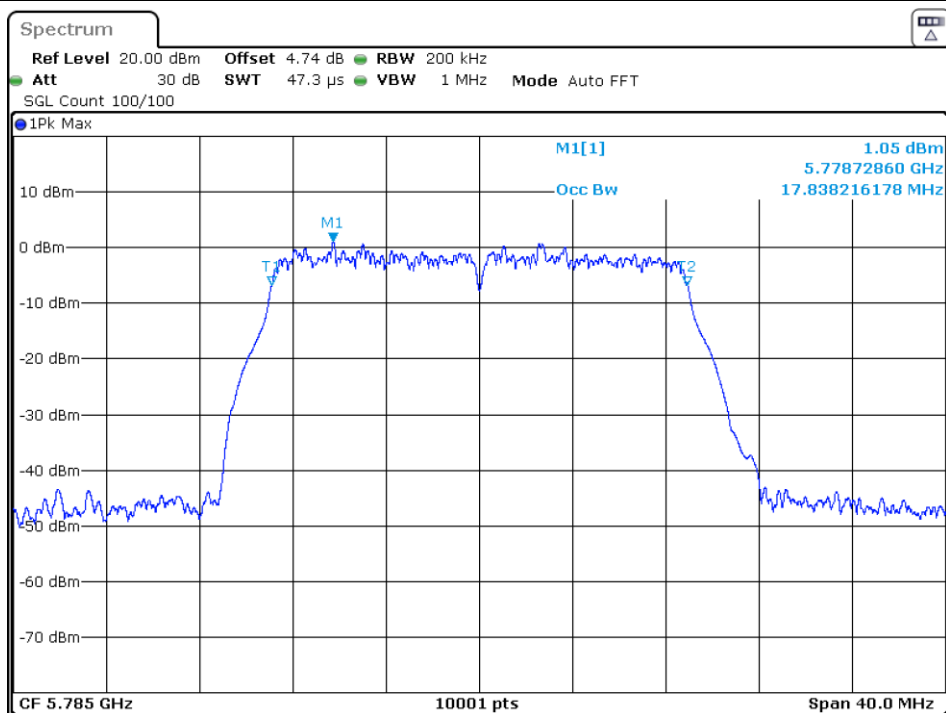


OBW NVNT ac20 5785MHz Ant1

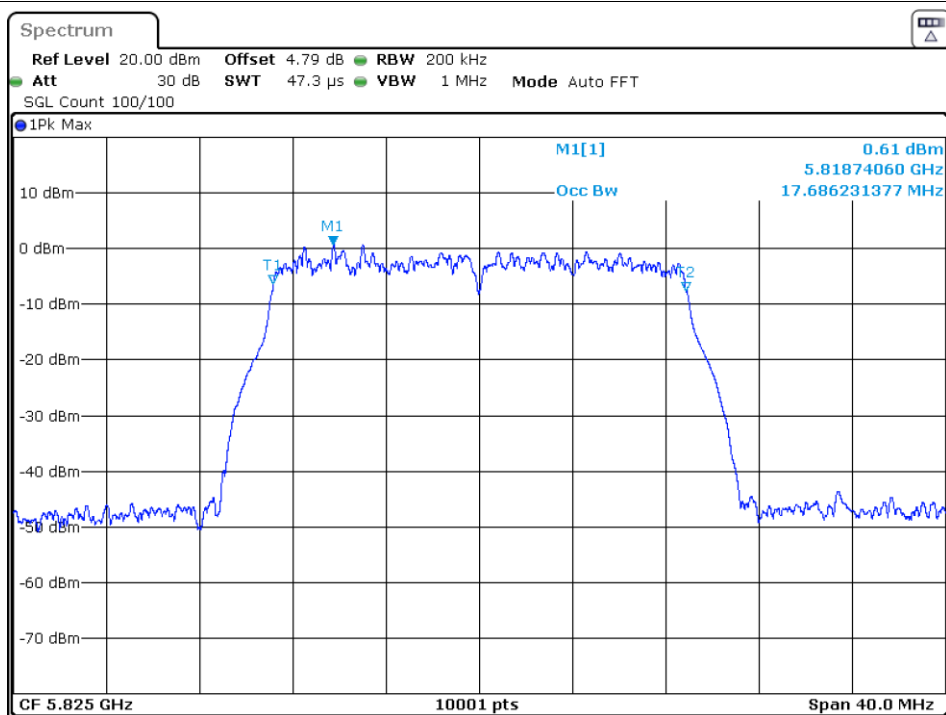


OBW NVNT ac20 5825MHz Ant1

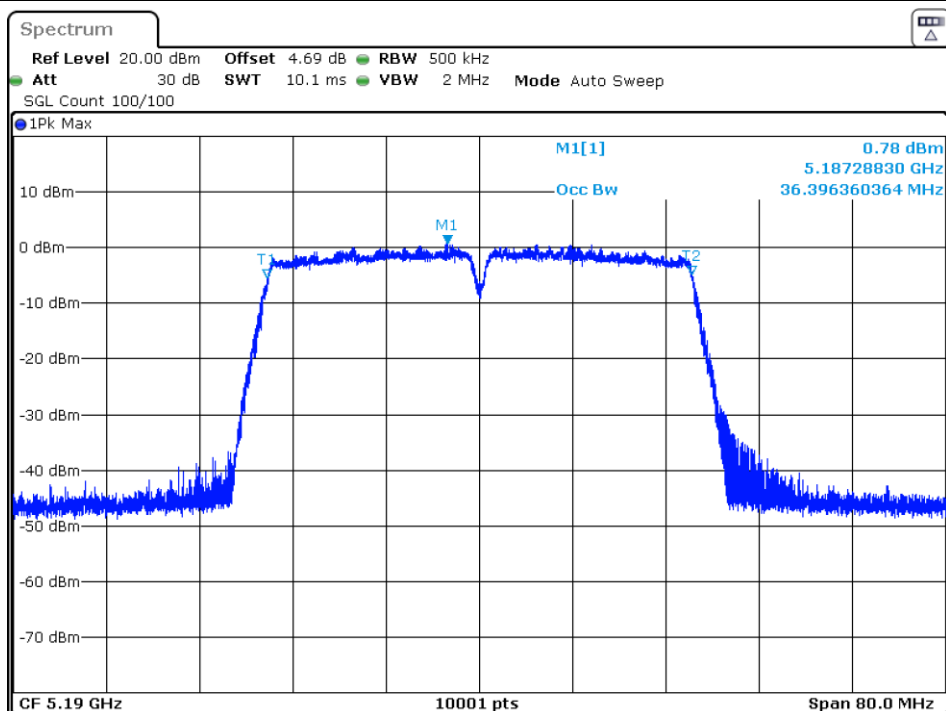


OBW NVNT ac40 5190MHz Ant1

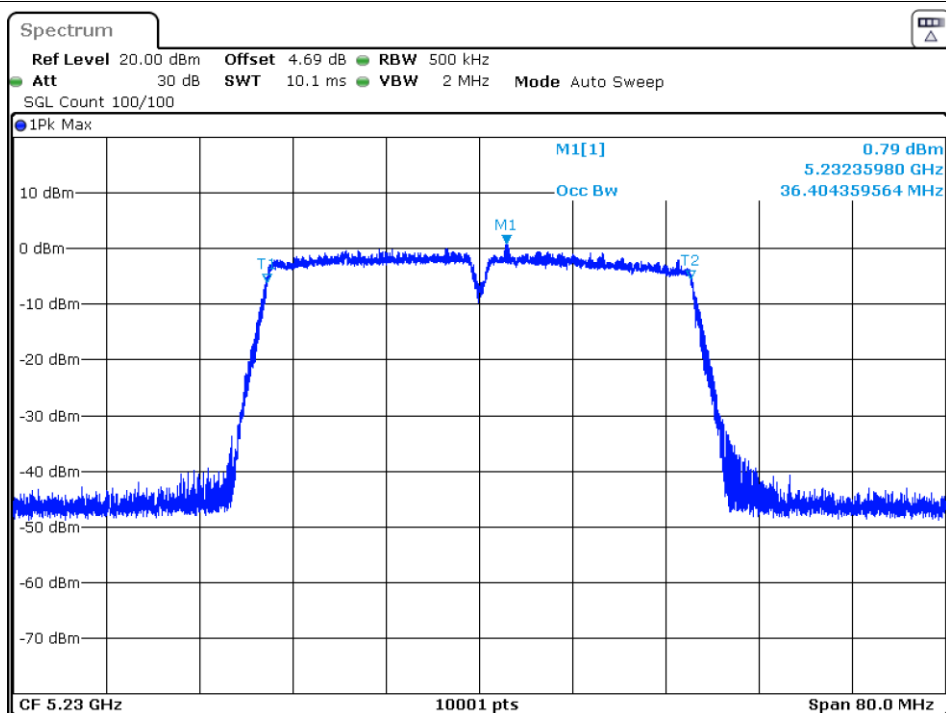


OBW NVNT ac40 5230MHz Ant1

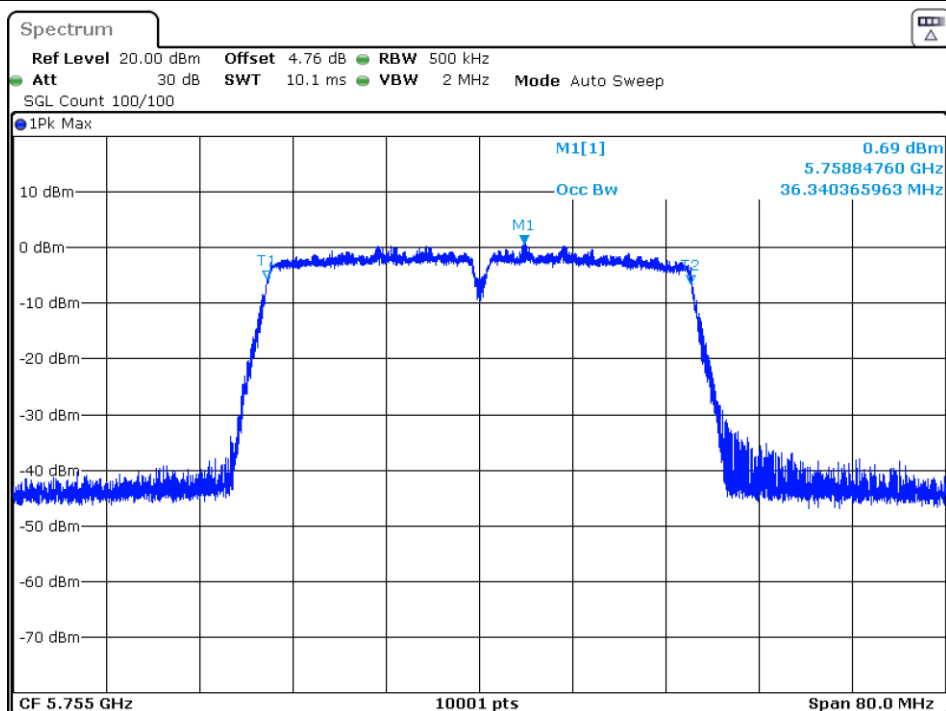


OBW NVNT ac40 5755MHz Ant1

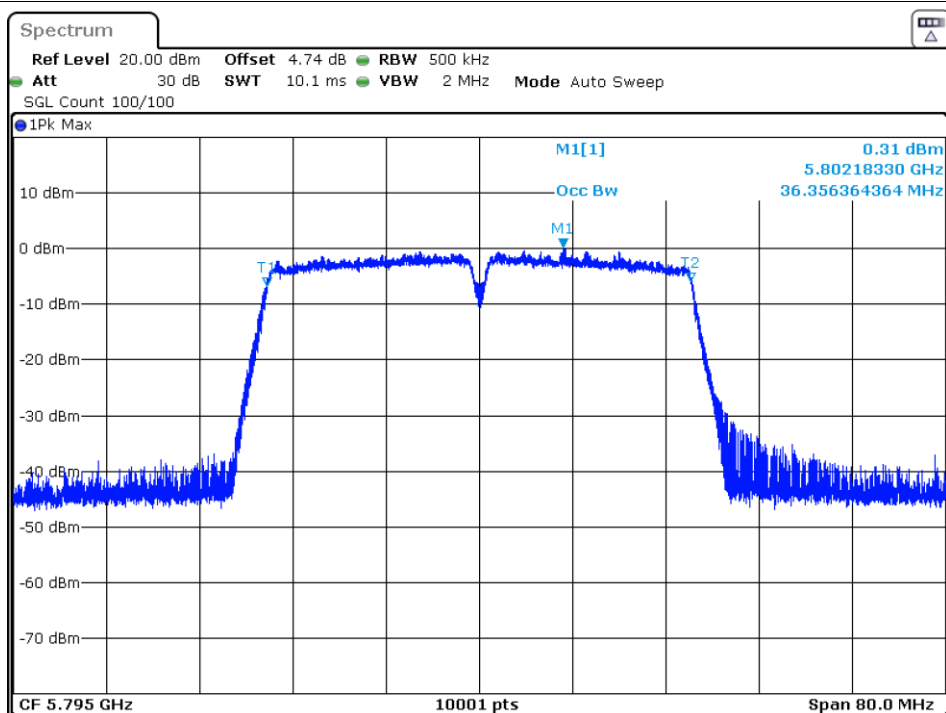


OBW NVNT ac40 5795MHz Ant1

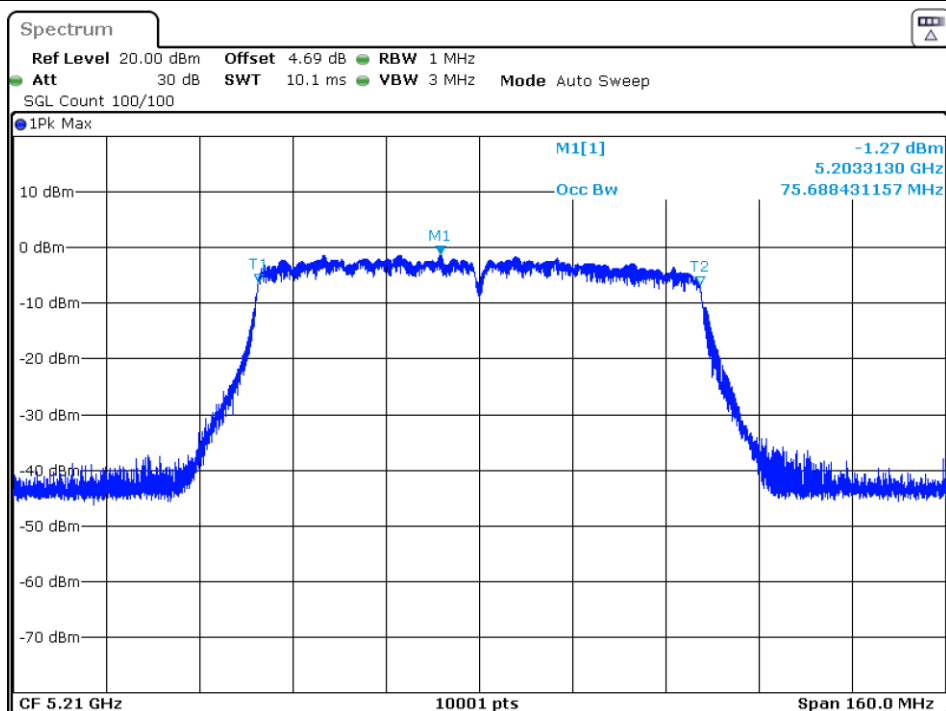


OBW NVNT ac80 5210MHz Ant1

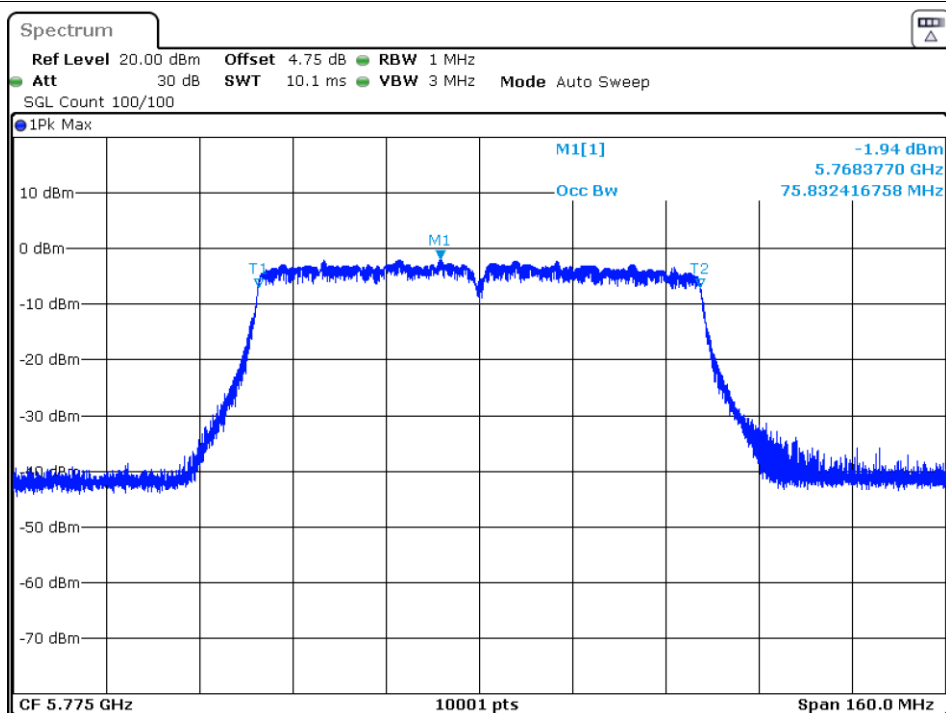


OBW NVNT ac80 5775MHz Ant1

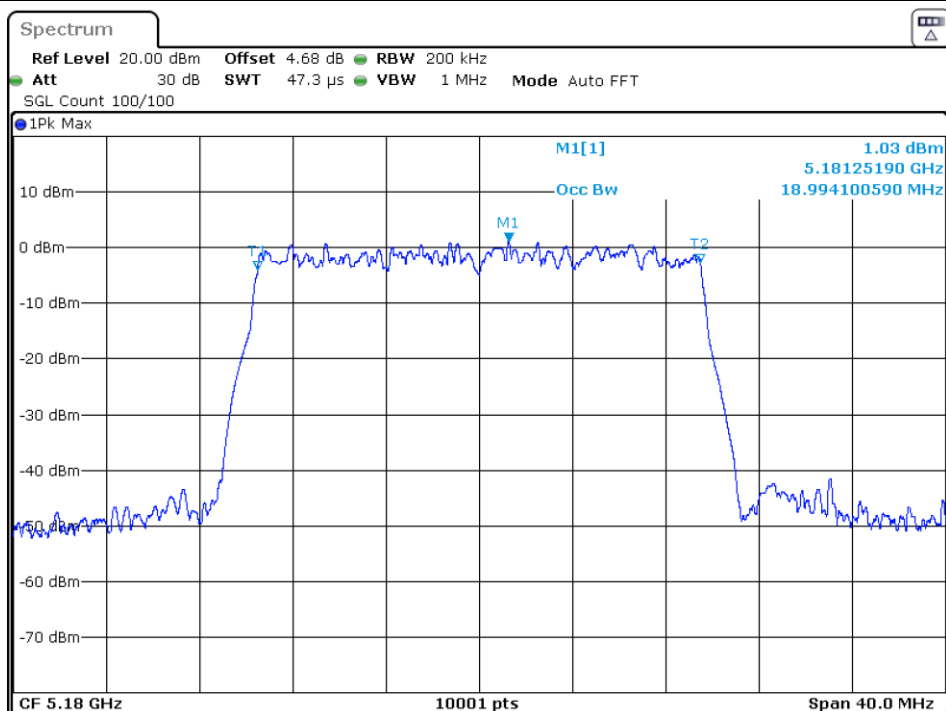


OBW NVNT ax20 5180MHz Ant1

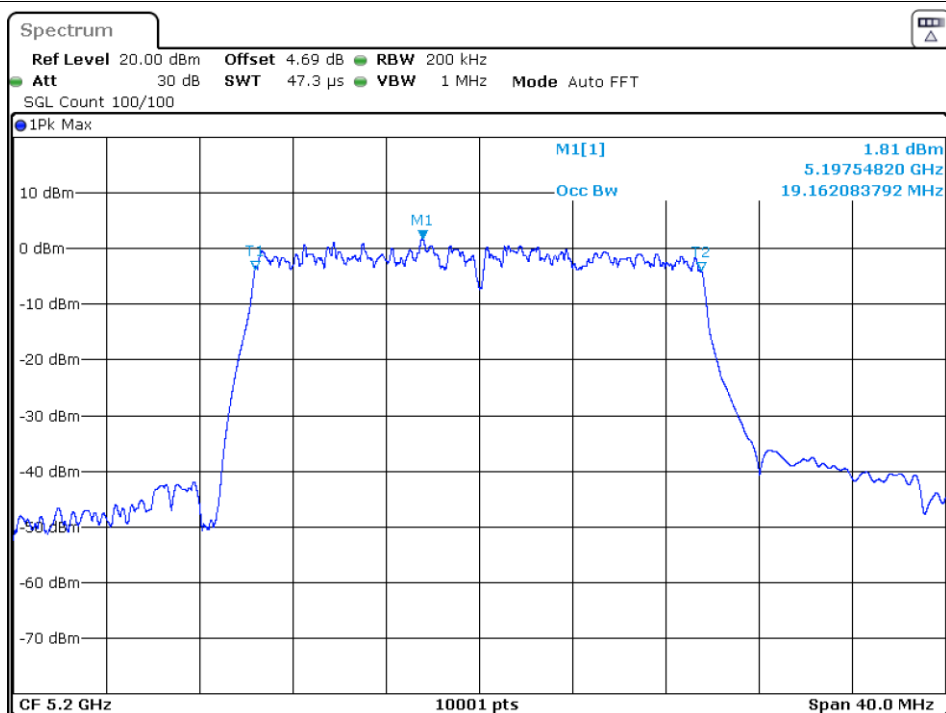


OBW NVNT ax20 5200MHz Ant1

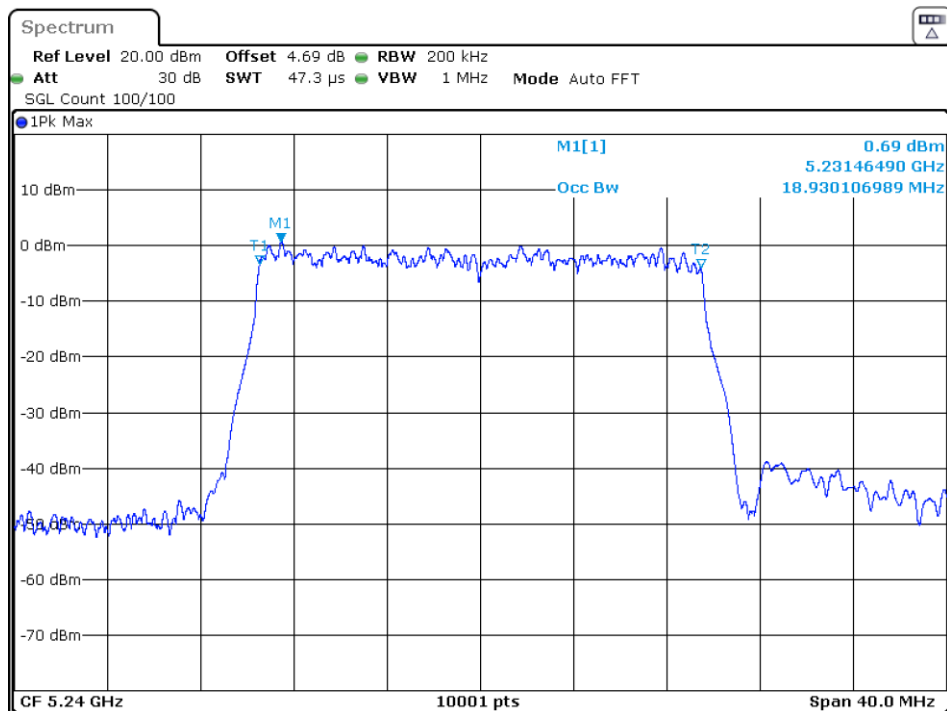


OBW NVNT ax20 5240MHz Ant1

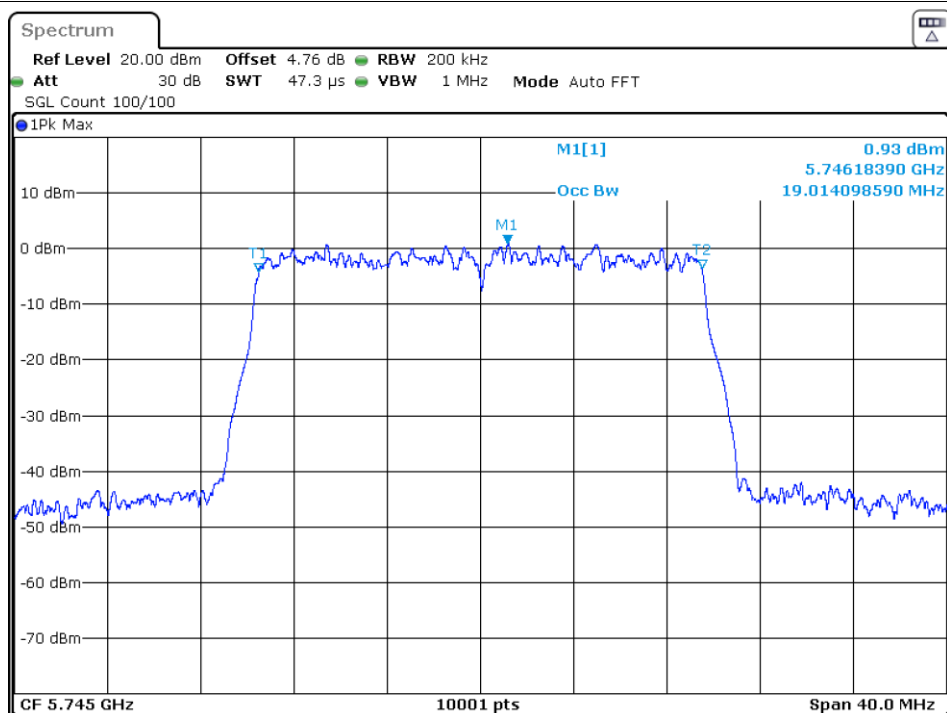


OBW NVNT ax20 5745MHz Ant1

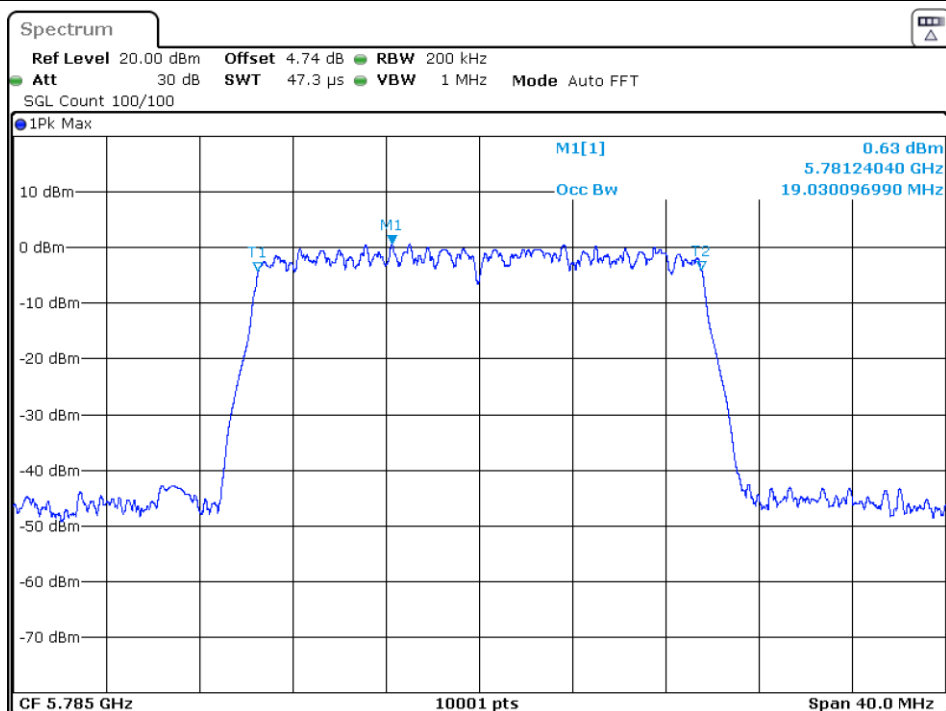


OBW NVNT ax20 5785MHz Ant1

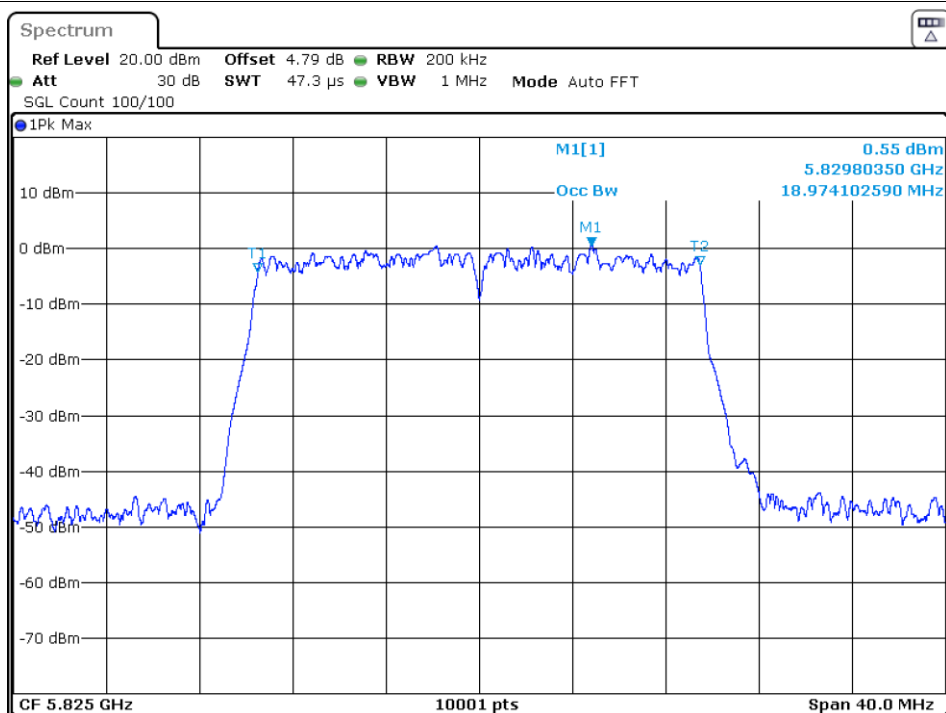


OBW NVNT ax20 5825MHz Ant1

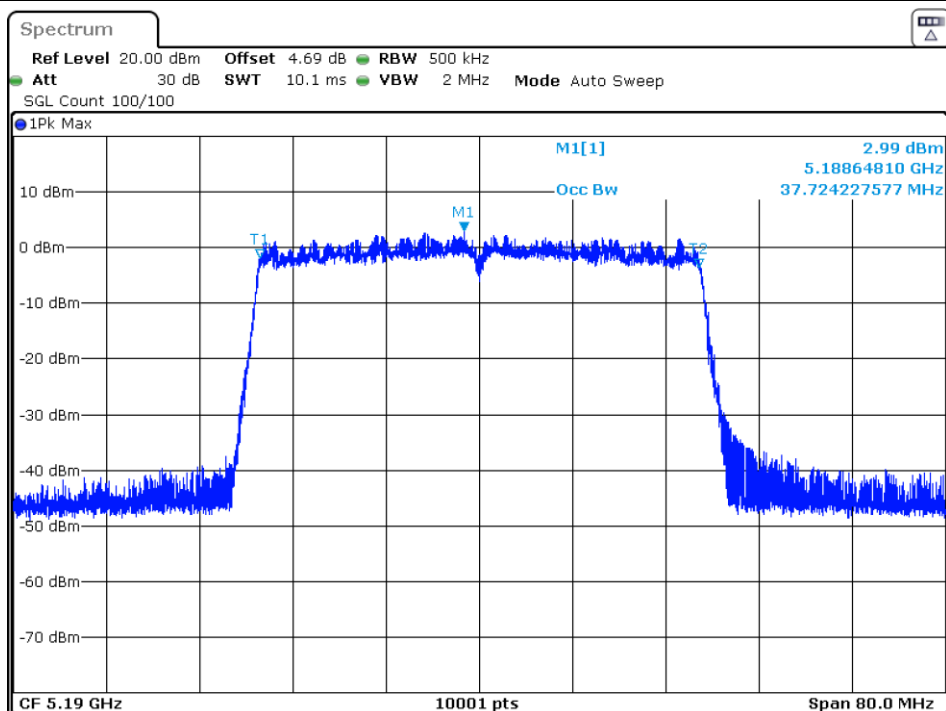


OBW NVNT ax40 5190MHz Ant1

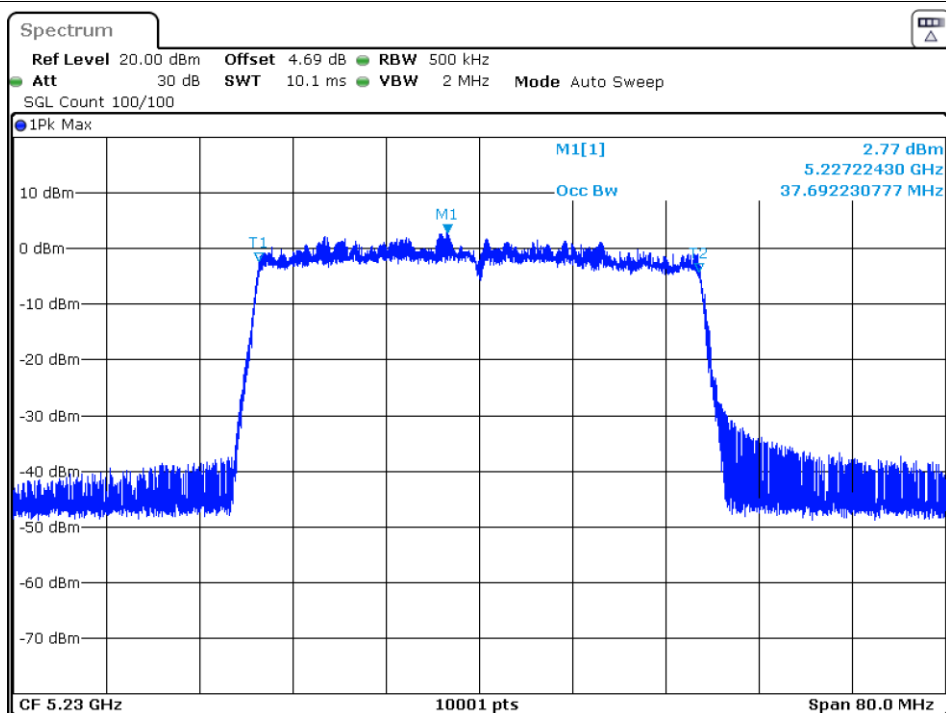


OBW NVNT ax40 5230MHz Ant1

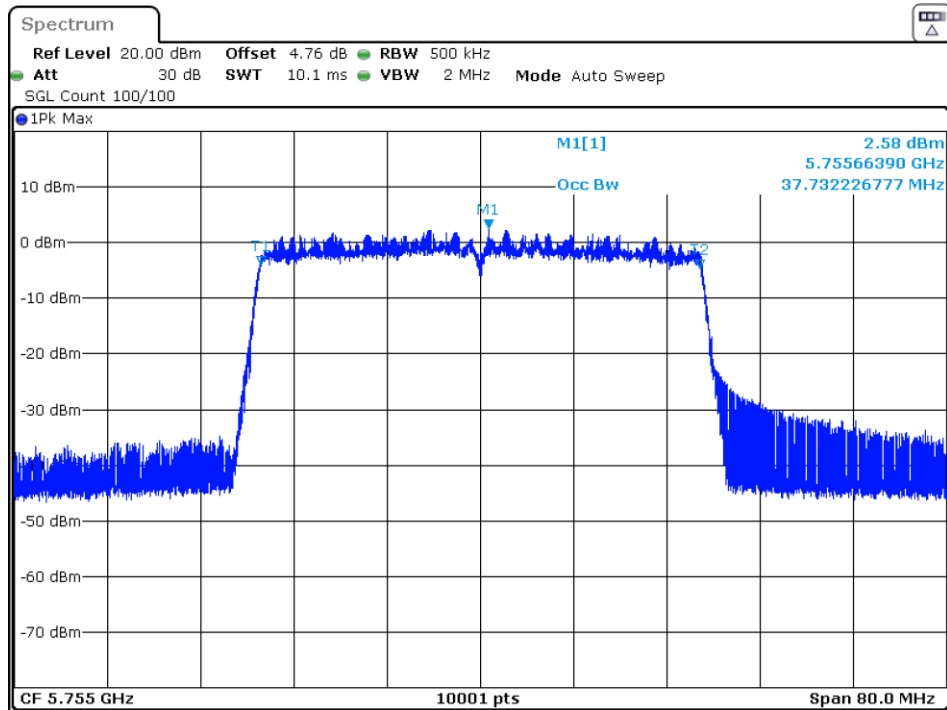


OBW NVNT ax40 5755MHz Ant1

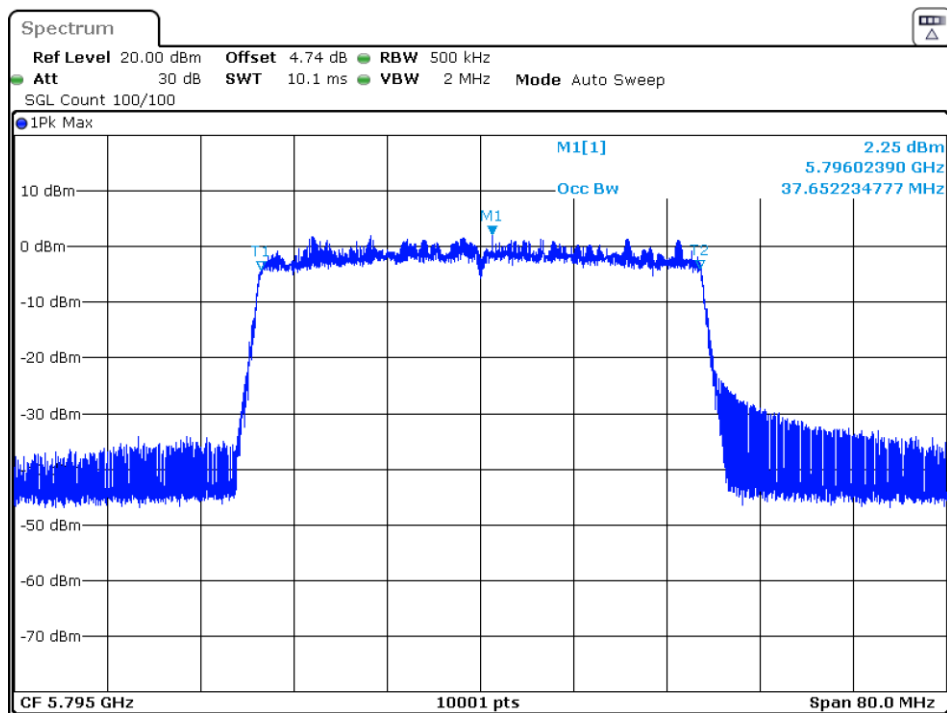

OBW NVNT ax40 5795MHz Ant1

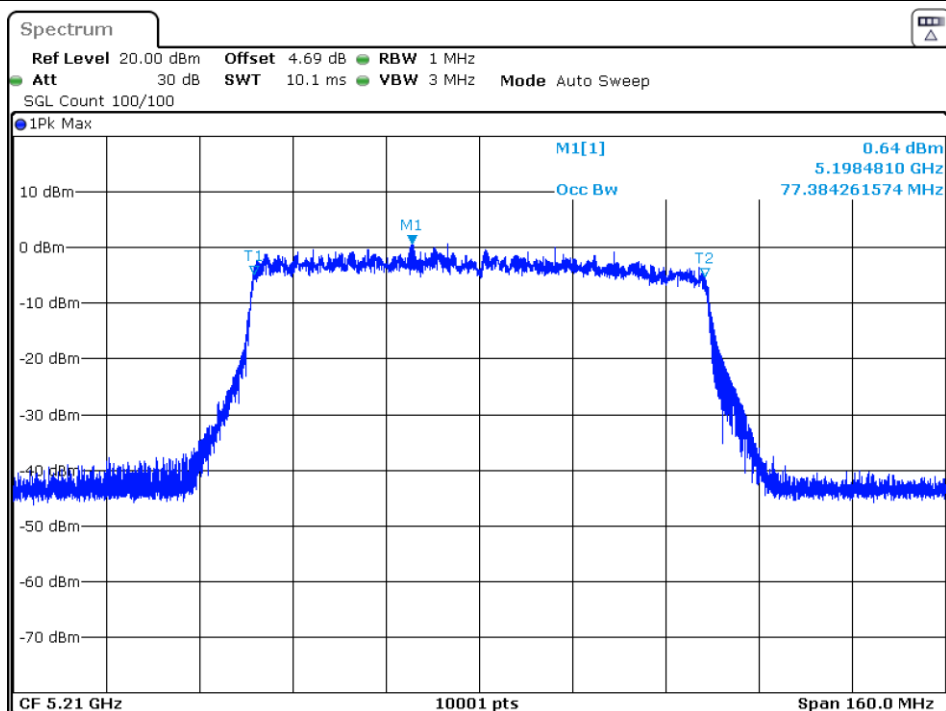

OBW NVNT ax80 5210MHz Ant1

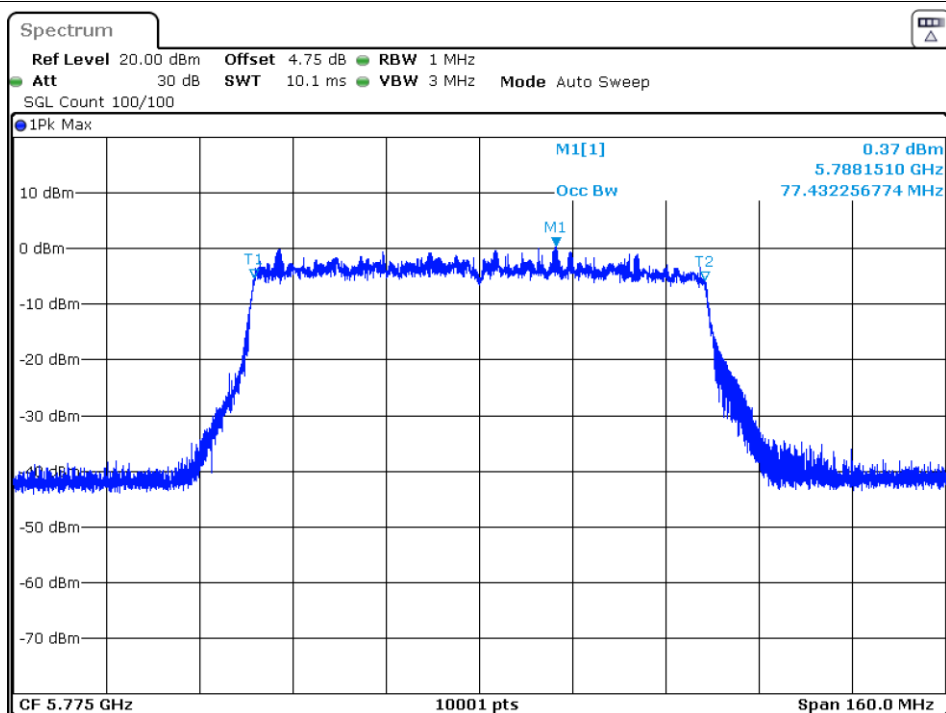


OBW NVNT ax80 5775MHz Ant1


Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total Conducted PSD (dBm)	Limit Conducted(dBm)	Verdict
NVNT	a	5180	Ant1	0.66	0.12	0.78	11	Pass
NVNT	a	5200	Ant1	0.61	0.15	0.76	11	Pass
NVNT	a	5240	Ant1	0	0.12	0.12	11	Pass
NVNT	a	5745	Ant1	0.47	0.15	0.62	30	Pass
NVNT	a	5785	Ant1	0.48	0.15	0.63	30	Pass
NVNT	a	5825	Ant1	-0.07	0.12	0.05	30	Pass
NVNT	n20	5180	Ant1	0.4	0.13	0.53	11	Pass
NVNT	n20	5200	Ant1	0.32	0.13	0.45	11	Pass
NVNT	n20	5240	Ant1	-0.17	0.16	-0.01	11	Pass
NVNT	n20	5745	Ant1	0.21	0.13	0.34	30	Pass
NVNT	n20	5785	Ant1	0.07	0.13	0.2	30	Pass
NVNT	n20	5825	Ant1	-0.39	0.13	-0.26	30	Pass
NVNT	n40	5190	Ant1	-4.19	0.32	-3.87	11	Pass
NVNT	n40	5230	Ant1	-4.73	0.26	-4.47	11	Pass
NVNT	n40	5755	Ant1	-4.75	0.26	-4.49	30	Pass
NVNT	n40	5795	Ant1	-4.96	0.26	-4.7	30	Pass
NVNT	ac20	5180	Ant1	0.45	0.13	0.58	11	Pass
NVNT	ac20	5200	Ant1	0.26	0.16	0.42	11	Pass
NVNT	ac20	5240	Ant1	-0.25	0.16	-0.09	11	Pass
NVNT	ac20	5745	Ant1	0.21	0.16	0.37	30	Pass
NVNT	ac20	5785	Ant1	0.09	0.13	0.22	30	Pass
NVNT	ac20	5825	Ant1	-0.48	0.13	-0.35	30	Pass
NVNT	ac40	5190	Ant1	-4.14	0.26	-3.88	11	Pass
NVNT	ac40	5230	Ant1	-4.69	0.26	-4.43	11	Pass
NVNT	ac40	5755	Ant1	-4.88	0.32	-4.56	30	Pass
NVNT	ac40	5795	Ant1	-4.92	0.26	-4.66	30	Pass
NVNT	ac80	5210	Ant1	-10.33	0.5	-9.83	11	Pass
NVNT	ac80	5775	Ant1	-11.04	0.5	-10.54	30	Pass
NVNT	ax20	5180	Ant1	0.16	0.21	0.37	11	Pass
NVNT	ax20	5200	Ant1	-0.03	0.17	0.14	11	Pass
NVNT	ax20	5240	Ant1	-0.44	0.21	-0.23	11	Pass
NVNT	ax20	5745	Ant1	-0.21	0.17	-0.04	30	Pass
NVNT	ax20	5785	Ant1	-0.08	0.17	0.09	30	Pass
NVNT	ax20	5825	Ant1	-0.57	0.21	-0.36	30	Pass
NVNT	ax40	5190	Ant1	-4.25	0.31	-3.94	11	Pass
NVNT	ax40	5230	Ant1	-4.88	0.38	-4.5	11	Pass
NVNT	ax40	5755	Ant1	-5.01	0.31	-4.7	30	Pass
NVNT	ax40	5795	Ant1	-5.06	0.31	-4.75	30	Pass
NVNT	ax80	5210	Ant1	-10.18	0.56	-9.62	11	Pass


NVNT	ax80	5775	Ant1	-11	0.56	-10.44	30	Pass
------	------	------	------	-----	------	--------	----	------

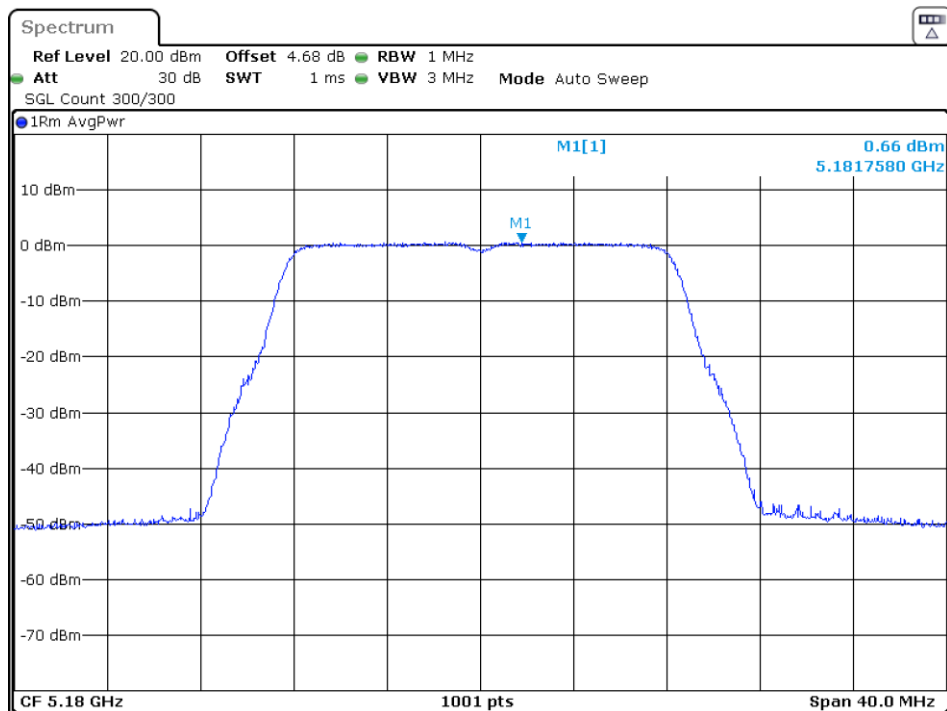


PSD NVNT a 5180MHz Ant1

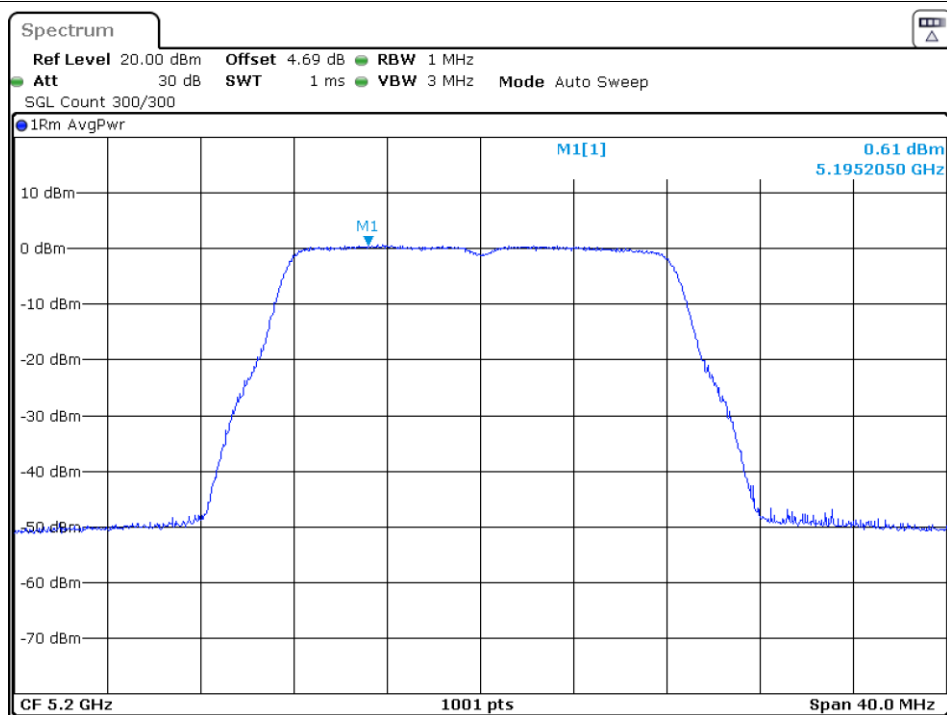


PSD NVNT a 5200MHz Ant1

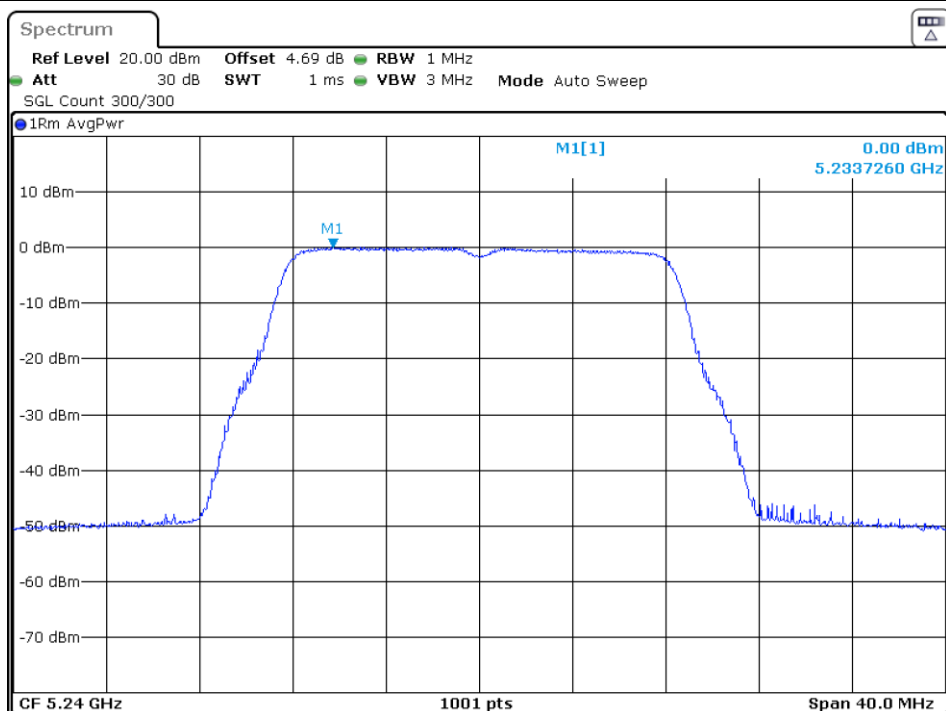


PSD NVNT a 5240MHz Ant1

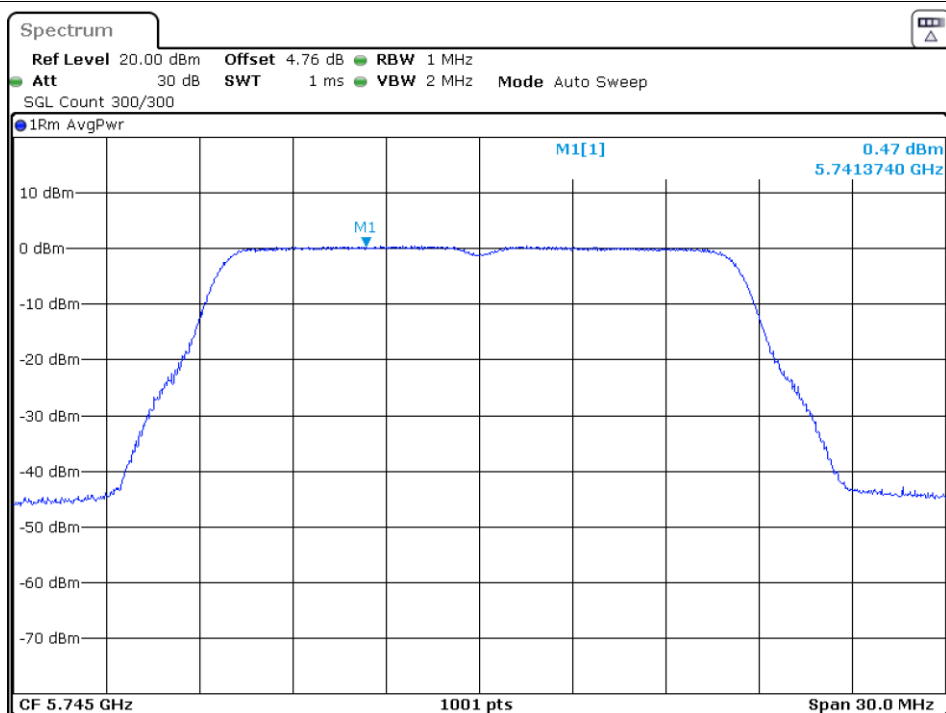


PSD NVNT a 5745MHz Ant1

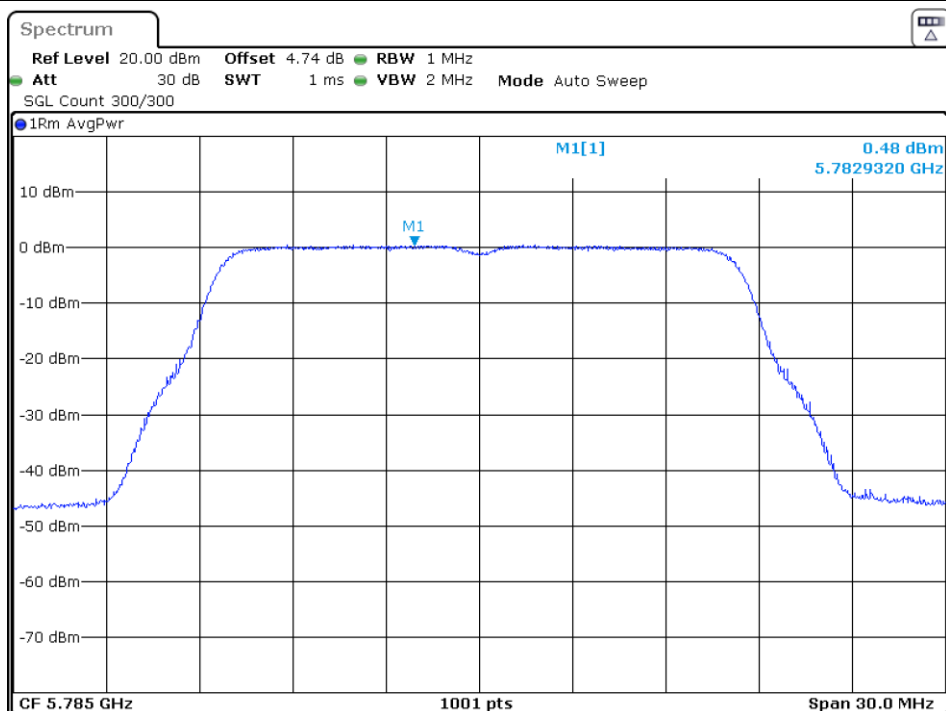


PSD NVNT a 5785MHz Ant1

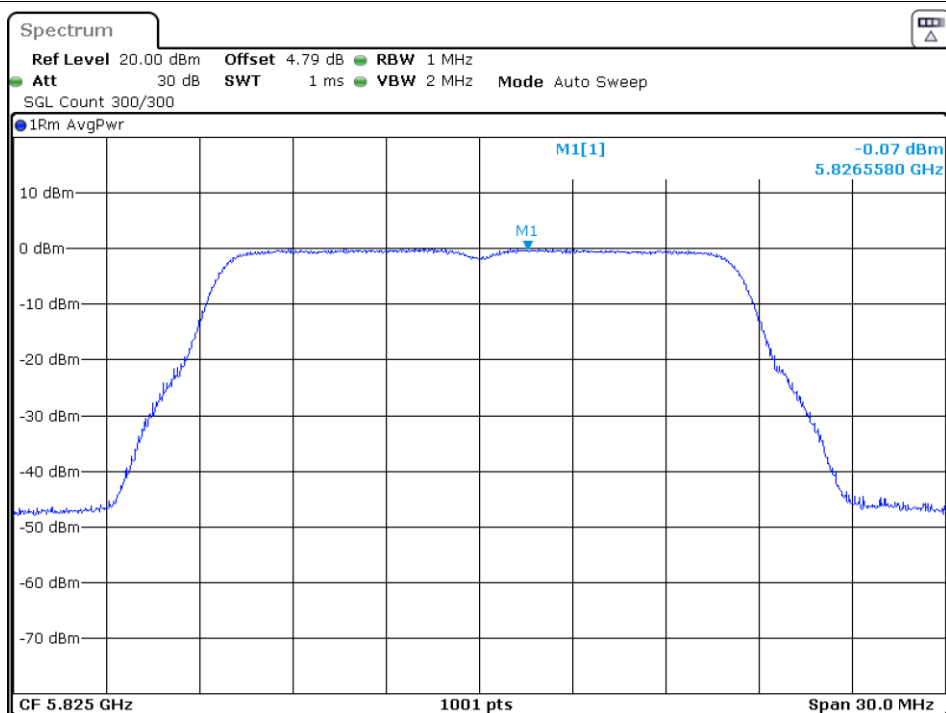


PSD NVNT a 5825MHz Ant1

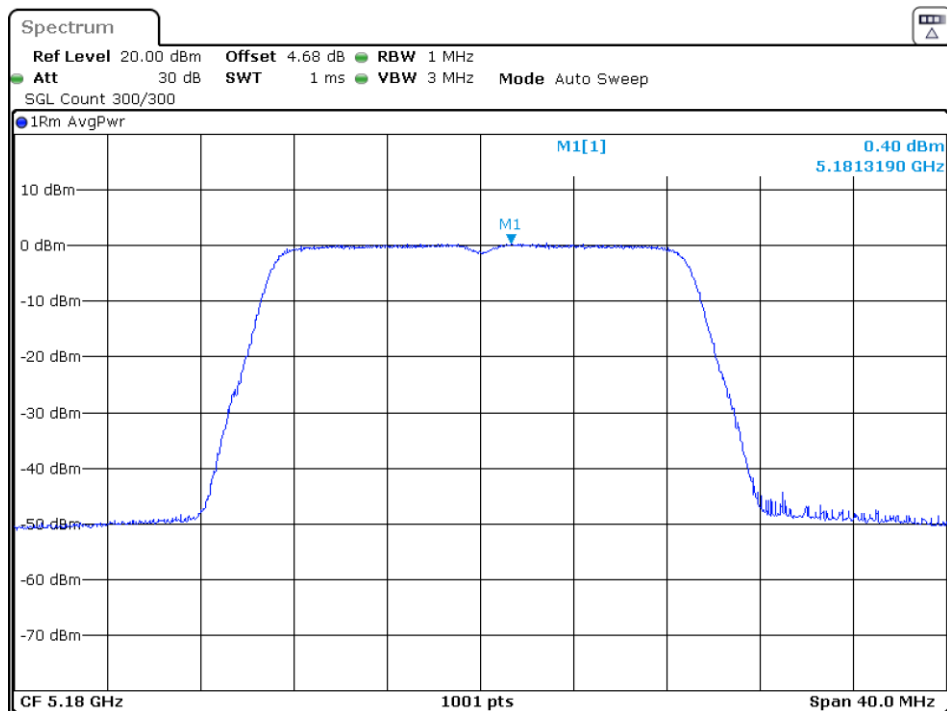


PSD NVNT n20 5180MHz Ant1

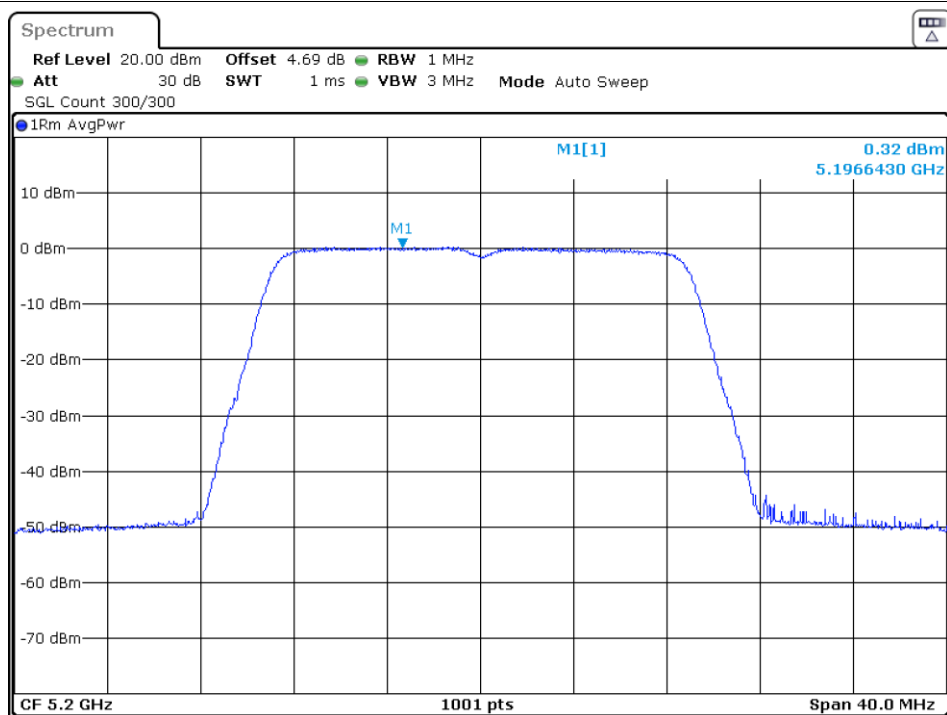


PSD NVNT n20 5200MHz Ant1

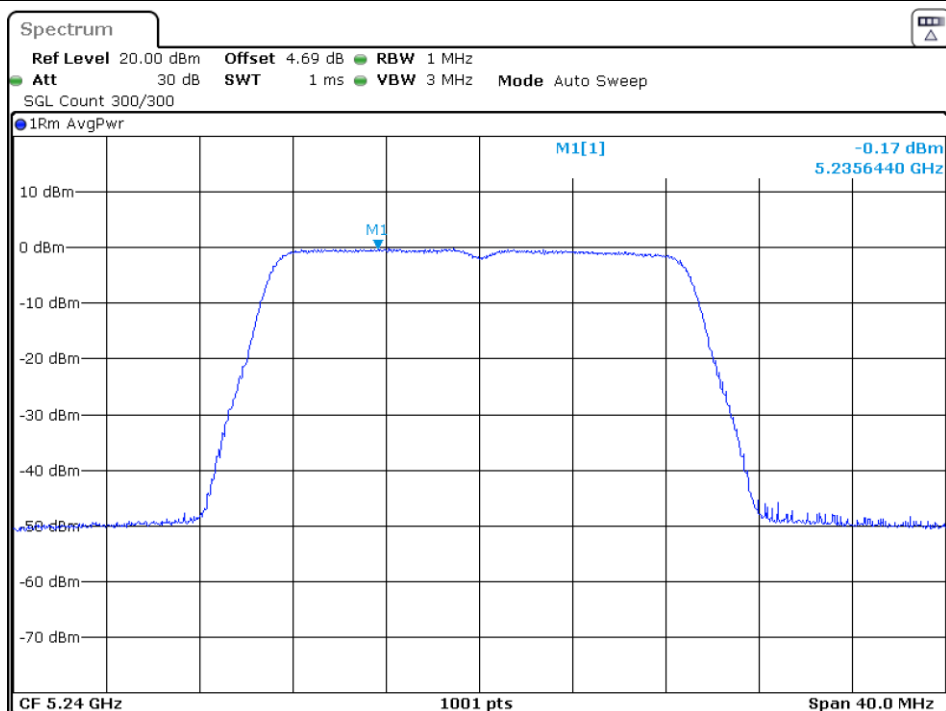


PSD NVNT n20 5240MHz Ant1

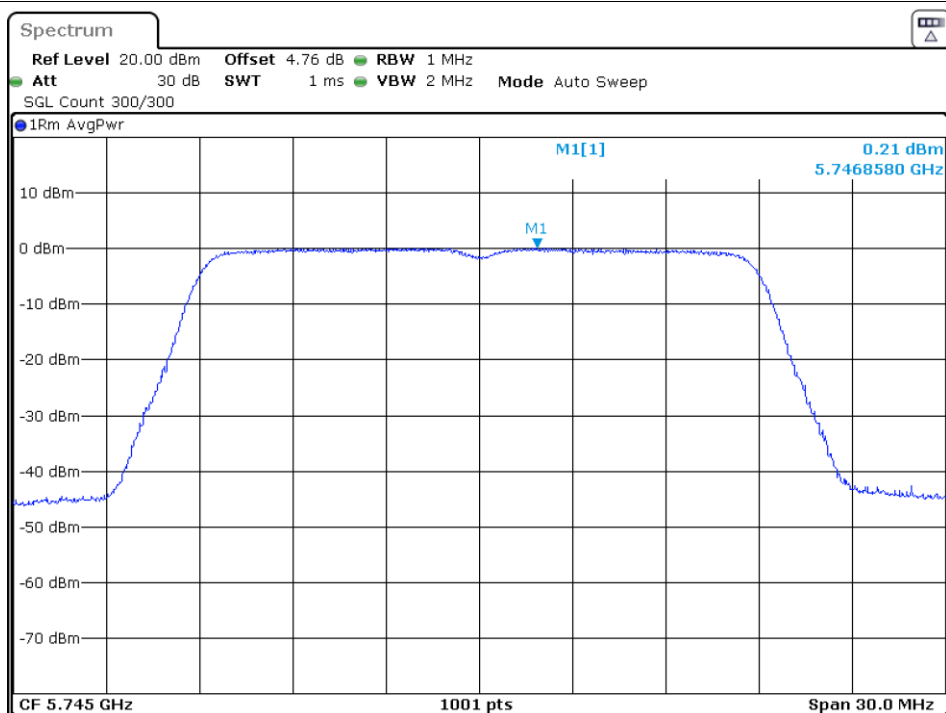


PSD NVNT n20 5745MHz Ant1

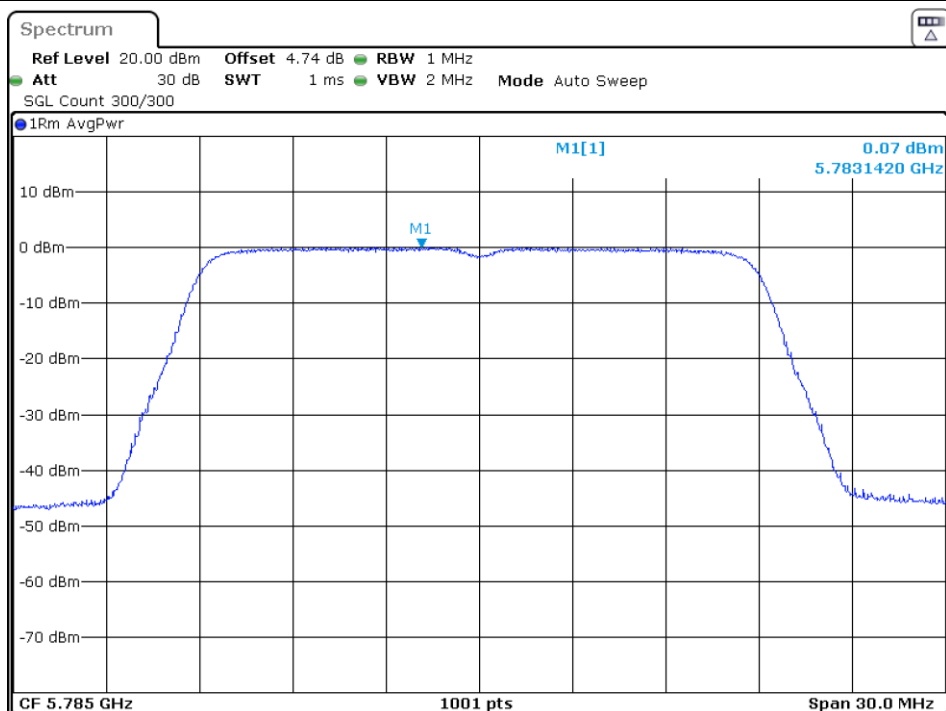


PSD NVNT n20 5785MHz Ant1

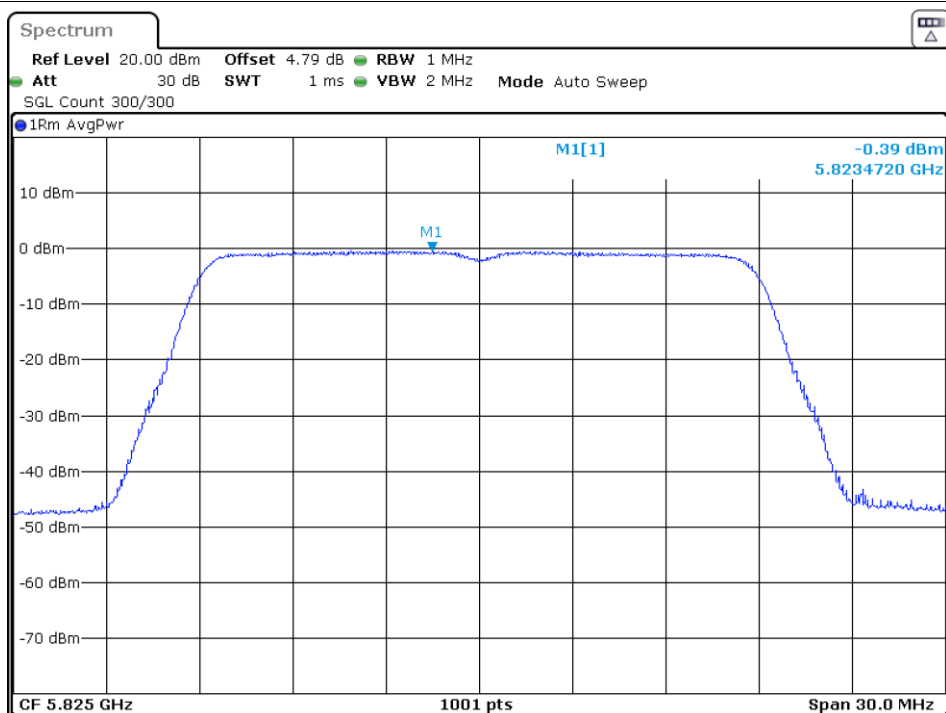


PSD NVNT n20 5825MHz Ant1

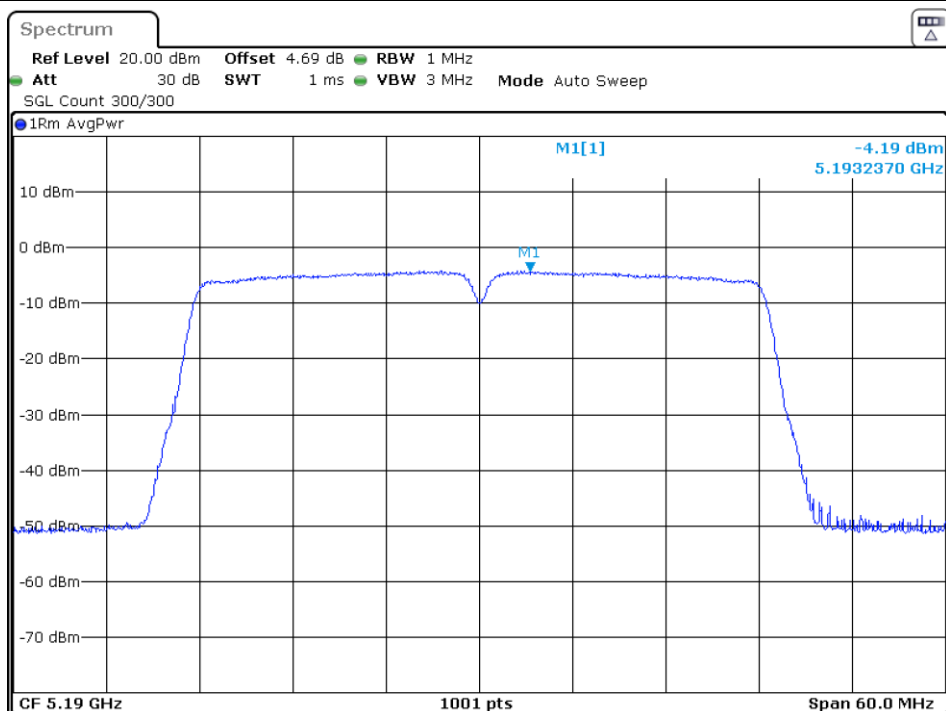


PSD NVNT n40 5190MHz Ant1

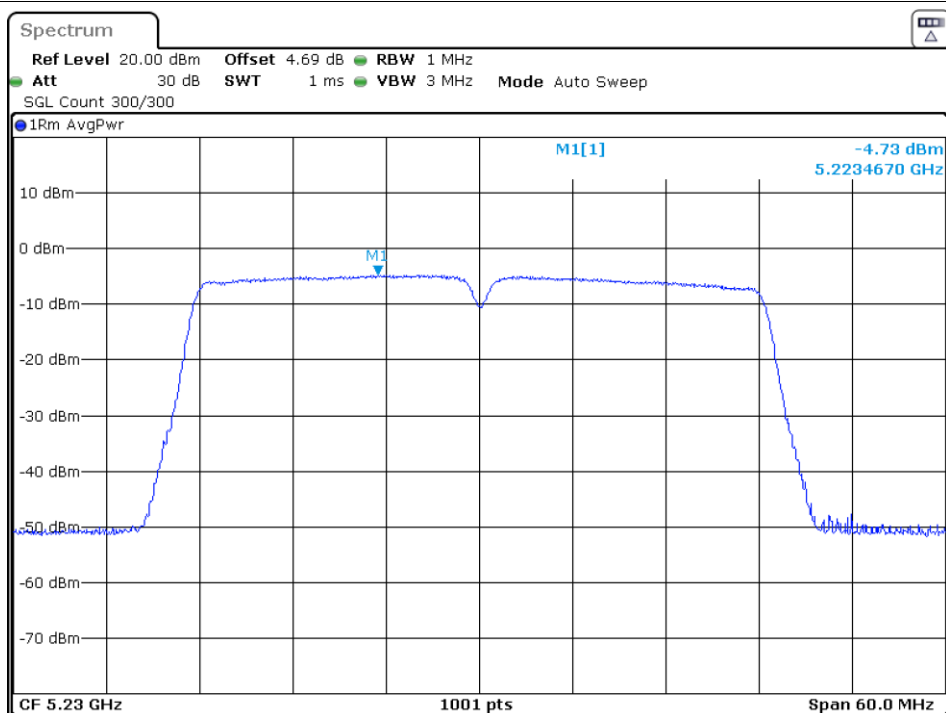


PSD NVNT n40 5230MHz Ant1

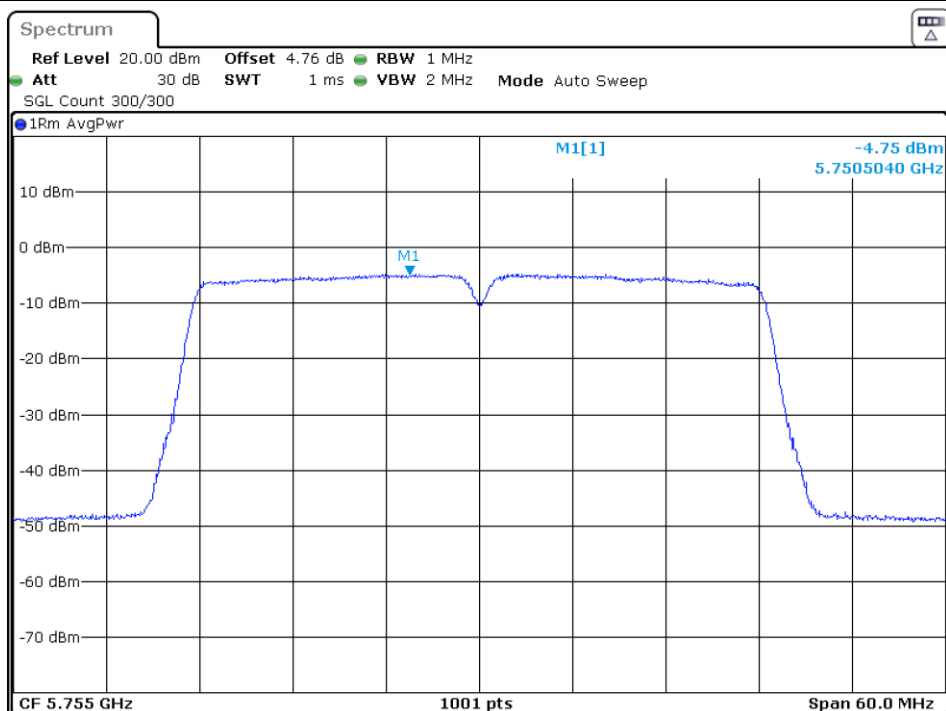


PSD NVNT n40 5755MHz Ant1

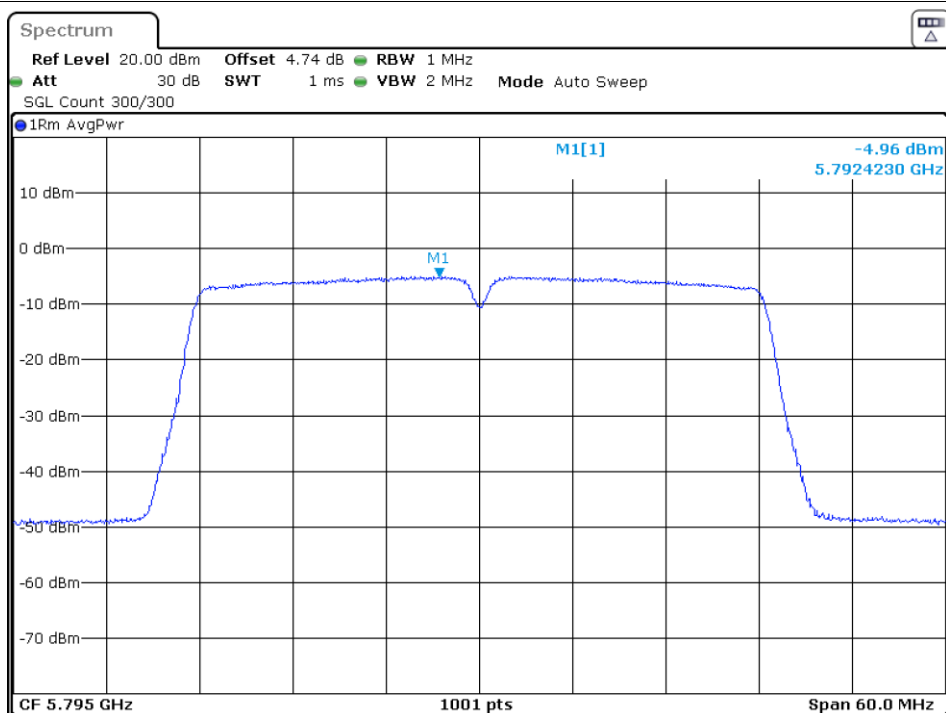


PSD NVNT n40 5795MHz Ant1

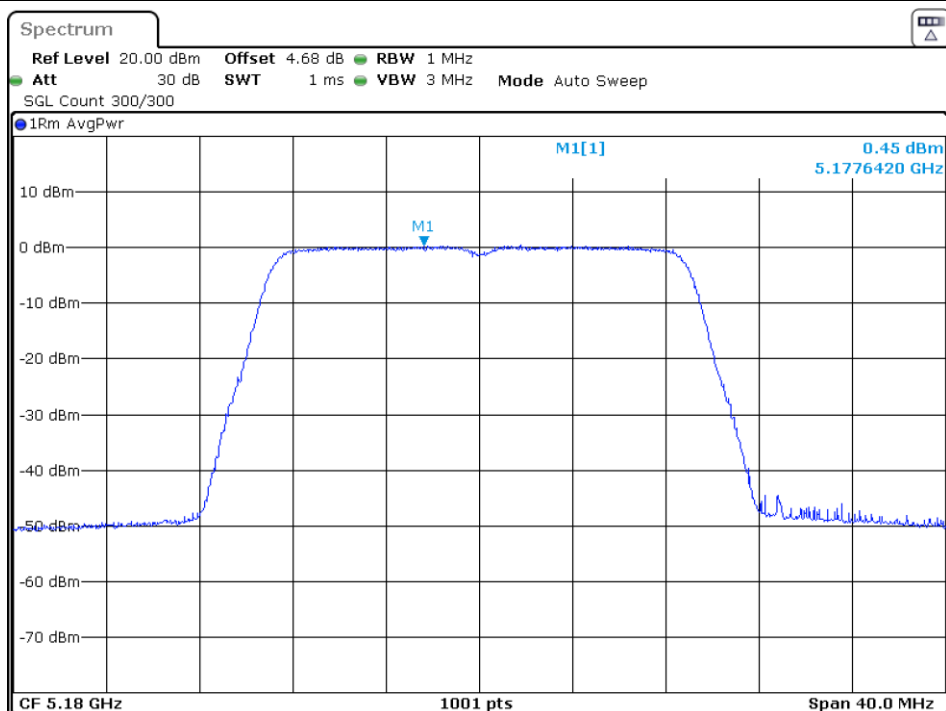


PSD NVNT ac20 5180MHz Ant1

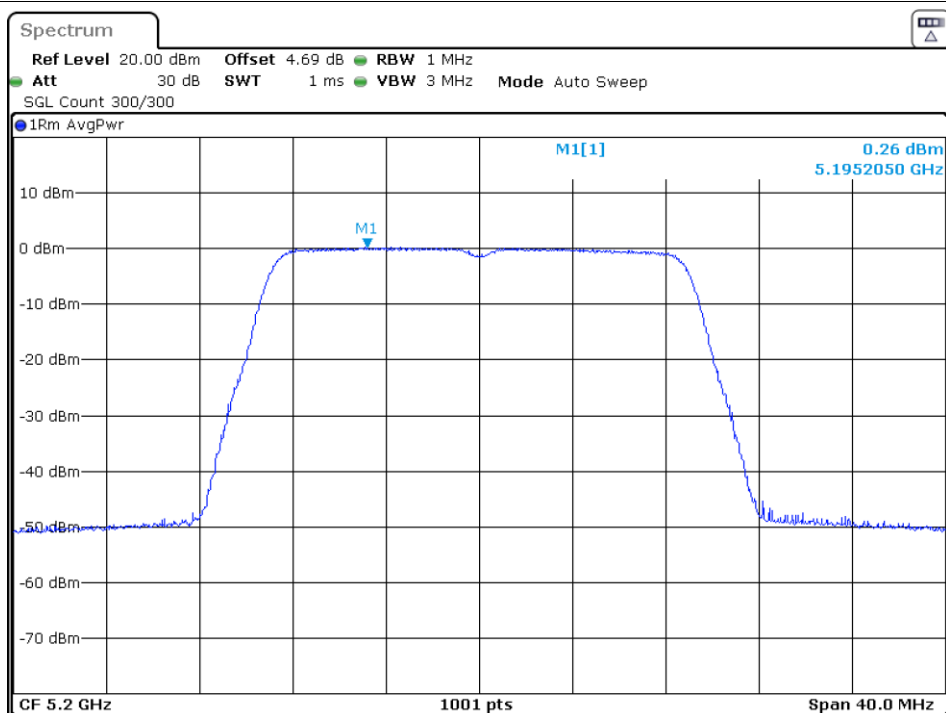


PSD NVNT ac20 5200MHz Ant1

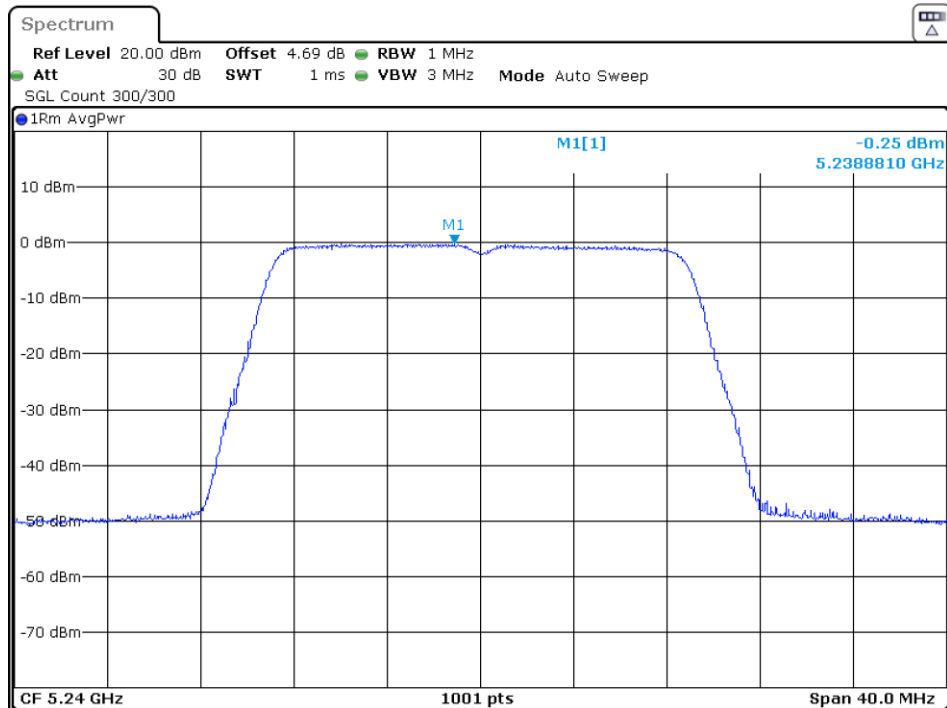


PSD NVNT ac20 5240MHz Ant1

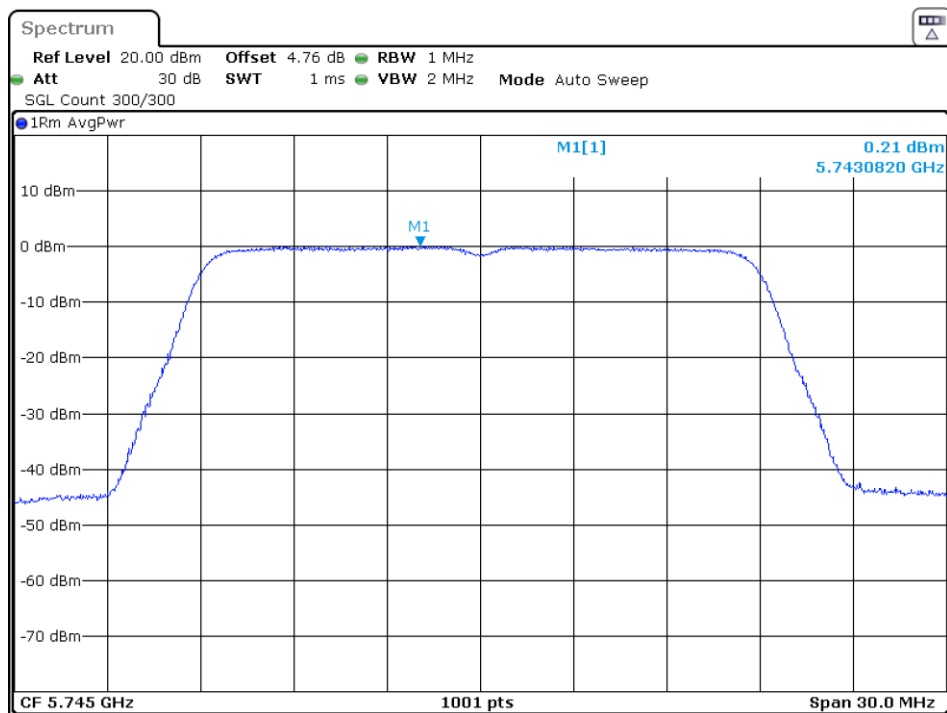


PSD NVNT ac20 5745MHz Ant1

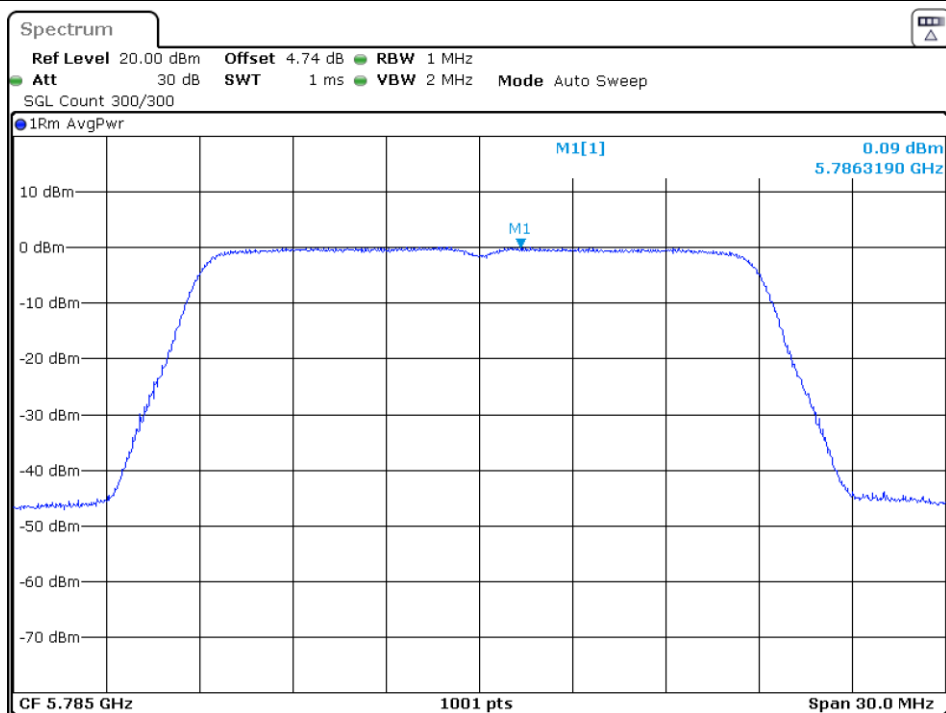


PSD NVNT ac20 5785MHz Ant1

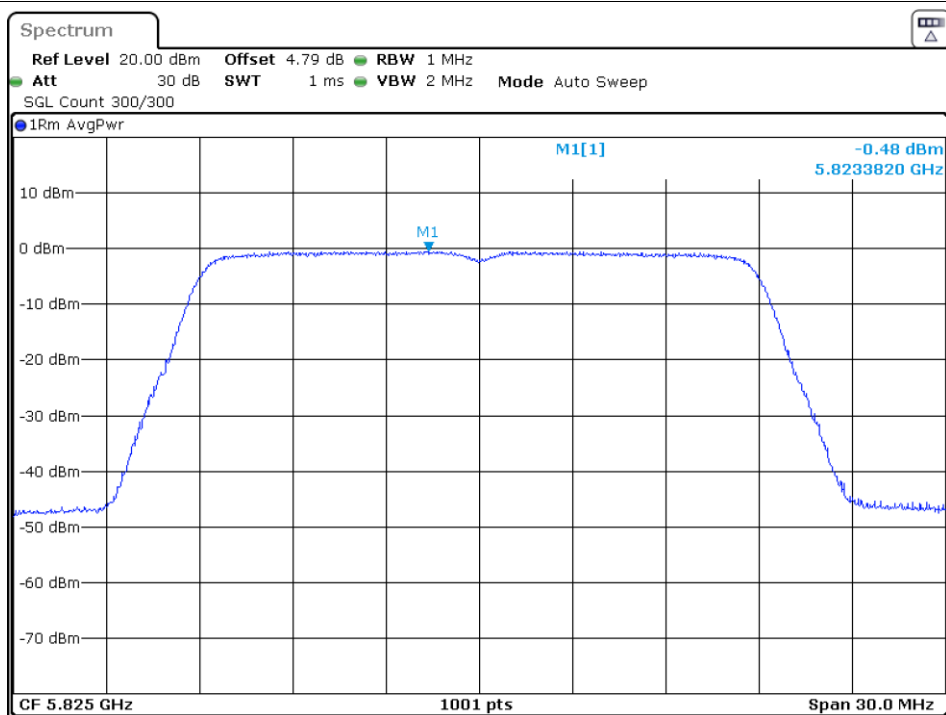


PSD NVNT ac20 5825MHz Ant1

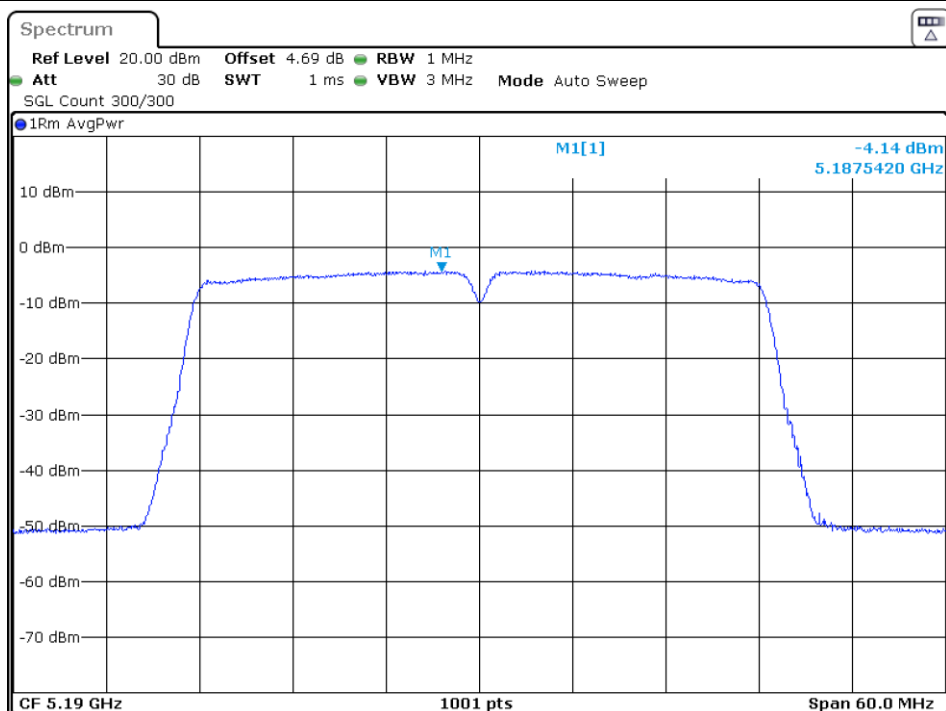


PSD NVNT ac40 5190MHz Ant1

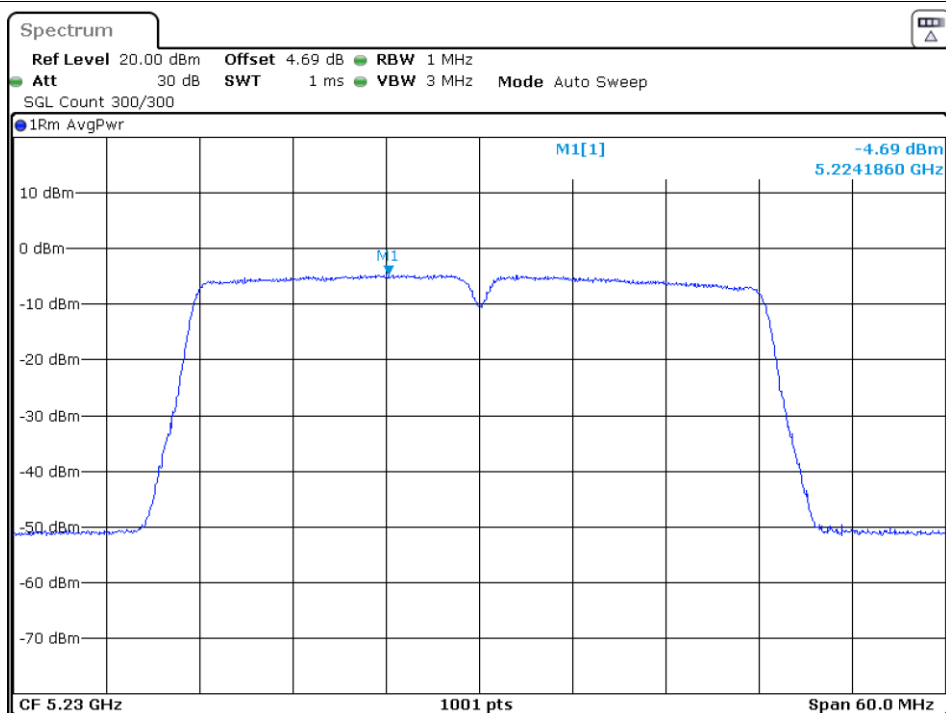


PSD NVNT ac40 5230MHz Ant1

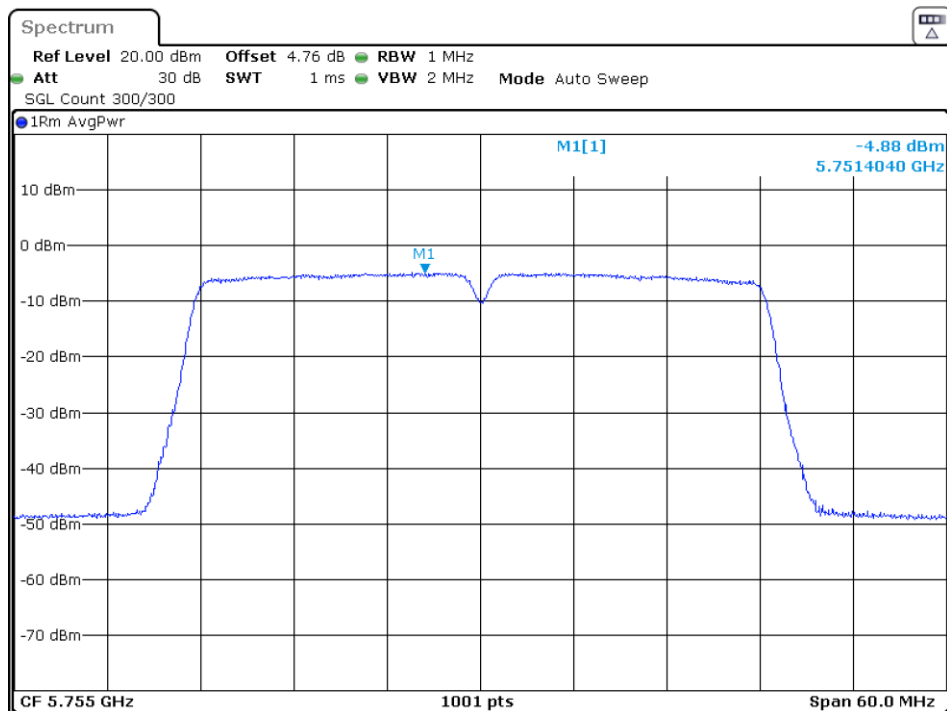


PSD NVNT ac40 5755MHz Ant1

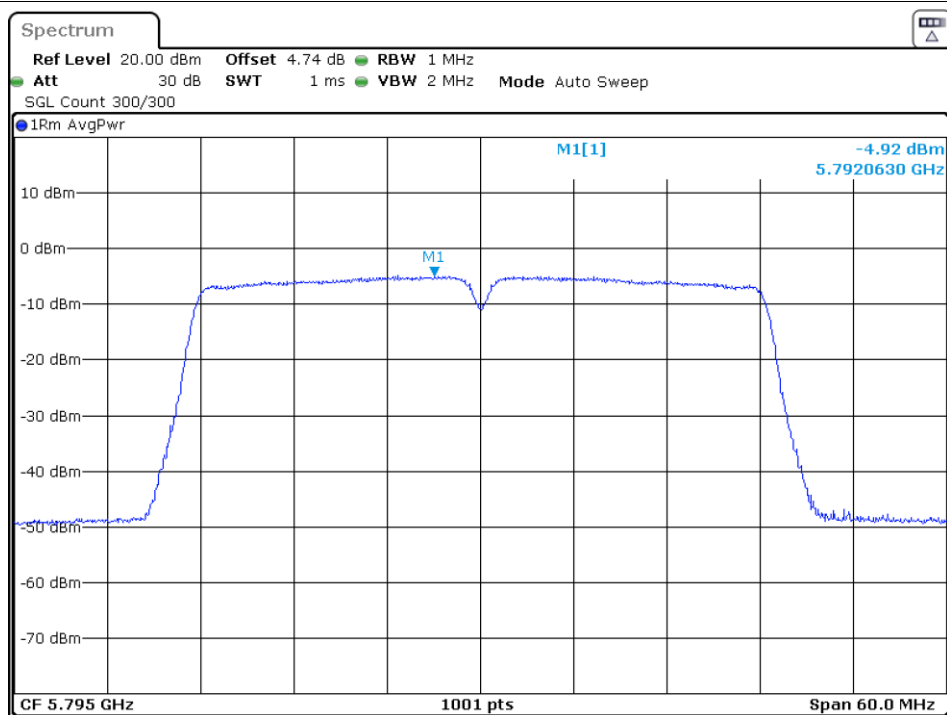


PSD NVNT ac40 5795MHz Ant1

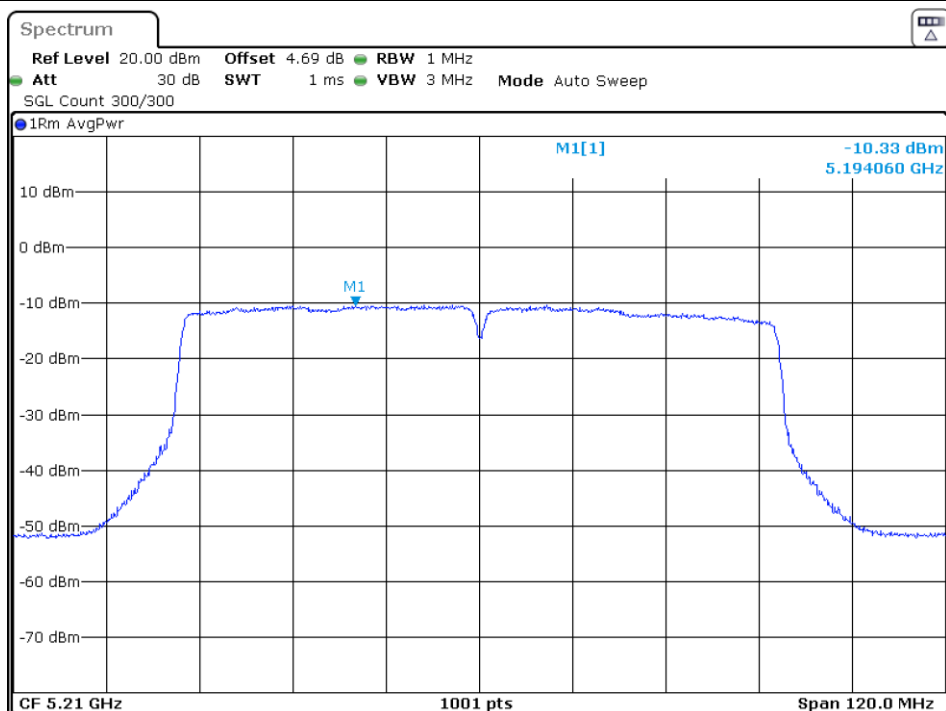


PSD NVNT ac80 5210MHz Ant1

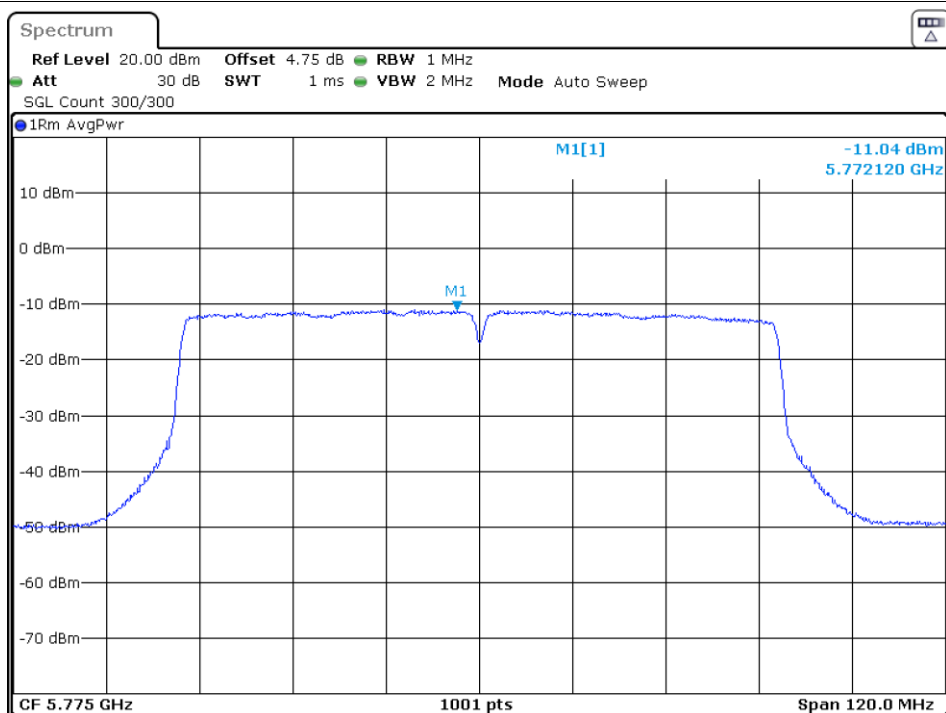


PSD NVNT ac80 5775MHz Ant1

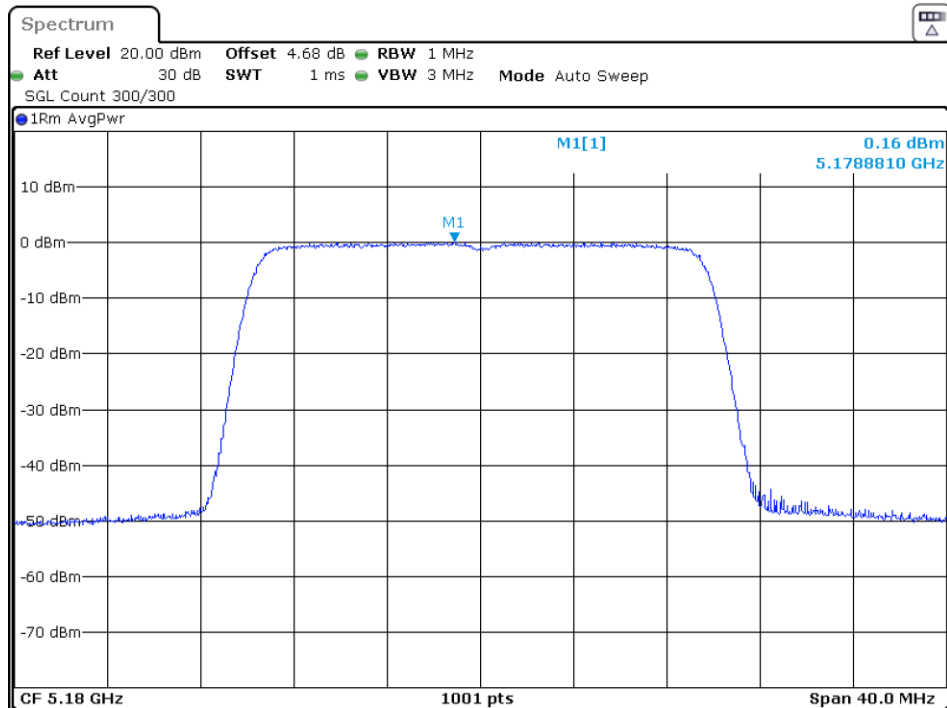


PSD NVNT ax20 5180MHz Ant1

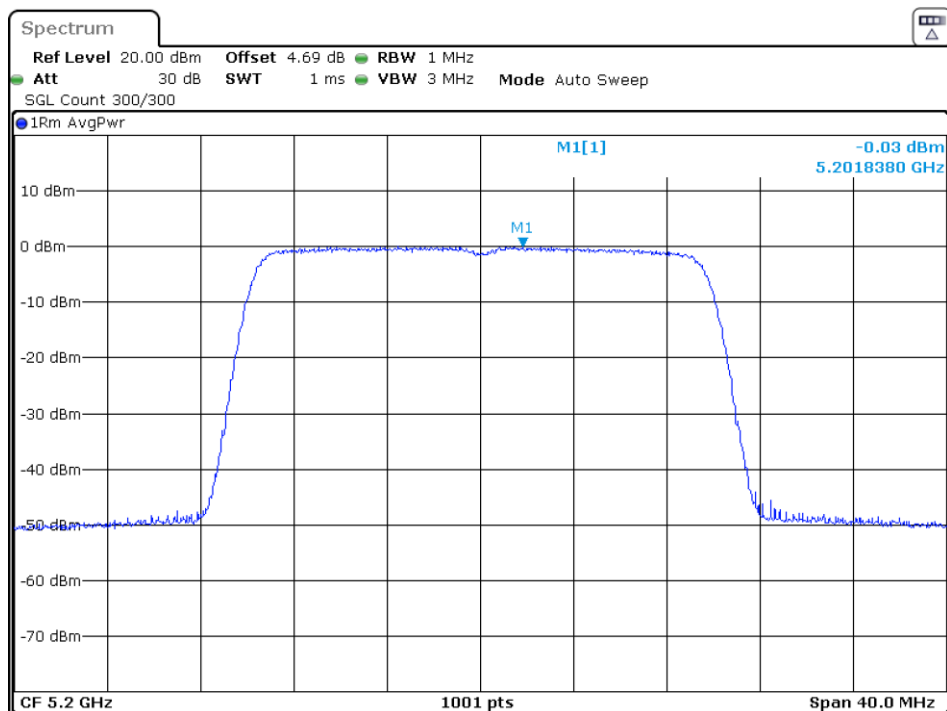


PSD NVNT ax20 5200MHz Ant1

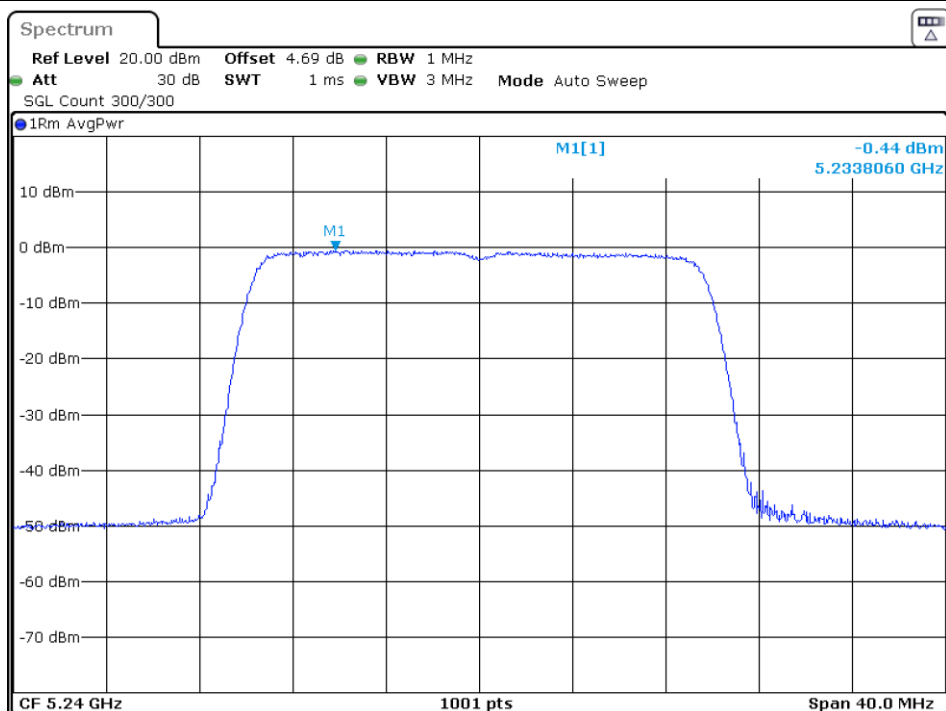


PSD NVNT ax20 5240MHz Ant1

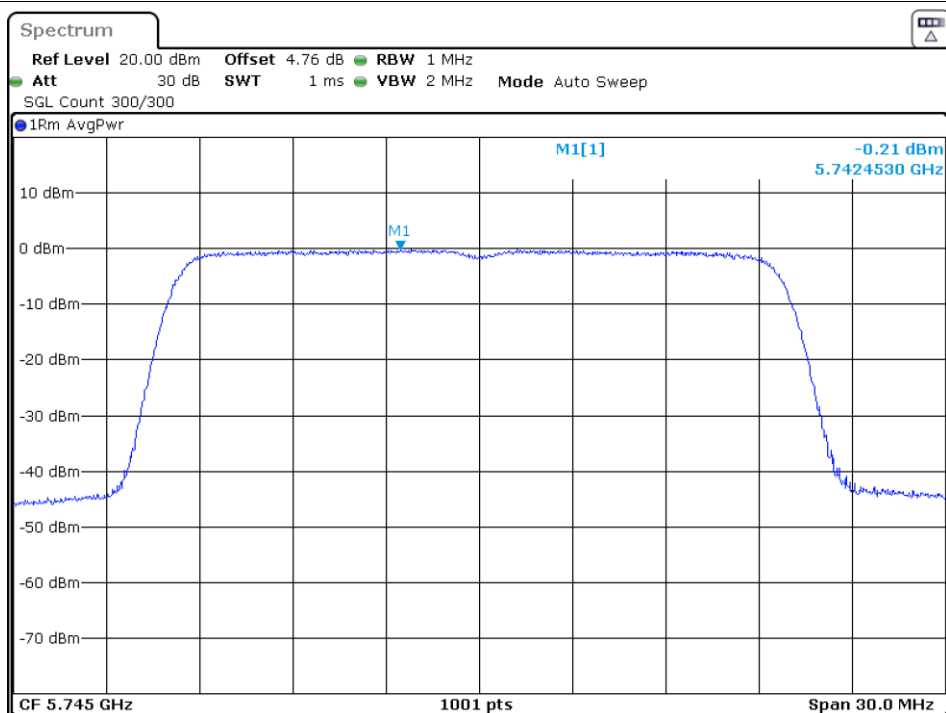


PSD NVNT ax20 5745MHz Ant1

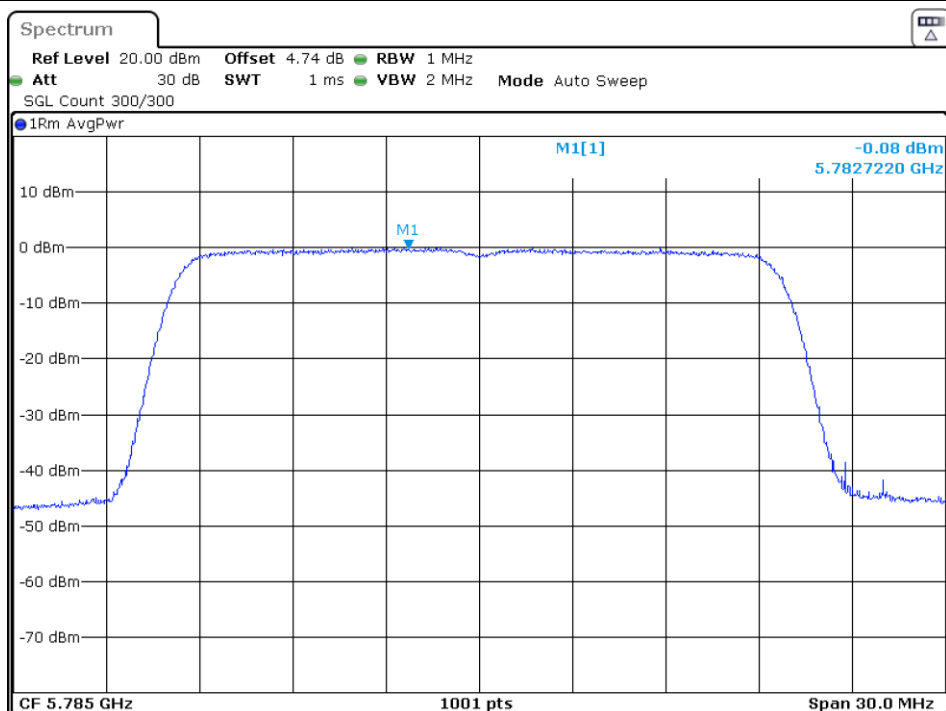


PSD NVNT ax20 5785MHz Ant1

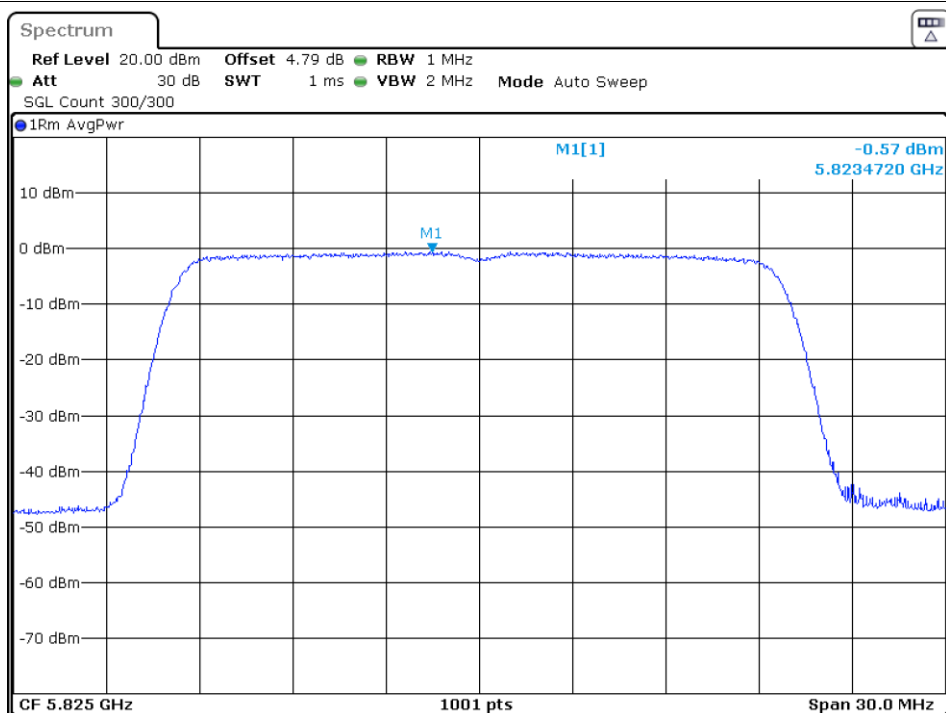


PSD NVNT ax20 5825MHz Ant1

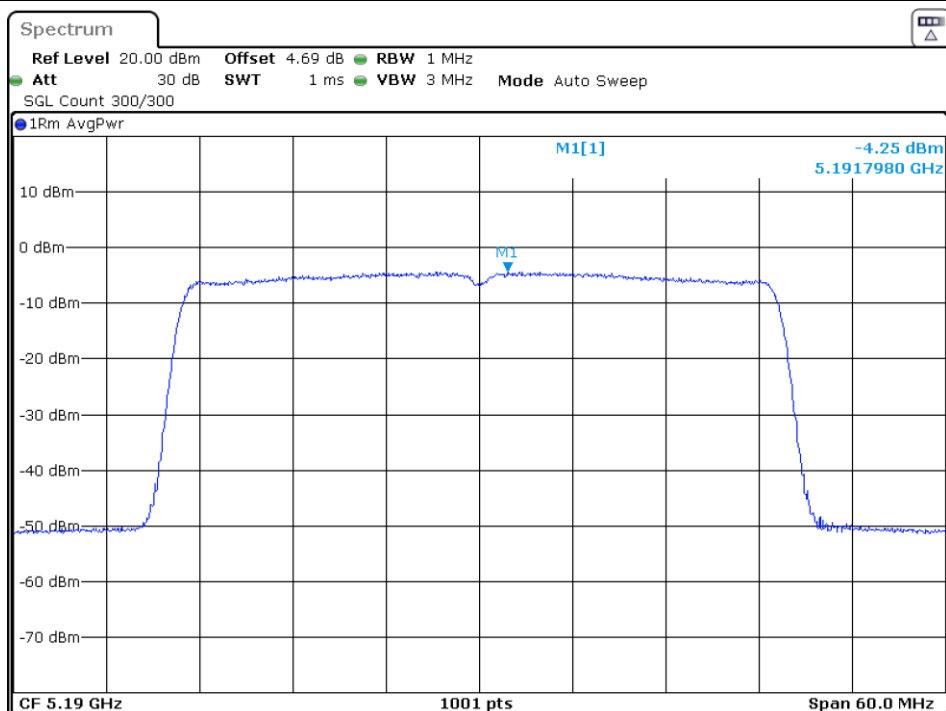


PSD NVNT ax40 5190MHz Ant1

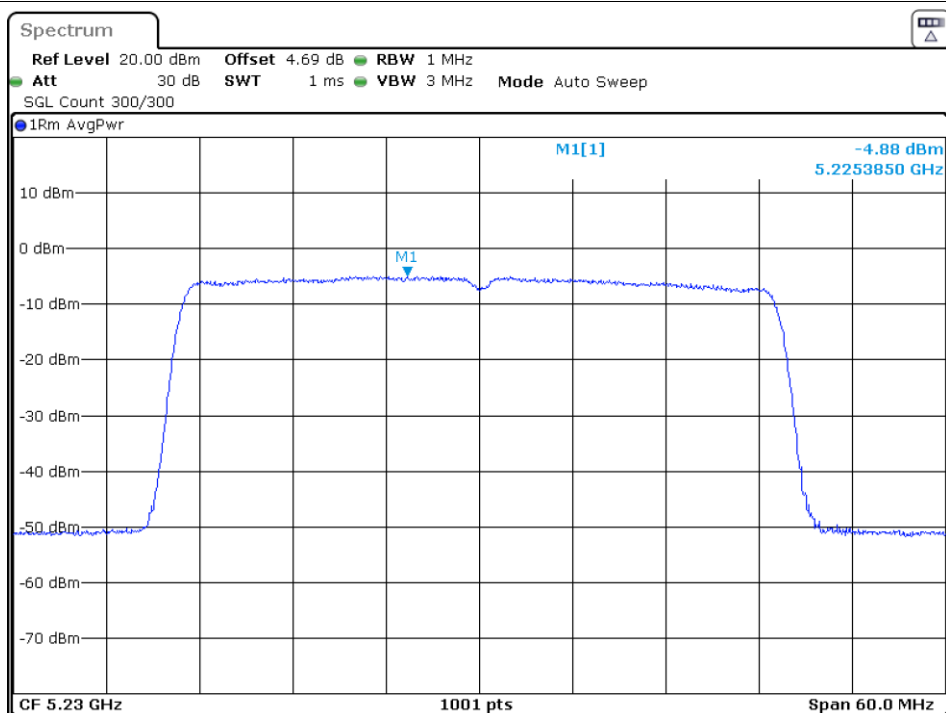


PSD NVNT ax40 5230MHz Ant1

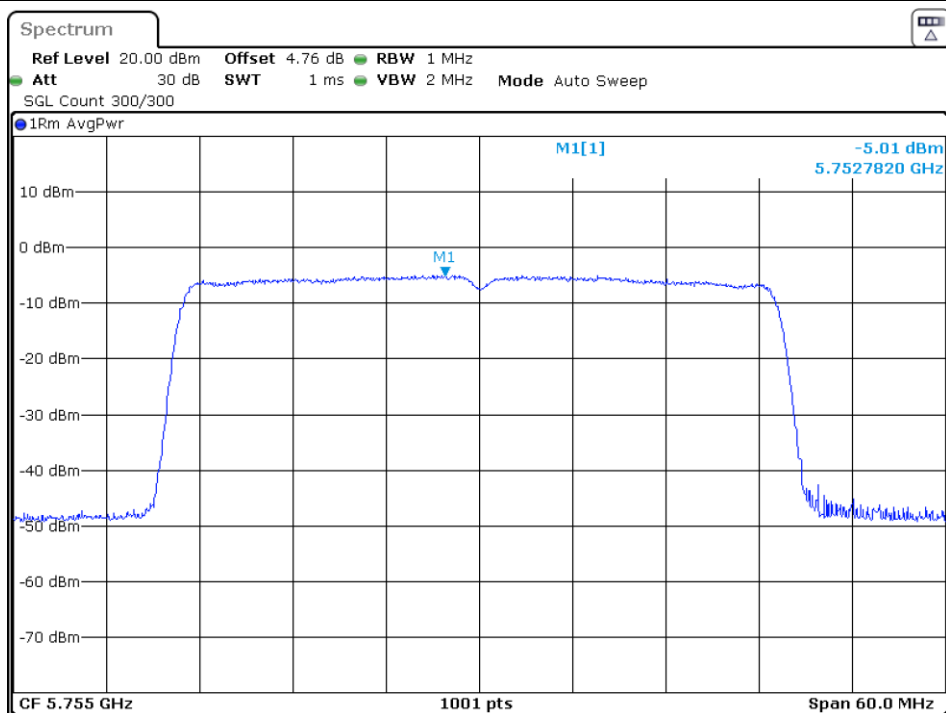


PSD NVNT ax40 5755MHz Ant1

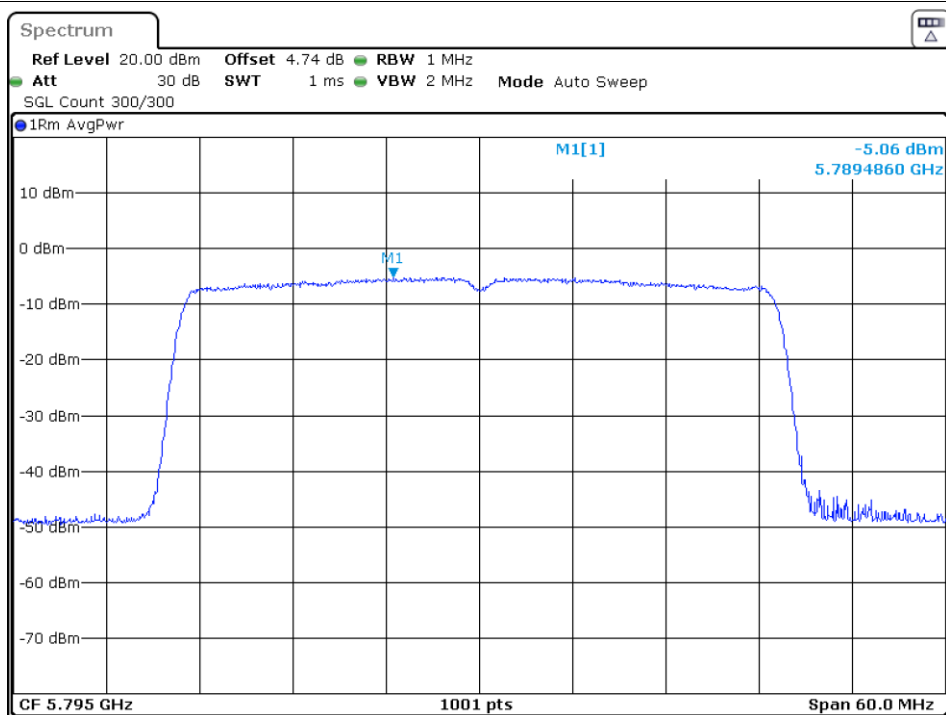

PSD NVNT ax40 5795MHz Ant1

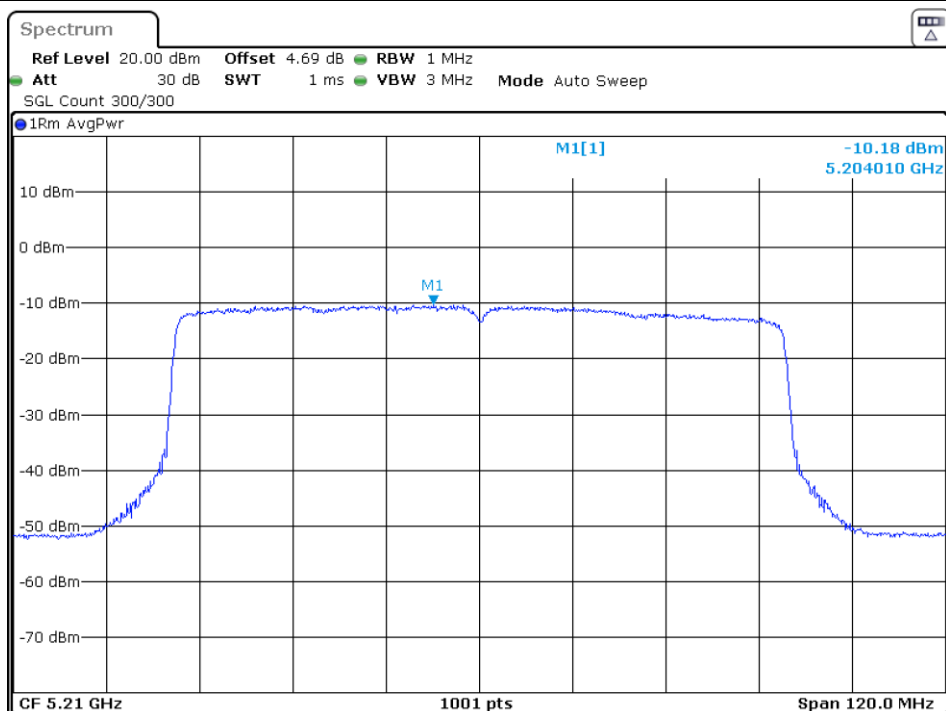

PSD NVNT ax80 5210MHz Ant1

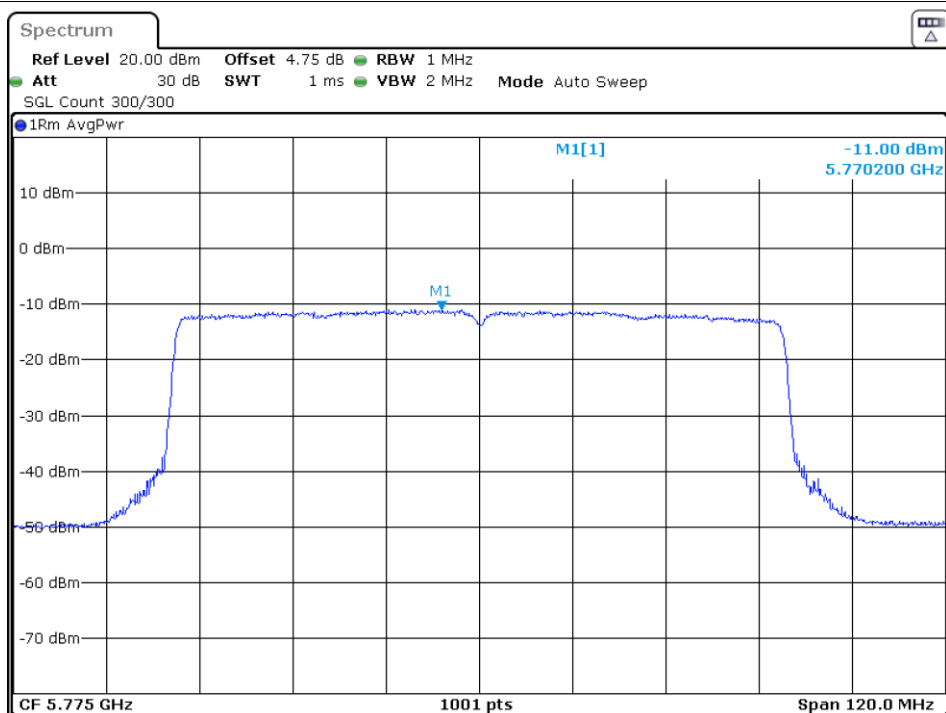

PSD NVNT ax80 5775MHz Ant1

Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
0C 120V	a	5180	Ant1	5179.988	-12000	-2.32	25	Pass
10C 120V	a	5180	Ant1	5179.988	-12000	-2.32	25	Pass
20C 120V	a	5180	Ant1	5179.988	-12000	-2.32	25	Pass
30C 120V	a	5180	Ant1	5179.988	-12000	-2.32	25	Pass
40C 120V	a	5180	Ant1	5179.988	-12000	-2.32	25	Pass
0C 120V	a	5200	Ant1	5199.988	-12000	-2.31	25	Pass
10C 120V	a	5200	Ant1	5199.988	-12000	-2.31	25	Pass
20C 120V	a	5200	Ant1	5199.988	-12000	-2.31	25	Pass
30C 120V	a	5200	Ant1	5199.988	-12000	-2.31	25	Pass
40C 120V	a	5200	Ant1	5199.988	-12000	-2.31	25	Pass
0C 120V	a	5240	Ant1	5239.988	-12000	-2.29	25	Pass
10C 120V	a	5240	Ant1	5239.988	-12000	-2.29	25	Pass
20C 120V	a	5240	Ant1	5239.988	-12000	-2.29	25	Pass
30C 120V	a	5240	Ant1	5239.988	-12000	-2.29	25	Pass
40C 120V	a	5240	Ant1	5239.988	-12000	-2.29	25	Pass
0C 120V	a	5745	Ant1	5744.989	-11000	-1.91	25	Pass
10C 120V	a	5745	Ant1	5744.989	-11000	-1.91	25	Pass
20C 120V	a	5745	Ant1	5744.989	-11000	-1.91	25	Pass
30C 120V	a	5745	Ant1	5744.989	-11000	-1.91	25	Pass
40C 120V	a	5745	Ant1	5744.989	-11000	-1.91	25	Pass
0C 120V	a	5785	Ant1	5784.988	-12000	-2.07	25	Pass
10C 120V	a	5785	Ant1	5784.988	-12000	-2.07	25	Pass
20C 120V	a	5785	Ant1	5784.988	-12000	-2.07	25	Pass
30C 120V	a	5785	Ant1	5784.988	-12000	-2.07	25	Pass
40C 120V	a	5785	Ant1	5784.988	-12000	-2.07	25	Pass
0C 120V	a	5825	Ant1	5824.987	-13000	-2.23	25	Pass
10C 120V	a	5825	Ant1	5824.987	-13000	-2.23	25	Pass
20C 120V	a	5825	Ant1	5824.987	-13000	-2.23	25	Pass
30C 120V	a	5825	Ant1	5824.987	-13000	-2.23	25	Pass
40C 120V	a	5825	Ant1	5824.987	-13000	-2.23	25	Pass
0C 120V	n20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
10C 120V	n20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
20C 120V	n20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
30C 120V	n20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
40C 120V	n20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
0C 120V	n20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
10C 120V	n20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
20C 120V	n20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
30C 120V	n20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
40C 120V	n20	5200	Ant1	5199.988	-12000	-2.31	25	Pass

0C 120V	n20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
10C 120V	n20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
20C 120V	n20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
30C 120V	n20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
40C 120V	n20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
0C 120V	n20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
10C 120V	n20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
20C 120V	n20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
30C 120V	n20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
40C 120V	n20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
0C 120V	n20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
10C 120V	n20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
20C 120V	n20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
30C 120V	n20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
40C 120V	n20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
0C 120V	n20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
10C 120V	n20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
20C 120V	n20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
30C 120V	n20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
40C 120V	n20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
0C 120V	n40	5190	Ant1	5189.988	-12000	-2.31	25	Pass
10C 120V	n40	5190	Ant1	5189.988	-12000	-2.31	25	Pass
20C 120V	n40	5190	Ant1	5189.988	-12000	-2.31	25	Pass
30C 120V	n40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
40C 120V	n40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
0C 120V	n40	5230	Ant1	5229.989	-11000	-2.1	25	Pass
10C 120V	n40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
20C 120V	n40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
30C 120V	n40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
40C 120V	n40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
0C 120V	n40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
10C 120V	n40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
20C 120V	n40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
30C 120V	n40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
40C 120V	n40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
0C 120V	n40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
10C 120V	n40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
20C 120V	n40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
30C 120V	n40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
40C 120V	n40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
0C 120V	ac20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
10C 120V	ac20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
20C 120V	ac20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
30C 120V	ac20	5180	Ant1	5179.989	-11000	-2.12	25	Pass


40C 120V	ac20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
0C 120V	ac20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
10C 120V	ac20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
20C 120V	ac20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
30C 120V	ac20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
40C 120V	ac20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
0C 120V	ac20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
10C 120V	ac20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
20C 120V	ac20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
30C 120V	ac20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
40C 120V	ac20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
0C 120V	ac20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
10C 120V	ac20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
20C 120V	ac20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
30C 120V	ac20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
40C 120V	ac20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
0C 120V	ac20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
10C 120V	ac20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
20C 120V	ac20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
30C 120V	ac20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
40C 120V	ac20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
0C 120V	ac20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
10C 120V	ac20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
20C 120V	ac20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
30C 120V	ac20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
40C 120V	ac20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
0C 120V	ac40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
10C 120V	ac40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
20C 120V	ac40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
30C 120V	ac40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
40C 120V	ac40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
0C 120V	ac40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
10C 120V	ac40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
20C 120V	ac40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
30C 120V	ac40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
40C 120V	ac40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
0C 120V	ac40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
10C 120V	ac40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
20C 120V	ac40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
30C 120V	ac40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
40C 120V	ac40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
0C 120V	ac40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
10C 120V	ac40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
20C 120V	ac40	5795	Ant1	5794.987	-13000	-2.24	25	Pass

30C 120V	ac40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
40C 120V	ac40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
0C 120V	ac80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
10C 120V	ac80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
20C 120V	ac80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
30C 120V	ac80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
40C 120V	ac80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
0C 120V	ac80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
10C 120V	ac80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
20C 120V	ac80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
30C 120V	ac80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
40C 120V	ac80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
0C 120V	ax20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
10C 120V	ax20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
20C 120V	ax20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
30C 120V	ax20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
40C 120V	ax20	5180	Ant1	5179.989	-11000	-2.12	25	Pass
0C 120V	ax20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
10C 120V	ax20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
20C 120V	ax20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
30C 120V	ax20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
40C 120V	ax20	5200	Ant1	5199.988	-12000	-2.31	25	Pass
0C 120V	ax20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
10C 120V	ax20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
20C 120V	ax20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
30C 120V	ax20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
40C 120V	ax20	5240	Ant1	5239.988	-12000	-2.29	25	Pass
0C 120V	ax20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
10C 120V	ax20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
20C 120V	ax20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
30C 120V	ax20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
40C 120V	ax20	5745	Ant1	5744.989	-11000	-1.91	25	Pass
0C 120V	ax20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
10C 120V	ax20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
20C 120V	ax20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
30C 120V	ax20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
40C 120V	ax20	5785	Ant1	5784.988	-12000	-2.07	25	Pass
0C 120V	ax20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
10C 120V	ax20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
20C 120V	ax20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
30C 120V	ax20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
40C 120V	ax20	5825	Ant1	5824.987	-13000	-2.23	25	Pass
0C 120V	ax40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
10C 120V	ax40	5190	Ant1	5189.989	-11000	-2.12	25	Pass


20C 120V	ax40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
30C 120V	ax40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
40C 120V	ax40	5190	Ant1	5189.989	-11000	-2.12	25	Pass
0C 120V	ax40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
10C 120V	ax40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
20C 120V	ax40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
30C 120V	ax40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
40C 120V	ax40	5230	Ant1	5229.988	-12000	-2.29	25	Pass
0C 120V	ax40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
10C 120V	ax40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
20C 120V	ax40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
30C 120V	ax40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
40C 120V	ax40	5755	Ant1	5754.987	-13000	-2.26	25	Pass
0C 120V	ax40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
10C 120V	ax40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
20C 120V	ax40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
30C 120V	ax40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
40C 120V	ax40	5795	Ant1	5794.987	-13000	-2.24	25	Pass
0C 120V	ax80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
10C 120V	ax80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
20C 120V	ax80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
30C 120V	ax80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
40C 120V	ax80	5210	Ant1	5209.988	-12000	-2.3	25	Pass
0C 120V	ax80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
10C 120V	ax80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
20C 120V	ax80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
30C 120V	ax80	5775	Ant1	5774.987	-13000	-2.25	25	Pass
40C 120V	ax80	5775	Ant1	5774.987	-13000	-2.25	25	Pass

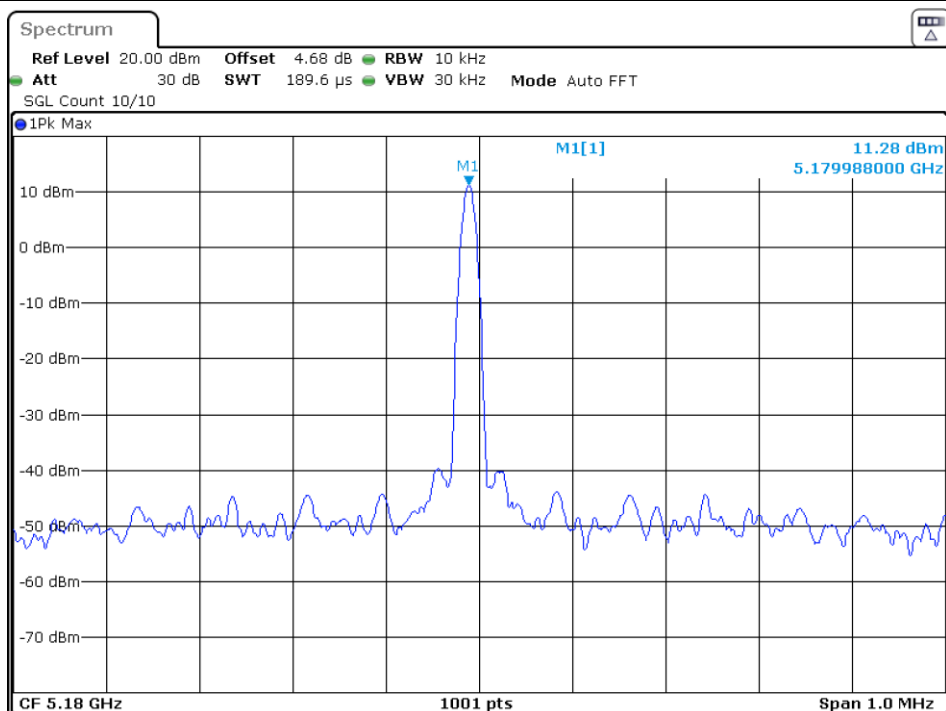


Freq. Stability 0C 120V a 5180MHz Ant1

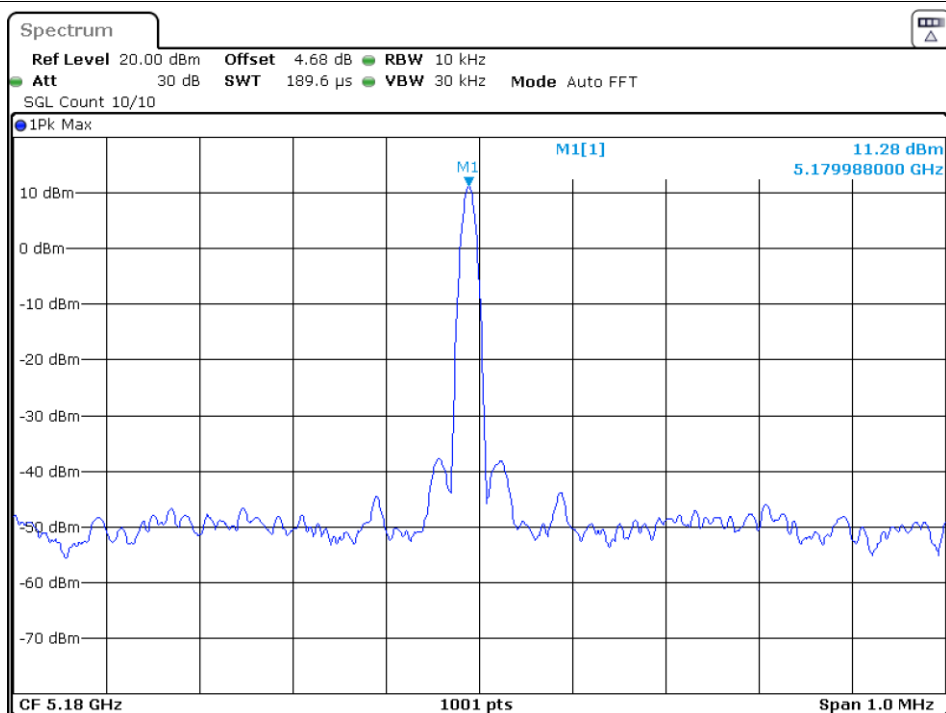


Freq. Stability 10C 120V a 5180MHz Ant1

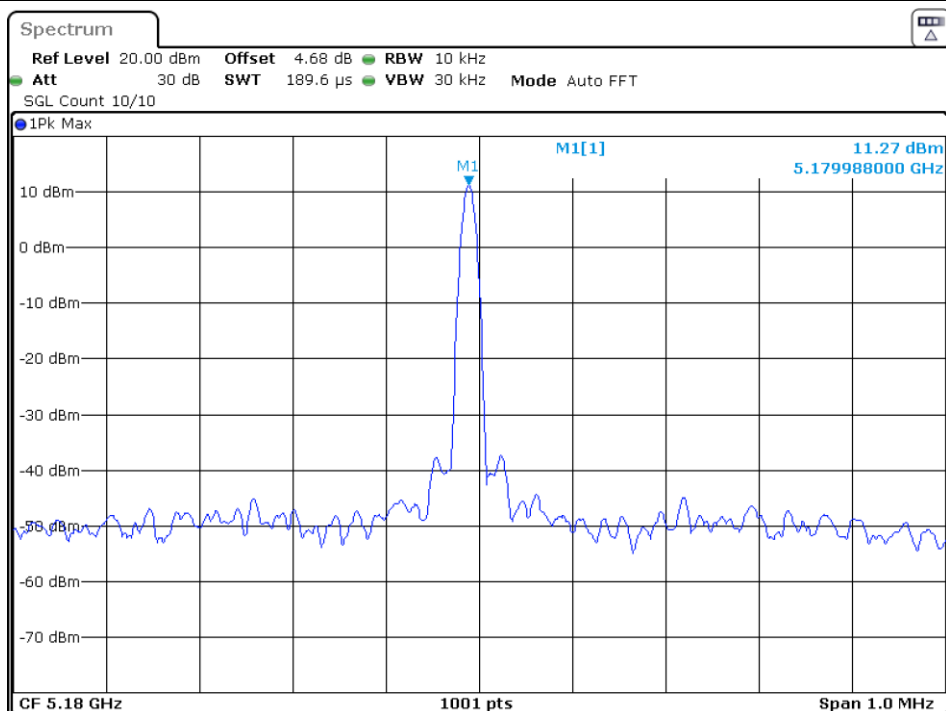


Freq. Stability 20C 120V a 5180MHz Ant1

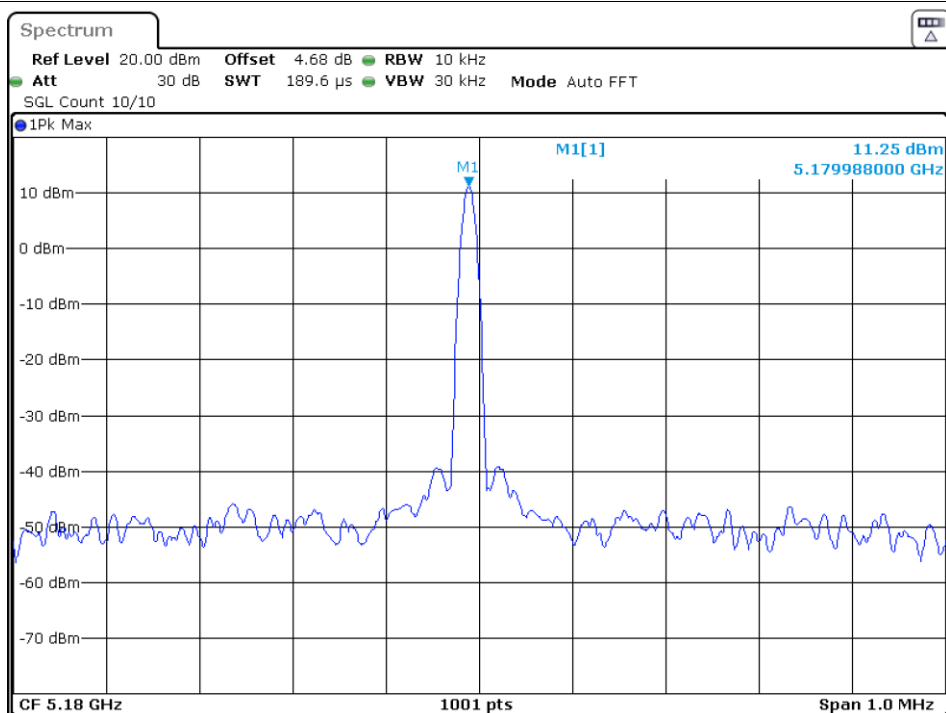


Freq. Stability 30C 120V a 5180MHz Ant1

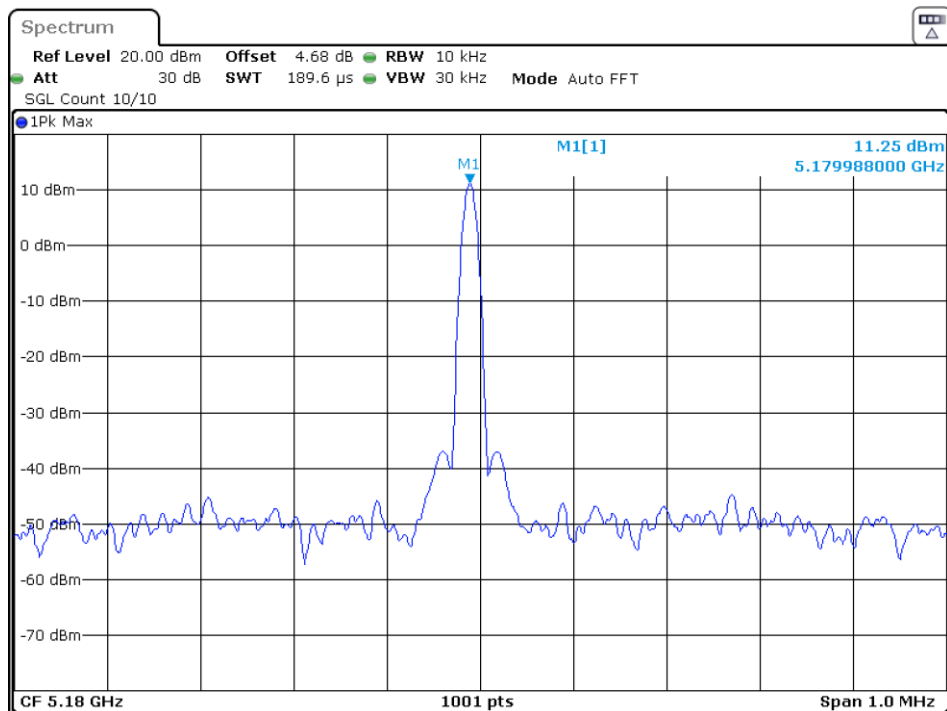


Freq. Stability 40C 120V a 5180MHz Ant1

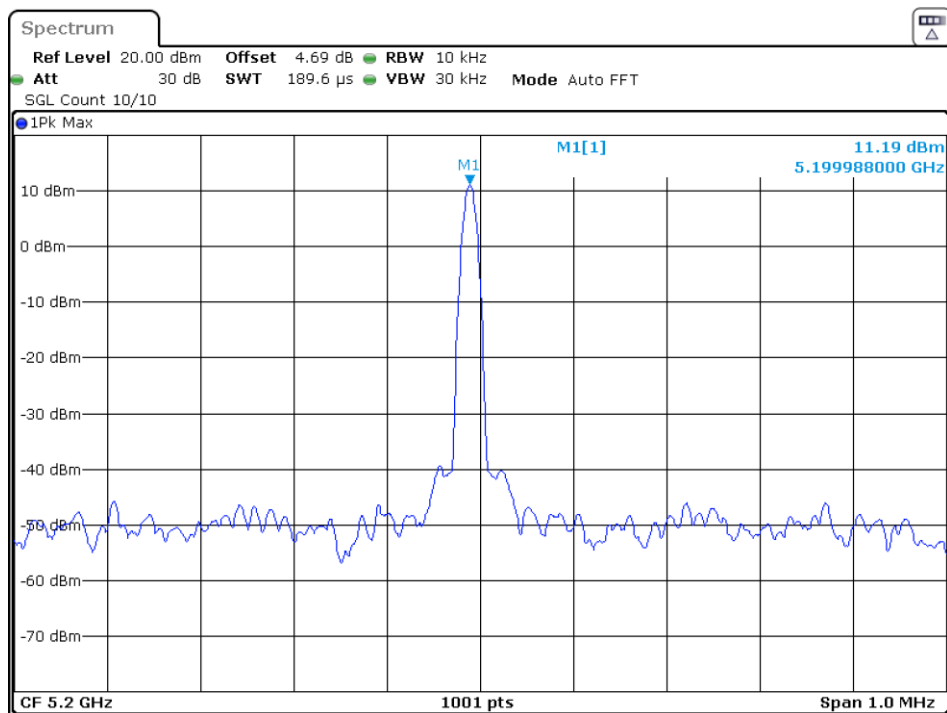


Freq. Stability 0C 120V a 5200MHz Ant1

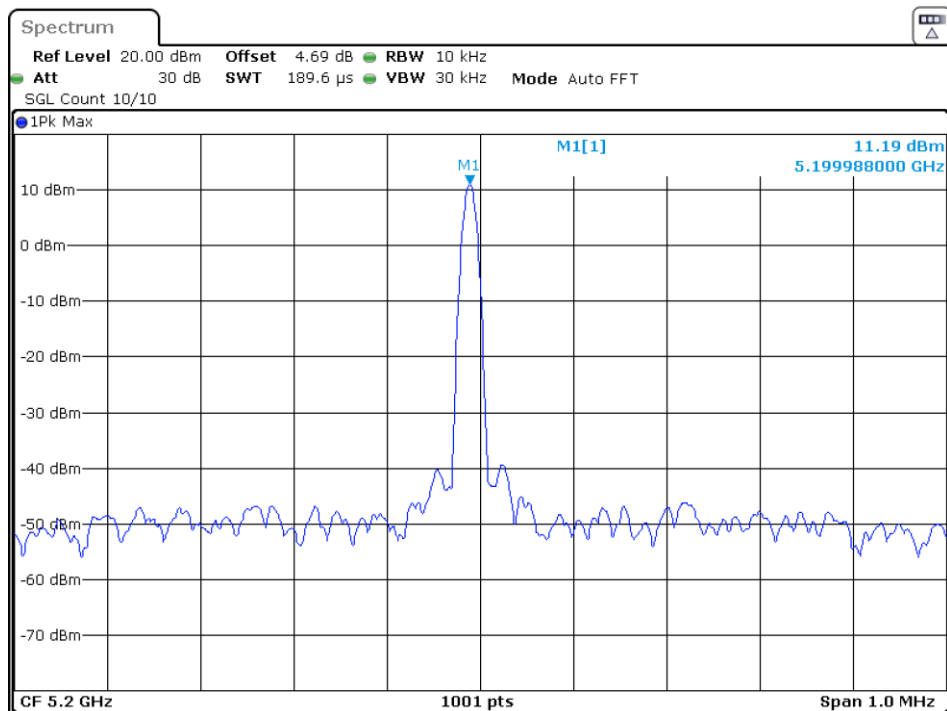


Freq. Stability 10C 120V a 5200MHz Ant1

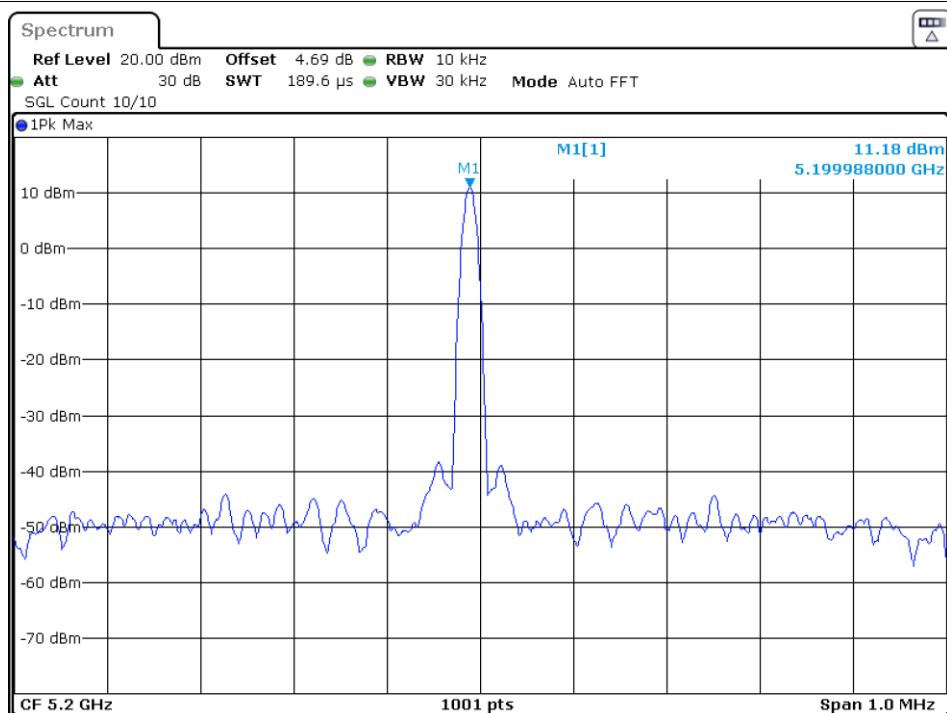


Freq. Stability 20C 120V a 5200MHz Ant1

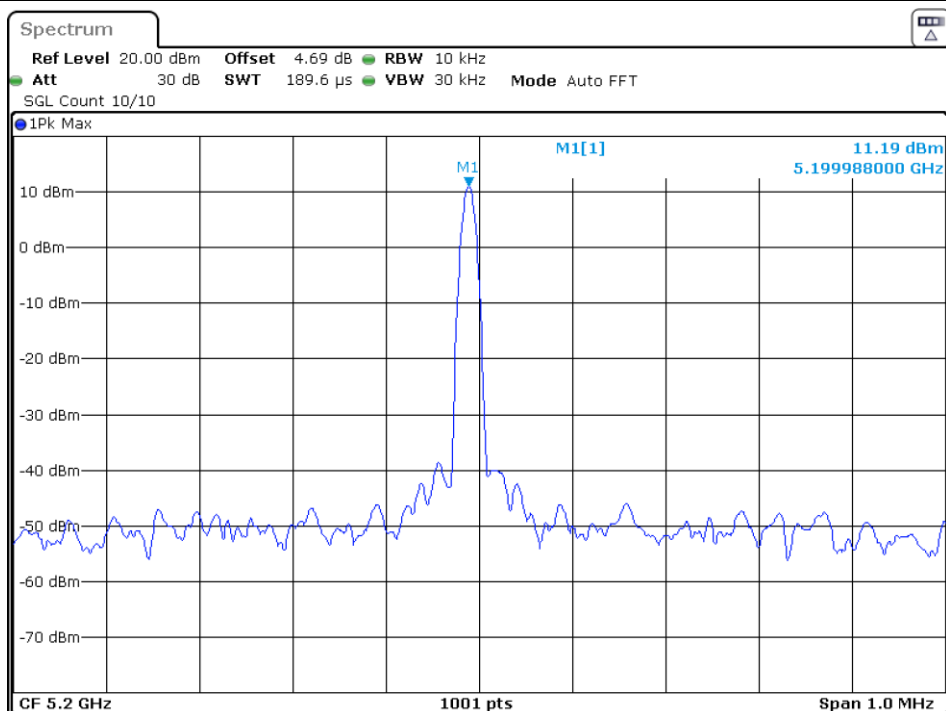


Freq. Stability 30C 120V a 5200MHz Ant1

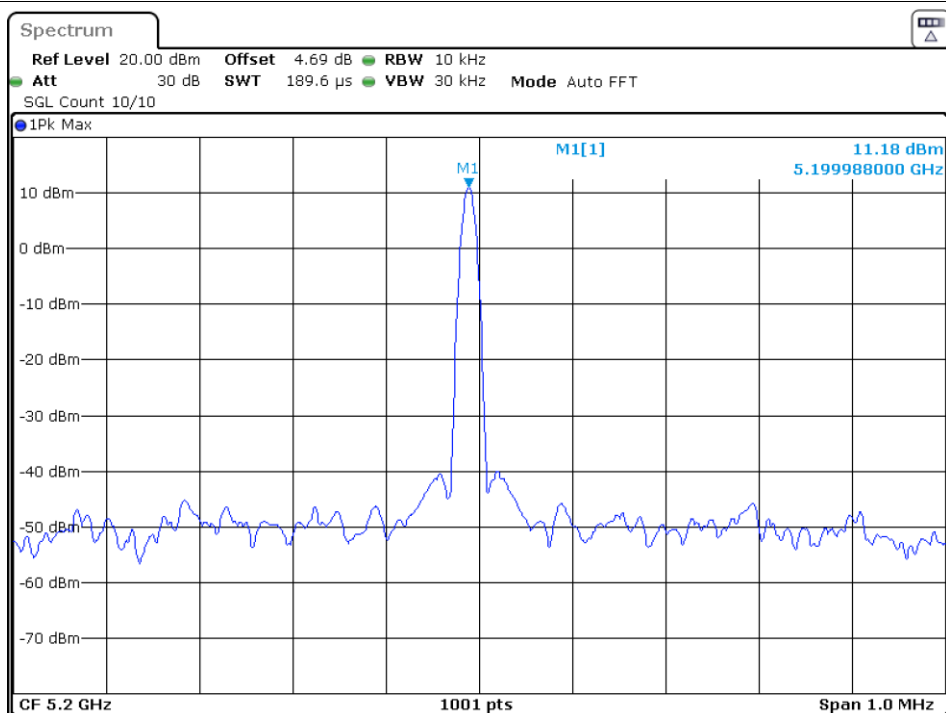


Freq. Stability 40C 120V a 5200MHz Ant1

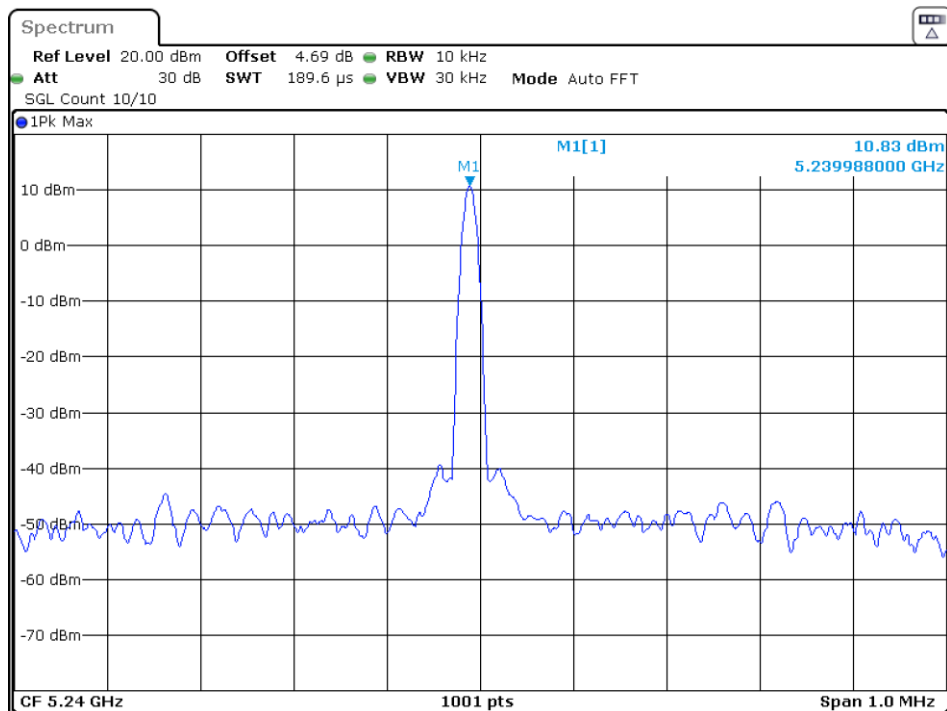


Freq. Stability 0C 120V a 5240MHz Ant1

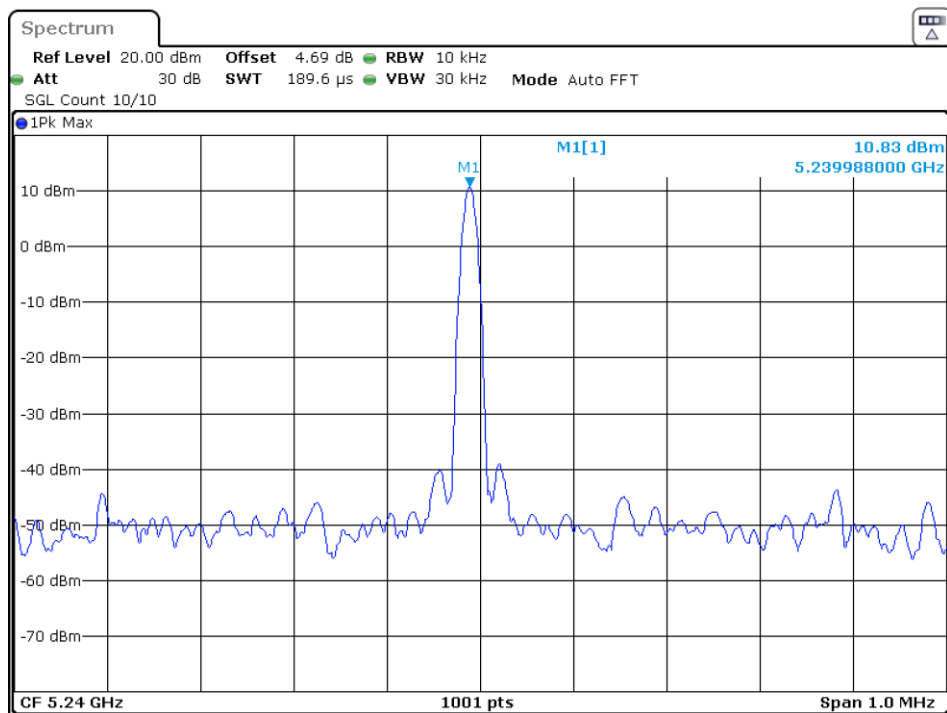


Freq. Stability 10C 120V a 5240MHz Ant1

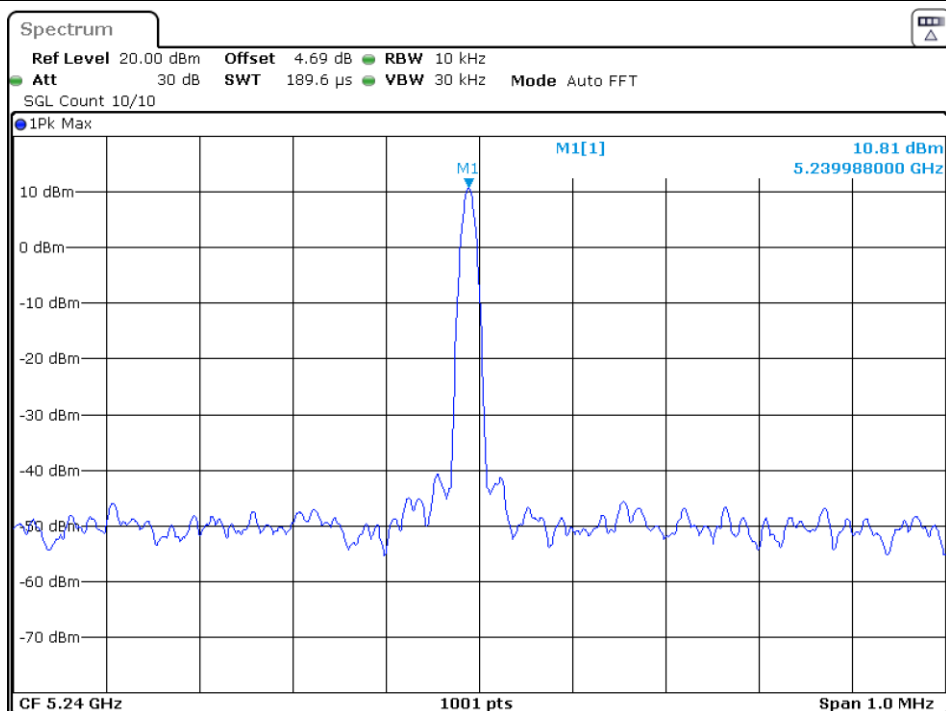


Freq. Stability 20C 120V a 5240MHz Ant1

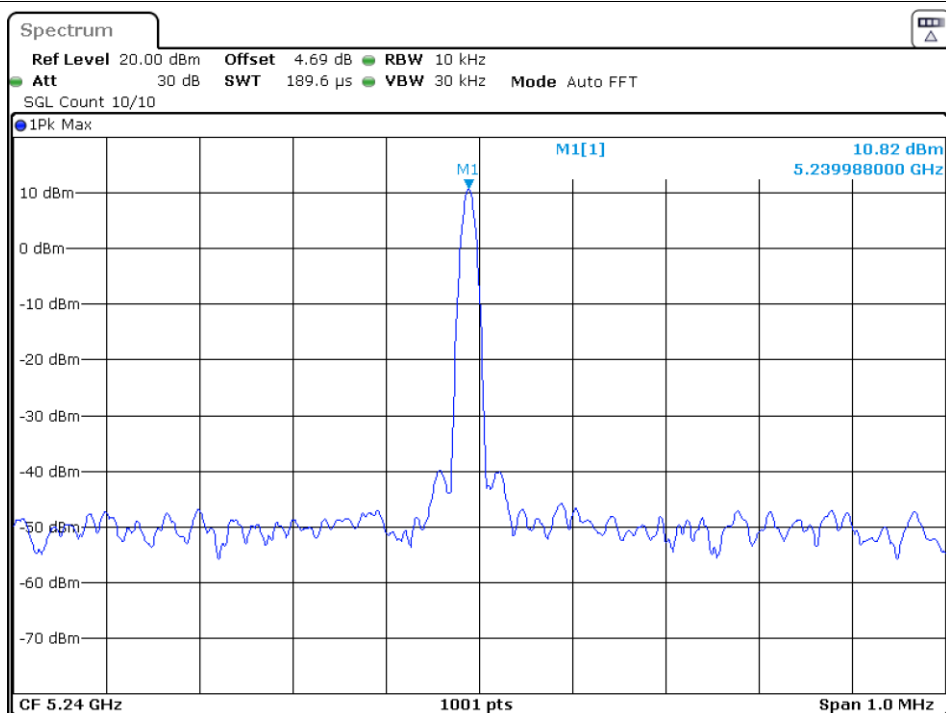

Freq. Stability 30C 120V a 5240MHz Ant1

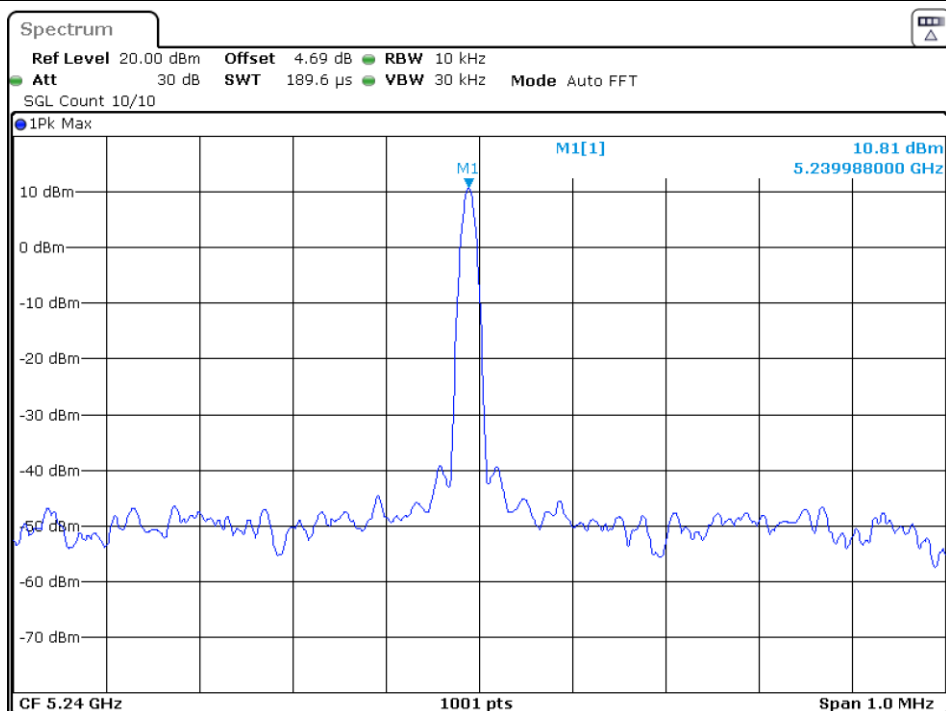

Freq. Stability 40C 120V a 5240MHz Ant1

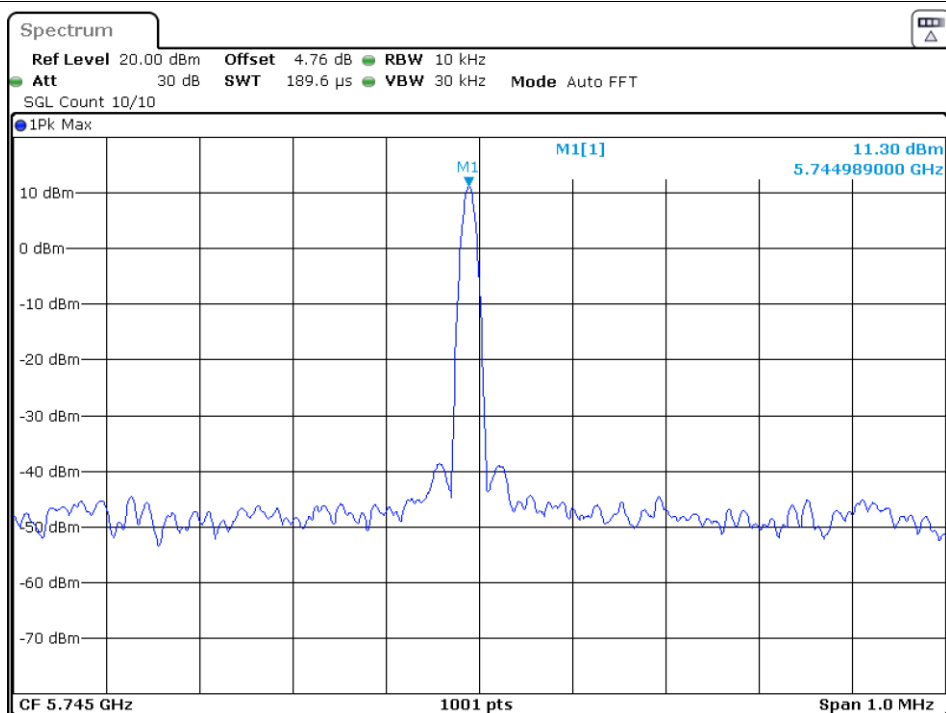

Freq. Stability 0C 120V a 5745MHz Ant1