

Appendix Test Data

Report No.:	1812C60160712504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-3-23	Finish Test Date:	2026-3-30
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24.8°C	Relative Humidity:	60%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	26.480	5166.600	5193.080	---	---
11A	Ant1	5220	27.000	5206.200	5233.200	---	---
11A	Ant1	5240	26.360	5227.000	5253.360	---	---
11A	Ant1	5745	27.160	5730.600	5757.760	---	---
11A	Ant1	5785	26.840	5771.080	5797.920	---	---
11A	Ant1	5825	27.120	5811.000	5838.120	---	---
11N20SISO	Ant1	5180	27.840	5166.440	5194.280	---	---
11N20SISO	Ant1	5220	28.720	5205.880	5234.600	---	---
11N20SISO	Ant1	5240	27.440	5226.720	5254.160	---	---
11N20SISO	Ant1	5745	28.320	5730.680	5759.000	---	---
11N20SISO	Ant1	5785	28.280	5770.800	5799.080	---	---
11N20SISO	Ant1	5825	27.720	5811.160	5838.880	---	---
11N40SISO	Ant1	5190	47.760	5166.080	5213.840	---	---
11N40SISO	Ant1	5230	48.320	5205.760	5254.080	---	---
11N40SISO	Ant1	5755	48.080	5730.920	5779.000	---	---
11N40SISO	Ant1	5795	48.240	5770.360	5818.600	---	---
11AC20SISO	Ant1	5180	27.640	5166.240	5193.880	---	---
11AC20SISO	Ant1	5220	27.000	5206.640	5233.640	---	---
11AC20SISO	Ant1	5240	26.320	5226.520	5252.840	---	---
11AC20SISO	Ant1	5745	27.440	5731.000	5758.440	---	---
11AC20SISO	Ant1	5785	28.200	5770.520	5798.720	---	---
11AC20SISO	Ant1	5825	27.800	5811.160	5838.960	---	---
11AC40SISO	Ant1	5190	47.840	5166.400	5214.240	---	---
11AC40SISO	Ant1	5230	47.680	5206.560	5254.240	---	---
11AC40SISO	Ant1	5755	48.080	5730.680	5778.760	---	---


11AC40SISO	Ant1	5795	50.160	5769.880	5820.040	---	---
11AX20SISO	Ant1	5180	29.120	5166.480	5195.600	---	---
11AX20SISO	Ant1	5220	28.440	5206.840	5235.280	---	---
11AX20SISO	Ant1	5240	28.720	5226.920	5255.640	---	---
11AX20SISO	Ant1	5745	28.680	5732.040	5760.720	---	---
11AX20SISO	Ant1	5785	28.800	5771.200	5800.000	---	---
11AX20SISO	Ant1	5825	27.000	5812.040	5839.040	---	---
11AX40SISO	Ant1	5190	44.320	5167.920	5212.240	---	---
11AX40SISO	Ant1	5230	45.840	5207.280	5253.120	---	---
11AX40SISO	Ant1	5755	48.880	5729.960	5778.840	---	---
11AX40SISO	Ant1	5795	47.920	5771.000	5818.920	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

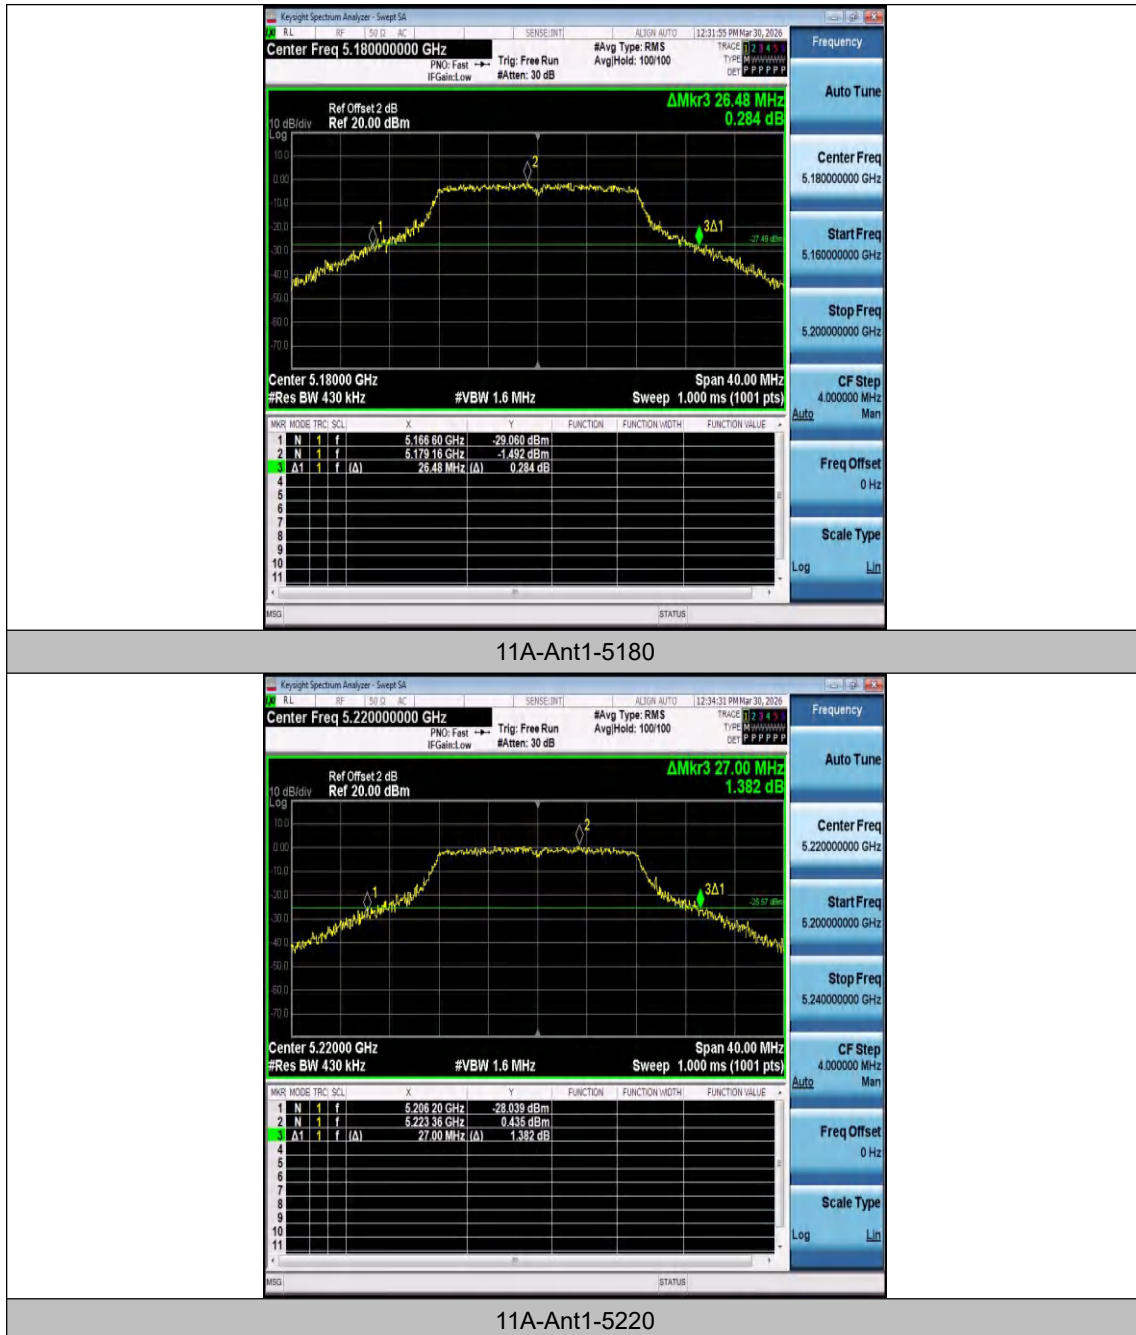





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

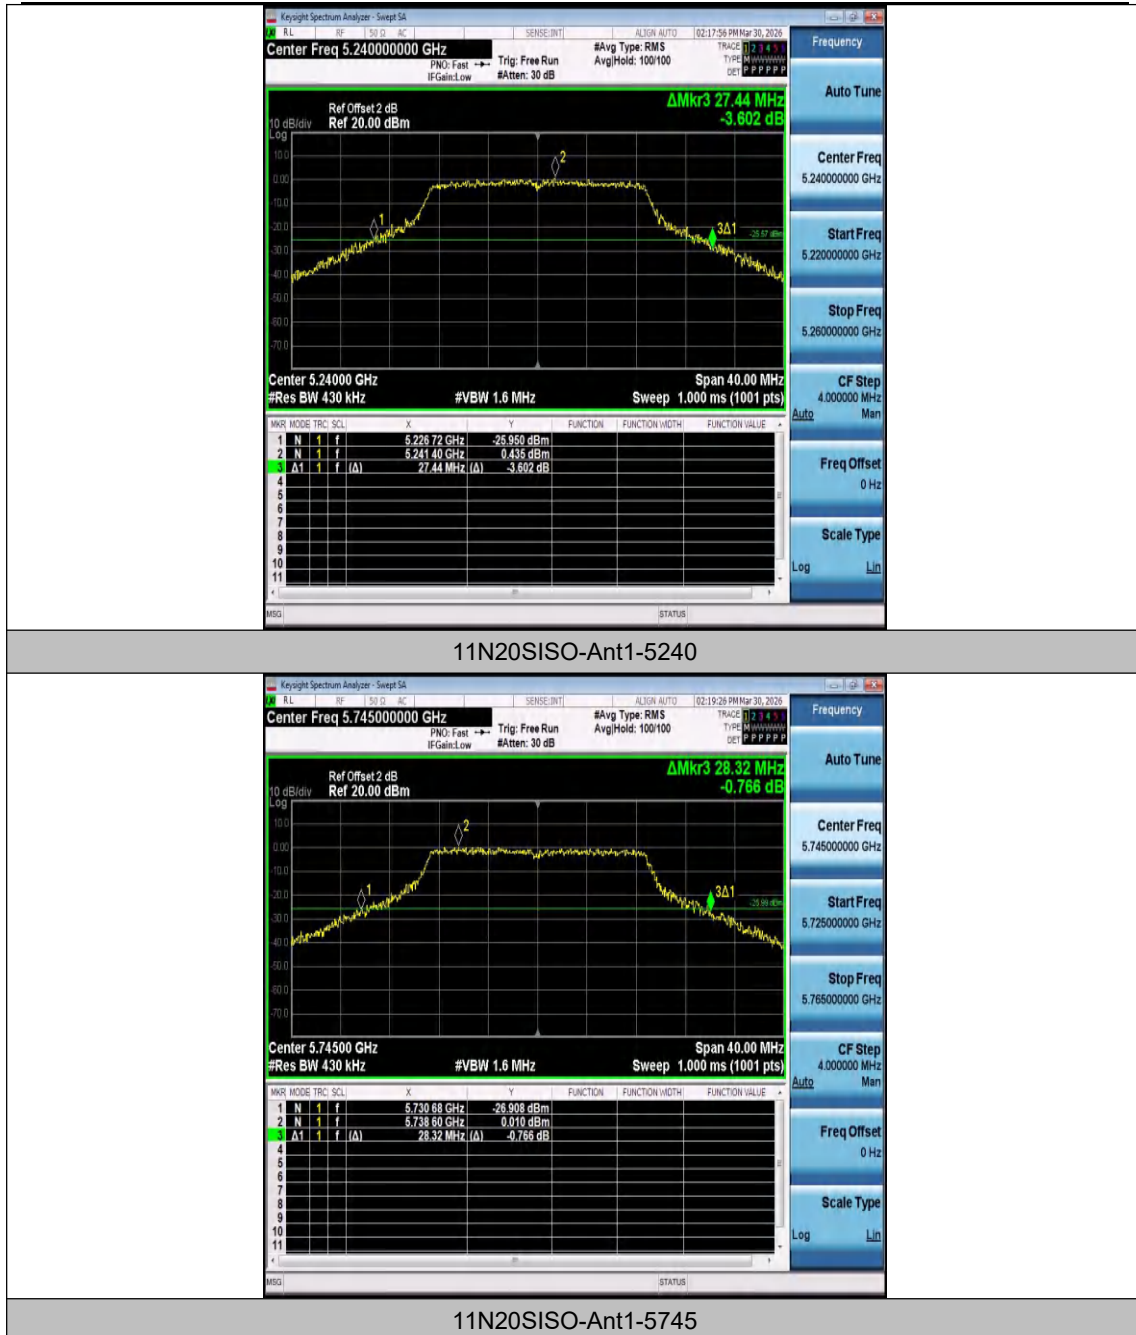



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



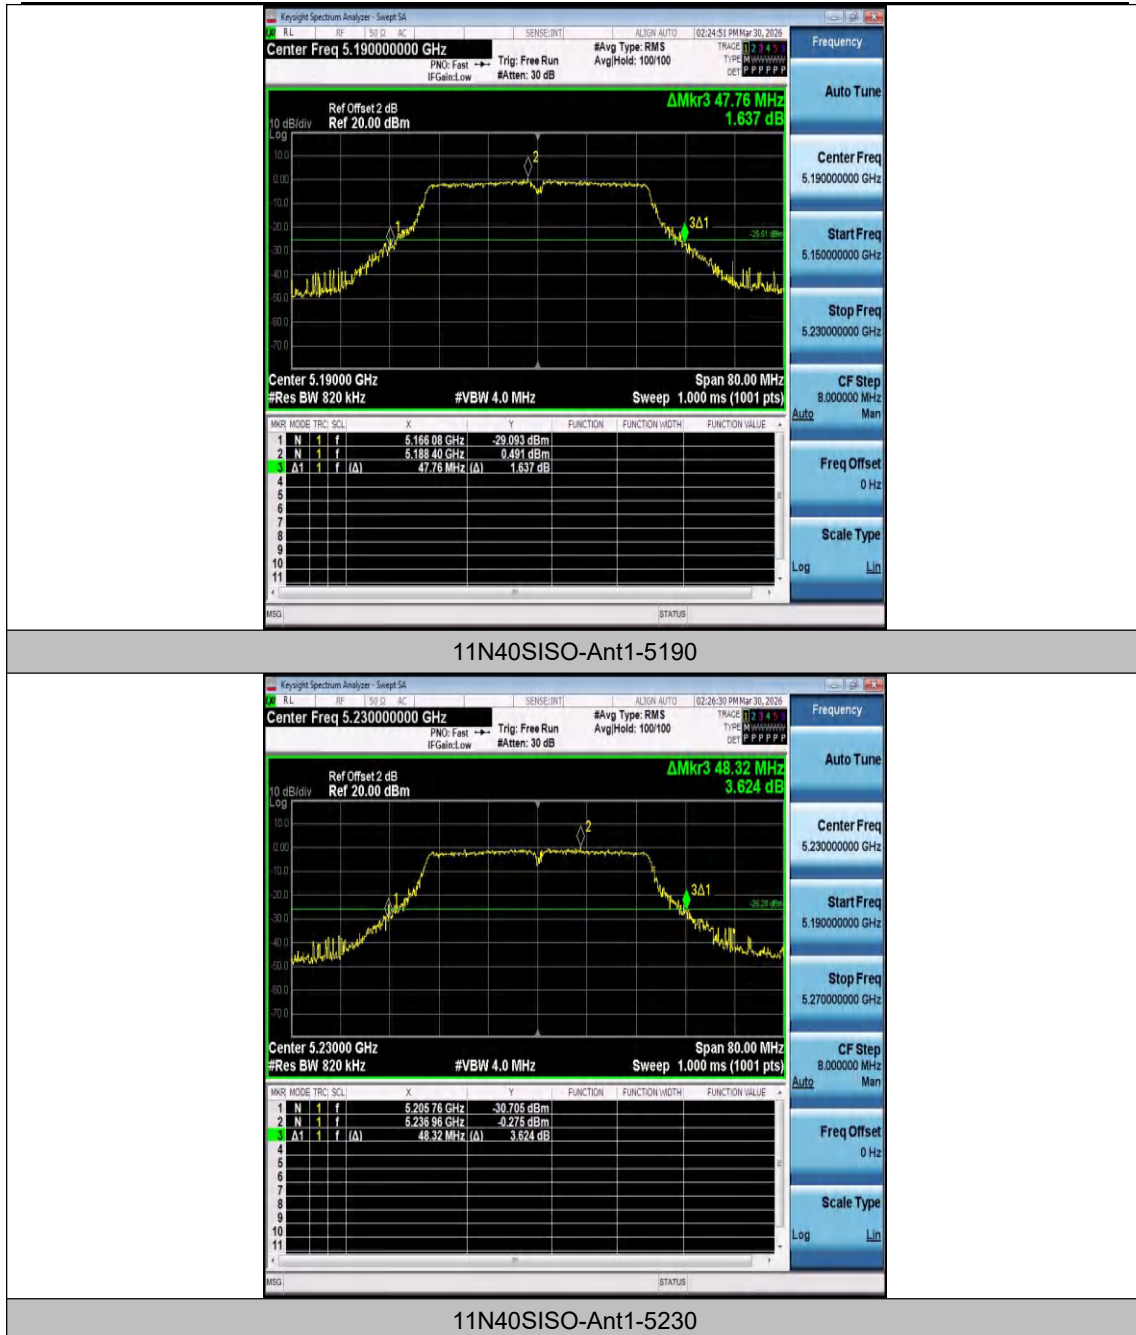

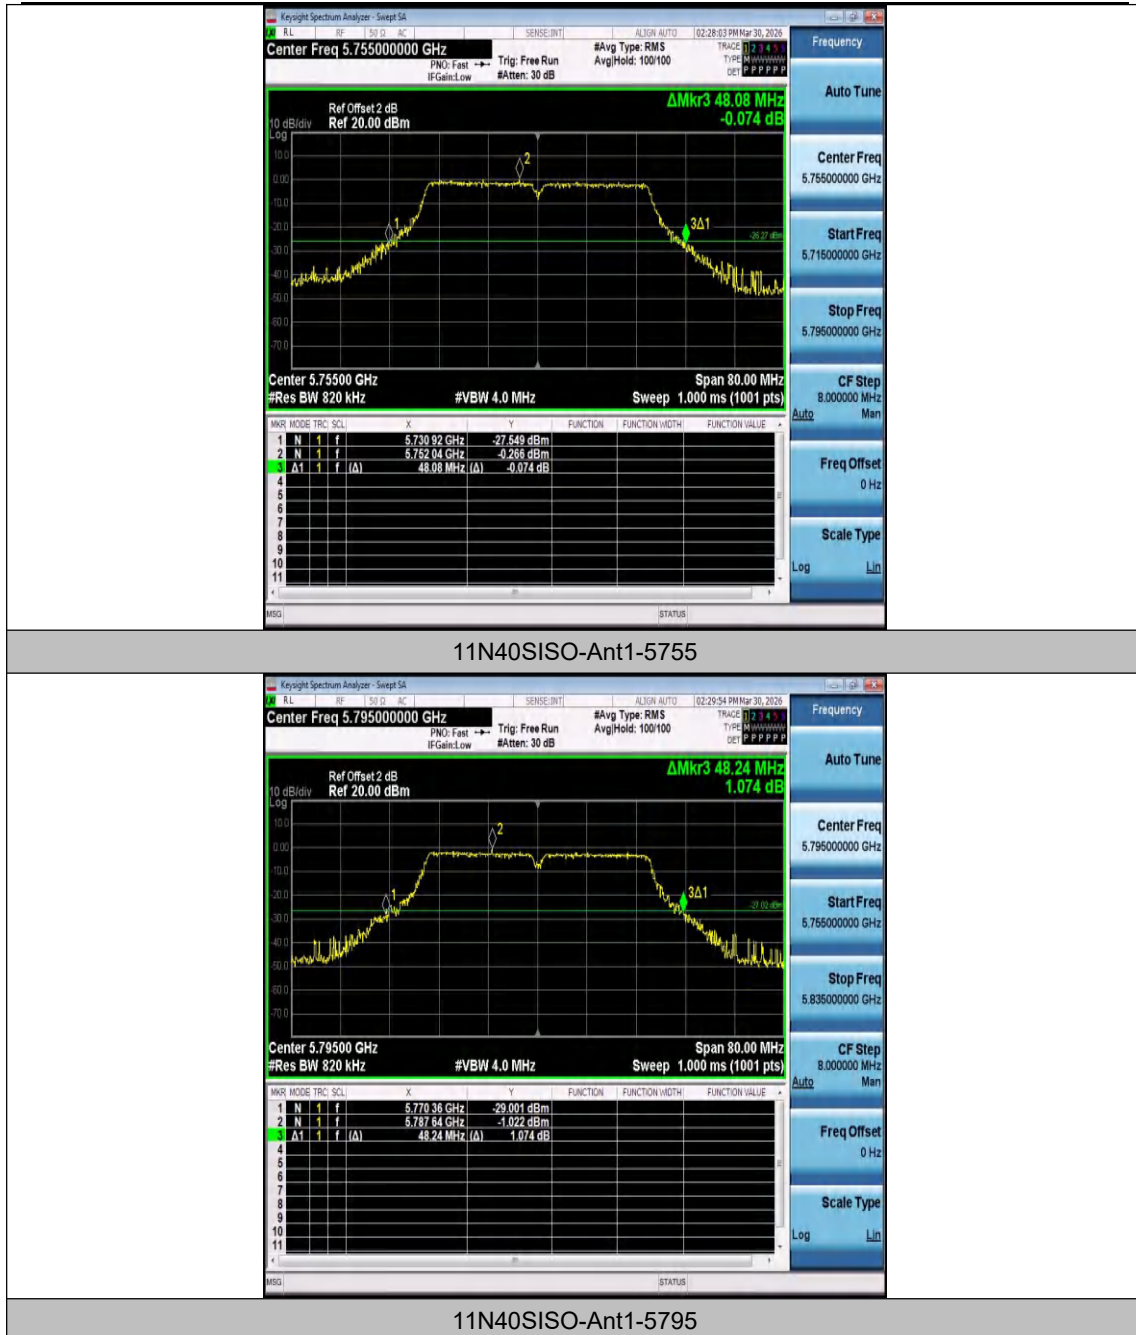

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com










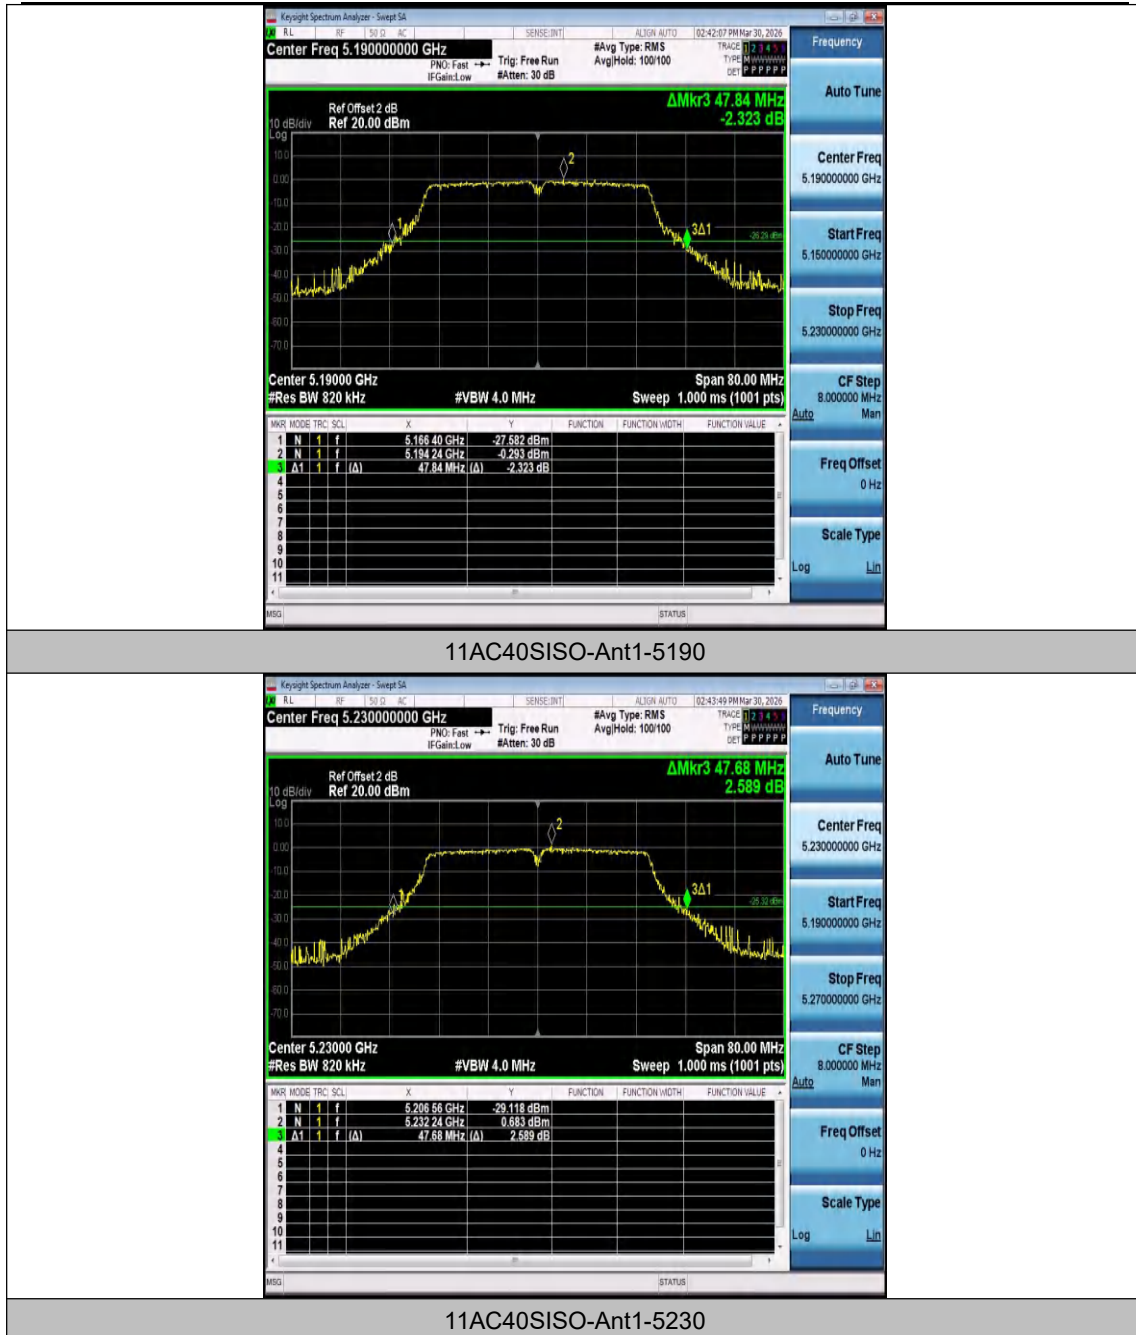





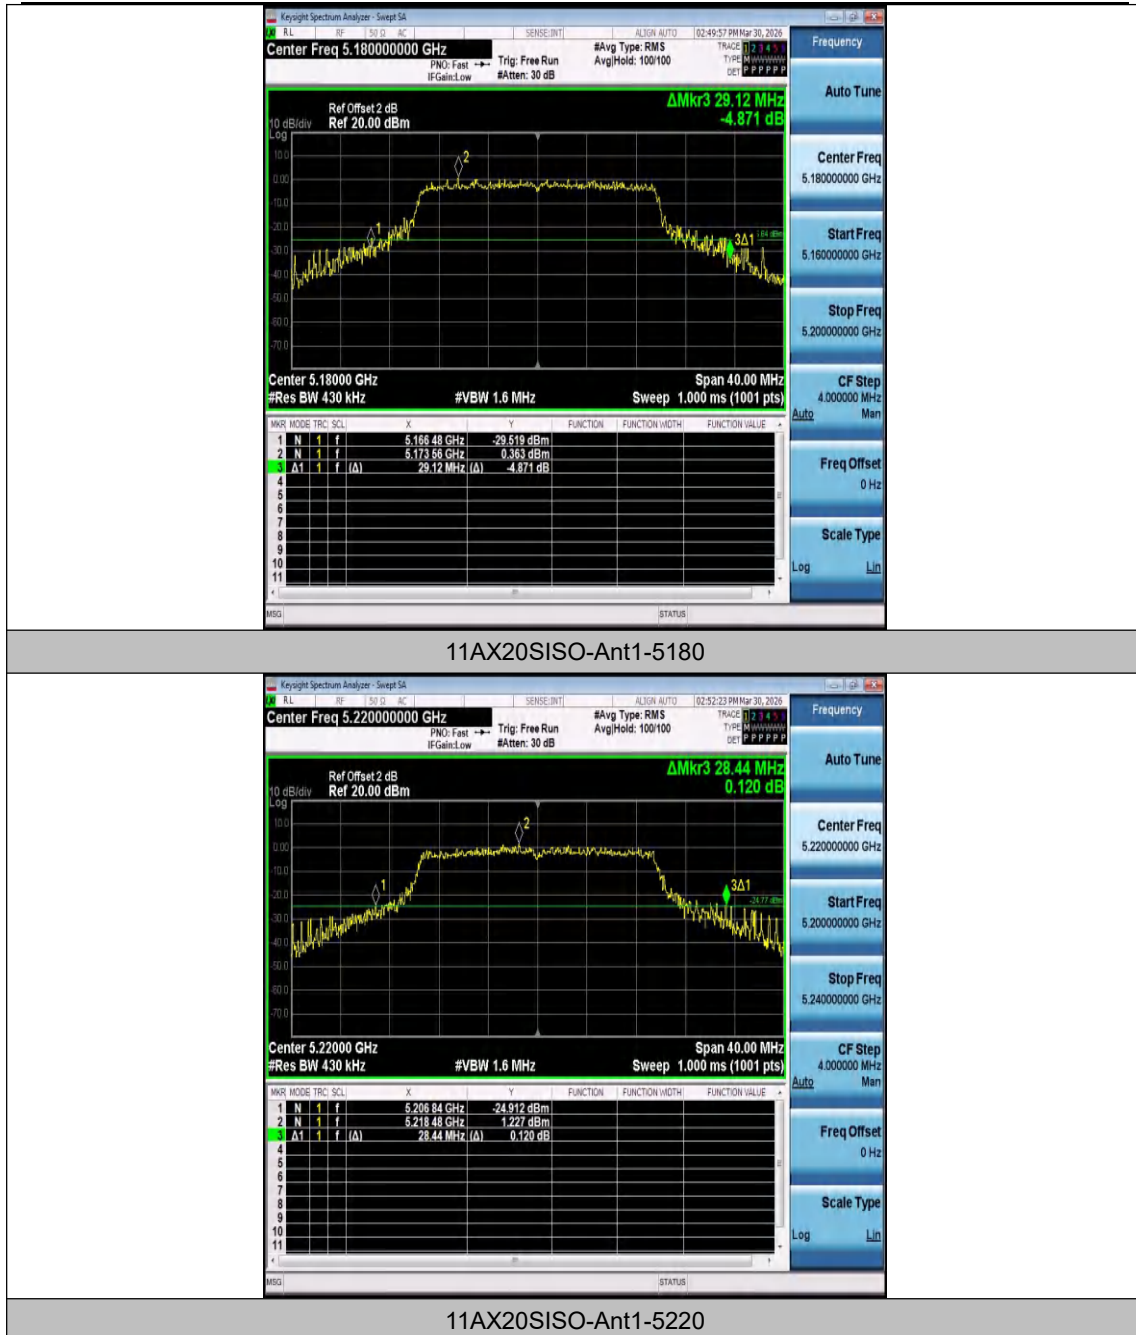

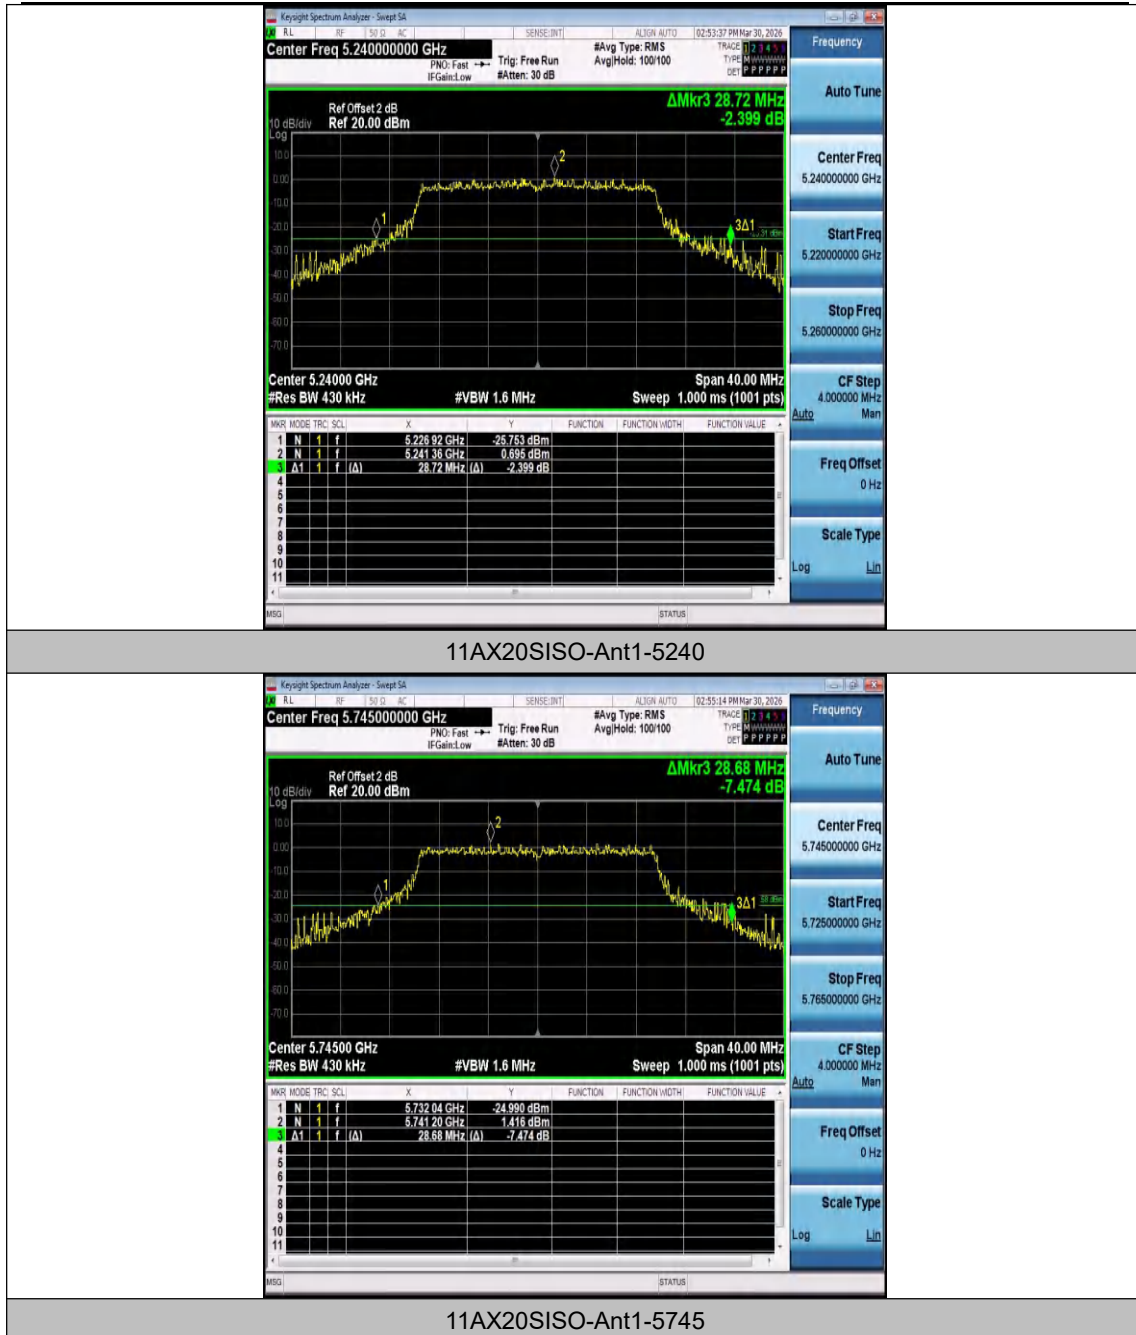

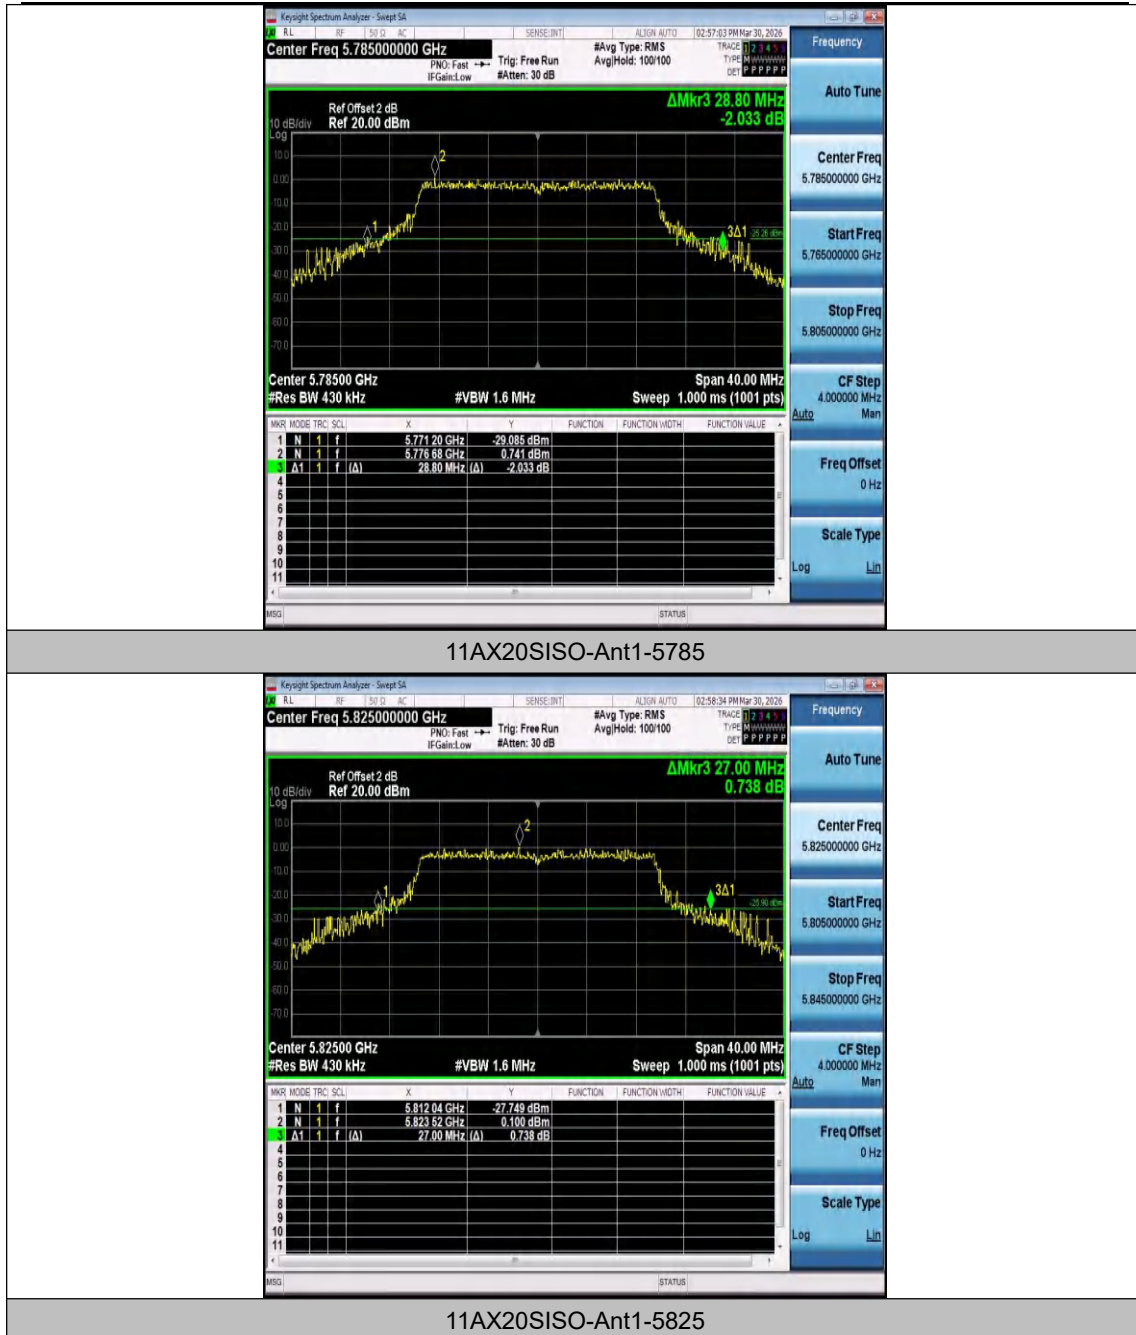

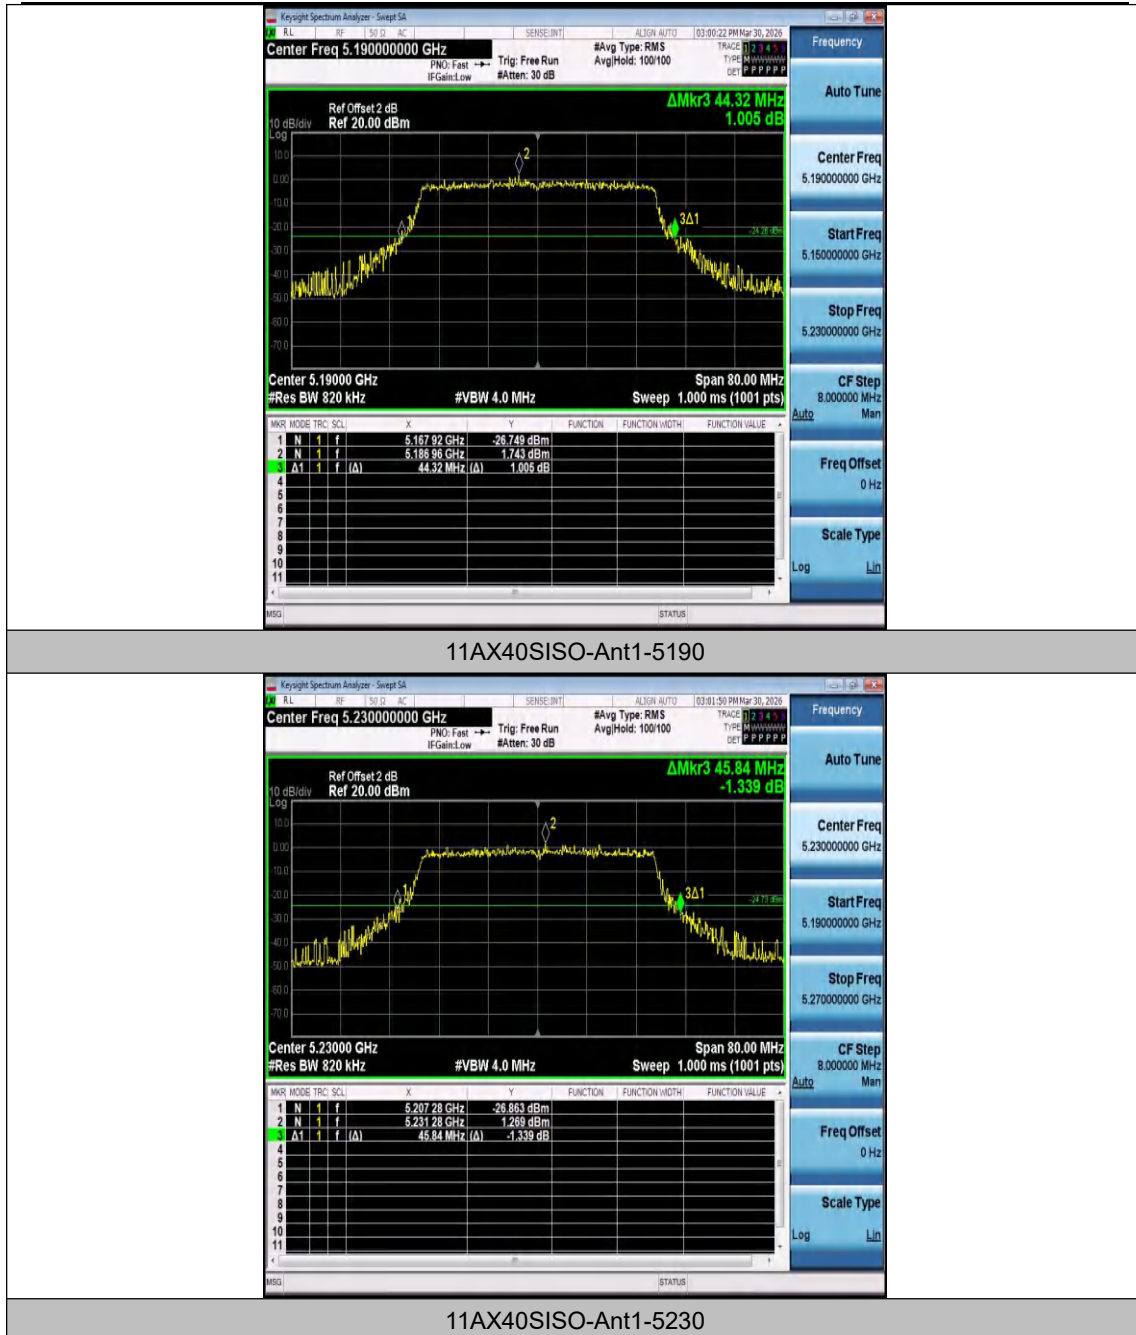

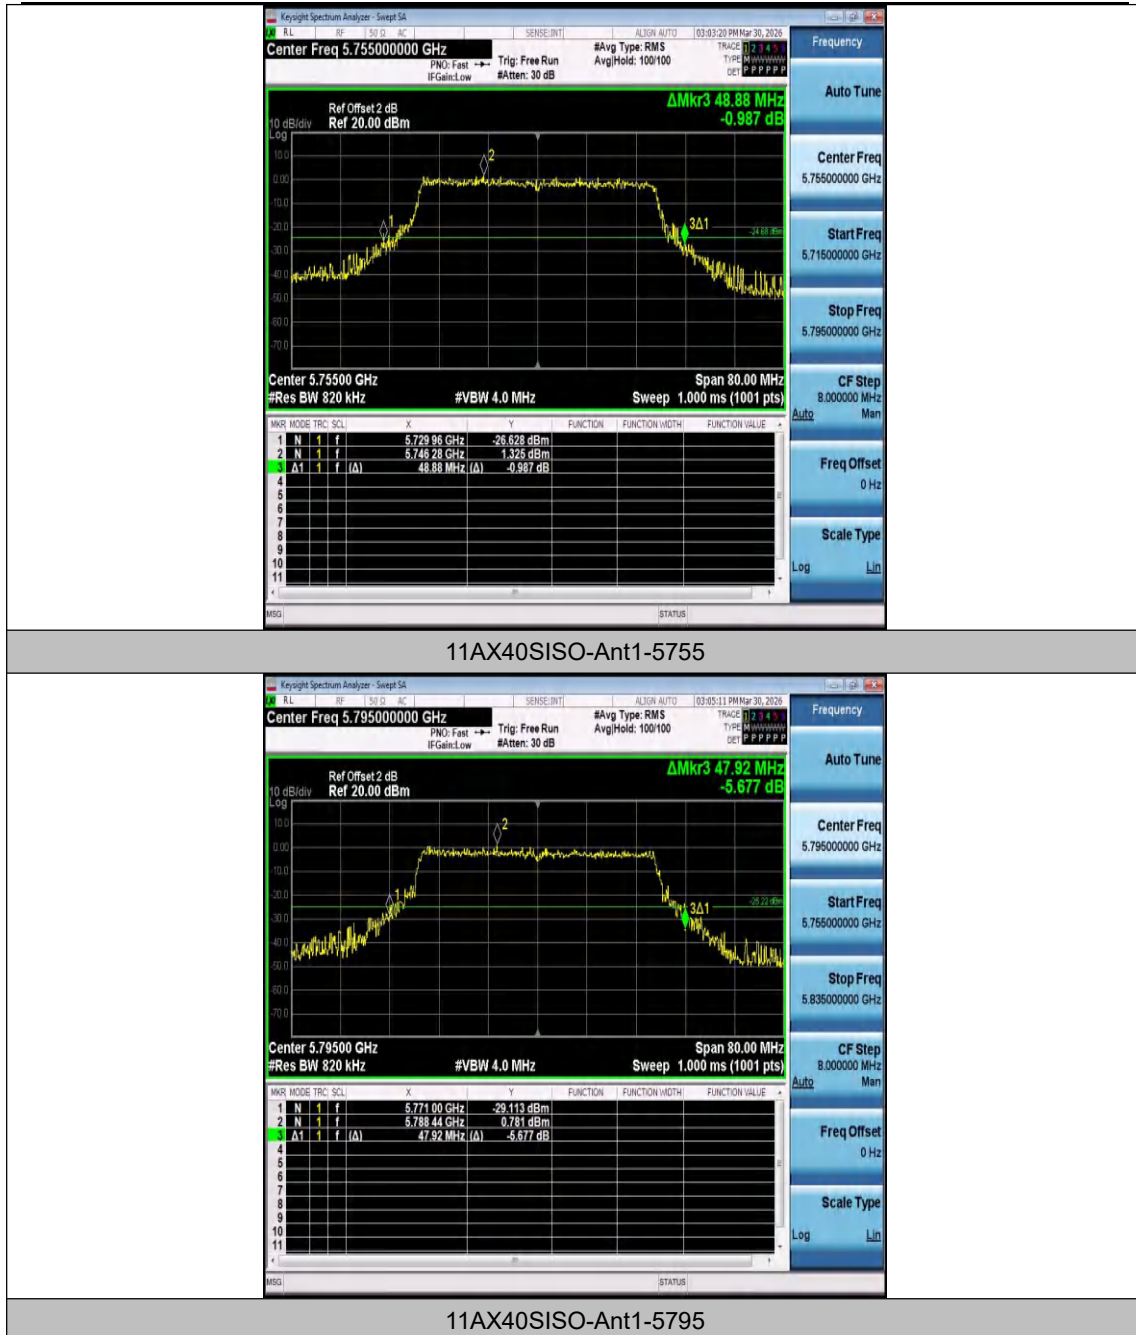

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.453	5171.3046	5188.7576	---	---
11A	Ant1	5220	17.501	5211.2428	5228.7438	---	---
11A	Ant1	5240	17.474	5231.3458	5248.8198	---	---
11A	Ant1	5745	17.733	5736.0191	5753.7521	---	---
11A	Ant1	5785	17.653	5776.0792	5793.7322	---	---
11A	Ant1	5825	17.713	5816.0978	5833.8108	---	---
11N20SISO	Ant1	5180	18.575	5170.7911	5189.3661	---	---
11N20SISO	Ant1	5220	18.566	5210.7763	5229.3423	---	---
11N20SISO	Ant1	5240	18.526	5230.7892	5249.3152	---	---
11N20SISO	Ant1	5745	18.775	5735.5913	5754.3663	---	---
11N20SISO	Ant1	5785	18.765	5775.5909	5794.3559	---	---
11N20SISO	Ant1	5825	18.748	5815.6165	5834.3645	---	---
11N40SISO	Ant1	5190	36.791	5171.6419	5208.4329	---	---
11N40SISO	Ant1	5230	36.981	5211.6485	5248.6295	---	---
11N40SISO	Ant1	5755	37.155	5736.3483	5773.5033	---	---
11N40SISO	Ant1	5795	37.281	5776.3344	5813.6154	---	---
11AC20SISO	Ant1	5180	18.466	5170.8054	5189.2714	---	---
11AC20SISO	Ant1	5220	18.494	5210.8167	5229.3107	---	---
11AC20SISO	Ant1	5240	18.570	5230.7752	5249.3452	---	---
11AC20SISO	Ant1	5745	18.775	5735.6004	5754.3754	---	---
11AC20SISO	Ant1	5785	18.725	5775.6072	5794.3322	---	---
11AC20SISO	Ant1	5825	18.811	5815.5736	5834.3846	---	---
11AC40SISO	Ant1	5190	36.998	5171.5031	5208.5011	---	---
11AC40SISO	Ant1	5230	36.870	5211.6715	5248.5415	---	---
11AC40SISO	Ant1	5755	37.170	5736.3112	5773.4812	---	---
11AC40SISO	Ant1	5795	37.126	5776.4739	5813.5999	---	---
11AX20SISO	Ant1	5180	19.318	5170.3918	5189.7098	---	---
11AX20SISO	Ant1	5220	19.357	5210.4046	5229.7616	---	---
11AX20SISO	Ant1	5240	19.229	5230.4577	5249.6867	---	---
11AX20SISO	Ant1	5745	19.529	5735.1936	5754.7226	---	---
11AX20SISO	Ant1	5785	19.412	5775.3186	5794.7306	---	---
11AX20SISO	Ant1	5825	19.542	5815.2711	5834.8131	---	---
11AX40SISO	Ant1	5190	38.023	5171.1182	5209.1412	---	---
11AX40SISO	Ant1	5230	38.131	5211.0173	5249.1483	---	---
11AX40SISO	Ant1	5755	38.238	5735.8423	5774.0803	---	---
11AX40SISO	Ant1	5795	38.323	5775.8843	5814.2073	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

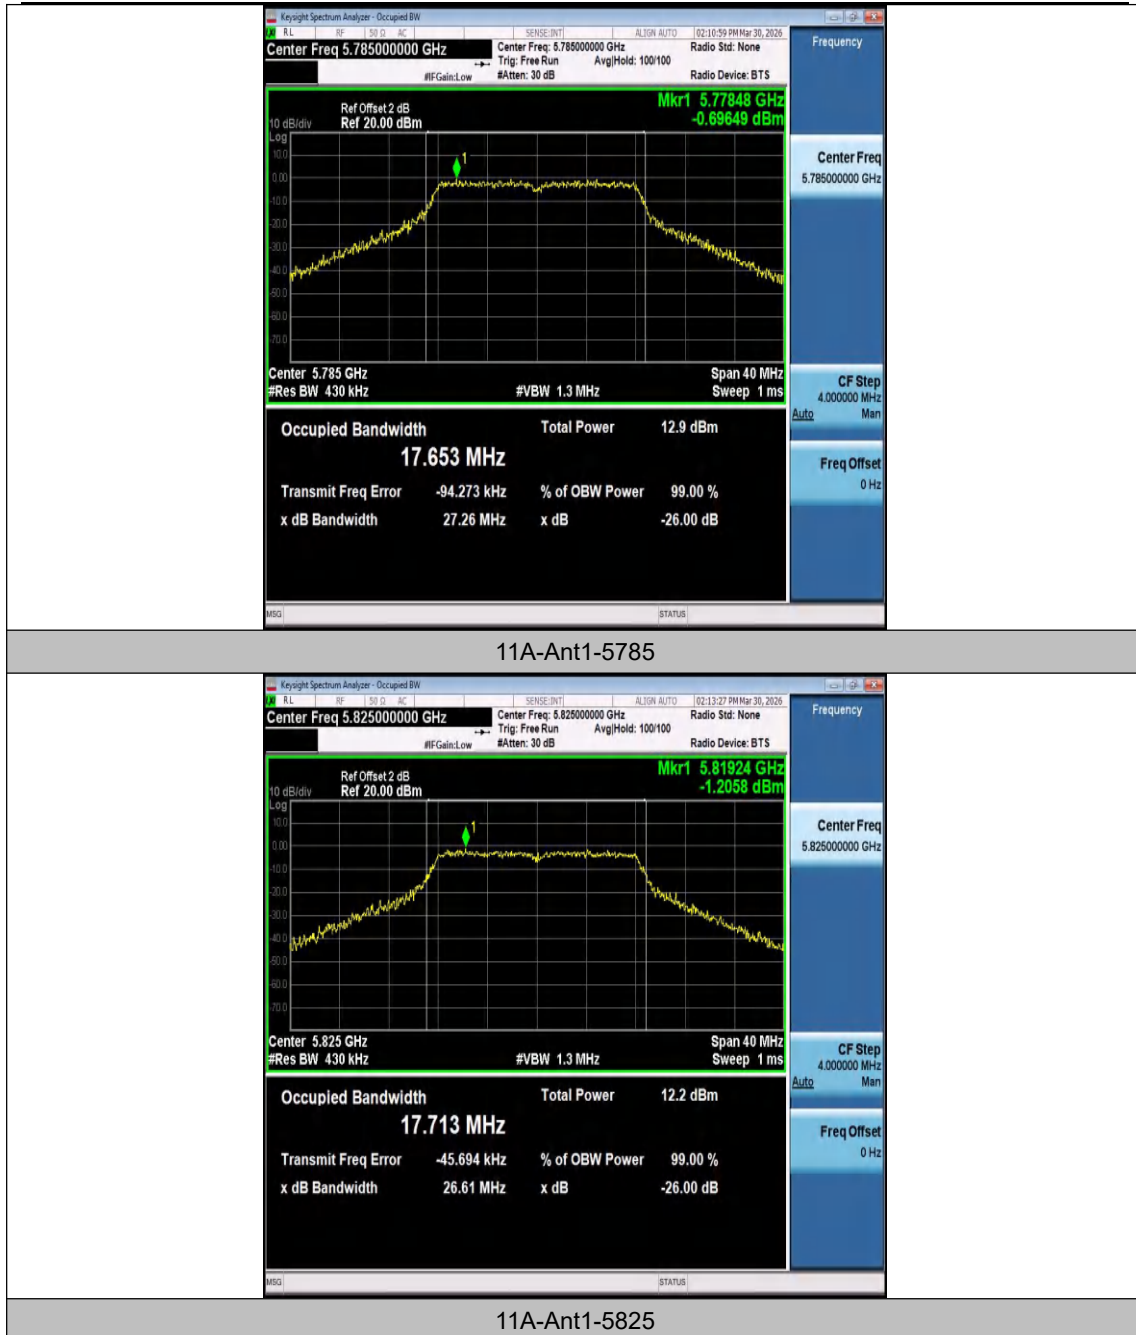

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

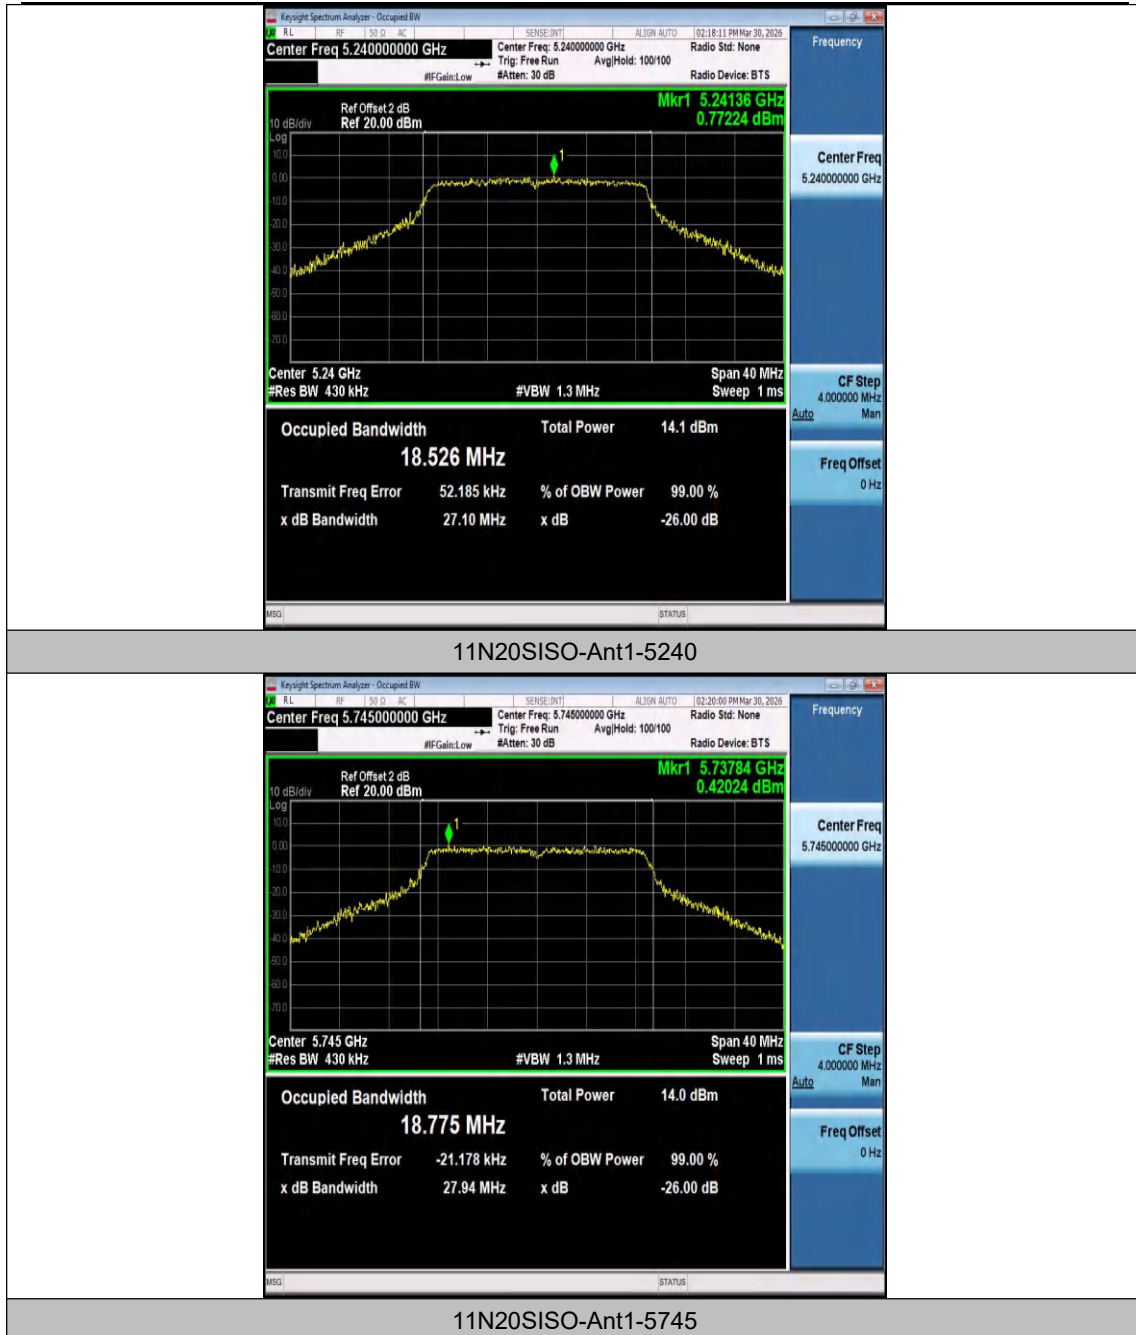

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

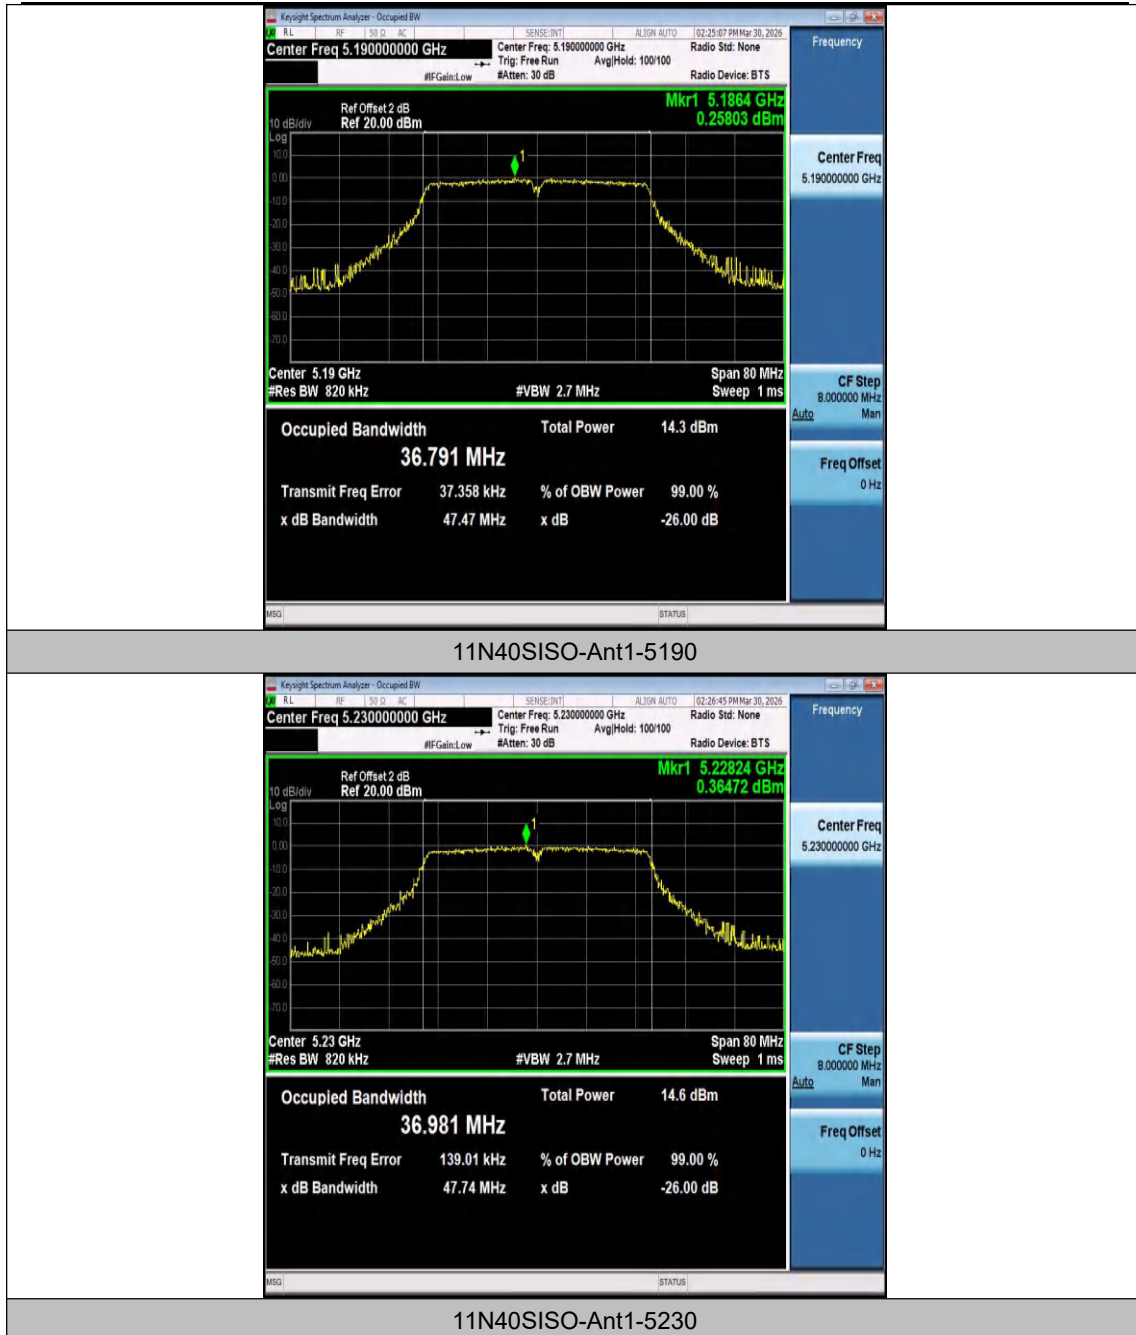

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

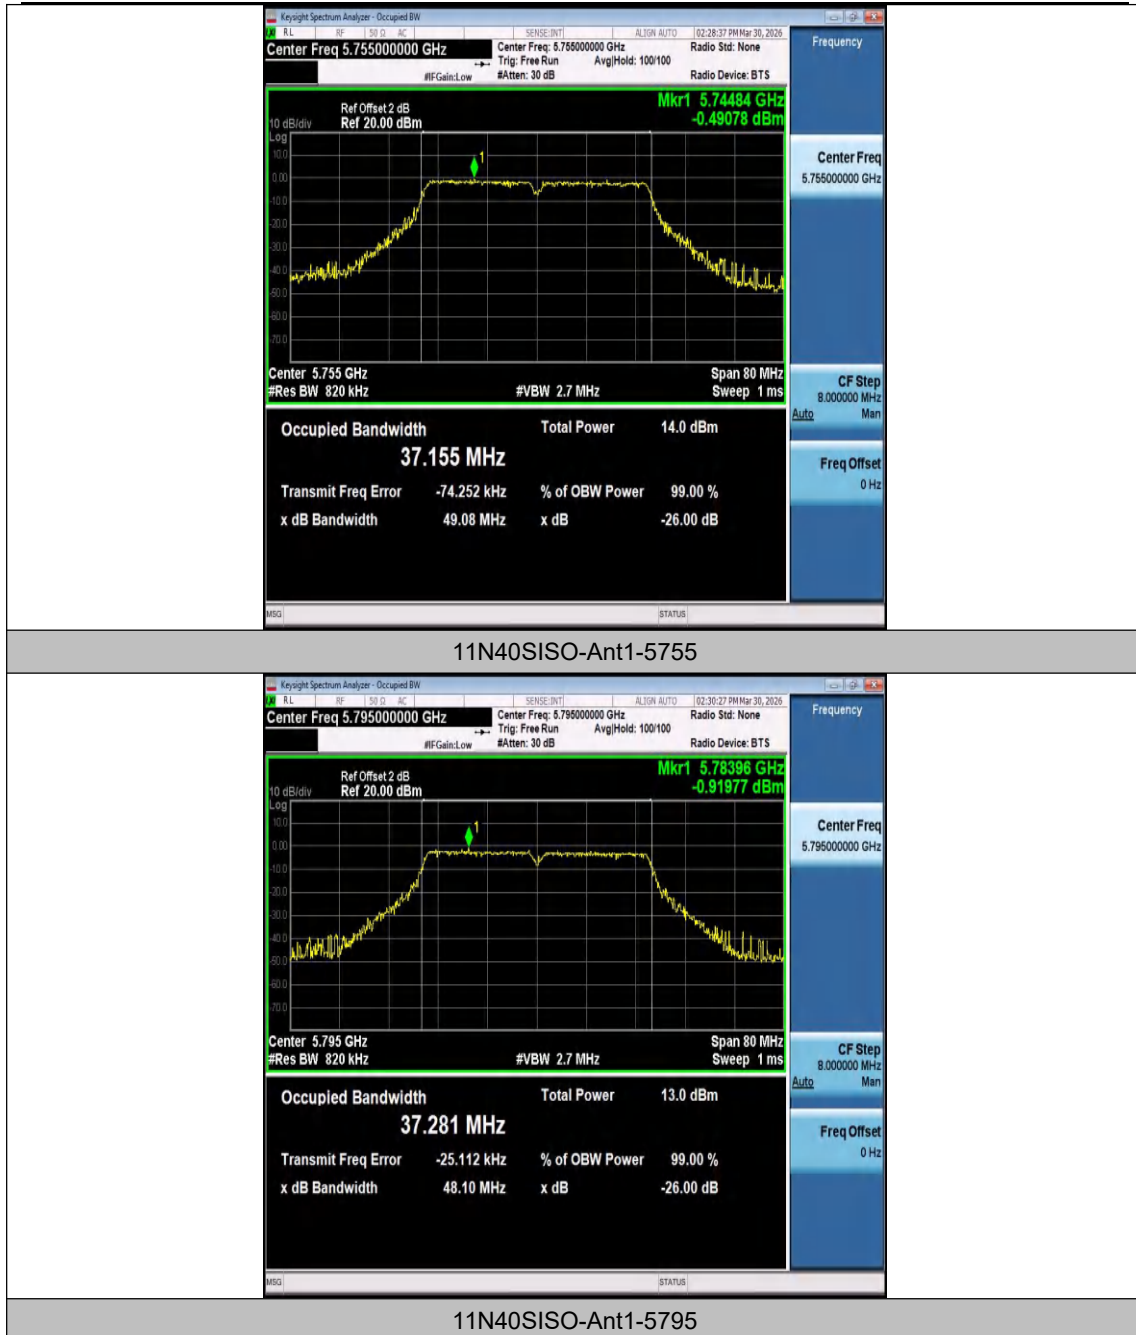

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

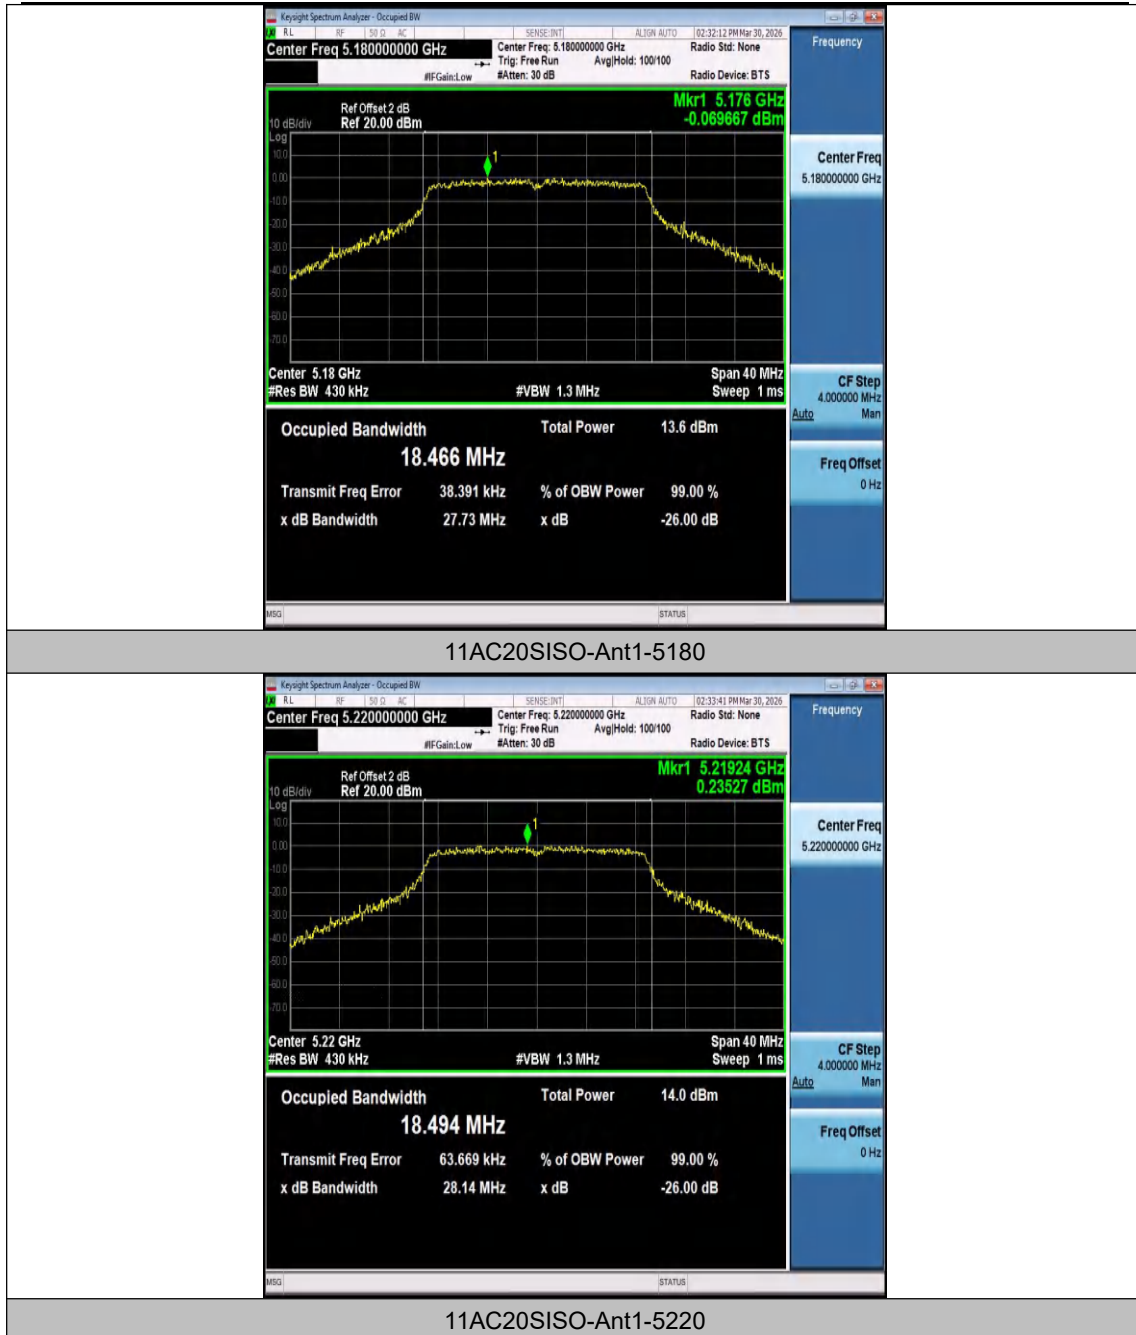

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

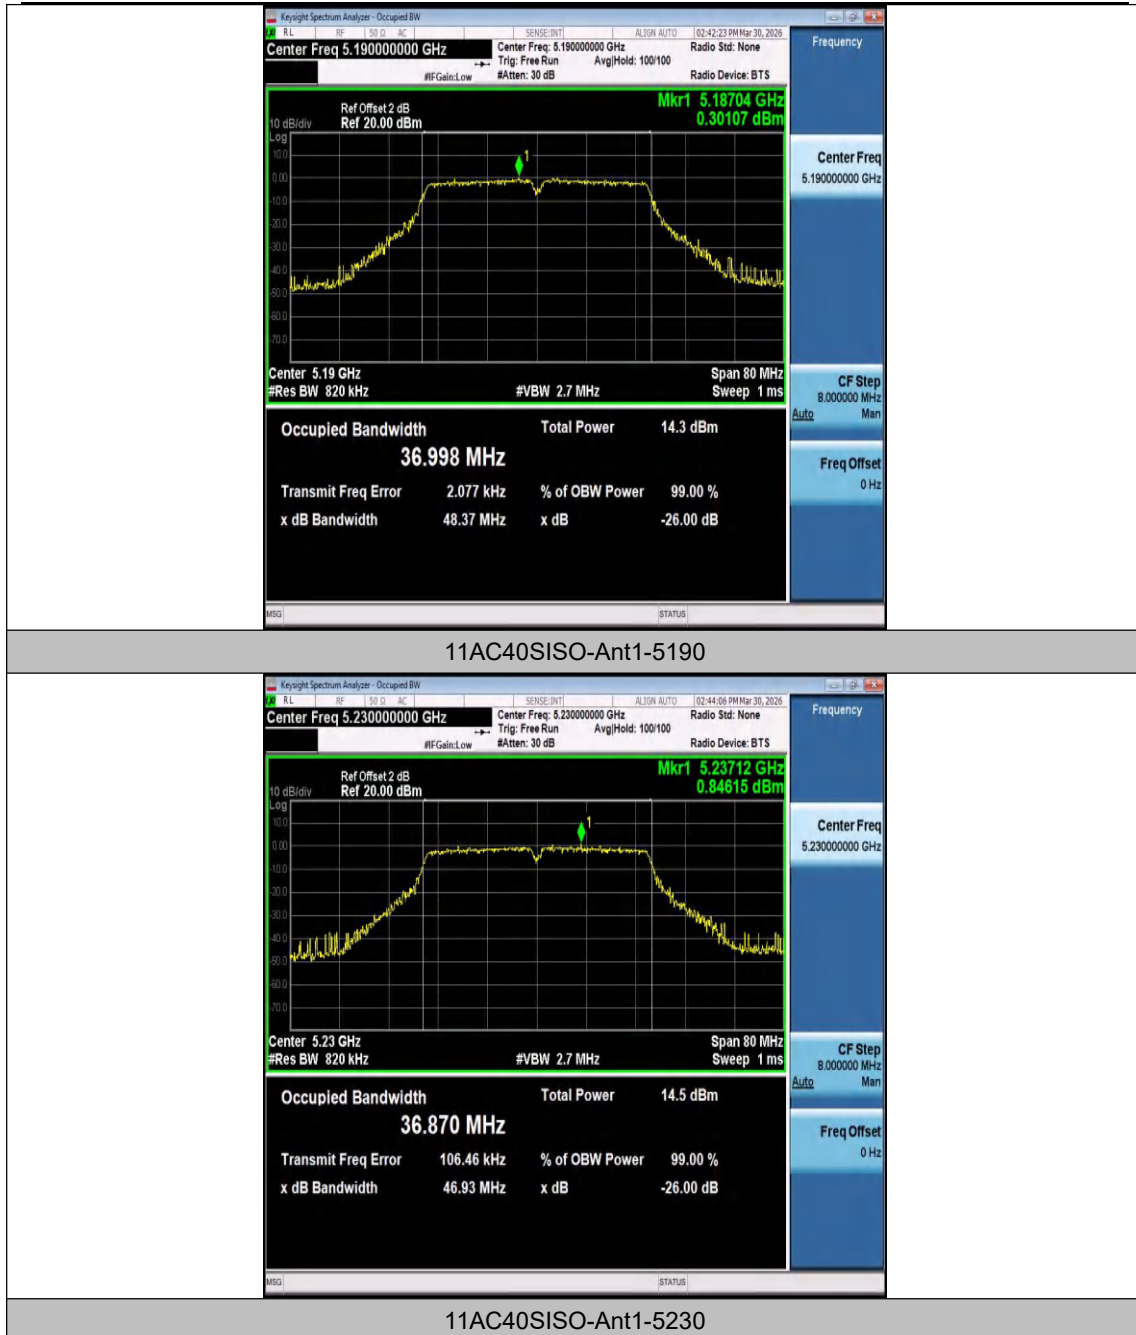

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

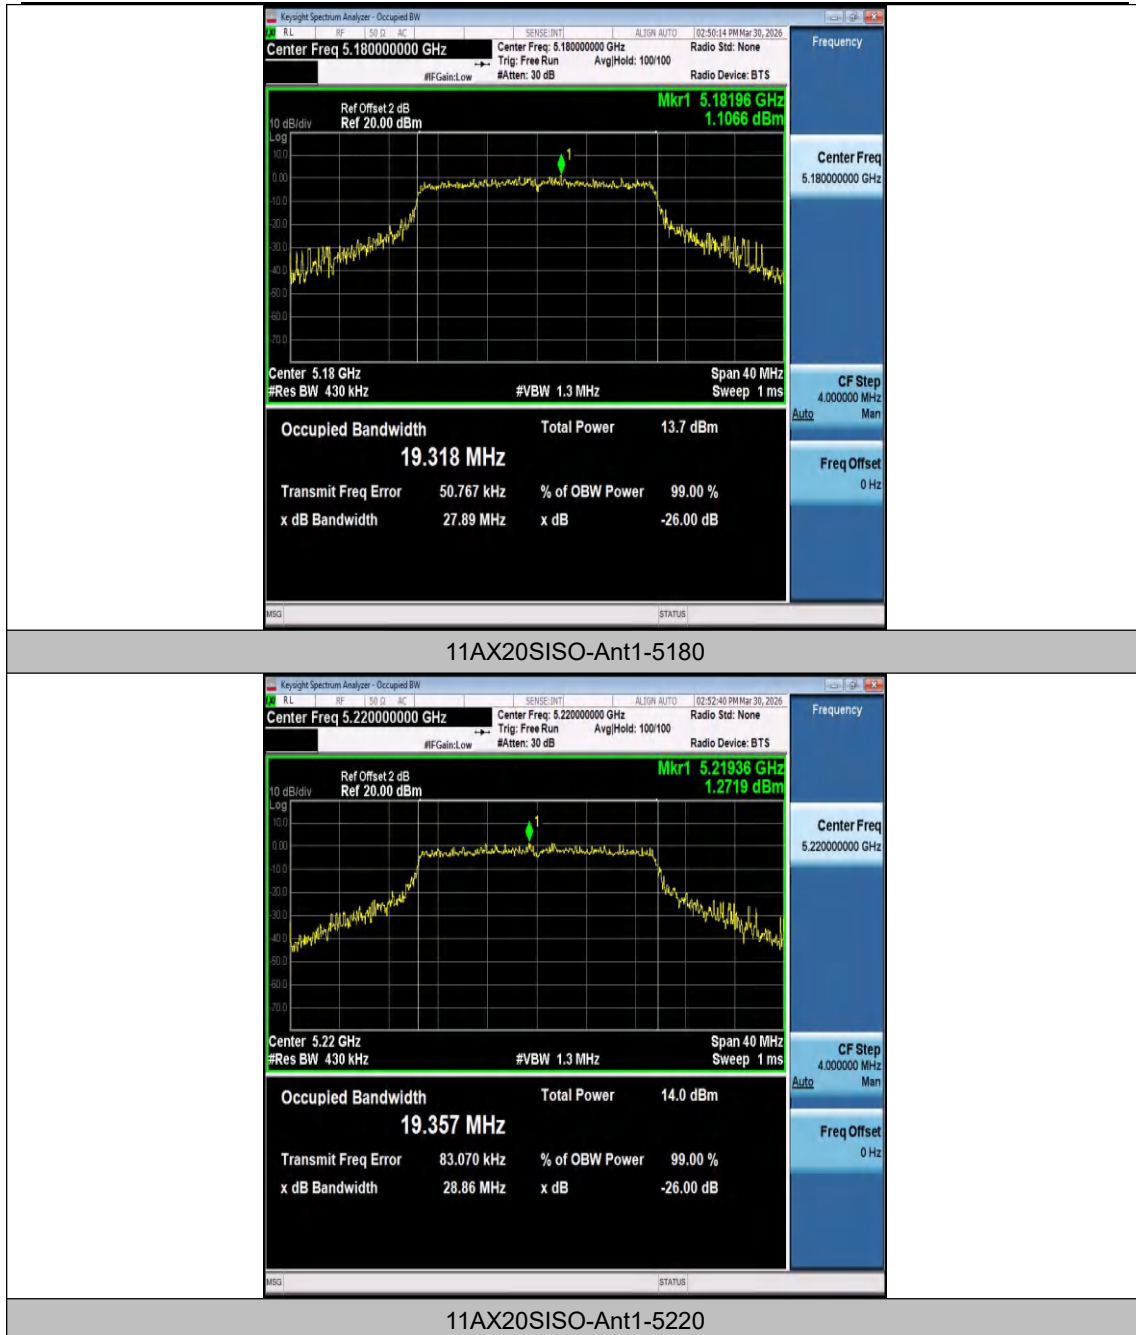

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

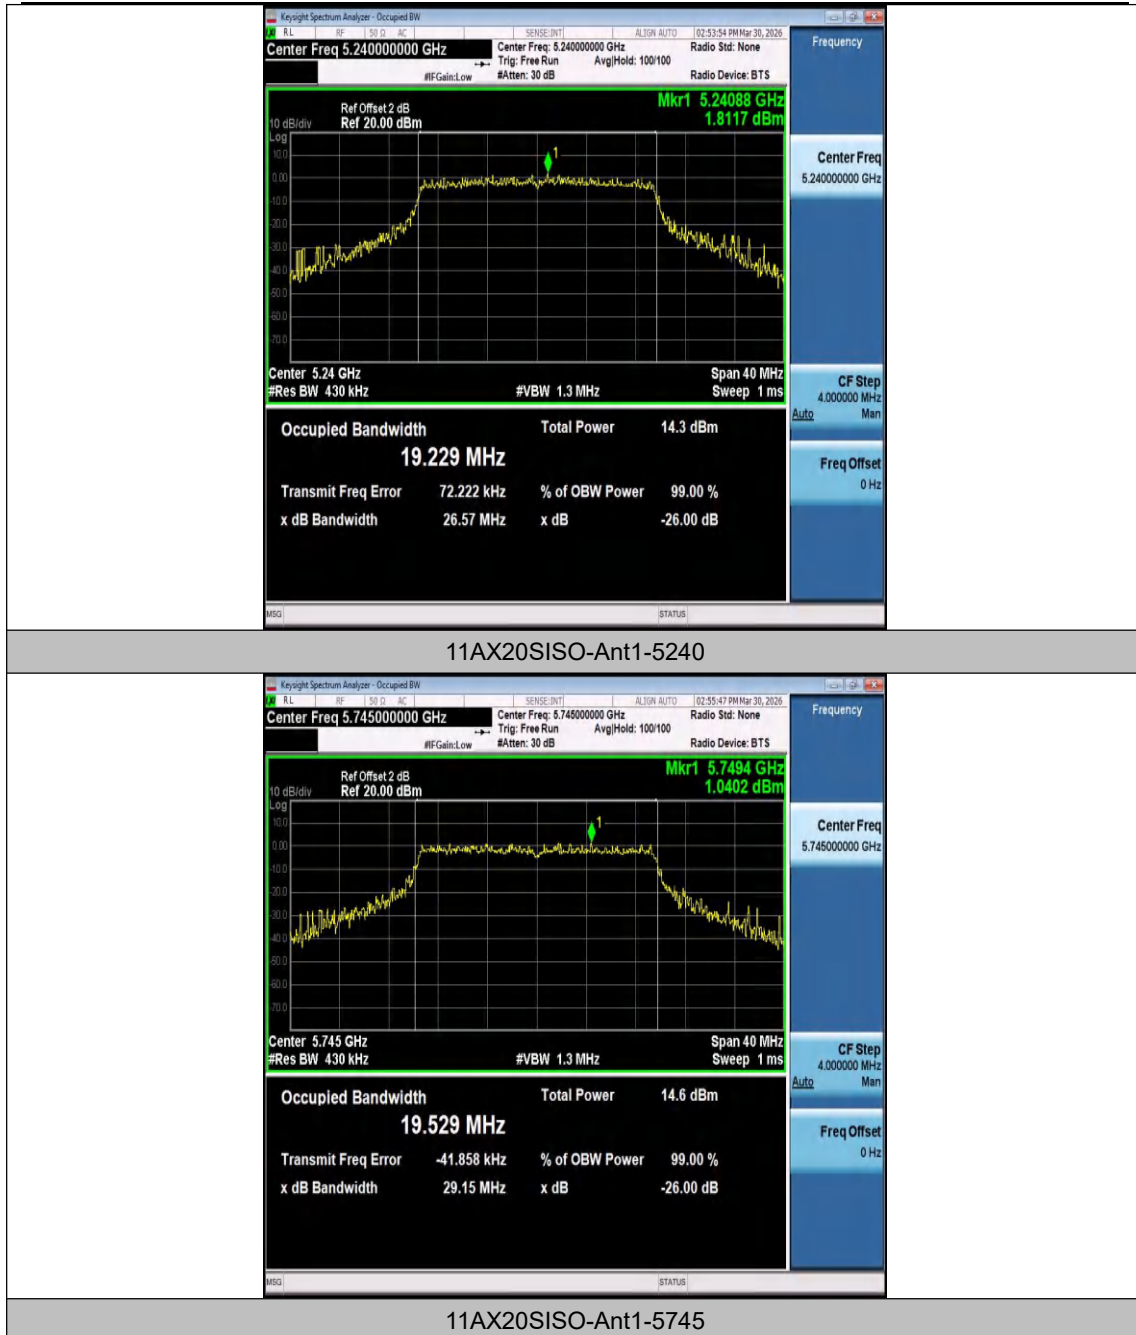

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

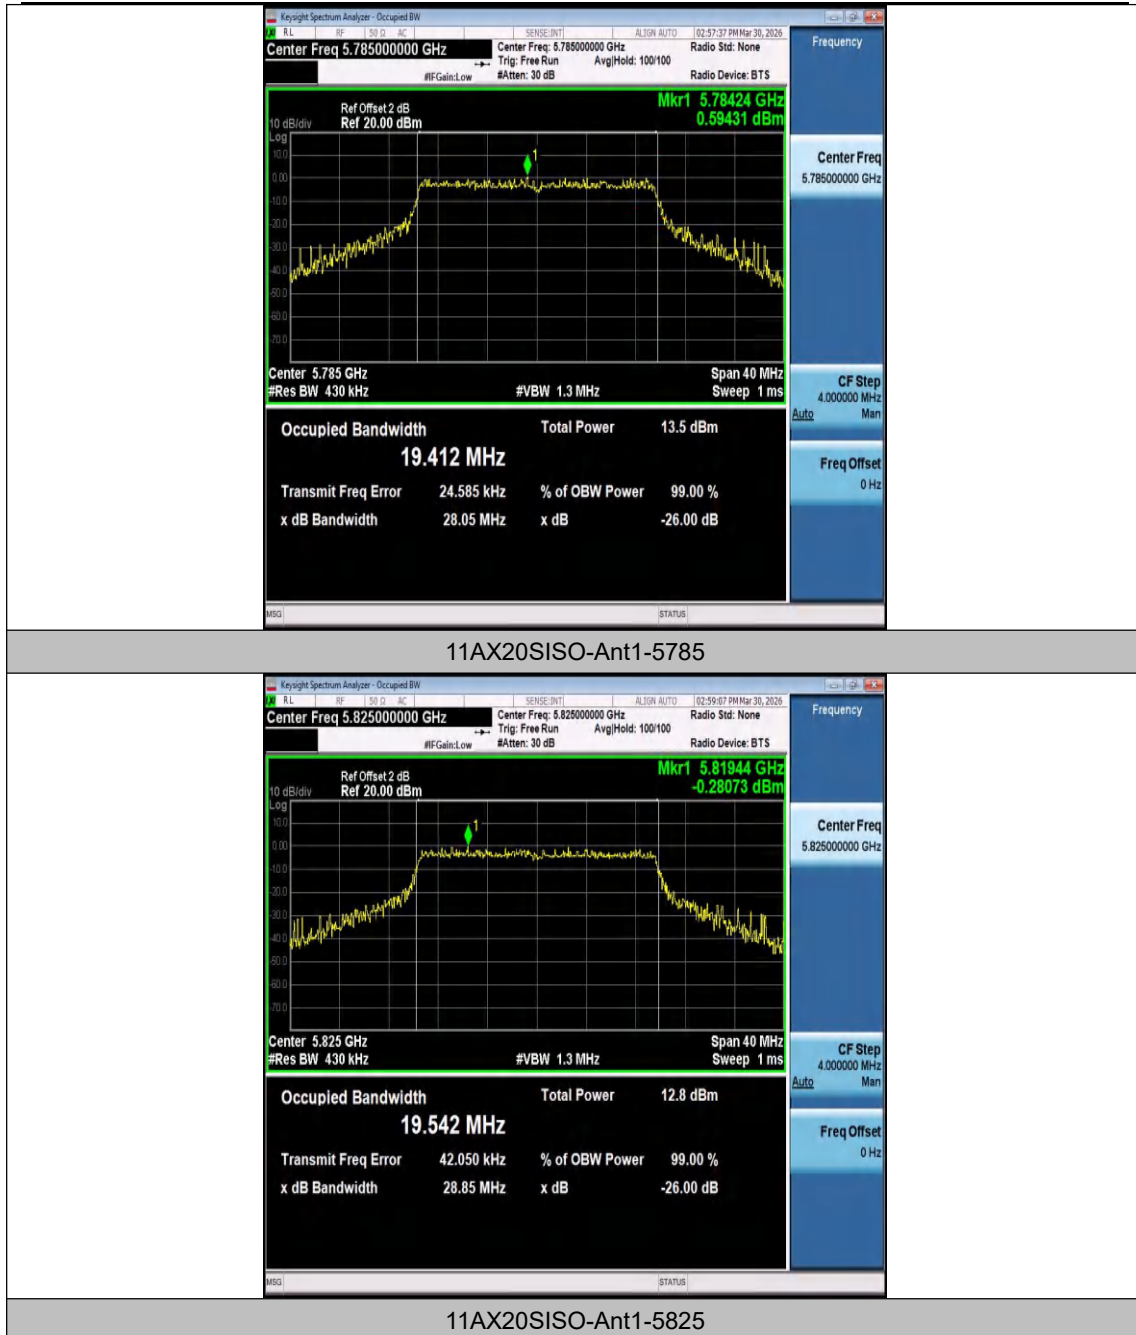

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

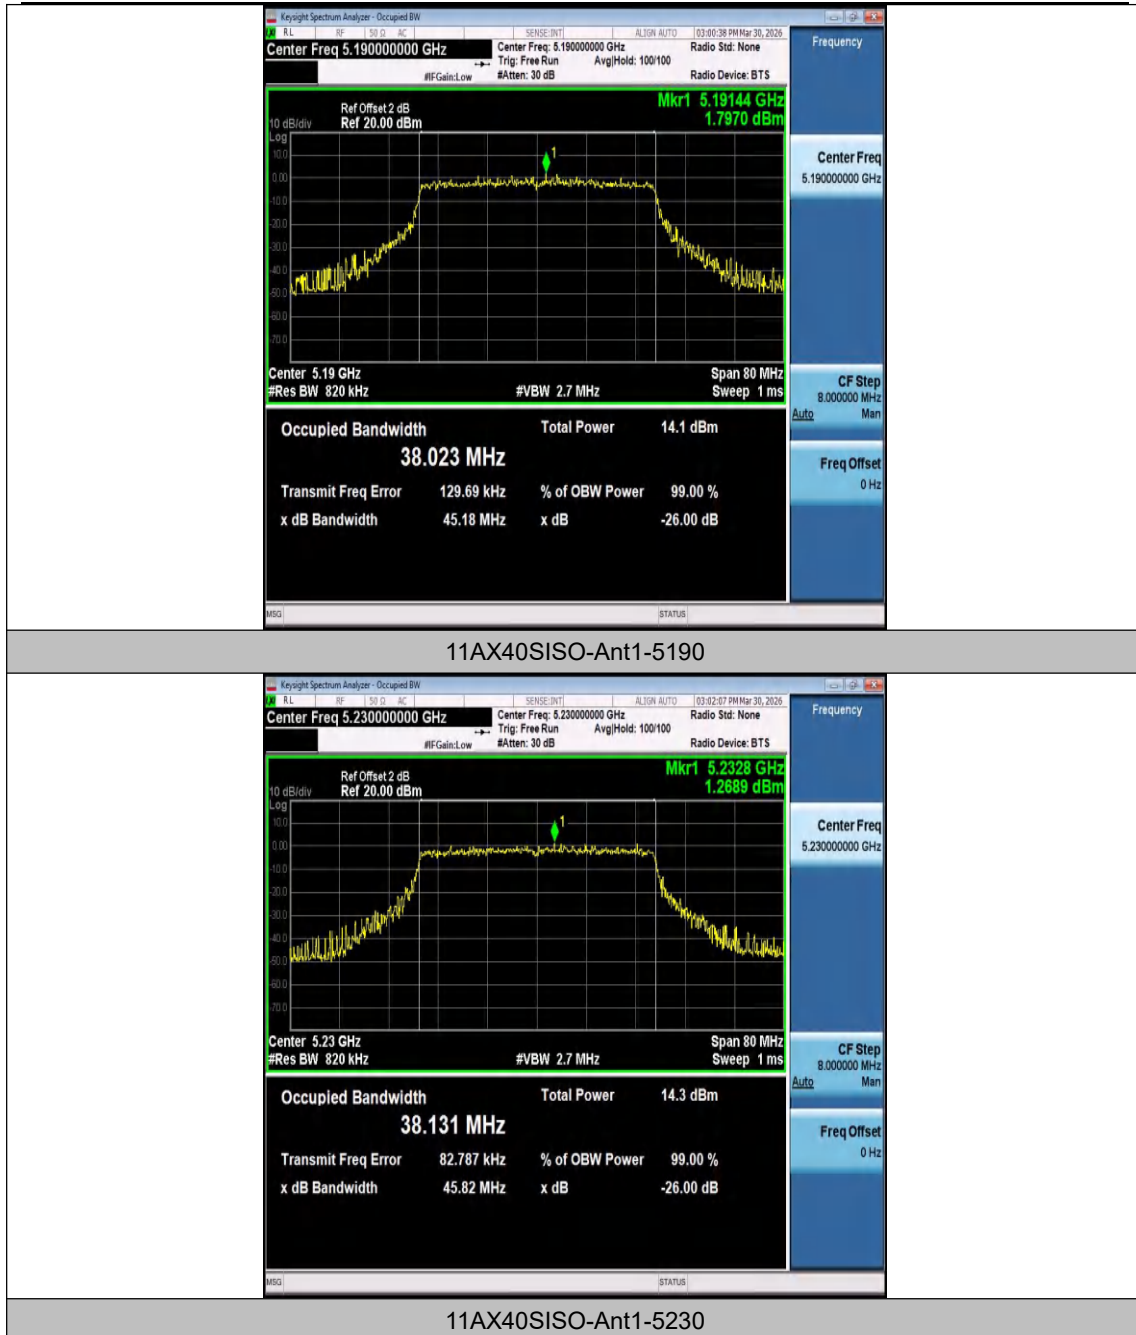

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

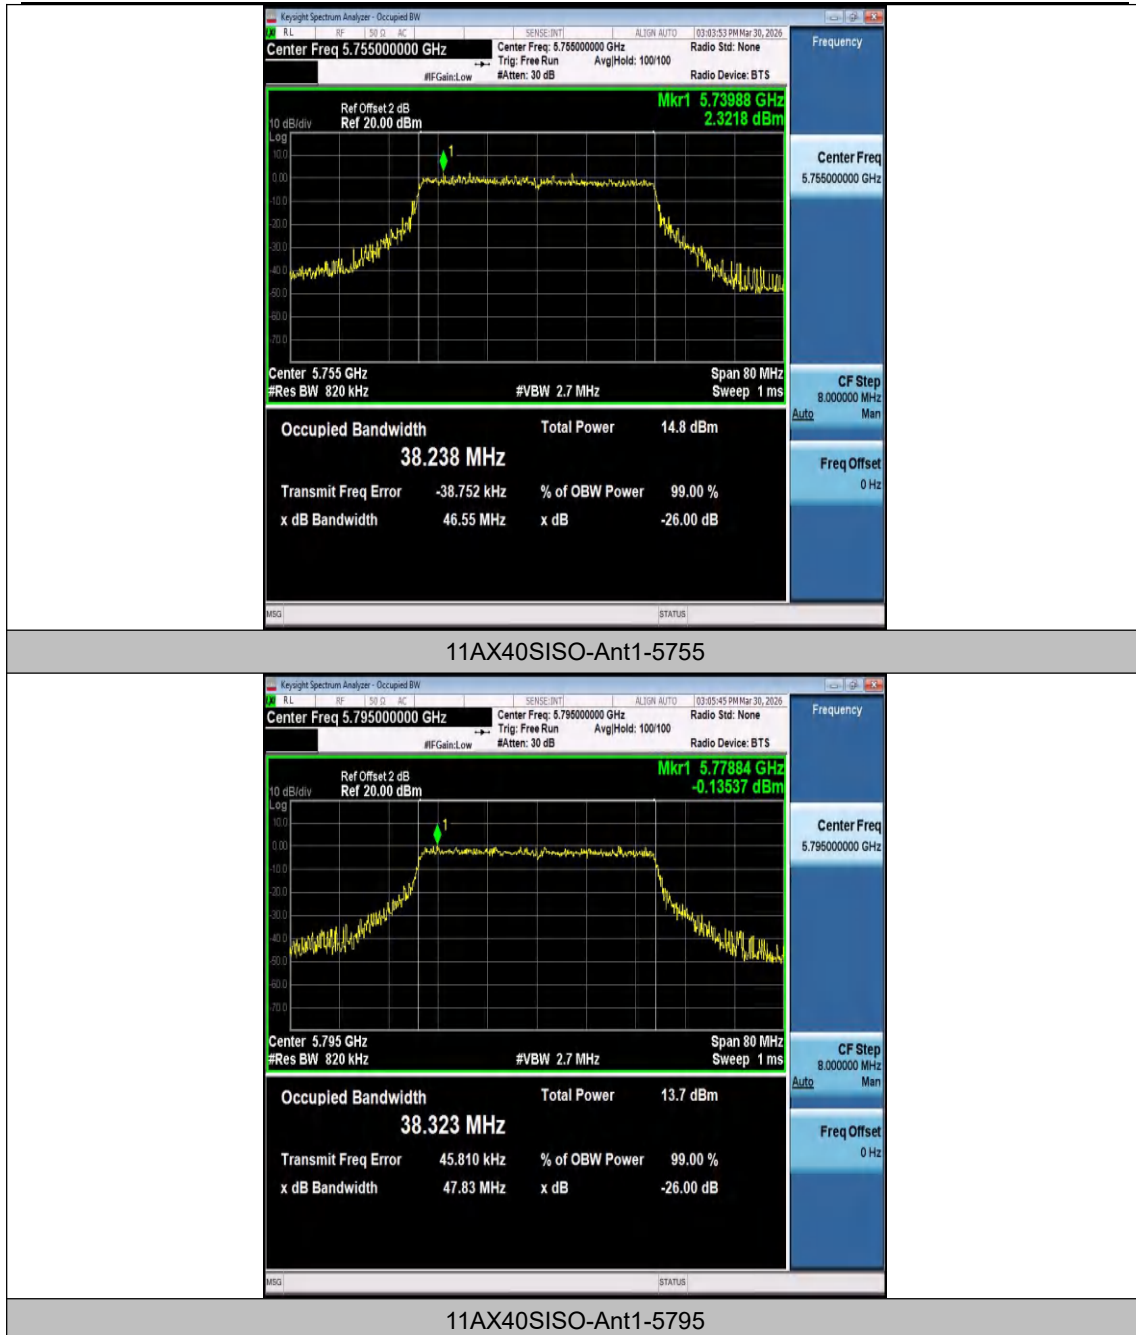

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A3: Minimum 6dB Bandwidth


Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.400	5736.800	5753.200	0.5	PASS
11A	Ant1	5785	16.320	5776.840	5793.160	0.5	PASS
11A	Ant1	5825	16.320	5816.840	5833.160	0.5	PASS
11N20SISO	Ant1	5745	17.600	5736.200	5753.800	0.5	PASS
11N20SISO	Ant1	5785	17.600	5776.200	5793.800	0.5	PASS
11N20SISO	Ant1	5825	17.640	5816.160	5833.800	0.5	PASS
11N40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11N40SISO	Ant1	5795	36.240	5776.840	5813.080	0.5	PASS
11AC20SISO	Ant1	5745	17.640	5736.200	5753.840	0.5	PASS
11AC20SISO	Ant1	5785	17.600	5776.200	5793.800	0.5	PASS
11AC20SISO	Ant1	5825	17.560	5816.240	5833.800	0.5	PASS
11AC40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11AC40SISO	Ant1	5795	36.320	5776.840	5813.160	0.5	PASS
11AX20SISO	Ant1	5745	19.000	5735.520	5754.520	0.5	PASS
11AX20SISO	Ant1	5785	19.000	5775.520	5794.520	0.5	PASS
11AX20SISO	Ant1	5825	18.920	5815.600	5834.520	0.5	PASS
11AX40SISO	Ant1	5755	38.000	5736.040	5774.040	0.5	PASS
11AX40SISO	Ant1	5795	37.920	5775.960	5813.880	0.5	PASS

Test Graphs B4

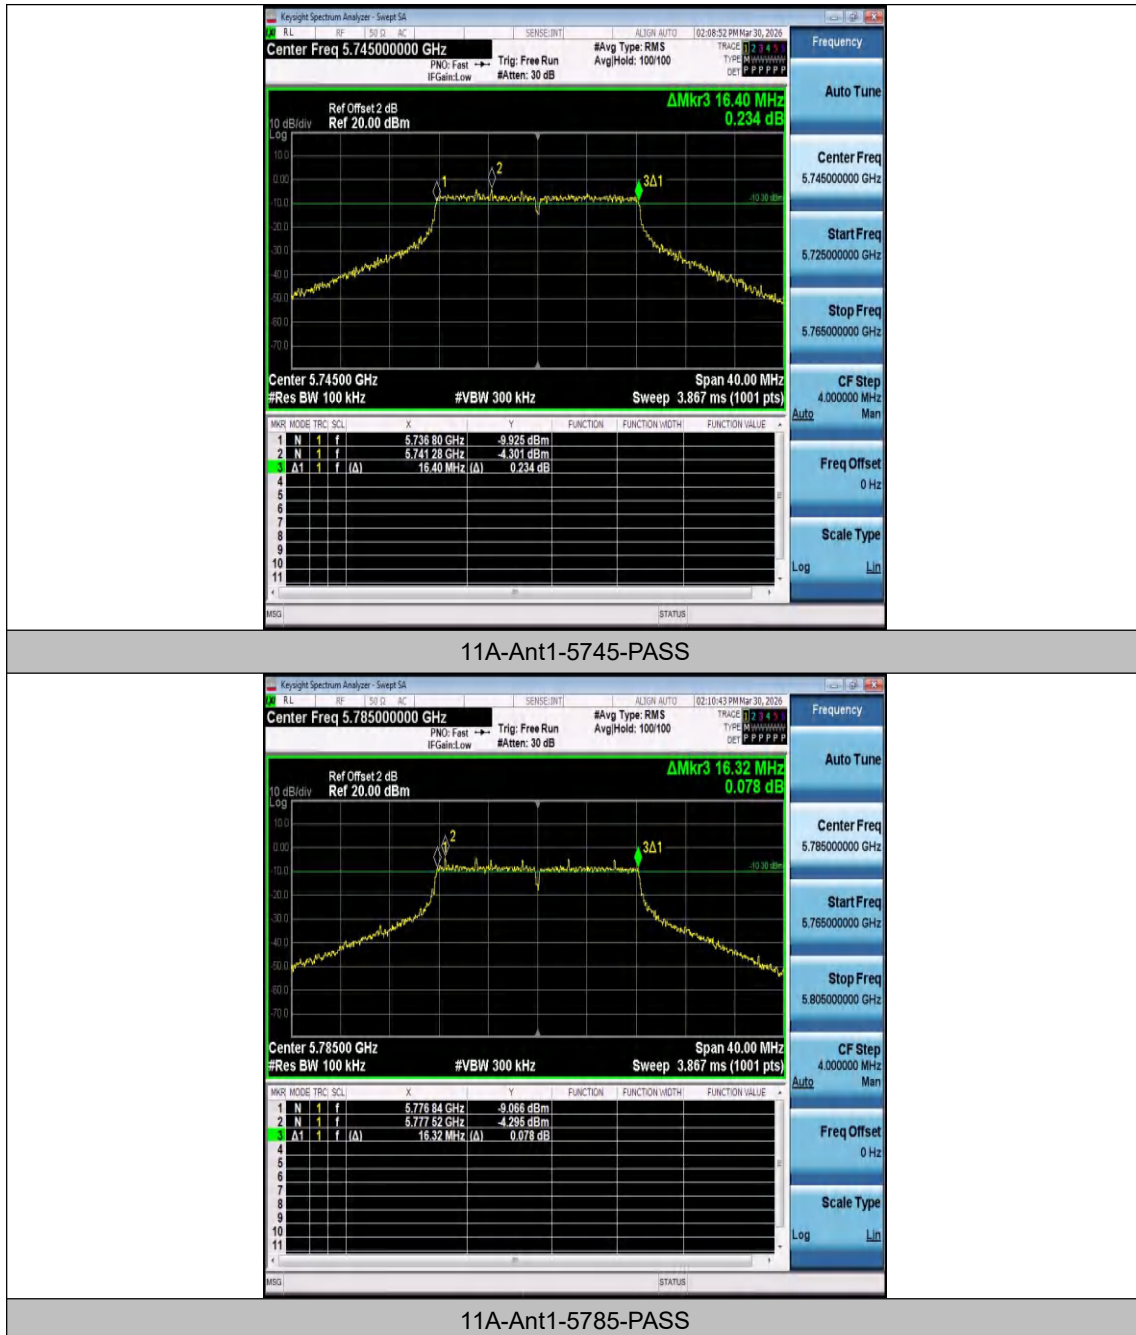

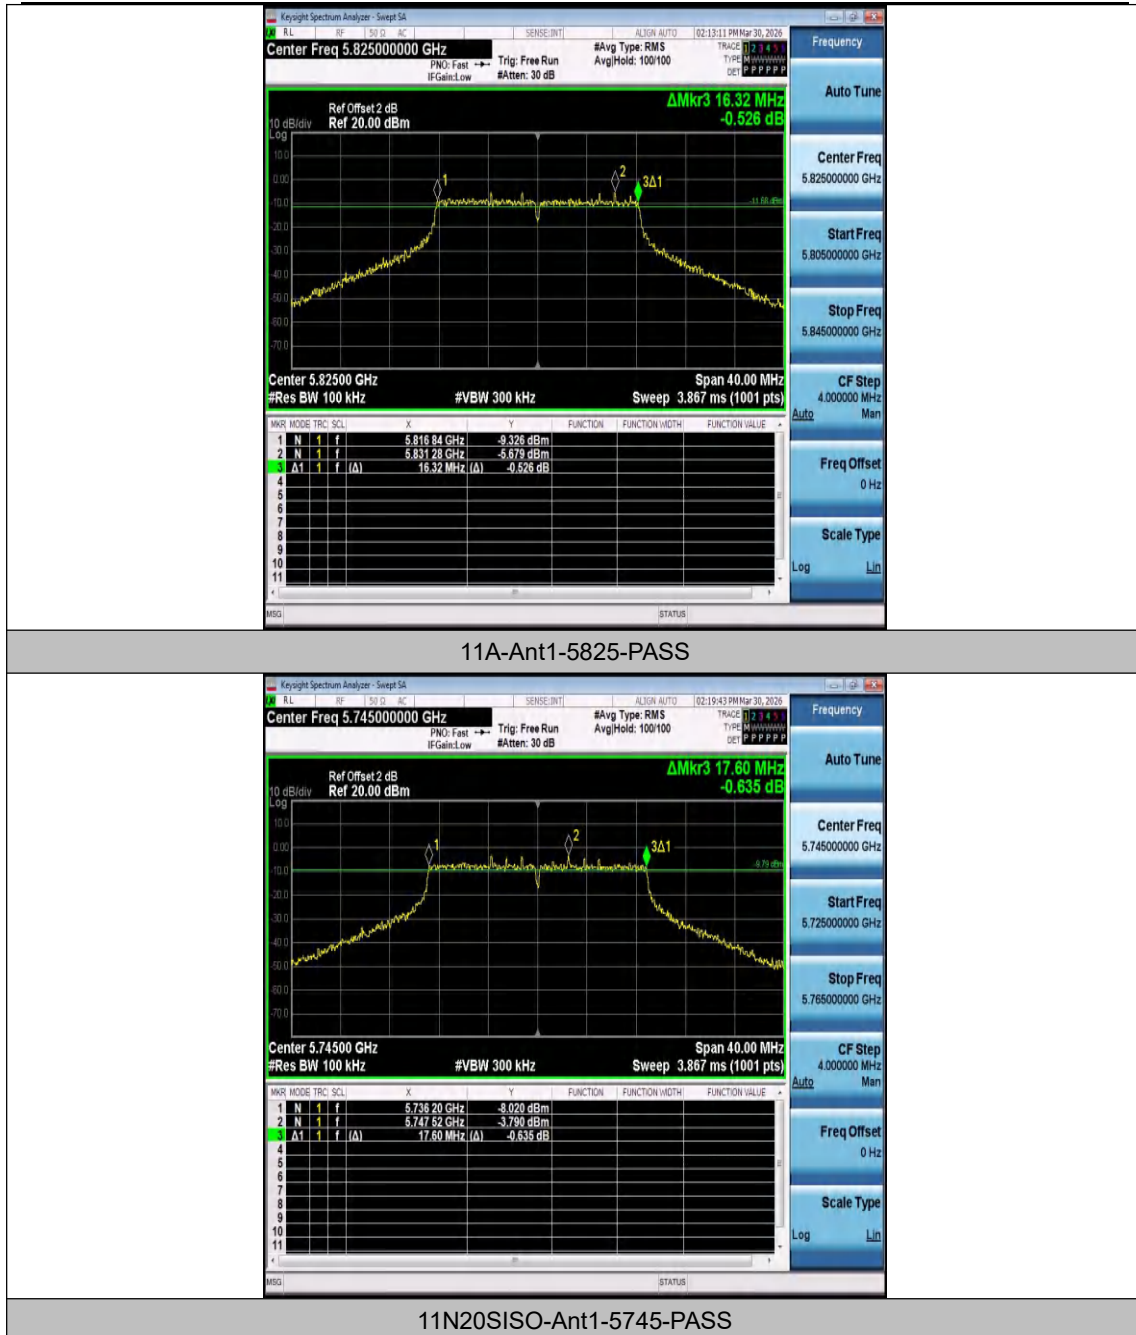


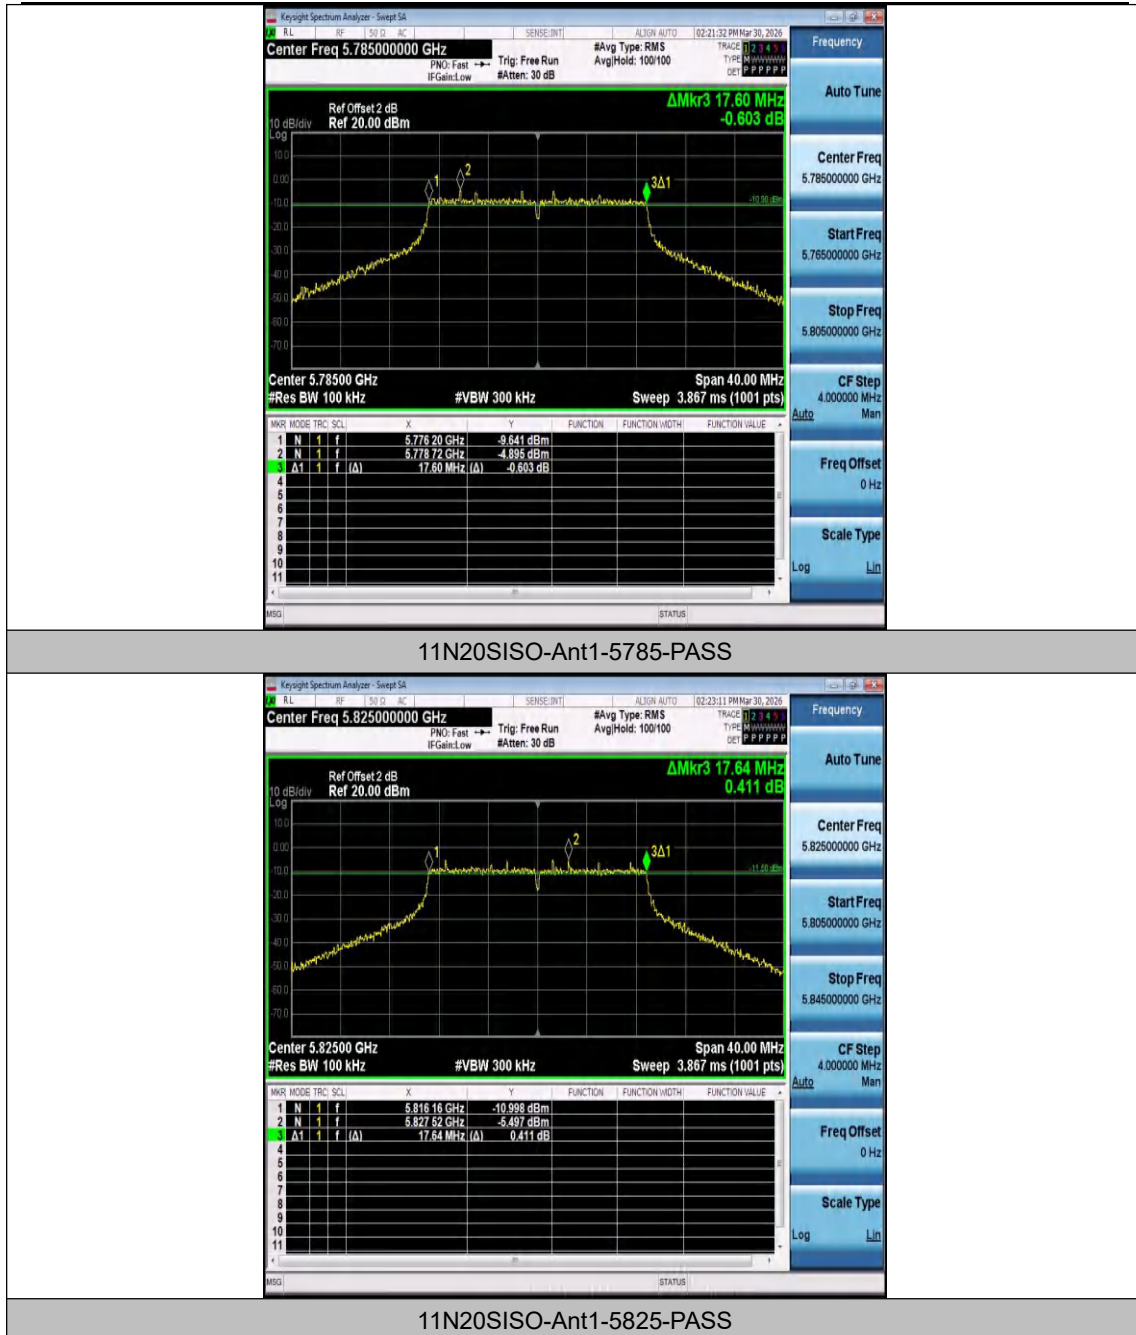


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

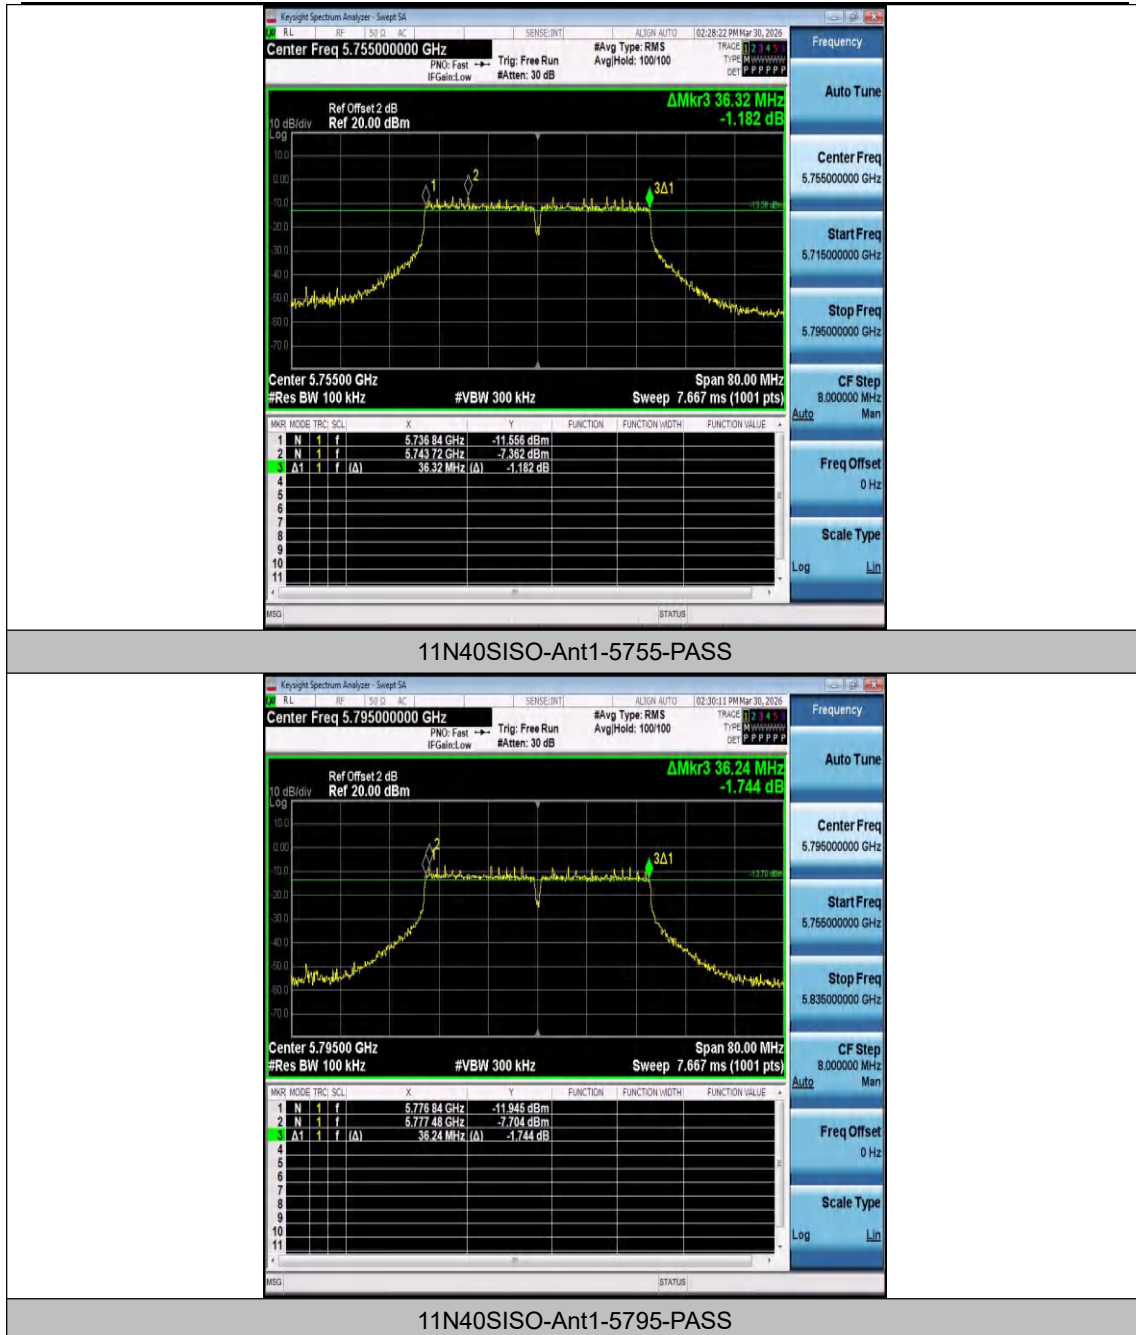




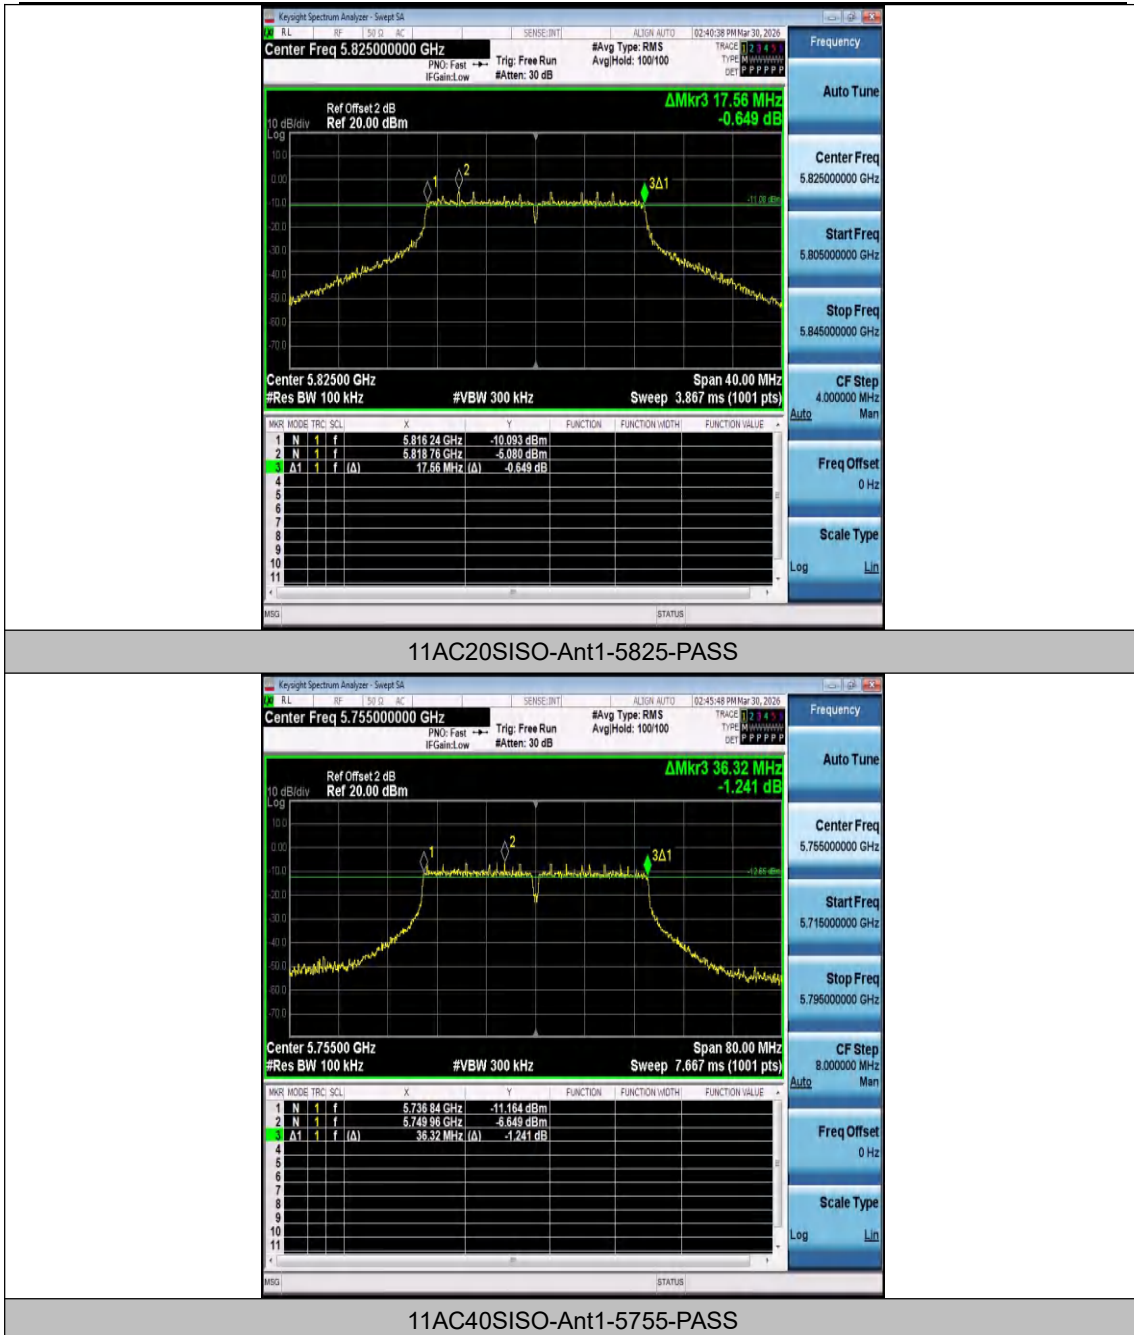

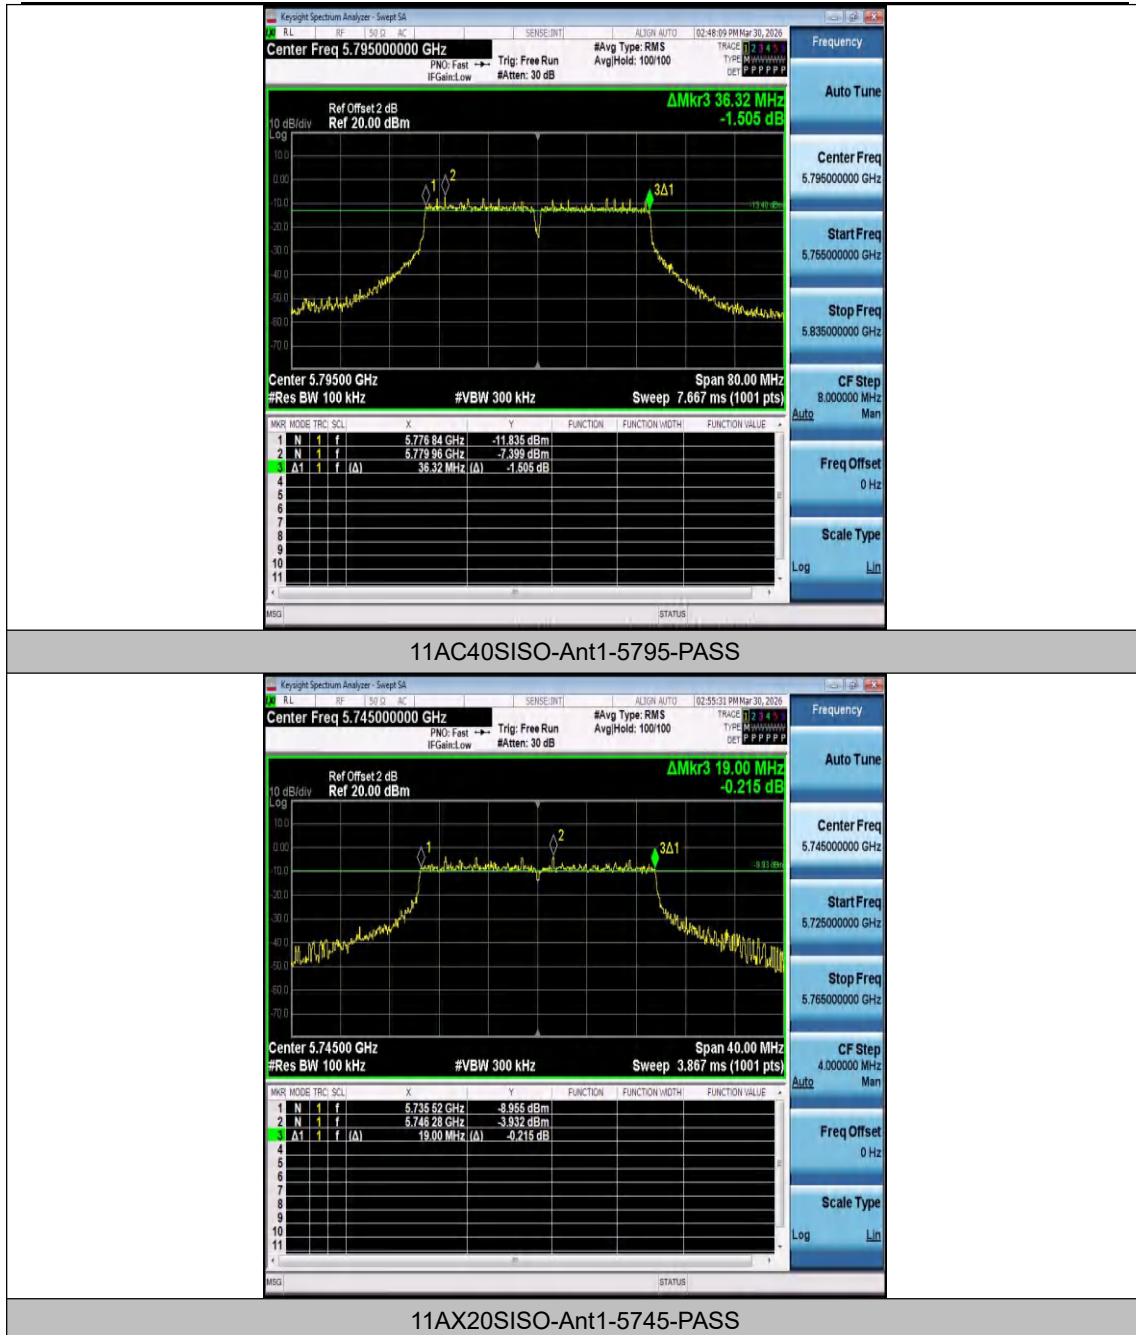

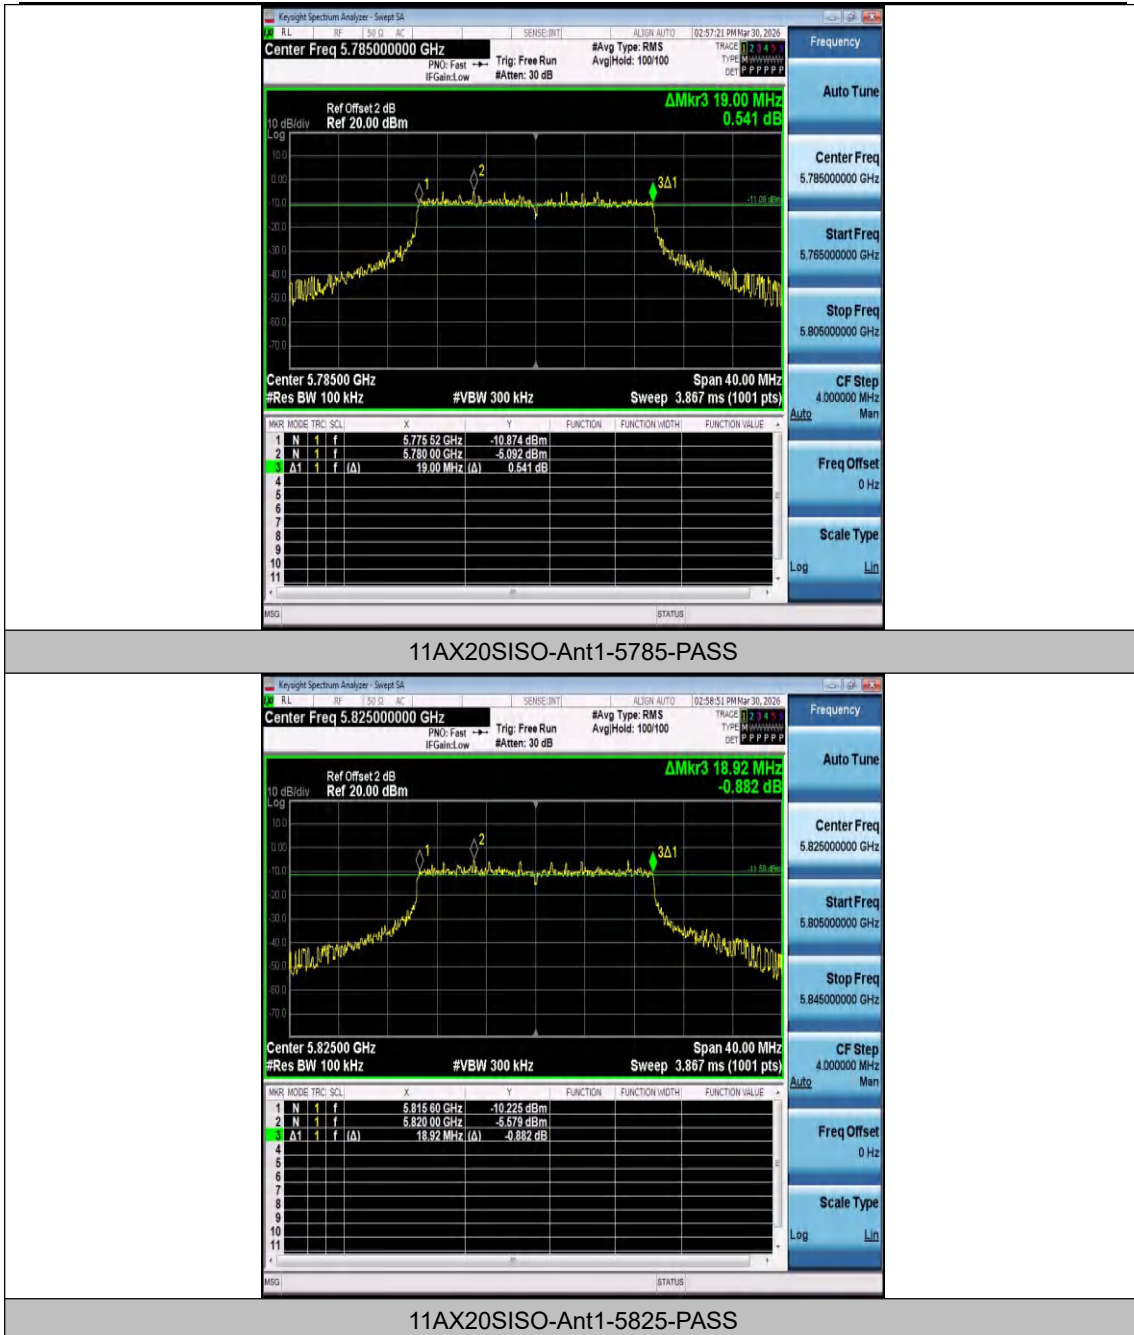

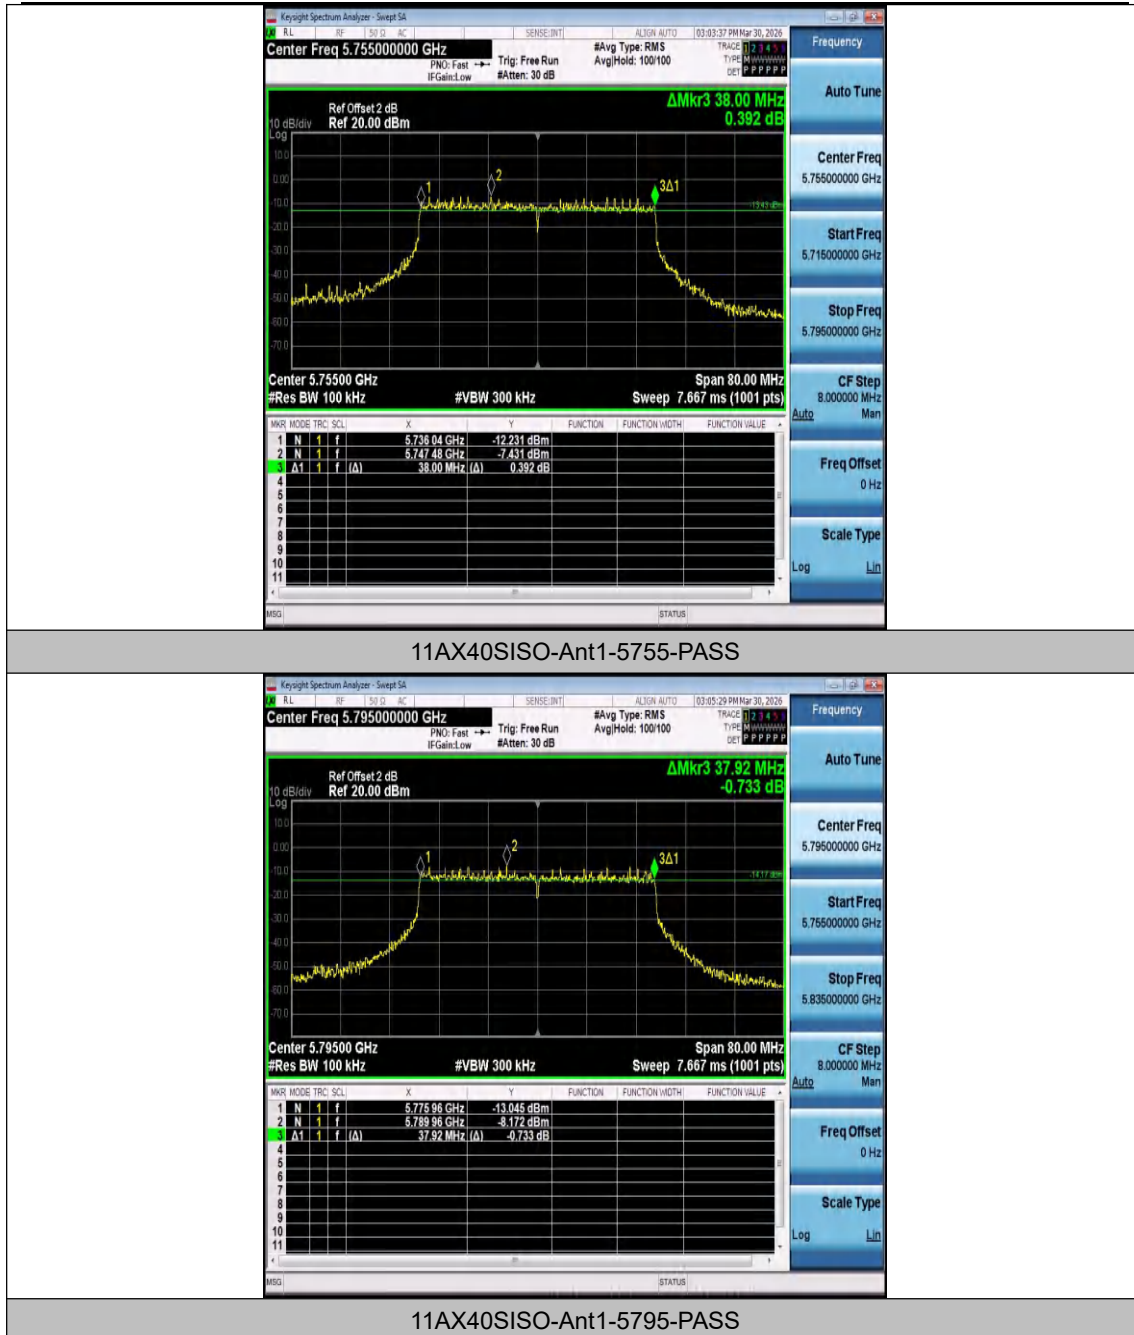

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Duty Cycle

Test Result


Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

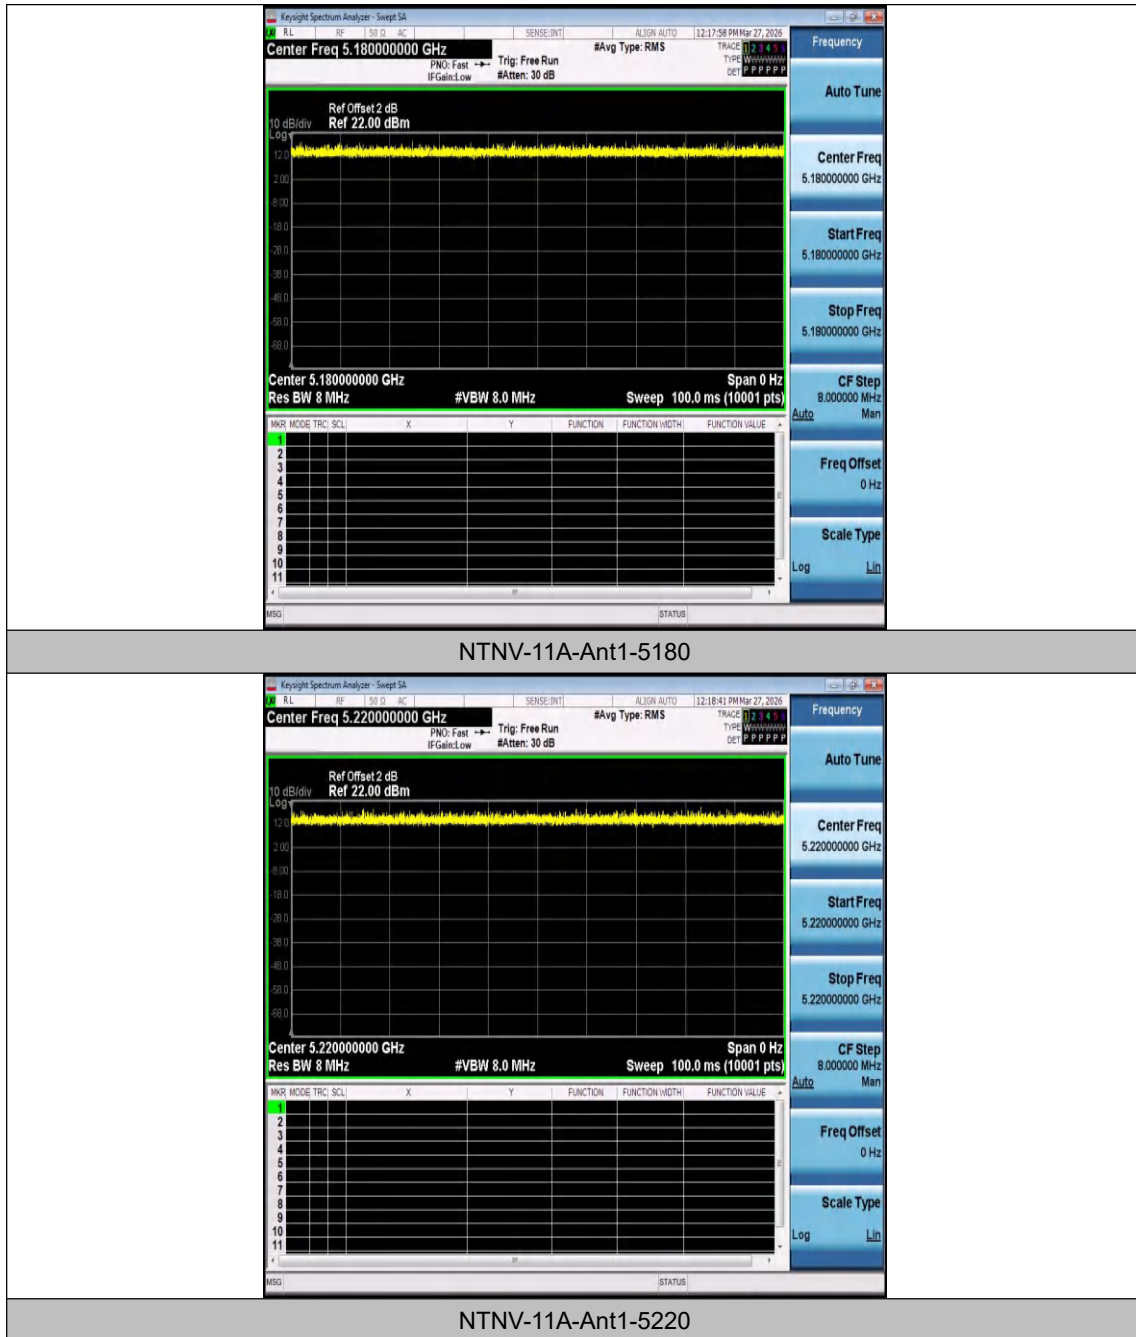

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

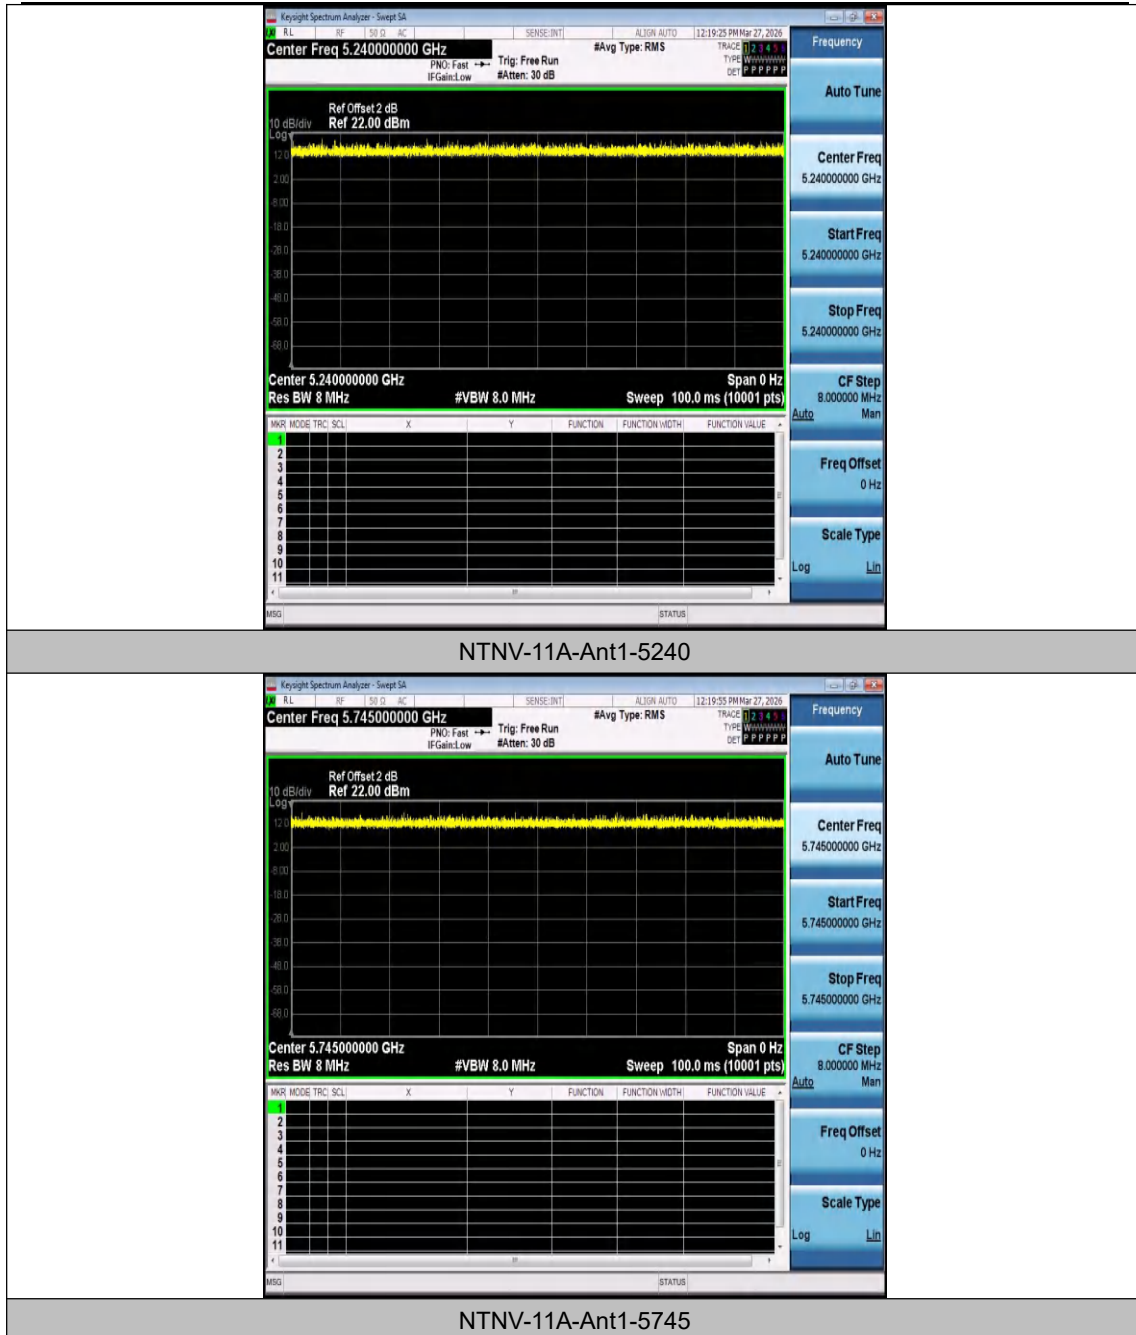

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

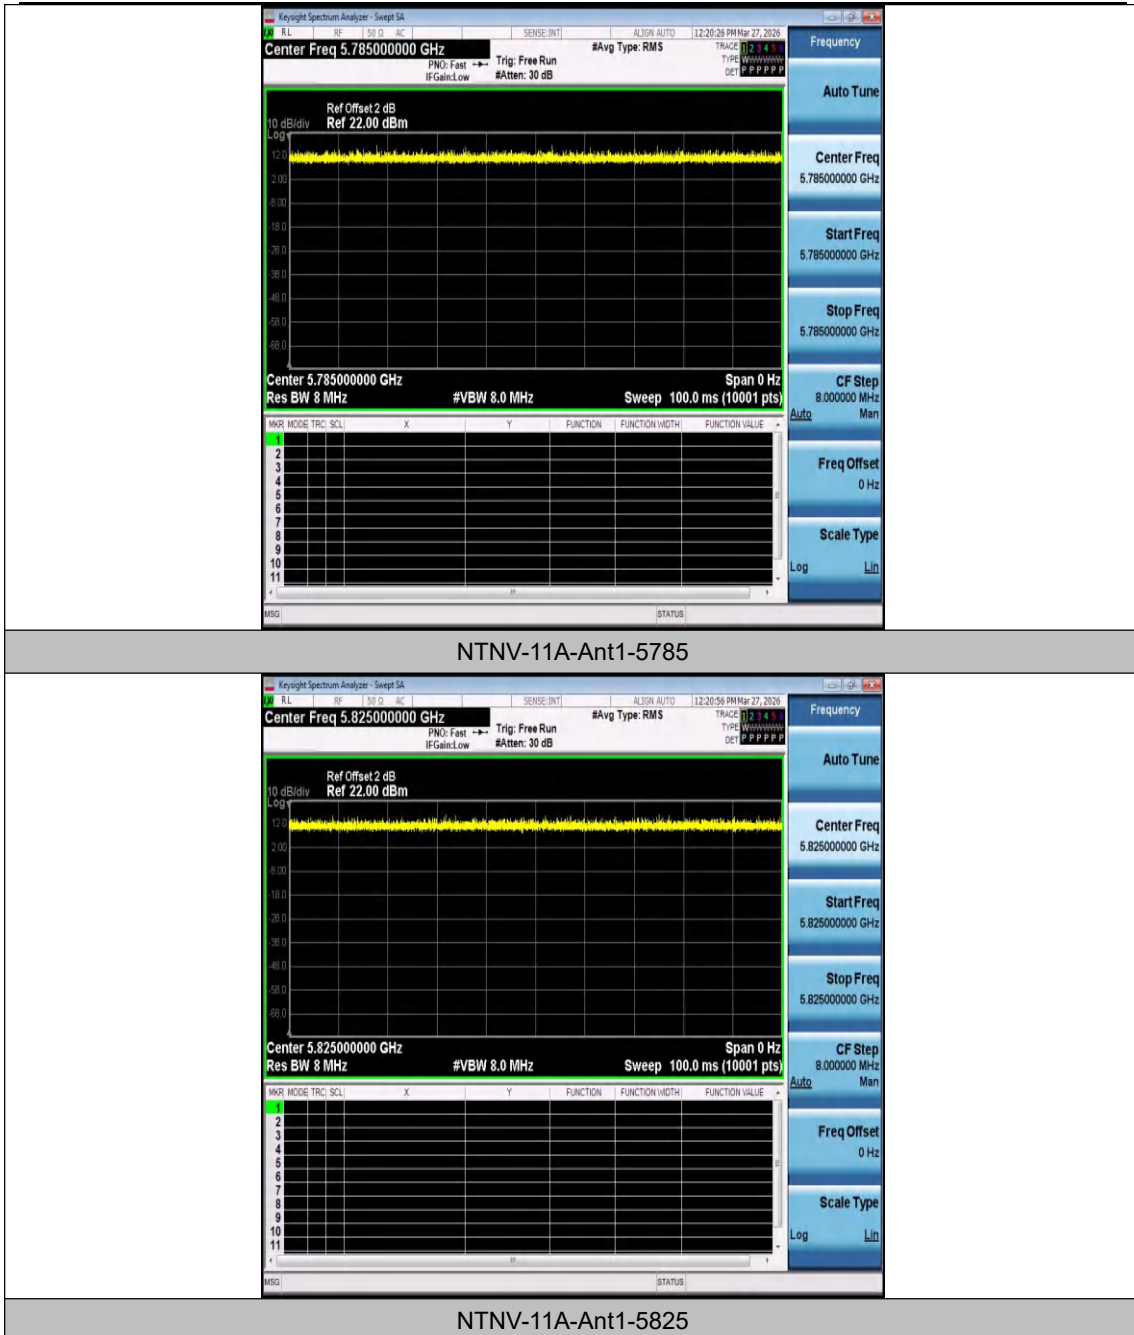

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

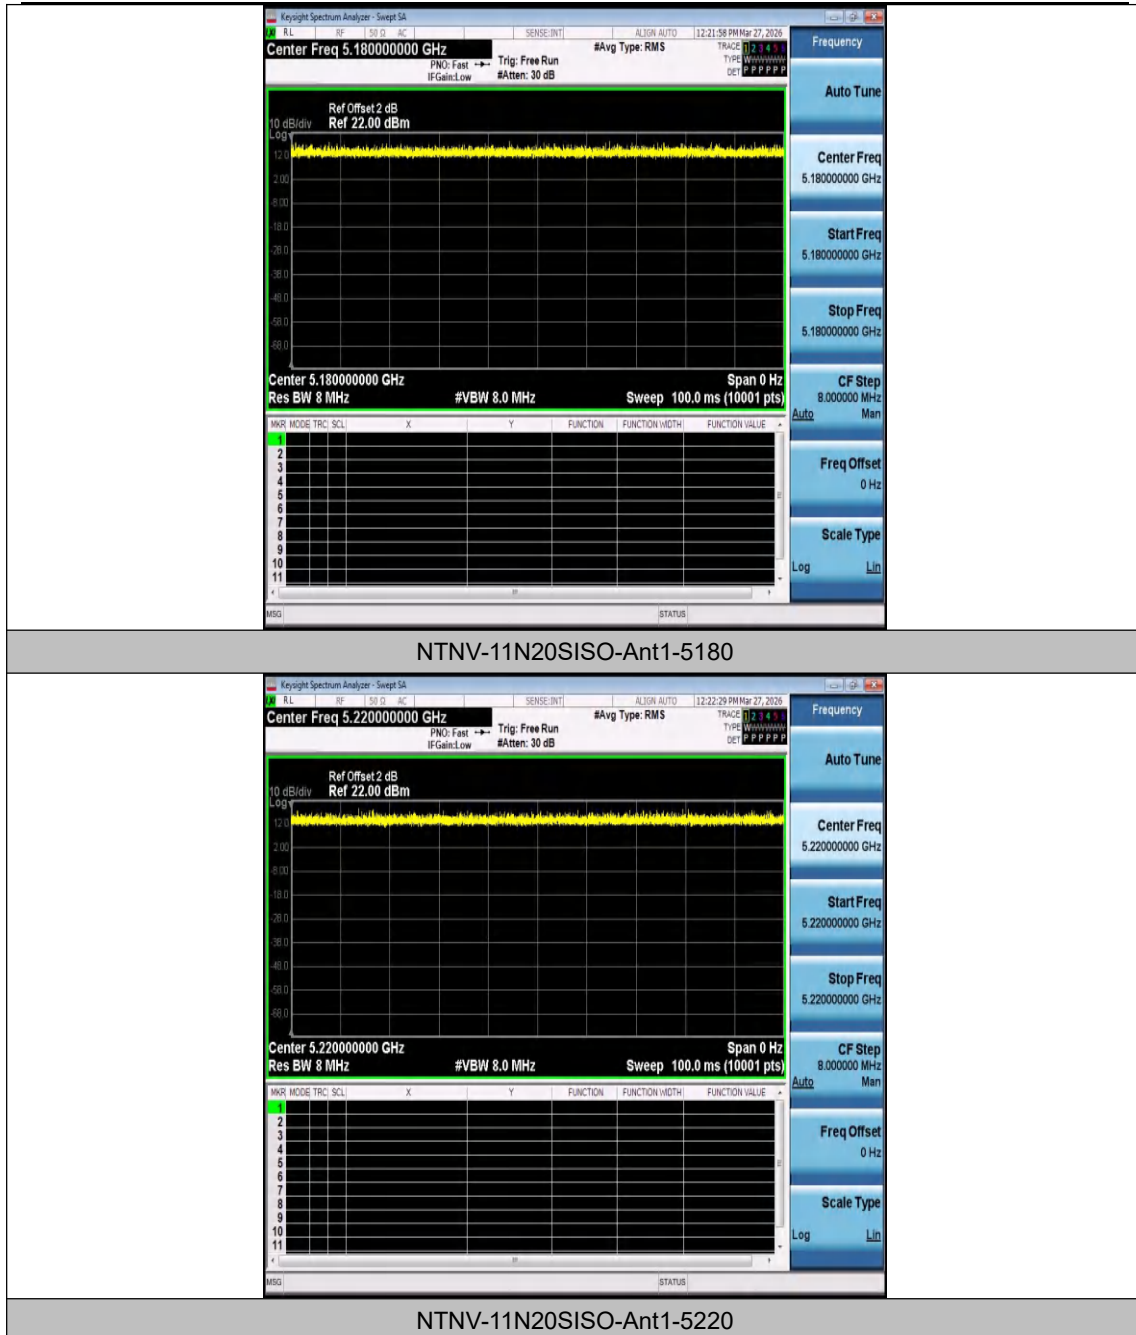

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

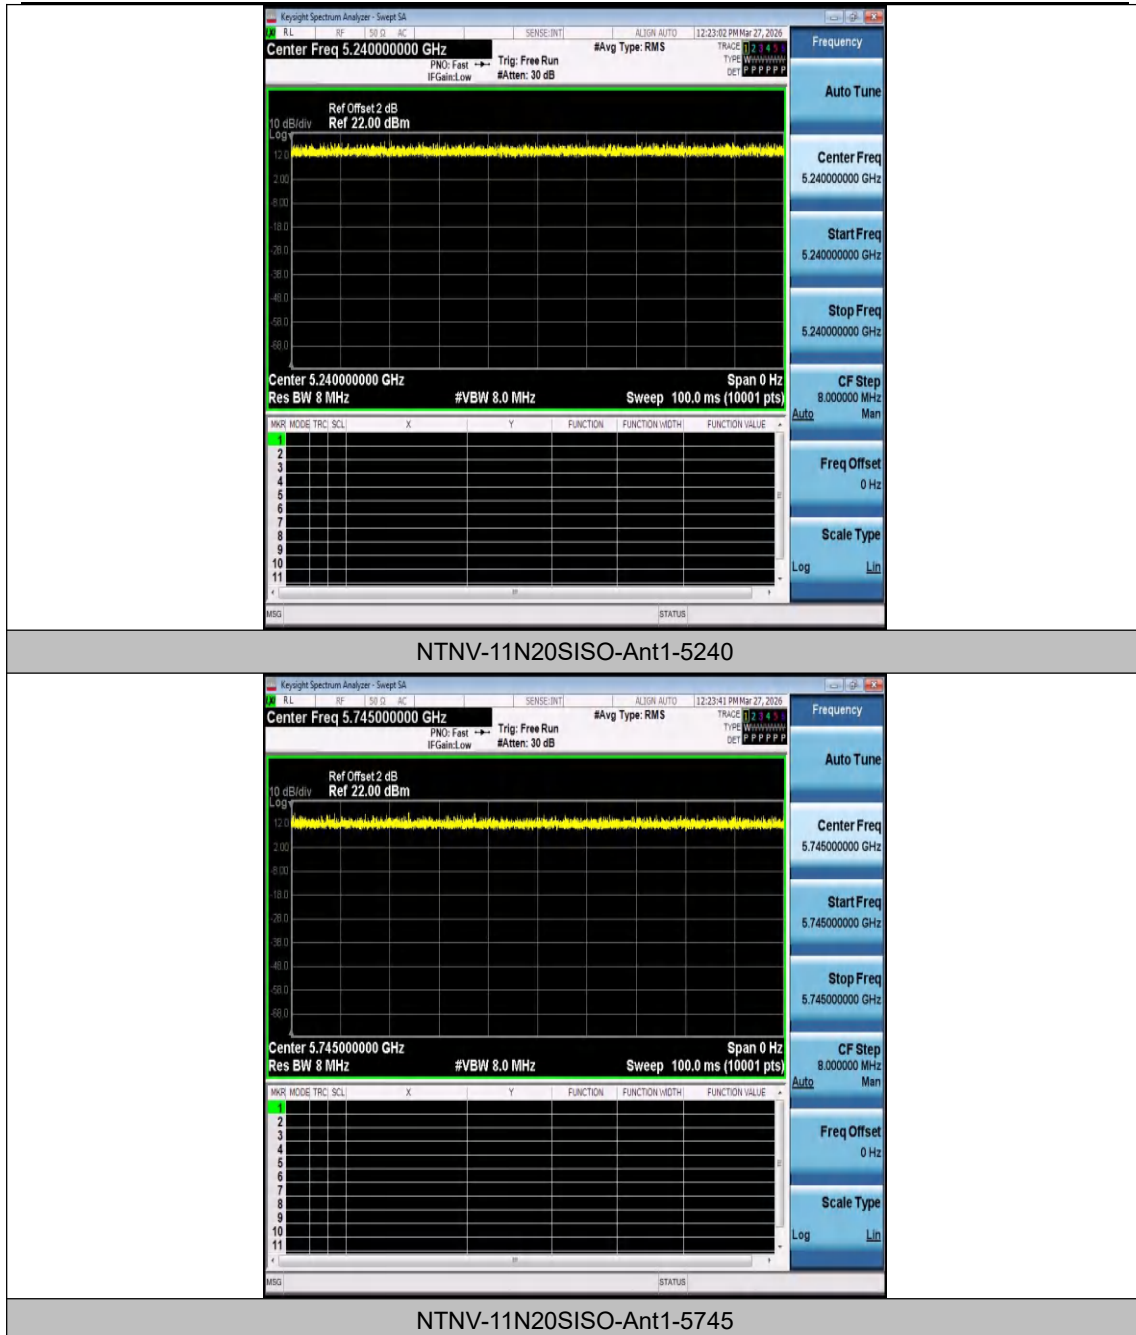

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

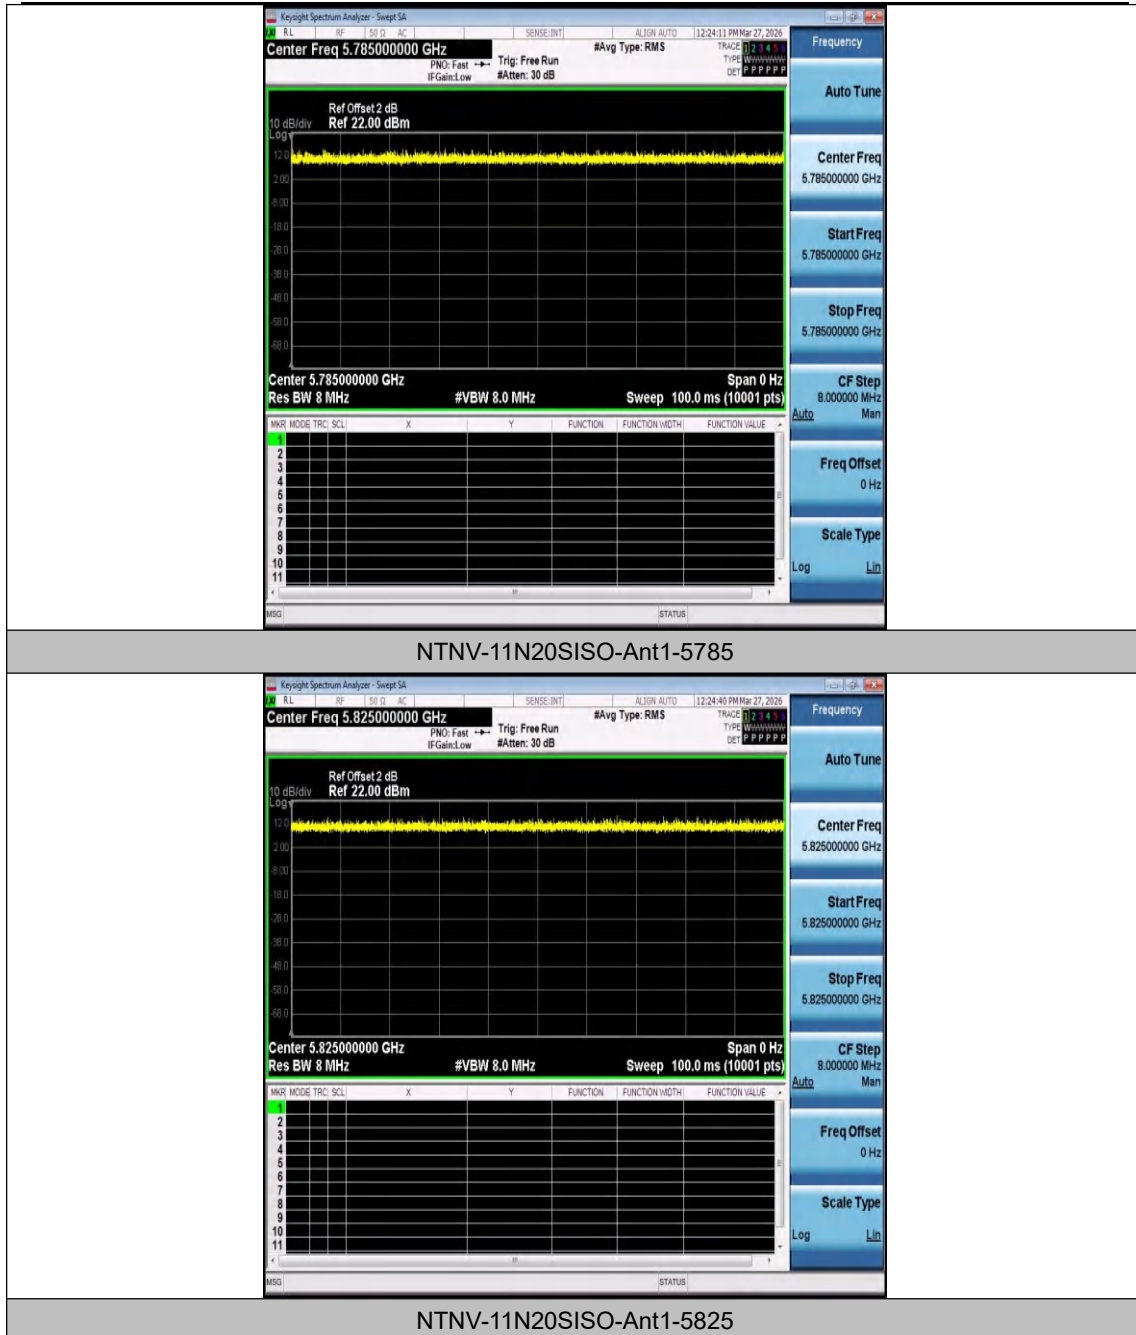

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

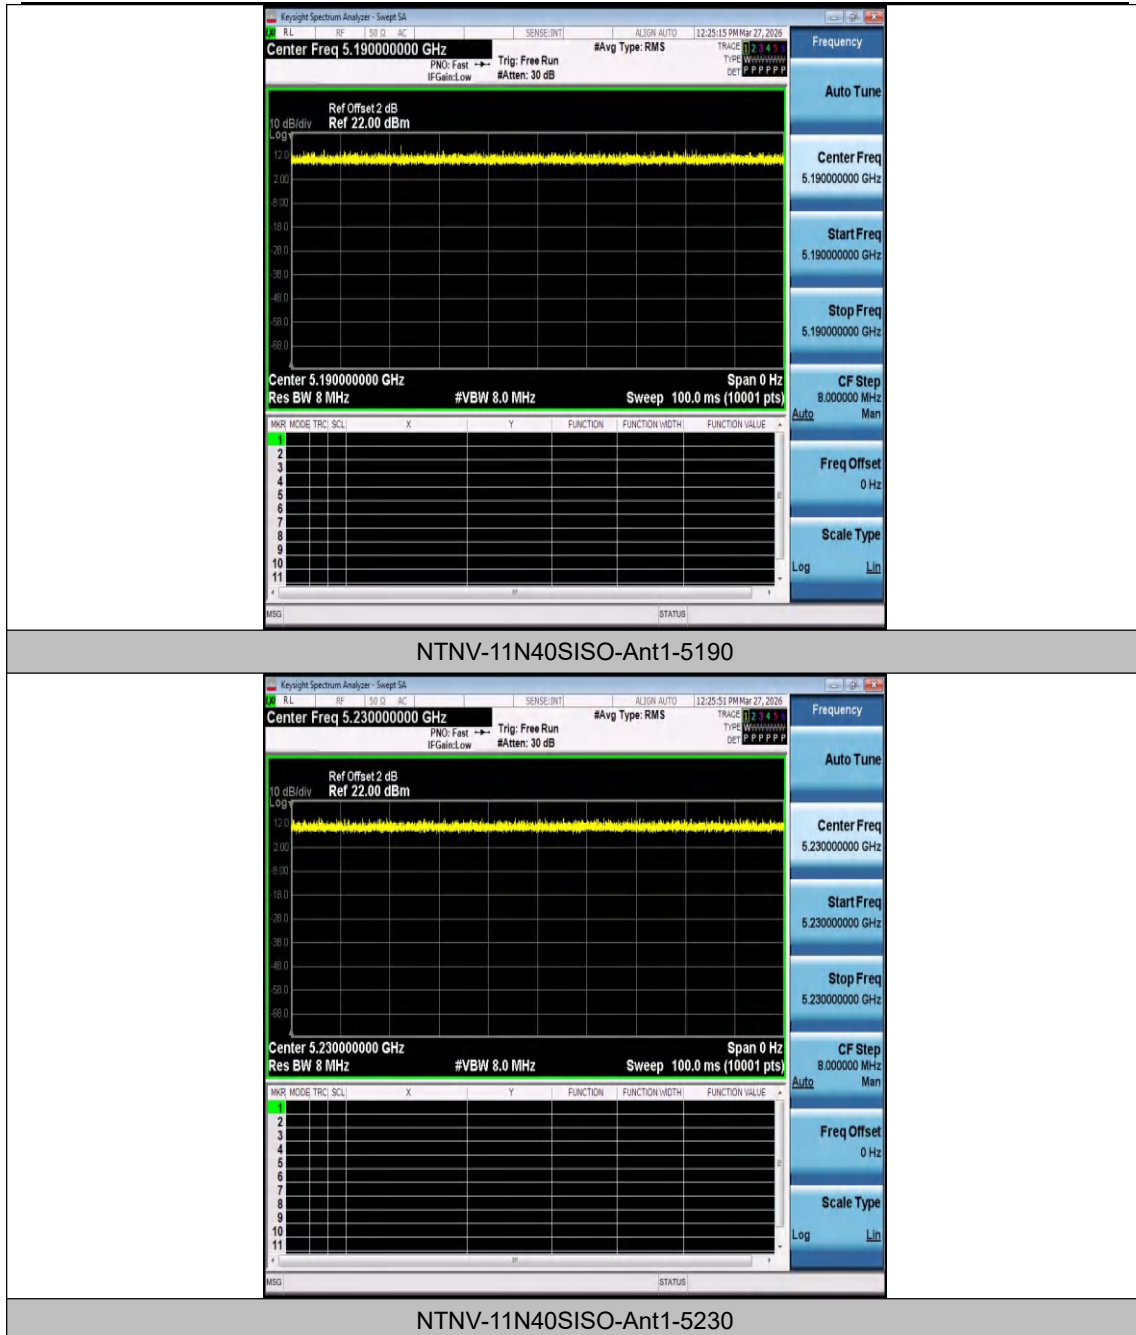

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

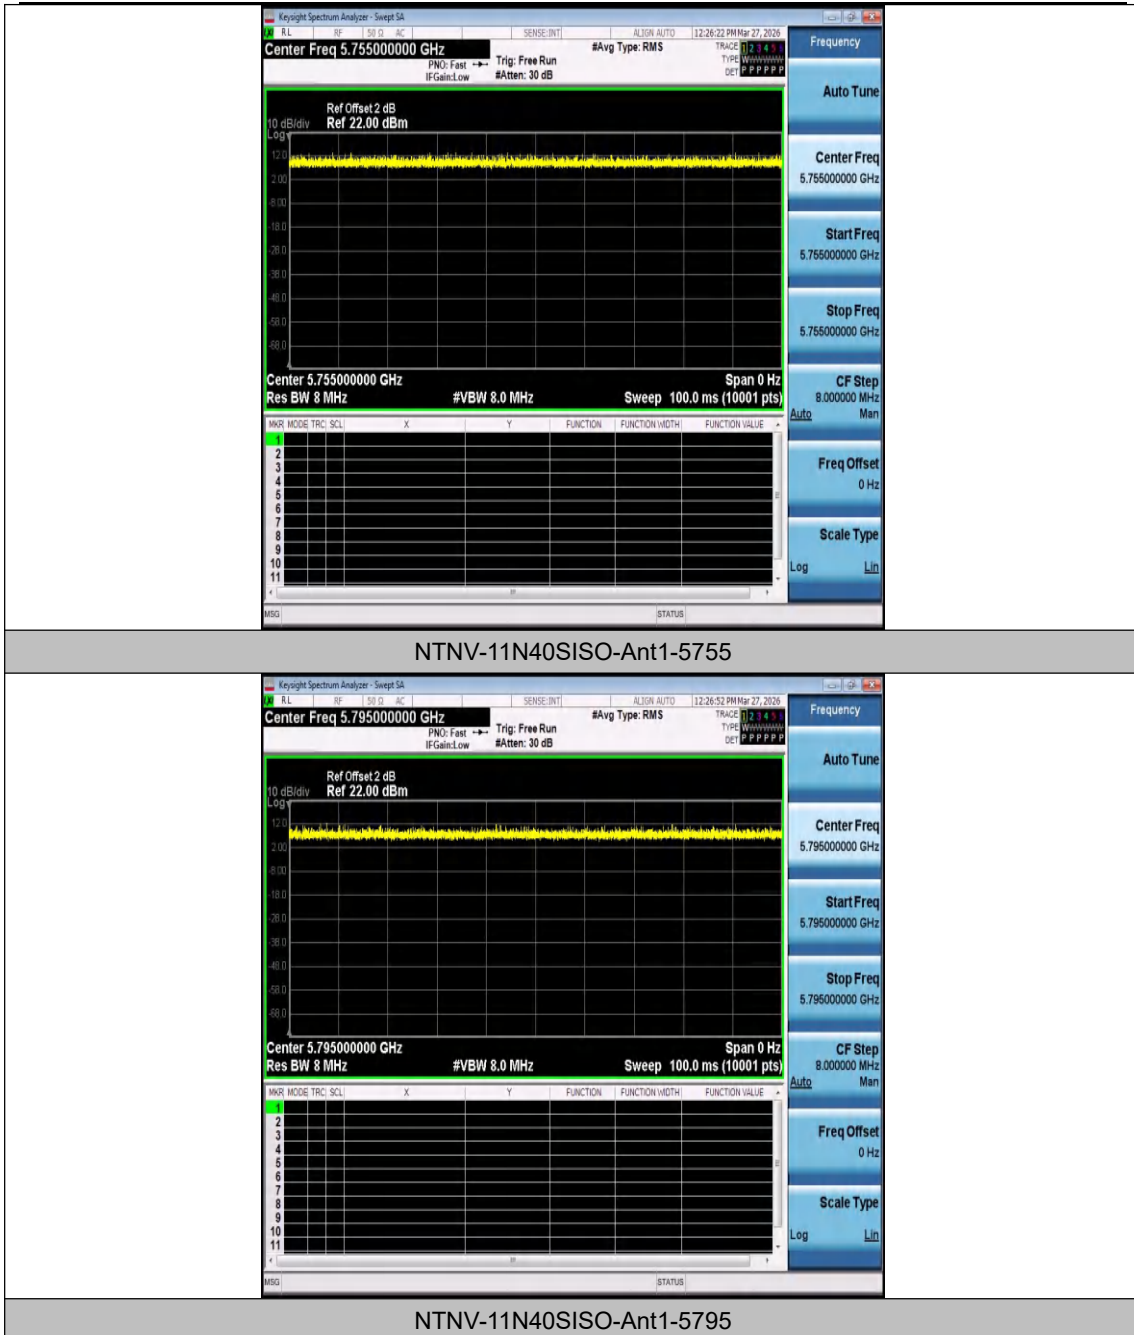

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

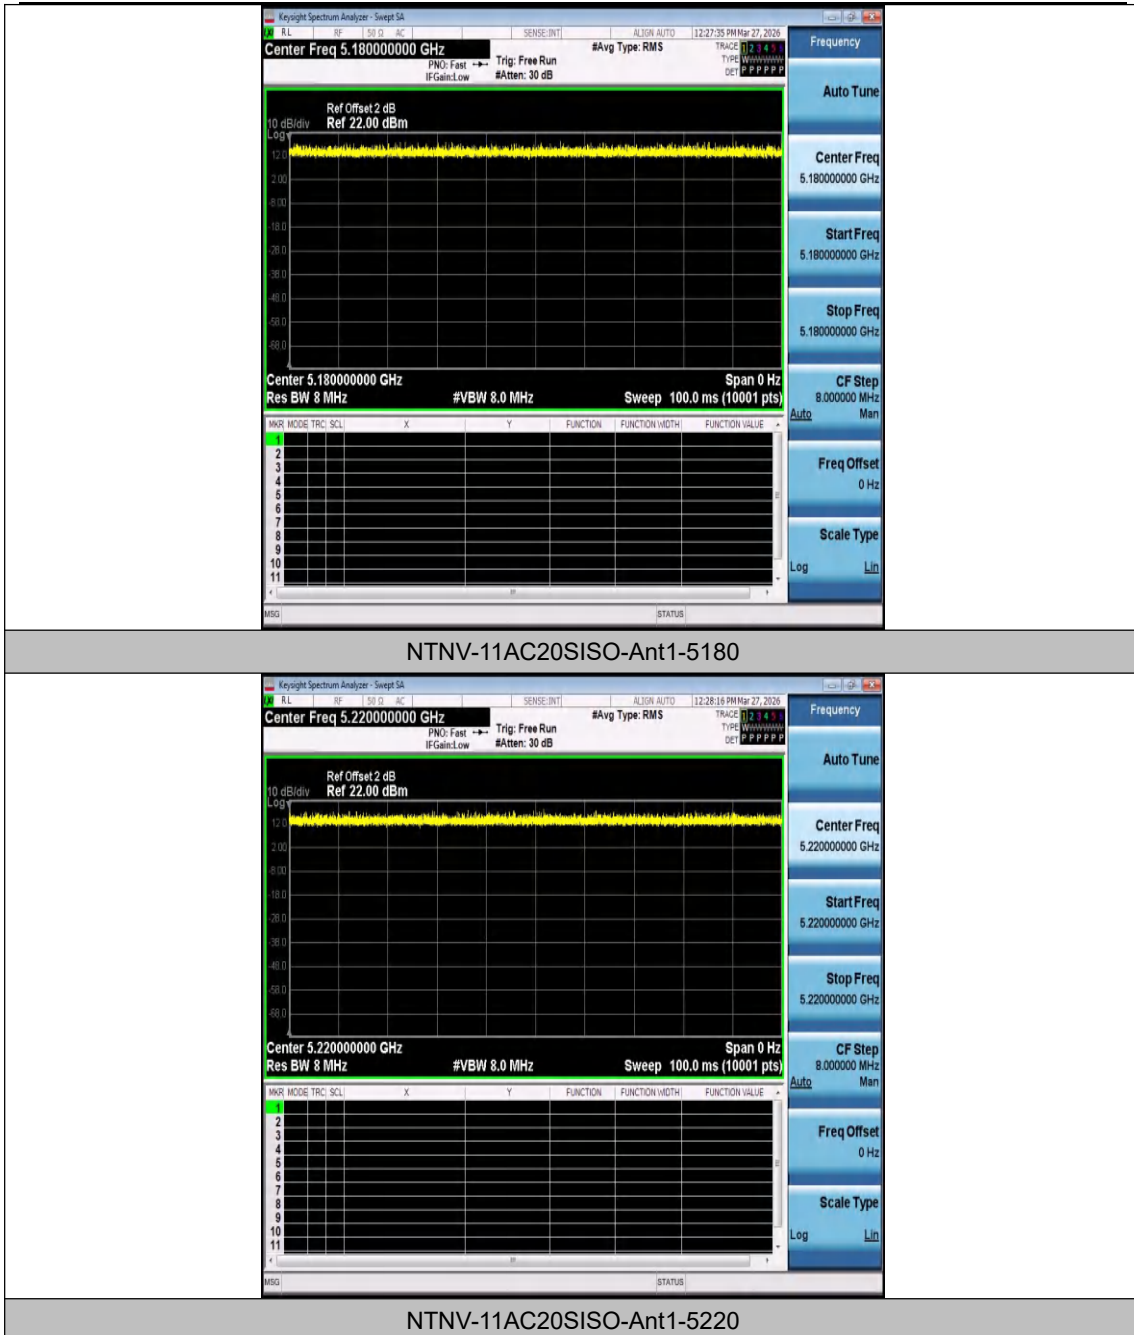


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

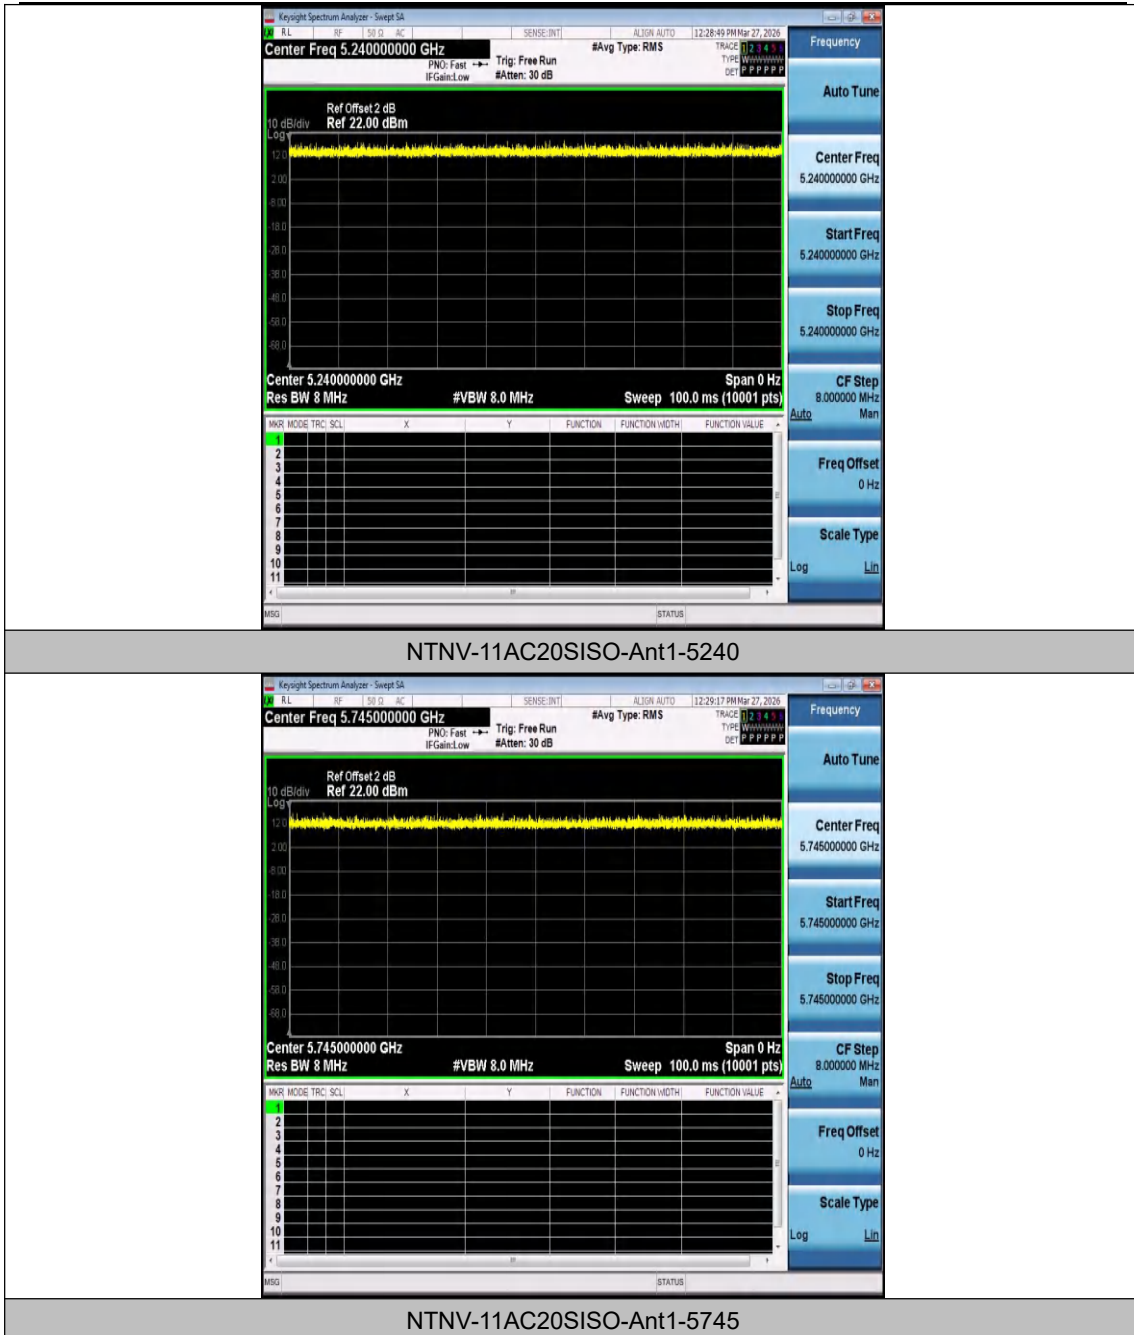

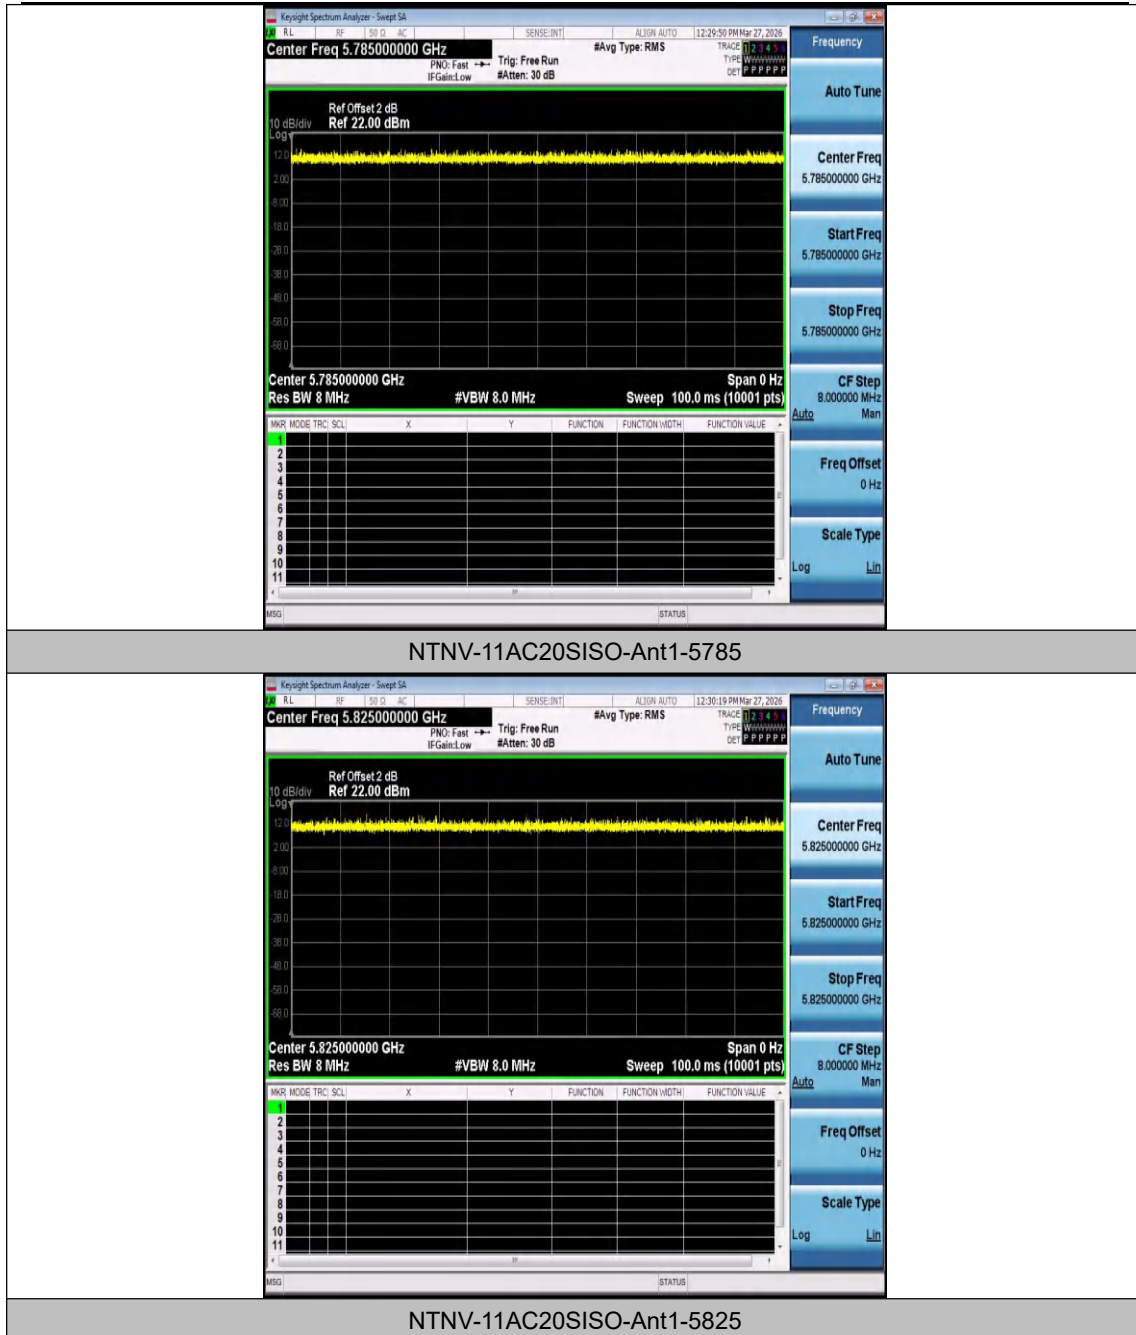

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

