

## Appendix Test Data

|                  |                     |                    |             |
|------------------|---------------------|--------------------|-------------|
| Report No.:      | 1812C50634012504-01 | Test Sample No.:   | 1-2-2       |
| Start Test Date: | 2025-12-3           | Finish Test Date:  | 2025-12-3   |
| Test Engineer:   | Alex Peng           | Auditor:           | Justin Feng |
| Temperature:     | 23.7°C              | Relative Humidity: | 55%         |
| Pressure:        | 101kPa              |                    |             |

## Appendix A1: 26dB Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency [MHz] | 26db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|-----------------|----------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5180            | 20.200         | 5169.920 | 5190.120 | ---        | ---     |
| 11A        | Ant1    | 5220            | 25.040         | 5207.240 | 5232.280 | ---        | ---     |
| 11A        | Ant1    | 5240            | 21.040         | 5229.760 | 5250.800 | ---        | ---     |
| 11A        | Ant1    | 5745            | 22.280         | 5733.280 | 5755.560 | ---        | ---     |
| 11A        | Ant1    | 5785            | 24.880         | 5772.320 | 5797.200 | ---        | ---     |
| 11A        | Ant1    | 5825            | 25.440         | 5811.640 | 5837.080 | ---        | ---     |
| 11N20SISO  | Ant1    | 5180            | 22.480         | 5168.480 | 5190.960 | ---        | ---     |
| 11N20SISO  | Ant1    | 5220            | 20.680         | 5209.640 | 5230.320 | ---        | ---     |
| 11N20SISO  | Ant1    | 5240            | 21.880         | 5228.480 | 5250.360 | ---        | ---     |
| 11N20SISO  | Ant1    | 5745            | 24.680         | 5731.560 | 5756.240 | ---        | ---     |
| 11N20SISO  | Ant1    | 5785            | 28.040         | 5771.360 | 5799.400 | ---        | ---     |
| 11N20SISO  | Ant1    | 5825            | 26.360         | 5812.400 | 5838.760 | ---        | ---     |
| 11N40SISO  | Ant1    | 5190            | 40.800         | 5169.520 | 5210.320 | ---        | ---     |
| 11N40SISO  | Ant1    | 5230            | 41.360         | 5209.200 | 5250.560 | ---        | ---     |
| 11N40SISO  | Ant1    | 5755            | 52.960         | 5726.840 | 5779.800 | ---        | ---     |
| 11N40SISO  | Ant1    | 5795            | 57.120         | 5765.960 | 5823.080 | ---        | ---     |
| 11AC20SISO | Ant1    | 5180            | 20.560         | 5169.800 | 5190.360 | ---        | ---     |
| 11AC20SISO | Ant1    | 5220            | 20.760         | 5209.560 | 5230.320 | ---        | ---     |
| 11AC20SISO | Ant1    | 5240            | 20.480         | 5229.680 | 5250.160 | ---        | ---     |
| 11AC20SISO | Ant1    | 5745            | 23.040         | 5732.240 | 5755.280 | ---        | ---     |
| 11AC20SISO | Ant1    | 5785            | 27.400         | 5770.080 | 5797.480 | ---        | ---     |
| 11AC20SISO | Ant1    | 5825            | 27.640         | 5812.680 | 5840.320 | ---        | ---     |
| 11AC40SISO | Ant1    | 5190            | 41.280         | 5169.520 | 5210.800 | ---        | ---     |
| 11AC40SISO | Ant1    | 5230            | 41.200         | 5209.200 | 5250.400 | ---        | ---     |
| 11AC40SISO | Ant1    | 5755            | 44.320         | 5731.160 | 5775.480 | ---        | ---     |


|            |      |      |        |          |          |     |     |
|------------|------|------|--------|----------|----------|-----|-----|
| 11AC40SISO | Ant1 | 5795 | 56.960 | 5768.760 | 5825.720 | --- | --- |
| 11AX20SISO | Ant1 | 5180 | 20.440 | 5169.800 | 5190.240 | --- | --- |
| 11AX20SISO | Ant1 | 5220 | 20.480 | 5209.840 | 5230.320 | --- | --- |
| 11AX20SISO | Ant1 | 5240 | 20.600 | 5229.600 | 5250.200 | --- | --- |
| 11AX20SISO | Ant1 | 5745 | 24.560 | 5732.240 | 5756.800 | --- | --- |
| 11AX20SISO | Ant1 | 5785 | 27.000 | 5771.240 | 5798.240 | --- | --- |
| 11AX20SISO | Ant1 | 5825 | 27.960 | 5811.480 | 5839.440 | --- | --- |
| 11AX40SISO | Ant1 | 5190 | 41.360 | 5169.440 | 5210.800 | --- | --- |
| 11AX40SISO | Ant1 | 5230 | 41.280 | 5209.440 | 5250.720 | --- | --- |
| 11AX40SISO | Ant1 | 5755 | 54.080 | 5725.480 | 5779.560 | --- | --- |
| 11AX40SISO | Ant1 | 5795 | 54.800 | 5768.360 | 5823.160 | --- | --- |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

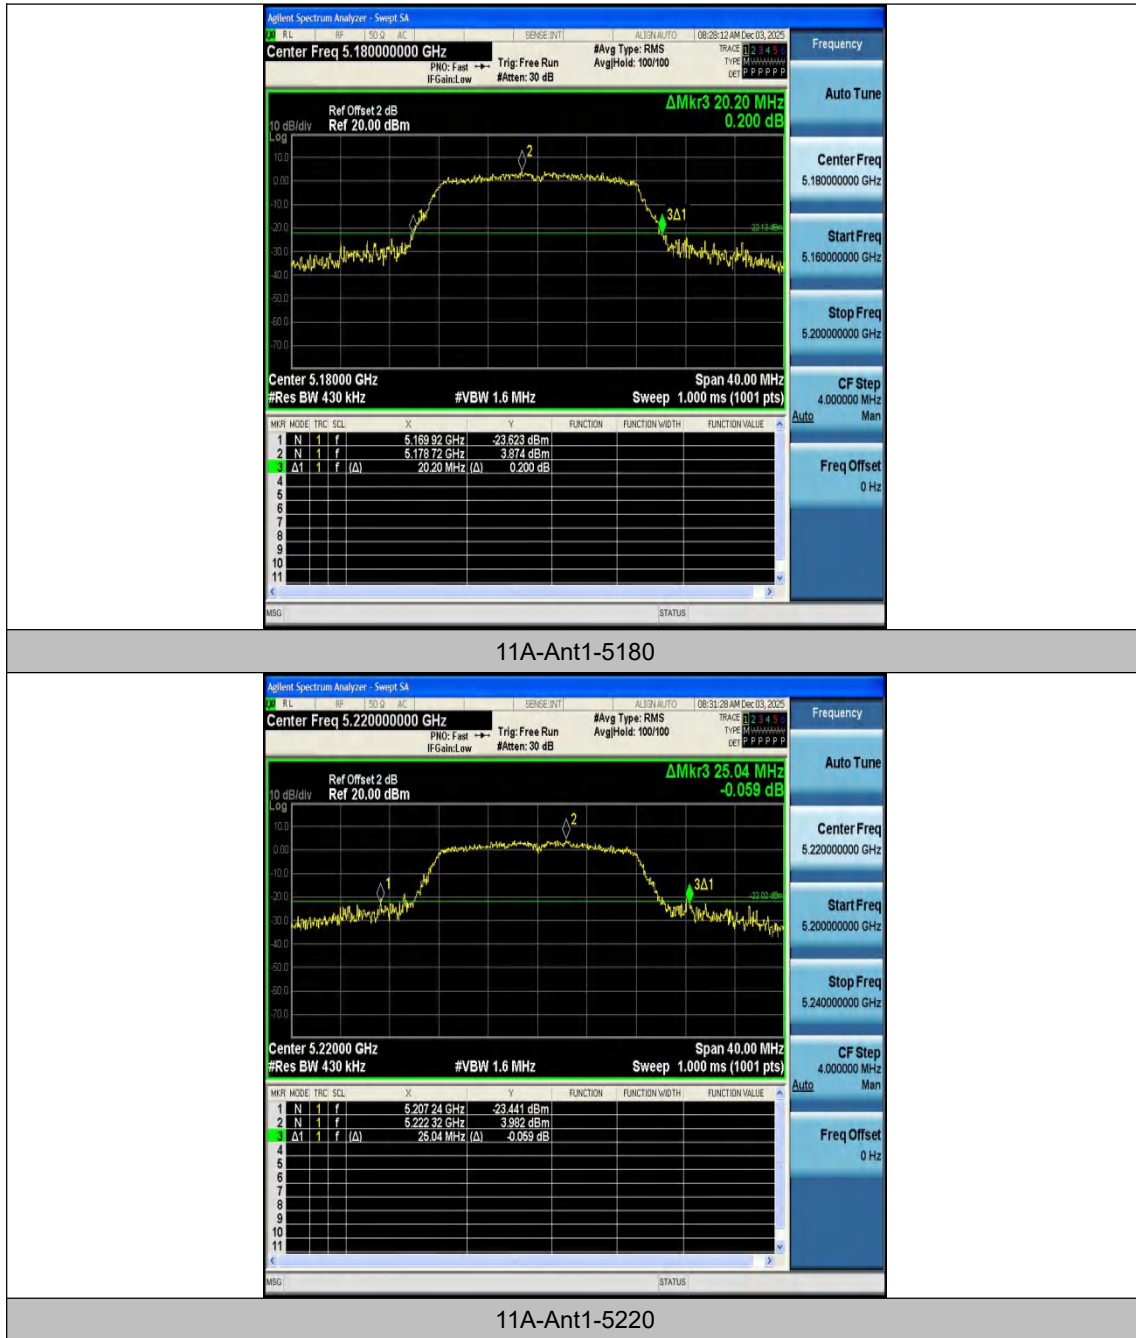

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

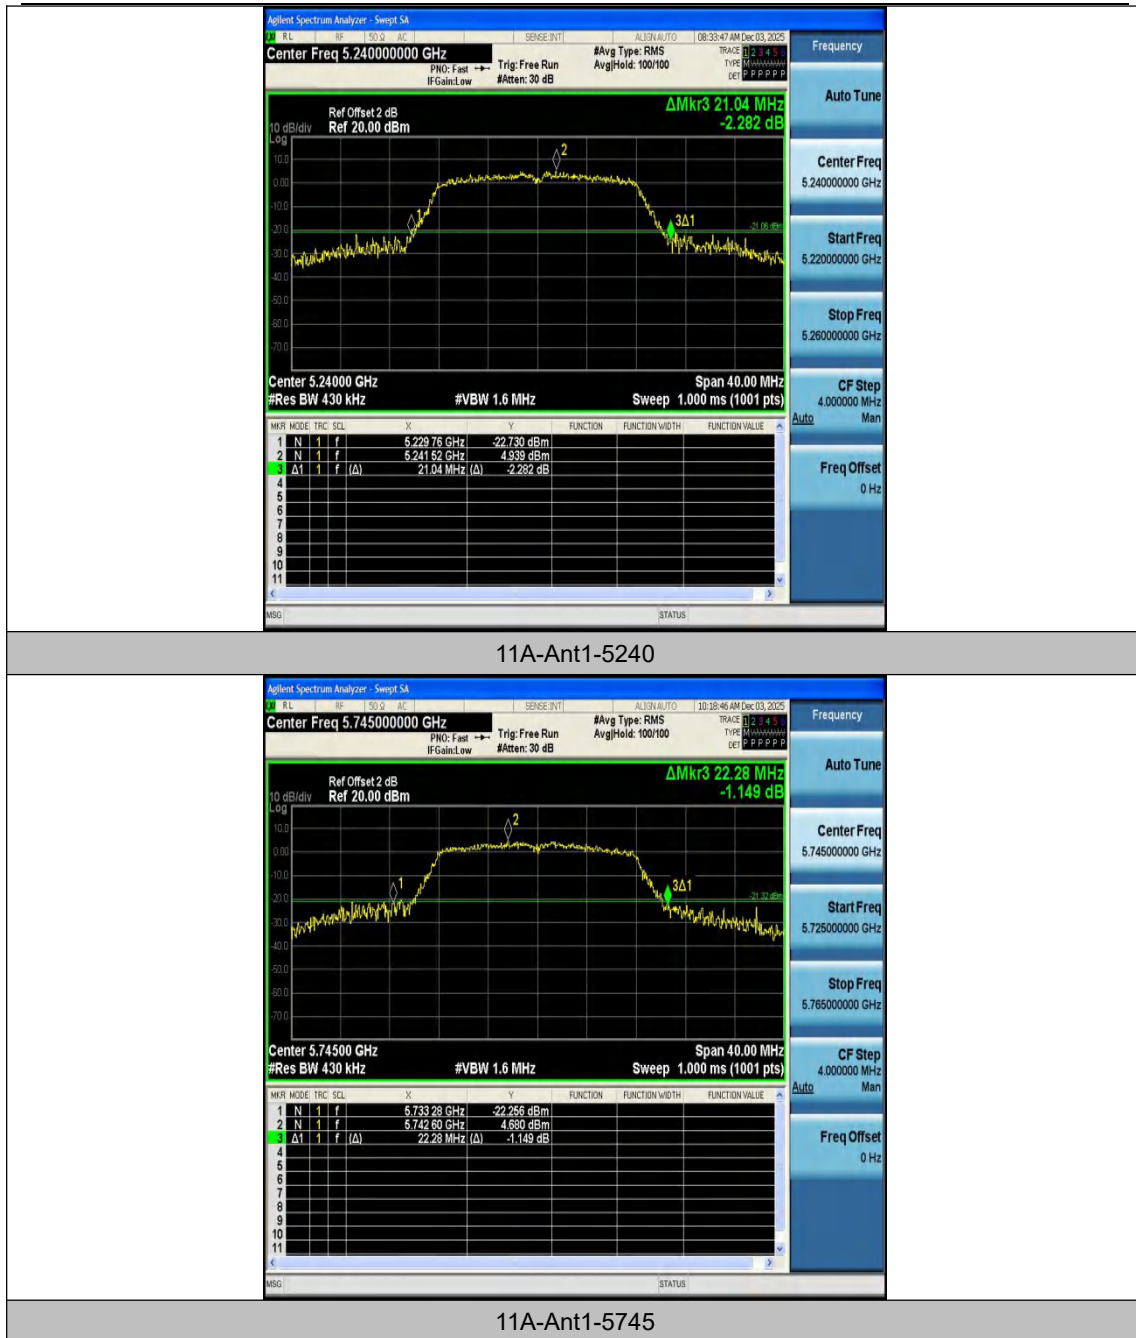








**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



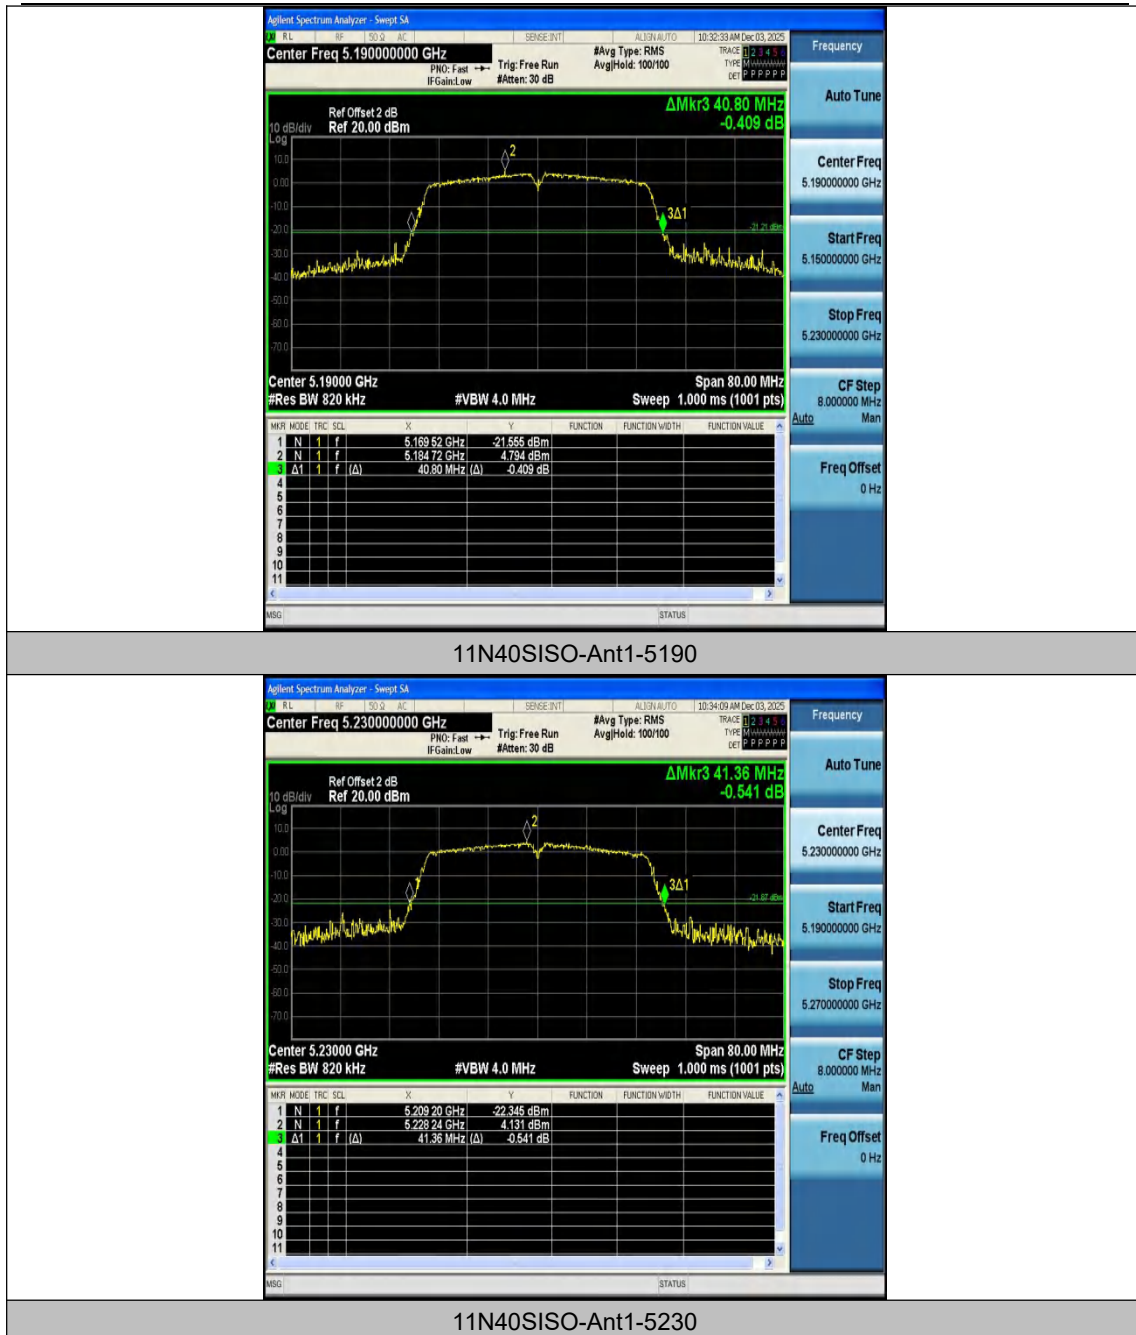



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



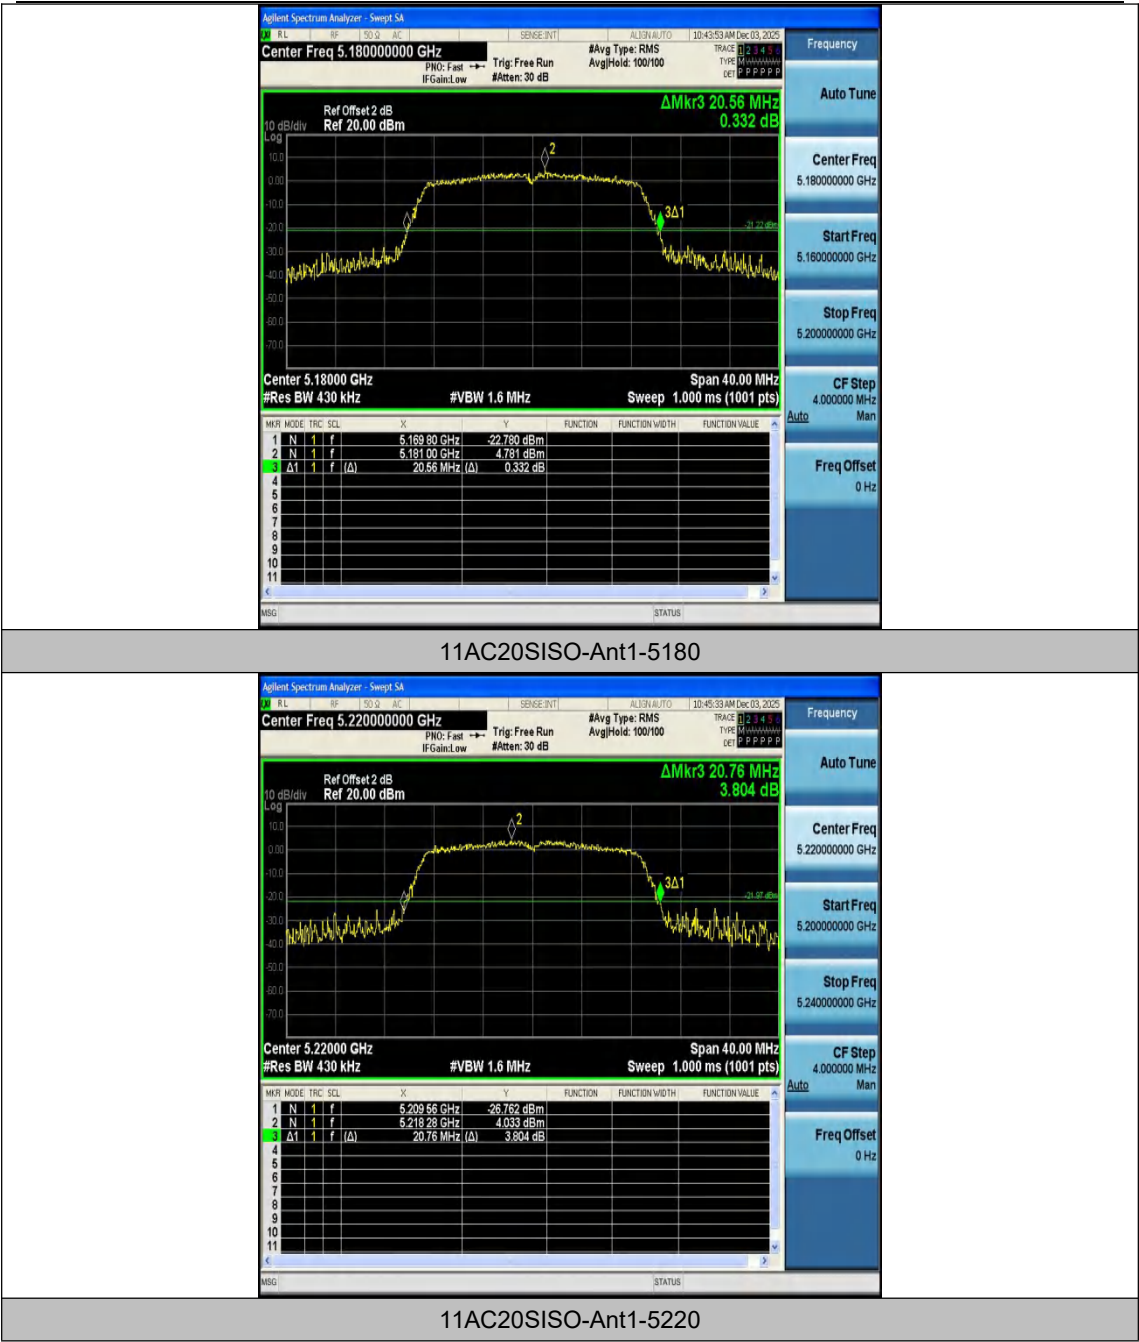

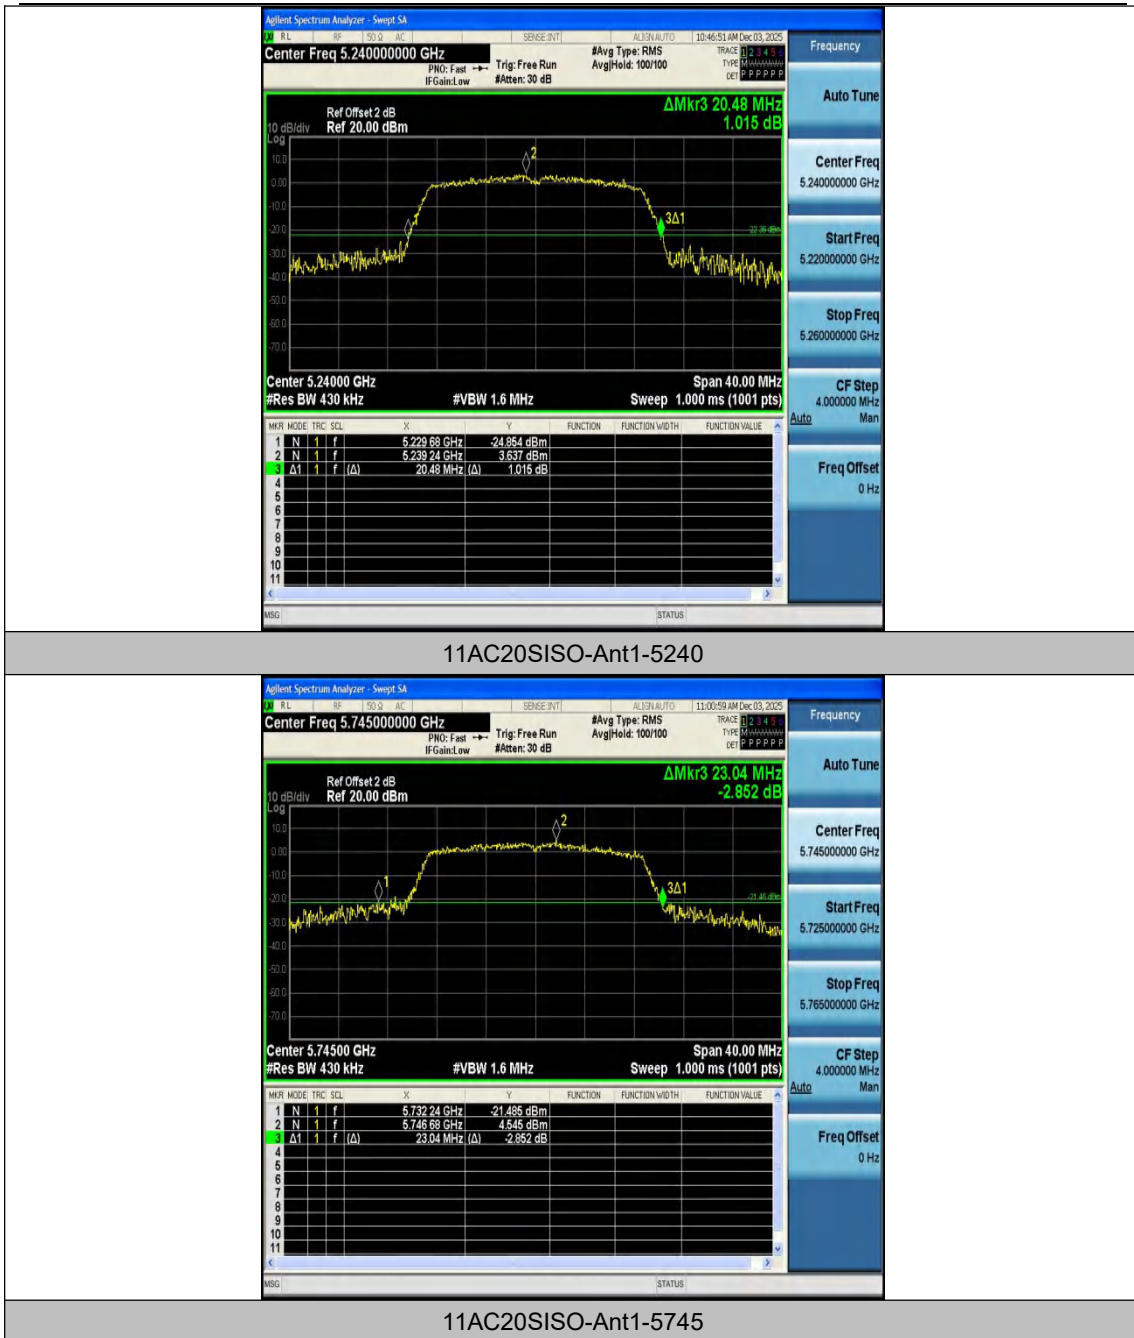


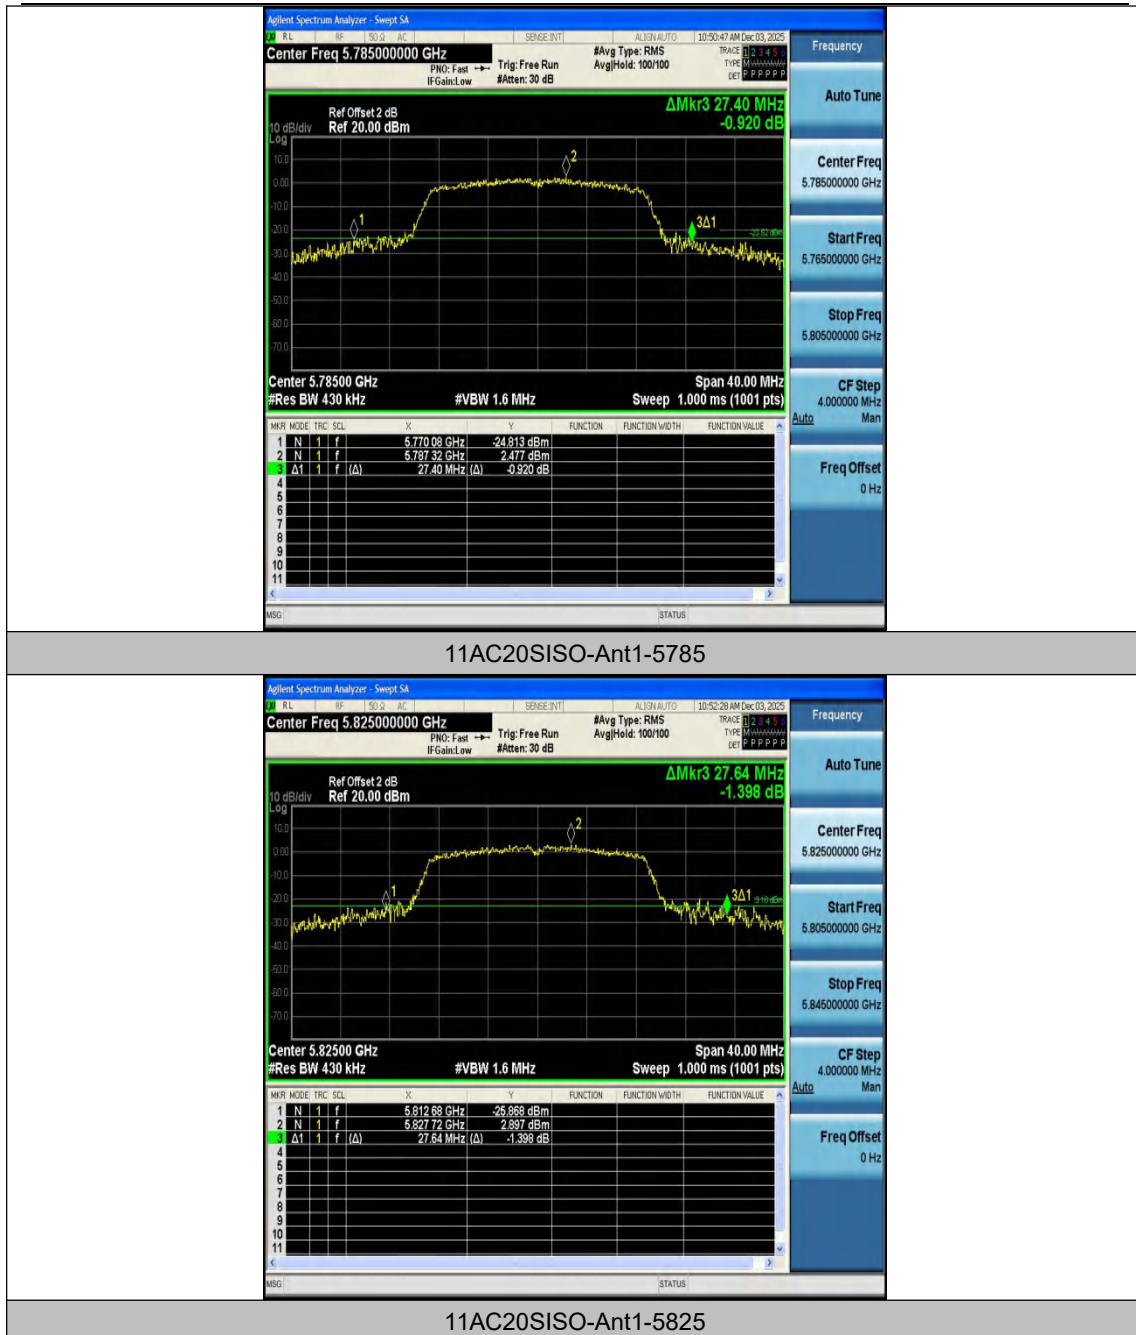

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

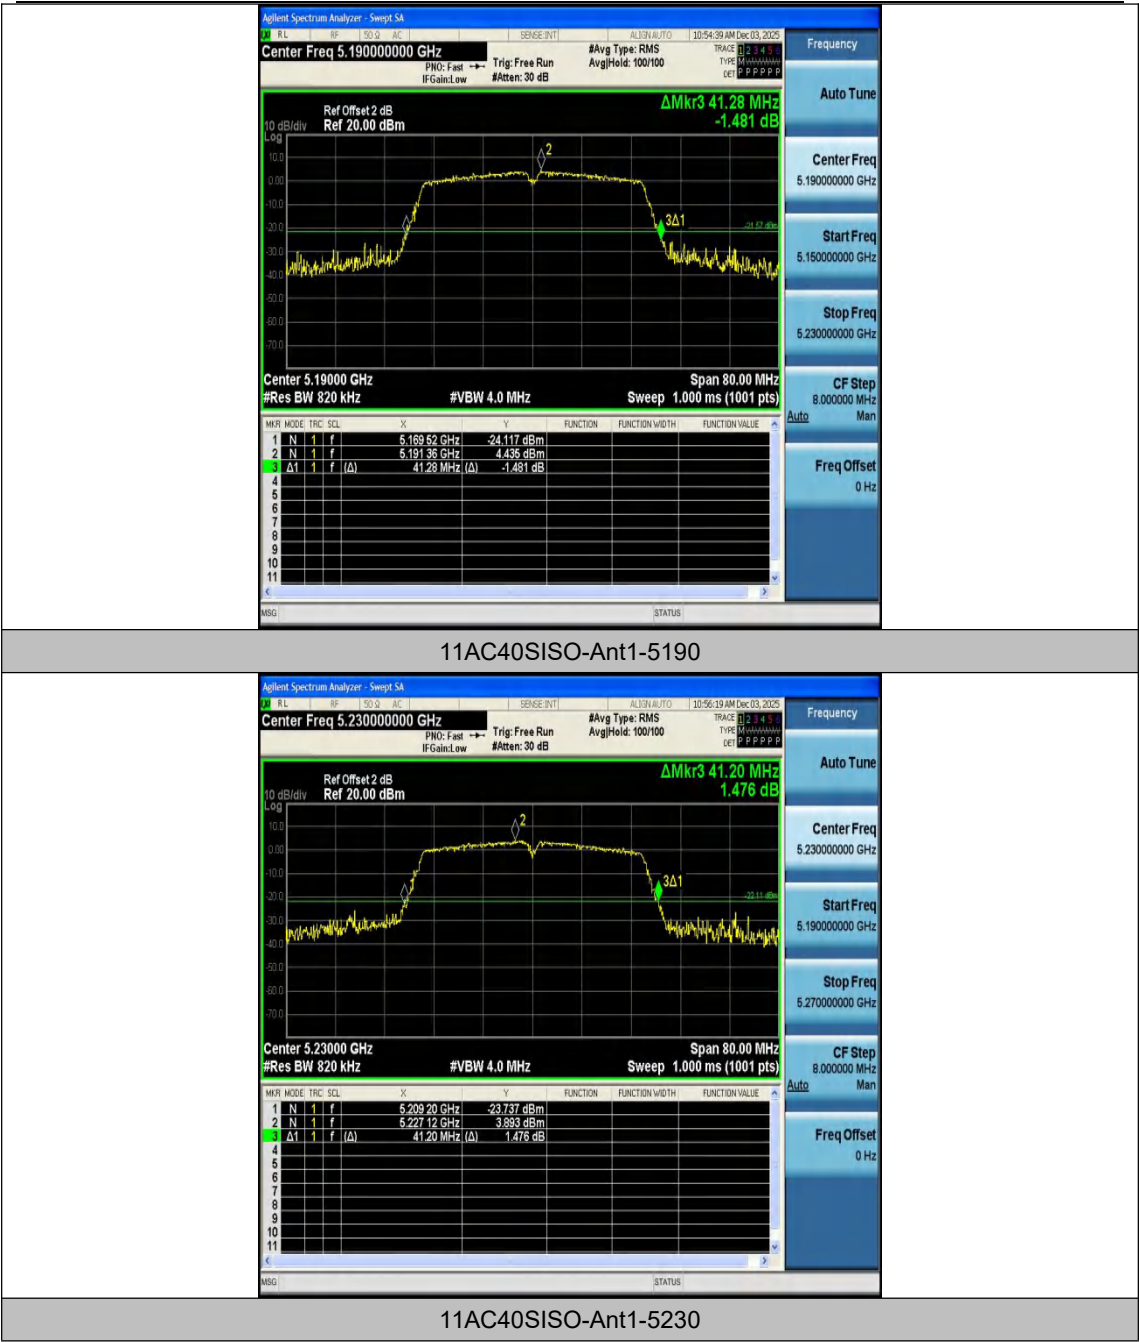



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.



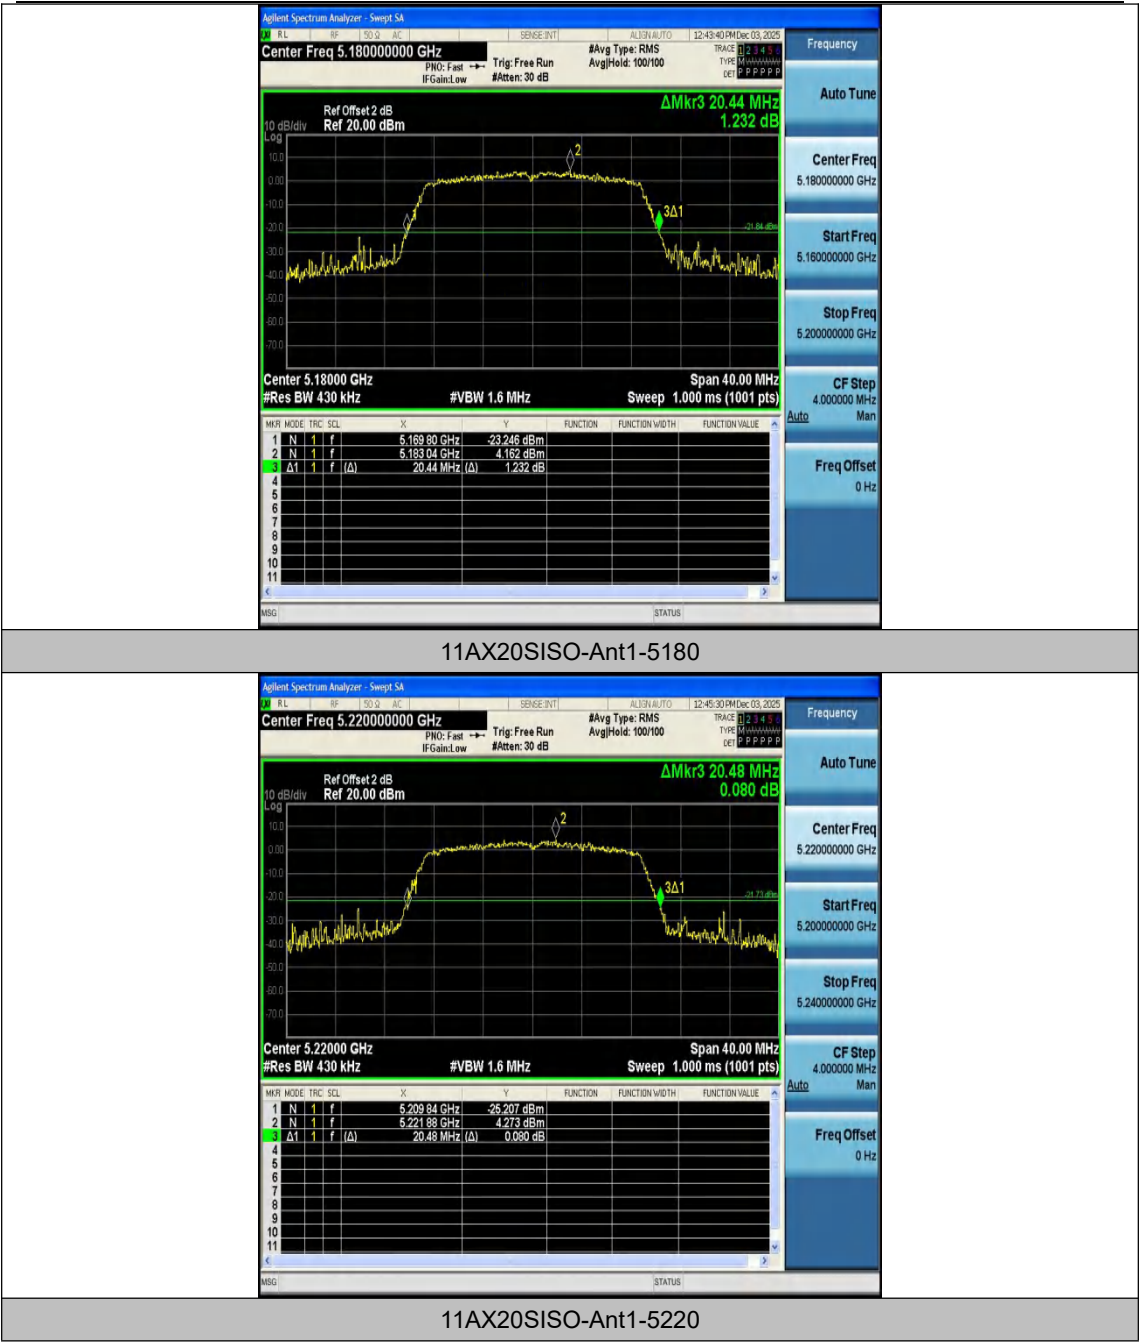

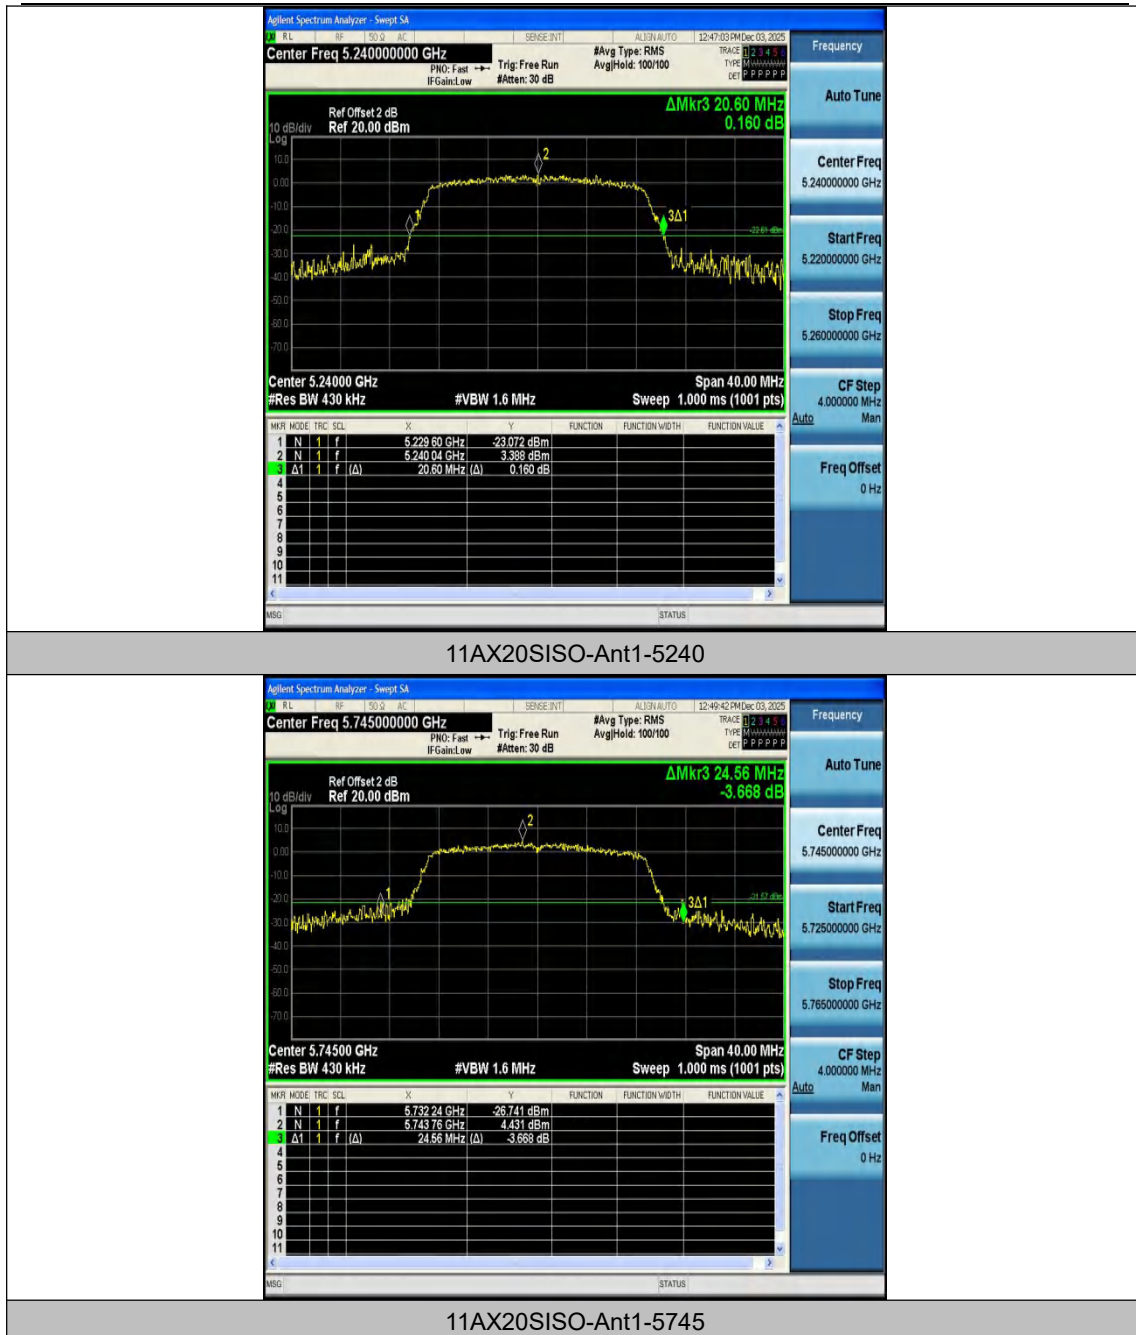

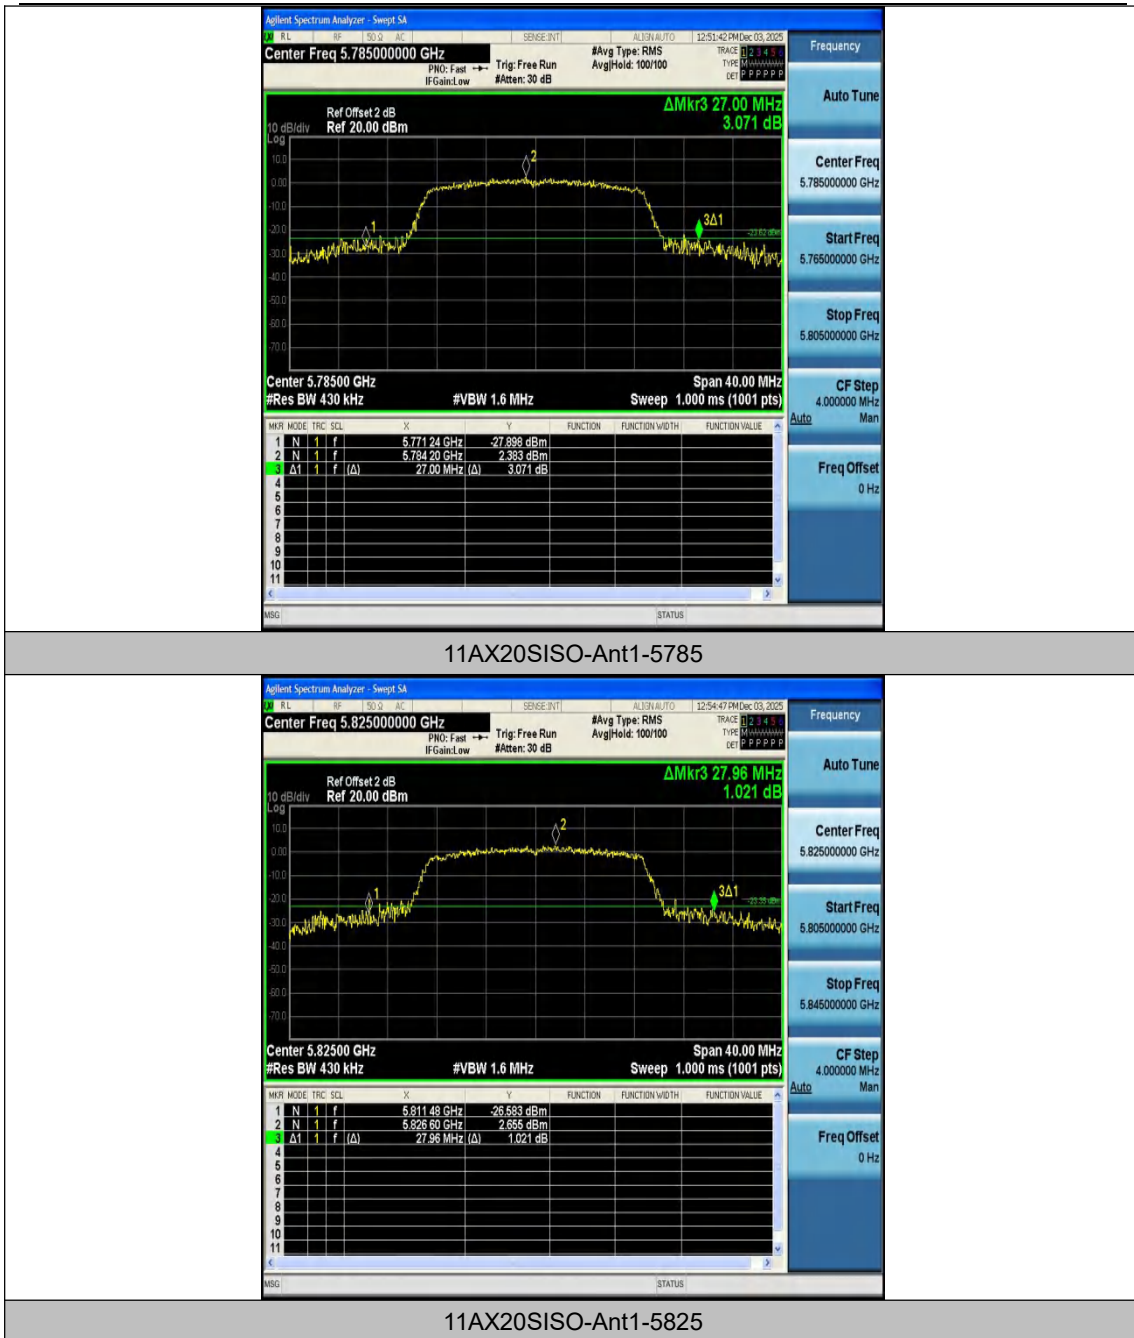

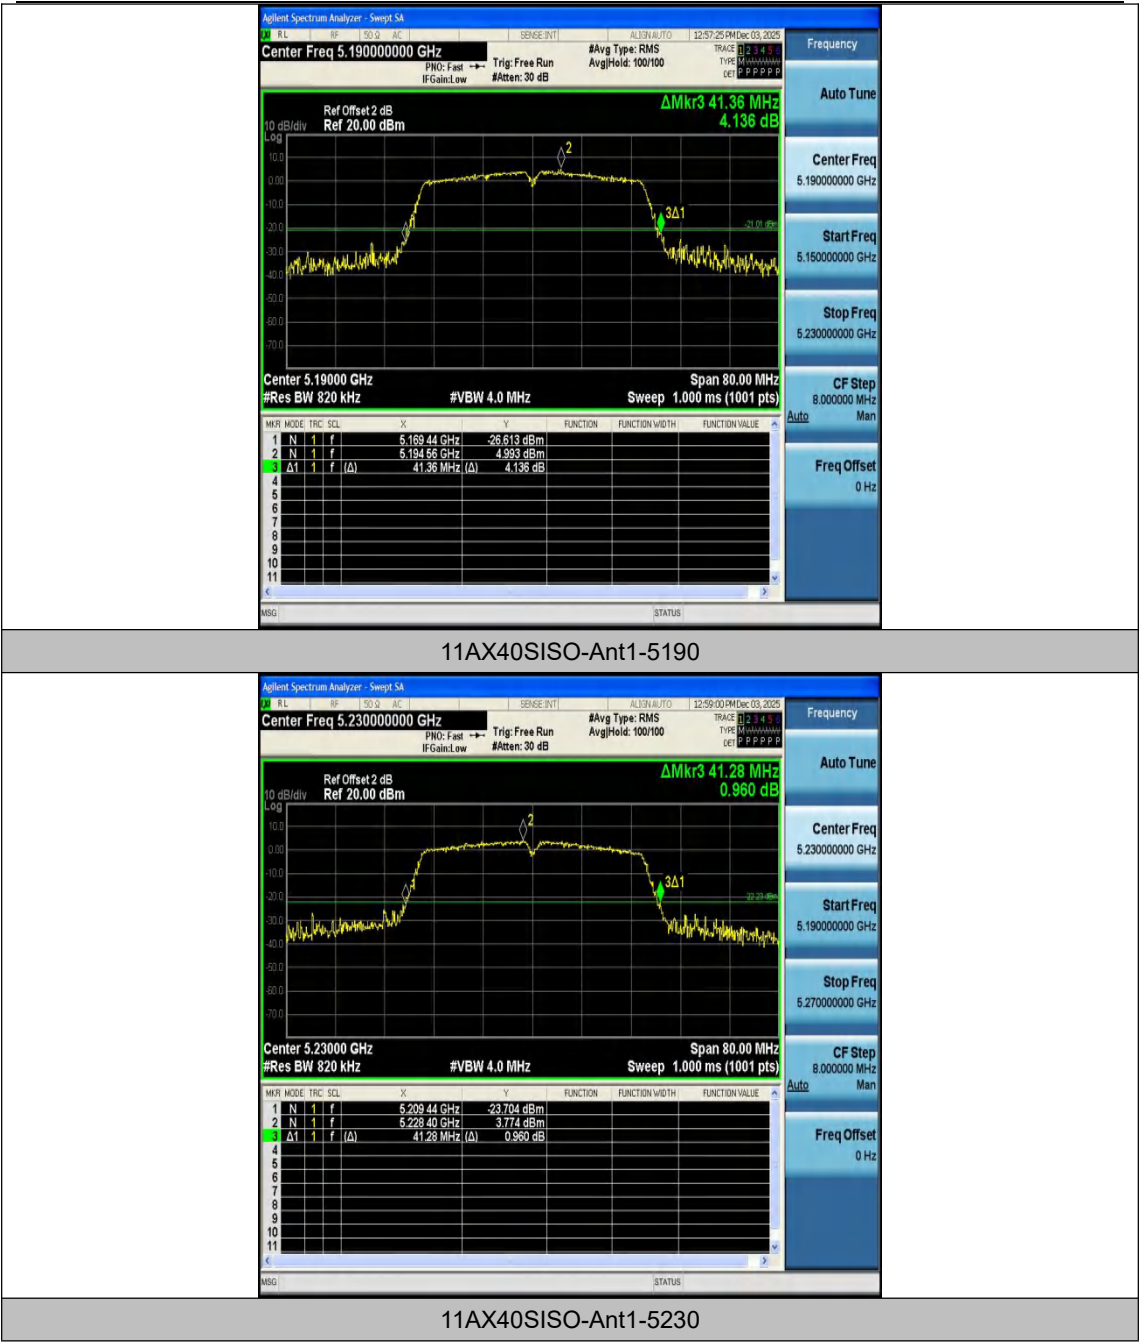




## Appendix A2: 99% Occupied Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | OCB [MHz] | FL[MHz]   | FH[MHz]   | Limit[MHz] | Verdict |
|------------|---------|----------------|-----------|-----------|-----------|------------|---------|
| 11A        | Ant1    | 5180           | 16.863    | 5171.5545 | 5188.4175 | ---        | ---     |
| 11A        | Ant1    | 5220           | 17.030    | 5211.4532 | 5228.4832 | ---        | ---     |
| 11A        | Ant1    | 5240           | 16.883    | 5231.6071 | 5248.4901 | ---        | ---     |
| 11A        | Ant1    | 5745           | 16.900    | 5736.4506 | 5753.3506 | ---        | ---     |
| 11A        | Ant1    | 5785           | 16.896    | 5776.5309 | 5793.4269 | ---        | ---     |
| 11A        | Ant1    | 5825           | 16.901    | 5816.6211 | 5833.5221 | ---        | ---     |
| 11N20SISO  | Ant1    | 5180           | 17.932    | 5171.0619 | 5188.9939 | ---        | ---     |
| 11N20SISO  | Ant1    | 5220           | 17.808    | 5211.0981 | 5228.9061 | ---        | ---     |
| 11N20SISO  | Ant1    | 5240           | 17.962    | 5231.0825 | 5249.0445 | ---        | ---     |
| 11N20SISO  | Ant1    | 5745           | 17.862    | 5736.0216 | 5753.8836 | ---        | ---     |
| 11N20SISO  | Ant1    | 5785           | 17.933    | 5776.0355 | 5793.9685 | ---        | ---     |
| 11N20SISO  | Ant1    | 5825           | 17.865    | 5816.1137 | 5833.9787 | ---        | ---     |
| 11N40SISO  | Ant1    | 5190           | 36.048    | 5172.0121 | 5208.0601 | ---        | ---     |
| 11N40SISO  | Ant1    | 5230           | 36.054    | 5211.9081 | 5247.9621 | ---        | ---     |
| 11N40SISO  | Ant1    | 5755           | 36.225    | 5736.7090 | 5772.9340 | ---        | ---     |
| 11N40SISO  | Ant1    | 5795           | 36.480    | 5776.7037 | 5813.1837 | ---        | ---     |
| 11AC20SISO | Ant1    | 5180           | 17.741    | 5171.1622 | 5188.9032 | ---        | ---     |
| 11AC20SISO | Ant1    | 5220           | 17.831    | 5211.0615 | 5228.8925 | ---        | ---     |
| 11AC20SISO | Ant1    | 5240           | 17.846    | 5231.0452 | 5248.8912 | ---        | ---     |
| 11AC20SISO | Ant1    | 5745           | 17.869    | 5736.0274 | 5753.8964 | ---        | ---     |
| 11AC20SISO | Ant1    | 5785           | 18.006    | 5775.9633 | 5793.9693 | ---        | ---     |
| 11AC20SISO | Ant1    | 5825           | 17.907    | 5816.0736 | 5833.9806 | ---        | ---     |
| 11AC40SISO | Ant1    | 5190           | 36.084    | 5172.0242 | 5208.1082 | ---        | ---     |
| 11AC40SISO | Ant1    | 5230           | 36.098    | 5211.9329 | 5248.0309 | ---        | ---     |
| 11AC40SISO | Ant1    | 5755           | 36.386    | 5736.5627 | 5772.9487 | ---        | ---     |
| 11AC40SISO | Ant1    | 5795           | 36.382    | 5776.7860 | 5813.1680 | ---        | ---     |
| 11AX20SISO | Ant1    | 5180           | 17.772    | 5171.1514 | 5188.9234 | ---        | ---     |
| 11AX20SISO | Ant1    | 5220           | 17.740    | 5211.1155 | 5228.8555 | ---        | ---     |
| 11AX20SISO | Ant1    | 5240           | 17.768    | 5231.0974 | 5248.8654 | ---        | ---     |
| 11AX20SISO | Ant1    | 5745           | 17.927    | 5735.9627 | 5753.8897 | ---        | ---     |
| 11AX20SISO | Ant1    | 5785           | 17.916    | 5776.0245 | 5793.9405 | ---        | ---     |
| 11AX20SISO | Ant1    | 5825           | 17.870    | 5816.1006 | 5833.9706 | ---        | ---     |
| 11AX40SISO | Ant1    | 5190           | 36.131    | 5171.9657 | 5208.0967 | ---        | ---     |
| 11AX40SISO | Ant1    | 5230           | 36.042    | 5211.9197 | 5247.9617 | ---        | ---     |
| 11AX40SISO | Ant1    | 5755           | 36.251    | 5736.6588 | 5772.9098 | ---        | ---     |
| 11AX40SISO | Ant1    | 5795           | 36.340    | 5776.8167 | 5813.1567 | ---        | ---     |

## Test Graphs

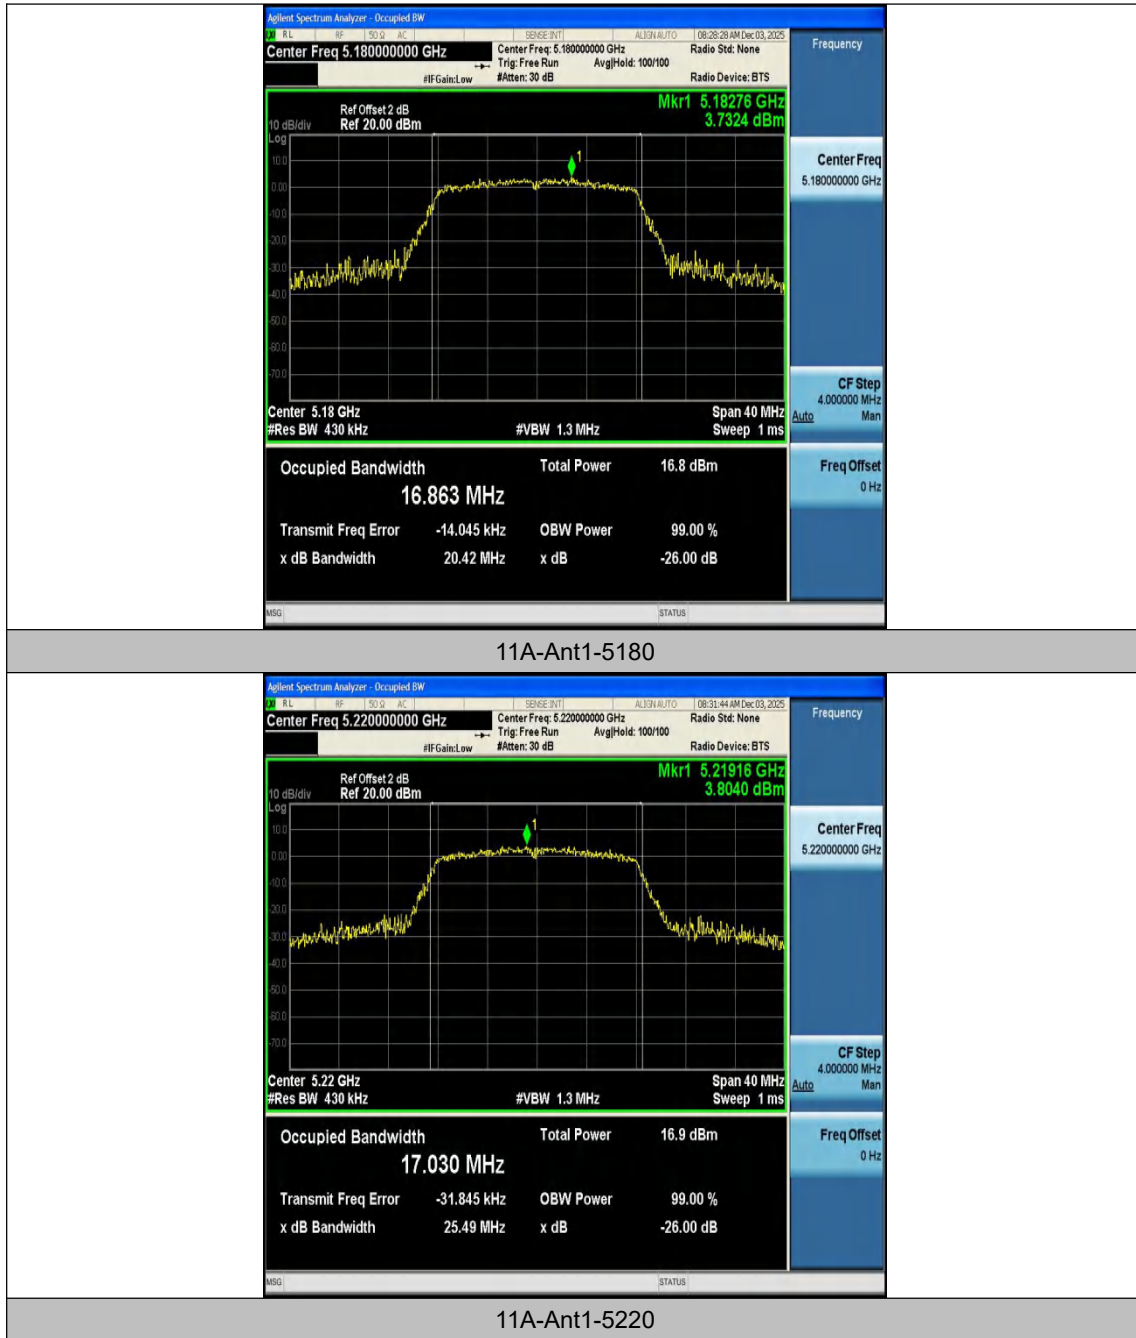


## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



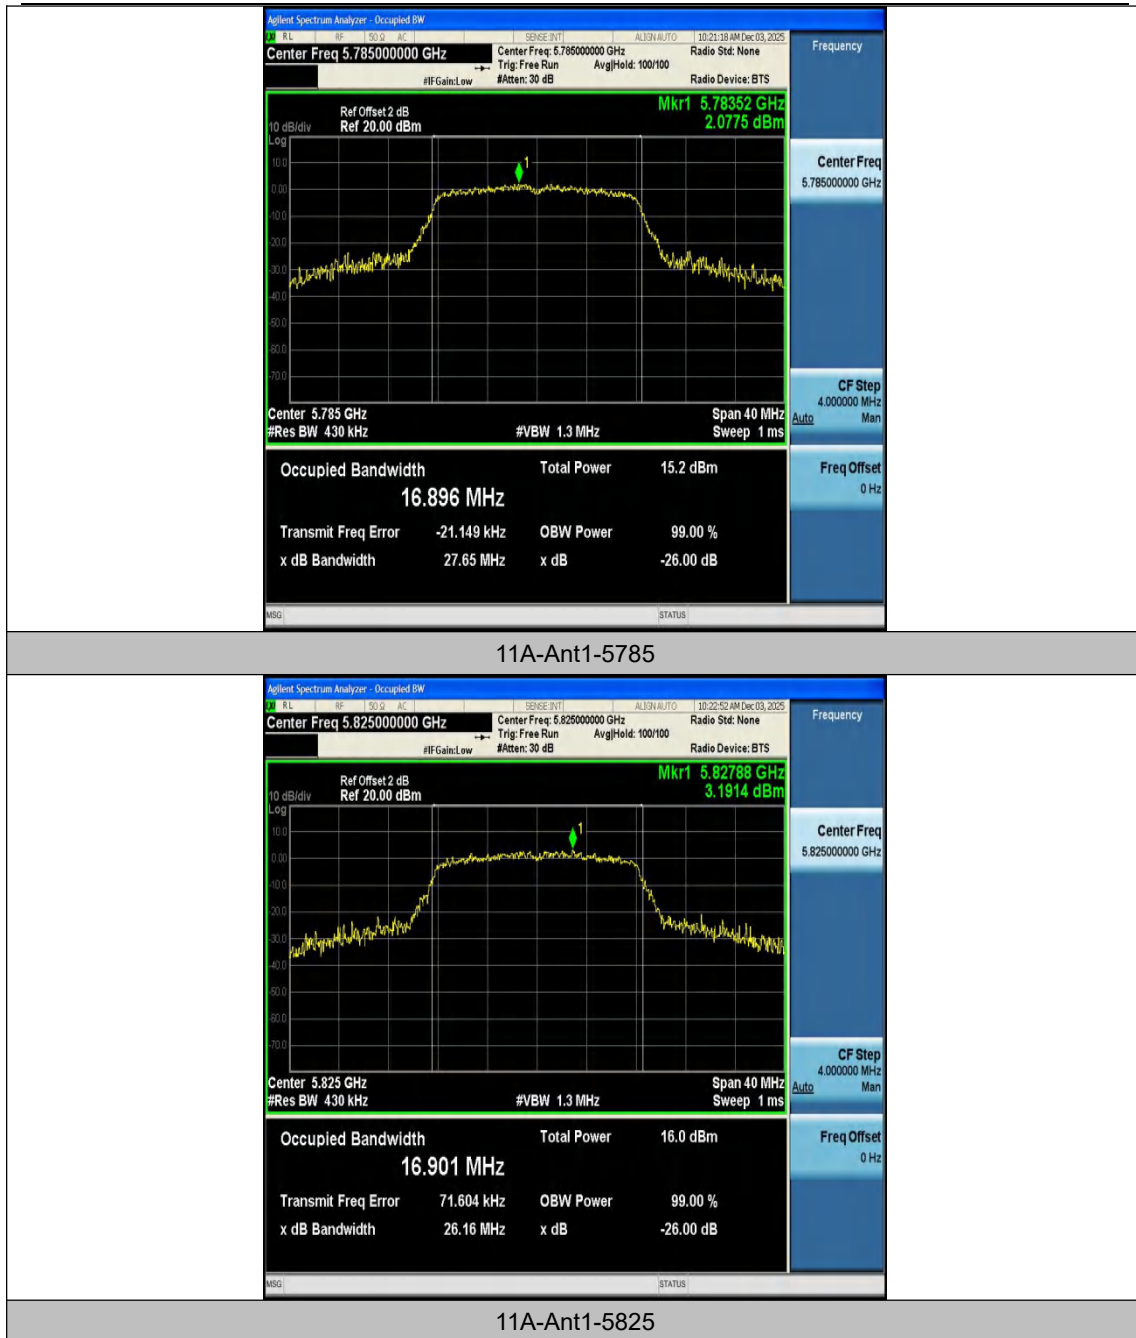

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)








**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

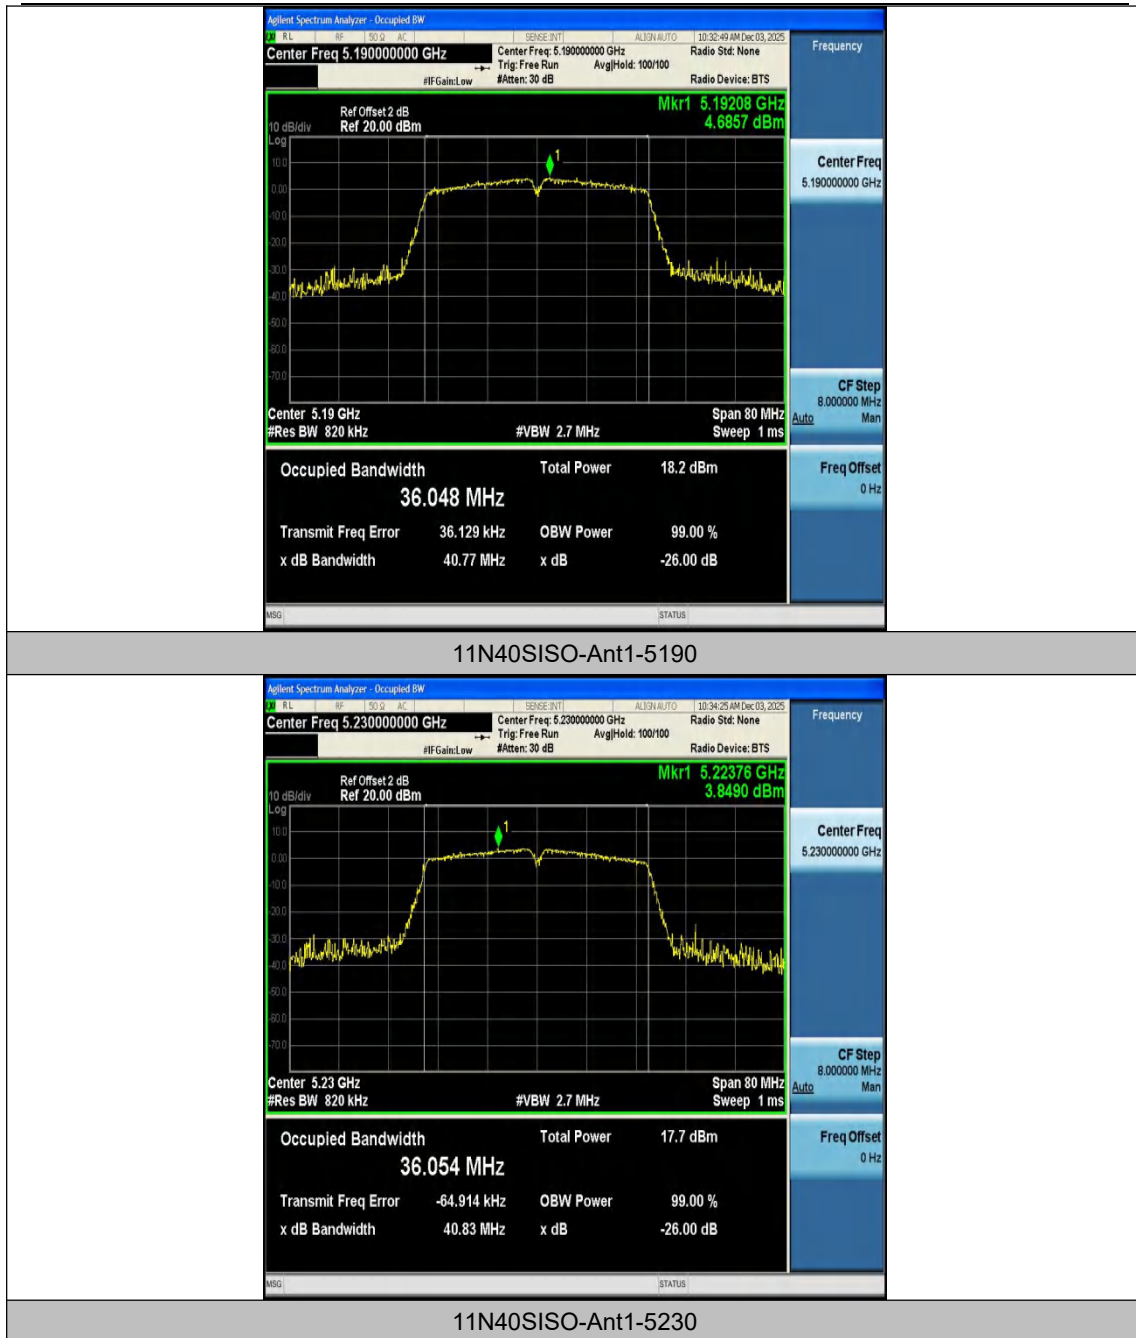

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

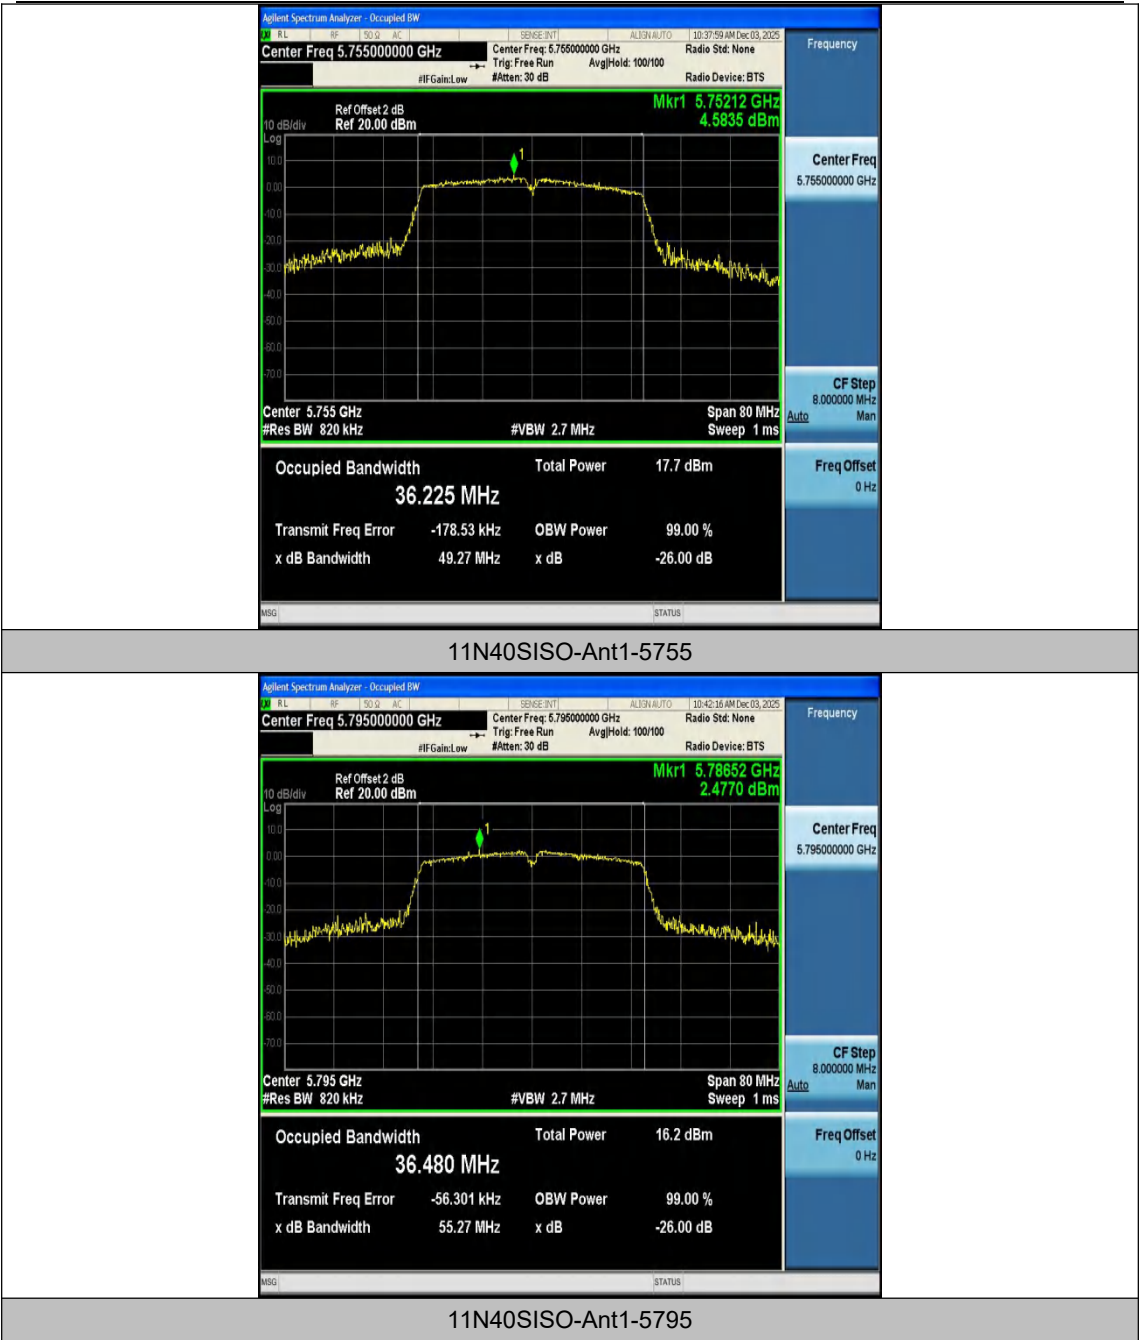

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

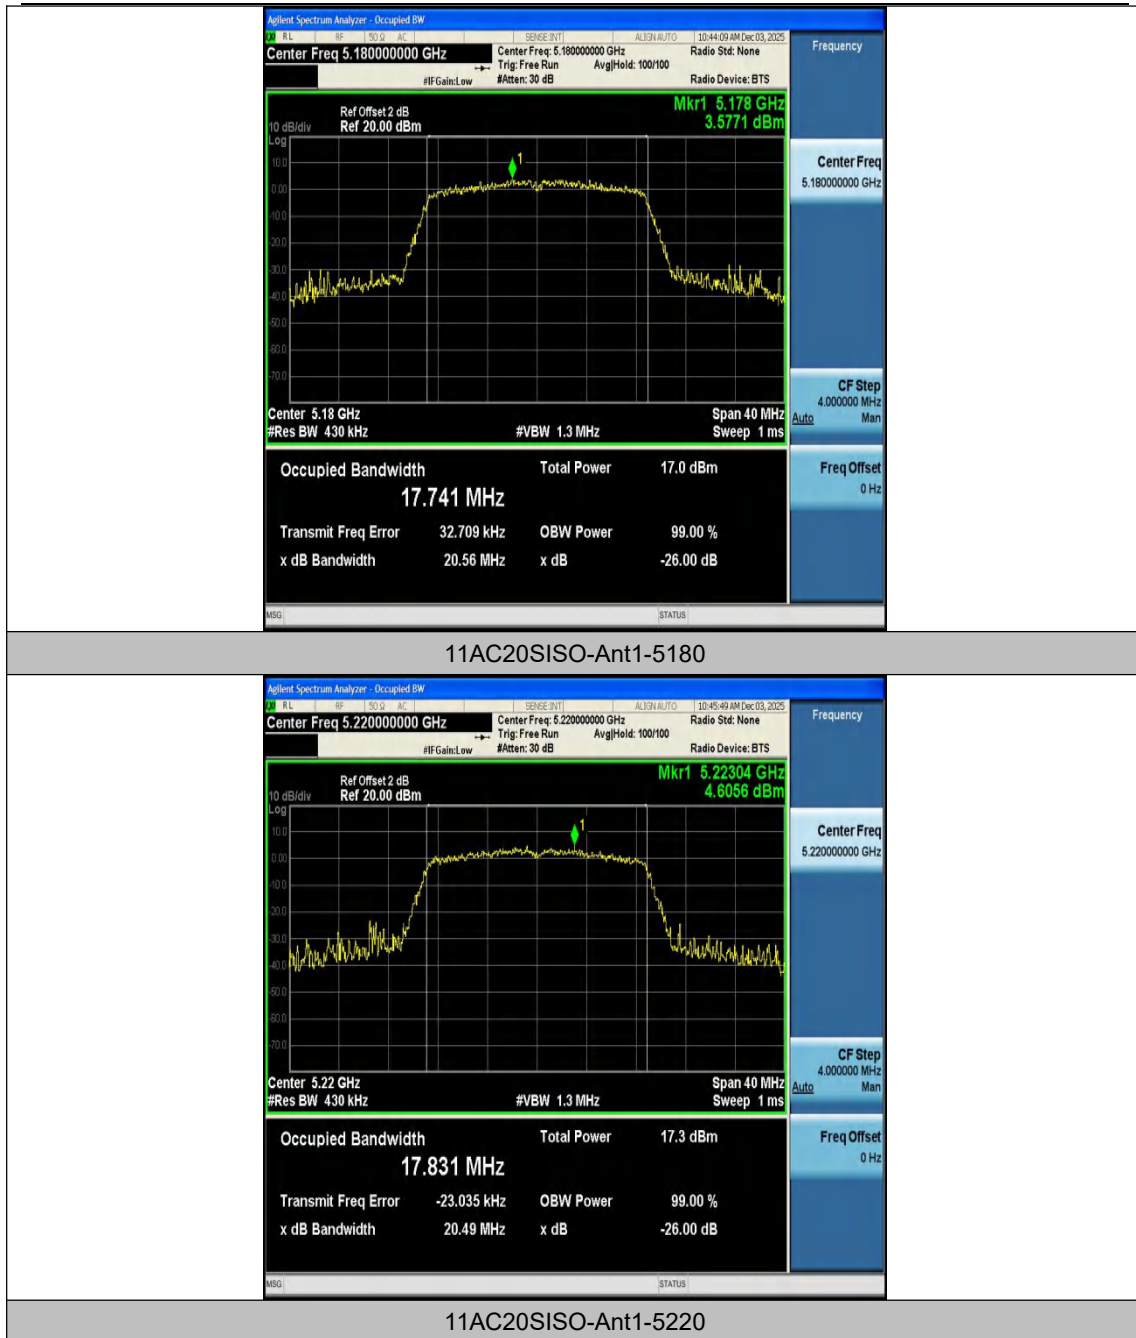


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)






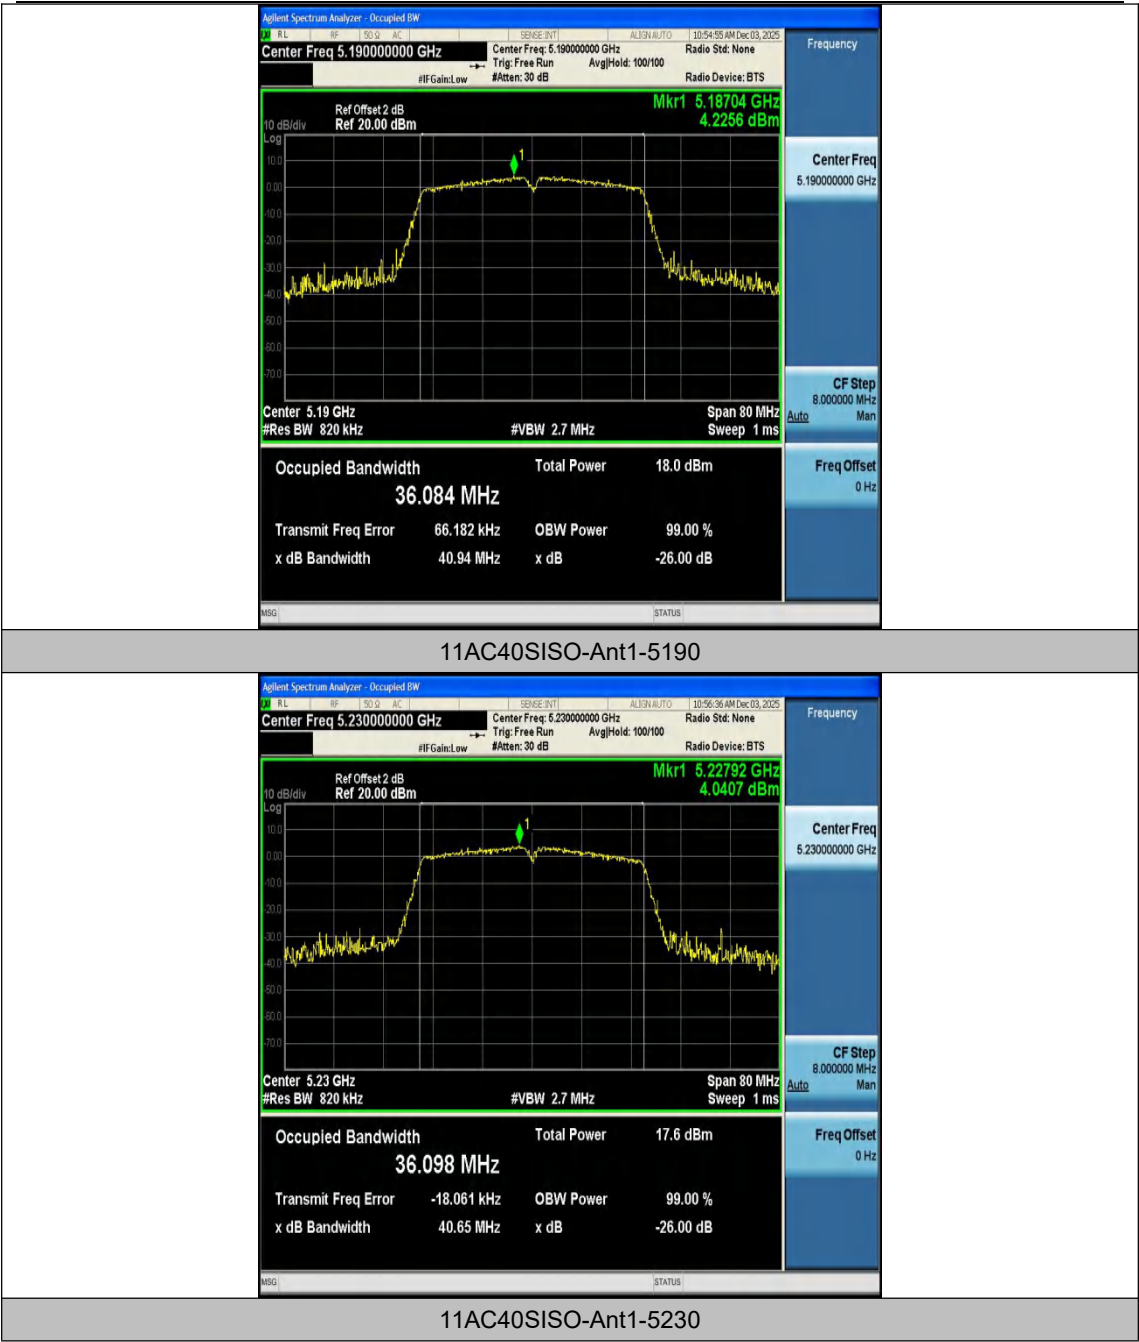

**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

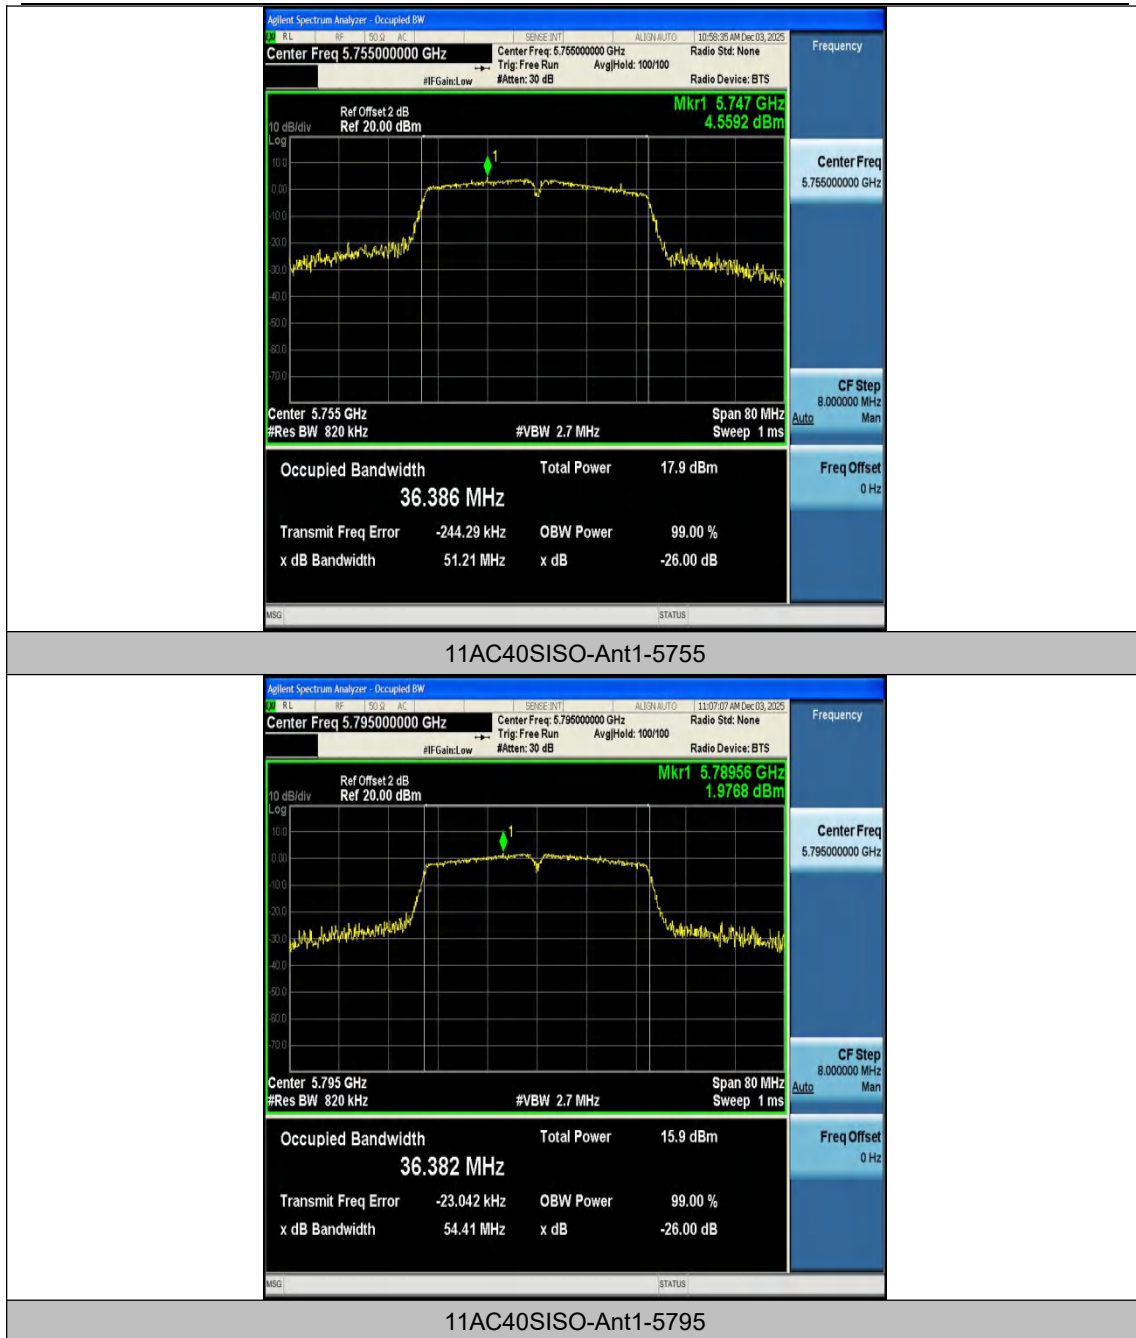

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

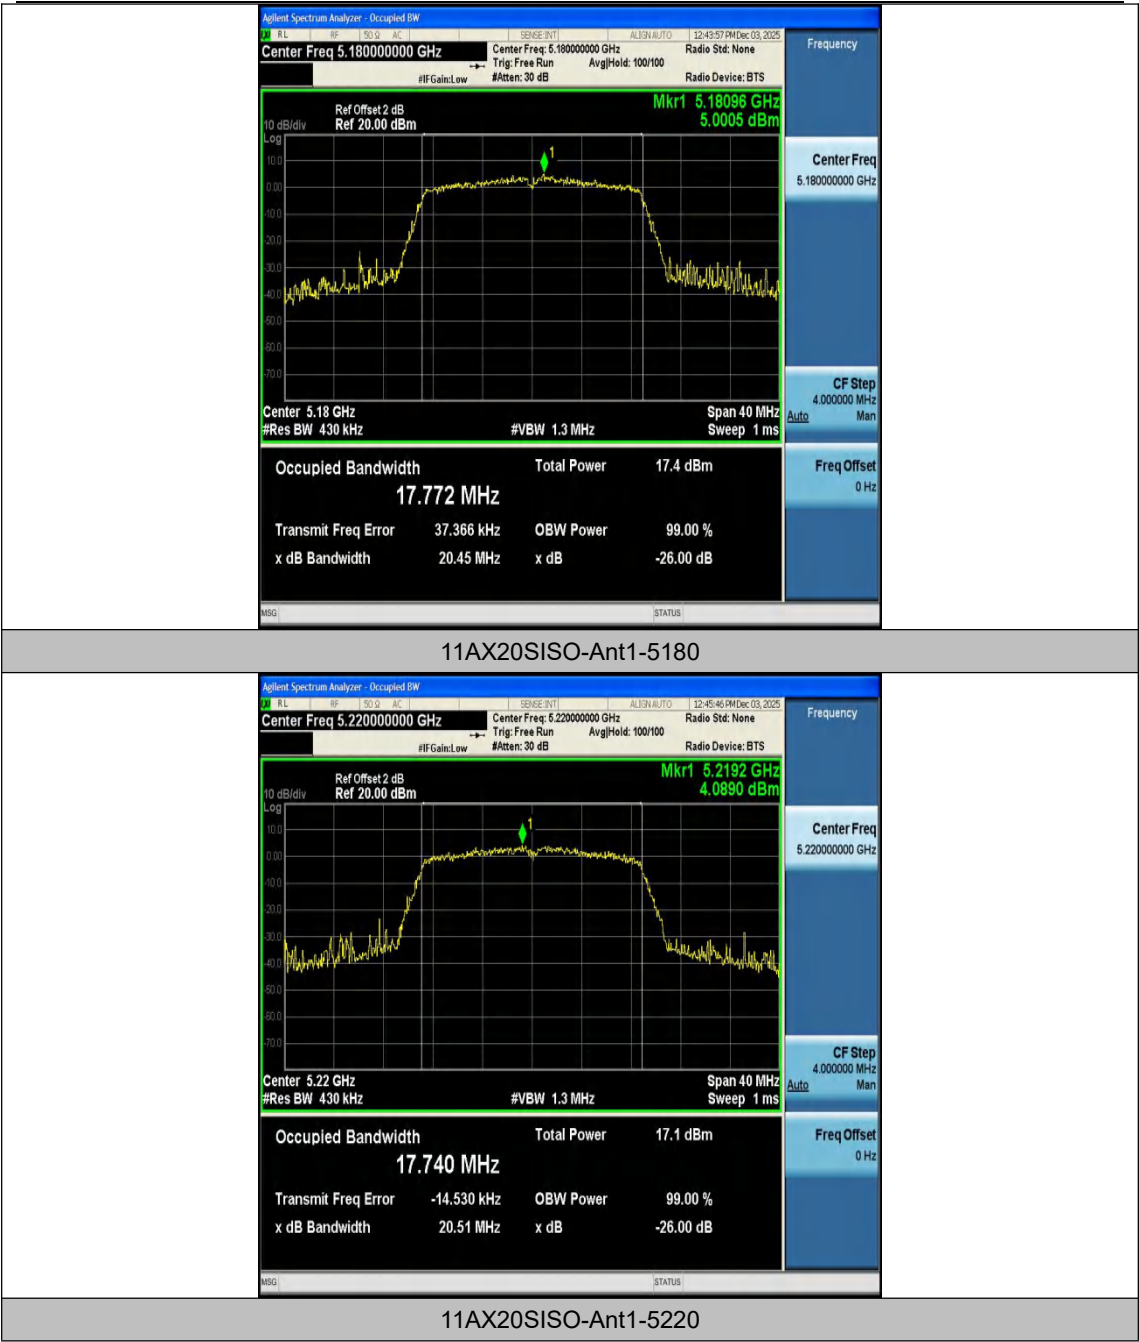





**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

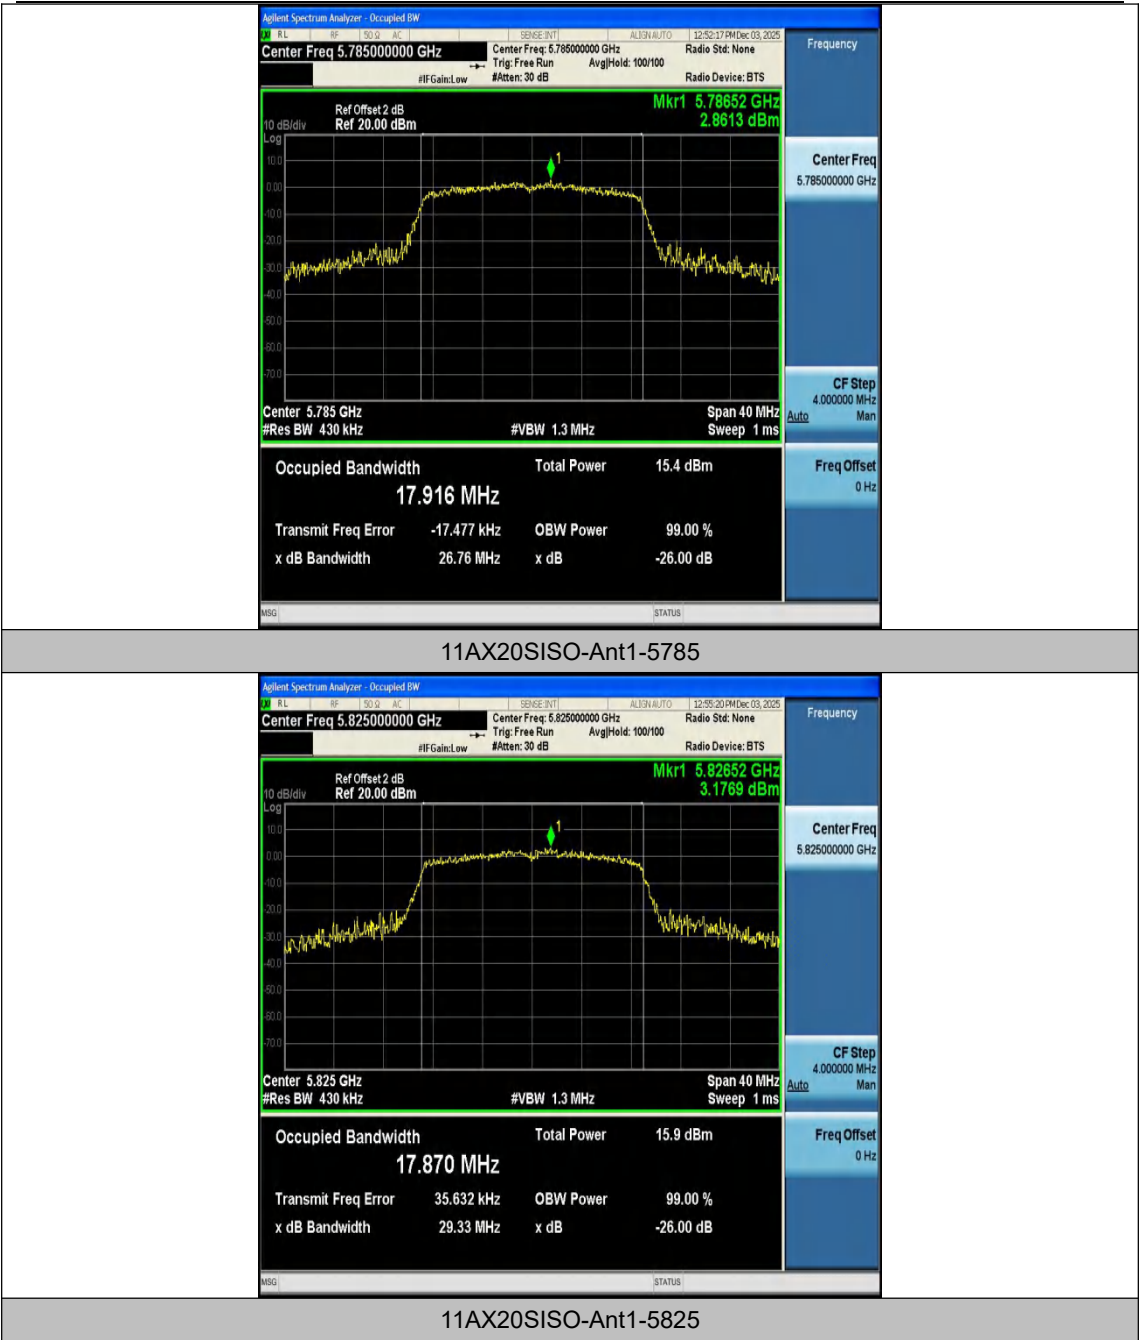

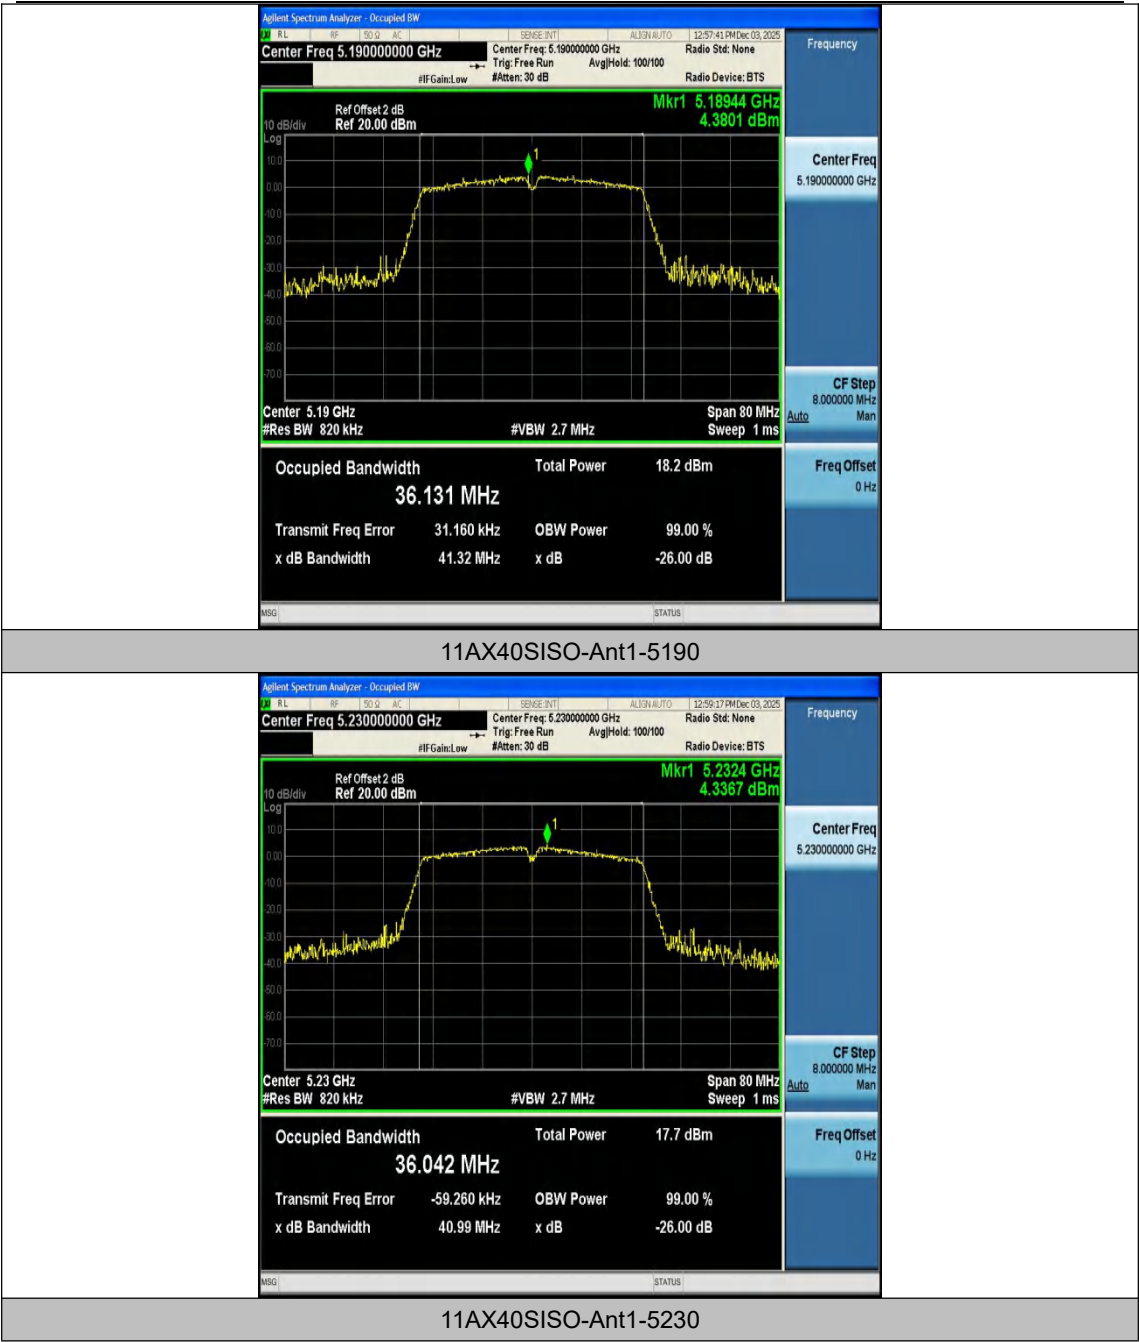

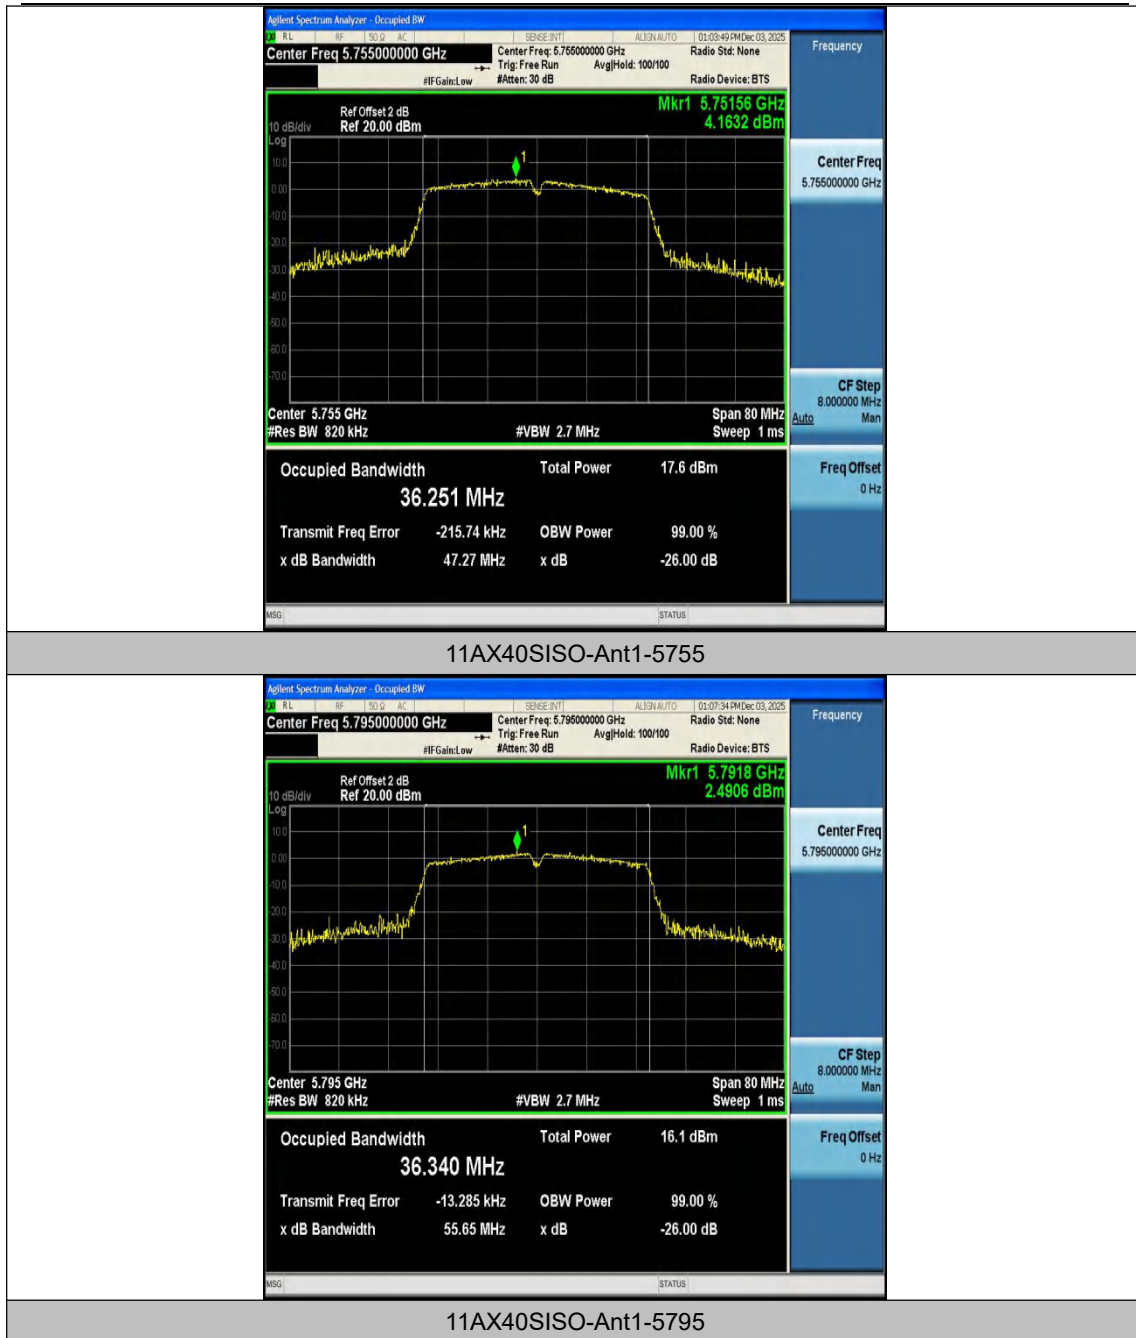

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix A3: Minimum 6dB Bandwidth


### Test Result B4


| Test Mode  | Antenna | Frequency[MHz] | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|---------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5745           | 16.280        | 5736.840 | 5753.120 | 0.5        | PASS    |
| 11A        | Ant1    | 5785           | 16.360        | 5776.800 | 5793.160 | 0.5        | PASS    |
| 11A        | Ant1    | 5825           | 16.360        | 5816.840 | 5833.200 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5745           | 17.560        | 5736.200 | 5753.760 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5785           | 17.600        | 5776.200 | 5793.800 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5825           | 17.560        | 5816.240 | 5833.800 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5755           | 35.440        | 5736.840 | 5772.280 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5795           | 36.320        | 5776.840 | 5813.160 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5745           | 17.600        | 5736.200 | 5753.800 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5785           | 17.600        | 5776.200 | 5793.800 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5825           | 17.560        | 5816.240 | 5833.800 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5755           | 36.000        | 5736.840 | 5772.840 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5795           | 36.320        | 5776.840 | 5813.160 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5745           | 17.560        | 5736.200 | 5753.760 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5785           | 17.600        | 5776.200 | 5793.800 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5825           | 17.560        | 5816.240 | 5833.800 | 0.5        | PASS    |
| 11AX40SISO | Ant1    | 5755           | 35.920        | 5736.840 | 5772.760 | 0.5        | PASS    |
| 11AX40SISO | Ant1    | 5795           | 36.320        | 5776.840 | 5813.160 | 0.5        | PASS    |


## Test Graphs B4

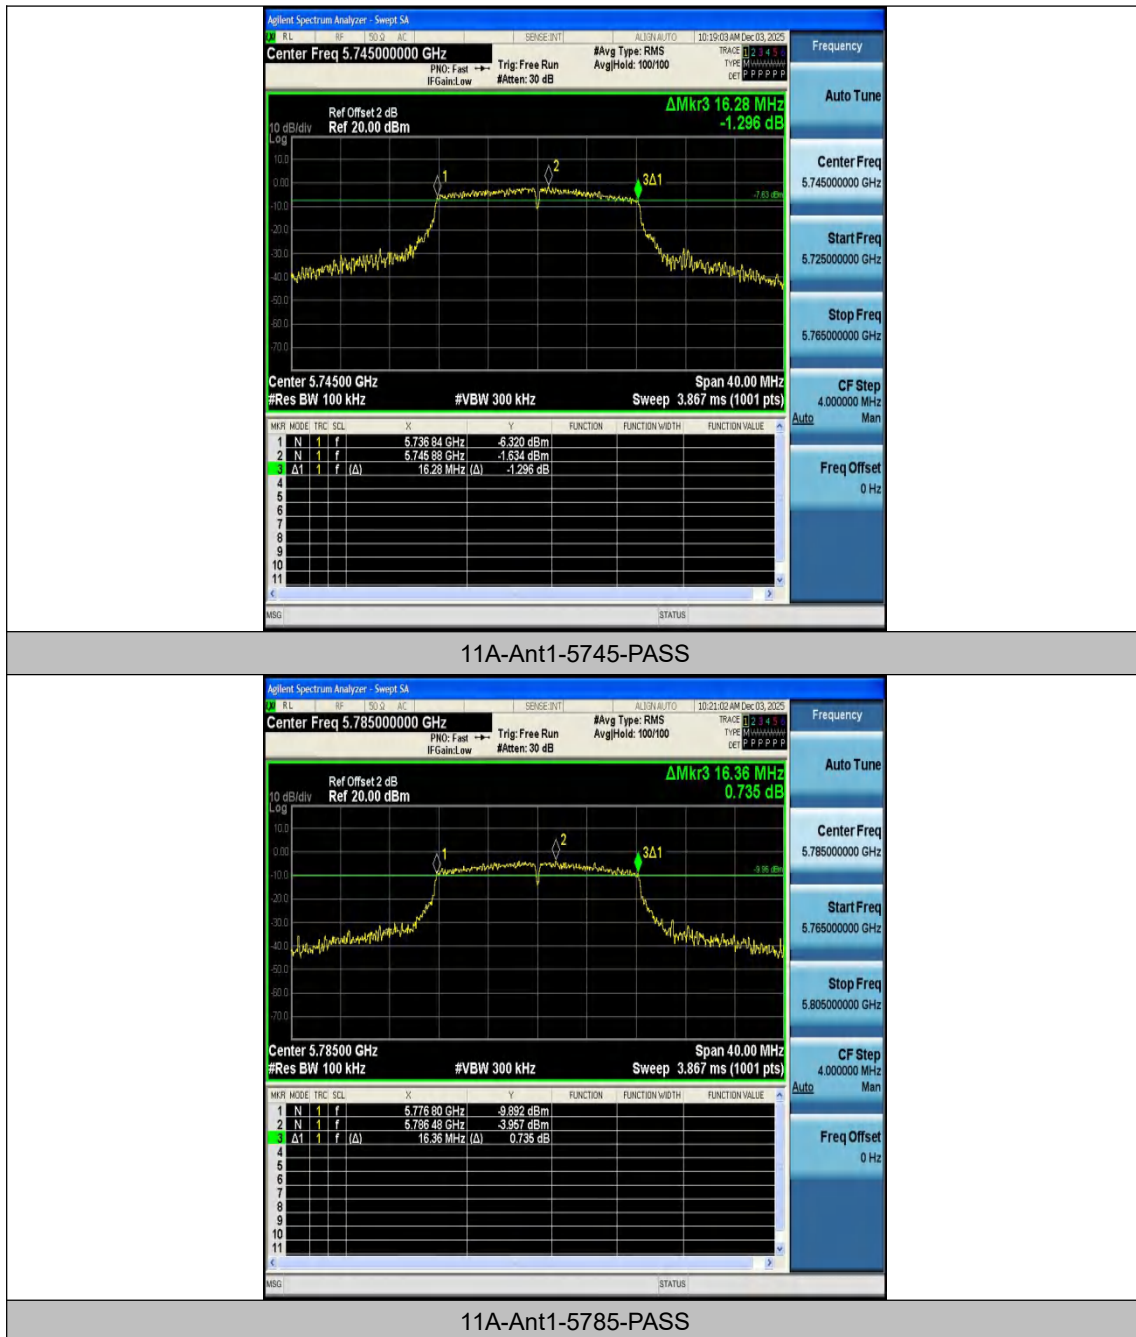


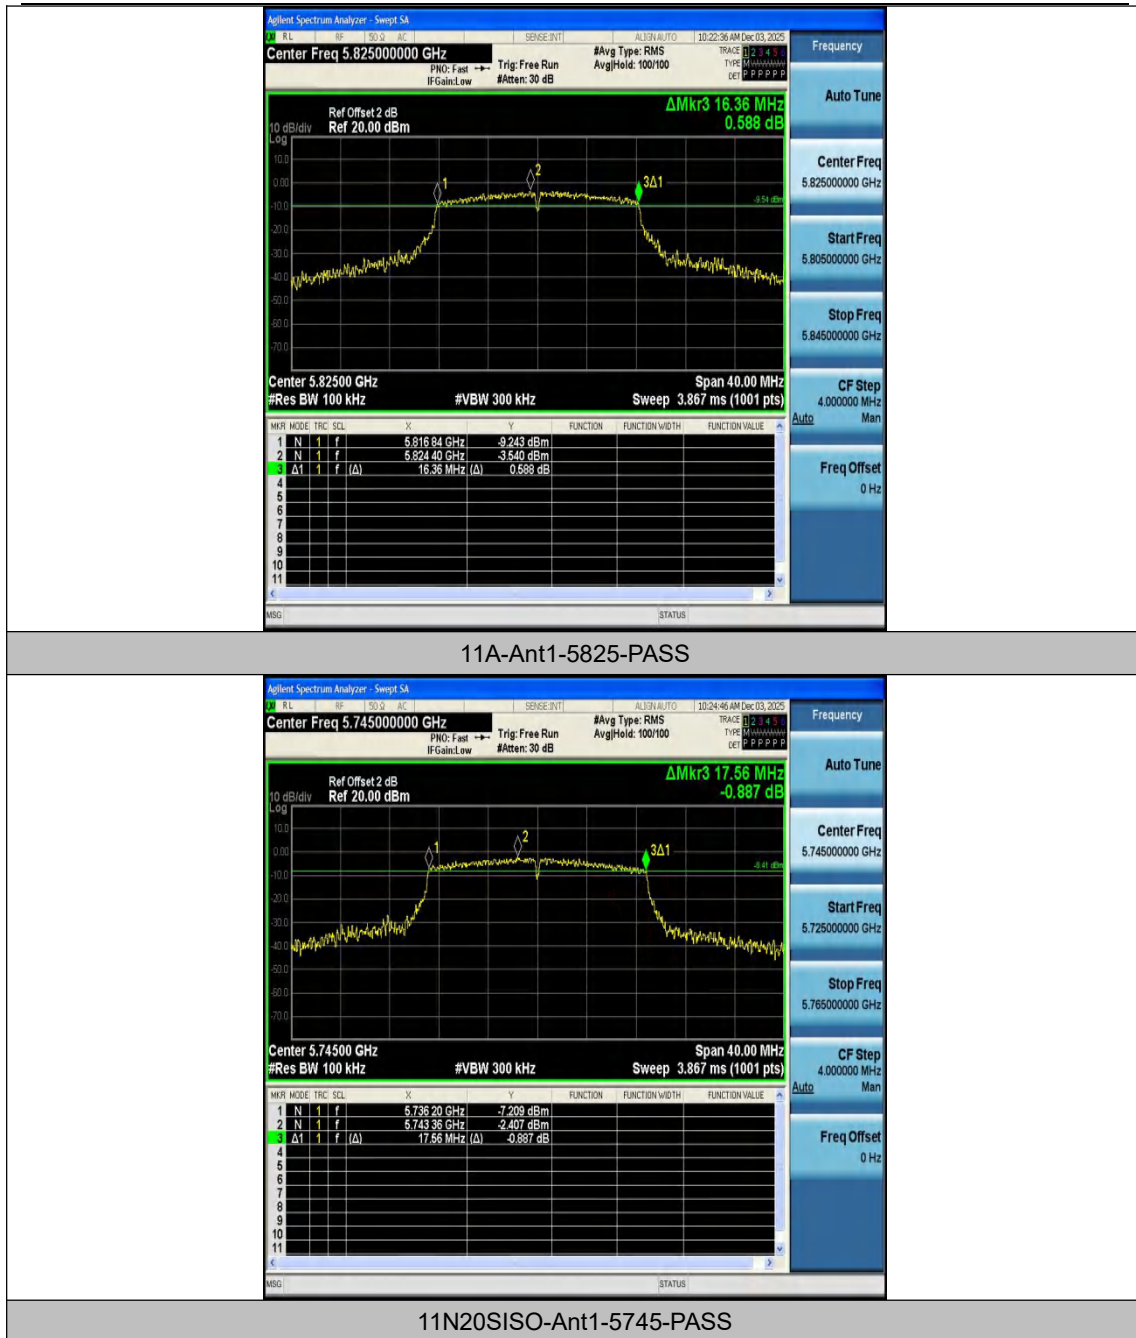

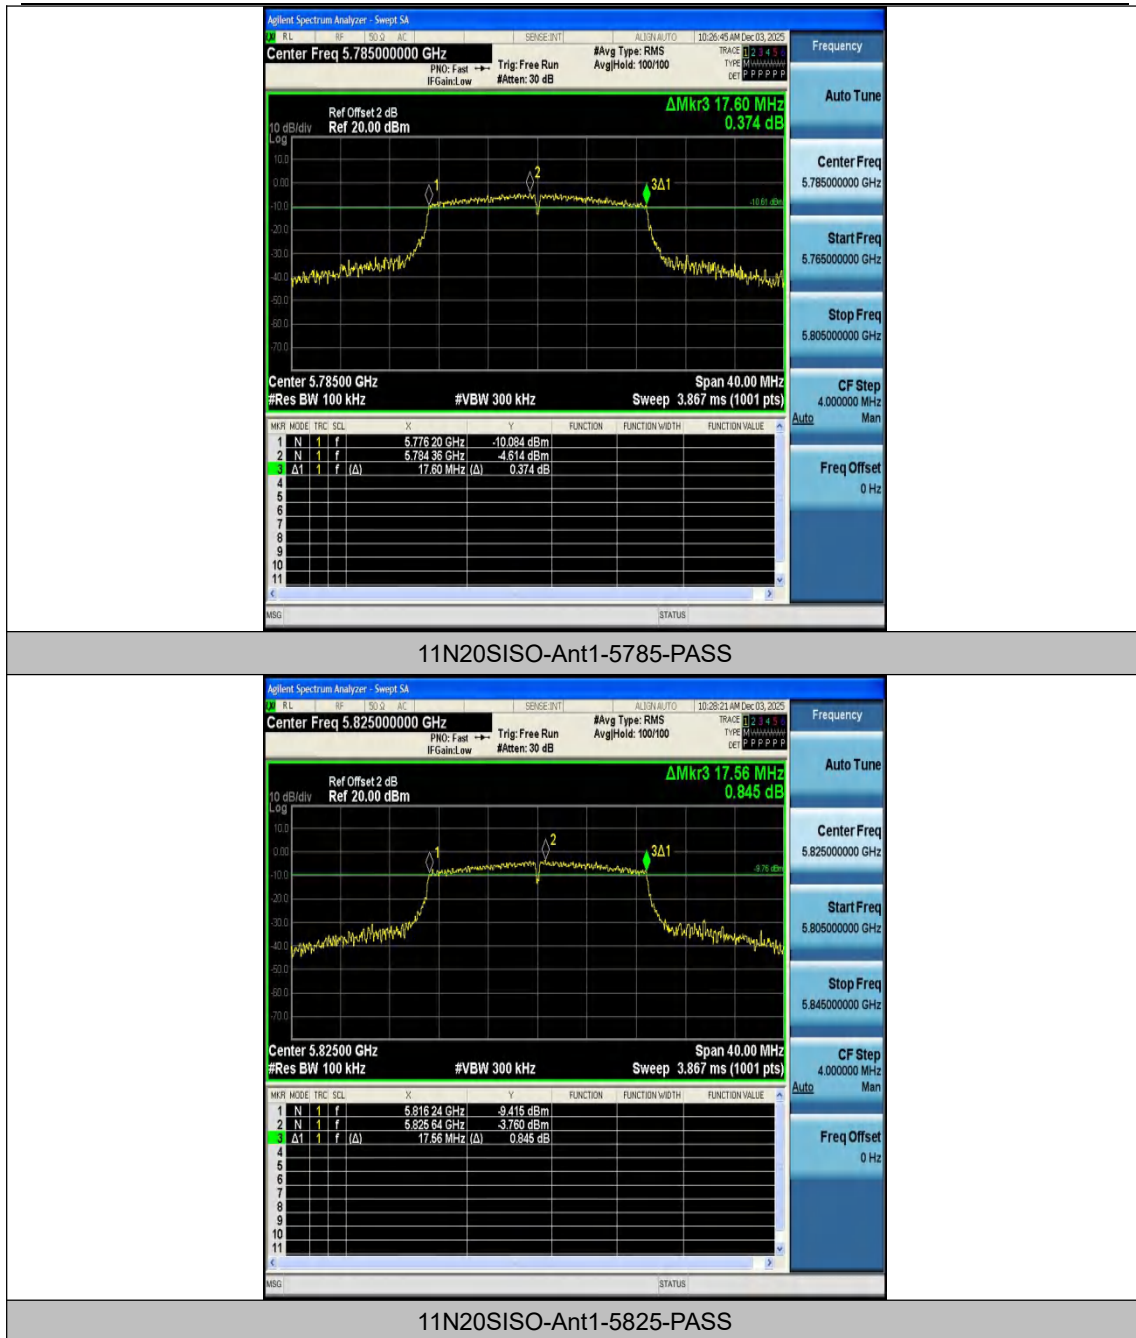

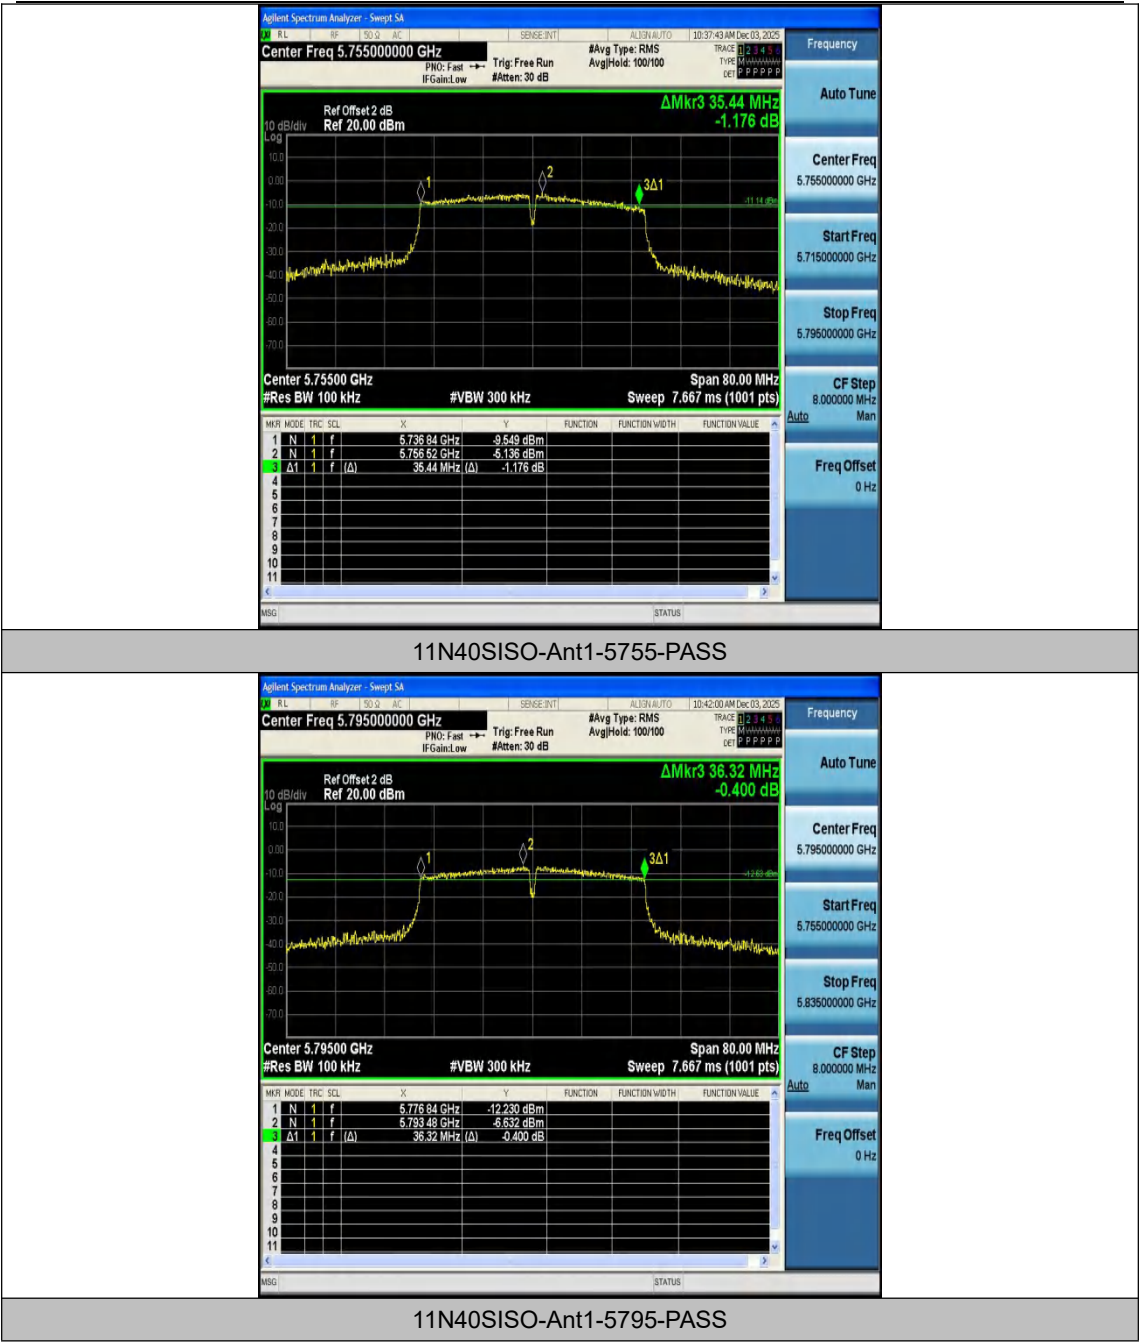

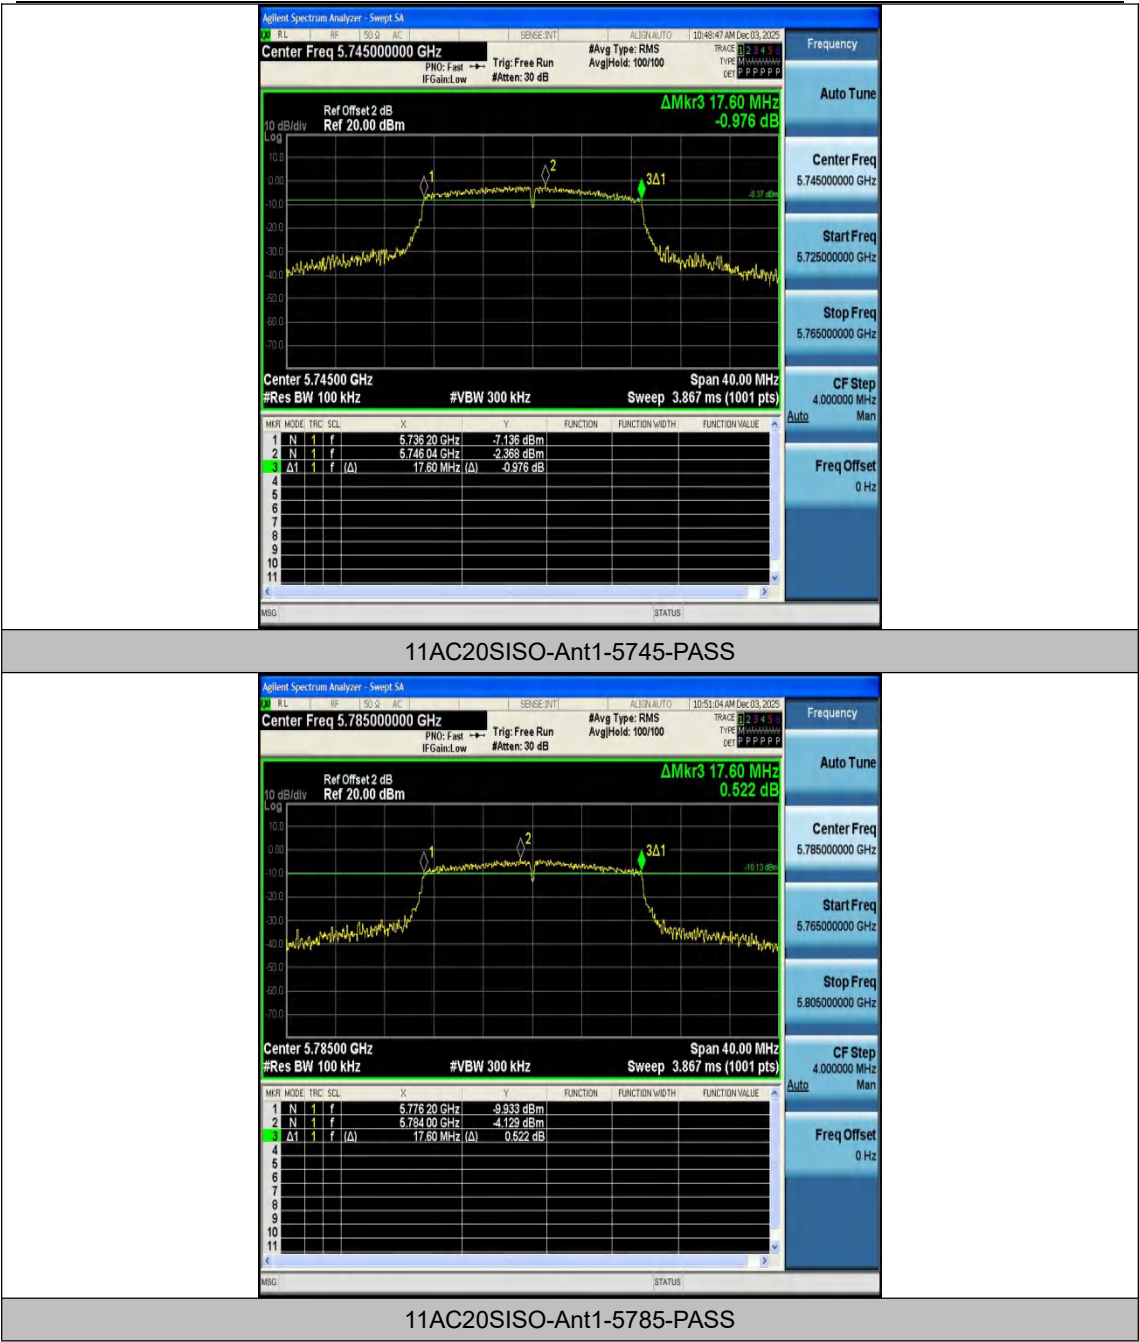


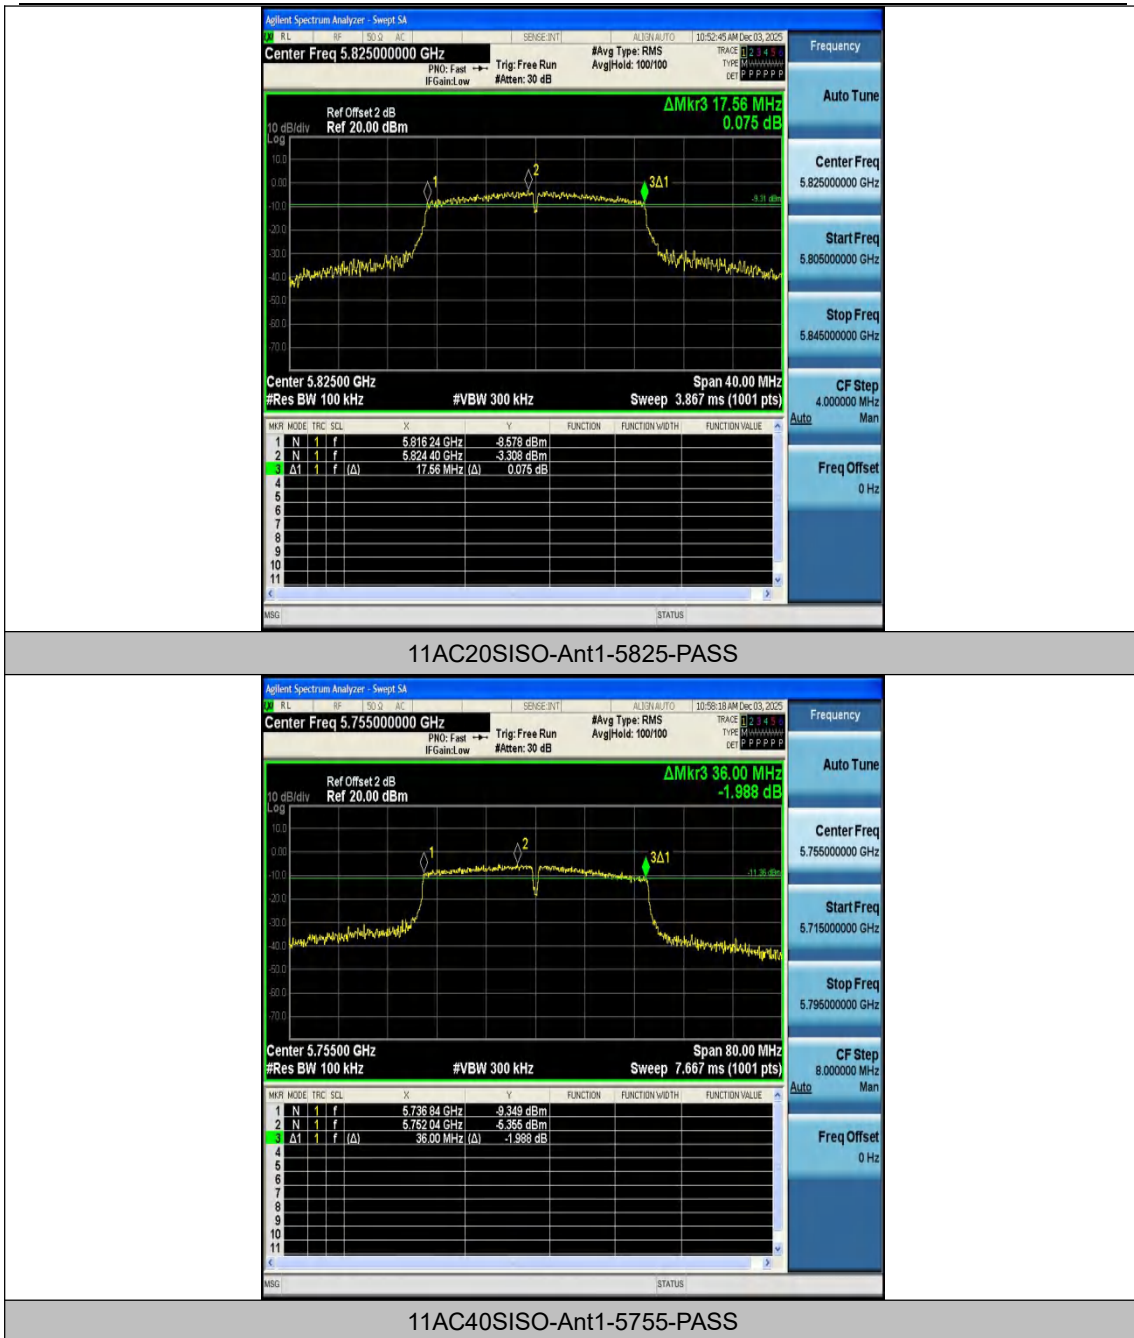



### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

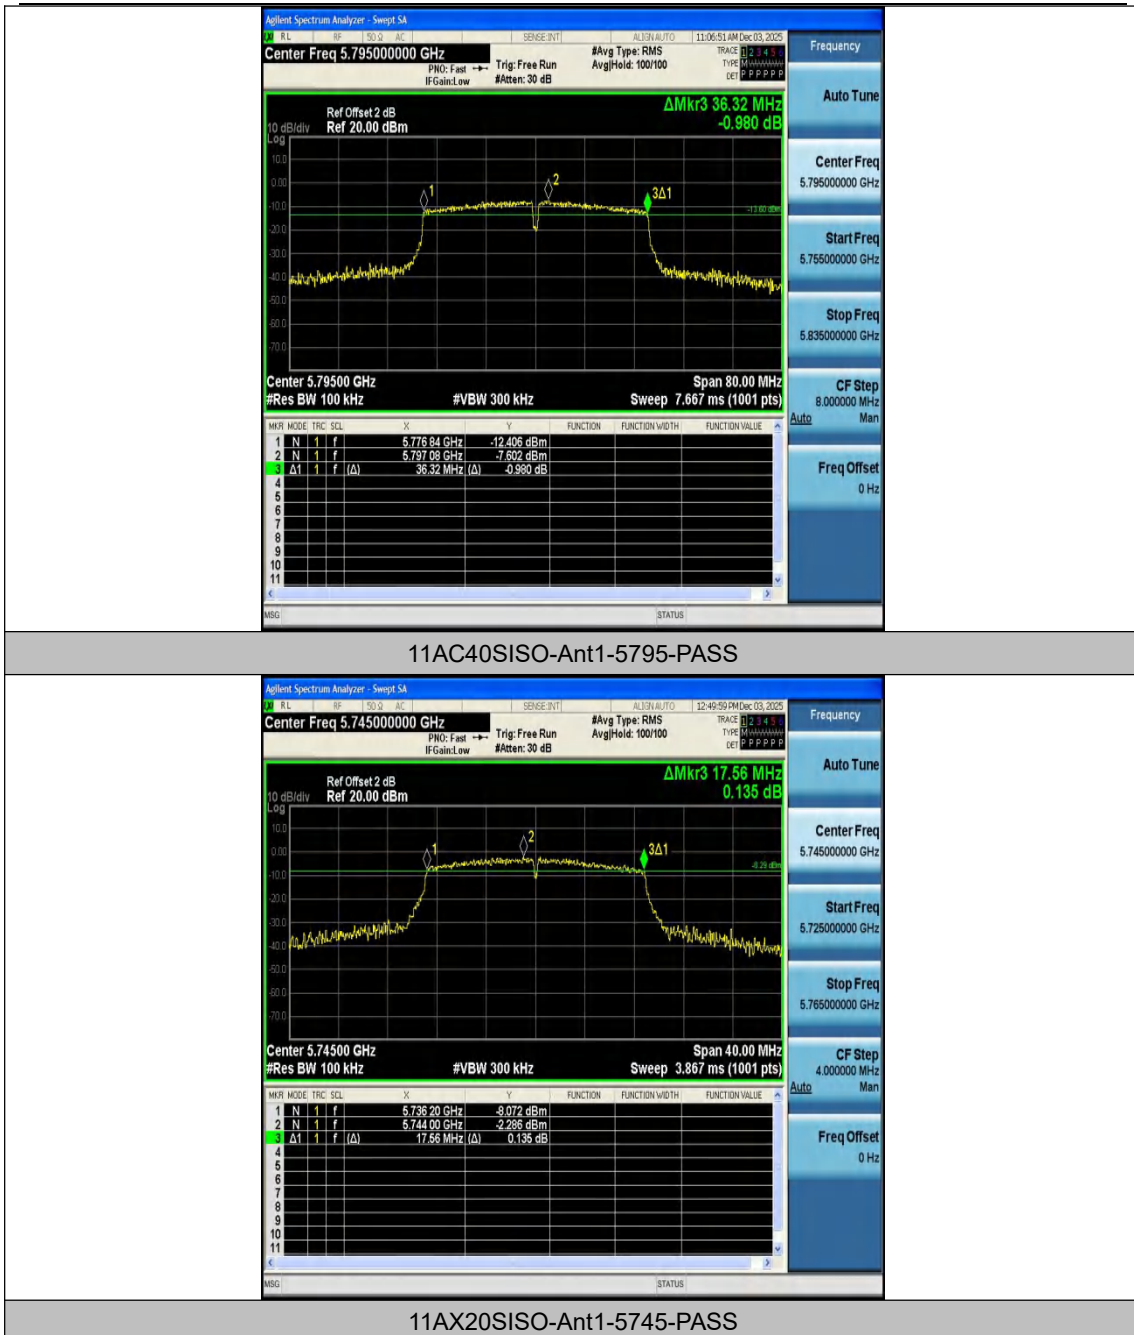

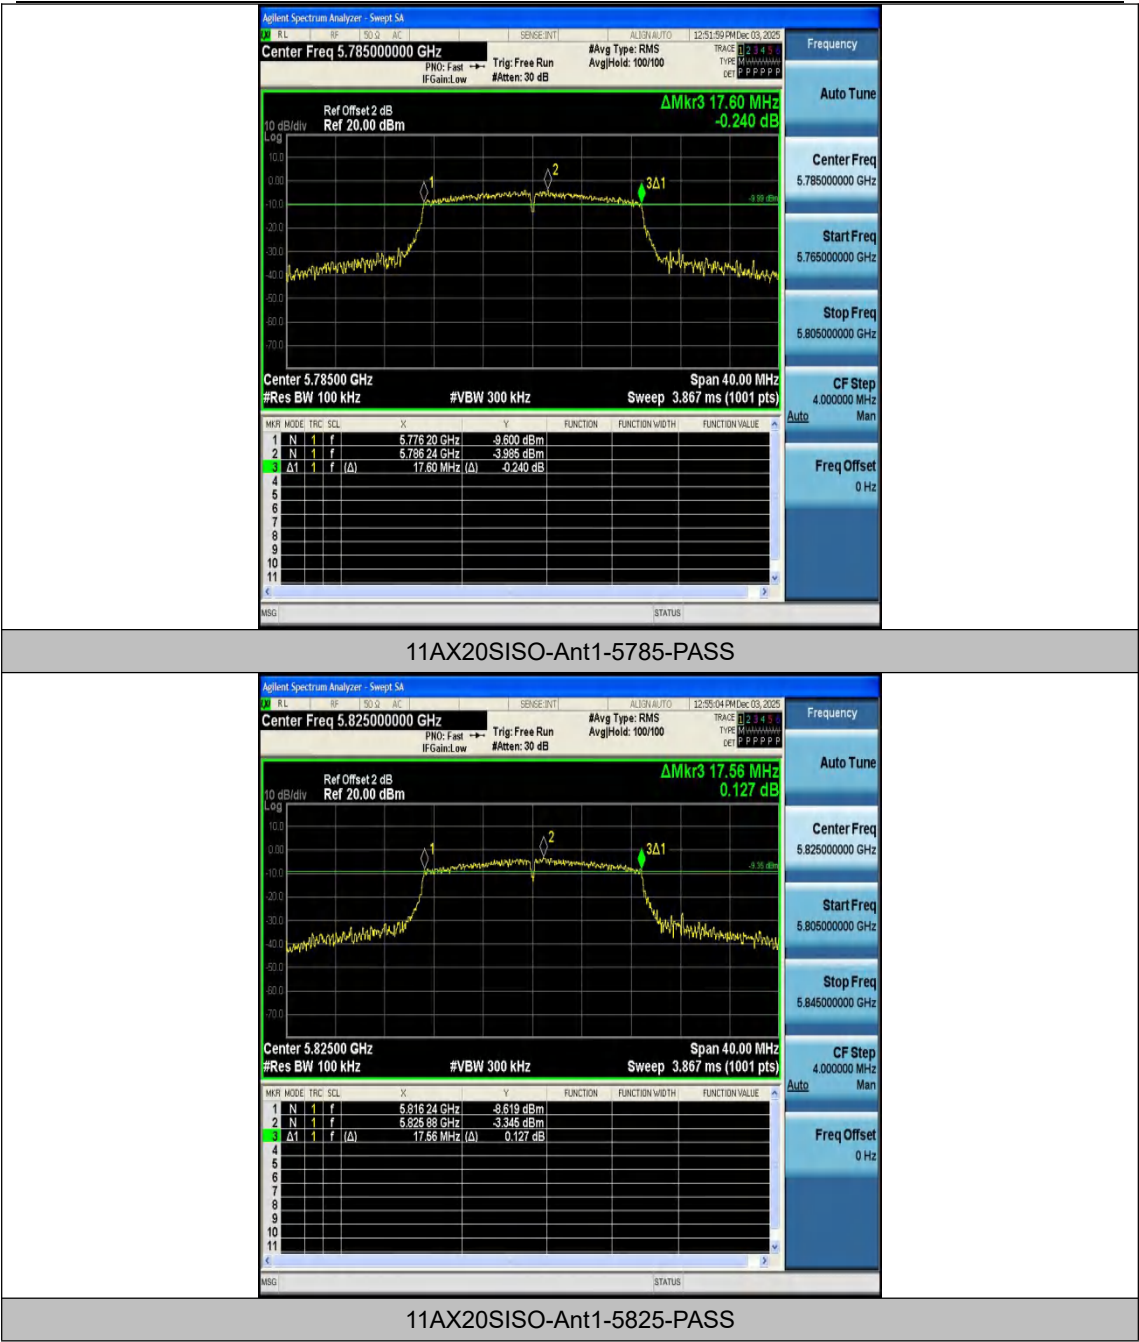

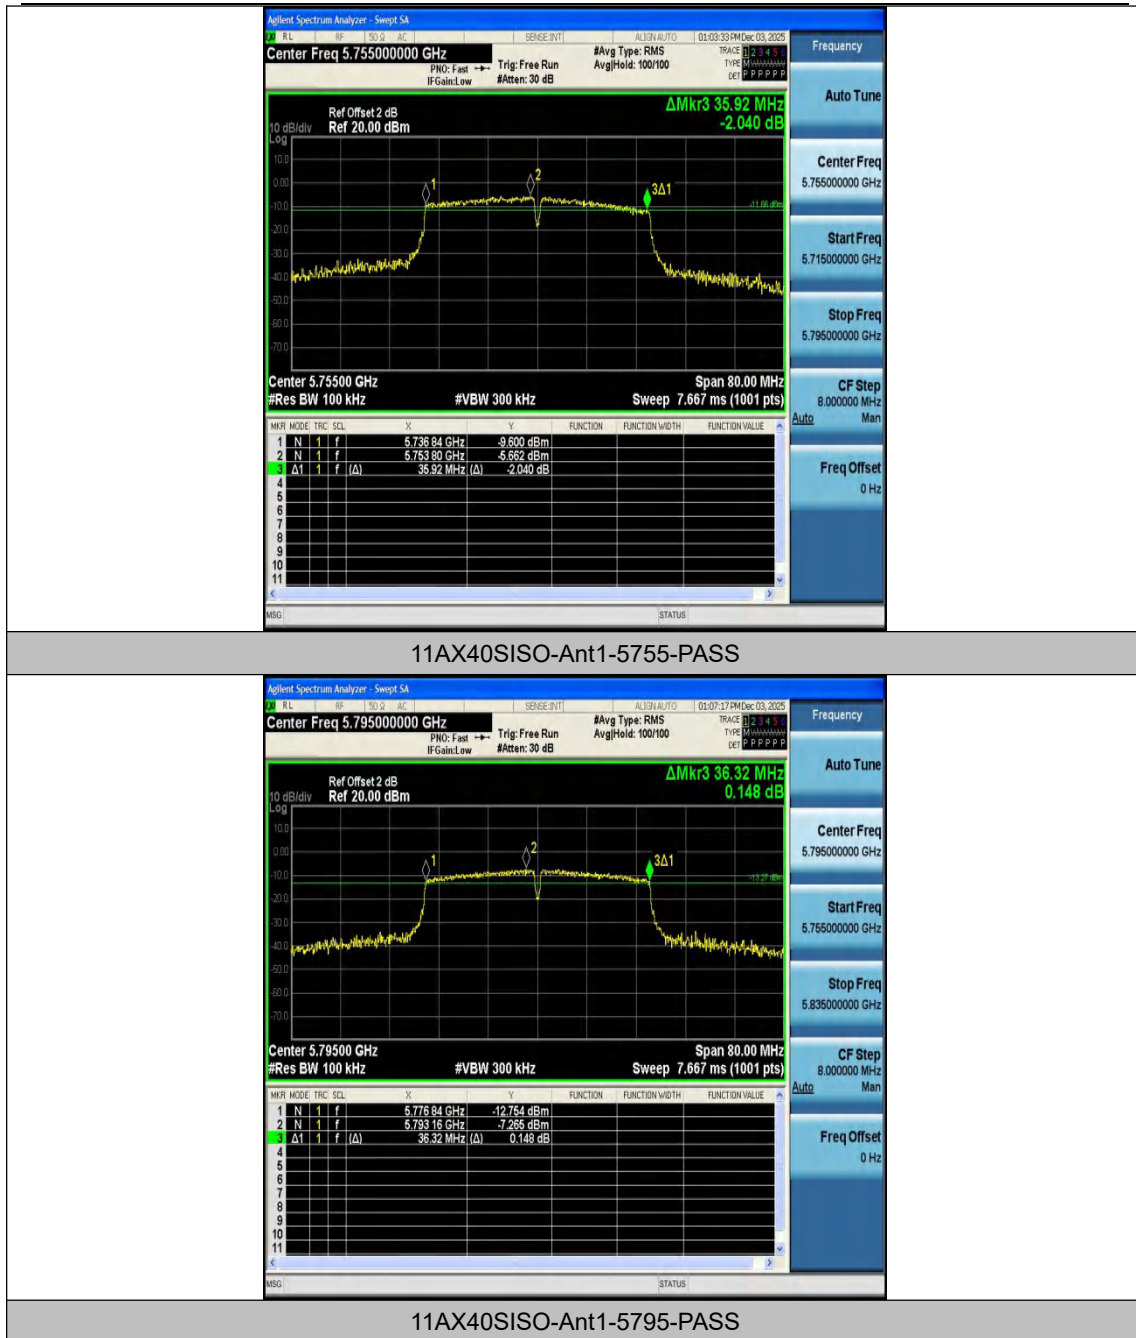

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix B: Duty Cycle

### Test Result


| Test Mode  | Antenna | Frequency [MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Dc Factor [dB] | 1/T  |
|------------|---------|-----------------|----------------------------|--------------------------|----------------|----------------|------|
| 11A        | Ant1    | 5180            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5220            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5240            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5745            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5785            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5825            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5180            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5220            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5240            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5745            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5785            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5825            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5190            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5230            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5755            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5795            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5180            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5220            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5240            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5745            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5785            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5825            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5190            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5230            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5755            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5795            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5180            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5220            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5240            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5745            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5785            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX20SISO | Ant1    | 5825            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX40SISO | Ant1    | 5190            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX40SISO | Ant1    | 5230            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX40SISO | Ant1    | 5755            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AX40SISO | Ant1    | 5795            | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

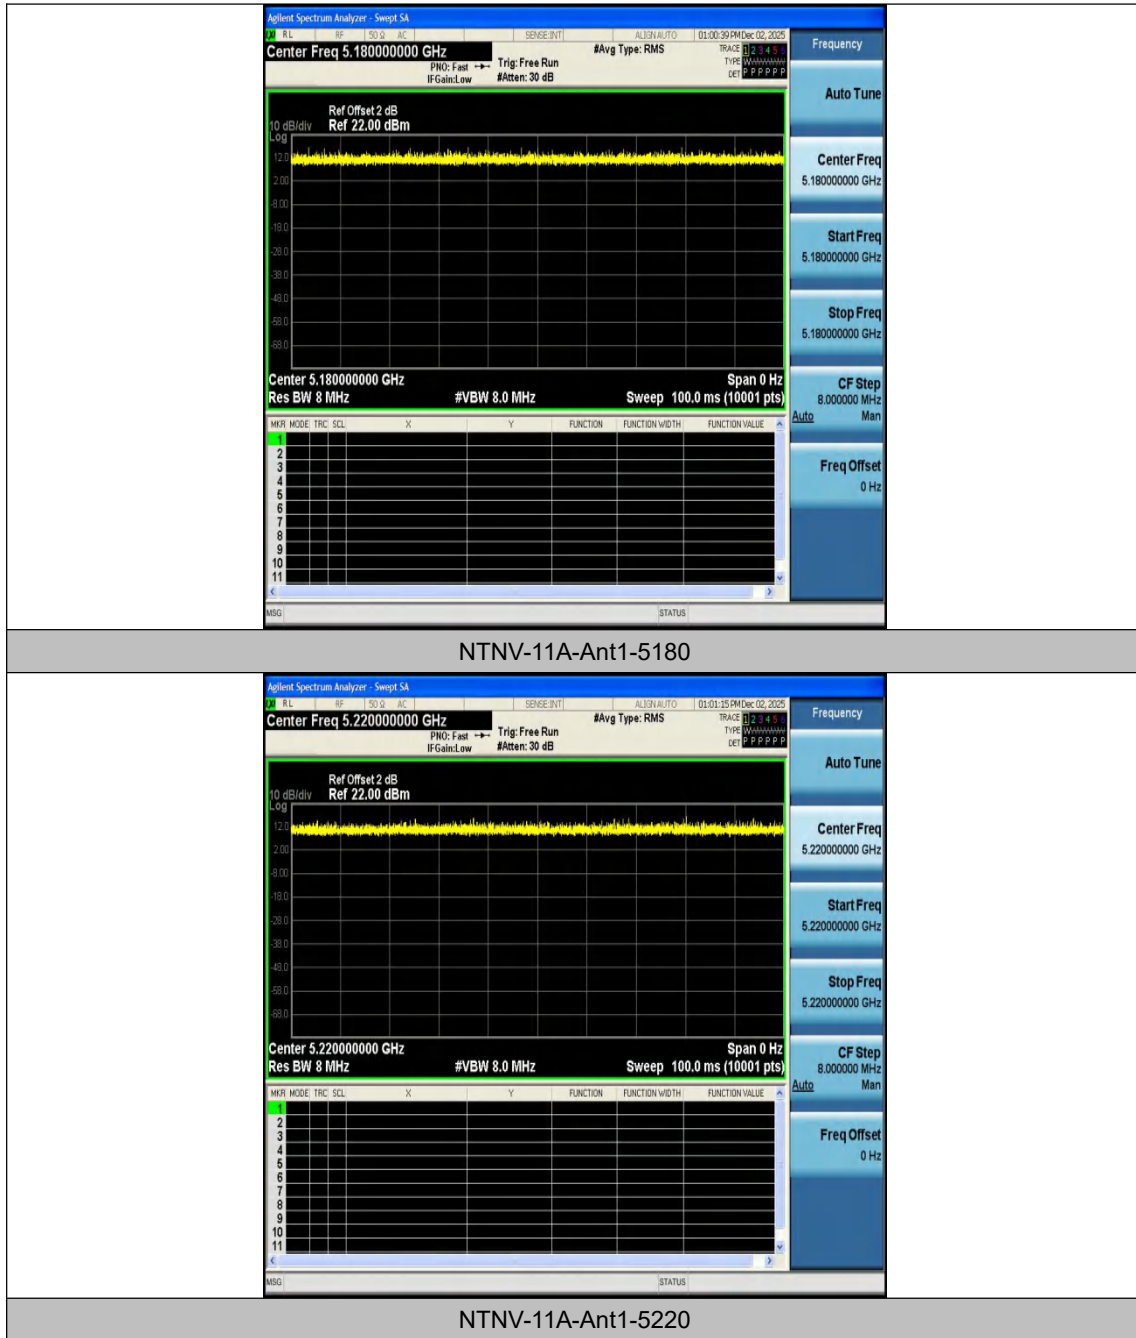

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

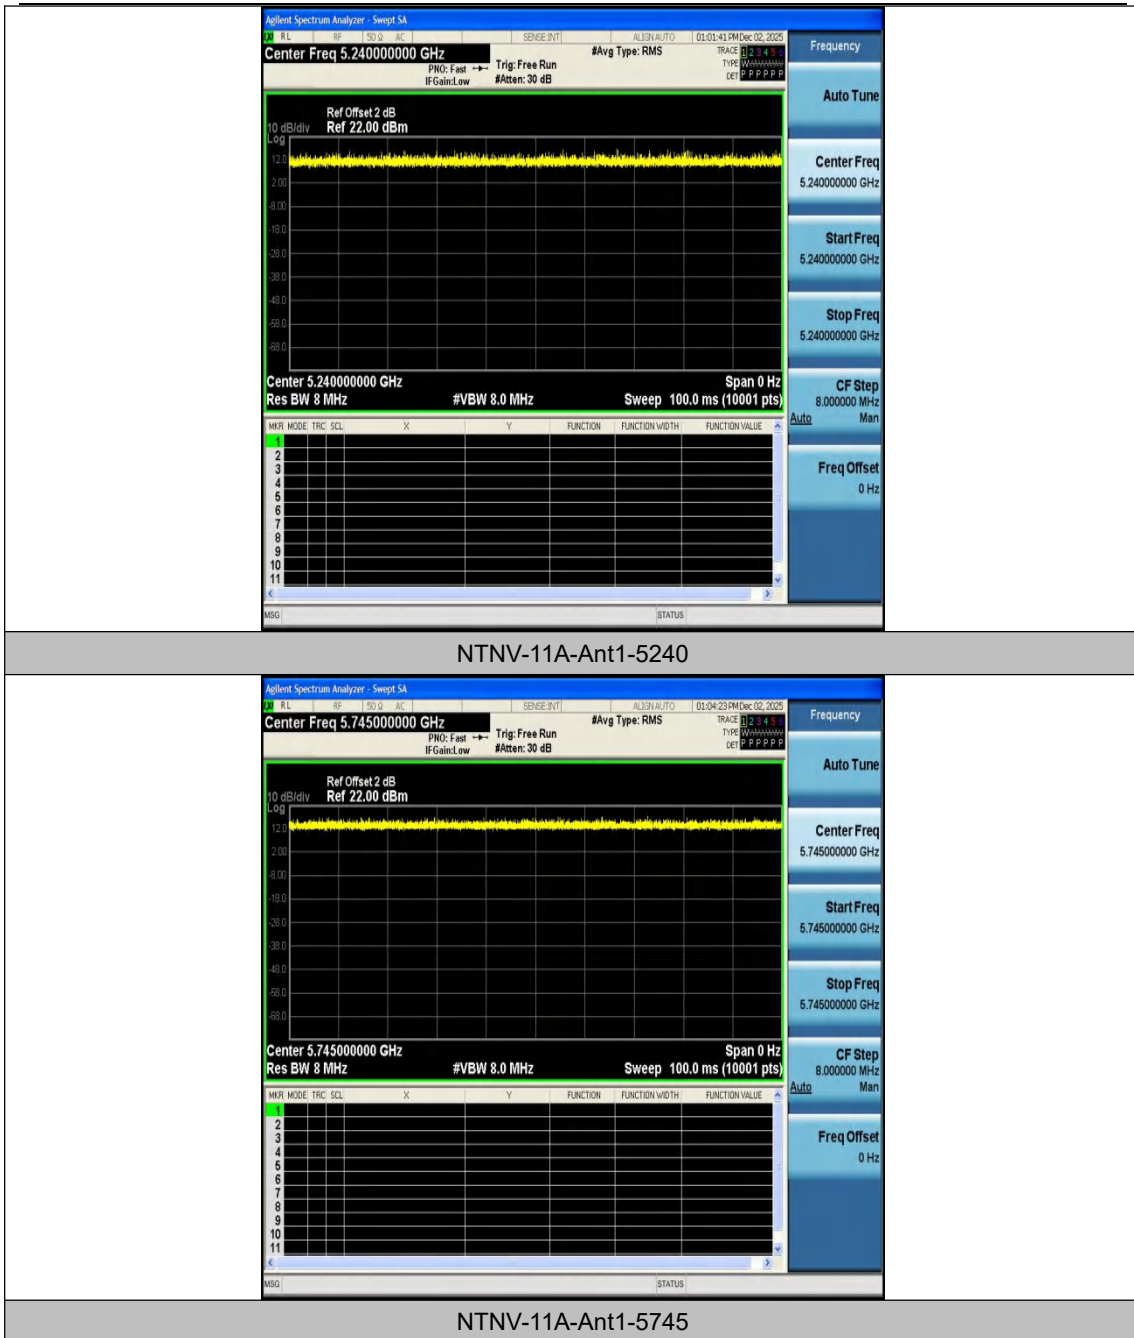

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

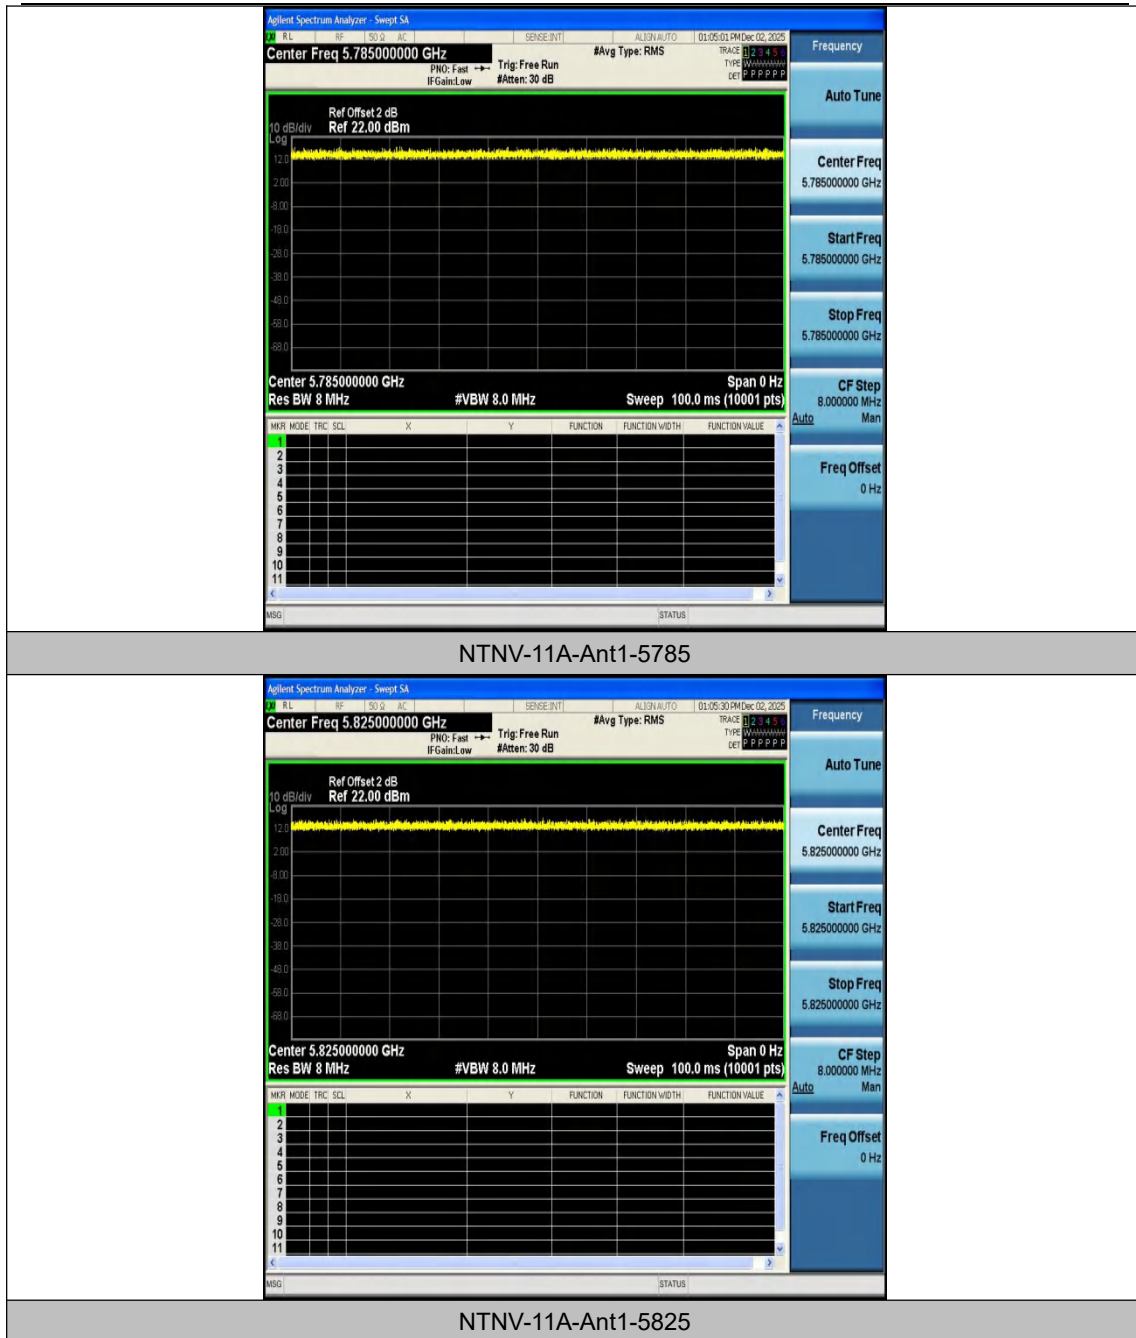

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

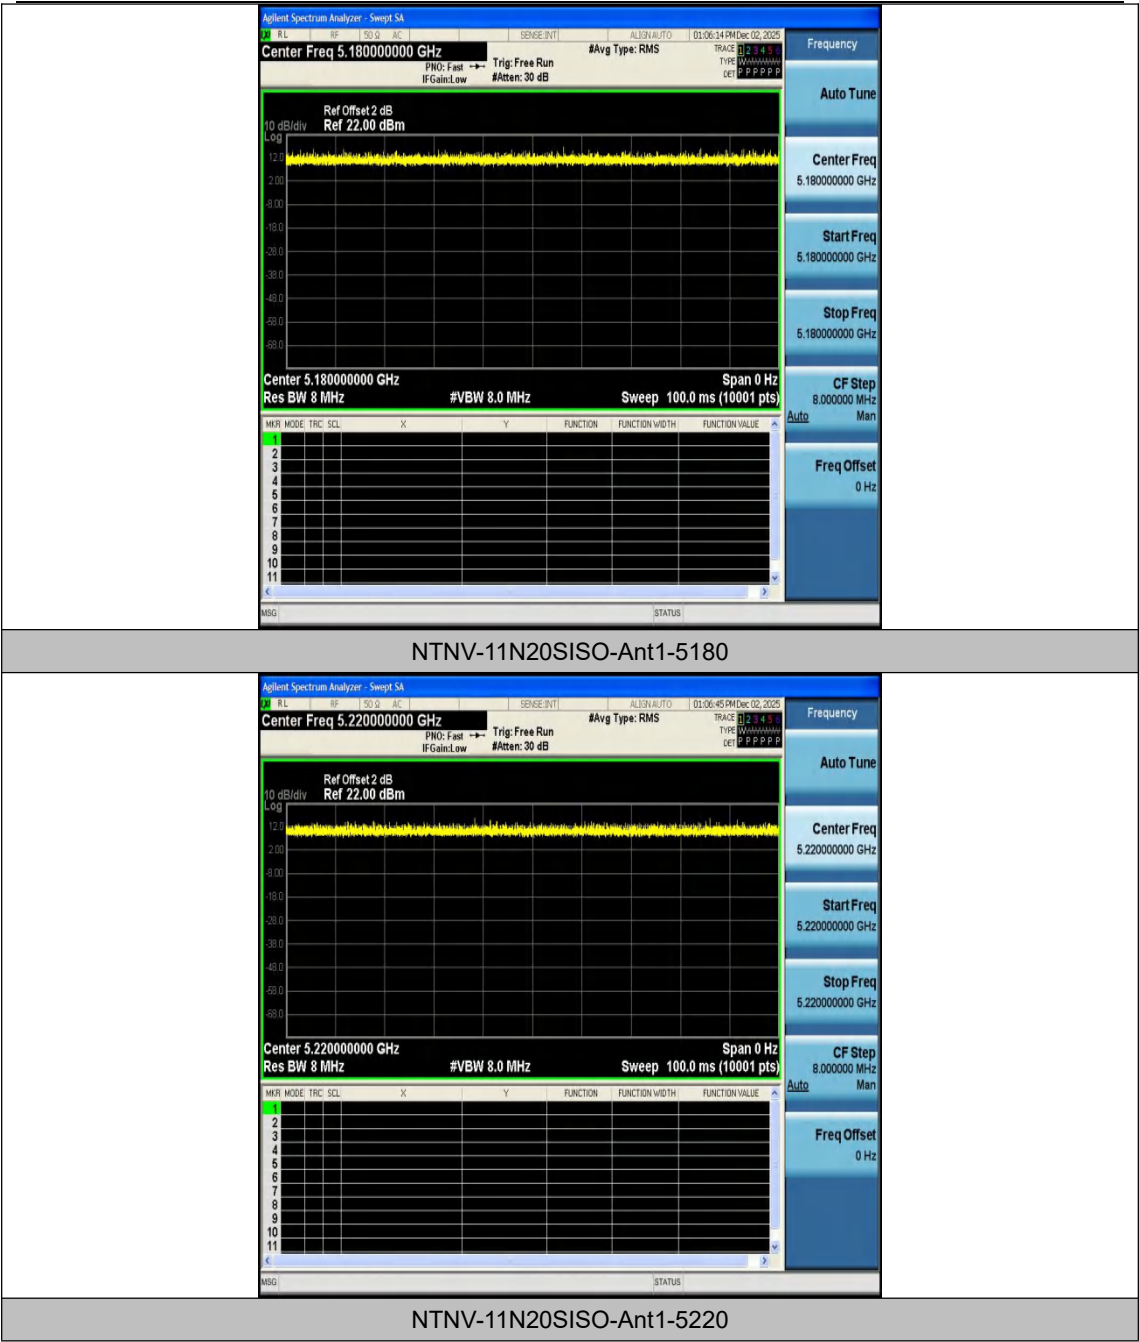



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

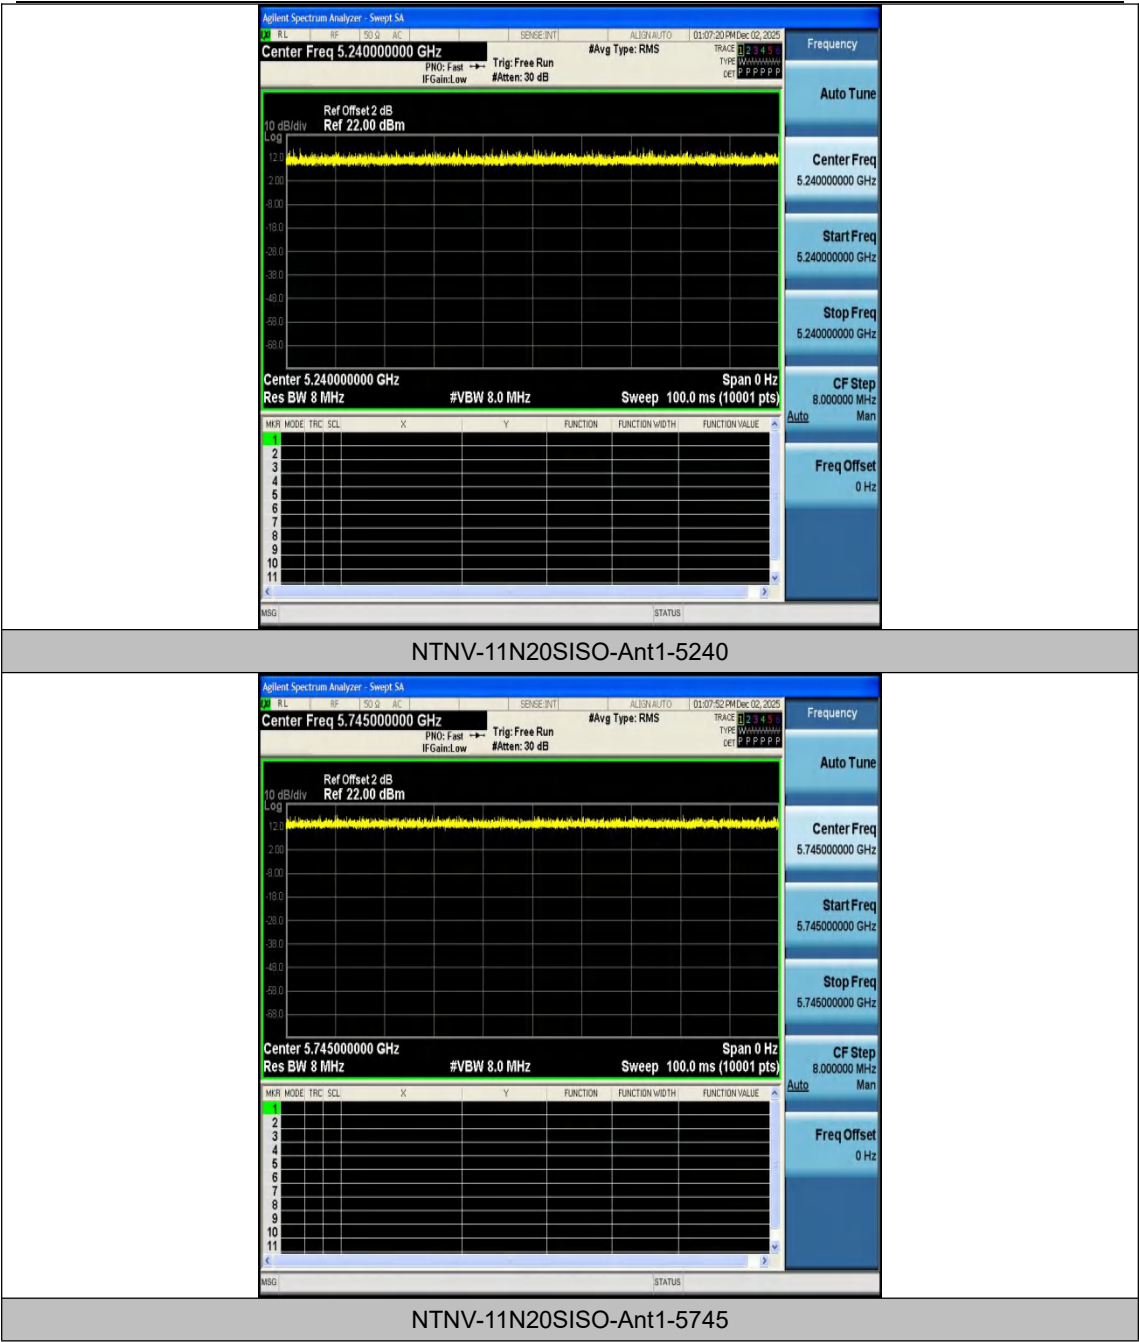

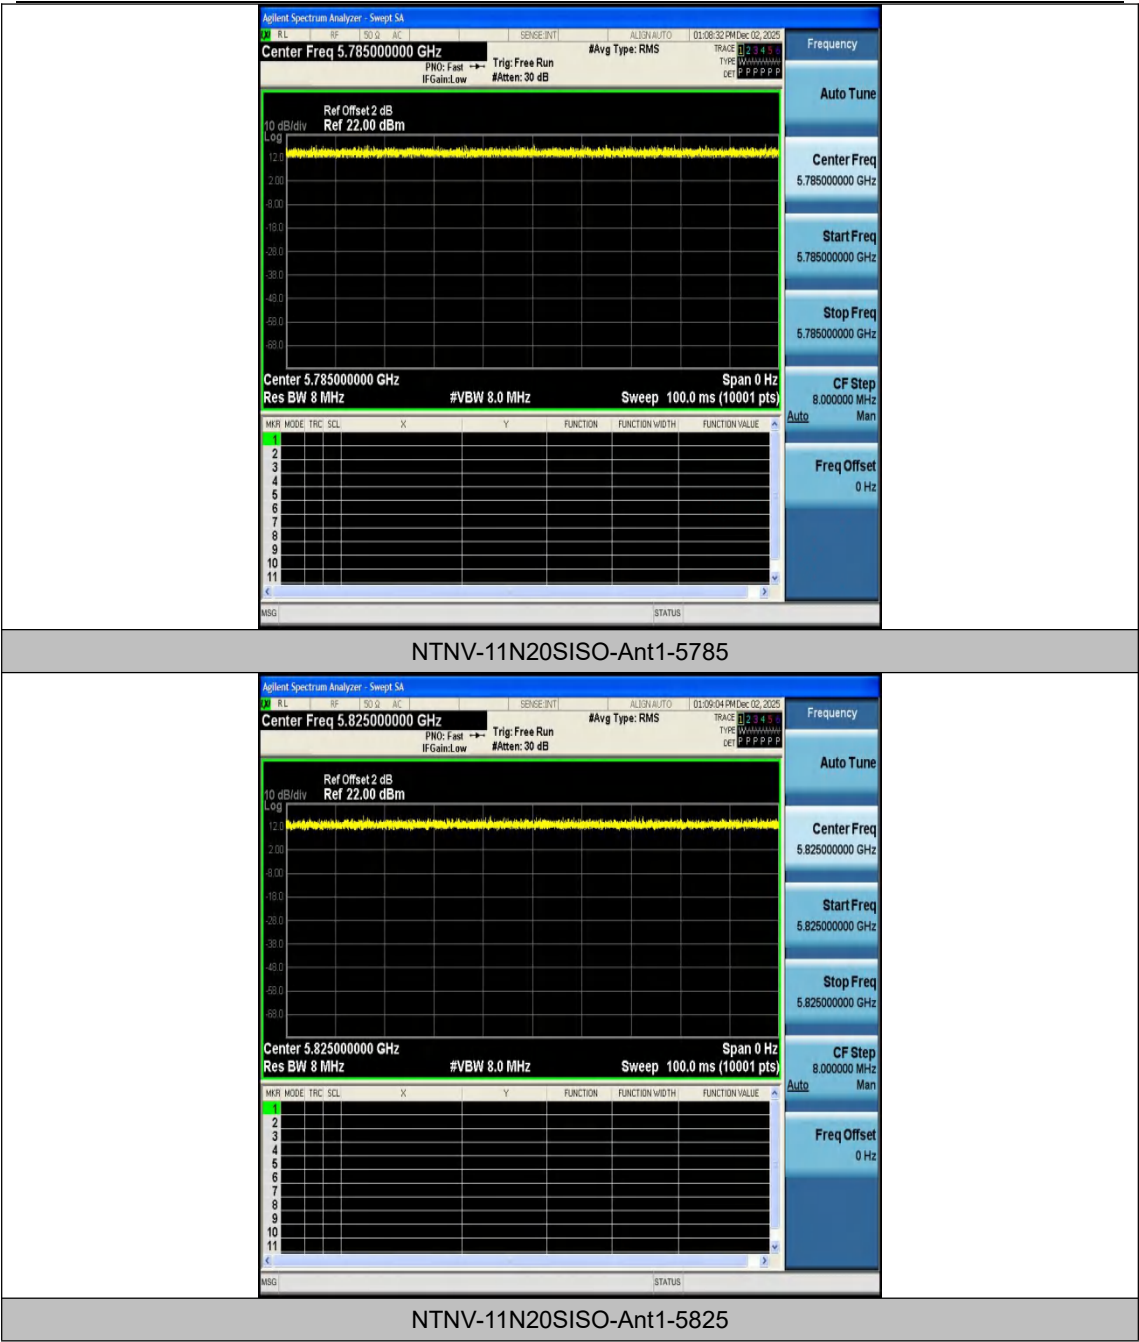

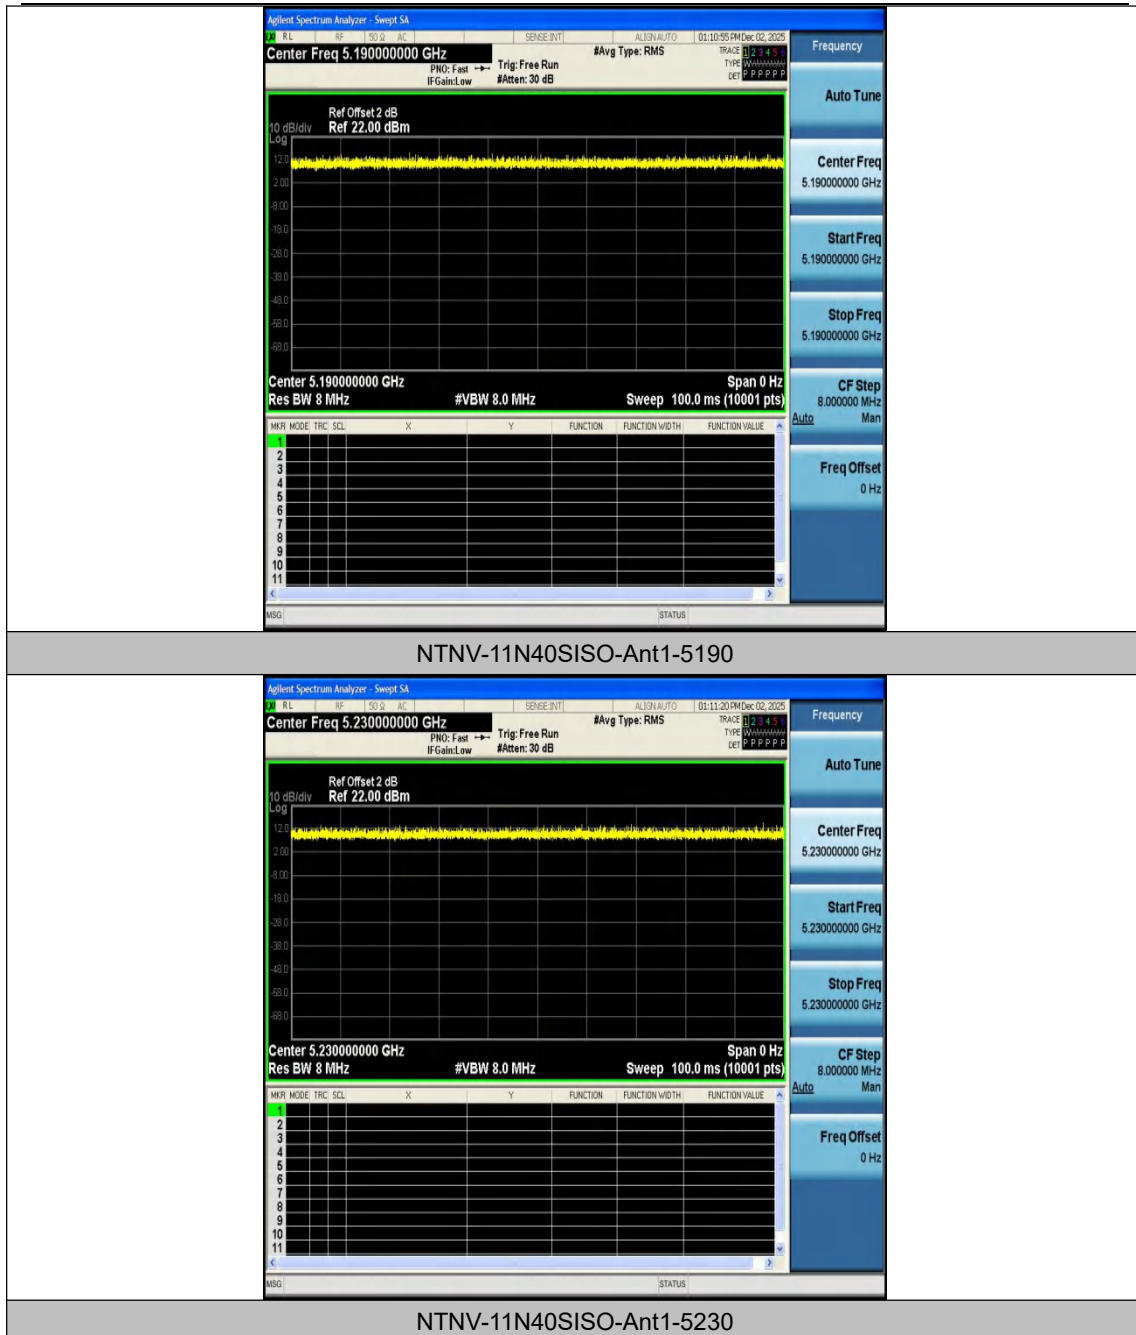


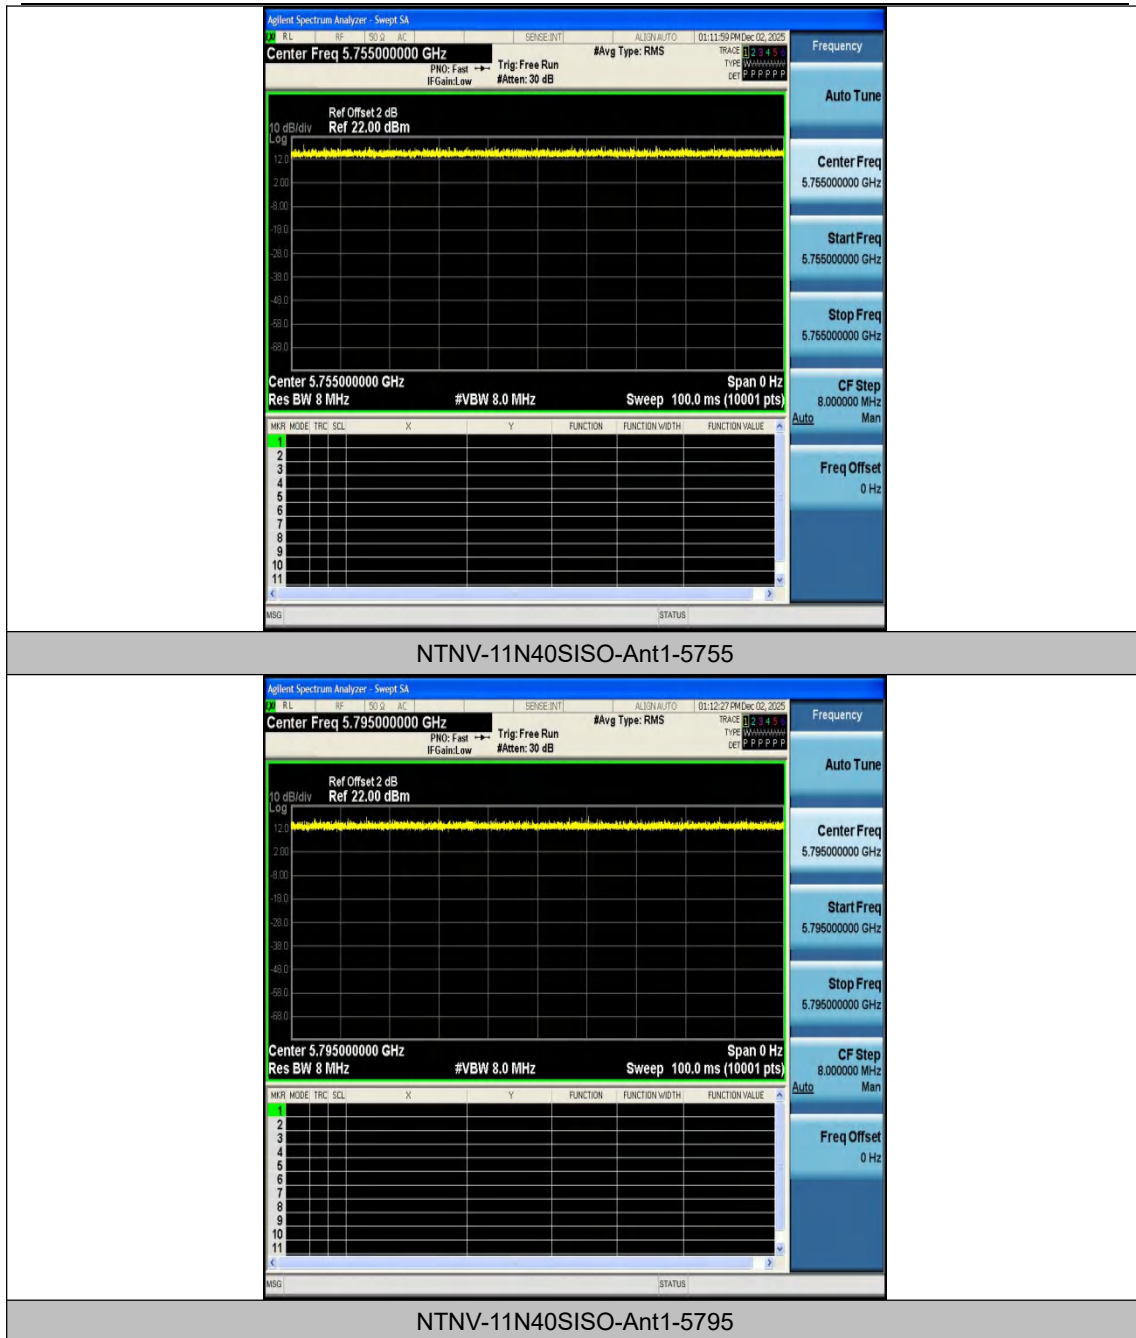

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

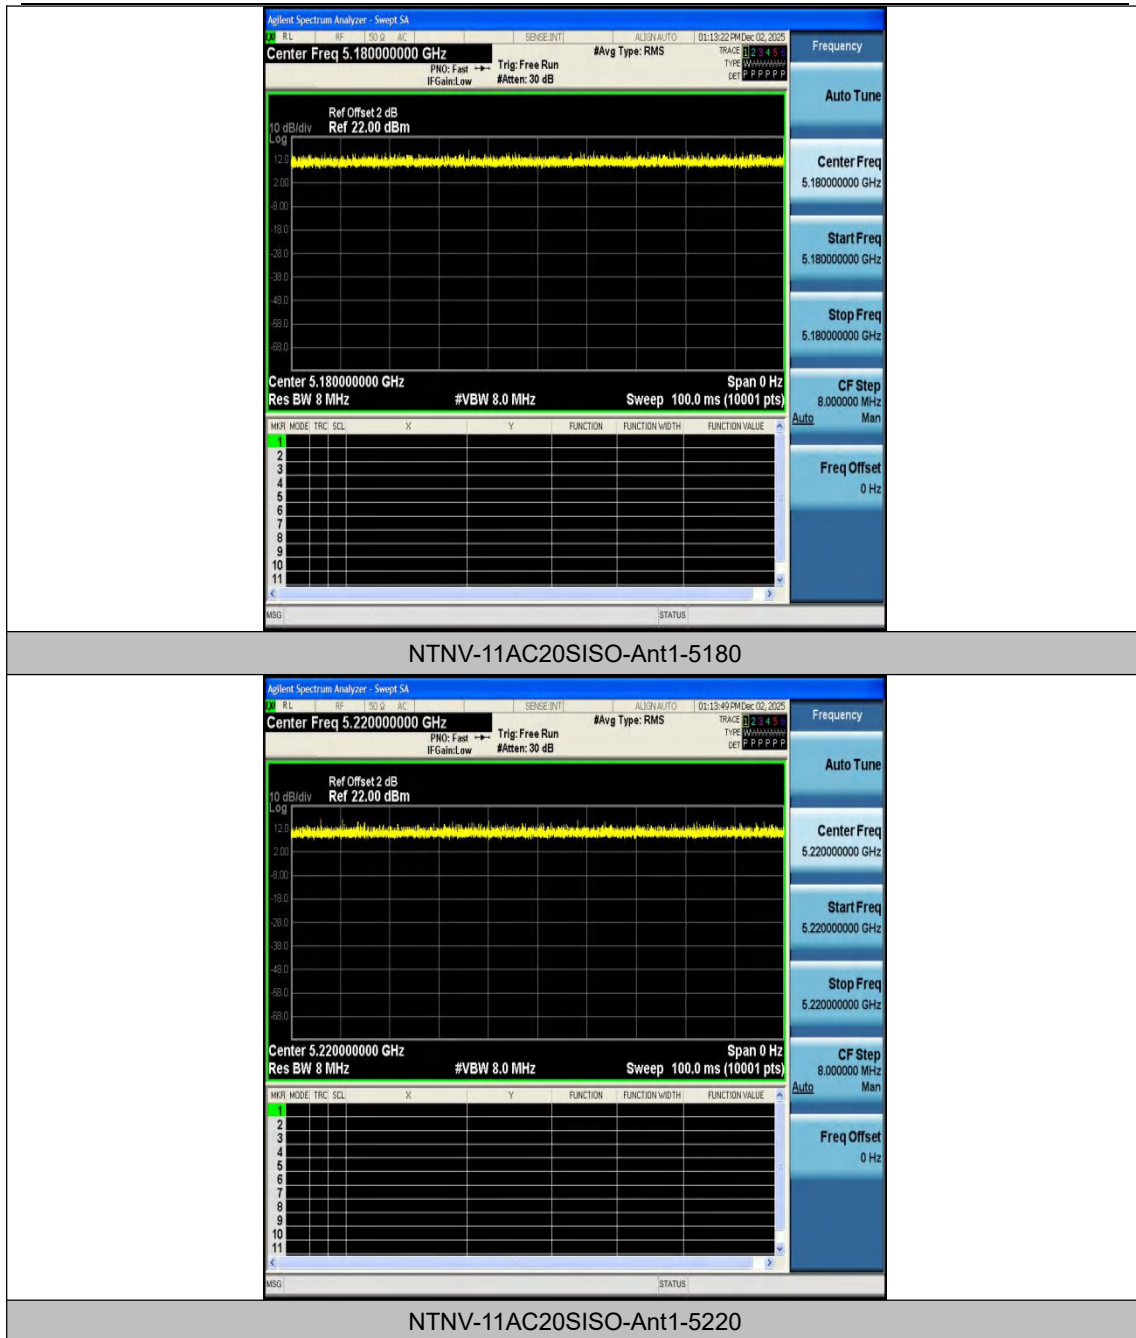

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

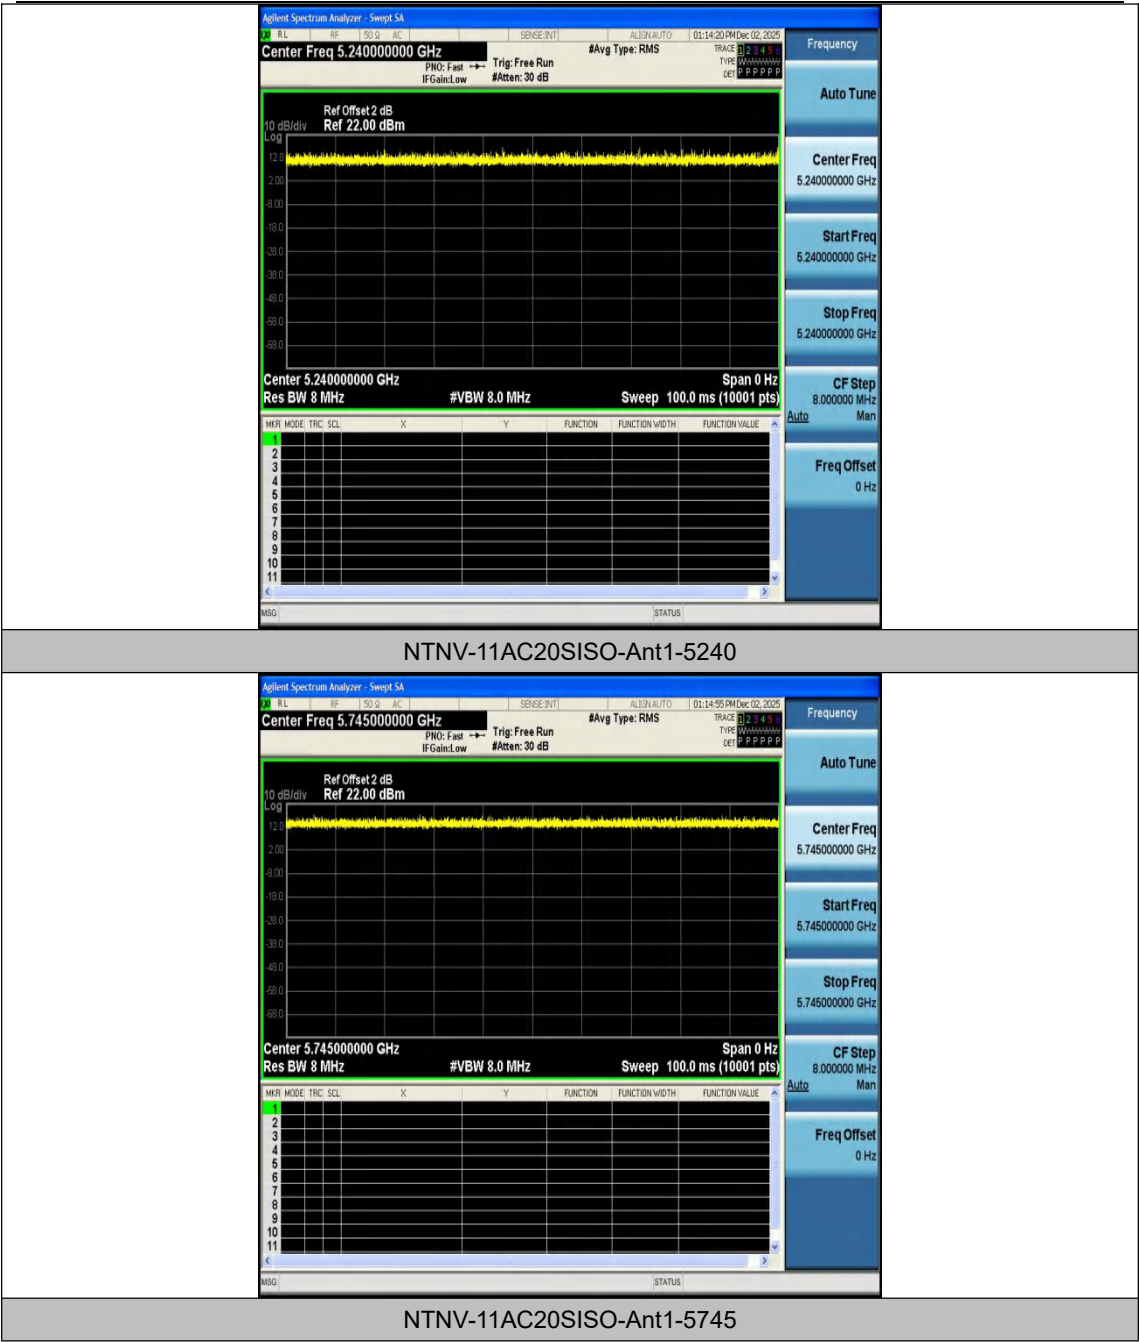

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

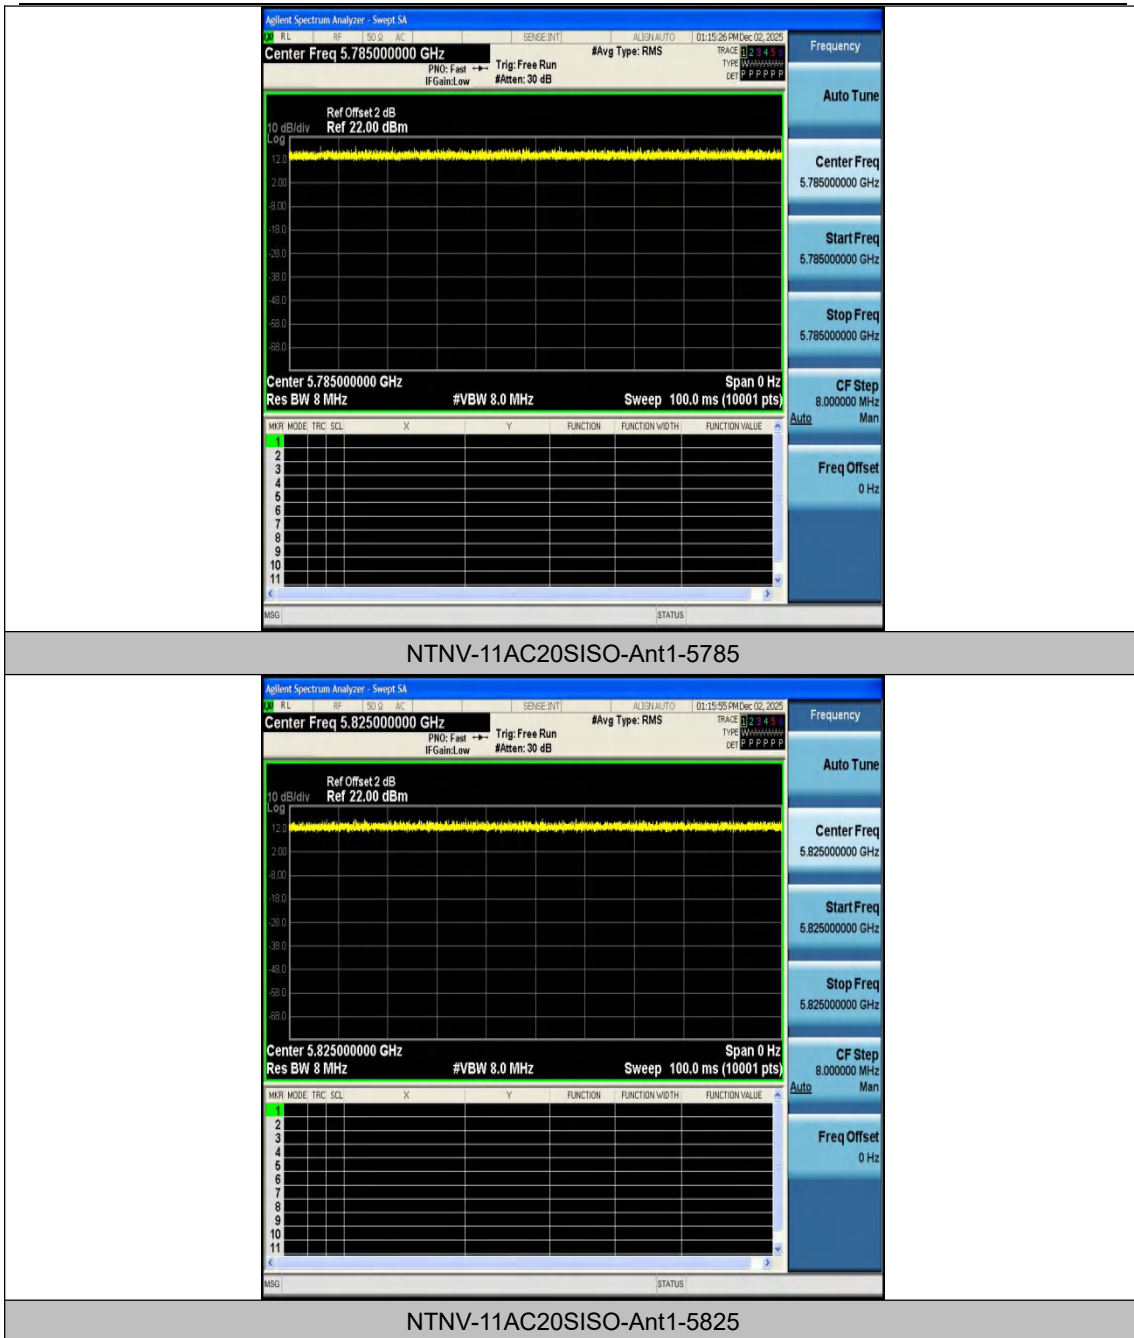

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)