

Appendix Test Data

Report No.:	1812C60163612504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-3-24	Finish Test Date:	2026-4-7
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24.8°C	Relative Humidity:	58%
Pressure:	101kPa		




Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.000	5169.960	5189.960	---	---
11A	Ant1	5220	19.800	5210.200	5230.000	---	---
11A	Ant1	5240	19.640	5230.240	5249.880	---	---
11A	Ant1	5745	19.680	5735.120	5754.800	---	---
11A	Ant1	5785	19.800	5775.120	5794.920	---	---
11A	Ant1	5825	19.560	5815.320	5834.880	---	---
11N20SISO	Ant1	5180	20.160	5170.000	5190.160	---	---
11N20SISO	Ant1	5220	20.280	5209.840	5230.120	---	---
11N20SISO	Ant1	5240	20.240	5229.840	5250.080	---	---
11N20SISO	Ant1	5745	20.200	5734.960	5755.160	---	---
11N20SISO	Ant1	5785	20.320	5774.840	5795.160	---	---
11N20SISO	Ant1	5825	20.000	5815.000	5835.000	---	---
11N40SISO	Ant1	5190	40.320	5169.920	5210.240	---	---
11N40SISO	Ant1	5230	40.320	5209.920	5250.240	---	---
11N40SISO	Ant1	5755	40.160	5735.000	5775.160	---	---
11N40SISO	Ant1	5795	40.080	5775.000	5815.080	---	---


Test Graphs

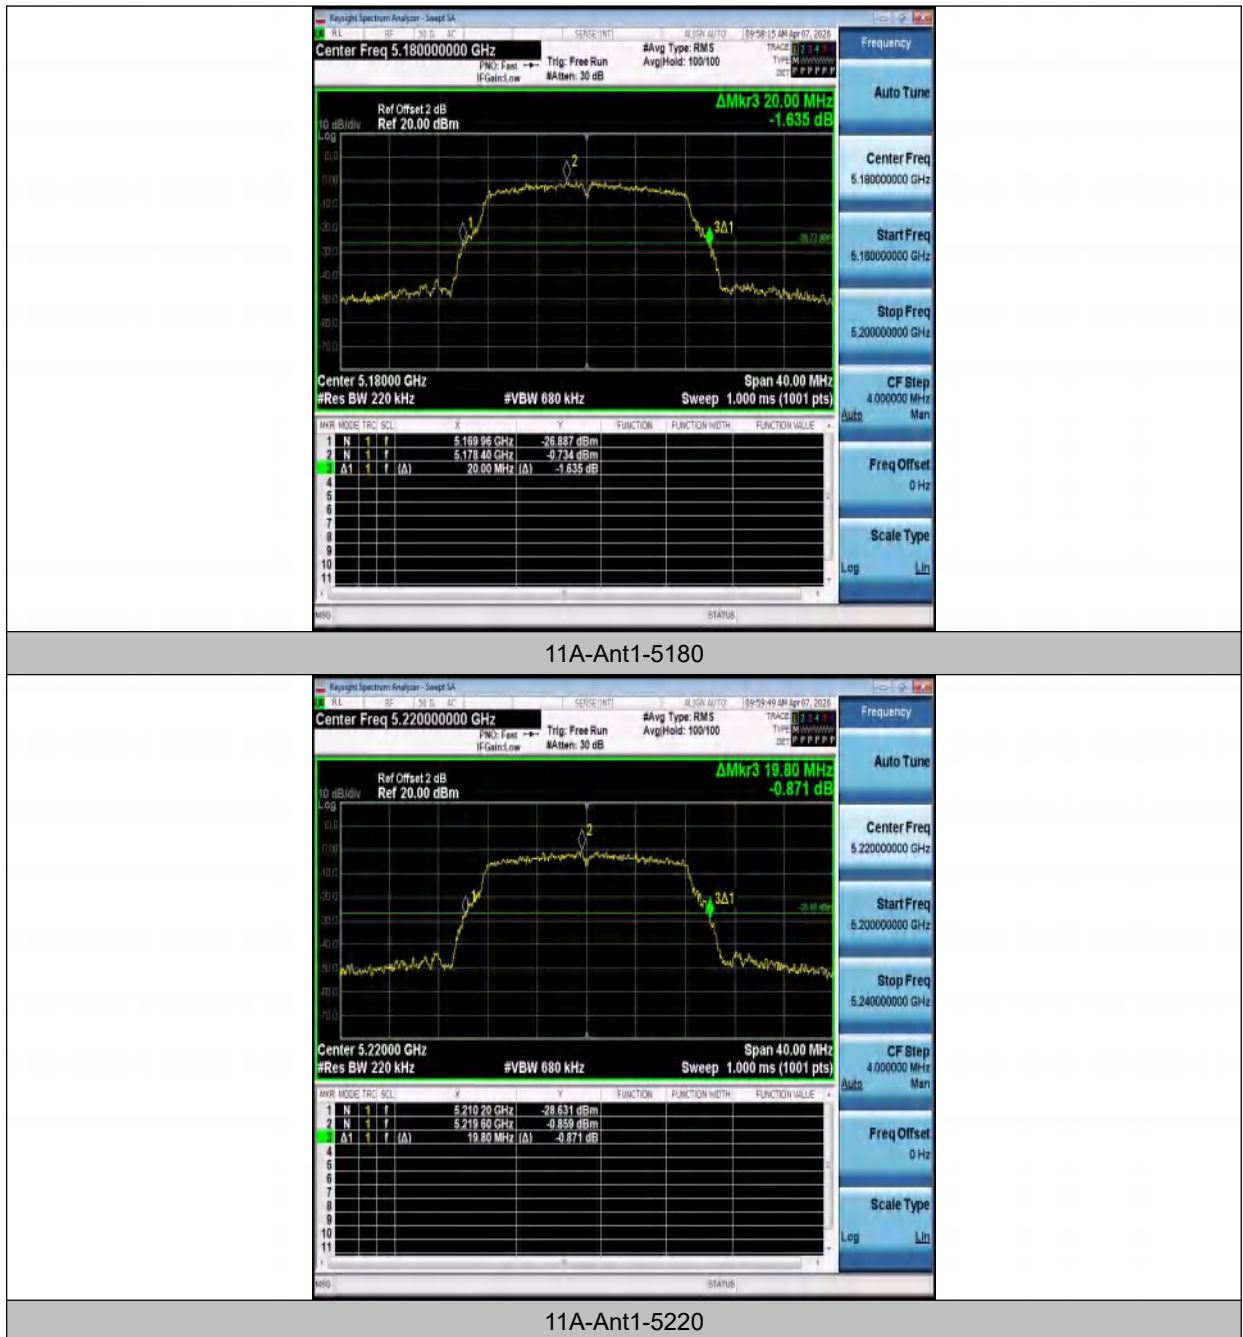

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

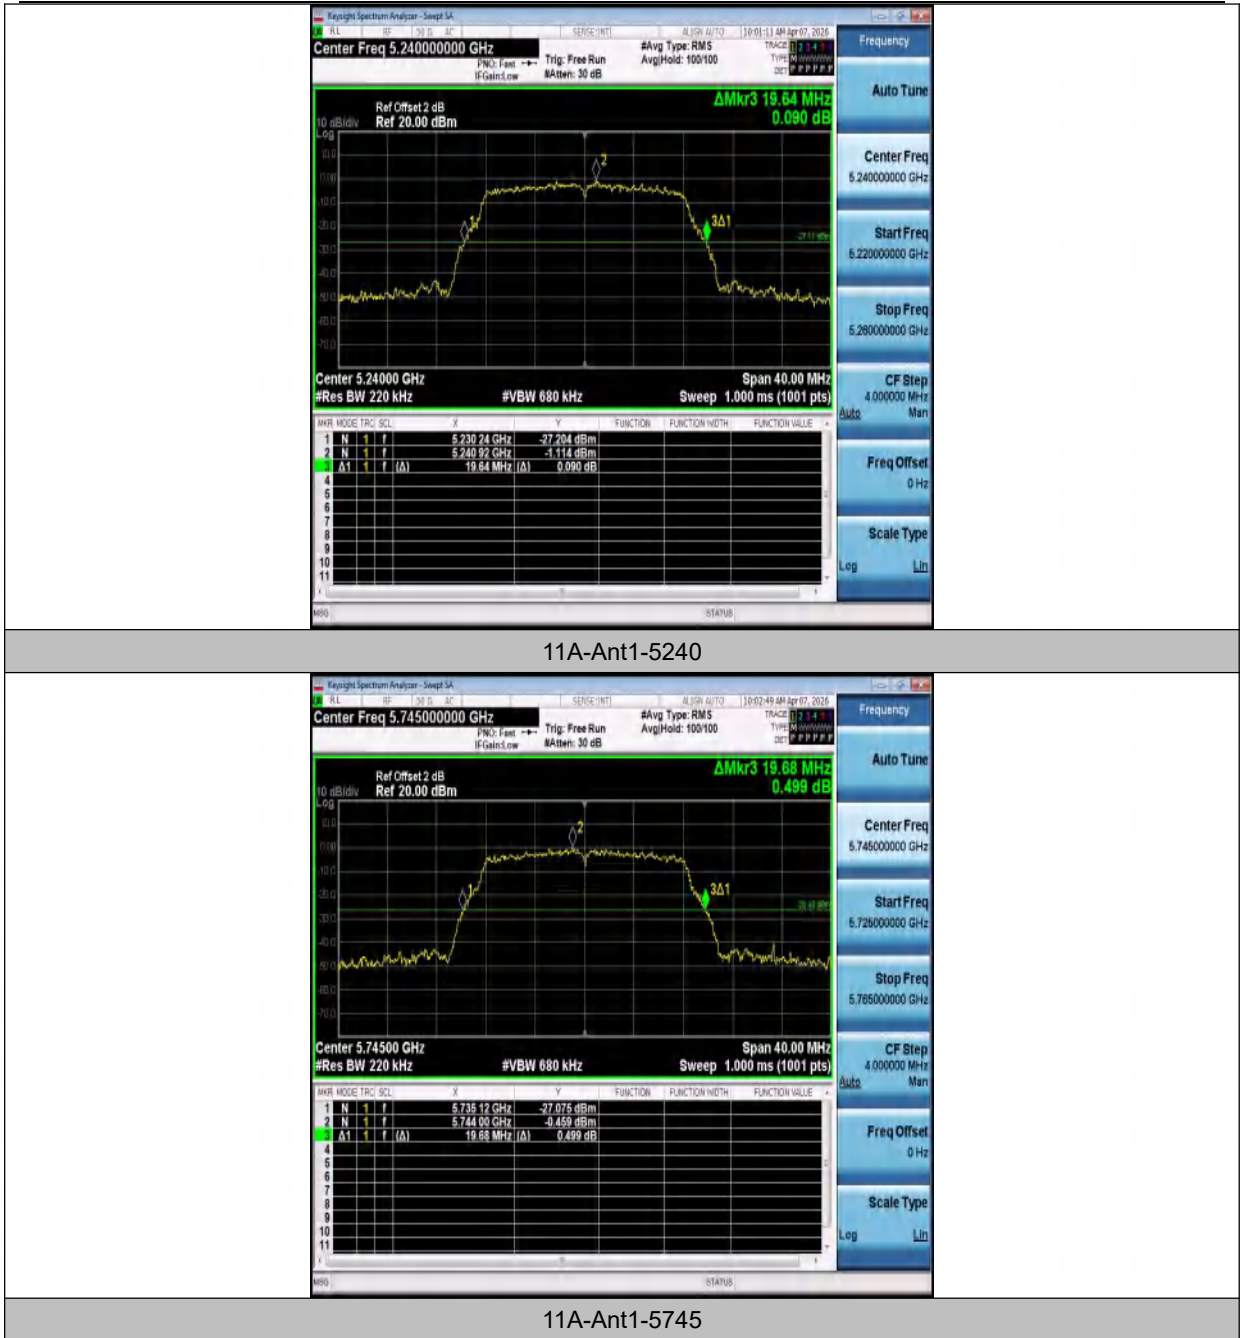


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




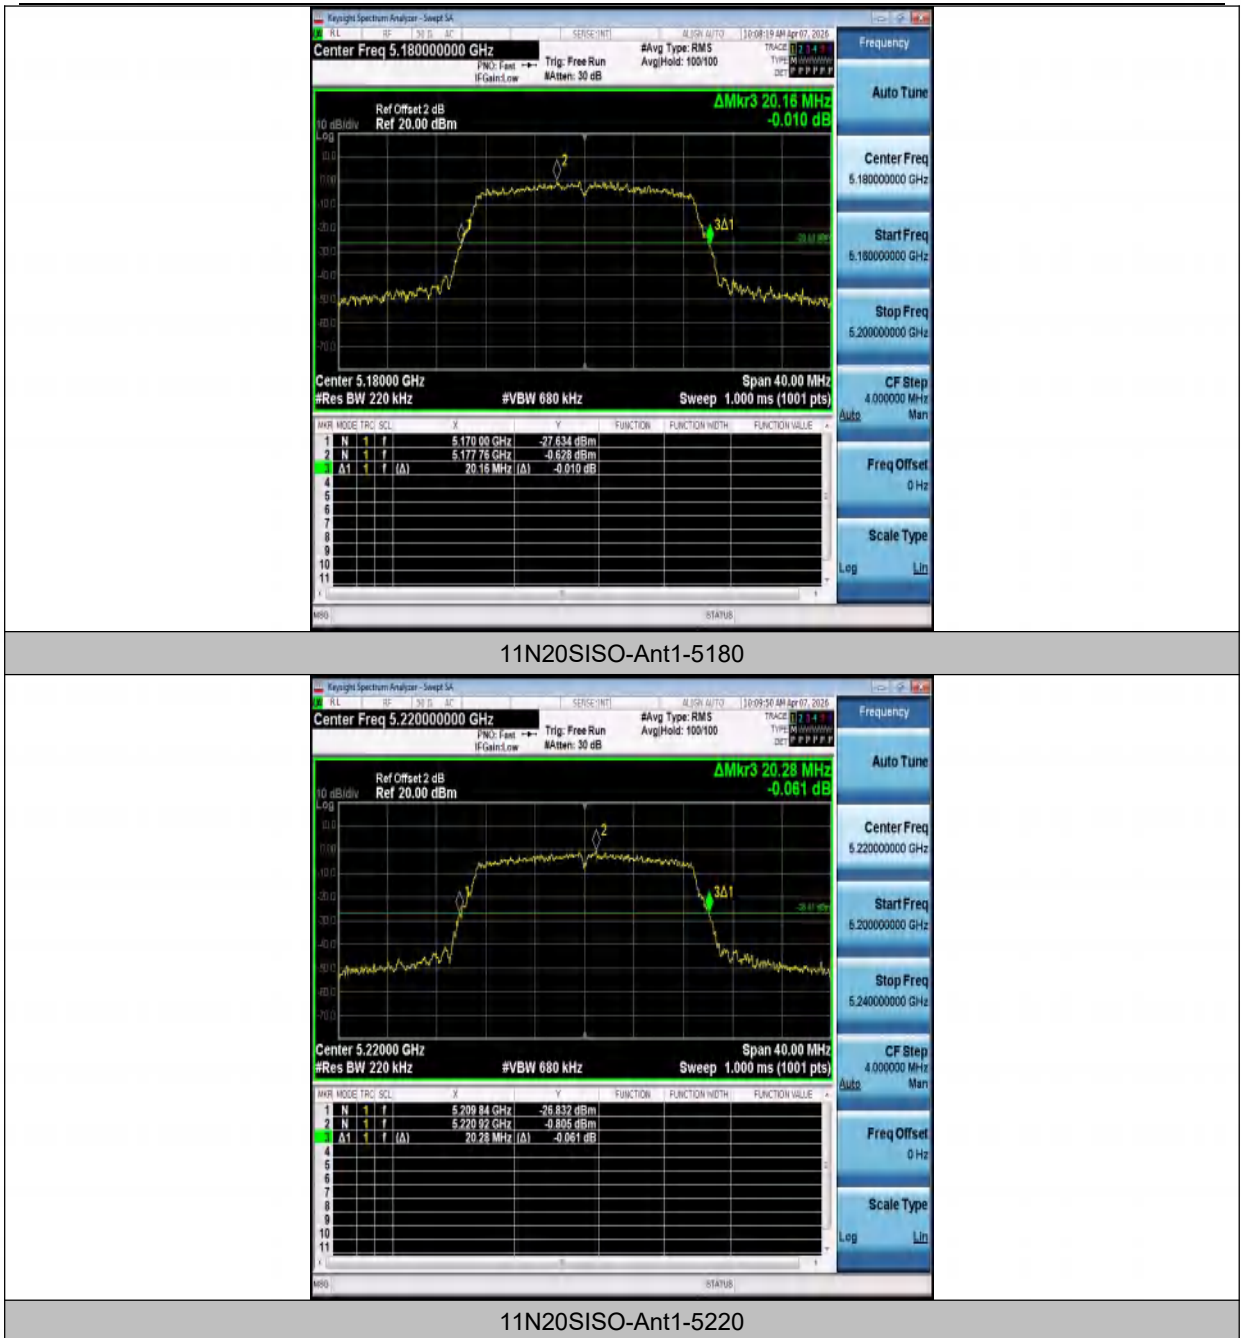

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

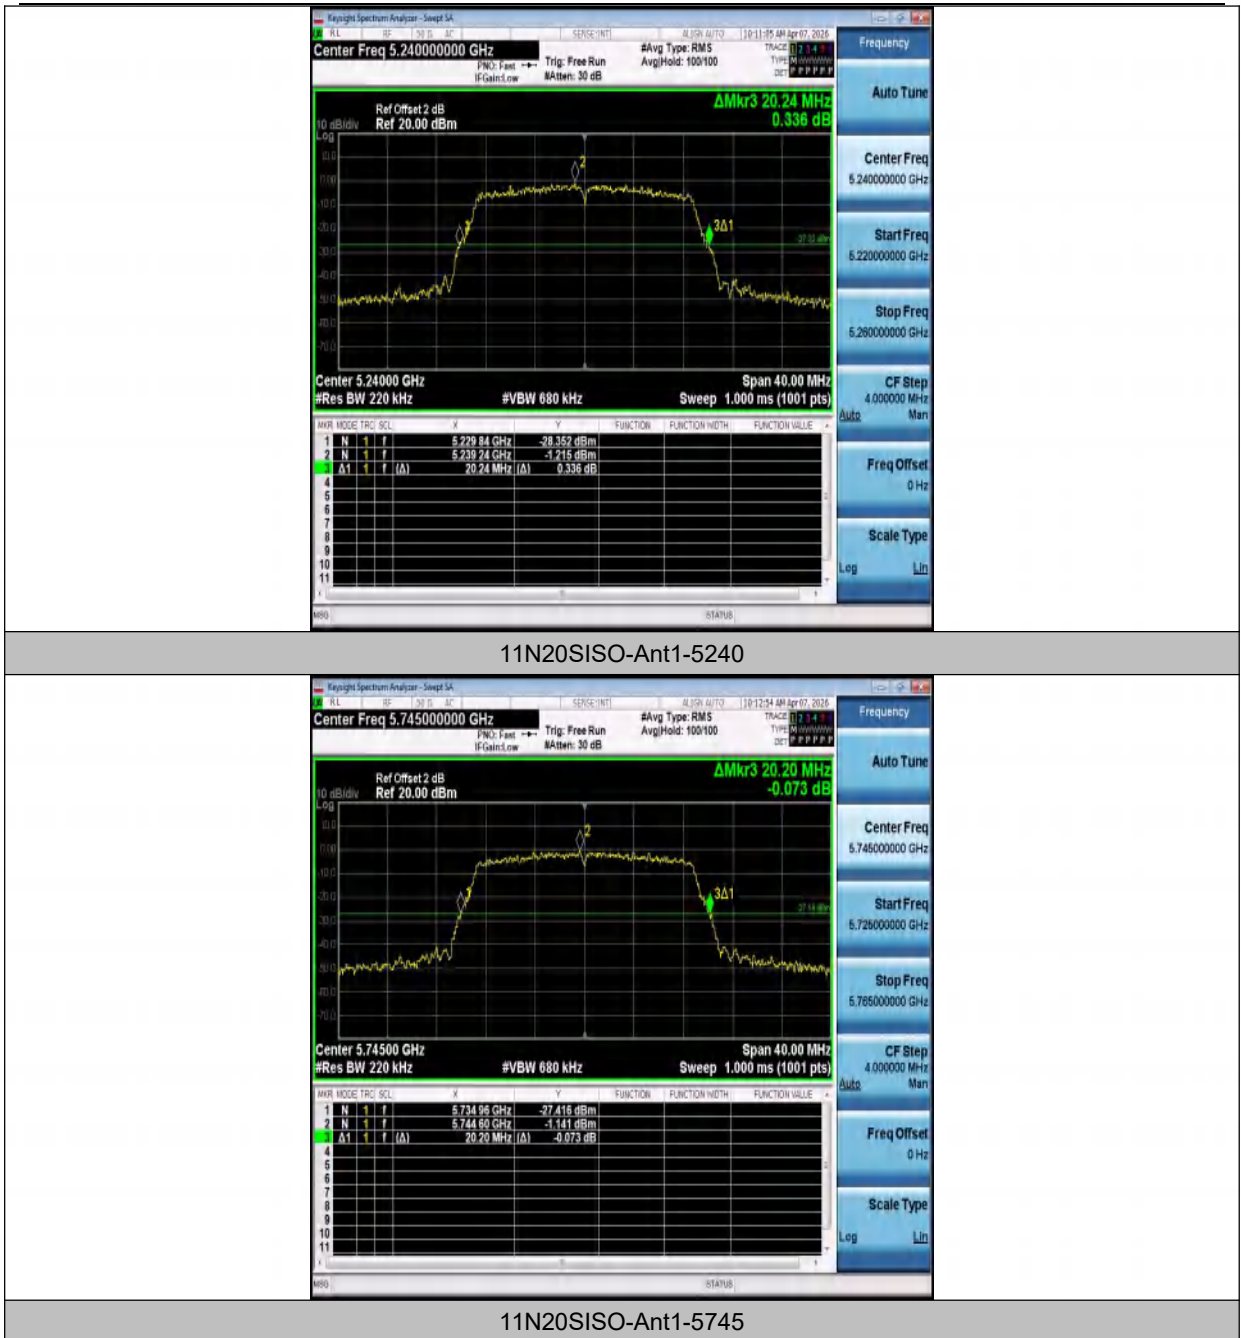

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

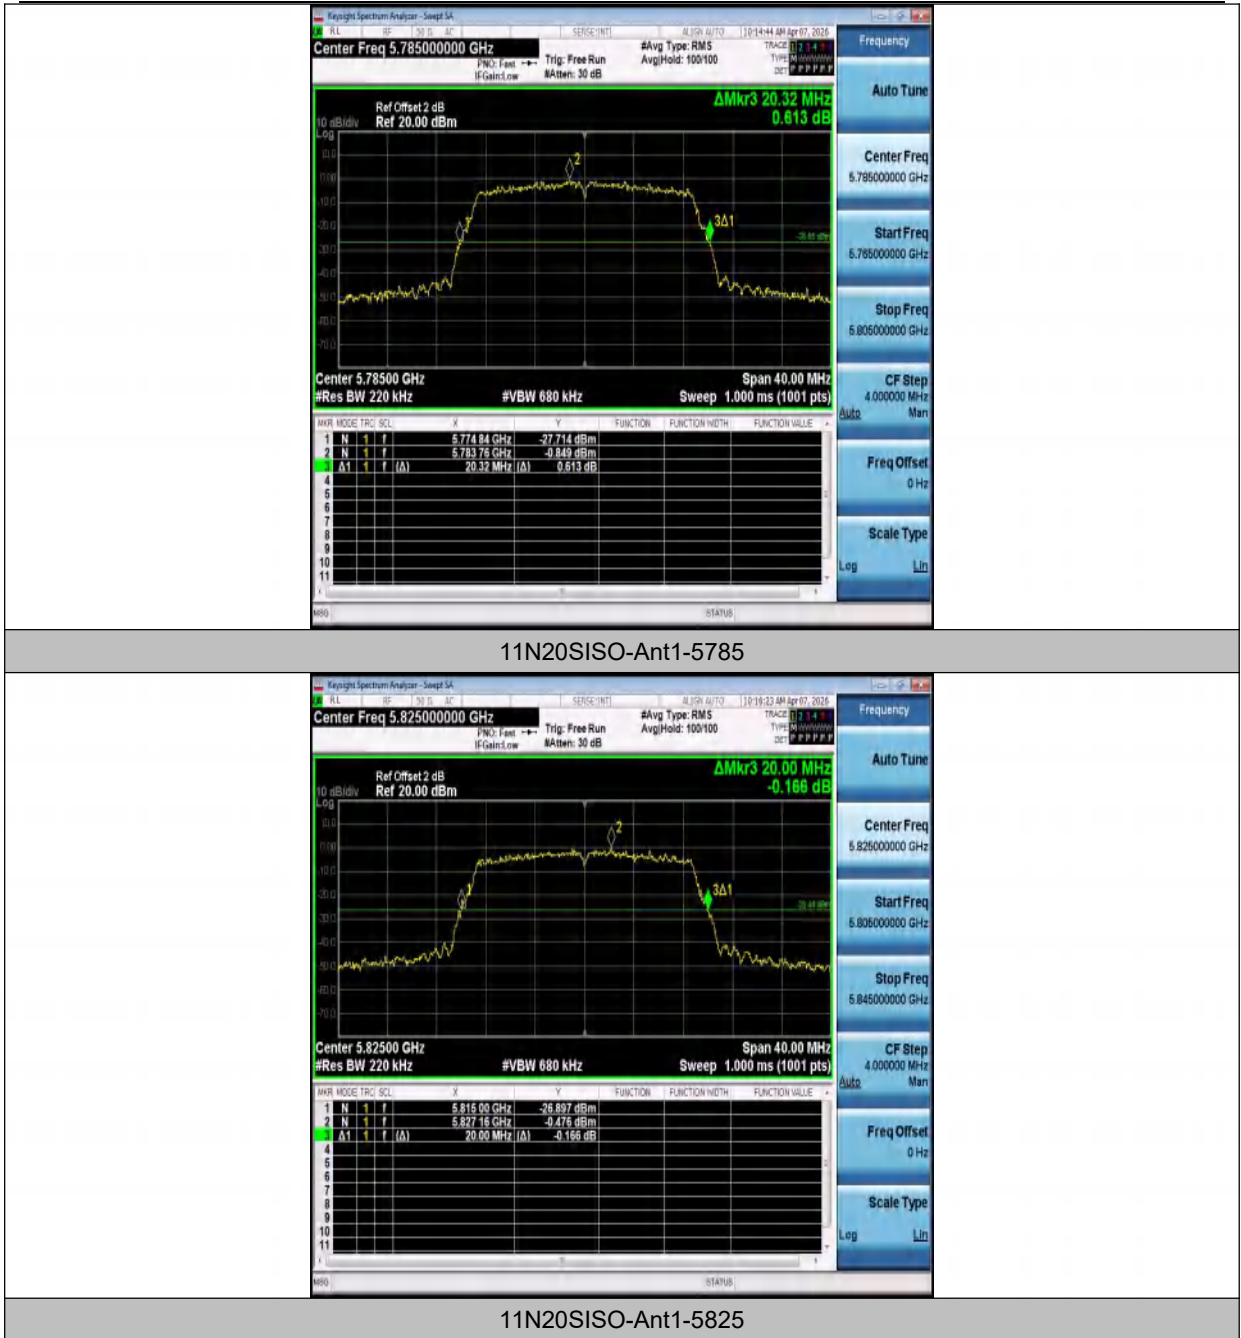

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

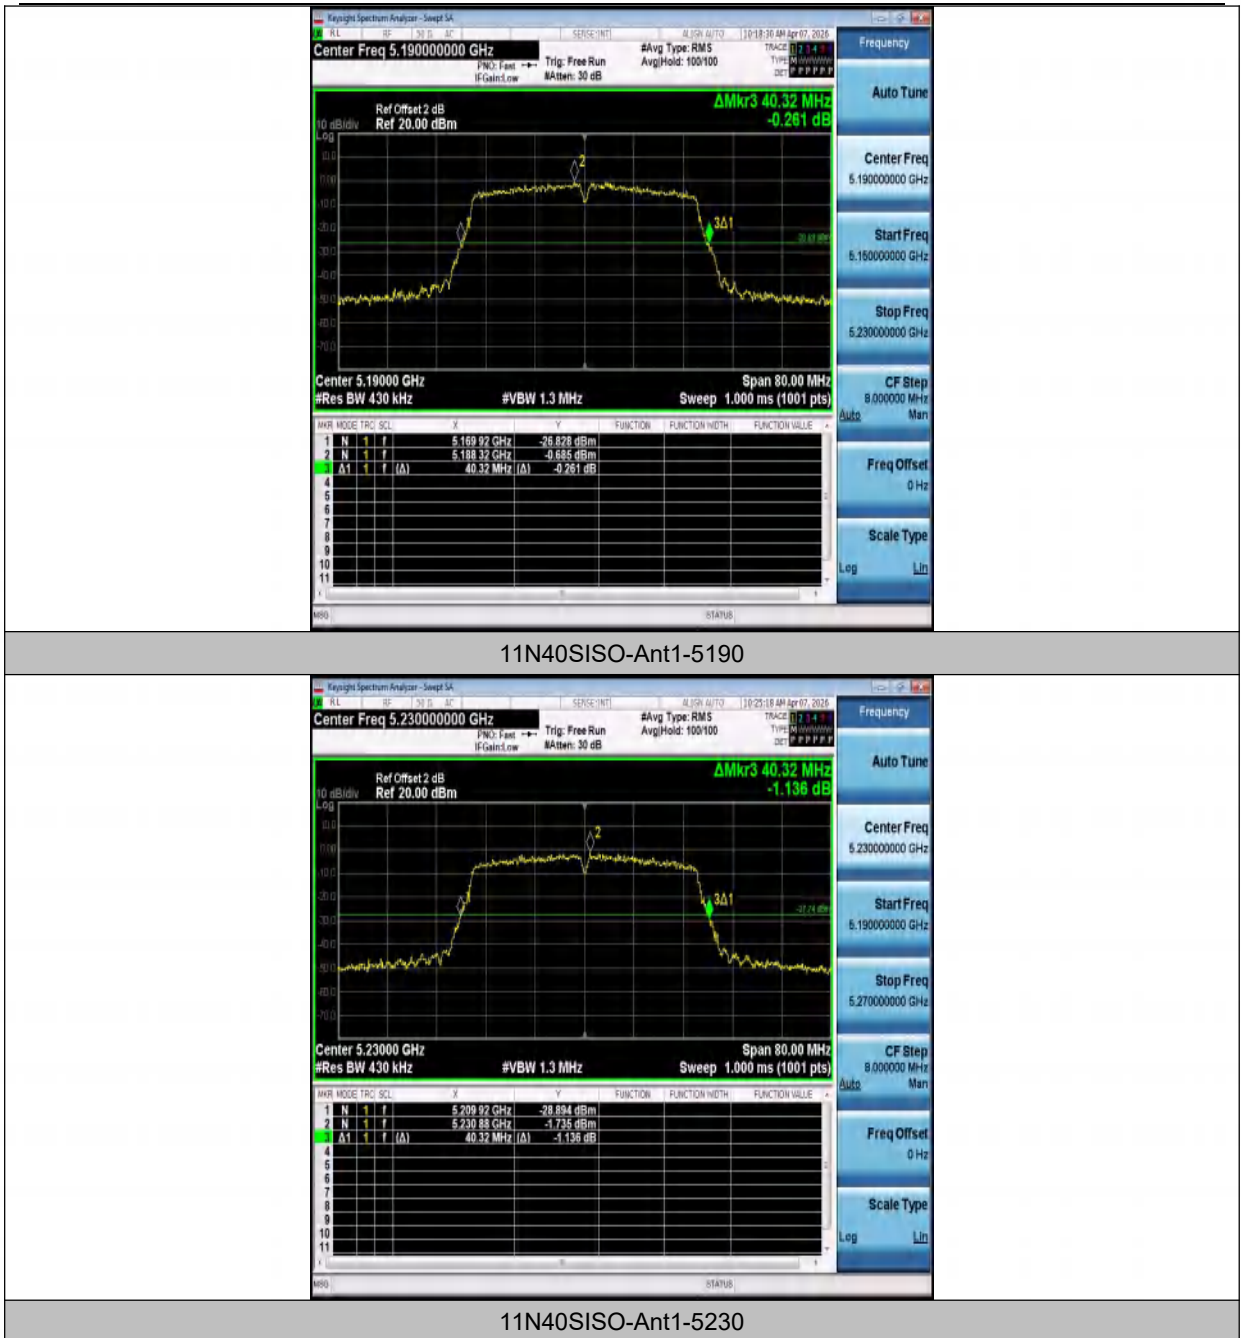

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

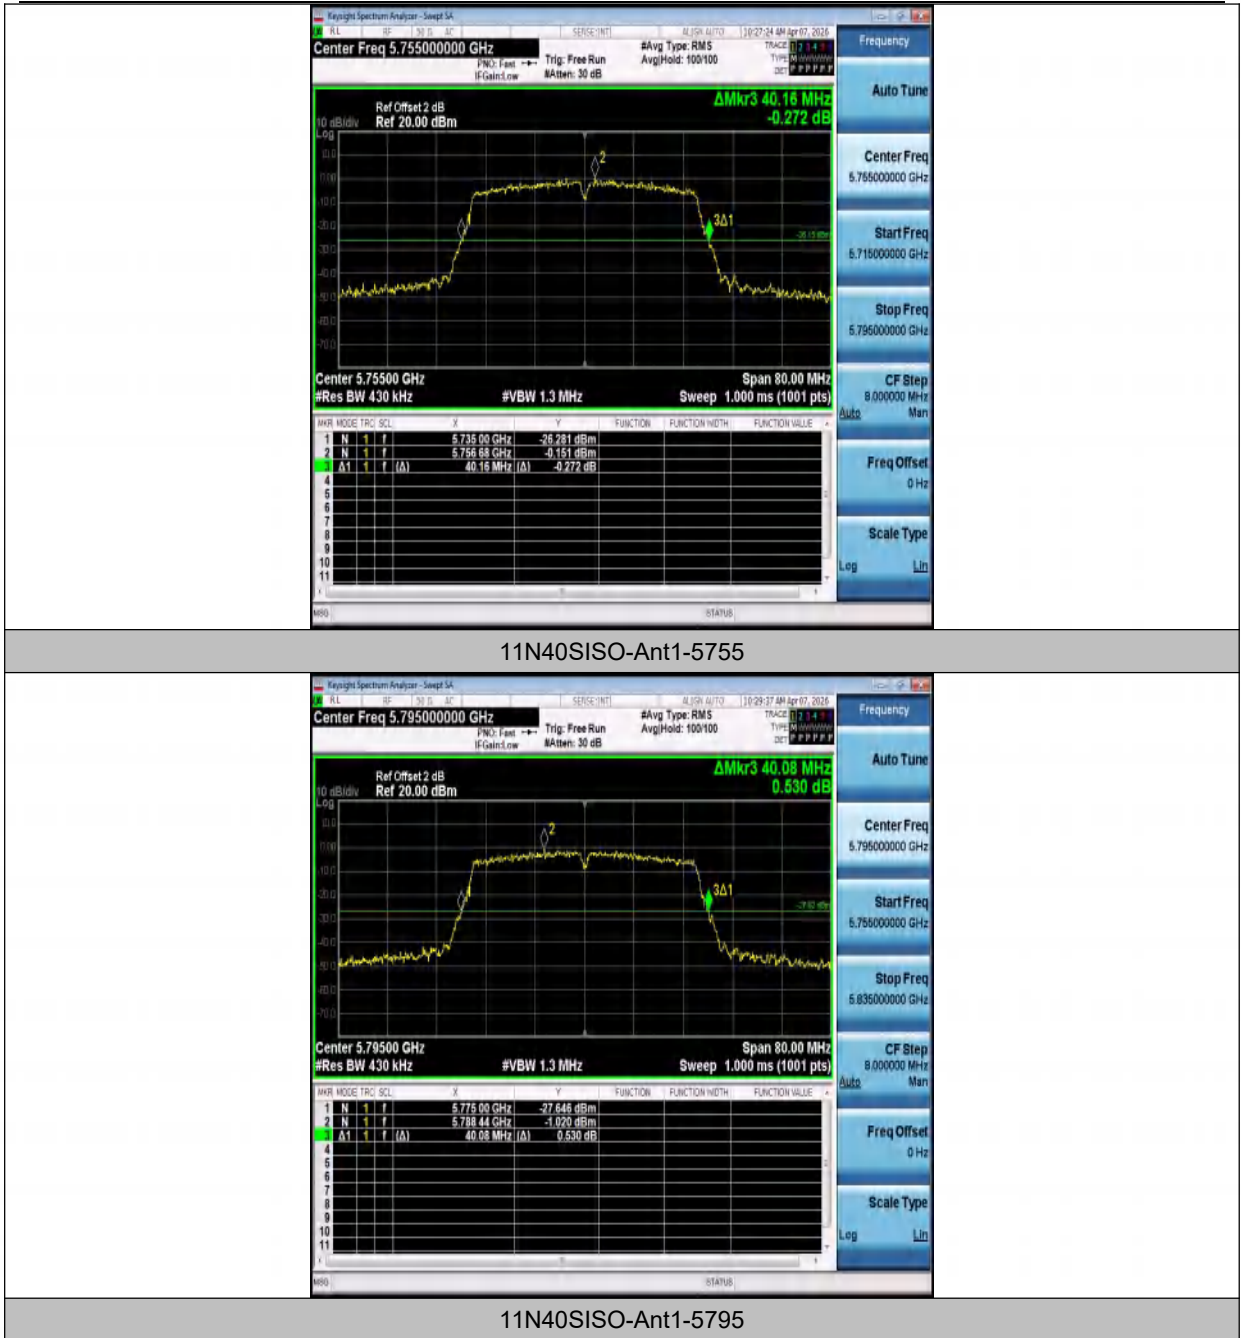

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.750	5171.6140	5188.3640	---	---
11A	Ant1	5220	16.771	5211.6570	5228.4280	---	---
11A	Ant1	5240	16.730	5231.6452	5248.3752	---	---
11A	Ant1	5745	16.760	5736.6894	5753.4494	---	---
11A	Ant1	5785	16.713	5776.6655	5793.3785	---	---
11A	Ant1	5825	16.735	5816.6758	5833.4108	---	---
11N20SISO	Ant1	5180	17.768	5171.1352	5188.9032	---	---
11N20SISO	Ant1	5220	17.827	5211.1147	5228.9417	---	---
11N20SISO	Ant1	5240	17.744	5231.1479	5248.8919	---	---
11N20SISO	Ant1	5745	17.737	5736.1795	5753.9165	---	---
11N20SISO	Ant1	5785	17.833	5776.0684	5793.9014	---	---
11N20SISO	Ant1	5825	17.806	5816.1559	5833.9619	---	---
11N40SISO	Ant1	5190	36.163	5171.9218	5208.0848	---	---
11N40SISO	Ant1	5230	36.134	5211.9538	5248.0878	---	---
11N40SISO	Ant1	5755	36.084	5737.0498	5773.1338	---	---
11N40SISO	Ant1	5795	36.113	5776.9552	5813.0682	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.320	5736.840	5753.160	0.5	PASS
11A	Ant1	5785	16.320	5776.840	5793.160	0.5	PASS
11A	Ant1	5825	16.320	5816.840	5833.160	0.5	PASS
11N20SISO	Ant1	5745	17.520	5736.240	5753.760	0.5	PASS
11N20SISO	Ant1	5785	17.560	5776.200	5793.760	0.5	PASS
11N20SISO	Ant1	5825	17.560	5816.200	5833.760	0.5	PASS
11N40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11N40SISO	Ant1	5795	36.320	5776.840	5813.160	0.5	PASS

Test Graphs B4





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



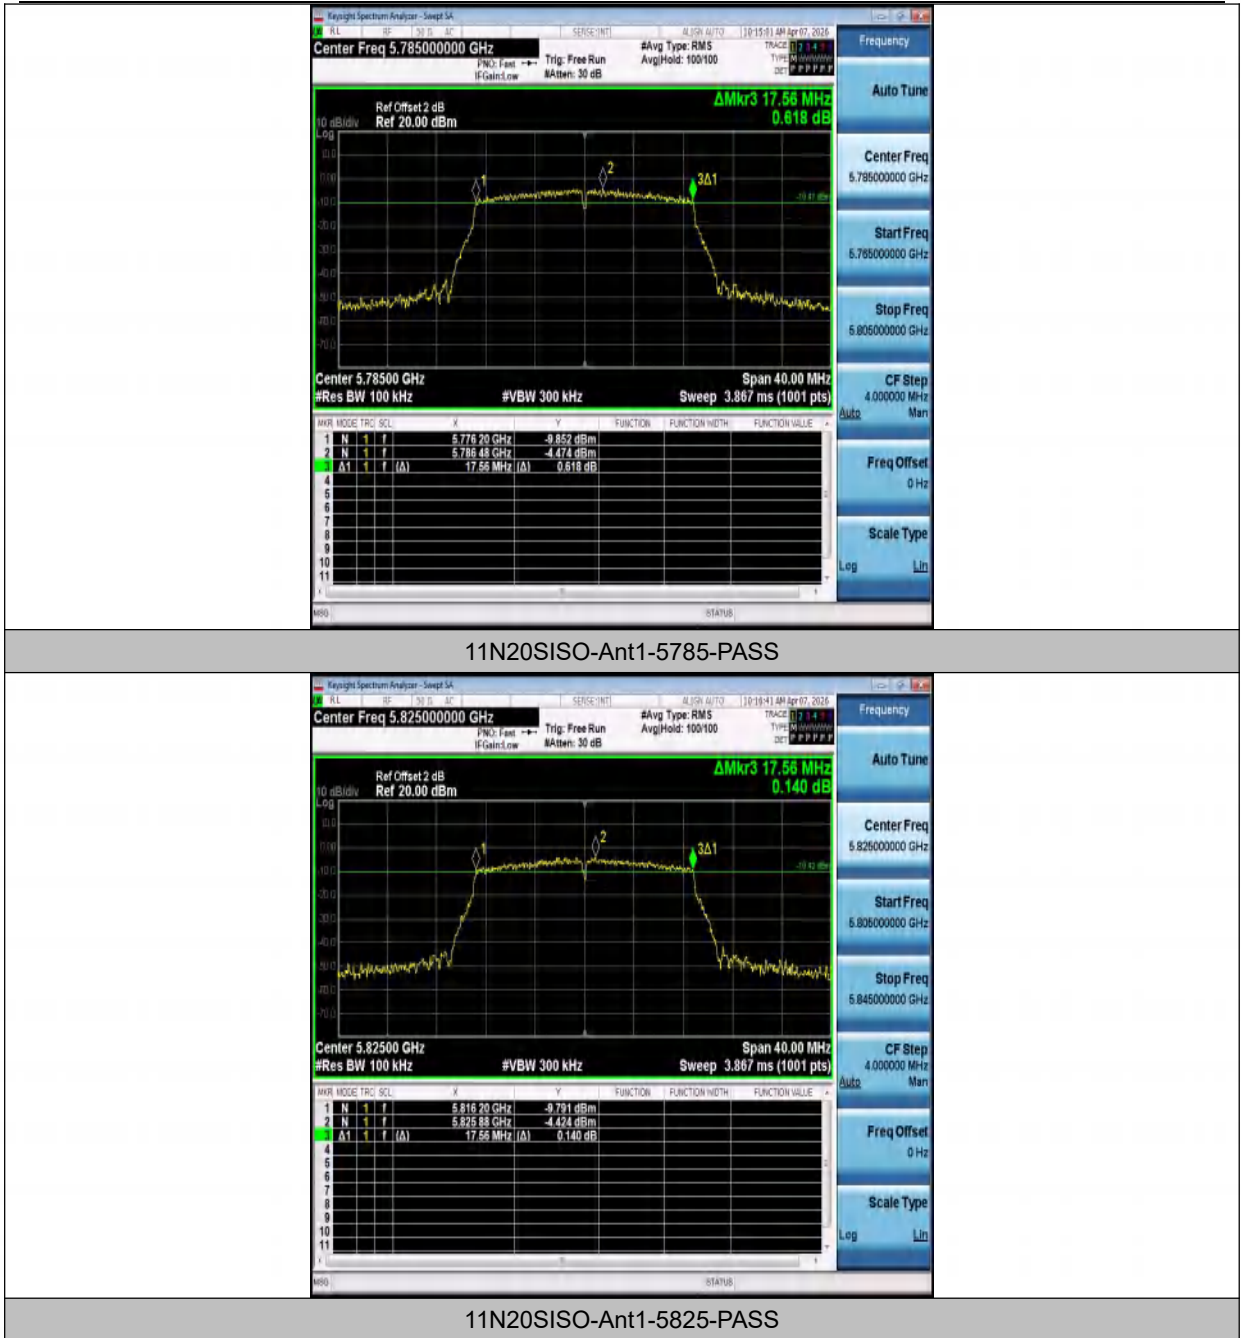

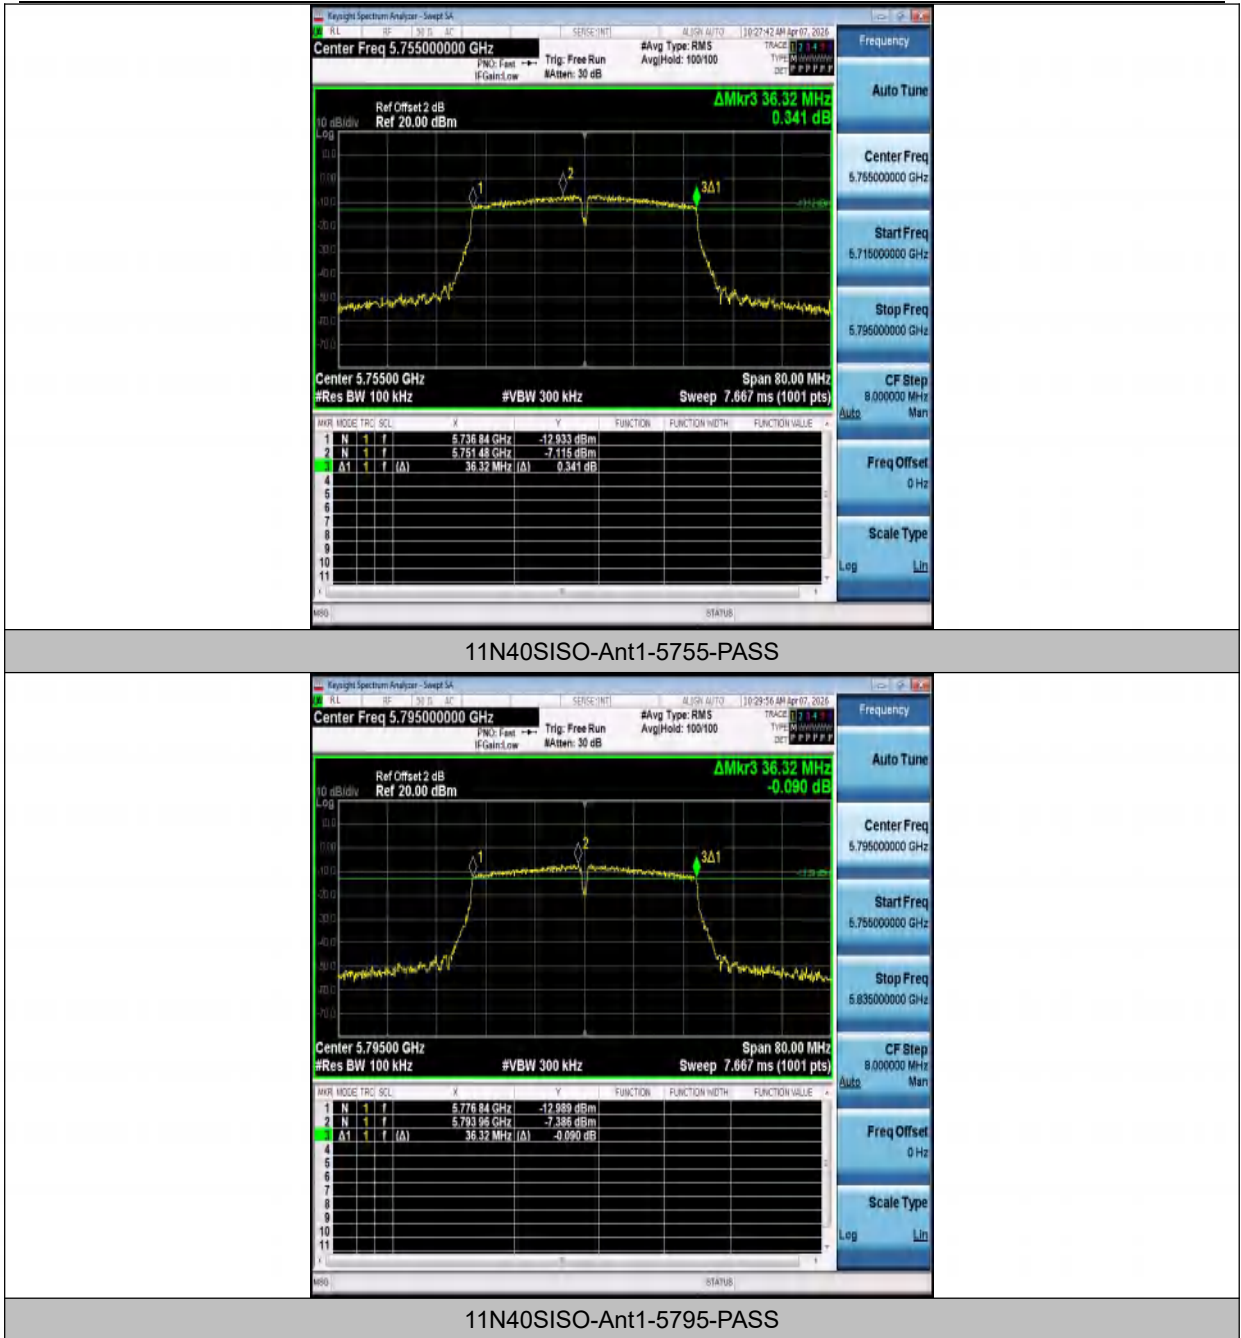

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01


Test Graphs

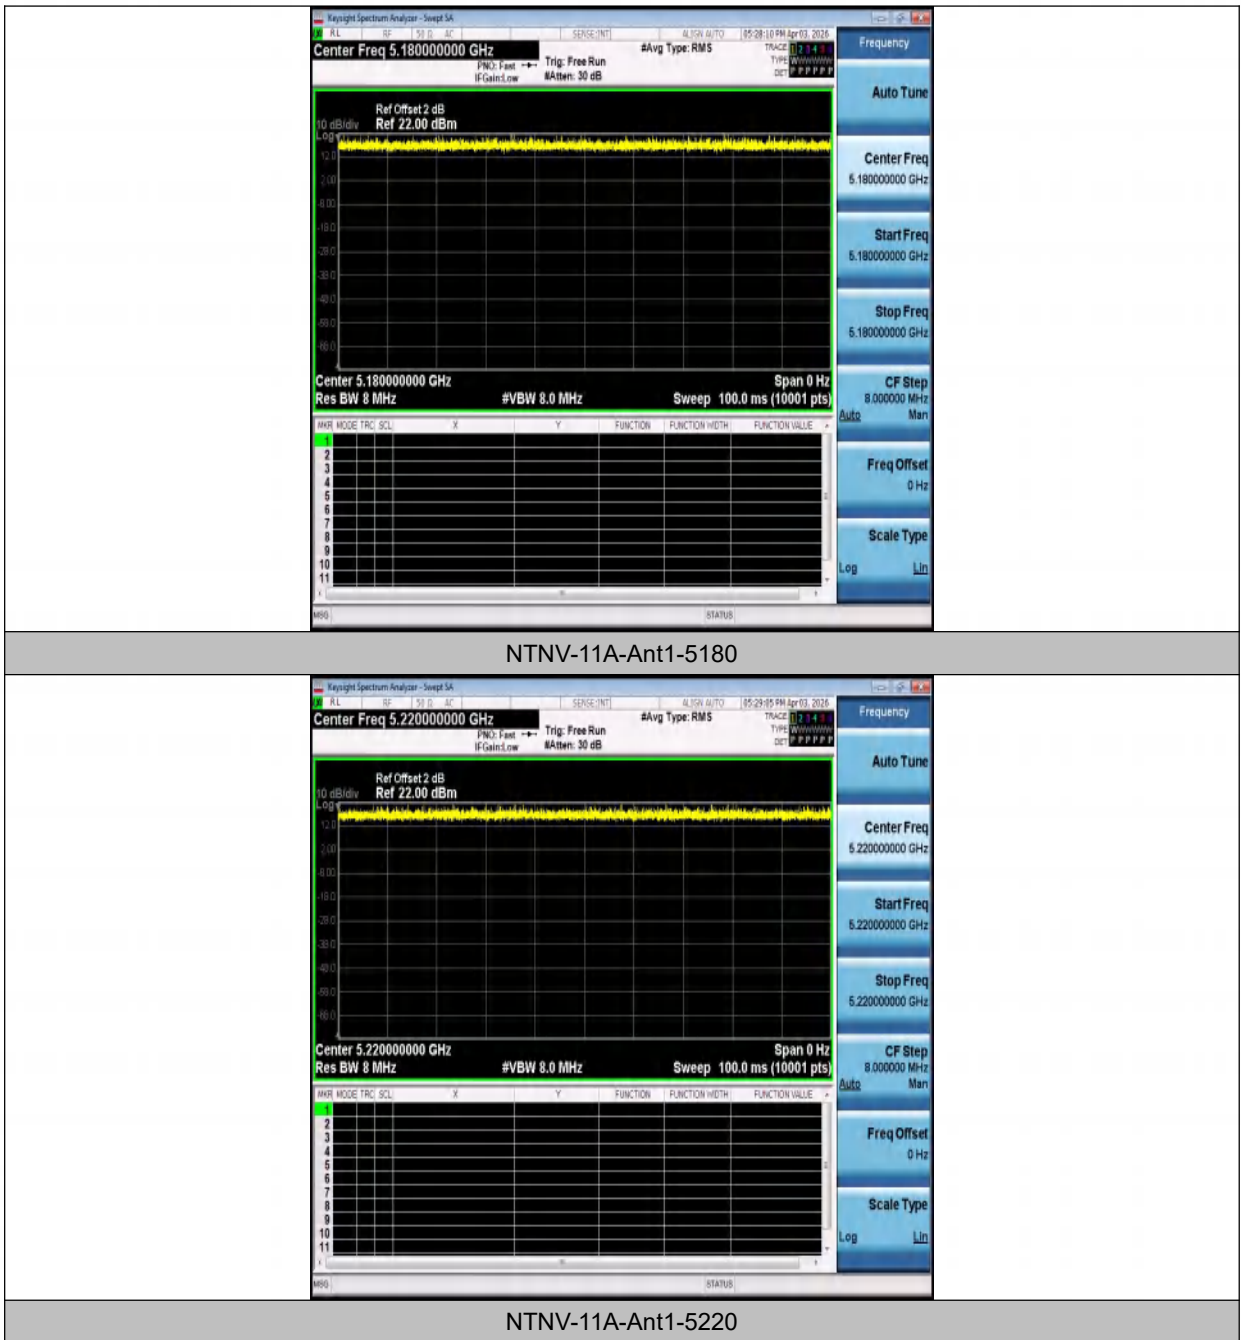

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

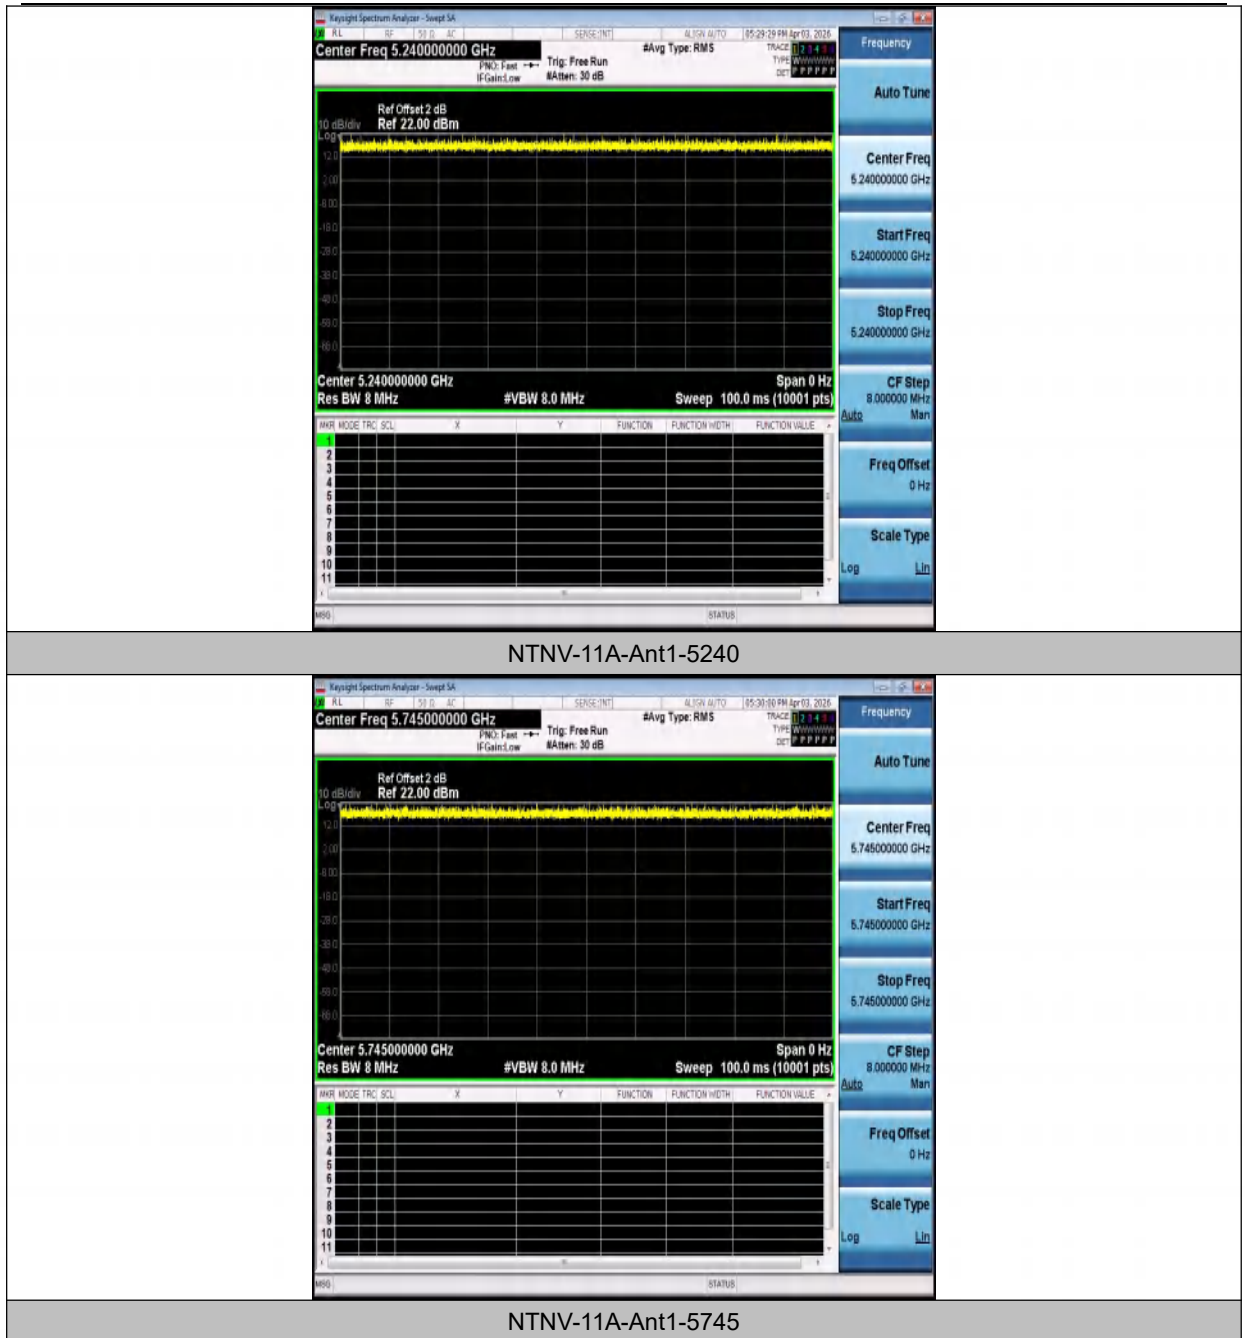

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

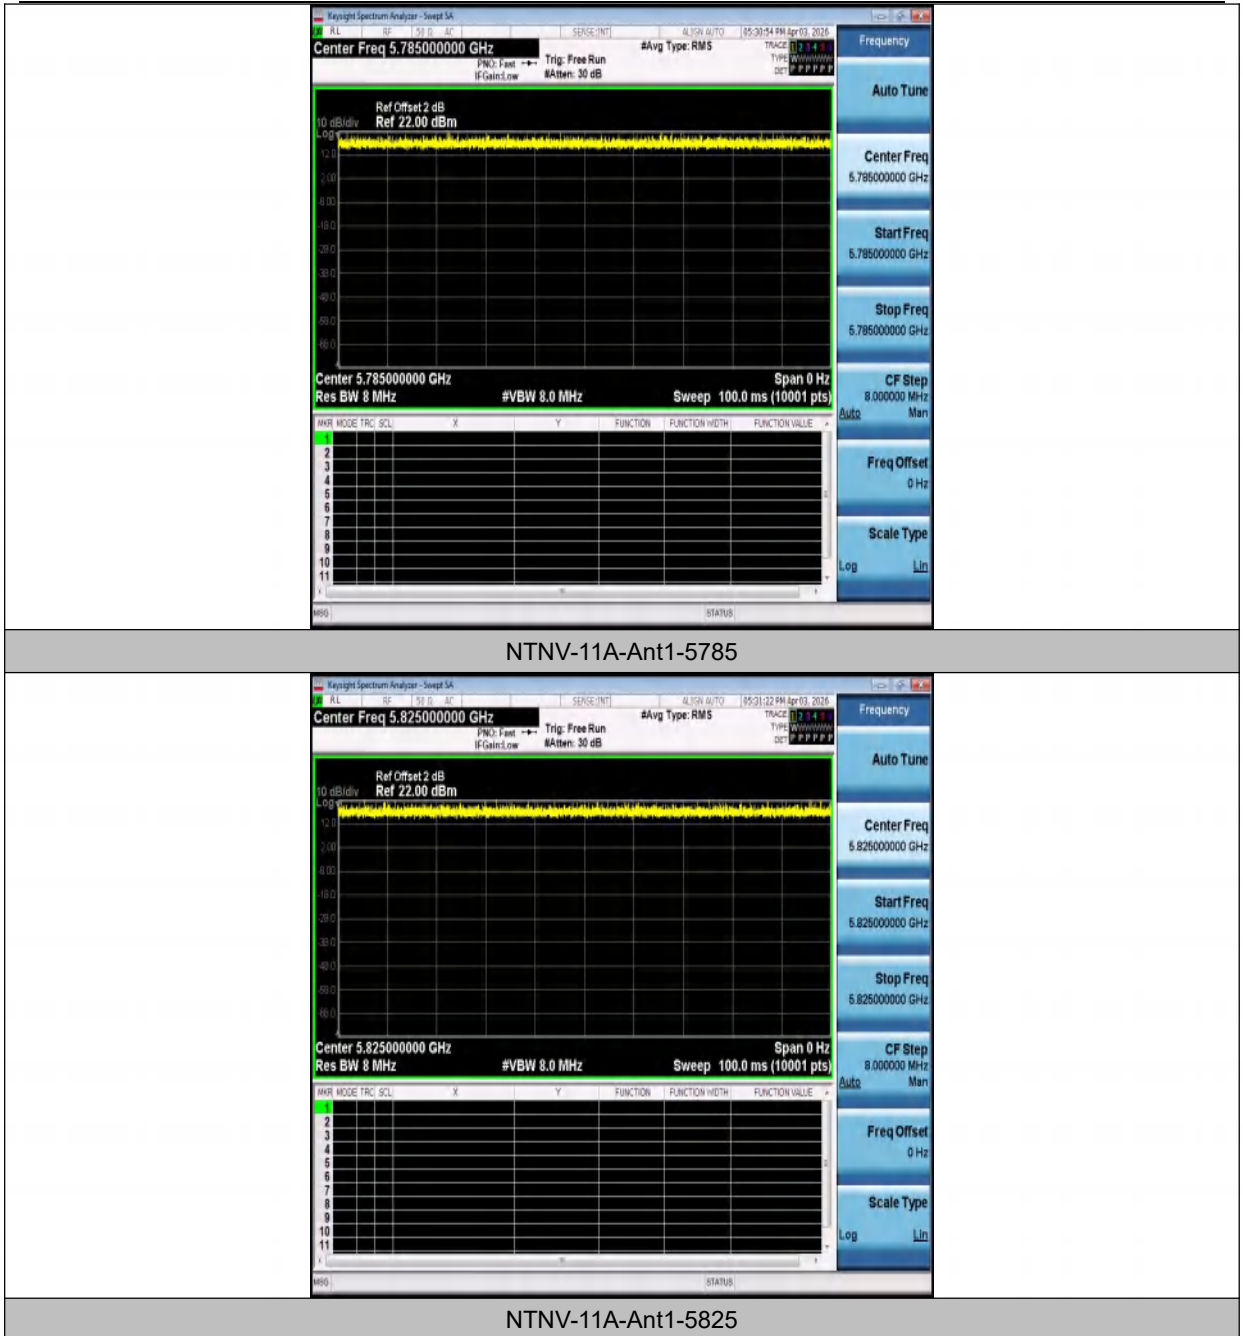

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

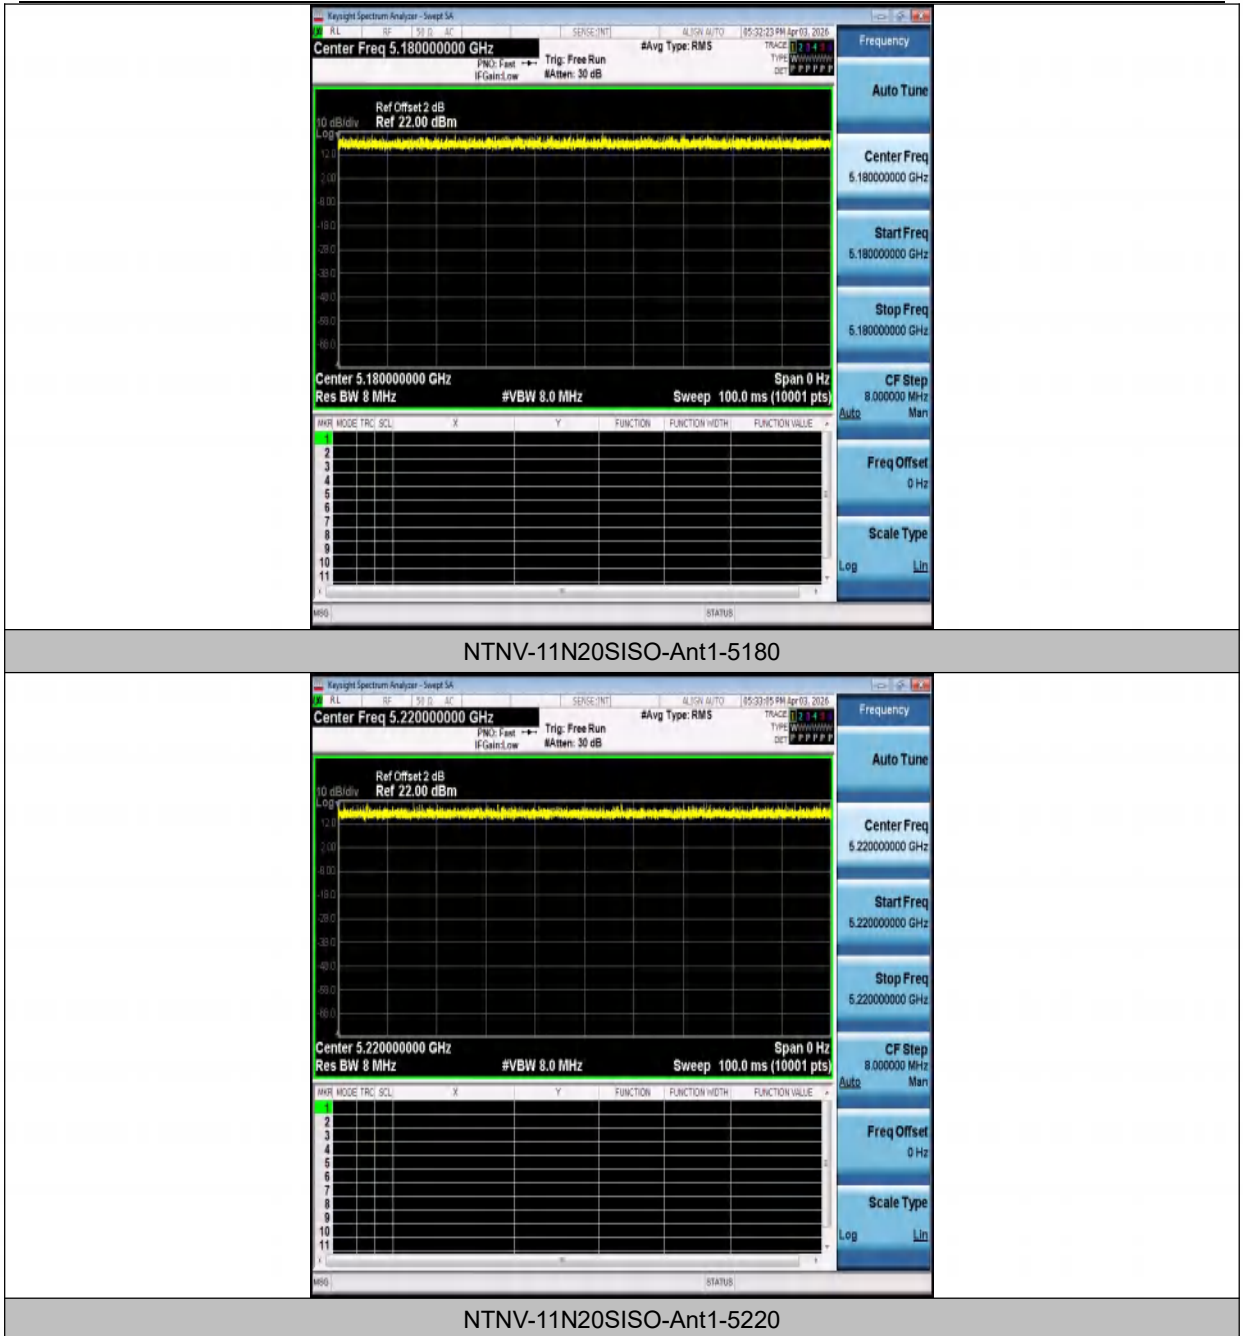

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

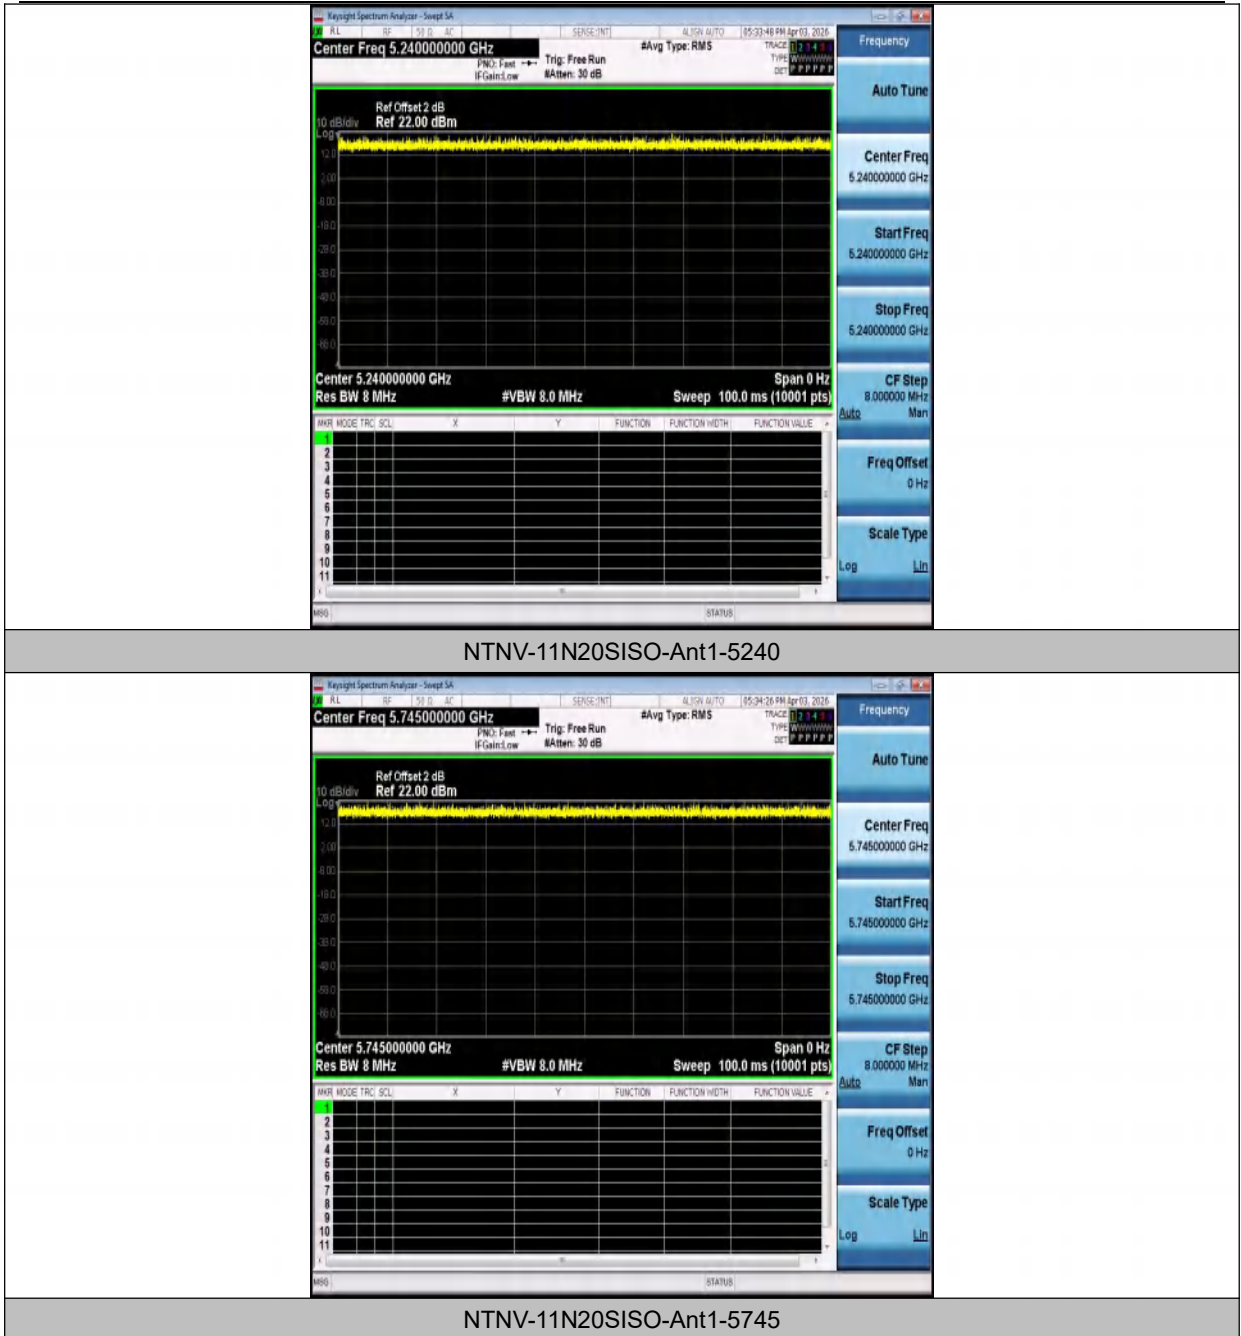

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

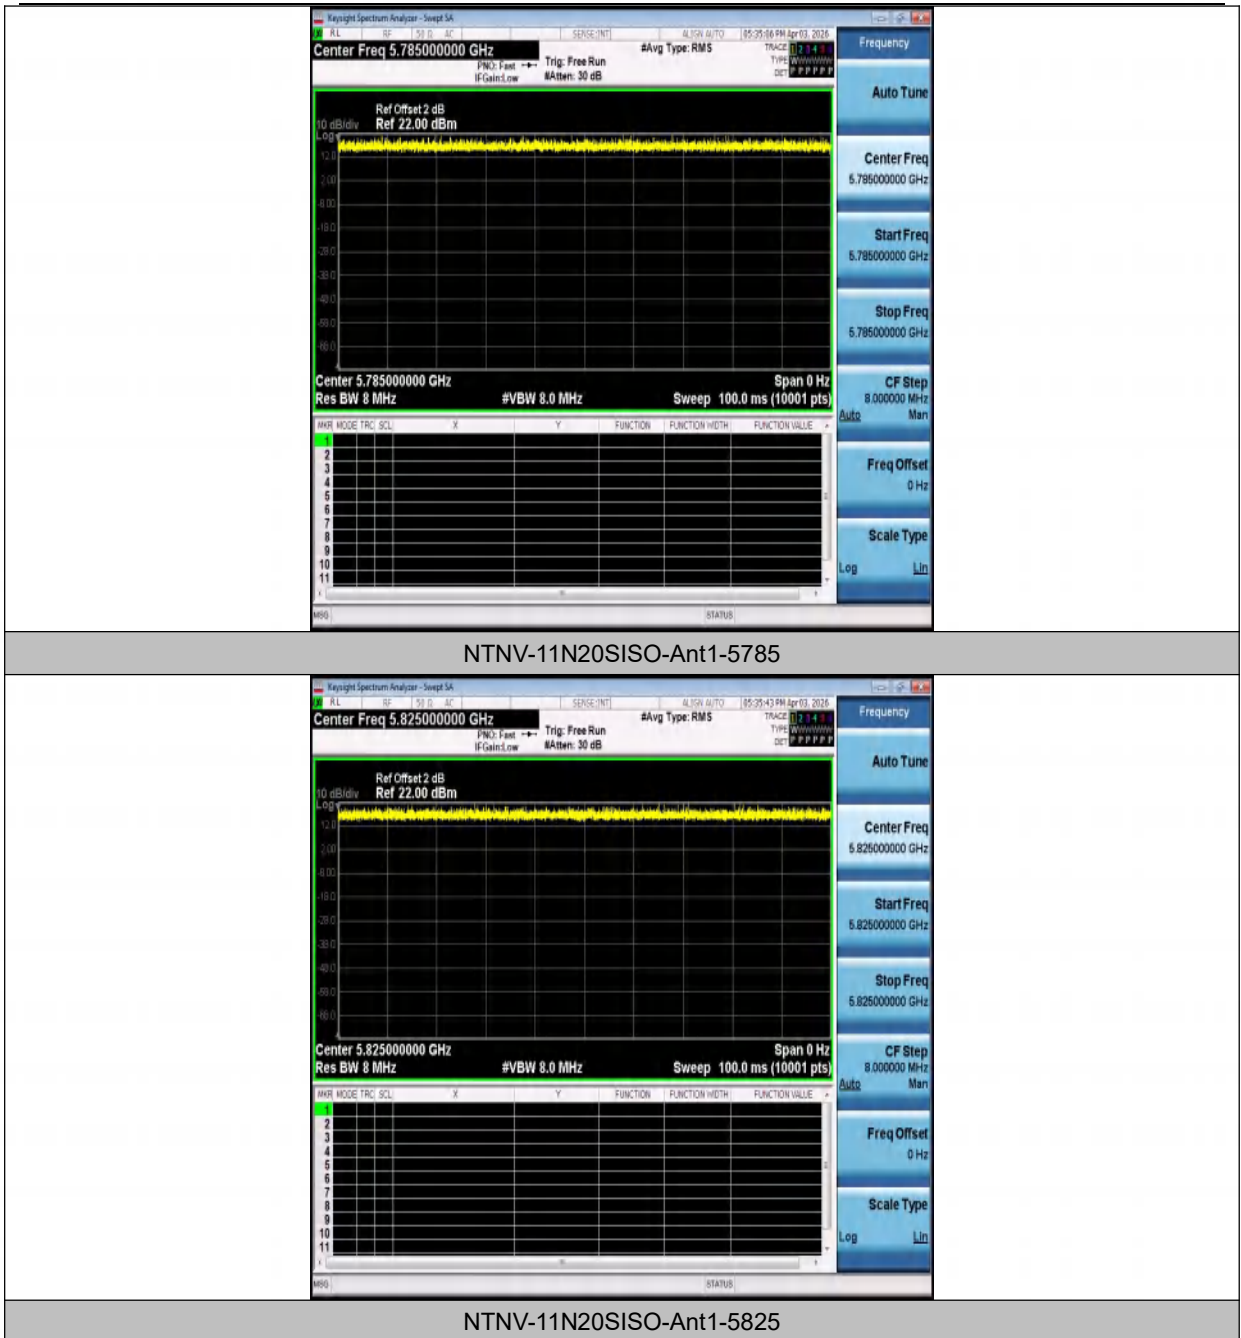

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

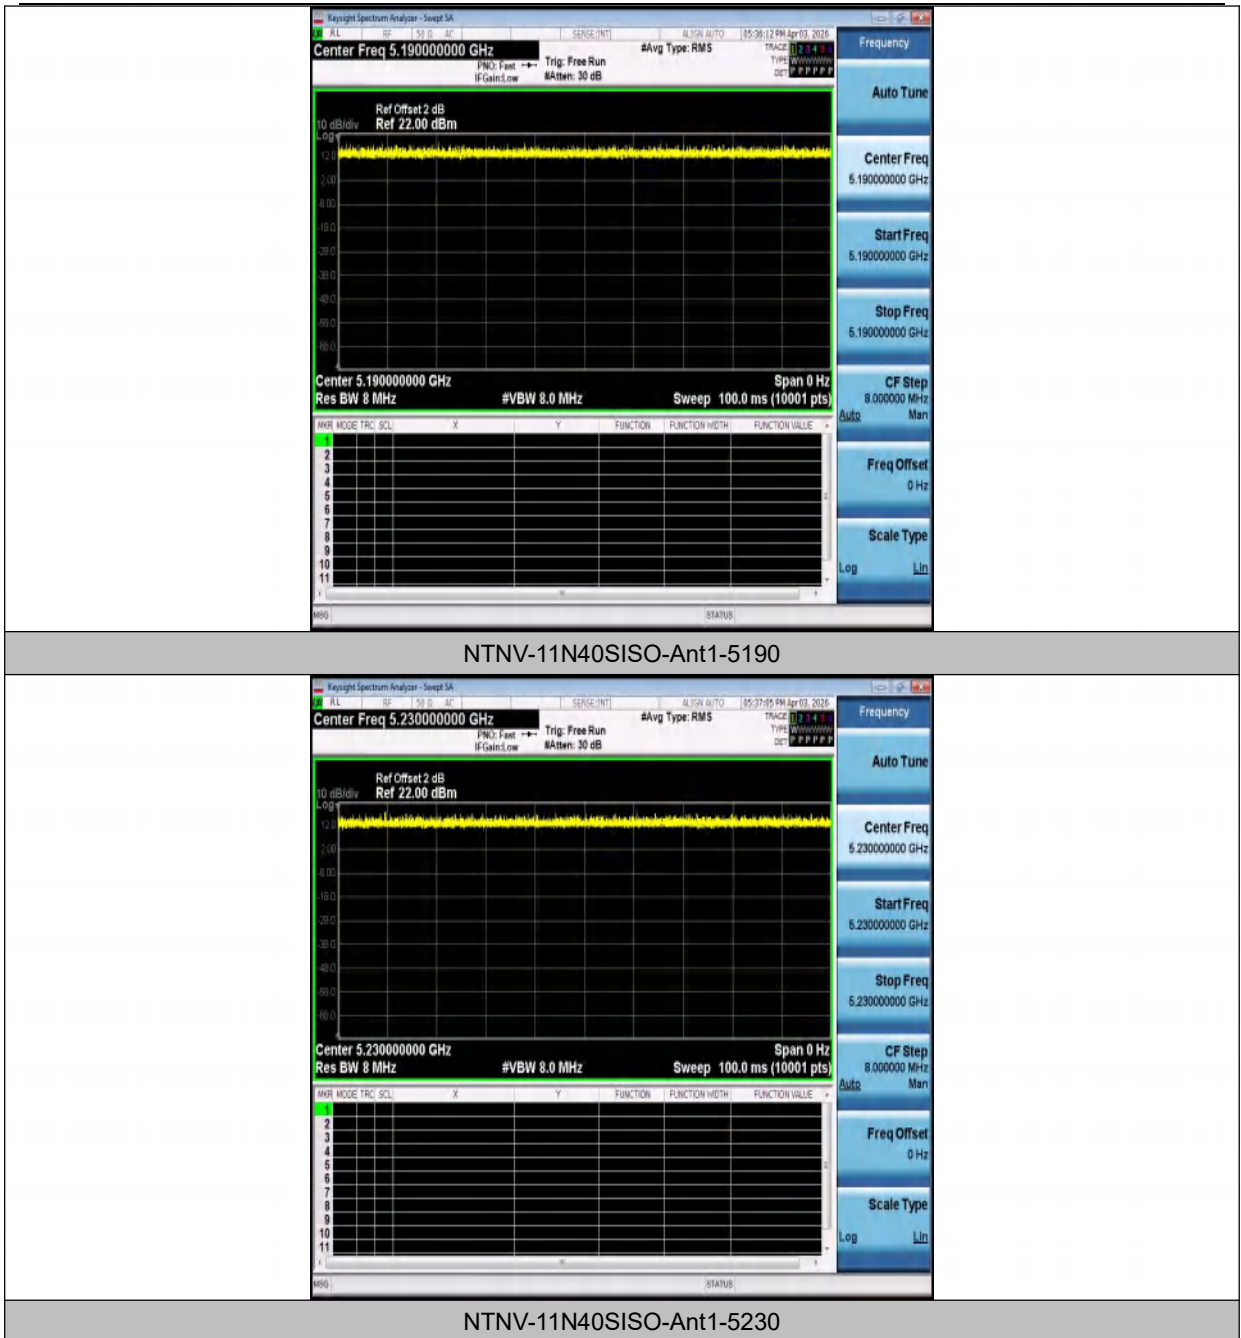

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

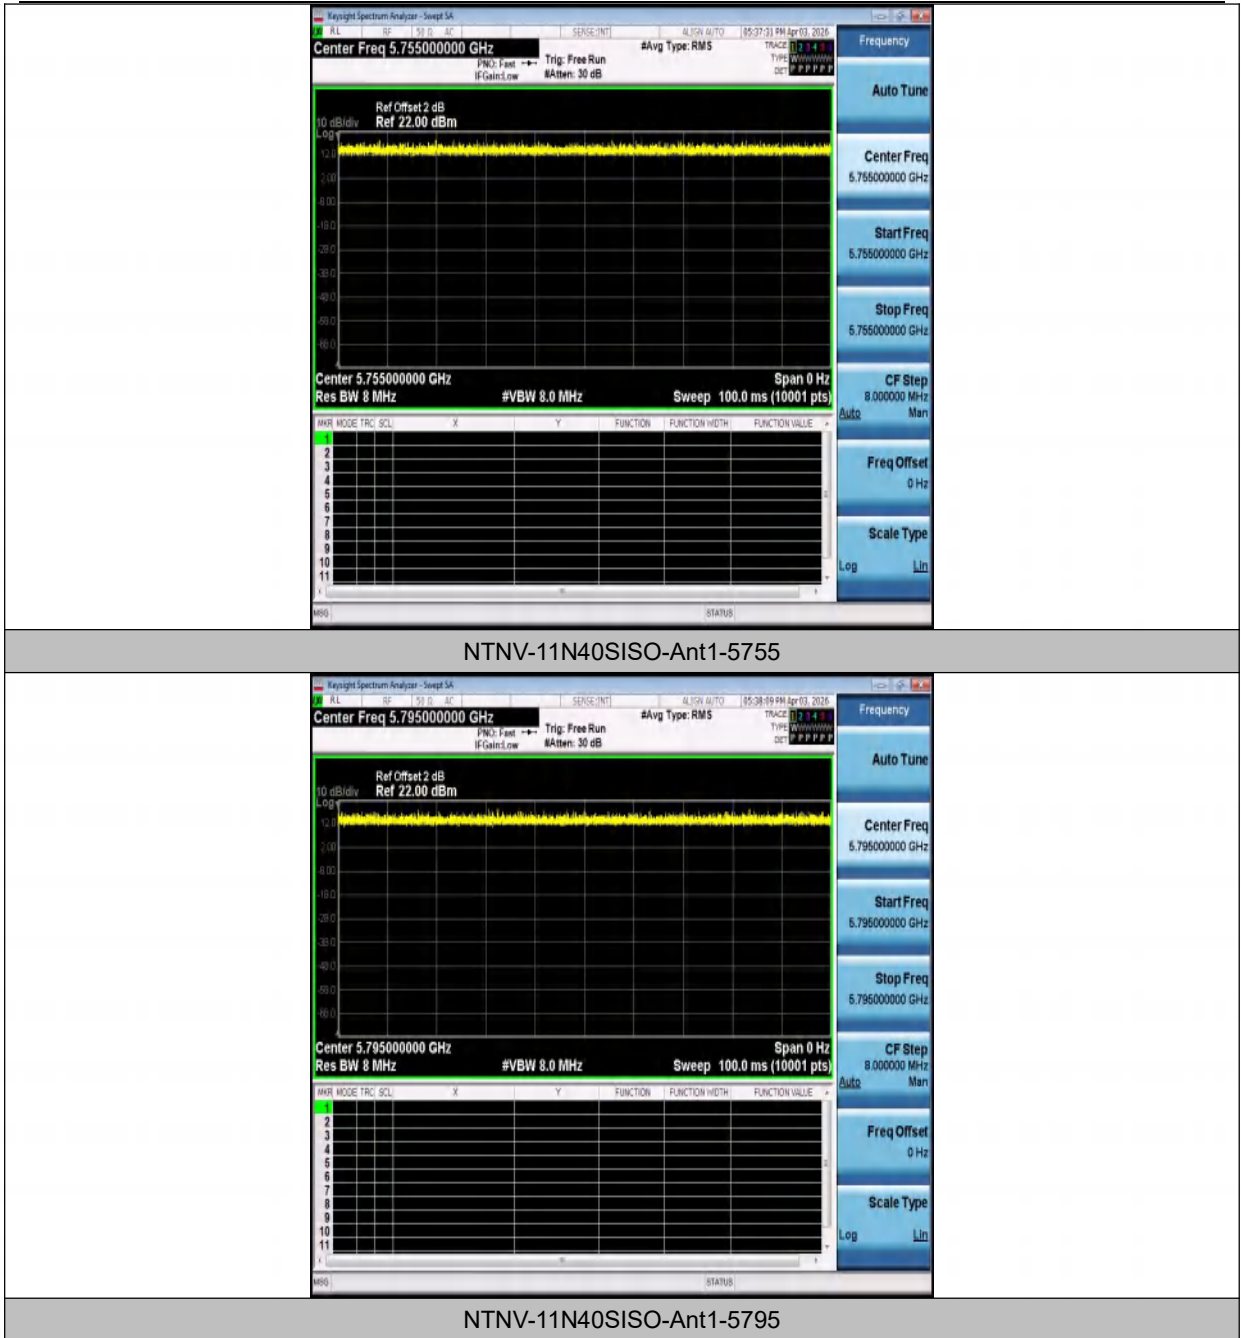

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	13.55	≤23.98	PASS
11A	Ant1	5220	13.22	≤23.98	PASS
11A	Ant1	5240	12.90	≤23.98	PASS
11A	Ant1	5745	13.73	≤30.00	PASS
11A	Ant1	5785	13.58	≤30.00	PASS
11A	Ant1	5825	13.47	≤30.00	PASS
11N20SISO	Ant1	5180	13.61	≤23.98	PASS
11N20SISO	Ant1	5220	13.10	≤23.98	PASS
11N20SISO	Ant1	5240	12.83	≤23.98	PASS
11N20SISO	Ant1	5745	13.69	≤30.00	PASS
11N20SISO	Ant1	5785	13.40	≤30.00	PASS
11N20SISO	Ant1	5825	13.46	≤30.00	PASS
11N40SISO	Ant1	5190	13.28	≤23.98	PASS
11N40SISO	Ant1	5230	12.69	≤23.98	PASS
11N40SISO	Ant1	5755	13.89	≤30.00	PASS
11N40SISO	Ant1	5795	13.49	≤30.00	PASS

Note: The cable loss are compensated in the graph.


Test Graphs Channel Power

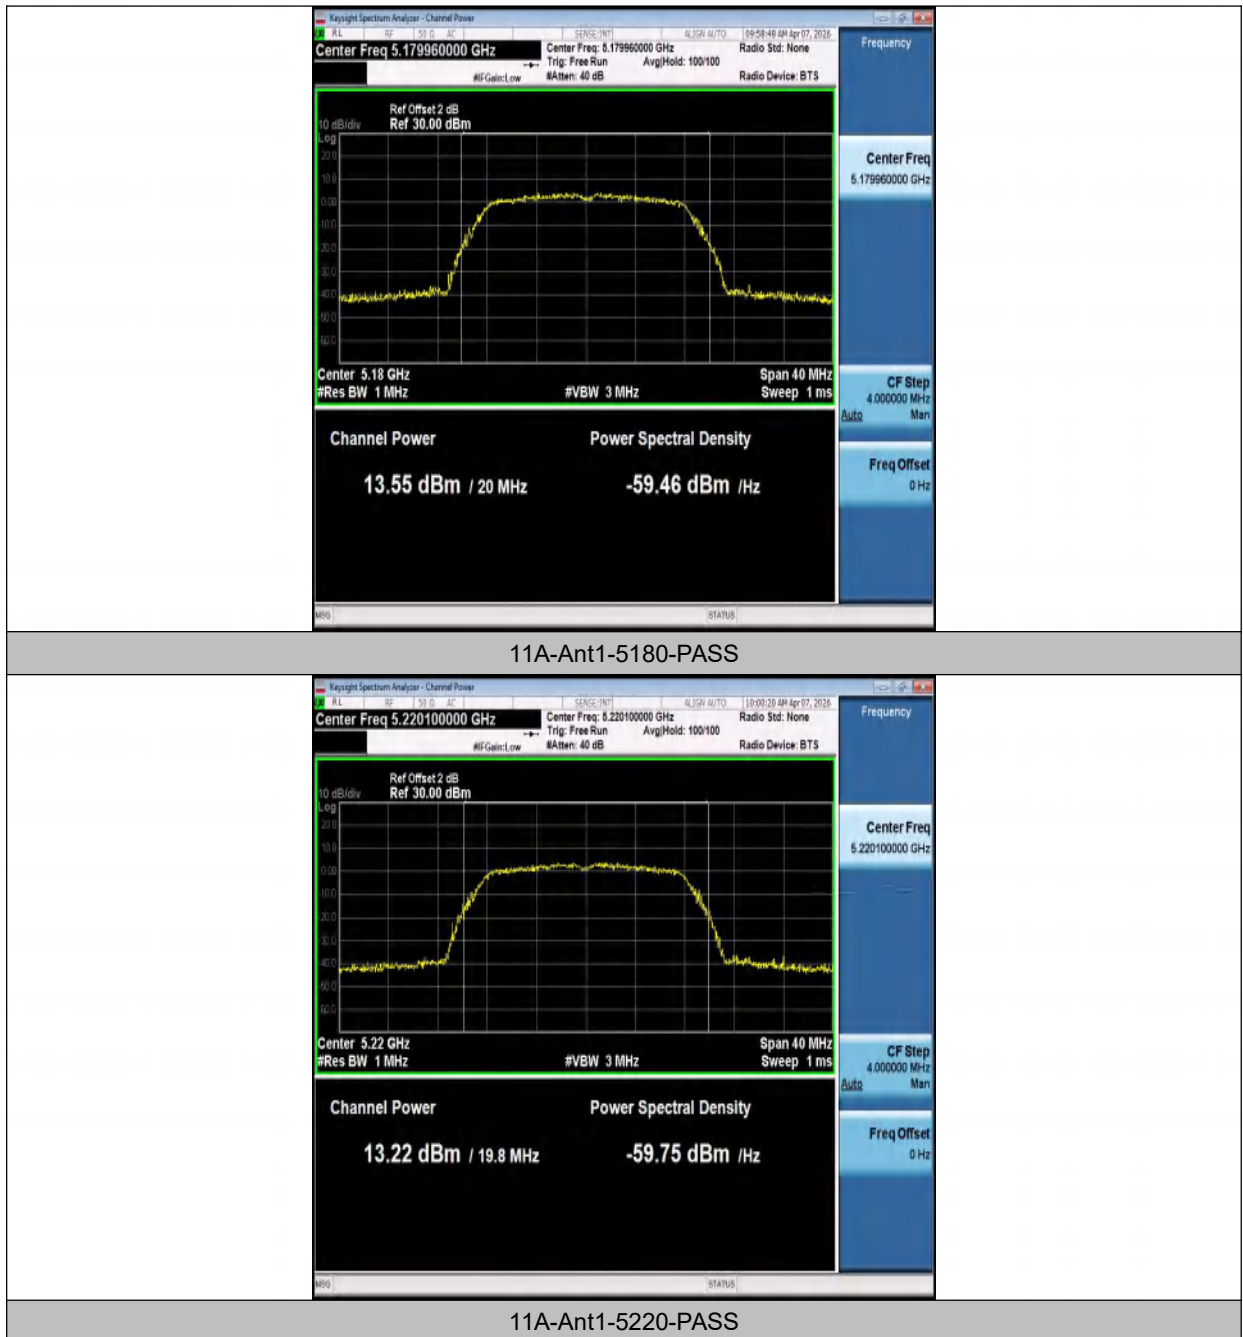

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

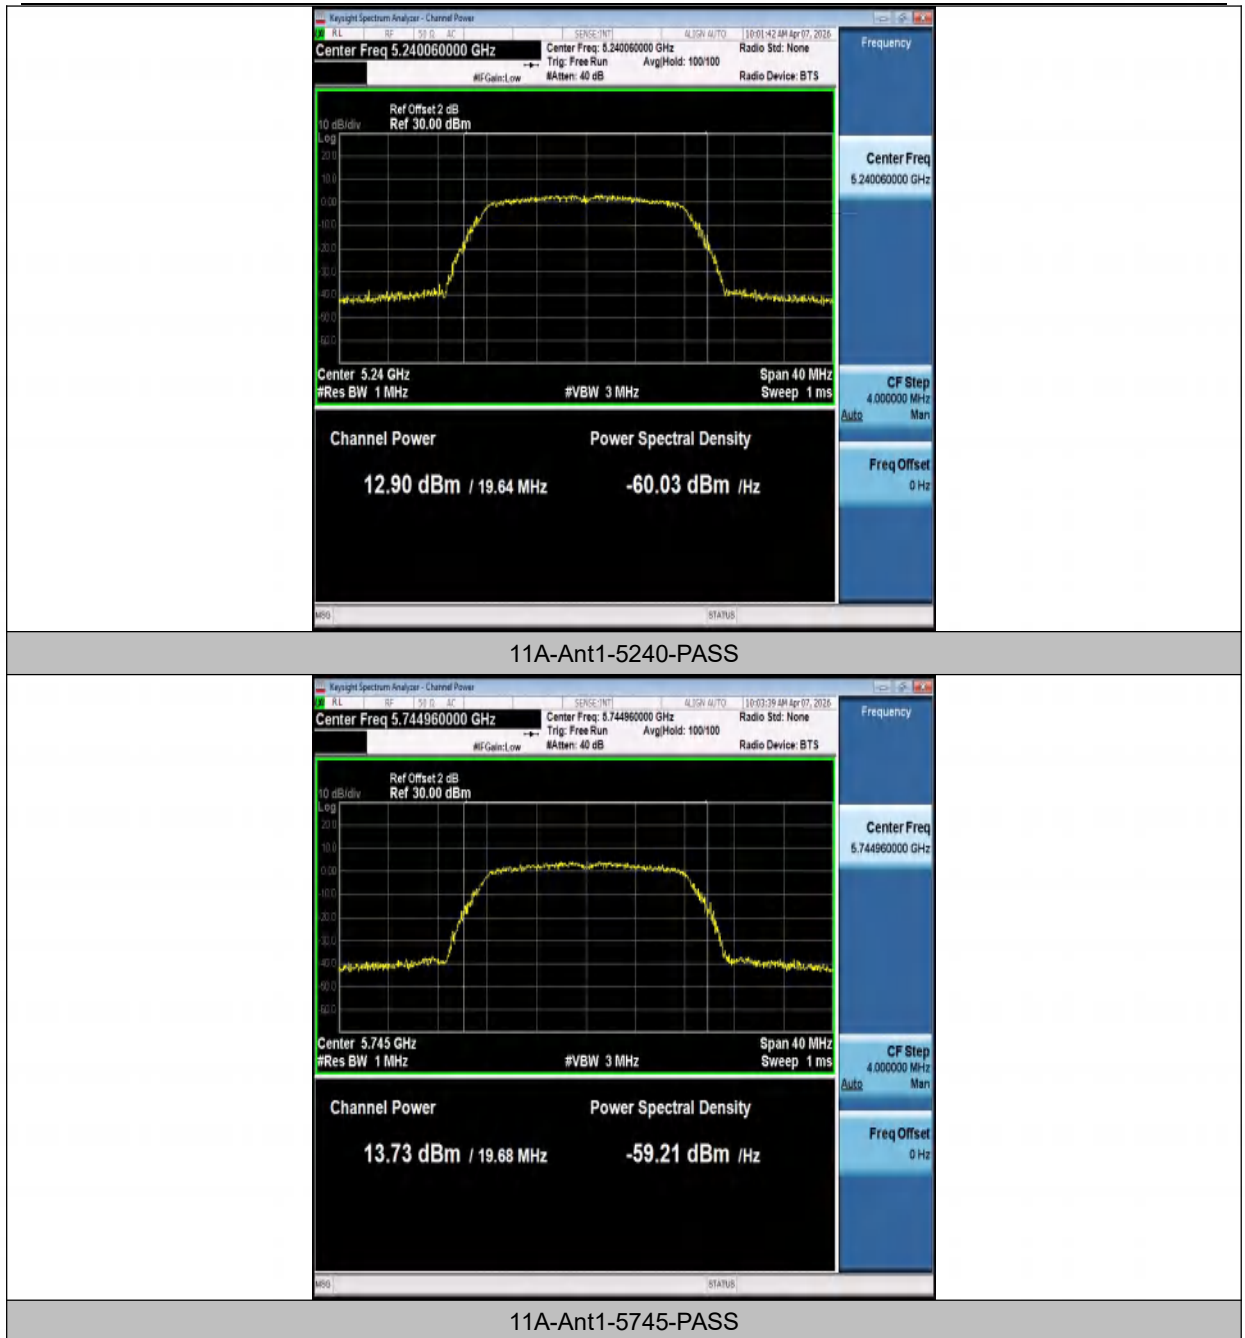

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

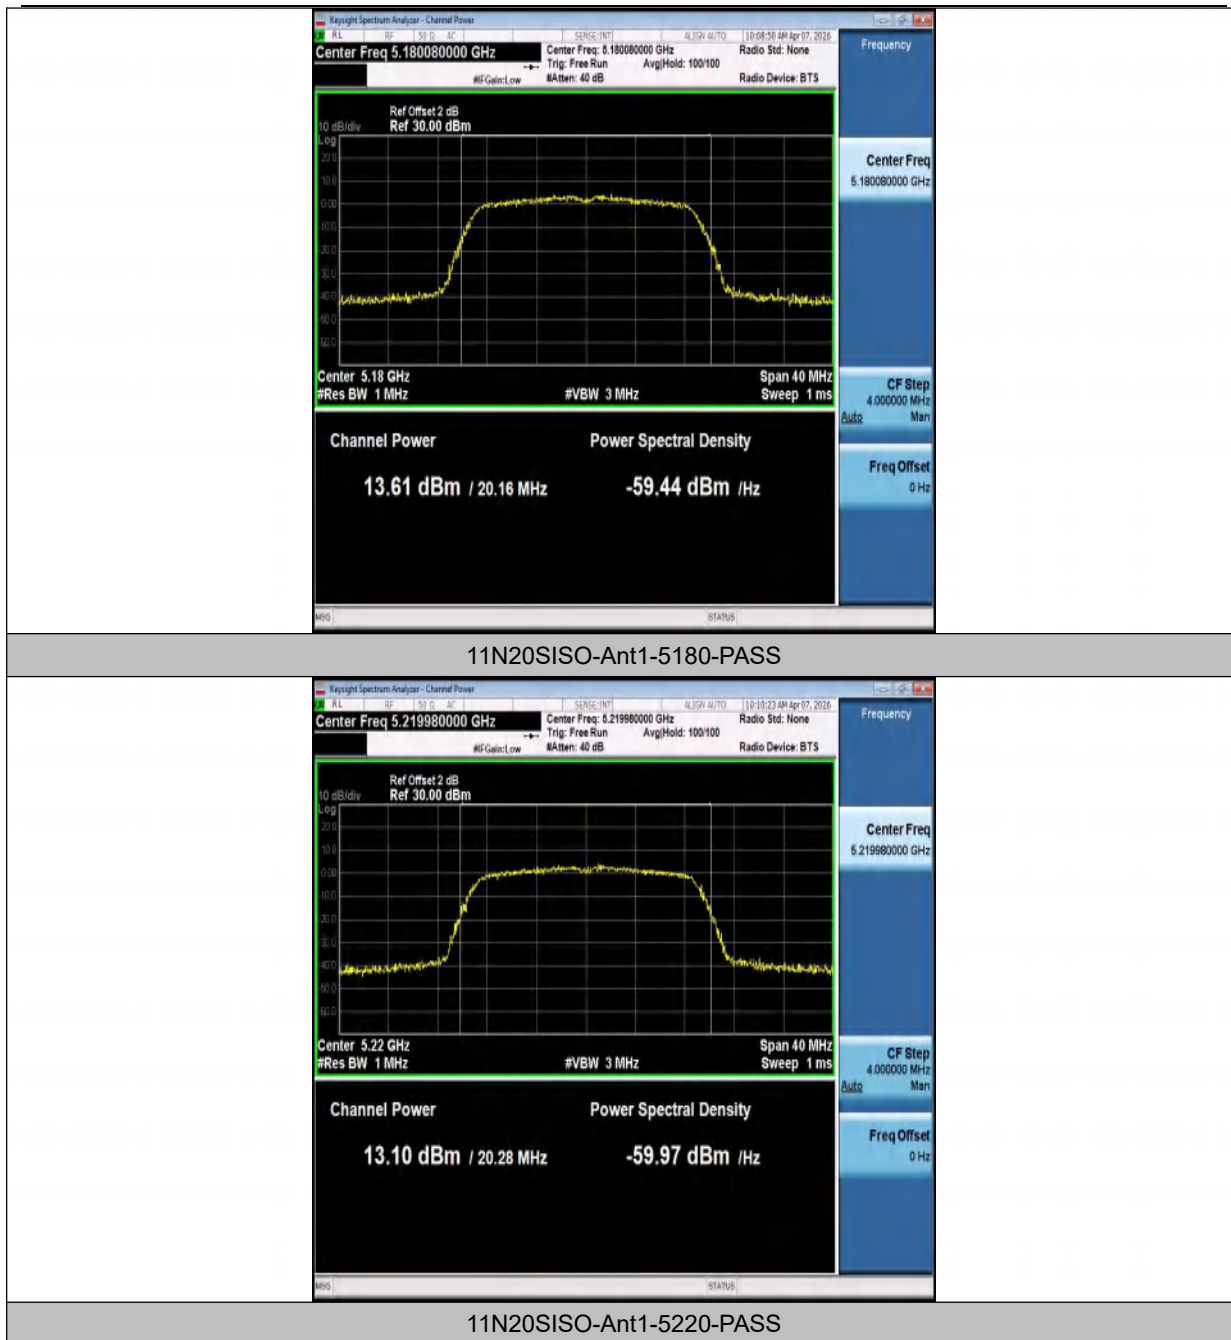

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

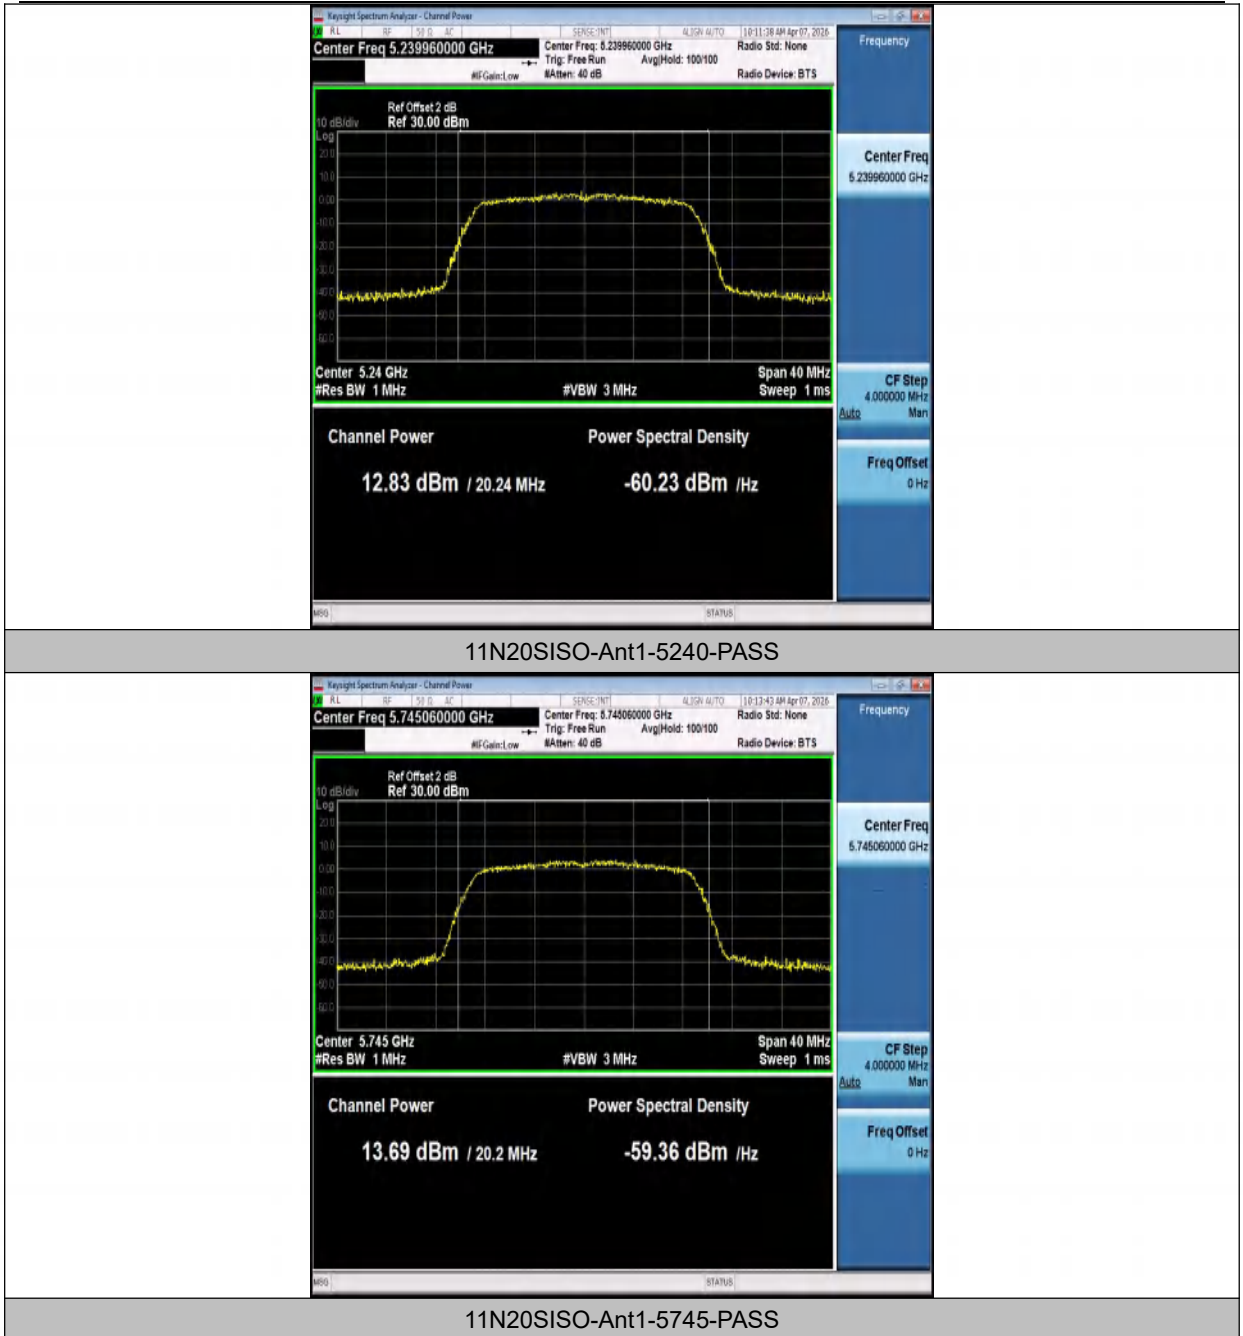

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

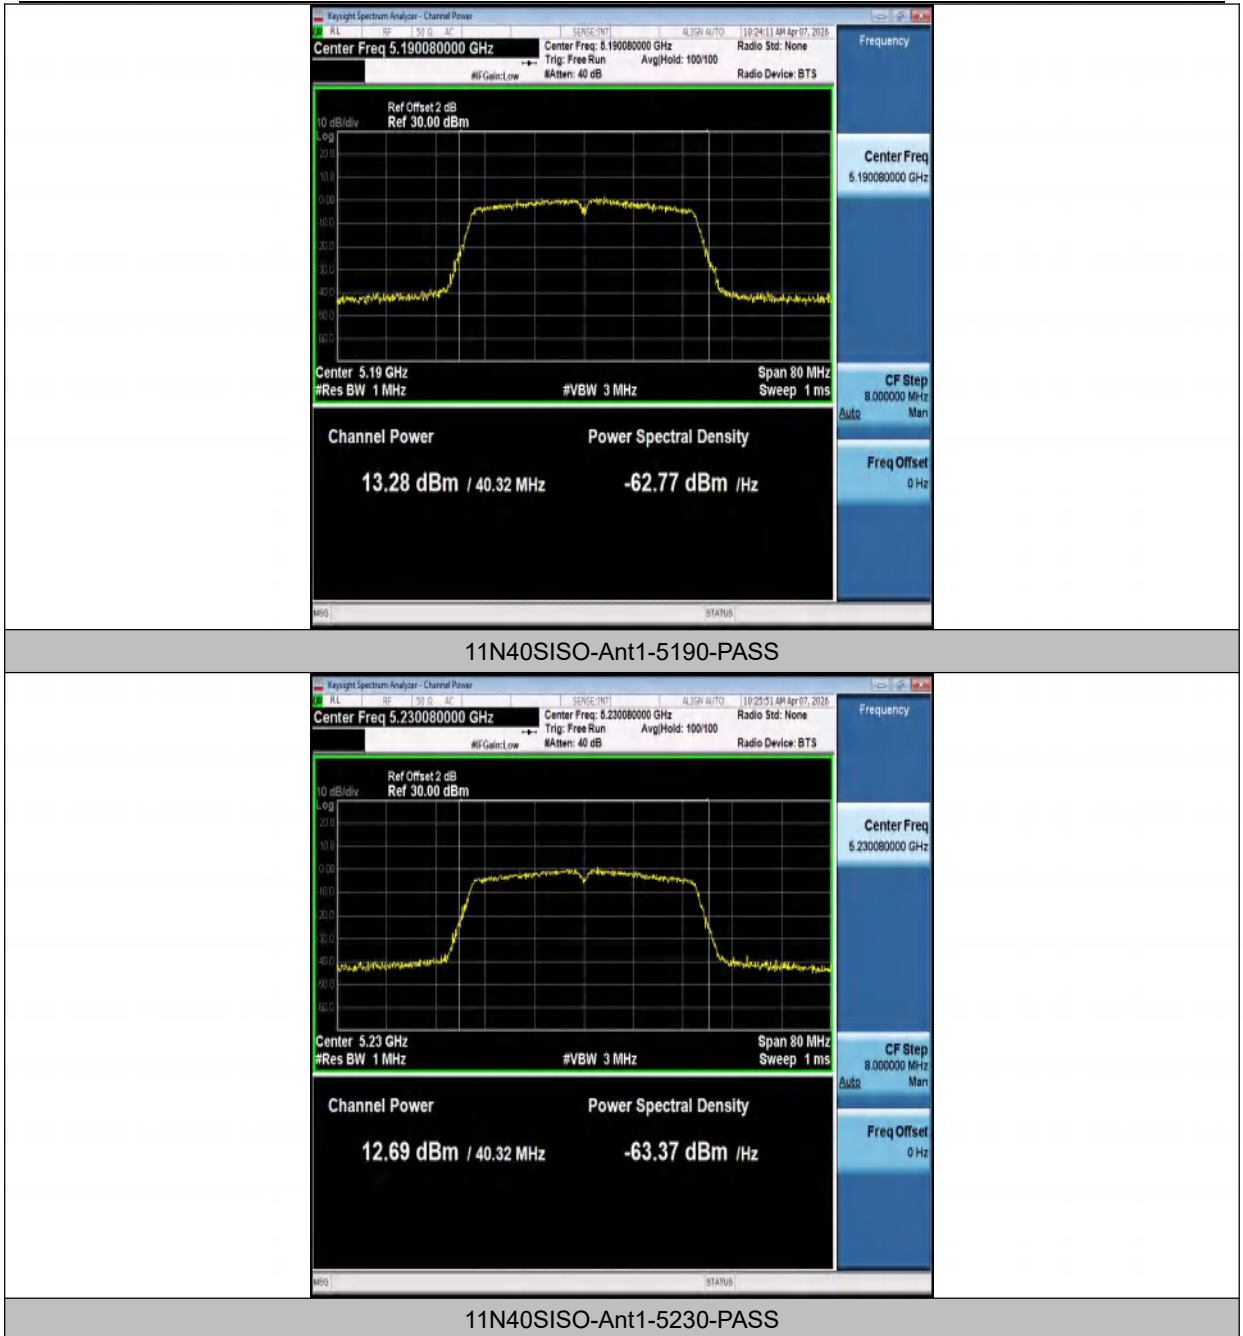

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

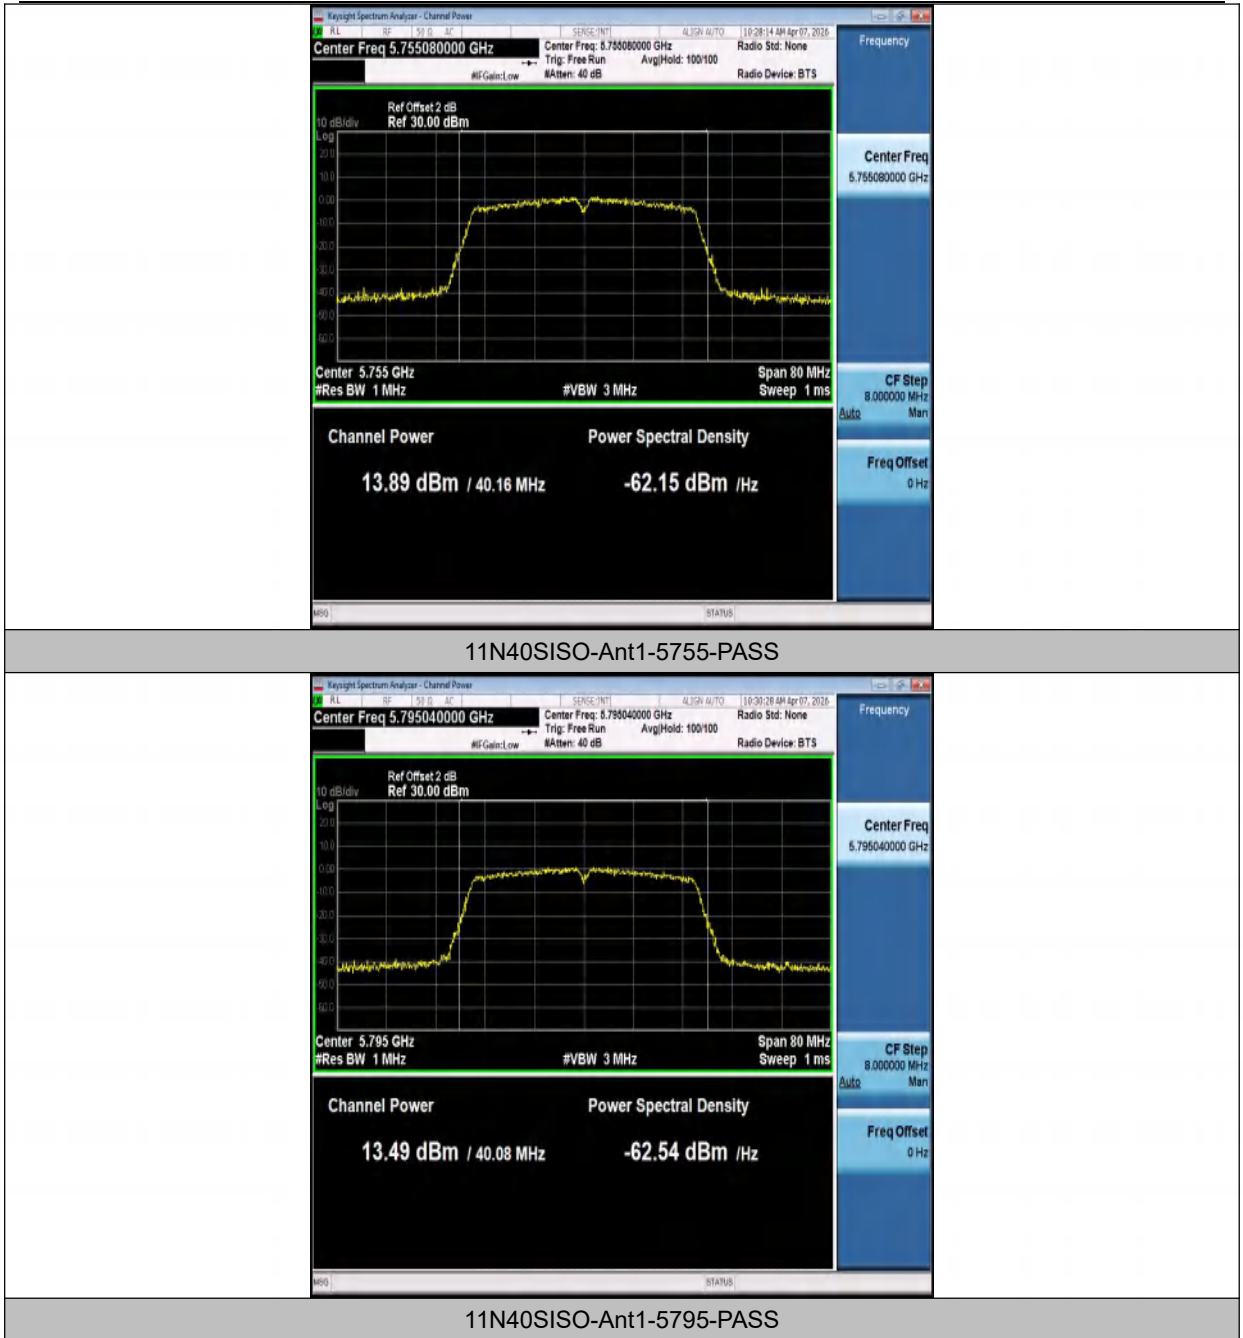

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-1.05	≤11.00	PASS
11A	Ant1	5220	-1.57	≤11.00	PASS
11A	Ant1	5240	-1.76	≤11.00	PASS
11N20SISO	Ant1	5180	-1.19	≤11.00	PASS
11N20SISO	Ant1	5220	-1.69	≤11.00	PASS
11N20SISO	Ant1	5240	-2.05	≤11.00	PASS
11N40SISO	Ant1	5190	-4.49	≤11.00	PASS
11N40SISO	Ant1	5230	-5.04	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency[MHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-3.85	≤30.00	PASS
11A	Ant1	5785	-3.88	≤30.00	PASS
11A	Ant1	5825	-3.77	≤30.00	PASS
11N20SISO	Ant1	5745	-3.88	≤30.00	PASS
11N20SISO	Ant1	5785	-4.31	≤30.00	PASS
11N20SISO	Ant1	5825	-4.33	≤30.00	PASS
11N40SISO	Ant1	5755	-6.97	≤30.00	PASS
11N40SISO	Ant1	5795	-7.40	≤30.00	PASS

Note:

- 1.The cable loss and RBW Factor are compensated in the graph.
2. RBW Factor= $10 \cdot \log(500/300) = 2.22\text{dB}$
3. Offset=cable loss(2dB) + RBW Factor


Test Graphs B1

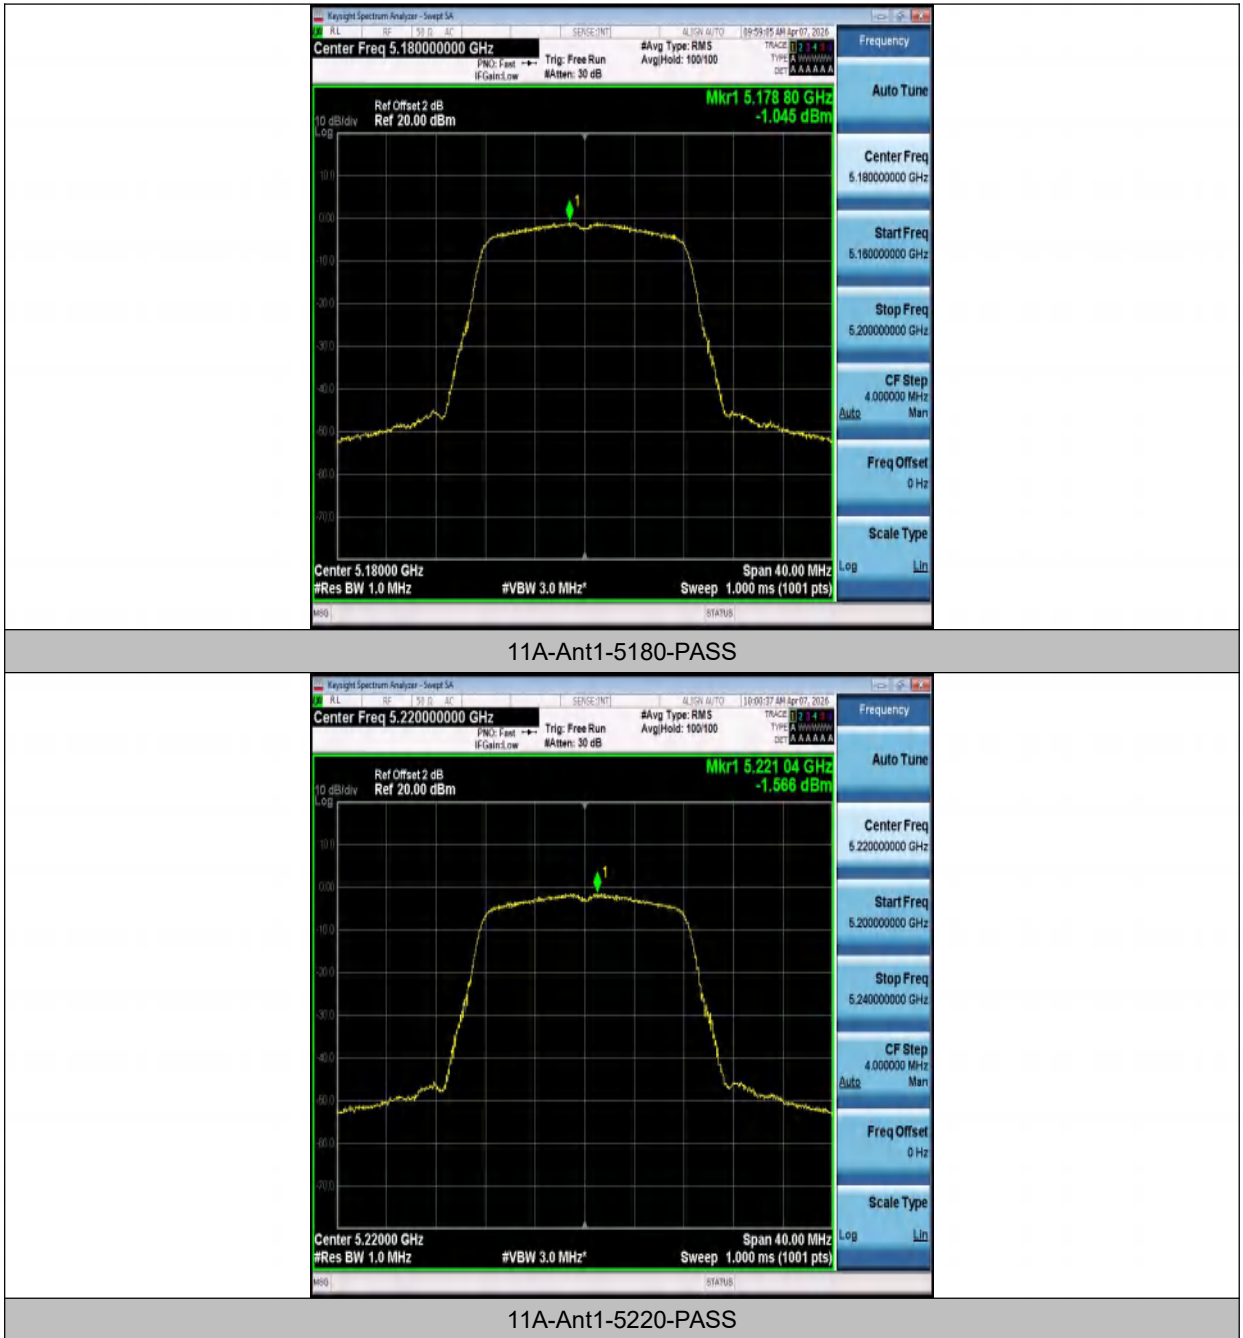

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

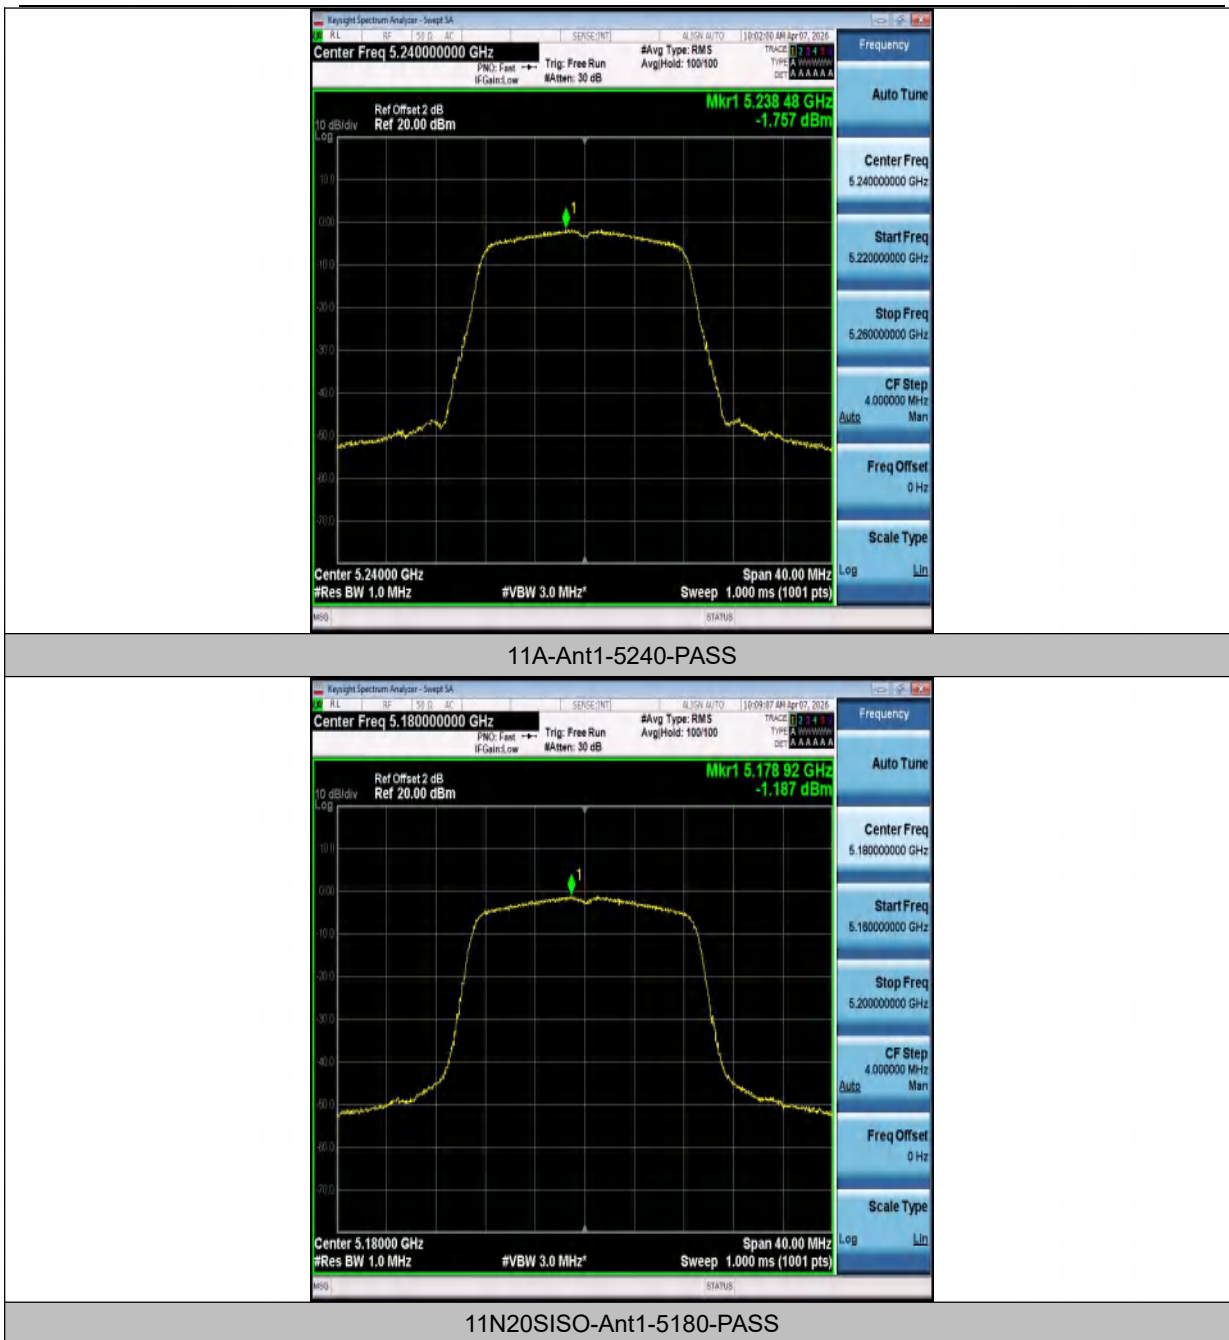

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

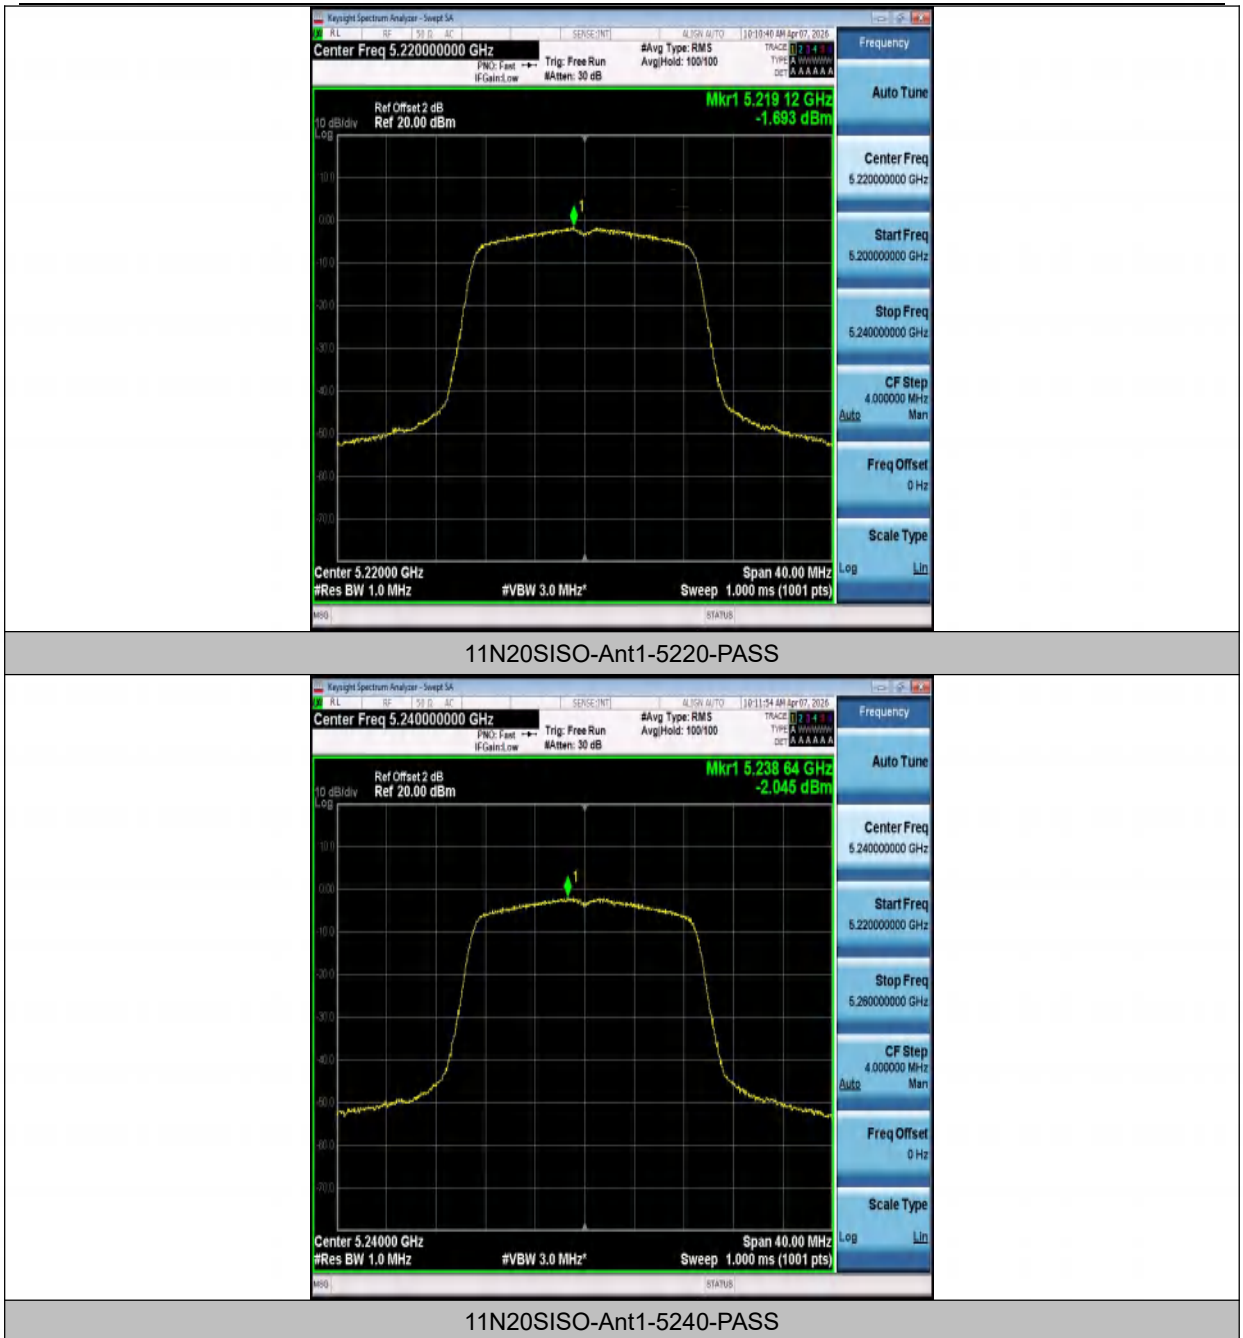

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

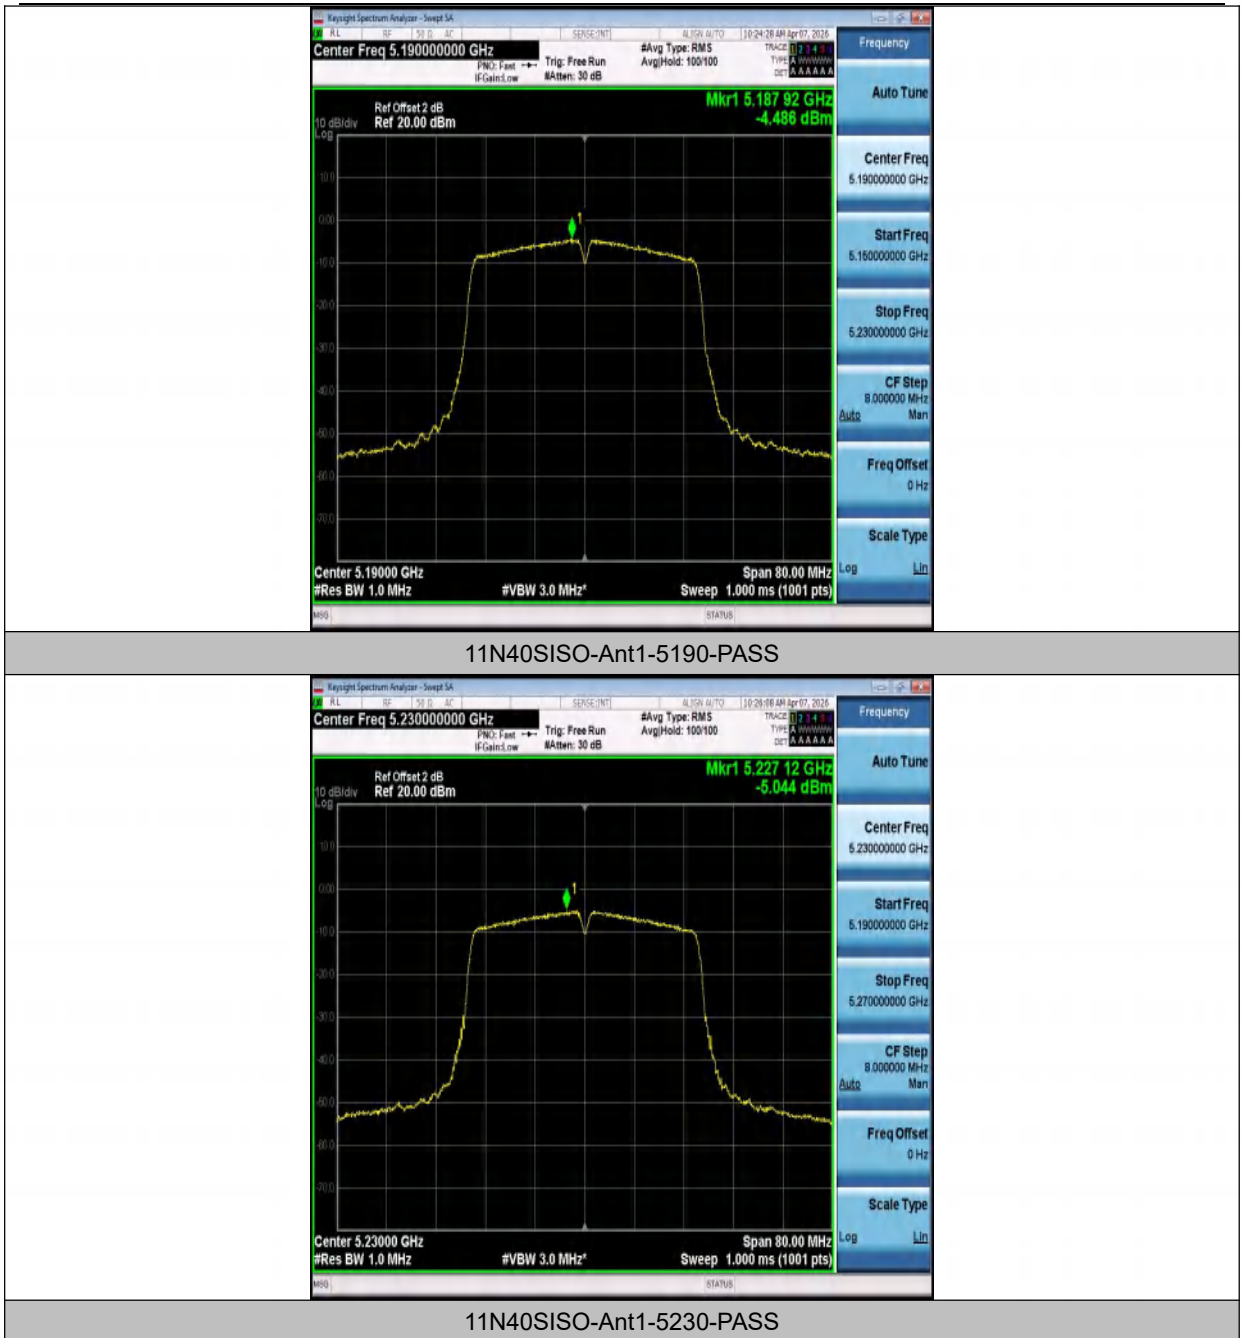


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

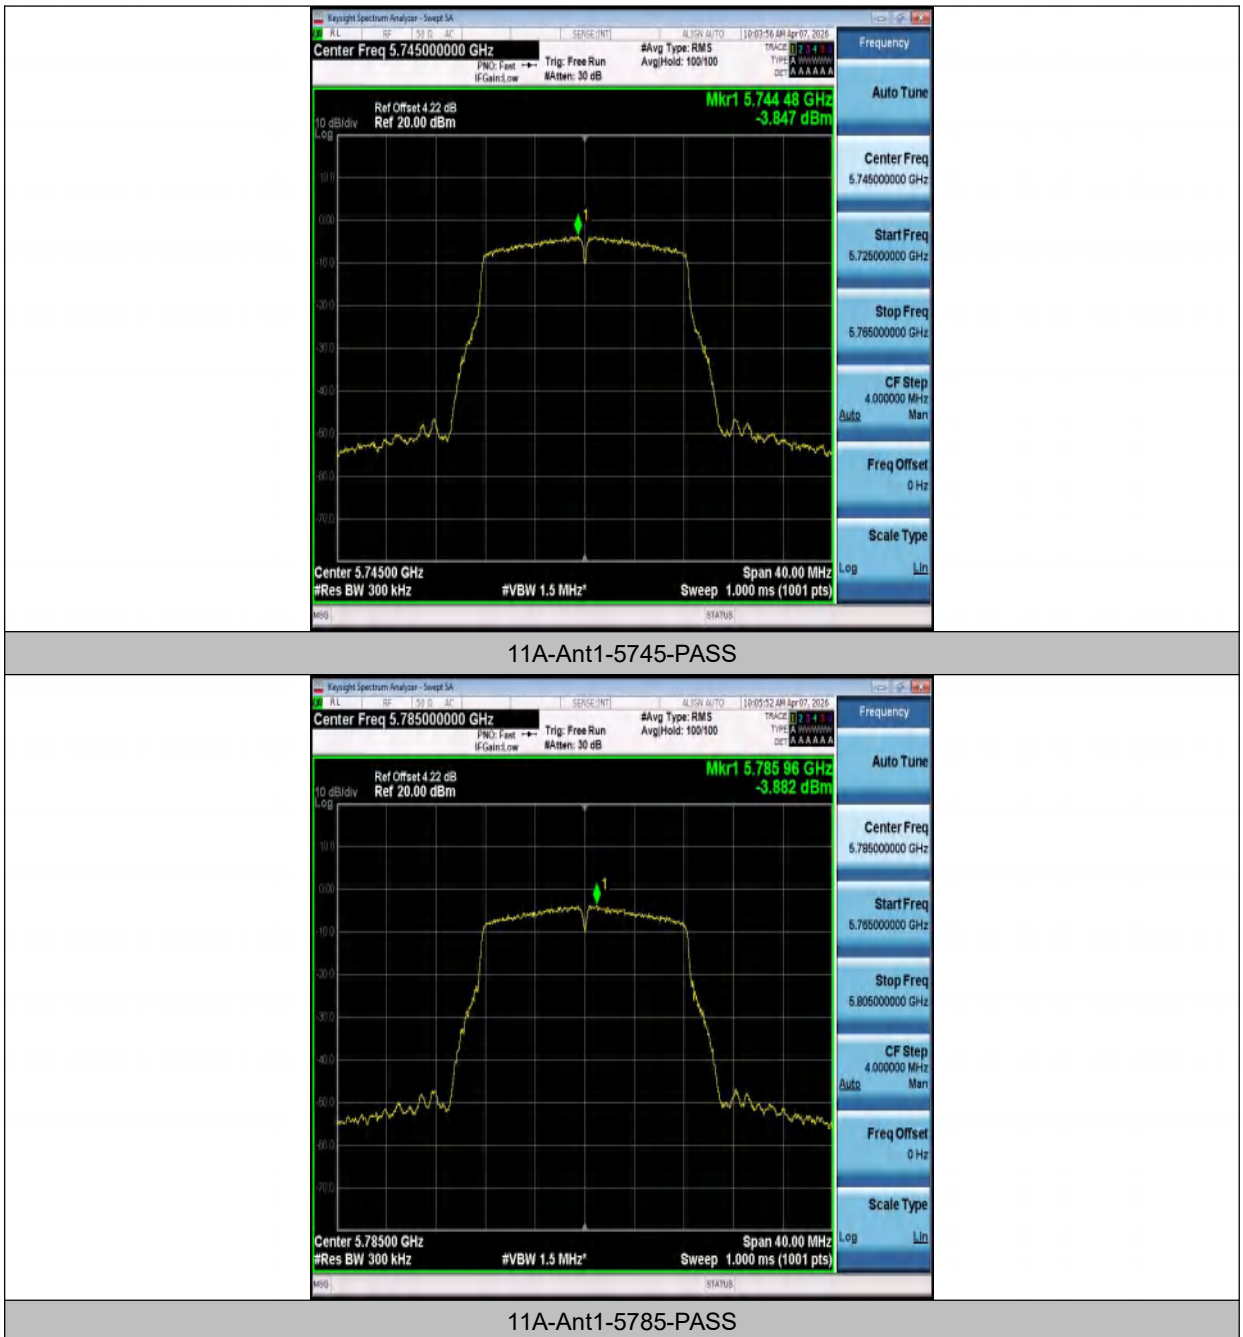

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

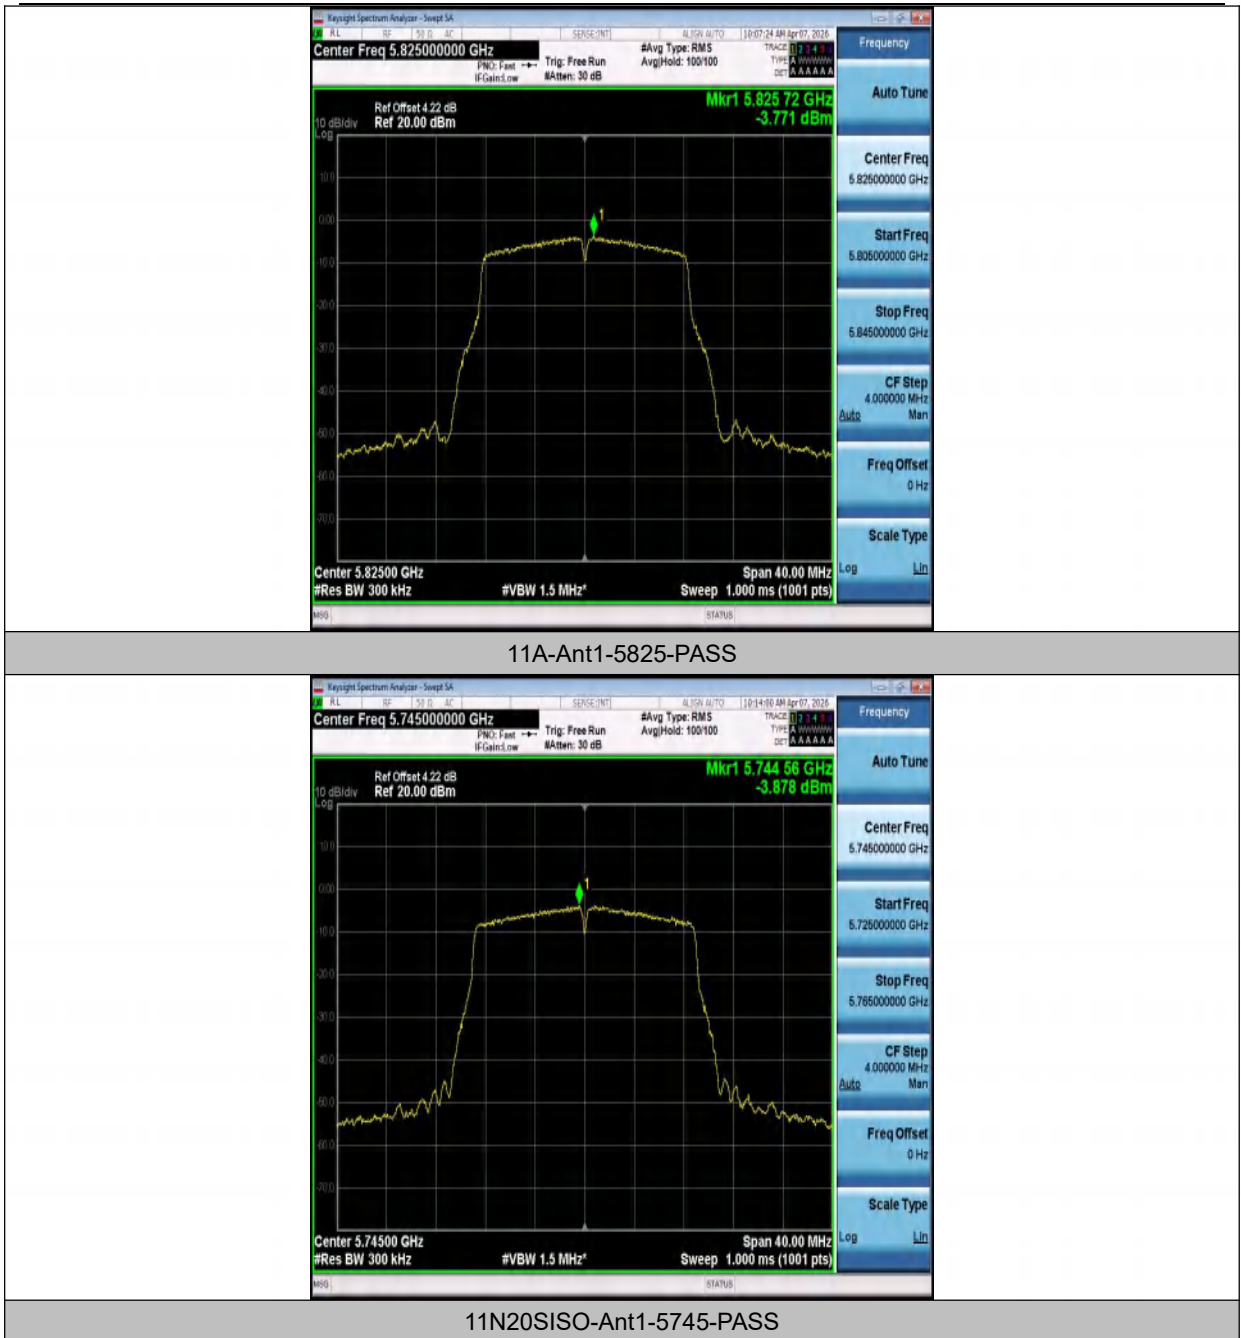

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

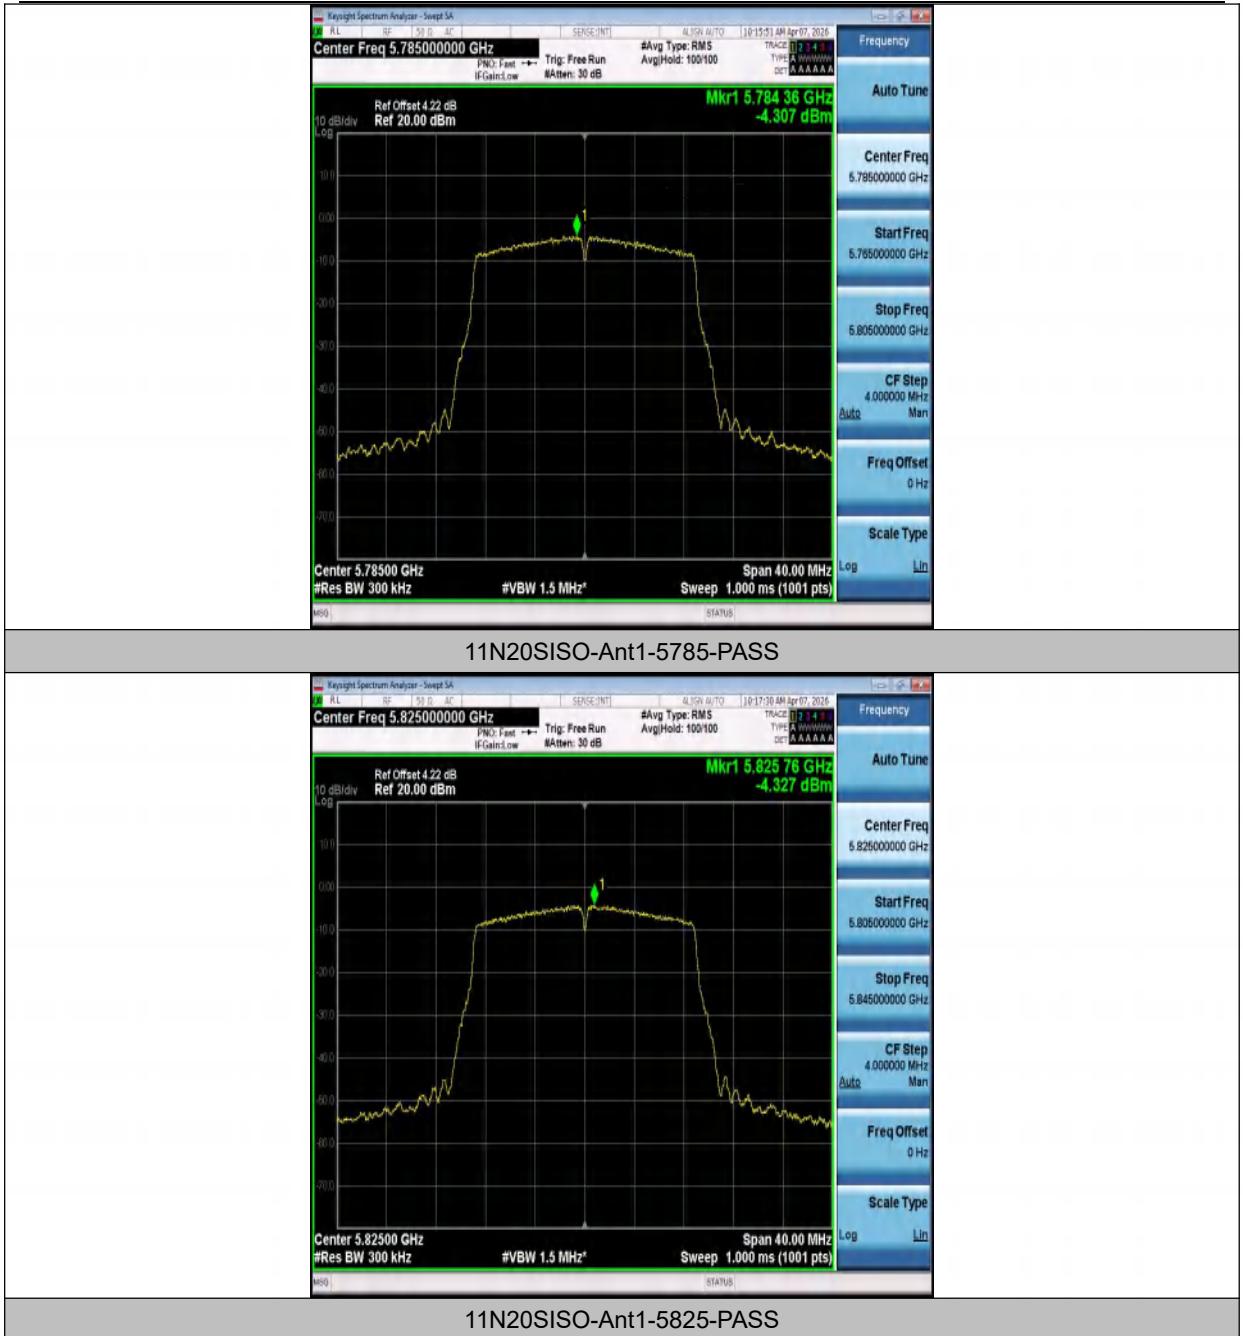

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

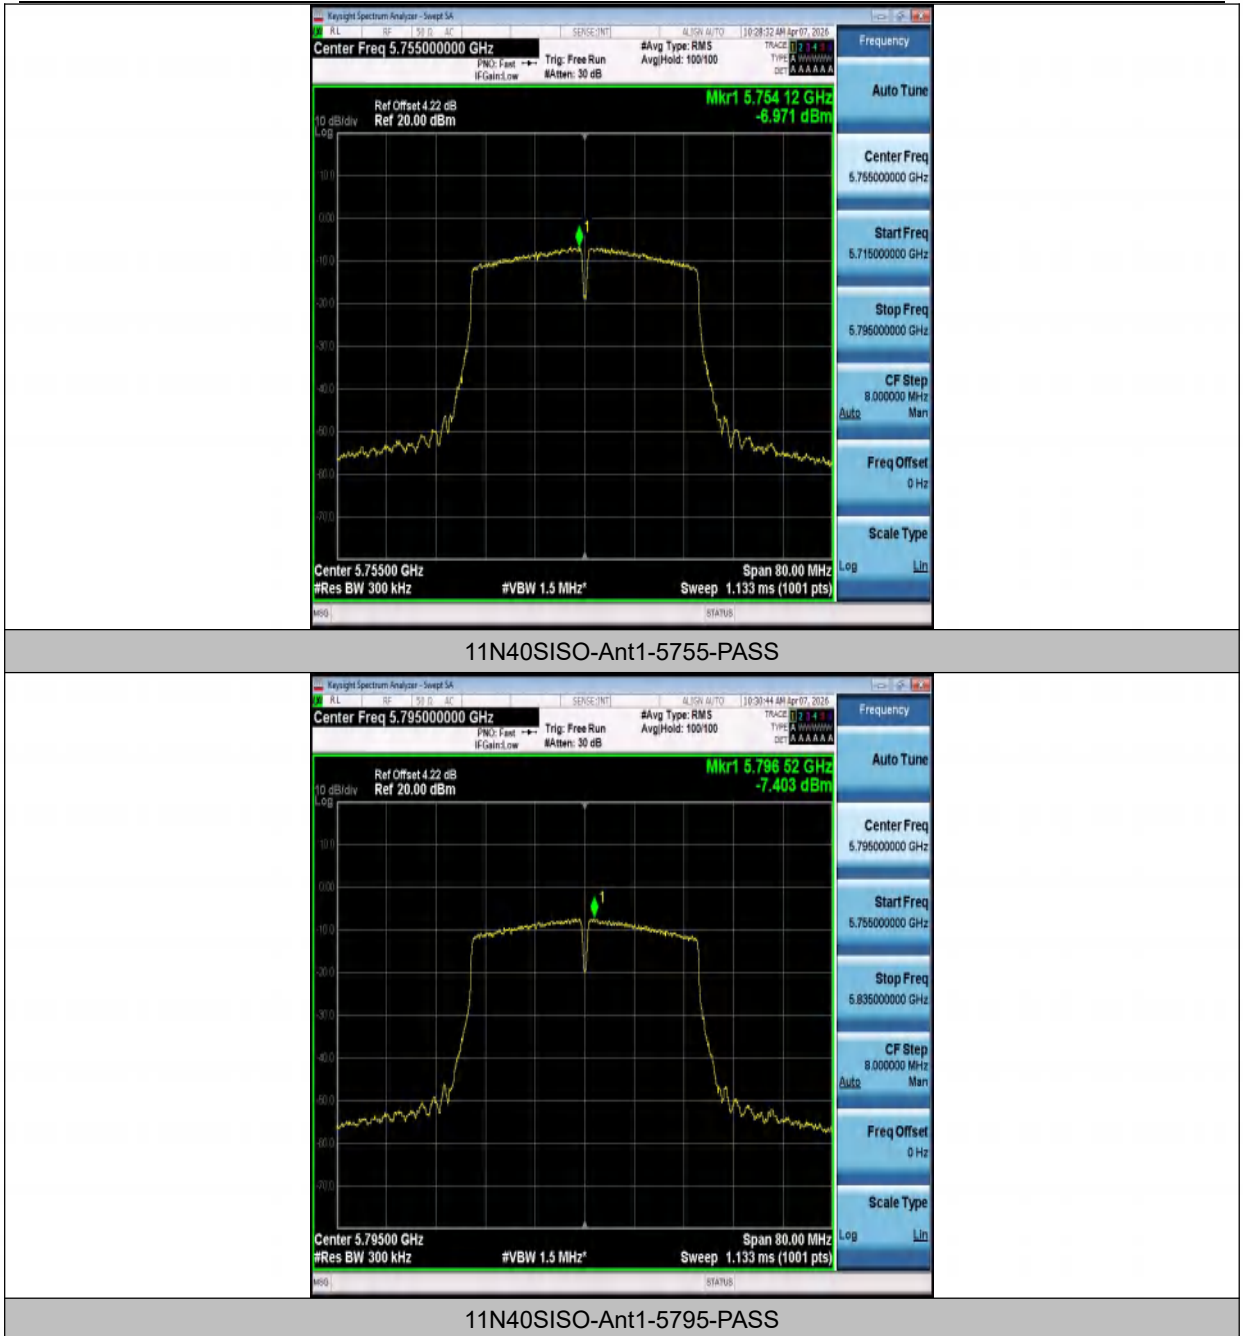

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-43.39	≤-27	PASS
11A	Ant1	High	5240	-45.02	≤-27	PASS
11N20SISO	Ant1	Low	5180	-43.69	≤-27	PASS
11N20SISO	Ant1	High	5240	-45.59	≤-27	PASS
11N40SISO	Ant1	Low	5190	-41.95	≤-27	PASS
11N40SISO	Ant1	High	5230	-45.02	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-40.9	≤16.60	PASS
11A	Ant1	Low	5745	5700~5720	-36.98	≤15.05	PASS
11A	Ant1	Low	5745	5650~5700	-42.59	≤-26.19	PASS
11A	Ant1	Low	5745	5760~5650	-44.61	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-43.94	≤16.65	PASS
11A	Ant1	High	5825	5855~5875	-44.96	≤10.40	PASS
11A	Ant1	High	5825	5875~5925	-45.44	≤-25.91	PASS
11A	Ant1	High	5825	5925~5935	-45.36	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-43.03	≤15.82	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-43.09	≤10.09	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-45.36	≤-26.27	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-45.12	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-42.87	≤16.03	PASS
11N20SISO	Ant1	High	5825	5855~5875	-40.24	≤13.39	PASS
11N20SISO	Ant1	High	5825	5875~5925	-46.4	≤-26.61	PASS
11N20SISO	Ant1	High	5825	5925~5935	-45.73	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-40.48	≤15.74	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-41.85	≤11.50	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-44.99	≤-26.70	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-45.11	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-46.5	≤15.66	PASS
11N40SISO	Ant1	High	5795	5855~5875	-45.43	≤10.16	PASS
11N40SISO	Ant1	High	5795	5875~5925	-45.32	≤-25.36	PASS
11N40SISO	Ant1	High	5795	5925~5935	-45.23	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

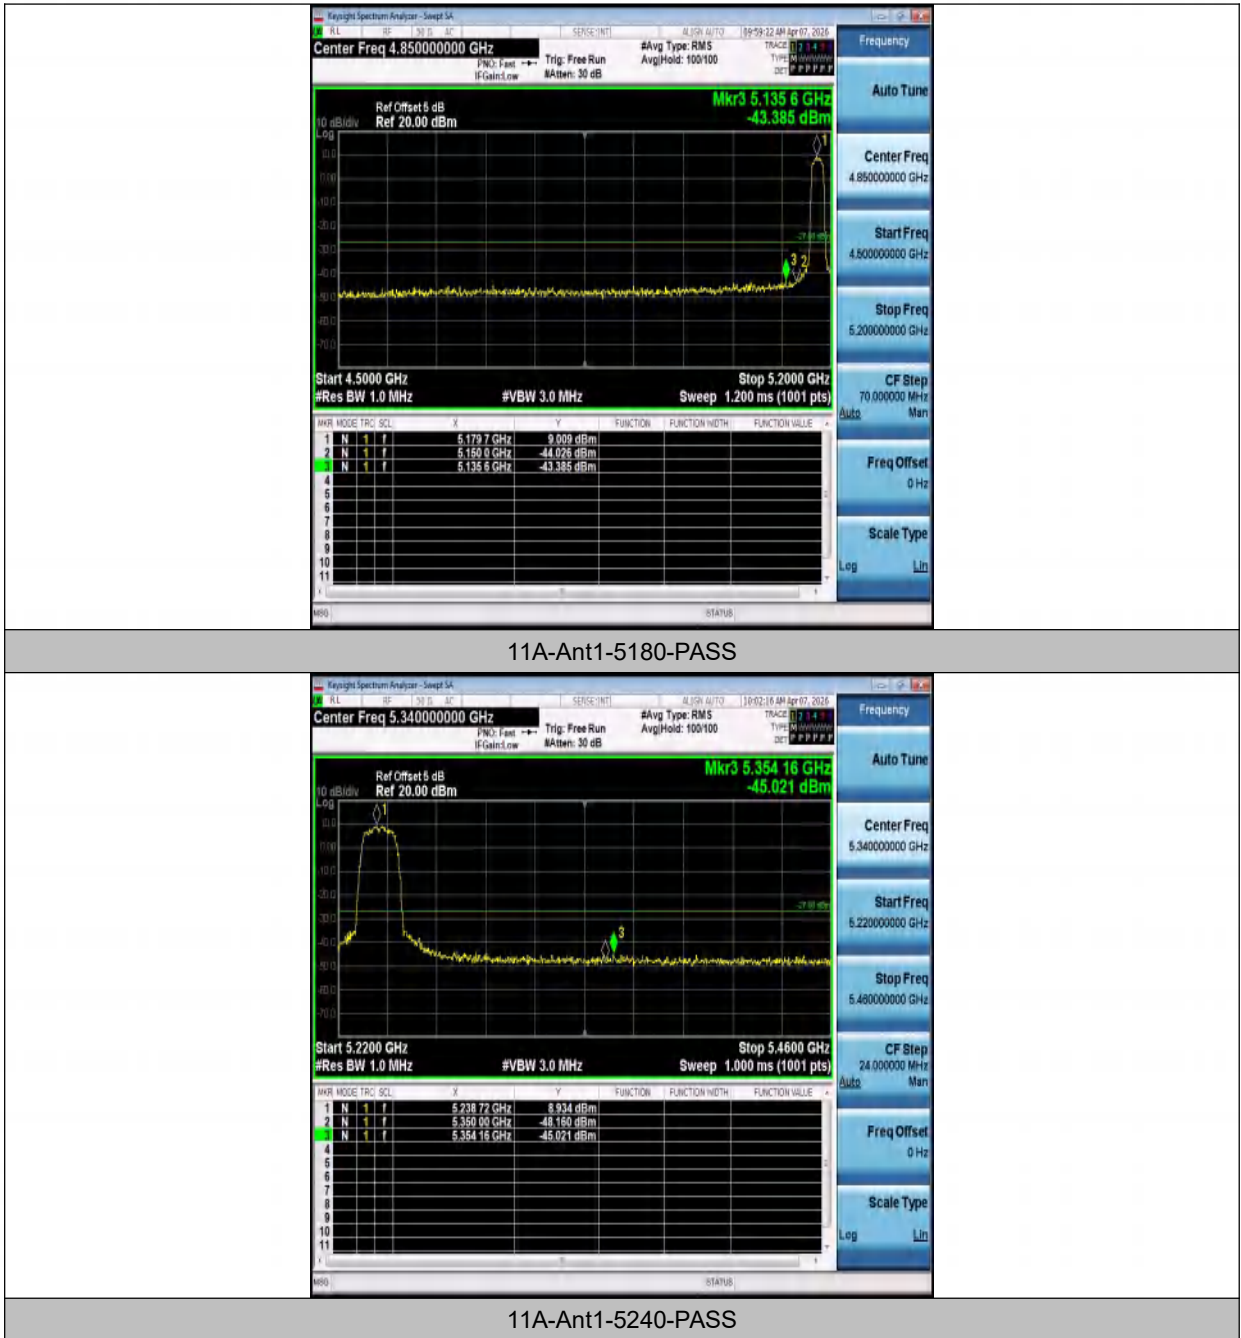


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

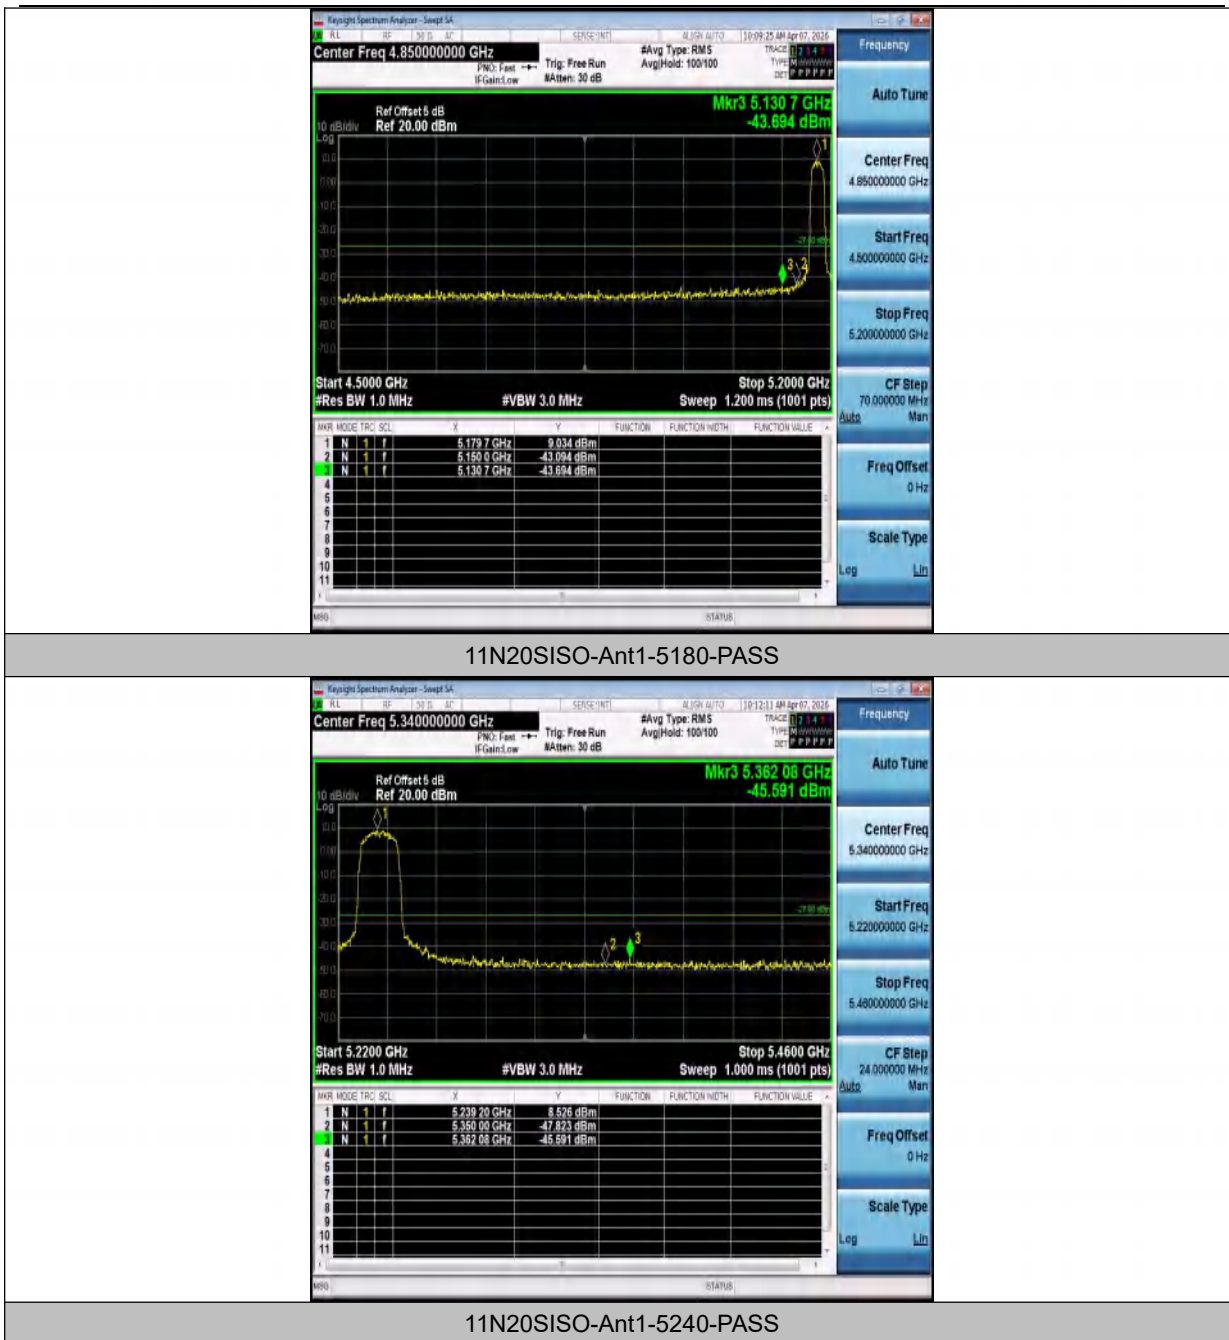

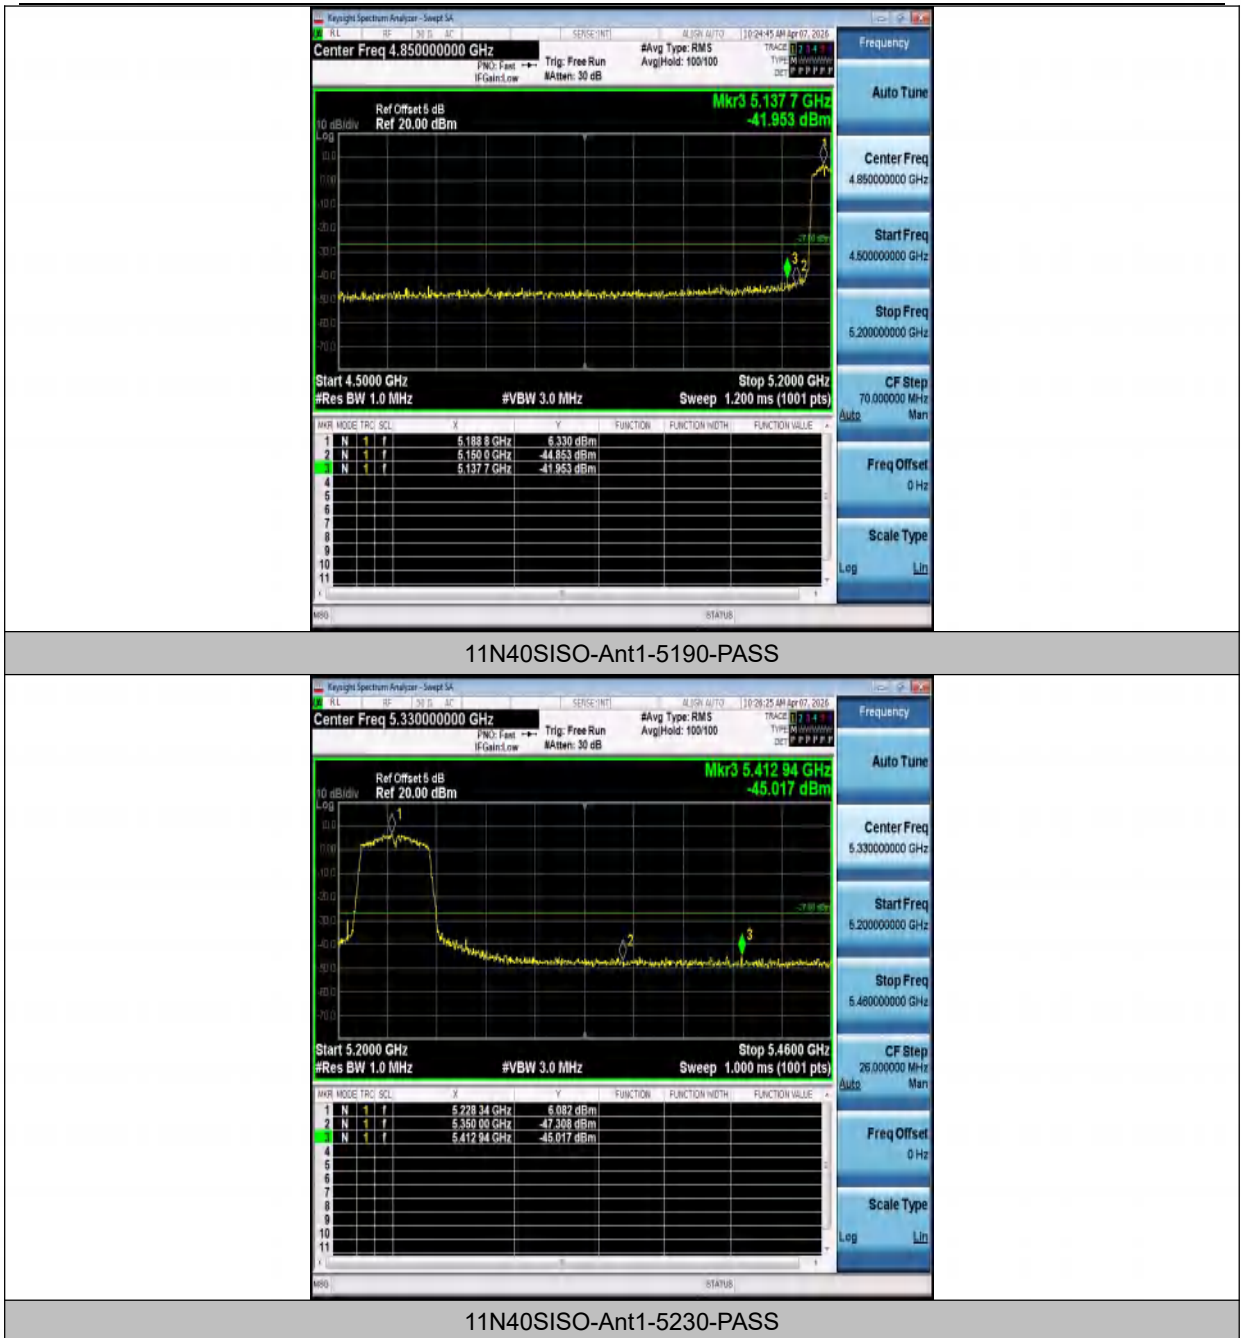

Test Graphs B4



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





---END---