

Appendix Test Data

Report No.:	1812C60076312503-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-28	Finish Test Date:	2026-3-25
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	21.8°C	Relative Humidity:	48%
Pressure:	101kPa		




Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.320	5169.640	5189.960	---	---
11A	Ant1	5220	20.360	5209.640	5230.000	---	---
11A	Ant1	5240	20.640	5229.520	5250.160	---	---
11A	Ant1	5745	20.320	5734.960	5755.280	---	---
11A	Ant1	5785	20.520	5774.600	5795.120	---	---
11A	Ant1	5825	20.240	5815.080	5835.320	---	---
11N20SISO	Ant1	5180	21.400	5169.240	5190.640	---	---
11N20SISO	Ant1	5220	21.280	5209.400	5230.680	---	---
11N20SISO	Ant1	5240	21.160	5229.480	5250.640	---	---
11N20SISO	Ant1	5745	21.160	5734.520	5755.680	---	---
11N20SISO	Ant1	5785	21.360	5774.320	5795.680	---	---
11N20SISO	Ant1	5825	21.240	5814.440	5835.680	---	---
11N40SISO	Ant1	5190	38.800	5170.880	5209.680	---	---
11N40SISO	Ant1	5230	38.560	5210.960	5249.520	---	---
11N40SISO	Ant1	5755	38.720	5735.960	5774.680	---	---
11N40SISO	Ant1	5795	38.560	5775.960	5814.520	---	---


Test Graphs

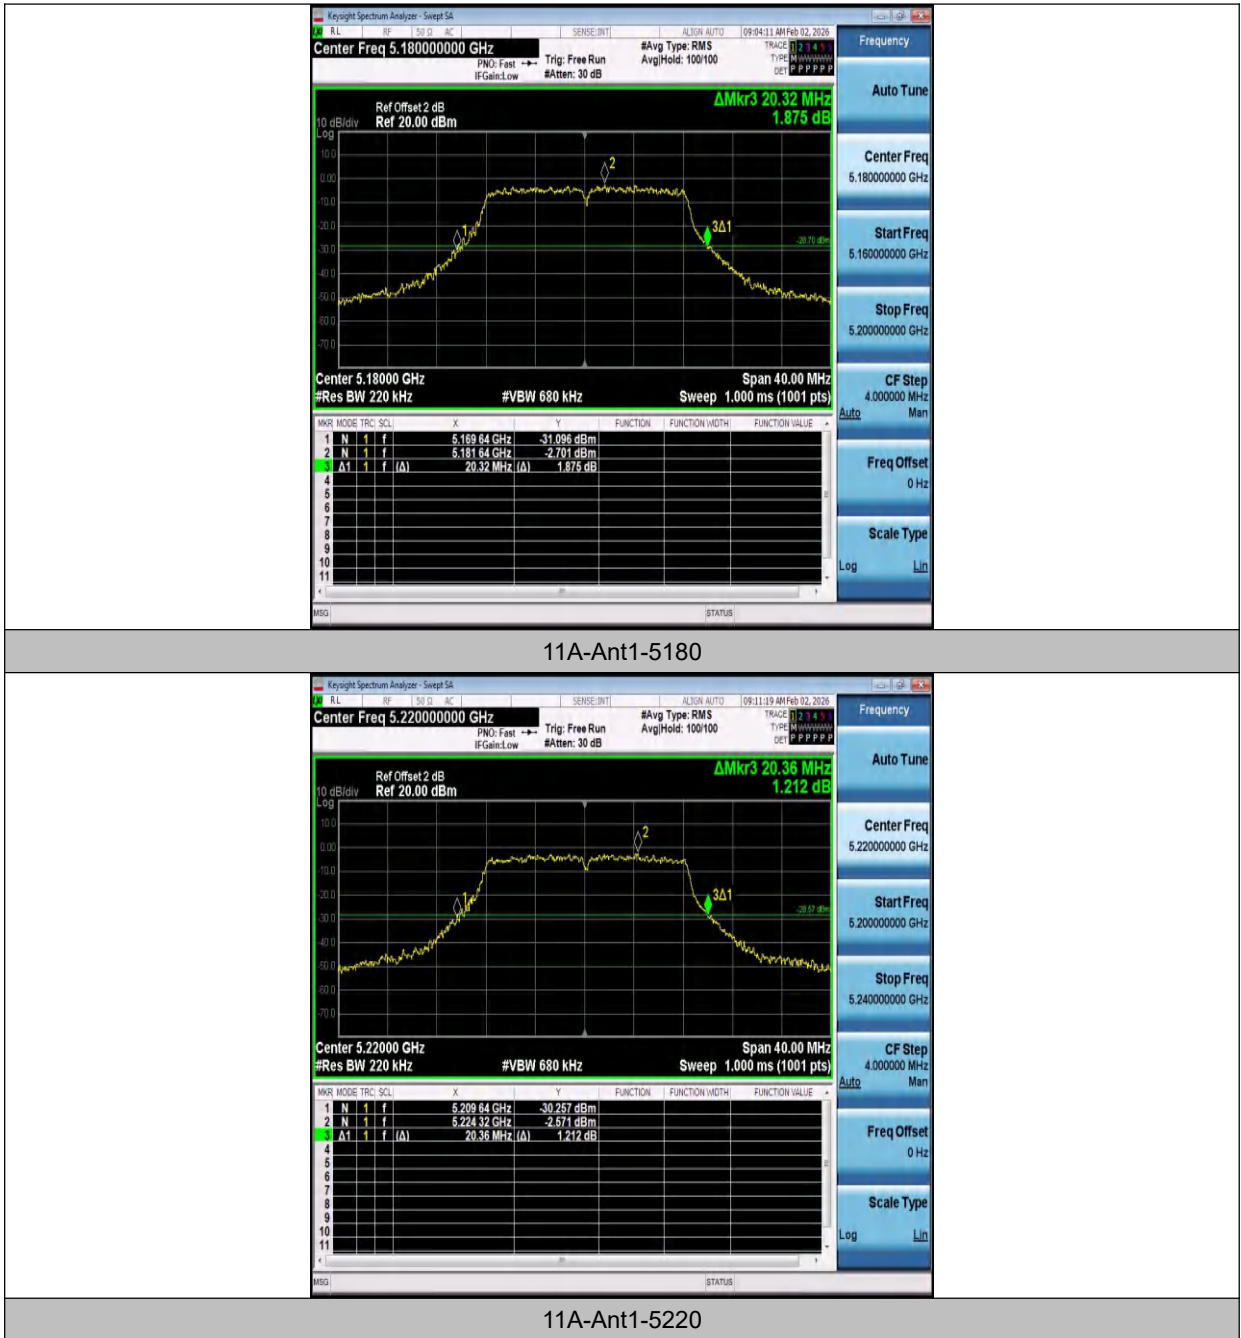


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

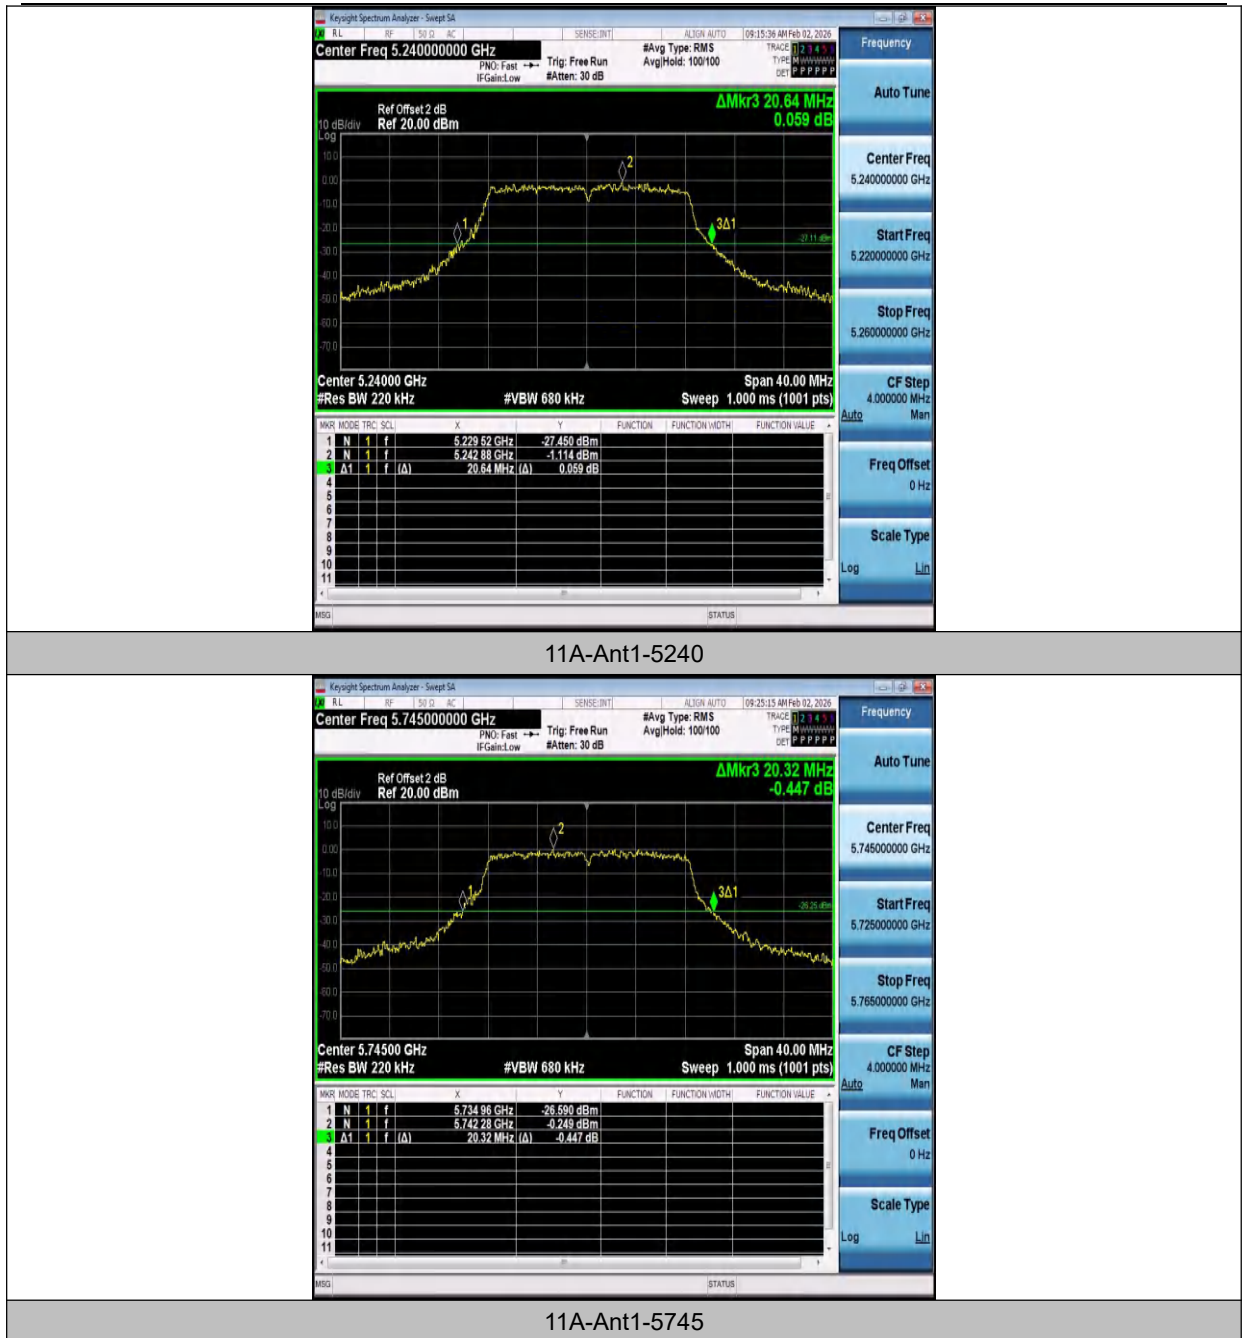


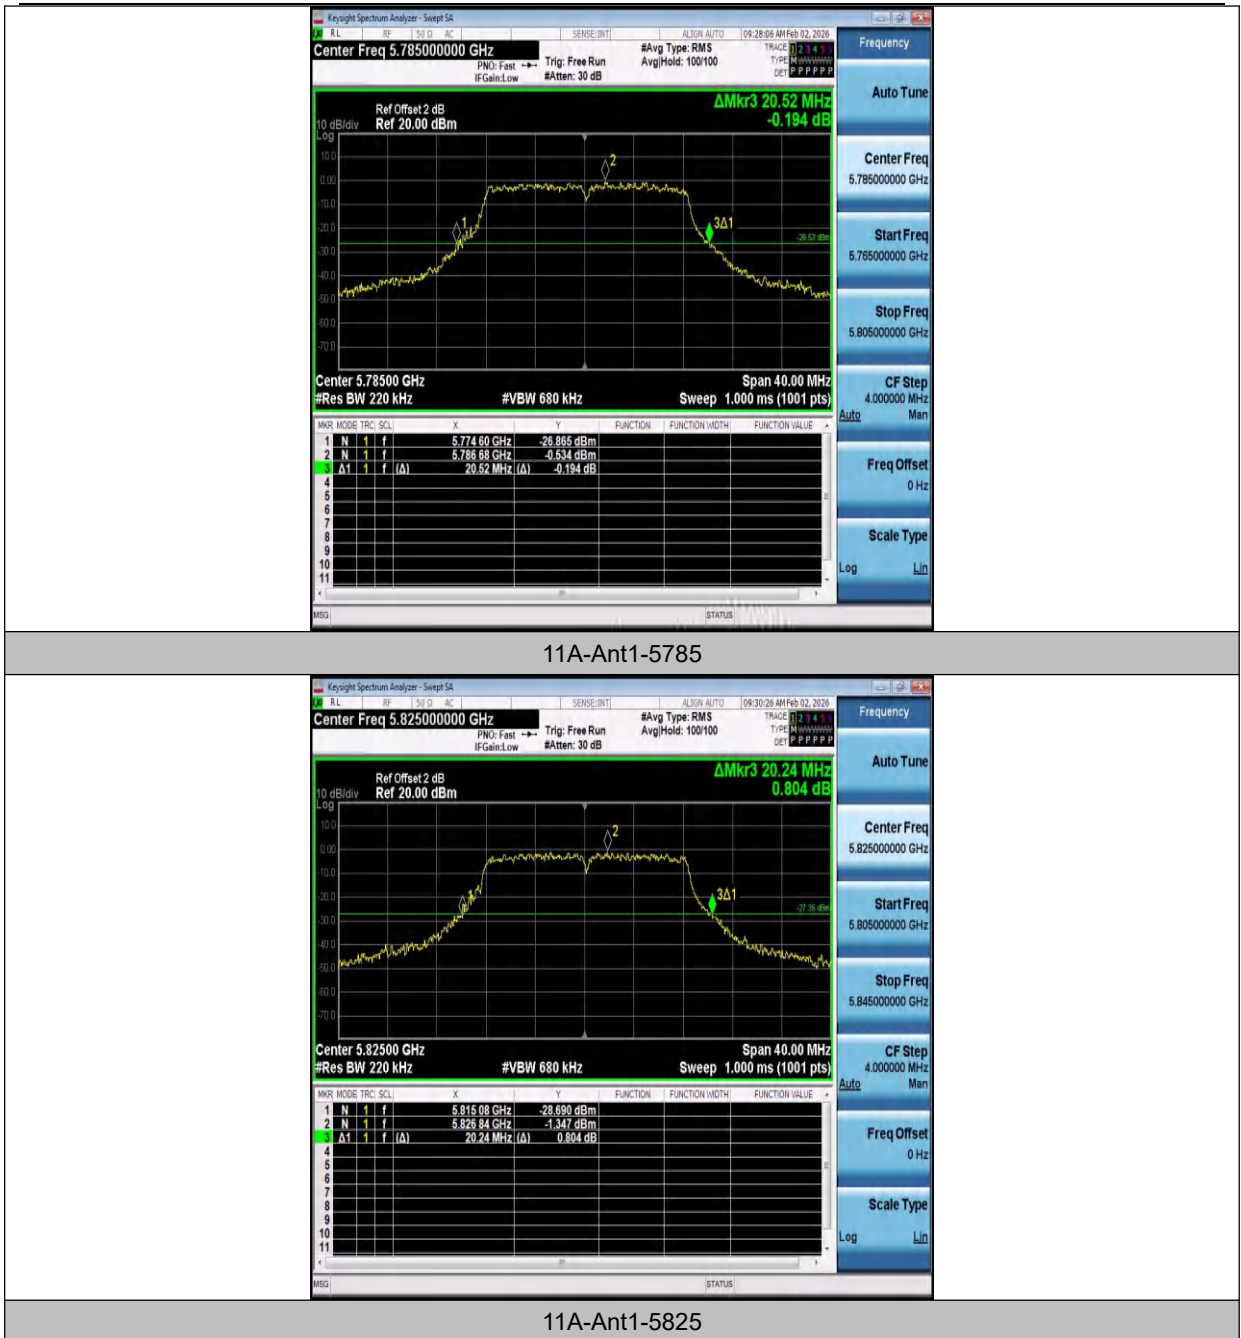

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

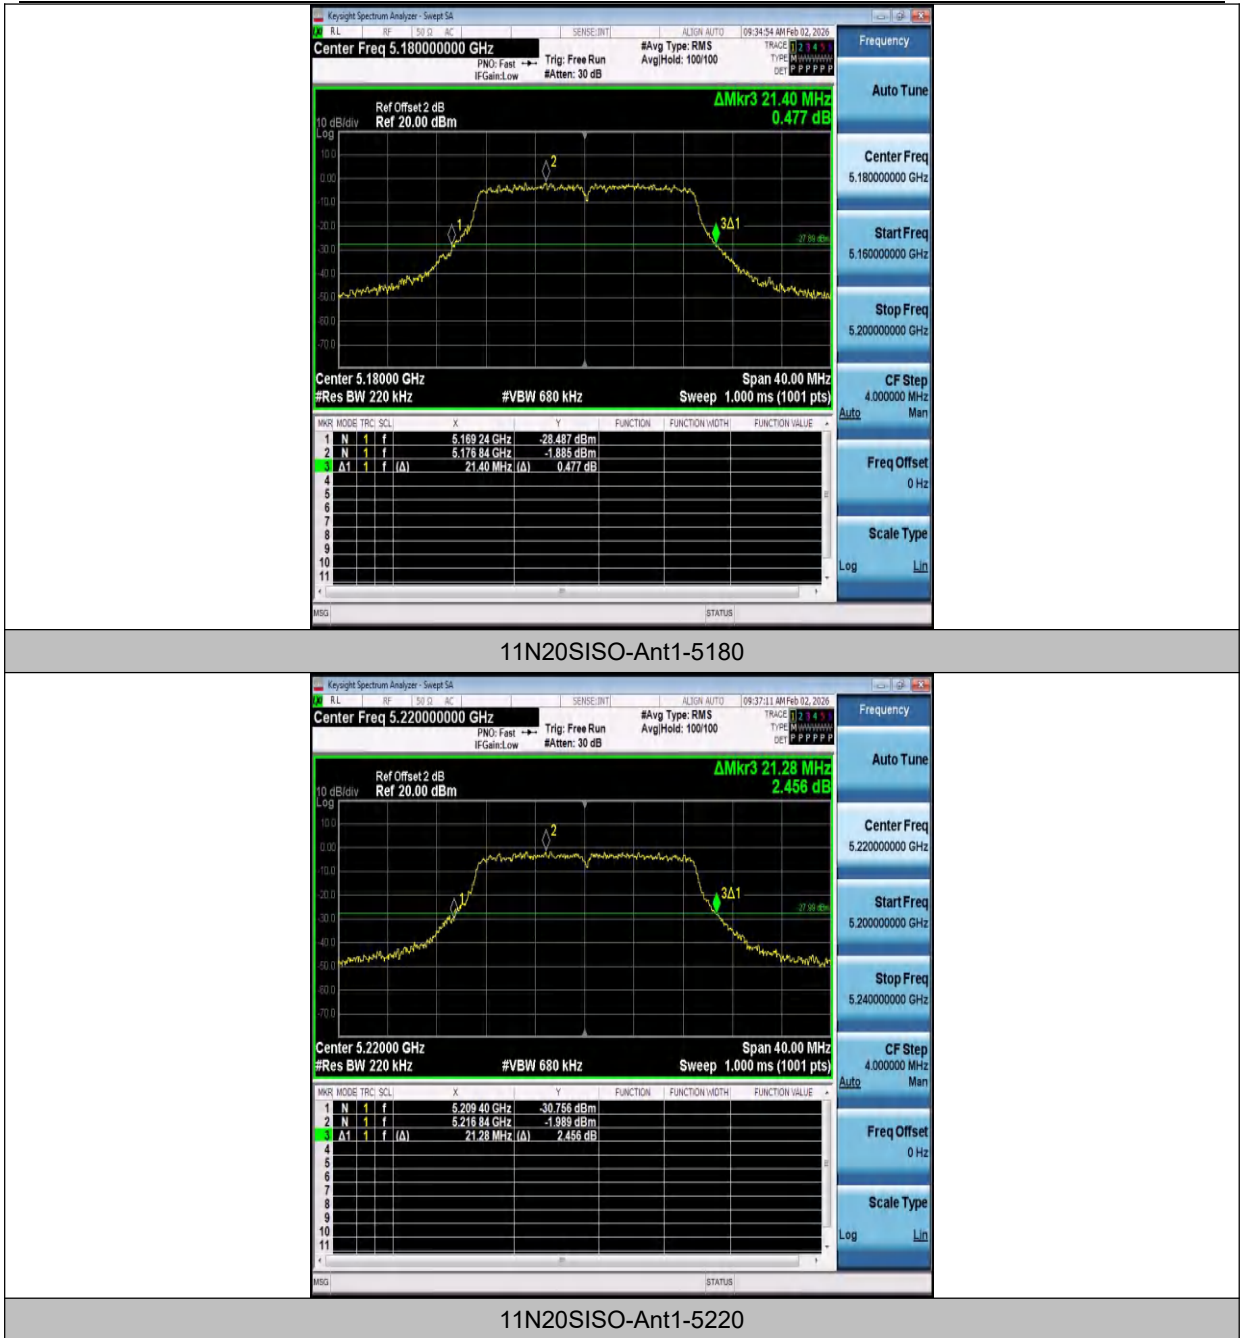

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

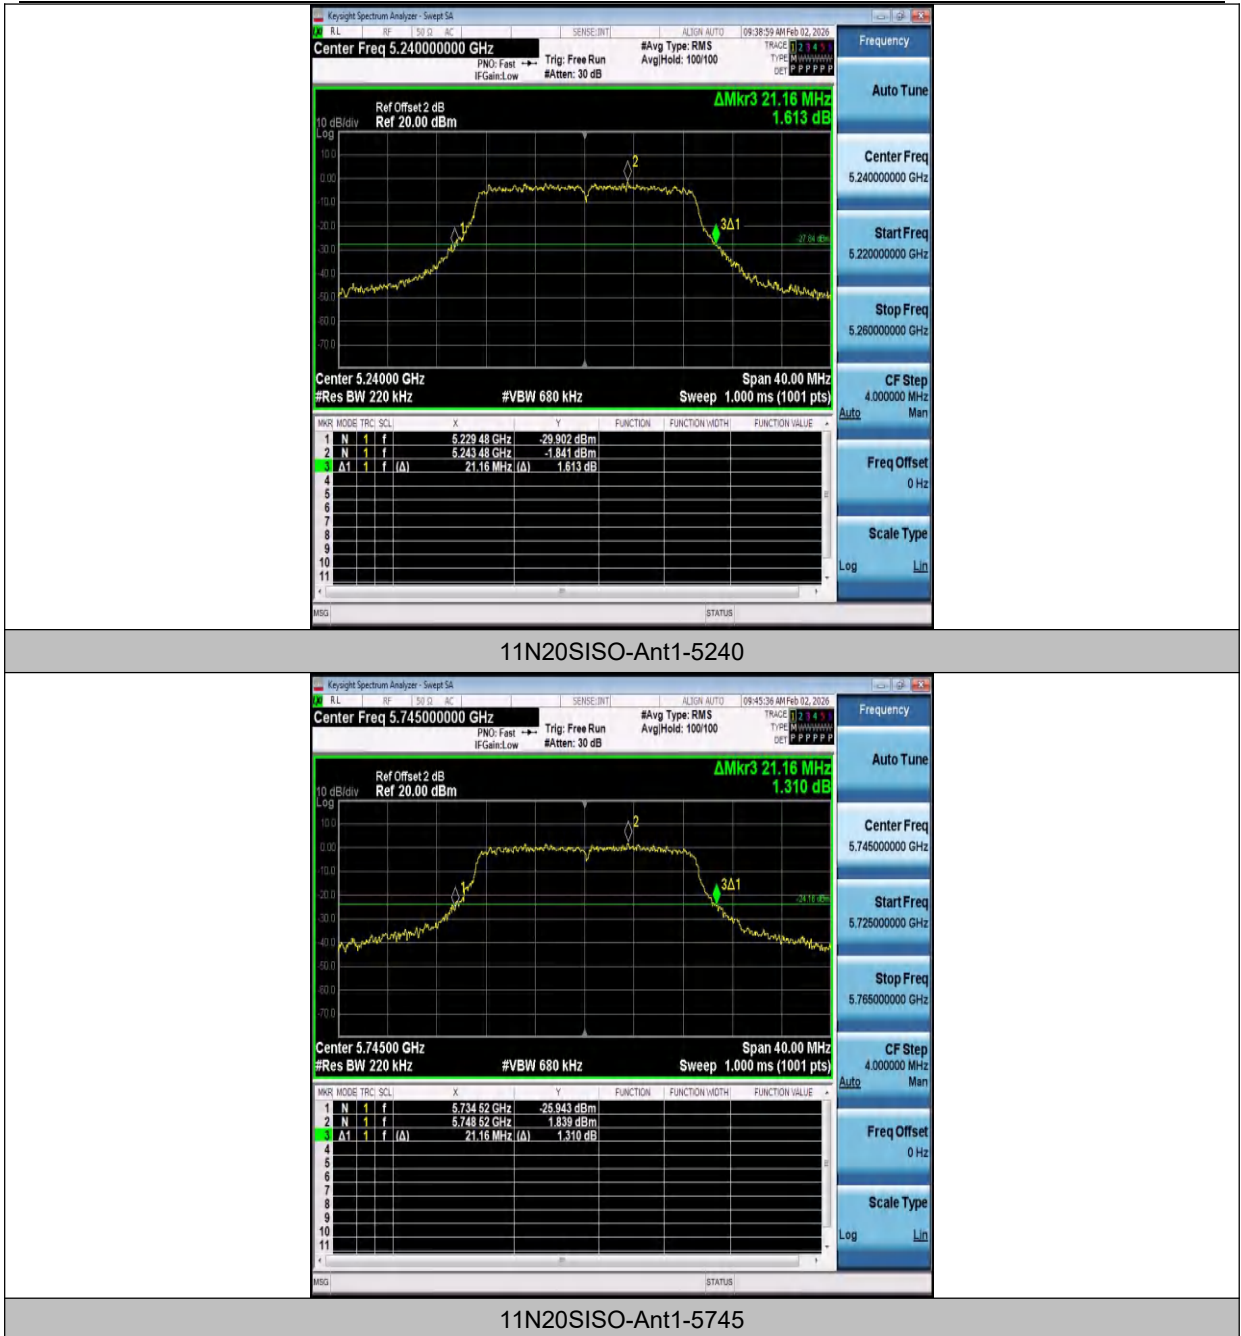

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

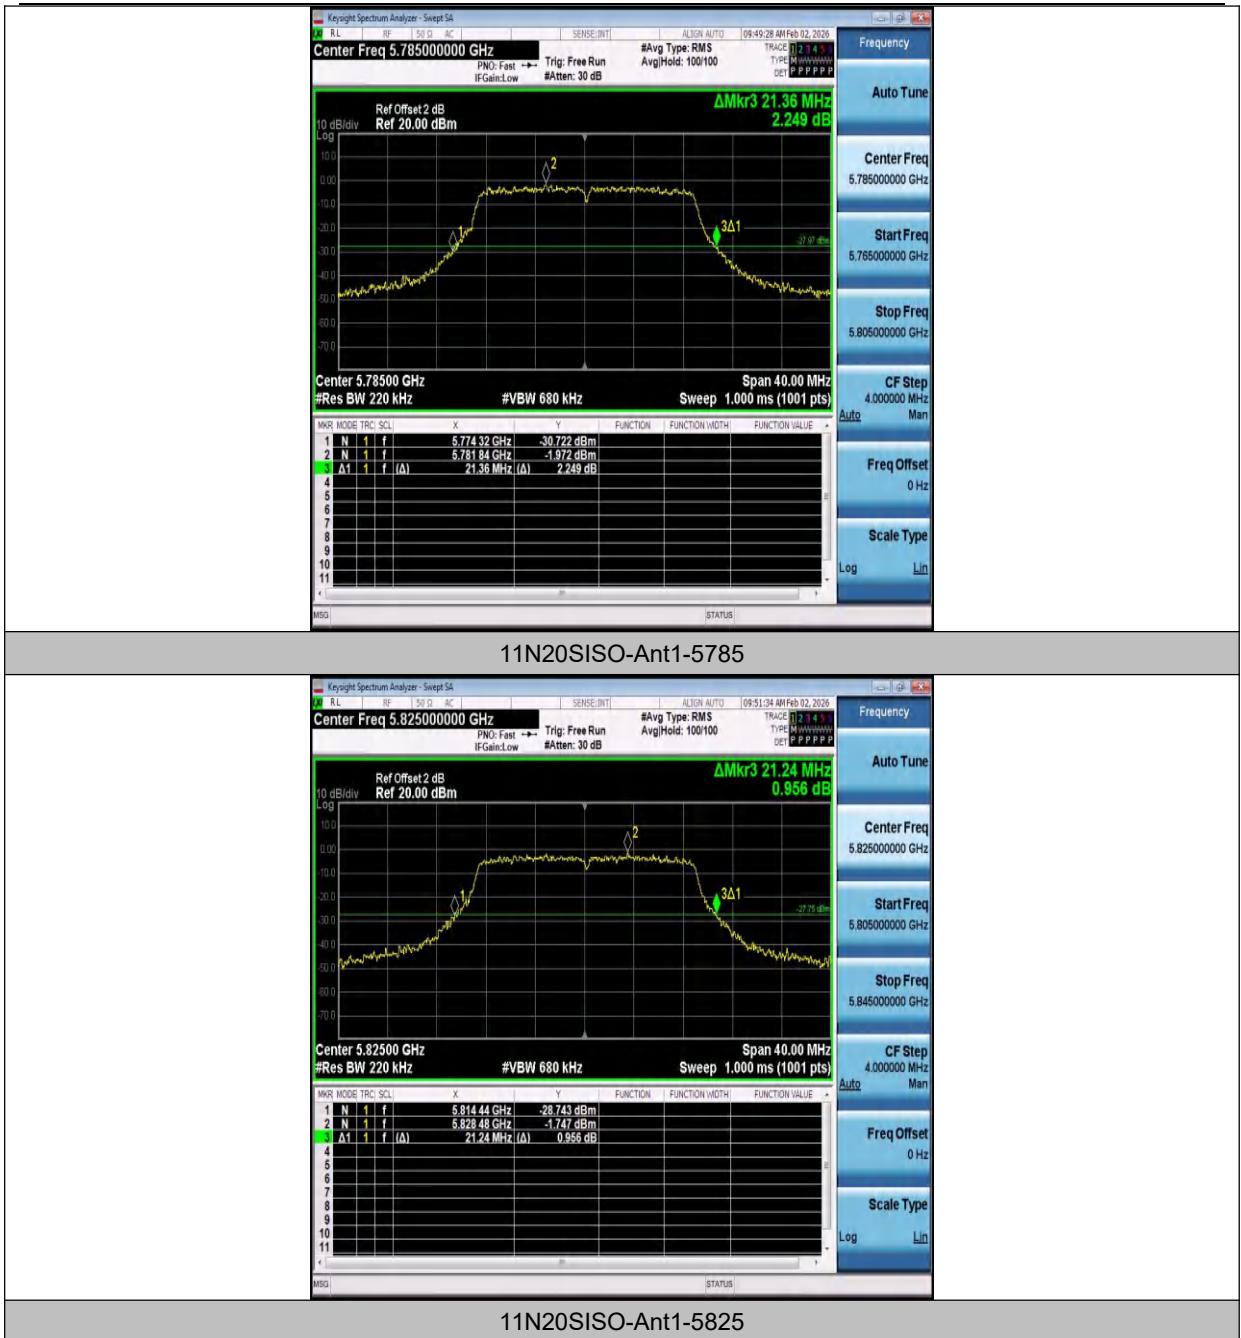


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

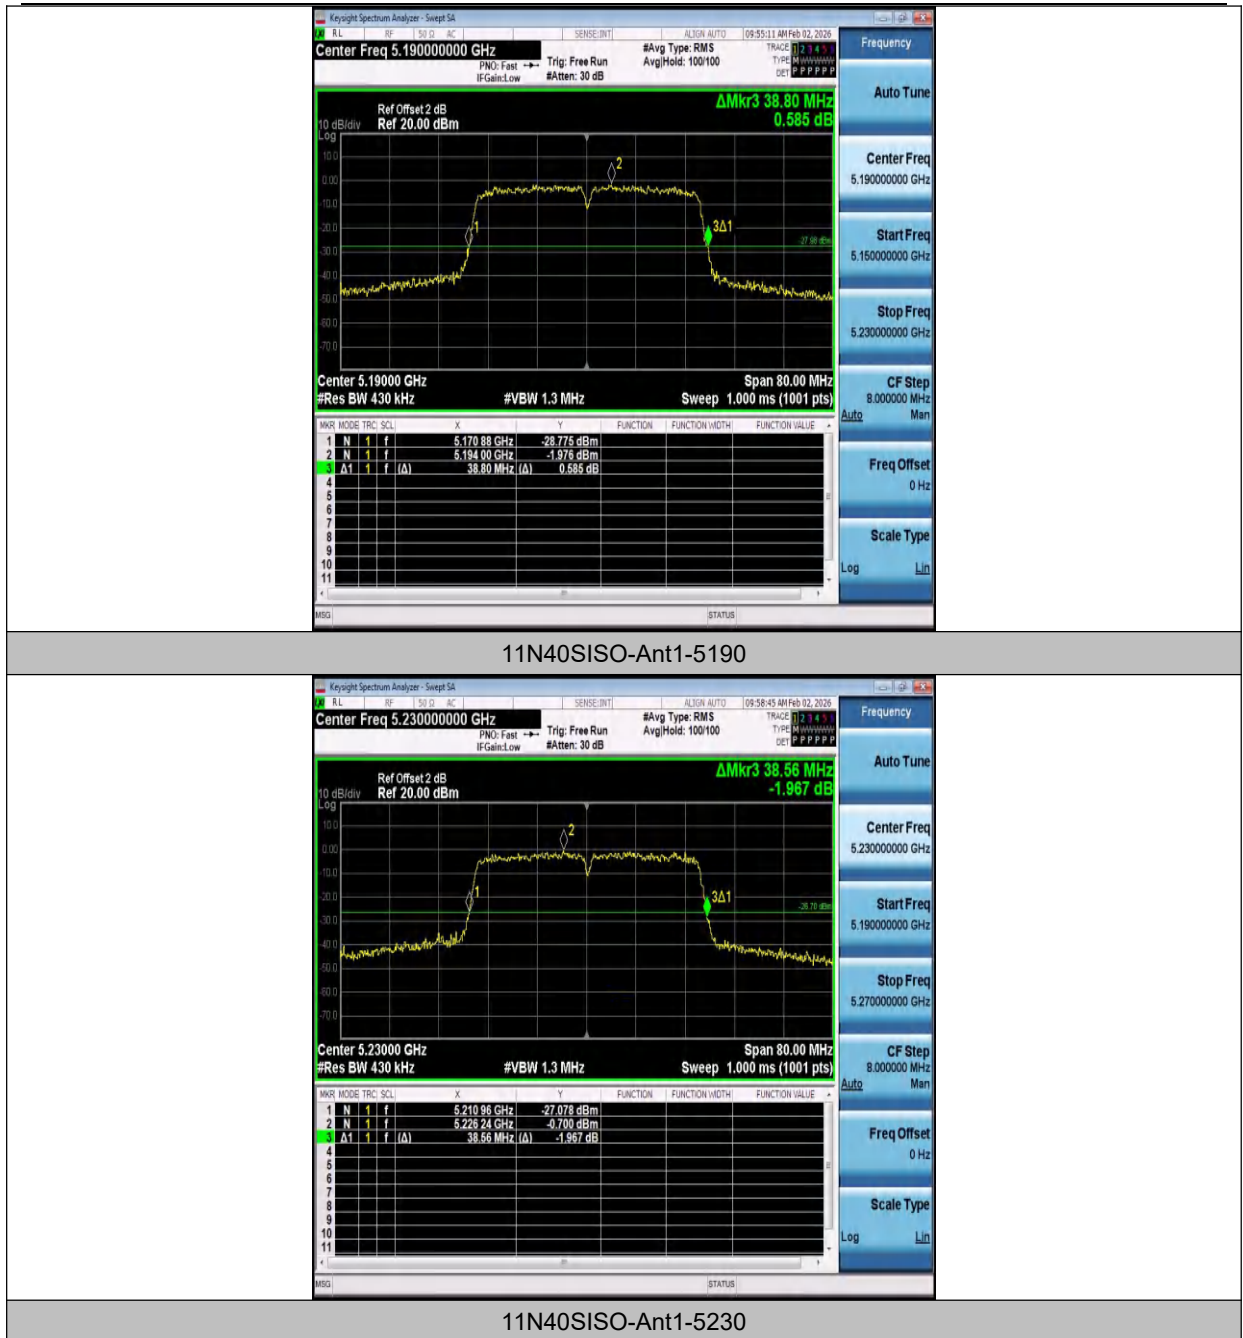

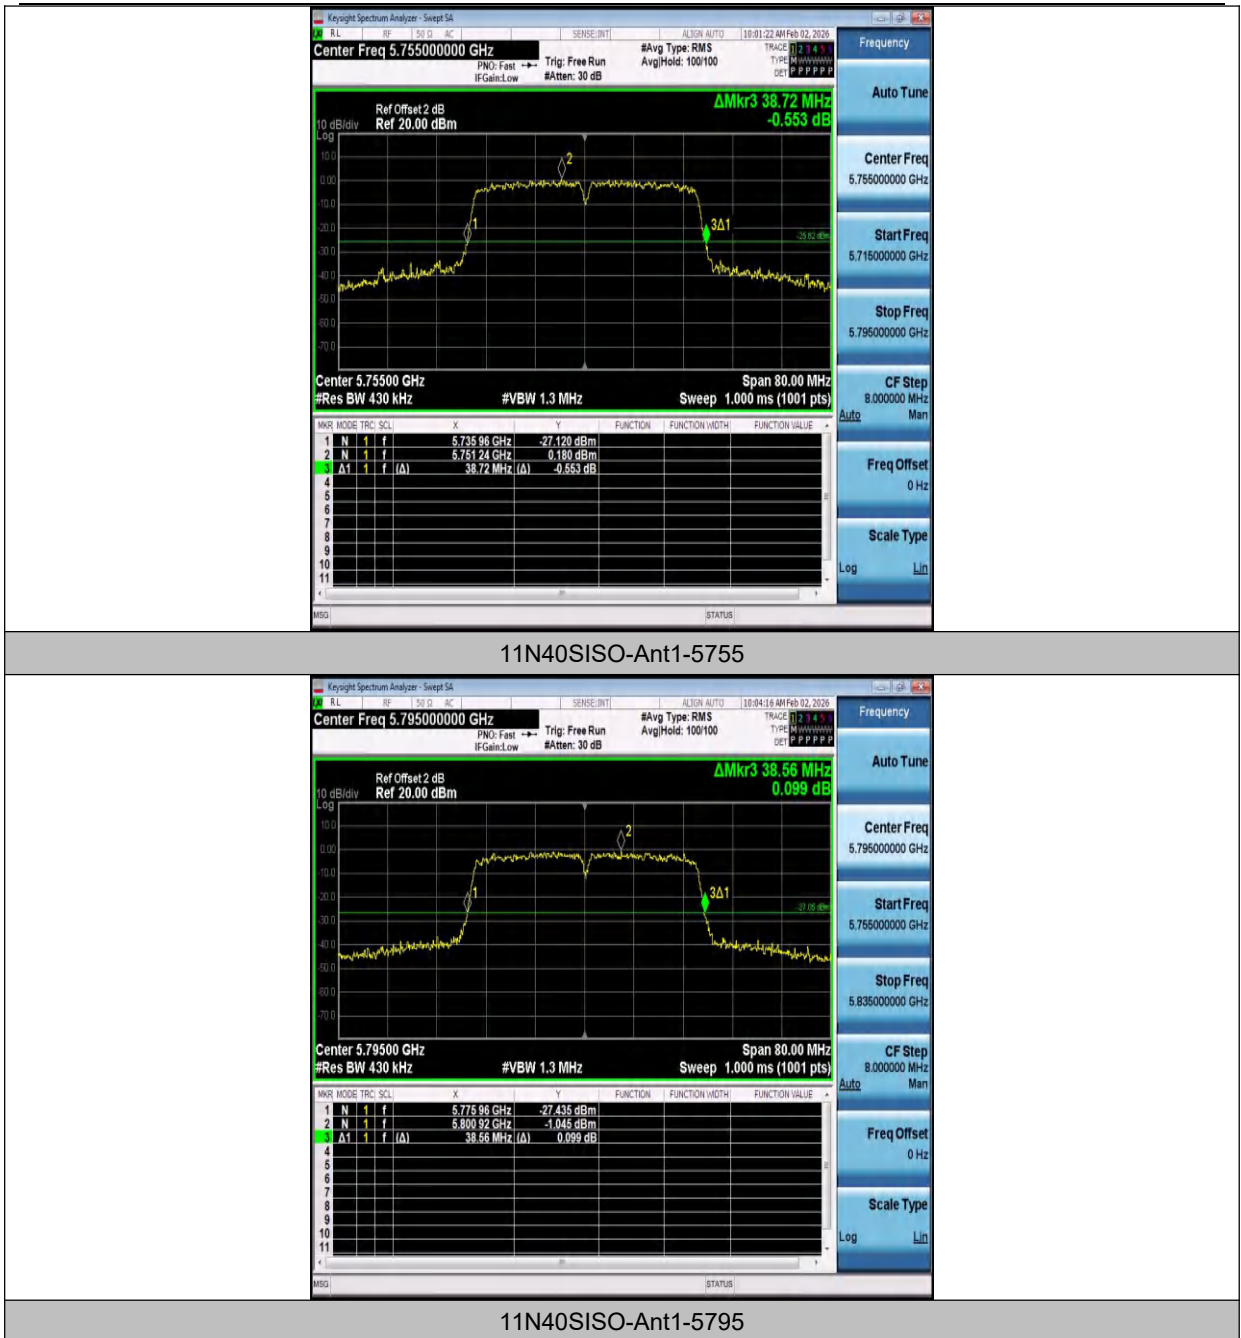

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.864	5171.6399	5188.5039	---	---
11A	Ant1	5220	16.836	5211.6841	5228.5201	---	---
11A	Ant1	5240	16.874	5231.6490	5248.5230	---	---
11A	Ant1	5745	16.847	5736.6699	5753.5169	---	---
11A	Ant1	5785	16.890	5776.6147	5793.5047	---	---
11A	Ant1	5825	16.827	5816.6776	5833.5046	---	---
11N20SISO	Ant1	5180	17.893	5171.2106	5189.1036	---	---
11N20SISO	Ant1	5220	17.895	5211.2033	5229.0983	---	---
11N20SISO	Ant1	5240	17.863	5231.1987	5249.0617	---	---
11N20SISO	Ant1	5745	17.868	5736.2230	5754.0910	---	---
11N20SISO	Ant1	5785	17.864	5776.2268	5794.0908	---	---
11N20SISO	Ant1	5825	17.864	5816.2129	5834.0769	---	---
11N40SISO	Ant1	5190	35.777	5172.3220	5208.0990	---	---
11N40SISO	Ant1	5230	35.787	5212.3062	5248.0932	---	---
11N40SISO	Ant1	5755	35.779	5737.3220	5773.1010	---	---
11N40SISO	Ant1	5795	35.786	5777.3234	5813.1094	---	---


Test Graphs

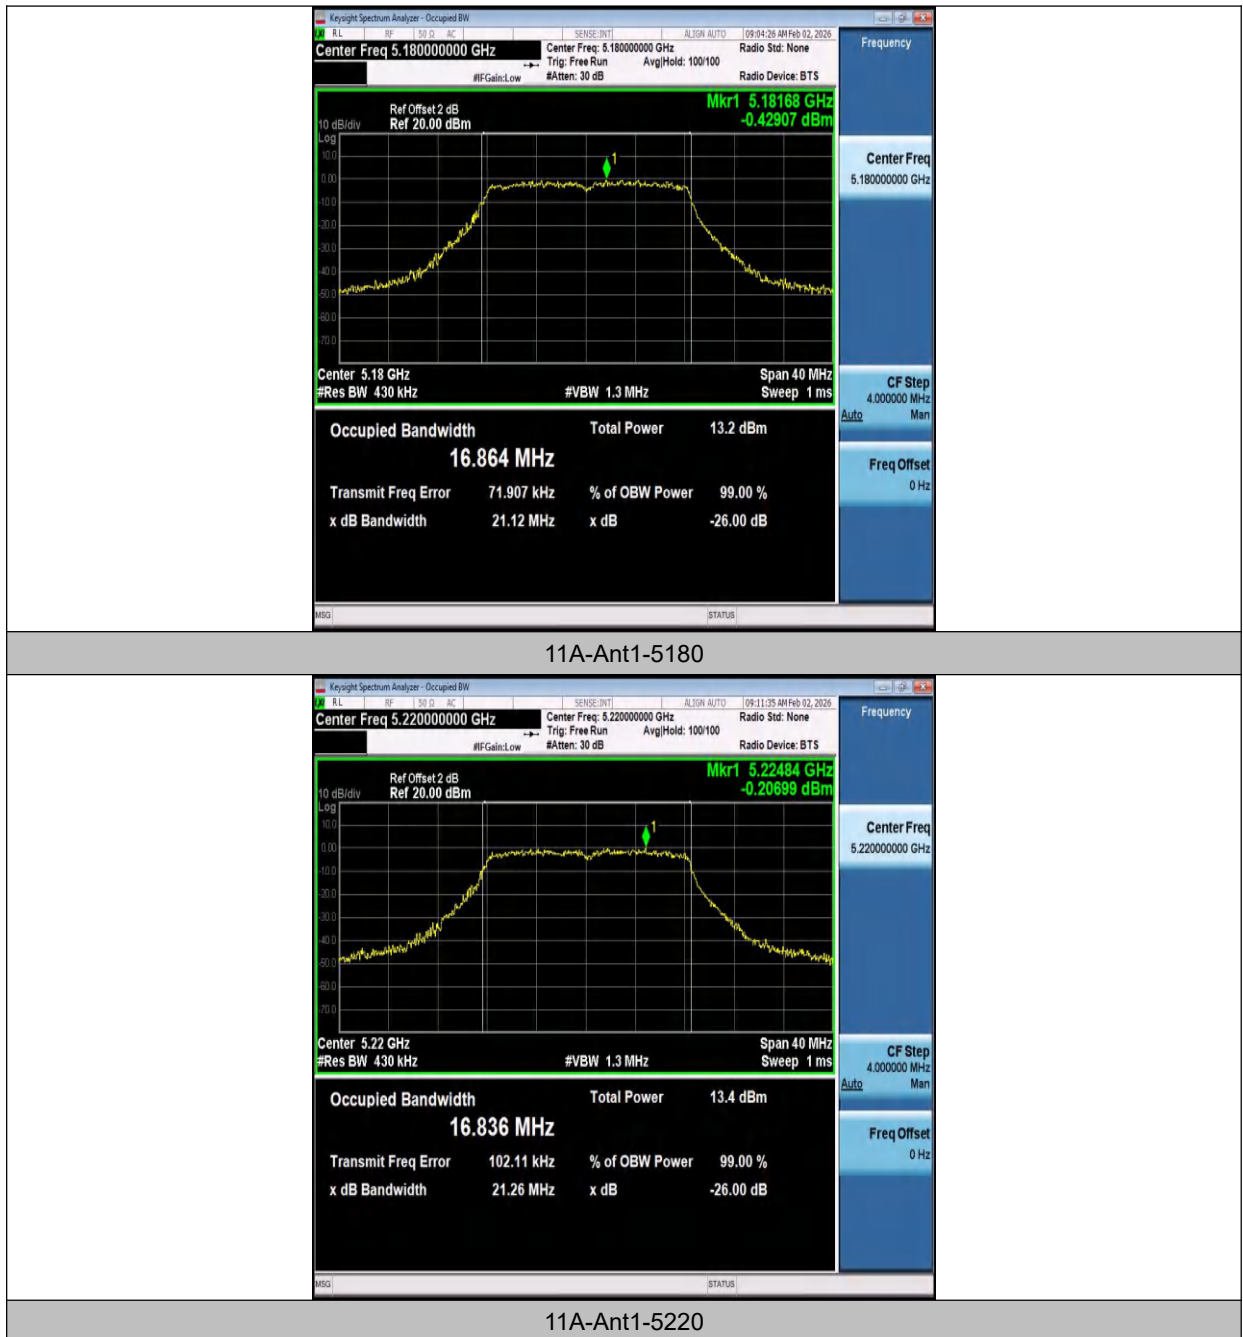

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

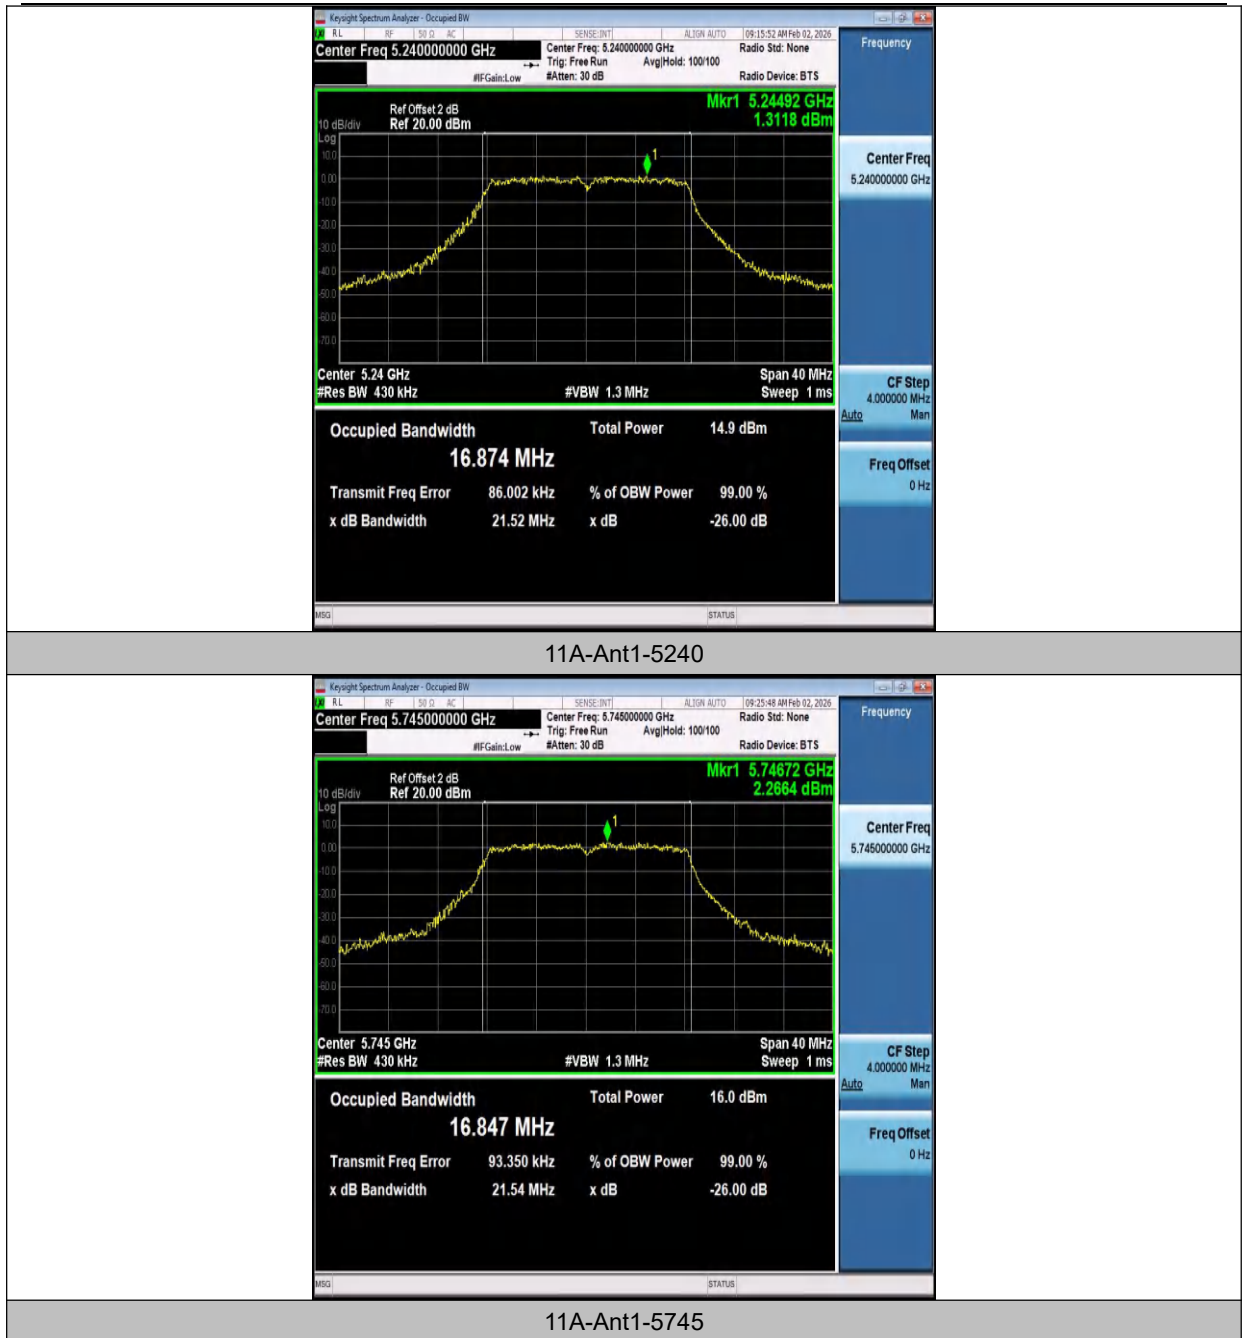

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

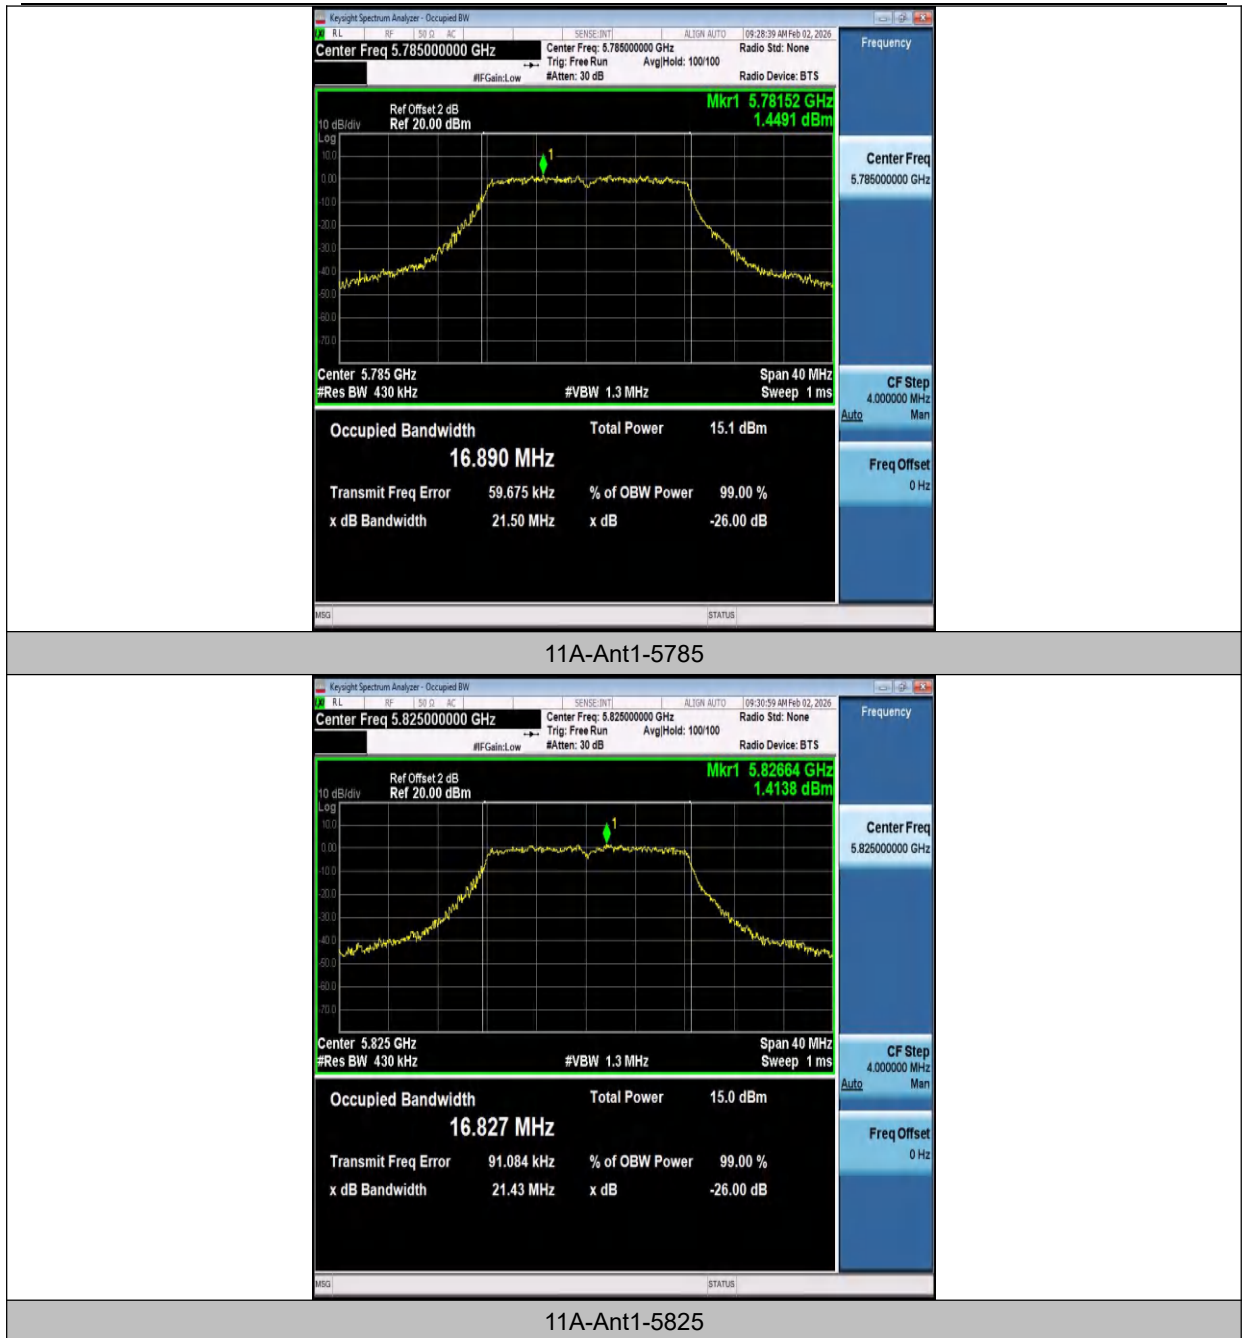

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

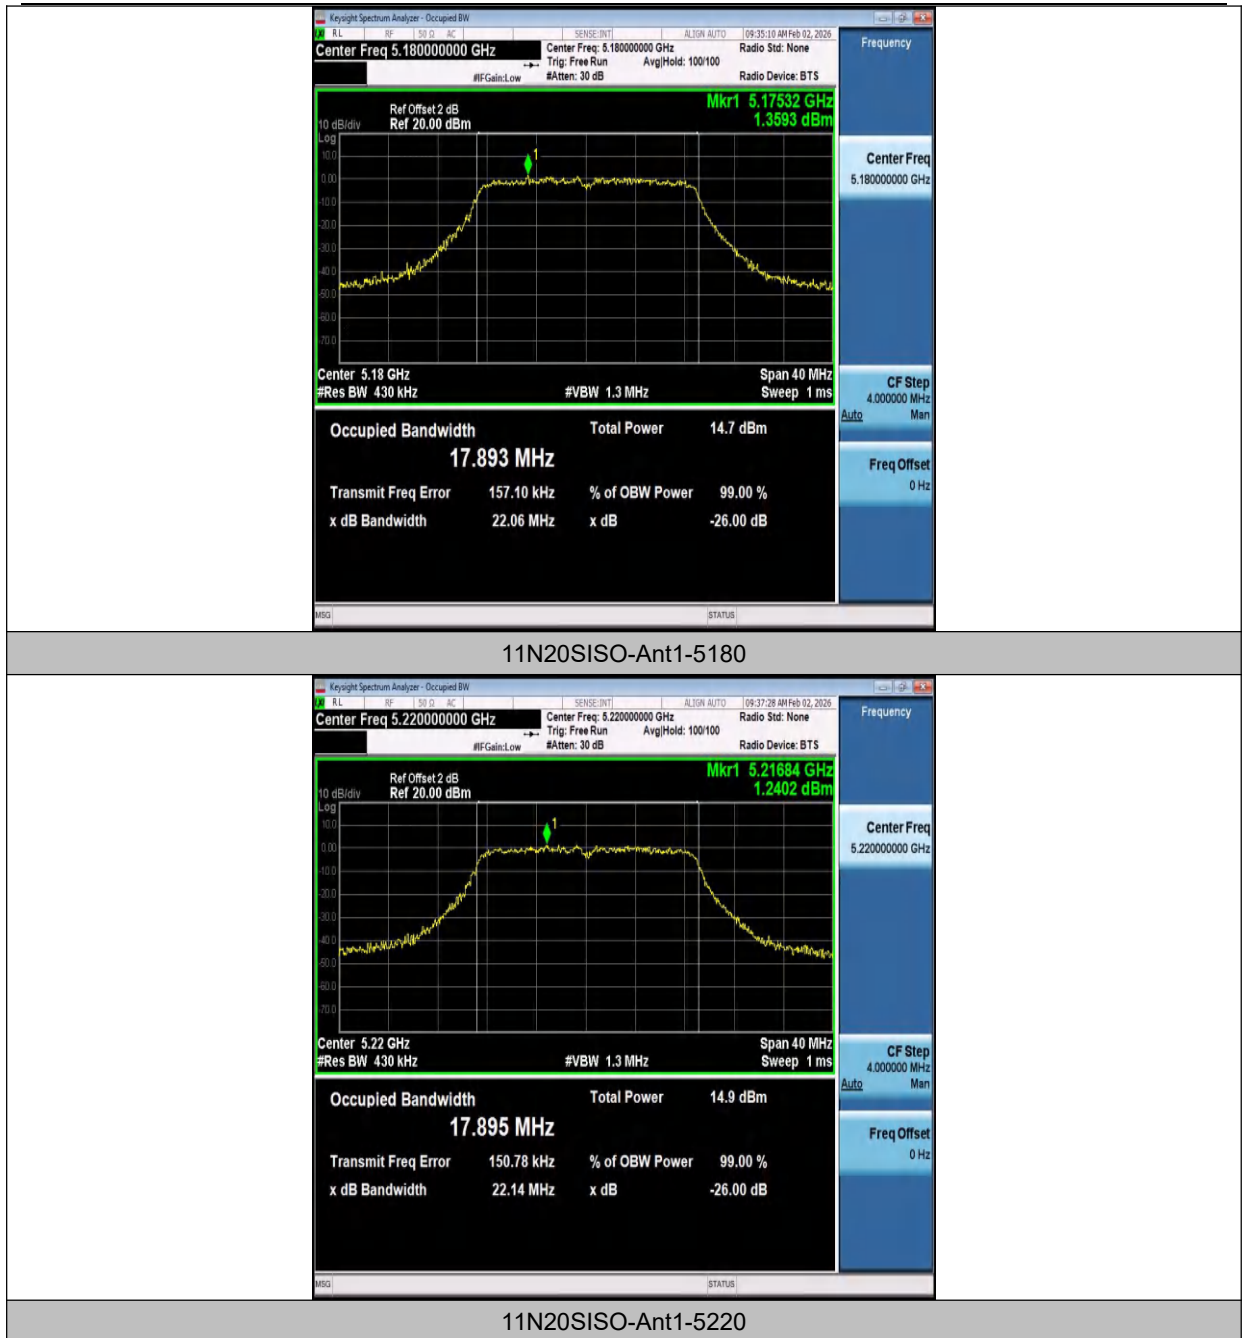

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

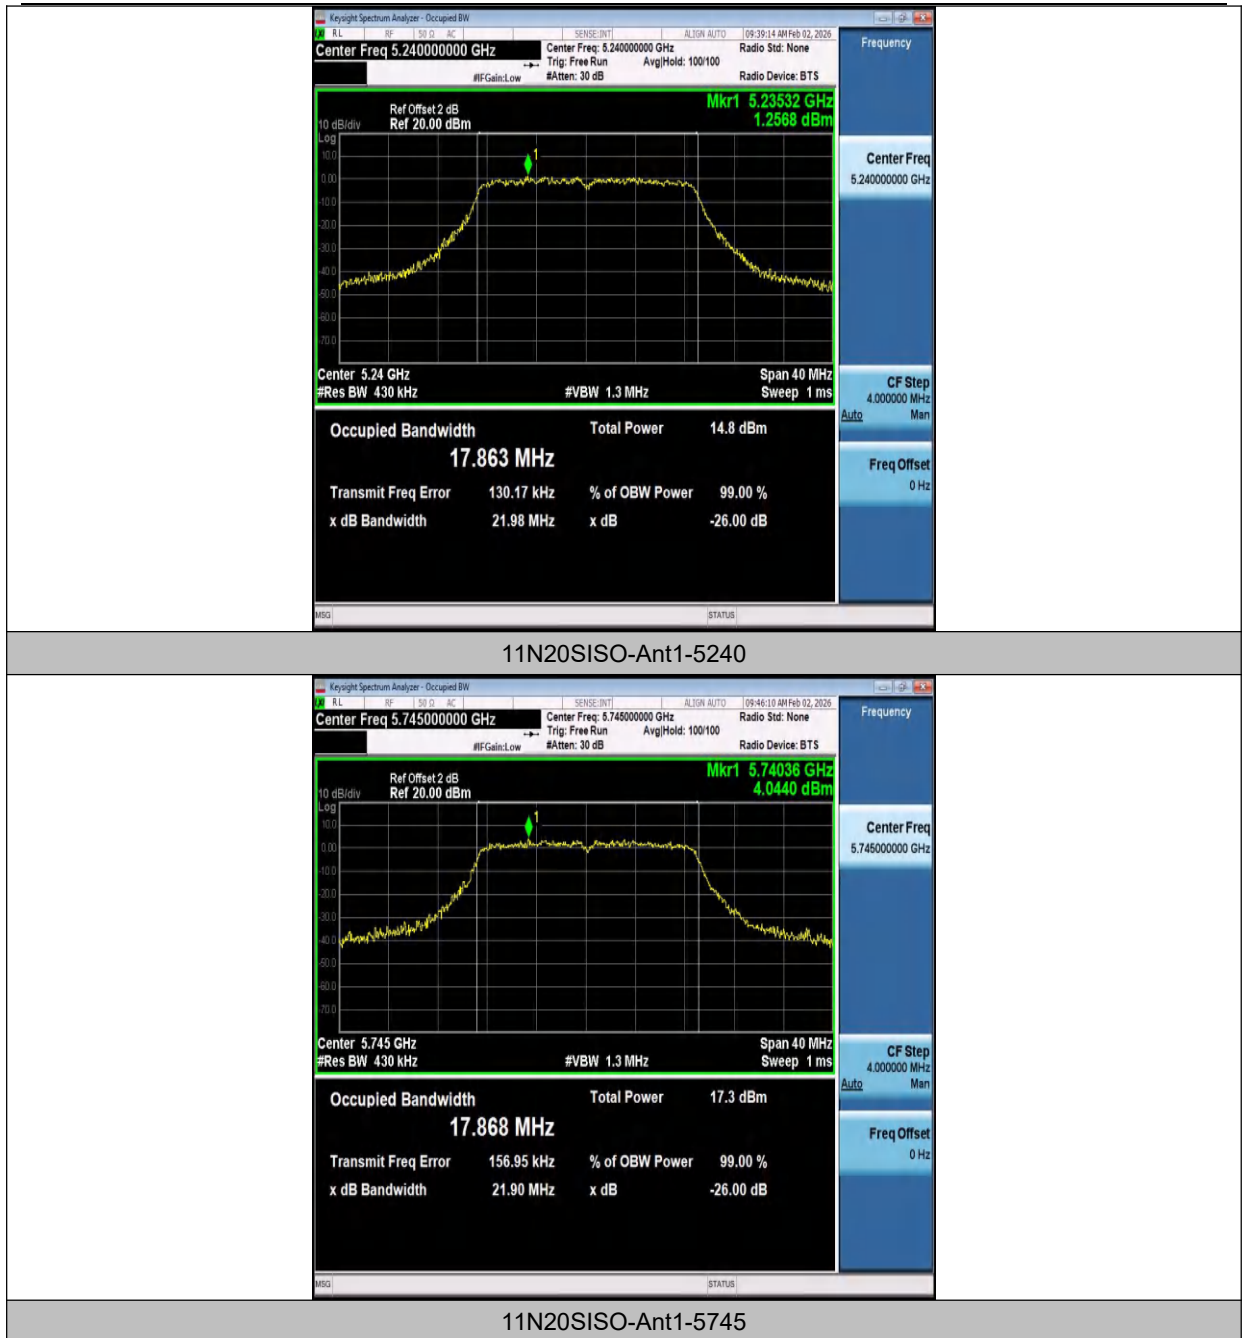

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

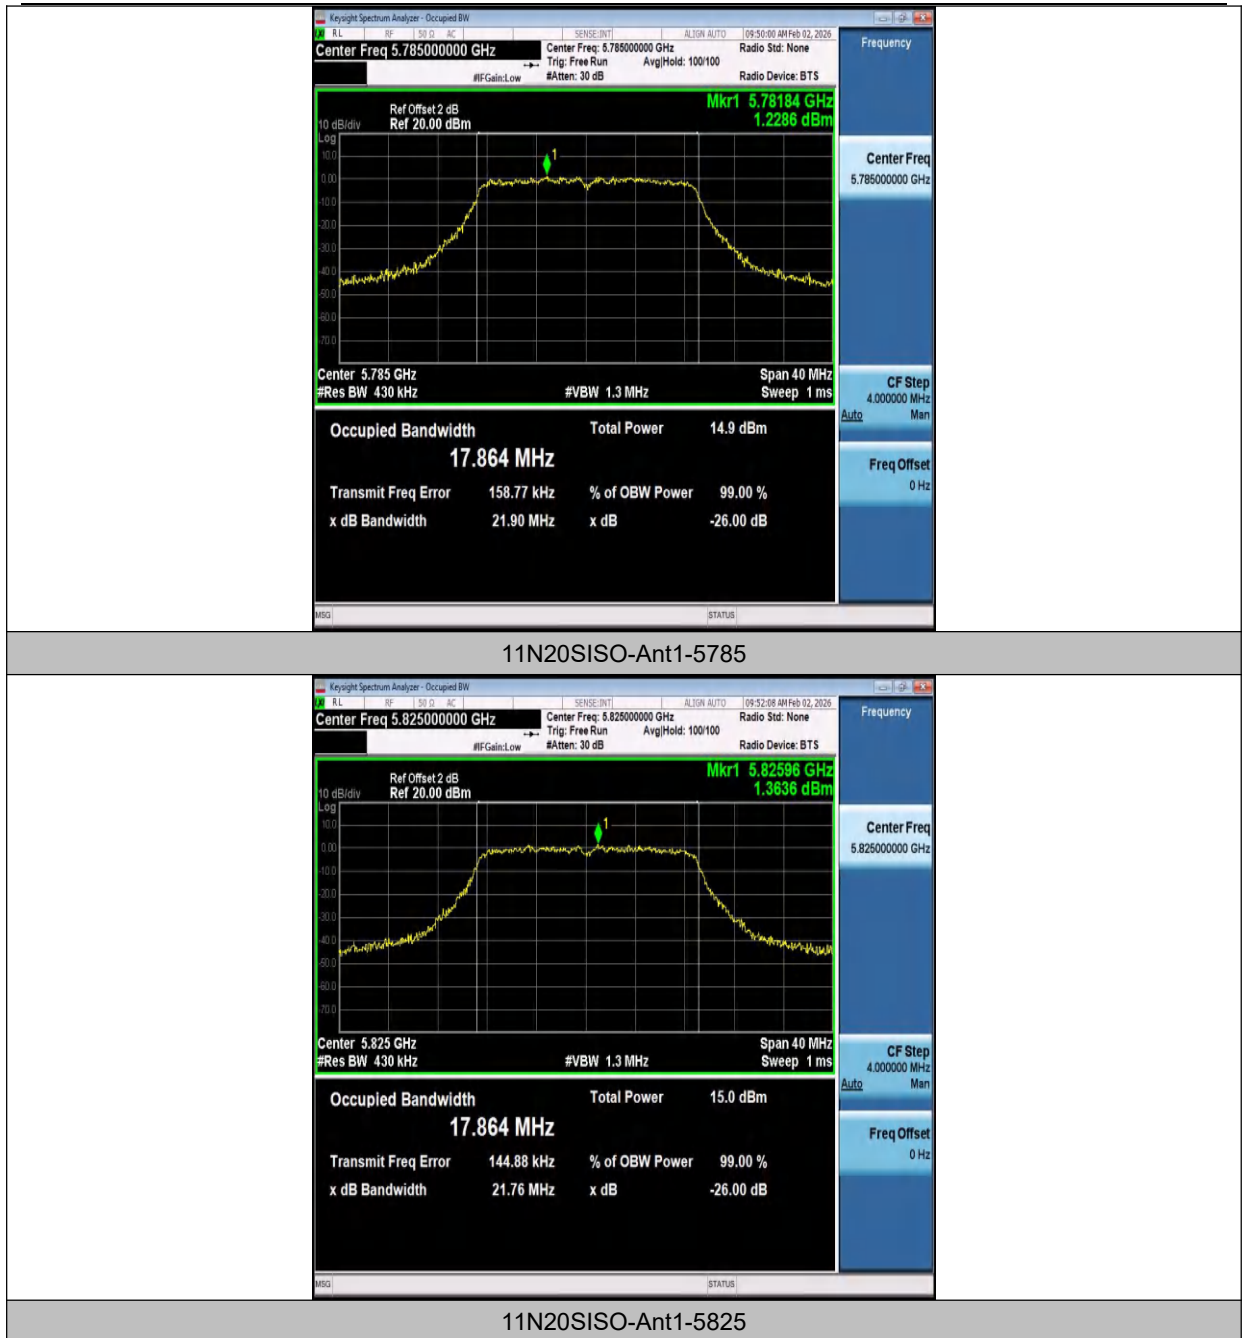

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

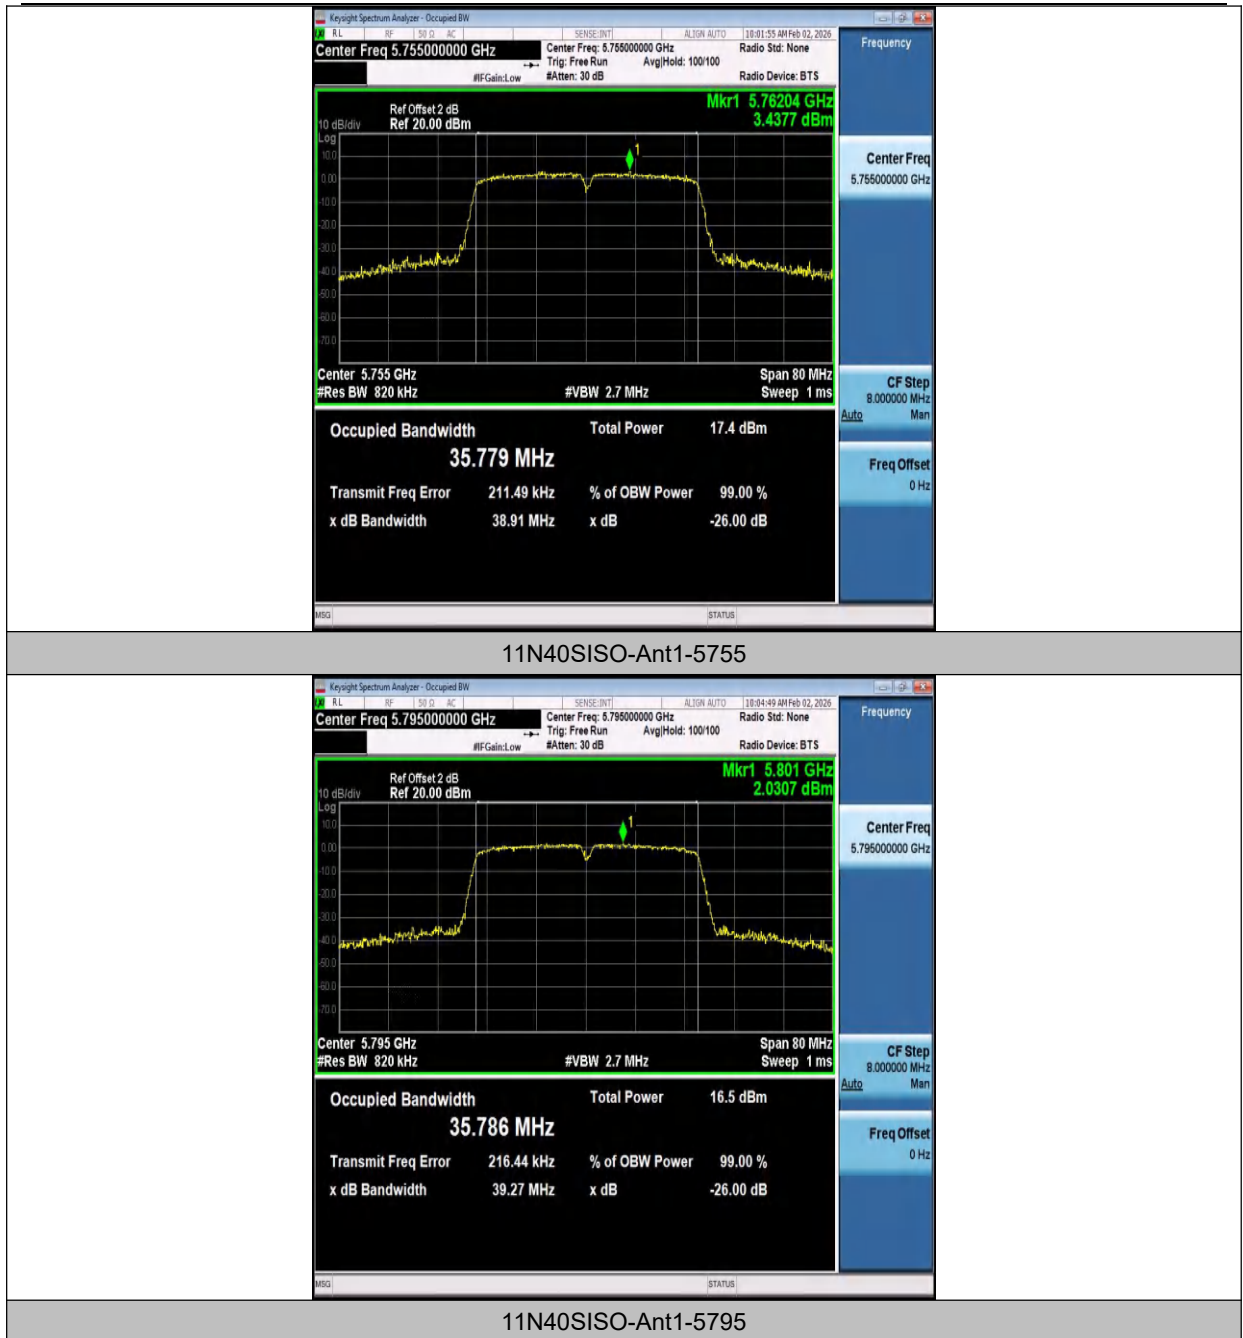

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.440	5736.920	5753.360	0.5	PASS
11A	Ant1	5785	16.480	5776.920	5793.400	0.5	PASS
11A	Ant1	5825	16.480	5816.920	5833.400	0.5	PASS
11N20SISO	Ant1	5745	17.600	5736.360	5753.960	0.5	PASS
11N20SISO	Ant1	5785	17.640	5776.320	5793.960	0.5	PASS
11N20SISO	Ant1	5825	17.600	5816.360	5833.960	0.5	PASS
11N40SISO	Ant1	5755	36.320	5737.000	5773.320	0.5	PASS
11N40SISO	Ant1	5795	36.320	5777.000	5813.320	0.5	PASS


Test Graphs B4

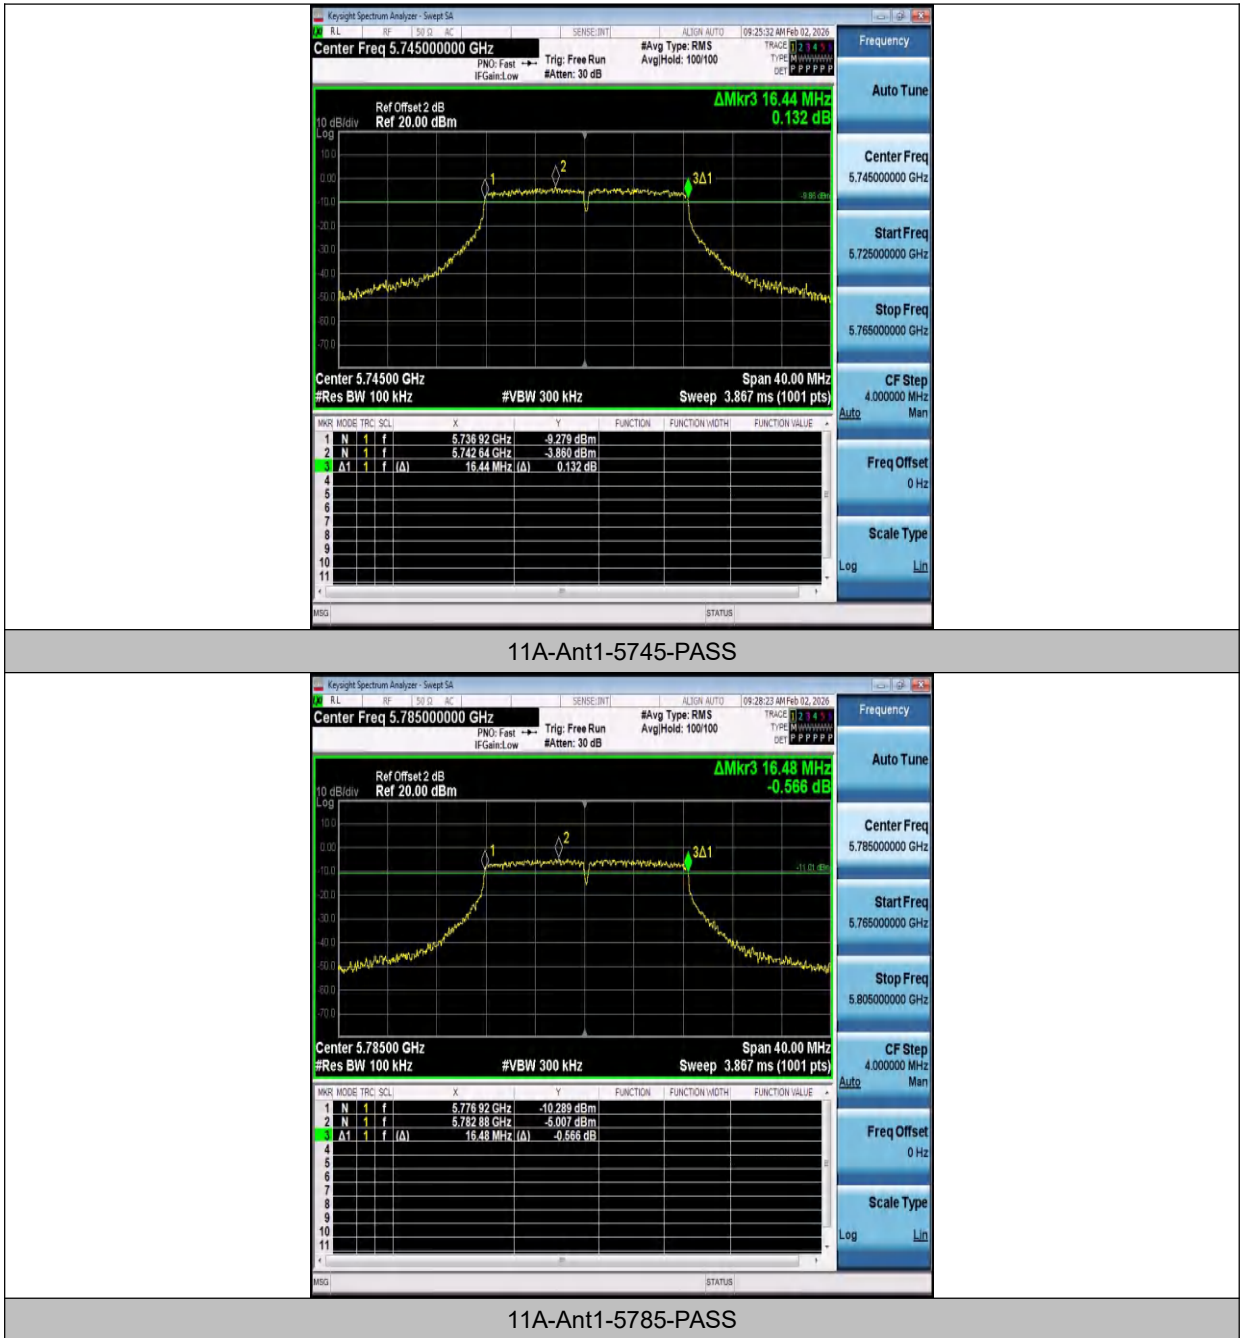


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

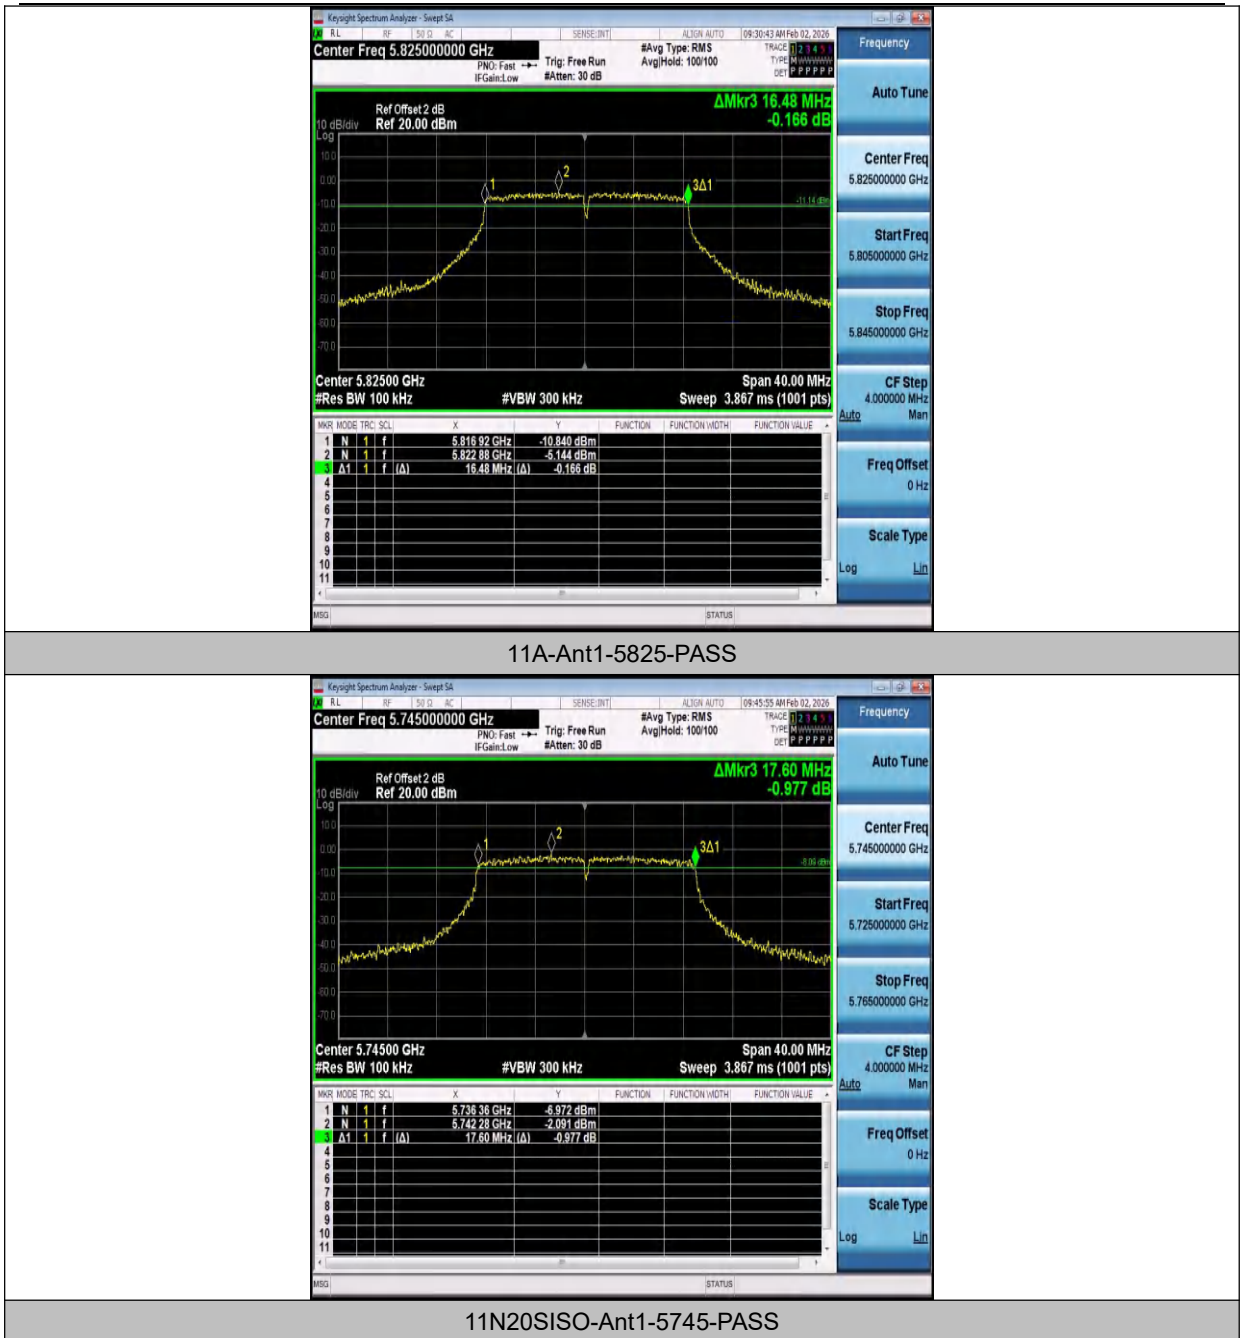


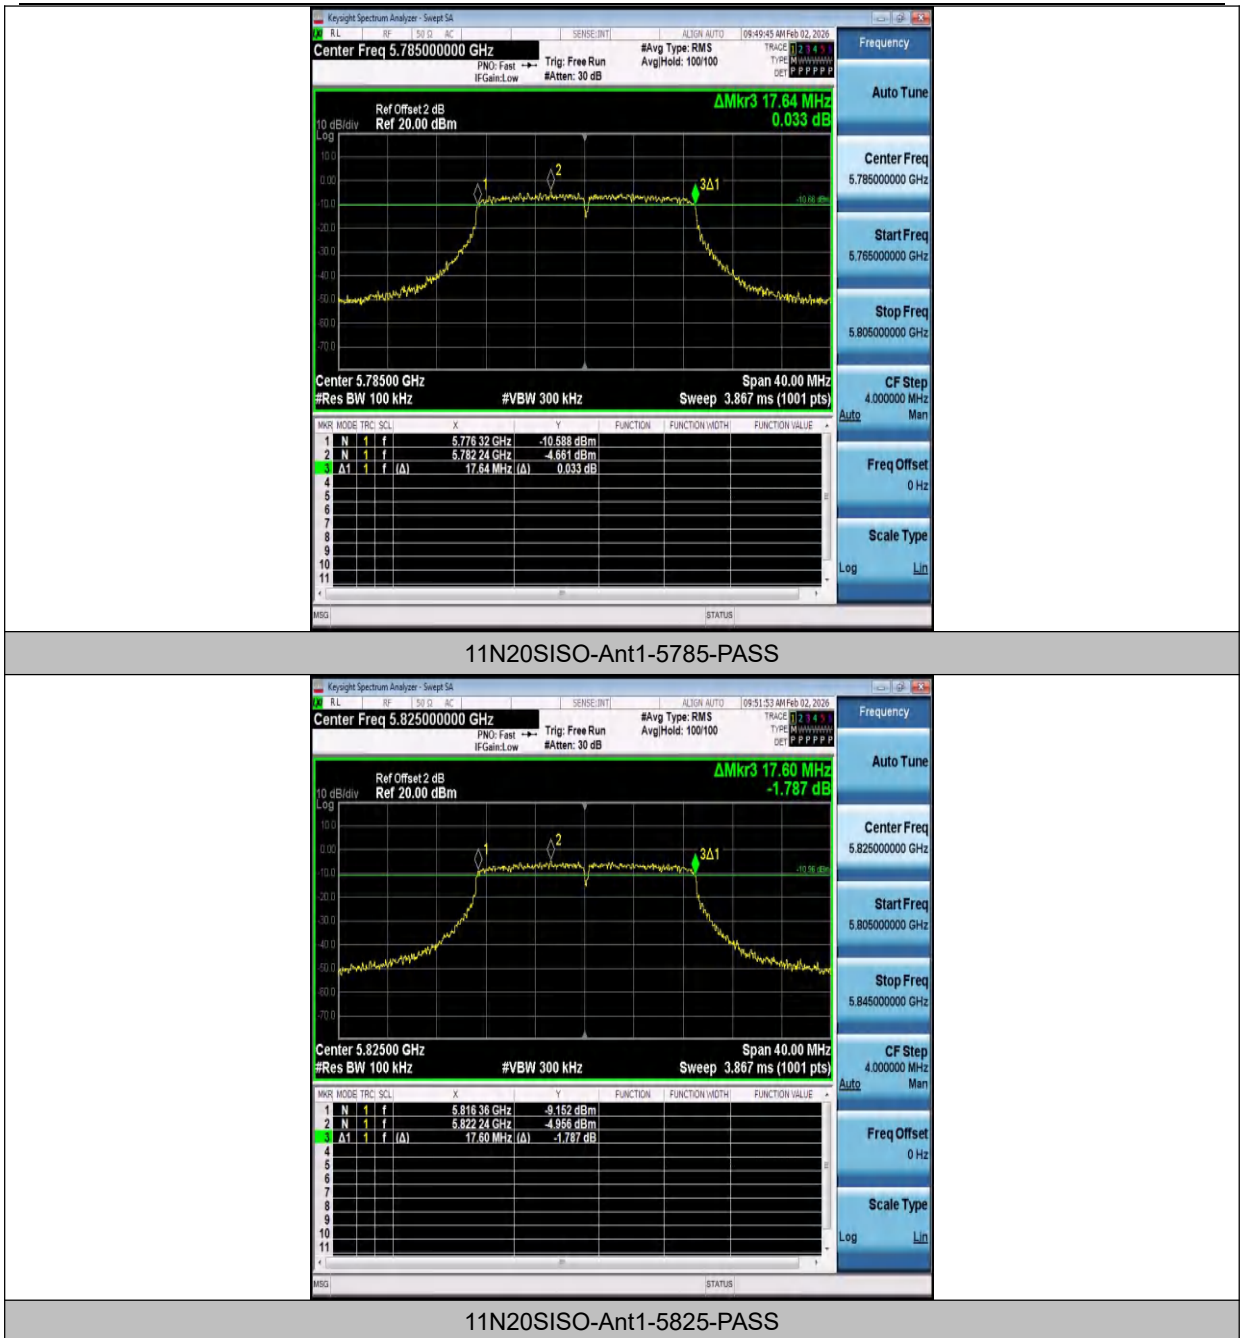

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

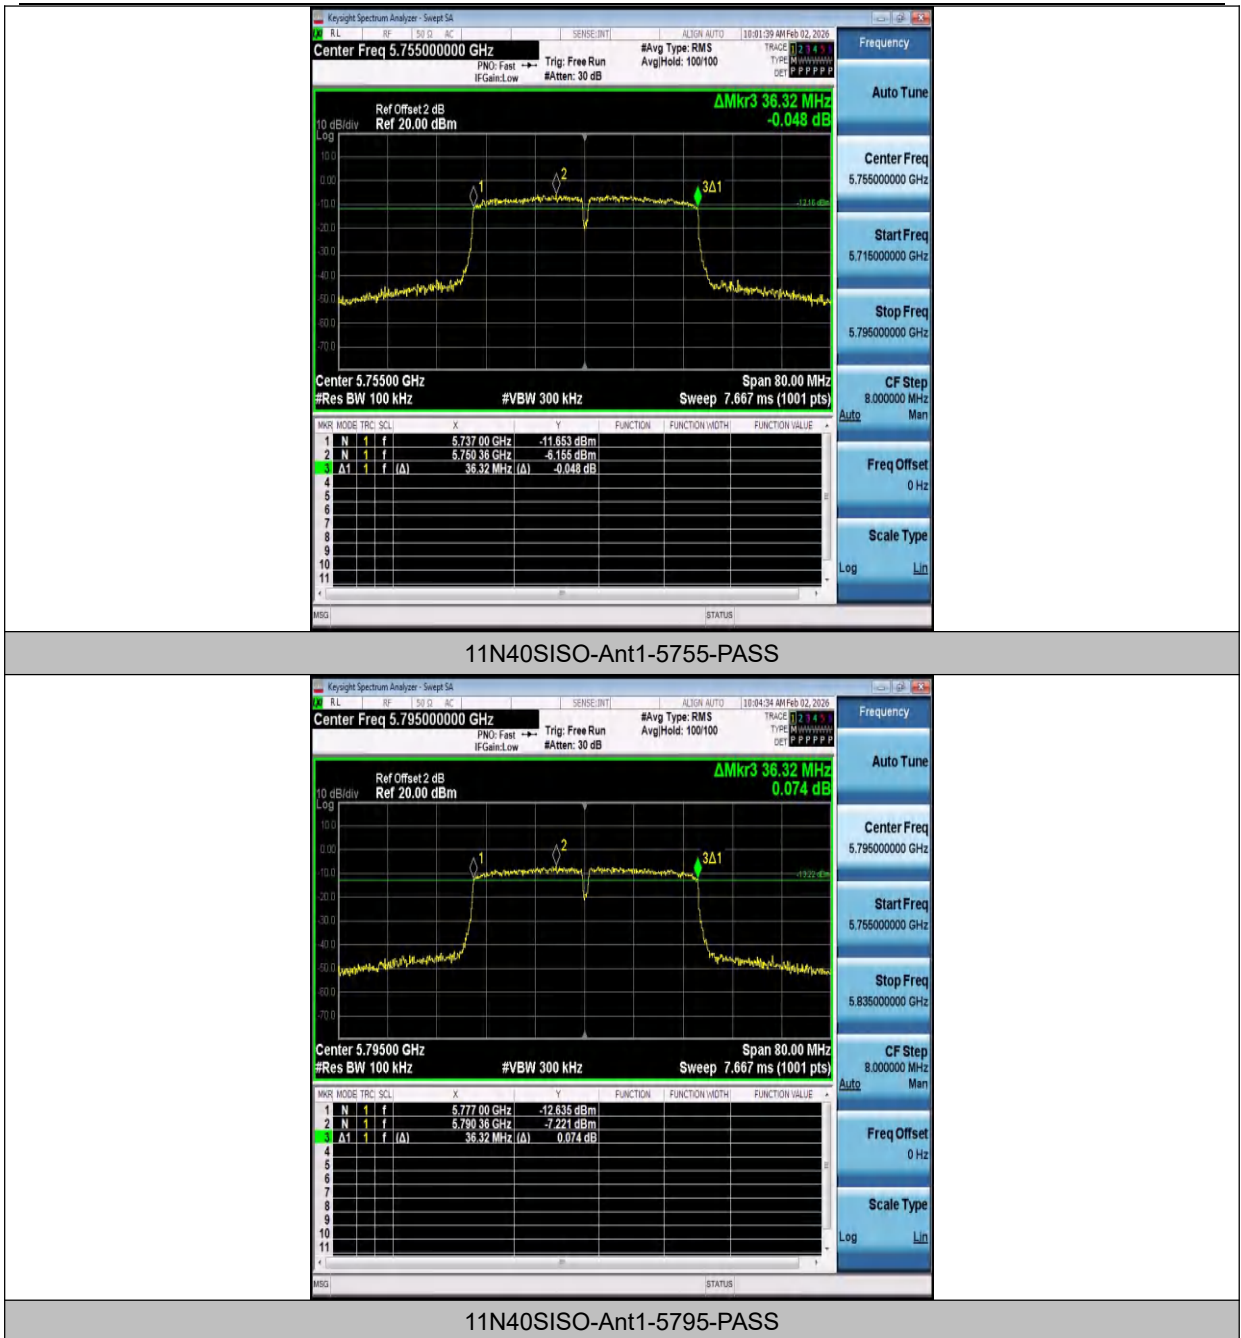


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01


Test Graphs

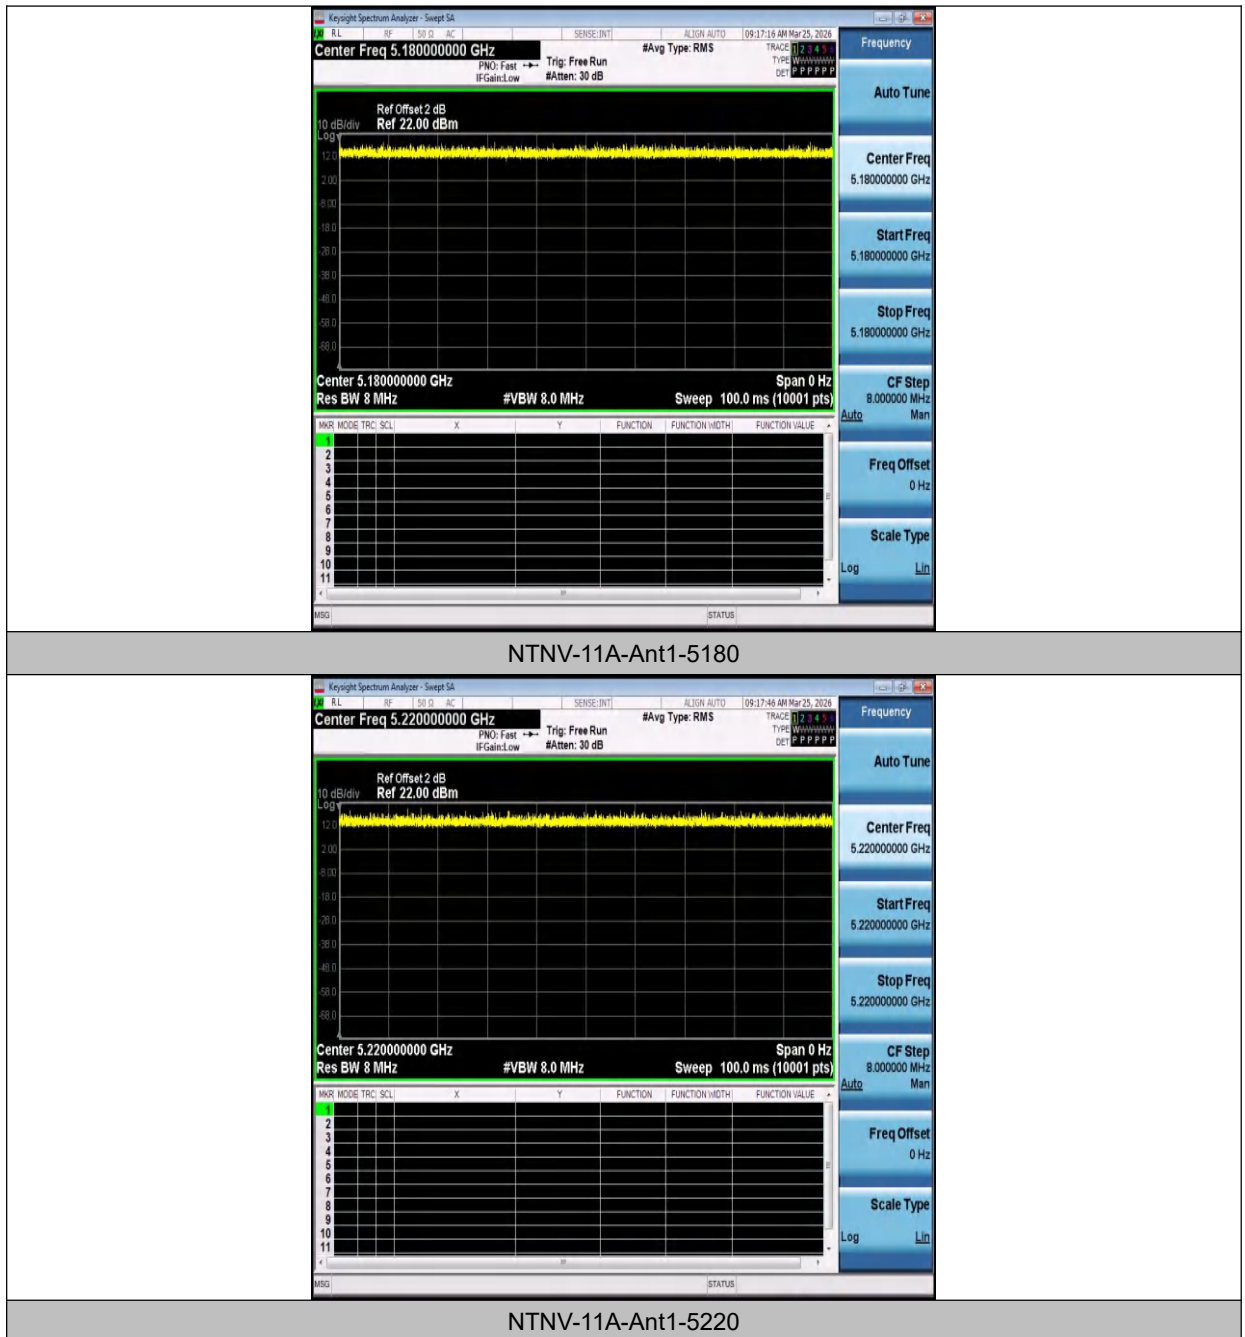

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

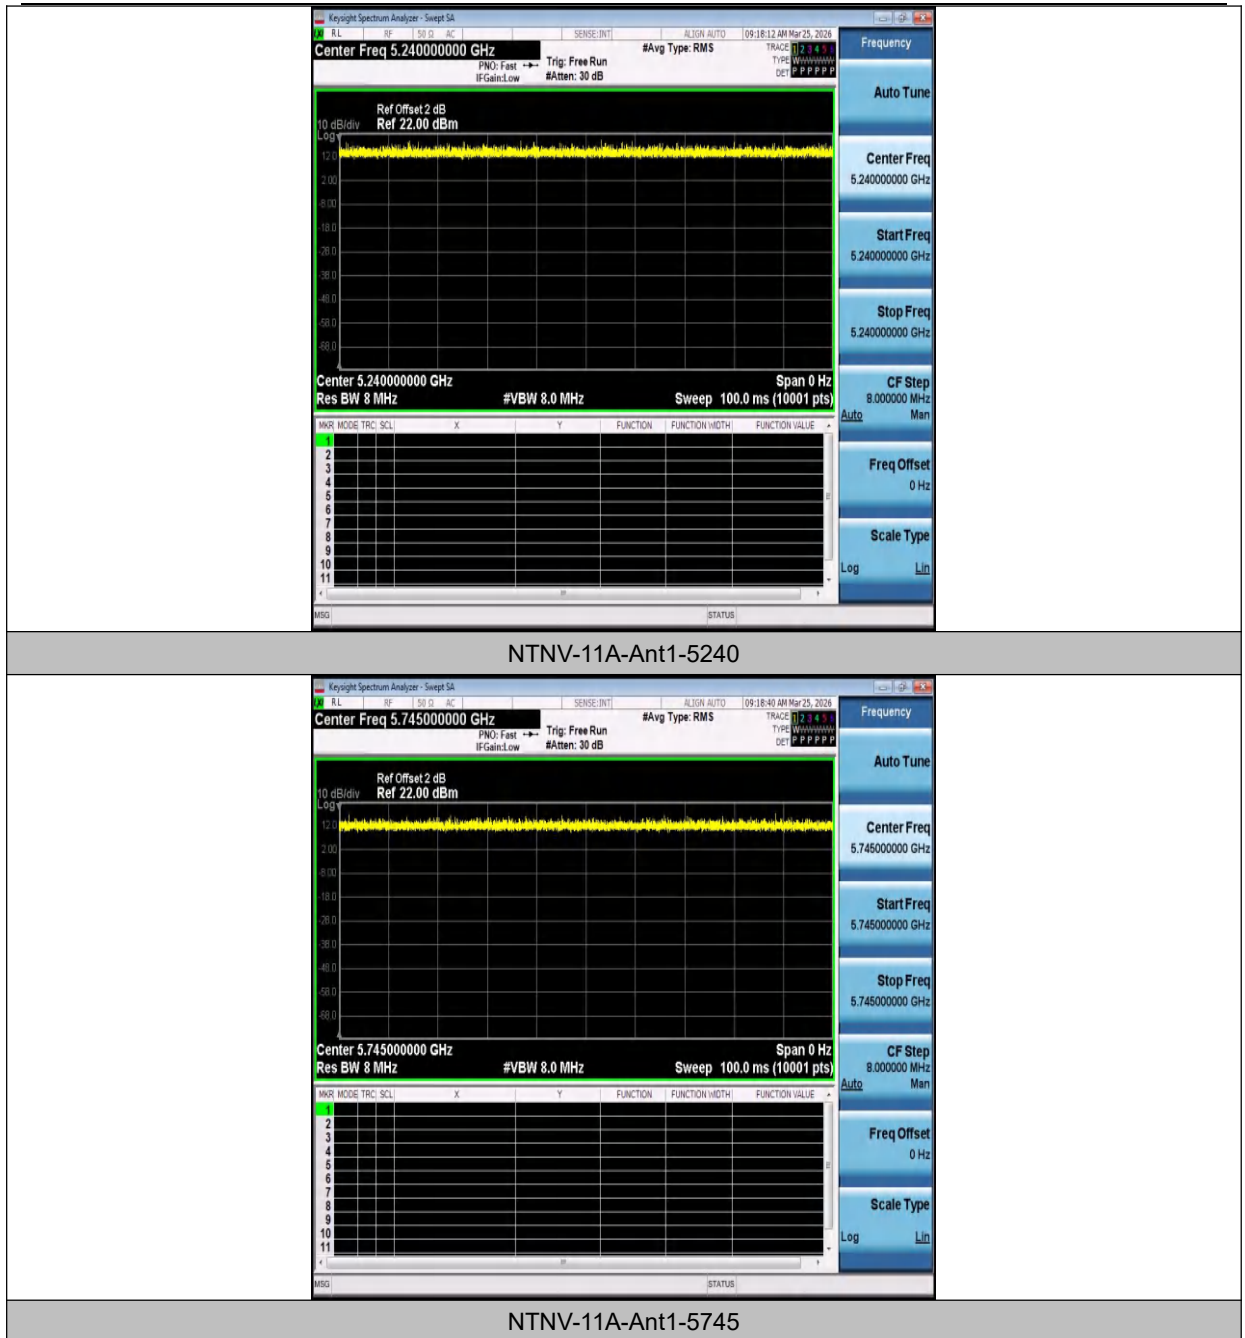

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

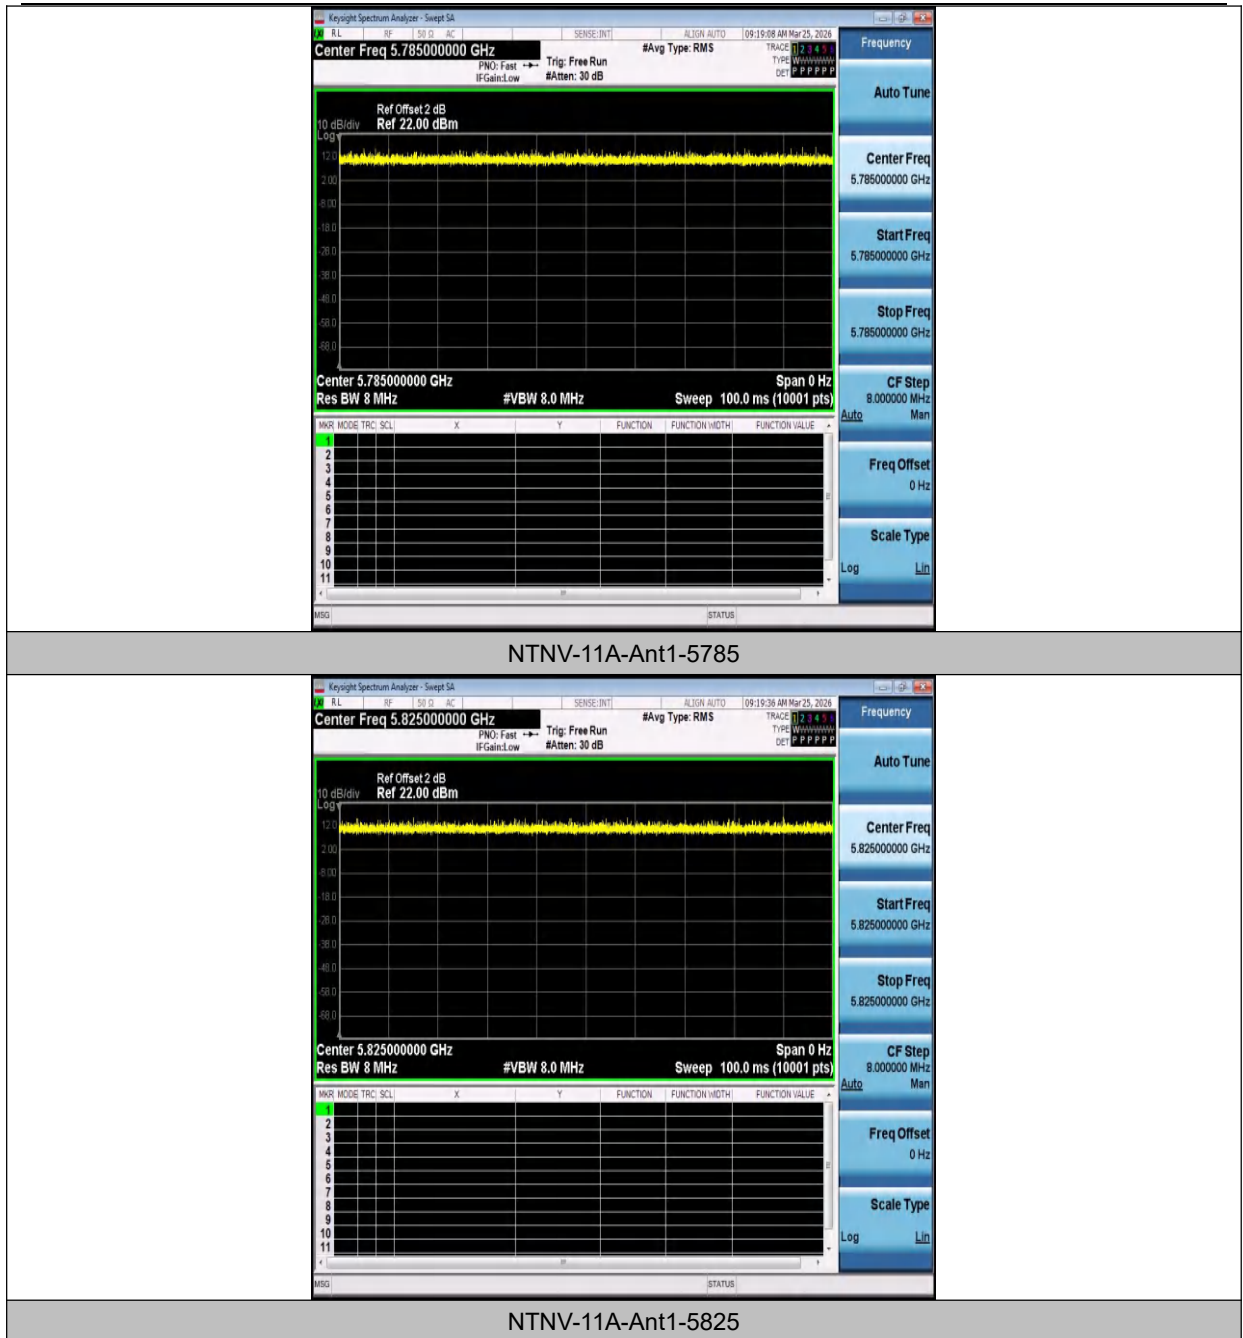

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

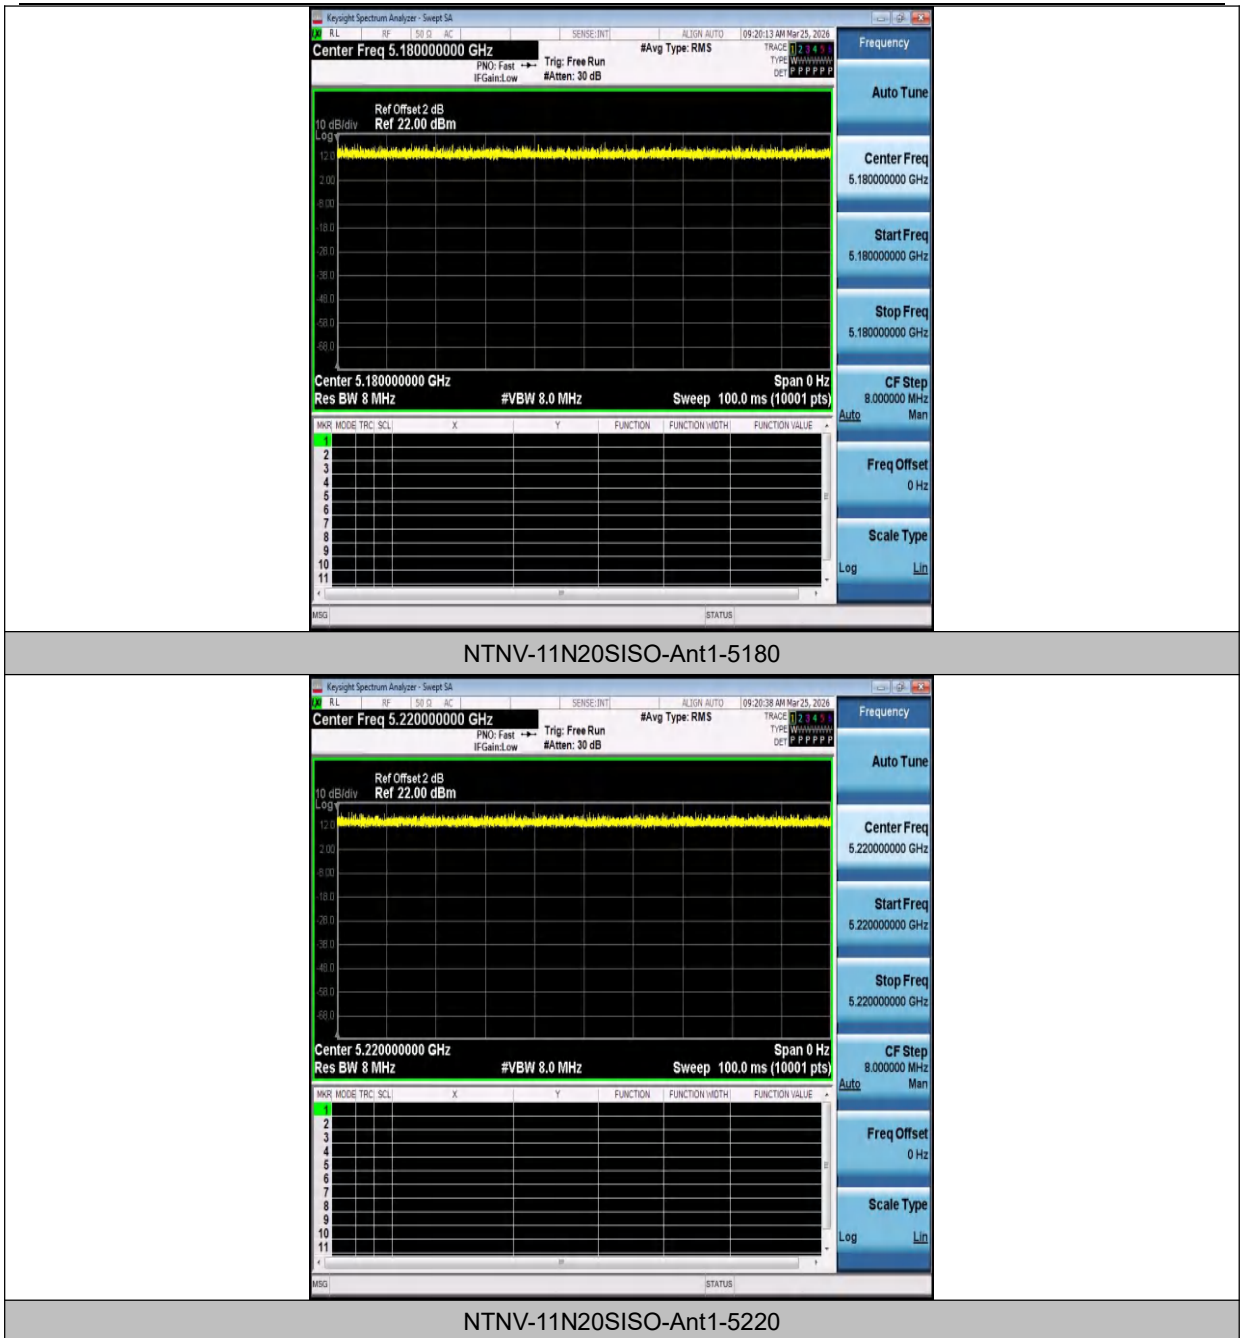

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

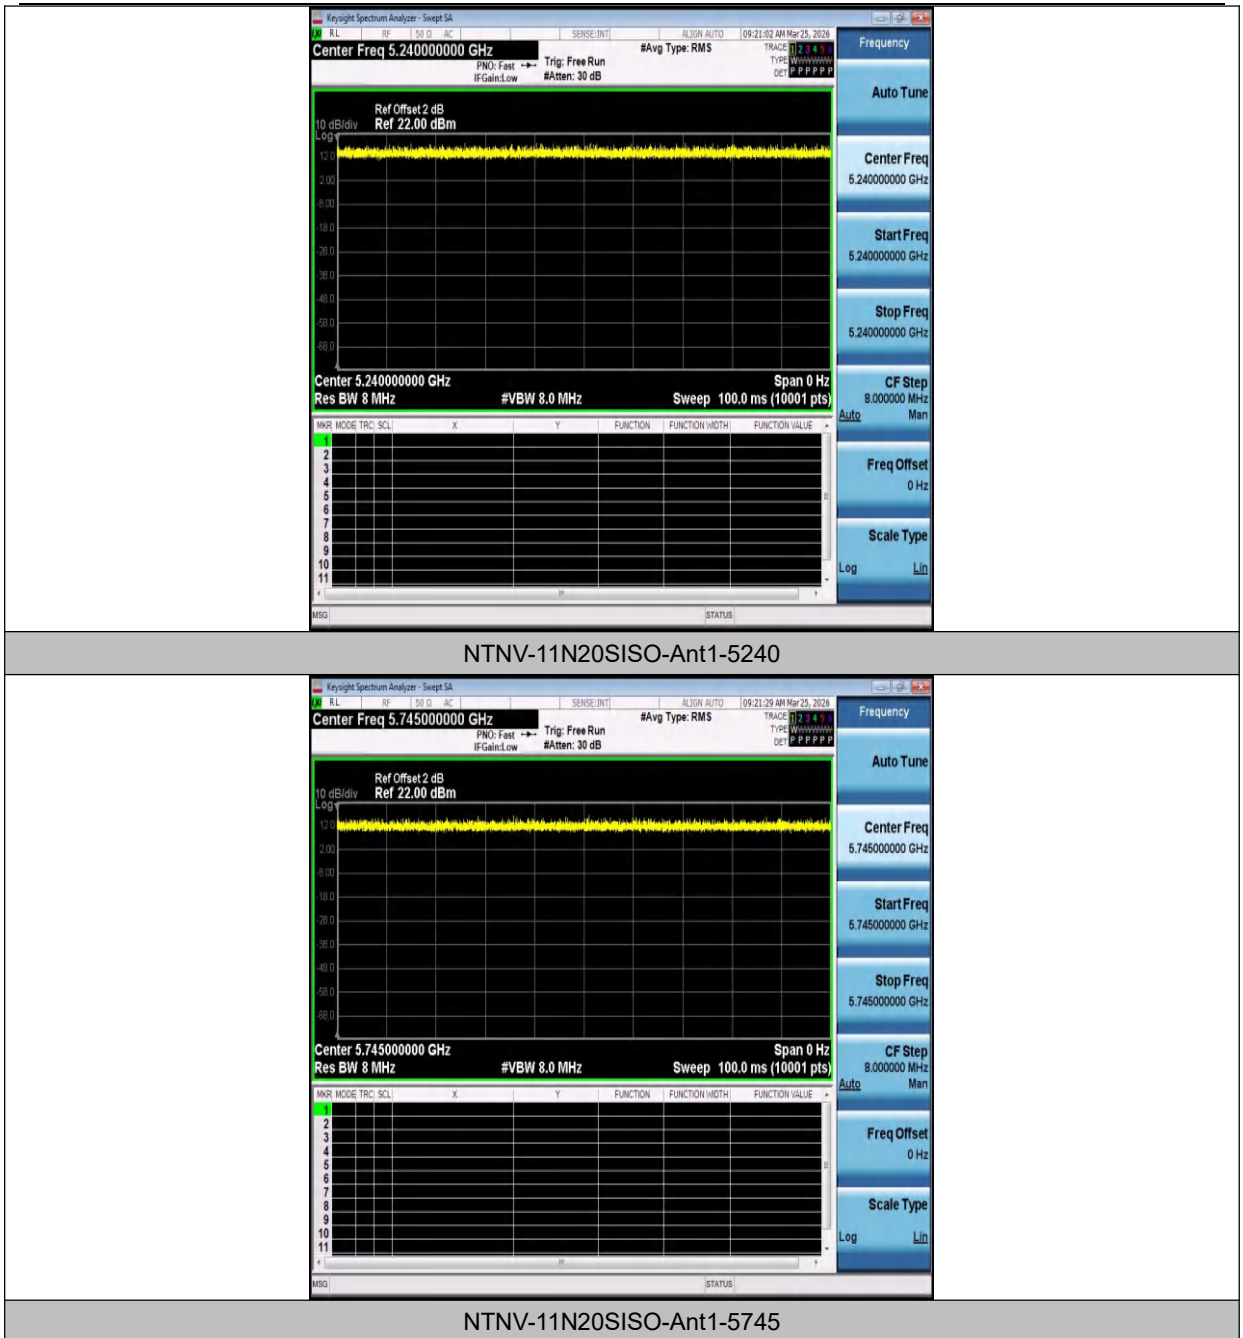

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

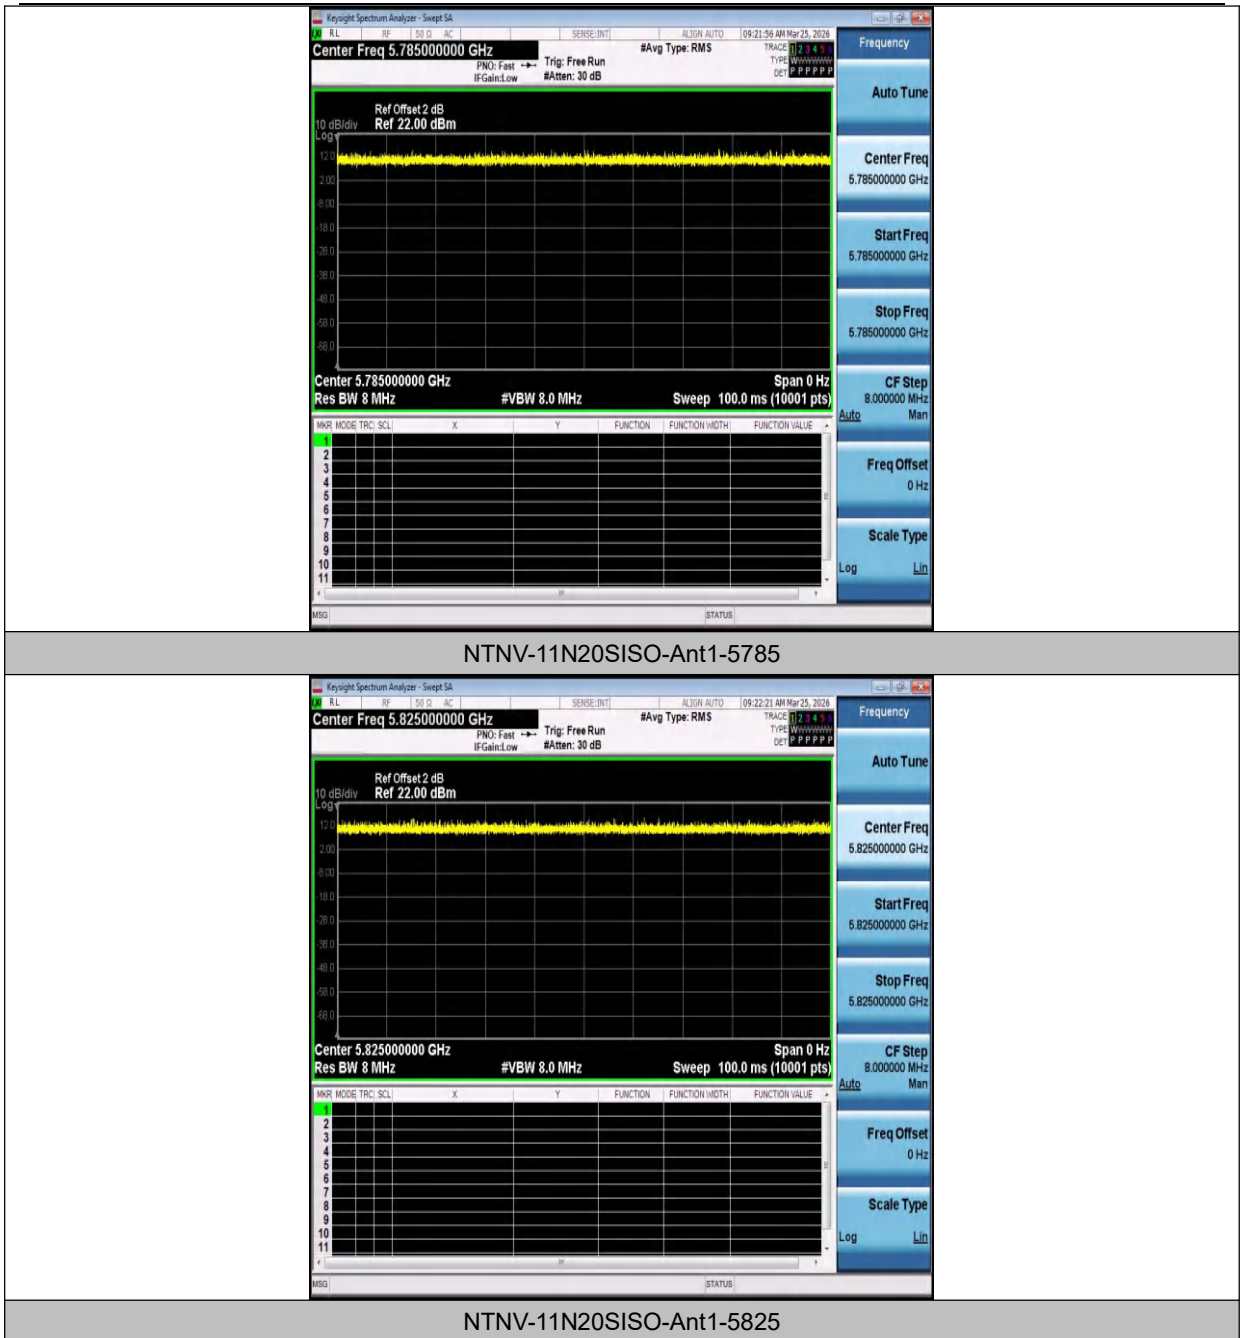

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

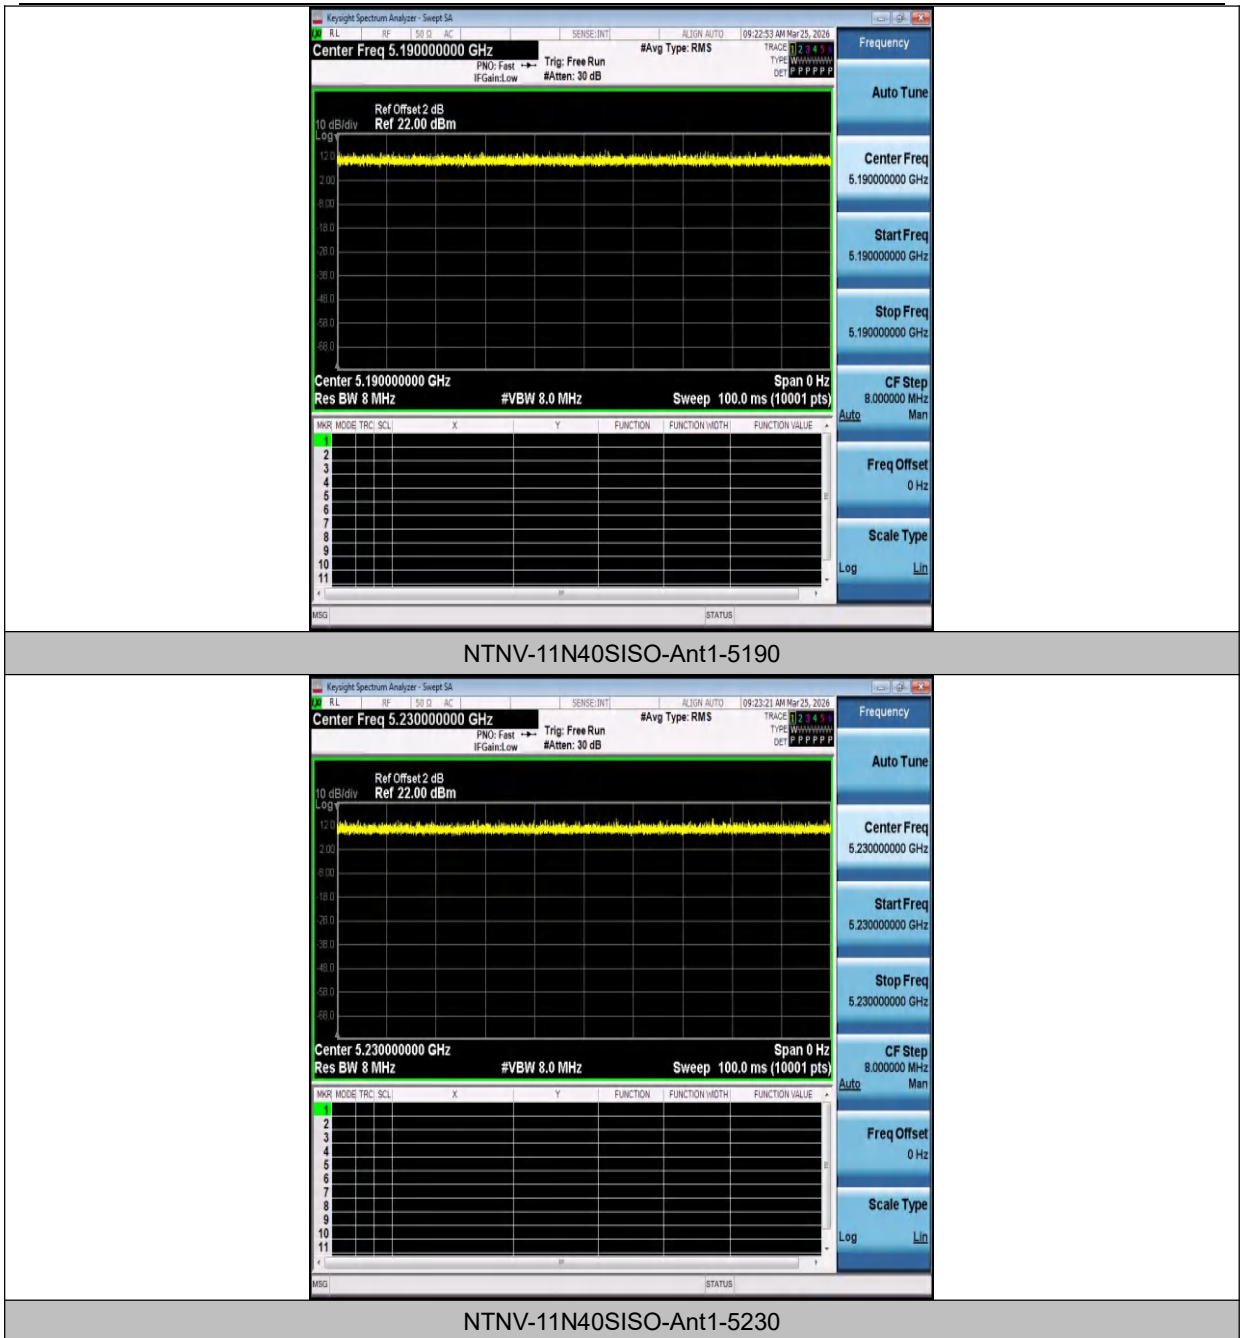

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

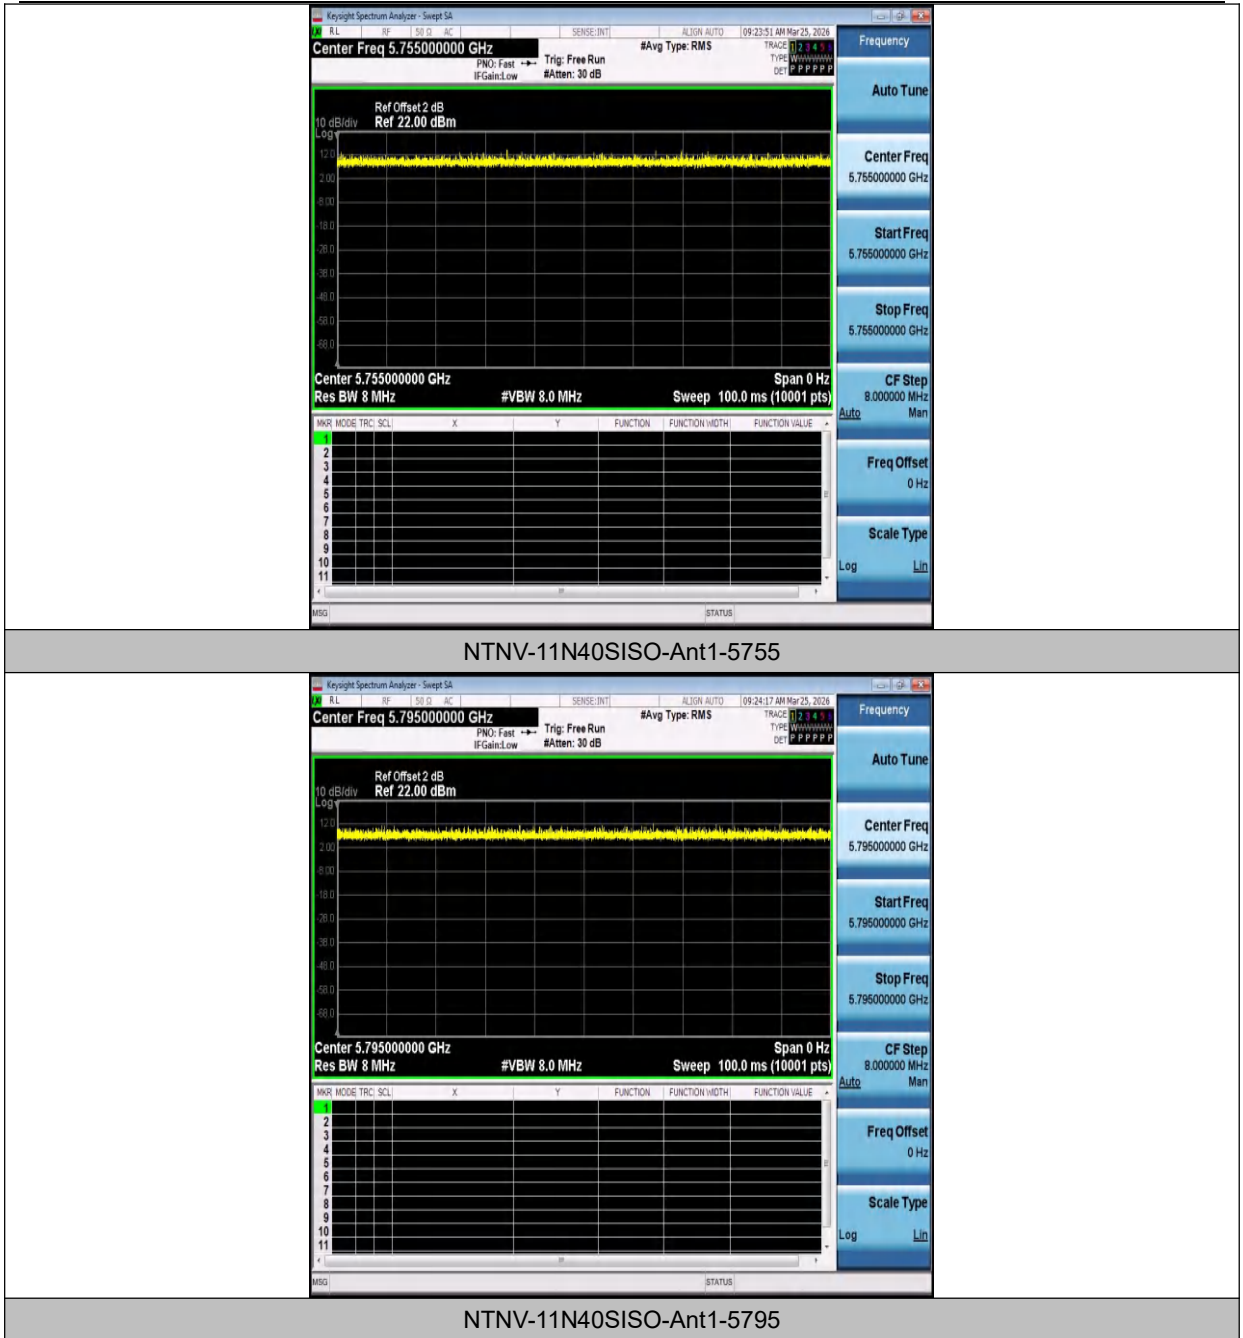

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	13.14	≤23.98	PASS
11A	Ant1	5220	13.67	≤23.98	PASS
11A	Ant1	5240	13.40	≤23.98	PASS
11A	Ant1	5745	14.20	≤30.00	PASS
11A	Ant1	5785	13.54	≤30.00	PASS
11A	Ant1	5825	13.53	≤30.00	PASS
11N20SISO	Ant1	5180	13.10	≤23.98	PASS
11N20SISO	Ant1	5220	13.43	≤23.98	PASS
11N20SISO	Ant1	5240	13.34	≤23.98	PASS
11N20SISO	Ant1	5745	14.63	≤30.00	PASS
11N20SISO	Ant1	5785	13.60	≤30.00	PASS
11N20SISO	Ant1	5825	13.69	≤30.00	PASS
11N40SISO	Ant1	5190	14.64	≤23.98	PASS
11N40SISO	Ant1	5230	13.80	≤23.98	PASS
11N40SISO	Ant1	5755	14.99	≤30.00	PASS
11N40SISO	Ant1	5795	14.22	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

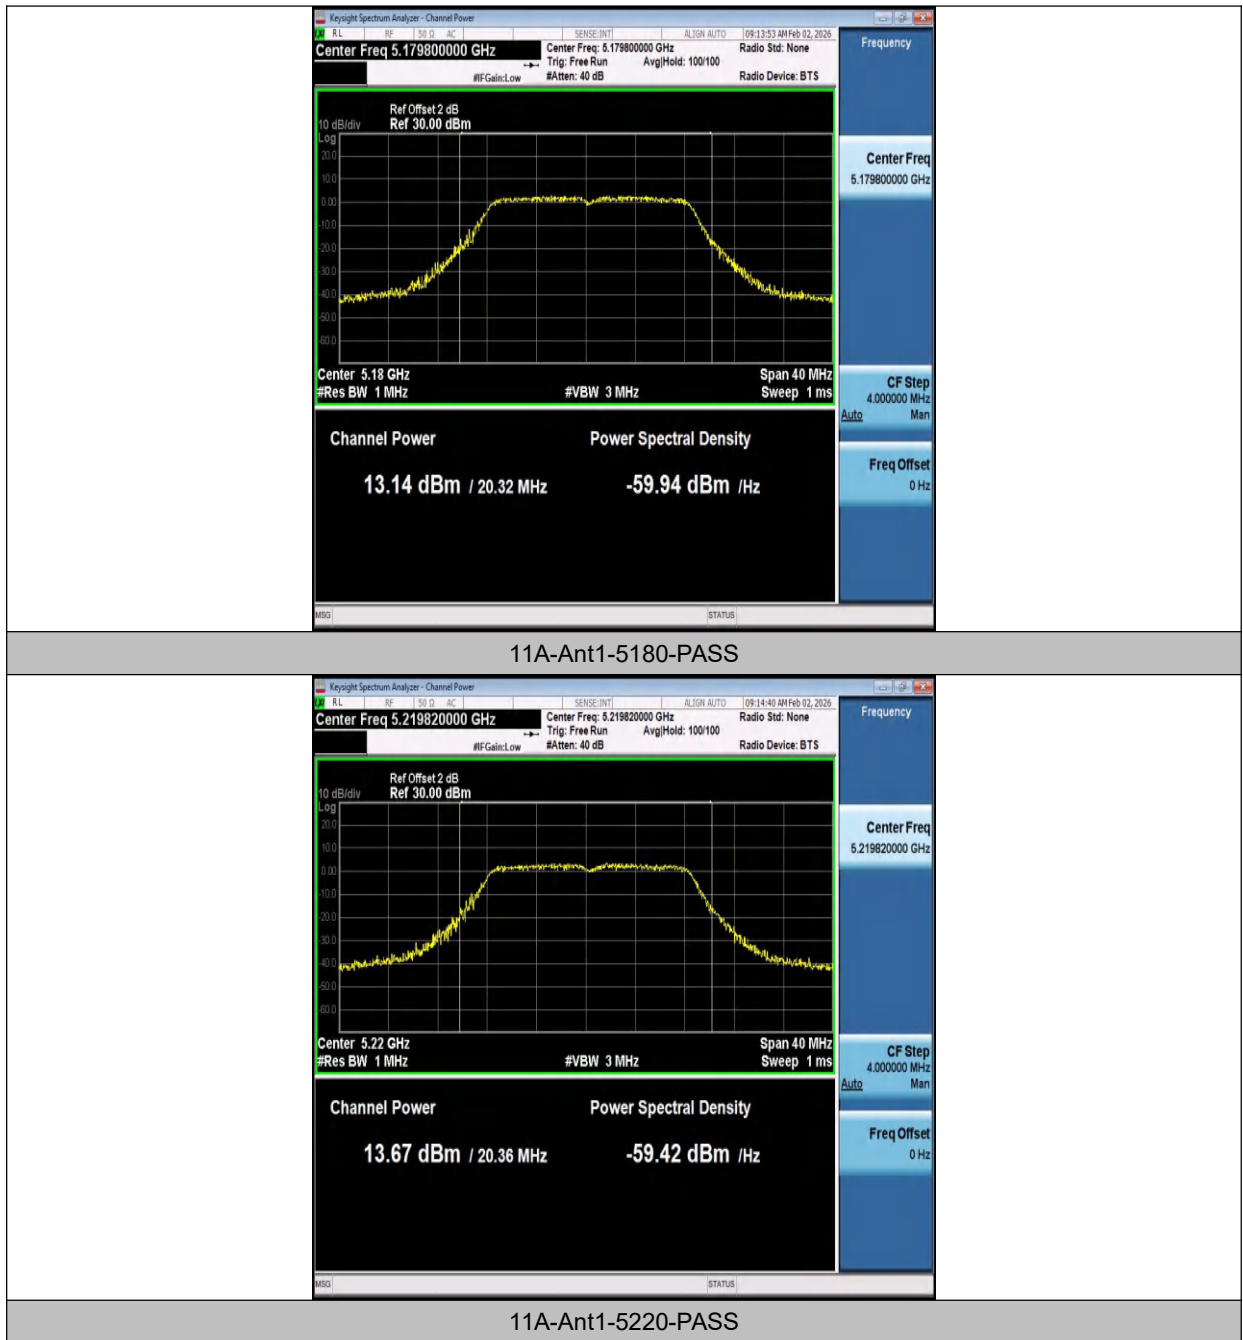

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

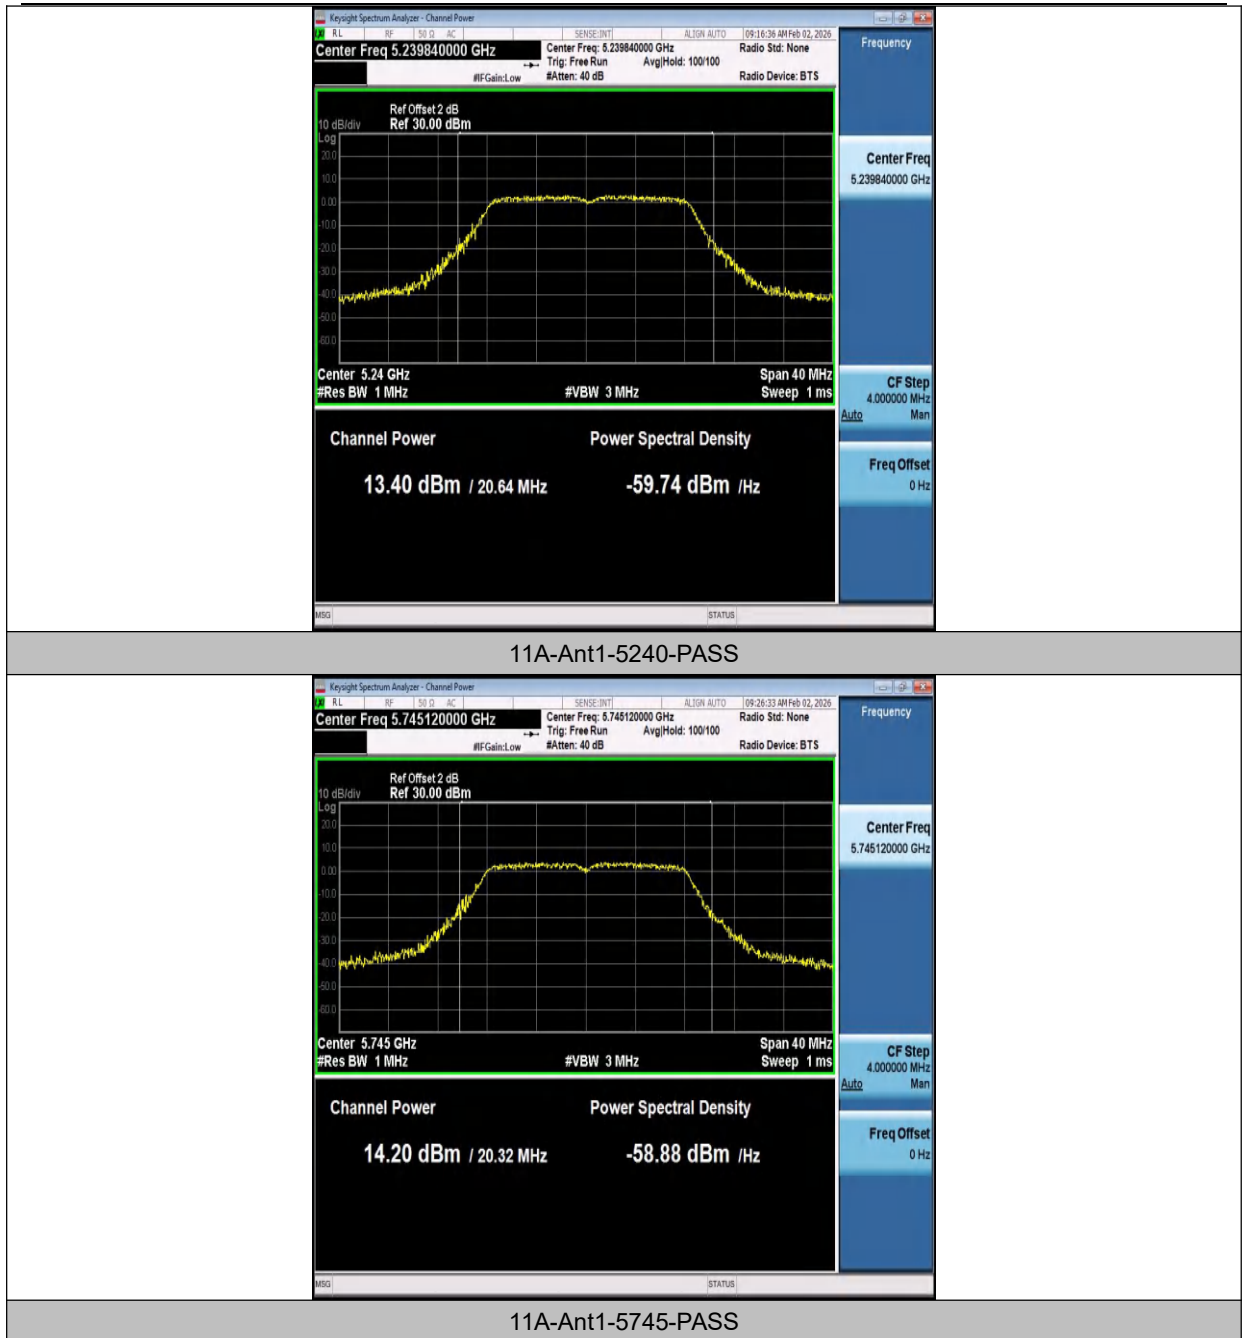

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

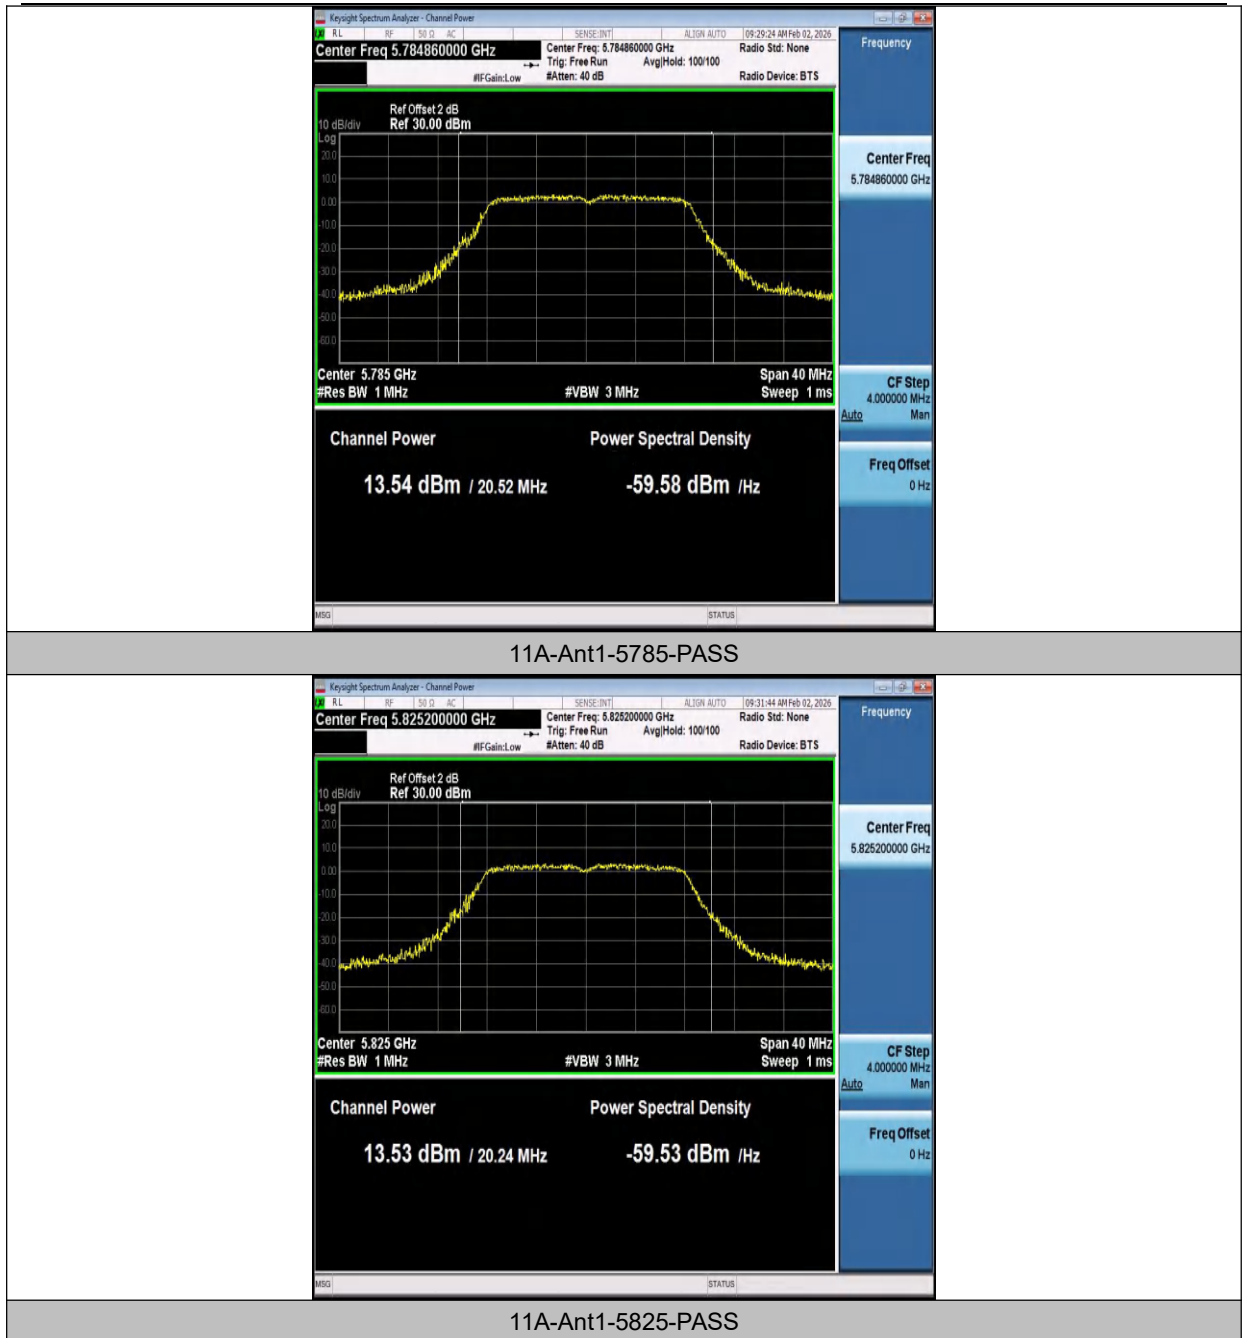

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

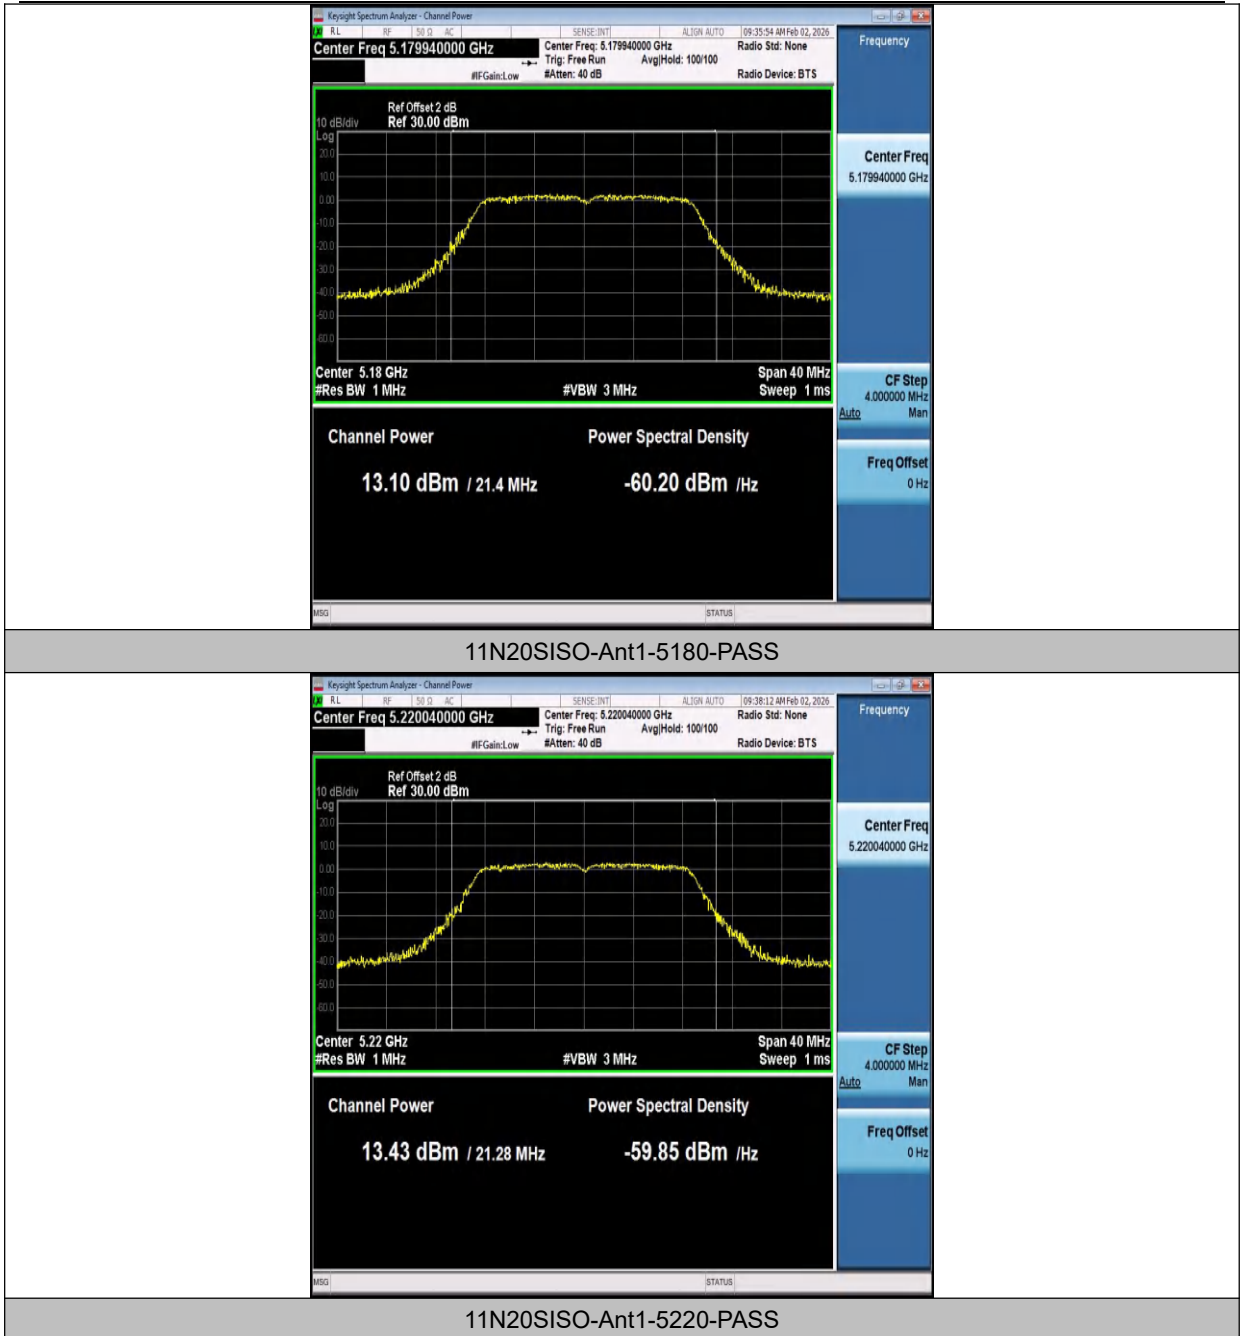

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

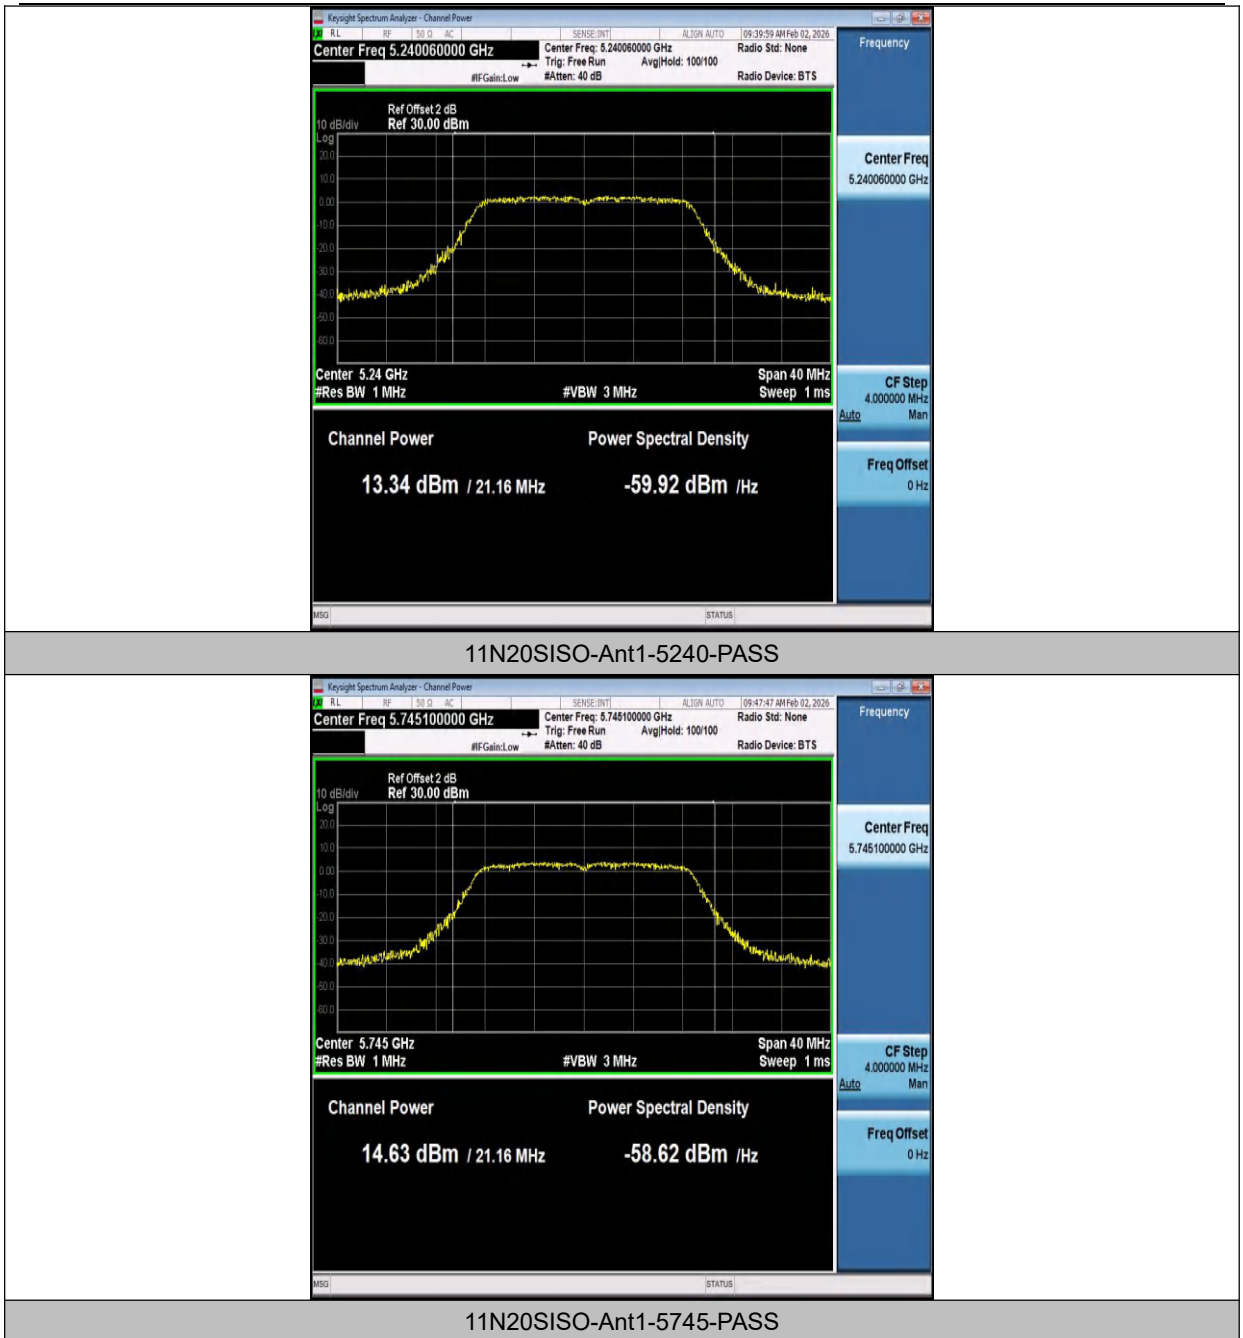

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

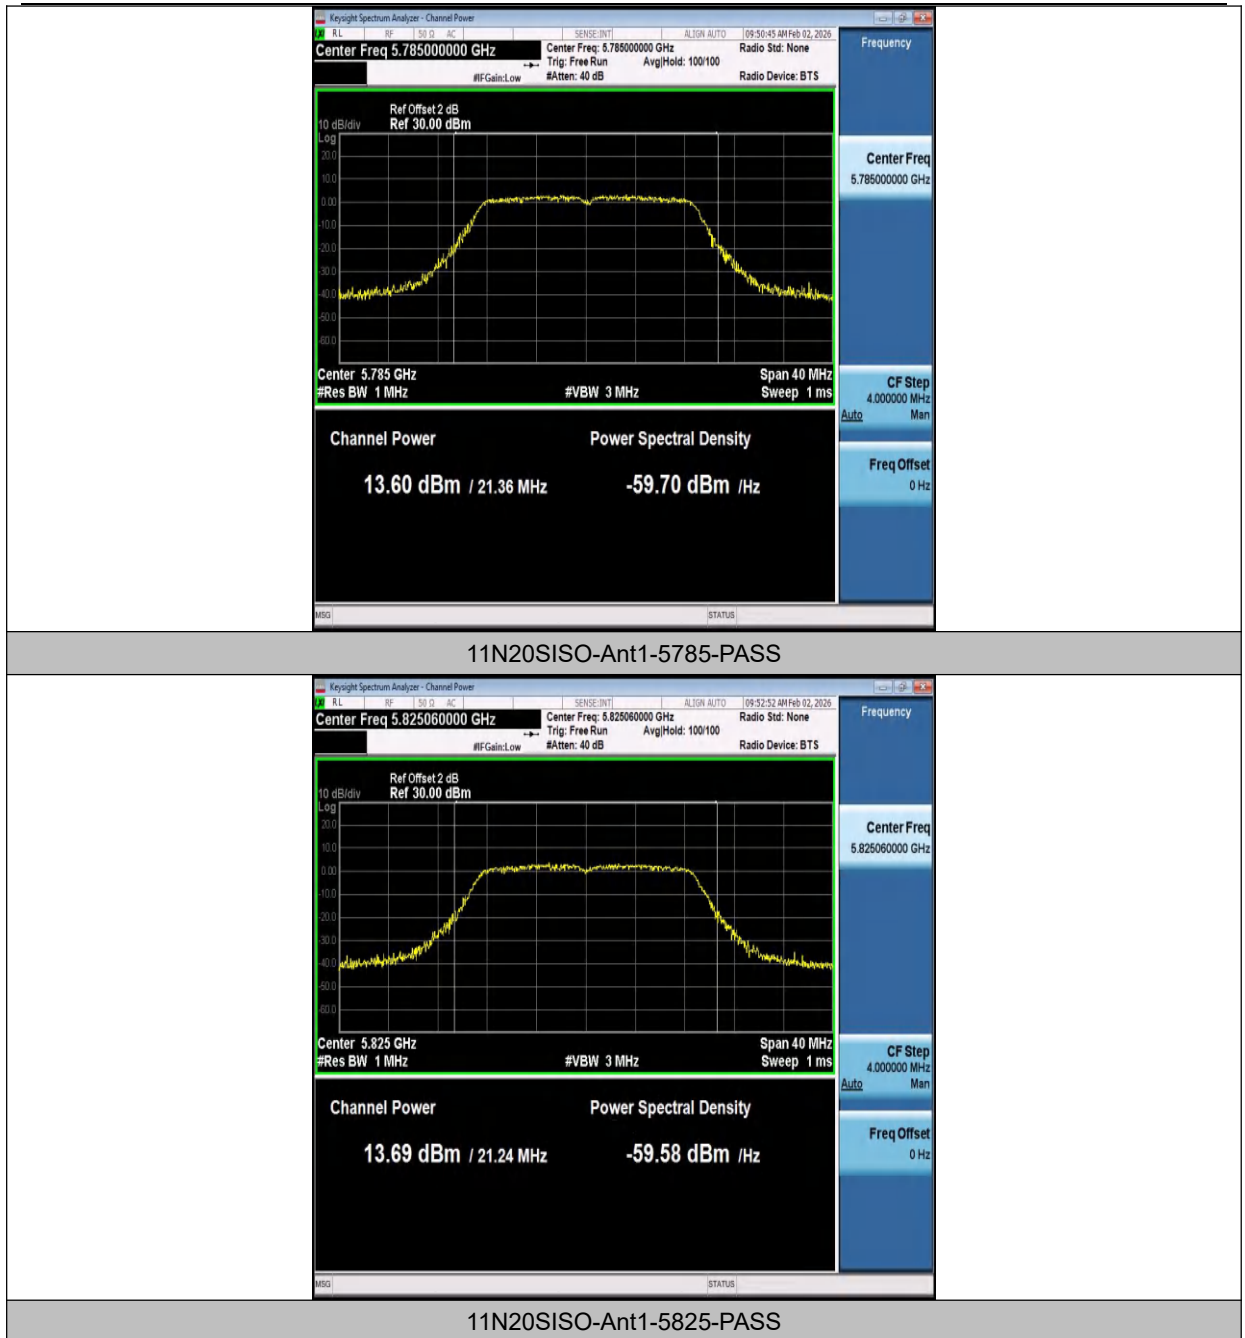

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

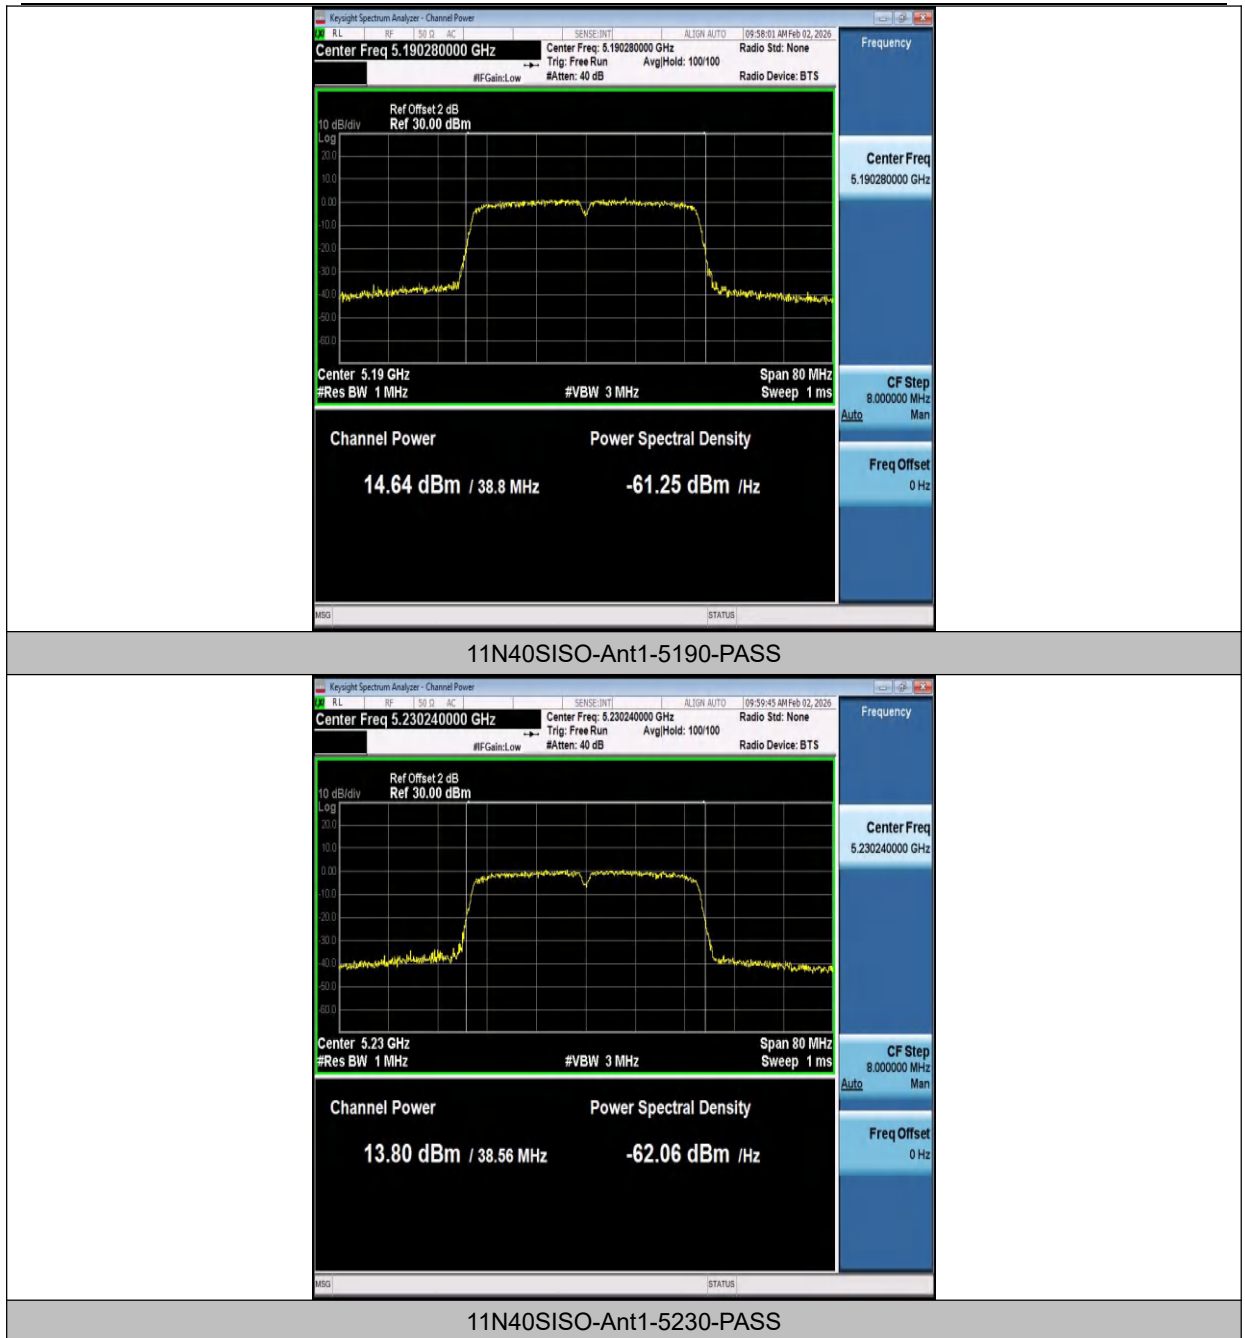

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

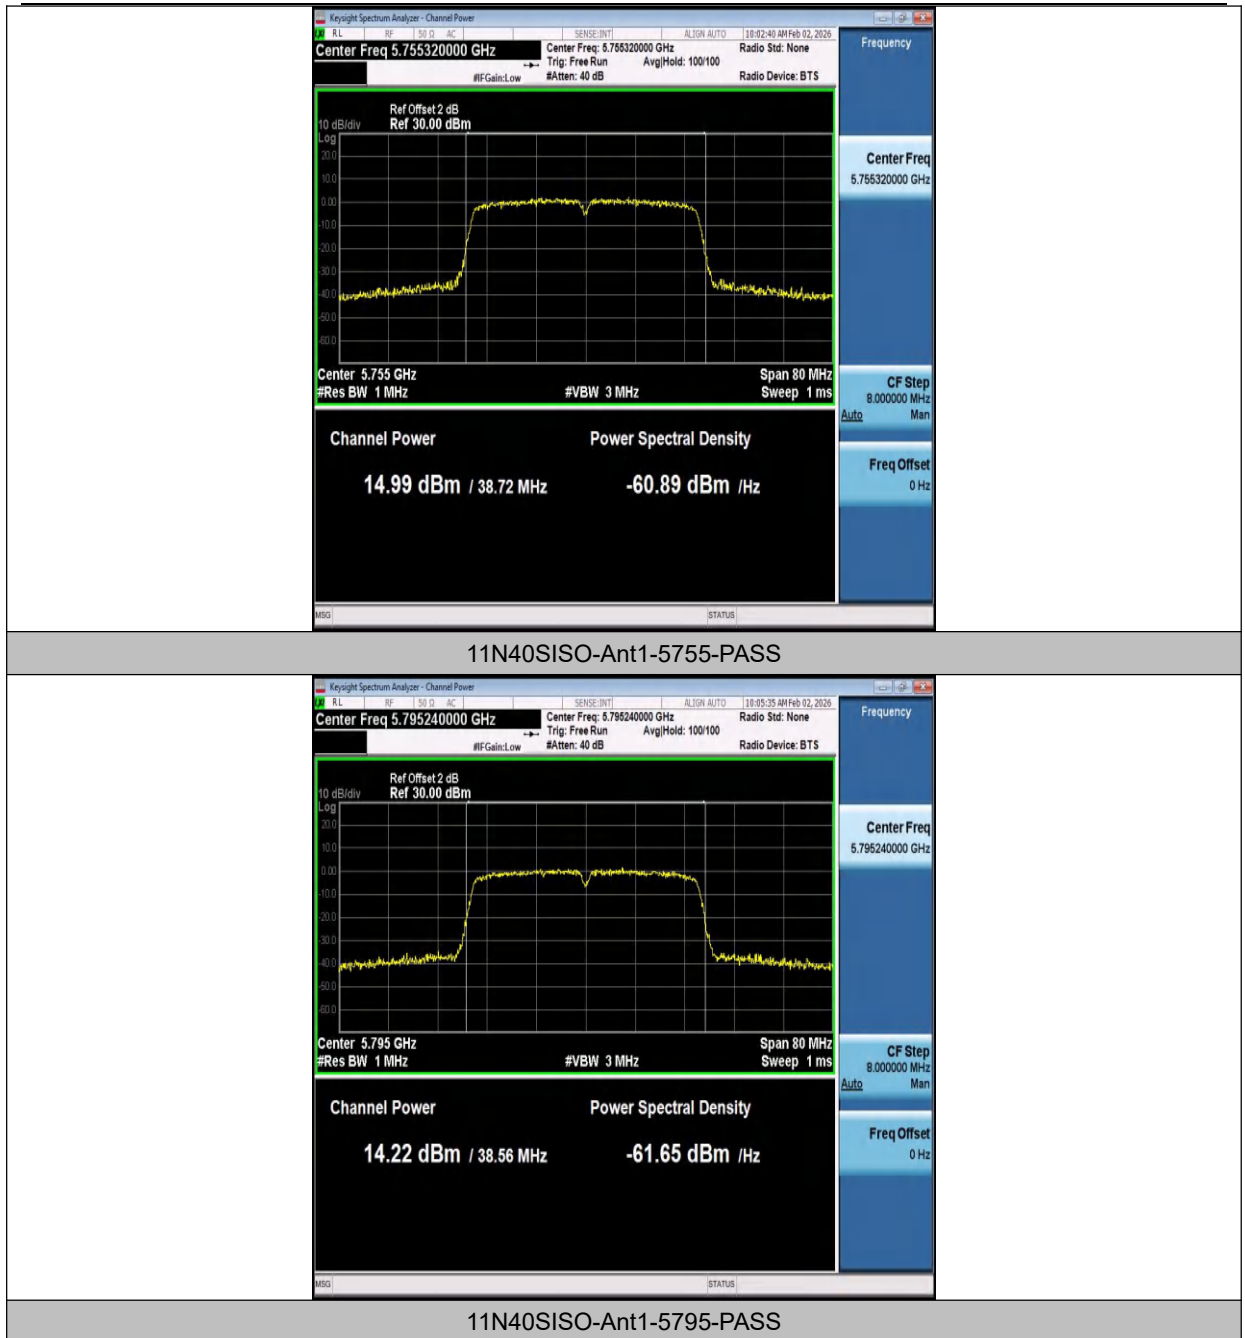

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-2.26	≤11.00	PASS
11A	Ant1	5220	-1.93	≤11.00	PASS
11A	Ant1	5240	-2.25	≤11.00	PASS
11N20SISO	Ant1	5180	-2.91	≤11.00	PASS
11N20SISO	Ant1	5220	-2.42	≤11.00	PASS
11N20SISO	Ant1	5240	-2.67	≤11.00	PASS
11N40SISO	Ant1	5190	-4.26	≤11.00	PASS
11N40SISO	Ant1	5230	-4.73	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Result B4


Test Mode	Antenna	Frequency[MHz]	Result[dBm/500KHz]	Limit[dBm/500KHz]	Verdict
11A	Ant1	5745	-4.21	≤30.00	PASS
11A	Ant1	5785	-4.90	≤30.00	PASS
11A	Ant1	5825	-4.91	≤30.00	PASS
11N20SISO	Ant1	5745	-4.45	≤30.00	PASS
11N20SISO	Ant1	5785	-5.11	≤30.00	PASS
11N20SISO	Ant1	5825	-5.17	≤30.00	PASS
11N40SISO	Ant1	5755	-6.59	≤30.00	PASS
11N40SISO	Ant1	5795	-7.35	≤30.00	PASS

Note:

1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (2.22dB)


Test Graphs B1

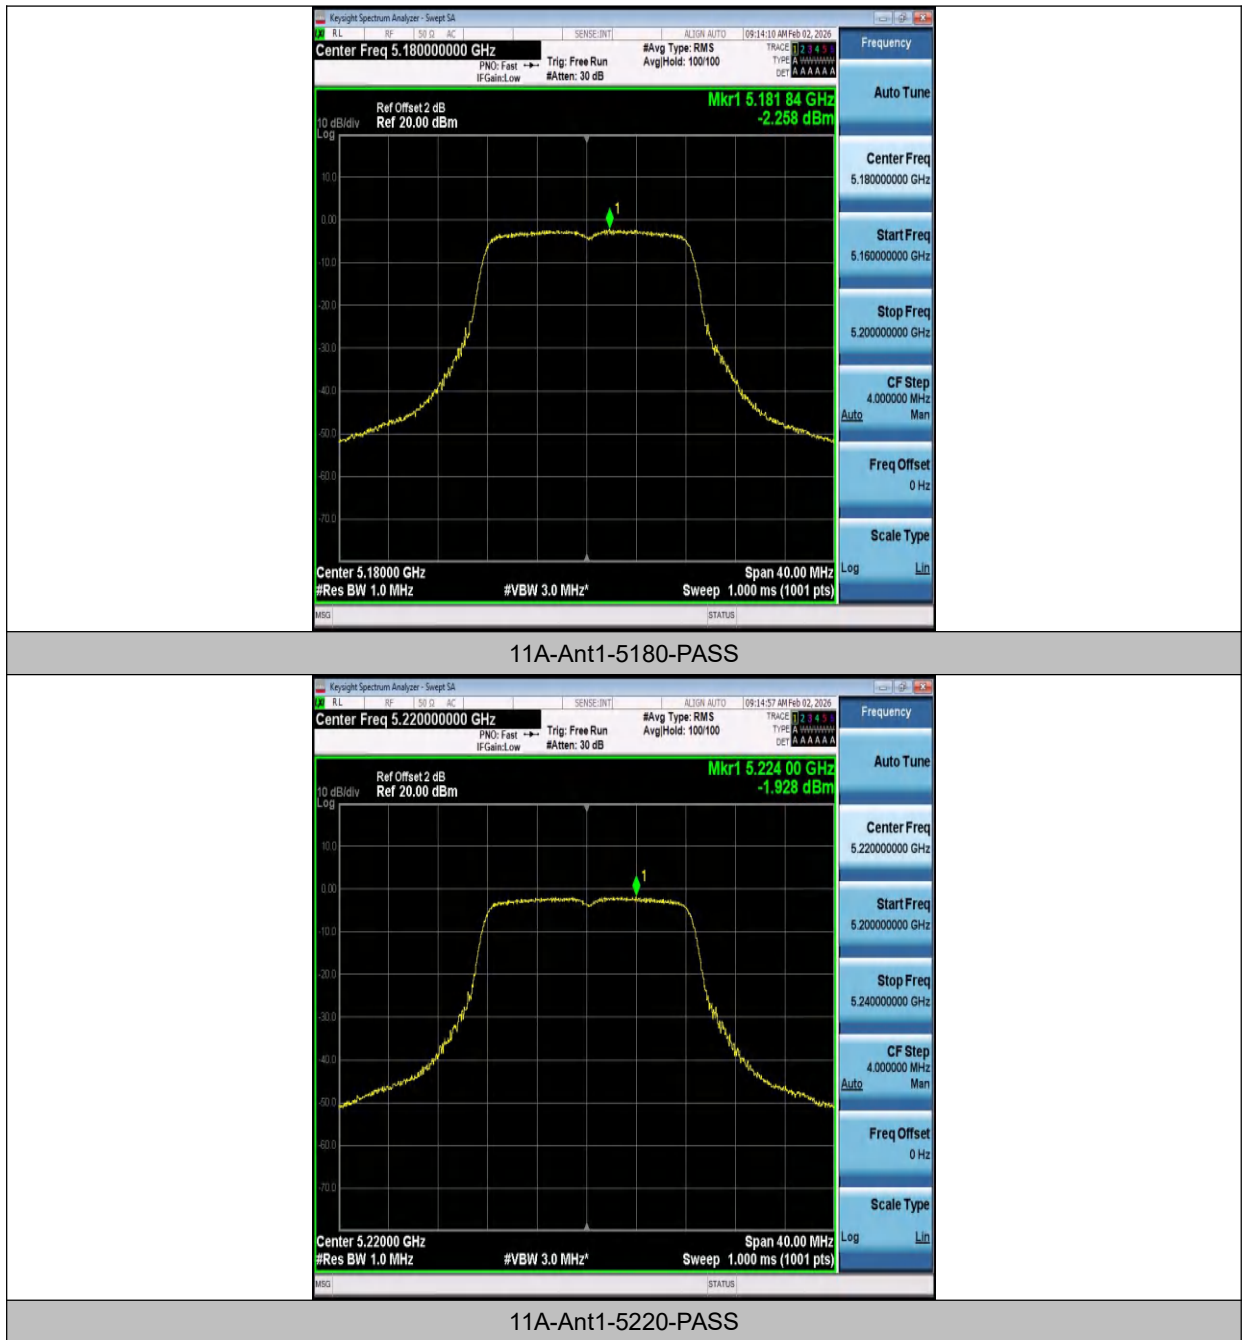

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

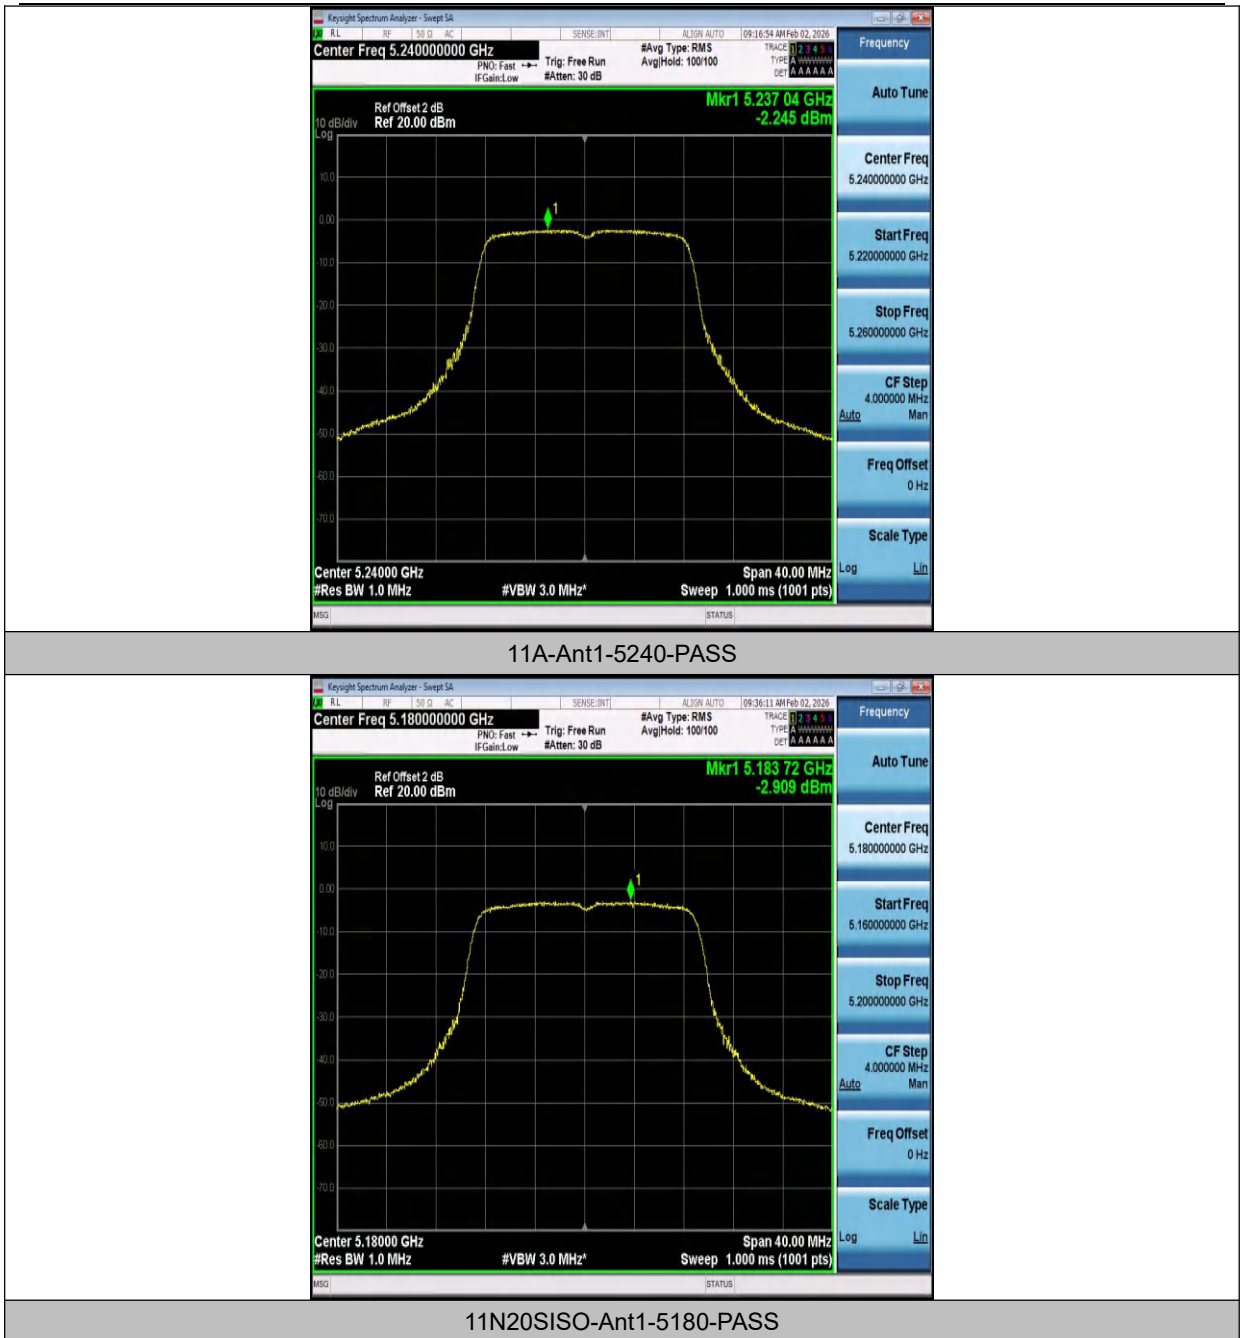

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

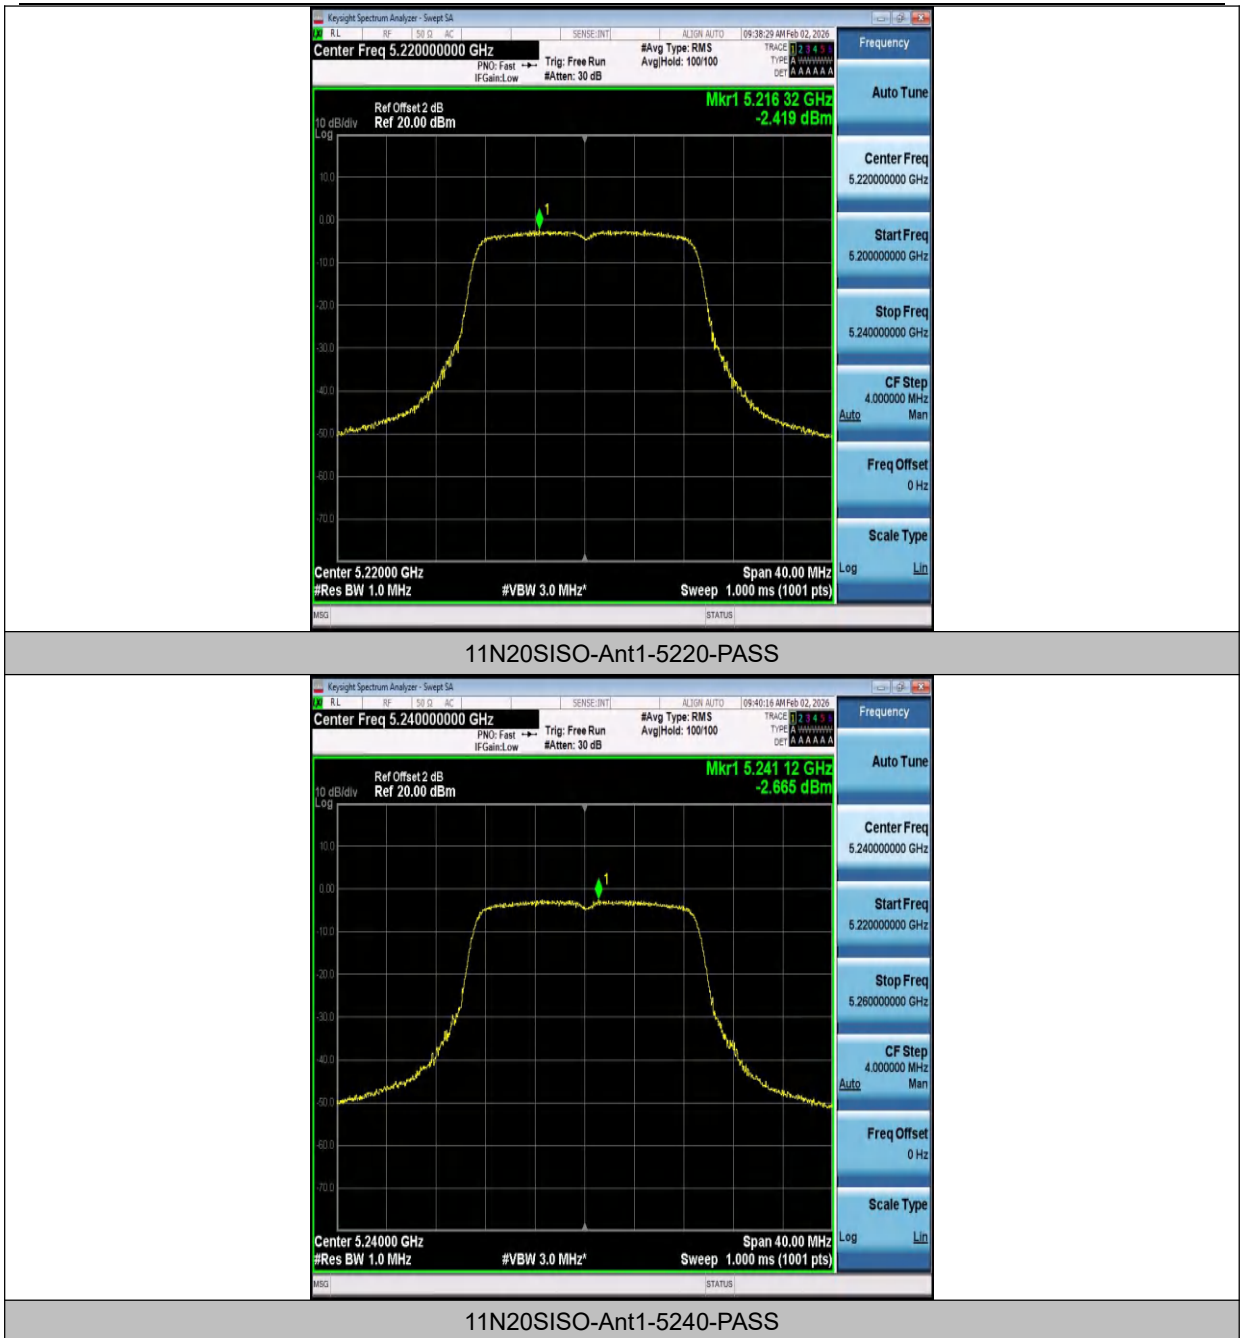

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

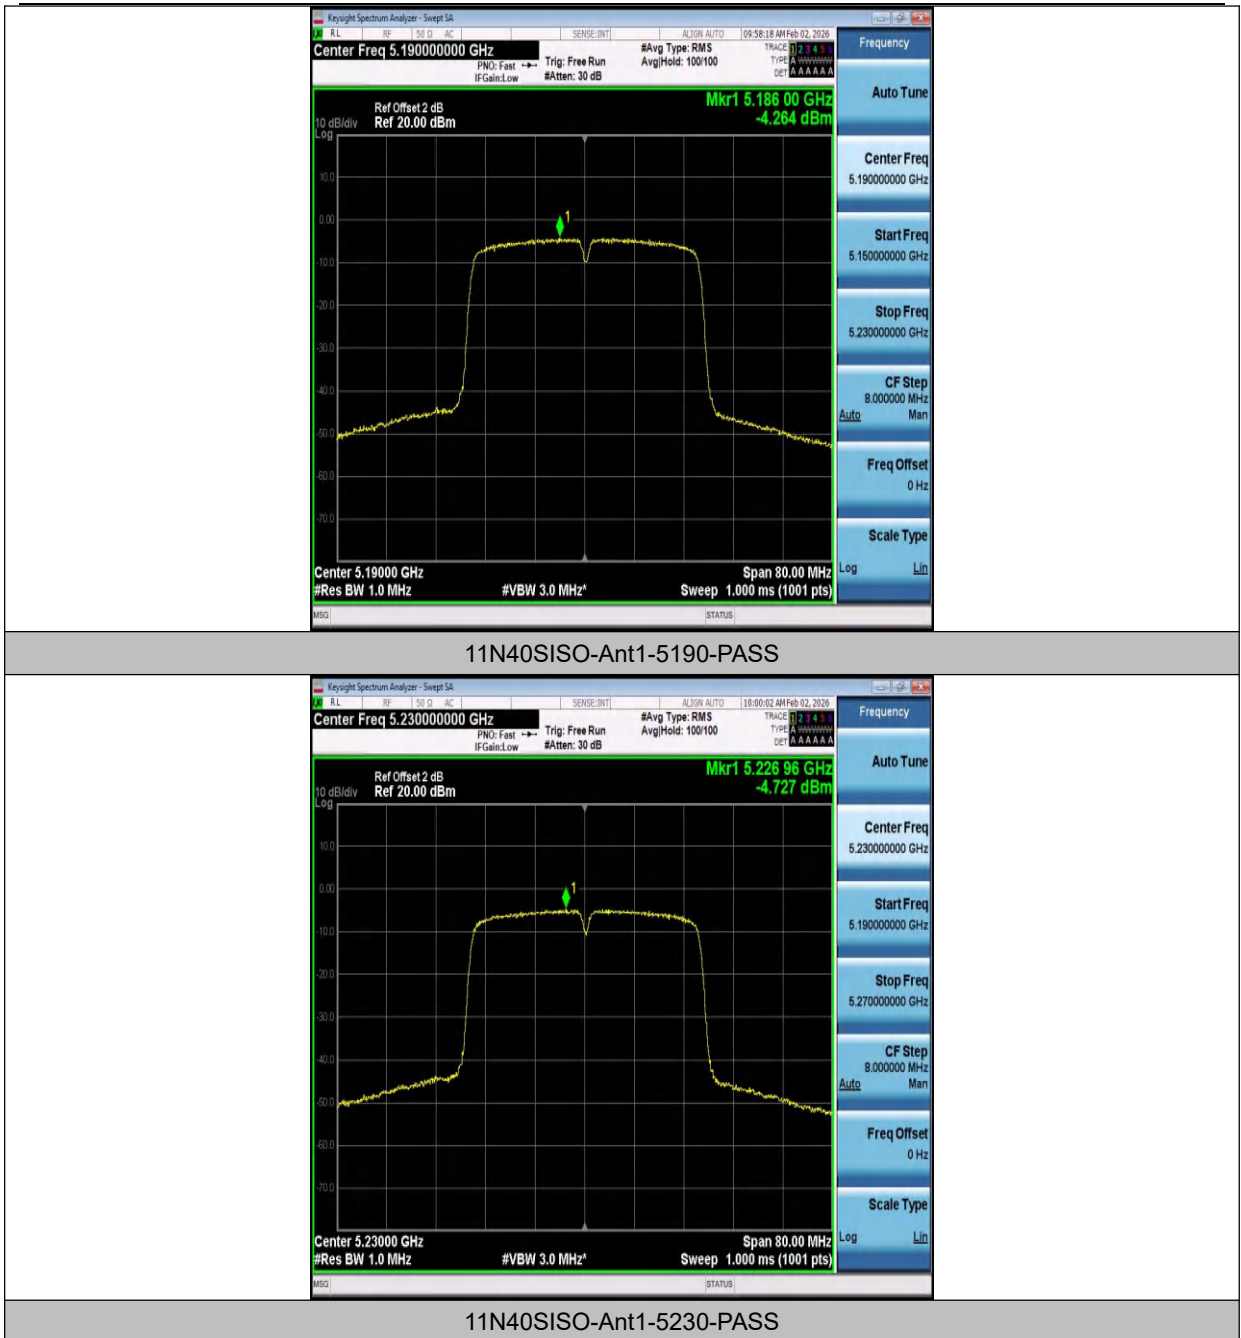


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

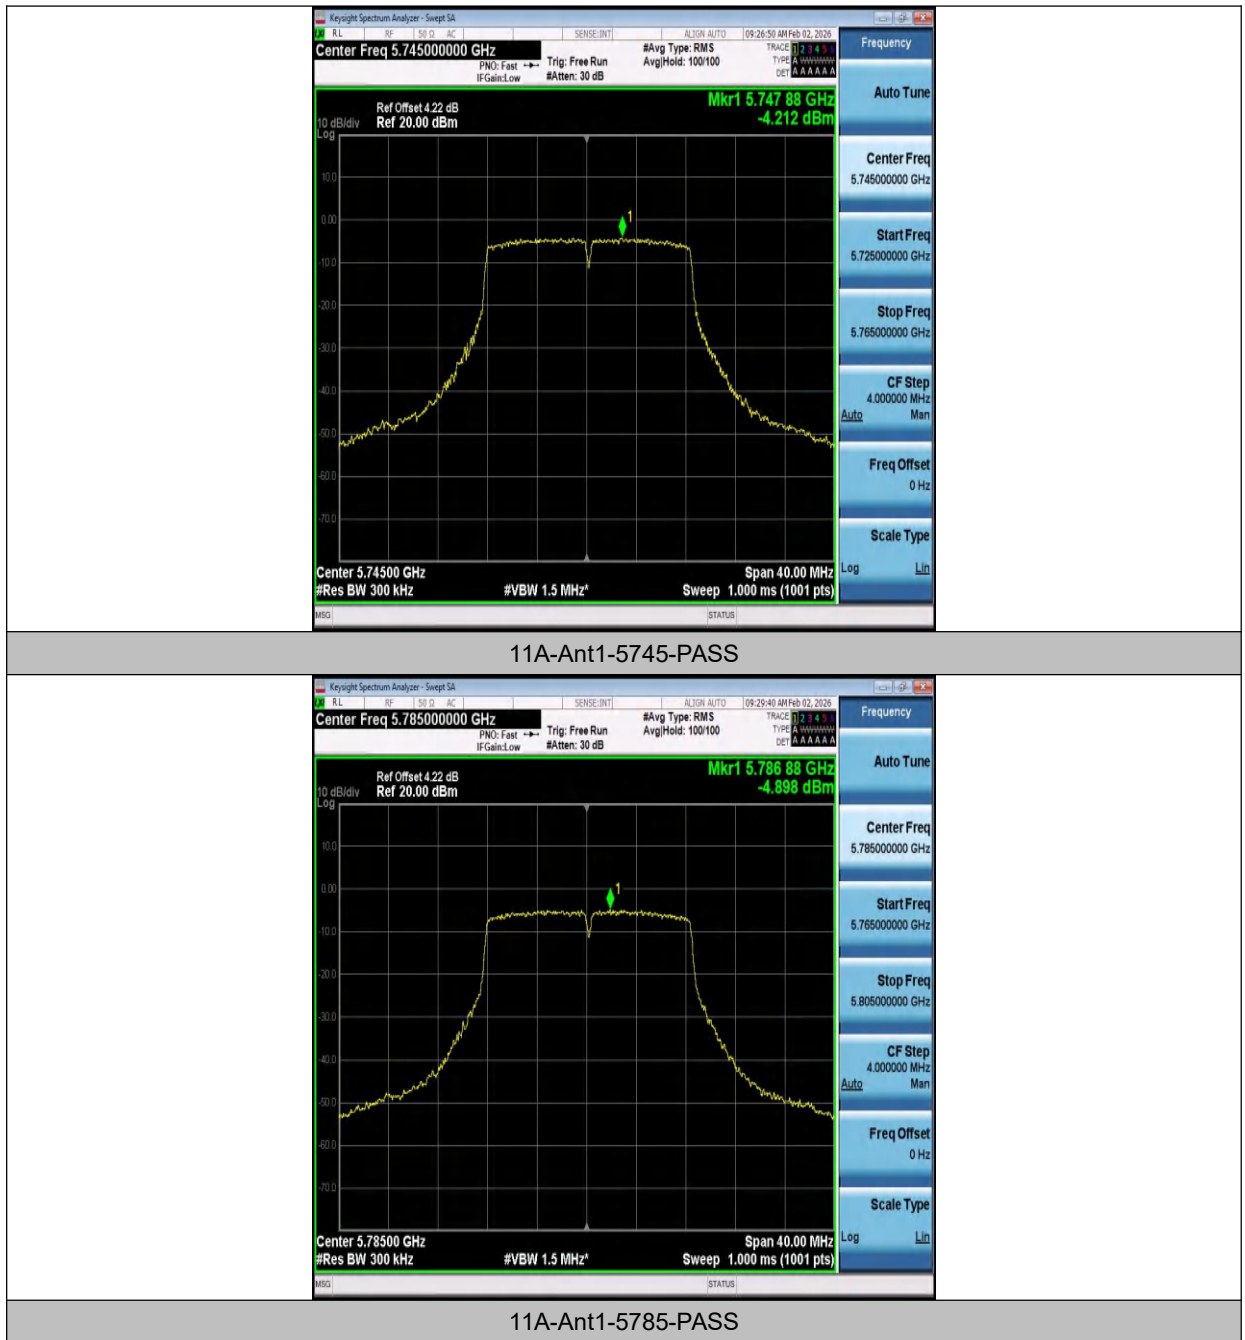

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

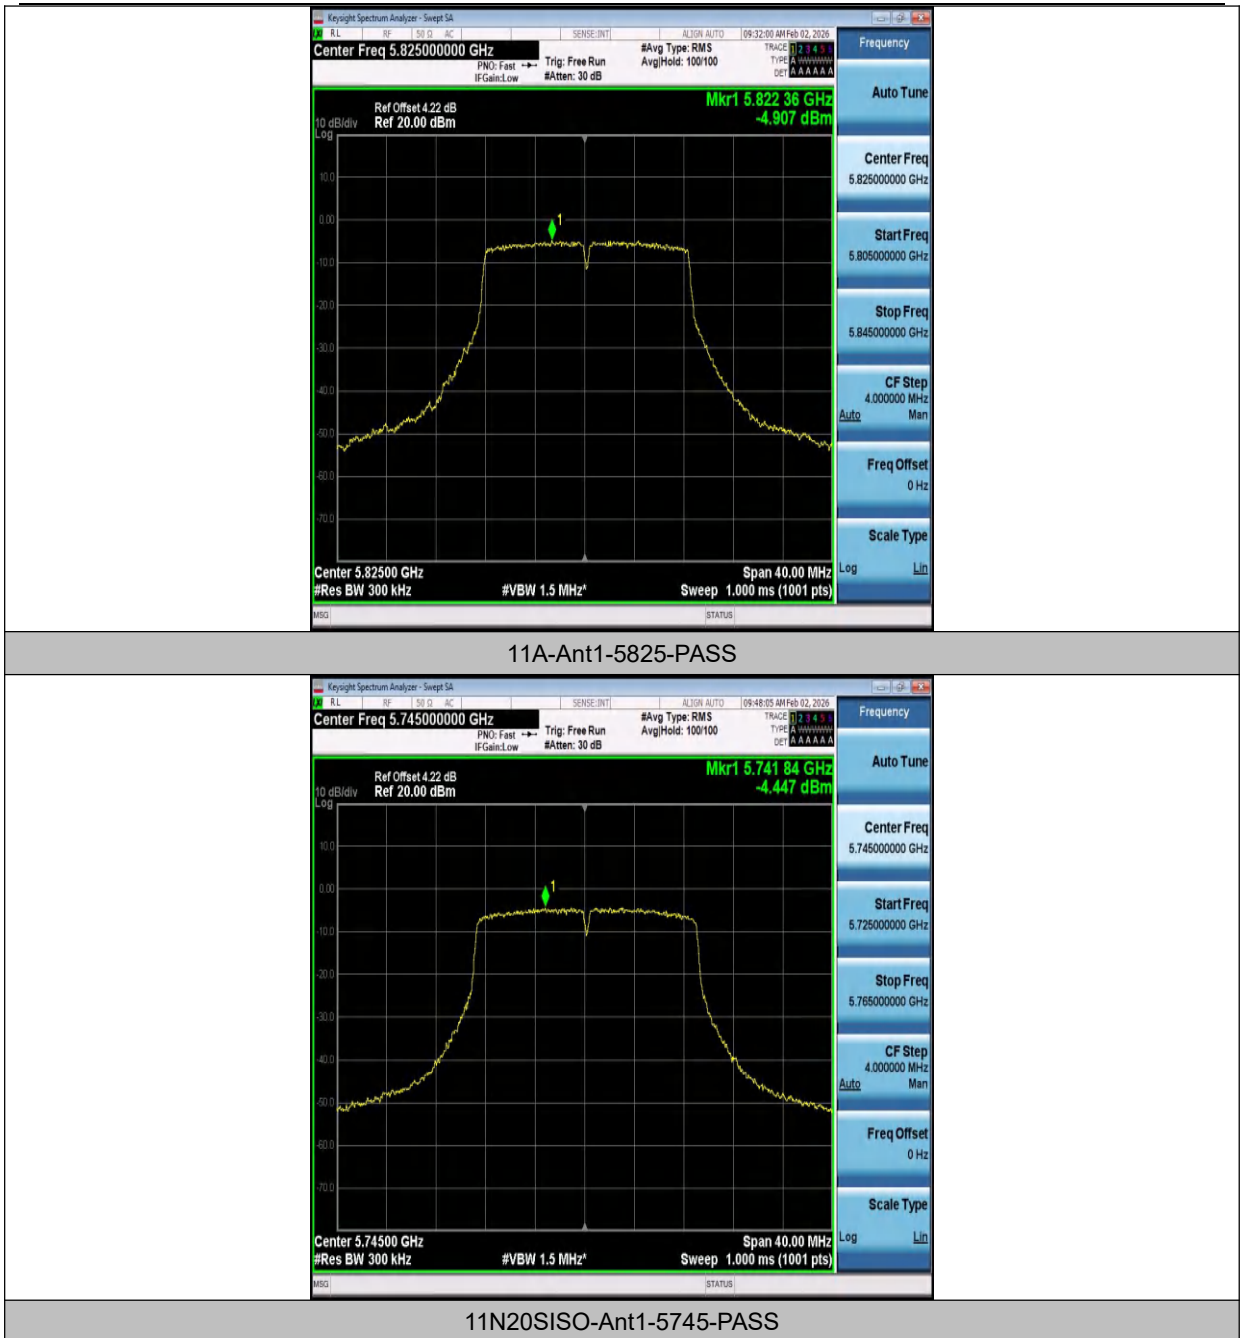

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

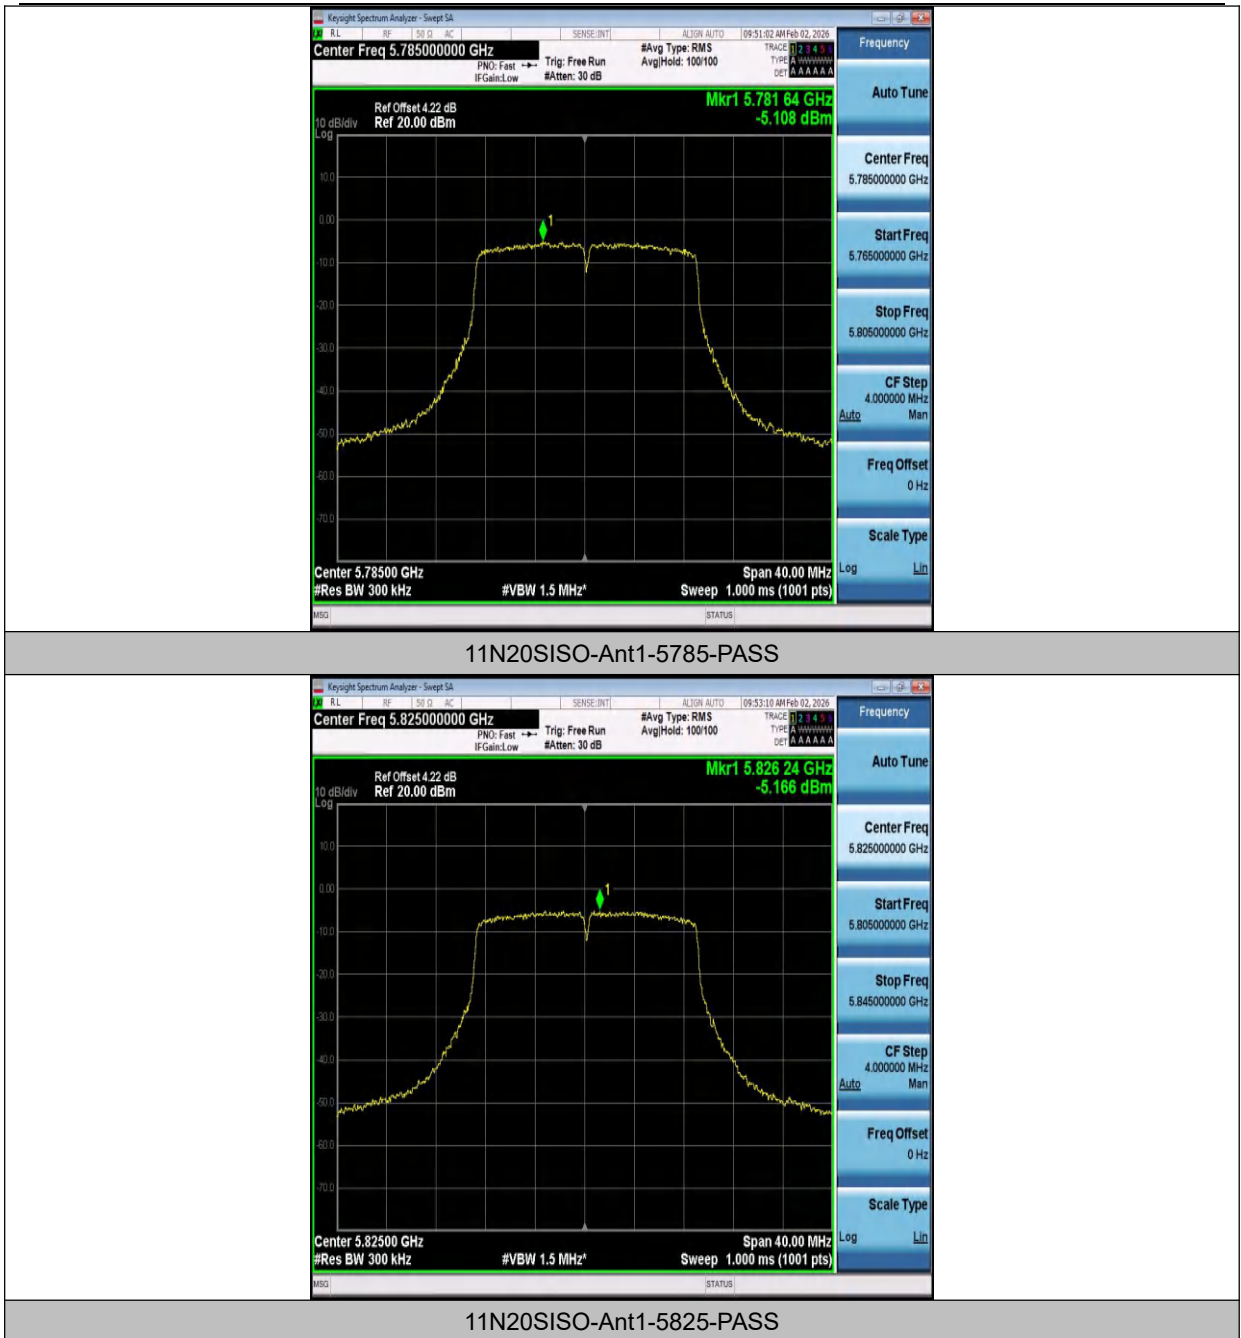

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

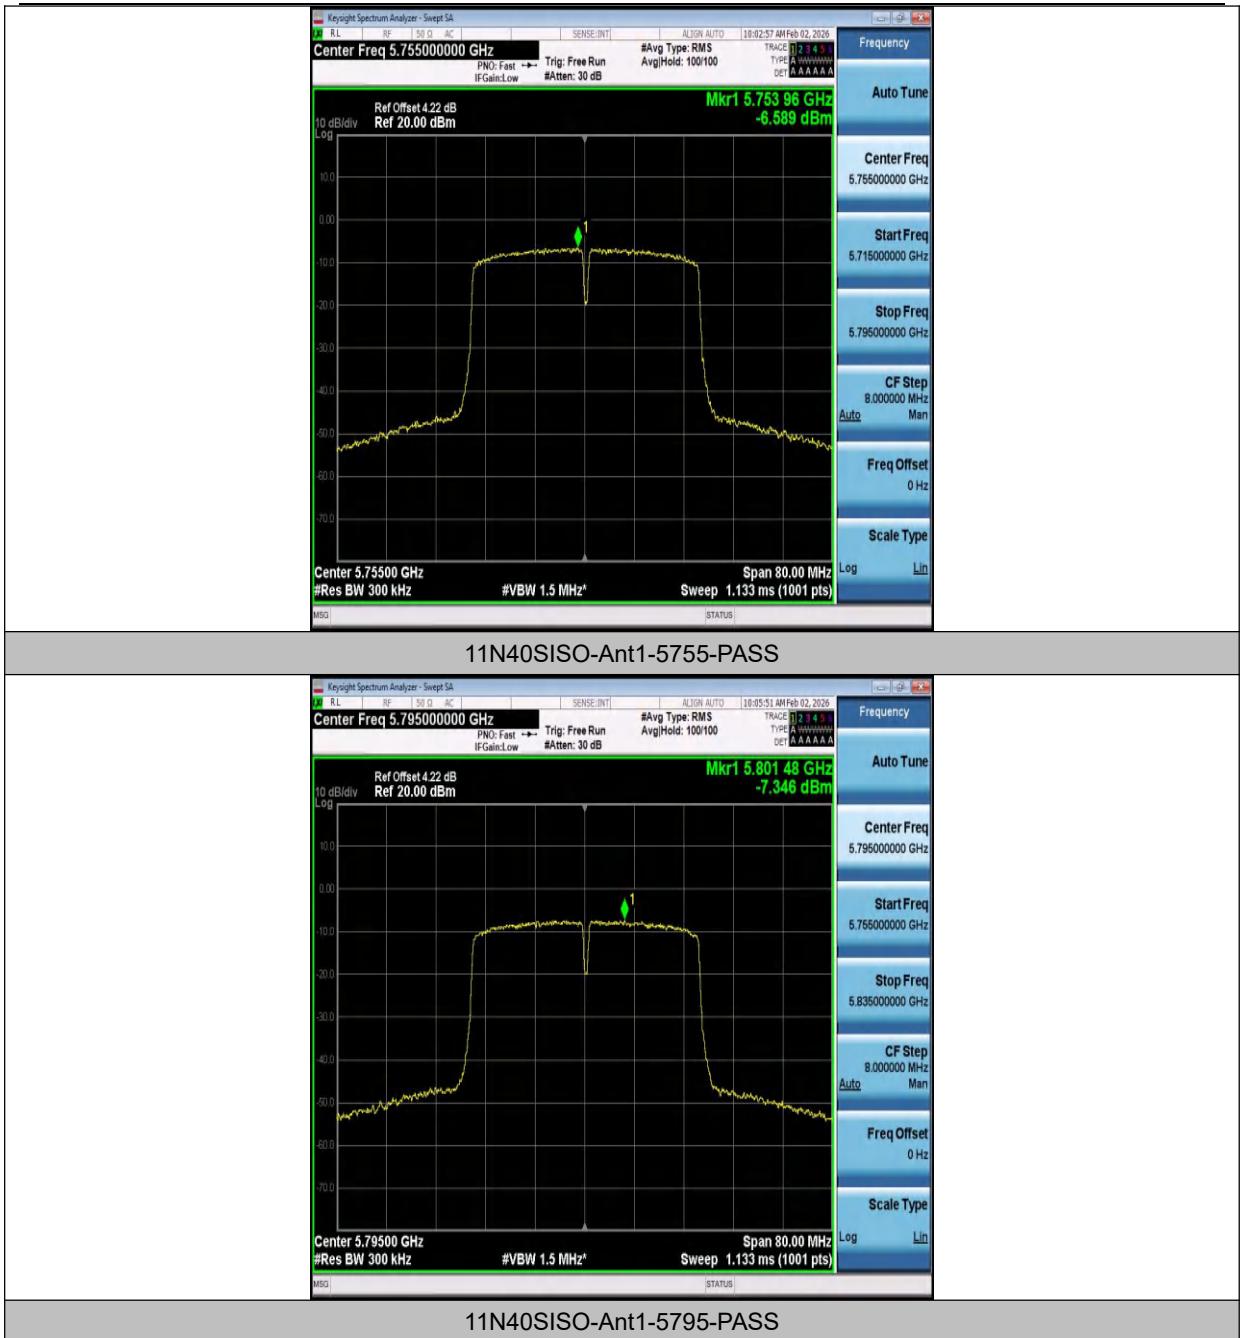

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-45.74	≤-27	PASS
11A	Ant1	High	5240	-46.31	≤-27	PASS
11N20SISO	Ant1	Low	5180	-45.3	≤-27	PASS
11N20SISO	Ant1	High	5240	-45.75	≤-27	PASS
11N40SISO	Ant1	Low	5190	-43.41	≤-27	PASS
11N40SISO	Ant1	High	5230	-45.96	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-41.89	≤17.91	PASS
11A	Ant1	Low	5745	5700~5720	-44.34	≤10.38	PASS
11A	Ant1	Low	5745	5650~5700	-46.61	≤-26.45	PASS
11A	Ant1	Low	5745	5645~5650	-46.75	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-44.43	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-44.01	≤10.10	PASS
11A	Ant1	High	5825	5875~5925	-45.68	≤-26.11	PASS
11A	Ant1	High	5825	5925~5935	-45.6	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-39.79	≤16.87	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-44.2	≤10.25	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-46.91	≤-26.96	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-46.09	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-43.74	≤16.03	PASS
11N20SISO	Ant1	High	5825	5855~5875	-44.06	≤11.00	PASS
11N20SISO	Ant1	High	5825	5875~5925	-45.41	≤-26.51	PASS
11N20SISO	Ant1	High	5825	5925~5935	-45.86	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-38.31	≤16.04	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-38.52	≤14.44	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-46.78	≤-26.80	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-46.74	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-46.96	≤15.66	PASS
11N40SISO	Ant1	High	5795	5855~5875	-45.21	≤10.53	PASS
11N40SISO	Ant1	High	5795	5875~5925	-46.75	≤-26.46	PASS
11N40SISO	Ant1	High	5795	5925~5935	-45.89	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

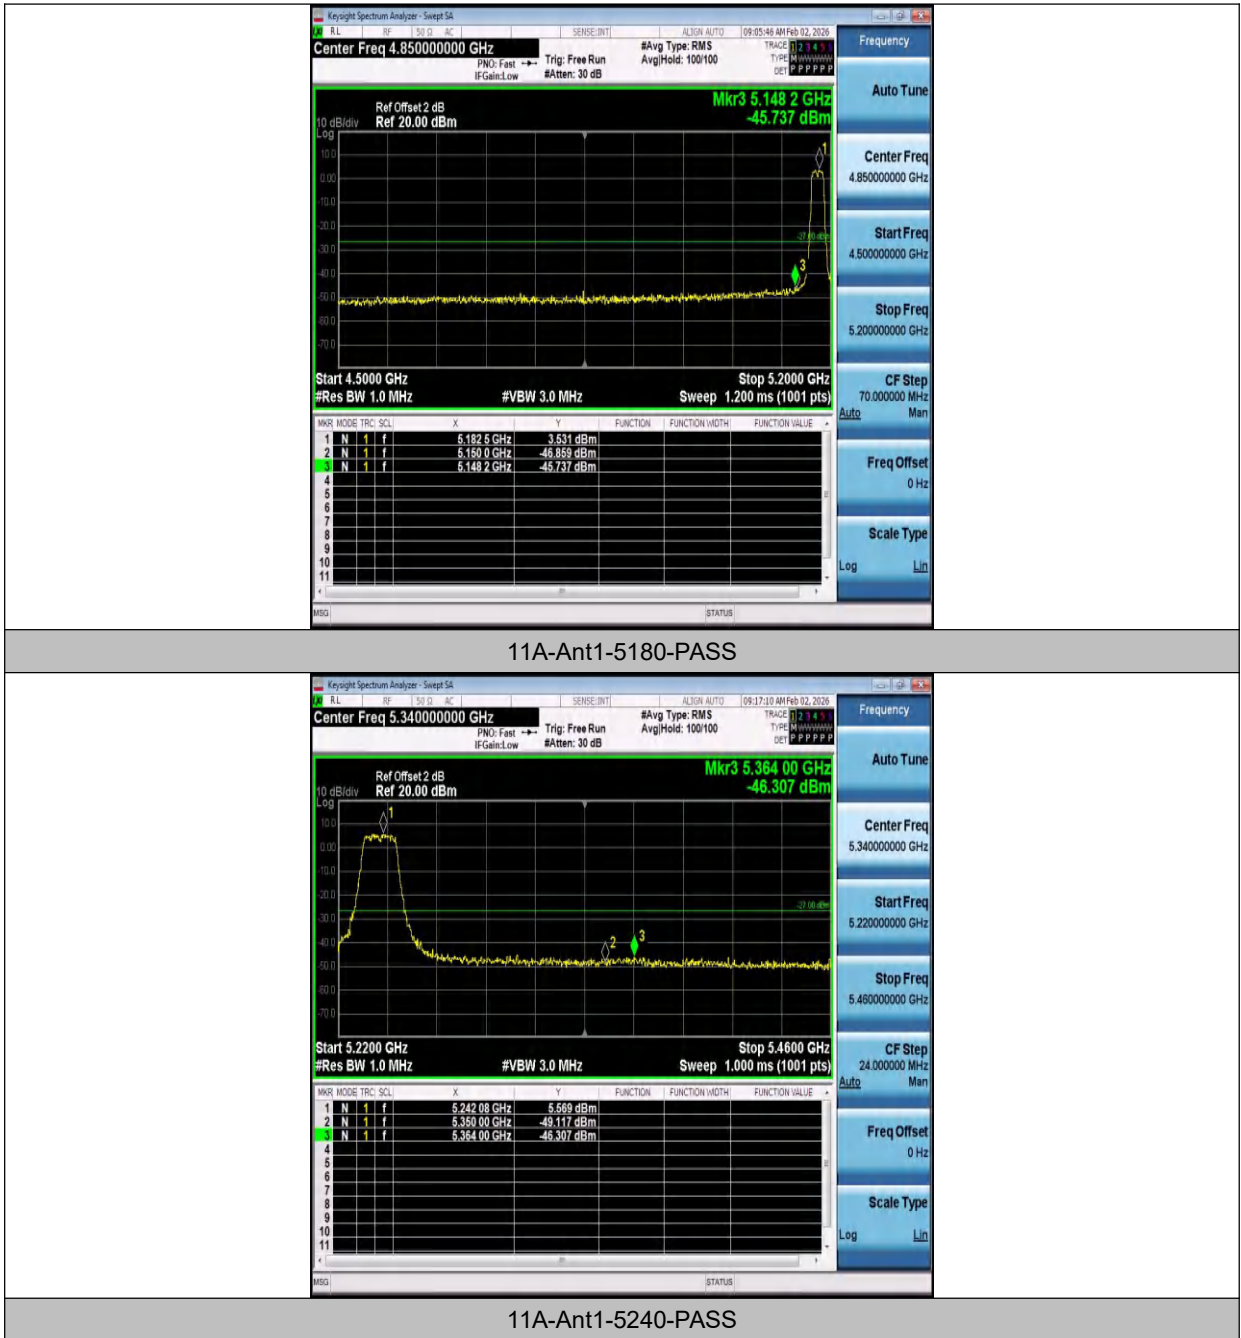


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

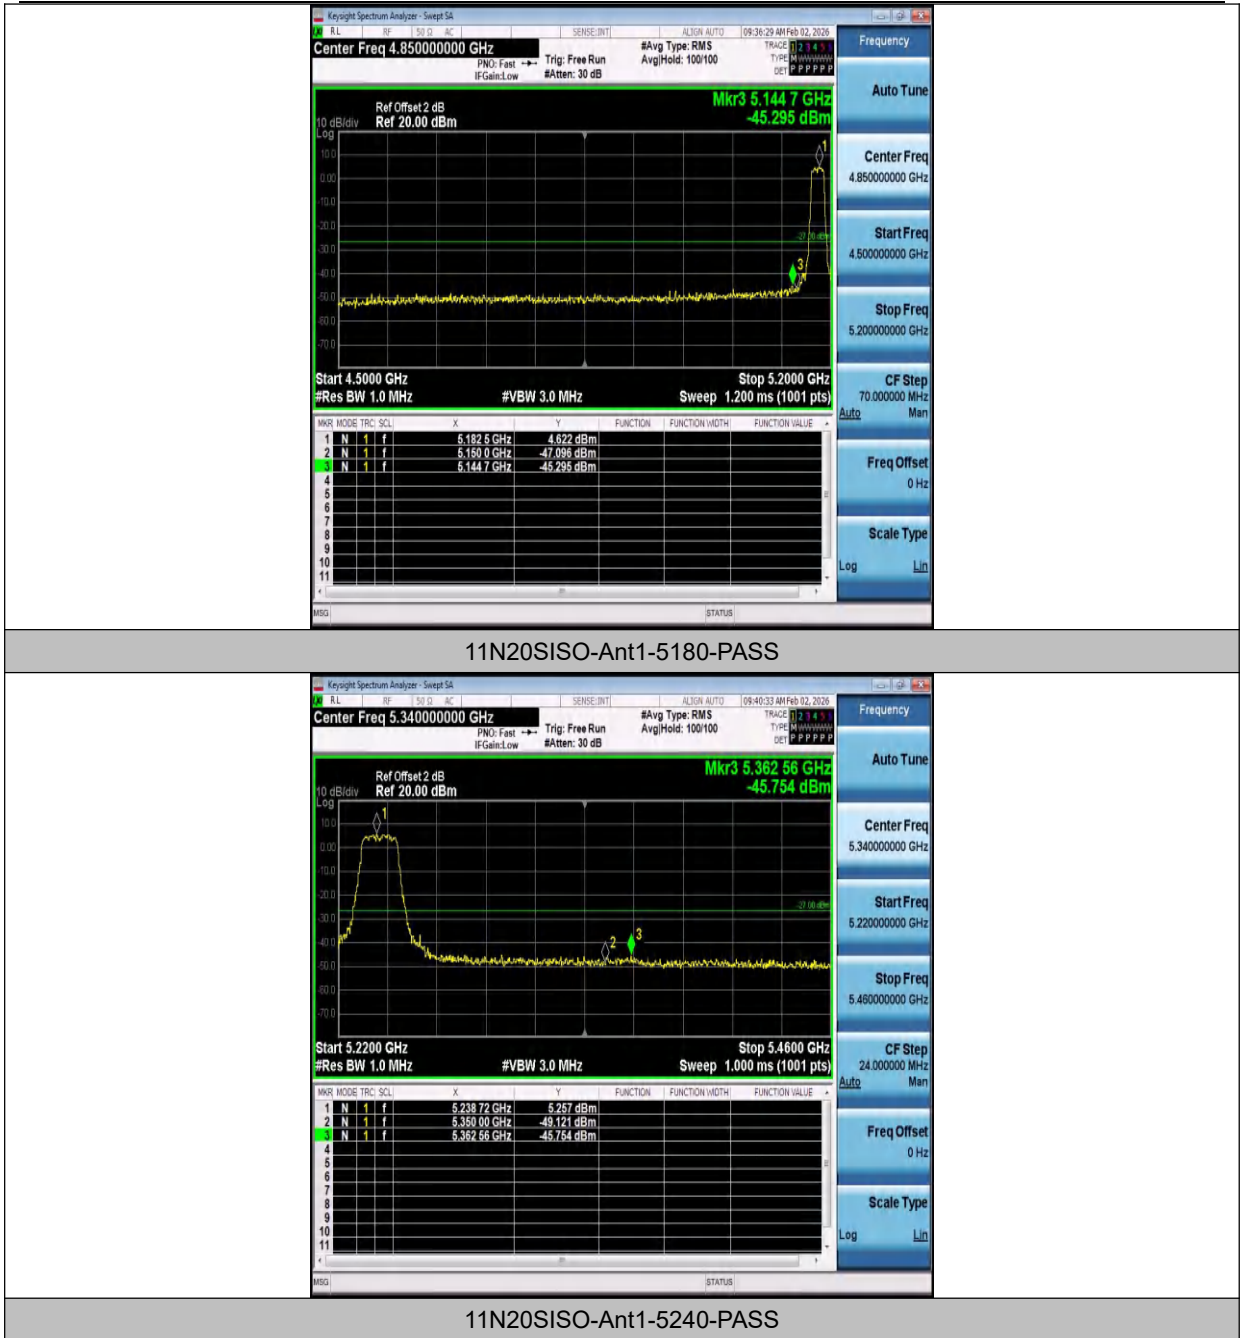

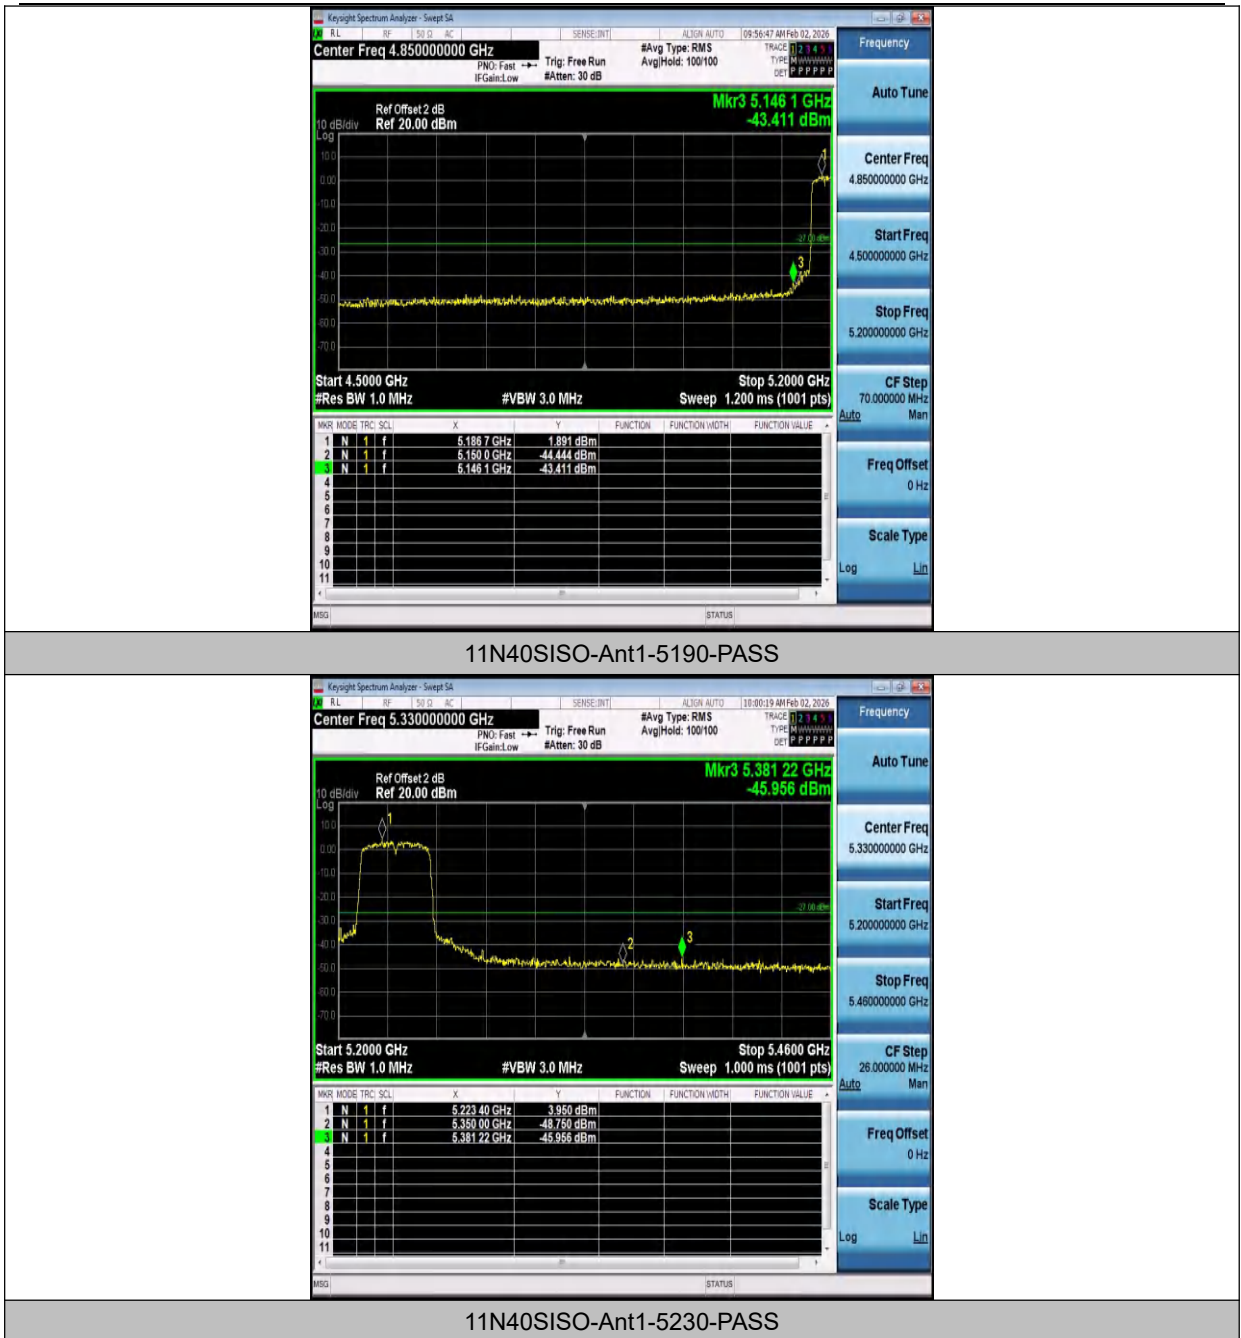

Test Graphs B4



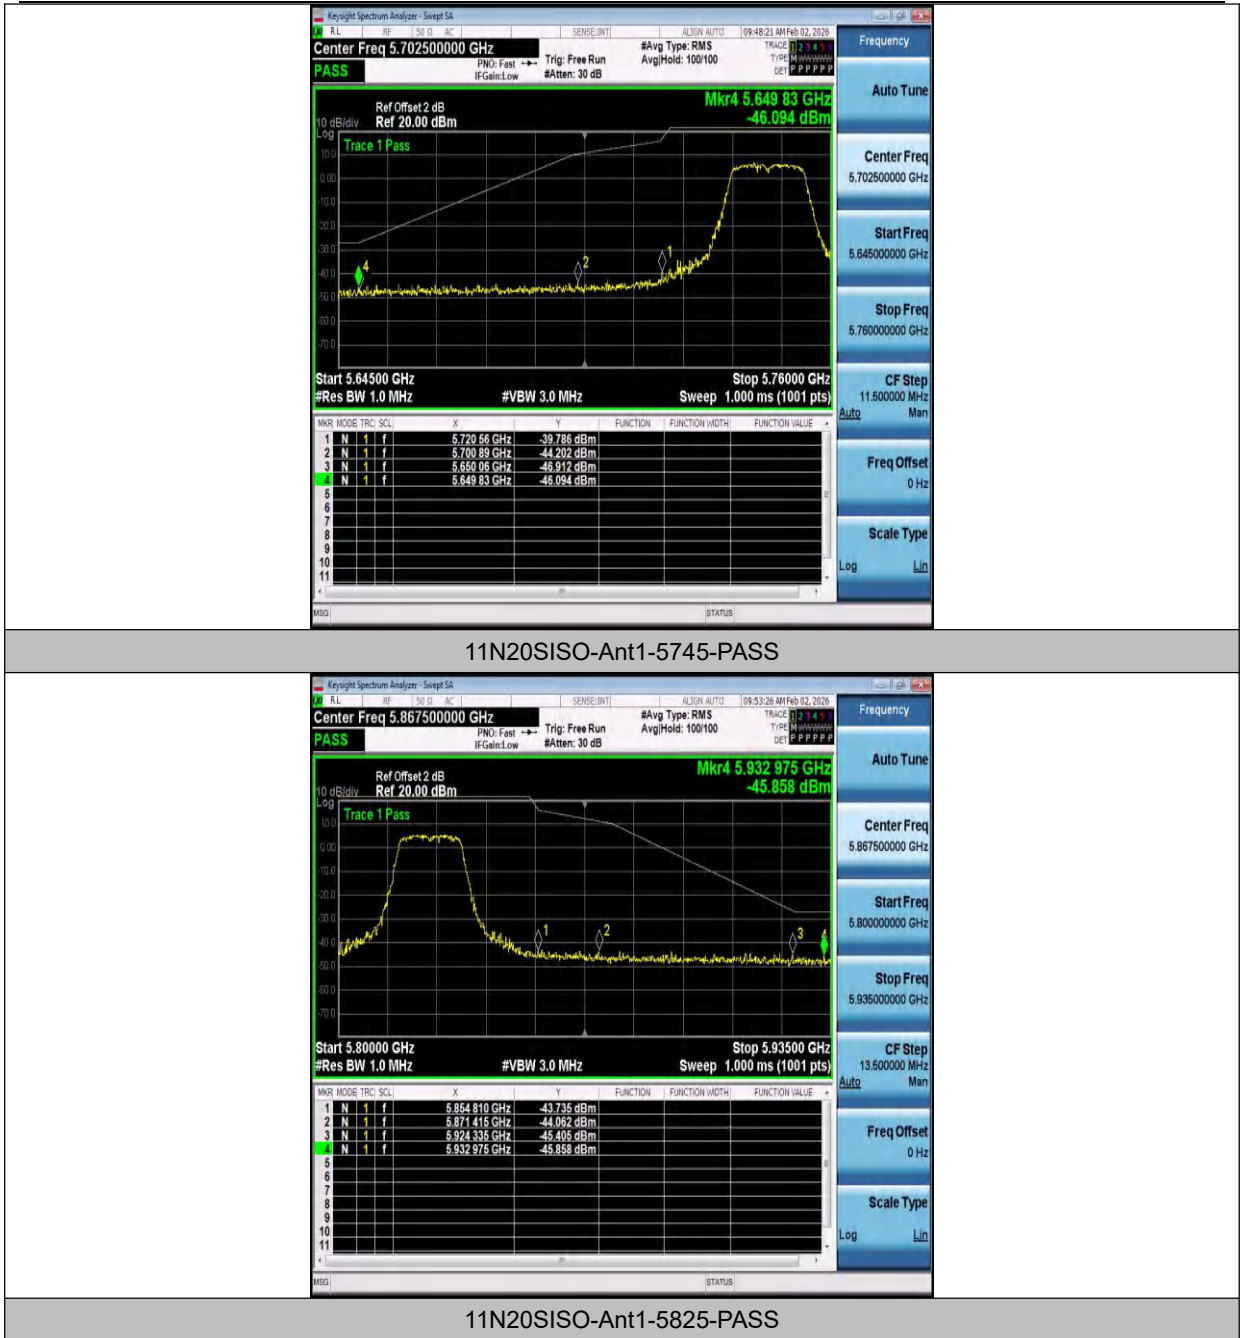



---END---