


Test_Mode	\	Test_Frequency	6489.6Mhz
Tset_Engineer	\	Test_Date	2026/6/18


Test Graph

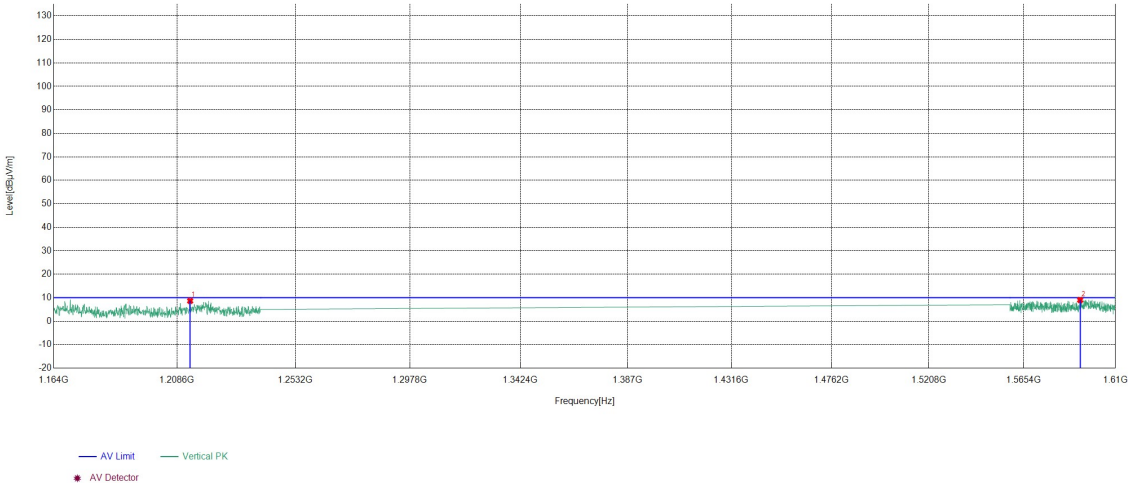

Suspected List									
NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1213.5255	-22.31	30.98	8.67	10.00	1.33	PASS	Vertical	PK
2	1592.7447	-21.03	30.03	9.00	10.00	1.00	PASS	Vertical	PK

Test_Mode	\	Test_Frequency	6489.6Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

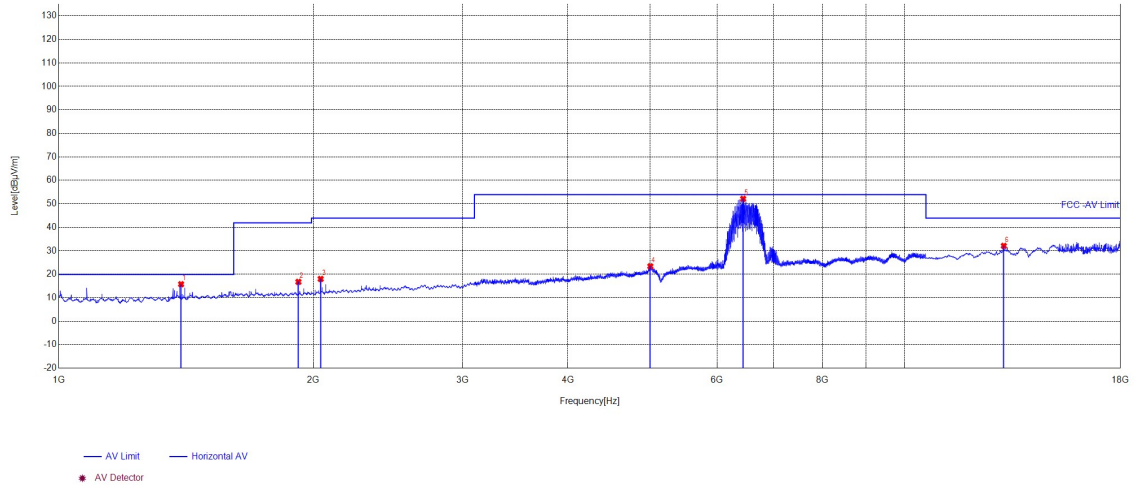


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1395.0651	-21.72	37.47	15.75	19.90	4.15	PASS	Horizontal	AV
2	1920.01	-19.72	36.47	16.75	41.90	25.15	PASS	Horizontal	AV
3	2040	-19.38	37.38	18.00	43.90	25.90	PASS	Horizontal	AV
4	5005.1905	-8.27	31.64	23.37	53.90	30.53	PASS	Horizontal	AV
5	6444.5845	-4.46	56.59	52.13	53.90	1.77	PASS	Horizontal	AV
6	13103.7037	6.38	25.70	32.08	43.90	11.82	PASS	Horizontal	AV

Test_Mode	\	Test_Frequency	6489.6Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

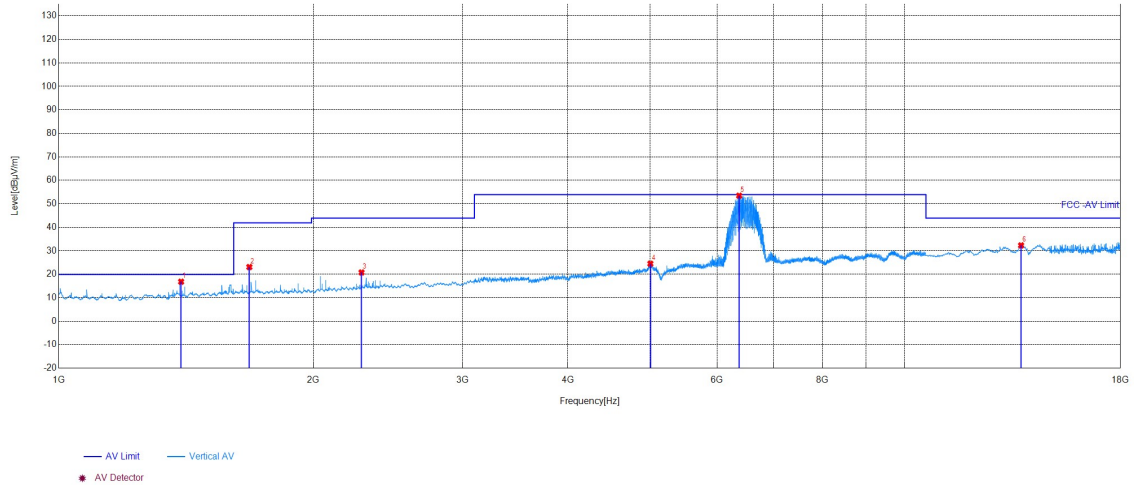


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1395.0651	-21.72	38.54	16.82	19.90	3.08	PASS	Vertical	AV
2	1679.99	-20.57	43.63	23.06	41.90	18.84	PASS	Vertical	AV
3	2280	-18.28	39.03	20.75	43.90	23.15	PASS	Vertical	AV
4	5005.9406	-8.27	32.75	24.48	53.90	29.42	PASS	Vertical	AV
5	6374.8275	-4.67	58.12	53.45	53.90	0.45	PASS	Vertical	AV
6	13733.3333	7.23	25.05	32.28	43.90	11.62	PASS	Vertical	AV

Test_Mode	\	Test_Frequency	6489.6Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

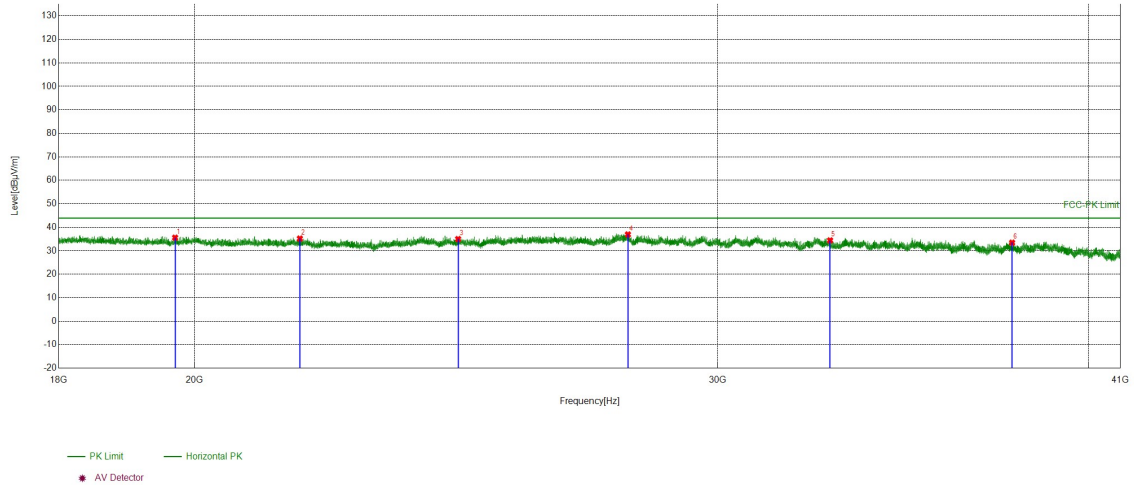


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	19698.3879	-25.41	60.97	35.56	43.90	8.34	PASS	Horizontal	AV
2	21699.468	-25.64	60.82	35.18	43.90	8.72	PASS	Horizontal	AV
3	24532.2613	-21.81	56.77	34.96	43.90	8.94	PASS	Horizontal	AV
4	27985.1594	-21.19	58.11	36.92	43.90	6.98	PASS	Horizontal	AV
5	32734.3894	-18.80	53.21	34.41	43.90	9.49	PASS	Horizontal	AV
6	37696.1478	-15.06	48.50	33.44	43.90	10.46	PASS	Horizontal	AV

Test_Mode	\	Test_Frequency	6489.6Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

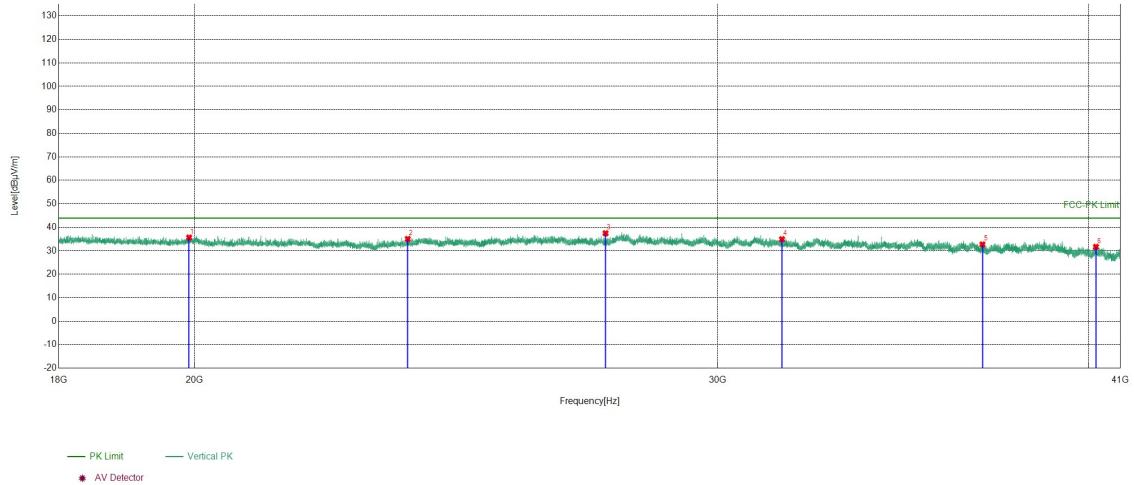


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	19913.6765	-24.89	60.50	35.61	43.90	8.29	PASS	Vertical	AV
2	23593.8238	-23.07	58.08	35.01	43.90	8.89	PASS	Vertical	AV
3	27503.9802	-21.59	59.03	37.44	43.90	6.46	PASS	Vertical	AV
4	31536.5015	-19.65	54.54	34.89	43.90	9.01	PASS	Vertical	AV
5	36839.5936	-16.95	49.63	32.68	43.90	11.22	PASS	Vertical	AV
6	40229.0092	-12.96	44.61	31.65	43.90	12.25	PASS	Vertical	AV

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18


Test Graph

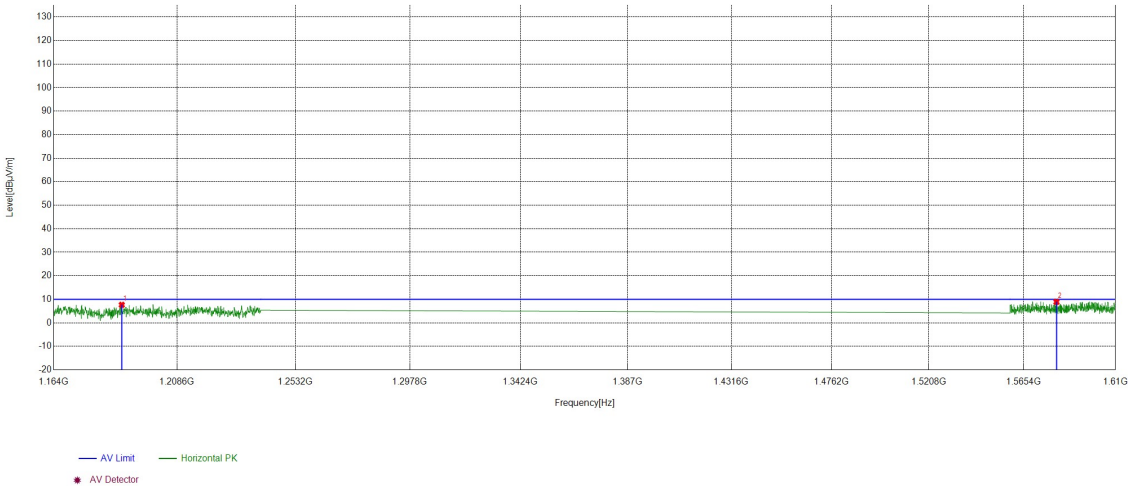

Suspected List									
NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1188.4204	-22.41	30.07	7.66	10.00	2.34	PASS	Horizontal	PK
2	1581.2583	-21.10	29.99	8.89	10.00	1.11	PASS	Horizontal	PK

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18


Test Graph

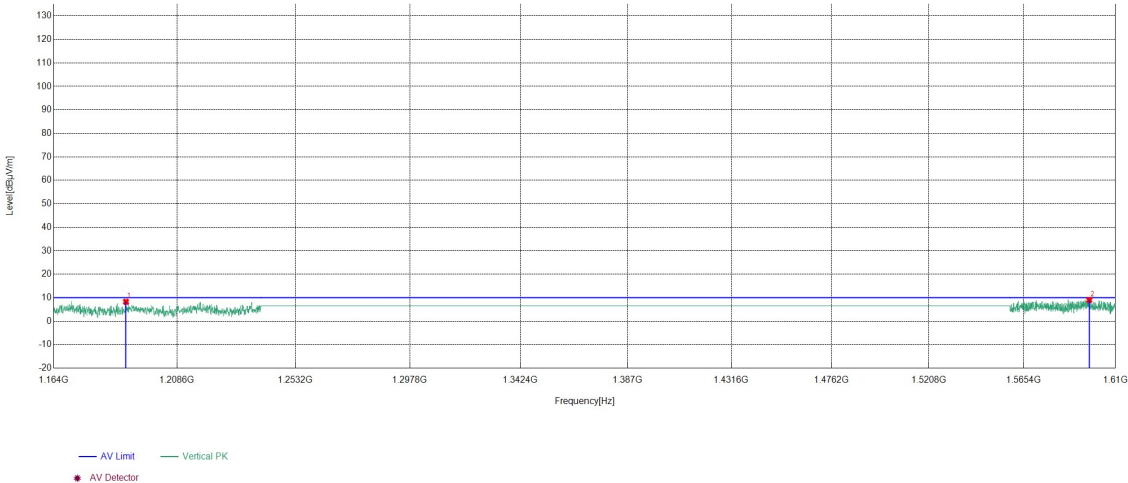

Suspected List									
NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1189.9419	-22.40	30.67	8.27	10.00	1.73	PASS	Vertical	PK
2	1597.1862	-21.00	29.99	8.99	10.00	1.01	PASS	Vertical	PK

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18


Test Graph

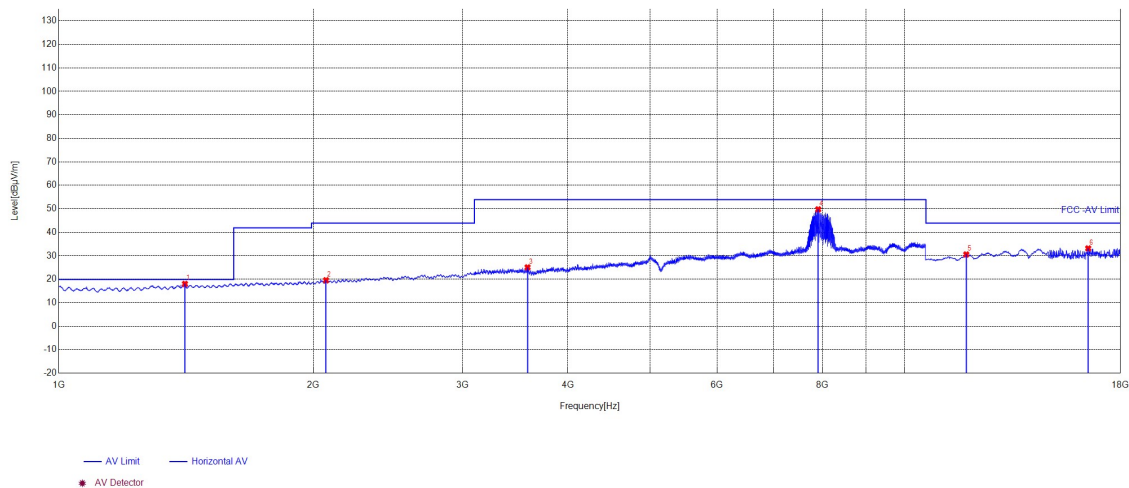

Suspected List									
NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1409.7197	-21.68	39.69	18.01	19.90	1.89	PASS	Horizontal	AV
2	2070	-19.22	38.77	19.55	43.90	24.35	PASS	Horizontal	AV
3	3583.0483	-13.76	38.81	25.05	53.90	28.85	PASS	Horizontal	AV
4	7905.7306	-1.60	51.36	49.76	53.90	4.14	PASS	Horizontal	AV
5	11829.6296	2.75	27.79	30.54	43.90	13.36	PASS	Horizontal	AV
6	16488.8889	10.62	22.50	33.12	43.90	10.78	PASS	Horizontal	AV

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

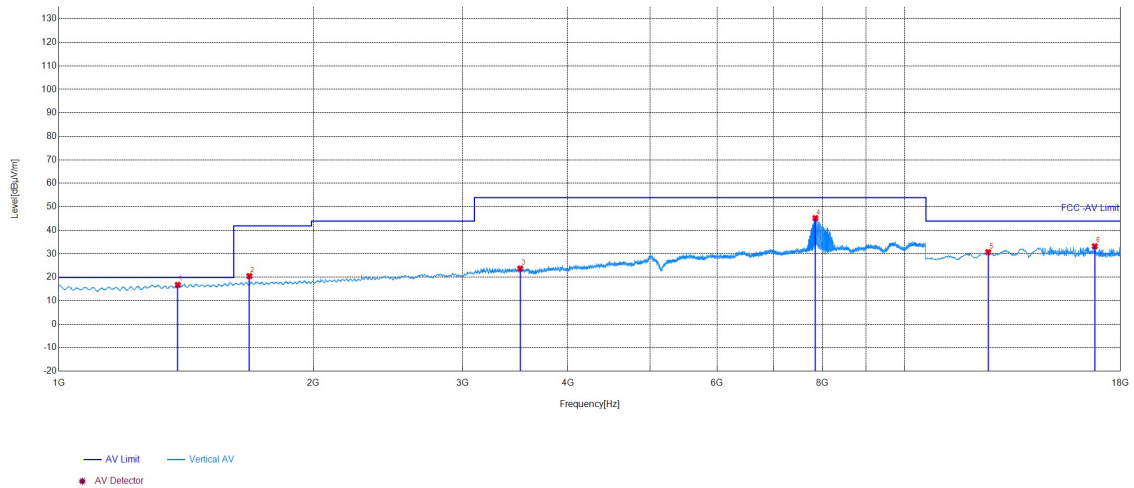


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	1382.2422	-21.80	38.53	16.73	19.90	3.17	PASS	Vertical	AV
2	1679.99	-20.57	41.04	20.47	41.90	21.43	PASS	Vertical	AV
3	3512.5413	-14.24	37.97	23.73	53.90	30.17	PASS	Vertical	AV
4	7844.9745	-2.04	47.20	45.16	53.90	8.74	PASS	Vertical	AV
5	12555.5556	5.00	25.70	30.70	43.90	13.20	PASS	Vertical	AV
6	16785.1852	11.30	21.90	33.20	43.90	10.70	PASS	Vertical	AV

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

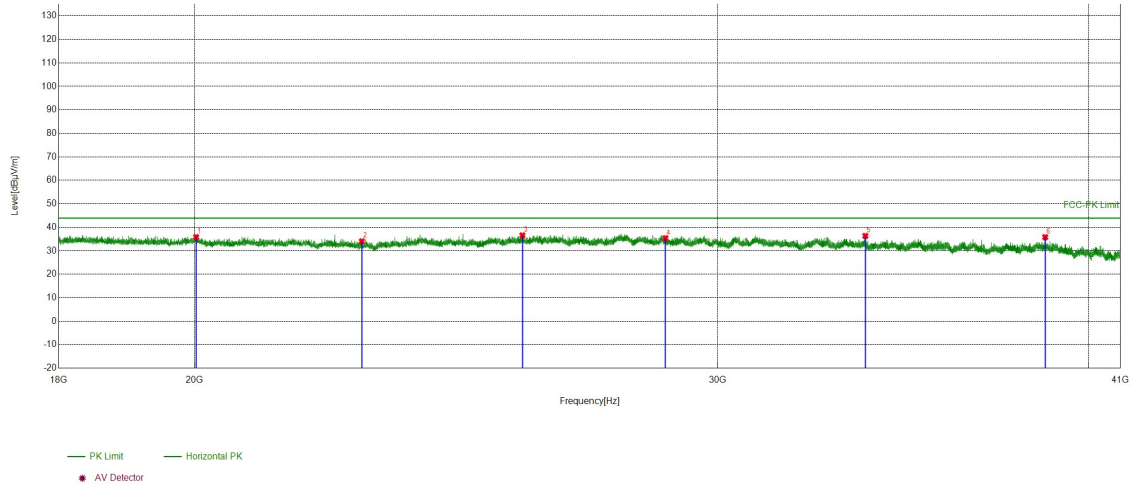


Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	20022.2409	-24.72	60.53	35.81	43.90	8.09	PASS	Horizontal	AV
2	22767.6307	-25.04	59.05	34.01	43.90	9.89	PASS	Horizontal	AV
3	25786.2715	-20.81	57.35	36.54	43.90	7.36	PASS	Horizontal	AV
4	28811.3525	-21.47	56.83	35.36	43.90	8.54	PASS	Horizontal	AV
5	33642.4657	-17.42	53.74	36.32	43.90	7.58	PASS	Horizontal	AV
6	38677.8271	-13.70	49.49	35.79	43.90	8.11	PASS	Horizontal	AV

Test_Mode	UWB 8M	Test_Frequency	7987.2Mhz
Tset_Engineer	\	Test_Date	2026/6/18

Test Graph

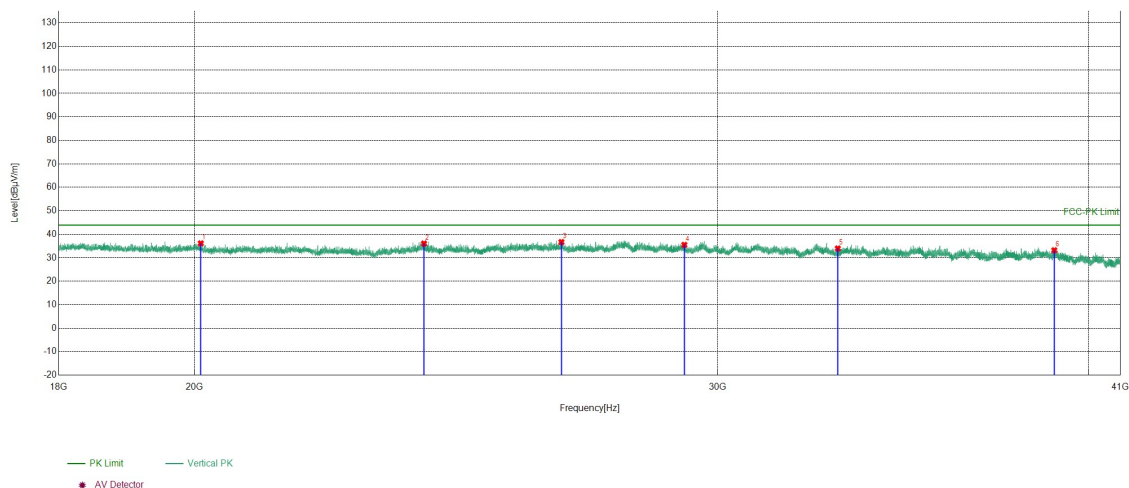

Suspected List

NO	Freq. [MHz]	Factor [dB]	Reading [dBμV]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Result	Polarity	Remark
1	20094.9238	-25.04	61.16	36.12	43.90	7.78	PASS	Vertical	AV
2	23892.8357	-22.15	58.19	36.04	43.90	7.86	PASS	Vertical	AV
3	26578.4231	-21.11	57.77	36.66	43.90	7.24	PASS	Vertical	AV
4	29236.4095	-21.45	56.92	35.47	43.90	8.43	PASS	Vertical	AV
5	32931.2773	-18.75	52.69	33.94	43.90	9.96	PASS	Vertical	AV
6	38951.078	-12.95	46.12	33.17	43.90	10.73	PASS	Vertical	AV

Remark:

1) Scan from 9kHz to 40GHz, disturbance above 18GHz and below 30MHz was very low, and the above harmonics were the highest point could be found when testing, so only the above harmonics had been displayed. The amplitude of spurious emissions from the radiator which are attenuated more than 20dB below the limit need not be reported.

5 PHOTOGRAPHS

Refer to Appendix Photographs of Report No. EED32S811126.

Statement

1. This report is considered invalid without approved signature, special seal and the seal on the perforation;
2. The Company Name shown on Report and Address, the sample(s) and sample information was/were provided by the applicant who should be responsible for the authenticity which CTI hasn't verified;
3. The result(s) shown in this report refer(s) only to the sample(s) tested;
4. Unless otherwise stated, the decision rule for conformity reporting is based on Binary Statement for Simple Acceptance Rule stated in ILAC-G8:09/2019/CNAS-GL015:2022;
5. Without written approval of CTI, this report can't be reproduced except in full;

*** End of Report ***