



## Appendix G

### RF Test Data for 5.8GWIFI (Conducted Measurement)

Product Name: IP PHONE

Test Model: CIP291PLUS

#### Environmental Conditions

|                    |           |
|--------------------|-----------|
| Temperature:       | 23.2°C    |
| Relative Humidity: | 53.1%     |
| ATM Pressure:      | 100.0 kPa |
| Test Engineer:     | Jerry Chu |
| Supervised by:     | Can Kun   |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.1 Min emission bandwidth

### Test Result B4

| TestMode   | Antenna | Frequency[MHz] | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|---------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5745           | 15.440        | 5737.400 | 5752.840 | 0.5        | PASS    |
| 11A        | Ant1    | 5785           | 16.320        | 5776.760 | 5793.080 | 0.5        | PASS    |
| 11A        | Ant1    | 5825           | 16.280        | 5816.800 | 5833.080 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5745           | 17.280        | 5736.400 | 5753.680 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5785           | 17.280        | 5776.160 | 5793.440 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5825           | 16.240        | 5816.560 | 5832.800 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5755           | 34.960        | 5737.480 | 5772.440 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5795           | 35.040        | 5777.400 | 5812.440 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5745           | 17.640        | 5736.120 | 5753.760 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5785           | 17.040        | 5776.160 | 5793.200 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5825           | 17.520        | 5816.200 | 5833.720 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5755           | 33.760        | 5738.680 | 5772.440 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5795           | 33.840        | 5777.400 | 5811.240 | 0.5        | PASS    |
| 11AC80SISO | Ant1    | 5775           | 75.040        | 5737.400 | 5812.440 | 0.5        | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## Test Graphs B4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

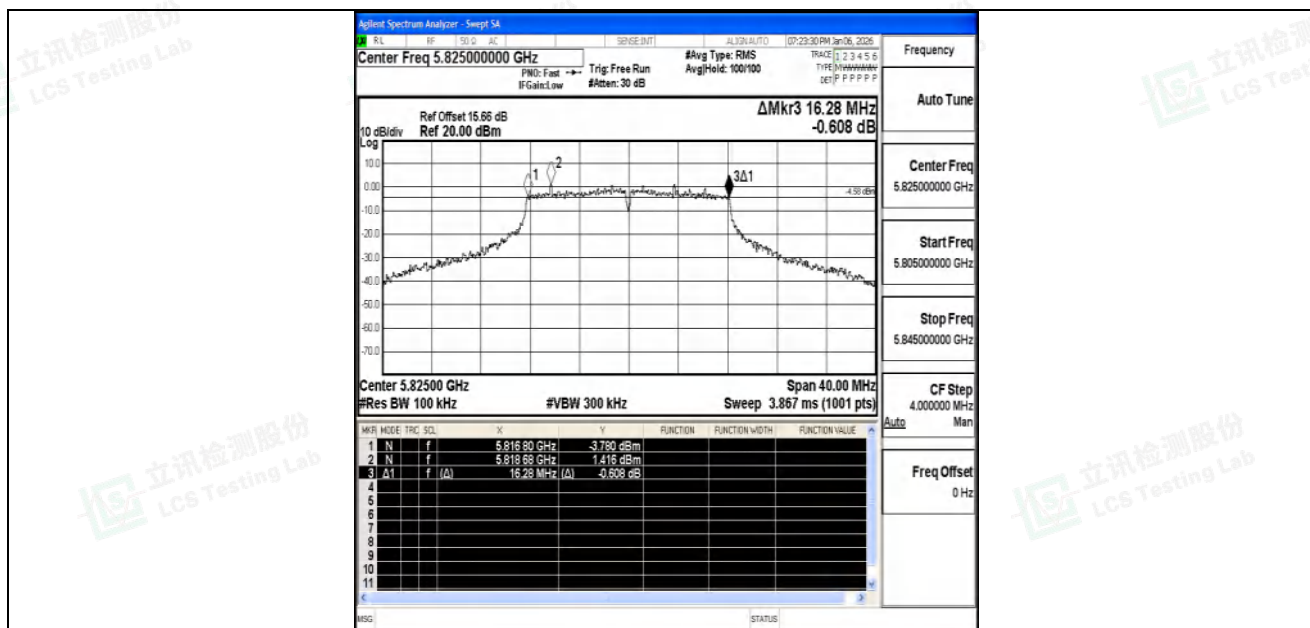

11A-Ant1-5825-PASS

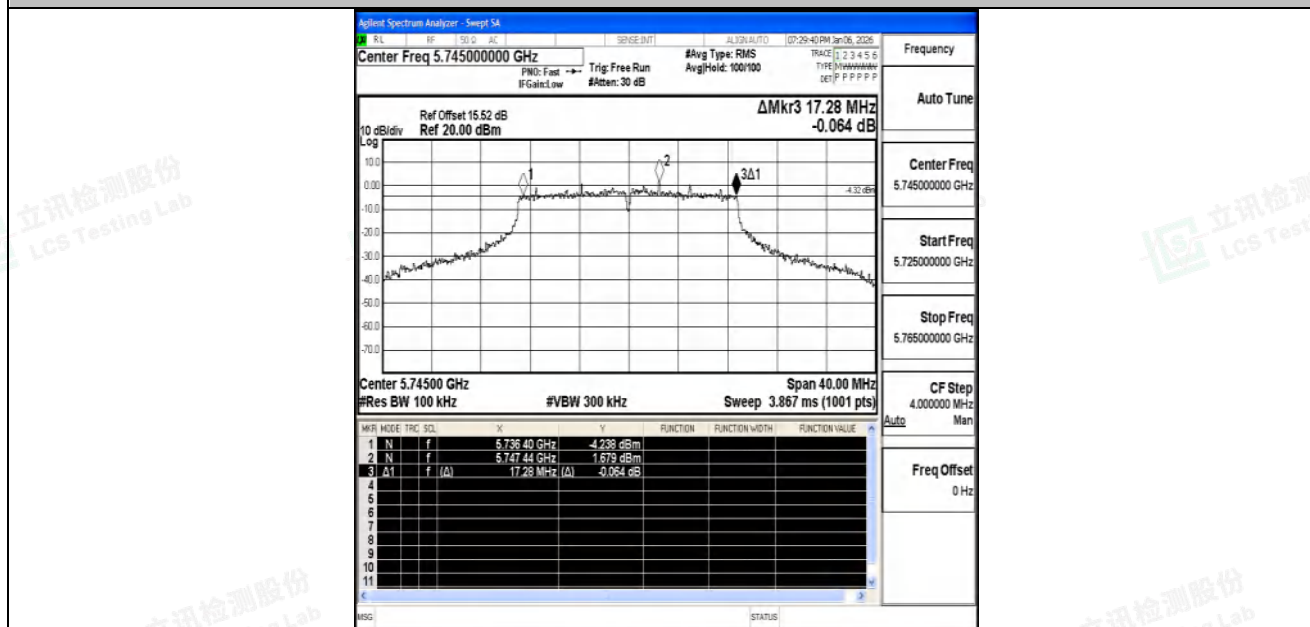

11N20SISO-Ant1-5745-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

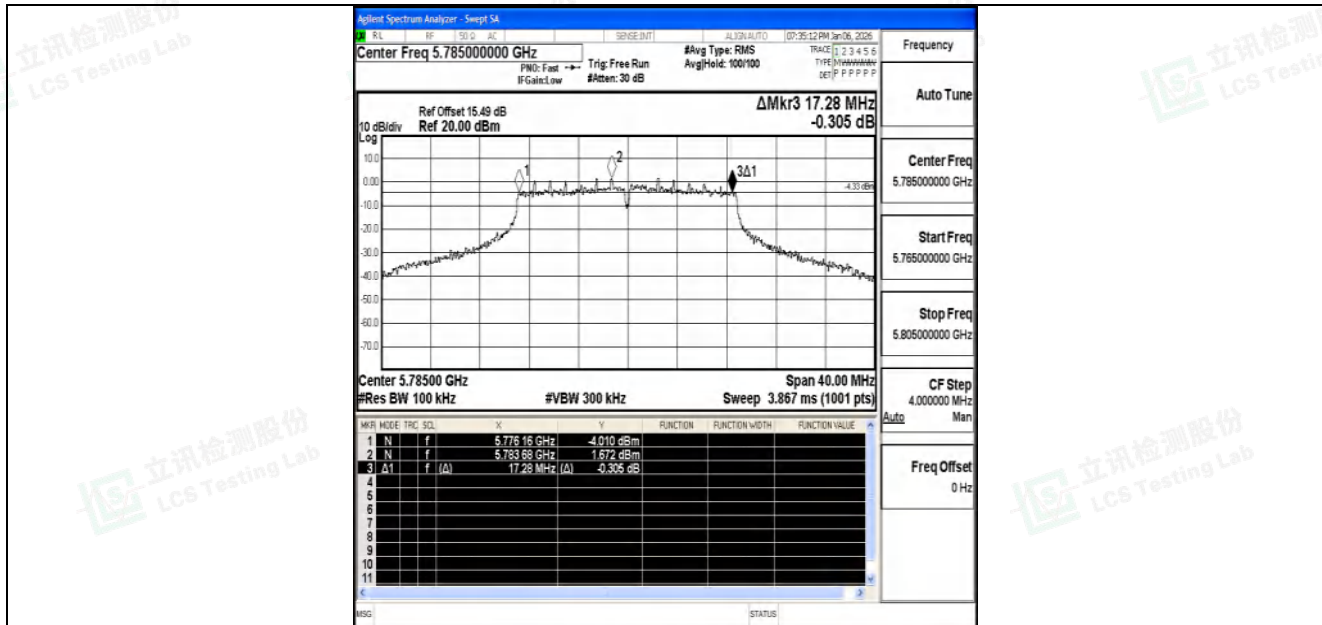

11N20SISO-Ant1-5785-PASS

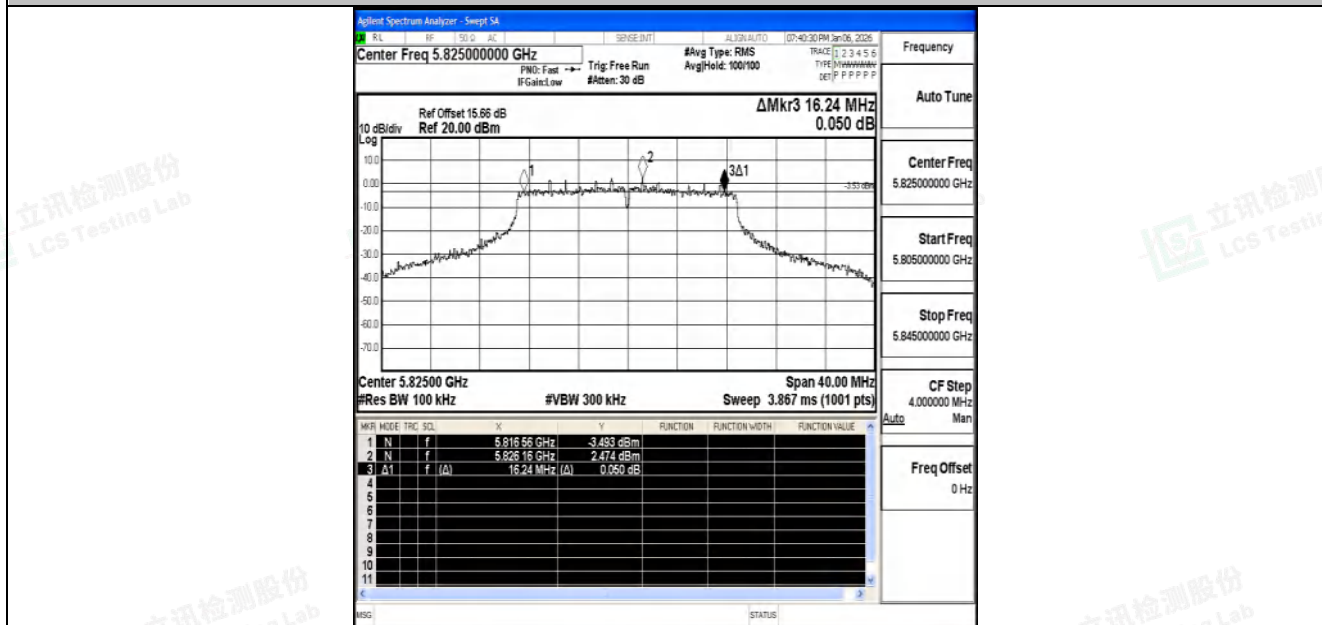

11N20SISO-Ant1-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

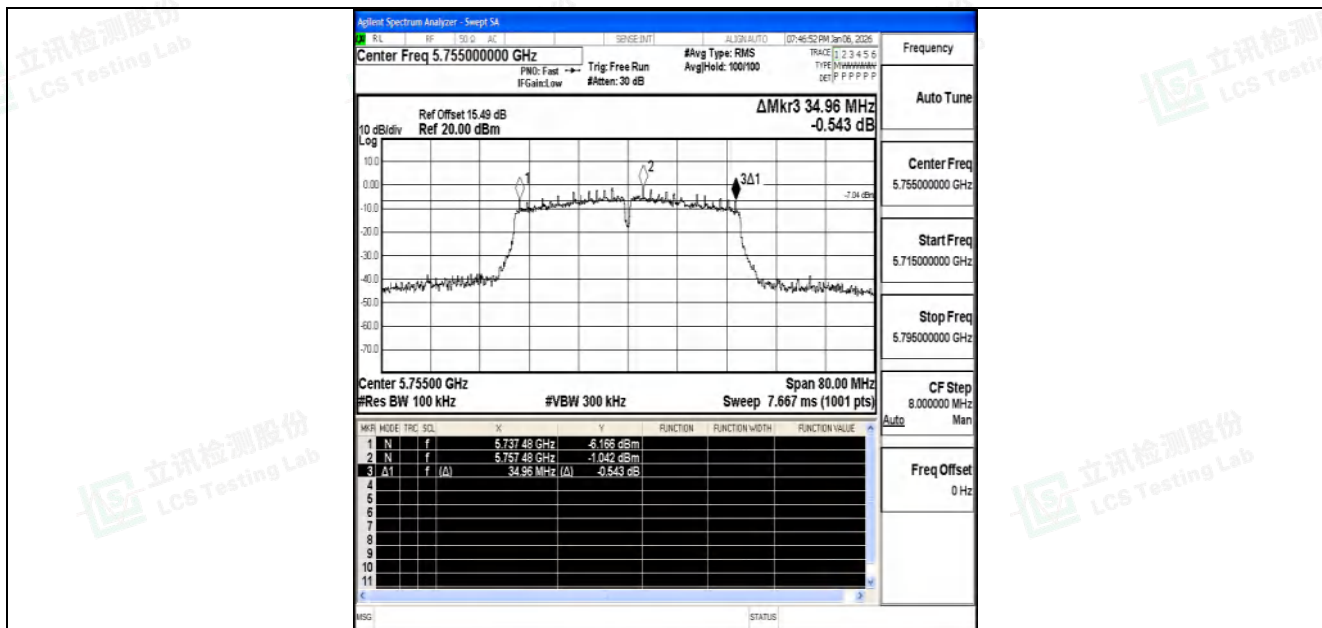

11N40SISO-Ant1-5755-PASS

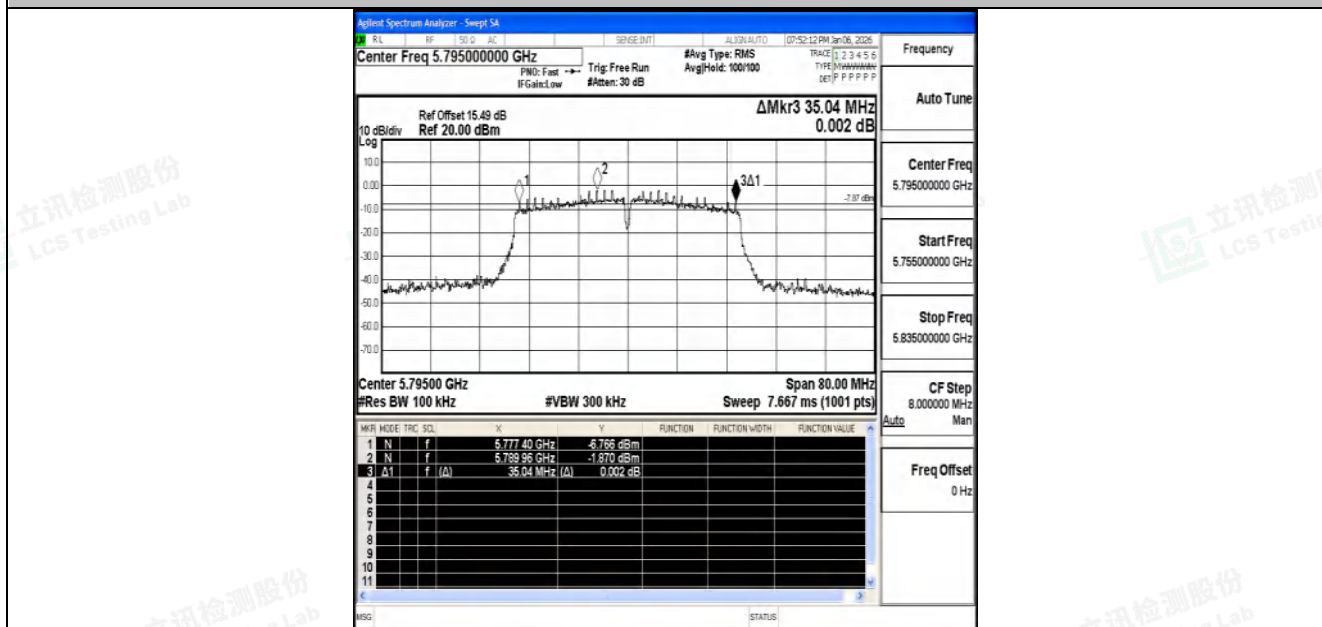

11N40SISO-Ant1-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

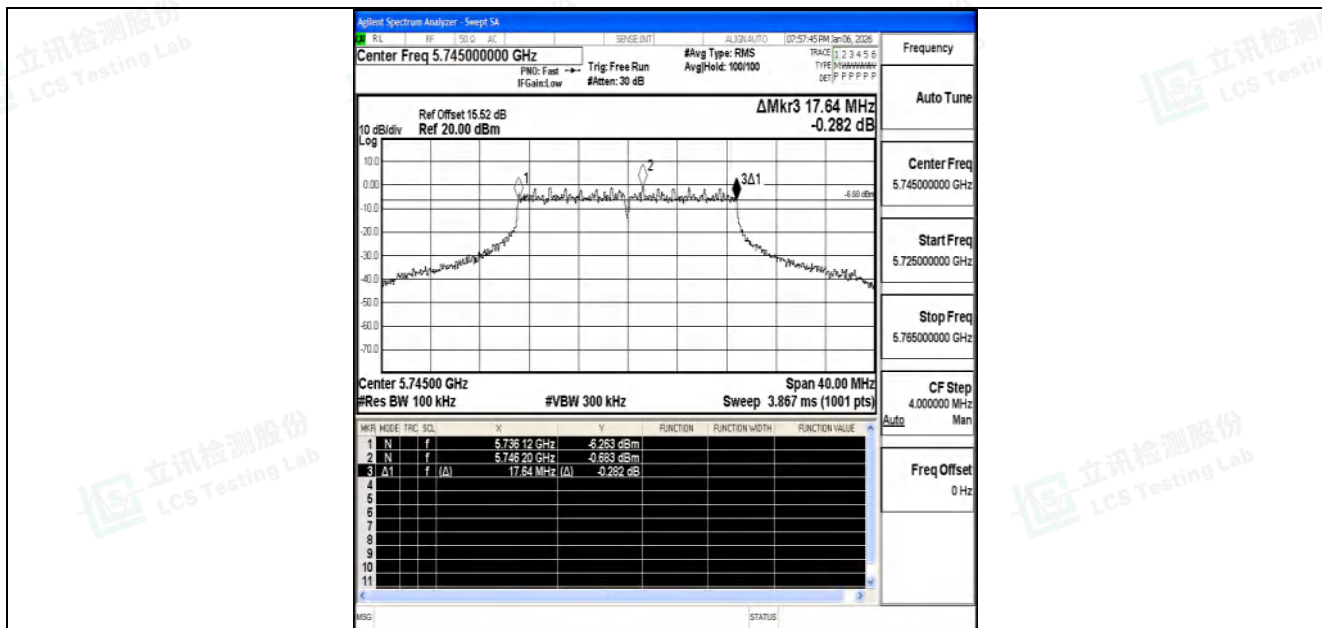

11AC20SISO-Ant1-5745-PASS

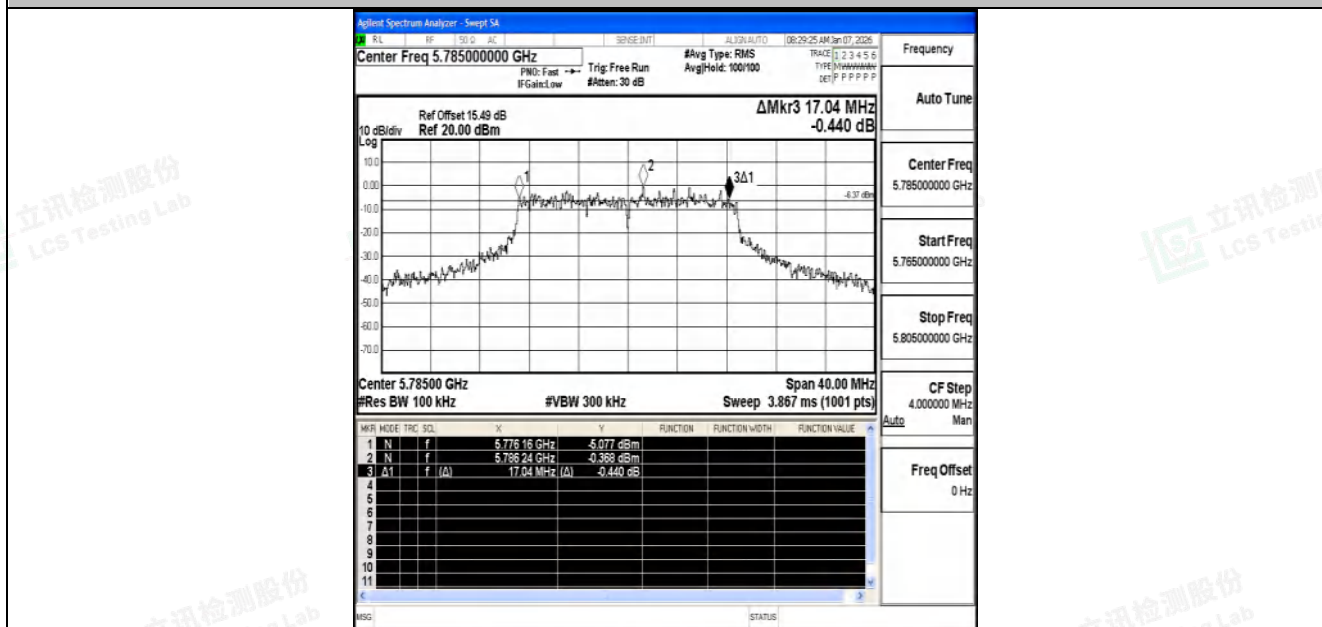

11AC20SISO-Ant1-5785-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

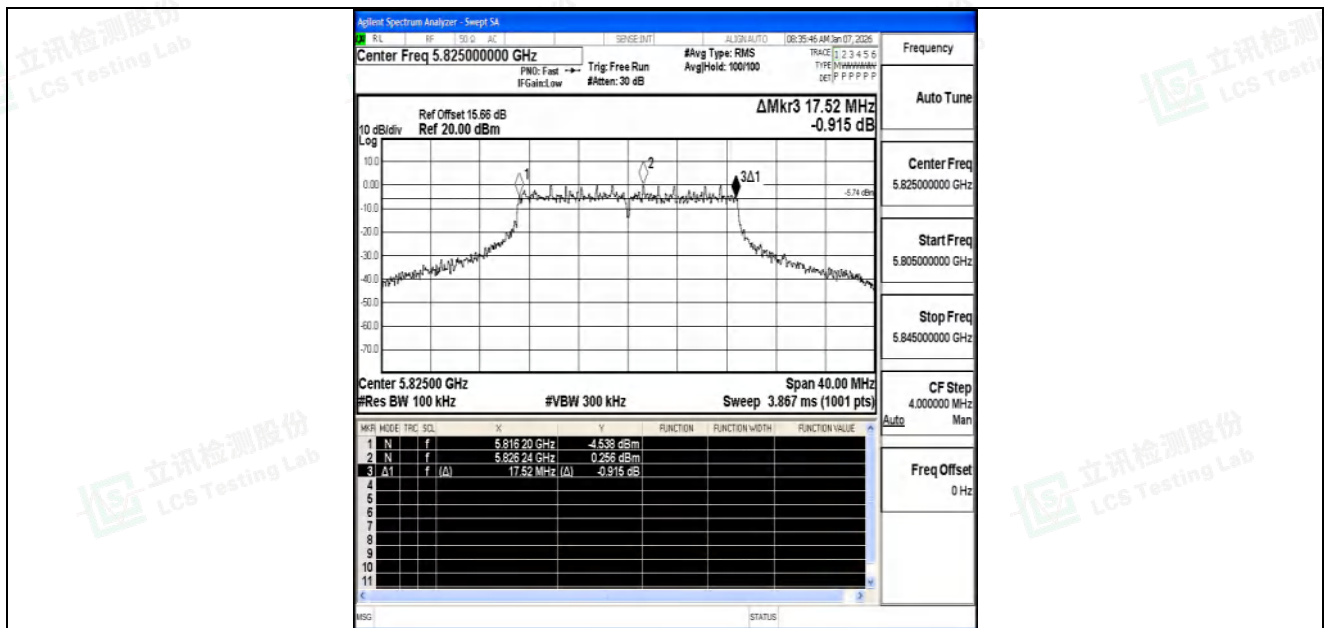

11AC20SISO-Ant1-5825-PASS

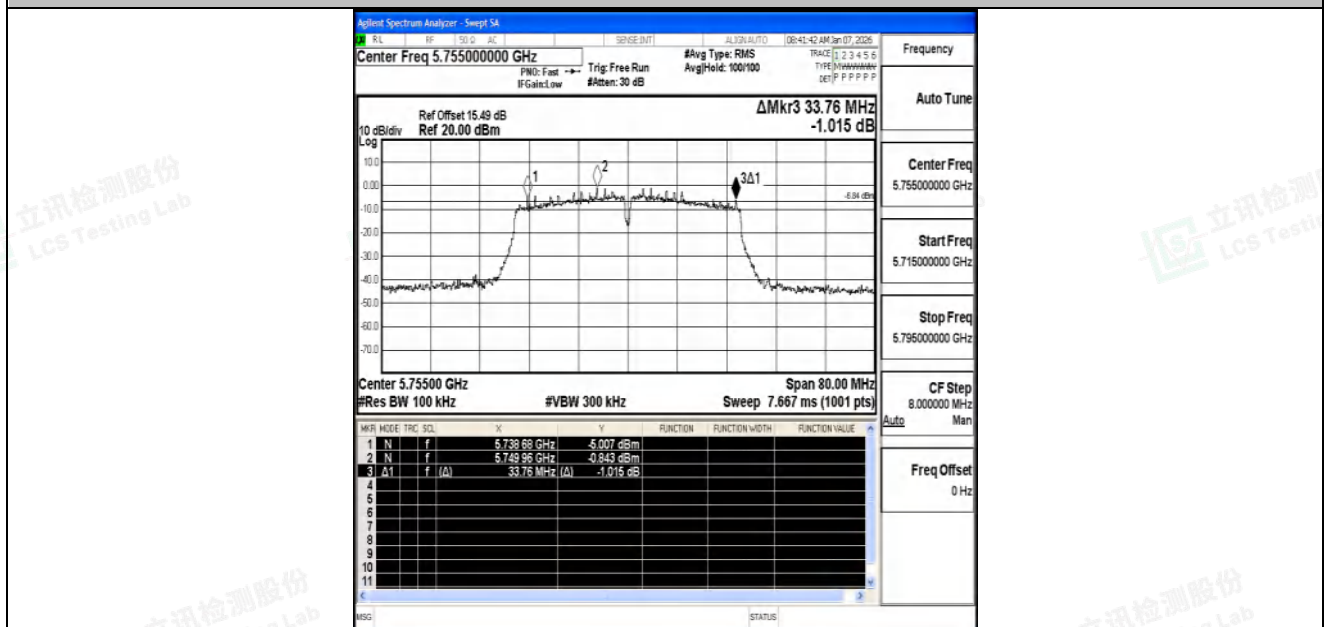

11AC40SISO-Ant1-5755-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

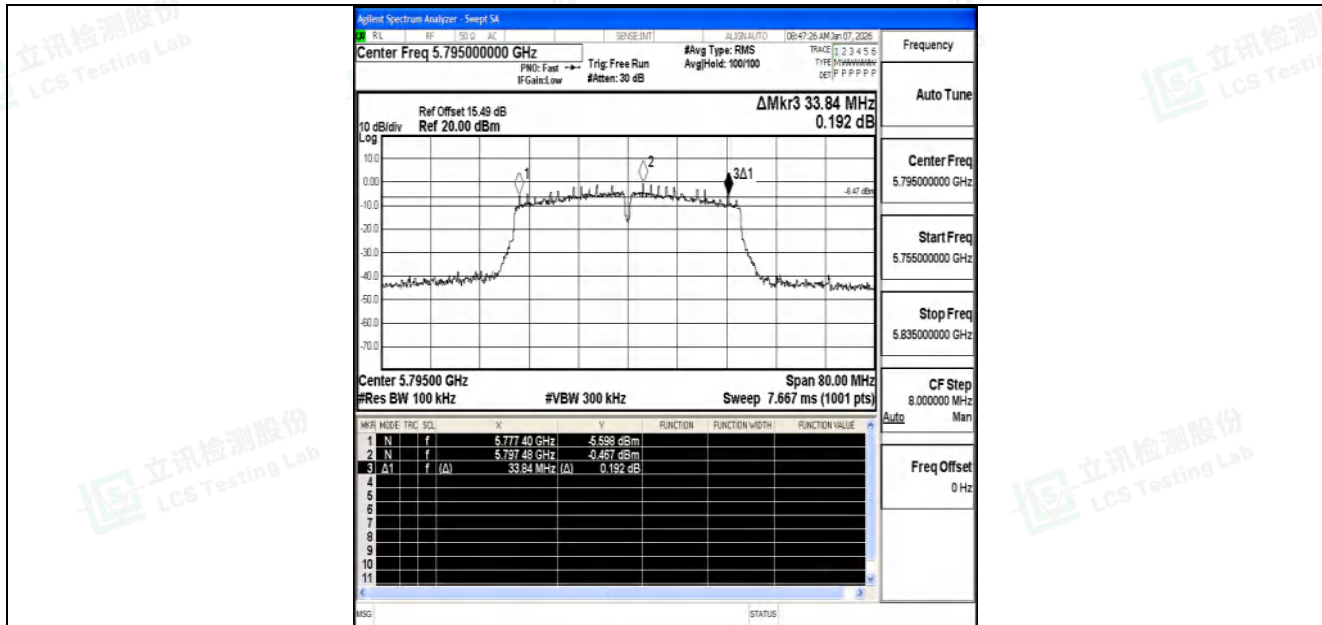

11AC40SISO-Ant1-5795-PASS

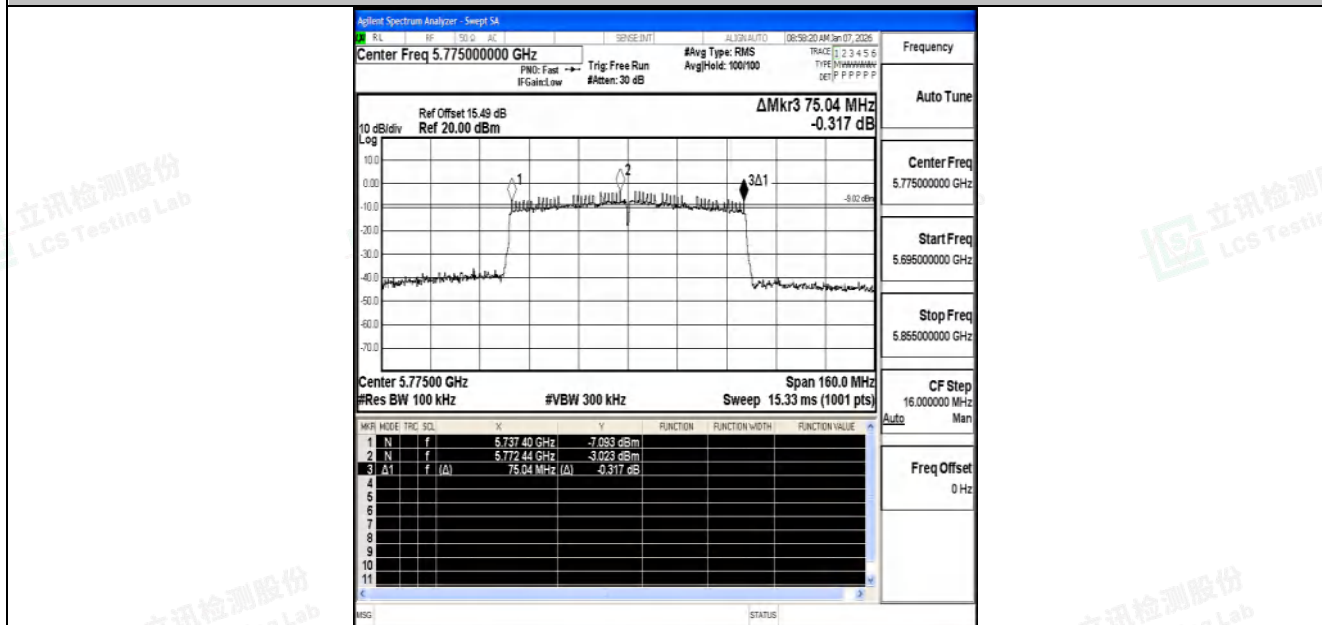

11AC80SISO-Ant1-5775-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**Test Result B4**

| TestMode   | Antenna | Frequency[MHz] | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|---------------|----------|----------|------------|---------|
| 11A        | Ant2    | 5745           | 16.360        | 5736.760 | 5753.120 | 0.5        | PASS    |
| 11A        | Ant2    | 5785           | 14.440        | 5778.080 | 5792.520 | 0.5        | PASS    |
| 11A        | Ant2    | 5825           | 16.320        | 5816.800 | 5833.120 | 0.5        | PASS    |
| 11N20SISO  | Ant2    | 5745           | 16.000        | 5736.840 | 5752.840 | 0.5        | PASS    |
| 11N20SISO  | Ant2    | 5785           | 17.560        | 5776.160 | 5793.720 | 0.5        | PASS    |
| 11N20SISO  | Ant2    | 5825           | 17.240        | 5816.160 | 5833.400 | 0.5        | PASS    |
| 11N40SISO  | Ant2    | 5755           | 35.040        | 5737.400 | 5772.440 | 0.5        | PASS    |
| 11N40SISO  | Ant2    | 5795           | 31.120        | 5777.480 | 5808.600 | 0.5        | PASS    |
| 11AC20SISO | Ant2    | 5745           | 17.640        | 5736.120 | 5753.760 | 0.5        | PASS    |
| 11AC20SISO | Ant2    | 5785           | 17.640        | 5776.120 | 5793.760 | 0.5        | PASS    |
| 11AC20SISO | Ant2    | 5825           | 17.720        | 5816.080 | 5833.800 | 0.5        | PASS    |
| 11AC40SISO | Ant2    | 5755           | 32.480        | 5739.960 | 5772.440 | 0.5        | PASS    |
| 11AC40SISO | Ant2    | 5795           | 32.640        | 5779.880 | 5812.520 | 0.5        | PASS    |
| 11AC80SISO | Ant2    | 5775           | 73.920        | 5737.400 | 5811.320 | 0.5        | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## Test Graphs B4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

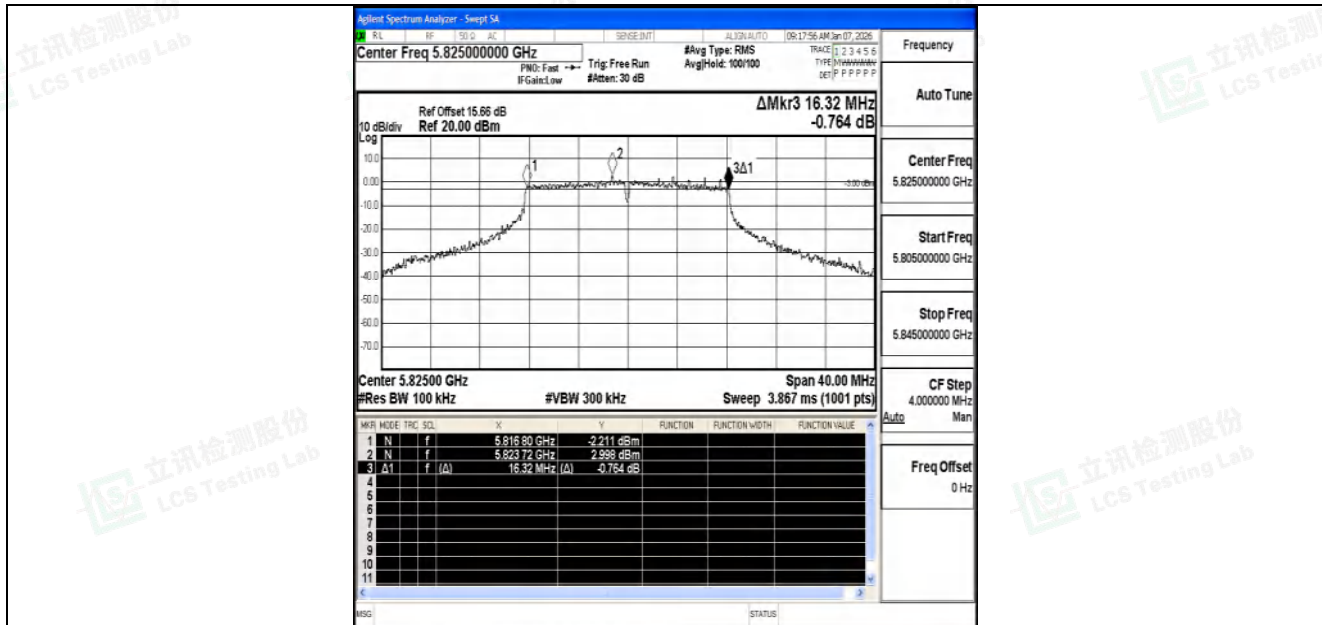

11A-Ant2-5825-PASS

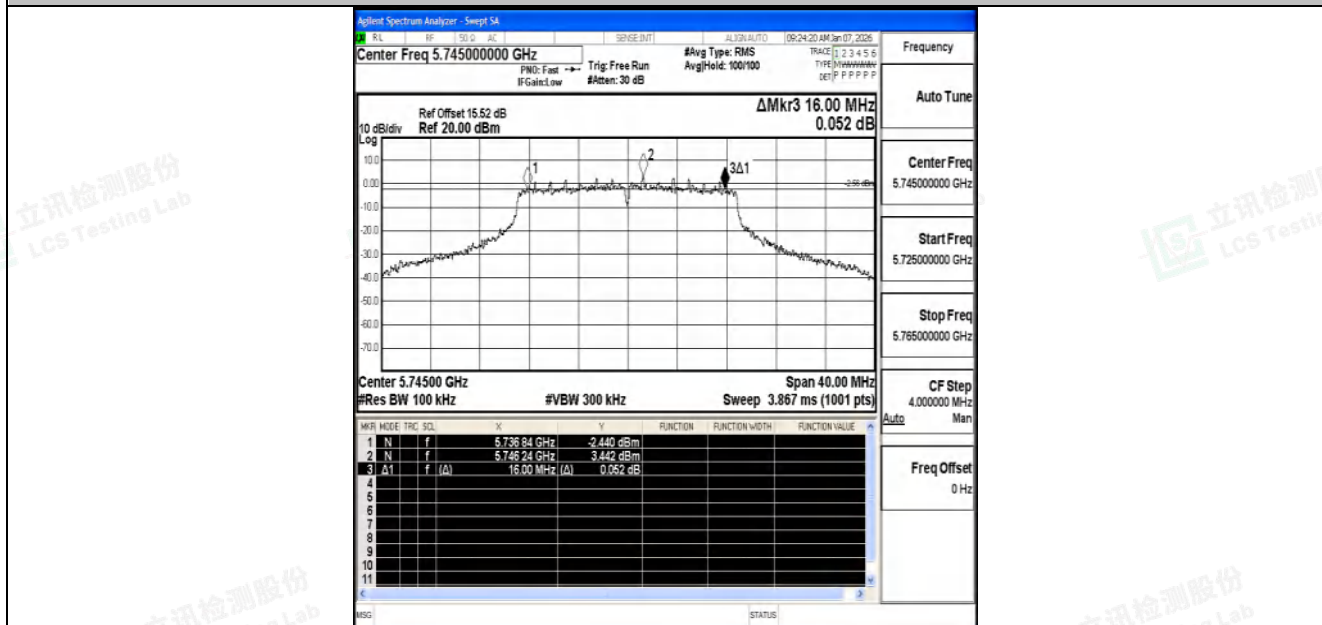

11N20SISO-Ant2-5745-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

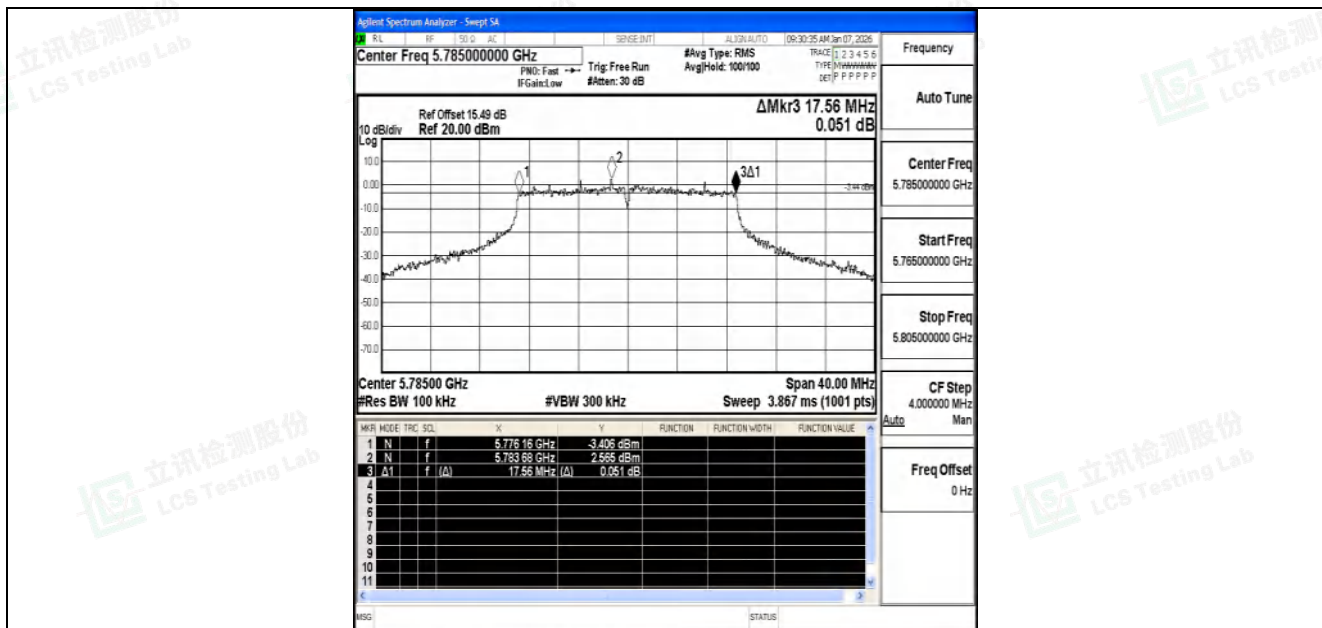

11N20SISO-Ant2-5785-PASS

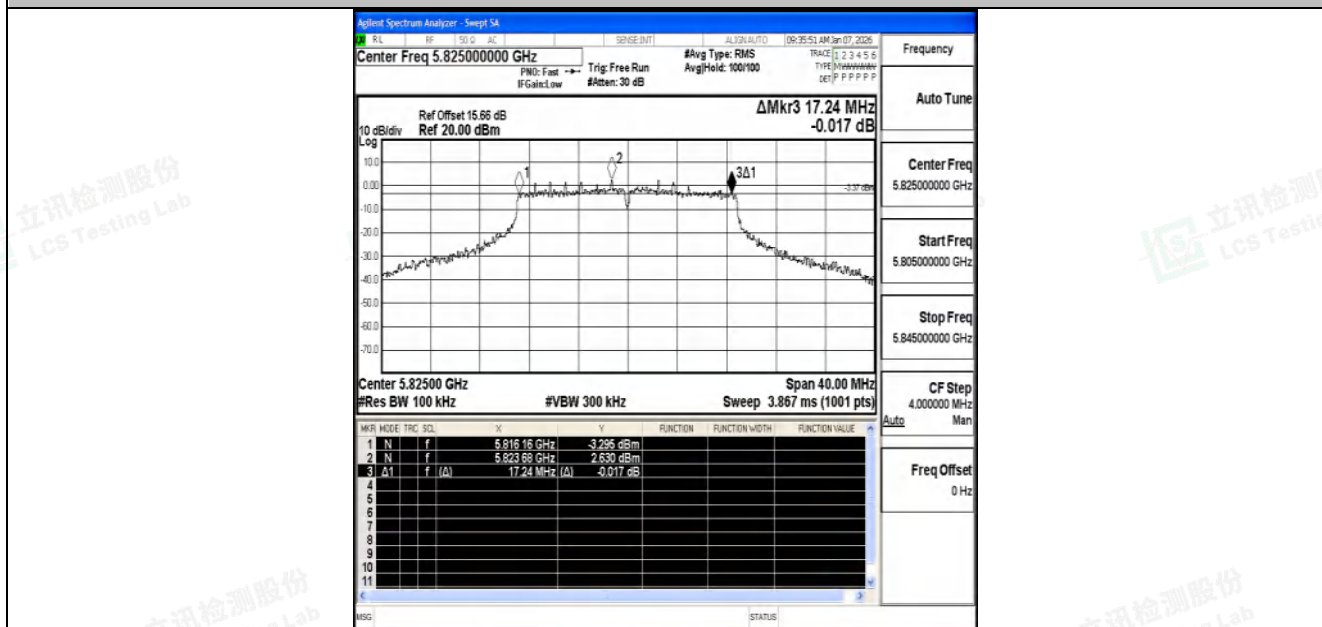

11N20SISO-Ant2-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

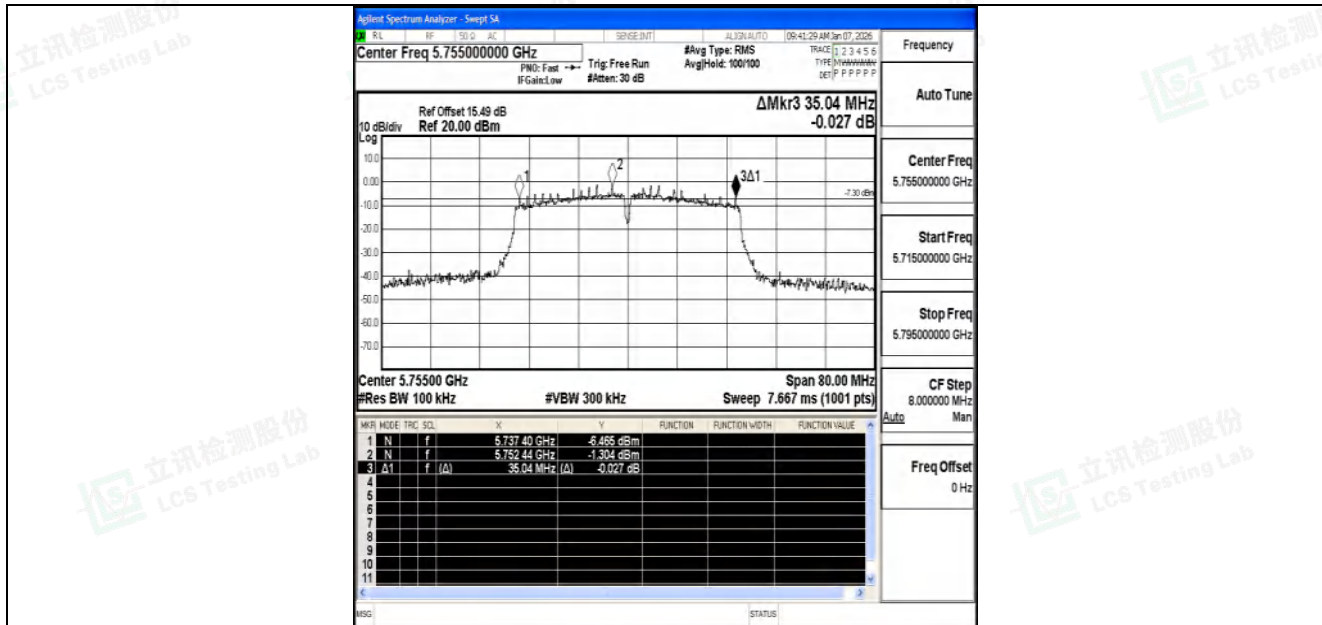

11N40SISO-Ant2-5755-PASS

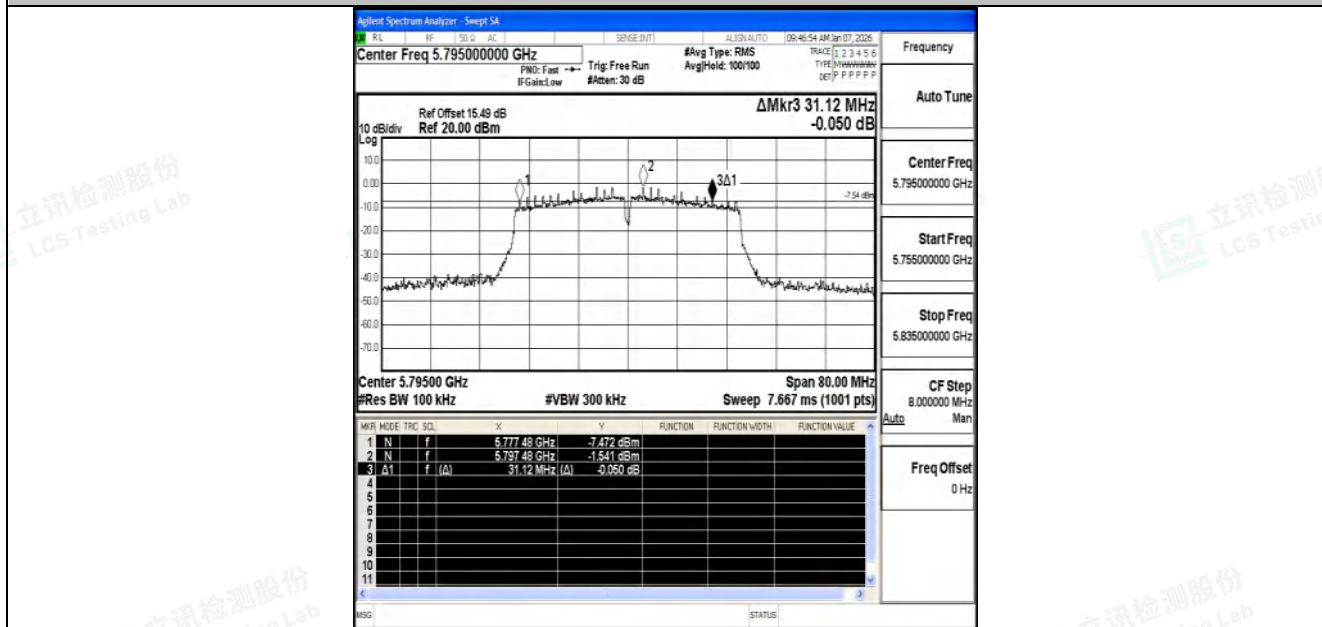

11N40SISO-Ant2-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

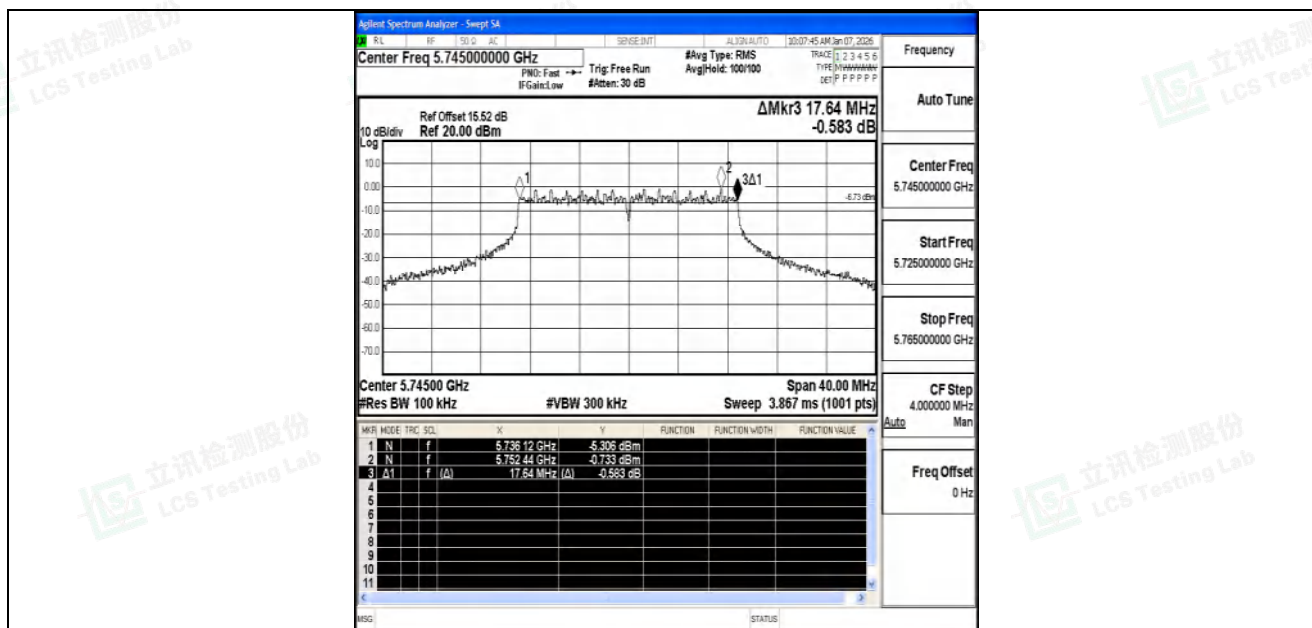

11AC20SISO-Ant2-5745-PASS

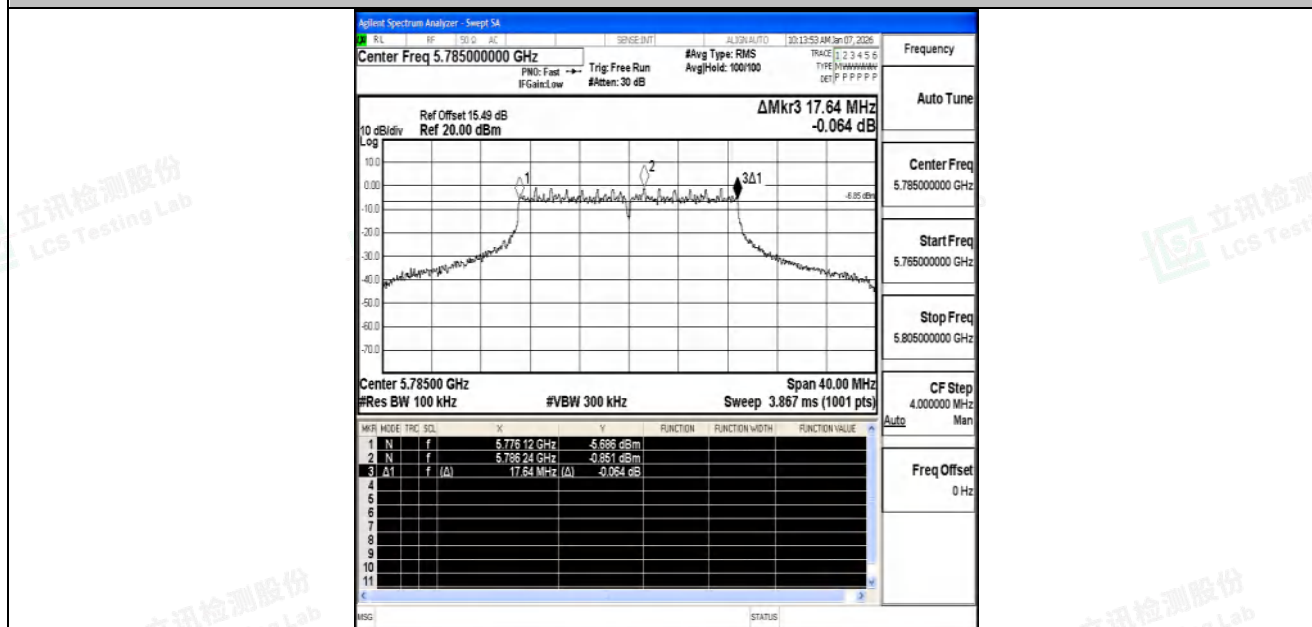

11AC20SISO-Ant2-5785-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

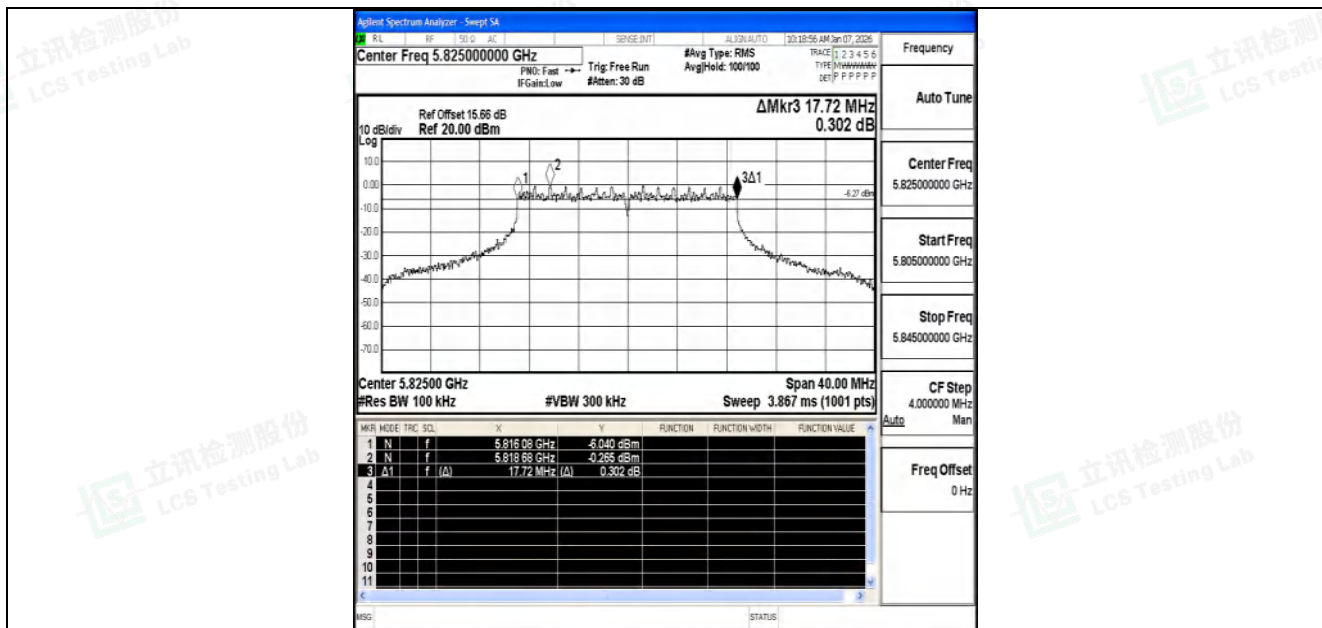

11AC20SISO-Ant2-5825-PASS

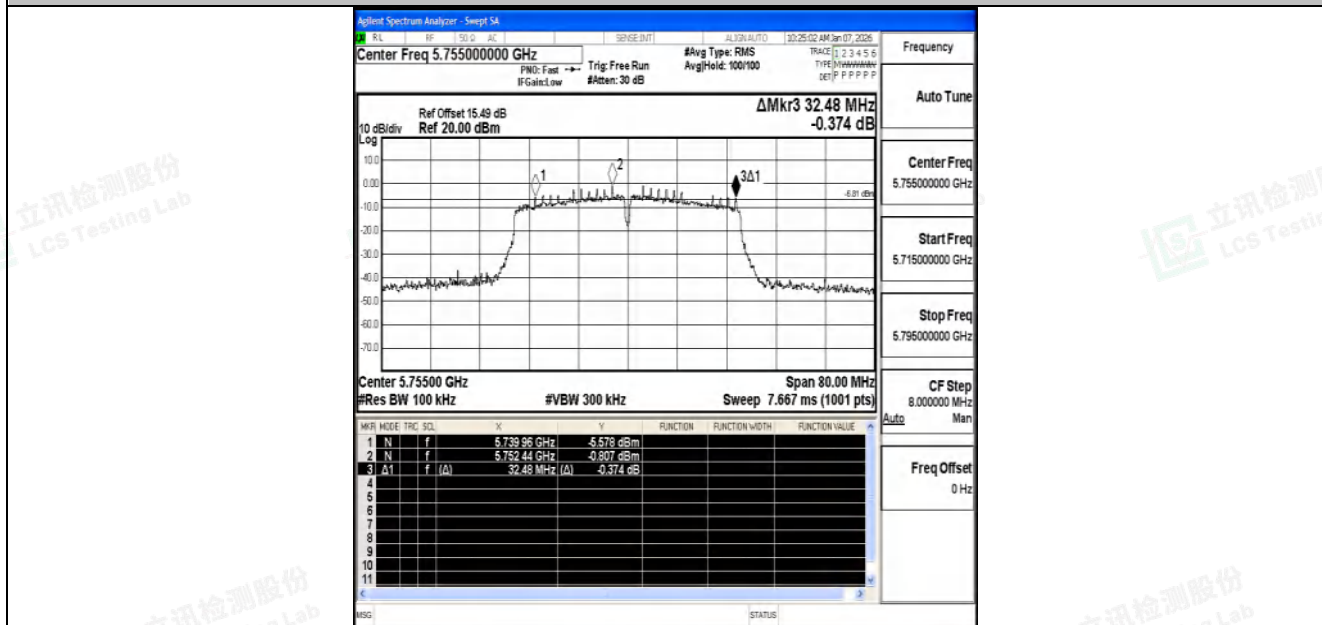

11AC40SISO-Ant2-5755-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

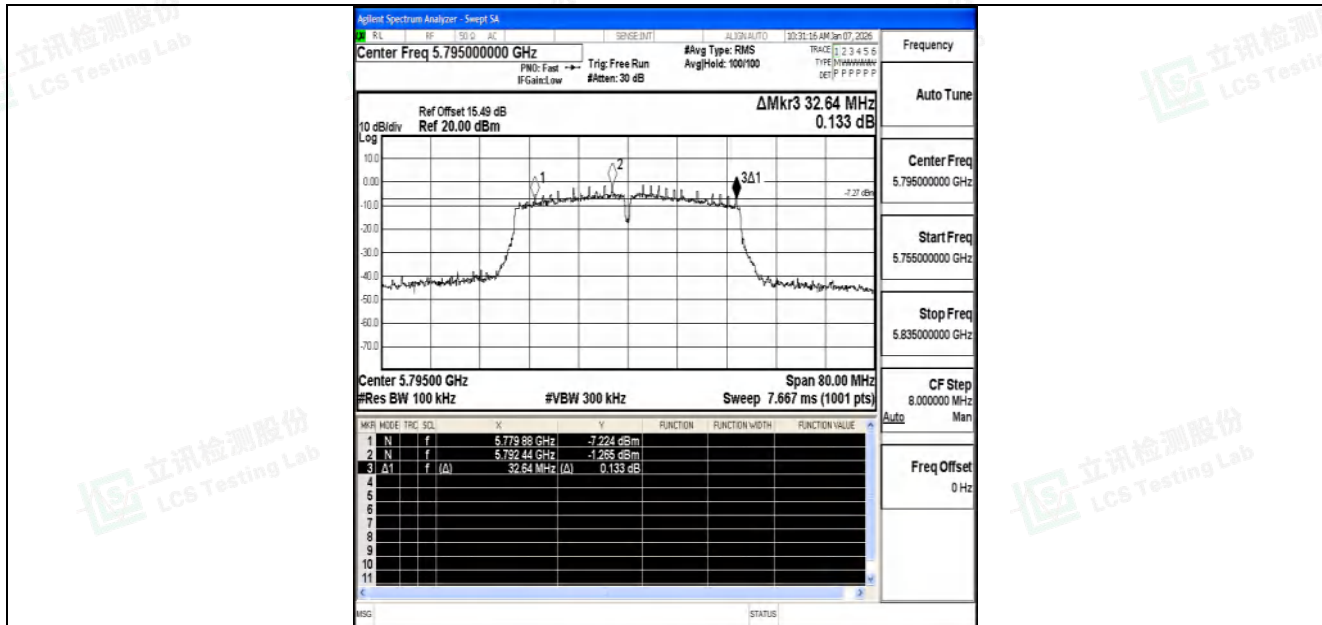

11AC40SISO-Ant2-5795-PASS

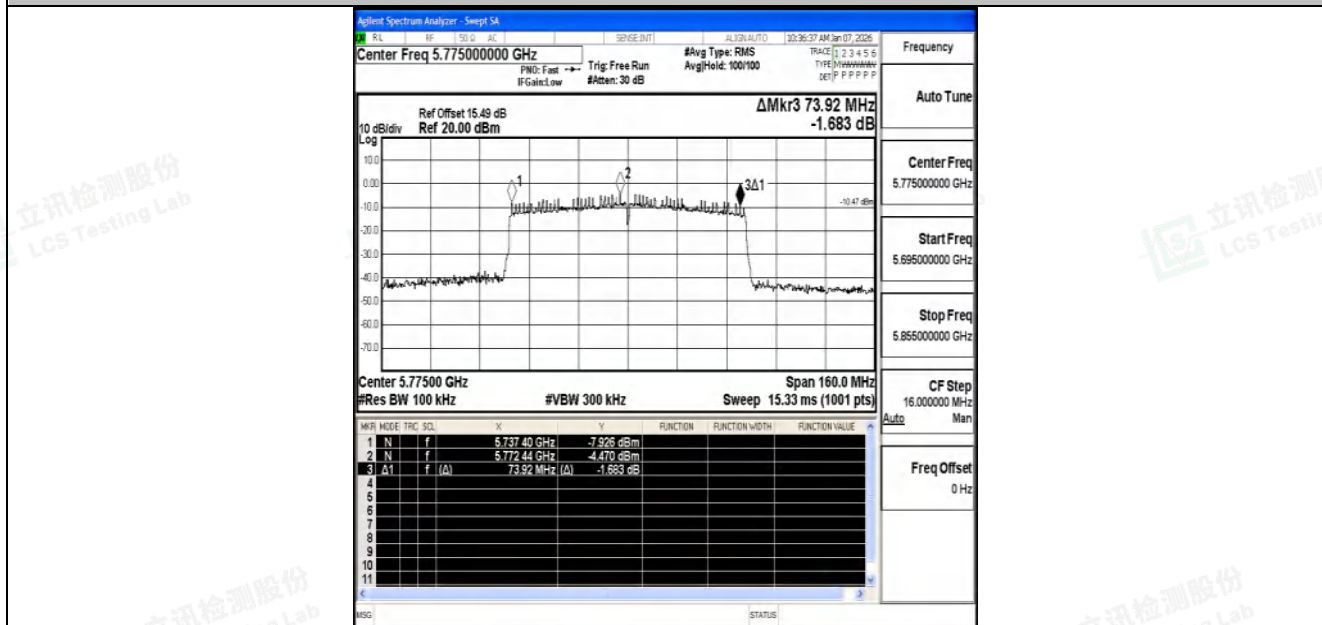

11AC80SISO-Ant2-5775-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.2 Maximum Conducted Output Power

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Power (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-------------------|-------------|---------|
| NVNT      | a    | 5745            | Ant1    | 12.58                 | 0.09             | 12.67             | 30          | Pass    |
| NVNT      | a    | 5785            | Ant1    | 12.37                 | 0.12             | 12.49             | 30          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 12.93                 | 0.09             | 13.02             | 30          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 12.32                 | 0.13             | 12.45             | 30          | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 12.29                 | 0.13             | 12.42             | 30          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 12.76                 | 0.1              | 12.86             | 30          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 10.98                 | 0.2              | 11.18             | 30          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 10.9                  | 0.2              | 11.1              | 30          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 9.4                   | 1.03             | 10.43             | 30          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 0.07                  | 10.09            | 10.16             | 30          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 4.26                  | 5.8              | 10.06             | 30          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 10.86                 | 0.26             | 11.12             | 30          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 10.66                 | 0.2              | 10.86             | 30          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 10.97                 | 0.51             | 11.48             | 30          | Pass    |

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Power (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-------------------|-------------|---------|
| NVNT      | a    | 5745            | Ant2    | 12.89                 | 0.09             | 12.98             | 30          | Pass    |
| NVNT      | a    | 5785            | Ant2    | 12.45                 | 0.12             | 12.57             | 30          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 13.14                 | 0.12             | 13.26             | 30          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 12.64                 | 0.1              | 12.74             | 30          | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 12.22                 | 0.1              | 12.32             | 30          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 13                    | 0.13             | 13.13             | 30          | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 11.1                  | 0.2              | 11.3              | 30          | Pass    |
| NVNT      | n40  | 5795            | Ant2    | 10.81                 | 0.2              | 11.01             | 30          | Pass    |
| NVNT      | ac20 | 5745            | Ant2    | 9.25                  | 0.79             | 10.04             | 30          | Pass    |
| NVNT      | ac20 | 5785            | Ant2    | 9.07                  | 1.03             | 10.1              | 30          | Pass    |
| NVNT      | ac20 | 5825            | Ant2    | 9.61                  | 1.09             | 10.7              | 30          | Pass    |
| NVNT      | ac40 | 5755            | Ant2    | 11.09                 | 0.44             | 11.53             | 30          | Pass    |
| NVNT      | ac40 | 5795            | Ant2    | 11.05                 | 0.26             | 11.31             | 30          | Pass    |
| NVNT      | ac80 | 5775            | Ant2    | 10.74                 | 0.51             | 11.25             | 30          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency (MHz) | Total Power (dBm) |       |           | Limit (dBm) | Verdict |
|-----------|------|-----------------|-------------------|-------|-----------|-------------|---------|
|           |      |                 | Ant1              | Ant2  | Ant1+Ant2 |             |         |
| NVNT      | n20  | 5745            | 12.45             | 12.74 | 15.61     | 30          | Pass    |
| NVNT      | n20  | 5785            | 12.42             | 12.32 | 15.38     | 30          | Pass    |
| NVNT      | n20  | 5825            | 12.86             | 13.13 | 16.01     | 30          | Pass    |
| NVNT      | n40  | 5755            | 11.18             | 11.3  | 14.25     | 30          | Pass    |
| NVNT      | n40  | 5795            | 11.1              | 11.01 | 14.07     | 30          | Pass    |
| NVNT      | ac20 | 5745            | 10.43             | 10.04 | 13.25     | 30          | Pass    |
| NVNT      | ac20 | 5785            | 10.16             | 10.1  | 13.14     | 30          | Pass    |
| NVNT      | ac20 | 5825            | 10.06             | 10.7  | 13.40     | 30          | Pass    |
| NVNT      | ac40 | 5755            | 11.12             | 11.53 | 14.34     | 30          | Pass    |
| NVNT      | ac40 | 5795            | 10.86             | 11.31 | 14.10     | 30          | Pass    |
| NVNT      | ac80 | 5775            | 11.48             | 11.25 | 14.38     | 30          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



### G.3 Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/500KHz) | Duty Factor (dB) | Total PSD (dBm/500KHz) | Limit (dBm/500KHz) | Verdict |
|-----------|------|-----------------|---------|----------------------------|------------------|------------------------|--------------------|---------|
| NVNT      | a    | 5745            | Ant1    | -0.61                      | 0.09             | -0.52                  | 30                 | Pass    |
| NVNT      | a    | 5785            | Ant1    | -0.61                      | 0.12             | -0.49                  | 30                 | Pass    |
| NVNT      | a    | 5825            | Ant1    | -0.02                      | 0.09             | 0.07                   | 30                 | Pass    |
| NVNT      | n20  | 5745            | Ant1    | -1.03                      | 0.13             | -0.9                   | 30                 | Pass    |
| NVNT      | n20  | 5785            | Ant1    | -0.8                       | 0.13             | -0.67                  | 30                 | Pass    |
| NVNT      | n20  | 5825            | Ant1    | -0.32                      | 0.1              | -0.22                  | 30                 | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -4.46                      | 0.2              | -4.26                  | 30                 | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -4.95                      | 0.2              | -4.75                  | 30                 | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | -3.81                      | 1.03             | -2.78                  | 30                 | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | -10.72                     | 10.09            | -0.63                  | 30                 | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | -6.56                      | 5.8              | -0.76                  | 30                 | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | -3.68                      | 0.26             | -3.42                  | 30                 | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | -3.99                      | 0.2              | -3.79                  | 30                 | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | -6.89                      | 0.51             | -6.38                  | 30                 | Pass    |

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/500KHz) | Duty Factor (dB) | Total PSD (dBm/500KHz) | Limit (dBm/500KHz) | Verdict |
|-----------|------|-----------------|---------|----------------------------|------------------|------------------------|--------------------|---------|
| NVNT      | a    | 5745            | Ant2    | 0.79                       | 0.09             | 0.88                   | 30                 | Pass    |
| NVNT      | a    | 5785            | Ant2    | 0.3                        | 0.12             | 0.42                   | 30                 | Pass    |
| NVNT      | a    | 5825            | Ant2    | 1.21                       | 0.12             | 1.33                   | 30                 | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 0.67                       | 0.1              | 0.77                   | 30                 | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 0.1                        | 0.1              | 0.2                    | 30                 | Pass    |
| NVNT      | n20  | 5825            | Ant2    | -0.15                      | 0.13             | -0.02                  | 30                 | Pass    |
| NVNT      | n40  | 5755            | Ant2    | -4.5                       | 0.2              | -4.3                   | 30                 | Pass    |
| NVNT      | n40  | 5795            | Ant2    | -4.72                      | 0.2              | -4.52                  | 30                 | Pass    |
| NVNT      | ac20 | 5745            | Ant2    | -3.61                      | 0.79             | -2.82                  | 30                 | Pass    |
| NVNT      | ac20 | 5785            | Ant2    | -4                         | 1.03             | -2.97                  | 30                 | Pass    |
| NVNT      | ac20 | 5825            | Ant2    | -3.22                      | 1.09             | -2.13                  | 30                 | Pass    |
| NVNT      | ac40 | 5755            | Ant2    | -4.38                      | 0.44             | -3.94                  | 30                 | Pass    |
| NVNT      | ac40 | 5795            | Ant2    | -4.24                      | 0.26             | -3.98                  | 30                 | Pass    |
| NVNT      | ac80 | 5775            | Ant2    | -8.28                      | 0.51             | -7.77                  | 30                 | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency (MHz) | Total PSD (dBm/500KHz) |       |           | Limit (dBm/500KHz) | Verdict |
|-----------|------|-----------------|------------------------|-------|-----------|--------------------|---------|
|           |      |                 | Ant1                   | Ant2  | Ant1+Ant2 |                    |         |
| NVNT      | n20  | 5745            | -0.9                   | 0.77  | 3.03      | 27.69              | Pass    |
| NVNT      | n20  | 5785            | -0.67                  | 0.2   | 2.80      | 27.69              | Pass    |
| NVNT      | n20  | 5825            | -0.22                  | -0.02 | 2.89      | 27.69              | Pass    |
| NVNT      | n40  | 5755            | -4.26                  | -4.3  | -1.27     | 27.69              | Pass    |
| NVNT      | n40  | 5795            | -4.75                  | -4.52 | -1.62     | 27.69              | Pass    |
| NVNT      | ac20 | 5745            | -2.78                  | -2.82 | 0.21      | 27.69              | Pass    |
| NVNT      | ac20 | 5785            | -0.63                  | -2.97 | 1.37      | 27.69              | Pass    |
| NVNT      | ac20 | 5825            | -0.76                  | -2.13 | 1.62      | 27.69              | Pass    |
| NVNT      | ac40 | 5755            | -3.42                  | -3.94 | -0.66     | 27.69              | Pass    |
| NVNT      | ac40 | 5795            | -3.79                  | -3.98 | -0.87     | 27.69              | Pass    |
| NVNT      | ac80 | 5775            | -6.38                  | -7.77 | -4.01     | 27.69              | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity




## Test Graphs

PSD NVNT a 5745MHz Ant1

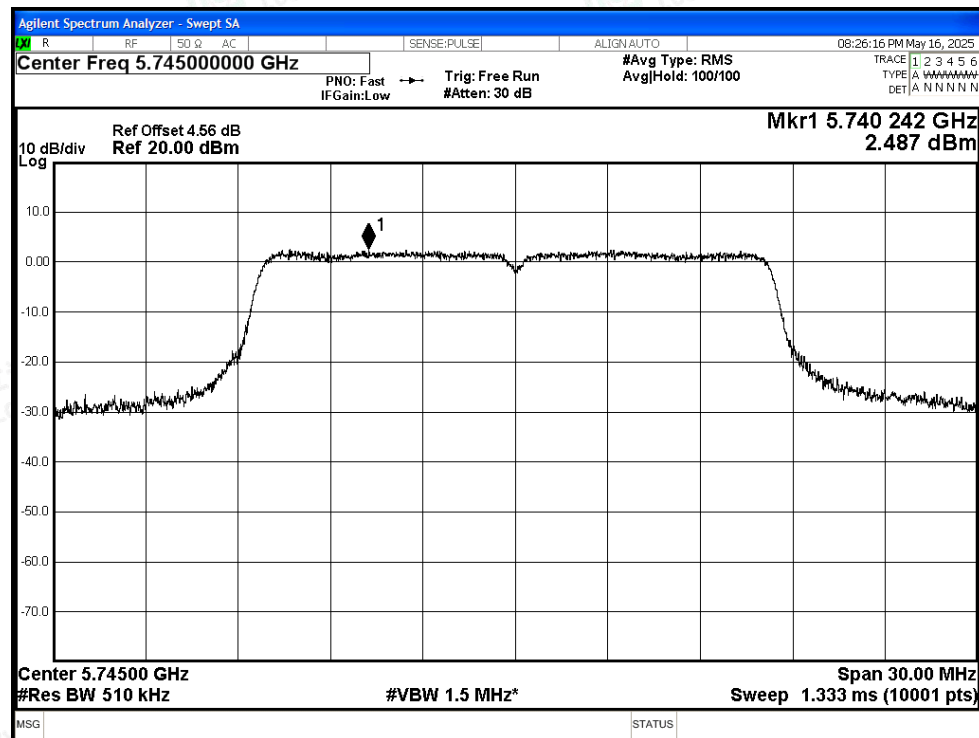

PSD NVNT a 5785MHz Ant1

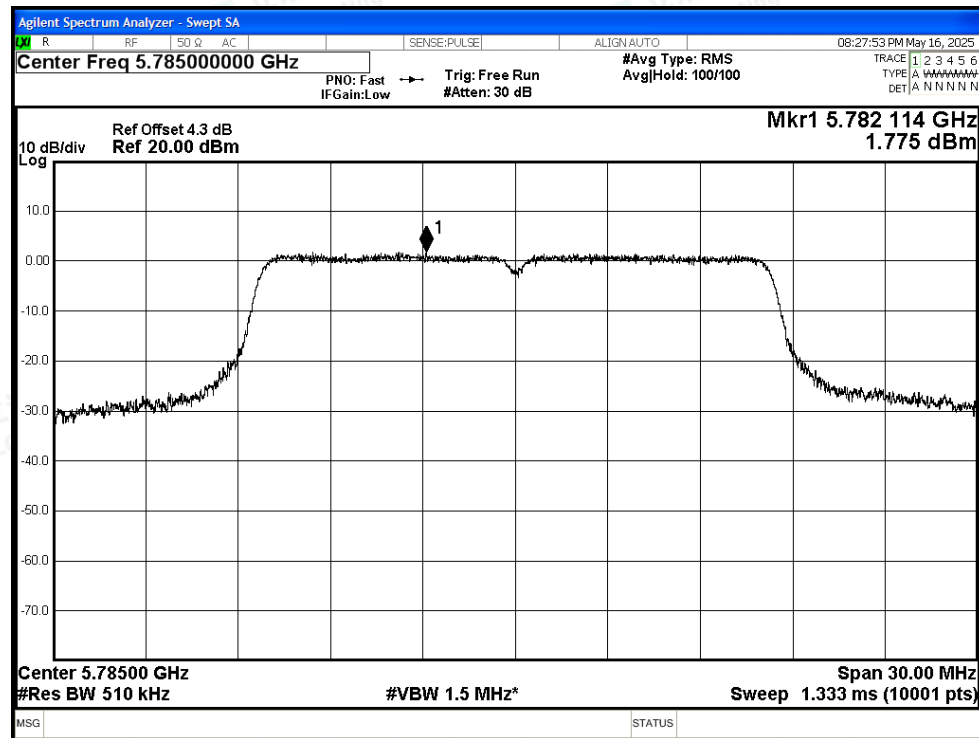

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5825MHz Ant1

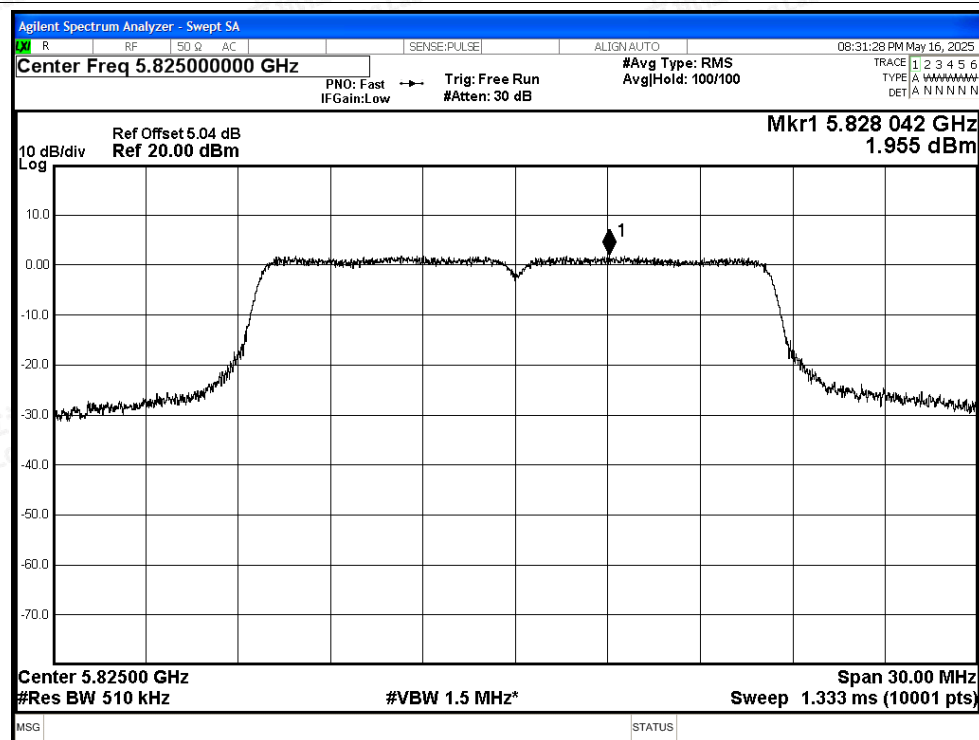

PSD NVNT n20 5745MHz Ant1


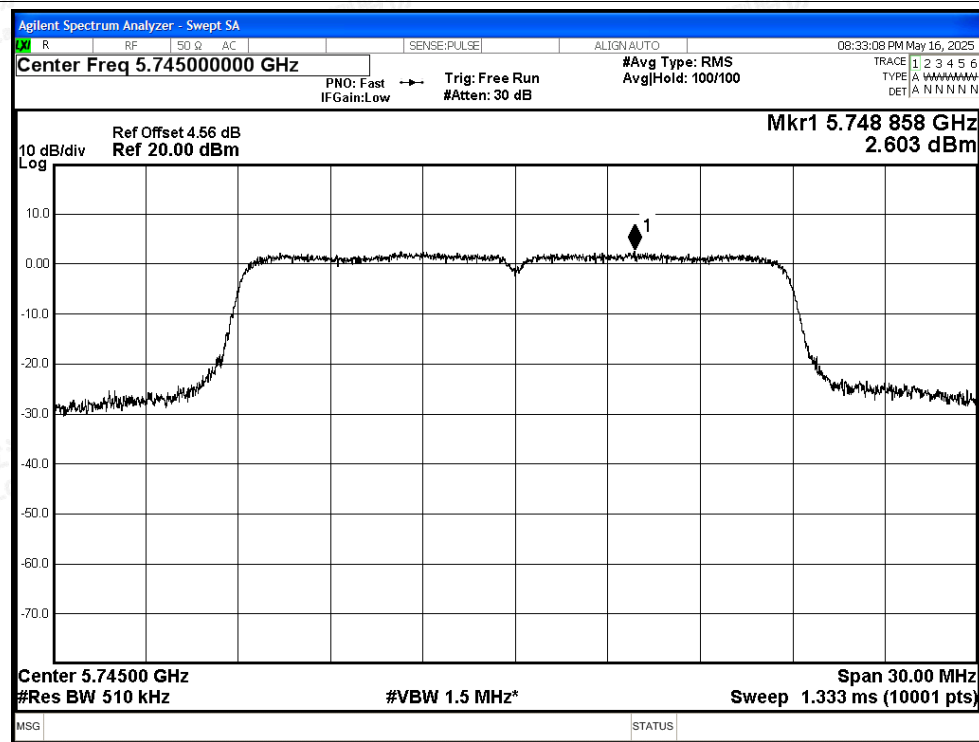


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

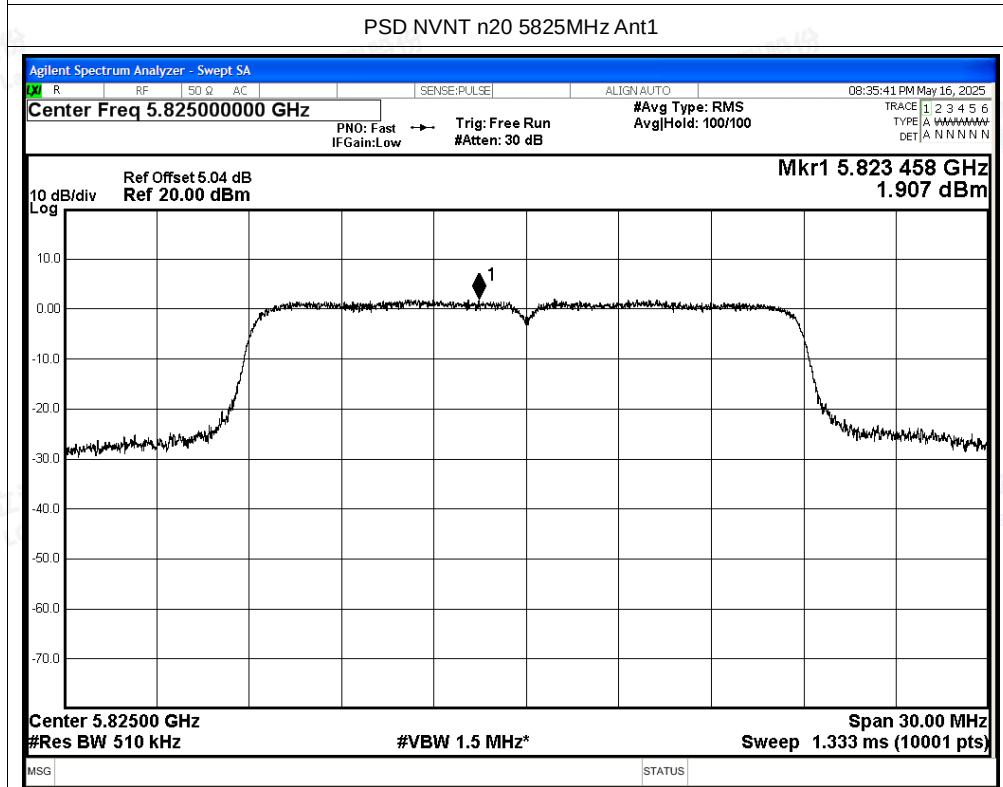
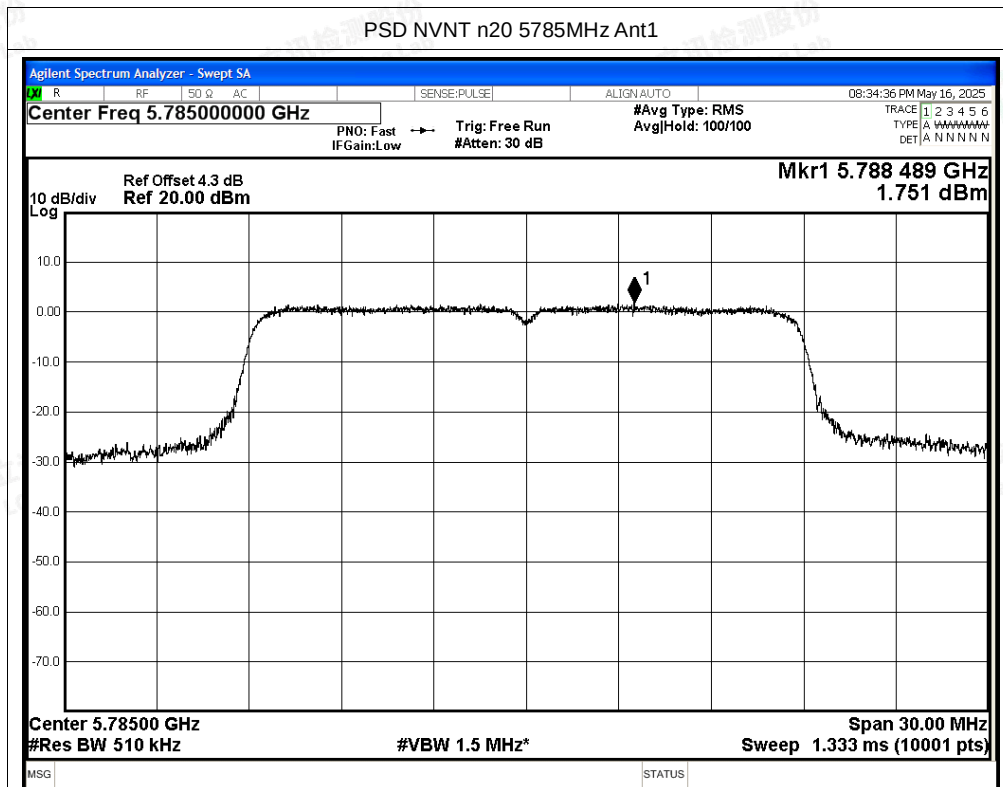


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

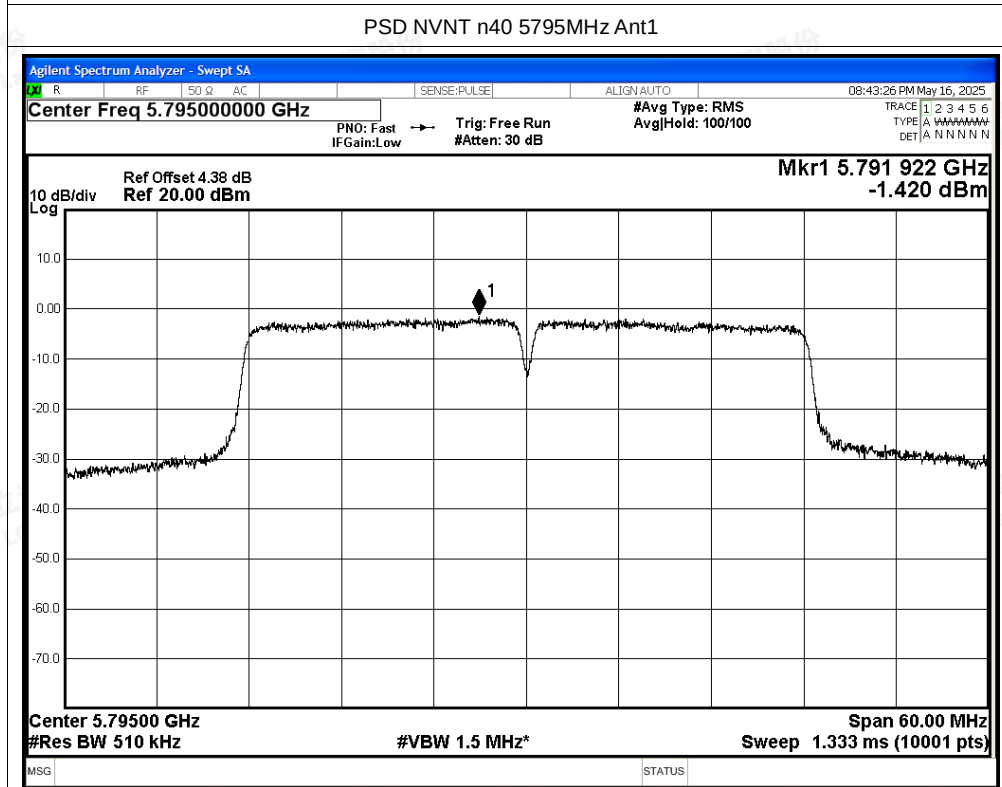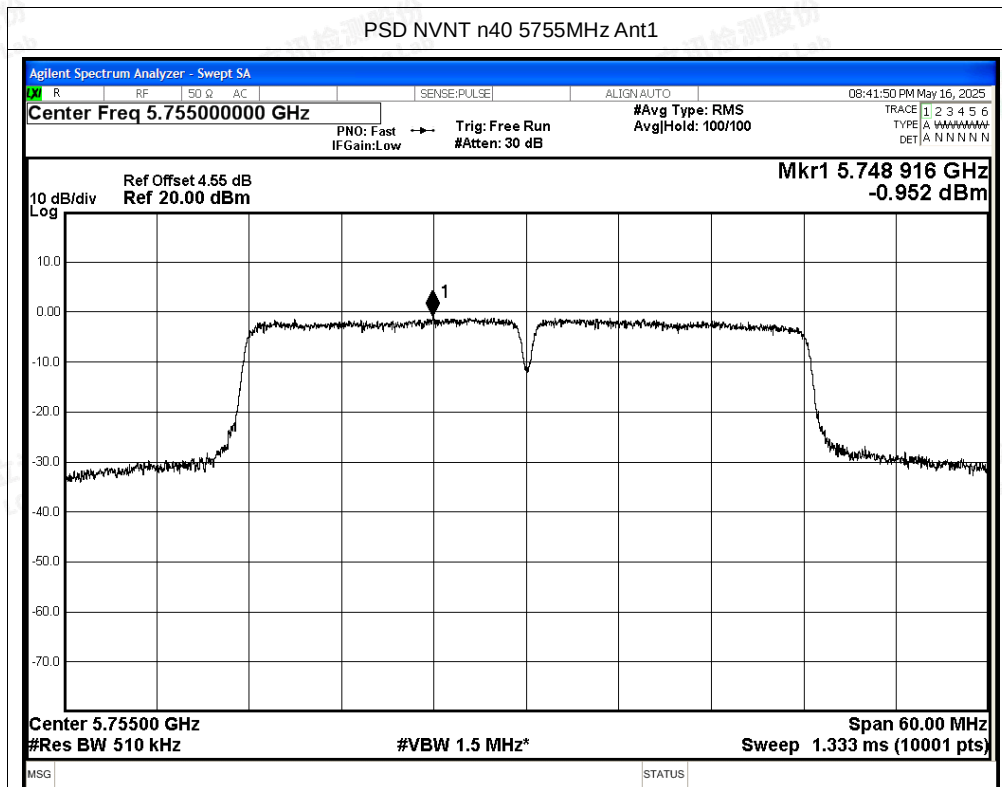

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5745MHz Ant1

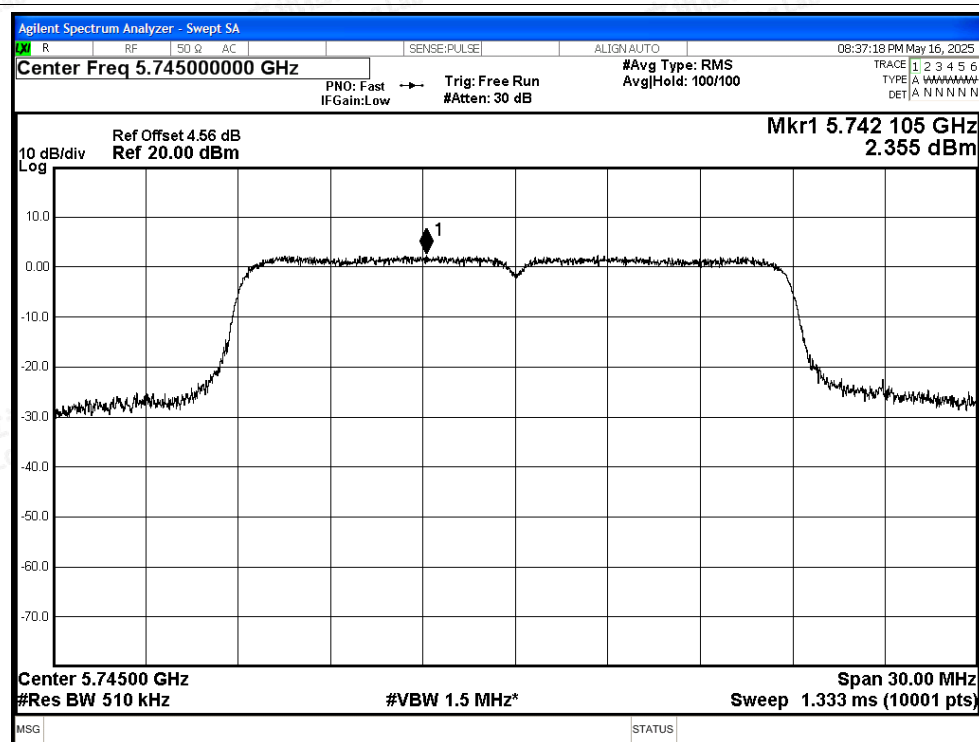

PSD NVNT ac20 5785MHz Ant1

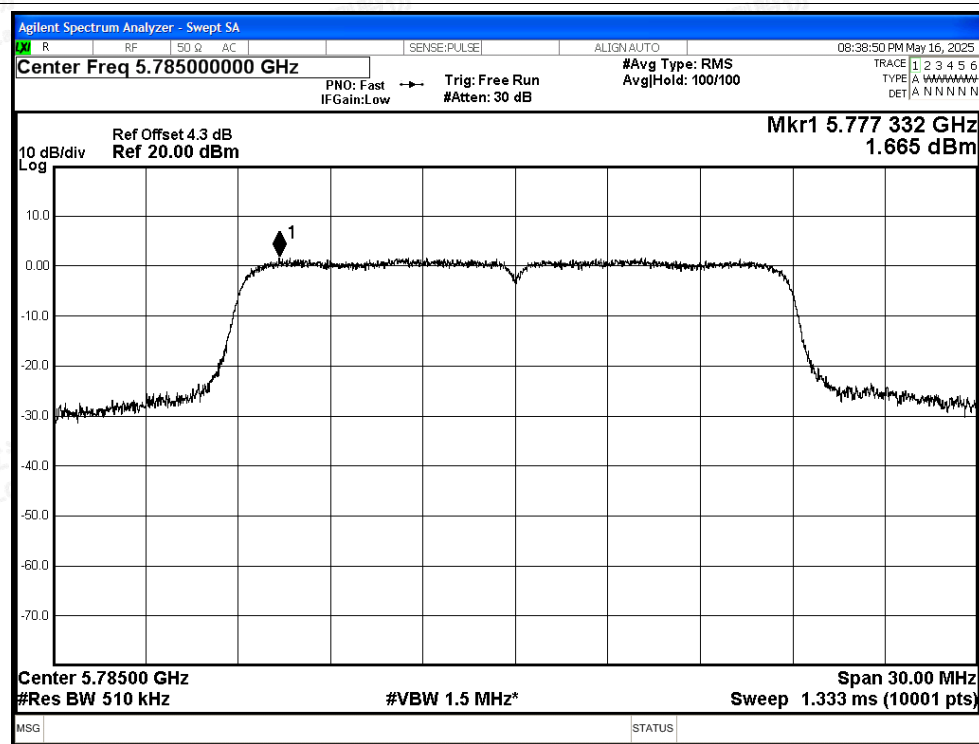

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant1

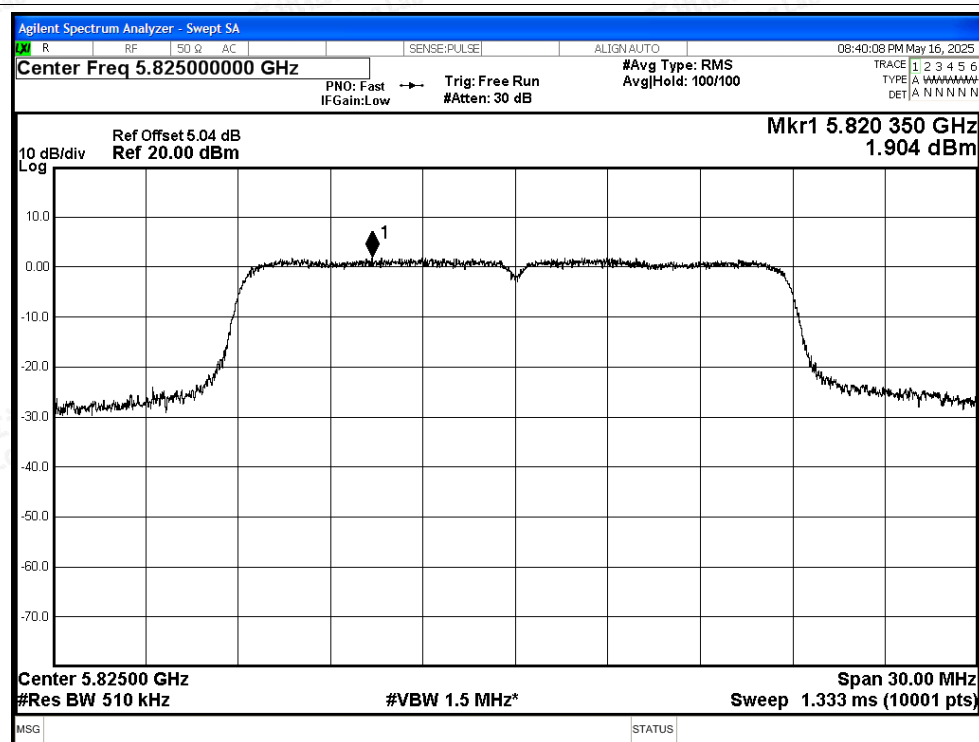

PSD NVNT ac40 5755MHz Ant1

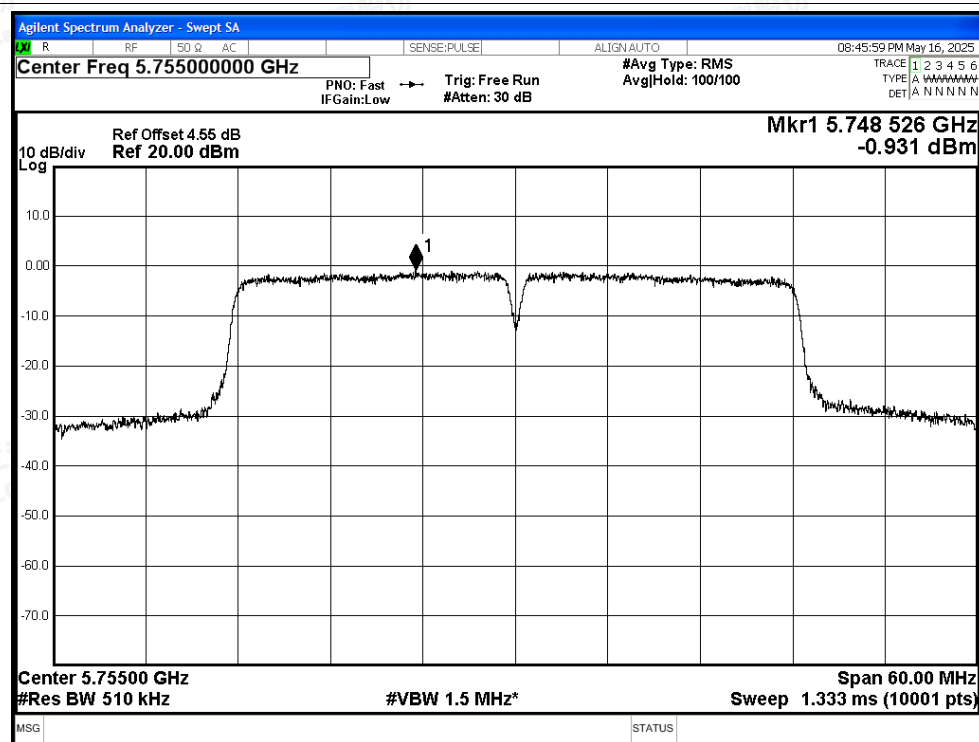

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant1

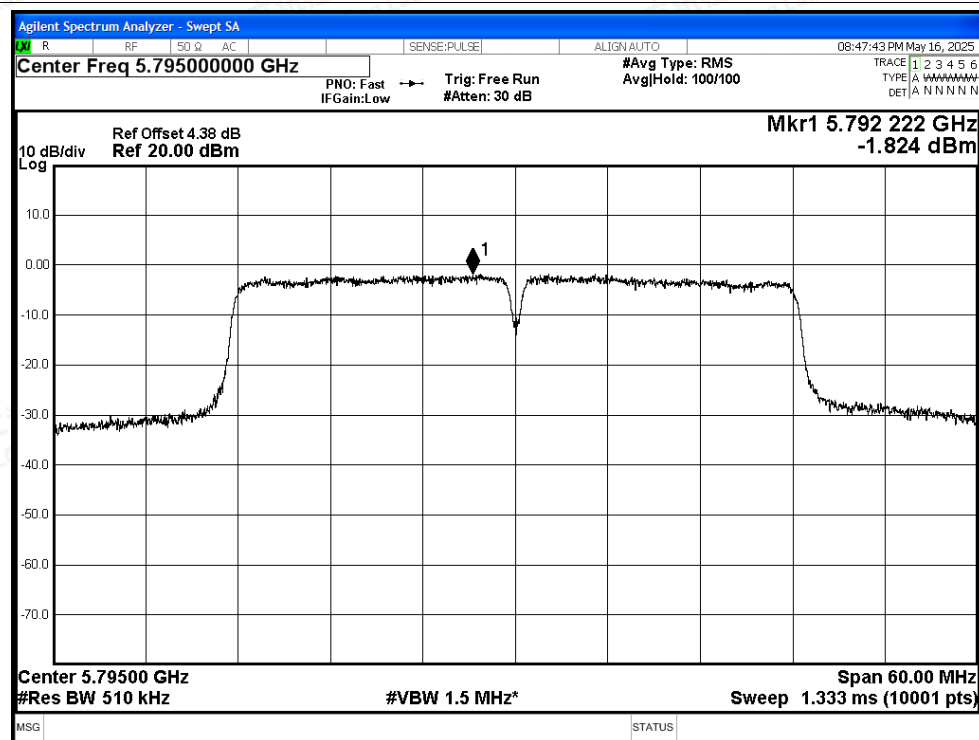

PSD NVNT ac80 5775MHz Ant1

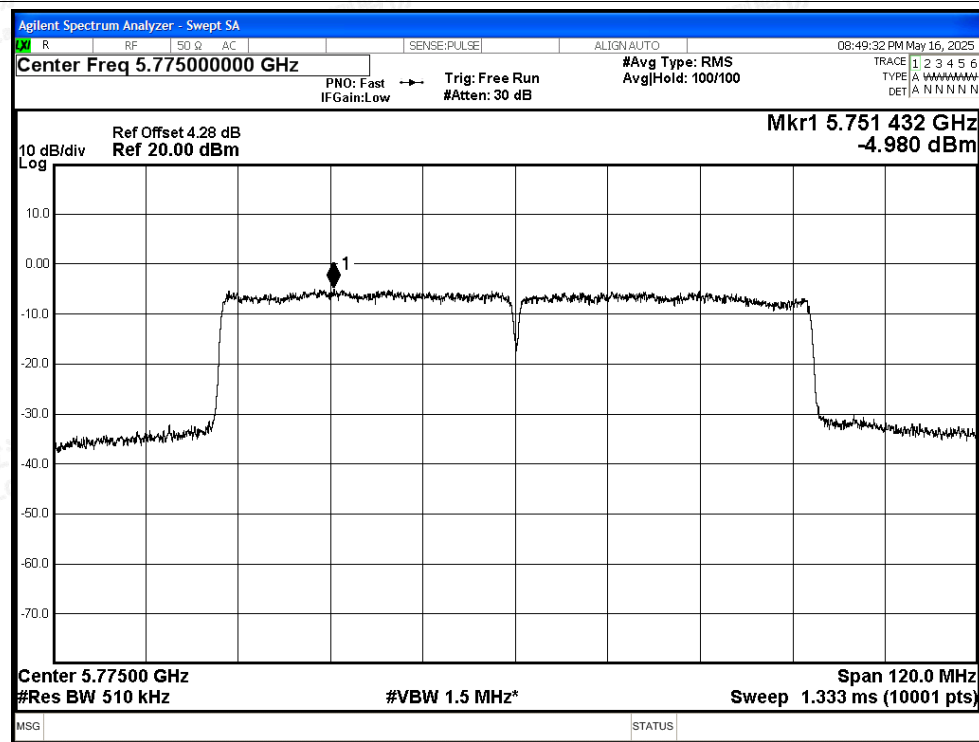

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.4 Emissions in Restricted Bands

### Test Result

| TestMode   | Antenna | ChName | Frequency[MHz] | Detector | Freq [MHz] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|--------|----------------|----------|------------|--------------|-------------|---------|
| 11A        | Ant1    | Low    | 5745           | Peak     | 5650.000   | -43.178      | ≤-27.00     | PASS    |
| 11A        | Ant1    | Low    | 5745           | Peak     | 5700.000   | -39.96       | ≤10.00      | PASS    |
| 11A        | Ant1    | Low    | 5745           | Peak     | 5720.000   | -35.44       | ≤15.60      | PASS    |
| 11A        | Ant1    | Low    | 5745           | Peak     | 5725.000   | -28.41       | ≤27.00      | PASS    |
| 11A        | Ant1    | High   | 5825           | Peak     | 5850.000   | -35.533      | ≤27.00      | PASS    |
| 11A        | Ant1    | High   | 5825           | Peak     | 5855.000   | -39.25       | ≤15.60      | PASS    |
| 11A        | Ant1    | High   | 5825           | Peak     | 5875.000   | -41.12       | ≤10.00      | PASS    |
| 11A        | Ant1    | High   | 5825           | Peak     | 5925.000   | -44.13       | ≤-27.00     | PASS    |
| 11N20SISO  | Ant1    | Low    | 5745           | Peak     | 5650.000   | -40.728      | ≤-27.00     | PASS    |
| 11N20SISO  | Ant1    | Low    | 5745           | Peak     | 5700.000   | -38.11       | ≤10.00      | PASS    |
| 11N20SISO  | Ant1    | Low    | 5745           | Peak     | 5720.000   | -34.47       | ≤15.60      | PASS    |
| 11N20SISO  | Ant1    | Low    | 5745           | Peak     | 5725.000   | -21.96       | ≤27.00      | PASS    |
| 11N20SISO  | Ant1    | High   | 5825           | Peak     | 5850.000   | -34.191      | ≤27.00      | PASS    |
| 11N20SISO  | Ant1    | High   | 5825           | Peak     | 5855.000   | -37.73       | ≤15.60      | PASS    |
| 11N20SISO  | Ant1    | High   | 5825           | Peak     | 5875.000   | -40.56       | ≤10.00      | PASS    |
| 11N20SISO  | Ant1    | High   | 5825           | Peak     | 5925.000   | -43.8        | ≤-27.00     | PASS    |
| 11N40SISO  | Ant1    | Low    | 5755           | Peak     | 5650.000   | -43.525      | ≤-27.00     | PASS    |
| 11N40SISO  | Ant1    | Low    | 5755           | Peak     | 5700.000   | -40.13       | ≤10.00      | PASS    |
| 11N40SISO  | Ant1    | Low    | 5755           | Peak     | 5720.000   | -36.2        | ≤15.60      | PASS    |
| 11N40SISO  | Ant1    | Low    | 5755           | Peak     | 5725.000   | -31.31       | ≤27.00      | PASS    |
| 11N40SISO  | Ant1    | High   | 5795           | Peak     | 5850.000   | -41.071      | ≤27.00      | PASS    |
| 11N40SISO  | Ant1    | High   | 5795           | Peak     | 5855.000   | -43.03       | ≤15.60      | PASS    |
| 11N40SISO  | Ant1    | High   | 5795           | Peak     | 5875.000   | -43.13       | ≤10.00      | PASS    |
| 11N40SISO  | Ant1    | High   | 5795           | Peak     | 5925.000   | -44.75       | ≤-27.00     | PASS    |
| 11AC20SISO | Ant1    | Low    | 5745           | Peak     | 5650.000   | -42.431      | ≤-27.00     | PASS    |
| 11AC20SISO | Ant1    | Low    | 5745           | Peak     | 5700.000   | -43.07       | ≤10.00      | PASS    |
| 11AC20SISO | Ant1    | Low    | 5745           | Peak     | 5720.000   | -41.32       | ≤15.60      | PASS    |
| 11AC20SISO | Ant1    | Low    | 5745           | Peak     | 5725.000   | -26.93       | ≤27.00      | PASS    |
| 11AC20SISO | Ant1    | High   | 5825           | Peak     | 5850.000   | -43.518      | ≤27.00      | PASS    |
| 11AC20SISO | Ant1    | High   | 5825           | Peak     | 5855.000   | -43.63       | ≤15.60      | PASS    |
| 11AC20SISO | Ant1    | High   | 5825           | Peak     | 5875.000   | -44.98       | ≤10.00      | PASS    |
| 11AC20SISO | Ant1    | High   | 5825           | Peak     | 5925.000   | -44.73       | ≤-27.00     | PASS    |
| 11AC40SISO | Ant1    | Low    | 5755           | Peak     | 5650.000   | -42.269      | ≤-27.00     | PASS    |
| 11AC40SISO | Ant1    | Low    | 5755           | Peak     | 5700.000   | -39.34       | ≤10.00      | PASS    |
| 11AC40SISO | Ant1    | Low    | 5755           | Peak     | 5720.000   | -34.06       | ≤15.60      | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |      |      |          |         |         |      |
|------------|------|------|------|------|----------|---------|---------|------|
| 11AC40SISO | Ant1 | Low  | 5755 | Peak | 5725.000 | -34.31  | ≤27.00  | PASS |
| 11AC40SISO | Ant1 | High | 5795 | Peak | 5850.000 | -42.378 | ≤27.00  | PASS |
| 11AC40SISO | Ant1 | High | 5795 | Peak | 5855.000 | -43.08  | ≤15.60  | PASS |
| 11AC40SISO | Ant1 | High | 5795 | Peak | 5875.000 | -43.99  | ≤10.00  | PASS |
| 11AC40SISO | Ant1 | High | 5795 | Peak | 5925.000 | -44.75  | ≤-27.00 | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | Peak | 5650.000 | -40.636 | ≤-27.00 | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | Peak | 5700.000 | -34.62  | ≤10.00  | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | Peak | 5720.000 | -30.75  | ≤15.60  | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | Peak | 5725.000 | -29.46  | ≤27.00  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | Peak | 5850.000 | -40.667 | ≤27.00  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | Peak | 5855.000 | -41.36  | ≤15.60  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | Peak | 5875.000 | -42.87  | ≤10.00  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | Peak | 5925.000 | -44.29  | ≤-27.00 | PASS |

## Note:


1. The Antenna Gain is compensated in the graph.
2. For transmitters operating in 5150-5350 GHz band and 5470-5725 GHz band: The limit in dBm for average detector is conversion from 54dBuV/m, according to 15.209(a). The limit in dBm for peak detector is 20dB above the limit of average detector in dBm.



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## Test Graphs

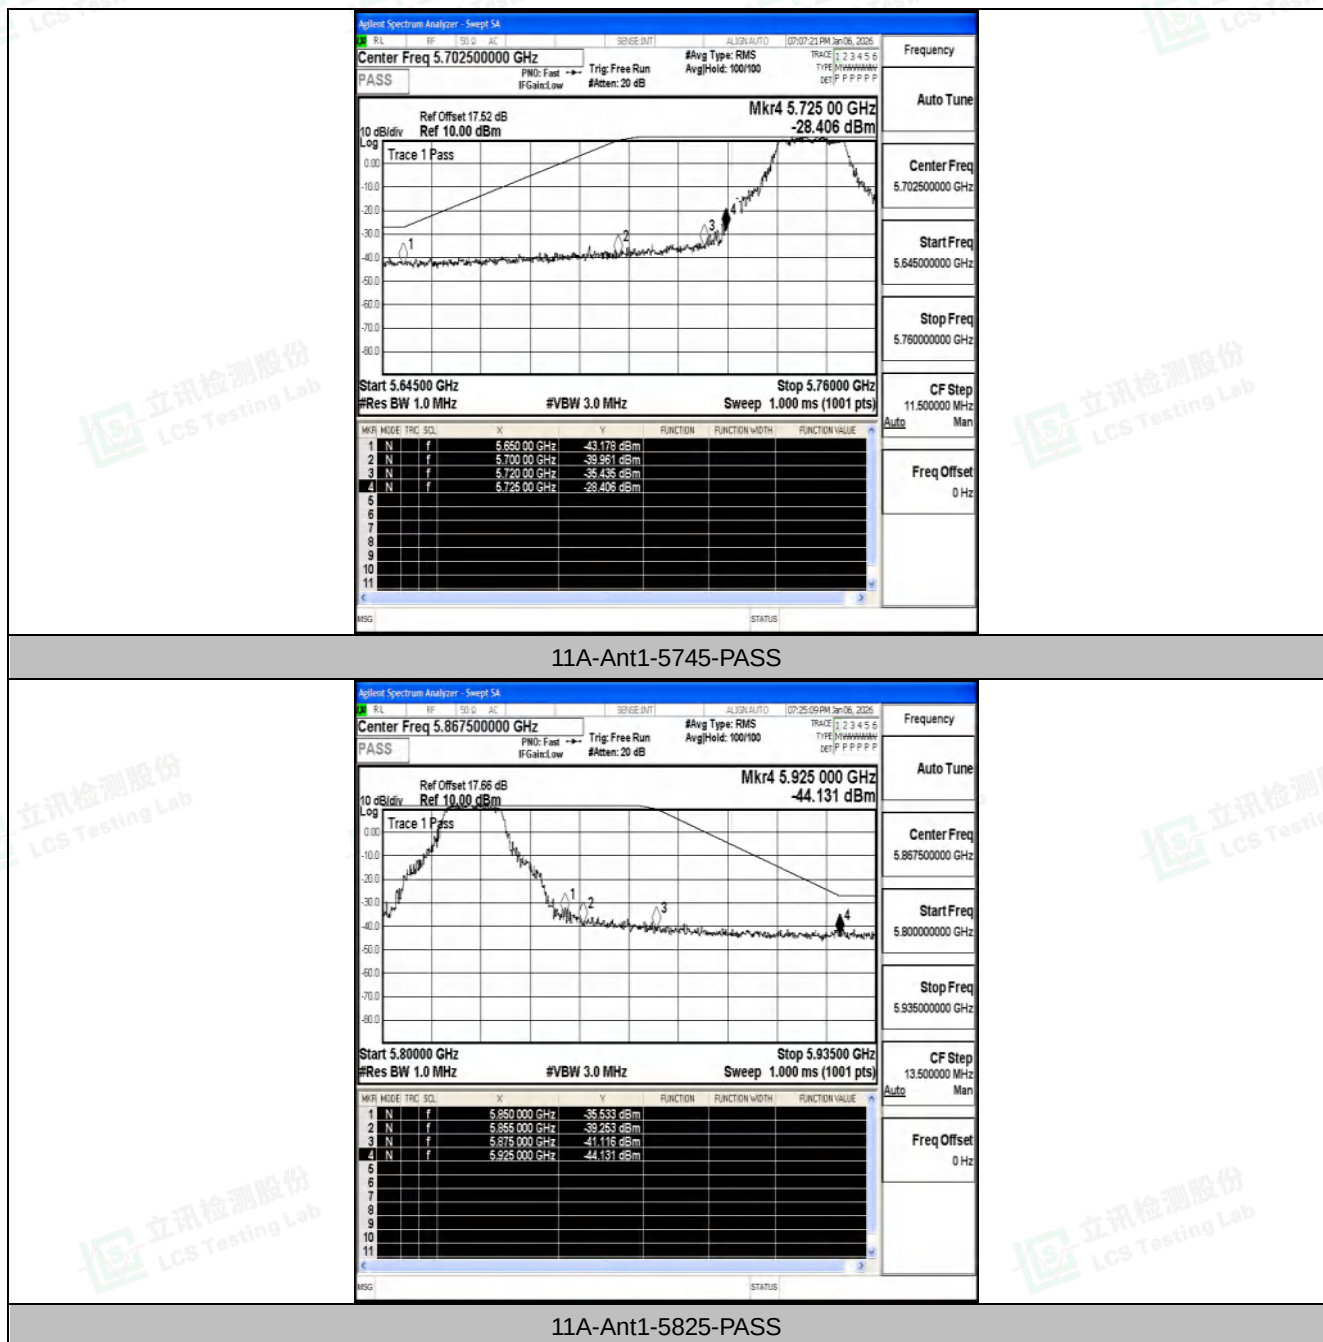


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

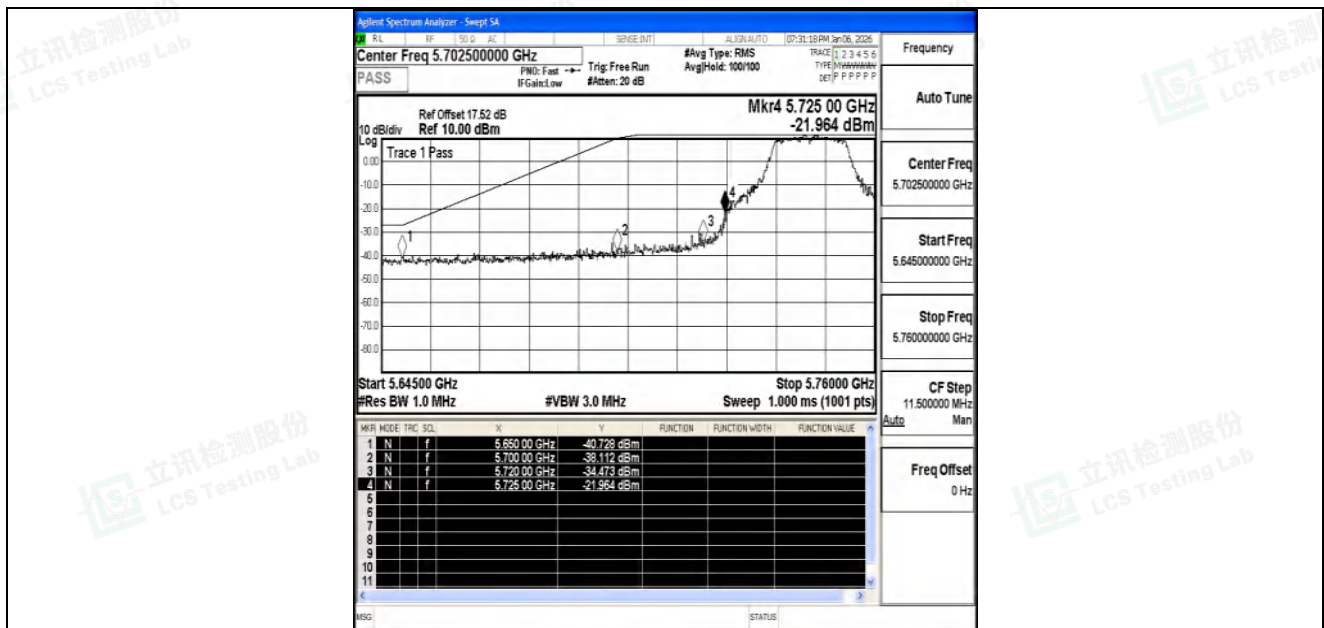

11N20SISO-Ant1-5745-PASS

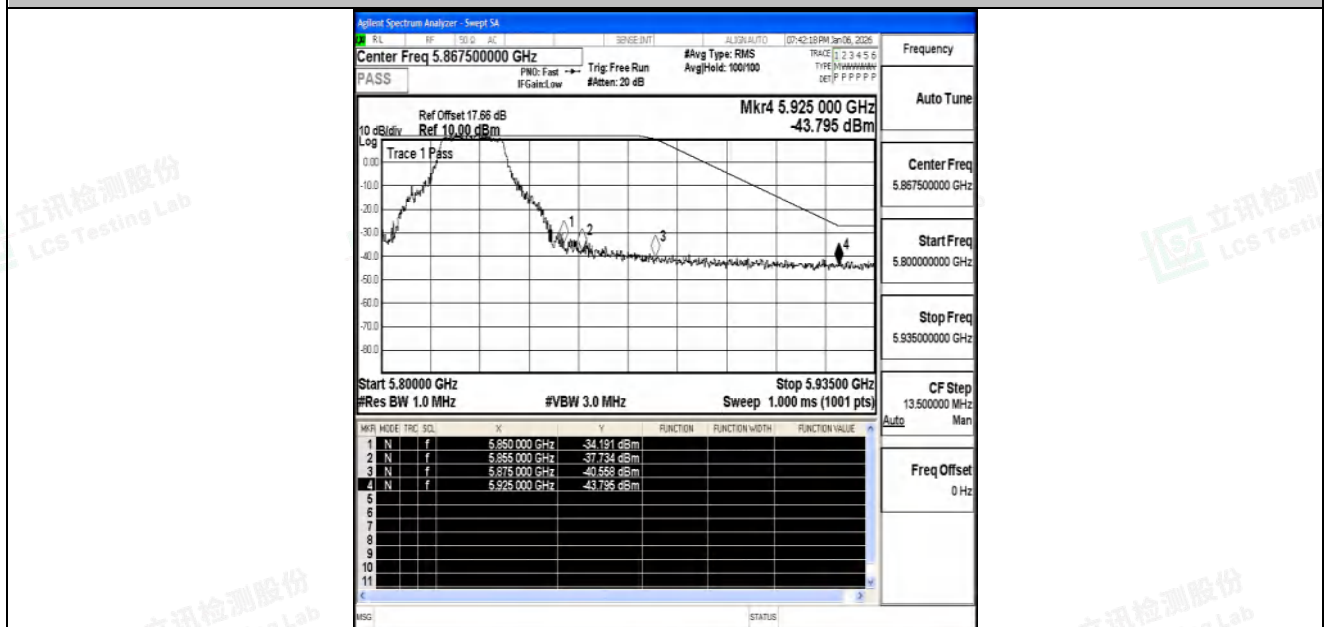

11N20SISO-Ant1-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

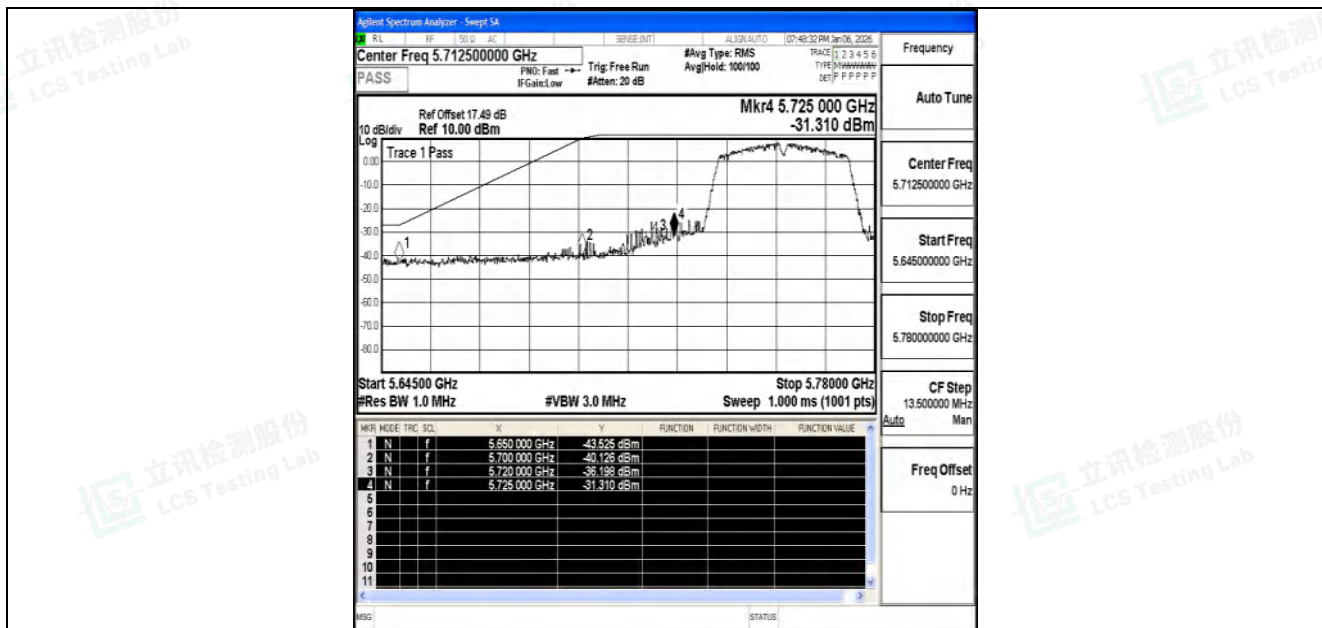

11N40SISO-Ant1-5755-PASS

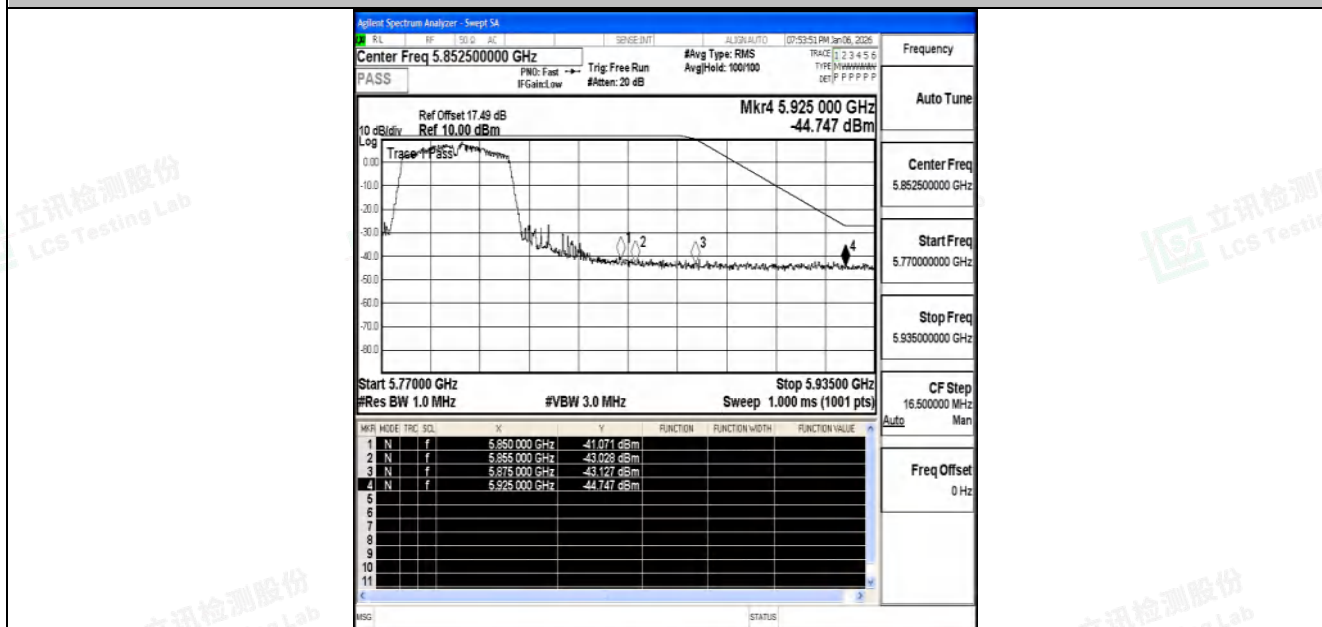

11N40SISO-Ant1-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

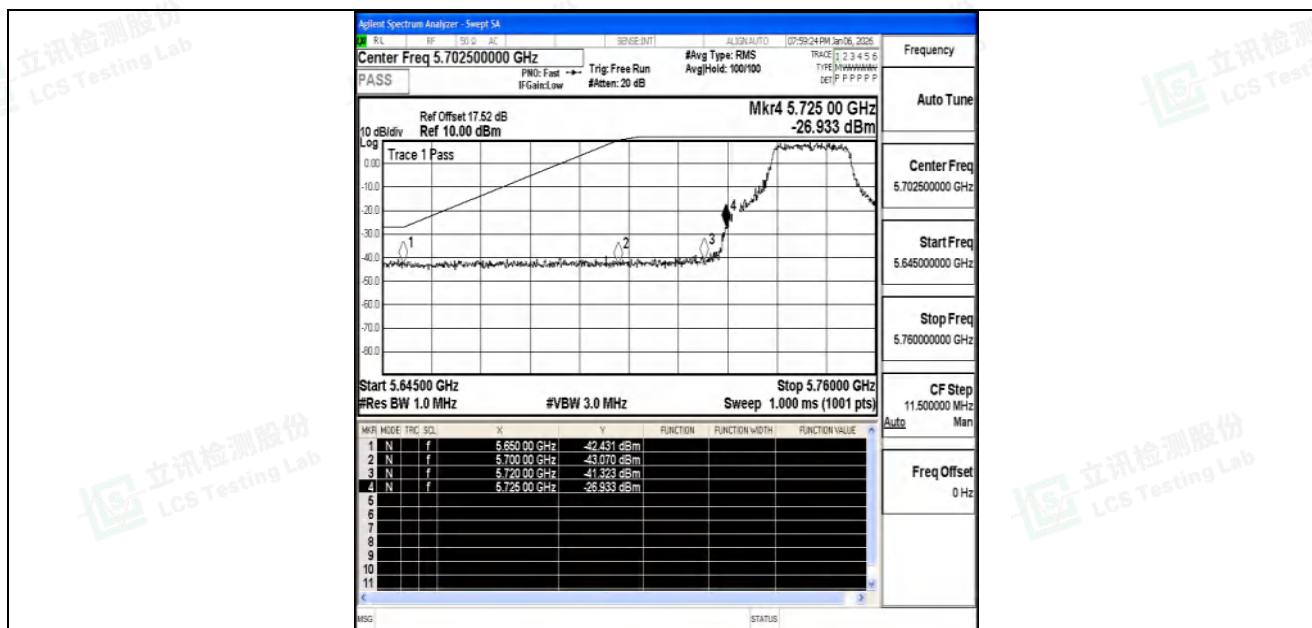

11AC20SISO-Ant1-5745-PASS

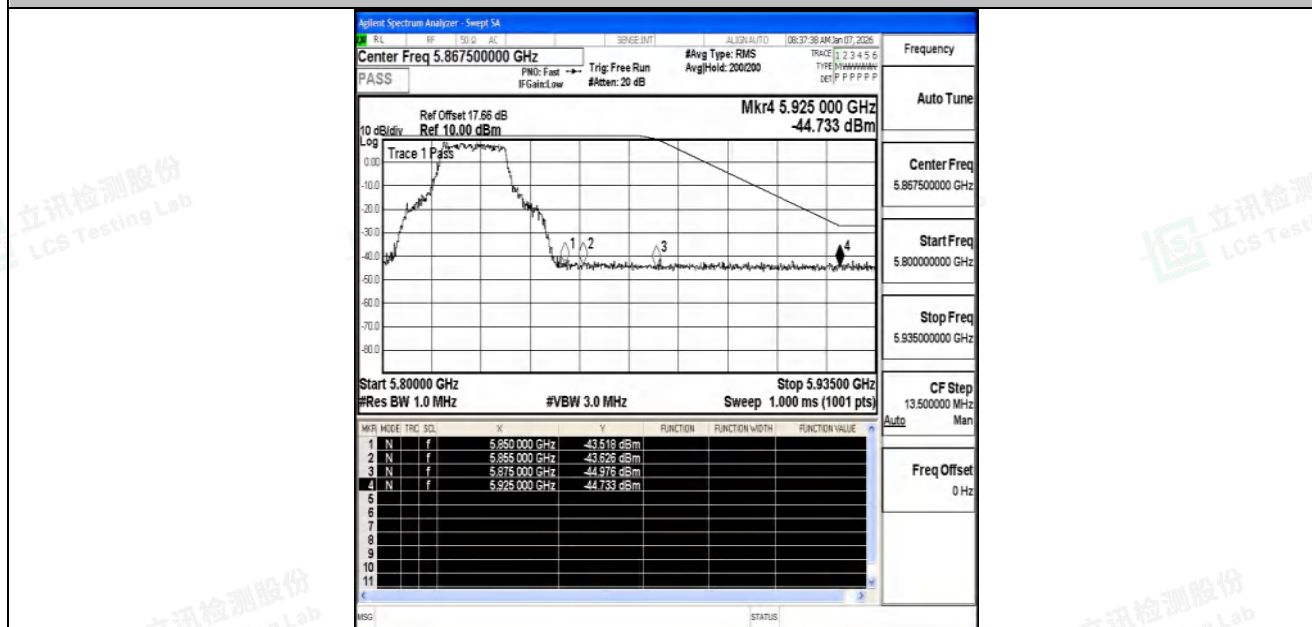

11AC20SISO-Ant1-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

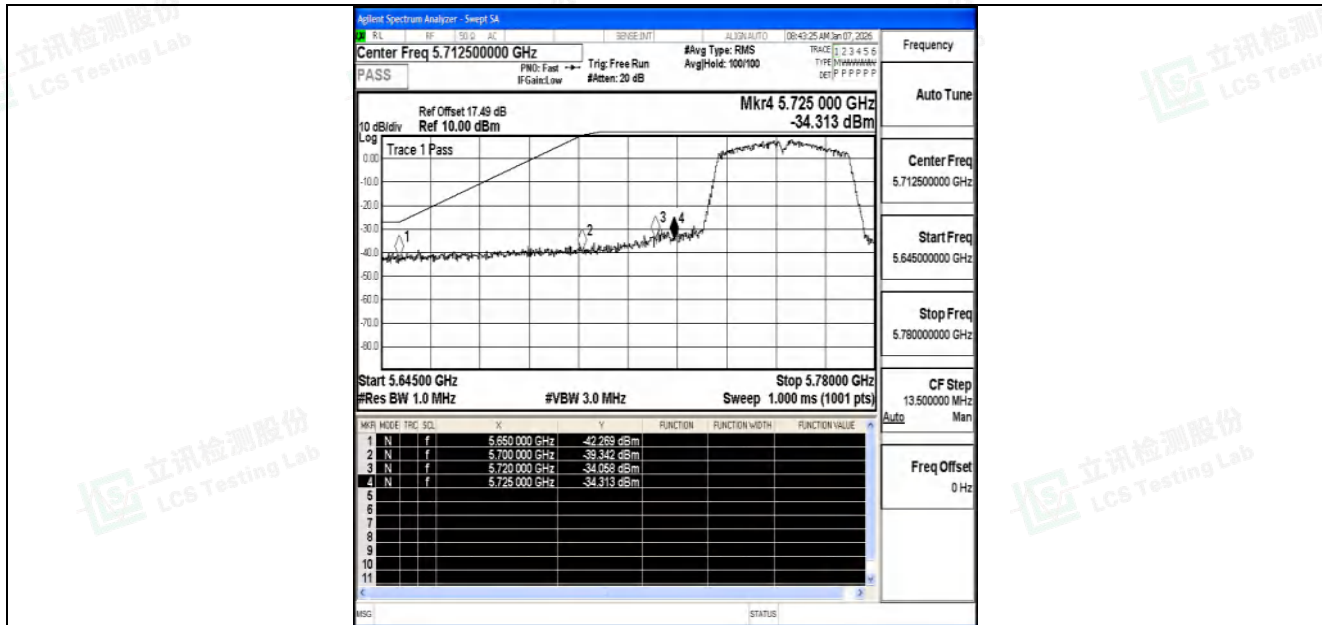

11AC40SISO-Ant1-5755-PASS

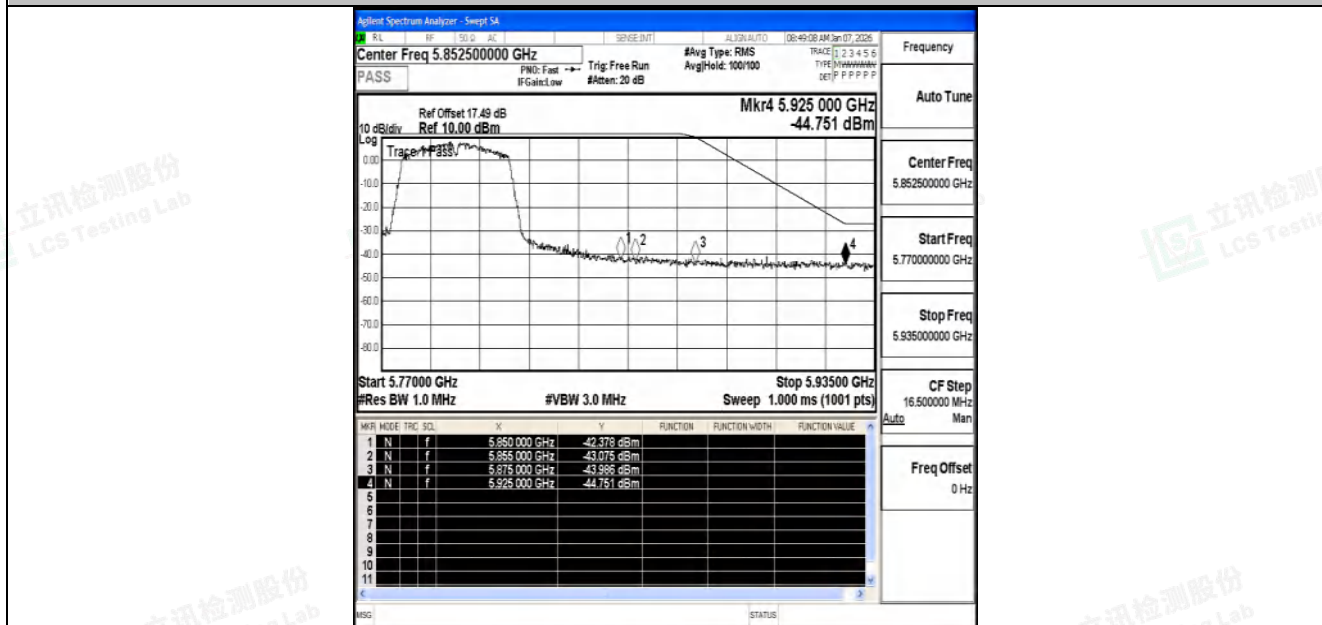

11AC40SISO-Ant1-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

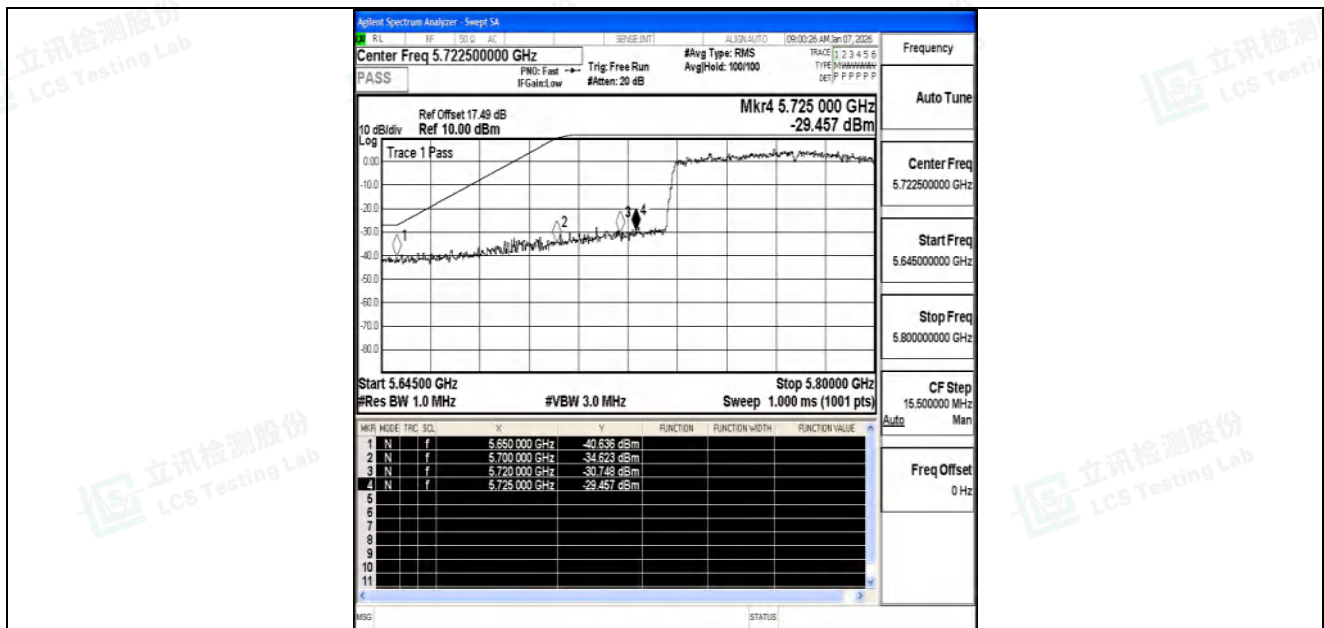

11AC80SISO-Ant1-5775-PASS

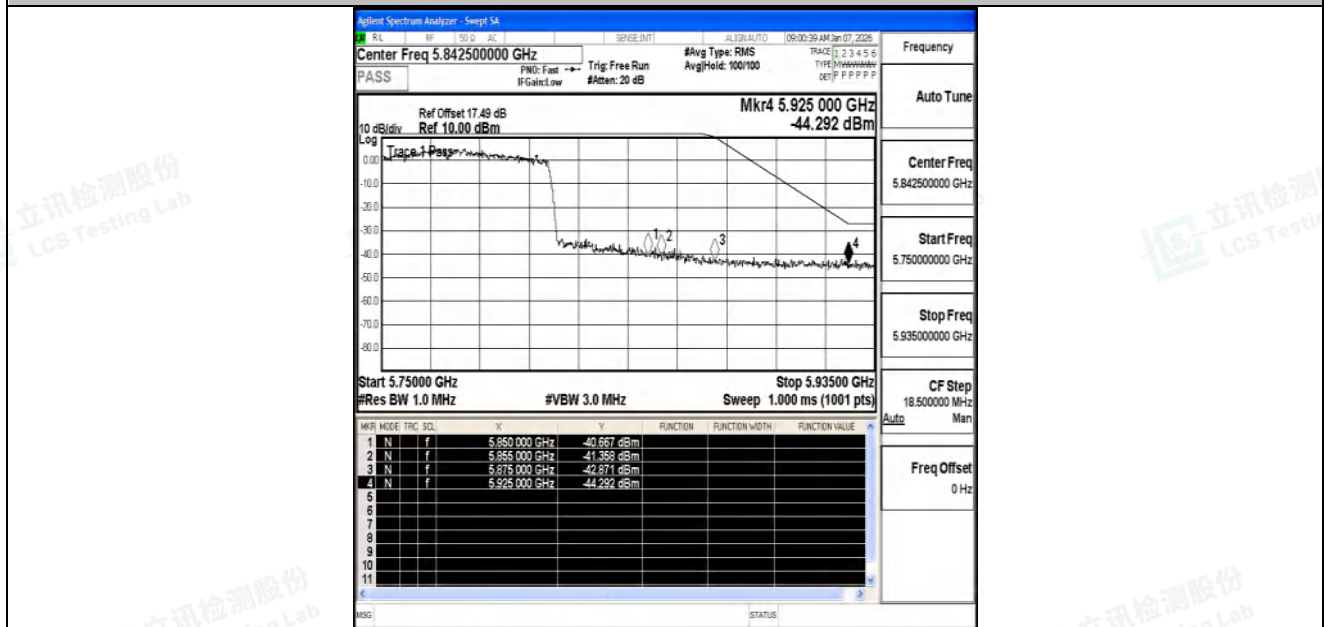

11AC80SISO-Ant1-5775-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**Test Result**

| TestMode   | Antenna | ChName | Frequency[MHz] | Detector | Freq [MHz] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|--------|----------------|----------|------------|--------------|-------------|---------|
| 11A        | Ant2    | Low    | 5745           | Peak     | 5650.000   | -41.585      | ≤-27.00     | PASS    |
| 11A        | Ant2    | Low    | 5745           | Peak     | 5700.000   | -37.55       | ≤10.00      | PASS    |
| 11A        | Ant2    | Low    | 5745           | Peak     | 5720.000   | -34.41       | ≤15.60      | PASS    |
| 11A        | Ant2    | Low    | 5745           | Peak     | 5725.000   | -28.27       | ≤27.00      | PASS    |
| 11A        | Ant2    | High   | 5825           | Peak     | 5850.000   | -36.548      | ≤27.00      | PASS    |
| 11A        | Ant2    | High   | 5825           | Peak     | 5855.000   | -37.18       | ≤15.60      | PASS    |
| 11A        | Ant2    | High   | 5825           | Peak     | 5875.000   | -41.5        | ≤10.00      | PASS    |
| 11A        | Ant2    | High   | 5825           | Peak     | 5925.000   | -42.51       | ≤-27.00     | PASS    |
| 11N20SISO  | Ant2    | Low    | 5745           | Peak     | 5650.000   | -42.802      | ≤-27.00     | PASS    |
| 11N20SISO  | Ant2    | Low    | 5745           | Peak     | 5700.000   | -38.26       | ≤10.00      | PASS    |
| 11N20SISO  | Ant2    | Low    | 5745           | Peak     | 5720.000   | -33.54       | ≤15.60      | PASS    |
| 11N20SISO  | Ant2    | Low    | 5745           | Peak     | 5725.000   | -23.11       | ≤27.00      | PASS    |
| 11N20SISO  | Ant2    | High   | 5825           | Peak     | 5850.000   | -34.787      | ≤27.00      | PASS    |
| 11N20SISO  | Ant2    | High   | 5825           | Peak     | 5855.000   | -36.53       | ≤15.60      | PASS    |
| 11N20SISO  | Ant2    | High   | 5825           | Peak     | 5875.000   | -38.55       | ≤10.00      | PASS    |
| 11N20SISO  | Ant2    | High   | 5825           | Peak     | 5925.000   | -43.82       | ≤-27.00     | PASS    |
| 11N40SISO  | Ant2    | Low    | 5755           | Peak     | 5650.000   | -42.097      | ≤-27.00     | PASS    |
| 11N40SISO  | Ant2    | Low    | 5755           | Peak     | 5700.000   | -39.04       | ≤10.00      | PASS    |
| 11N40SISO  | Ant2    | Low    | 5755           | Peak     | 5720.000   | -33.46       | ≤15.60      | PASS    |
| 11N40SISO  | Ant2    | Low    | 5755           | Peak     | 5725.000   | -31.85       | ≤27.00      | PASS    |
| 11N40SISO  | Ant2    | High   | 5795           | Peak     | 5850.000   | -41.919      | ≤27.00      | PASS    |
| 11N40SISO  | Ant2    | High   | 5795           | Peak     | 5855.000   | -43.4        | ≤15.60      | PASS    |
| 11N40SISO  | Ant2    | High   | 5795           | Peak     | 5875.000   | -43.1        | ≤10.00      | PASS    |
| 11N40SISO  | Ant2    | High   | 5795           | Peak     | 5925.000   | -45.06       | ≤-27.00     | PASS    |
| 11AC20SISO | Ant2    | Low    | 5745           | Peak     | 5650.000   | -42.595      | ≤-27.00     | PASS    |
| 11AC20SISO | Ant2    | Low    | 5745           | Peak     | 5700.000   | -40          | ≤10.00      | PASS    |
| 11AC20SISO | Ant2    | Low    | 5745           | Peak     | 5720.000   | -40.61       | ≤15.60      | PASS    |
| 11AC20SISO | Ant2    | Low    | 5745           | Peak     | 5725.000   | -27.85       | ≤27.00      | PASS    |
| 11AC20SISO | Ant2    | High   | 5825           | Peak     | 5850.000   | -44.395      | ≤27.00      | PASS    |
| 11AC20SISO | Ant2    | High   | 5825           | Peak     | 5855.000   | -43.47       | ≤15.60      | PASS    |
| 11AC20SISO | Ant2    | High   | 5825           | Peak     | 5875.000   | -43.2        | ≤10.00      | PASS    |
| 11AC20SISO | Ant2    | High   | 5825           | Peak     | 5925.000   | -43.19       | ≤-27.00     | PASS    |
| 11AC40SISO | Ant2    | Low    | 5755           | Peak     | 5650.000   | -41.667      | ≤-27.00     | PASS    |
| 11AC40SISO | Ant2    | Low    | 5755           | Peak     | 5700.000   | -38.82       | ≤10.00      | PASS    |
| 11AC40SISO | Ant2    | Low    | 5755           | Peak     | 5720.000   | -36.19       | ≤15.60      | PASS    |
| 11AC40SISO | Ant2    | Low    | 5755           | Peak     | 5725.000   | -33.78       | ≤27.00      | PASS    |
| 11AC40SISO | Ant2    | High   | 5795           | Peak     | 5850.000   | -42.814      | ≤27.00      | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |      |      |          |         |         |      |
|------------|------|------|------|------|----------|---------|---------|------|
| 11AC40SISO | Ant2 | High | 5795 | Peak | 5855.000 | -42.04  | ≤15.60  | PASS |
| 11AC40SISO | Ant2 | High | 5795 | Peak | 5875.000 | -43.64  | ≤10.00  | PASS |
| 11AC40SISO | Ant2 | High | 5795 | Peak | 5925.000 | -45.14  | ≤-27.00 | PASS |
| 11AC80SISO | Ant2 | Low  | 5775 | Peak | 5650.000 | -41.657 | ≤-27.00 | PASS |
| 11AC80SISO | Ant2 | Low  | 5775 | Peak | 5700.000 | -35.07  | ≤10.00  | PASS |
| 11AC80SISO | Ant2 | Low  | 5775 | Peak | 5720.000 | -32.49  | ≤15.60  | PASS |
| 11AC80SISO | Ant2 | Low  | 5775 | Peak | 5725.000 | -28.95  | ≤27.00  | PASS |
| 11AC80SISO | Ant2 | High | 5775 | Peak | 5850.000 | -38.18  | ≤27.00  | PASS |
| 11AC80SISO | Ant2 | High | 5775 | Peak | 5855.000 | -41.58  | ≤15.60  | PASS |
| 11AC80SISO | Ant2 | High | 5775 | Peak | 5875.000 | -42.49  | ≤10.00  | PASS |
| 11AC80SISO | Ant2 | High | 5775 | Peak | 5925.000 | -44.45  | ≤-27.00 | PASS |

Note:


- The Antenna Gain is compensated in the graph.
- For transmitters operating in 5150-5350 GHz band and 5470-5725 GHz band: The limit in dBm for average detector is conversion from 54dBuV/m, according to 15.209(a). The limit in dBm for peak detector is 20dB above the limit of average detector in dBm.



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## Test Graphs

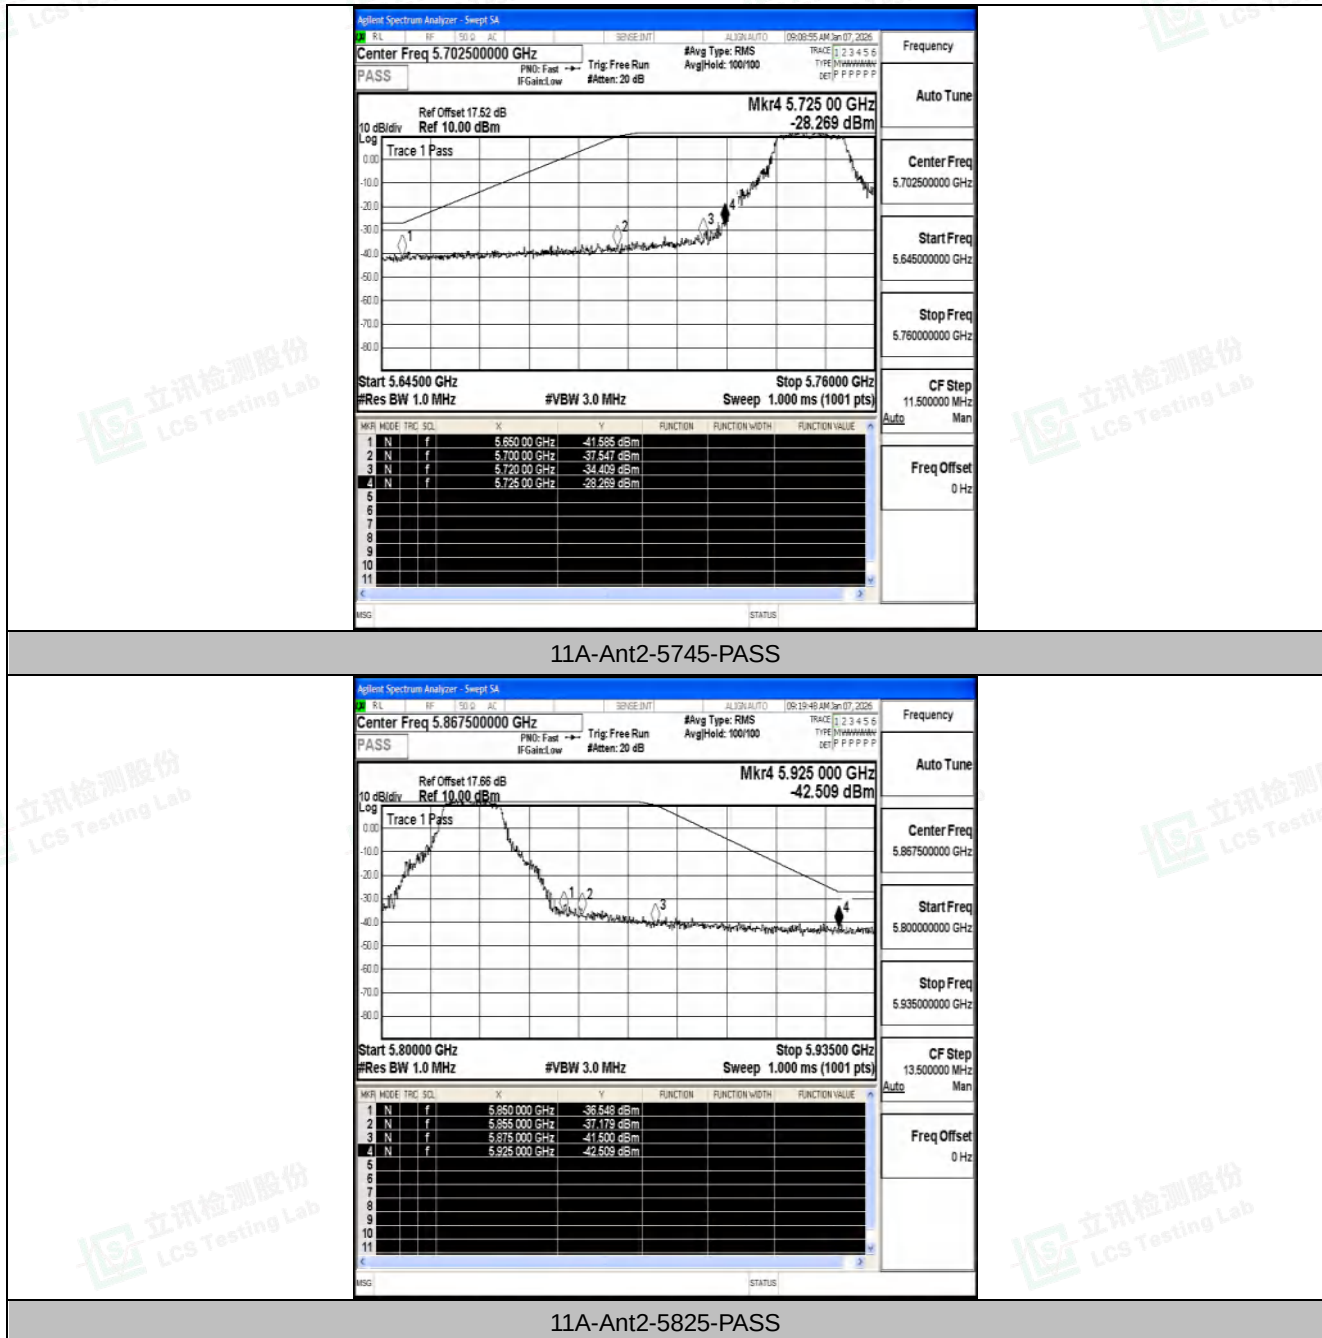


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

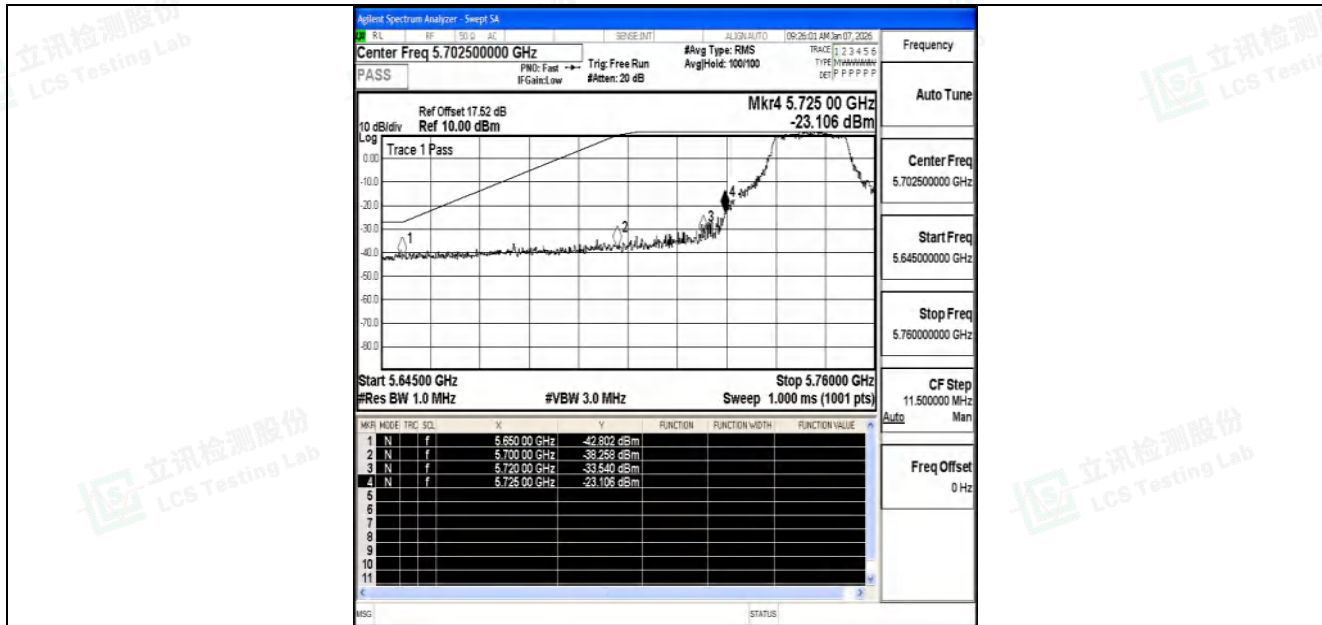

11N20SISO-Ant2-5745-PASS

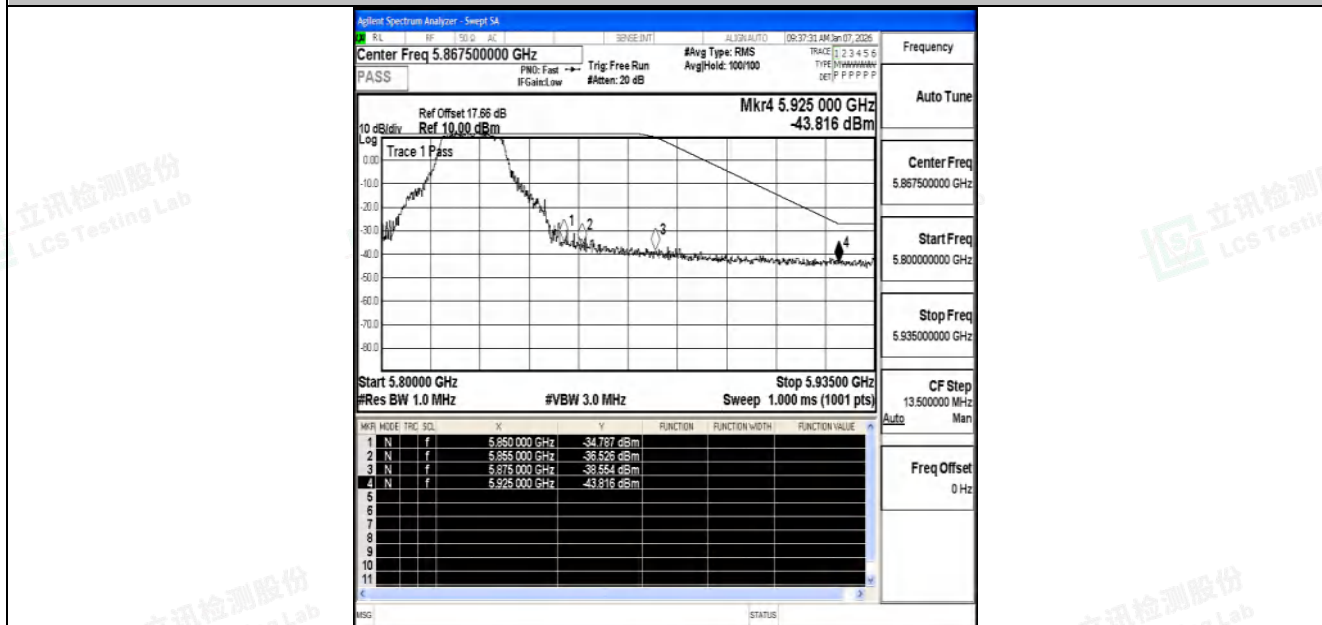

11N20SISO-Ant2-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

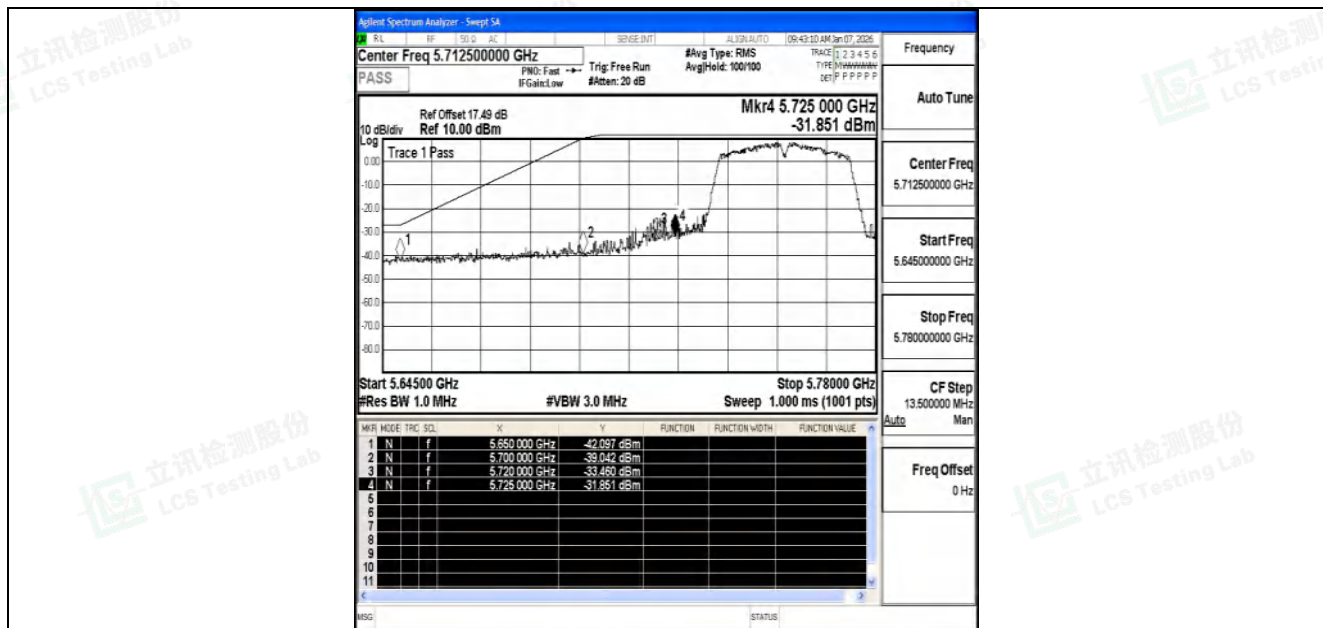

11N40SISO-Ant2-5755-PASS

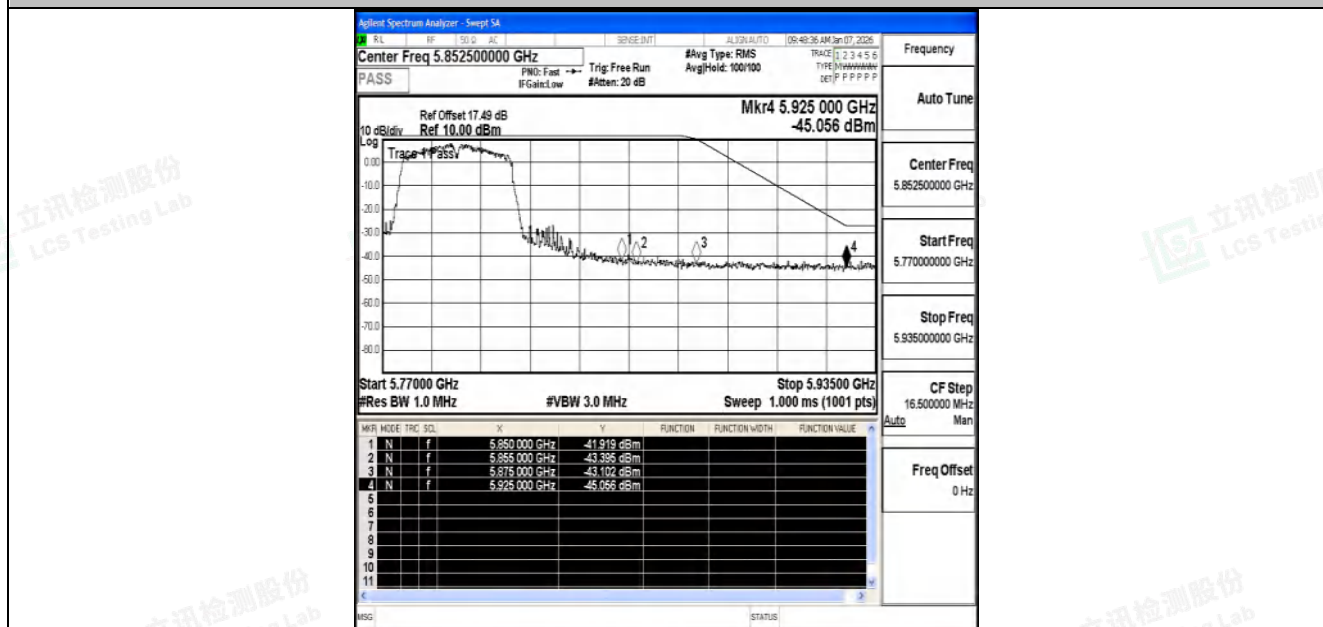

11N40SISO-Ant2-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

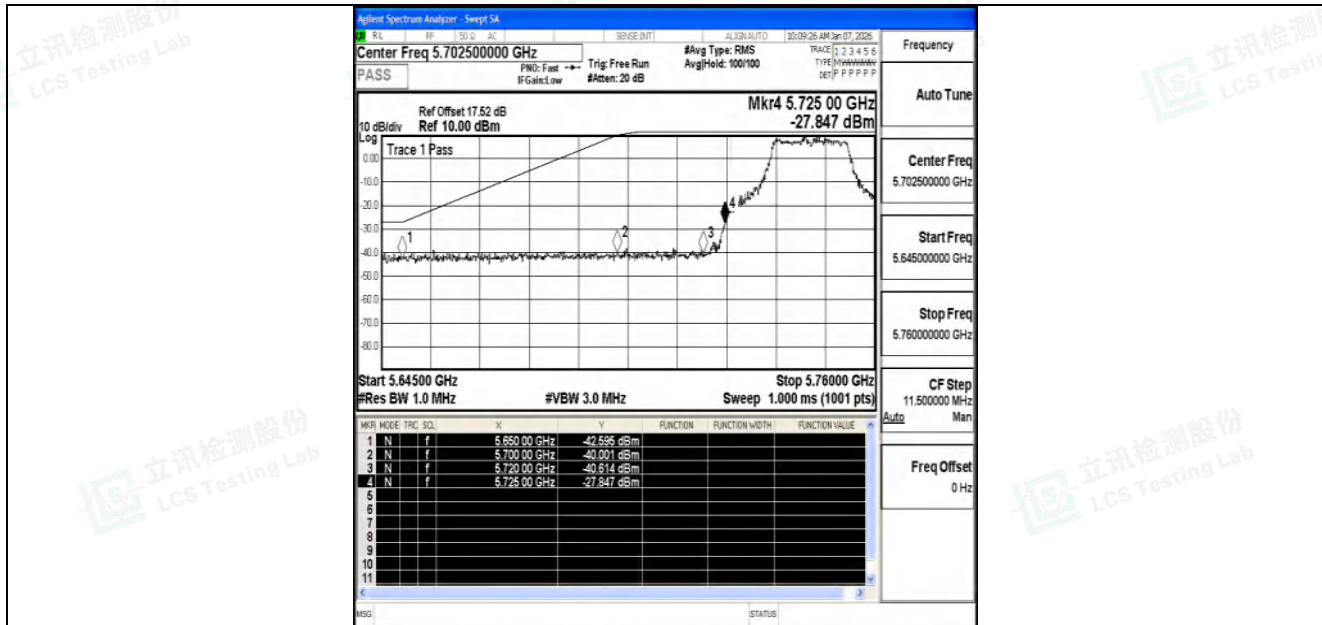

11AC20SISO-Ant2-5745-PASS

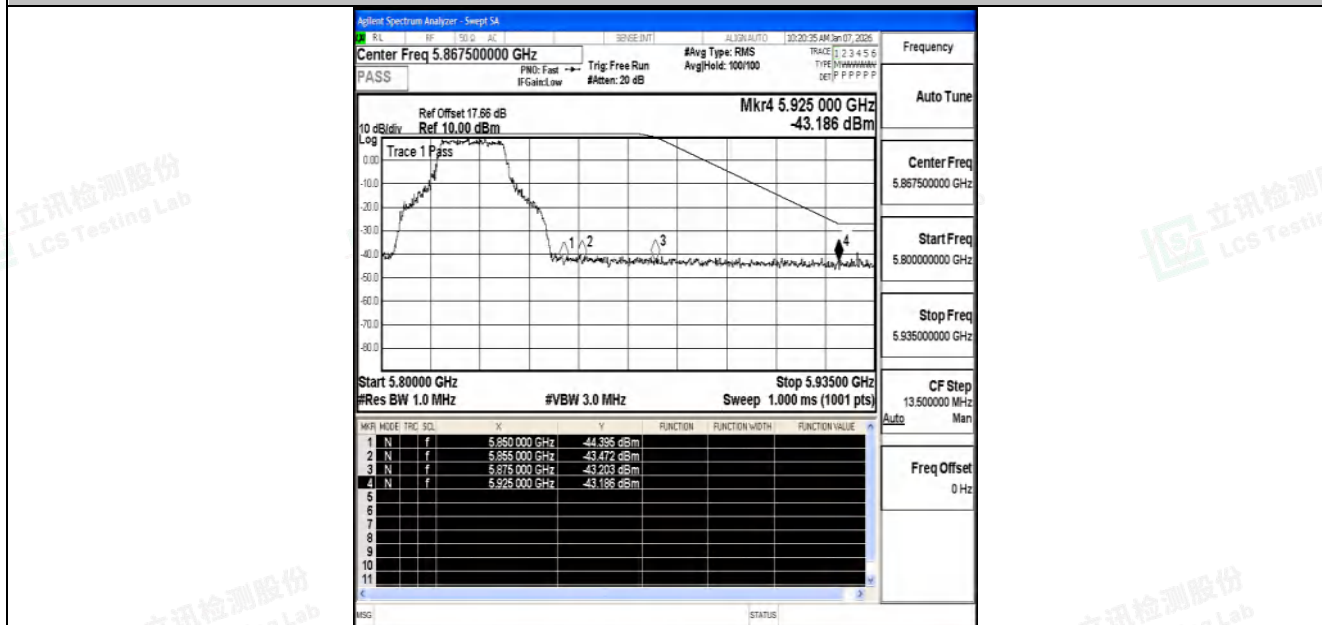

11AC20SISO-Ant2-5825-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

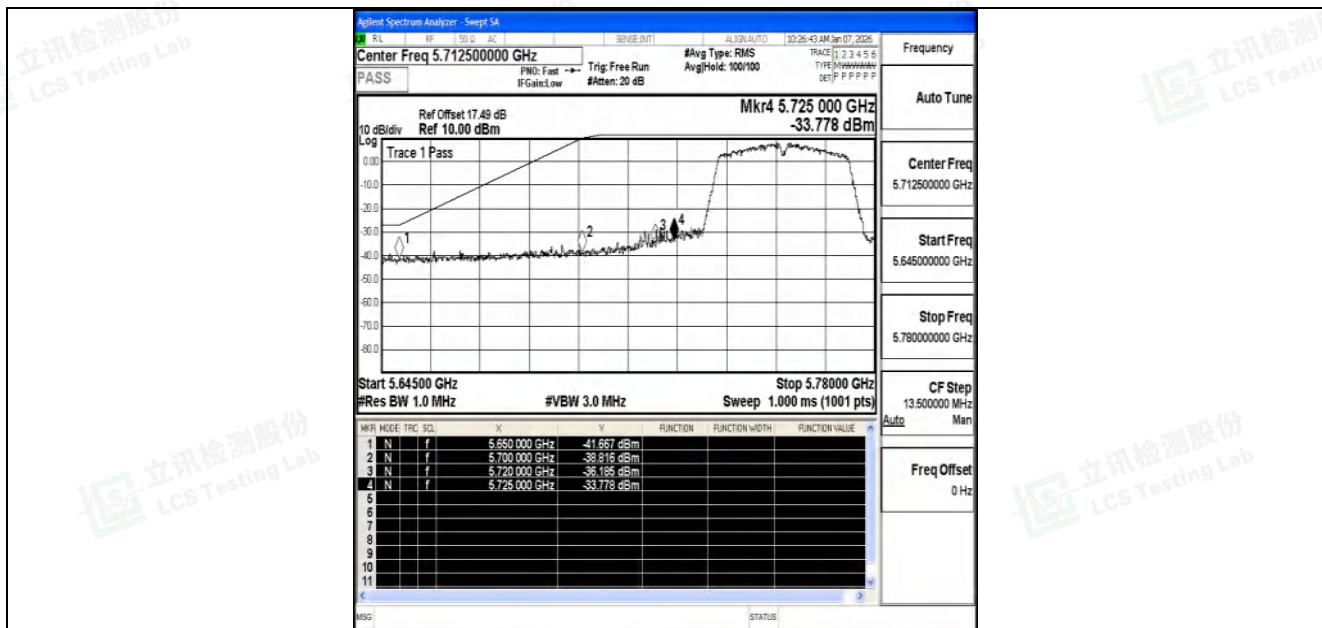

11AC40SISO-Ant2-5755-PASS

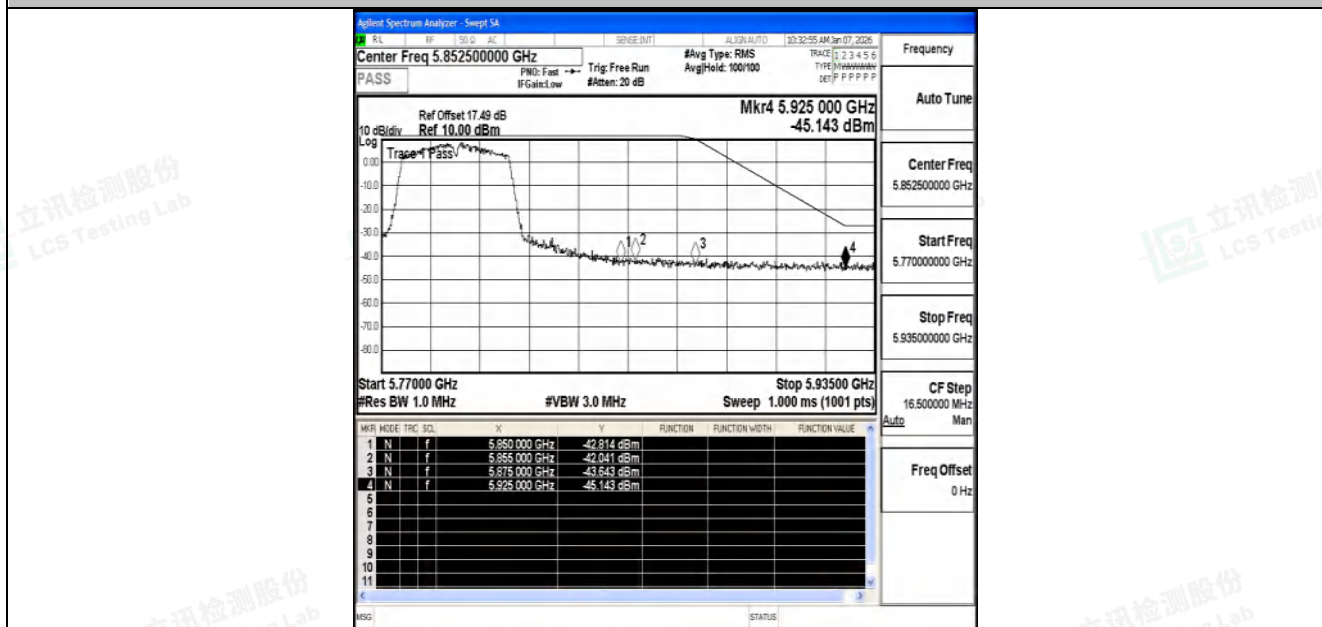

11AC40SISO-Ant2-5795-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

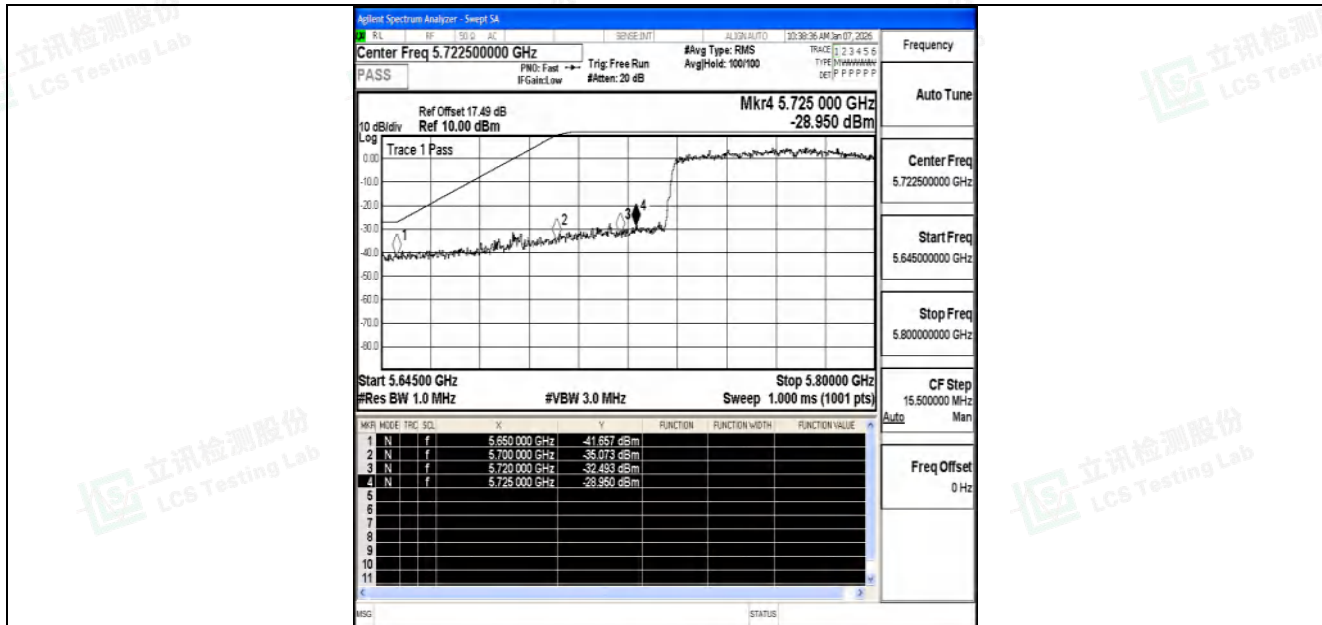

11AC80SISO-Ant2-5775-PASS

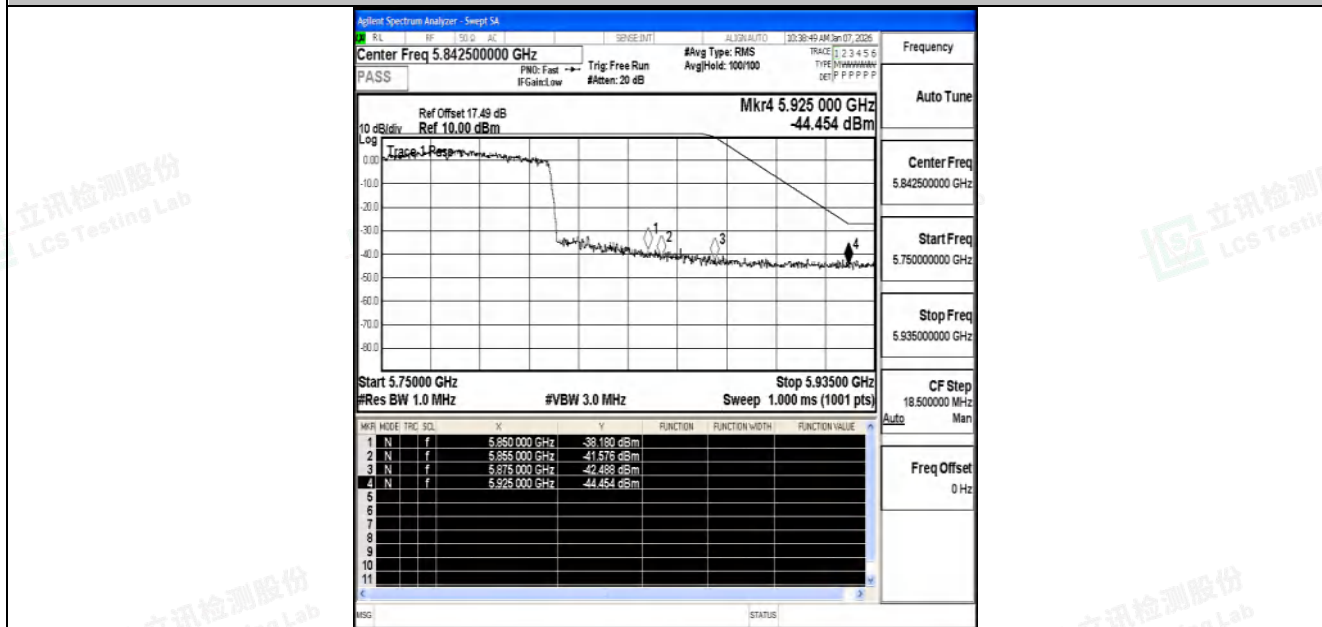

11AC80SISO-Ant2-5775-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency<br>(MHz) | Ant1<br>Power<br>(dBm) | Ant2<br>Power<br>(dBm) | Gain (dBi) | EIRP<br>Power<br>(dBm) | Detector | Limit<br>(dBm) | Verdict |
|-----------|------|--------------------|------------------------|------------------------|------------|------------------------|----------|----------------|---------|
| NVNT      | n20  | 5745               | -46.86                 | -45.71                 | 8.31       | -34.93                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5745               | -54.56                 | -53.08                 | 8.31       | -42.44                 | Average  | -27            | Pass    |
| NVNT      | n20  | 5745               | -41.89                 | -40.57                 | 8.31       | -29.86                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5745               | -50.35                 | -48.66                 | 8.31       | -38.10                 | Average  | 10             | Pass    |
| NVNT      | n20  | 5745               | -25.53                 | -23.41                 | 8.31       | -13.02                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5745               | -37.66                 | -37.23                 | 8.31       | -26.12                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5745               | -19.89                 | -19.39                 | 8.31       | -8.31                  | Peak     | 27             | Pass    |
| NVNT      | n20  | 5745               | -29.58                 | -28.55                 | 8.31       | -17.71                 | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | -28.56                 | -25.22                 | 8.31       | -15.26                 | Peak     | 27             | Pass    |
| NVNT      | n20  | 5825               | -38.79                 | -38.55                 | 8.31       | -27.35                 | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | -32.35                 | -29.34                 | 8.31       | -19.27                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5825               | -44.77                 | -44.32                 | 8.31       | -33.22                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5825               | -41.49                 | -42.59                 | 8.31       | -30.68                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5825               | -52.51                 | -51.04                 | 8.31       | -40.39                 | Average  | 10             | Pass    |
| NVNT      | n20  | 5825               | -46.08                 | -44.44                 | 8.31       | -33.86                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5825               | -53.66                 | -52.17                 | 8.31       | -41.53                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | -45.62                 | -46.79                 | 8.31       | -34.85                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5755               | -53.98                 | -53.08                 | 8.31       | -42.19                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | -41.62                 | -39.01                 | 8.31       | -28.80                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5755               | -47.22                 | -46.13                 | 8.31       | -35.32                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5755               | -22.20                 | -22.35                 | 8.31       | -10.95                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5755               | -32.72                 | -31.55                 | 8.31       | -20.78                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5755               | -18.76                 | -19.56                 | 8.31       | -7.82                  | Peak     | 27             | Pass    |
| NVNT      | n40  | 5755               | -31.15                 | -30.24                 | 8.31       | -19.35                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | -33.4                  | -33.6                  | 8.31       | -22.18                 | Peak     | 27             | Pass    |
| NVNT      | n40  | 5795               | -45.8                  | -45.9                  | 8.31       | -34.53                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | -33.0                  | -36.2                  | 8.31       | -22.99                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5795               | -47.1                  | -47.6                  | 8.31       | -36.02                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5795               | -43.6                  | -42.1                  | 8.31       | -31.47                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5795               | -52.6                  | -52.2                  | 8.31       | -41.08                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5795               | -48.7                  | -47.1                  | 8.31       | -36.51                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5795               | -56.0                  | -54.8                  | 8.31       | -44.04                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | -46.8                  | -46.1                  | 8.31       | -35.12                 | Peak     | -27            | Pass    |
| NVNT      | ac20 | 5745               | -55.7                  | -54.2                  | 8.31       | -43.57                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | -42.2                  | -38.3                  | 8.31       | -28.51                 | Peak     | 10             | Pass    |
| NVNT      | ac20 | 5745               | -52.2                  | -49.4                  | 8.31       | -39.26                 | Average  | 10             | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |       |       |      |        |         |      |      |
|------|------|------|-------|-------|------|--------|---------|------|------|
| NVNT | ac20 | 5745 | -25.9 | -27.9 | 8.31 | -15.47 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | -38.3 | -38.2 | 8.31 | -26.93 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | -17.8 | -18.0 | 8.31 | -6.58  | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | -31.0 | -27.8 | 8.31 | -17.79 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -27.9 | -25.8 | 8.31 | -15.40 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | -39.3 | -36.5 | 8.31 | -26.36 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -30.6 | -33.0 | 8.31 | -20.32 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | -44.7 | -43.3 | 8.31 | -32.62 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | -43.0 | -43.3 | 8.31 | -31.83 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | -52.6 | -51.6 | 8.31 | -40.75 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | -45.9 | -44.6 | 8.31 | -33.88 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | -54.4 | -52.9 | 8.31 | -42.27 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -46.2 | -46.7 | 8.31 | -35.12 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | -54.3 | -53.5 | 8.31 | -42.56 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -37.8 | -40.4 | 8.31 | -27.59 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | -46.5 | -47.7 | 8.31 | -35.74 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | -21.6 | -22.3 | 8.31 | -10.62 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | -31.3 | -34.9 | 8.31 | -21.42 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | -16.1 | -22.8 | 8.31 | -6.95  | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | -29.9 | -33.1 | 8.31 | -19.89 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -31.2 | -35.0 | 8.31 | -21.38 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | -45.4 | -49.8 | 8.31 | -35.74 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -35.6 | -41.2 | 8.31 | -26.23 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | -47.4 | -51.1 | 8.31 | -37.55 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | -45.1 | -46.8 | 8.31 | -34.55 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | -53.7 | -54.0 | 8.31 | -42.53 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | -48.5 | -45.9 | 8.31 | -35.69 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | -56.5 | -55.5 | 8.31 | -44.65 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -41.5 | -45.9 | 8.31 | -31.84 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | -51.3 | -53.5 | 8.31 | -40.94 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -23.9 | -27.3 | 8.31 | -13.96 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | -36.3 | -39.7 | 8.31 | -26.36 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | -26.0 | -25.2 | 8.31 | -14.26 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -32.4 | -35.3 | 8.31 | -22.29 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | -21.7 | -23.1 | 8.31 | -11.02 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -31.9 | -34.7 | 8.31 | -21.76 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | -25.2 | -26.4 | 8.31 | -14.44 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -33.6 | -37.1 | 8.31 | -23.69 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | -25.2 | -29.1 | 8.31 | -15.41 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -35.1 | -39.3 | 8.31 | -25.39 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | -31.6 | -35.5 | 8.31 | -21.81 | Peak    | 10   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |       |       |      |        |         |     |      |
|------|------|------|-------|-------|------|--------|---------|-----|------|
| NVNT | ac80 | 5775 | -41.5 | -44.2 | 8.31 | -31.32 | Average | 10  | Pass |
| NVNT | ac80 | 5775 | -43.2 | -44.2 | 8.31 | -32.35 | Peak    | -27 | Pass |
| NVNT | ac80 | 5775 | -52.3 | -54.1 | 8.31 | -41.79 | Average | -27 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## G.5 Frequency Stability

### Test Result

| TestMode   | Antenna | Frequency [MHz] | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|------------|---------|-----------------|---------------|------------------|----------------|-----------------|-------------|---------|
| 11A        | Ant1    | 5745            | NV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A        | Ant1    | 5745            | LV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A        | Ant1    | 5745            | HV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A        | Ant1    | 5785            | NV            | NT               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A        | Ant1    | 5785            | LV            | NT               | -80000.00      | -13.828868      | 20          | PASS    |
| 11A        | Ant1    | 5785            | HV            | NT               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A        | Ant1    | 5825            | NV            | NT               | -60000.00      | -10.300429      | 20          | PASS    |
| 11A        | Ant1    | 5825            | LV            | NT               | -80000.00      | -13.733906      | 20          | PASS    |
| 11A        | Ant1    | 5825            | HV            | NT               | -80000.00      | -13.733906      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5745            | NV            | NT               | -80000.00      | -13.925152      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5745            | LV            | NT               | -80000.00      | -13.925152      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5745            | HV            | NT               | -80000.00      | -13.925152      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5785            | NV            | NT               | -80000.00      | -13.828868      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5785            | LV            | NT               | -80000.00      | -13.828868      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5785            | HV            | NT               | -80000.00      | -13.828868      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5825            | NV            | NT               | -80000.00      | -13.733906      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5825            | LV            | NT               | -80000.00      | -13.733906      | 20          | PASS    |
| 11N20SISO  | Ant1    | 5825            | HV            | NT               | -80000.00      | -13.733906      | 20          | PASS    |
| 11N40SISO  | Ant1    | 5755            | NV            | NT               | -40000.00      | -6.950478       | 20          | PASS    |
| 11N40SISO  | Ant1    | 5755            | LV            | NT               | -80000.00      | -13.900956      | 20          | PASS    |
| 11N40SISO  | Ant1    | 5755            | HV            | NT               | -80000.00      | -13.900956      | 20          | PASS    |
| 11N40SISO  | Ant1    | 5795            | NV            | NT               | -80000.00      | -13.805004      | 20          | PASS    |
| 11N40SISO  | Ant1    | 5795            | LV            | NT               | -40000.00      | -6.902502       | 20          | PASS    |
| 11N40SISO  | Ant1    | 5795            | HV            | NT               | -80000.00      | -13.805004      | 20          | PASS    |
| 11AC20SISO | Ant1    | 5745            | NV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11AC20SISO | Ant1    | 5745            | LV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11AC20SISO | Ant1    | 5745            | HV            | NT               | -60000.00      | -10.443864      | 20          | PASS    |
| 11AC20SISO | Ant1    | 5785            | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
| 11AC20SISO | Ant1    | 5785            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
| 11AC20SISO | Ant1    | 5785            | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
| 11AC20SISO | Ant1    | 5825            | NV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
| 11AC20SISO | Ant1    | 5825            | LV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
| 11AC20SISO | Ant1    | 5825            | HV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
| 11AC40SISO | Ant1    | 5755            | NV            | NT               | -40000.00      | -6.950478       | 20          | PASS    |
| 11AC40SISO | Ant1    | 5755            | LV            | NT               | -80000.00      | -13.900956      | 20          | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |    |    |           |            |    |      |
|------------|------|------|----|----|-----------|------------|----|------|
| 11AC40SISO | Ant1 | 5755 | HV | NT | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant1 | 5795 | NV | NT | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SISO | Ant1 | 5795 | LV | NT | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SISO | Ant1 | 5795 | HV | NT | -80000.00 | -13.805004 | 20 | PASS |
| 11AC80SISO | Ant1 | 5775 | NV | NT | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant1 | 5775 | LV | NT | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant1 | 5775 | HV | NT | -80000.00 | -13.852814 | 20 | PASS |

| TestMode  | Antenna | Frequenc<br>y[MHz] | Voltage<br>[Vdc] | Temperat<br>ure<br>(°C) | Deviation<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|-----------|---------|--------------------|------------------|-------------------------|-------------------|--------------------|----------------|---------|
| 11A       | Ant1    | 5745               | NV               | -30                     | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | -20                     | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | -10                     | -80000.00         | -13.925152         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 0                       | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 10                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 20                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 30                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 40                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5745               | NV               | 50                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | -30                     | -80000.00         | -13.828868         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | -20                     | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | -10                     | -80000.00         | -13.828868         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 0                       | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 10                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 20                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 30                      | -80000.00         | -13.828868         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 40                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5785               | NV               | 50                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | -30                     | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | -20                     | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | -10                     | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 0                       | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 10                      | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 20                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 30                      | -60000.00         | -10.300429         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 40                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11A       | Ant1    | 5825               | NV               | 50                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11N20SISO | Ant1    | 5745               | NV               | -30                     | -80000.00         | -13.925152         | 20             | PASS    |
| 11N20SISO | Ant1    | 5745               | NV               | -20                     | -80000.00         | -13.925152         | 20             | PASS    |
| 11N20SISO | Ant1    | 5745               | NV               | -10                     | -80000.00         | -13.925152         | 20             | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|           |      |      |    |     |           |            |    |      |
|-----------|------|------|----|-----|-----------|------------|----|------|
| 11N20SISO | Ant1 | 5745 | NV | 0   | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant1 | 5745 | NV | 10  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant1 | 5745 | NV | 20  | -60000.00 | -10.443864 | 20 | PASS |
| 11N20SISO | Ant1 | 5745 | NV | 30  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant1 | 5745 | NV | 40  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant1 | 5745 | NV | 50  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | -30 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | -20 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | -10 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 0   | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 10  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 20  | -60000.00 | -10.371651 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 30  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 40  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5785 | NV | 50  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | -30 | -60000.00 | -10.300429 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | -20 | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | -10 | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 0   | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 10  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 20  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 30  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 40  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant1 | 5825 | NV | 50  | -60000.00 | -10.300429 | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | -30 | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | -20 | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | -10 | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 0   | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 20  | -80000.00 | -13.900956 | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 30  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 40  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5755 | NV | 50  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | -30 | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | -20 | -80000.00 | -13.805004 | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | -10 | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | 0   | -80000.00 | -13.805004 | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | 10  | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | 20  | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant1 | 5795 | NV | 30  | -40000.00 | -6.902502  | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |    |     |           |            |    |      |
|------------|------|------|----|-----|-----------|------------|----|------|
| 11N40SISO  | Ant1 | 5795 | NV | 40  | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO  | Ant1 | 5795 | NV | 50  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | -30 | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | -20 | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | -10 | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 0   | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 10  | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 20  | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 30  | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 40  | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant1 | 5745 | NV | 50  | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | -30 | -20000.00 | -3.457217  | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 0   | -20000.00 | -3.457217  | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 10  | -20000.00 | -3.457217  | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SISO | Ant1 | 5785 | NV | 50  | -40000.00 | -6.914434  | 20 | PASS |
| 11AC20SISO | Ant1 | 5825 | NV | -30 | -20000.00 | -3.433476  | 20 | PASS |
| 11AC20SISO | Ant1 | 5825 | NV | -20 | -20000.00 | -3.433476  | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|                |      |      |    |     |           |            |    |      |
|----------------|------|------|----|-----|-----------|------------|----|------|
| O              |      |      |    |     |           |            |    |      |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 0   | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 10  | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 20  | -20000.00 | -3.433476  | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 30  | -20000.00 | -3.433476  | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 40  | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SIS<br>O | Ant1 | 5825 | NV | 50  | -20000.00 | -3.433476  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | -30 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | -20 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | -10 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 0   | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 20  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 30  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 40  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5755 | NV | 50  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | -30 | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | -20 | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | -10 | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 0   | -40000.00 | -6.902502  | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|                |      |      |    |     |           |            |    |      |
|----------------|------|------|----|-----|-----------|------------|----|------|
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 10  | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 20  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 30  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 40  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5795 | NV | 50  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | -30 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | -20 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | -10 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 0   | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 30  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 40  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5775 | NV | 50  | -80000.00 | -13.852814 | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## Test Result

| TestMode   | Antenna | Frequenc<br>y[MHz] | Voltage<br>[Vdc] | Temperat<br>ure<br>(°C) | Deviation<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|------------|---------|--------------------|------------------|-------------------------|-------------------|--------------------|----------------|---------|
| 11A        | Ant2    | 5745               | NV               | NT                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A        | Ant2    | 5745               | LV               | NT                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A        | Ant2    | 5745               | HV               | NT                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11A        | Ant2    | 5785               | NV               | NT                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A        | Ant2    | 5785               | LV               | NT                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A        | Ant2    | 5785               | HV               | NT                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11A        | Ant2    | 5825               | NV               | NT                      | -60000.00         | -10.300429         | 20             | PASS    |
| 11A        | Ant2    | 5825               | LV               | NT                      | -60000.00         | -10.300429         | 20             | PASS    |
| 11A        | Ant2    | 5825               | HV               | NT                      | -60000.00         | -10.300429         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5745               | NV               | NT                      | -80000.00         | -13.925152         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5745               | LV               | NT                      | -80000.00         | -13.925152         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5745               | HV               | NT                      | -80000.00         | -13.925152         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5785               | NV               | NT                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5785               | LV               | NT                      | -80000.00         | -13.828868         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5785               | HV               | NT                      | -80000.00         | -13.828868         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5825               | NV               | NT                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5825               | LV               | NT                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11N20SISO  | Ant2    | 5825               | HV               | NT                      | -80000.00         | -13.733906         | 20             | PASS    |
| 11N40SISO  | Ant2    | 5755               | NV               | NT                      | -40000.00         | -6.950478          | 20             | PASS    |
| 11N40SISO  | Ant2    | 5755               | LV               | NT                      | -80000.00         | -13.900956         | 20             | PASS    |
| 11N40SISO  | Ant2    | 5755               | HV               | NT                      | -40000.00         | -6.950478          | 20             | PASS    |
| 11N40SISO  | Ant2    | 5795               | NV               | NT                      | -40000.00         | -6.902502          | 20             | PASS    |
| 11N40SISO  | Ant2    | 5795               | LV               | NT                      | -40000.00         | -6.902502          | 20             | PASS    |
| 11N40SISO  | Ant2    | 5795               | HV               | NT                      | -80000.00         | -13.805004         | 20             | PASS    |
| 11AC20SISO | Ant2    | 5745               | NV               | NT                      | -60000.00         | -10.443864         | 20             | PASS    |
| 11AC20SISO | Ant2    | 5745               | LV               | NT                      | -40000.00         | -6.962576          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5745               | HV               | NT                      | -40000.00         | -6.962576          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5785               | NV               | NT                      | -60000.00         | -10.371651         | 20             | PASS    |
| 11AC20SISO | Ant2    | 5785               | LV               | NT                      | -40000.00         | -6.914434          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5785               | HV               | NT                      | -40000.00         | -6.914434          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5825               | NV               | NT                      | -40000.00         | -6.866953          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5825               | LV               | NT                      | -40000.00         | -6.866953          | 20             | PASS    |
| 11AC20SISO | Ant2    | 5825               | HV               | NT                      | -40000.00         | -6.866953          | 20             | PASS    |
| 11AC40SISO | Ant2    | 5755               | NV               | NT                      | -80000.00         | -13.900956         | 20             | PASS    |
| 11AC40SISO | Ant2    | 5755               | LV               | NT                      | -80000.00         | -13.900956         | 20             | PASS    |
| 11AC40SISO | Ant2    | 5755               | HV               | NT                      | -80000.00         | -13.900956         | 20             | PASS    |
| 11AC40SISO | Ant2    | 5795               | NV               | NT                      | -40000.00         | -6.902502          | 20             | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |    |    |           |            |    |      |
|------------|------|------|----|----|-----------|------------|----|------|
| 11AC40SISO | Ant2 | 5795 | LV | NT | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | HV | NT | -80000.00 | -13.805004 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | NT | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | LV | NT | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | HV | NT | -80000.00 | -13.852814 | 20 | PASS |

| TestMode  | Antenna | Frequency [MHz] | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|---------|-----------------|---------------|------------------|----------------|-----------------|-------------|---------|
| 11A       | Ant2    | 5745            | NV            | -30              | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | -20              | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | -10              | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 0                | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 10               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 20               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 30               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 40               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5745            | NV            | 50               | -60000.00      | -10.443864      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | -30              | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | -20              | -40000.00      | -6.914434       | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | -10              | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 0                | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 10               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 20               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 30               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 40               | -60000.00      | -10.371651      | 20          | PASS    |
| 11A       | Ant2    | 5785            | NV            | 50               | -40000.00      | -6.914434       | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | -30              | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | -20              | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | -10              | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 0                | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 10               | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 20               | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 30               | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 40               | -60000.00      | -10.300429      | 20          | PASS    |
| 11A       | Ant2    | 5825            | NV            | 50               | -60000.00      | -10.300429      | 20          | PASS    |
| 11N20SISO | Ant2    | 5745            | NV            | -30              | -40000.00      | -6.962576       | 20          | PASS    |
| 11N20SISO | Ant2    | 5745            | NV            | -20              | -60000.00      | -10.443864      | 20          | PASS    |
| 11N20SISO | Ant2    | 5745            | NV            | -10              | -60000.00      | -10.443864      | 20          | PASS    |
| 11N20SISO | Ant2    | 5745            | NV            | 0                | -60000.00      | -10.443864      | 20          | PASS    |
| 11N20SISO | Ant2    | 5745            | NV            | 10               | -60000.00      | -10.443864      | 20          | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|           |      |      |    |     |           |            |    |      |
|-----------|------|------|----|-----|-----------|------------|----|------|
| 11N20SISO | Ant2 | 5745 | NV | 20  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant2 | 5745 | NV | 30  | -80000.00 | -13.925152 | 20 | PASS |
| 11N20SISO | Ant2 | 5745 | NV | 40  | -60000.00 | -10.443864 | 20 | PASS |
| 11N20SISO | Ant2 | 5745 | NV | 50  | -60000.00 | -10.443864 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | -30 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | -20 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | -10 | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 0   | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 10  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 20  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 30  | -60000.00 | -10.371651 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 40  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5785 | NV | 50  | -80000.00 | -13.828868 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | -30 | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | -20 | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | -10 | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 0   | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 10  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 20  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 30  | -80000.00 | -13.733906 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 40  | -60000.00 | -10.300429 | 20 | PASS |
| 11N20SISO | Ant2 | 5825 | NV | 50  | -80000.00 | -13.733906 | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | -30 | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | -20 | -80000.00 | -13.900956 | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | -10 | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 0   | -80000.00 | -13.900956 | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 10  | -80000.00 | -13.900956 | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 20  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 30  | -80000.00 | -13.900956 | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 40  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant2 | 5755 | NV | 50  | -40000.00 | -6.950478  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | -30 | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | -20 | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | -10 | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 0   | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 10  | -80000.00 | -13.805004 | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 20  | -40000.00 | -6.902502  | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 30  | -80000.00 | -13.805004 | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 40  | -80000.00 | -13.805004 | 20 | PASS |
| 11N40SISO | Ant2 | 5795 | NV | 50  | -80000.00 | -13.805004 | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |    |     |           |            |    |      |
|------------|------|------|----|-----|-----------|------------|----|------|
| 11AC20SISO | Ant2 | 5745 | NV | -30 | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | -20 | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | -10 | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 0   | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 10  | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 20  | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 30  | -60000.00 | -10.443864 | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 40  | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant2 | 5745 | NV | 50  | -40000.00 | -6.962576  | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | -30 | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | -20 | -40000.00 | -6.914434  | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | -10 | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 0   | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 10  | -40000.00 | -6.914434  | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 20  | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 30  | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 40  | -60000.00 | -10.371651 | 20 | PASS |
| 11AC20SISO | Ant2 | 5785 | NV | 50  | -40000.00 | -6.914434  | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | -30 | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | -20 | -60000.00 | -10.300429 | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | -10 | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 0   | -60000.00 | -10.300429 | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 10  | -40000.00 | -6.866953  | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 20  | -60000.00 | -10.300429 | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 30  | -20000.00 | -3.433476  | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 40  | -60000.00 | -10.300429 | 20 | PASS |
| 11AC20SISO | Ant2 | 5825 | NV | 50  | -40000.00 | -6.866953  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | -30 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | -20 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | -10 | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 0   | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 10  | -80000.00 | -13.900956 | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 20  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 30  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 40  | -80000.00 | -13.900956 | 20 | PASS |
| 11AC40SISO | Ant2 | 5755 | NV | 50  | -40000.00 | -6.950478  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | -30 | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | -20 | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | -10 | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | 0   | -40000.00 | -6.902502  | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|            |      |      |    |     |           |            |    |      |
|------------|------|------|----|-----|-----------|------------|----|------|
| 11AC40SISO | Ant2 | 5795 | NV | 10  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | 20  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | 30  | -40000.00 | -6.902502  | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | 40  | -80000.00 | -13.805004 | 20 | PASS |
| 11AC40SISO | Ant2 | 5795 | NV | 50  | -80000.00 | -13.805004 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | -30 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | -20 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | -10 | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 0   | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 10  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 20  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 30  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 40  | -80000.00 | -13.852814 | 20 | PASS |
| 11AC80SISO | Ant2 | 5775 | NV | 50  | -80000.00 | -13.852814 | 20 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.6 Duty Cycle

### Test Result

| TestMode   | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Dc Factor [%] | 1/T  |
|------------|---------|----------------|----------------------------|--------------------------|----------------|---------------|------|
| 11A        | Ant1    | 5745           | 1.39                       | 1.42                     | 97.89          | 0.09          | 0.72 |
| 11A        | Ant1    | 5785           | 1.38                       | 1.42                     | 97.18          | 0.12          | 0.72 |
| 11A        | Ant1    | 5825           | 1.40                       | 1.43                     | 97.90          | 0.09          | 0.71 |
| 11N20SISO  | Ant1    | 5745           | 1.30                       | 1.34                     | 97.01          | 0.13          | 0.77 |
| 11N20SISO  | Ant1    | 5785           | 1.29                       | 1.33                     | 96.99          | 0.13          | 0.78 |
| 11N20SISO  | Ant1    | 5825           | 1.30                       | 1.33                     | 97.74          | 0.10          | 0.77 |
| 11N40SISO  | Ant1    | 5755           | 0.65                       | 0.68                     | 95.59          | 0.20          | 1.54 |
| 11N40SISO  | Ant1    | 5795           | 0.65                       | 0.68                     | 95.59          | 0.20          | 1.54 |
| 11AC20SISO | Ant1    | 5745           | 0.15                       | 0.19                     | 78.95          | 1.03          | 6.67 |
| 11AC20SISO | Ant1    | 5785           | 0.14                       | 1.43                     | 9.79           | 10.09         | 7.14 |
| 11AC20SISO | Ant1    | 5825           | 0.45                       | 1.71                     | 26.32          | 5.80          | 2.22 |
| 11AC40SISO | Ant1    | 5755           | 0.65                       | 0.69                     | 94.20          | 0.26          | 1.54 |
| 11AC40SISO | Ant1    | 5795           | 0.65                       | 0.68                     | 95.59          | 0.20          | 1.54 |
| 11AC80SISO | Ant1    | 5775           | 0.32                       | 0.36                     | 88.89          | 0.51          | 3.13 |



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China



Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## Test Graphs

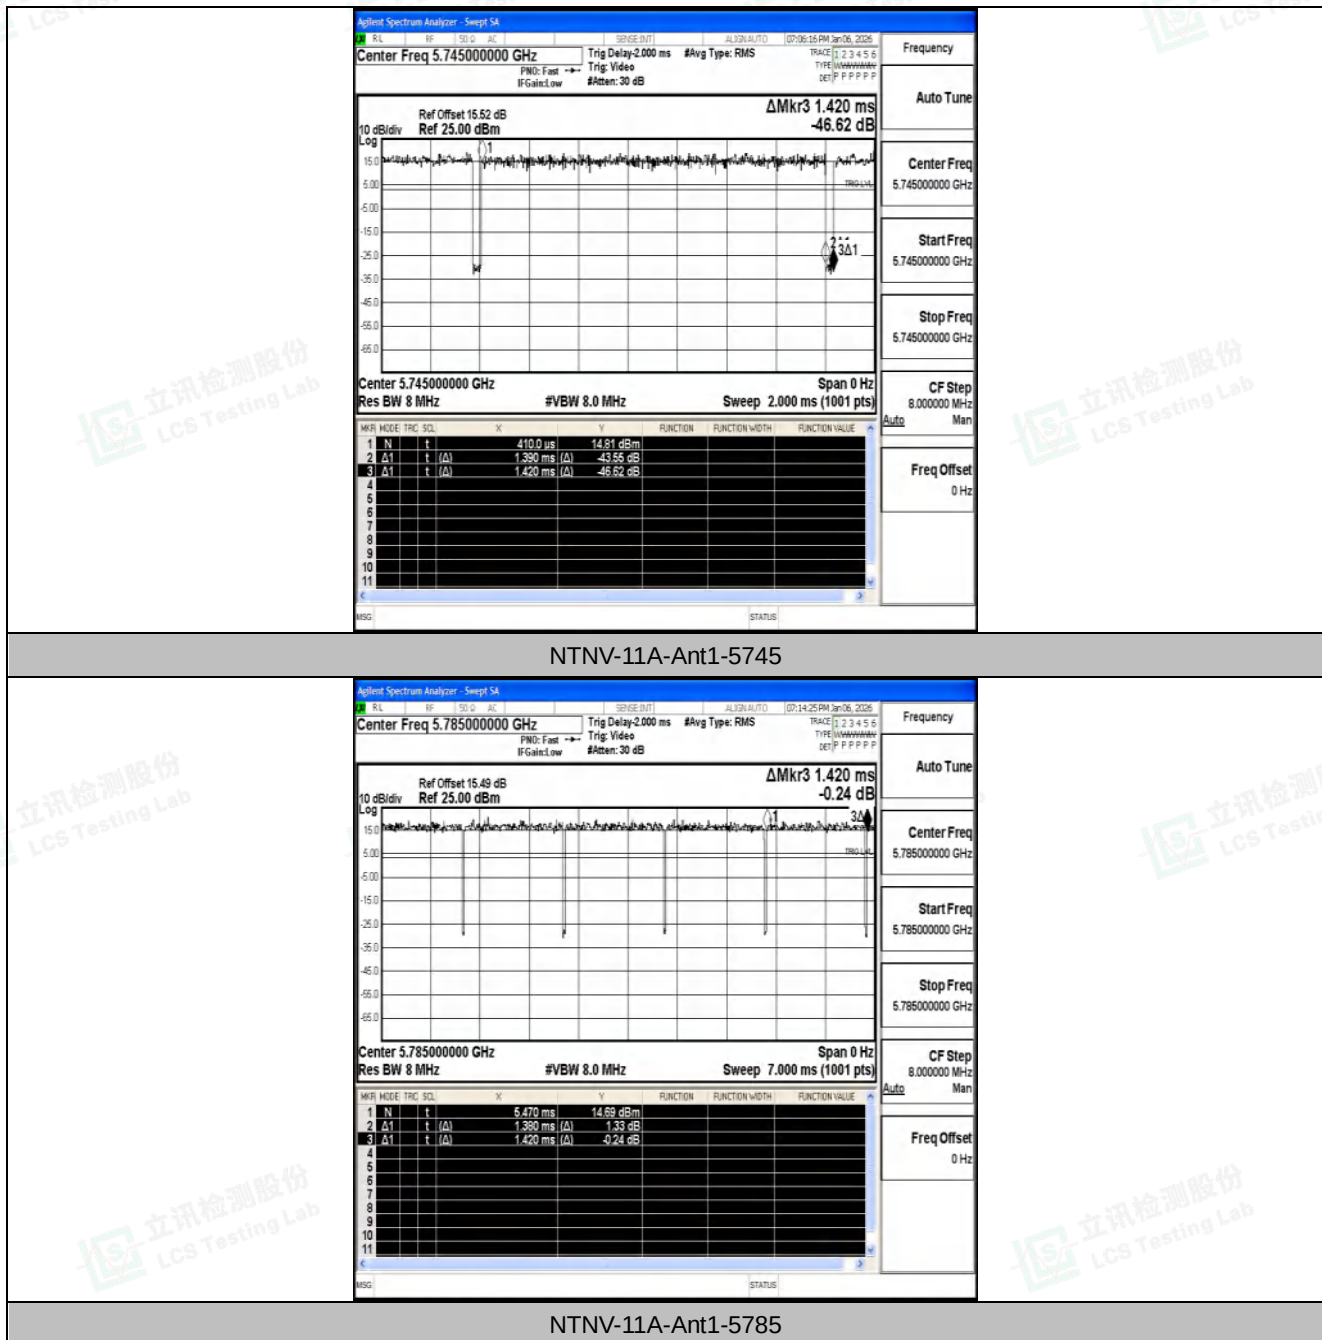

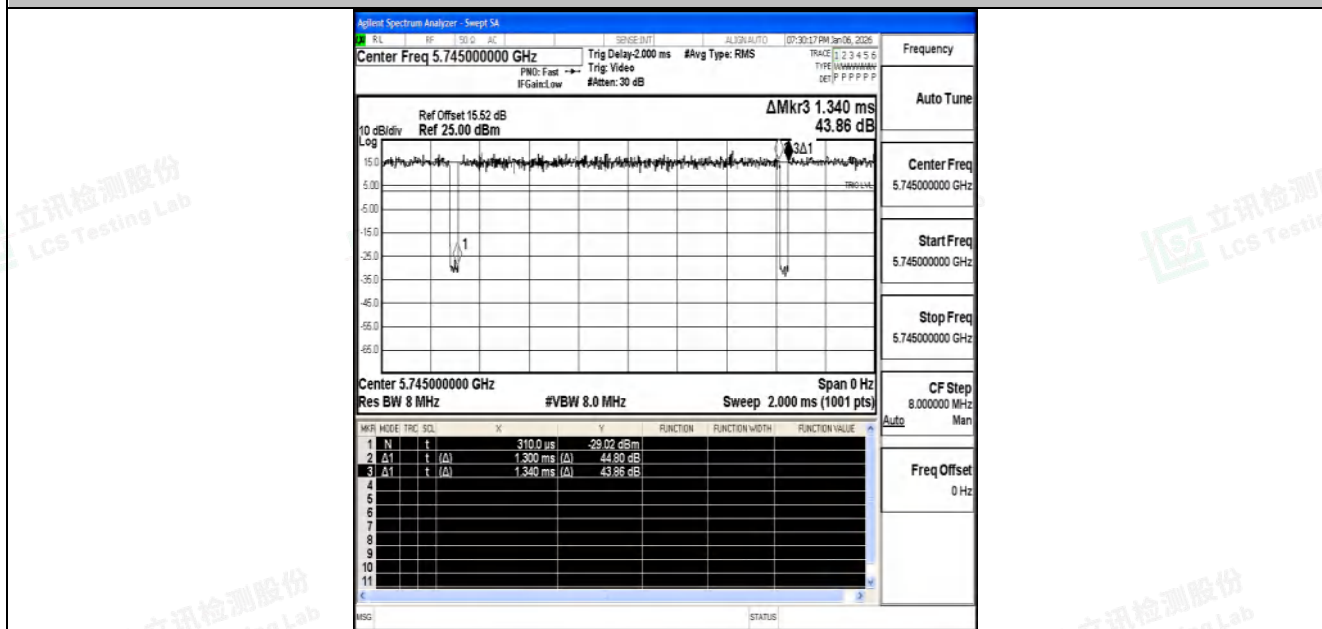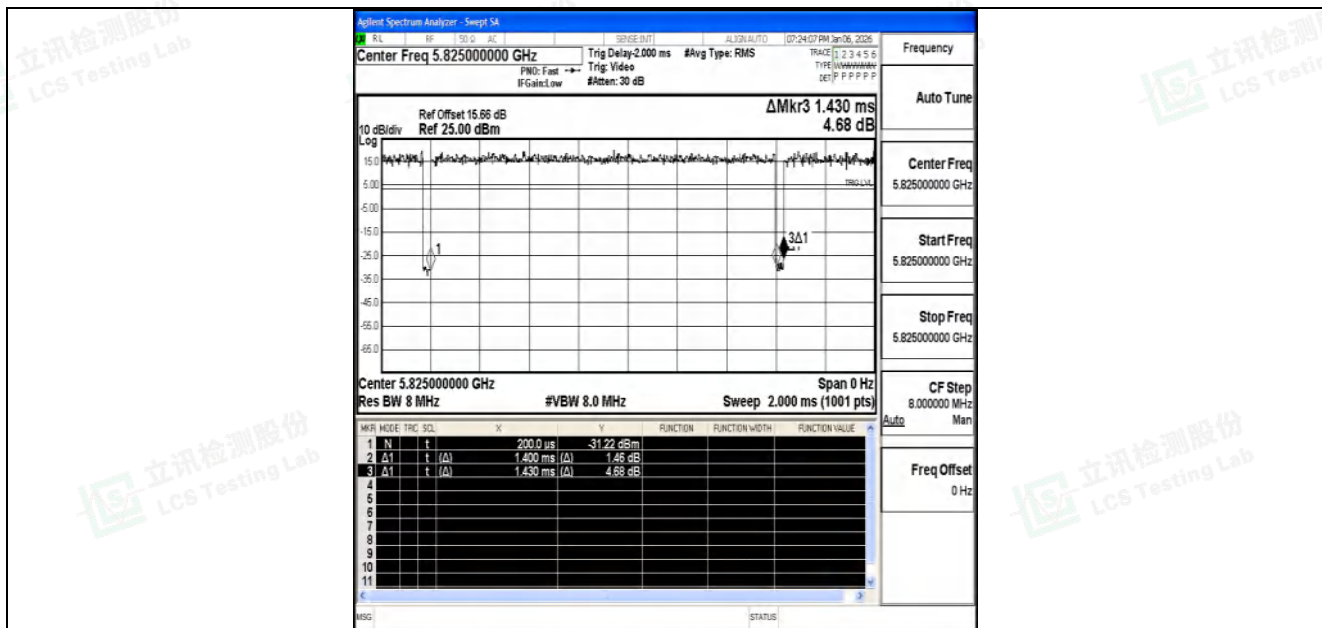


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

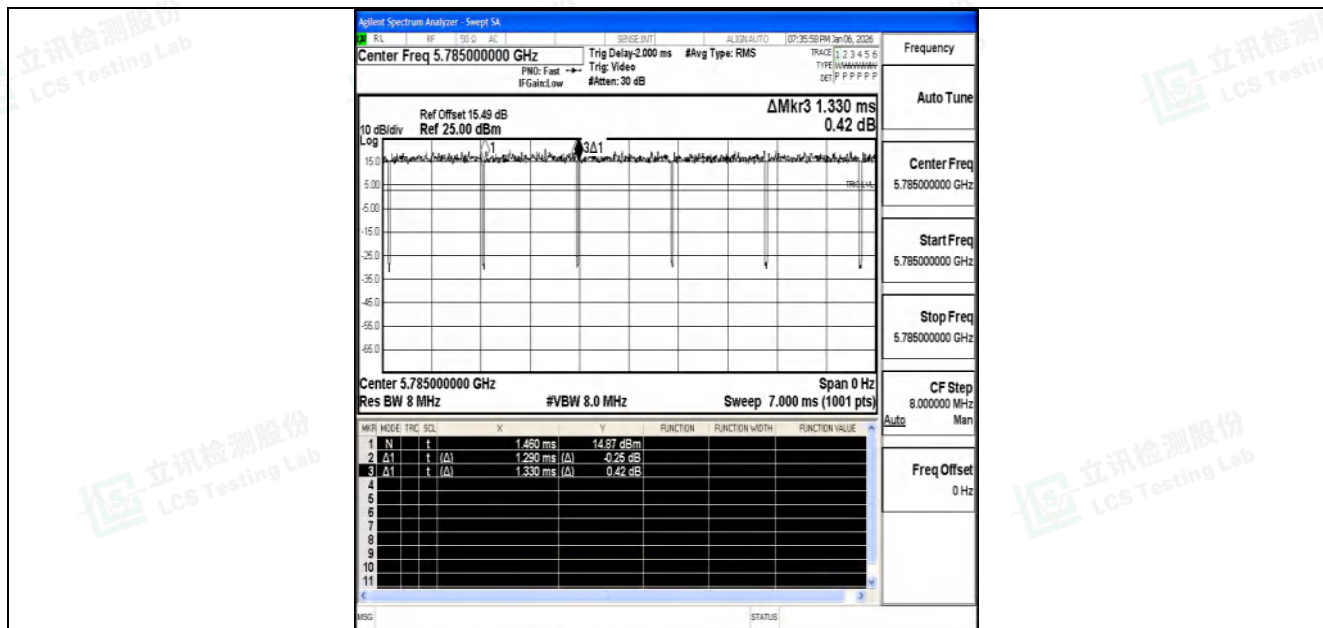

NTNV-11N20SISO-Ant1-5785

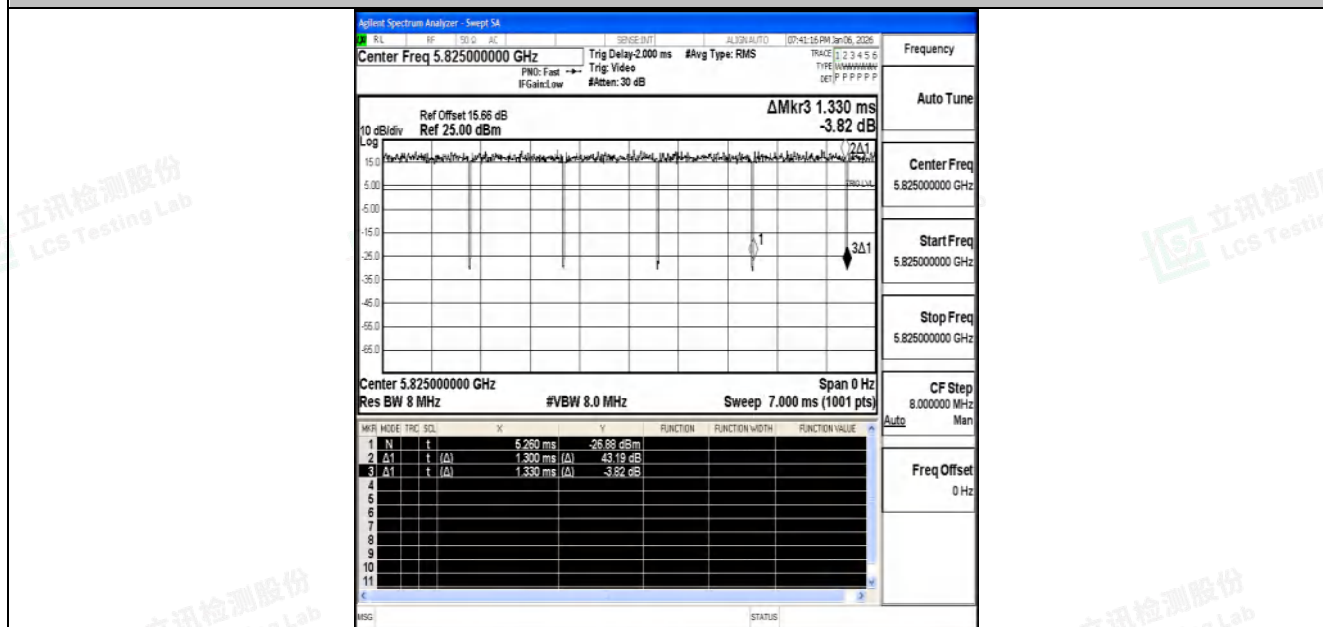

NTNV-11N20SISO-Ant1-5825




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

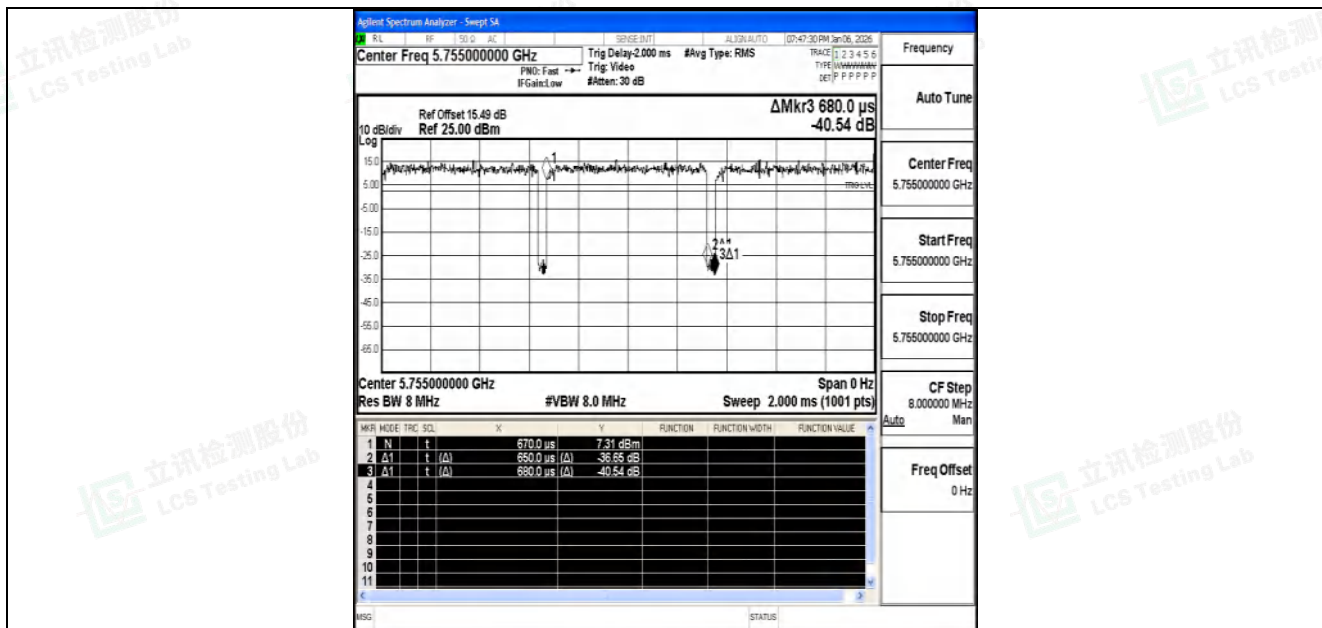

NTNV-11N40SISO-Ant1-5755

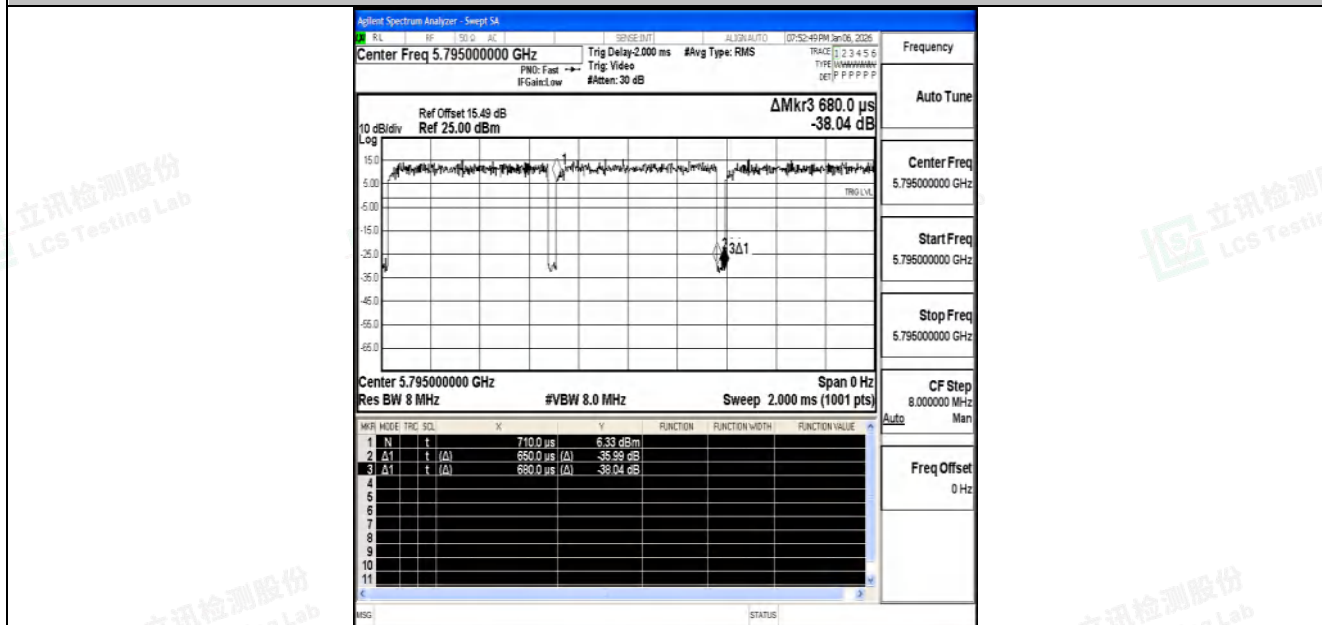

NTNV-11N40SISO-Ant1-5795




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

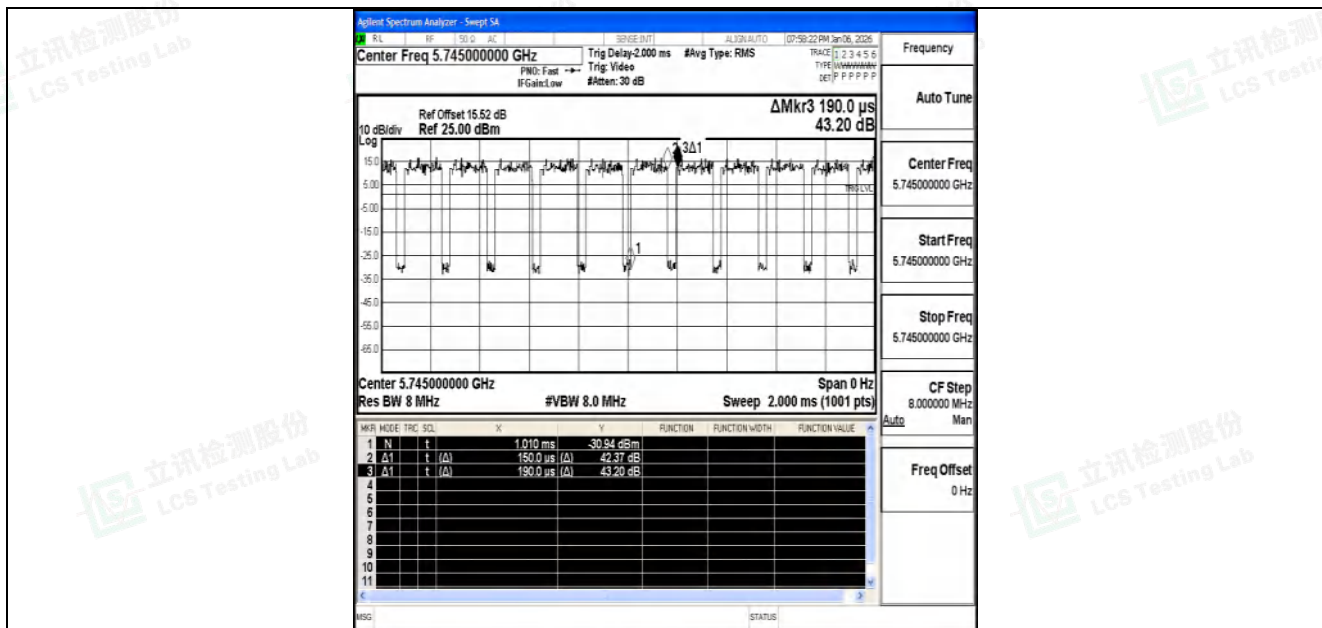

NTNV-11AC20SISO-Ant1-5745

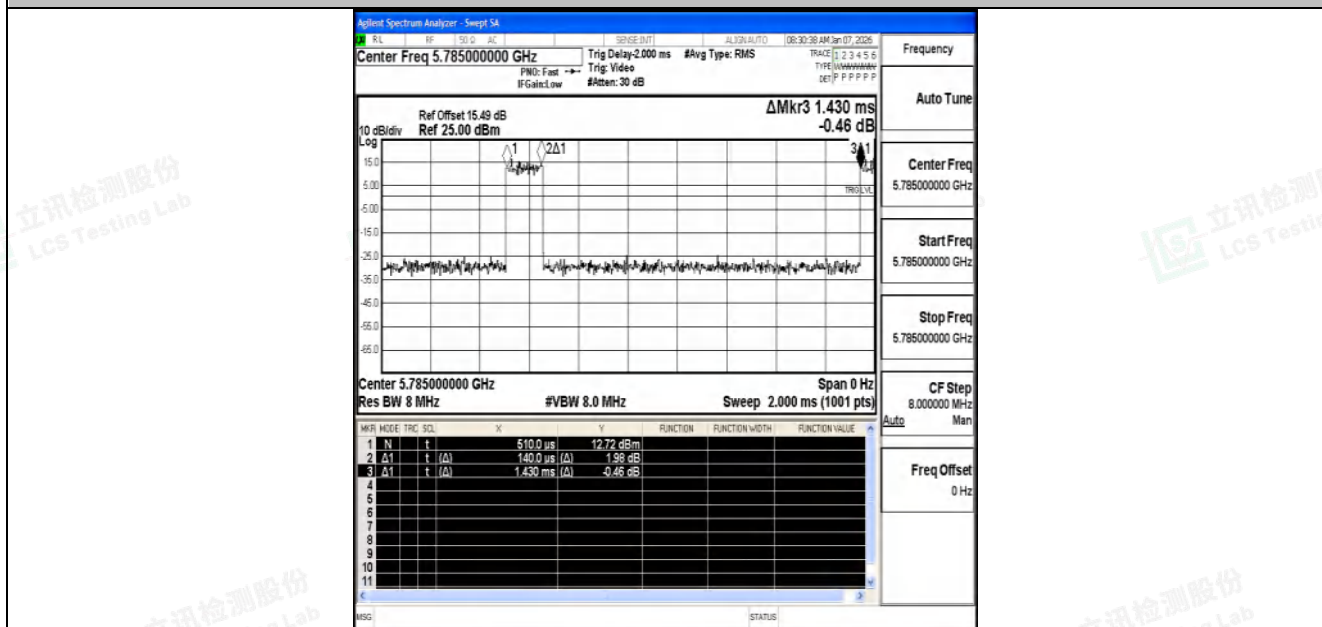

NTNV-11AC20SISO-Ant1-5785




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

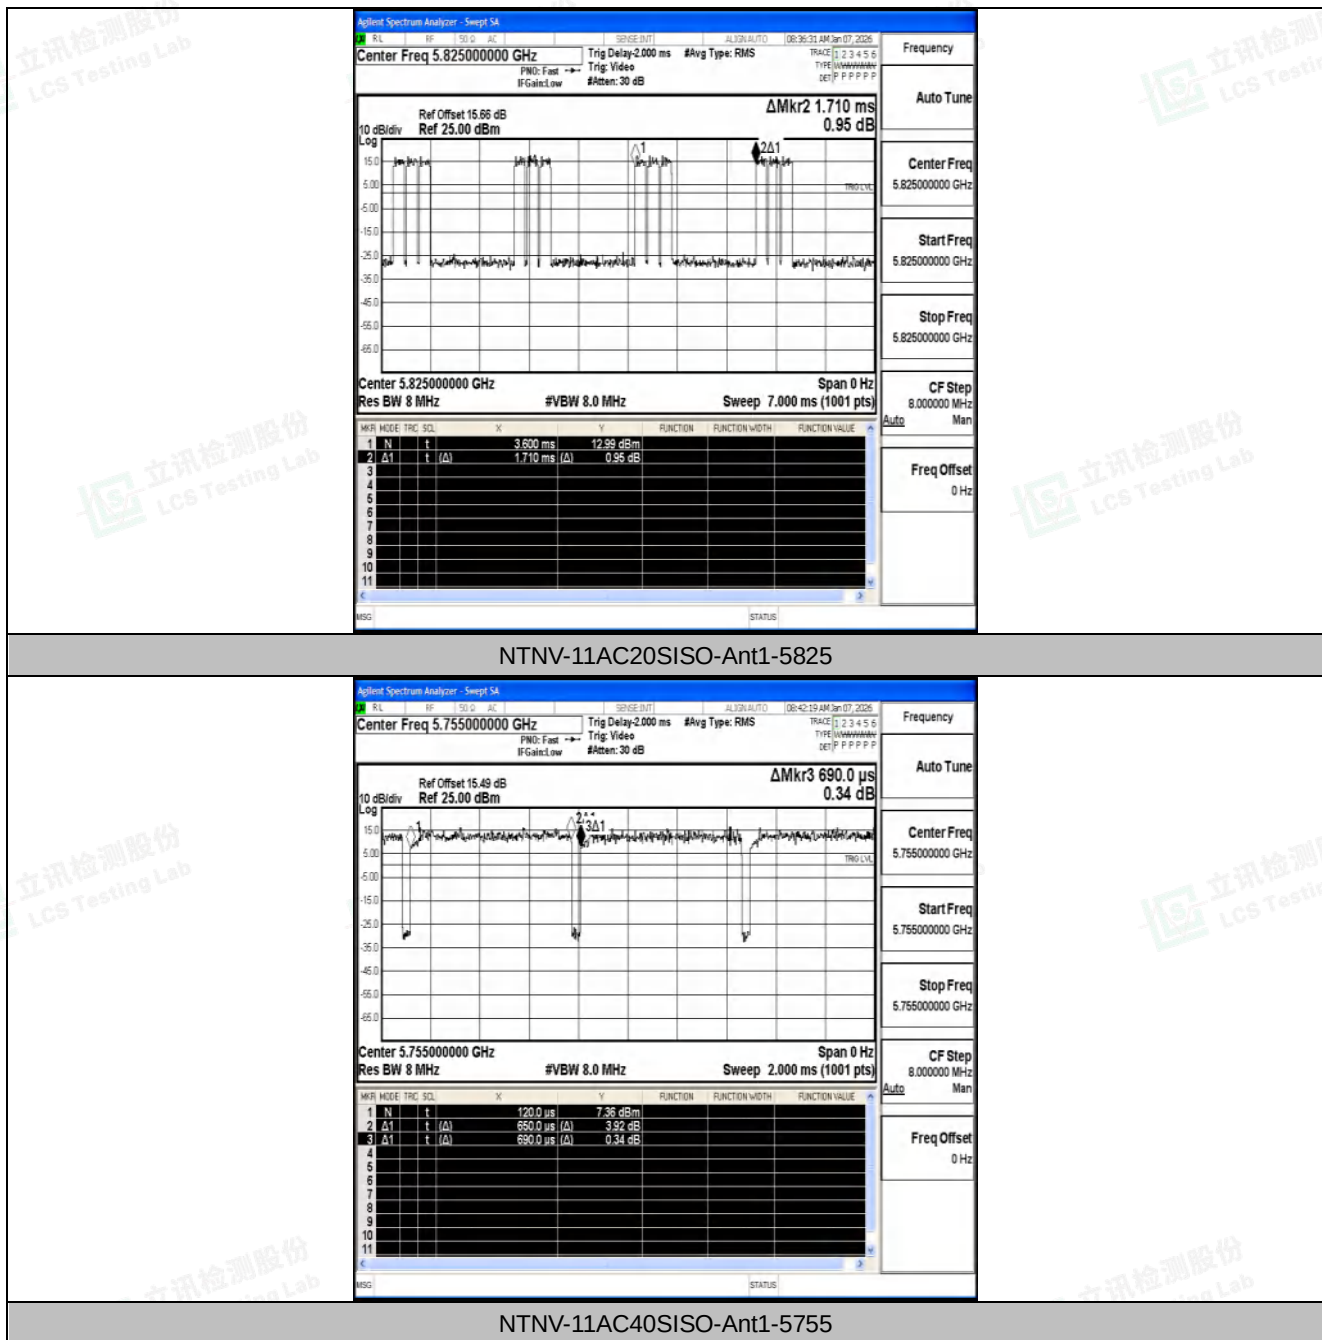


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

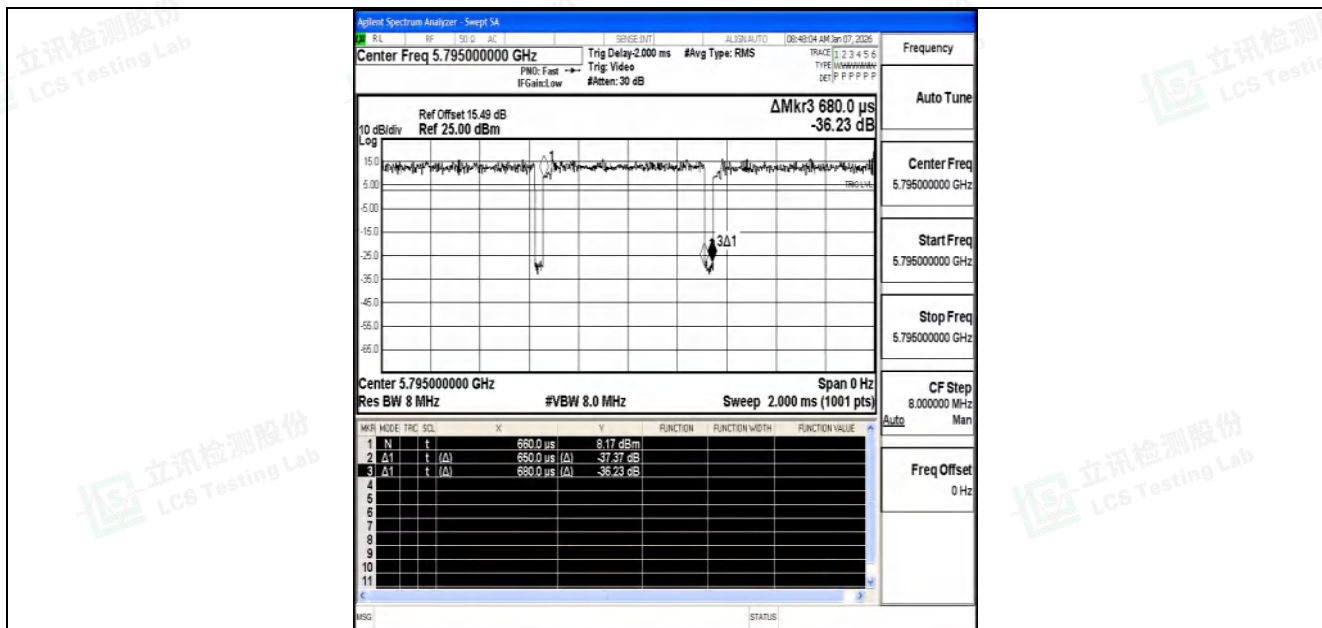

NTNV-11AC40SISO-Ant1-5795

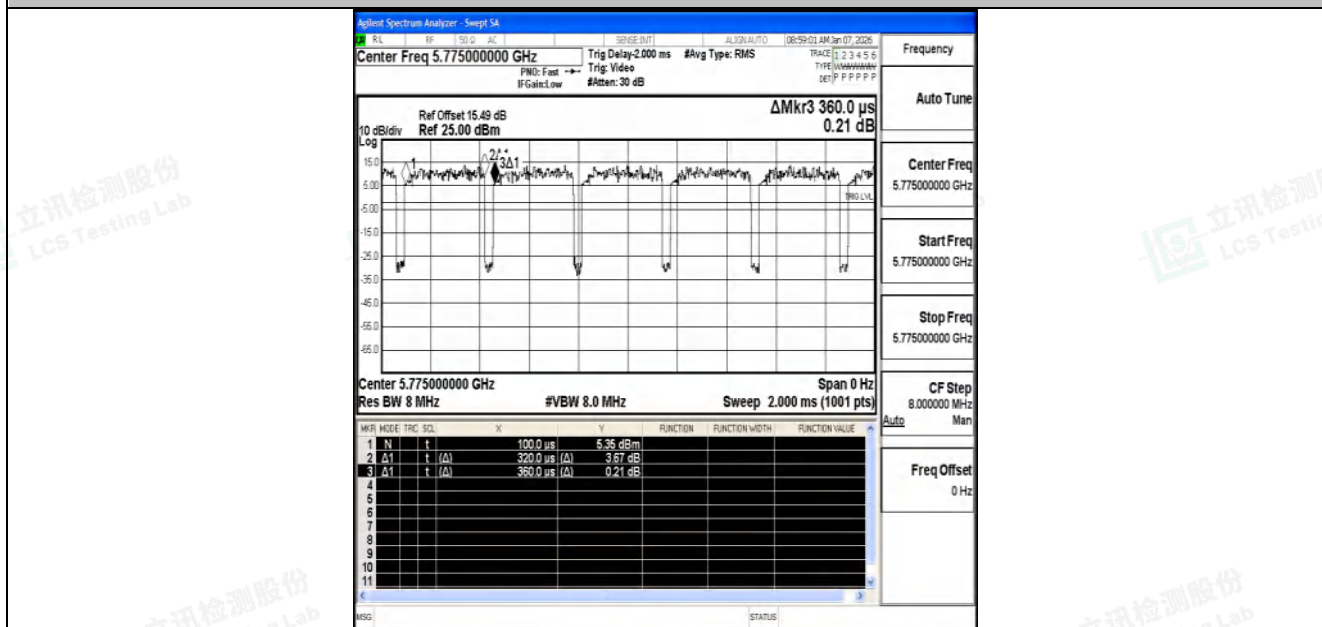

NTNV-11AC80SISO-Ant1-5775



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**Test Result**

| TestMode   | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Dc Factor [%] | 1/T  |
|------------|---------|----------------|----------------------------|--------------------------|----------------|---------------|------|
| 11A        | Ant2    | 5745           | 1.40                       | 1.43                     | 97.90          | 0.09          | 0.71 |
| 11A        | Ant2    | 5785           | 1.39                       | 1.43                     | 97.20          | 0.12          | 0.72 |
| 11A        | Ant2    | 5825           | 1.38                       | 1.42                     | 97.18          | 0.12          | 0.72 |
| 11N20SISO  | Ant2    | 5745           | 1.30                       | 1.33                     | 97.74          | 0.10          | 0.77 |
| 11N20SISO  | Ant2    | 5785           | 1.30                       | 1.33                     | 97.74          | 0.10          | 0.77 |
| 11N20SISO  | Ant2    | 5825           | 1.30                       | 1.34                     | 97.01          | 0.13          | 0.77 |
| 11N40SISO  | Ant2    | 5755           | 0.65                       | 0.68                     | 95.59          | 0.20          | 1.54 |
| 11N40SISO  | Ant2    | 5795           | 0.65                       | 0.68                     | 95.59          | 0.20          | 1.54 |
| 11AC20SISO | Ant2    | 5745           | 0.15                       | 0.18                     | 83.33          | 0.79          | 6.67 |
| 11AC20SISO | Ant2    | 5785           | 0.15                       | 0.19                     | 78.95          | 1.03          | 6.67 |
| 11AC20SISO | Ant2    | 5825           | 0.14                       | 0.18                     | 77.78          | 1.09          | 7.14 |
| 11AC40SISO | Ant2    | 5755           | 0.65                       | 0.72                     | 90.28          | 0.44          | 1.54 |
| 11AC40SISO | Ant2    | 5795           | 0.65                       | 0.69                     | 94.20          | 0.26          | 1.54 |
| 11AC80SISO | Ant2    | 5775           | 0.32                       | 0.36                     | 88.89          | 0.51          | 3.13 |



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## Test Graphs

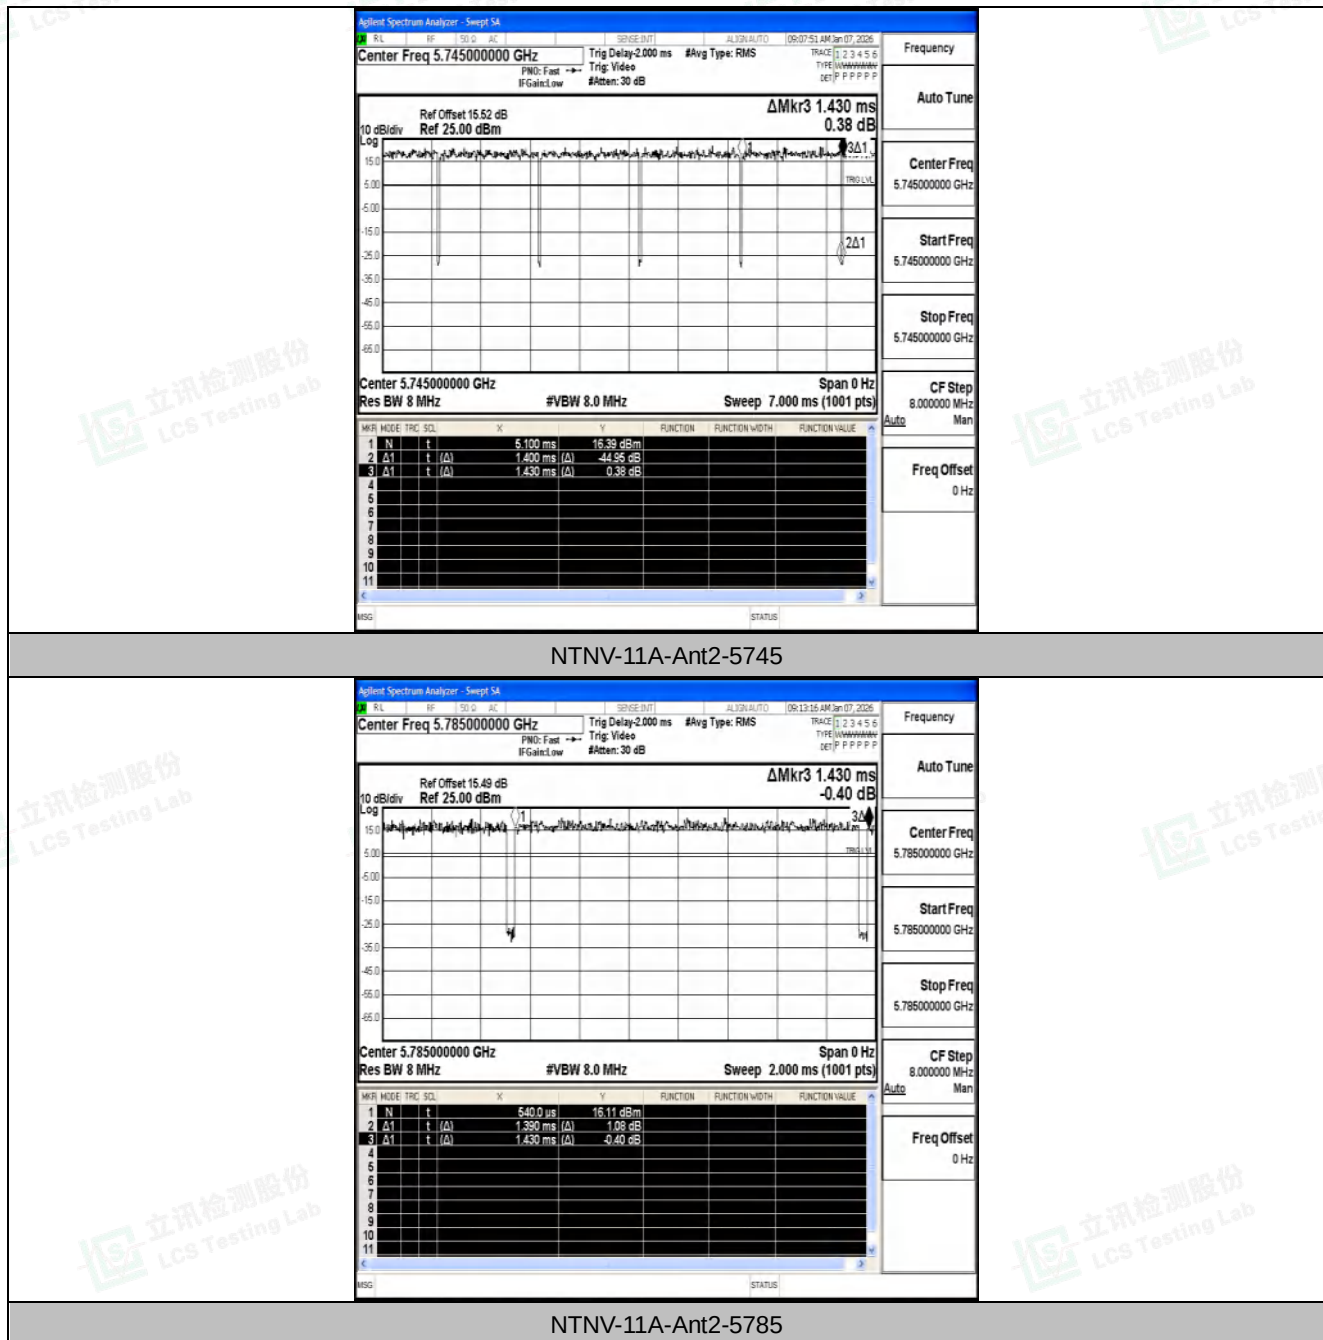


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

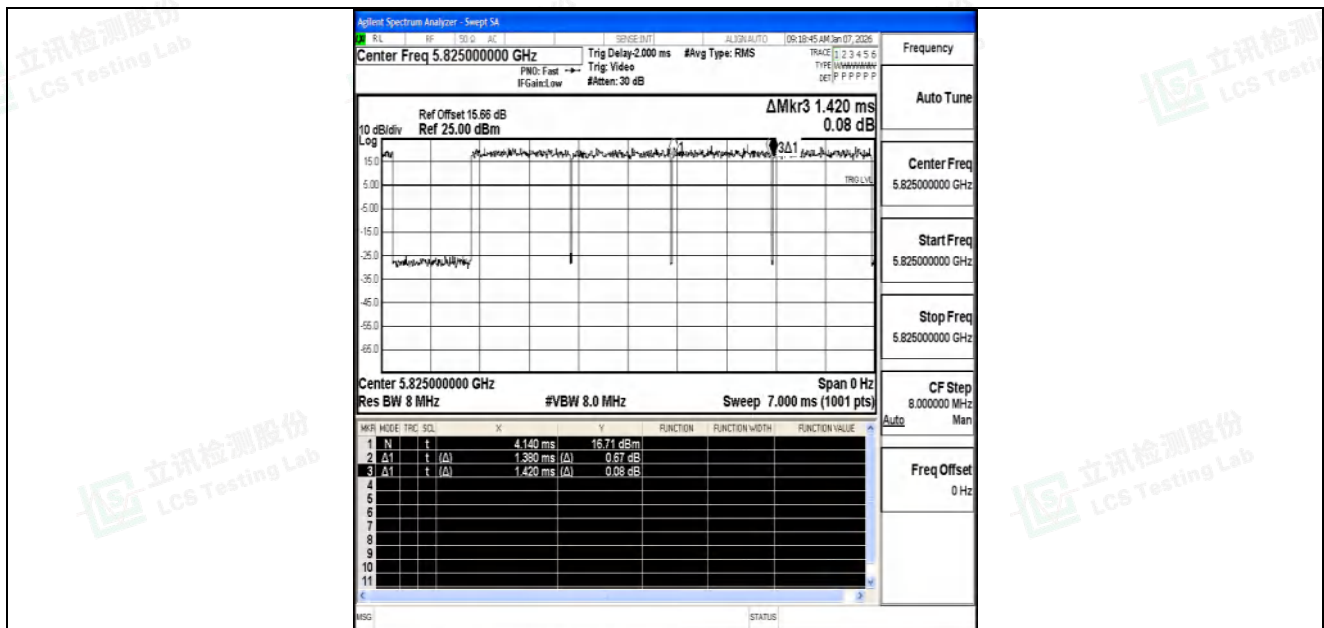

NTNV-11A-Ant2-5825

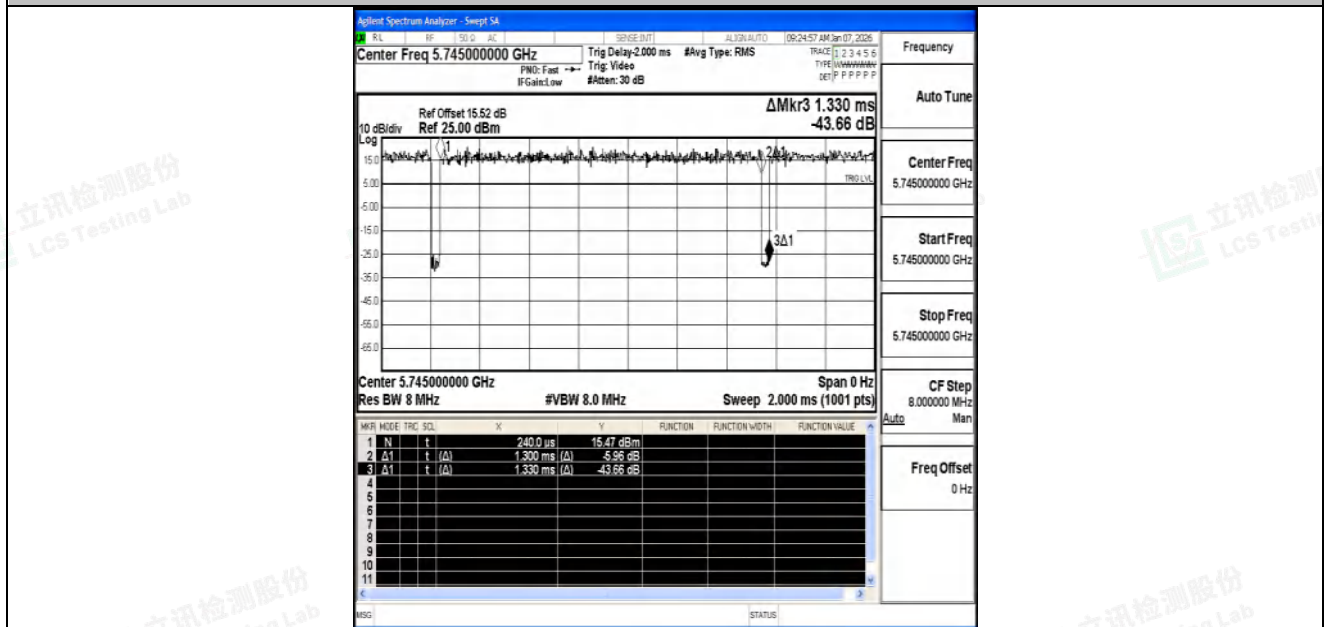

NTNV-11N20SISO-Ant2-5745




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

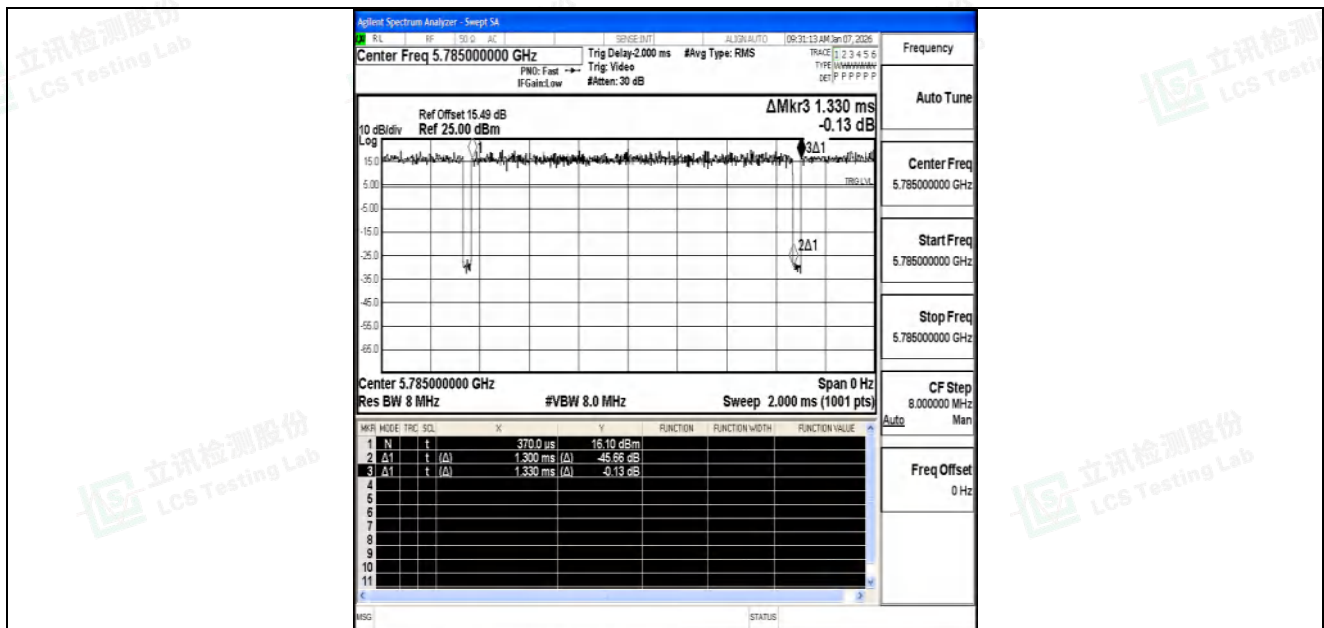

NTNV-11N20SISO-Ant2-5785

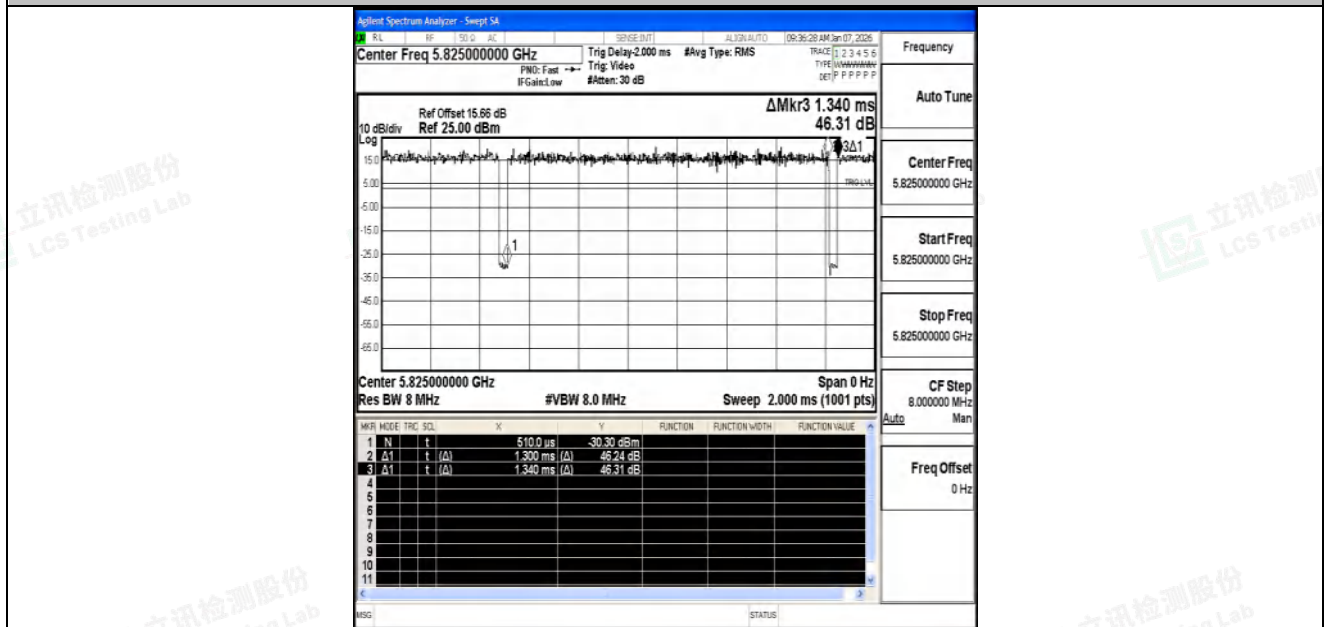

NTNV-11N20SISO-Ant2-5825




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

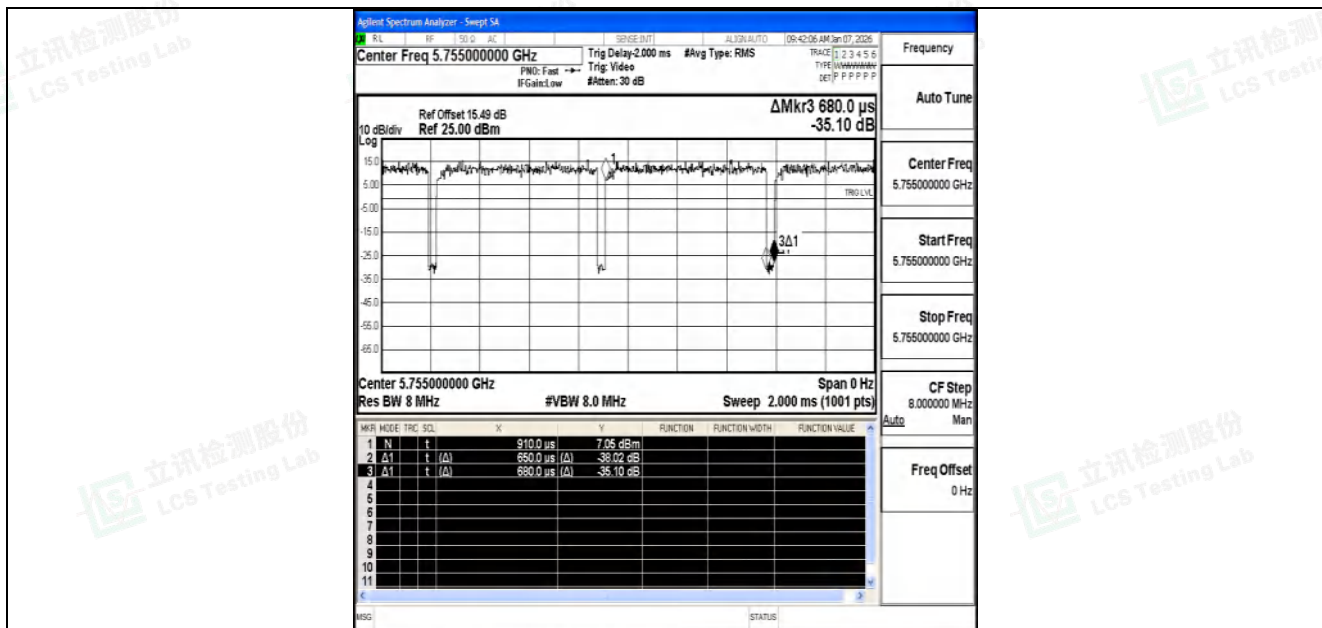

NTNV-11N40SISO-Ant2-5755

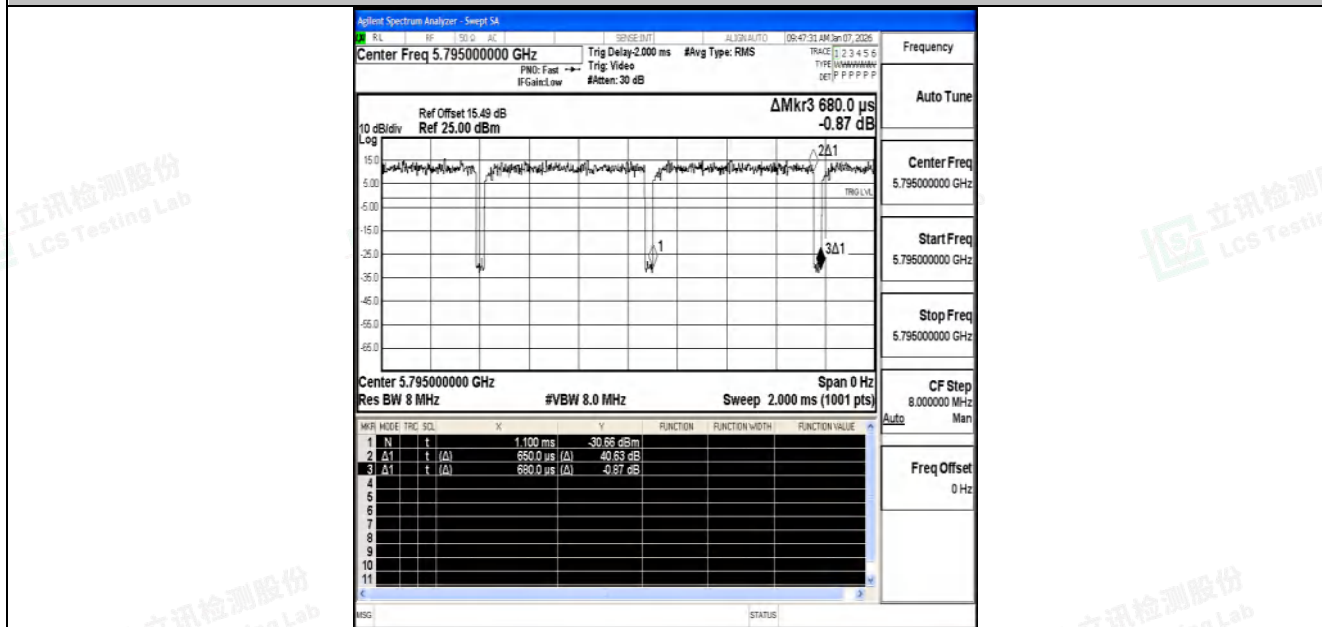

NTNV-11N40SISO-Ant2-5795




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

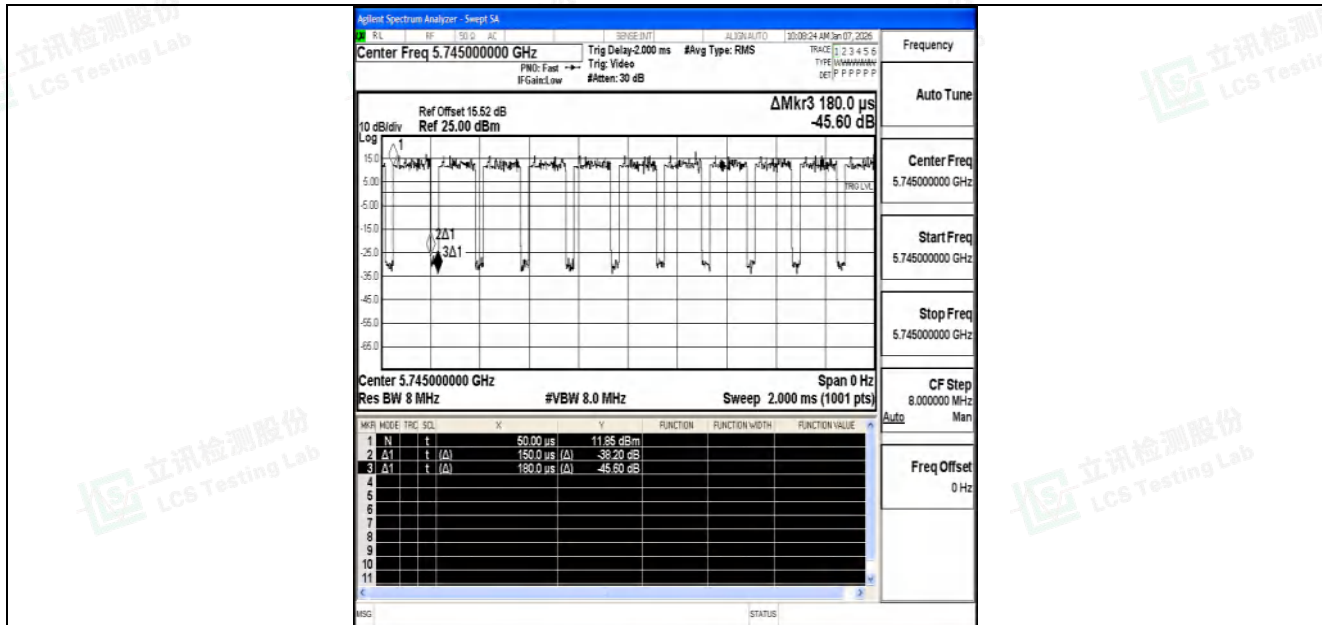

NTNV-11AC20SISO-Ant2-5745

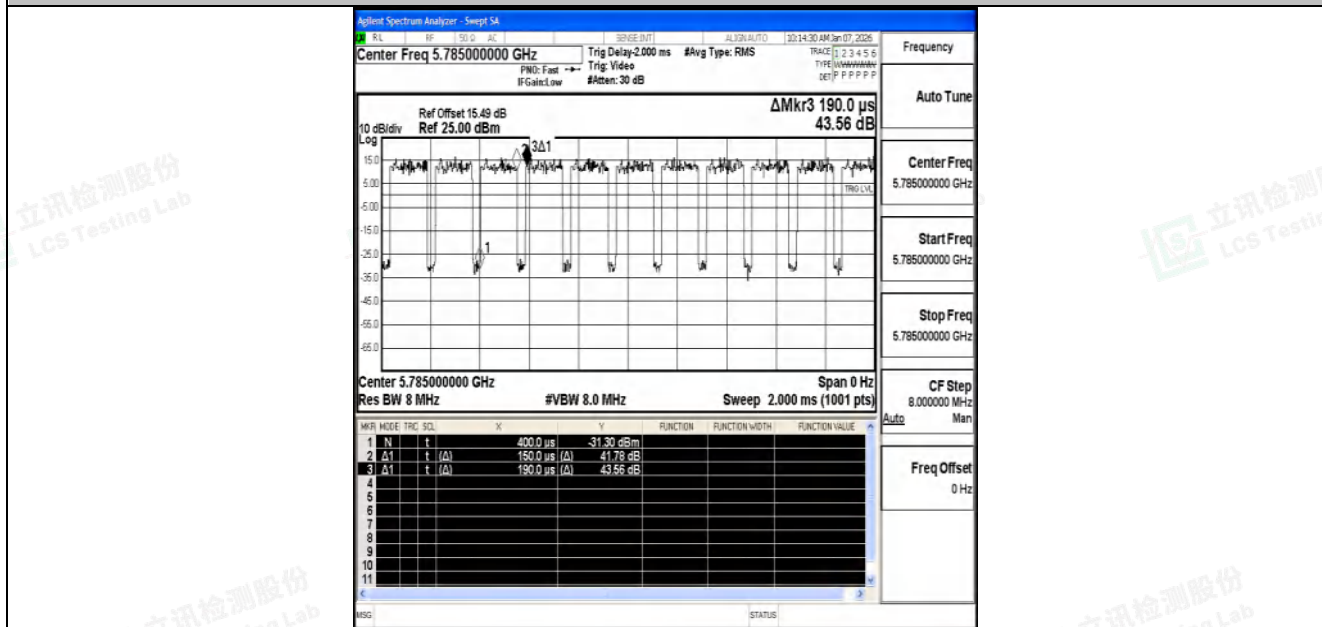

NTNV-11AC20SISO-Ant2-5785




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

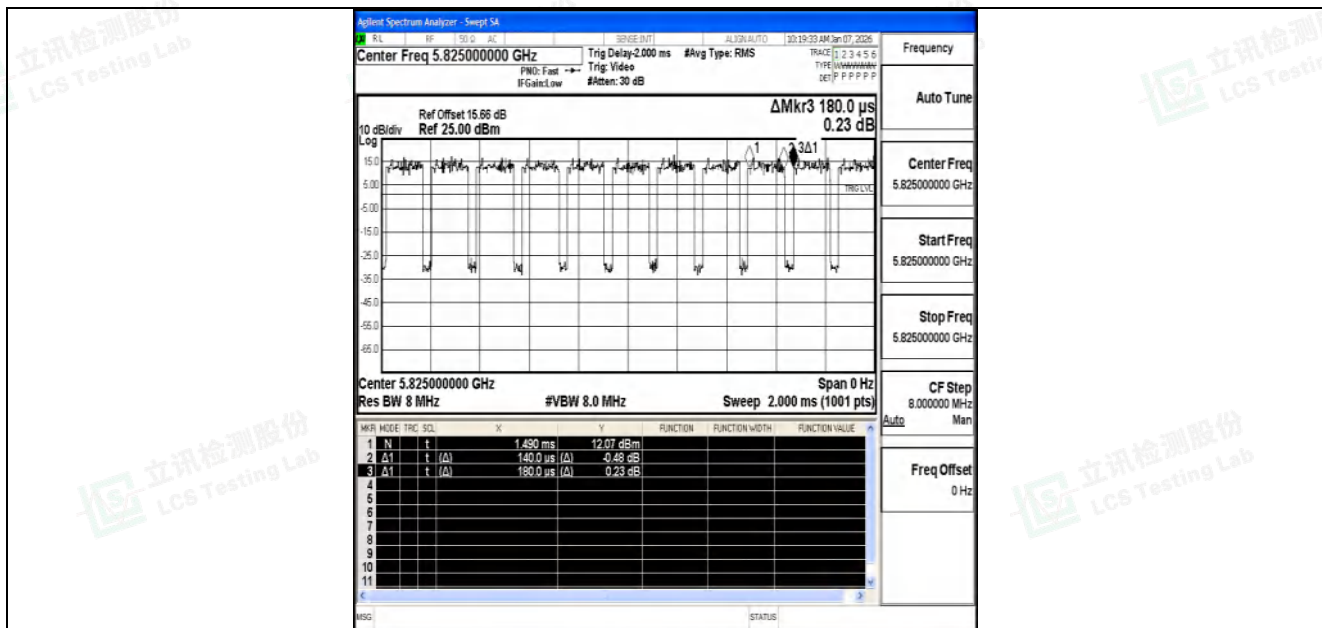

NTNV-11AC20SISO-Ant2-5825

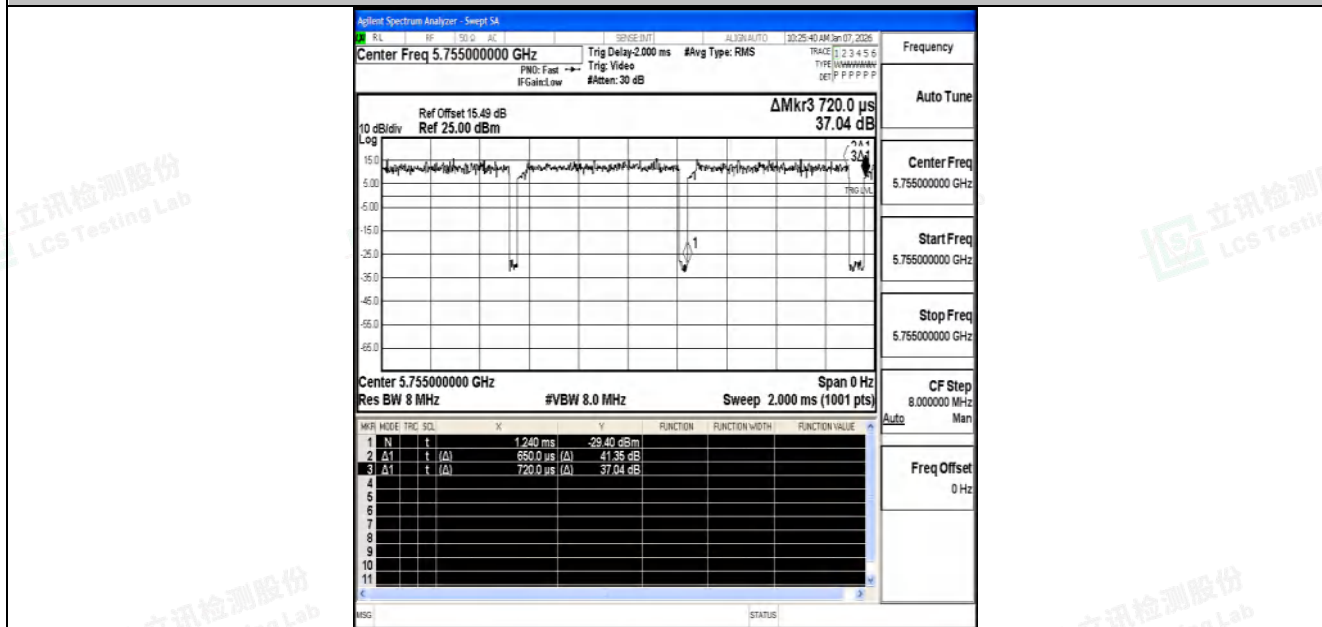

NTNV-11AC40SISO-Ant2-5755




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

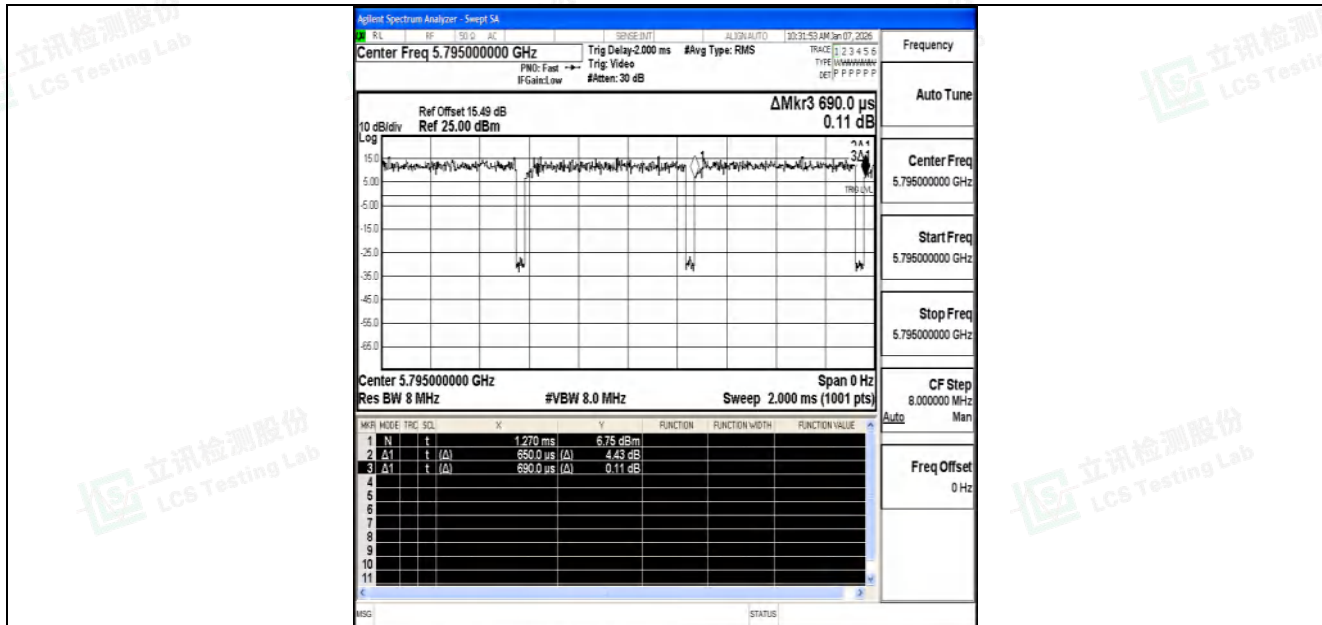

NTNV-11AC40SISO-Ant2-5795

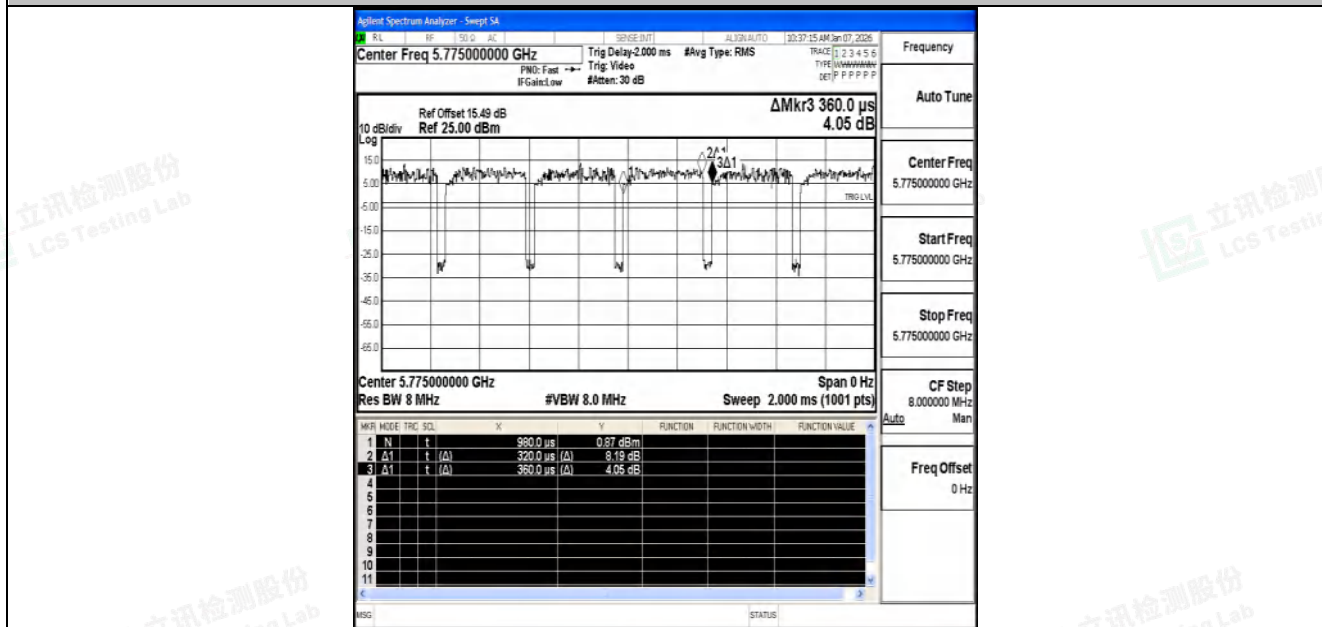

NTNV-11AC80SISO-Ant2-5775



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity