



802.11ax40_5755MHz_RU_Full_Chain 1

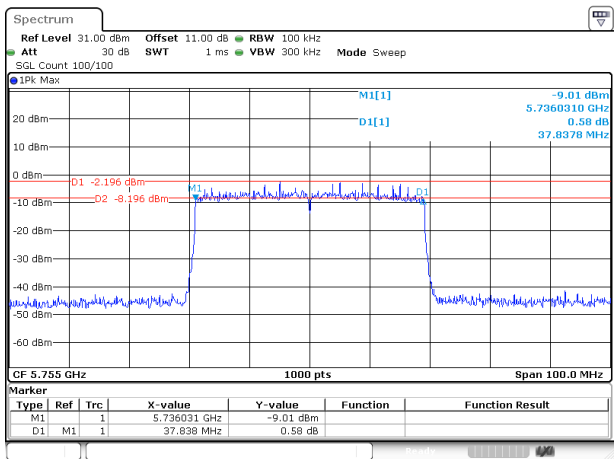


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:32:43

802.11ax40_5795MHz_RU_Full_Chain 1

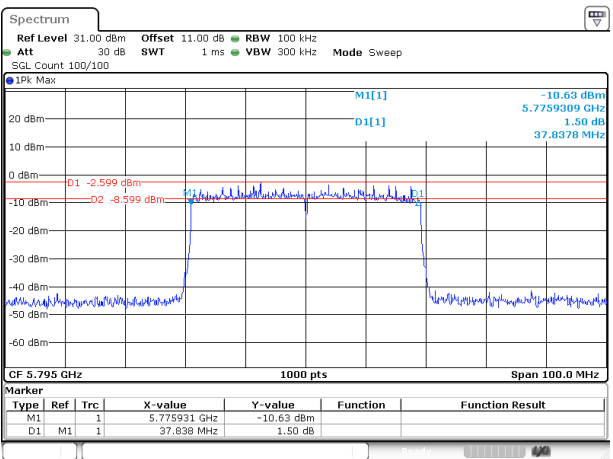


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:33:28

802.11ax80_5775MHz_RU_Full_Chain 0

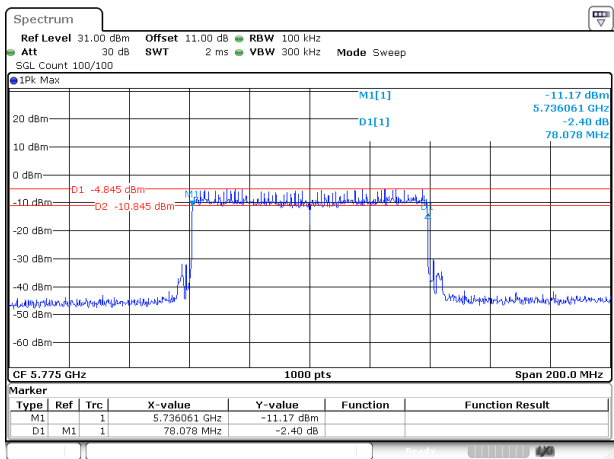

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:57:54

802.11ax80_5775MHz_RU_Full_Chain 1

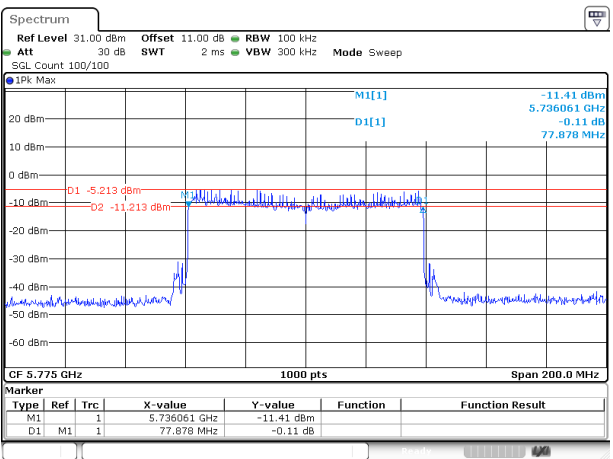

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:40:05

99% Occupied Bandwidth**Test Information:**

Sample No.:	3JK9-2	Test Date:	2026/05/04
Test Site:	RF	Test Mode:	Transmitting
Tester:	Cheeb Huang	Test Result:	N/A

Environmental Conditions:

Temperature: (°C)	25.2	Relative Humidity: (%)	51	ATM Pressure: (kPa)	100.8
----------------------	------	------------------------------	----	------------------------	-------

Test Data:
5150-5250MHz

Mode	Antenna	Test Frequency (MHz)	99% OBW (MHz)
802.11a	Chain 0	5180	16.350
		5200	16.400
		5240	16.350
	Chain 1	5180	16.350
		5200	16.350
		5240	16.350
802.11ac20	Chain 0	5180	17.550
		5200	17.550
		5240	17.550
	Chain 1	5180	17.550
		5200	17.550
		5240	17.550
802.11ac40	Chain 0	5190	36.100
		5230	36.100
	Chain 1	5190	36.100
		5230	36
802.11ac80	Chain 0	5210	76.200
	Chain 1	5210	76.200
802.11ax20_RU_Full	Chain 0	5180	18.950
		5200	18.850
		5240	18.950
	Chain 1	5180	18.850
		5200	18.900
		5240	18.850
802.11ax40_RU_Full	Chain 0	5190	37.700
		5230	37.800
	Chain 1	5190	37.700
		5230	37.700
802.11ax80_RU_Full	Chain 0	5210	77.400
	Chain 1	5210	77.400

Note:

The 99% Occupied Bandwidth have not fall into the band 5250-5350MHz, please refer to the test plots of 99% Occupied Bandwidth.

5250-5350MHz

Mode	Antenna	Test Frequency (MHz)	99% OBW (MHz)
802.11a	Chain 0	5260	16.400
		5300	16.400
		5320	16.350
	Chain 1	5260	16.350
		5300	16.400
		5320	16.450
802.11ac20	Chain 0	5260	17.550
		5300	17.550
		5320	17.550
	Chain 1	5260	17.600
		5300	17.550
		5320	17.550
802.11ac40	Chain 0	5270	36.200
		5310	36.200
	Chain 1	5270	36.100
		5310	36
802.11ac80	Chain 0	5290	76.200
	Chain 1	5290	76.200
802.11ax20_RU_Full	Chain 0	5260	18.950
		5300	18.900
		5320	18.900
	Chain 1	5260	18.900
		5300	18.850
		5320	18.850
802.11ax40_RU_Full	Chain 0	5270	37.700
		5310	37.700
	Chain 1	5270	37.700
		5310	37.700
802.11ax80_RU_Full	Chain 0	5290	77.200
	Chain 1	5290	77.200

5470-5725MHz

Mode	Antenna	Test Frequency (MHz)	99% OBW (MHz)
802.11a	Chain 0	5500	16.350
		5600	16.400
		5700	16.350
		5720	16.400
	Chain 1	5500	16.350
		5600	16.400
		5700	16.350
		5720	16.350
802.11ac20	Chain 0	5500	17.550
		5600	17.550
		5700	17.550
		5720	17.550
	Chain 1	5500	17.550
		5600	17.550
		5700	17.550
		5720	17.550
802.11ac40	Chain 0	5510	36.000
		5590	36.000
		5670	36.000
		5710	36.000
	Chain 1	5510	36.000
		5590	36.000
		5670	36.100
		5710	36.000
802.11ac80	Chain 0	5530	76.200
		5610	76.400
		5690	76.200
	Chain 1	5530	76.400
		5610	76.200
		5690	76.200

Mode	Antenna	Test Frequency (MHz)	99% OBW (MHz)
802.11ax20_RU_Full	Chain 0	5500	18.900
		5600	18.900
		5700	18.950
		5720	18.950
	Chain 1	5500	18.900
		5600	18.900
		5700	18.850
		5720	18.900
802.11ax40_RU_Full	Chain 0	5510	37.700
		5590	37.800
		5670	37.700
		5710	37.700
	Chain 1	5510	37.700
		5590	37.800
		5670	37.600
		5710	37.700
802.11ax80_RU_Full	Chain 0	5530	77.200
		5610	77.200
		5690	77.400
	Chain 1	5530	77.400
		5610	77.200
		5690	77.200

5725-5850MHz


Mode	Antenna	Test Frequency (MHz)	99% OBW (MHz)
802.11a	Chain 0	5745	16.350
		5785	16.350
		5825	16.350
	Chain 1	5745	16.350
		5785	16.350
		5825	16.350
802.11ac20	Chain 0	5745	17.550
		5785	17.550
		5825	17.550
	Chain 1	5745	17.550
		5785	17.550
		5825	17.550
802.11ac40	Chain 0	5755	36.100
		5795	36.100
	Chain 1	5755	36.000
		5795	36.100
802.11ac80	Chain 0	5775	76.200
	Chain 1	5775	76.400
802.11ax20_RU_Full	Chain 0	5745	18.950
		5785	18.900
		5825	18.900
	Chain 1	5745	18.900
		5785	18.950
		5825	18.900
802.11ax40_RU_Full	Chain 0	5755	37.800
		5795	37.800
	Chain 1	5755	37.700
		5795	37.800
802.11ax80_RU_Full	Chain 0	5775	77.000
	Chain 1	5775	77.400

Note:

The 99% Occupied Bandwidth have not fall into the band 5470-5725MHz, please refer to the test plots of 99% Occupied Bandwidth.


5150-5250MHz

802.11a_5180MHz_Chain 0

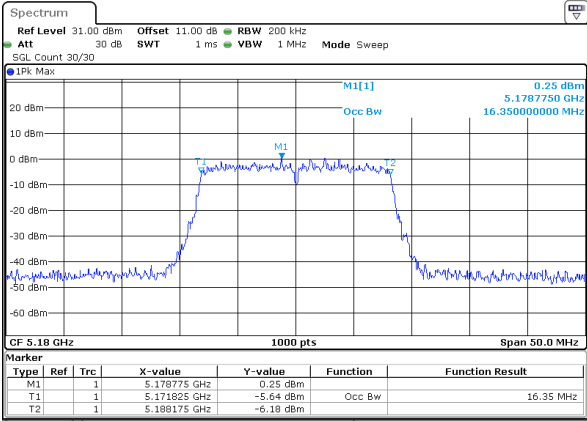


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:45:51

802.11a_5200MHz_Chain 0

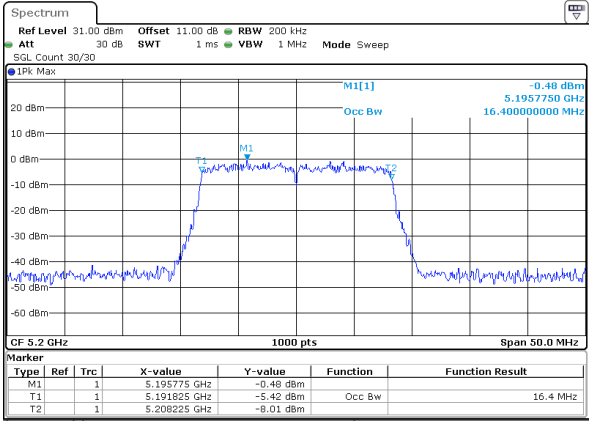


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:47:57

802.11a_5240MHz_Chain 0

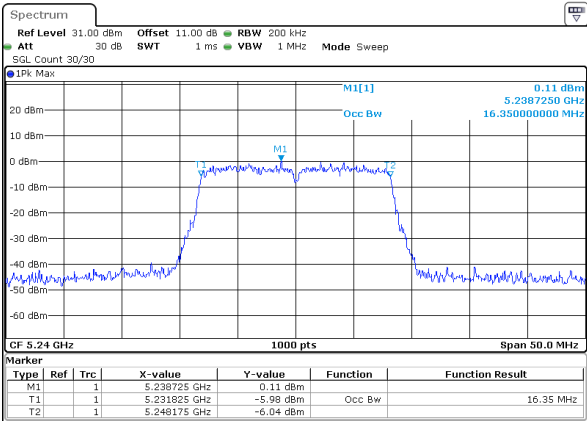


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:49:48

802.11a_5180MHz_Chain 1

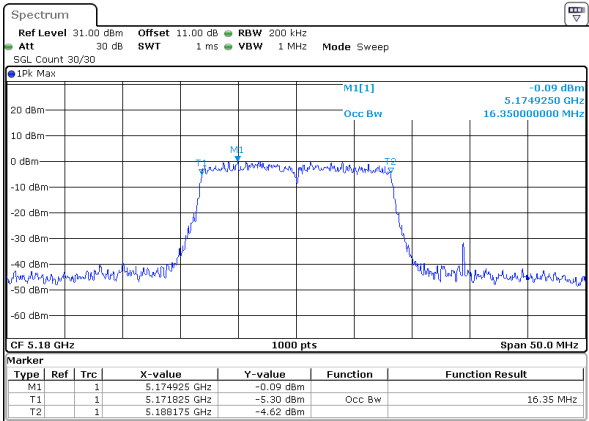


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:02:57

802.11a_5200MHz_Chain 1

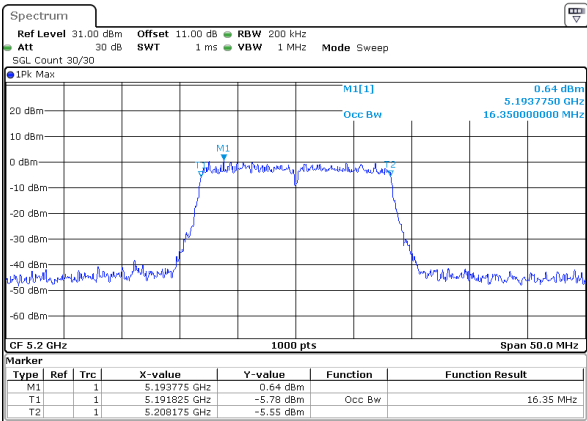


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:04:30

802.11a_5240MHz_Chain 1

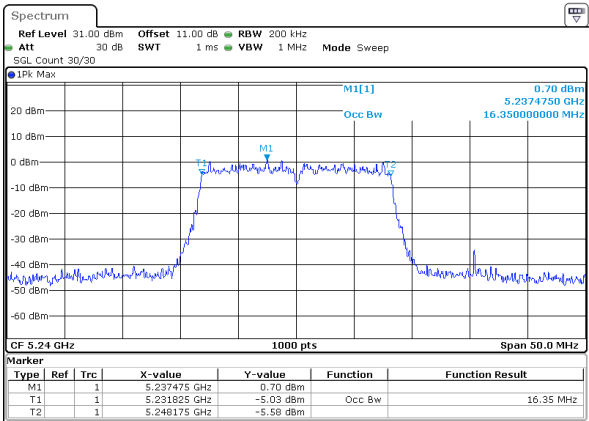


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:06:04

802.11ac20_5180MHz_Chain 0

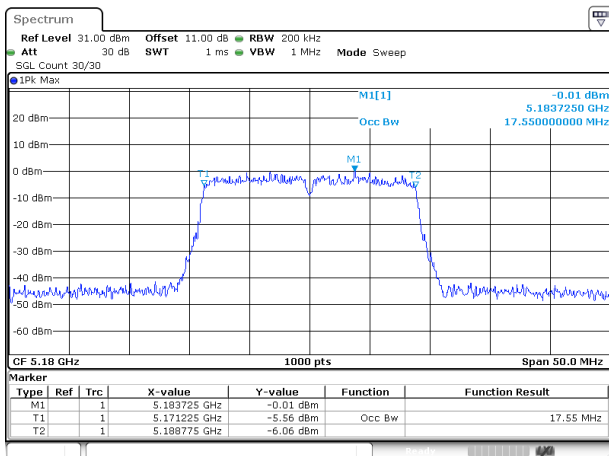


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 15:14:13

802.11ac20_5200MHz_Chain 0

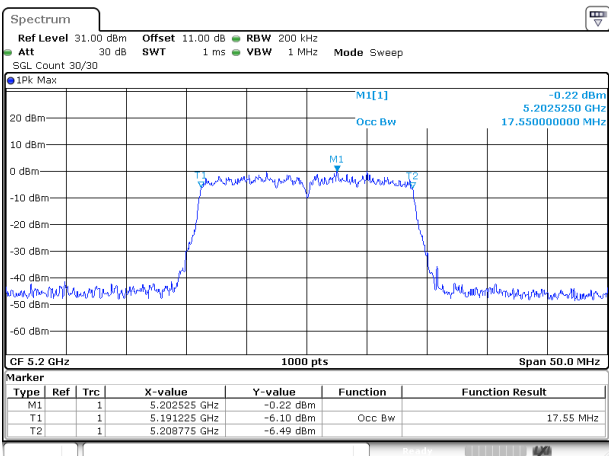


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 15:15:57

802.11ac20_5240MHz_Chain 0

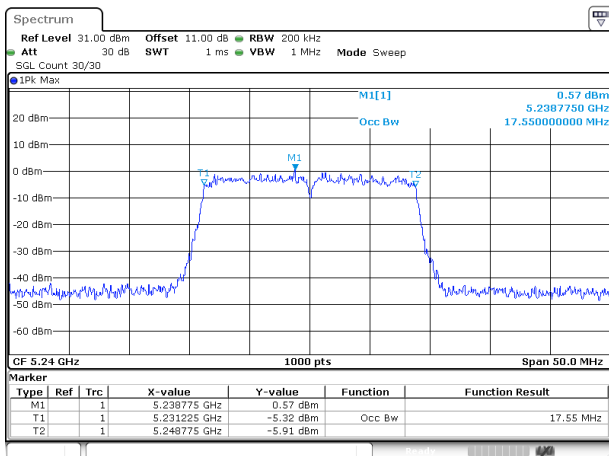


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 15:18:16

802.11ac20_5180MHz_Chain 1

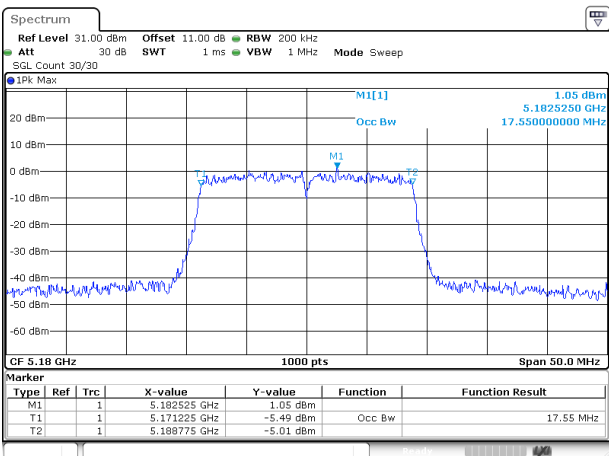


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 17:20:21

802.11ac20_5200MHz_Chain 1

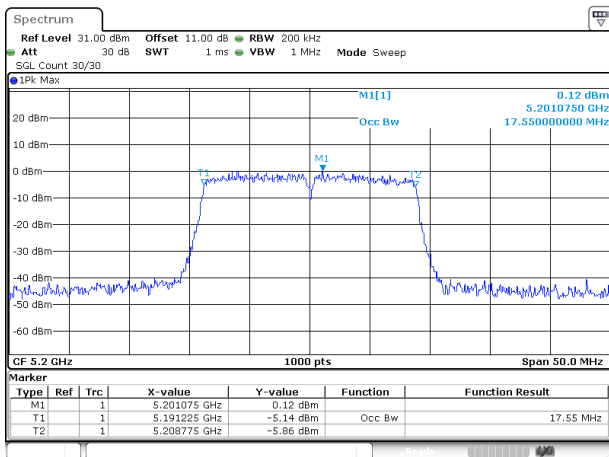


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 17:22:52

802.11ac20_5240MHz_Chain 1

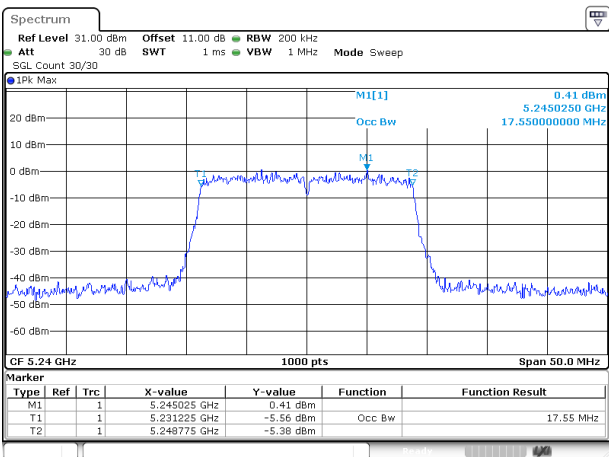


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
 Date: 4.MAY.2026 17:26:21

802.11ac40_5190MHz_Chain 0

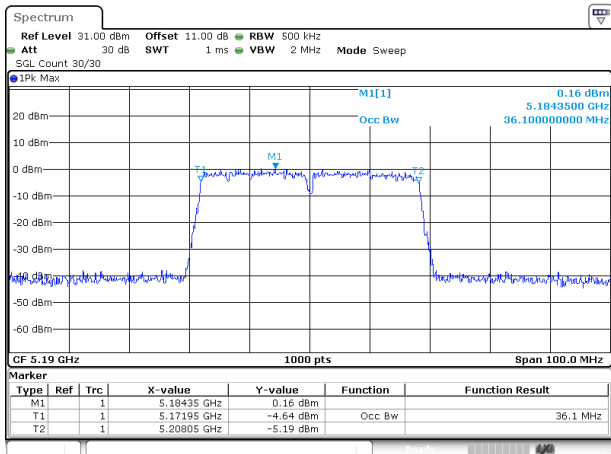


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:42:23

802.11ac40_5230MHz_Chain 0

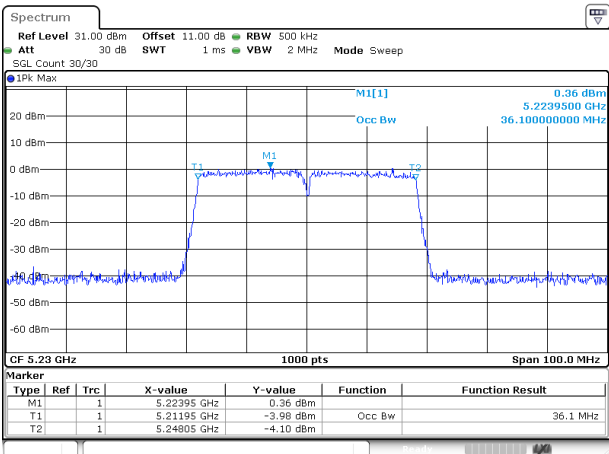


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:44:20

802.11ac40_5190MHz_Chain 1

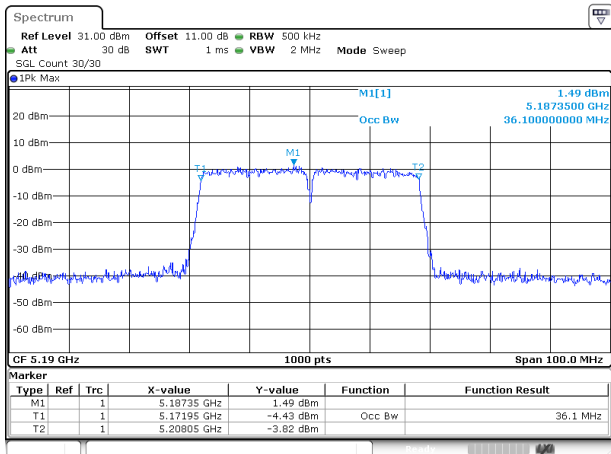


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:41:45

802.11ac40_5230MHz_Chain 1

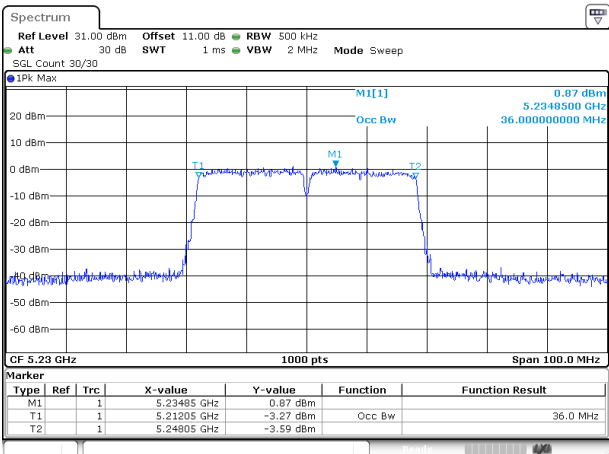


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:43:04

802.11ac80_5210MHz_Chain 0

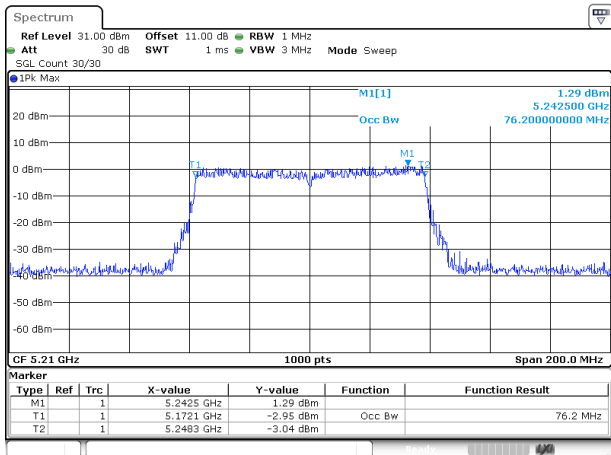


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:55:41

802.11ac80_5210MHz_Chain 1

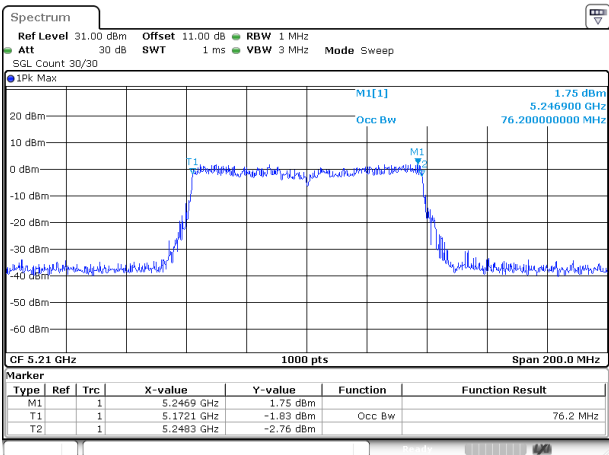


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:02:20

802.11ax20_5180MHz_RU_Full_Chain 0

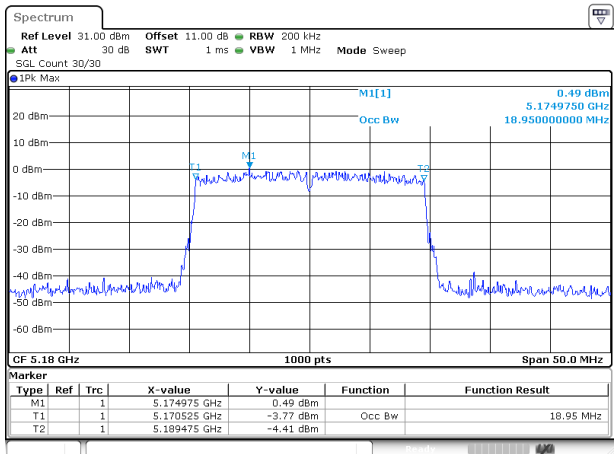


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:06:27

802.11ax20_5200MHz_RU_Full_Chain 0

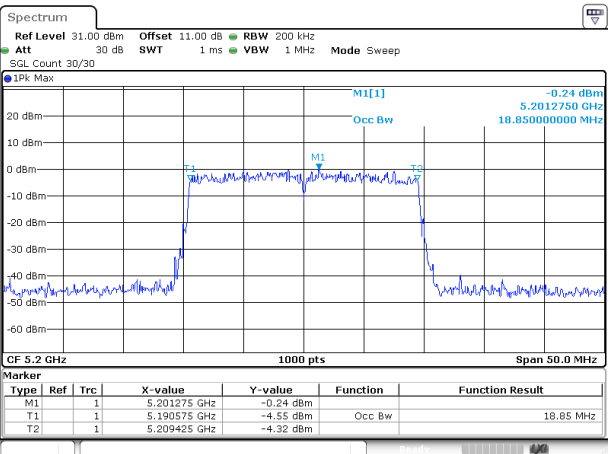


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:08:26

802.11ax20_5240MHz_RU_Full_Chain 0

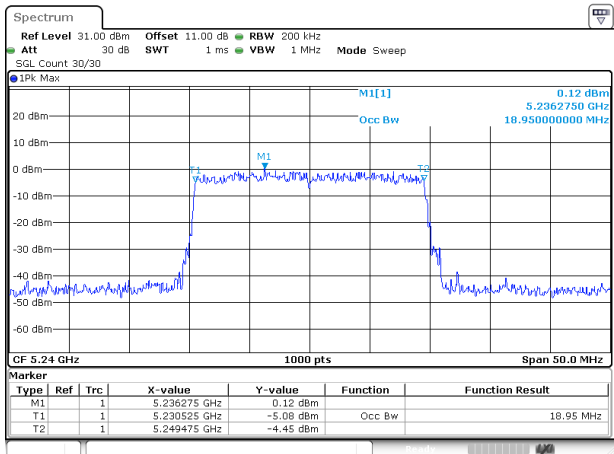


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:13:35

802.11ax20_5180MHz_RU_Full_Chain 1

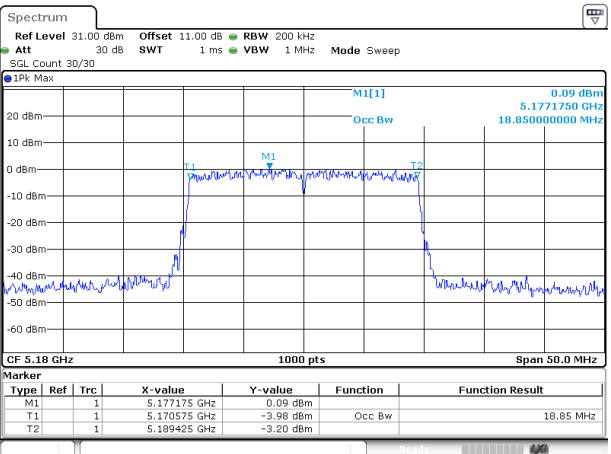


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:09:04

802.11ax20_5200MHz_RU_Full_Chain 1

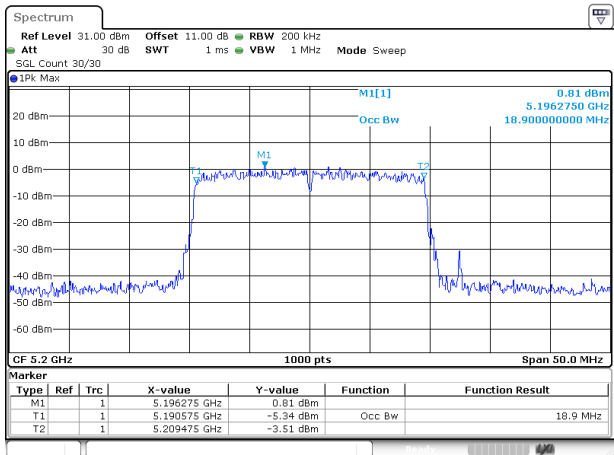


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:10:58

802.11ax20_5240MHz_RU_Full_Chain 1

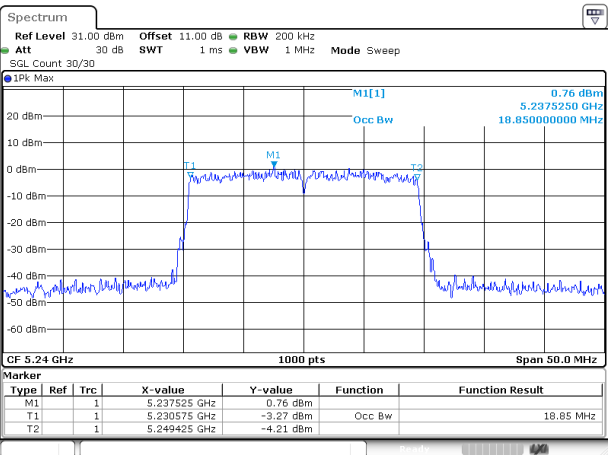


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:13:10

802.11ax40_5190MHz_RU_Full_Chain 0

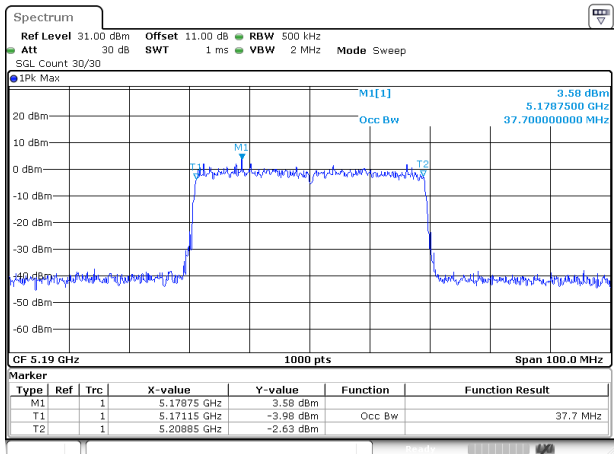


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:40:08

802.11ax40_5230MHz_RU_Full_Chain 0

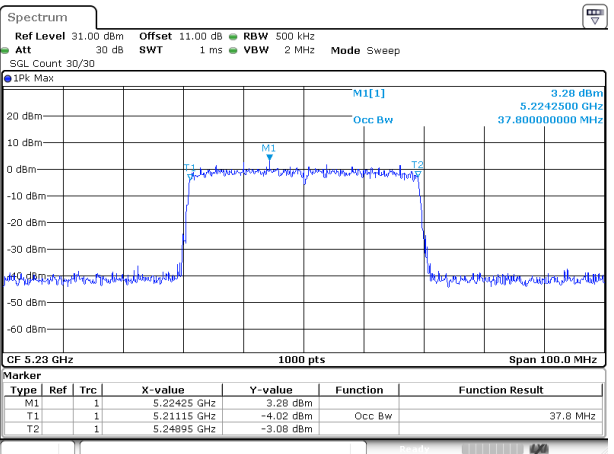


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:41:26

802.11ax40_5190MHz_RU_Full_Chain 1

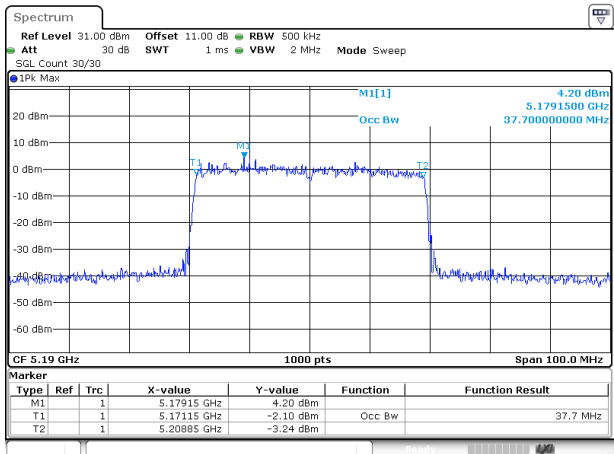


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:25:10

802.11ax40_5230MHz_RU_Full_Chain 1

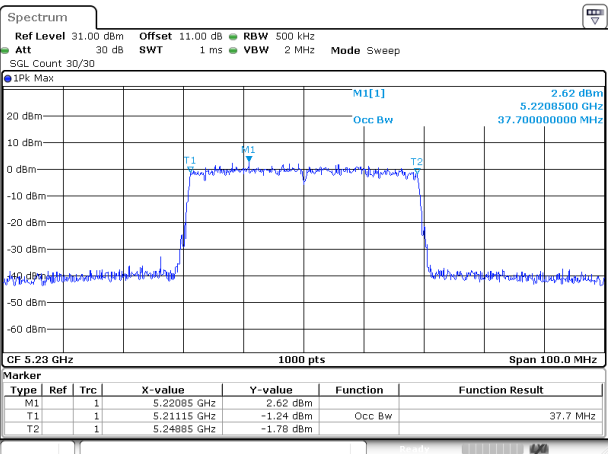


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:26:17

802.11ax80_5210MHz_RU_Full_Chain 0

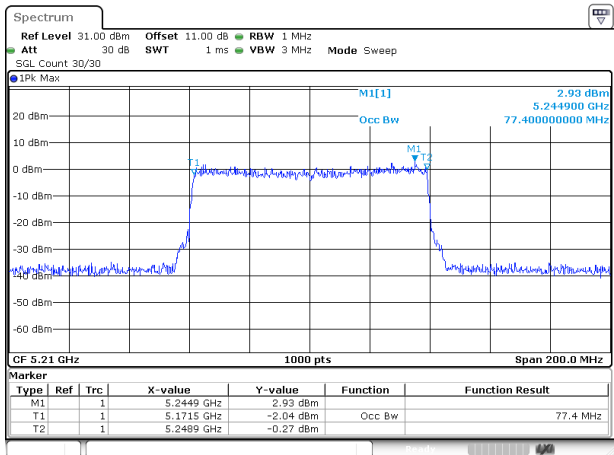

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:49:27


802.11ax80_5210MHz_RU_Full_Chain 1

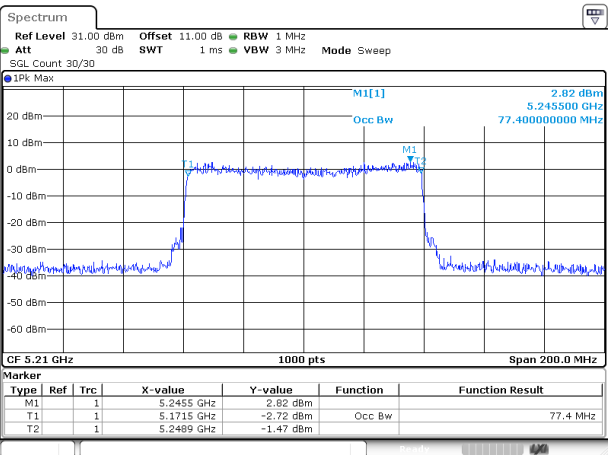

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:34:58


5250-5350MHz

802.11a_5260MHz_Chain 0

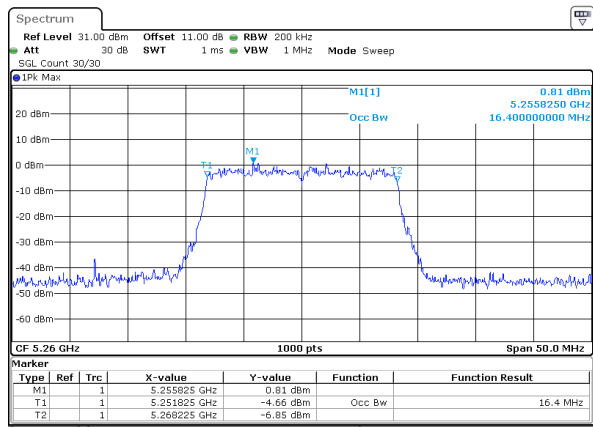


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:52:09

802.11a_5300MHz_Chain 0

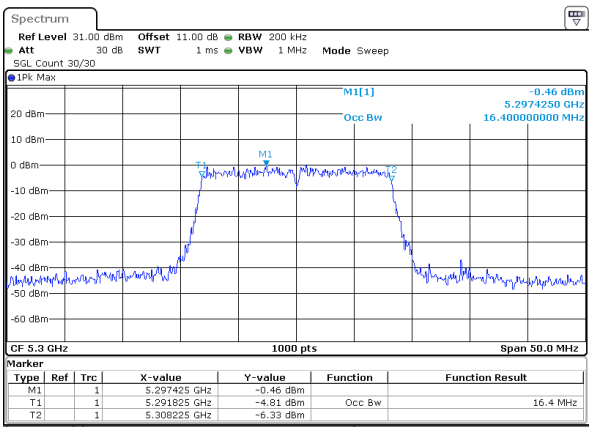


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:53:07

802.11a_5320MHz_Chain 0

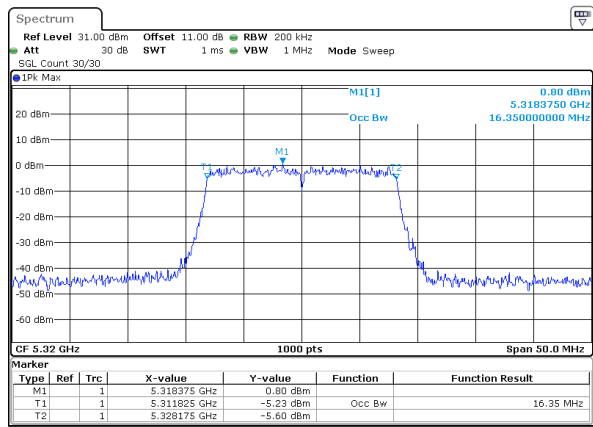


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:54:01

802.11a_5260MHz_Chain 1

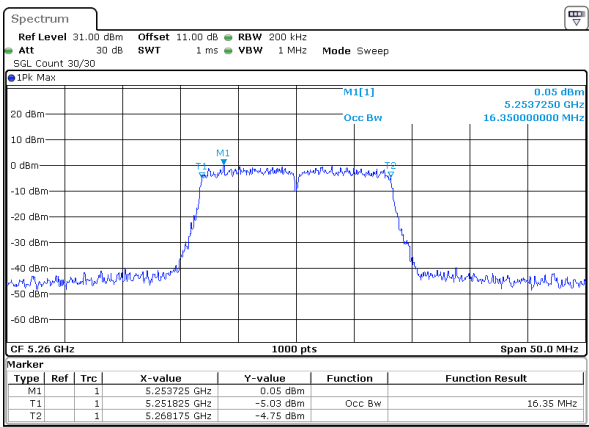


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:08:27

802.11a_5300MHz_Chain 1

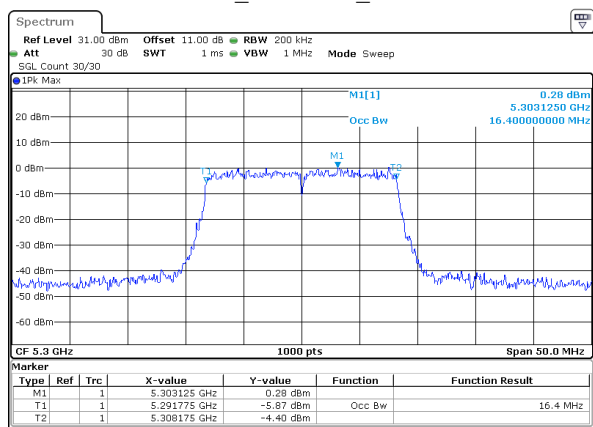


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:09:23

802.11a_5320MHz_Chain 1

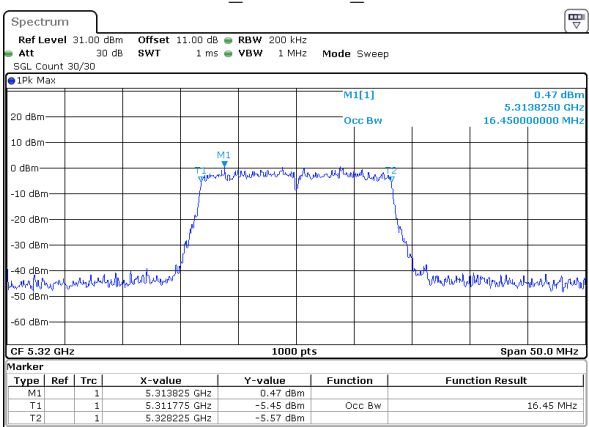


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:10:40

802.11ac20_5260MHz_Chain 0

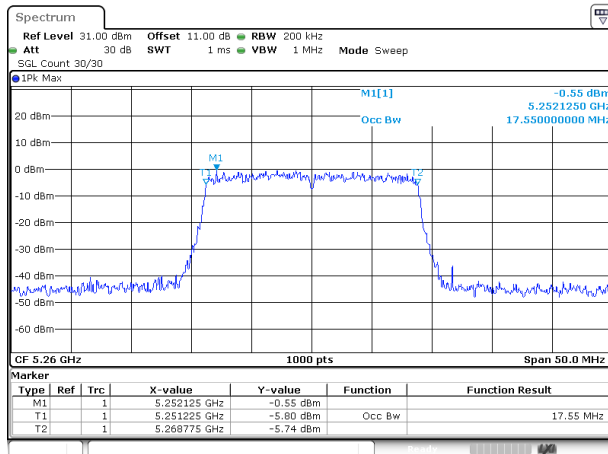


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:30:27

802.11ac20_5300MHz_Chain 0

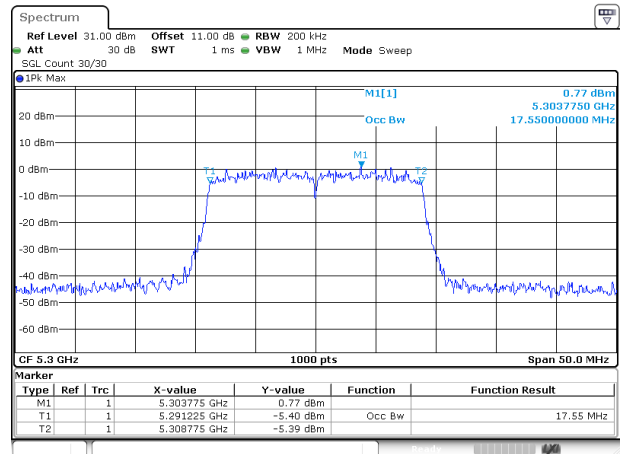


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:31:22

802.11ac20_5320MHz_Chain 0

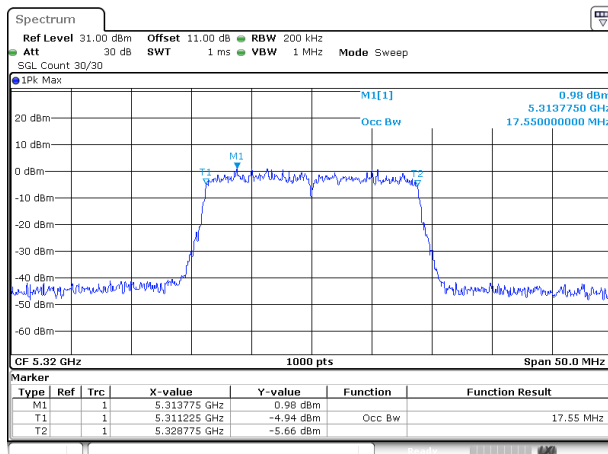


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:32:11

802.11ac20_5260MHz_Chain 1

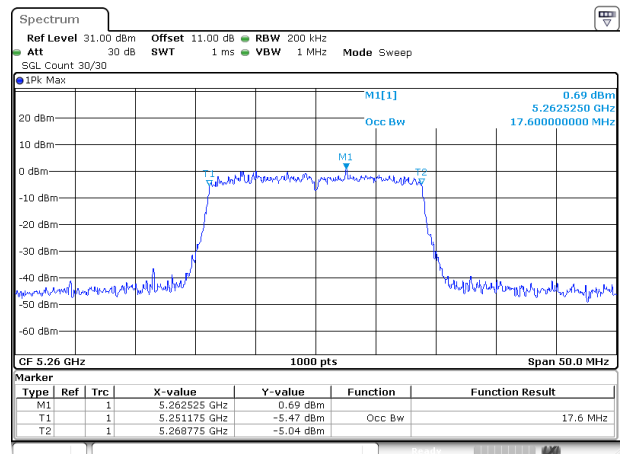


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:28:32

802.11ac20_5300MHz_Chain 1

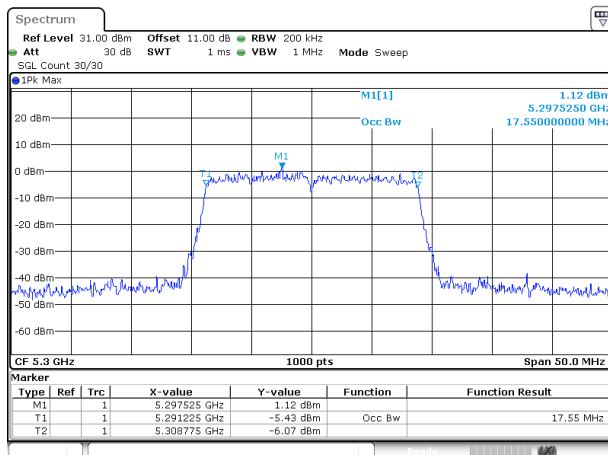


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:29:31

802.11ac20_5320MHz_Chain 1

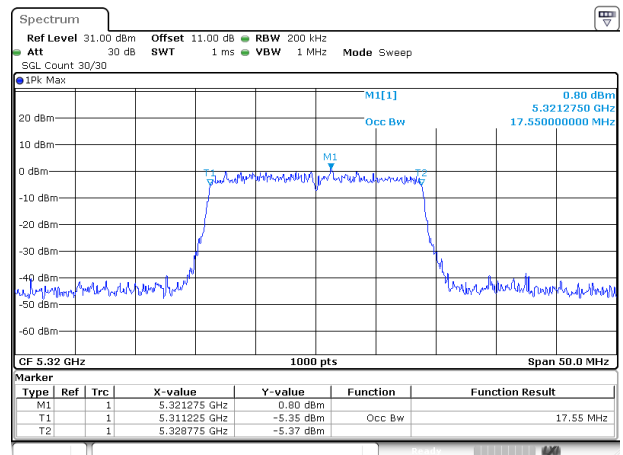


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:30:36

802.11ac40_5270MHz_Chain 0

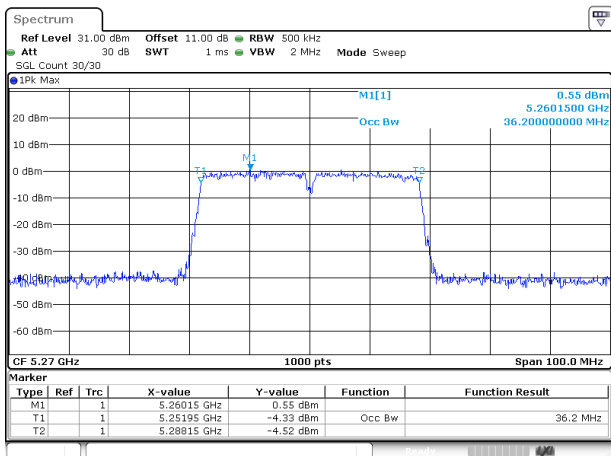


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:45:50

802.11ac40_5310MHz_Chain 0

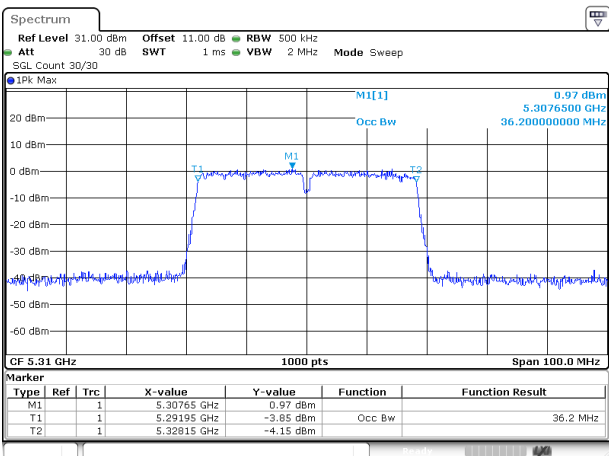


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:46:40

802.11ac40_5270MHz_Chain 1

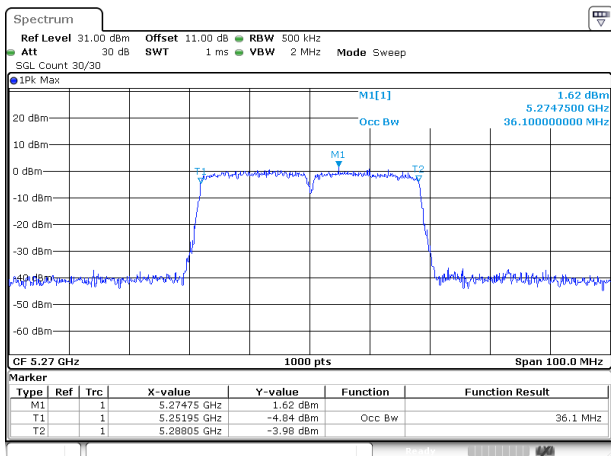


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:48:11

802.11ac40_5310MHz_Chain 1

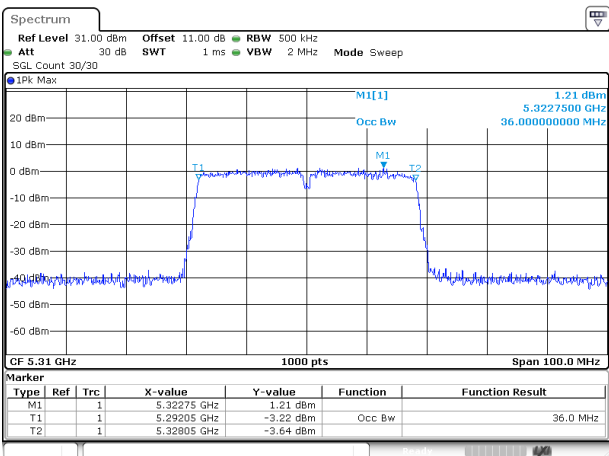


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:48:58

802.11ac80_5290MHz_Chain 0

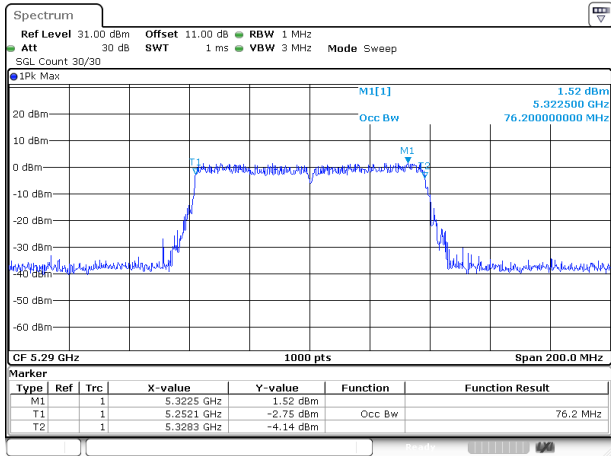


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:00:02

802.11ac80_5290MHz_Chain 1

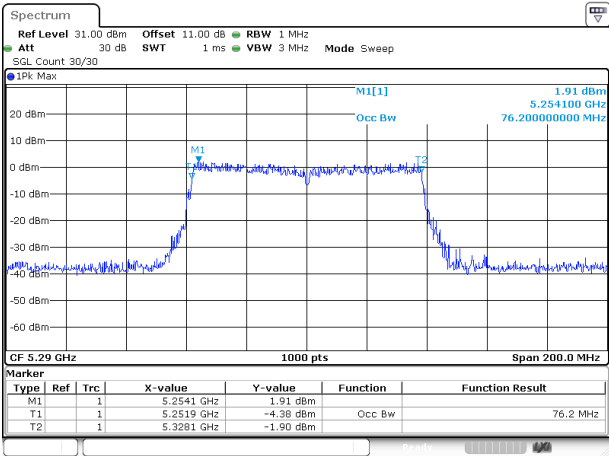


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:03:51

802.11ax20_5260MHz_RU_Full_Chain 0

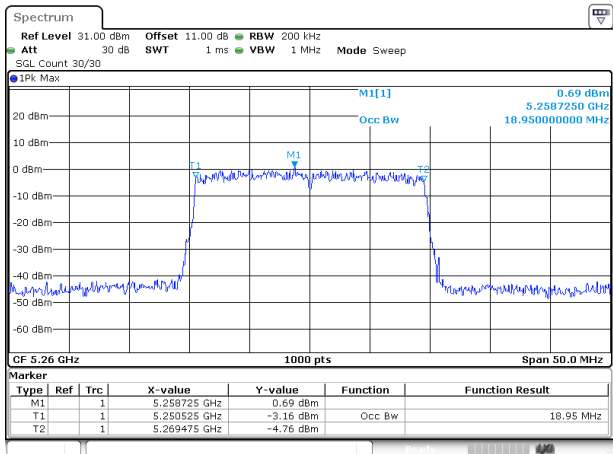


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:17:59

802.11ax20_5300MHz_RU_Full_Chain 0

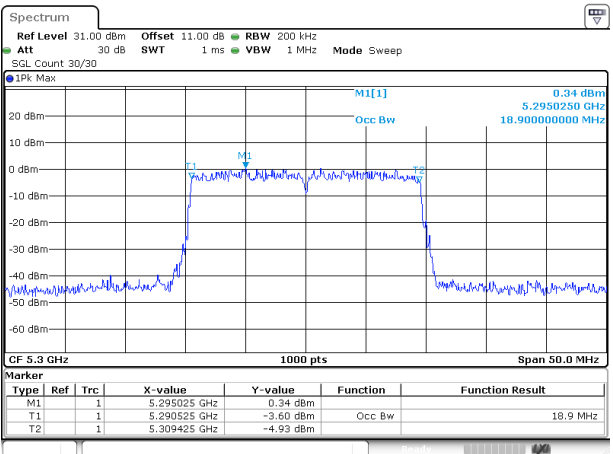


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:18:53

802.11ax20_5320MHz_RU_Full_Chain 0

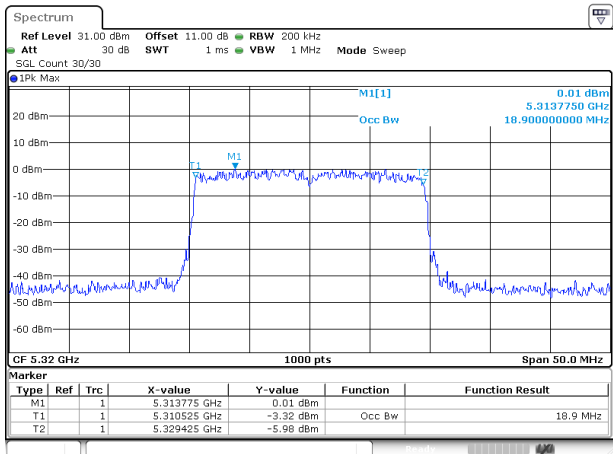


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:20:21

802.11ax20_5260MHz_RU_Full_Chain 1

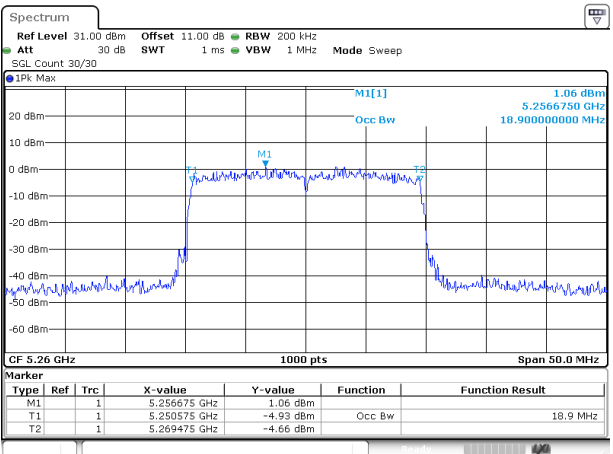


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:15:52

802.11ax20_5300MHz_RU_Full_Chain 1

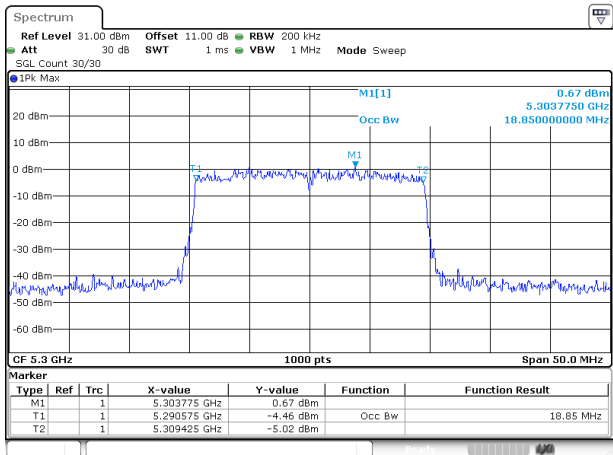


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:16:38

802.11ax20_5320MHz_RU_Full_Chain 1

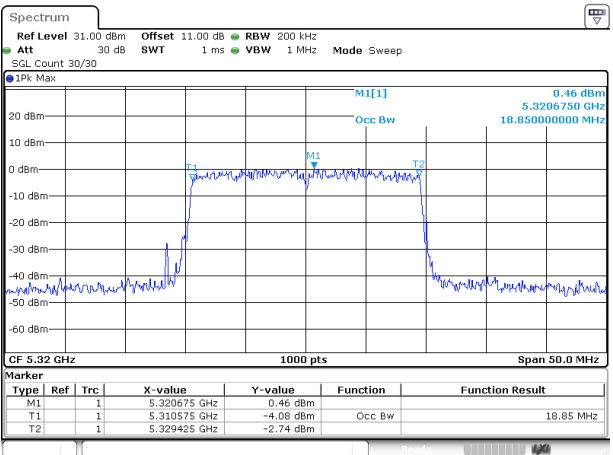


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:17:25

802.11ax40_5270MHz_RU_Full_Chain 0

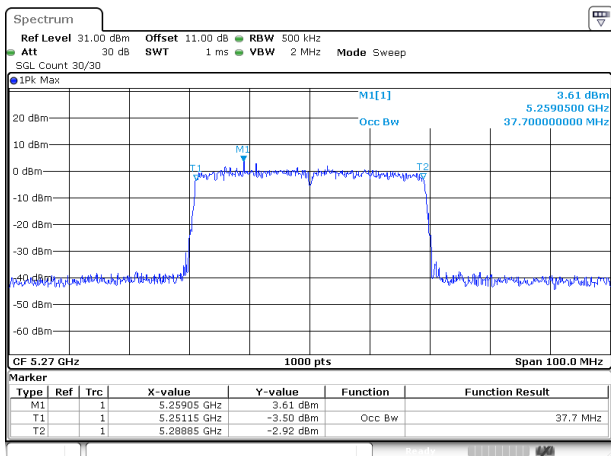


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:29:47

802.11ax40_5310MHz_RU_Full_Chain 0

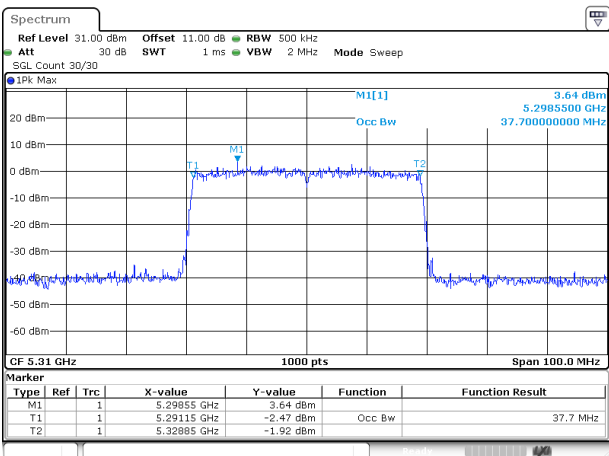


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:31:35

802.11ax40_5270MHz_RU_Full_Chain 1

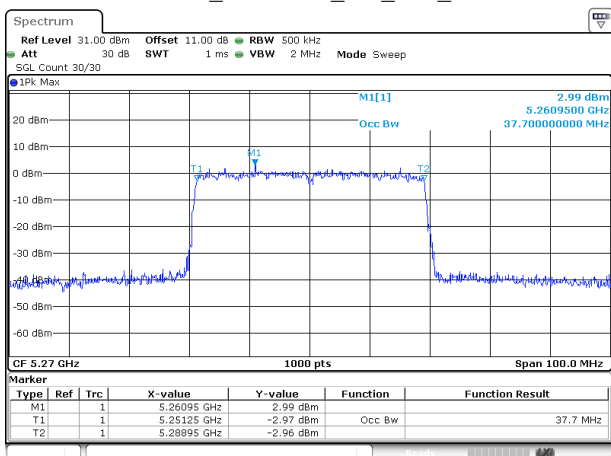


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:28:12

802.11ax40_5310MHz_RU_Full_Chain 1

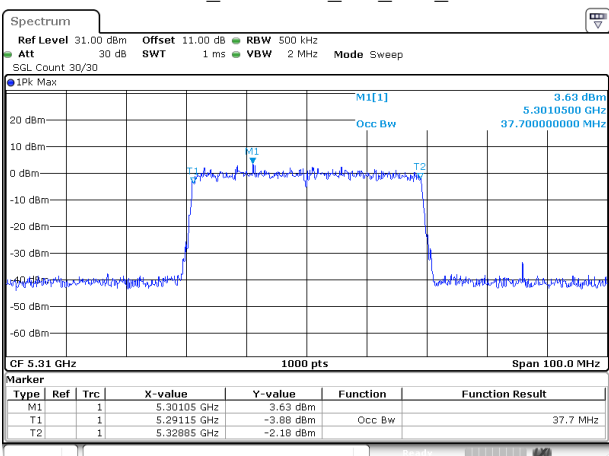


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:28:55

802.11ax80_5290MHz_RU_Full_Chain 0

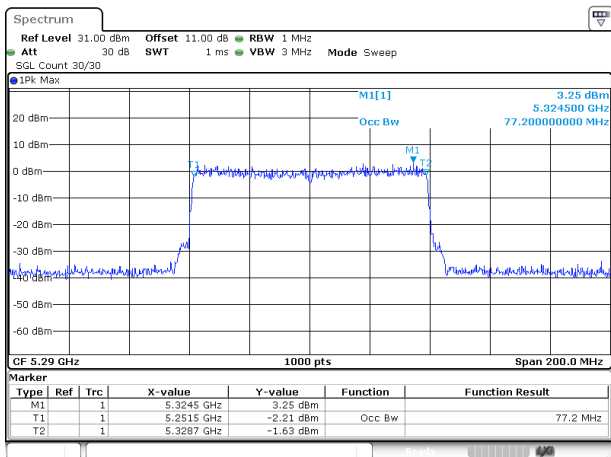

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:52:59


802.11ax80_5290MHz_RU_Full_Chain 1

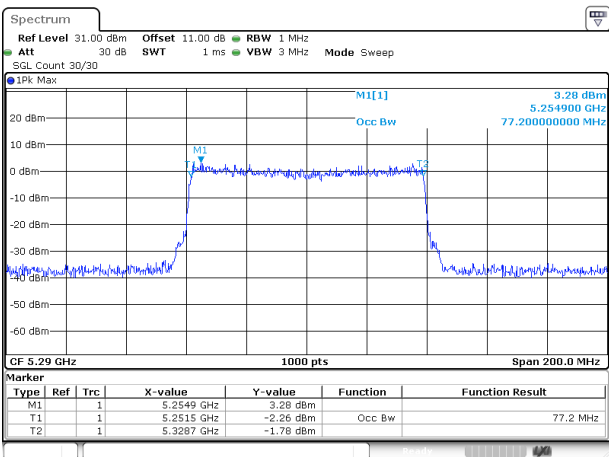

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:36:45


5470-5725MHz

802.11a_5500MHz_Chain 0

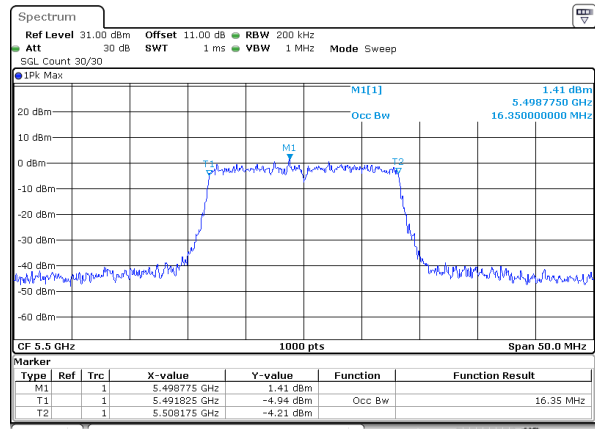


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:54:54

802.11a_5600MHz_Chain 0

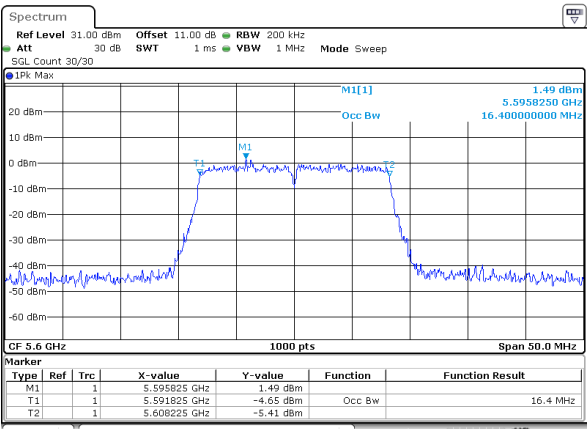


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:56:17

802.11a_5700MHz_Chain 0

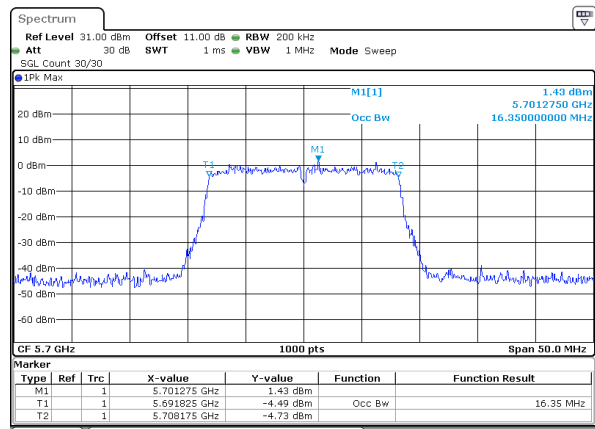


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:57:28

802.11a_5720MHz_Chain 0

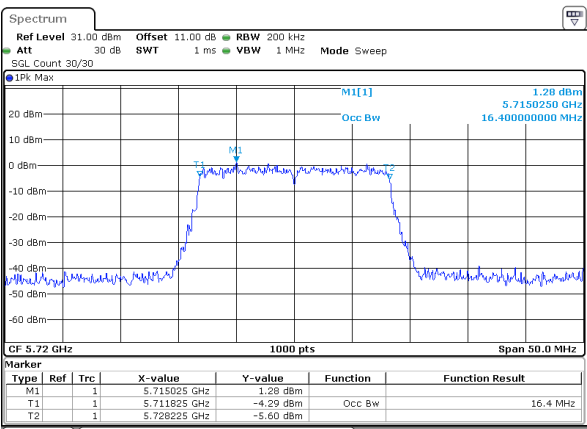


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 14:58:23

802.11a_5500MHz_Chain 1

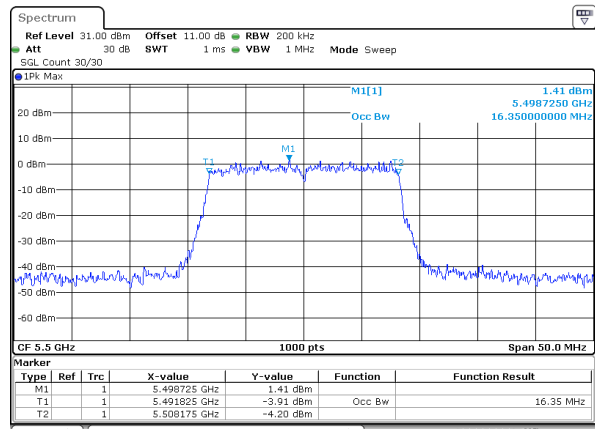


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:11:32

802.11a_5600MHz_Chain 1

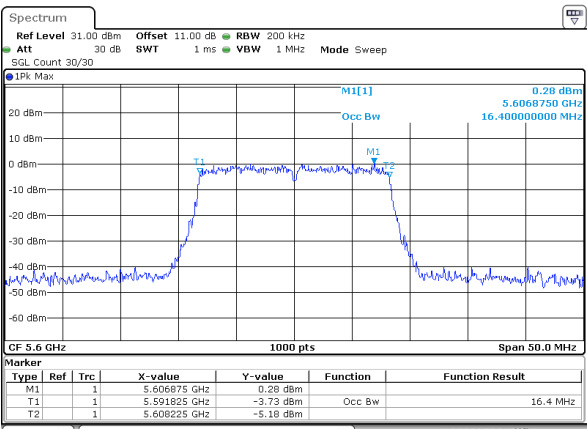


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:12:26

802.11a_5700MHz_Chain 1

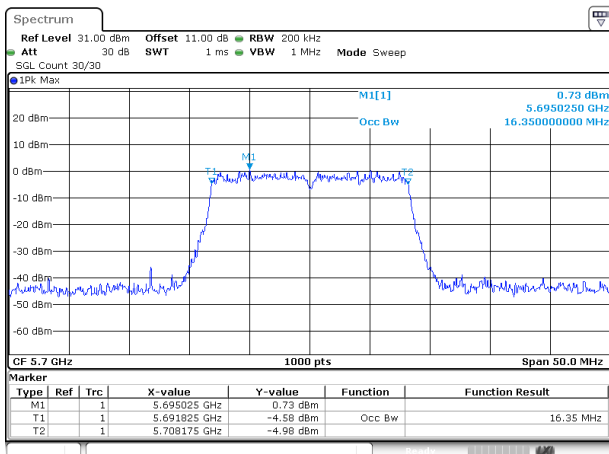


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:13:14

802.11a_5720MHz_Chain 1

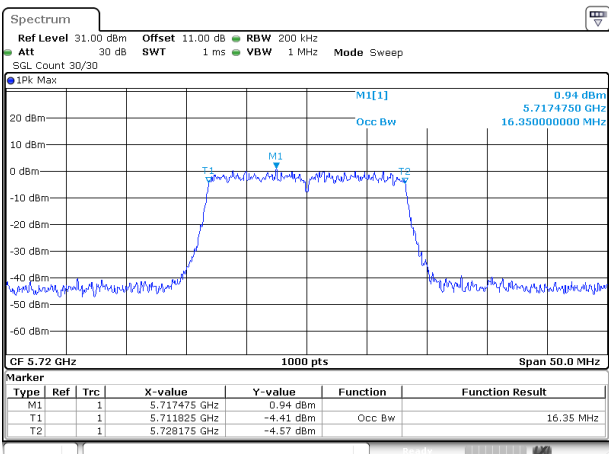


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:14:04

802.11ac20_5500MHz_Chain 0

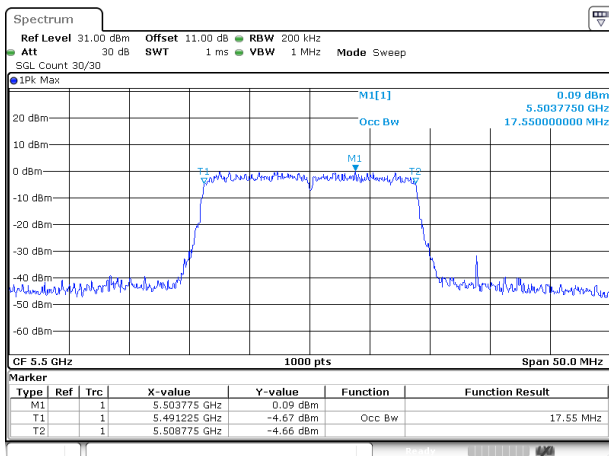


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:33:06

802.11ac20_5600MHz_Chain 0

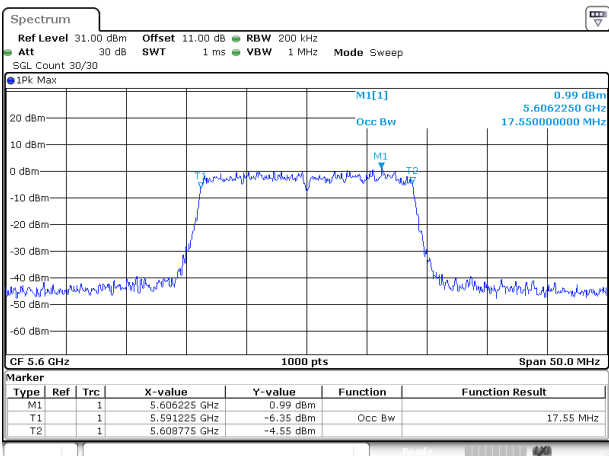


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:34:09

802.11ac20_5700MHz_Chain 0

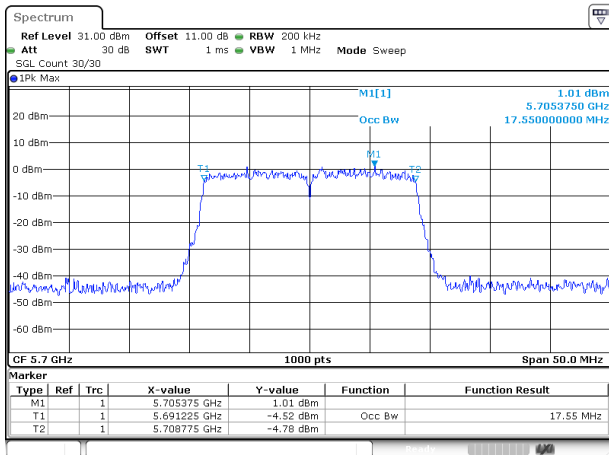


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:34:58

802.11ac20_5720MHz_Chain 0

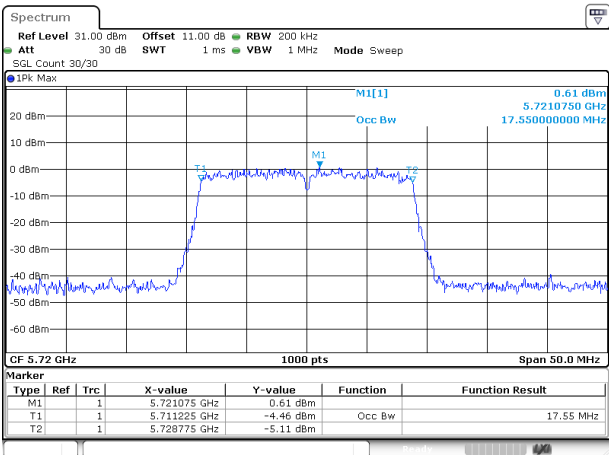


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:35:54

802.11ac20_5500MHz_Chain 1

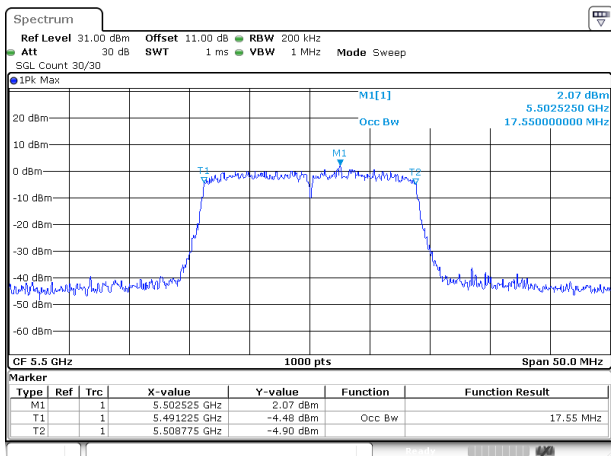


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:31:59

802.11ac20_5600MHz_Chain 1

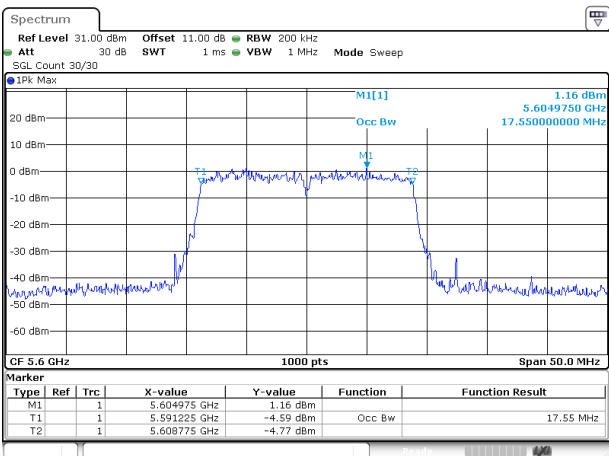


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:32:50

802.11ac20_5700MHz_Chain 1

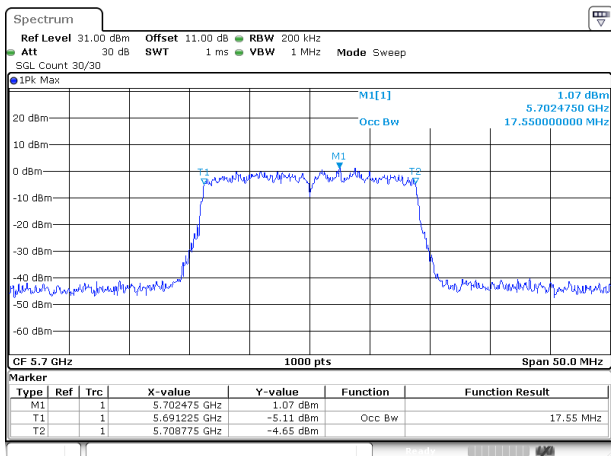


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:33:55

802.11ac20_5720MHz_Chain 1

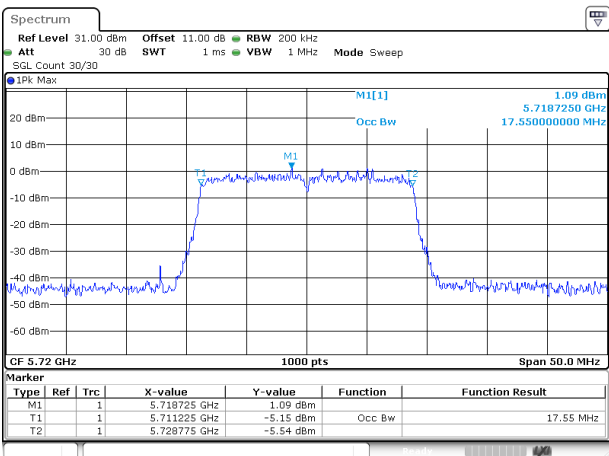


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:34:45

802.11ac40_5510MHz_Chain 0

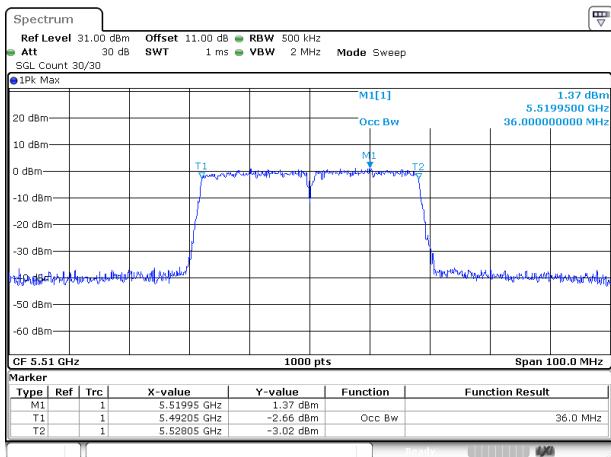


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:47:34

802.11ac40_5590MHz_Chain 0

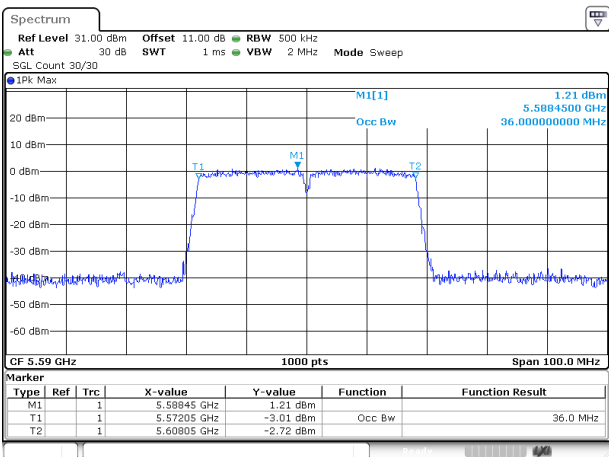


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:48:25

802.11ac40_5670MHz_Chain 0

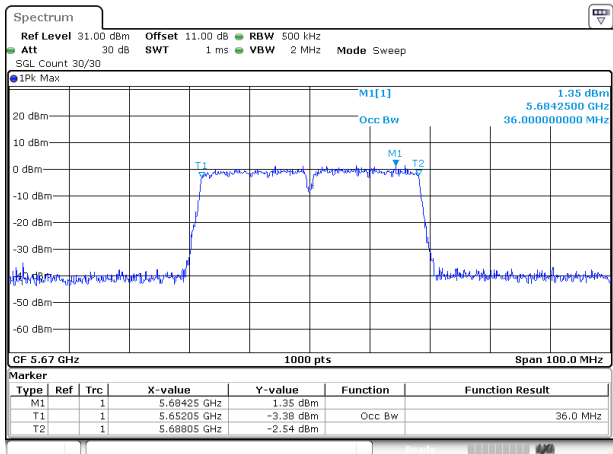


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:49:10

802.11ac40_5710MHz_Chain 0

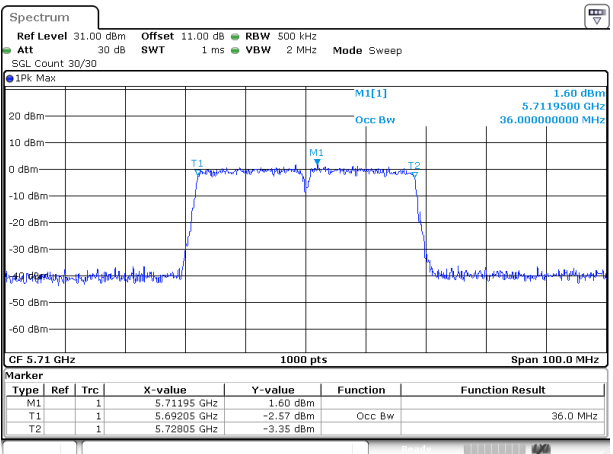


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 15:50:23

802.11ac40_5510MHz_Chain 1

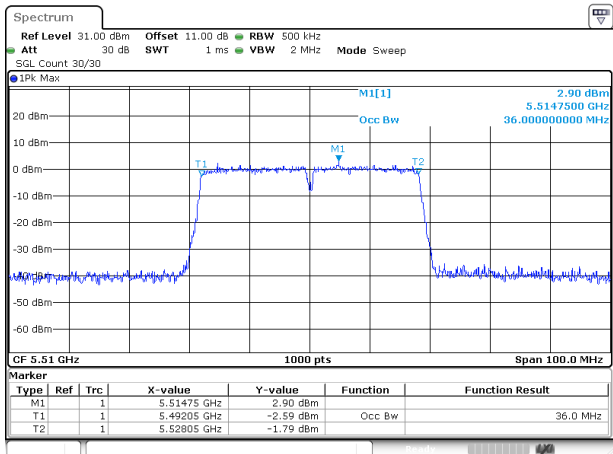


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:49:45

802.11ac40_5590MHz_Chain 1

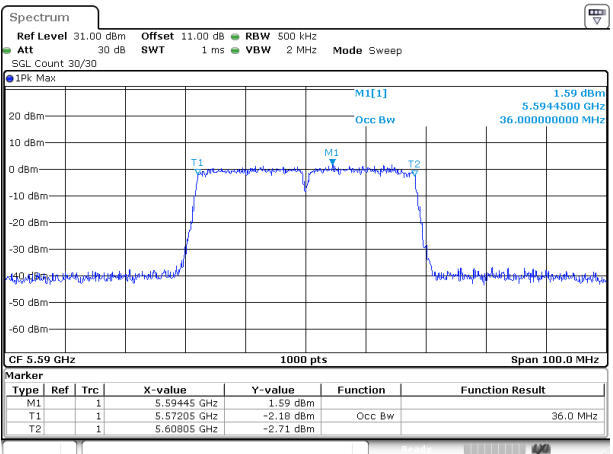


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:50:47

802.11ac40_5670MHz_Chain 1

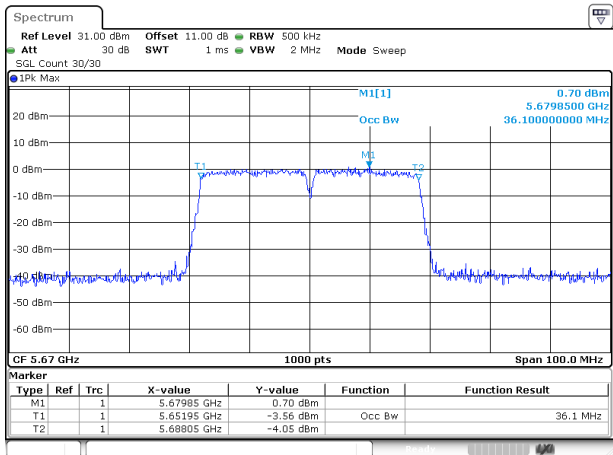


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:51:51

802.11ac40_5710MHz_Chain 1

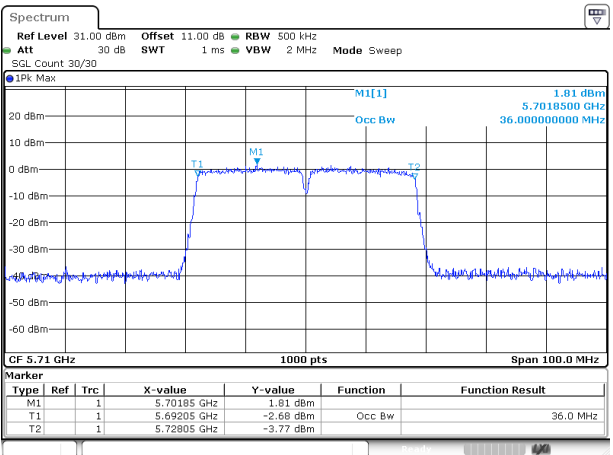


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 17:57:34

802.11ac80_5530MHz_Chain 0

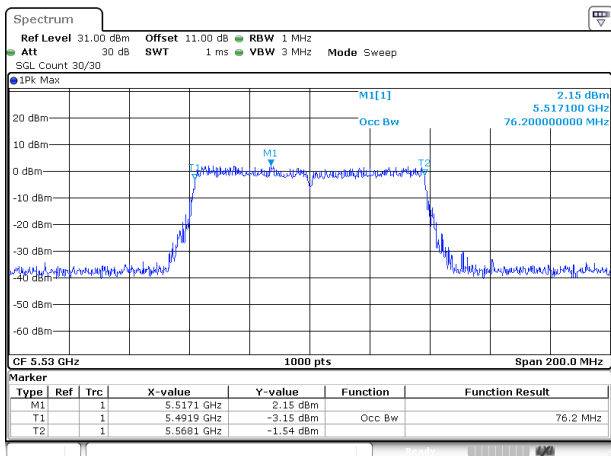


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:00:48

802.11ac80_5610MHz_Chain 0

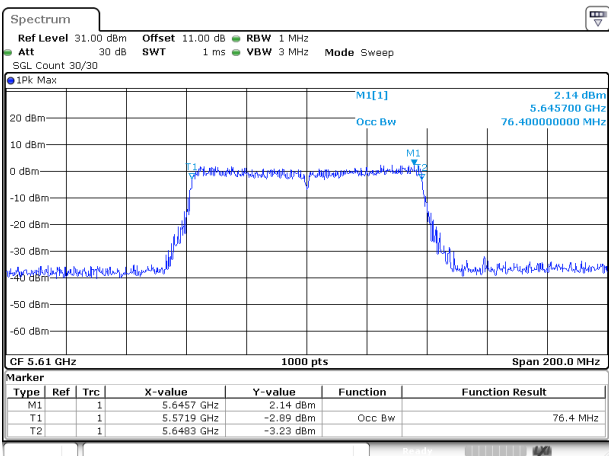


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:01:55

802.11ac80_5690MHz_Chain 0

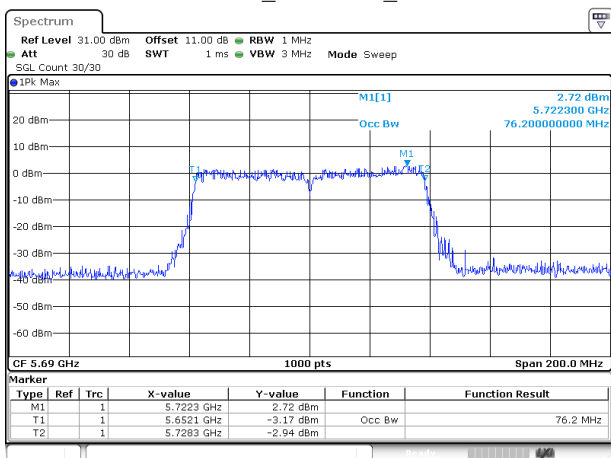


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:03:17

802.11ac80_5530MHz_Chain 1

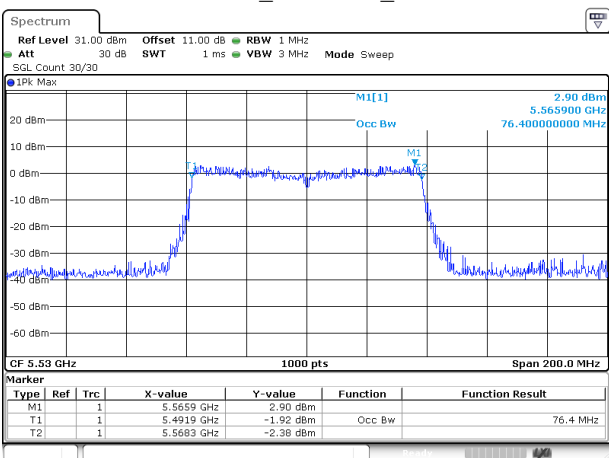


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:04:49

802.11ac80_5610MHz_Chain 1

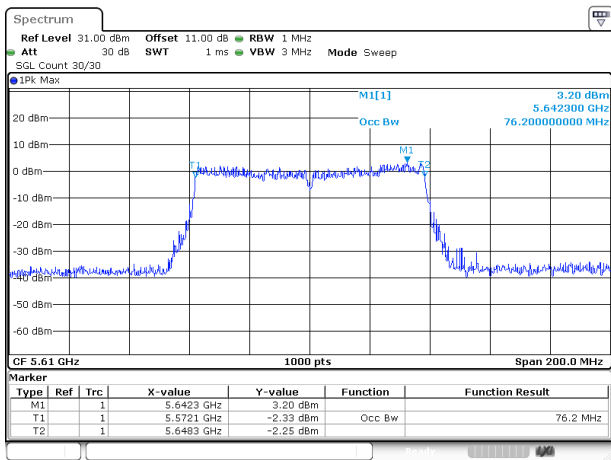


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:05:37

802.11ac80_5690MHz_Chain 1

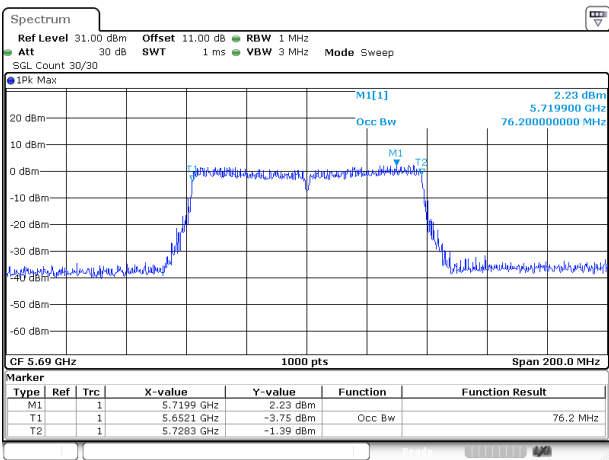


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:06:24

802.11ax20_5500MHz_RU_Full_Chain 0

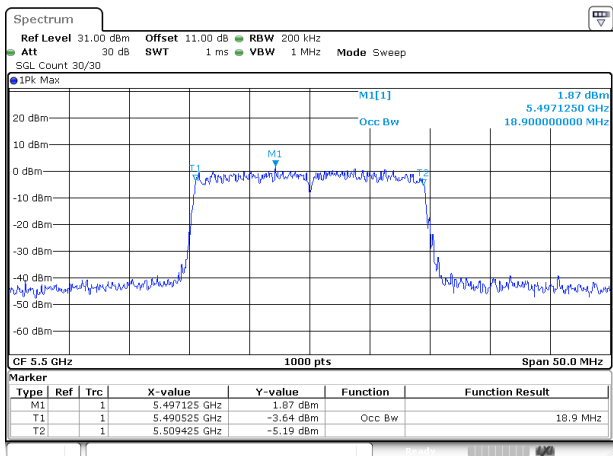


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:21:32

802.11ax20_5600MHz_RU_Full_Chain 0

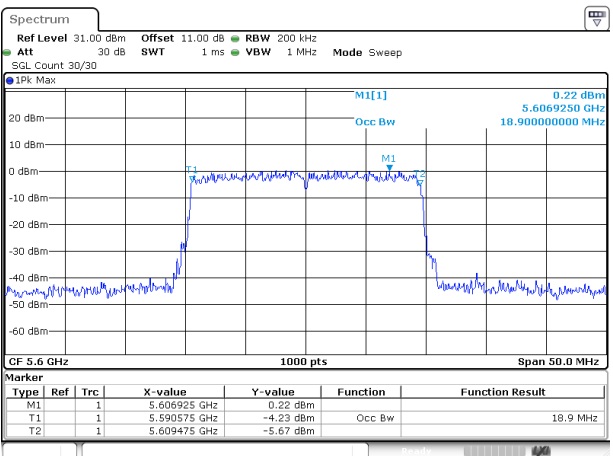


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:22:23

802.11ax20_5700MHz_RU_Full_Chain 0

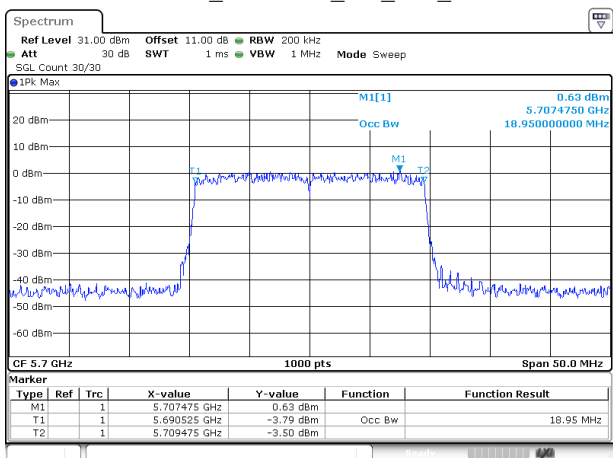


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:23:27

802.11ax20_5720MHz_RU_Full_Chain 0

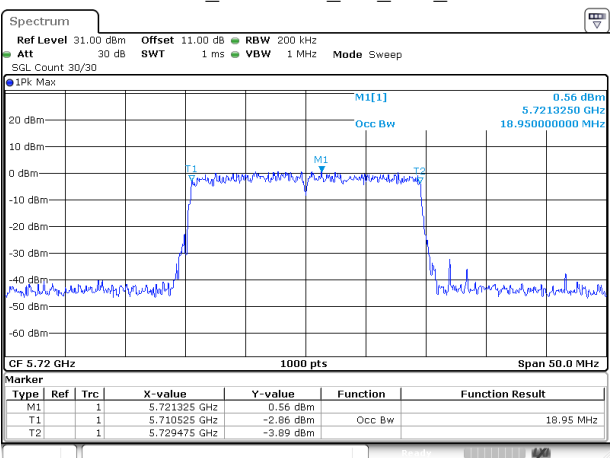


ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 16:24:24

802.11ax20_5500MHz_RU_Full_Chain 1

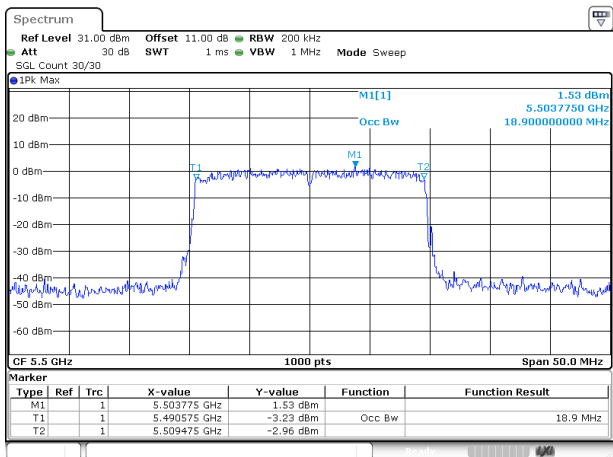

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:18:12

802.11ax20_5600MHz_RU_Full_Chain 1

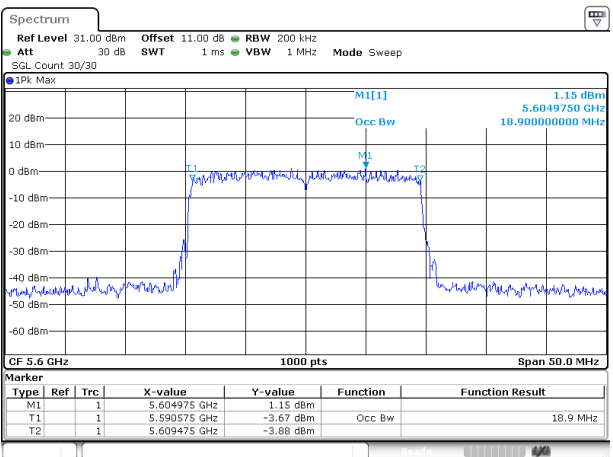

ProjectNo.:2601S14996E-RF Tester:Cheeb Huang
Date: 4.MAY.2026 18:19:00