




802.11n(HT20) HCH 5700MHz Ant1 NTN

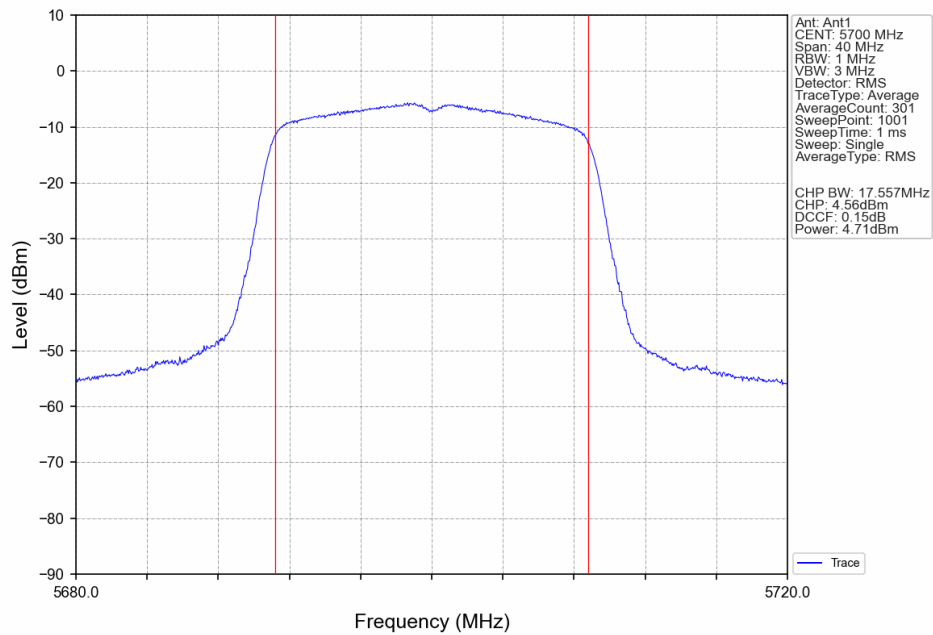


802.11n(HT20) LCH 5745MHz Ant1 NTN

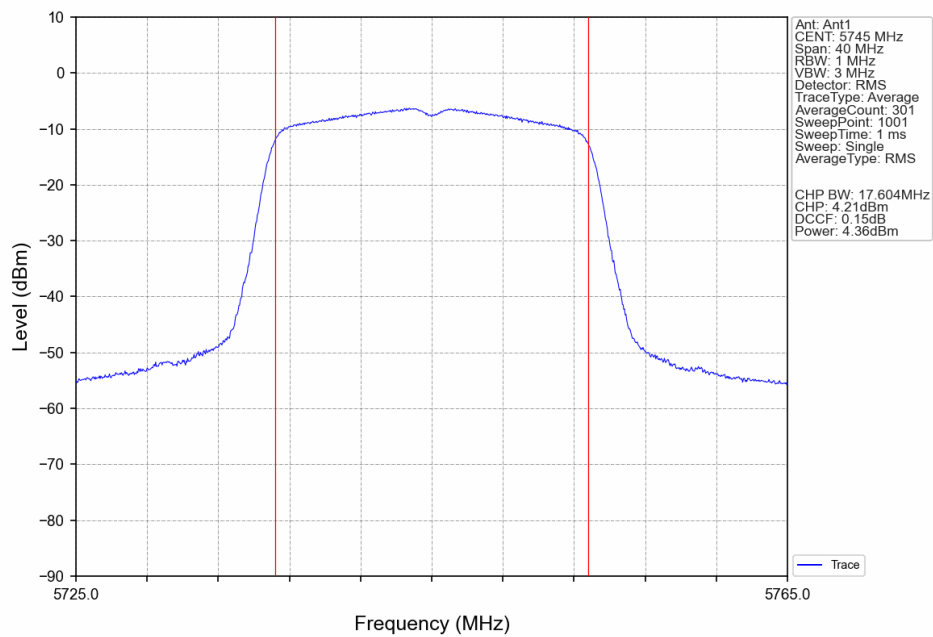


802.11n(HT20) MCH 5785MHz Ant1 NTNV

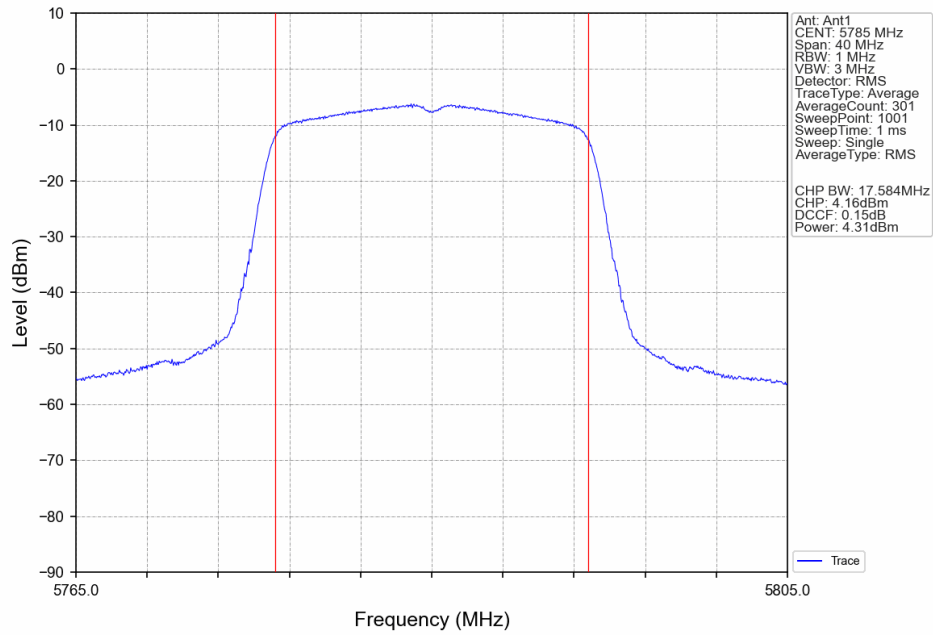


802.11n(HT20) HCH 5825MHz Ant1 NTNV

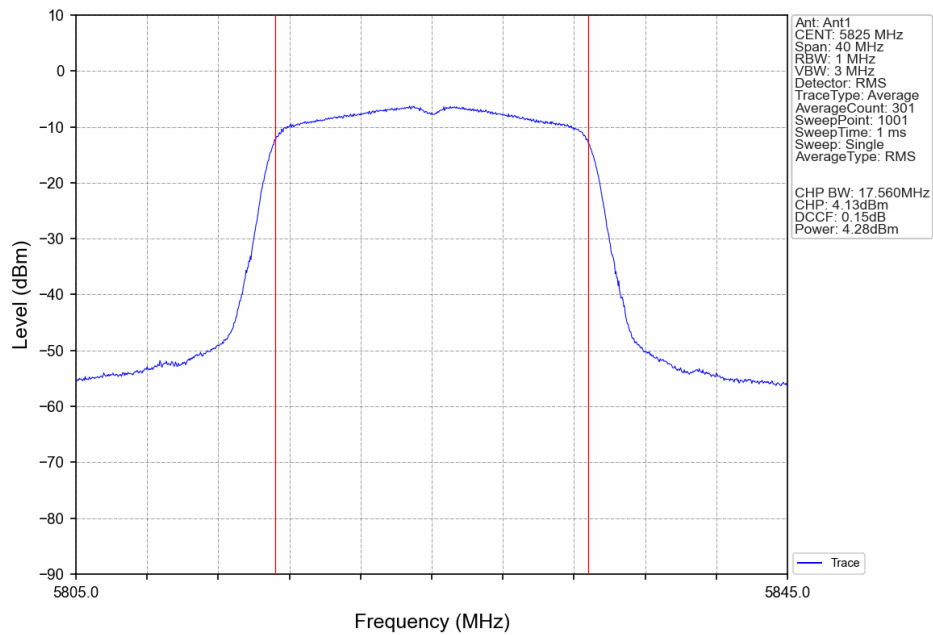


802.11n(HT40) LCH 5190MHz Ant1 NTN

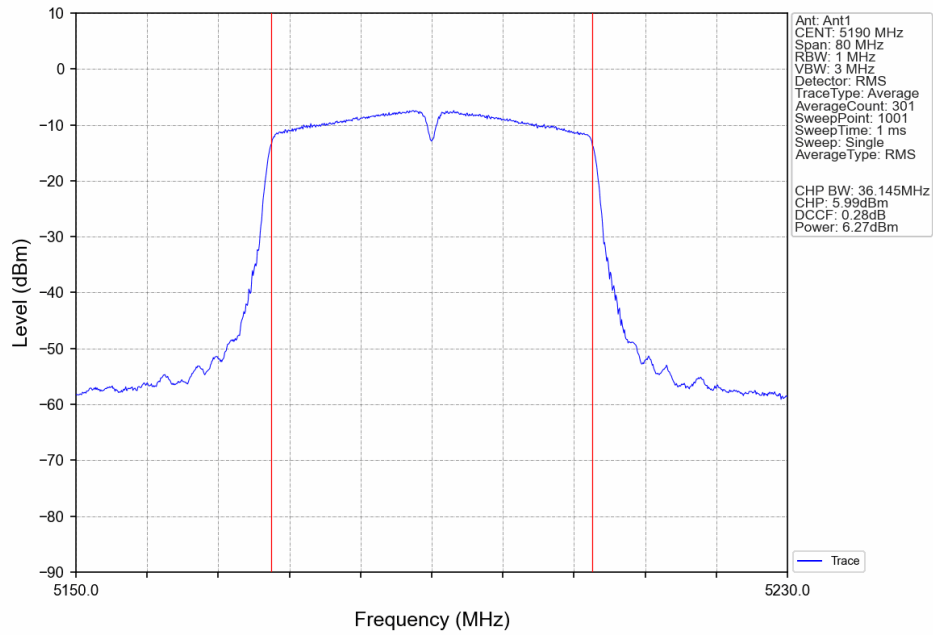


802.11n(HT40) HCH 5230MHz Ant1 NTN

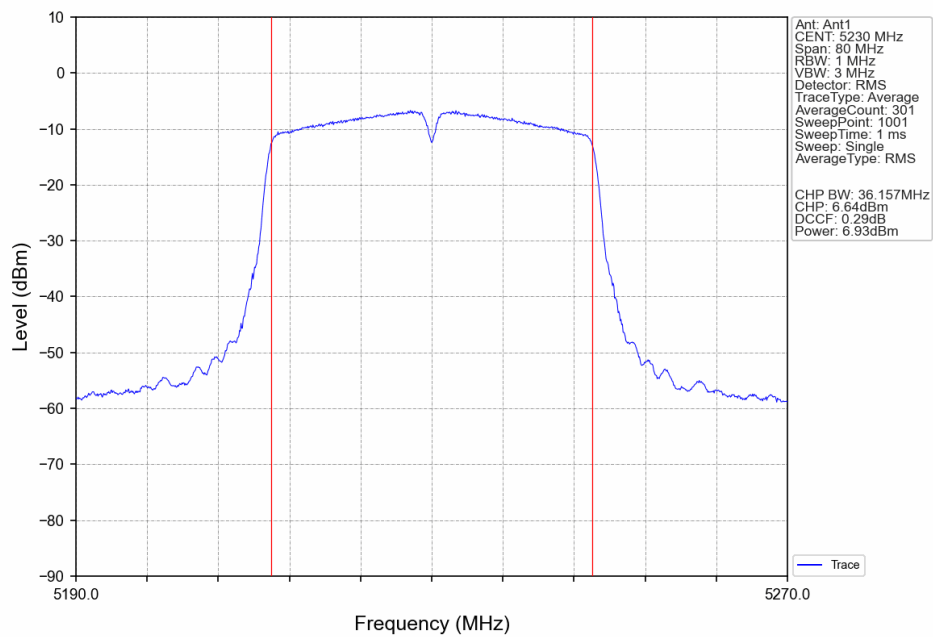


802.11n(HT40) LCH 5270MHz Ant1 NTV

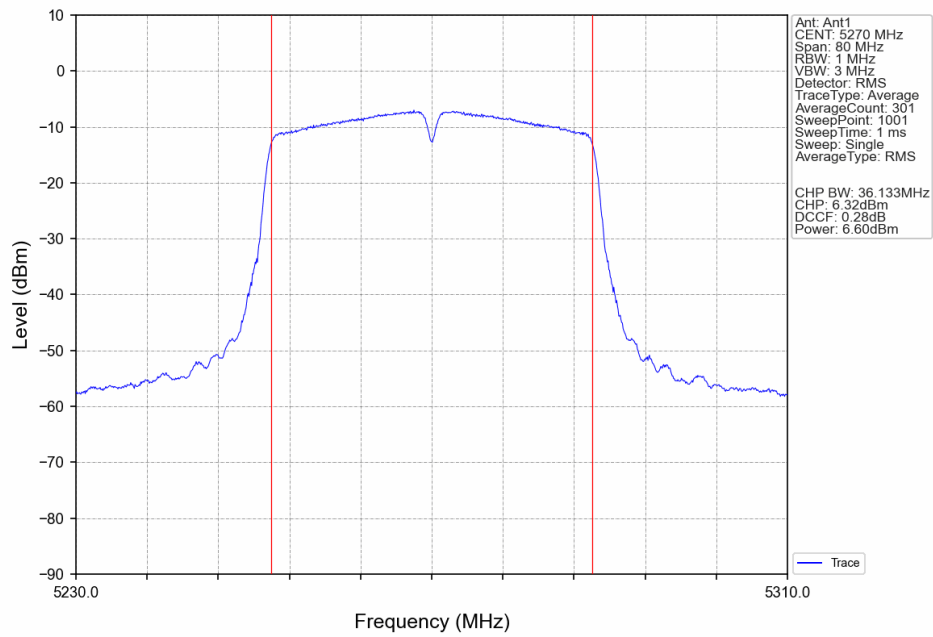


802.11n(HT40) HCH 5310MHz Ant1 NTV

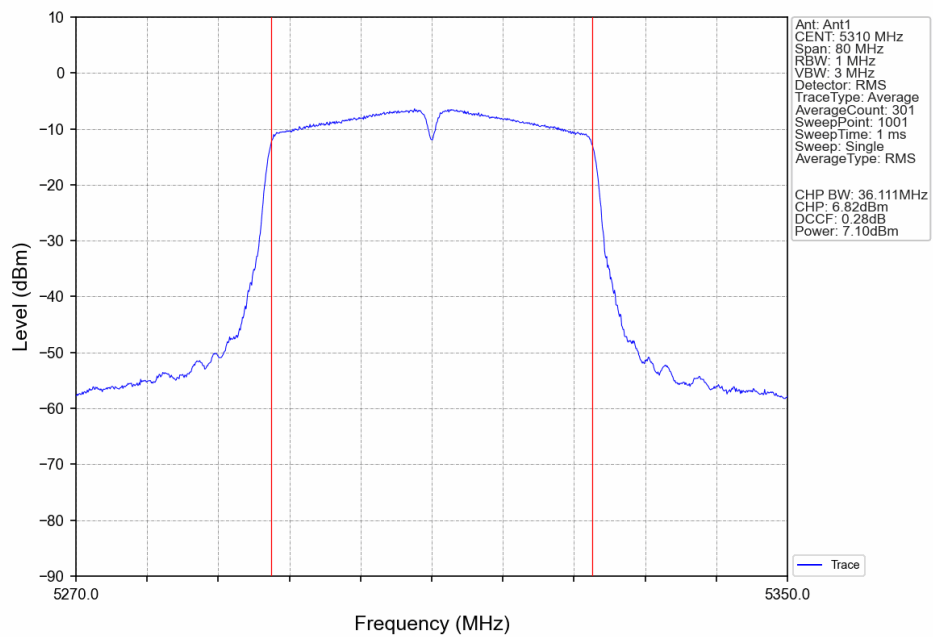


802.11n(HT40) LCH 5510MHz Ant1 NTN

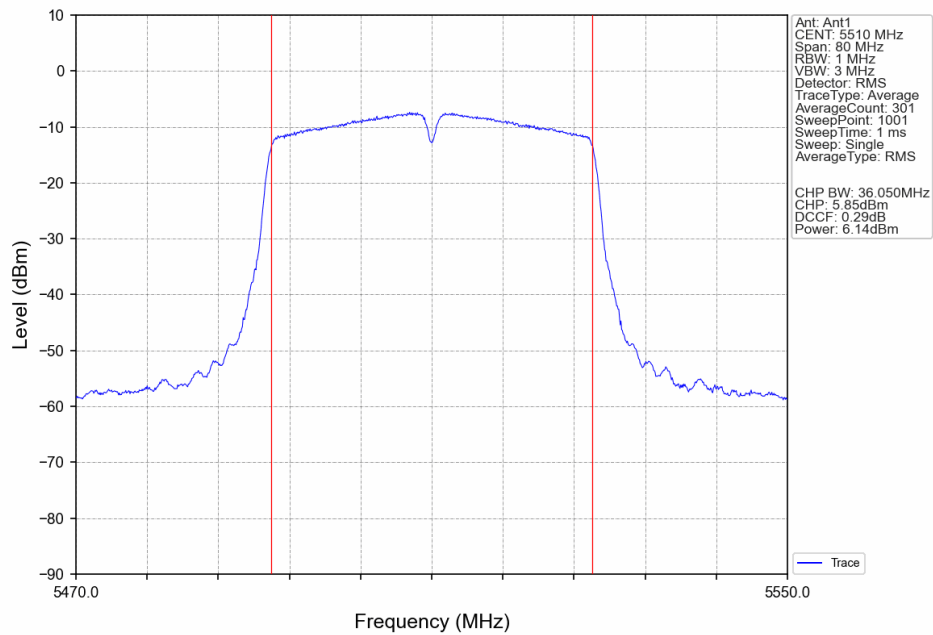


802.11n(HT40) MCH 5550MHz Ant1 NTN

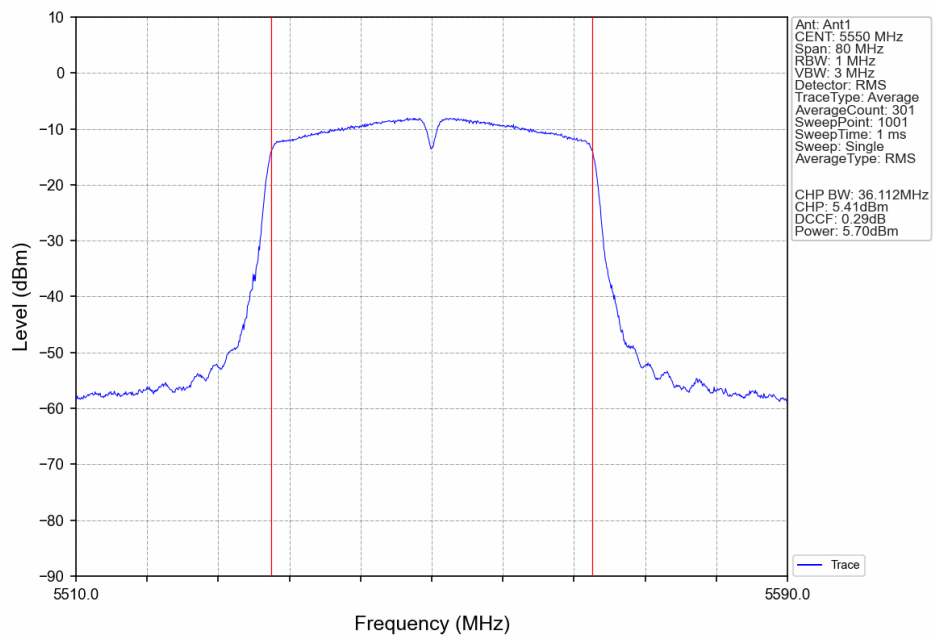


802.11n(HT40) HCH 5670MHz Ant1 NTN

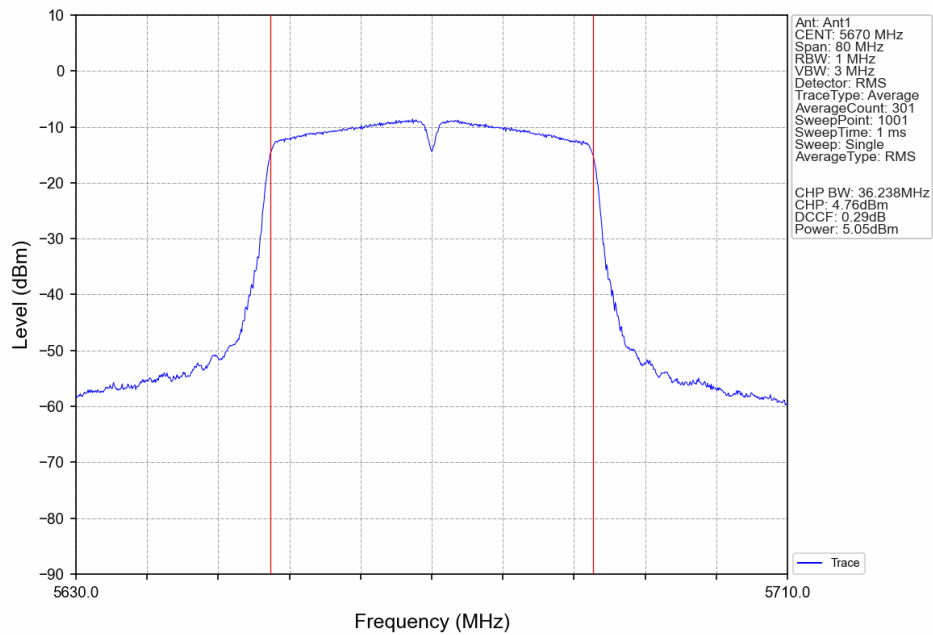


802.11n(HT40) LCH 5755MHz Ant1 NTN

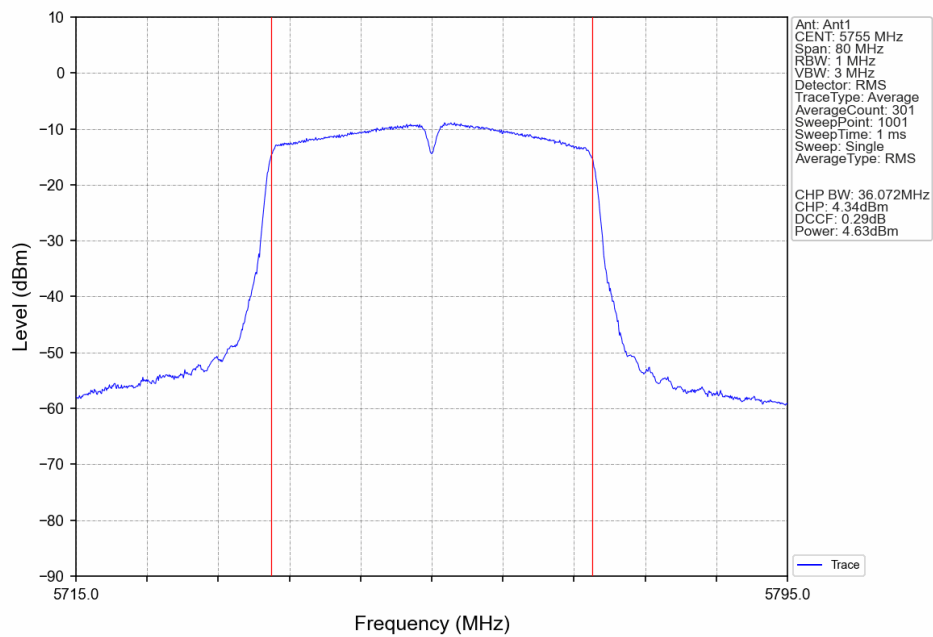


802.11n(HT40) HCH 5795MHz Ant1 NTN

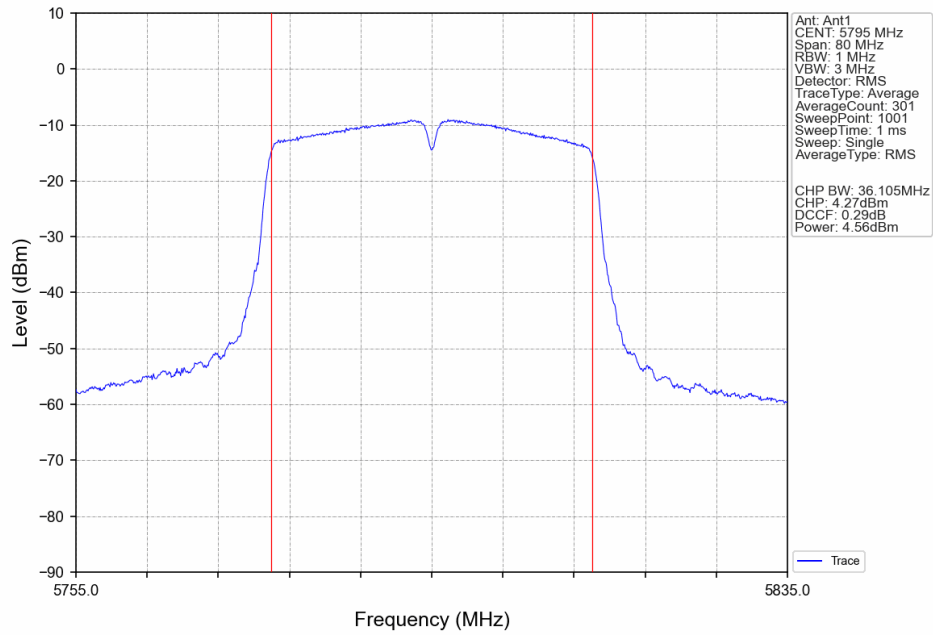


802.11ac(VHT20) LCH 5180MHz Ant1 NTN

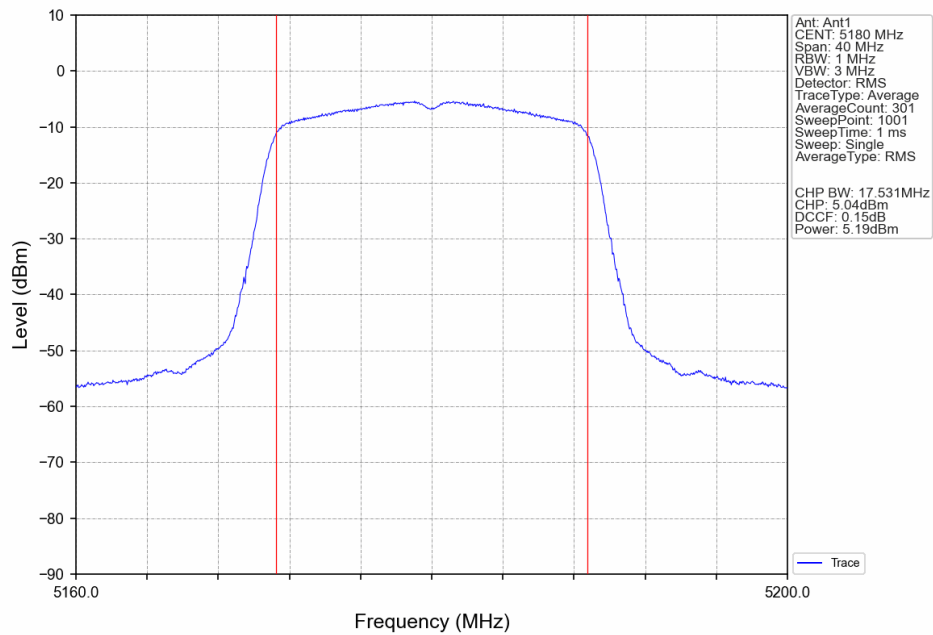


802.11ac(VHT20) MCH 5200MHz Ant1 NTN

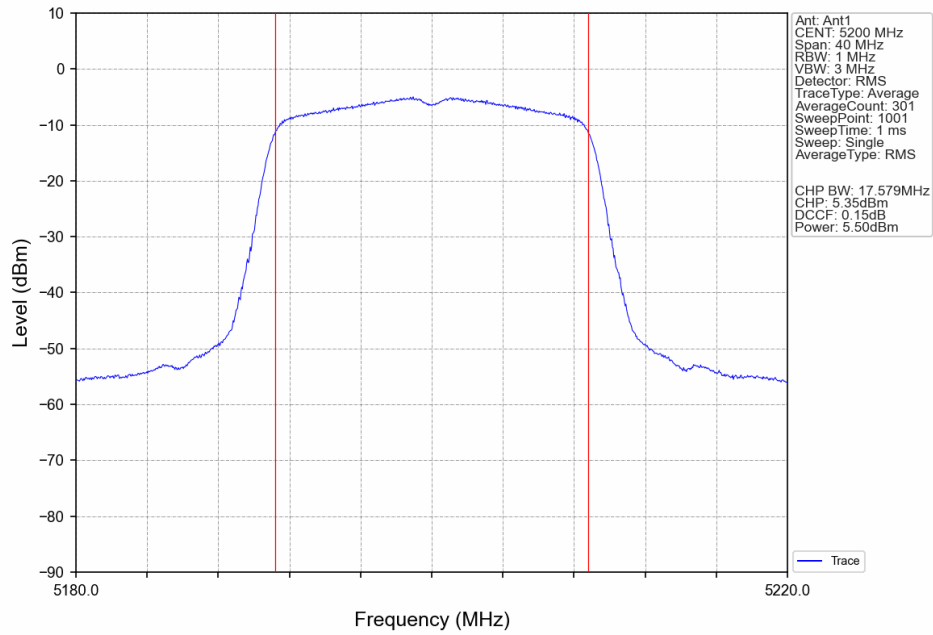


802.11ac(VHT20) HCH 5240MHz Ant1 NTN

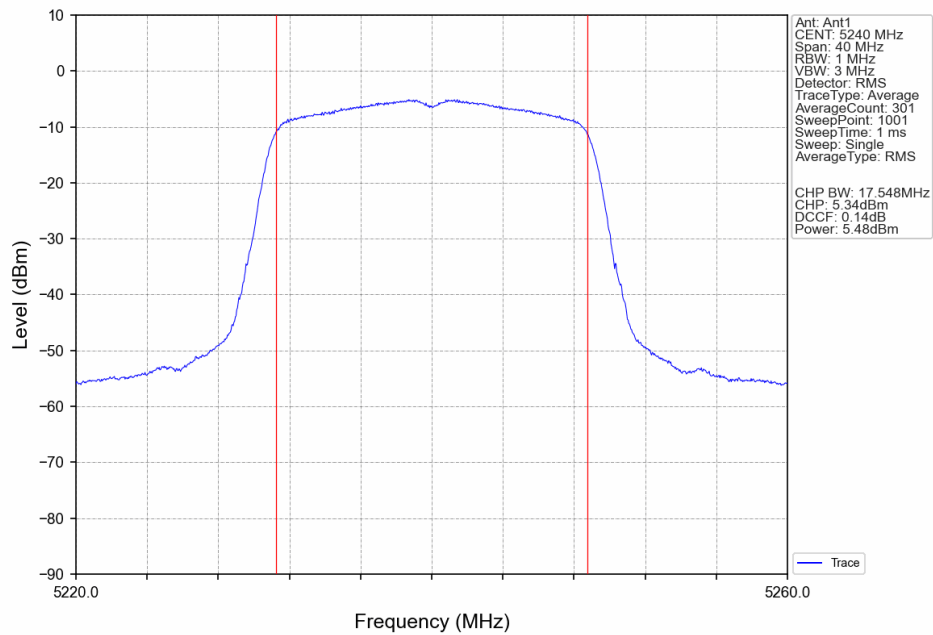


802.11ac(VHT20) LCH 5260MHz Ant1 NTN

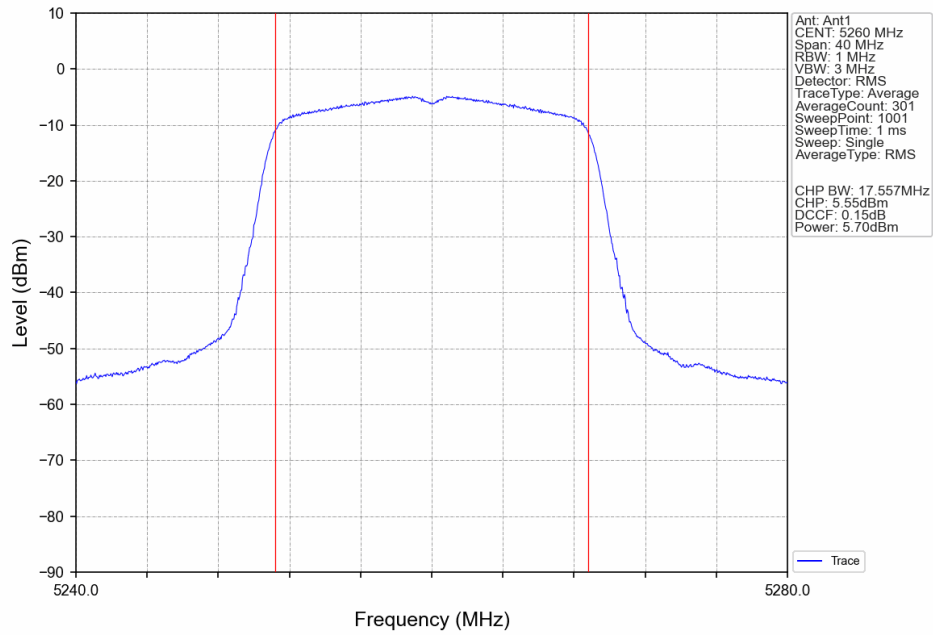


802.11ac(VHT20) MCH 5300MHz Ant1 NTN

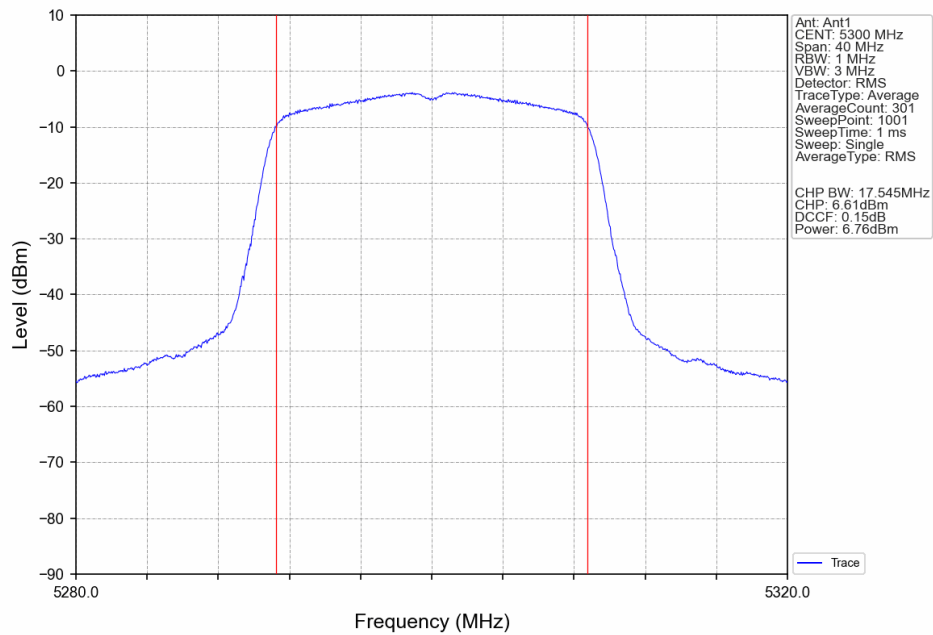


802.11ac(VHT20) HCH 5320MHz Ant1 NTN

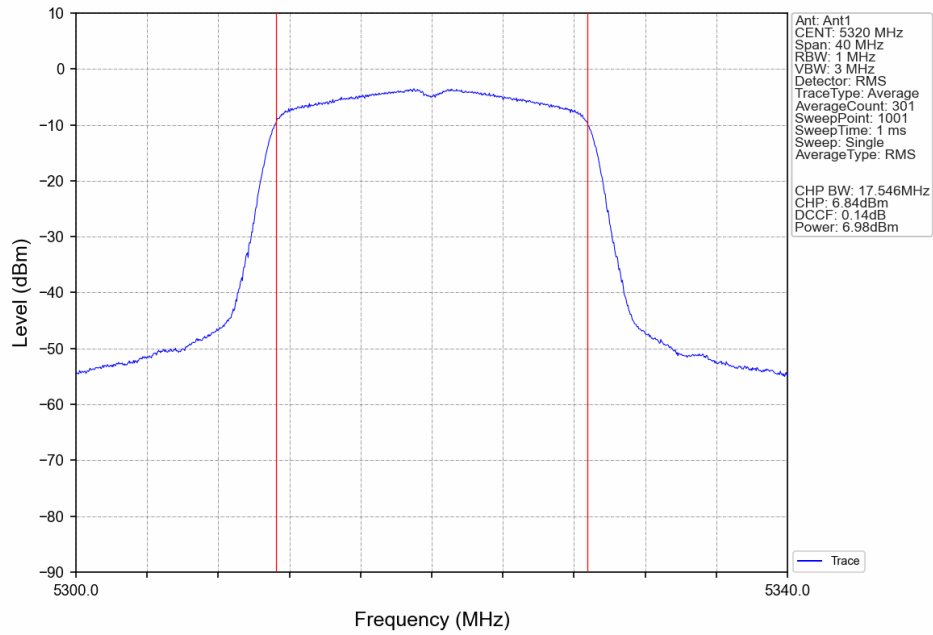


802.11ac(VHT20) LCH 5500MHz Ant1 NTN

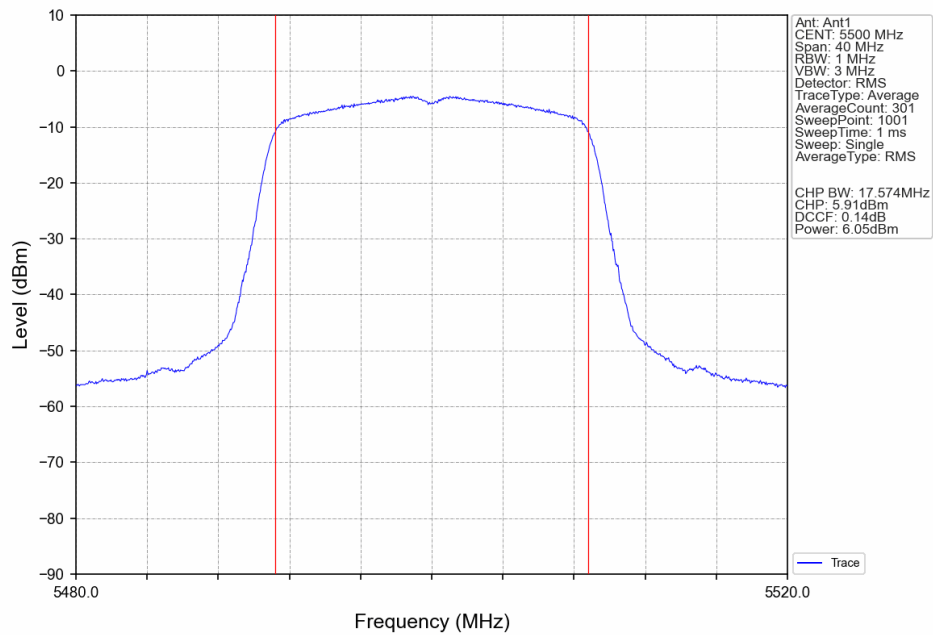


802.11ac(VHT20) MCH 5580MHz Ant1 NTNV

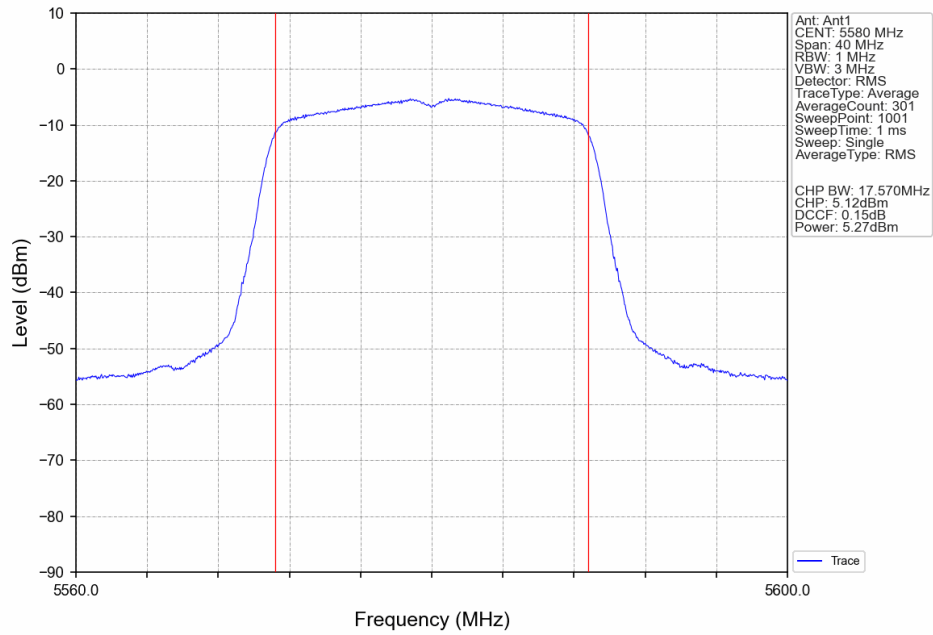


802.11ac(VHT20) HCH 5700MHz Ant1 NTNV

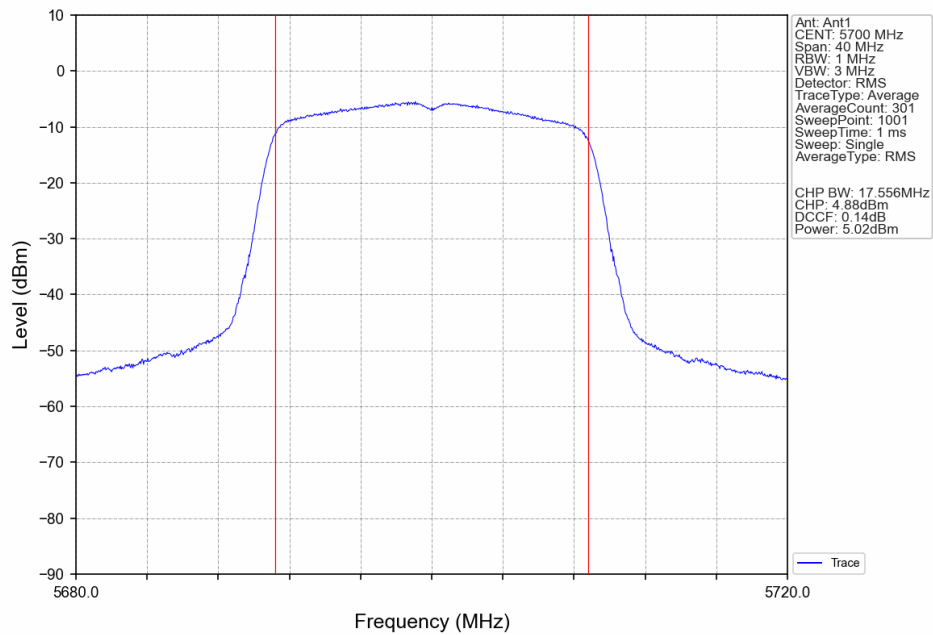


802.11ac(VHT20) LCH 5745MHz Ant1 NTN

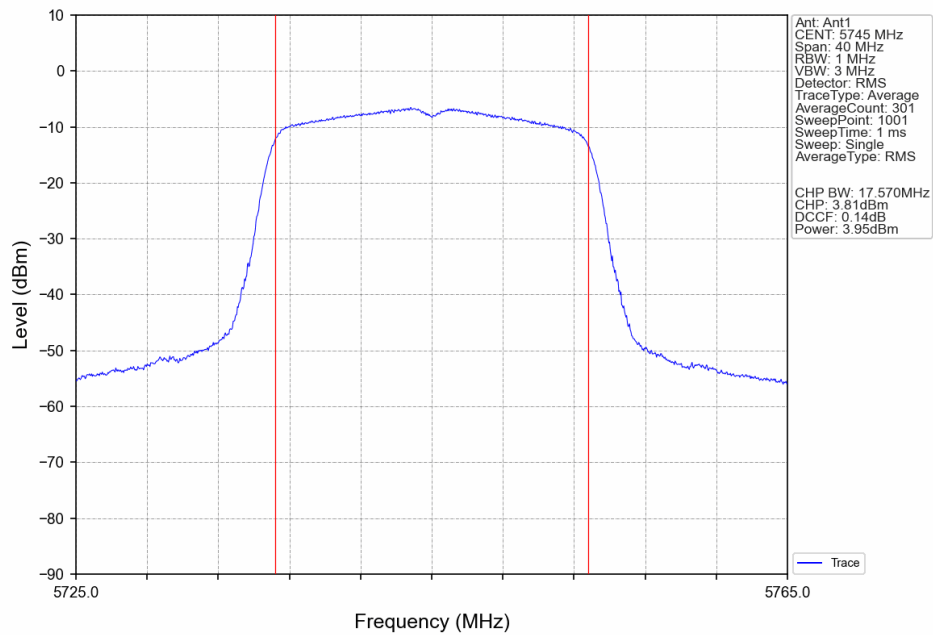


802.11ac(VHT20) MCH 5785MHz Ant1 NTN

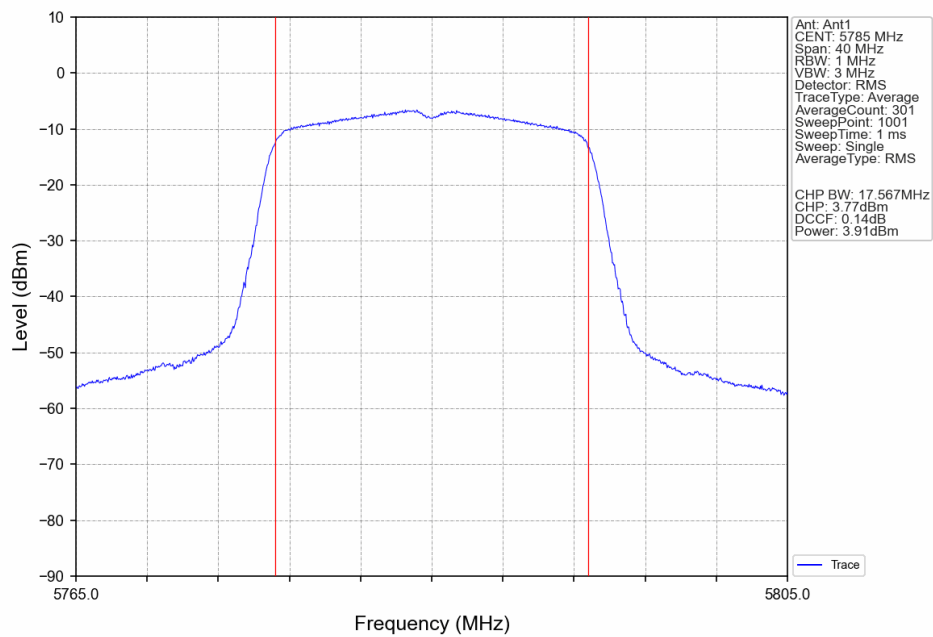


802.11ac(VHT20) HCH 5825MHz Ant1 NTN

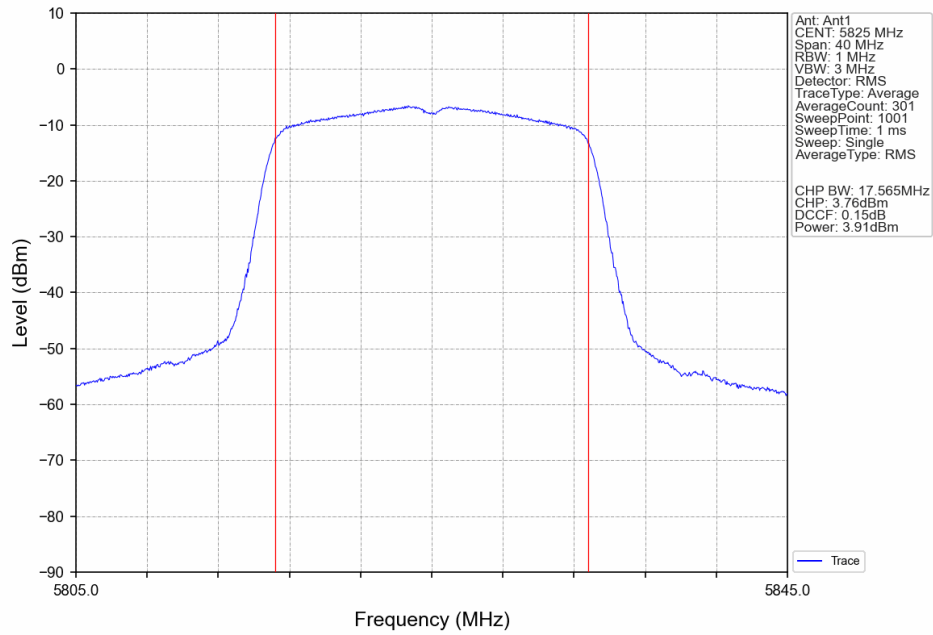


802.11ac(VHT40) LCH 5190MHz Ant1 NTN

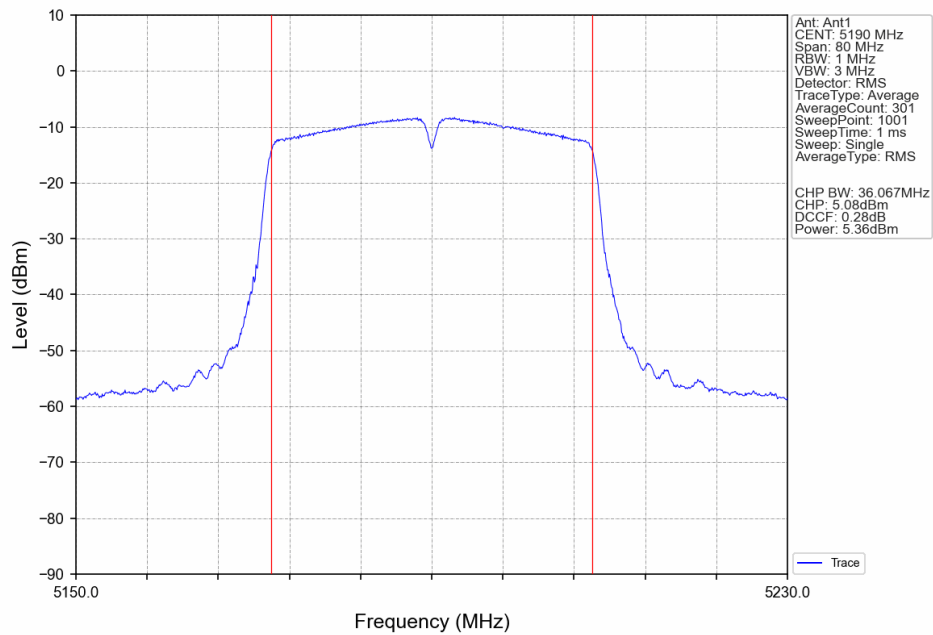


802.11ac(VHT40) HCH 5230MHz Ant1 NTN

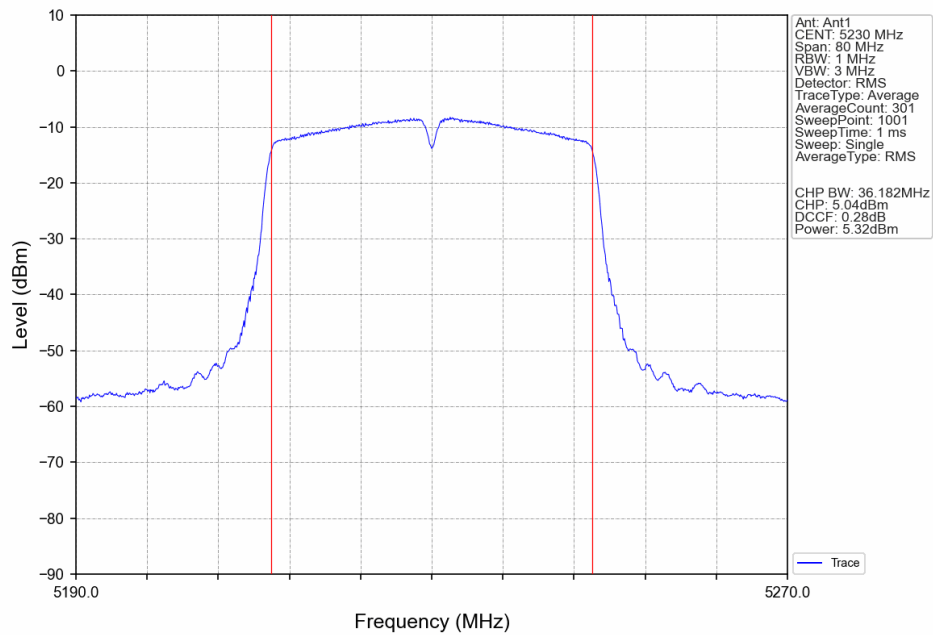


802.11ac(VHT40) LCH 5270MHz Ant1 NTN

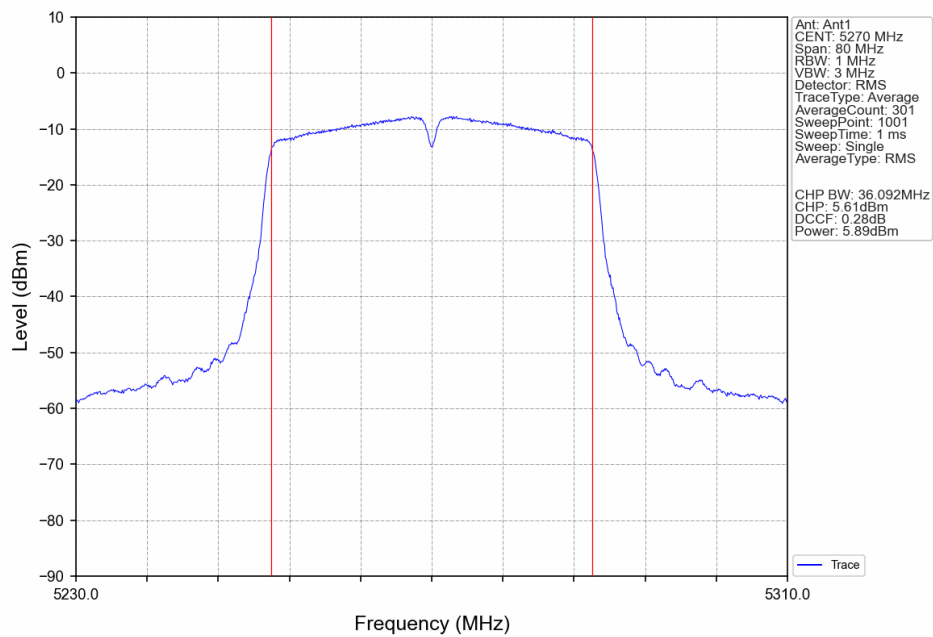


802.11ac(VHT40) HCH 5310MHz Ant1 NTNV

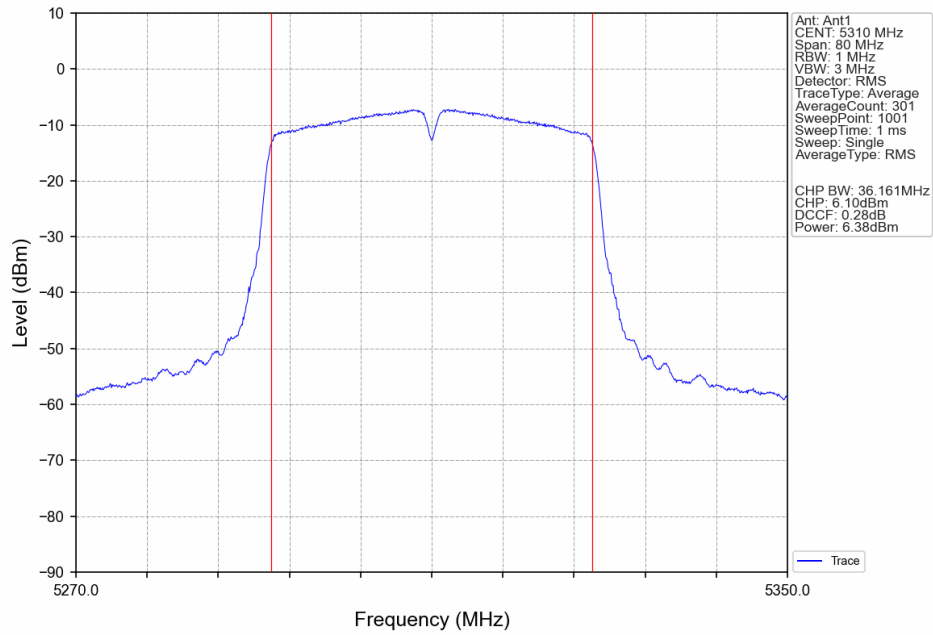


802.11ac(VHT40) LCH 5510MHz Ant1 NTNV

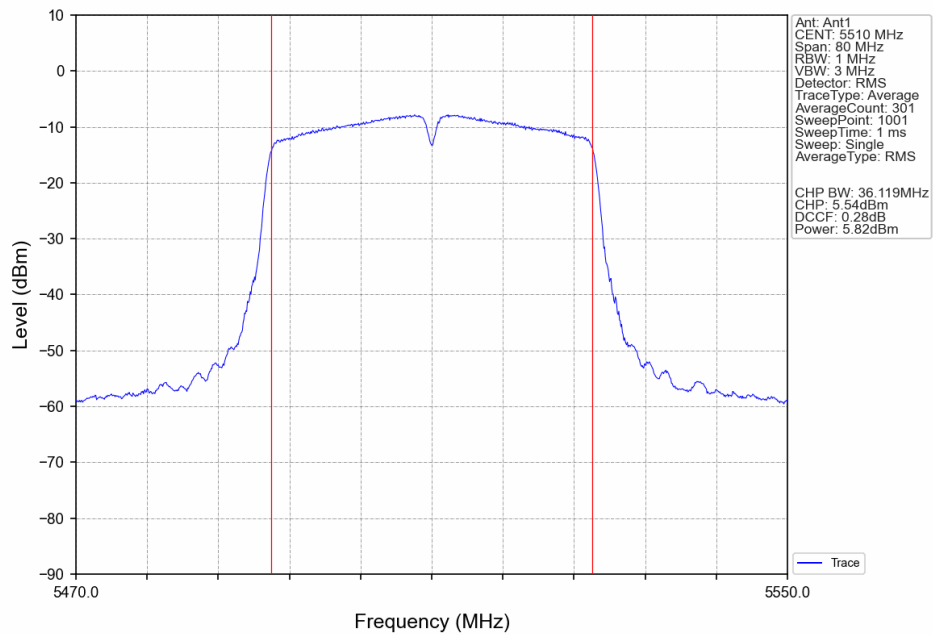


802.11ac(VHT40) MCH 5550MHz Ant1 NTN

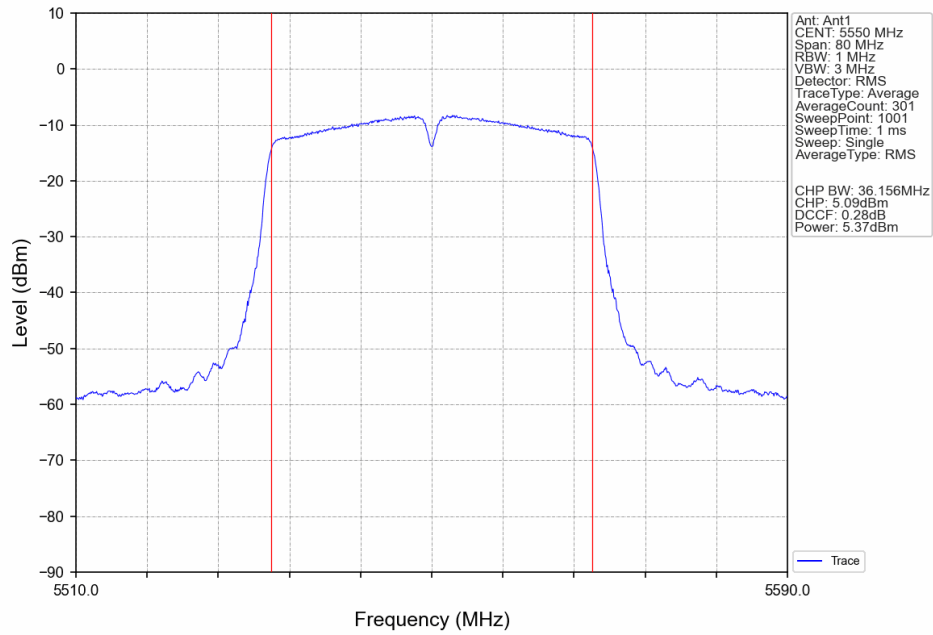


802.11ac(VHT40) HCH 5670MHz Ant1 NTN

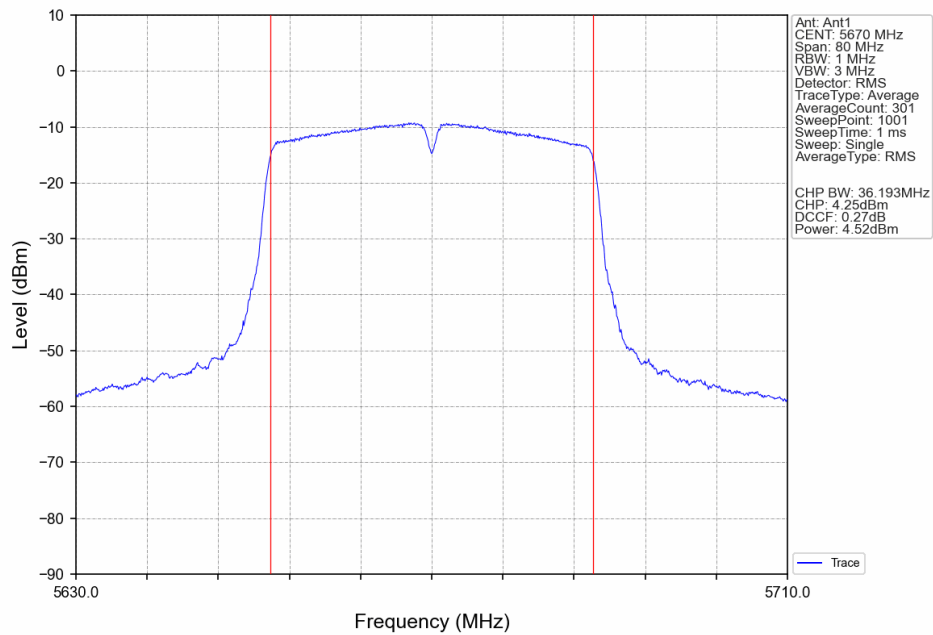


802.11ac(VHT40) LCH 5755MHz Ant1 NTN

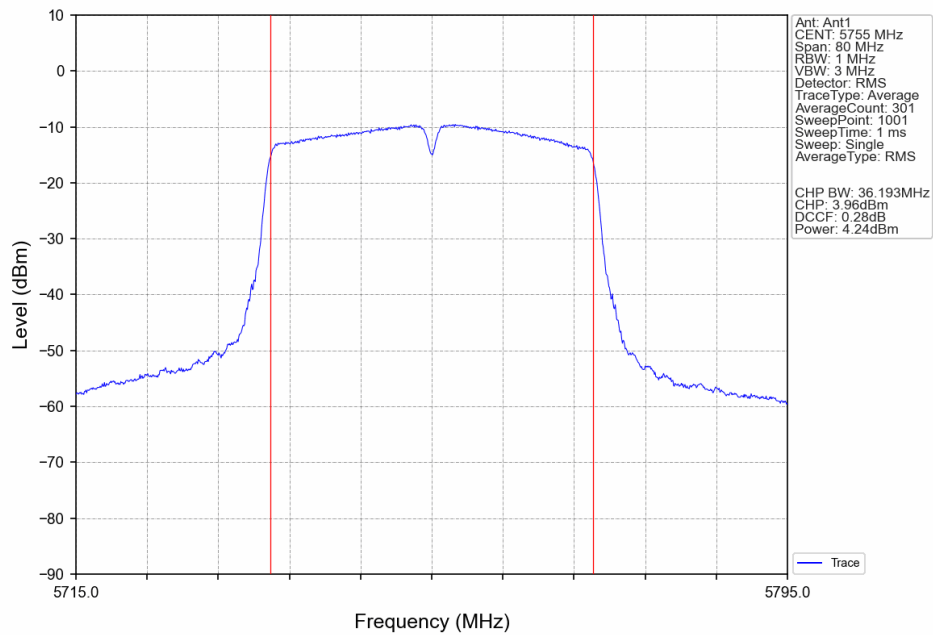


802.11ac(VHT40) HCH 5795MHz Ant1 NTN

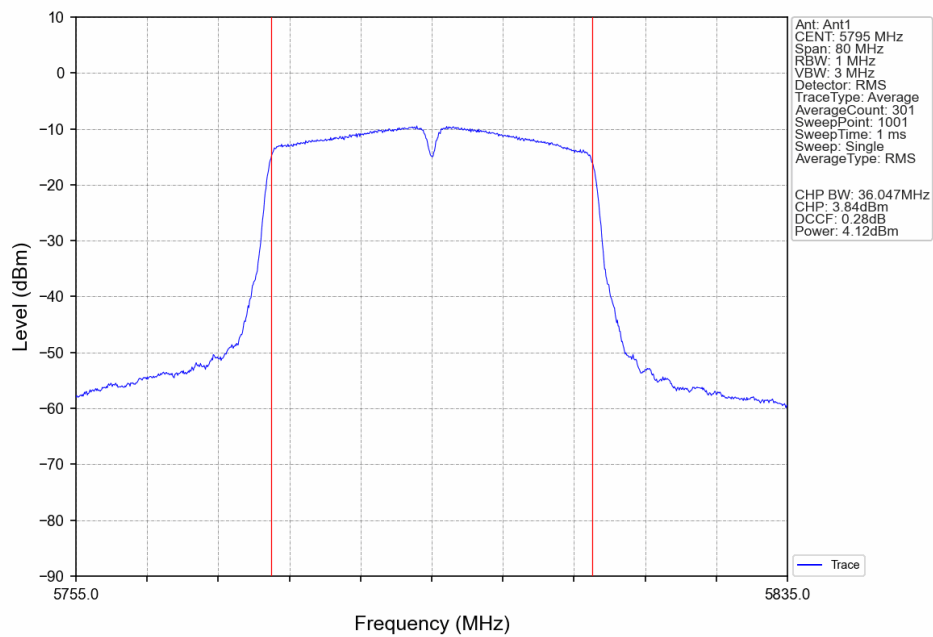


802.11ac(VHT80) MCH 5210MHz Ant1 NTNV

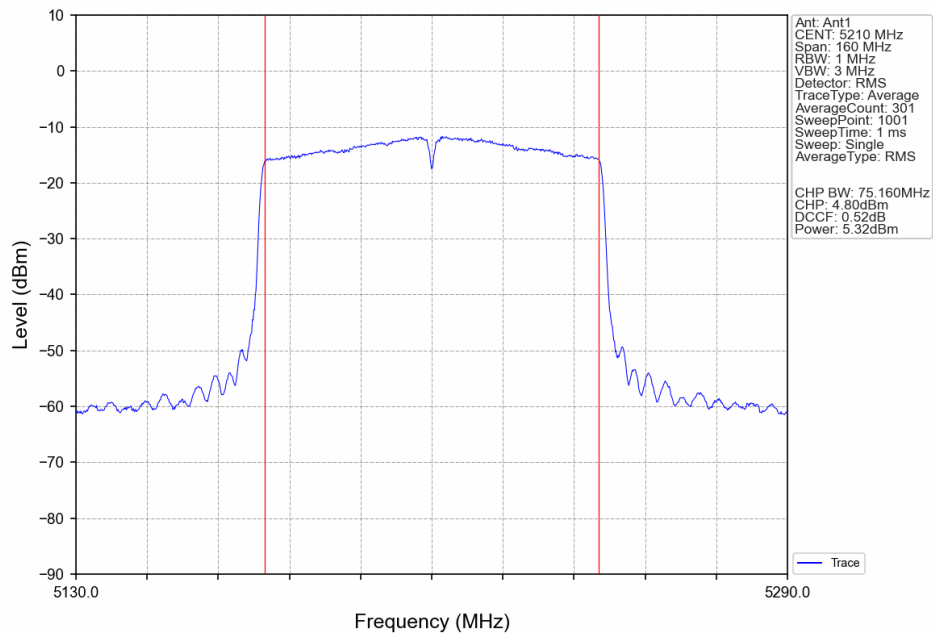


802.11ac(VHT80) MCH 5290MHz Ant1 NTNV

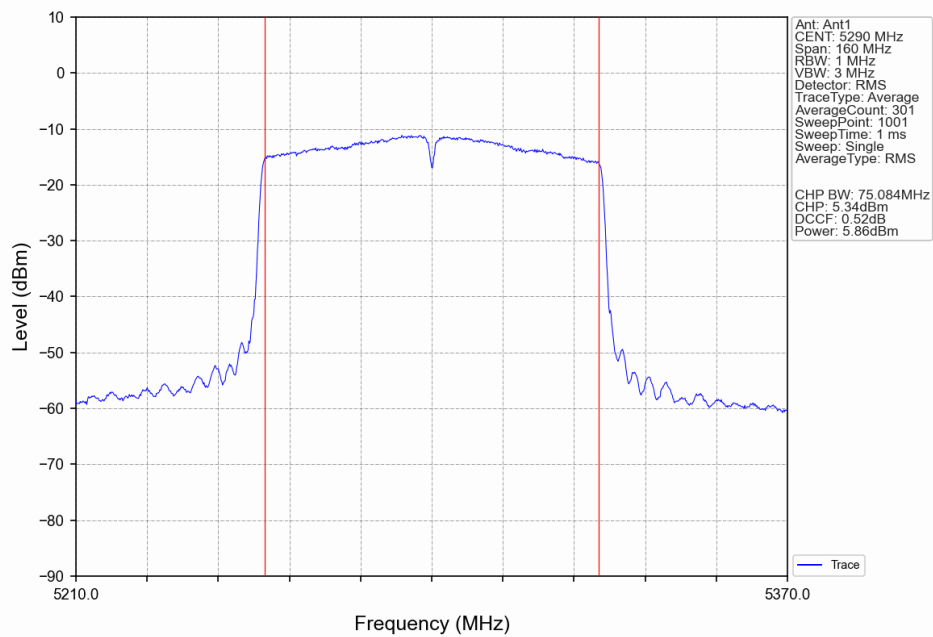


802.11ac(VHT80) LCH 5530MHz Ant1 NTNV

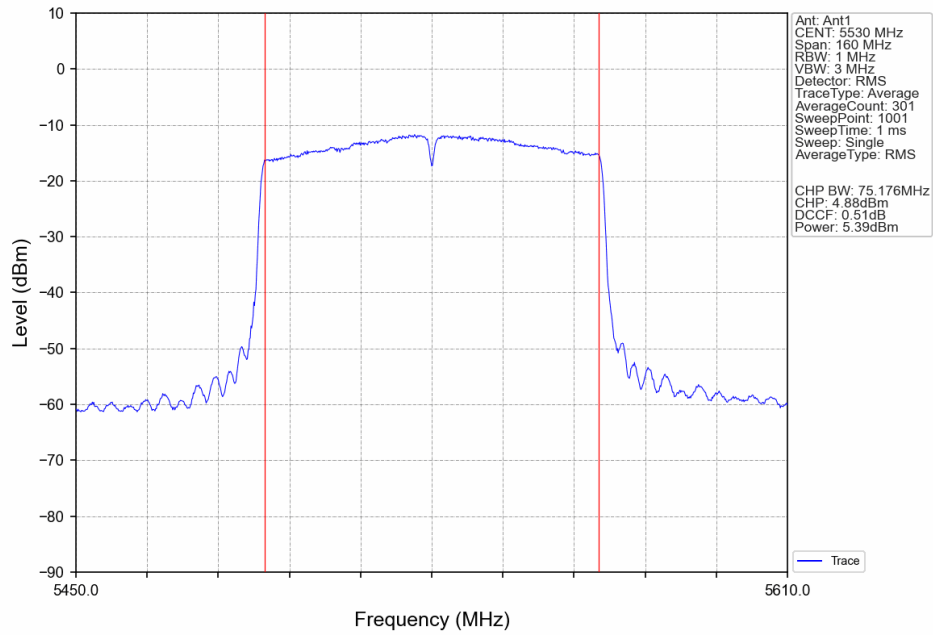

802.11ac(VHT80) HCH 5610MHz Ant1 NTNV

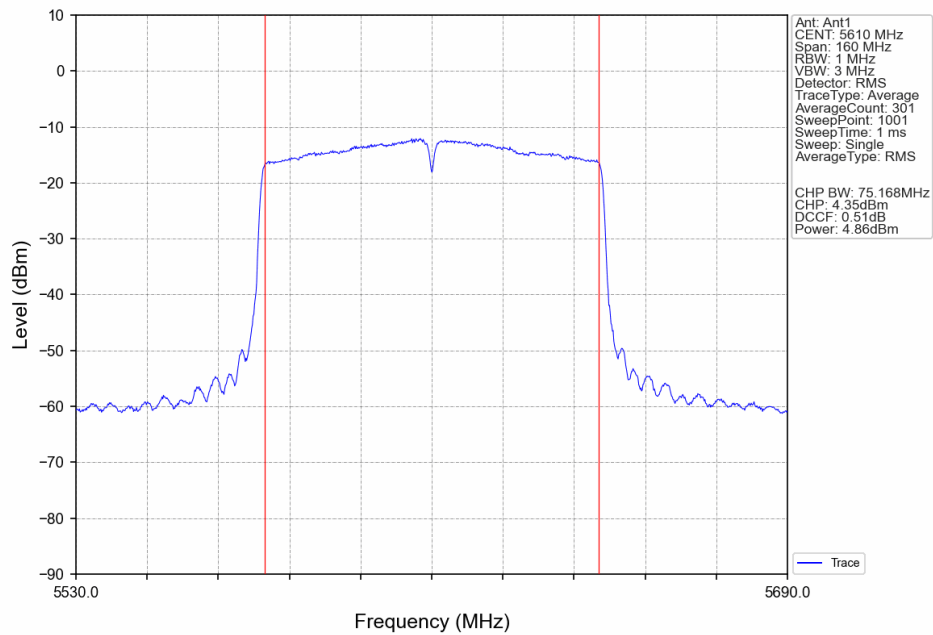

802.11ac(VHT80) MCH 5775MHz Ant1 NTN

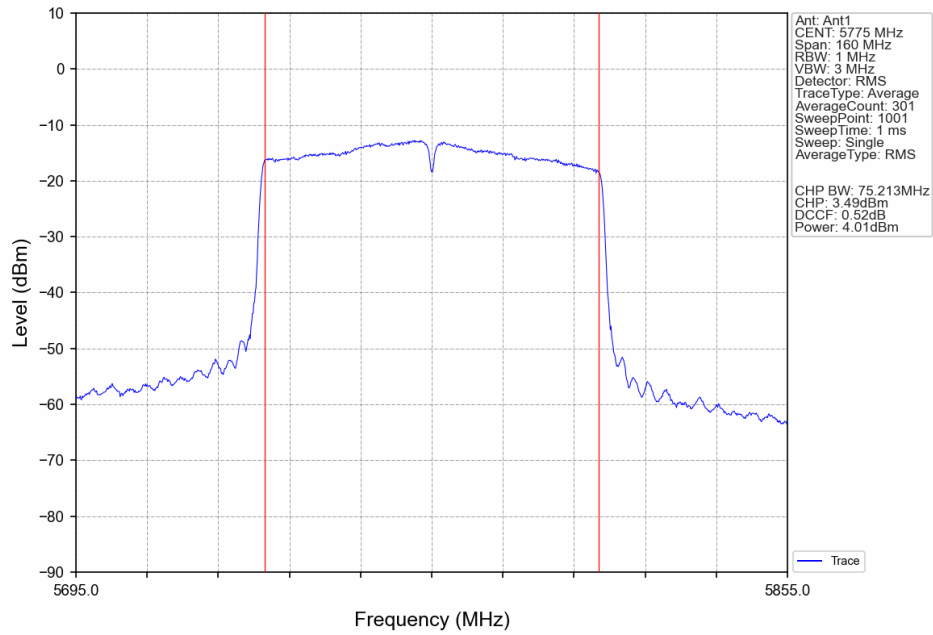

4. Maximum Power Spectral Density

4.1 Test Result

4.1.1 PSD

Mode	TX Type	Frequency (MHz)	Maximum PSD (dBm/MHz)		Verdict
			ANT1	Limit	
802.11a	SISO	5180	-3.14	<=11	Pass
		5200	-3.29	<=11	Pass
		5240	-3.05	<=11	Pass
		5260	-2.99	<=11	Pass
		5300	-2.94	<=11	Pass
		5320	-2.96	<=11	Pass
		5500	-3.29	<=11	Pass
		5580	-4.17	<=11	Pass
802.11n (HT20)	SISO	5700	-5.30	<=11	Pass
		5180	-3.76	<=11	Pass
		5200	-3.62	<=11	Pass
		5240	-3.51	<=11	Pass
		5260	-3.41	<=11	Pass
		5300	-3.31	<=11	Pass
		5320	-3.34	<=11	Pass
		5500	-3.78	<=11	Pass
802.11n (HT40)	SISO	5580	-4.57	<=11	Pass
		5700	-5.68	<=11	Pass
		5190	-7.12	<=11	Pass
		5230	-6.35	<=11	Pass
		5270	-6.83	<=11	Pass
		5310	-6.27	<=11	Pass
802.11ac (VHT20)	SISO	5510	-7.08	<=11	Pass
		5550	-7.50	<=11	Pass
		5670	-8.34	<=11	Pass
		5180	-5.14	<=11	Pass
		5200	-4.96	<=11	Pass
		5240	-4.81	<=11	Pass
		5260	-4.67	<=11	Pass
		5300	-3.72	<=11	Pass
802.11ac (VHT40)	SISO	5320	-3.24	<=11	Pass
		5500	-4.33	<=11	Pass
		5580	-5.15	<=11	Pass
		5700	-5.31	<=11	Pass
		5190	-7.84	<=11	Pass
		5230	-7.96	<=11	Pass
802.11ac (VHT80)	SISO	5270	-7.46	<=11	Pass
		5310	-6.92	<=11	Pass
		5510	-7.47	<=11	Pass
		5550	-7.83	<=11	Pass
802.11ac (VHT80)	SISO	5670	-8.70	<=11	Pass
		5210	-11.14	<=11	Pass
		5290	-10.62	<=11	Pass
		5530	-11.26	<=11	Pass
802.11ac (VHT80)	SISO	5610	-11.74	<=11	Pass

Note1: Antenna Gain:
- Band: 3 Ant1: 1.36dBi;


- Band: 2A Ant1: 1.36dBi;
- Band: 2C Ant1: 1.36dBi;
- Band: 1 Ant1: 1.36dBi;

4.1.2 PSD-Band3


Mode	TX Type	Frequency (MHz)	Maximum PSD (dBm/500kHz)		Verdict
			ANT1	Limit	
802.11a	SISO	5745	-8.48	<=30	Pass
		5785	-8.75	<=30	Pass
		5825	-8.61	<=30	Pass
802.11n (HT20)	SISO	5745	-9.10	<=30	Pass
		5785	-9.17	<=30	Pass
		5825	-9.05	<=30	Pass
802.11n (HT40)	SISO	5755	-11.86	<=30	Pass
		5795	-11.84	<=30	Pass
802.11ac (VHT20)	SISO	5745	-9.49	<=30	Pass
		5785	-9.41	<=30	Pass
		5825	-9.38	<=30	Pass
802.11ac (VHT40)	SISO	5755	-12.11	<=30	Pass
		5795	-12.29	<=30	Pass
802.11ac (VHT80)	SISO	5775	-14.85	<=30	Pass
Note1: Antenna Gain: - Band: 3 Ant1: 1.36dBi; - Band: 2A Ant1: 1.36dBi; - Band: 2C Ant1: 1.36dBi; - Band: 1 Ant1: 1.36dBi;					

4.2 Test Graph


4.2.1 PSD

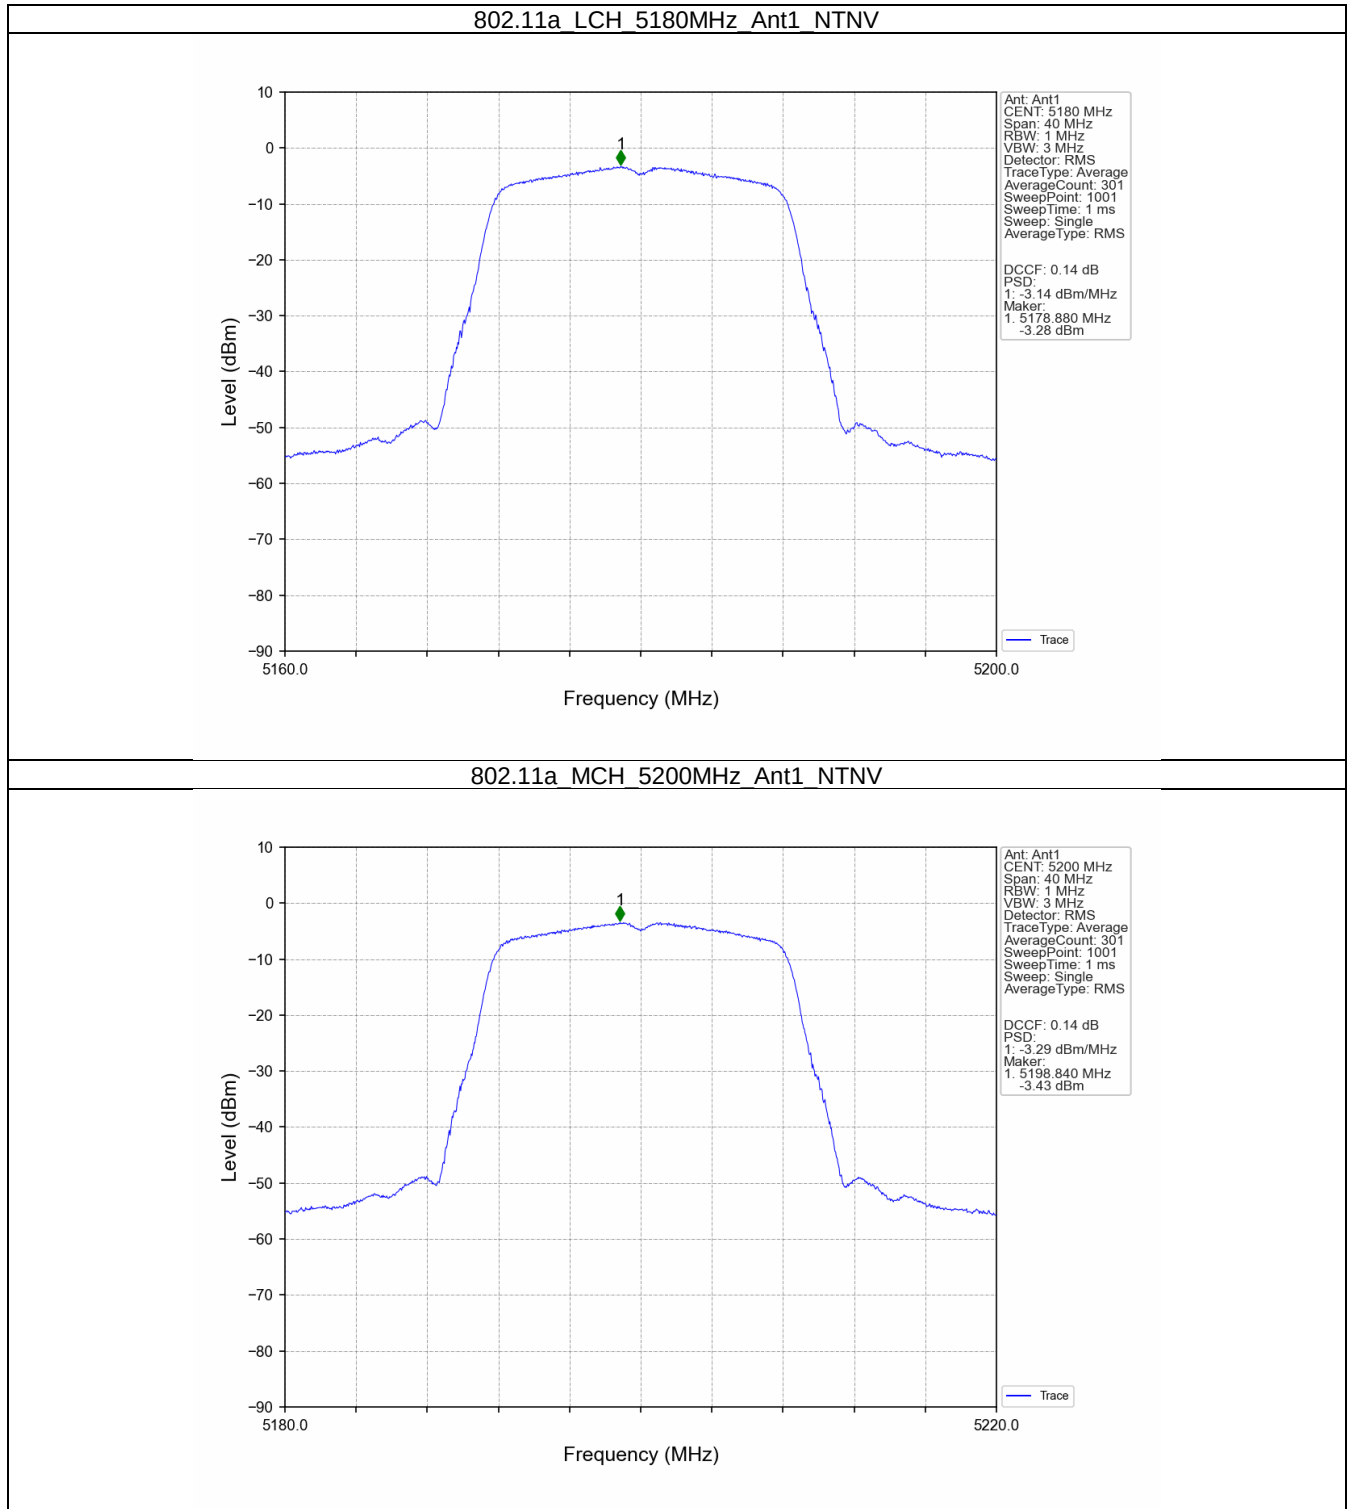


802.11a HCH 5240MHz Ant1 NTNV

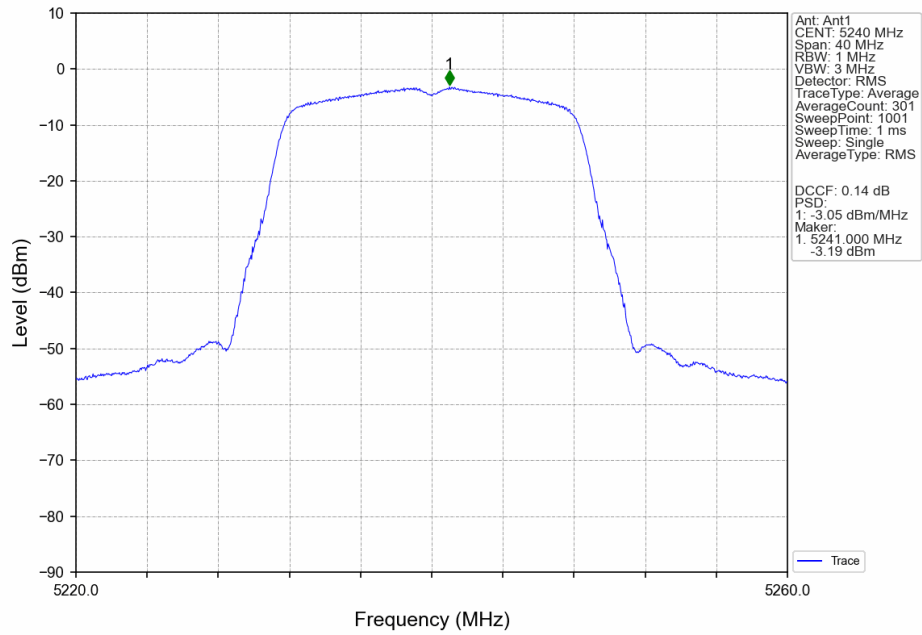


802.11a LCH 5260MHz Ant1 NTNV

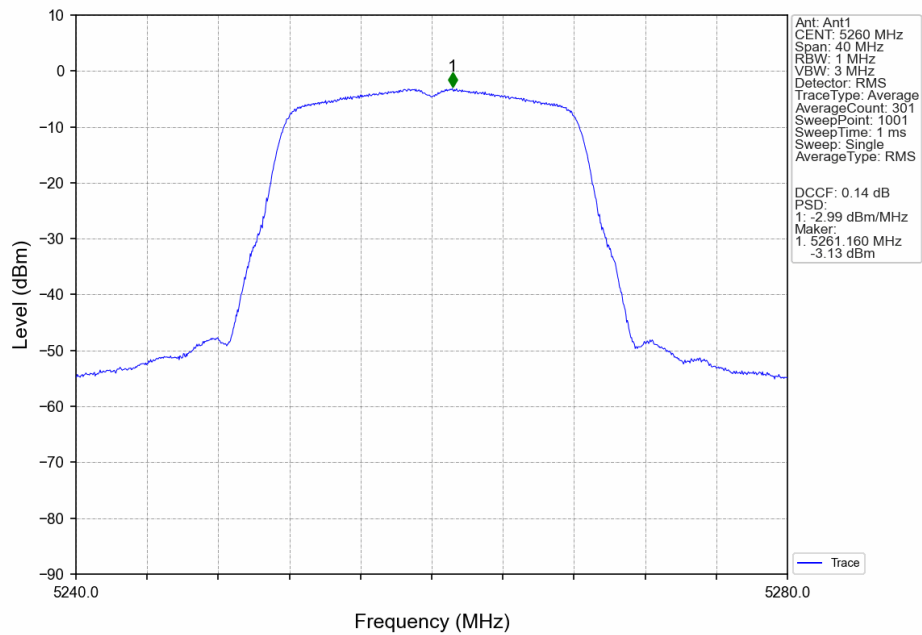


802.11a MCH 5300MHz Ant1 NTV

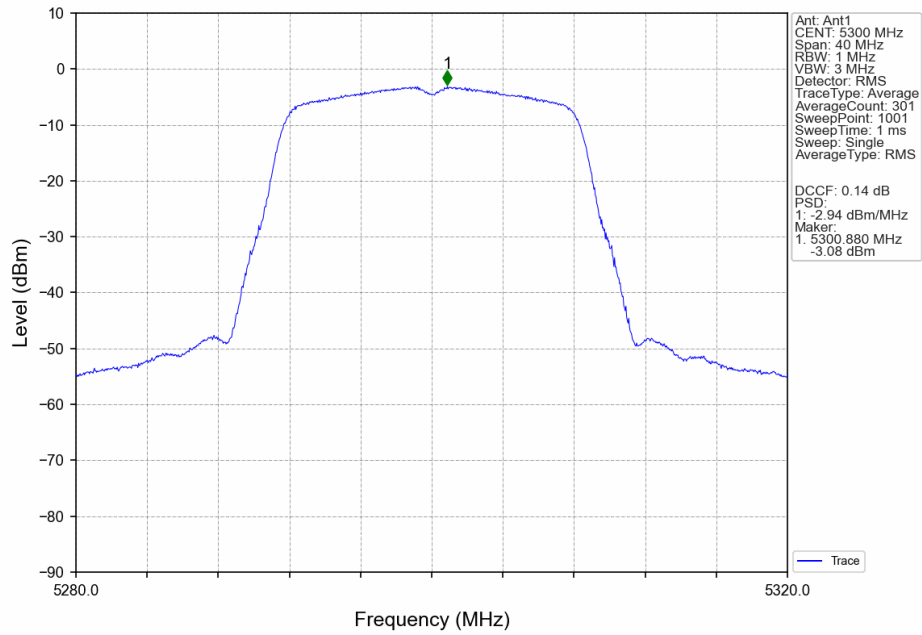


802.11a HCH 5320MHz Ant1 NTV

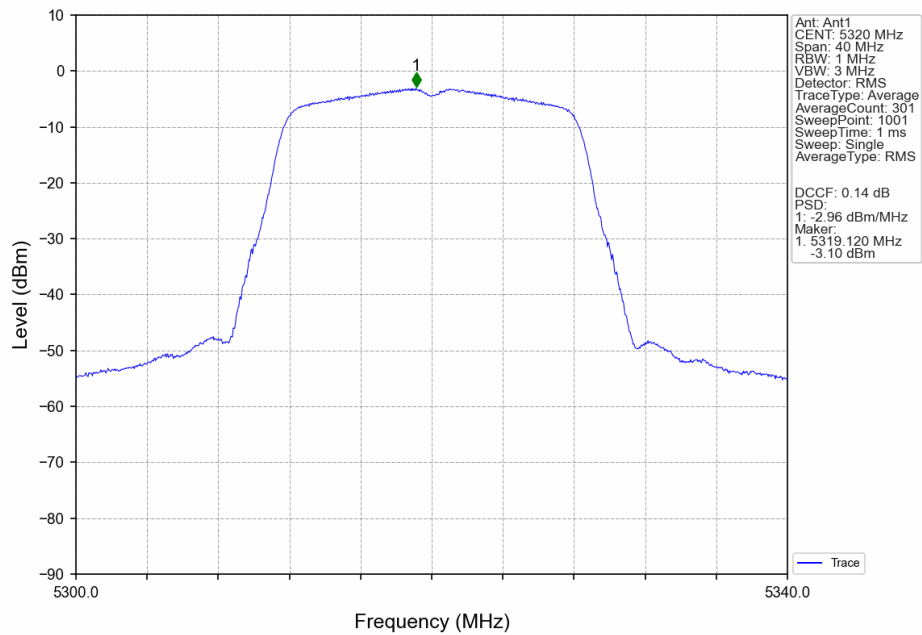


802.11a LCH 5500MHz Ant1 NTV

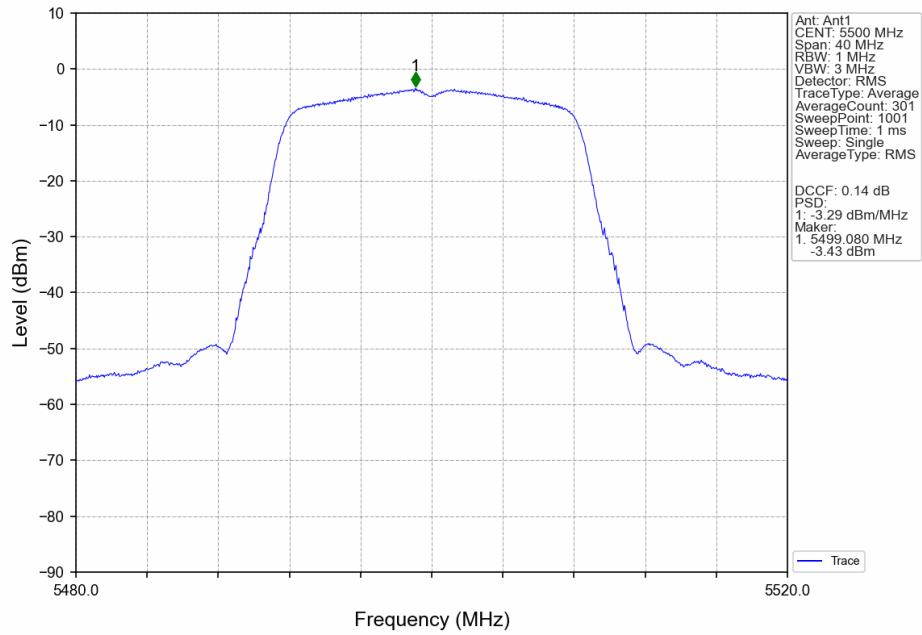


802.11a MCH 5580MHz Ant1 NTV

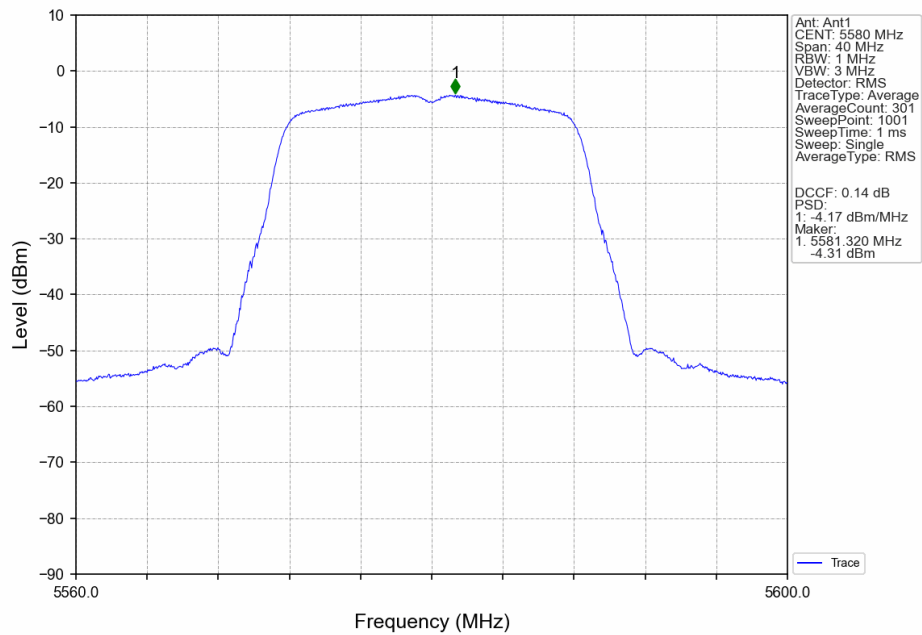


802.11a HCH 5700MHz Ant1 NTNV

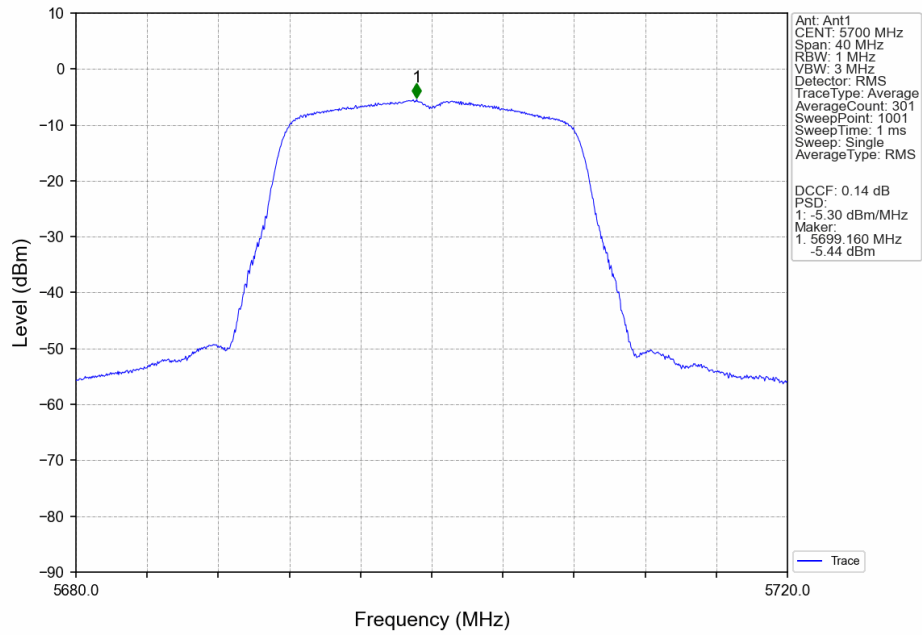


802.11n(HT20) LCH 5180MHz Ant1 NTNV

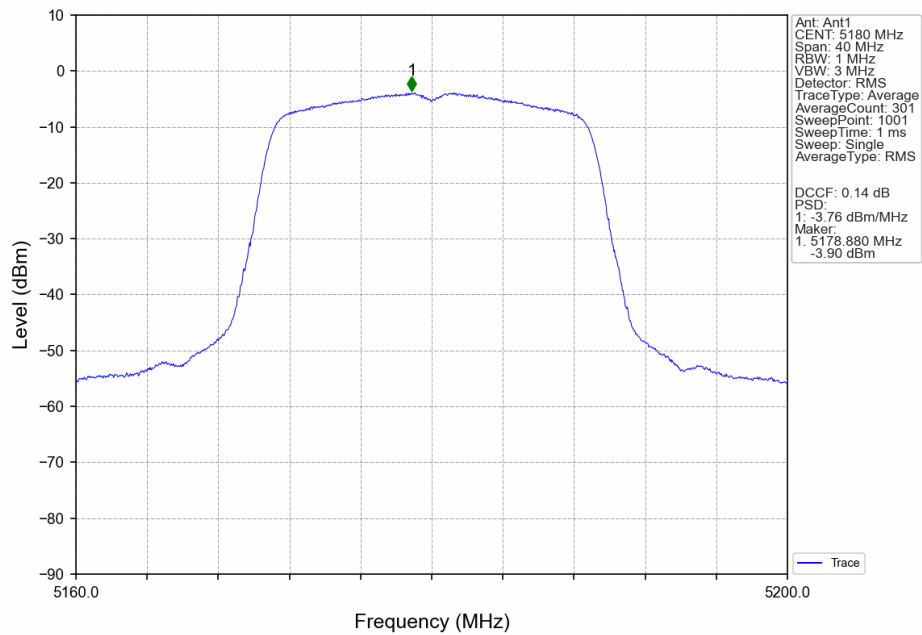


802.11n(HT20) MCH 5200MHz Ant1 NTNV

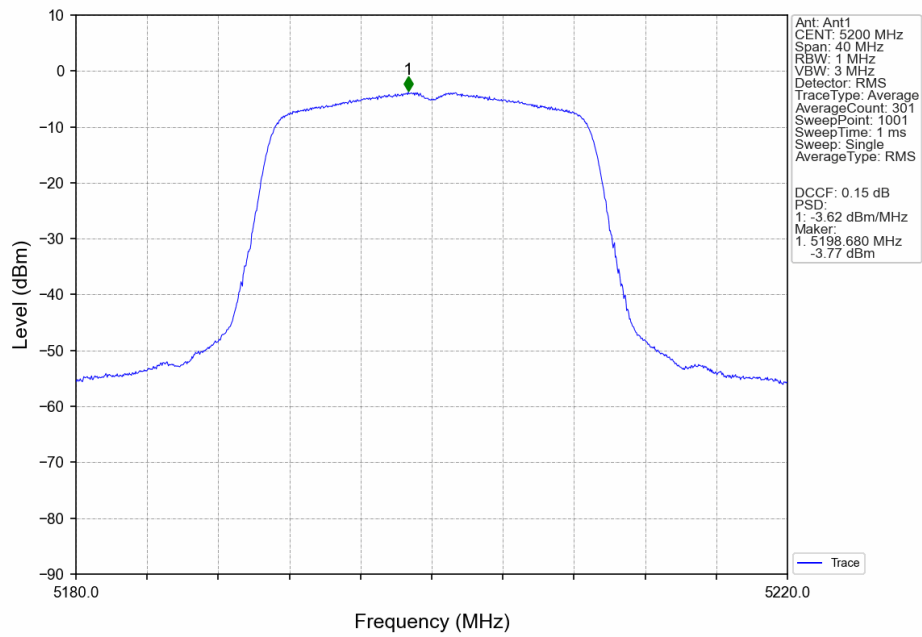


802.11n(HT20) HCH 5240MHz Ant1 NTNV

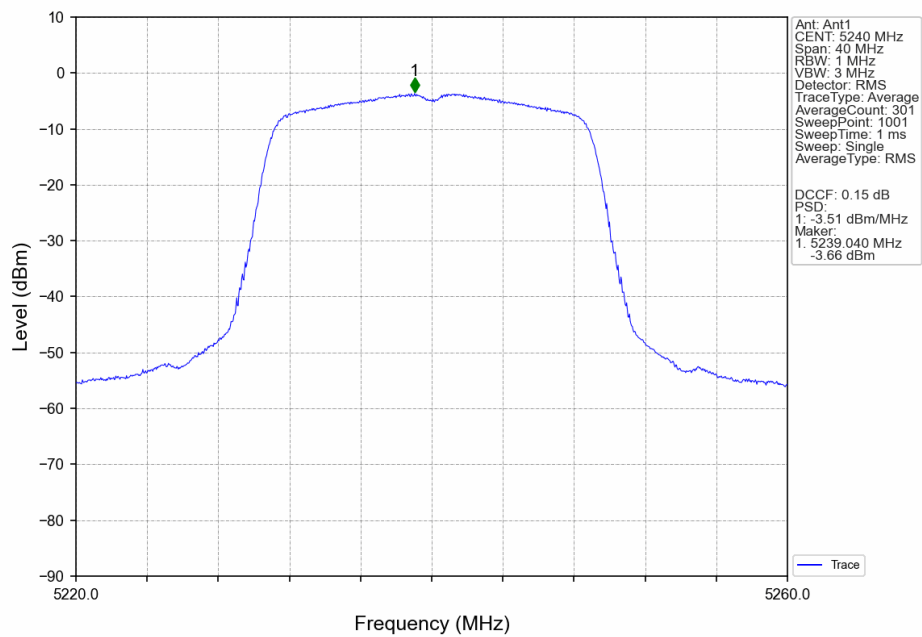


802.11n(HT20) LCH 5260MHz Ant1 NTVN

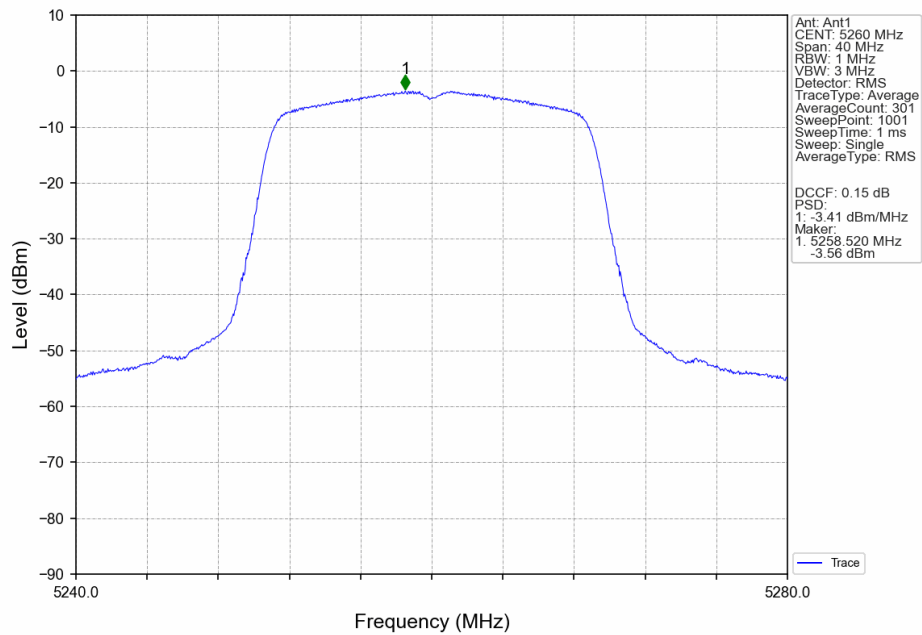


802.11n(HT20) MCH 5300MHz Ant1 NTVN

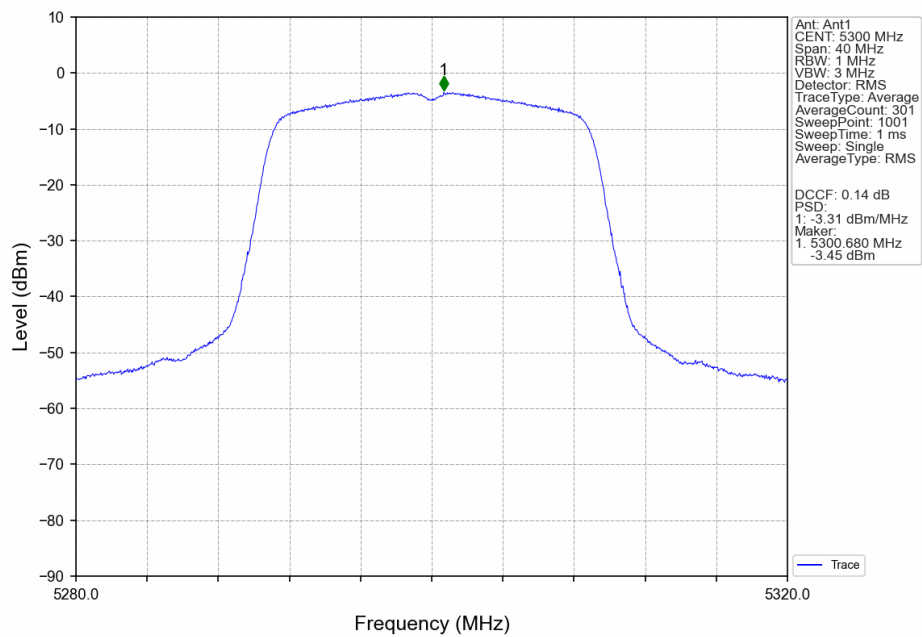


802.11n(HT20) HCH 5320MHz Ant1 NTV

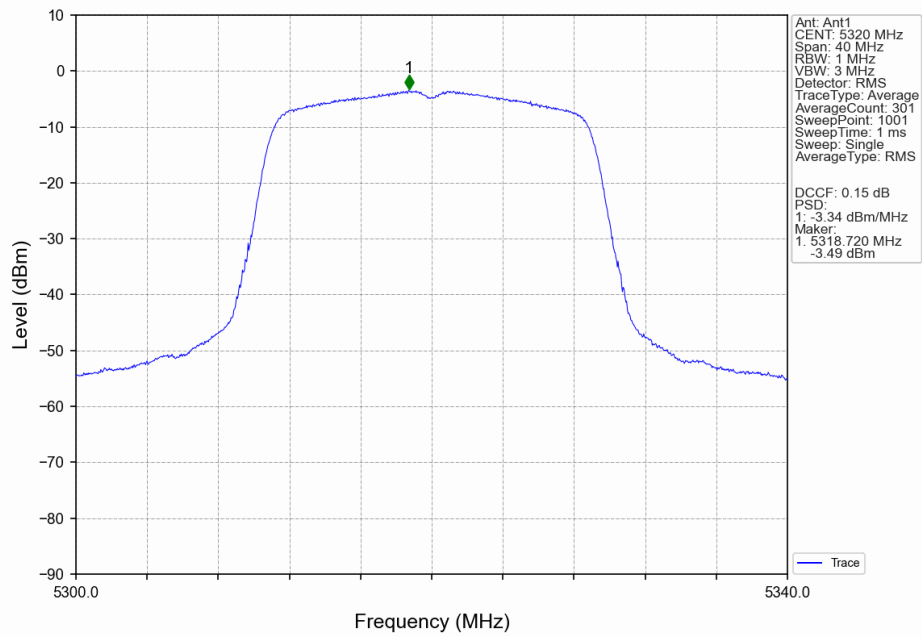


802.11n(HT20) LCH 5500MHz Ant1 NTV

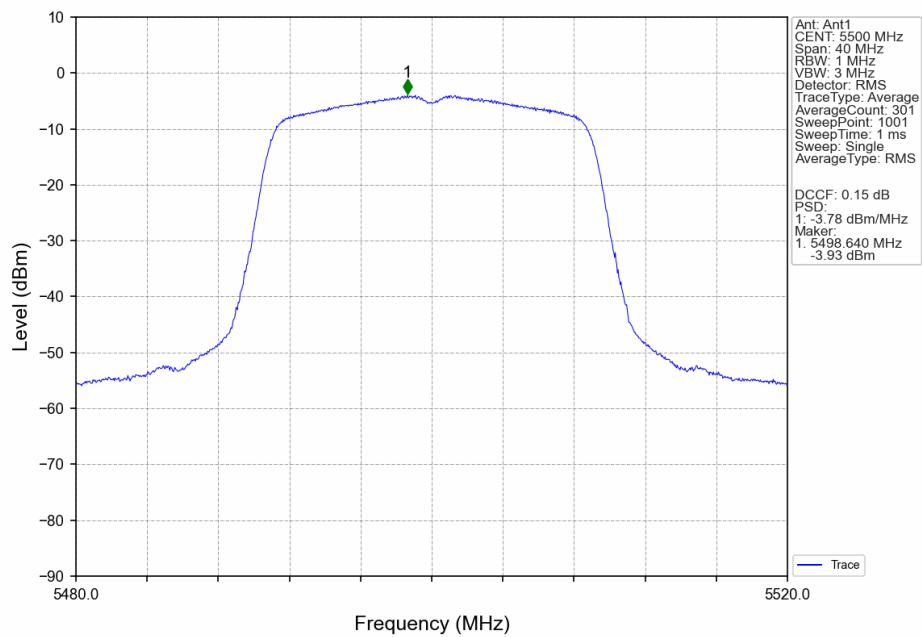


802.11n(HT20) MCH 5580MHz Ant1 NTNV

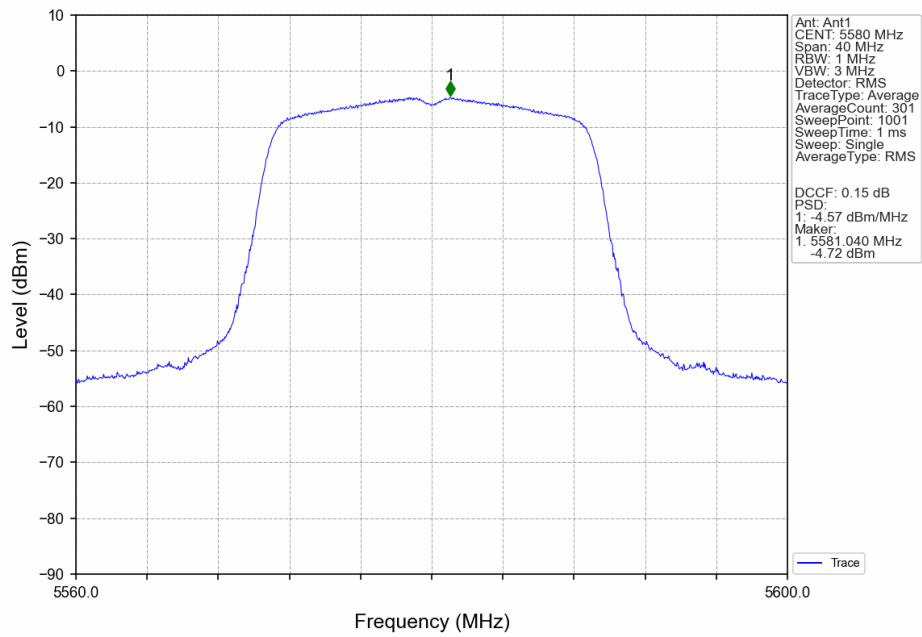


802.11n(HT20) HCH 5700MHz Ant1 NTNV

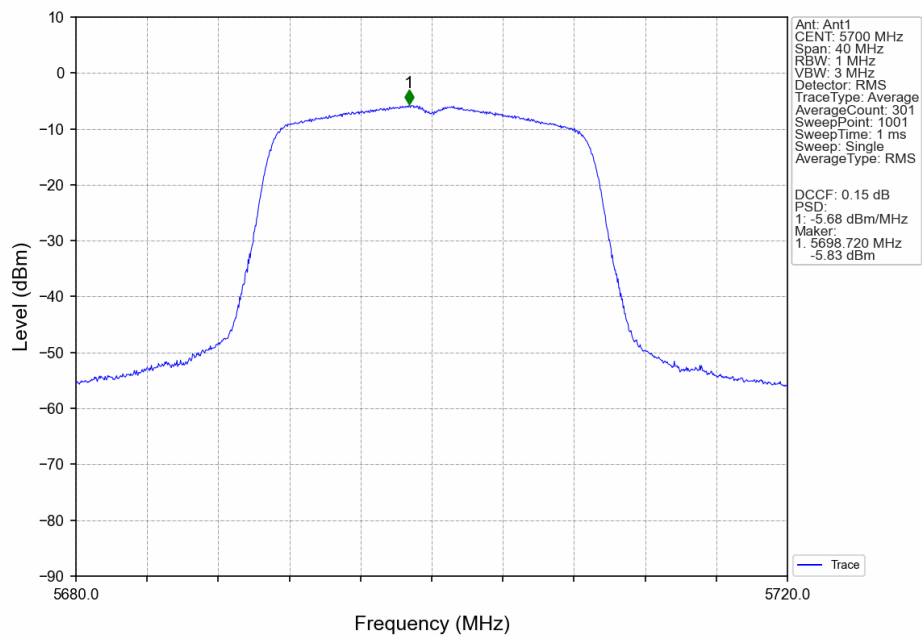


802.11n(HT40) LCH 5190MHz Ant1 NTN

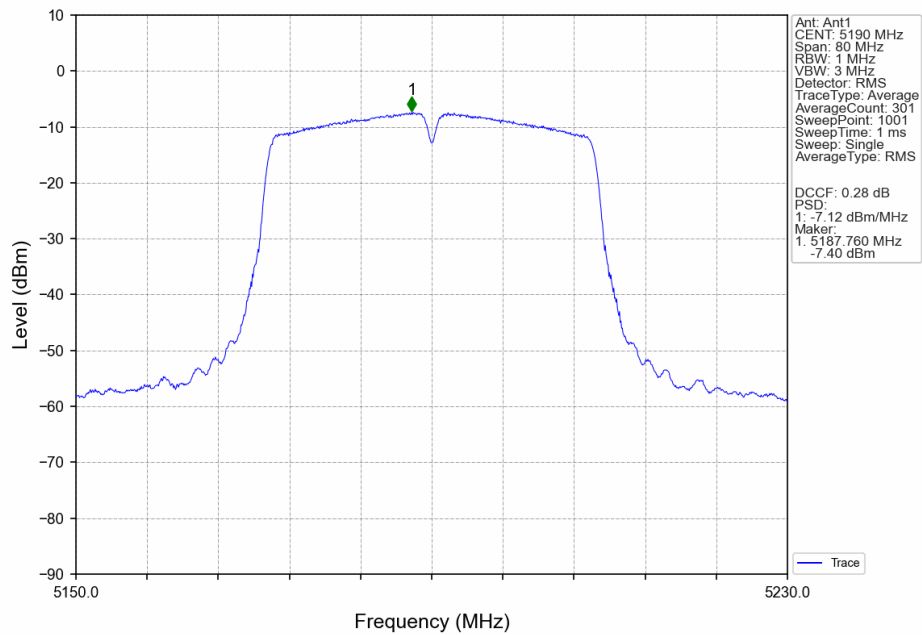


802.11n(HT40) HCH 5230MHz Ant1 NTN

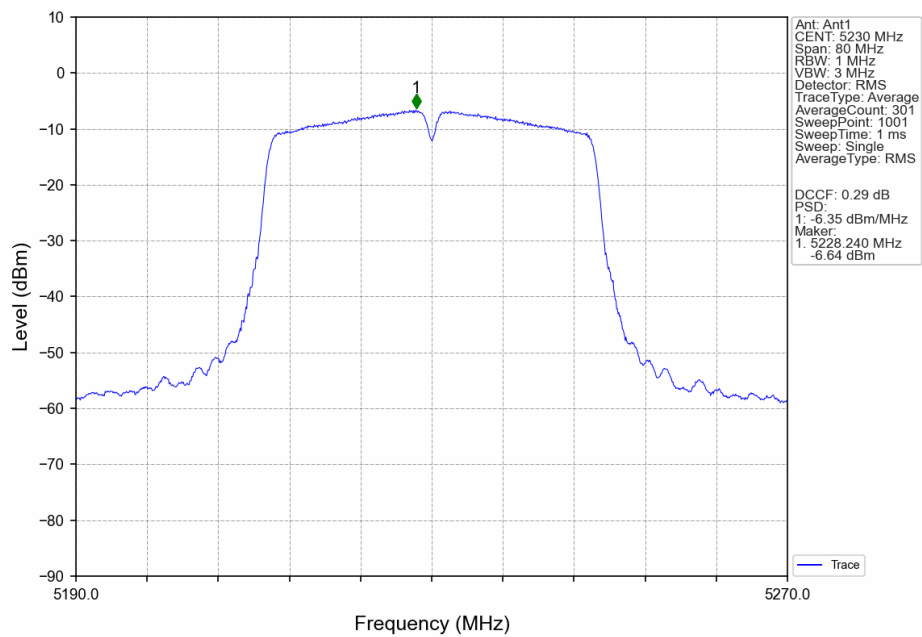


802.11n(HT40) LCH 5270MHz Ant1 NTN

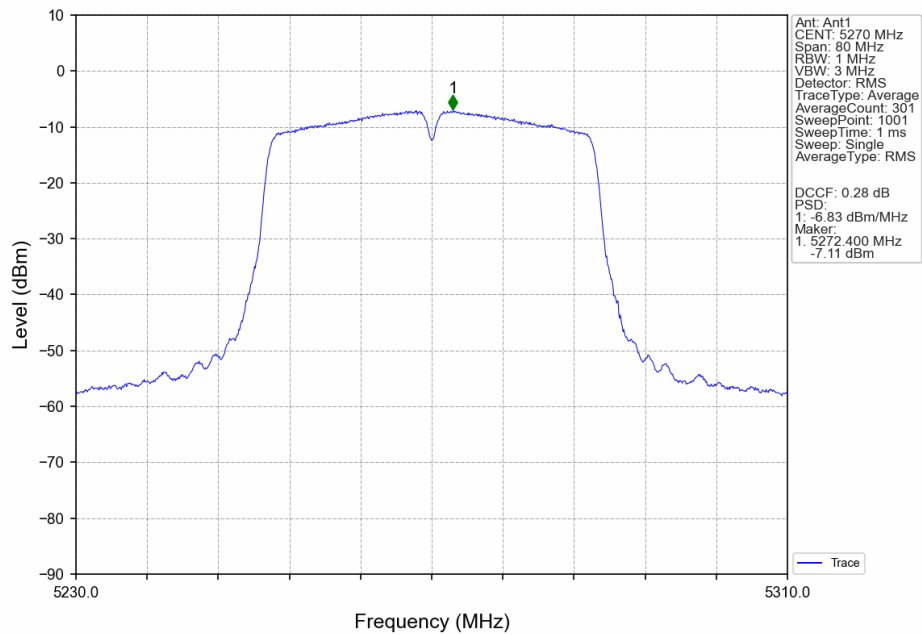


802.11n(HT40) HCH 5310MHz Ant1 NTN

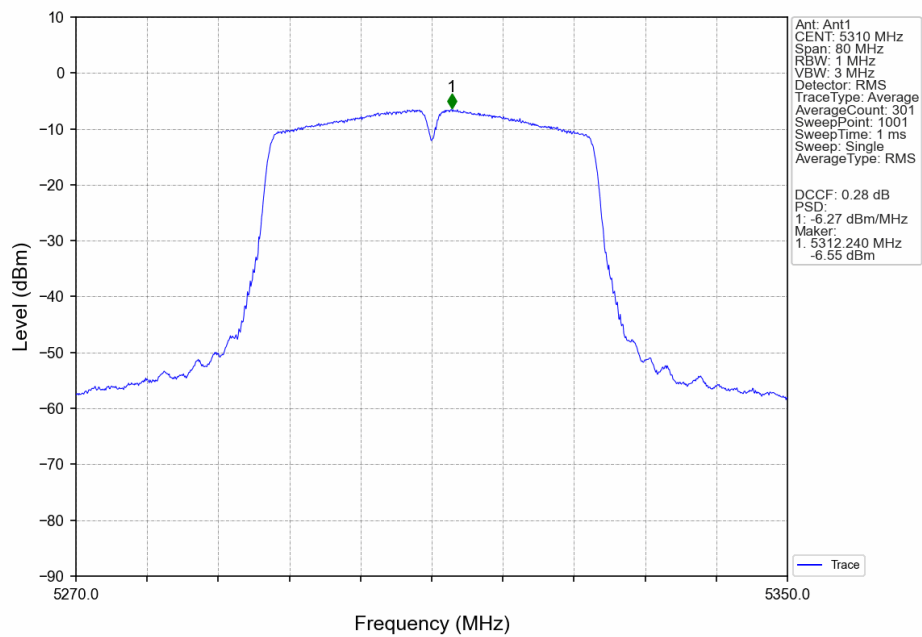


802.11n(HT40) LCH 5510MHz Ant1 NTN

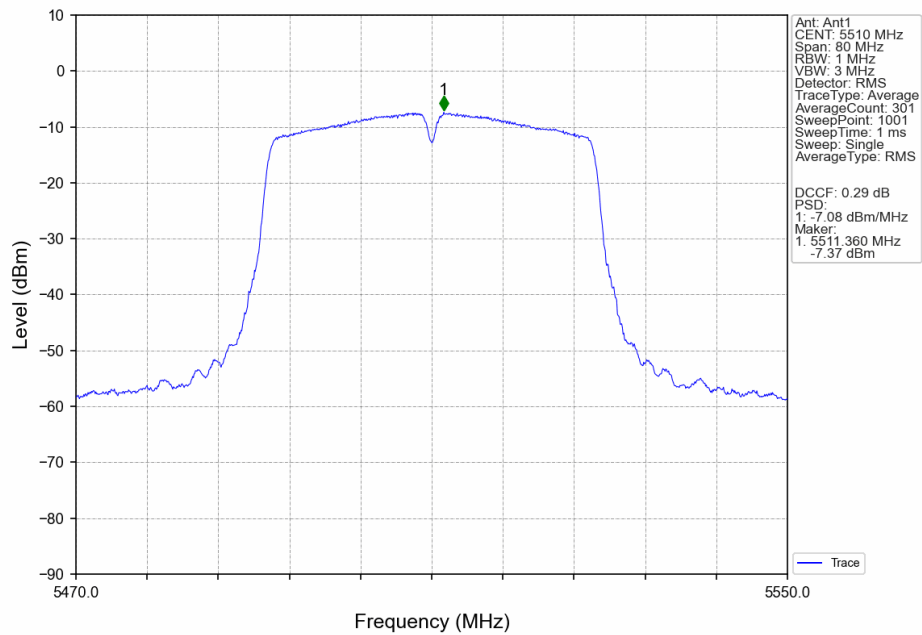


802.11n(HT40) MCH 5550MHz Ant1 NTN

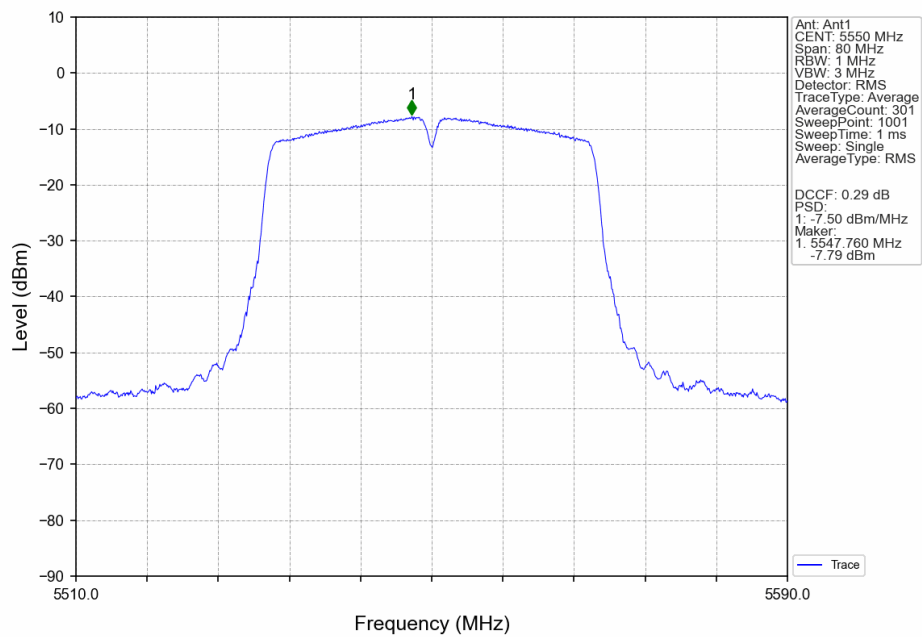


802.11n(HT40) HCH 5670MHz Ant1 NTN

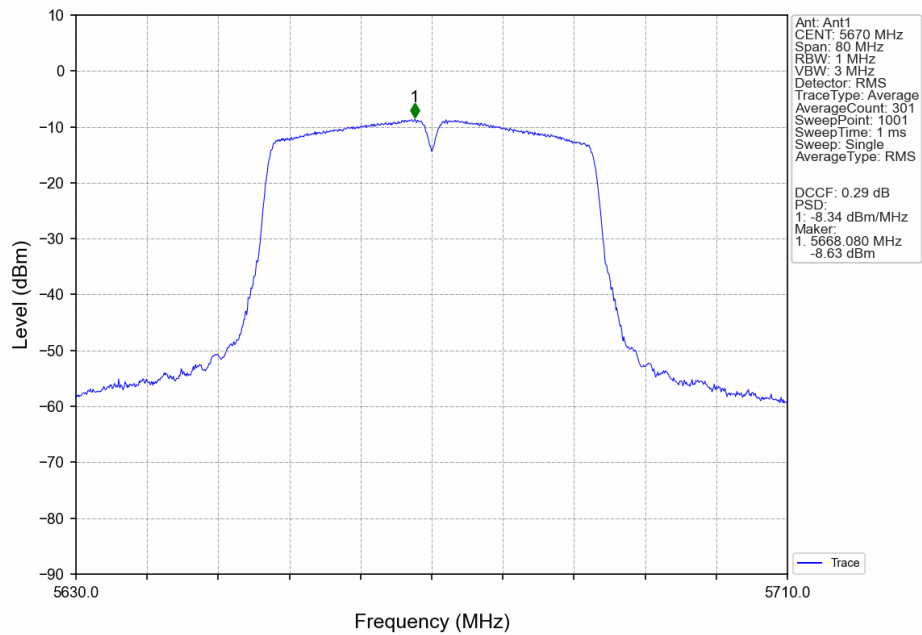


802.11ac(VHT20) LCH 5180MHz Ant1 NTN

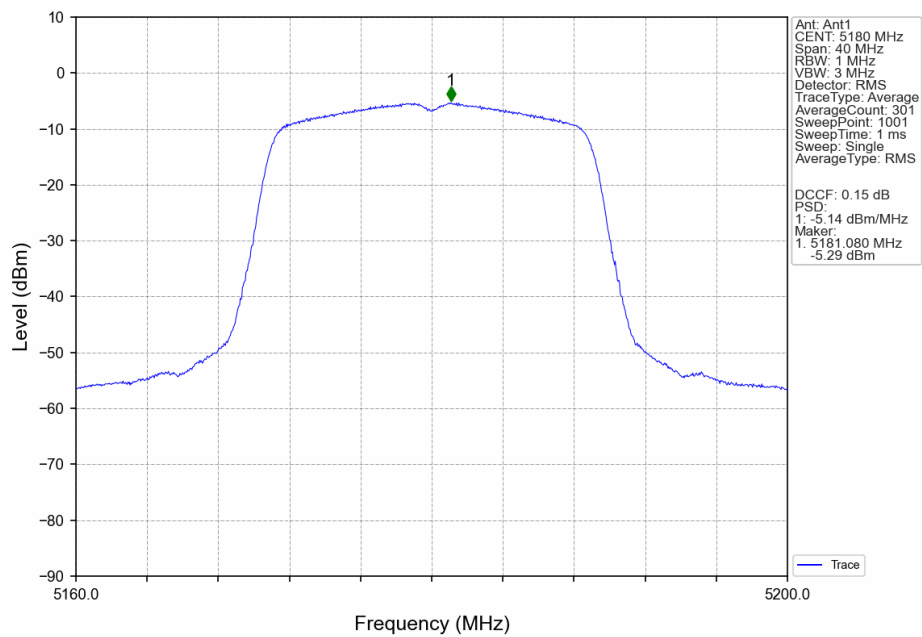


802.11ac(VHT20) MCH 5200MHz Ant1 NTN

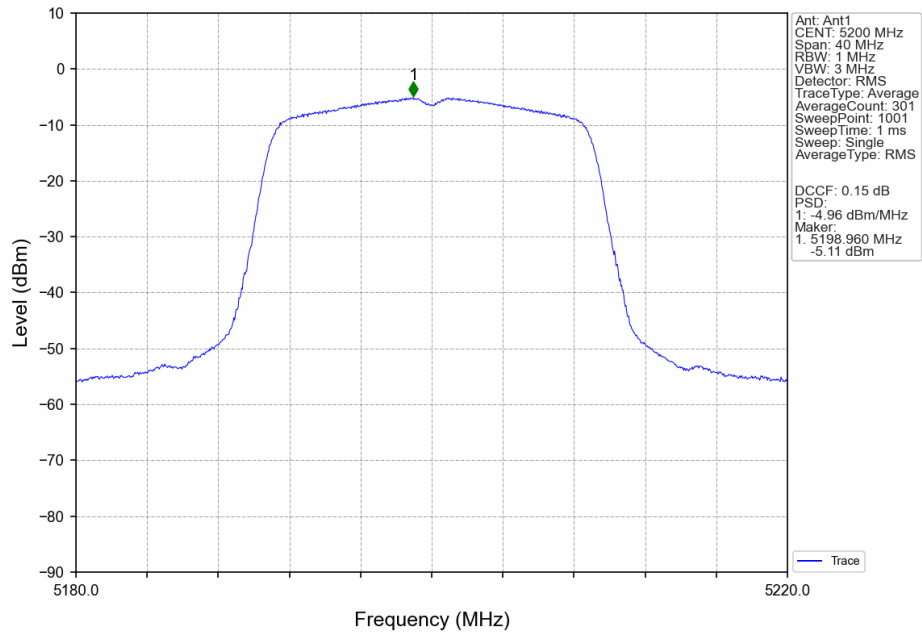


802.11ac(VHT20) HCH 5240MHz Ant1 NTN

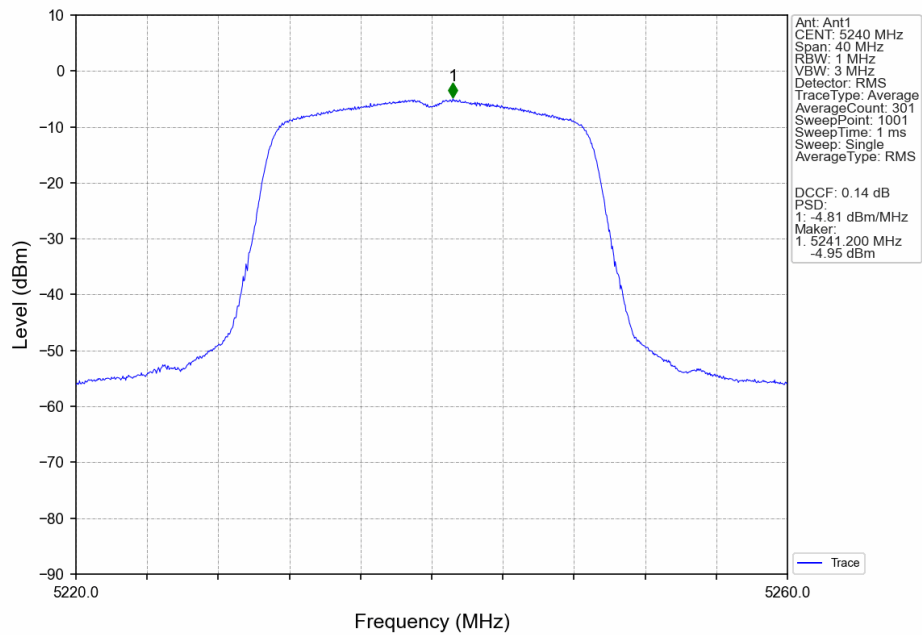


802.11ac(VHT20) LCH 5260MHz Ant1 NTN

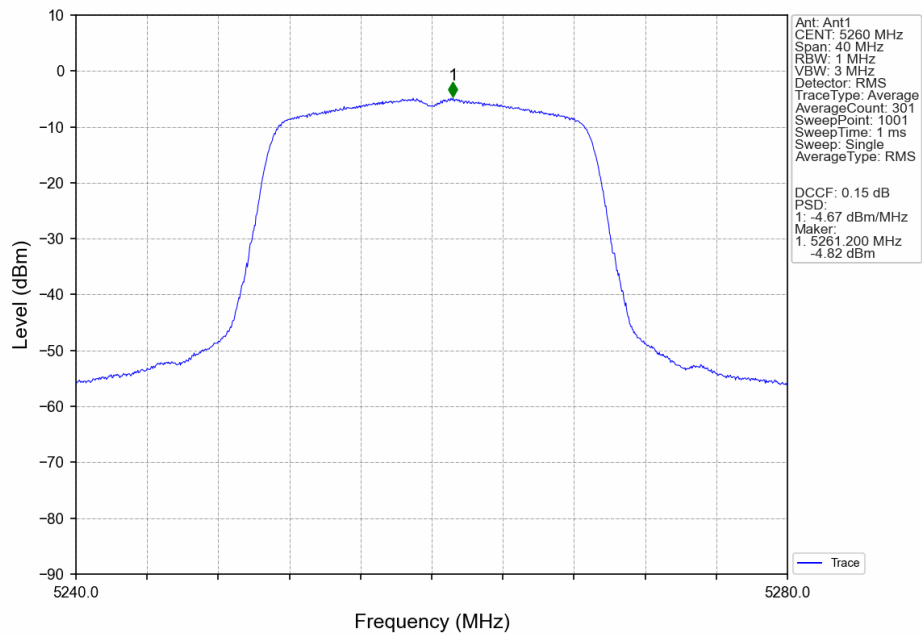


802.11ac(VHT20) MCH 5300MHz Ant1 NTN

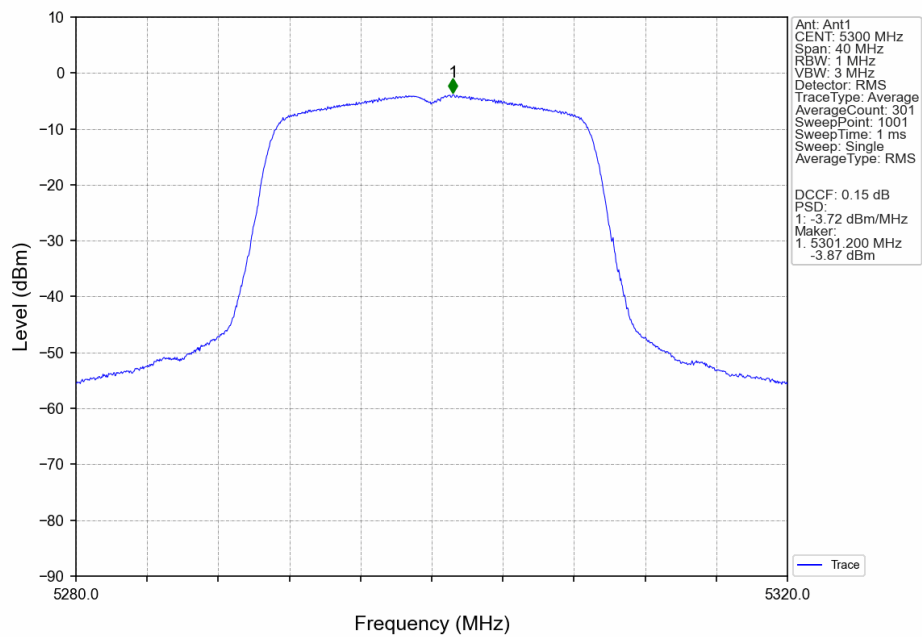


802.11ac(VHT20) HCH 5320MHz Ant1 NTN

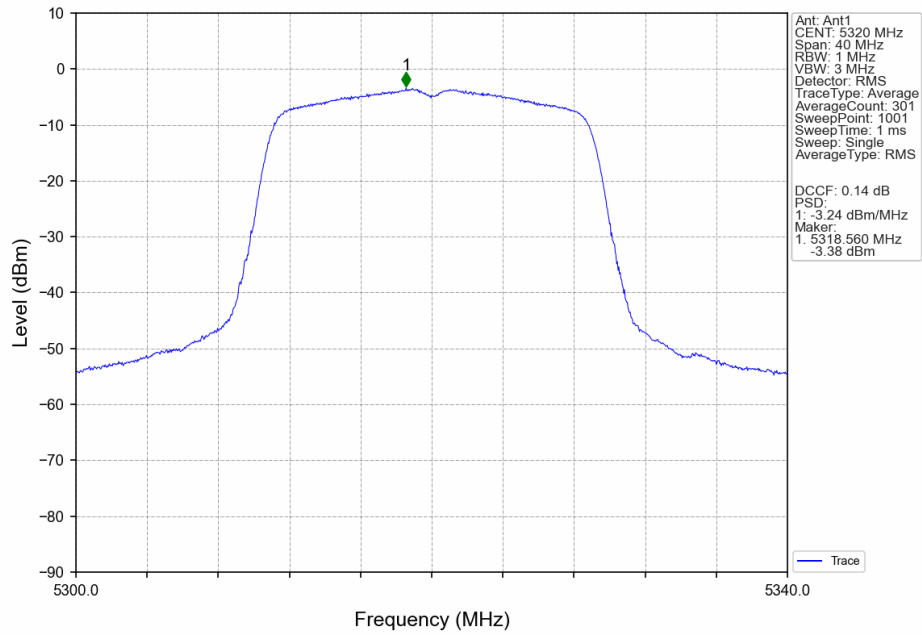


802.11ac(VHT20) LCH 5500MHz Ant1 NTN

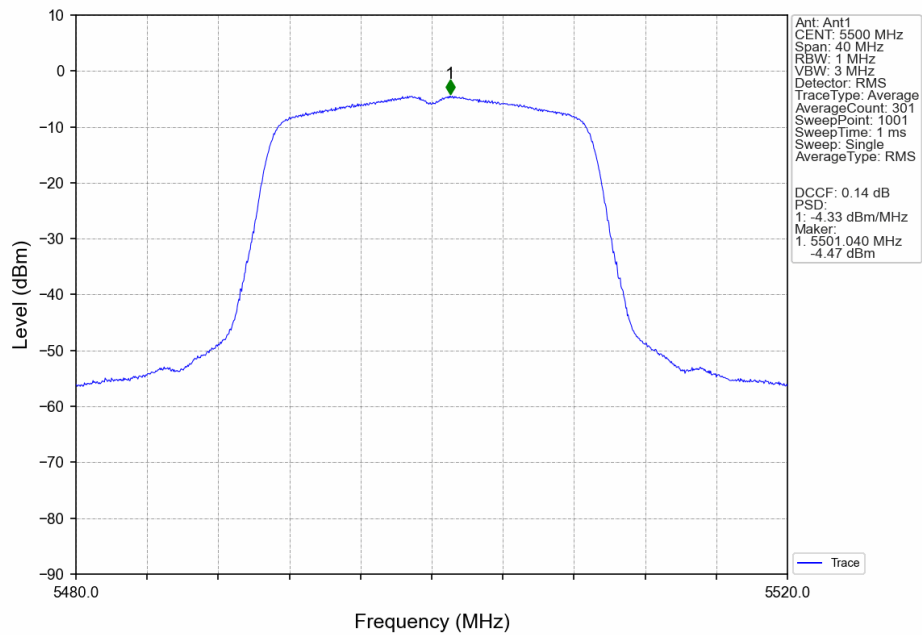


802.11ac(VHT20) MCH 5580MHz Ant1 NTN

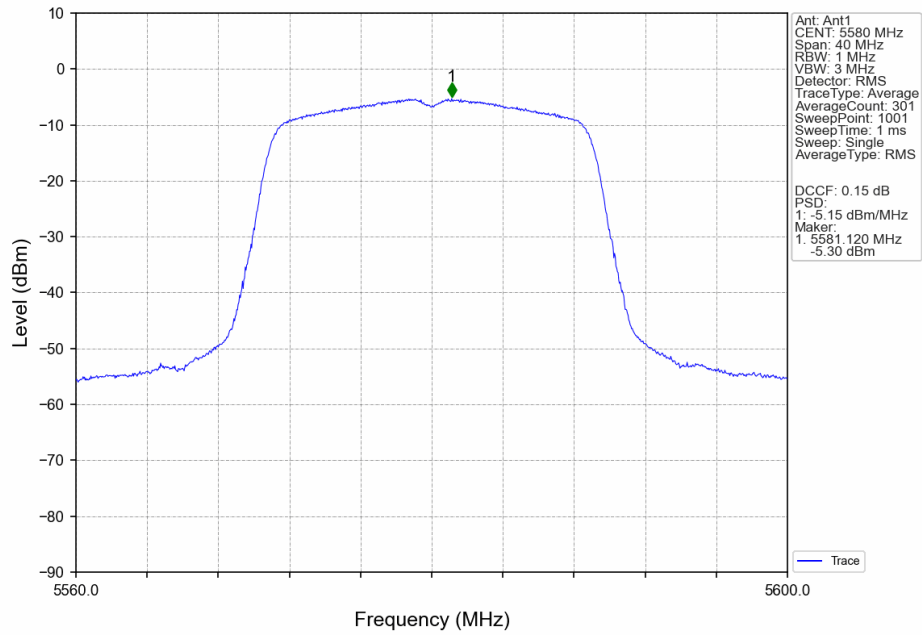


802.11ac(VHT20) HCH 5700MHz Ant1 NTN

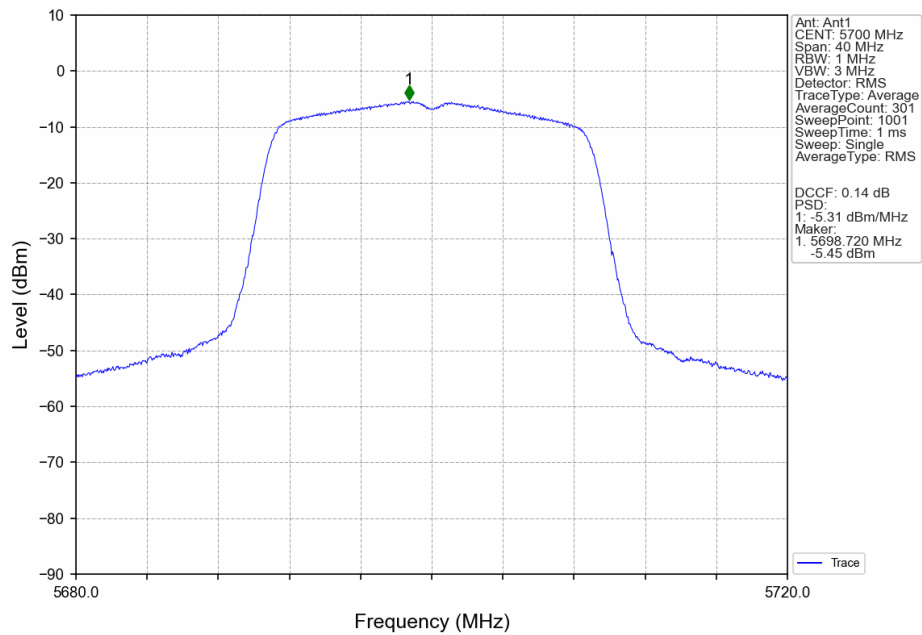


802.11ac(VHT40) LCH 5190MHz Ant1 NTN

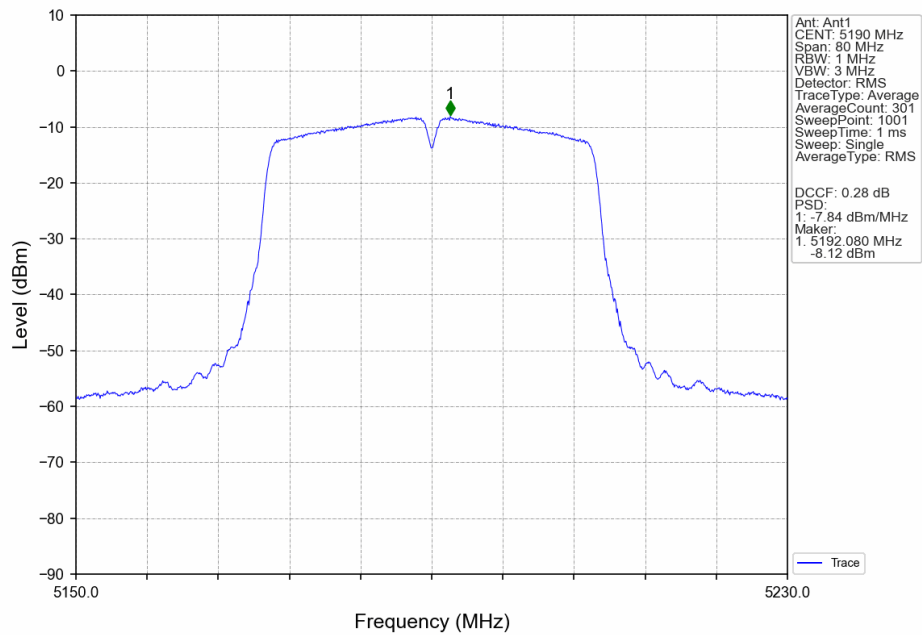


802.11ac(VHT40) HCH 5230MHz Ant1 NTN

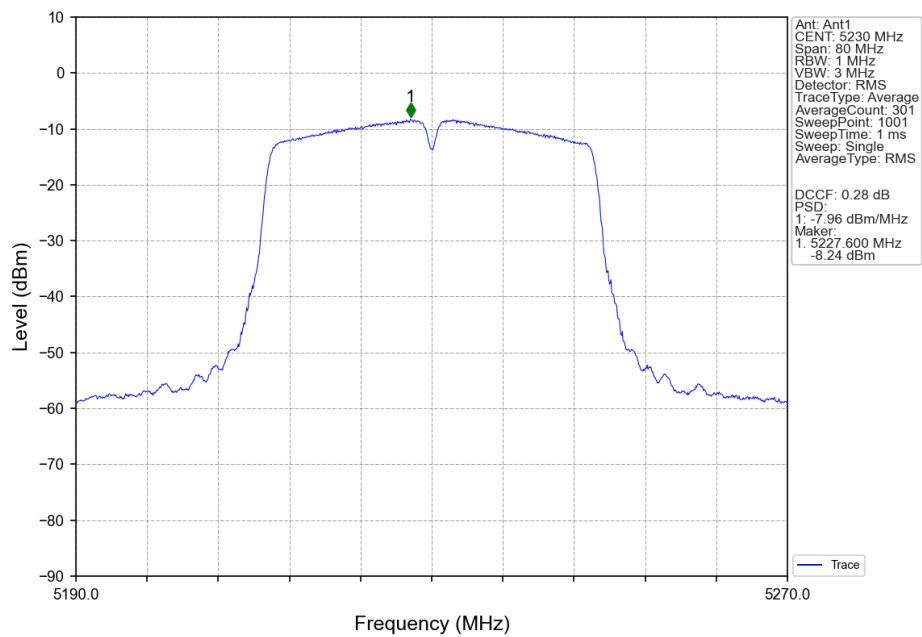


802.11ac(VHT40) LCH 5270MHz Ant1 NTN

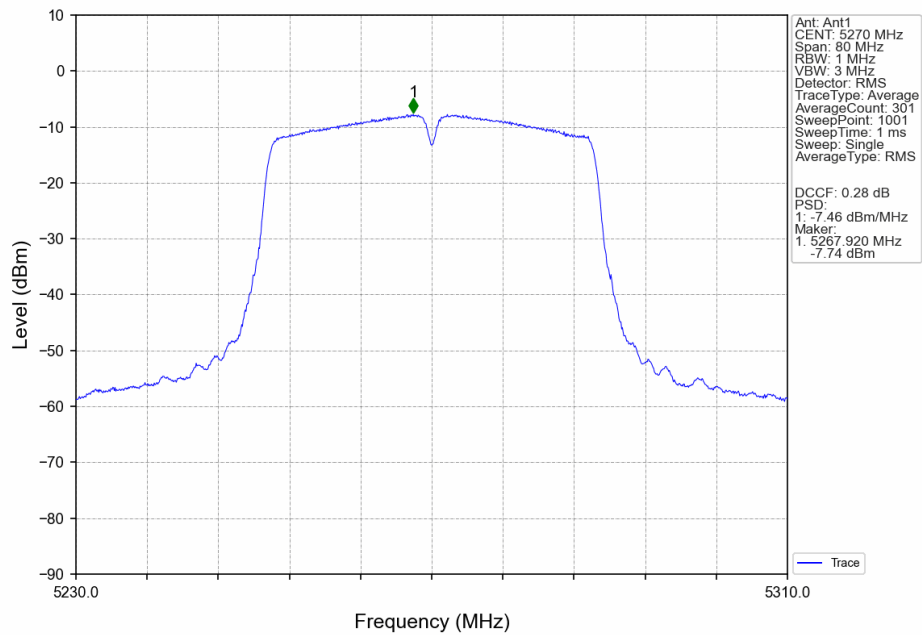


802.11ac(VHT40) HCH 5310MHz Ant1 NTN

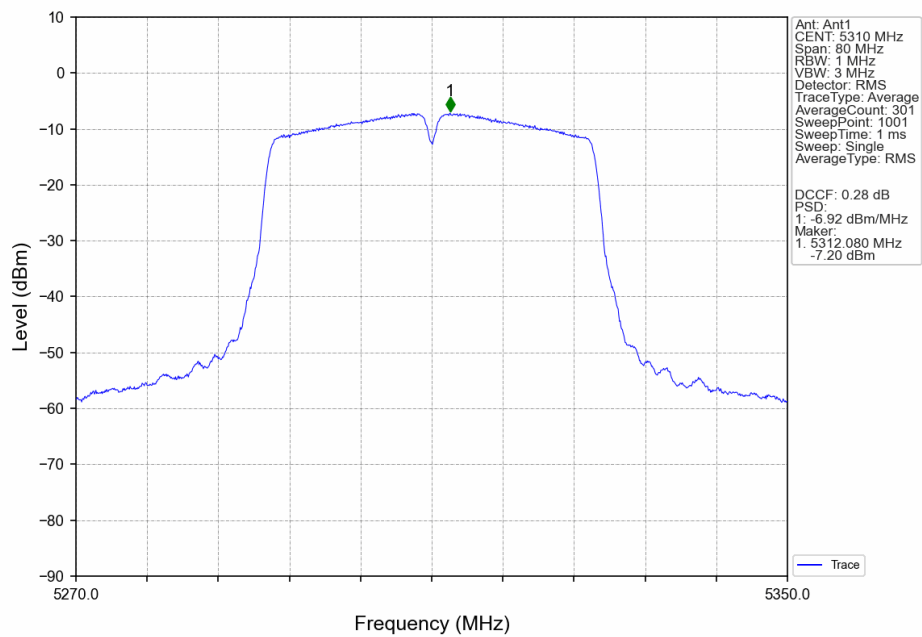


802.11ac(VHT40) LCH 5510MHz Ant1 NTNV

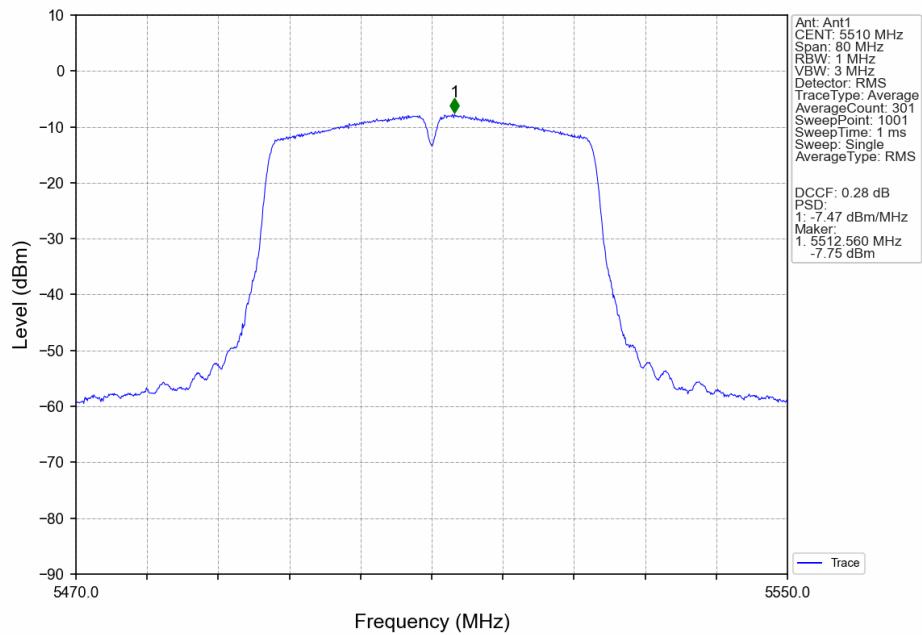


802.11ac(VHT40) MCH 5550MHz Ant1 NTNV

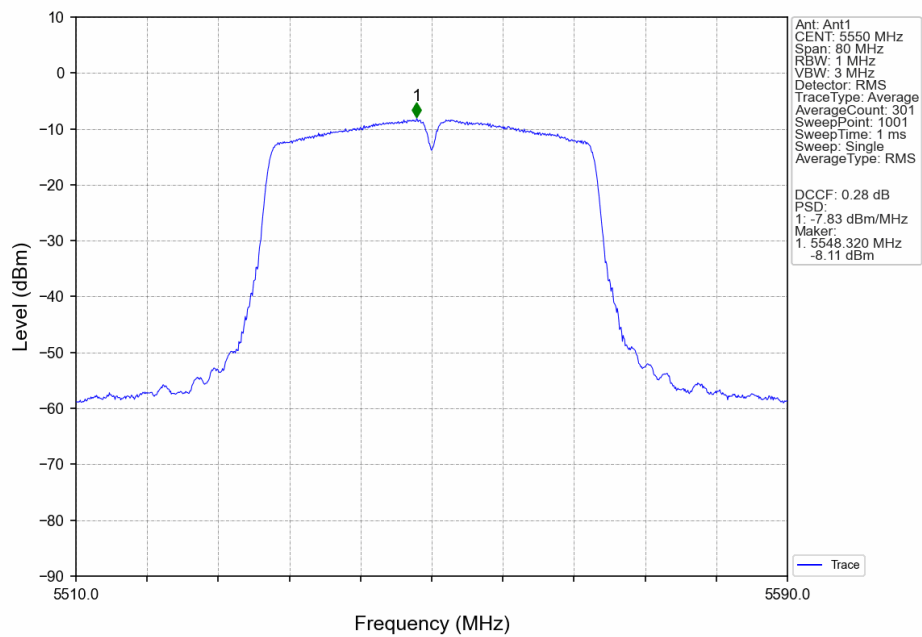


802.11ac(VHT40) HCH 5670MHz Ant1 NTN

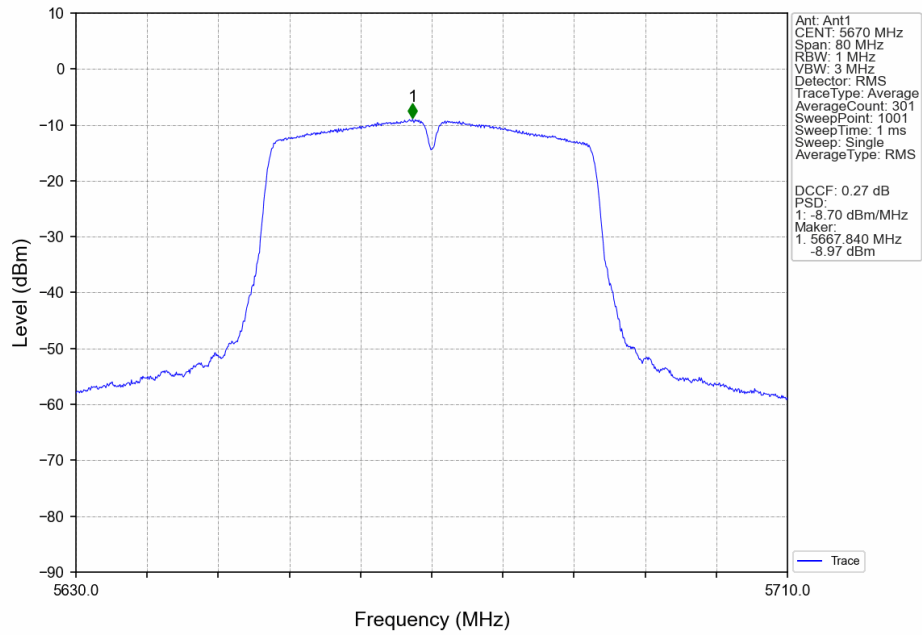


802.11ac(VHT80) MCH 5210MHz Ant1 NTN

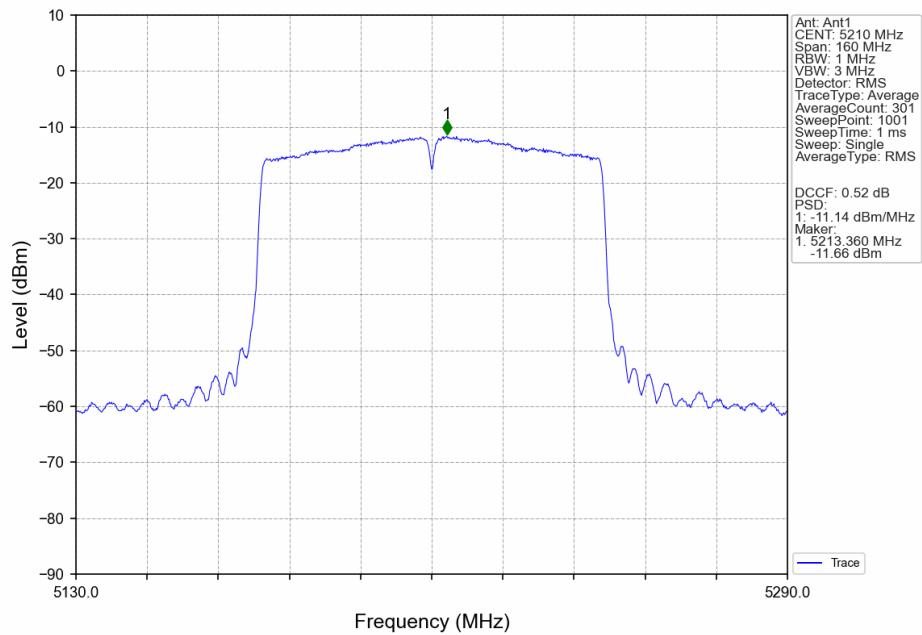


802.11ac(VHT80) MCH 5290MHz Ant1 NTN

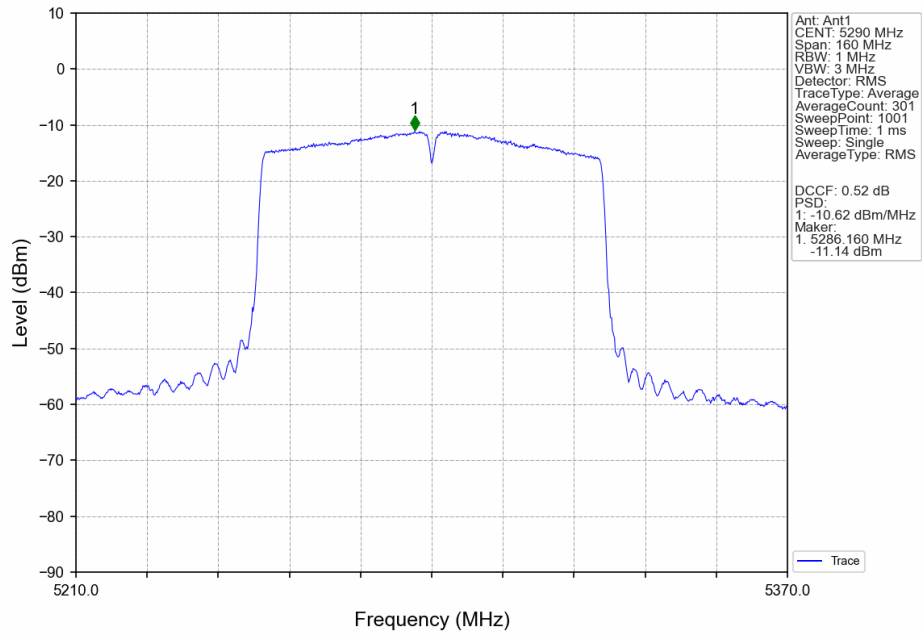

802.11ac(VHT80) LCH 5530MHz Ant1 NTN

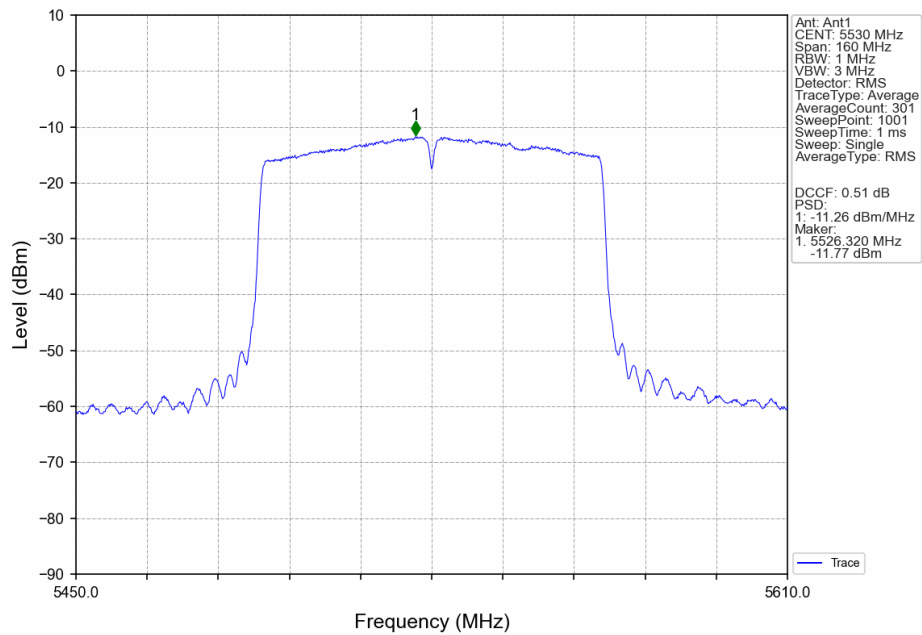


802.11ac(VHT80) HCH 5610MHz Ant1 NTN

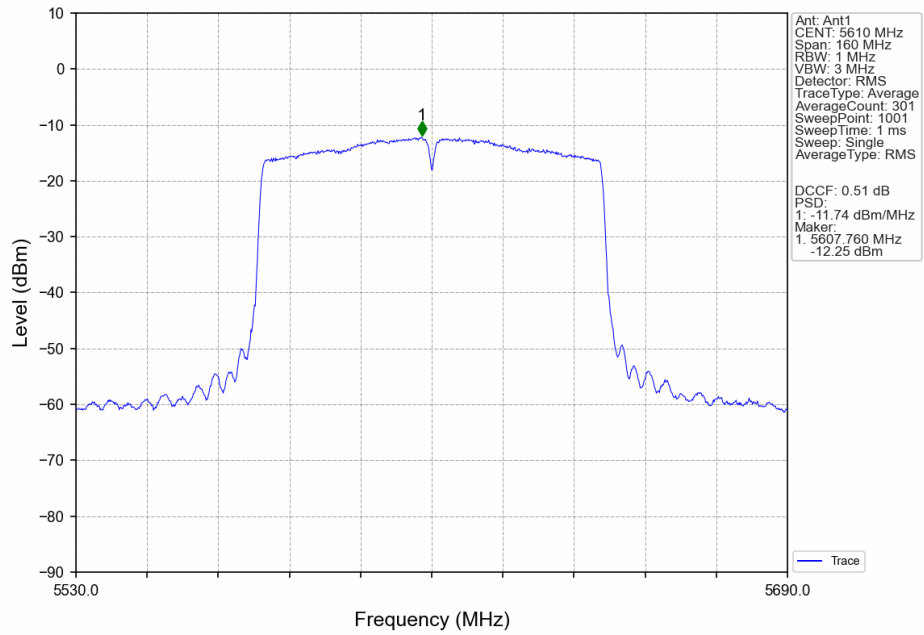


4.2.2 PSD-Band3


802.11a LCH 5745MHz Ant1 NTN

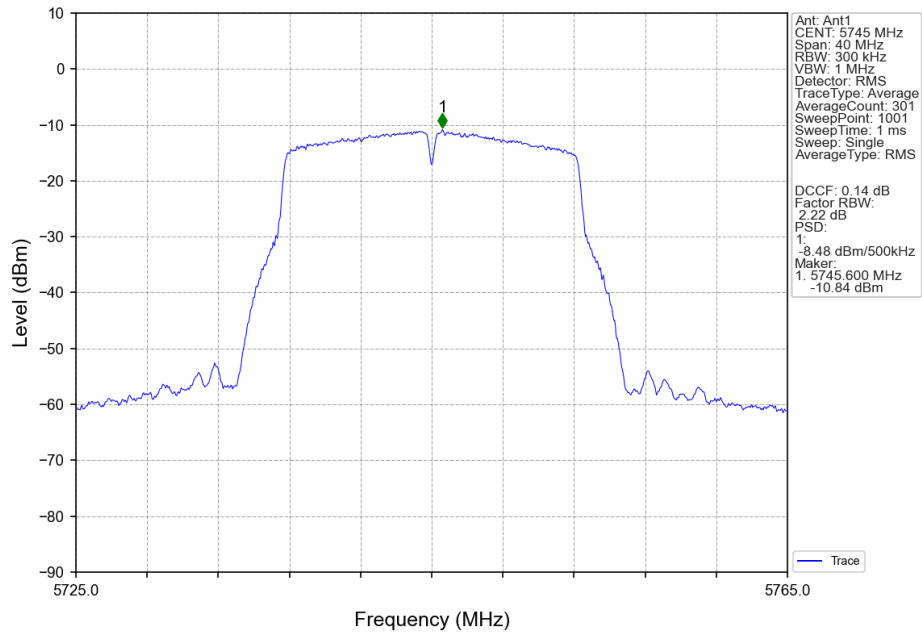


802.11a MCH 5785MHz Ant1 NTN

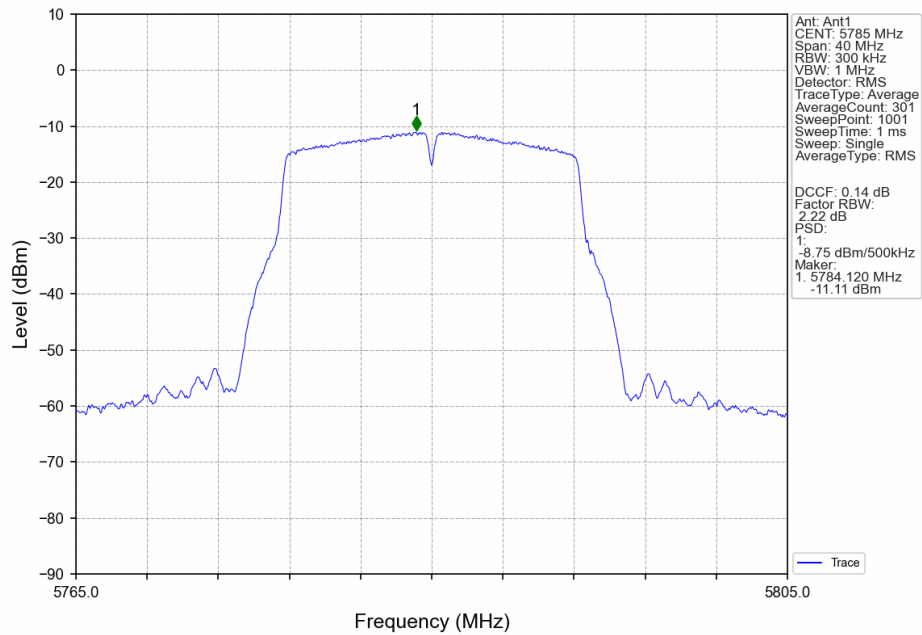


802.11a HCH 5825MHz Ant1 NTN

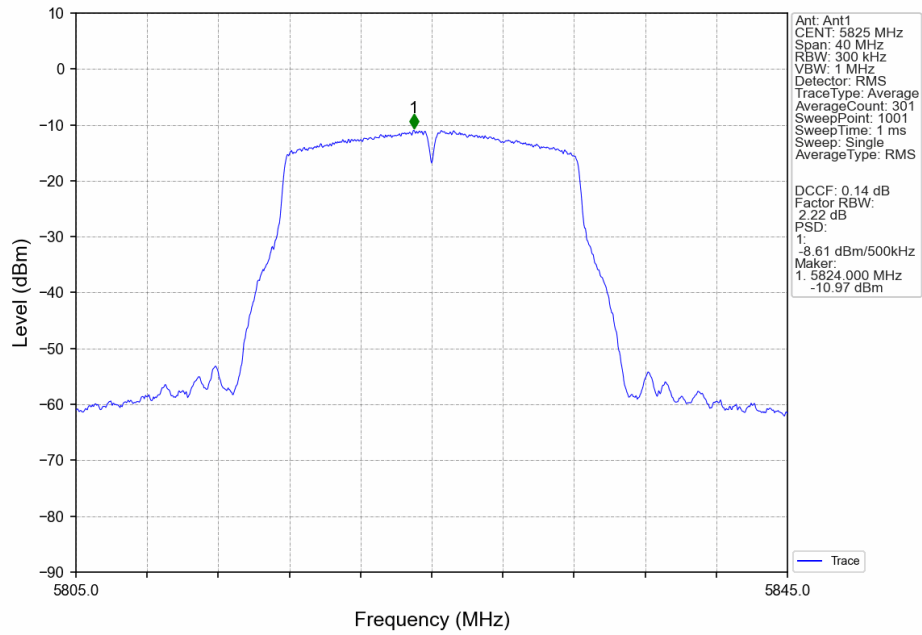


802.11n(HT20) LCH 5745MHz Ant1 NTN

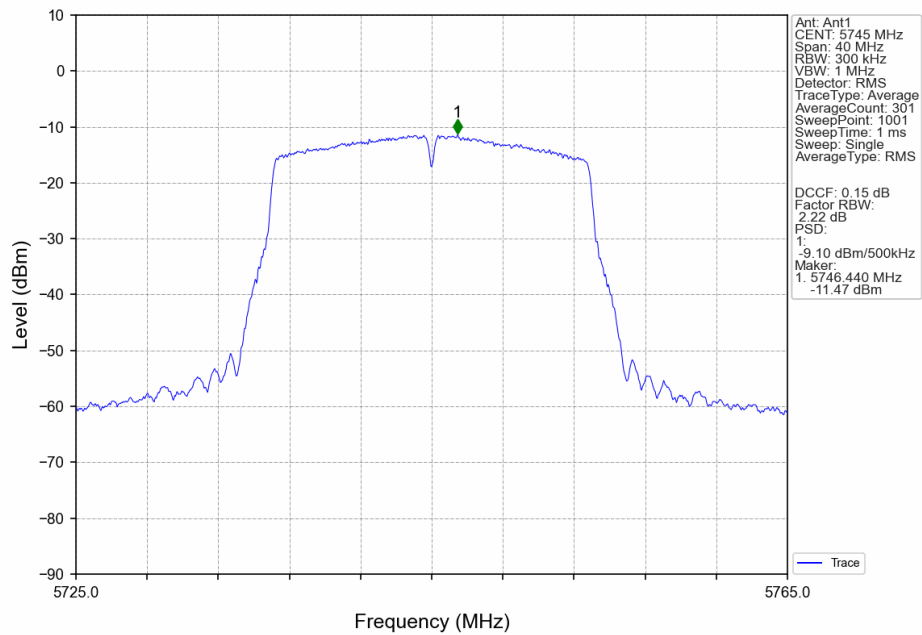


802.11n(HT20) MCH 5785MHz Ant1 NTNv

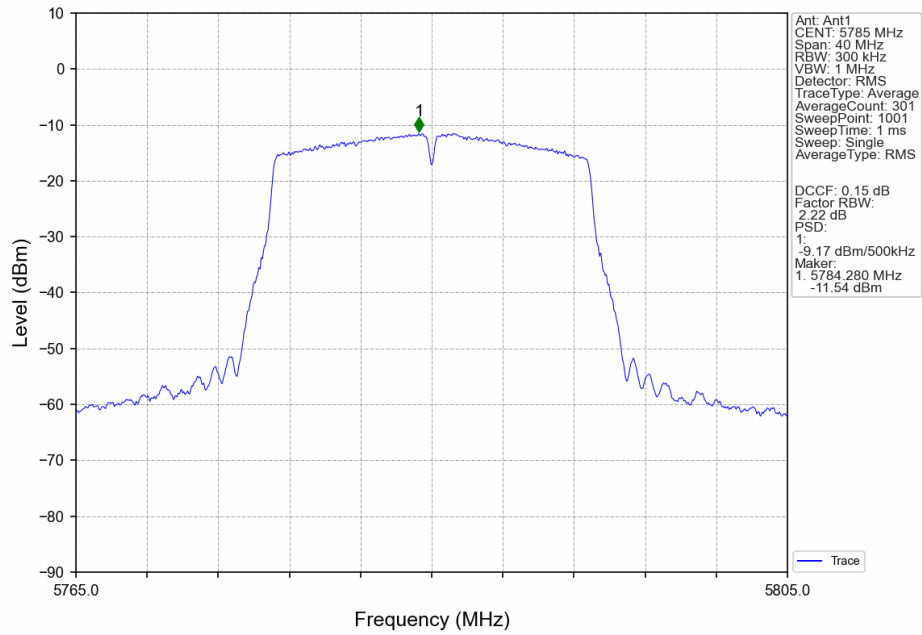


802.11n(HT20) HCH 5825MHz Ant1 NTNv

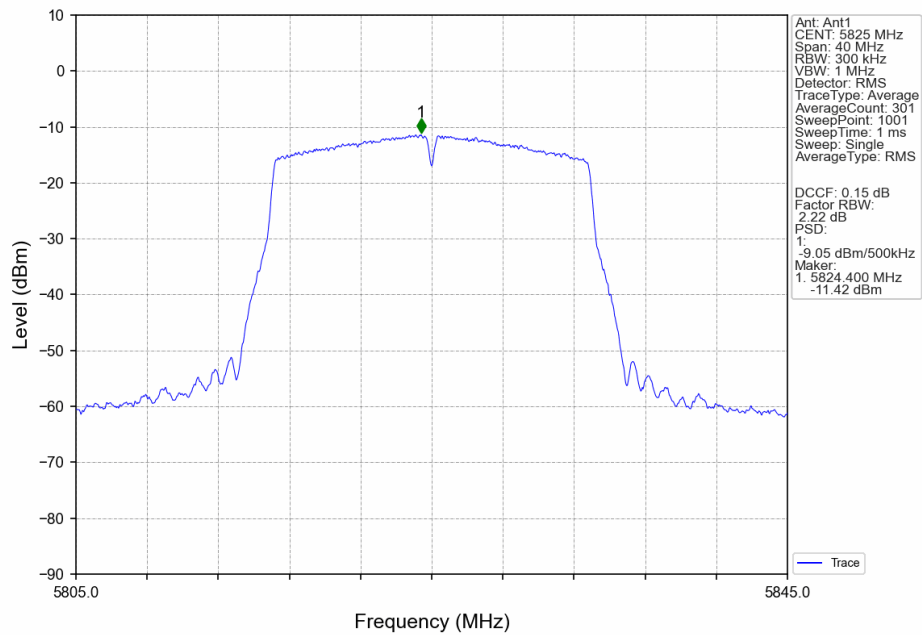


802.11n(HT40) LCH 5755MHz Ant1 NTN

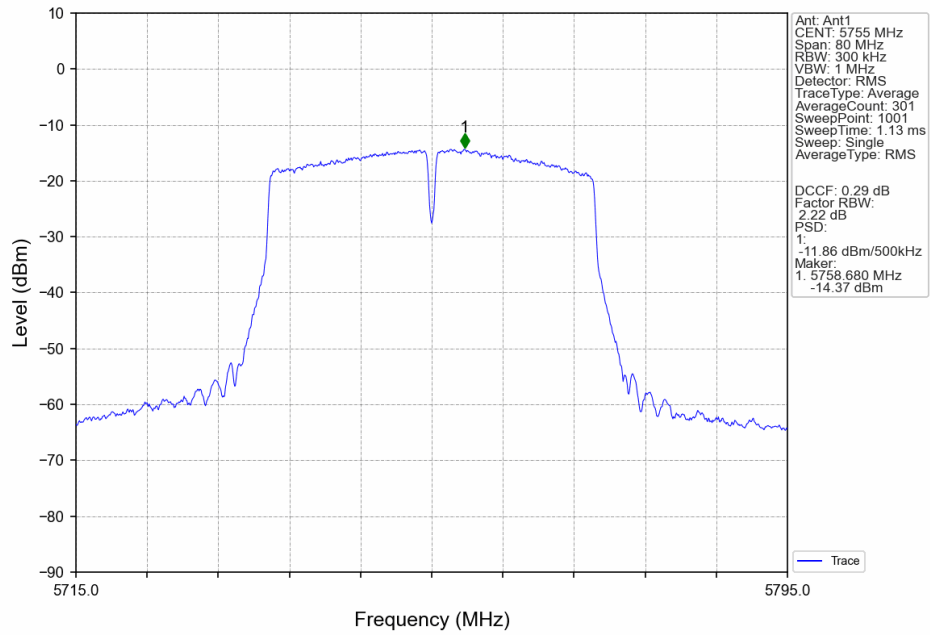


802.11n(HT40) HCH 5795MHz Ant1 NTN

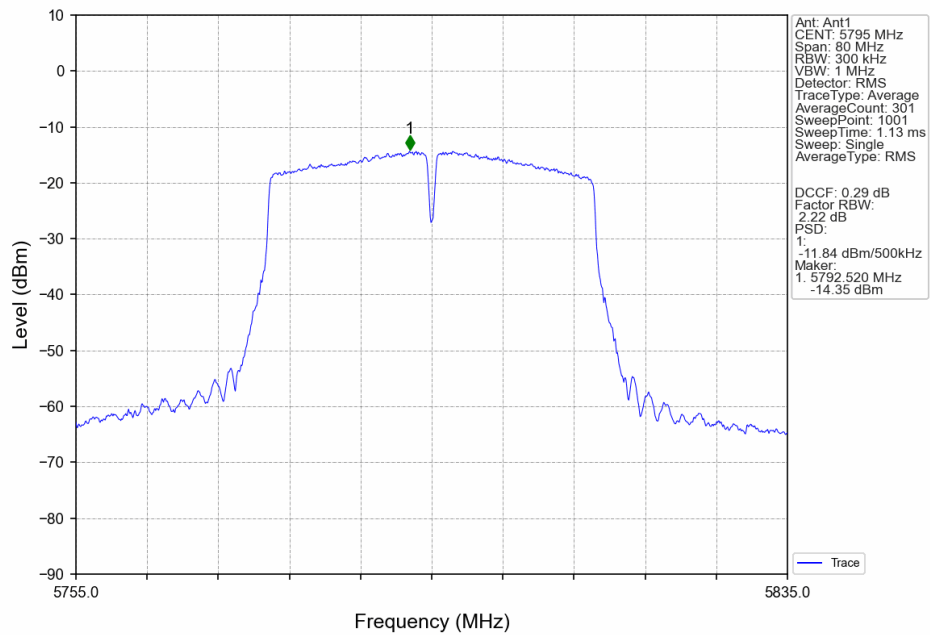


802.11ac(VHT20) LCH 5745MHz Ant1 NTNV

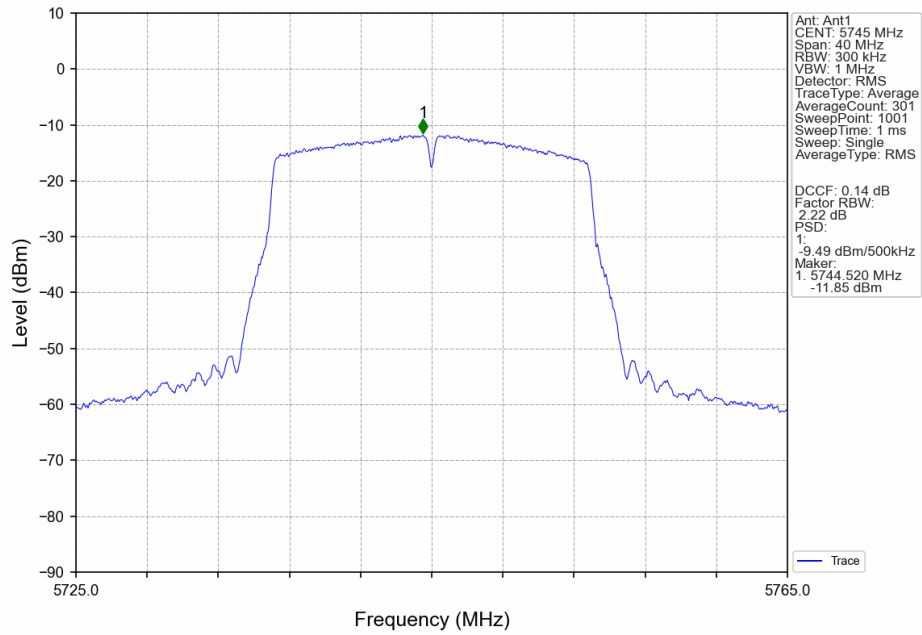


802.11ac(VHT20) MCH 5785MHz Ant1 NTNV

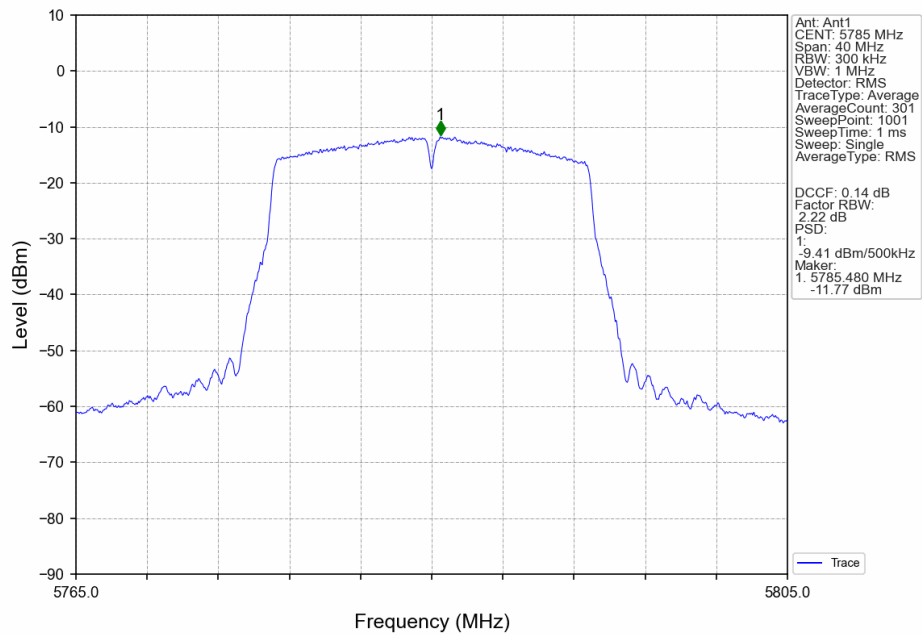


802.11ac(VHT20) HCH 5825MHz Ant1 NTN

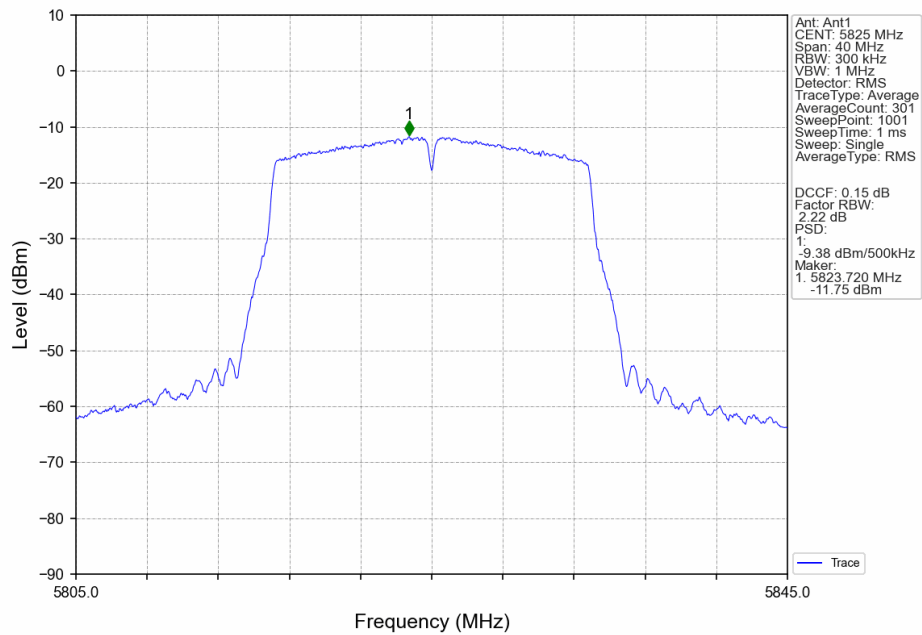


802.11ac(VHT40) LCH 5755MHz Ant1 NTN

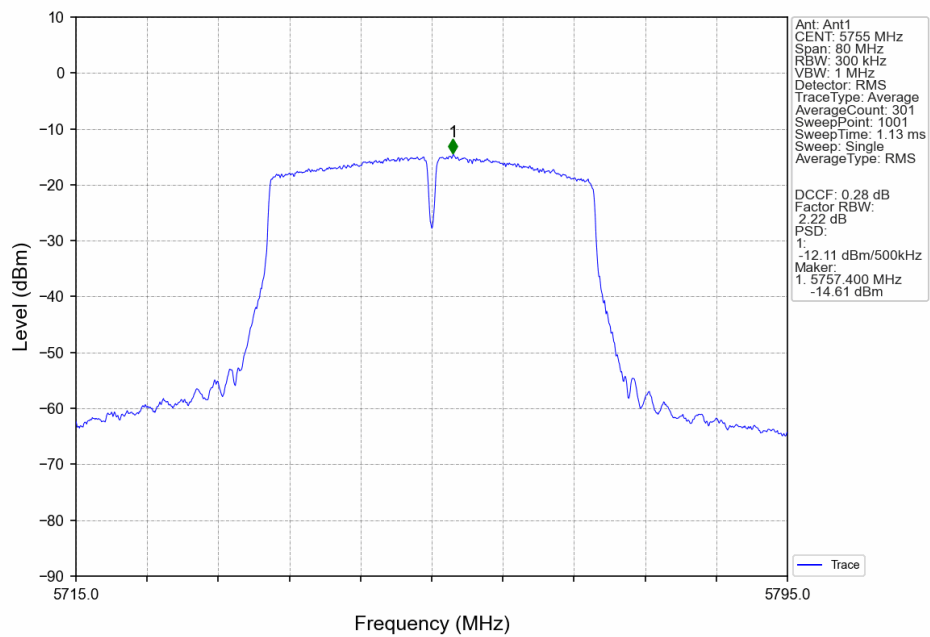

802.11ac(VHT40) HCH 5795MHz Ant1 NTN

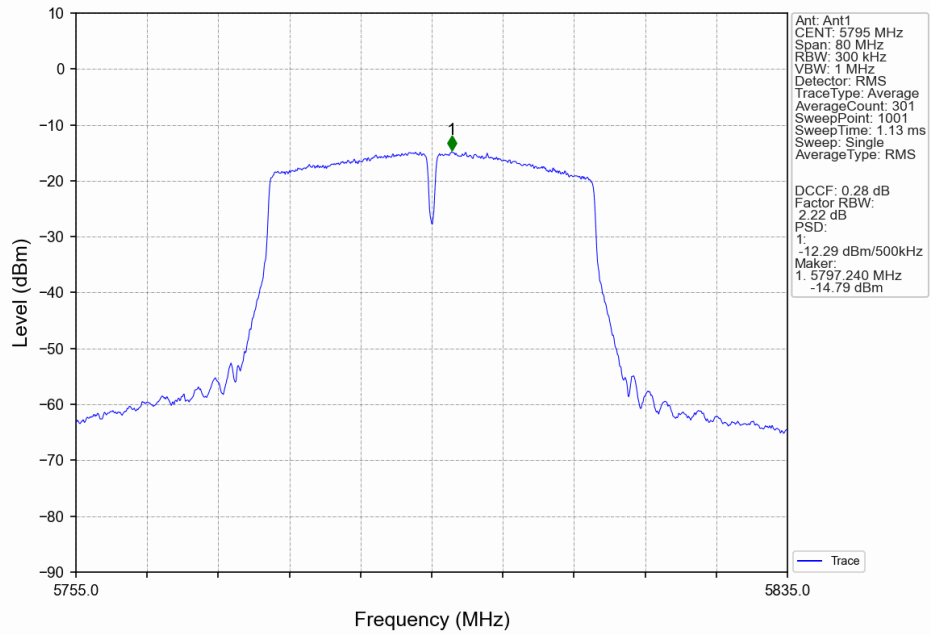

802.11ac(VHT80) MCH 5775MHz Ant1 NTN

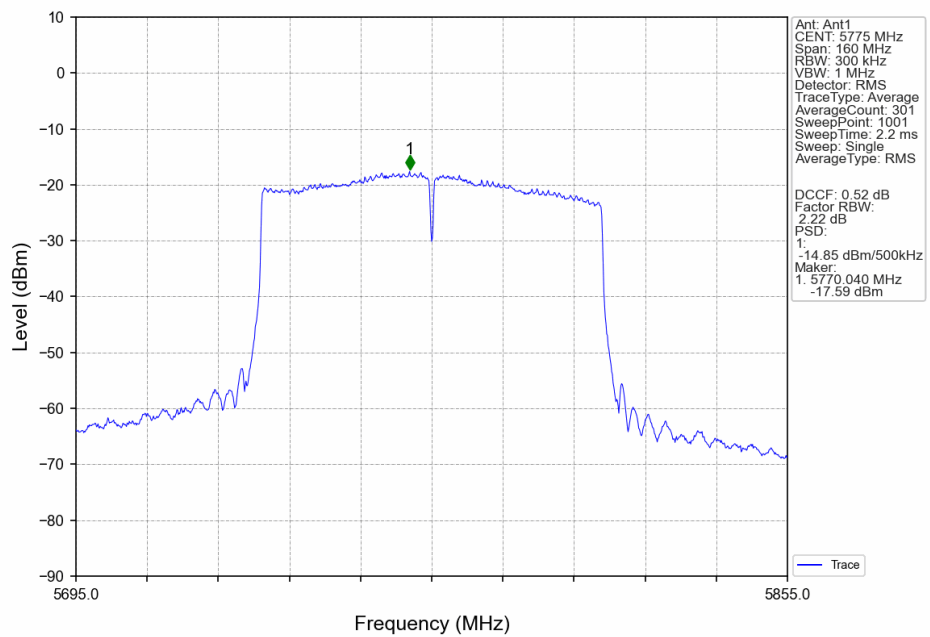

5. Frequency Stability

5.1 Test Result

5.1.1 Ant1

Ant1							
Mode	TX Type	Frequency (MHz)	Temperature (°C)	Voltage	Measured Frequency (MHz)	Limit (MHz)	Verdict
Carrier Wave	SISO	5180	20	LV	5179.993	5150 to 5250	Pass
				NV	5179.993	5150 to 5250	Pass
				HV	5179.993	5150 to 5250	Pass
			-30	NV	5179.992	5150 to 5250	Pass
			-20	NV	5179.992	5150 to 5250	Pass
			-10	NV	5179.992	5150 to 5250	Pass
			0	NV	5179.992	5150 to 5250	Pass
			10	NV	5179.992	5150 to 5250	Pass
			30	NV	5179.992	5150 to 5250	Pass
			40	NV	5179.992	5150 to 5250	Pass
			50	NV	5179.992	5150 to 5250	Pass
		5200	20	LV	5199.991	5150 to 5250	Pass
				NV	5199.991	5150 to 5250	Pass
				HV	5199.990	5150 to 5250	Pass
			-30	NV	5199.990	5150 to 5250	Pass
			-20	NV	5199.990	5150 to 5250	Pass
			-10	NV	5199.990	5150 to 5250	Pass
			0	NV	5199.990	5150 to 5250	Pass
			10	NV	5199.990	5150 to 5250	Pass
			30	NV	5199.990	5150 to 5250	Pass
			40	NV	5199.990	5150 to 5250	Pass
			50	NV	5199.990	5150 to 5250	Pass
		5240	20	LV	5239.989	5150 to 5250	Pass
				NV	5239.988	5150 to 5250	Pass
				HV	5239.988	5150 to 5250	Pass
			-30	NV	5239.988	5150 to 5250	Pass
			-20	NV	5239.988	5150 to 5250	Pass
			-10	NV	5239.988	5150 to 5250	Pass
			0	NV	5239.988	5150 to 5250	Pass
			10	NV	5239.988	5150 to 5250	Pass
			30	NV	5239.988	5150 to 5250	Pass
			40	NV	5239.988	5150 to 5250	Pass
			50	NV	5239.988	5150 to 5250	Pass
		5260	20	LV	5259.986	5250 to 5350	Pass
				NV	5259.986	5250 to 5350	Pass
				HV	5259.986	5250 to 5350	Pass
			-30	NV	5259.986	5250 to 5350	Pass
			-20	NV	5259.985	5250 to 5350	Pass
			-10	NV	5259.985	5250 to 5350	Pass
			0	NV	5259.985	5250 to 5350	Pass
			10	NV	5259.985	5250 to 5350	Pass
			30	NV	5259.985	5250 to 5350	Pass
			40	NV	5259.985	5250 to 5350	Pass
			50	NV	5259.985	5250 to 5350	Pass
		5300	20	LV	5299.983	5250 to 5350	Pass
				NV	5299.983	5250 to 5350	Pass

				HV	5299.983	5250 to 5350	Pass
			-30	NV	5299.983	5250 to 5350	Pass
			-20	NV	5299.983	5250 to 5350	Pass
			-10	NV	5299.983	5250 to 5350	Pass
			0	NV	5299.983	5250 to 5350	Pass
			10	NV	5299.983	5250 to 5350	Pass
			30	NV	5299.983	5250 to 5350	Pass
			40	NV	5299.983	5250 to 5350	Pass
			50	NV	5299.982	5250 to 5350	Pass
		5320	20	LV	5319.982	5250 to 5350	Pass
				NV	5319.982	5250 to 5350	Pass
				HV	5319.982	5250 to 5350	Pass
			-30	NV	5319.982	5250 to 5350	Pass
			-20	NV	5319.982	5250 to 5350	Pass
			-10	NV	5319.982	5250 to 5350	Pass
			0	NV	5319.982	5250 to 5350	Pass
			10	NV	5319.982	5250 to 5350	Pass
			30	NV	5319.982	5250 to 5350	Pass
			40	NV	5319.982	5250 to 5350	Pass
			50	NV	5319.982	5250 to 5350	Pass
		5500	20	LV	5499.998	5470 to 5725	Pass
				NV	5499.997	5470 to 5725	Pass
				HV	5499.997	5470 to 5725	Pass
			-30	NV	5499.997	5470 to 5725	Pass
			-20	NV	5499.997	5470 to 5725	Pass
			-10	NV	5499.996	5470 to 5725	Pass
			0	NV	5499.996	5470 to 5725	Pass
			10	NV	5499.996	5470 to 5725	Pass
			30	NV	5499.996	5470 to 5725	Pass
			40	NV	5499.995	5470 to 5725	Pass
			50	NV	5499.995	5470 to 5725	Pass
		5580	20	LV	5579.991	5470 to 5725	Pass
				NV	5579.991	5470 to 5725	Pass
				HV	5579.991	5470 to 5725	Pass
			-30	NV	5579.991	5470 to 5725	Pass
			-20	NV	5579.991	5470 to 5725	Pass
			-10	NV	5579.991	5470 to 5725	Pass
			0	NV	5579.991	5470 to 5725	Pass
			10	NV	5579.991	5470 to 5725	Pass
			30	NV	5579.991	5470 to 5725	Pass
			40	NV	5579.991	5470 to 5725	Pass
			50	NV	5579.991	5470 to 5725	Pass
		5700	20	LV	5699.990	5470 to 5725	Pass
				NV	5699.990	5470 to 5725	Pass
				HV	5699.990	5470 to 5725	Pass
			-30	NV	5699.990	5470 to 5725	Pass
			-20	NV	5699.990	5470 to 5725	Pass
			-10	NV	5699.990	5470 to 5725	Pass
			0	NV	5699.990	5470 to 5725	Pass
			10	NV	5699.990	5470 to 5725	Pass
			30	NV	5699.990	5470 to 5725	Pass
			40	NV	5699.990	5470 to 5725	Pass
			50	NV	5699.989	5470 to 5725	Pass
		5745	20	LV	5744.989	5725 to 5850	Pass
				NV	5744.989	5725 to 5850	Pass
				HV	5744.989	5725 to 5850	Pass
			-30	NV	5744.989	5725 to 5850	Pass
			-20	NV	5744.989	5725 to 5850	Pass
			-10	NV	5744.989	5725 to 5850	Pass

			0	NV	5744.989	5725 to 5850	Pass
			10	NV	5744.989	5725 to 5850	Pass
			30	NV	5744.989	5725 to 5850	Pass
			40	NV	5744.989	5725 to 5850	Pass
			50	NV	5744.989	5725 to 5850	Pass
		5785	20	LV	5784.989	5725 to 5850	Pass
				NV	5784.988	5725 to 5850	Pass
				HV	5784.988	5725 to 5850	Pass
			-30	NV	5784.988	5725 to 5850	Pass
			-20	NV	5784.988	5725 to 5850	Pass
			-10	NV	5784.988	5725 to 5850	Pass
			0	NV	5784.988	5725 to 5850	Pass
			10	NV	5784.988	5725 to 5850	Pass
			30	NV	5784.988	5725 to 5850	Pass
			40	NV	5784.988	5725 to 5850	Pass
			50	NV	5784.988	5725 to 5850	Pass
		5825	20	LV	5824.987	5725 to 5850	Pass
				NV	5824.987	5725 to 5850	Pass
				HV	5824.987	5725 to 5850	Pass
			-30	NV	5824.987	5725 to 5850	Pass
			-20	NV	5824.987	5725 to 5850	Pass
			-10	NV	5824.987	5725 to 5850	Pass
			0	NV	5824.987	5725 to 5850	Pass
			10	NV	5824.987	5725 to 5850	Pass
			30	NV	5824.987	5725 to 5850	Pass
			40	NV	5824.987	5725 to 5850	Pass
			50	NV	5824.987	5725 to 5850	Pass
		5190	20	LV	5189.988	5150 to 5250	Pass
				NV	5189.988	5150 to 5250	Pass
				HV	5189.988	5150 to 5250	Pass
			-30	NV	5189.988	5150 to 5250	Pass
			-20	NV	5189.988	5150 to 5250	Pass
			-10	NV	5189.988	5150 to 5250	Pass
			0	NV	5189.988	5150 to 5250	Pass
			10	NV	5189.988	5150 to 5250	Pass
			30	NV	5189.988	5150 to 5250	Pass
			40	NV	5189.988	5150 to 5250	Pass
			50	NV	5189.988	5150 to 5250	Pass
		5230	20	LV	5229.987	5150 to 5250	Pass
				NV	5229.987	5150 to 5250	Pass
				HV	5229.987	5150 to 5250	Pass
			-30	NV	5229.987	5150 to 5250	Pass
			-20	NV	5229.987	5150 to 5250	Pass
			-10	NV	5229.987	5150 to 5250	Pass
			0	NV	5229.987	5150 to 5250	Pass
			10	NV	5229.987	5150 to 5250	Pass
			30	NV	5229.987	5150 to 5250	Pass
			40	NV	5229.987	5150 to 5250	Pass
			50	NV	5229.987	5150 to 5250	Pass
		5270	20	LV	5269.987	5250 to 5350	Pass
				NV	5269.987	5250 to 5350	Pass
				HV	5269.987	5250 to 5350	Pass
			-30	NV	5269.987	5250 to 5350	Pass
			-20	NV	5269.987	5250 to 5350	Pass
			-10	NV	5269.987	5250 to 5350	Pass
			0	NV	5269.987	5250 to 5350	Pass
			10	NV	5269.987	5250 to 5350	Pass
			30	NV	5269.987	5250 to 5350	Pass
			40	NV	5269.987	5250 to 5350	Pass

			50	NV	5269.987	5250 to 5350	Pass
		5310	20	LV	5309.987	5250 to 5350	Pass
				NV	5309.987	5250 to 5350	Pass
				HV	5309.987	5250 to 5350	Pass
			-30	NV	5309.987	5250 to 5350	Pass
			-20	NV	5309.987	5250 to 5350	Pass
			-10	NV	5309.986	5250 to 5350	Pass
			0	NV	5309.987	5250 to 5350	Pass
			10	NV	5309.986	5250 to 5350	Pass
			30	NV	5309.986	5250 to 5350	Pass
			40	NV	5309.986	5250 to 5350	Pass
			50	NV	5309.986	5250 to 5350	Pass
		5510	20	LV	5509.986	5470 to 5725	Pass
				NV	5509.986	5470 to 5725	Pass
				HV	5509.986	5470 to 5725	Pass
			-30	NV	5509.986	5470 to 5725	Pass
			-20	NV	5509.986	5470 to 5725	Pass
			-10	NV	5509.986	5470 to 5725	Pass
			0	NV	5509.986	5470 to 5725	Pass
			10	NV	5509.986	5470 to 5725	Pass
			30	NV	5509.986	5470 to 5725	Pass
			40	NV	5509.986	5470 to 5725	Pass
			50	NV	5509.986	5470 to 5725	Pass
		5550	20	LV	5549.986	5470 to 5725	Pass
				NV	5549.985	5470 to 5725	Pass
				HV	5549.986	5470 to 5725	Pass
			-30	NV	5549.985	5470 to 5725	Pass
			-20	NV	5549.985	5470 to 5725	Pass
			-10	NV	5549.985	5470 to 5725	Pass
			0	NV	5549.985	5470 to 5725	Pass
			10	NV	5549.985	5470 to 5725	Pass
			30	NV	5549.985	5470 to 5725	Pass
			40	NV	5549.985	5470 to 5725	Pass
			50	NV	5549.985	5470 to 5725	Pass
		5670	20	LV	5669.985	5470 to 5725	Pass
				NV	5669.985	5470 to 5725	Pass
				HV	5669.985	5470 to 5725	Pass
			-30	NV	5669.985	5470 to 5725	Pass
			-20	NV	5669.985	5470 to 5725	Pass
			-10	NV	5669.985	5470 to 5725	Pass
			0	NV	5669.985	5470 to 5725	Pass
			10	NV	5669.985	5470 to 5725	Pass
			30	NV	5669.985	5470 to 5725	Pass
			40	NV	5669.985	5470 to 5725	Pass
			50	NV	5669.985	5470 to 5725	Pass
		5755	20	LV	5754.985	5725 to 5850	Pass
				NV	5754.984	5725 to 5850	Pass
				HV	5754.984	5725 to 5850	Pass
			-30	NV	5754.984	5725 to 5850	Pass
			-20	NV	5754.984	5725 to 5850	Pass
			-10	NV	5754.984	5725 to 5850	Pass
			0	NV	5754.984	5725 to 5850	Pass
			10	NV	5754.984	5725 to 5850	Pass
			30	NV	5754.984	5725 to 5850	Pass
			40	NV	5754.984	5725 to 5850	Pass
			50	NV	5754.984	5725 to 5850	Pass
		5795	20	LV	5794.984	5725 to 5850	Pass
				NV	5794.984	5725 to 5850	Pass
				HV	5794.984	5725 to 5850	Pass

			-30	NV	5794.984	5725 to 5850	Pass
			-20	NV	5794.984	5725 to 5850	Pass
			-10	NV	5794.984	5725 to 5850	Pass
			0	NV	5794.984	5725 to 5850	Pass
			10	NV	5794.984	5725 to 5850	Pass
			30	NV	5794.984	5725 to 5850	Pass
			40	NV	5794.984	5725 to 5850	Pass
			50	NV	5794.984	5725 to 5850	Pass
		5210	20	LV	5209.985	5150 to 5250	Pass
				NV	5209.985	5150 to 5250	Pass
				HV	5209.985	5150 to 5250	Pass
			-30	NV	5209.985	5150 to 5250	Pass
			-20	NV	5209.985	5150 to 5250	Pass
			-10	NV	5209.985	5150 to 5250	Pass
			0	NV	5209.985	5150 to 5250	Pass
			10	NV	5209.985	5150 to 5250	Pass
			30	NV	5209.985	5150 to 5250	Pass
			40	NV	5209.985	5150 to 5250	Pass
			50	NV	5209.985	5150 to 5250	Pass
		5290	20	LV	5289.985	5250 to 5350	Pass
				NV	5289.985	5250 to 5350	Pass
				HV	5289.985	5250 to 5350	Pass
			-30	NV	5289.985	5250 to 5350	Pass
			-20	NV	5289.985	5250 to 5350	Pass
			-10	NV	5289.985	5250 to 5350	Pass
			0	NV	5289.985	5250 to 5350	Pass
			10	NV	5289.985	5250 to 5350	Pass
			30	NV	5289.985	5250 to 5350	Pass
			40	NV	5289.985	5250 to 5350	Pass
			50	NV	5289.985	5250 to 5350	Pass
		5530	20	LV	5529.984	5470 to 5725	Pass
				NV	5529.984	5470 to 5725	Pass
				HV	5529.984	5470 to 5725	Pass
			-30	NV	5529.984	5470 to 5725	Pass
			-20	NV	5529.984	5470 to 5725	Pass
			-10	NV	5529.984	5470 to 5725	Pass
			0	NV	5529.984	5470 to 5725	Pass
			10	NV	5529.984	5470 to 5725	Pass
			30	NV	5529.984	5470 to 5725	Pass
			40	NV	5529.984	5470 to 5725	Pass
			50	NV	5529.984	5470 to 5725	Pass
		5610	20	LV	5609.984	5470 to 5725	Pass
				NV	5609.984	5470 to 5725	Pass
				HV	5609.984	5470 to 5725	Pass
			-30	NV	5609.984	5470 to 5725	Pass
			-20	NV	5609.984	5470 to 5725	Pass
			-10	NV	5609.984	5470 to 5725	Pass
			0	NV	5609.984	5470 to 5725	Pass
			10	NV	5609.984	5470 to 5725	Pass
			30	NV	5609.984	5470 to 5725	Pass
			40	NV	5609.984	5470 to 5725	Pass
			50	NV	5609.984	5470 to 5725	Pass
		5775	20	LV	5774.983	5725 to 5850	Pass
				NV	5774.983	5725 to 5850	Pass
				HV	5774.983	5725 to 5850	Pass
			-30	NV	5774.983	5725 to 5850	Pass
			-20	NV	5774.983	5725 to 5850	Pass
			-10	NV	5774.983	5725 to 5850	Pass
			0	NV	5774.983	5725 to 5850	Pass



			10	NV	5774.983	5725 to 5850	Pass
			30	NV	5774.983	5725 to 5850	Pass
			40	NV	5774.983	5725 to 5850	Pass
			50	NV	5774.983	5725 to 5850	Pass

***** End of Report *****