


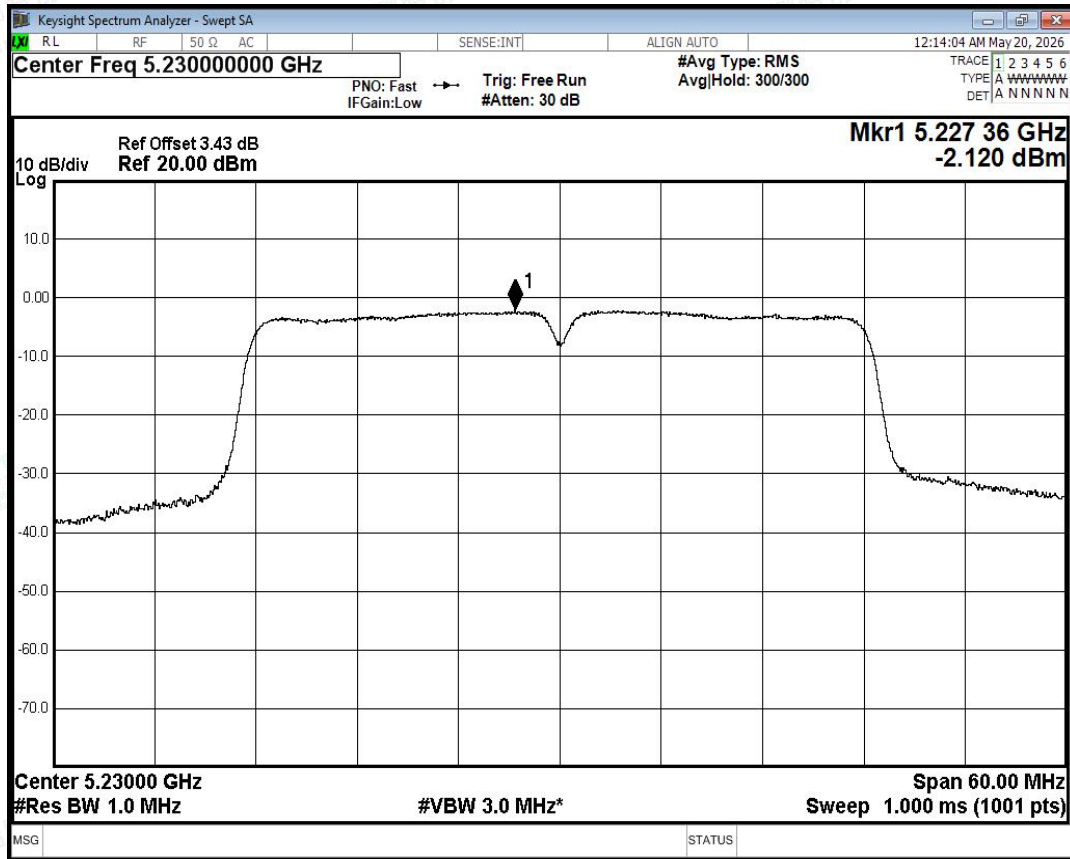


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

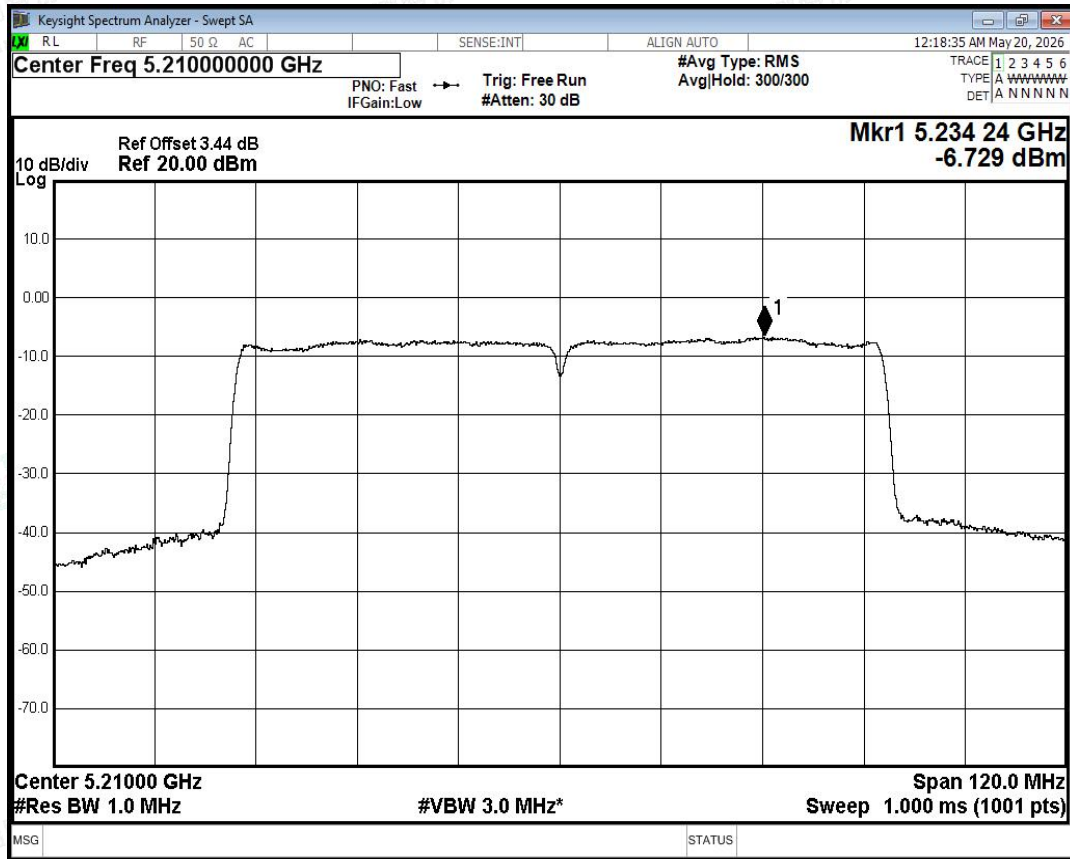

PSD NVNT ac80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-58.07	2.14	39.30	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-65.08	2.14	32.29	Average	54	Pass
NVNT	a	5180	Ant1	5149.6	-39.54	2.14	57.83	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-46.27	2.14	51.10	Average	54	Pass
NVNT	a	5180	Ant1	5150	-39.06	2.14	58.31	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-46.41	2.14	50.96	Average	54	Pass
NVNT	a	5240	Ant1	5350	-46.5	2.14	50.87	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-56.15	2.14	41.22	Average	54	Pass
NVNT	a	5240	Ant1	5350.08	-46.5	2.14	50.87	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350.56	-56.07	2.14	41.30	Average	54	Pass
NVNT	a	5240	Ant1	5460	-48.27	2.14	49.10	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-56.86	2.14	40.51	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-50.6	2.14	46.77	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-58.27	2.14	39.10	Average	54	Pass
NVNT	n20	5180	Ant1	5149.6	-36.35	2.14	61.02	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5149.6	-44.08	2.14	53.29	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-36.66	2.14	60.71	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-43.65	2.14	53.72	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-48.56	2.14	48.81	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-56.14	2.14	41.23	Average	54	Pass
NVNT	n20	5240	Ant1	5446.8	-46.67	2.14	50.70	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350.32	-55.82	2.14	41.55	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-49.5	2.14	47.87	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-56.87	2.14	40.50	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-60.63	2.14	36.74	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-67.95	2.14	29.42	Average	54	Pass
NVNT	n40	5190	Ant1	5149.7	-40.86	2.14	56.51	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-47.83	2.14	49.54	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-39.56	2.14	57.81	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-47.64	2.14	49.73	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-48.51	2.14	48.86	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-55.72	2.14	41.65	Average	54	Pass
NVNT	n40	5230	Ant1	5412.48	-47.14	2.14	50.23	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350.11	-55.72	2.14	41.65	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-49.75	2.14	47.62	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-56.57	2.14	40.80	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-51.77	2.14	45.60	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	4500	-58.21	2.14	39.16	Average	54	Pass
NVNT	ac20	5180	Ant1	5149.6	-36.15	2.14	61.22	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5149.6	-43.89	2.14	53.48	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-35.15	2.14	62.22	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-43.41	2.14	53.96	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-48.62	2.14	48.75	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-56.19	2.14	41.18	Average	54	Pass
NVNT	ac20	5240	Ant1	5425.44	-47.02	2.14	50.35	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5351.28	-55.81	2.14	41.56	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-49.7	2.14	47.67	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-56.73	2.14	40.64	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-50.74	2.14	46.63	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.11	2.14	39.26	Average	54	Pass
NVNT	ac40	5190	Ant1	5149.7	-43.13	2.14	54.24	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5148.97	-48.02	2.14	49.35	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-41.82	2.14	55.55	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-47.62	2.14	49.75	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-48.65	2.14	48.72	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-55.87	2.14	41.50	Average	54	Pass
NVNT	ac40	5230	Ant1	5363.34	-46.75	2.14	50.62	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350.11	-55.87	2.14	41.50	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.36	2.14	49.01	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-56.41	2.14	40.96	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-44.03	2.14	53.34	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-52.43	2.14	44.94	Average	54	Pass
NVNT	ac80	5210	Ant1	5356.05	-42.06	2.14	55.31	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350.44	-52.16	2.14	45.21	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-50.09	2.14	47.28	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-55.84	2.14	41.53	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-52.28	2.14	45.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-57.81	2.14	39.56	Average	54	Pass
NVNT	ac80	5210	Ant1	5148.59	-36.82	2.14	60.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5148.59	-44.91	2.14	52.46	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-37.62	2.14	59.75	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-45.07	2.14	52.30	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

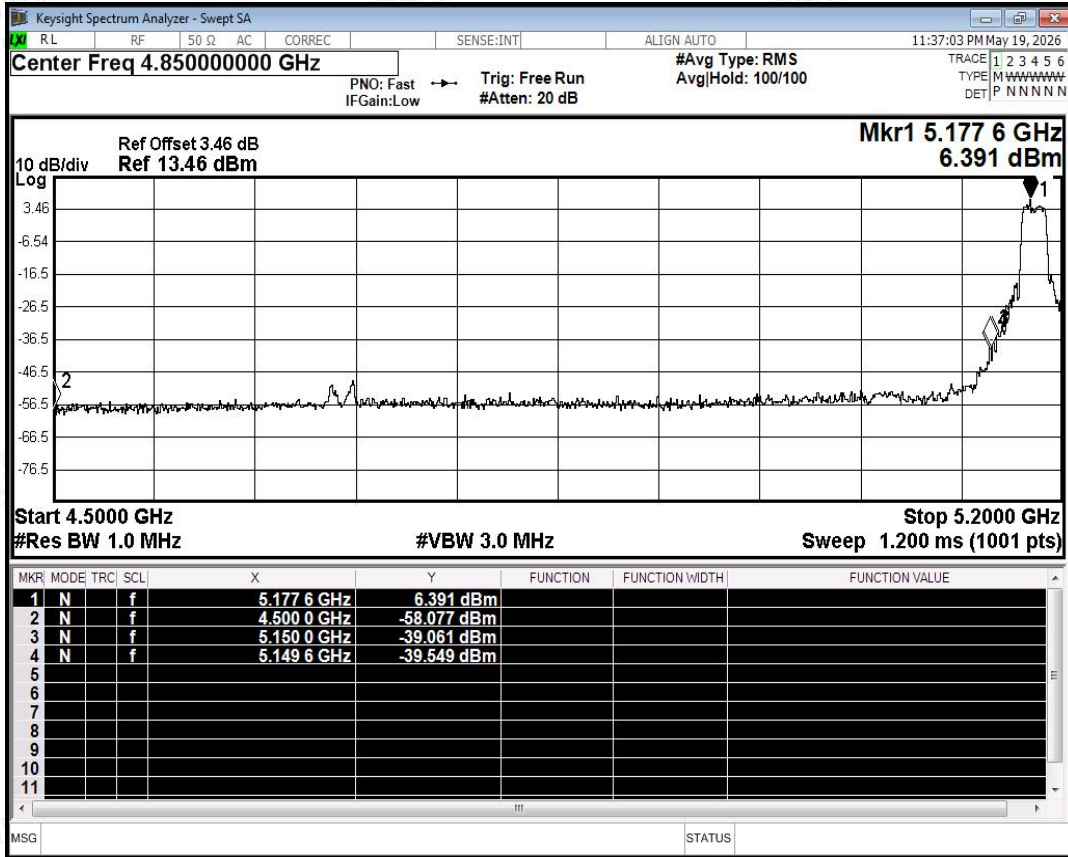

Restrict Band NVNT a 5180MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

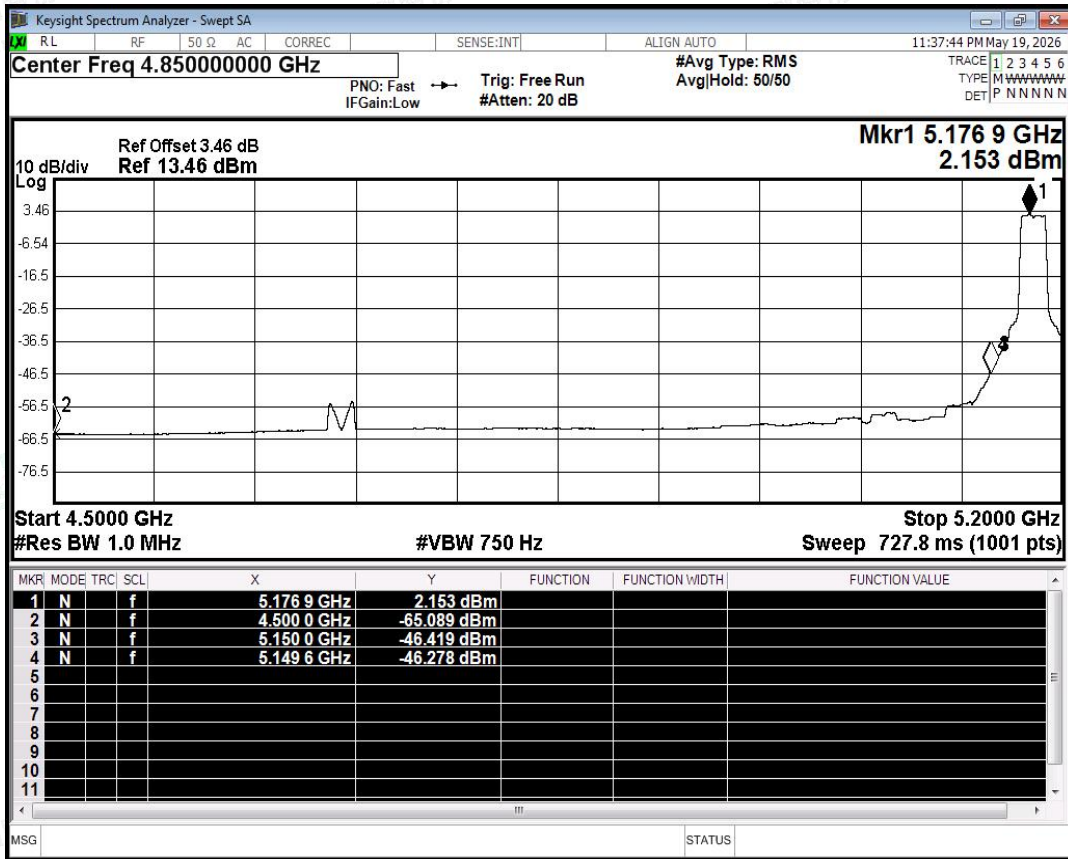

Restrict Band NVNT a 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

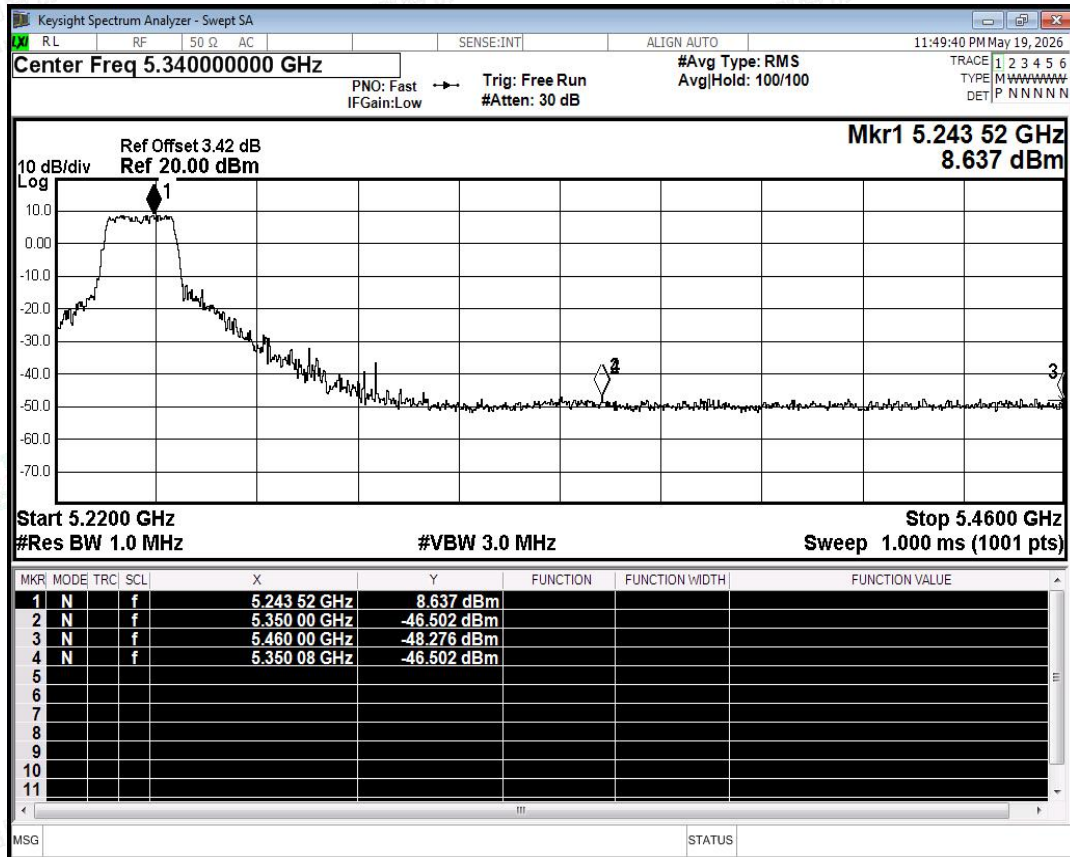

Restrict Band NVNT a 5240MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

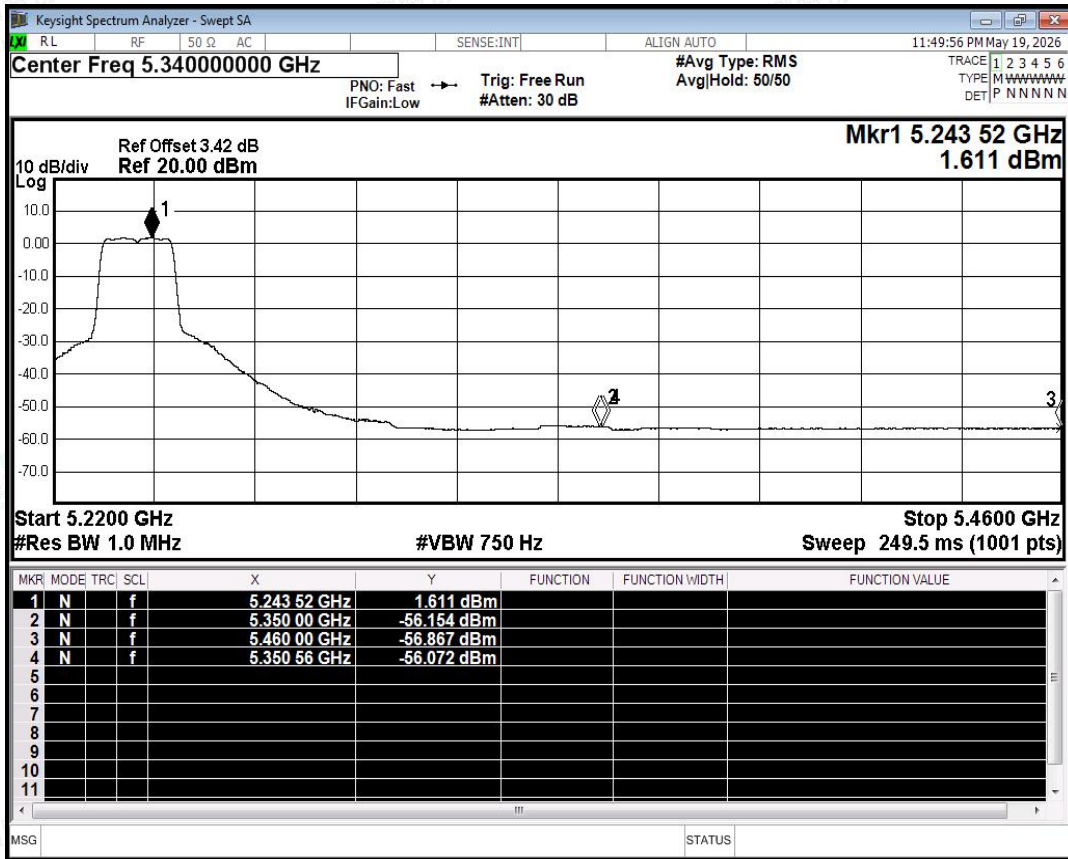

Restrict Band NVNT a 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

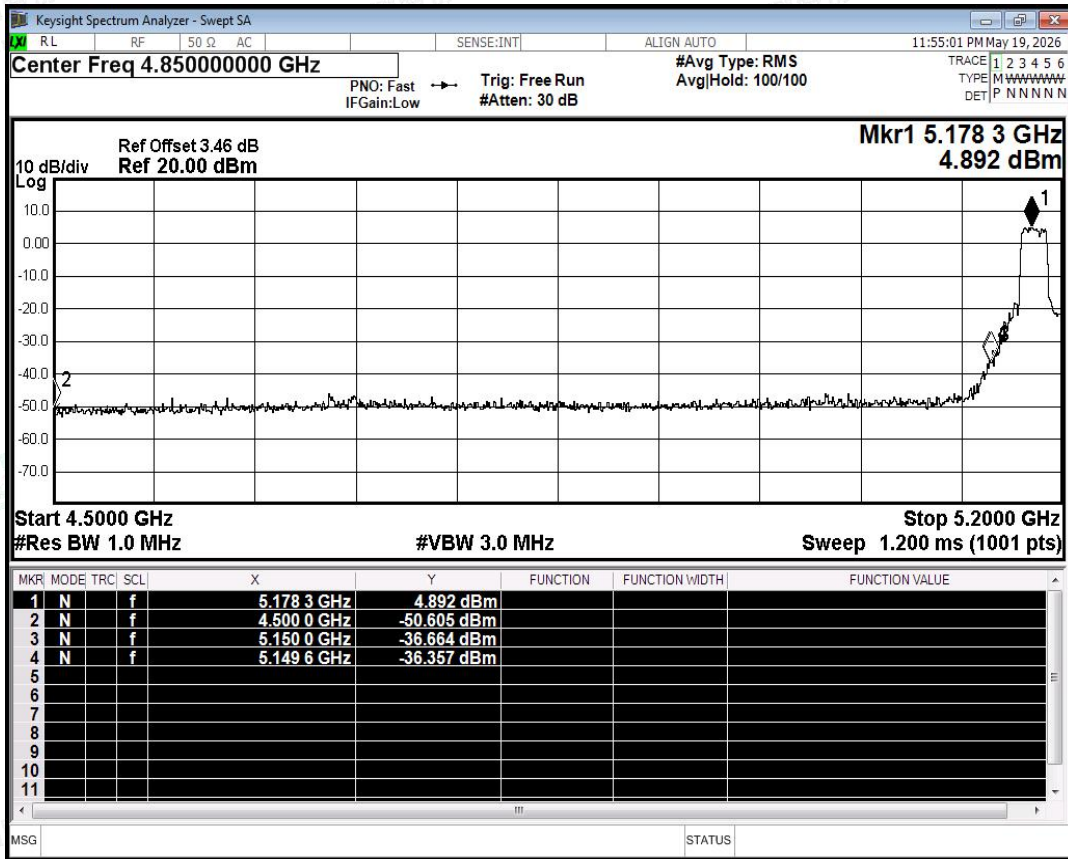

Restrict Band NVNT n20 5180MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

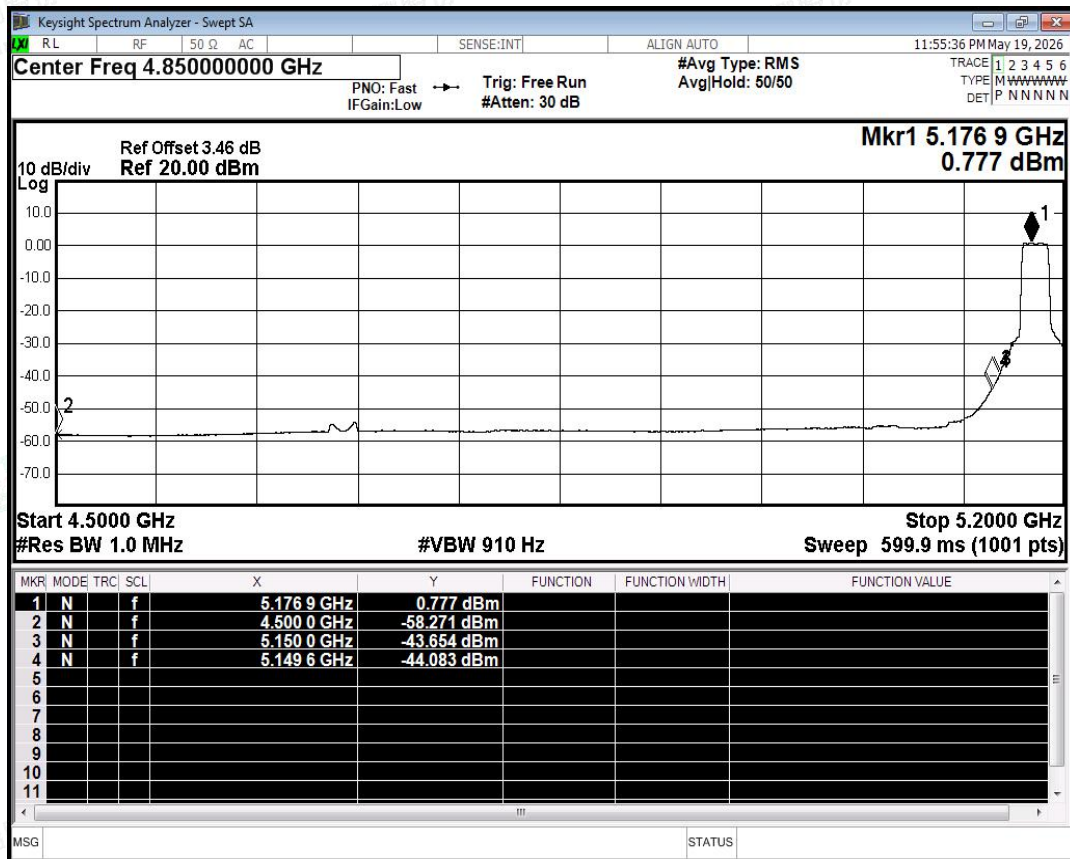

Restrict Band NVNT n20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

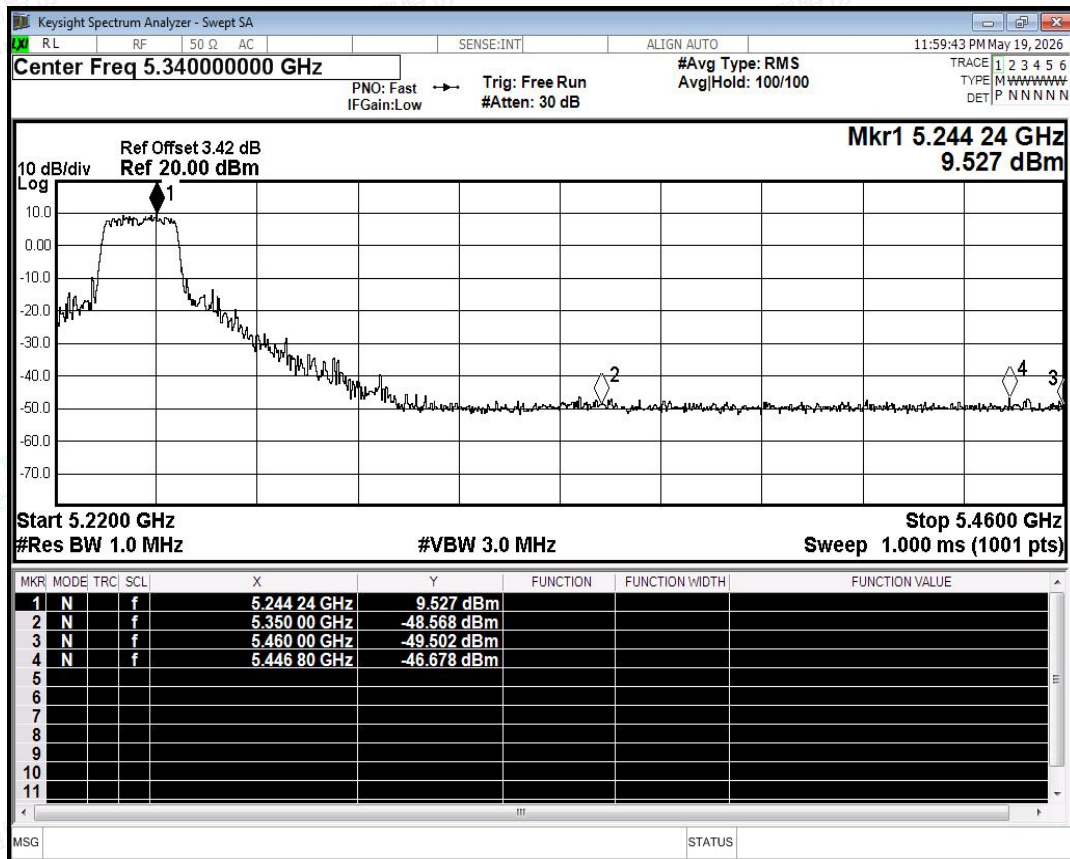

Restrict Band NVNT n20 5240MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

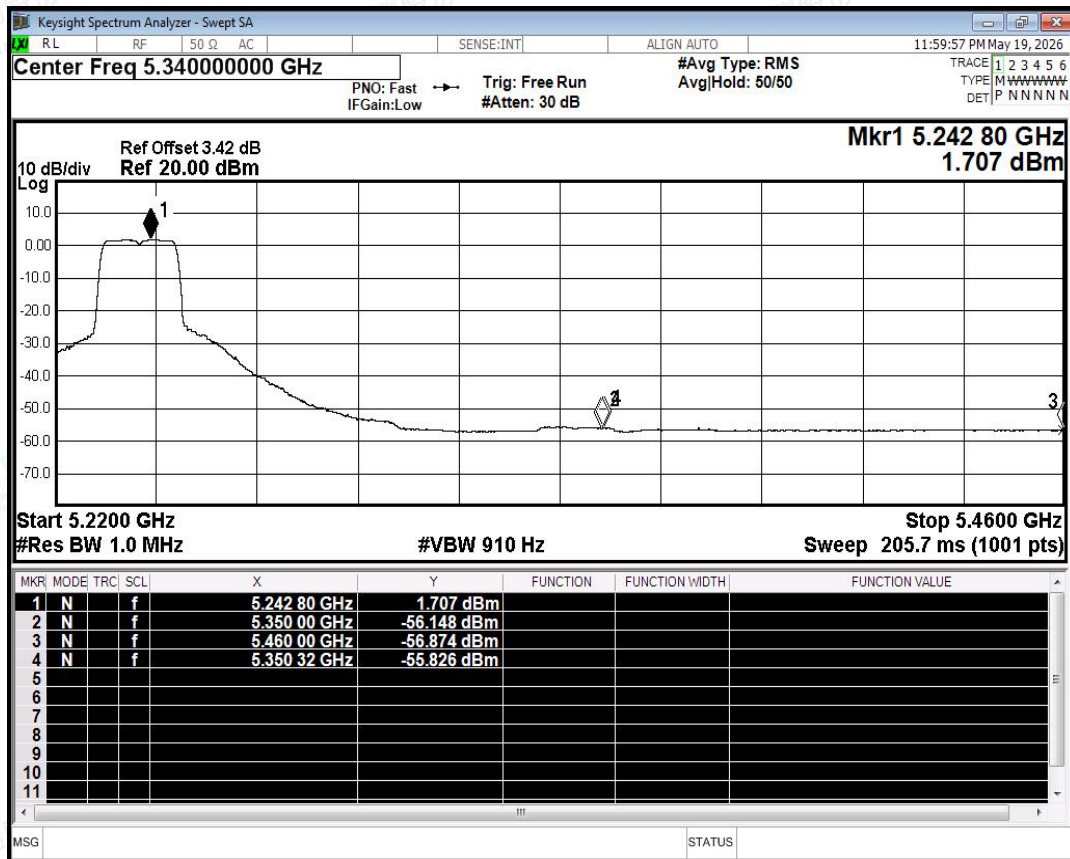

Restrict Band NVNT n20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

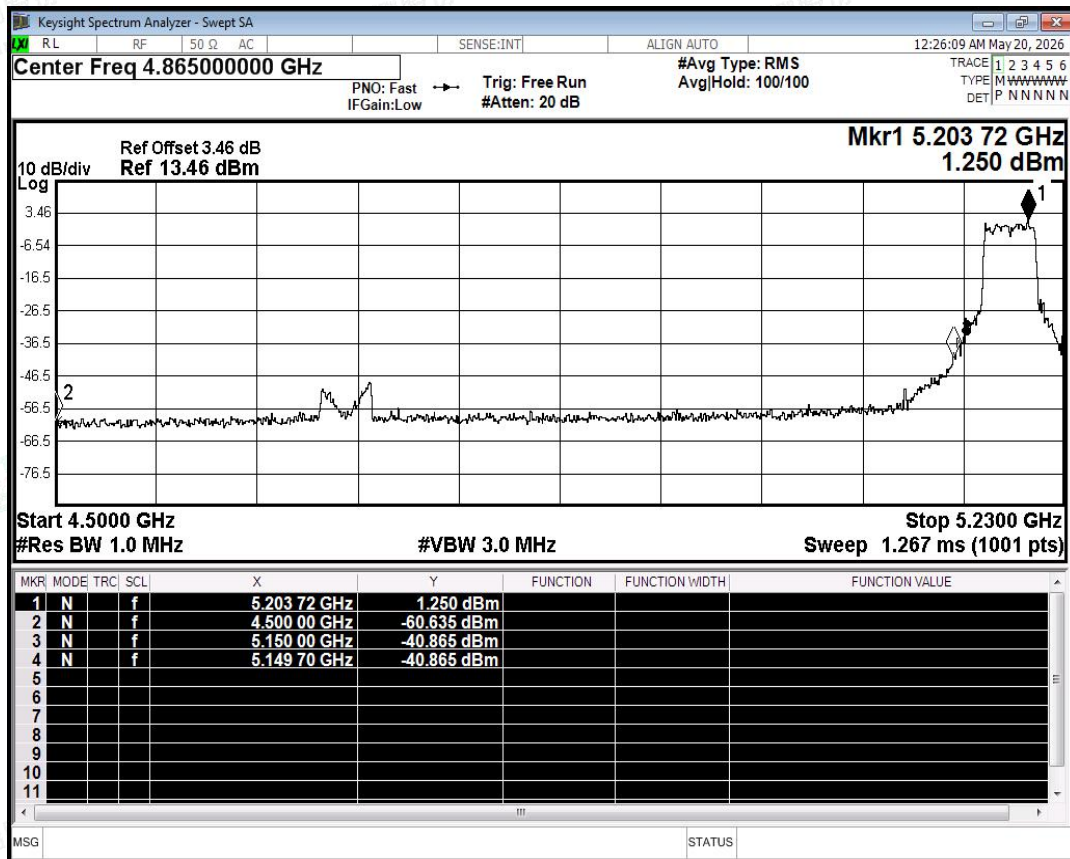

Restrict Band NVNT n40 5190MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

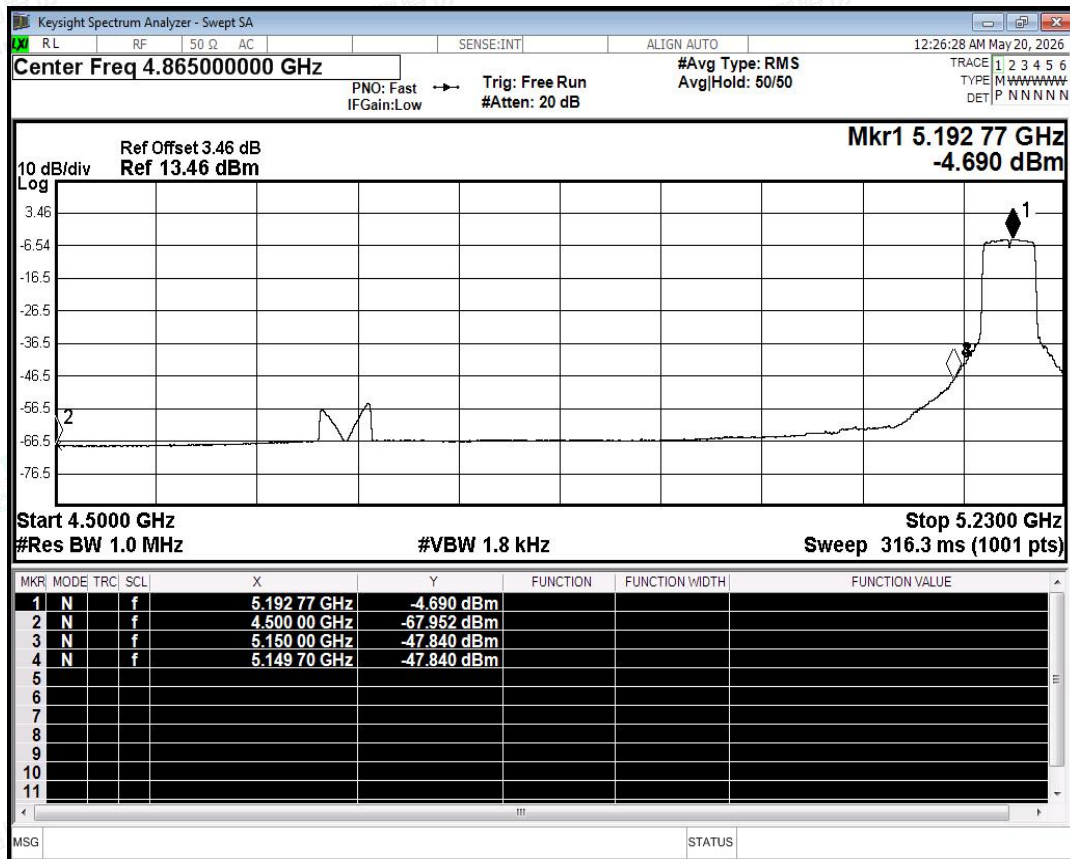

Restrict Band NVNT n40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

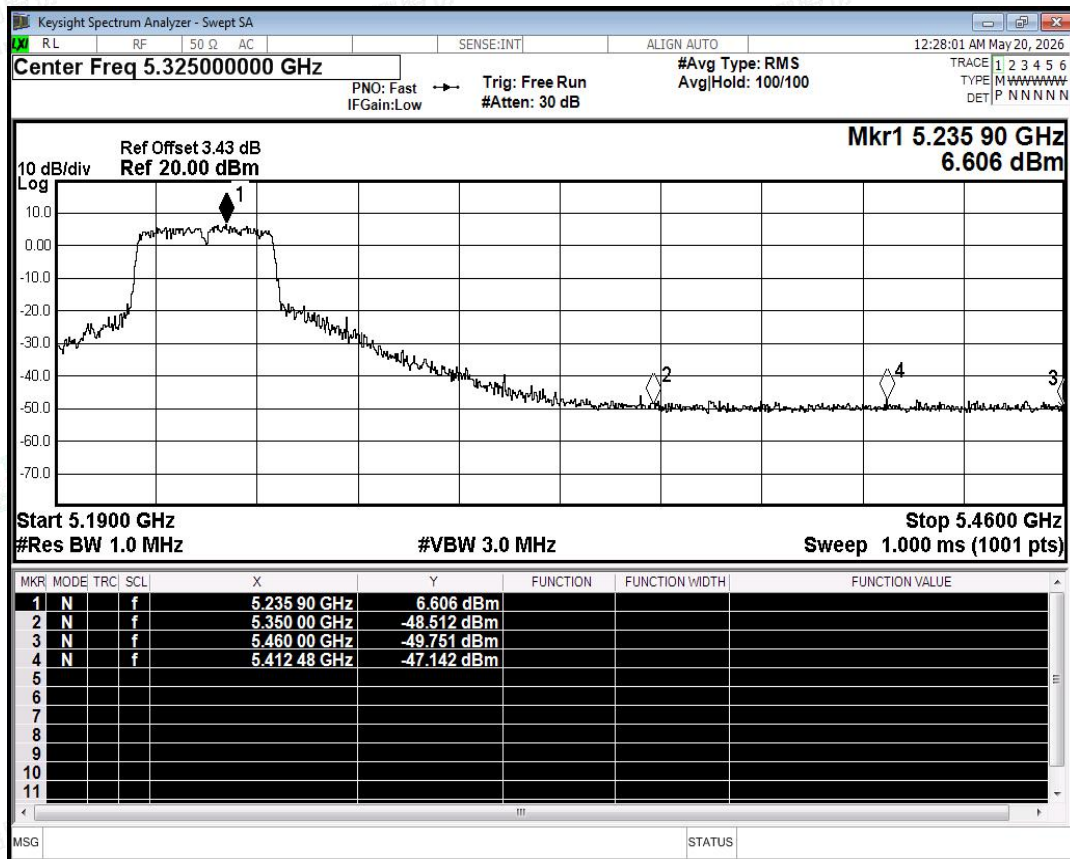

Restrict Band NVNT n40 5230MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

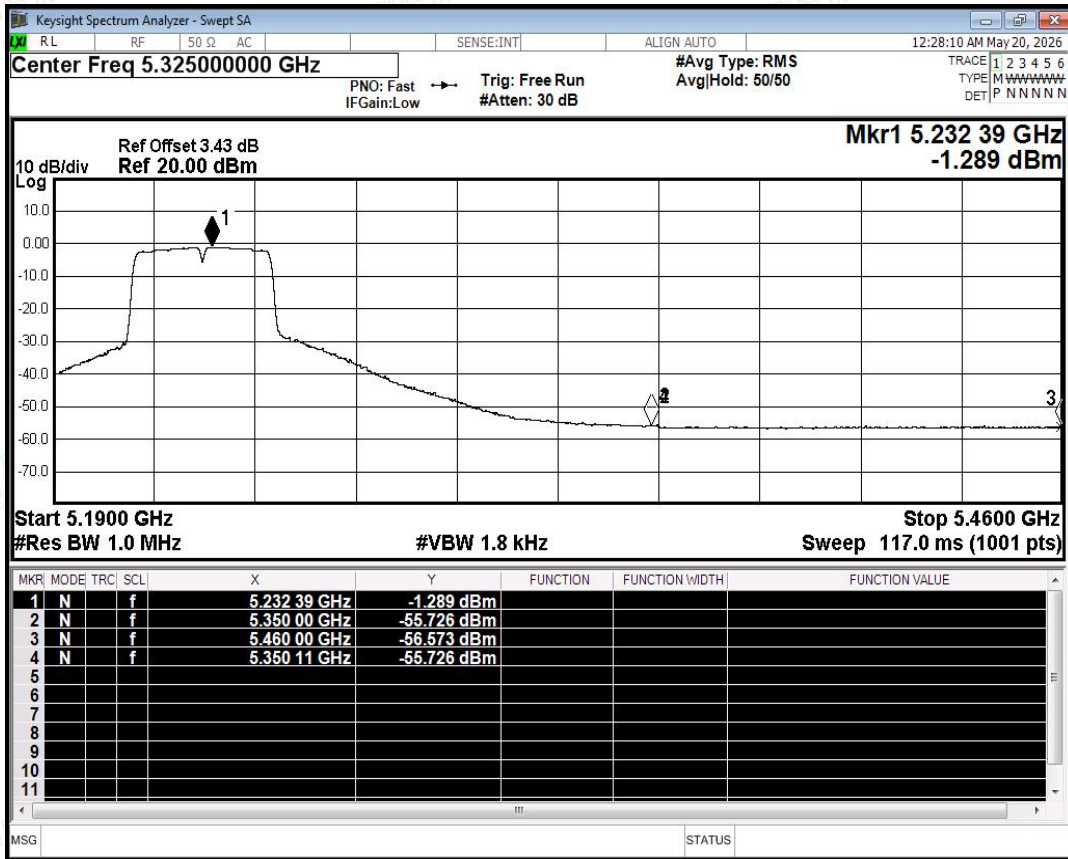

Restrict Band NVNT n40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

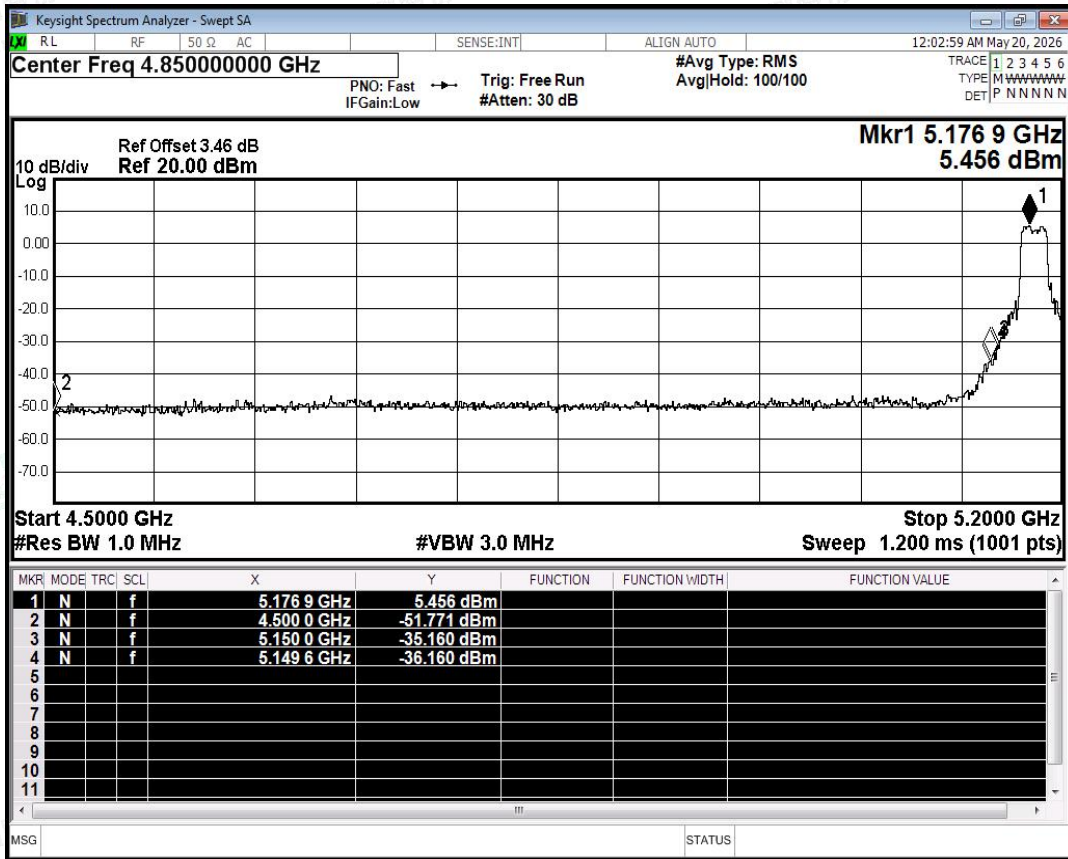

Restrict Band NVNT ac20 5180MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

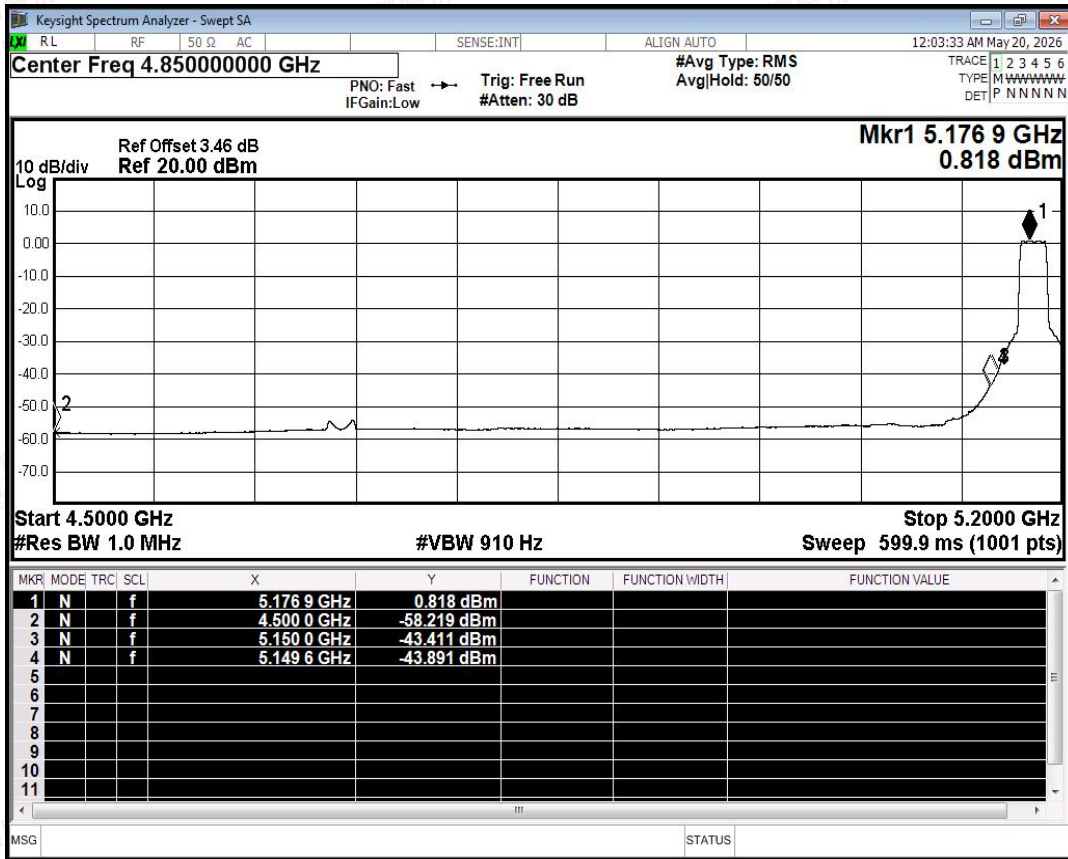

Restrict Band NVNT ac20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

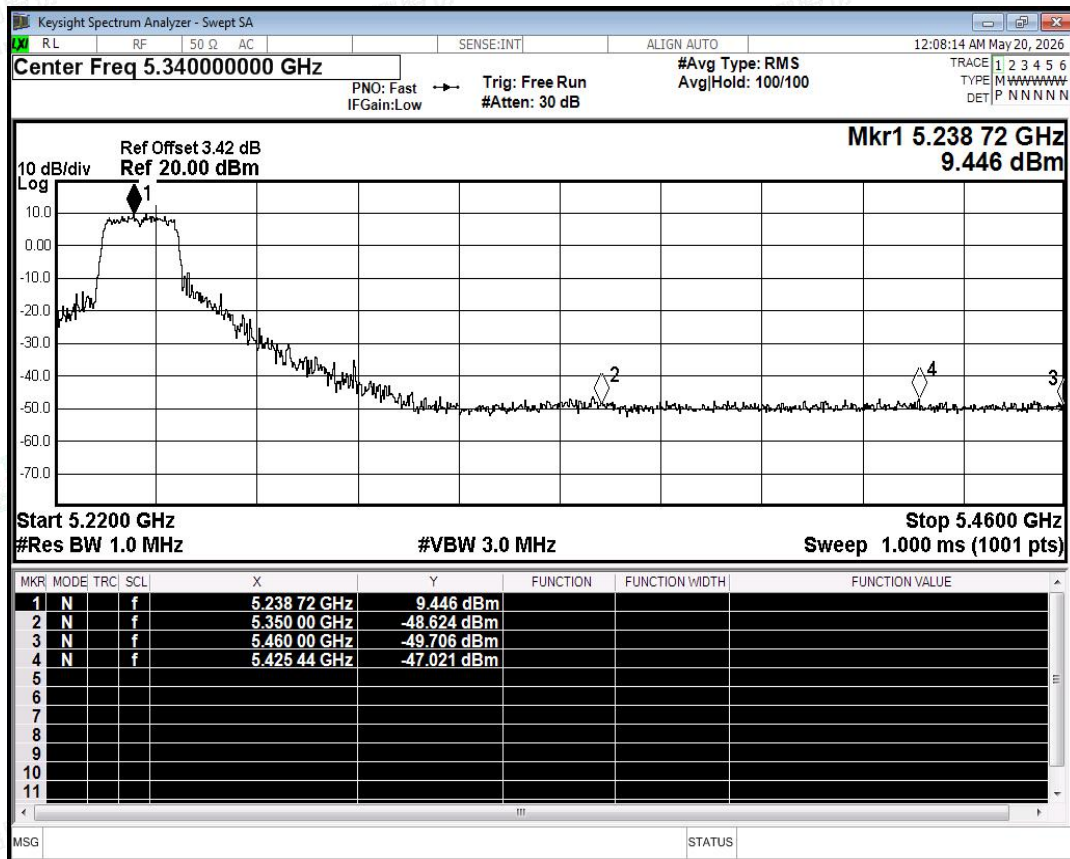

Restrict Band NVNT ac20 5240MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

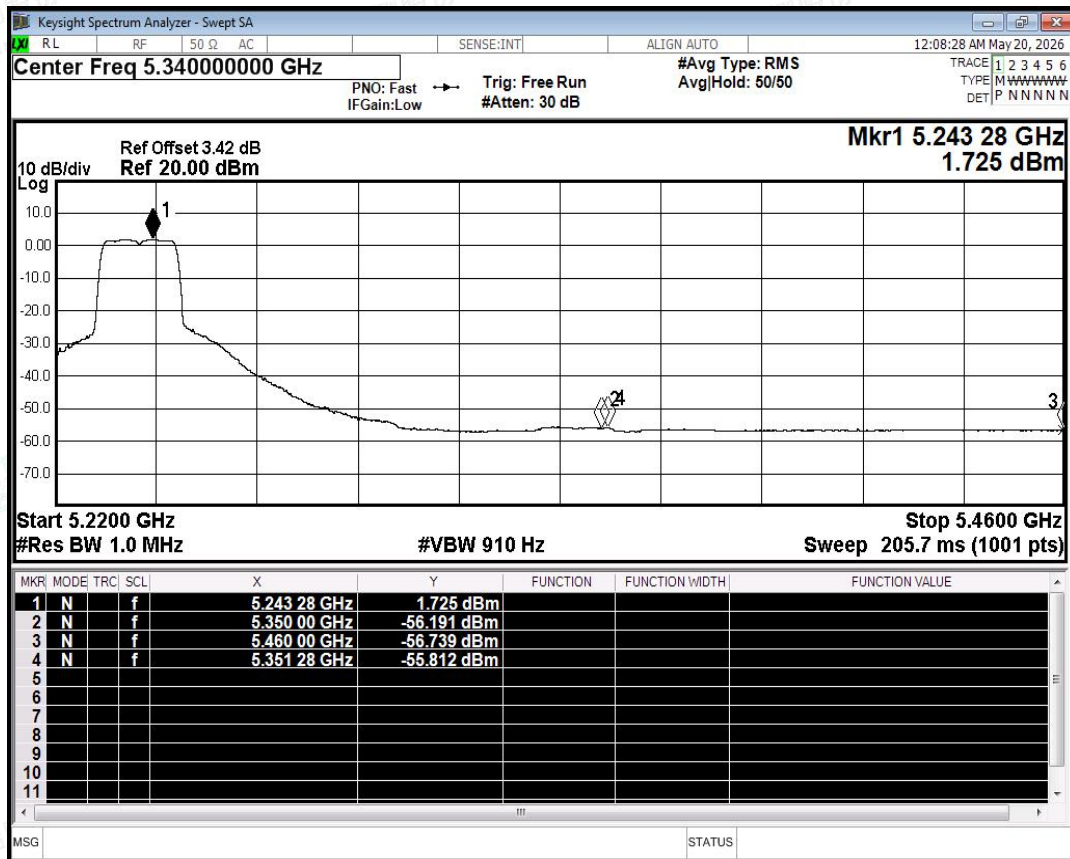

Restrict Band NVNT ac20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

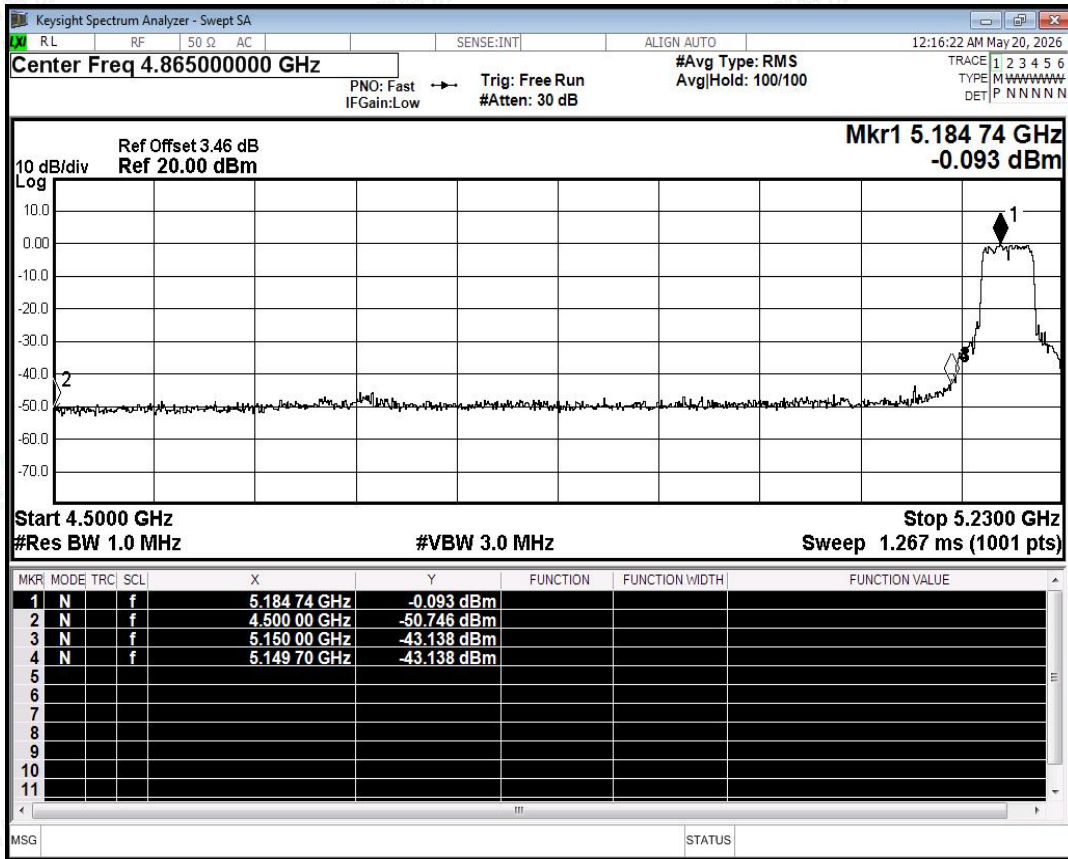

Restrict Band NVNT ac40 5190MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

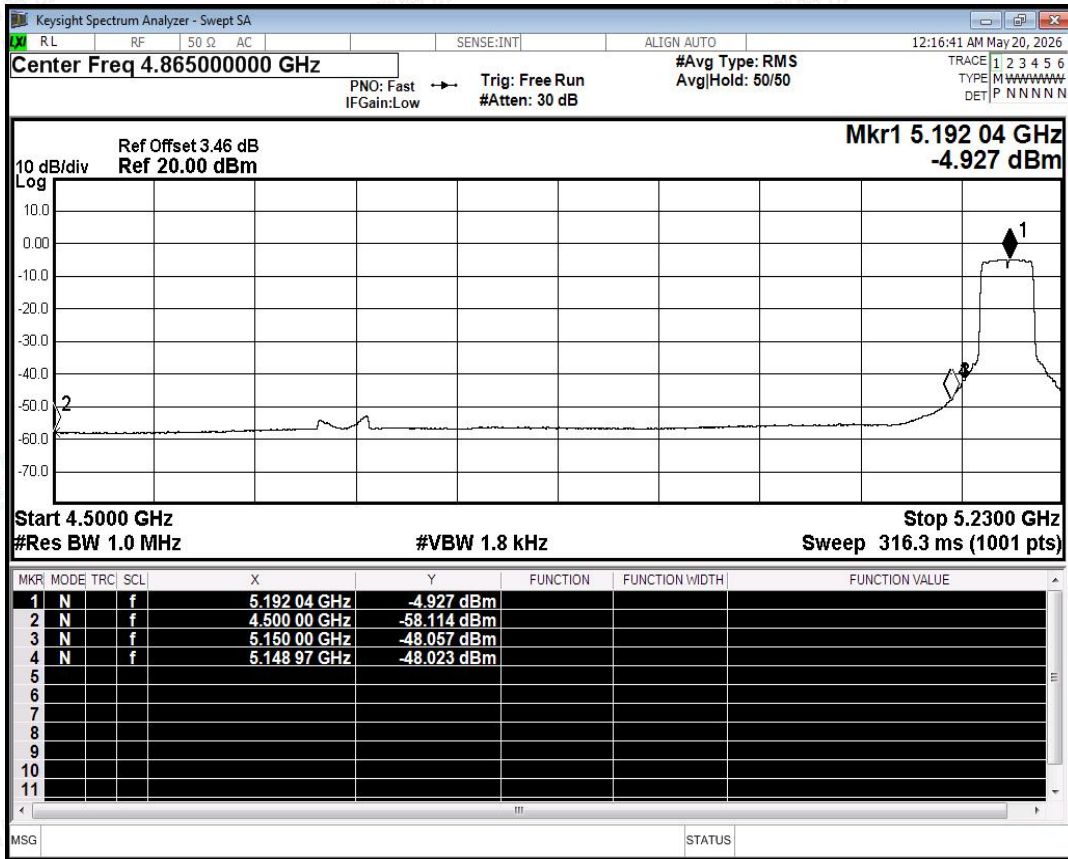

Restrict Band NVNT ac40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

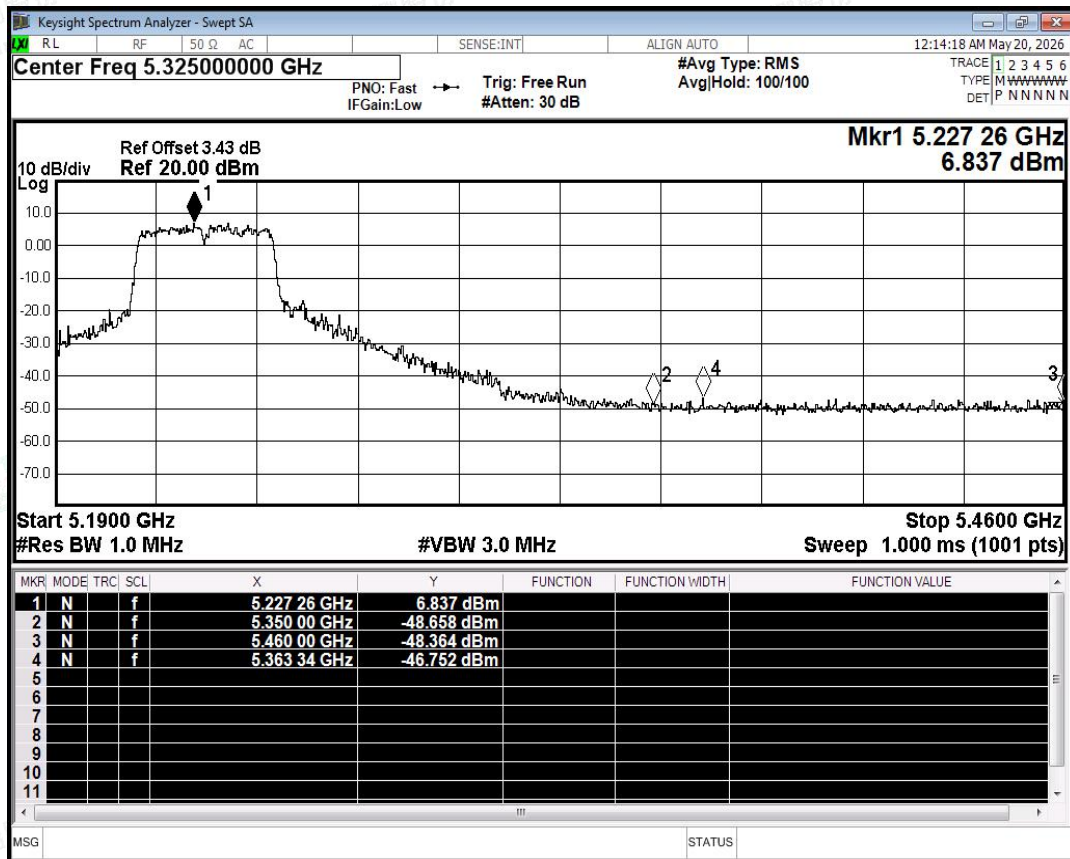

Restrict Band NVNT ac40 5230MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

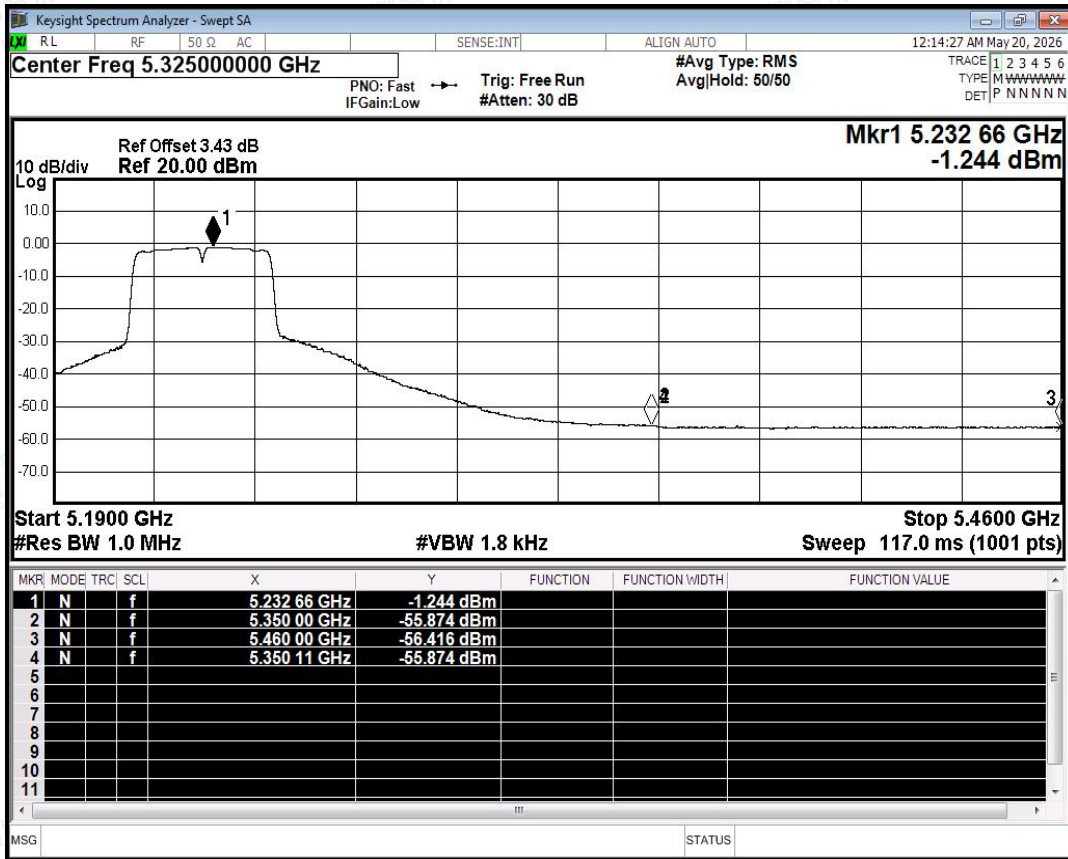

Restrict Band NVNT ac40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

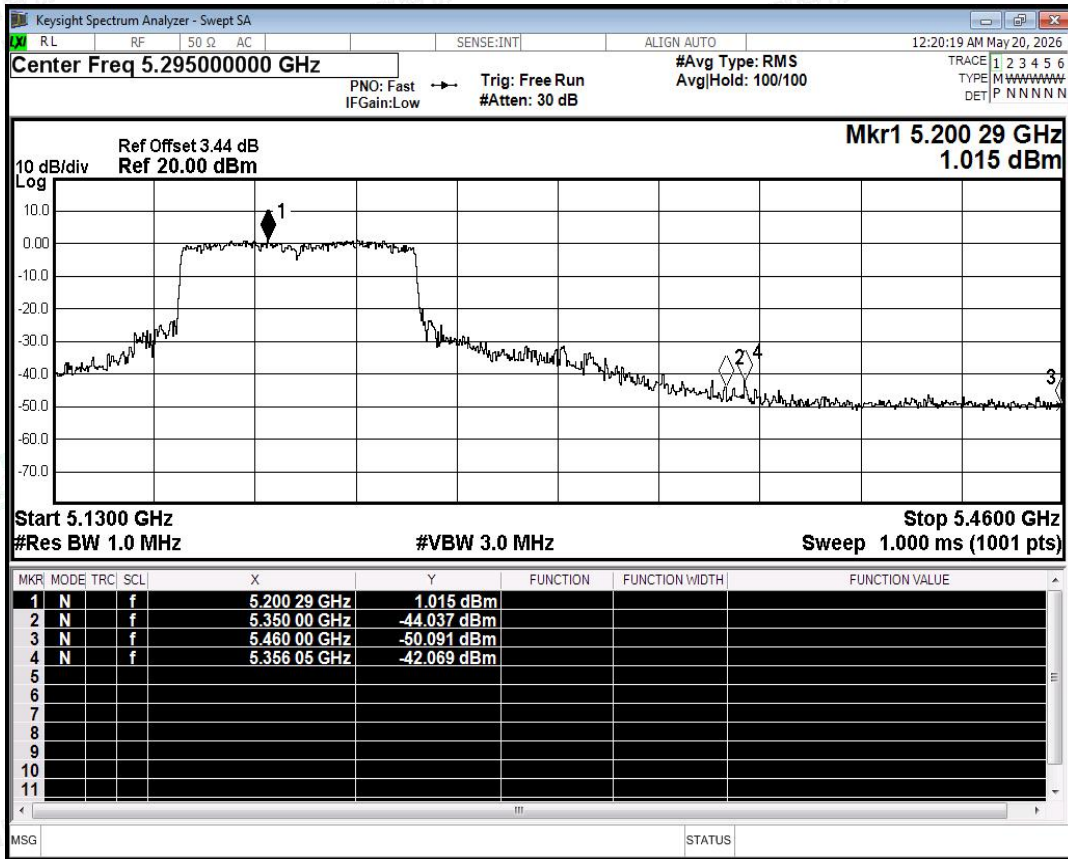

Restrict Band NVNT ac80 5210MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

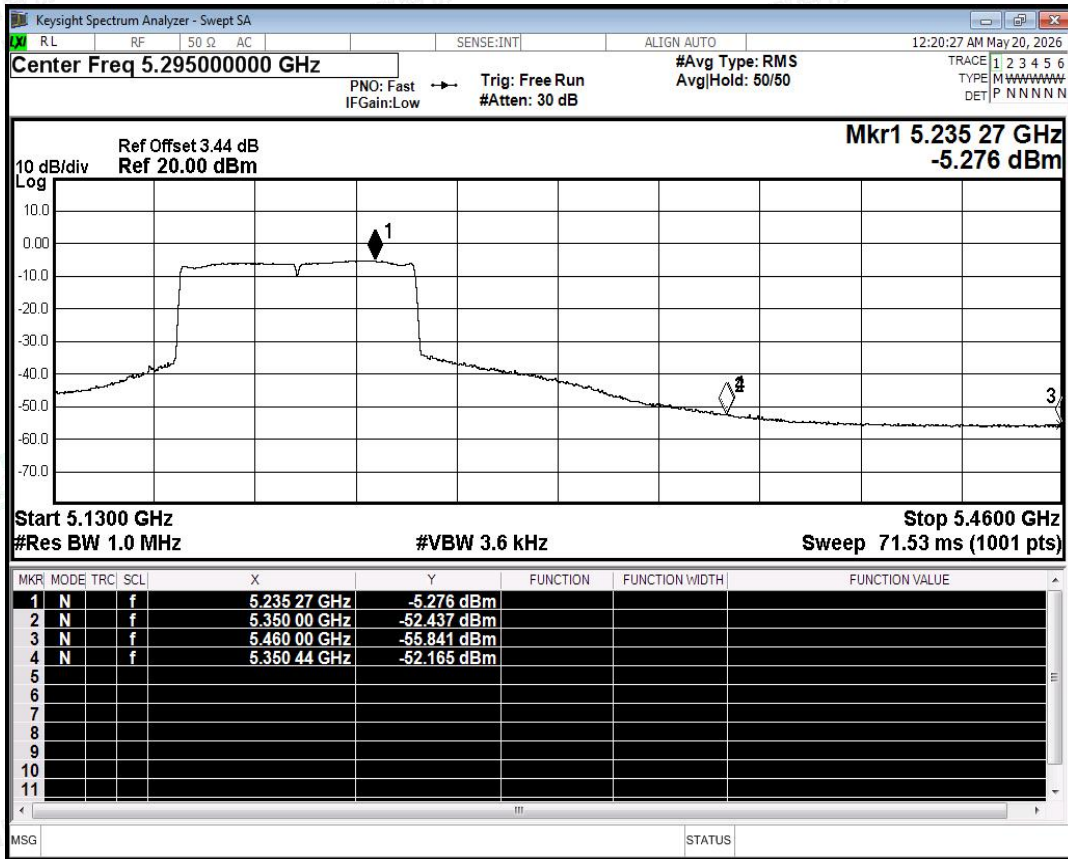

Restrict Band NVNT ac80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

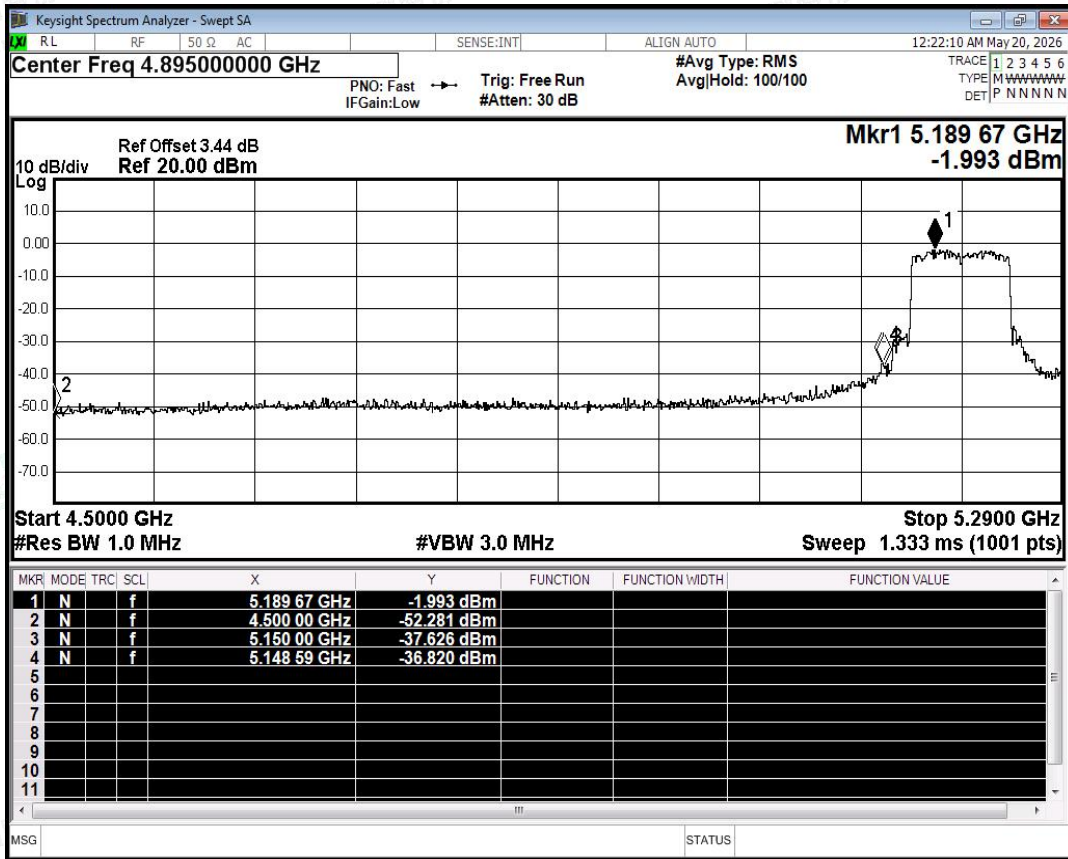

Restrict Band NVNT ac80 5210MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

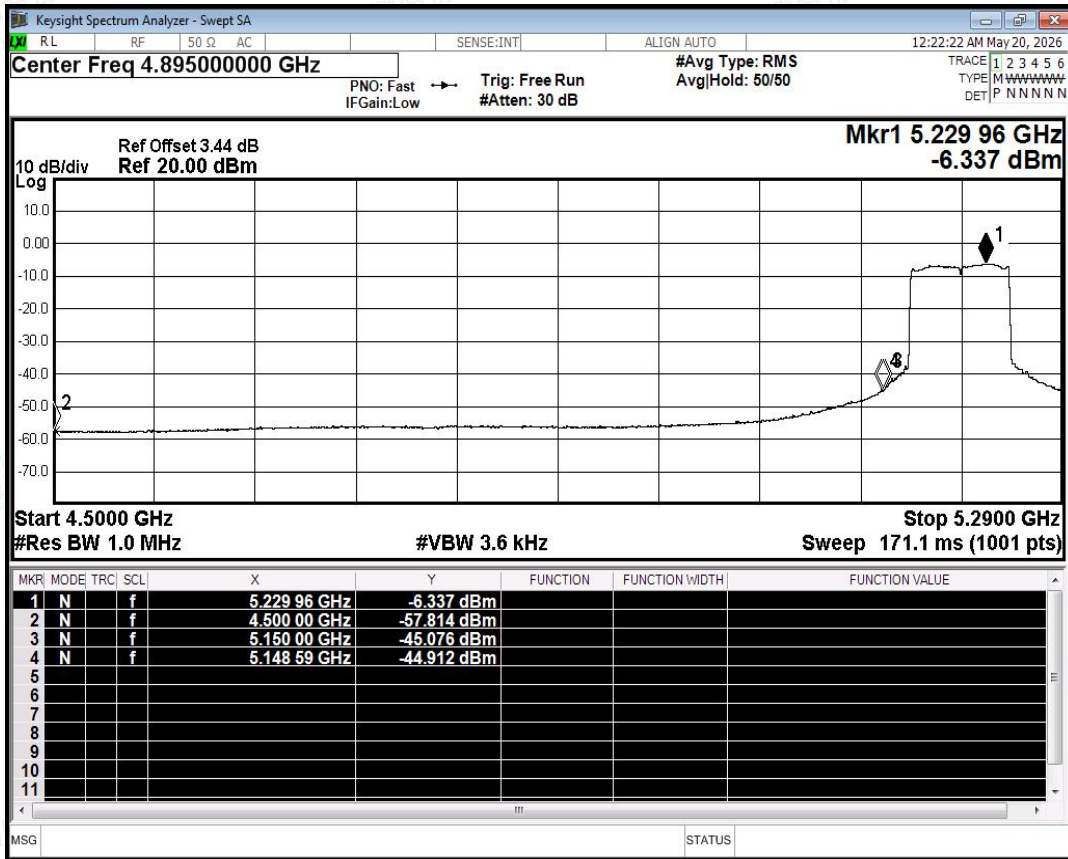

Restrict Band NVNT ac80 5210MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5240	0	0	25	Pass
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

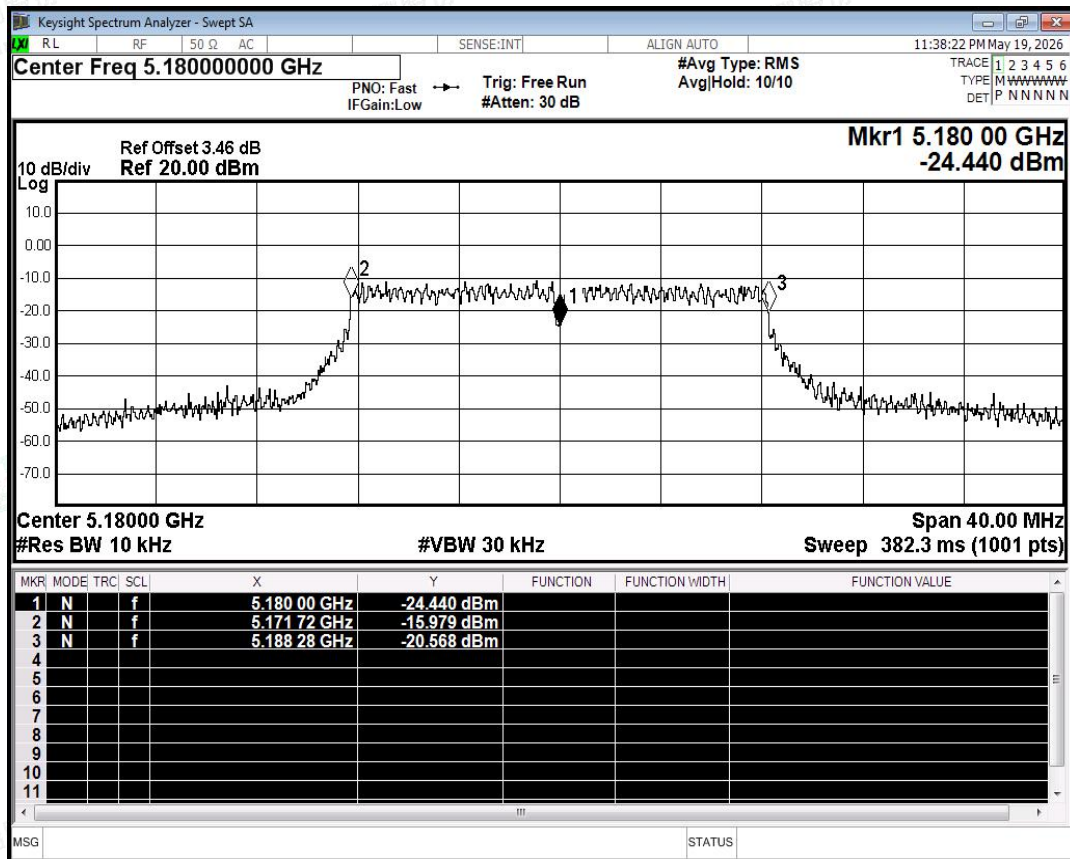

Freq. Stability NVNT a 5180MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity