


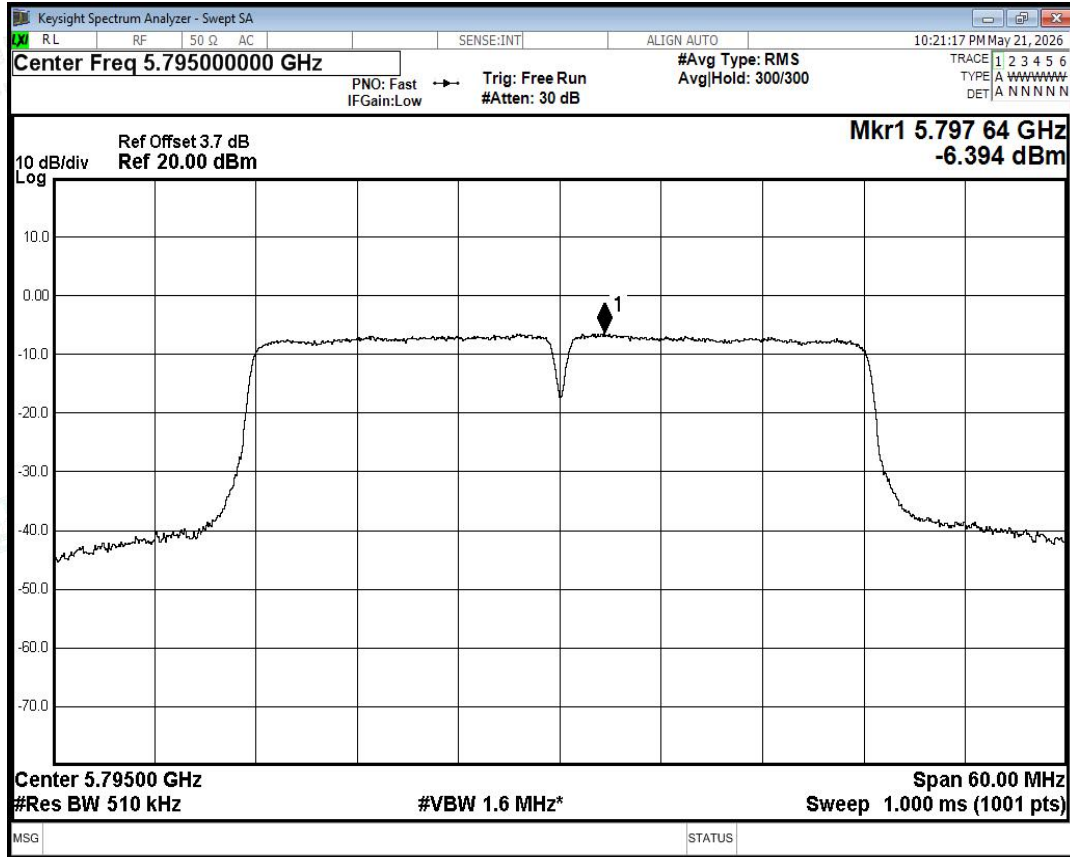


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

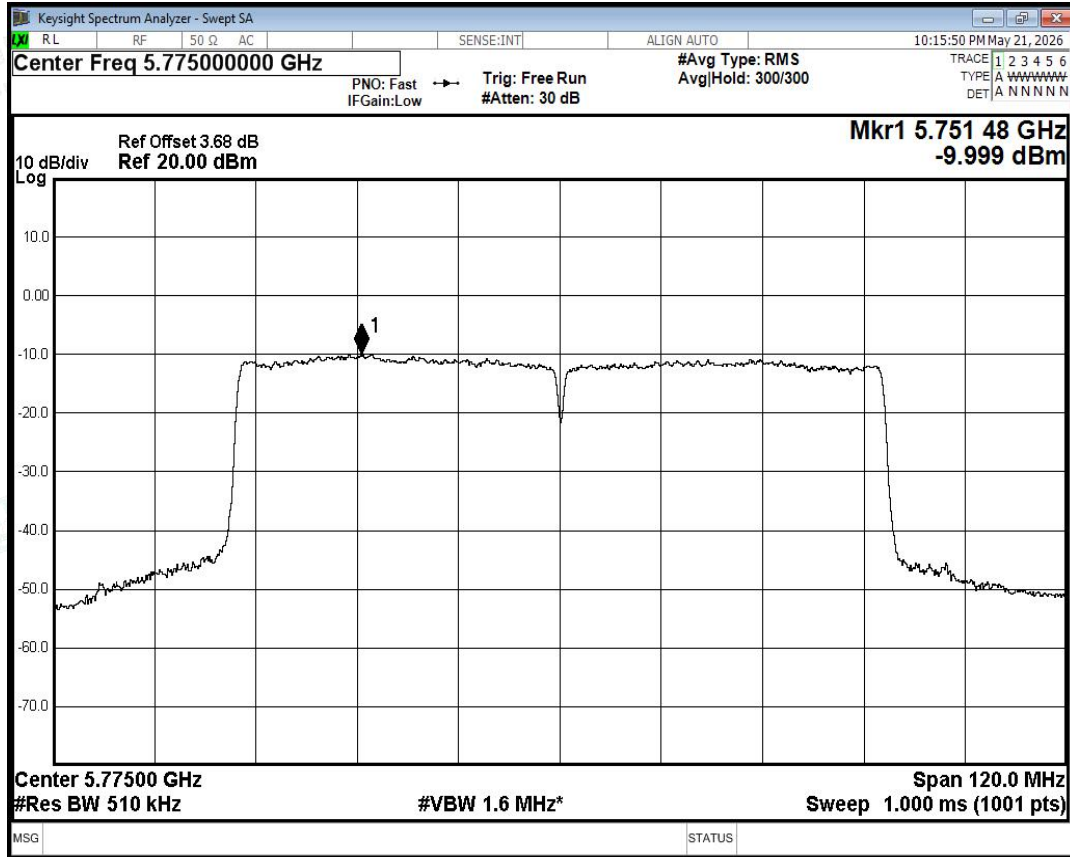

PSD NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5745	Ant1	5650	-49.87	2.14	-47.73	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-56.88	2.14	-54.74	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-43.55	2.14	-41.41	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-54.14	2.14	-52.00	Average	10	Pass
NVNT	a	5745	Ant1	5720	-30.98	2.14	-28.84	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-45.09	2.14	-42.95	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-28.94	2.14	-26.80	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-39.06	2.14	-36.92	Average	27	Pass
NVNT	a	5825	Ant1	5850	-36.01	2.14	-33.87	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-47.02	2.14	-44.88	Average	27	Pass
NVNT	a	5825	Ant1	5855	-42.97	2.14	-40.83	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-51.31	2.14	-49.17	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-46.43	2.14	-44.29	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-53.63	2.14	-51.49	Average	10	Pass
NVNT	a	5825	Ant1	5925	-47.49	2.14	-45.35	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-55.06	2.14	-52.92	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-49.9	2.14	-47.76	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-56.58	2.14	-54.44	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-45.65	2.14	-43.51	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-54.23	2.14	-52.09	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-29.85	2.14	-27.71	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-44.21	2.14	-42.07	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-24.07	2.14	-21.93	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-36.74	2.14	-34.60	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-29.44	2.14	-27.30	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-44.74	2.14	-42.60	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-39.92	2.14	-37.78	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-50.64	2.14	-48.50	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-46.48	2.14	-44.34	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-53.77	2.14	-51.63	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-46.58	2.14	-44.44	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-54.97	2.14	-52.83	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-49.09	2.14	-46.95	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-56.3	2.14	-54.16	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-45.1	2.14	-42.96	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-51.93	2.14	-49.79	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant1	5720	-30.85	2.14	-28.71	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-41.42	2.14	-39.28	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-25.89	2.14	-23.75	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-38.46	2.14	-36.32	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-46.46	2.14	-44.32	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-52.85	2.14	-50.71	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-44.65	2.14	-42.51	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-53.57	2.14	-51.43	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-46.95	2.14	-44.81	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-55.21	2.14	-53.07	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-49.34	2.14	-47.20	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-55.89	2.14	-53.75	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-47.86	2.14	-45.72	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-56.43	2.14	-54.29	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-47.53	2.14	-45.39	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-53.99	2.14	-51.85	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-30.51	2.14	-28.37	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-43.92	2.14	-41.78	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-27.79	2.14	-25.65	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-36.97	2.14	-34.83	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-35.37	2.14	-33.23	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-44.77	2.14	-42.63	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-41.48	2.14	-39.34	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-50.71	2.14	-48.57	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-46.3	2.14	-44.16	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-53.97	2.14	-51.83	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-47.66	2.14	-45.52	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-55.26	2.14	-53.12	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-49.42	2.14	-47.28	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-56.22	2.14	-54.08	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-43.93	2.14	-41.79	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-51.89	2.14	-49.75	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-27.68	2.14	-25.54	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-42.01	2.14	-39.87	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-29.13	2.14	-26.99	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-38.85	2.14	-36.71	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-46.31	2.14	-44.17	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-53.03	2.14	-50.89	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-47.11	2.14	-44.97	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-53.41	2.14	-51.27	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-47.71	2.14	-45.57	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant1	5875	-55.19	2.14	-53.05	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-49.29	2.14	-47.15	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-55.73	2.14	-53.59	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-35.83	2.14	-33.69	Peak	27	Pass
NVNT	ac80	5775	Ant1	5850	-46.07	2.14	-43.93	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-40.02	2.14	-37.88	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-47.08	2.14	-44.94	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-44.32	2.14	-42.18	Peak	10	Pass
NVNT	ac80	5775	Ant1	5875	-51.17	2.14	-49.03	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-49.44	2.14	-47.30	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-55.2	2.14	-53.06	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-48.9	2.14	-46.76	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-54.72	2.14	-52.58	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-43.17	2.14	-41.03	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-49.24	2.14	-47.10	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-34.64	2.14	-32.50	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-43.77	2.14	-41.63	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-29.12	2.14	-26.98	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-42.57	2.14	-40.43	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

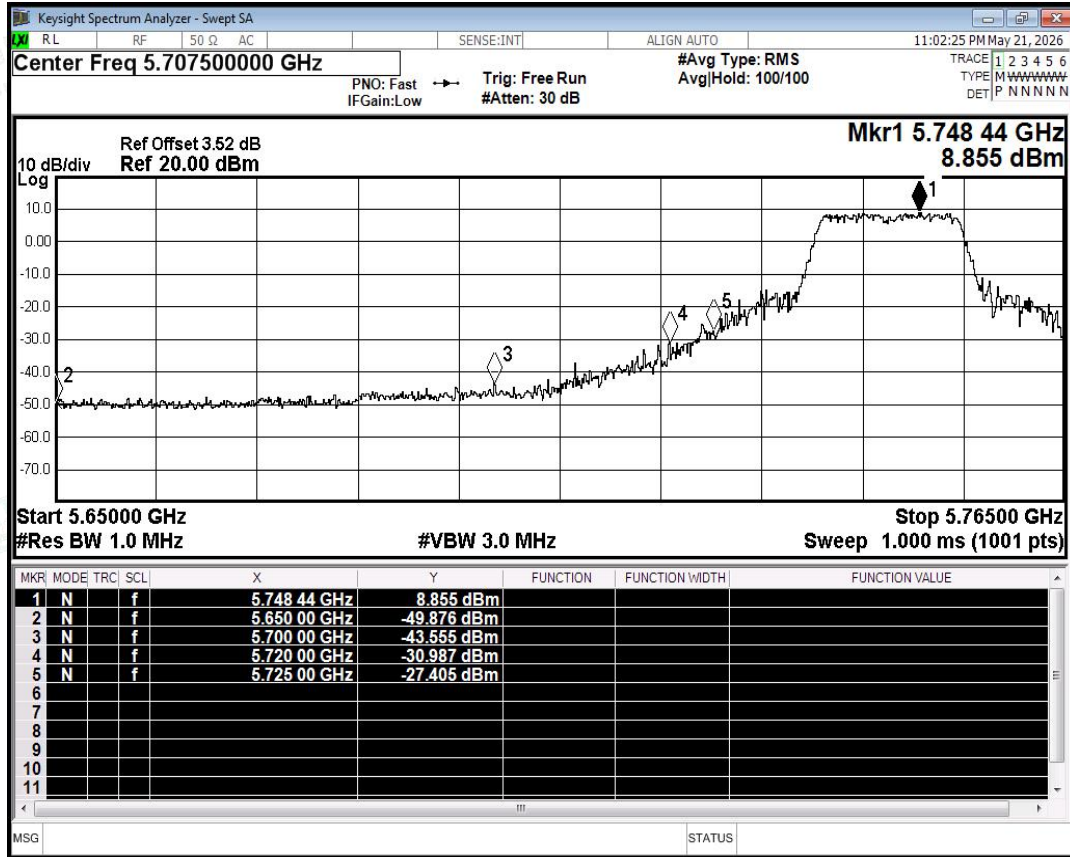

Restrict Band NVNT a 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

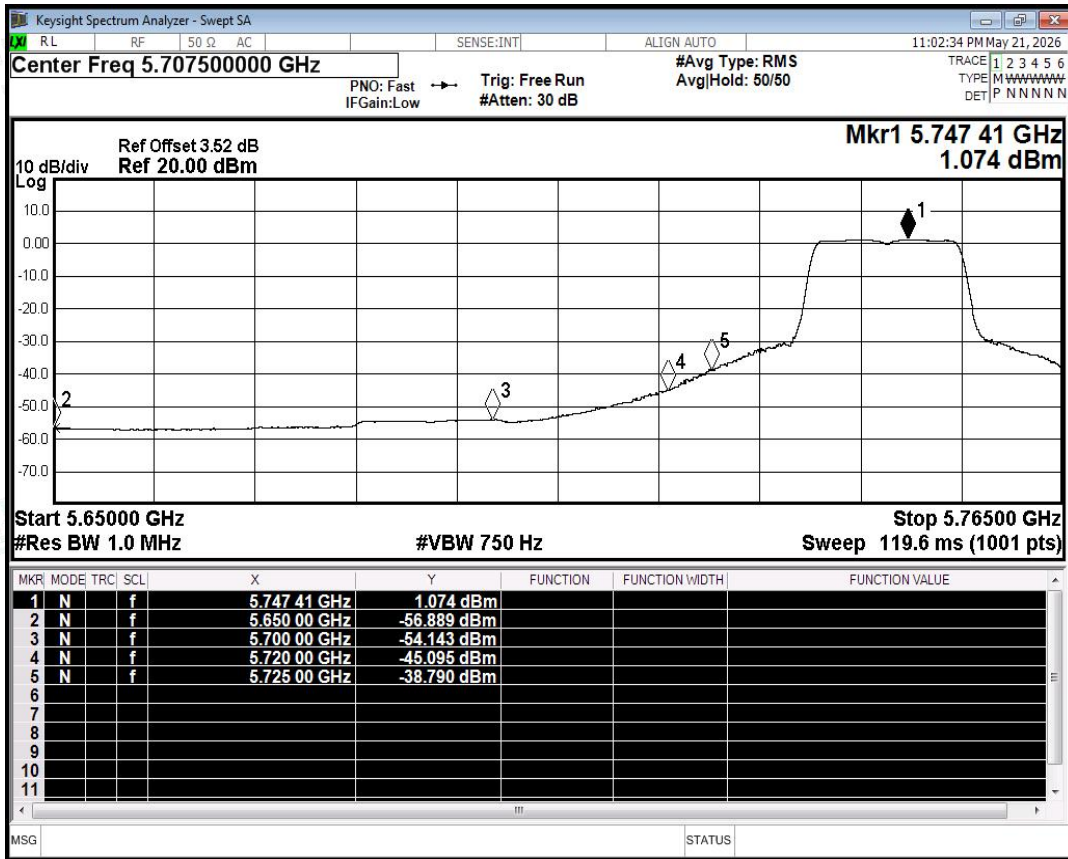

Restrict Band NVNT a 5745MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

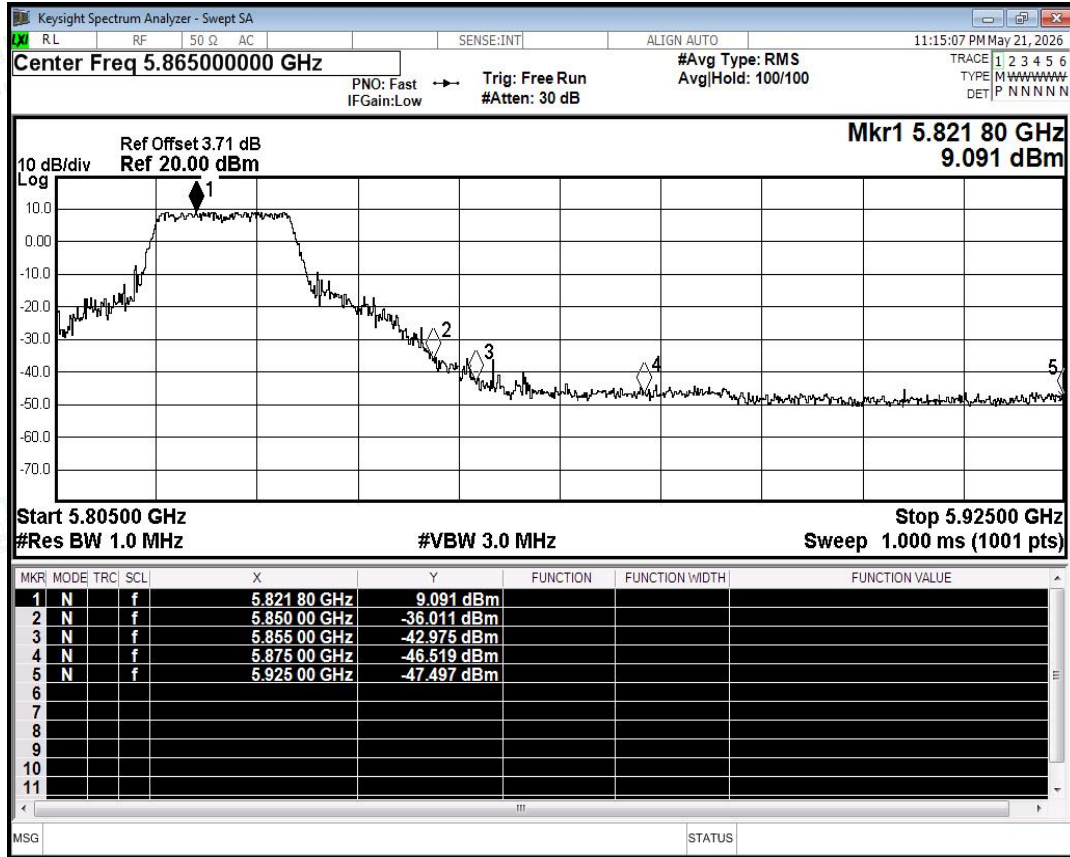

Restrict Band NVNT a 5825MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

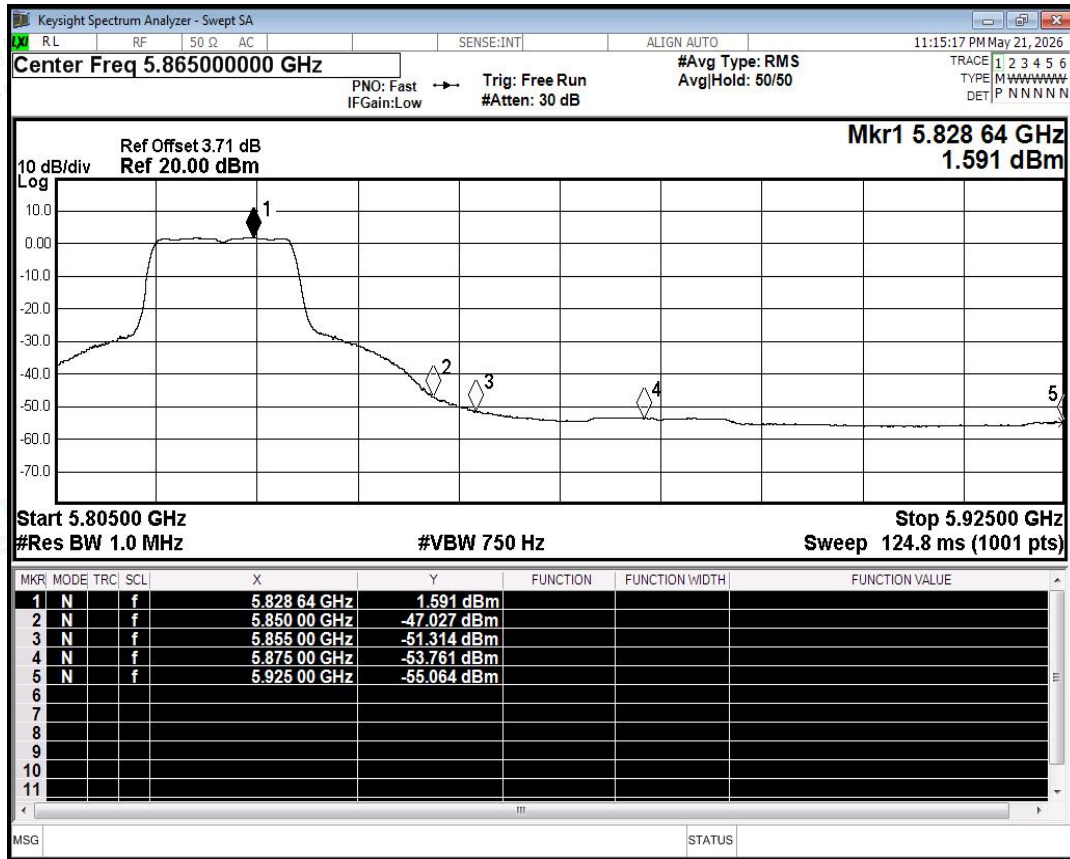

Restrict Band NVNT a 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

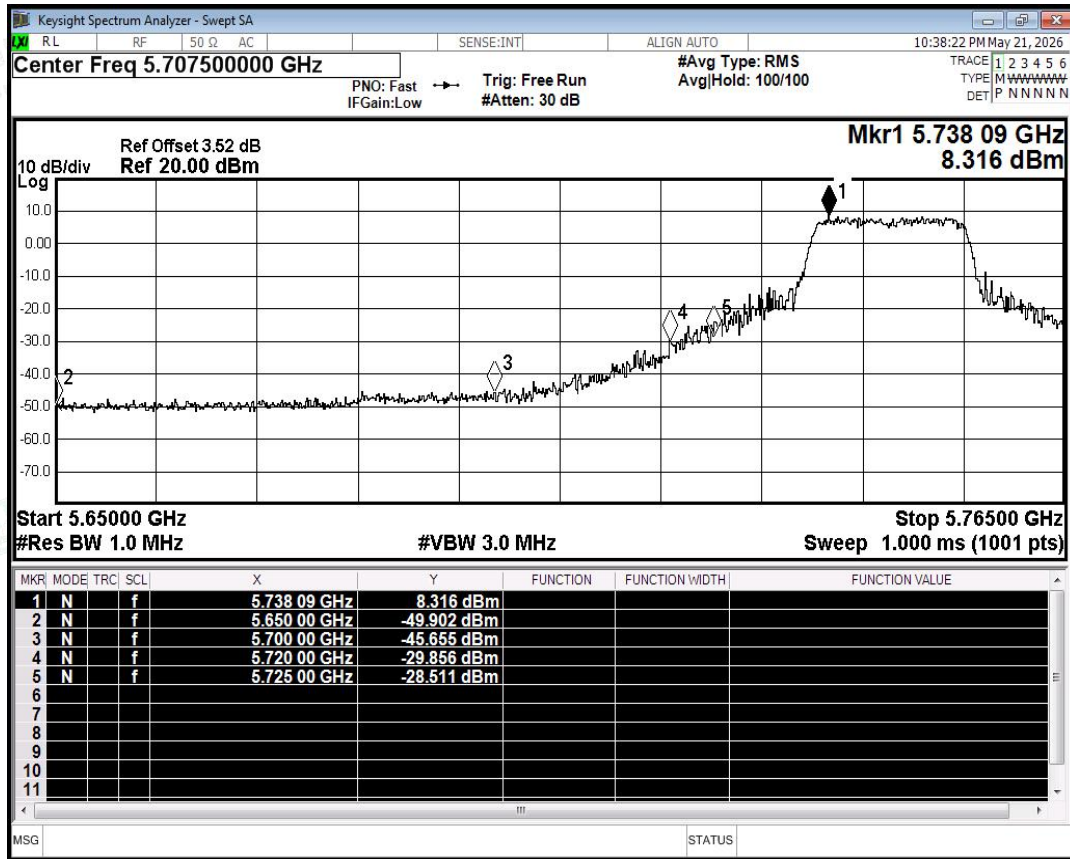

Restrict Band NVNT n20 5745MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

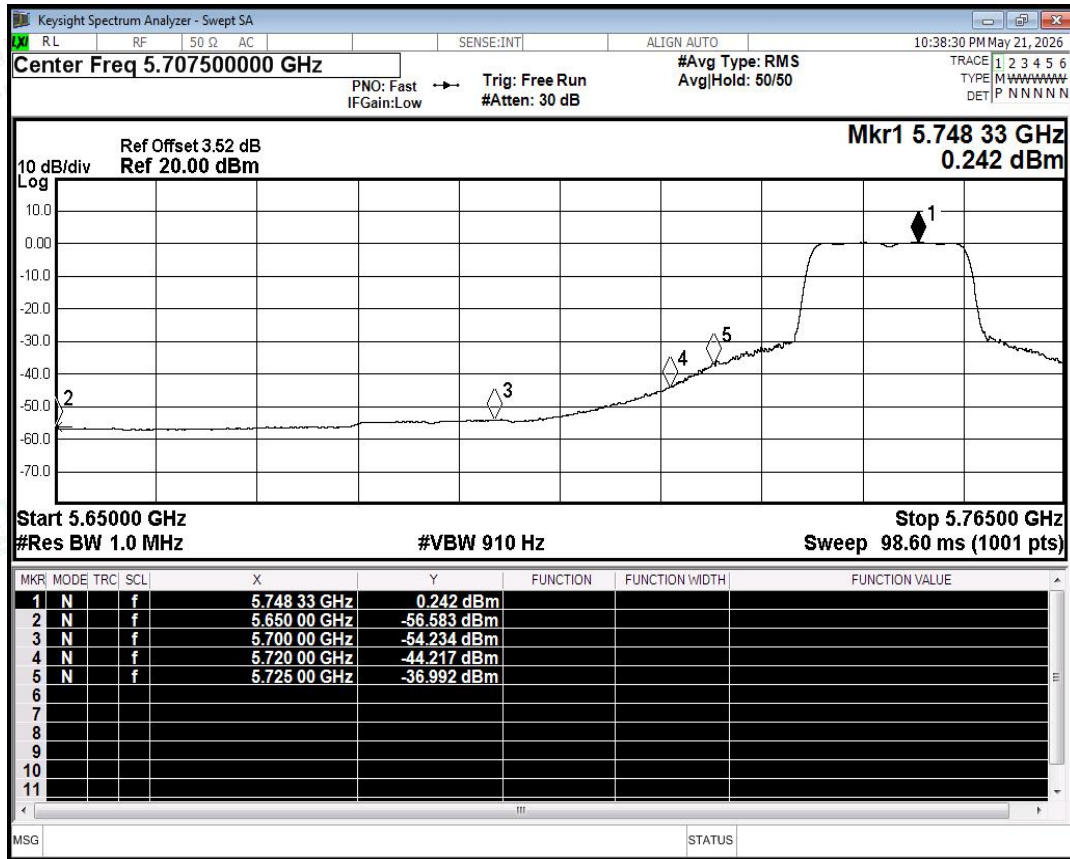

Restrict Band NVNT n20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

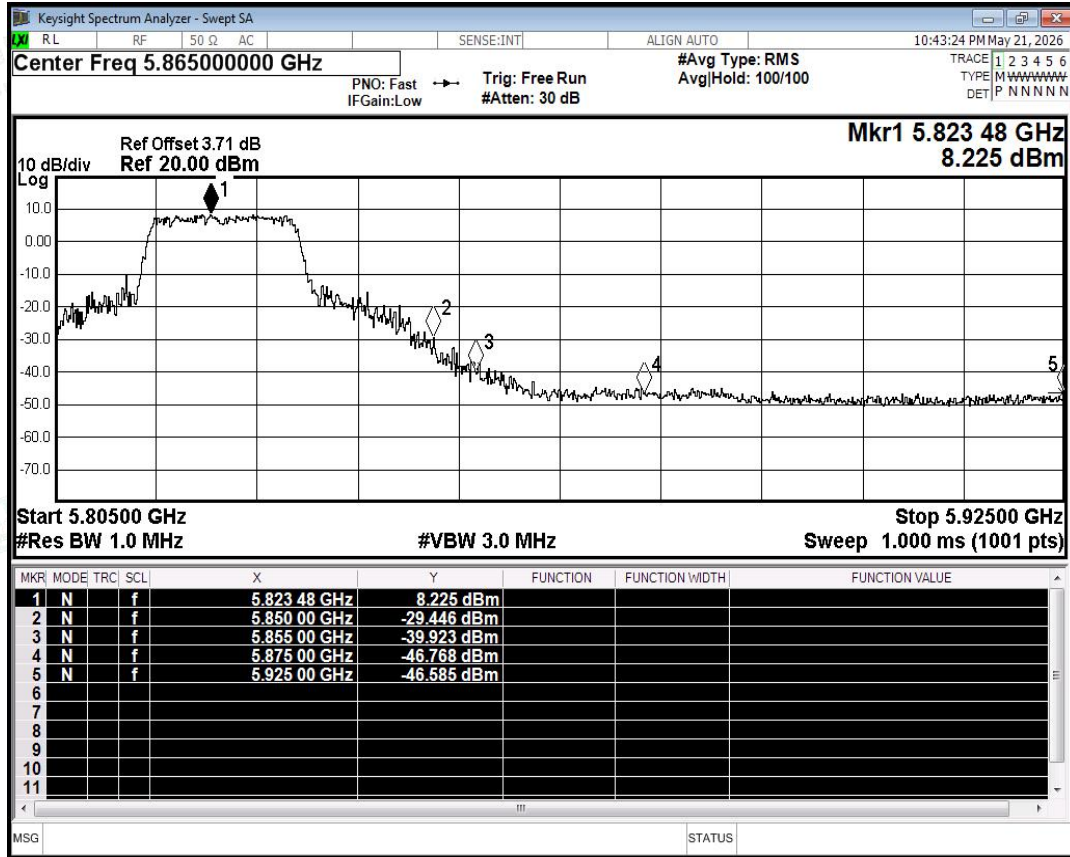

Restrict Band NVNT n20 5825MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

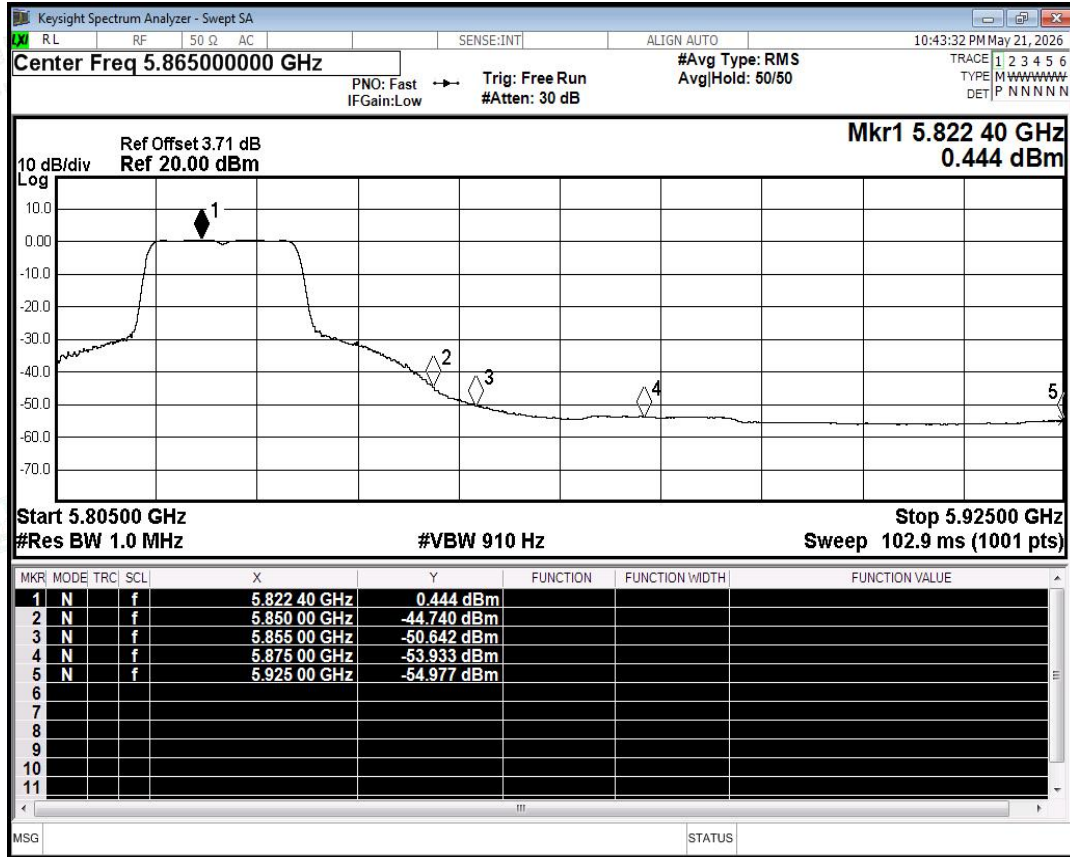

Restrict Band NVNT n20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

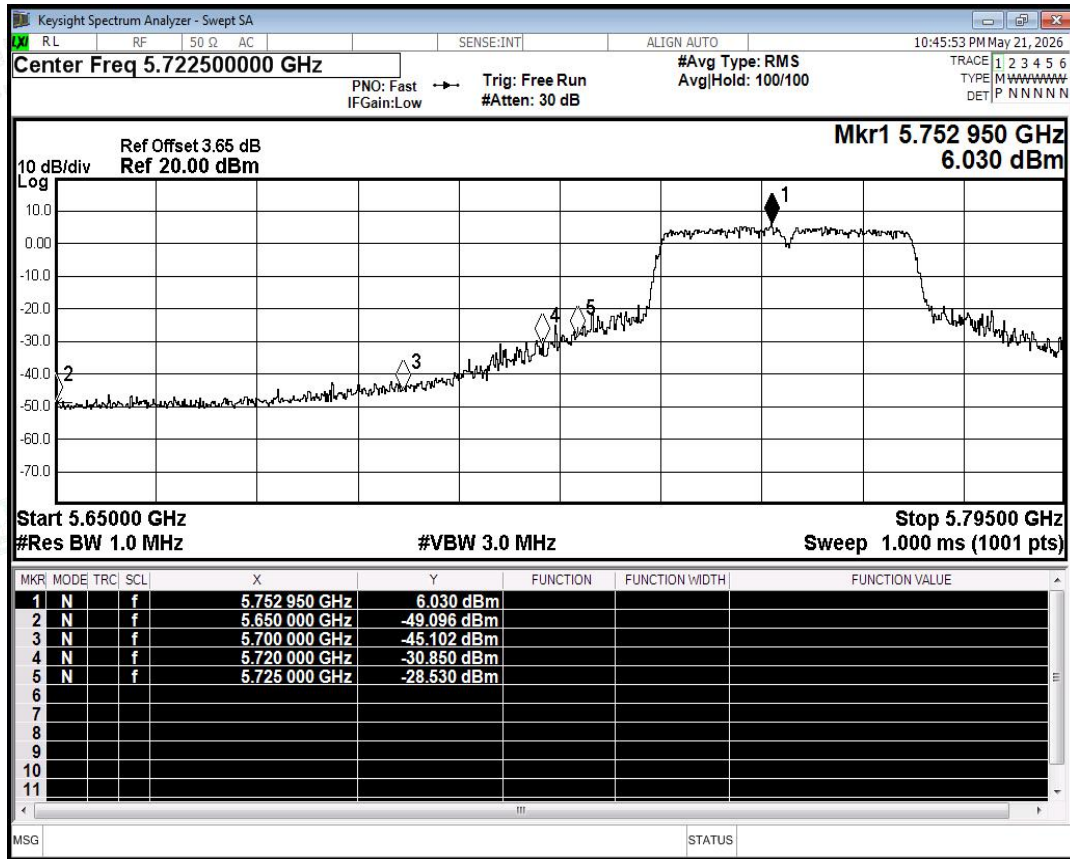

Restrict Band NVNT n40 5755MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

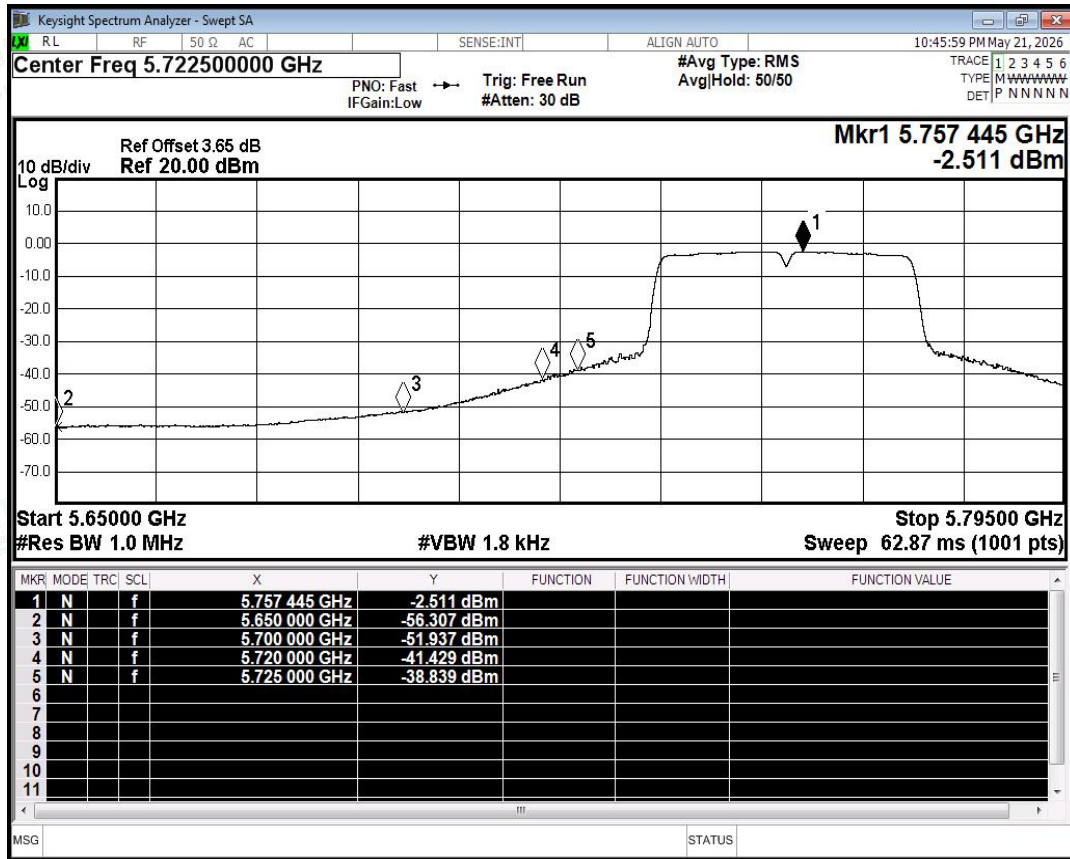

Restrict Band NVNT n40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

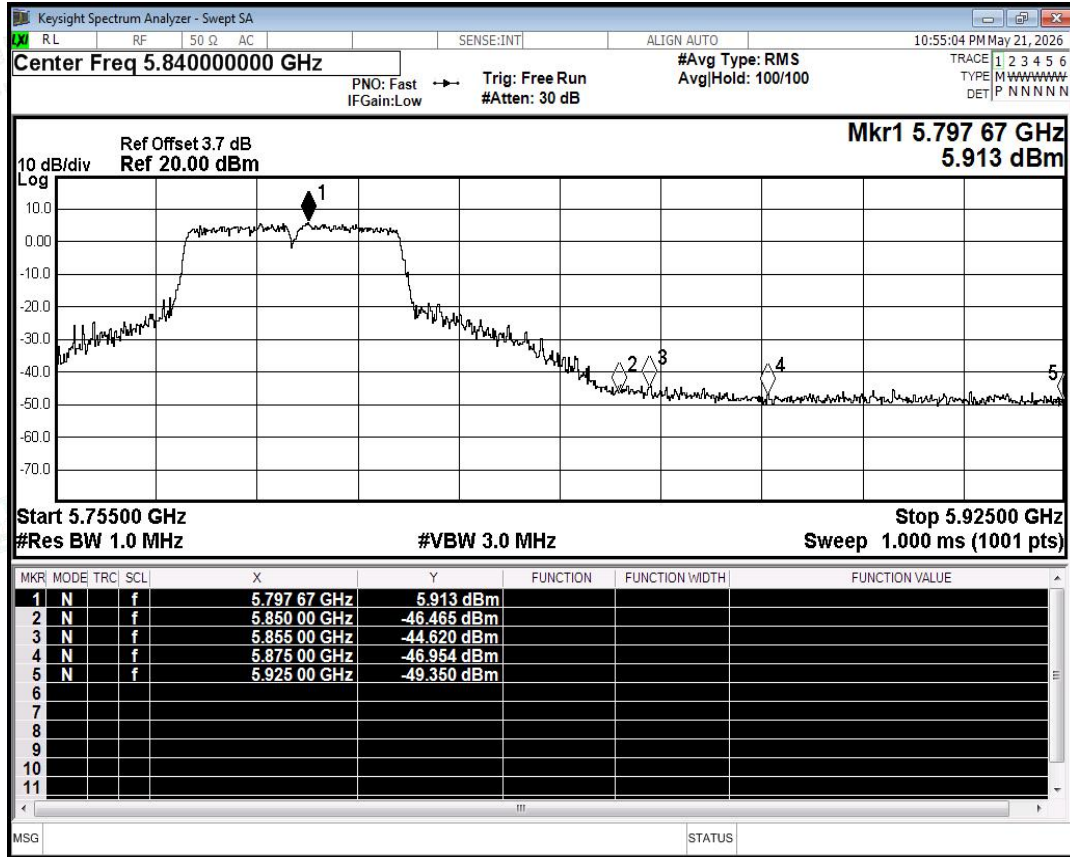

Restrict Band NVNT n40 5795MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

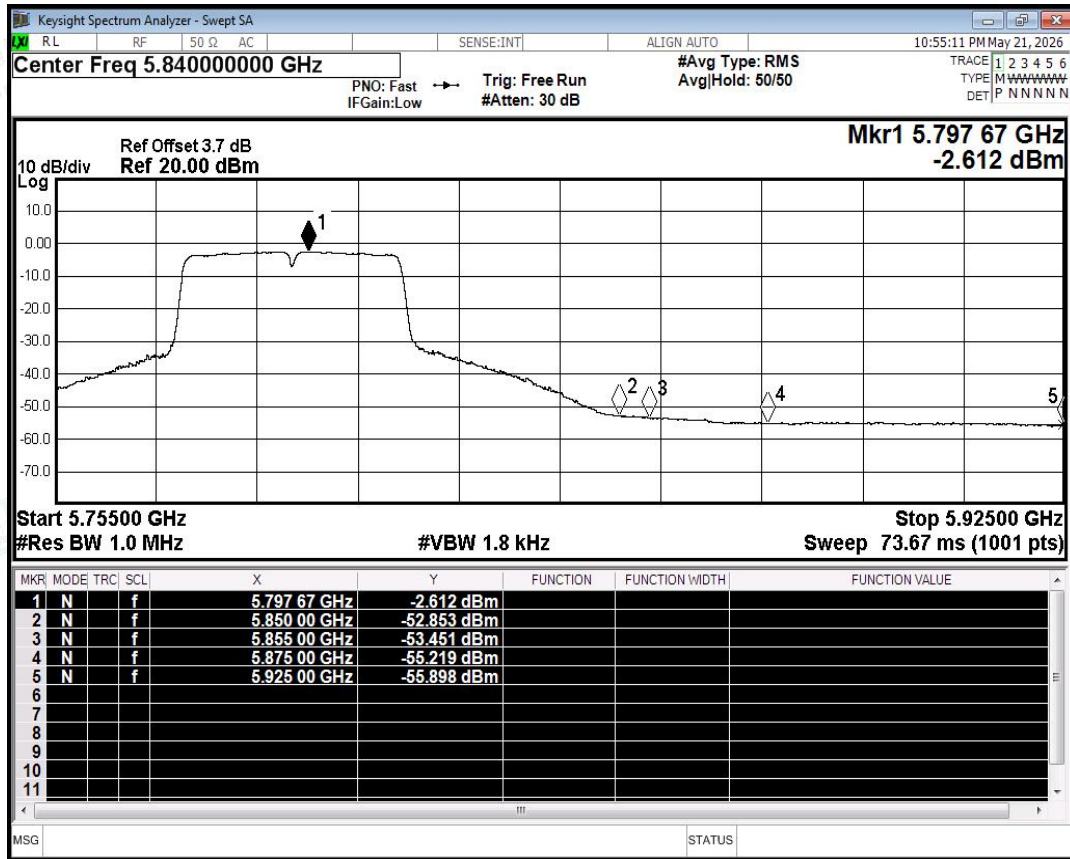

Restrict Band NVNT n40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

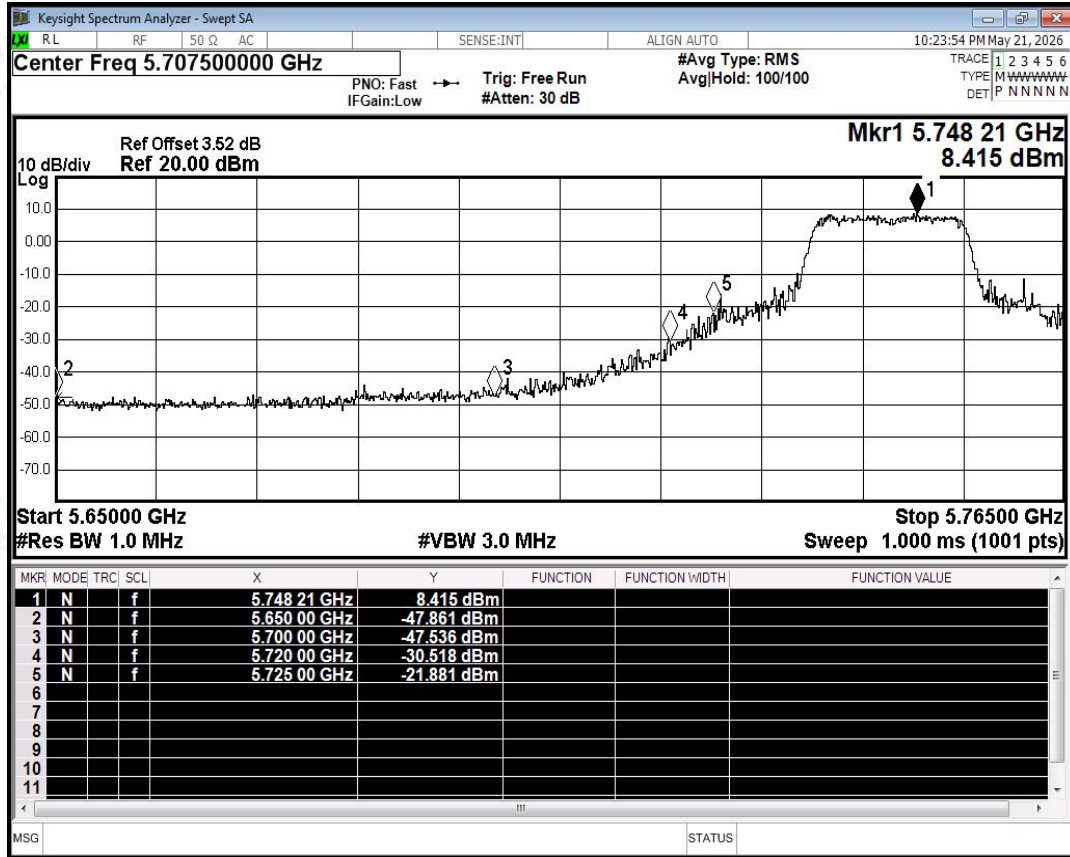

Restrict Band NVNT ac20 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

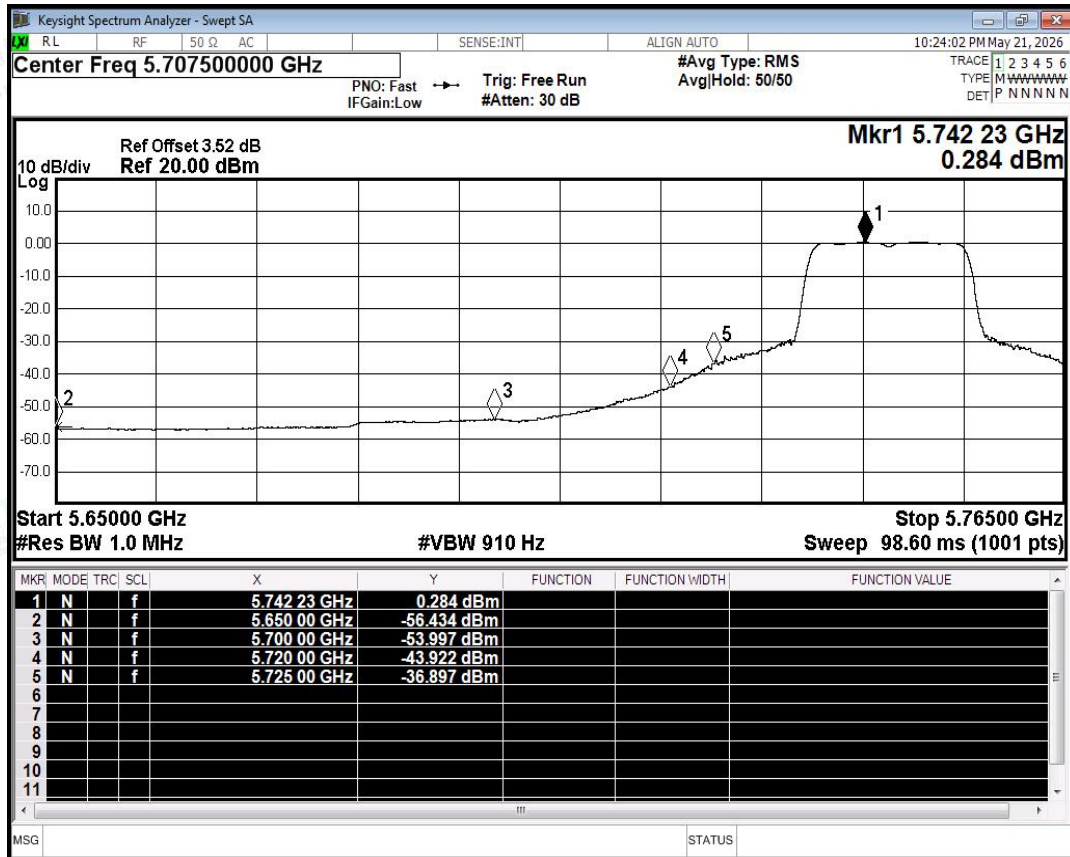

Restrict Band NVNT ac20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

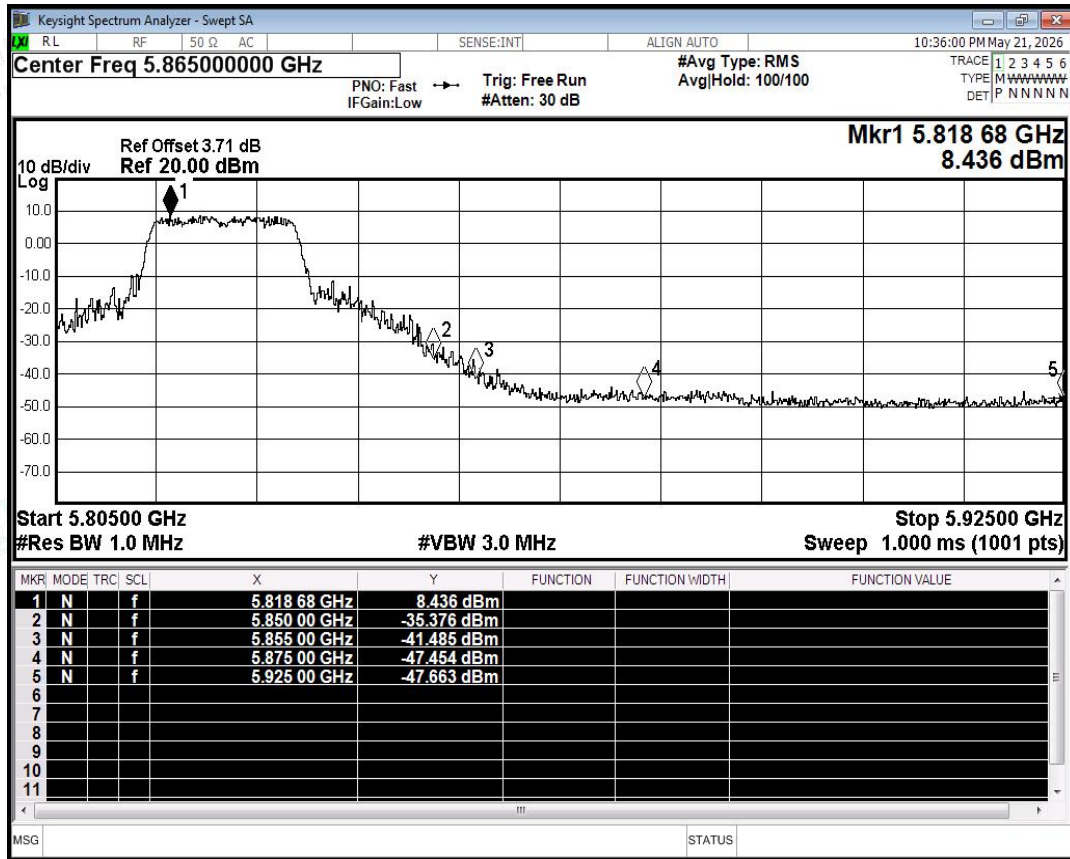

Restrict Band NVNT ac20 5825MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

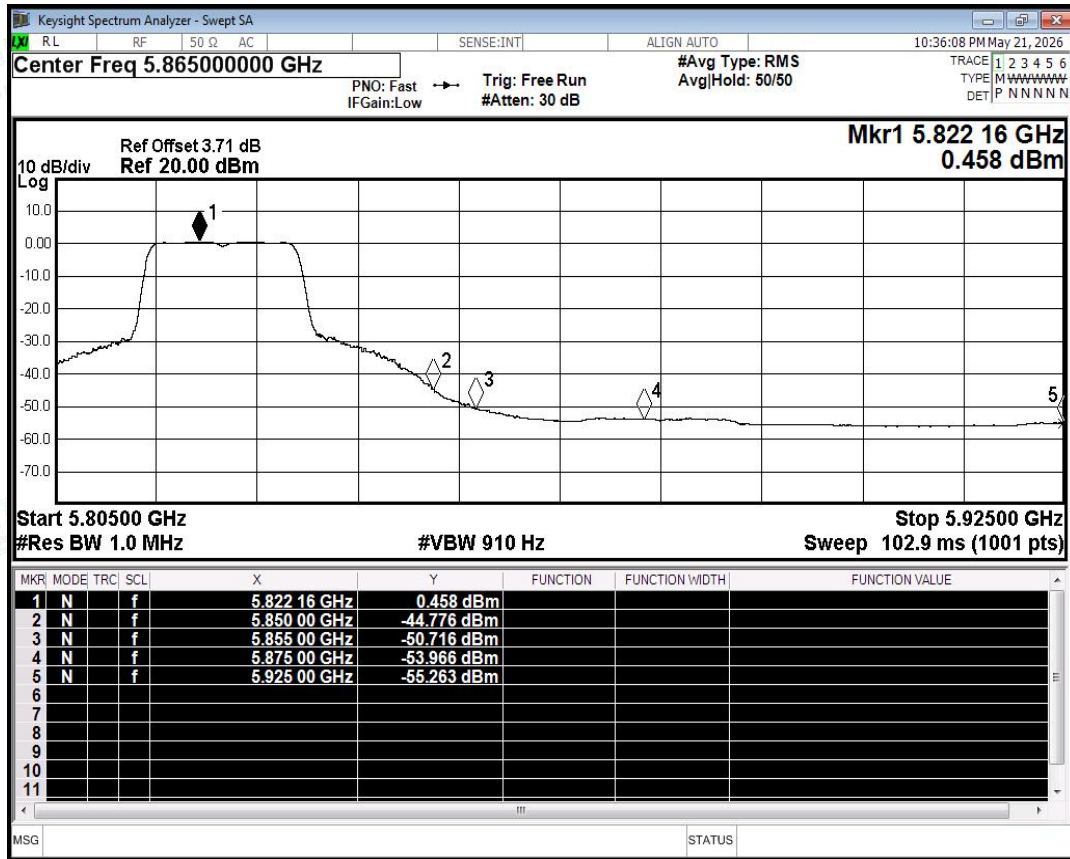

Restrict Band NVNT ac20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

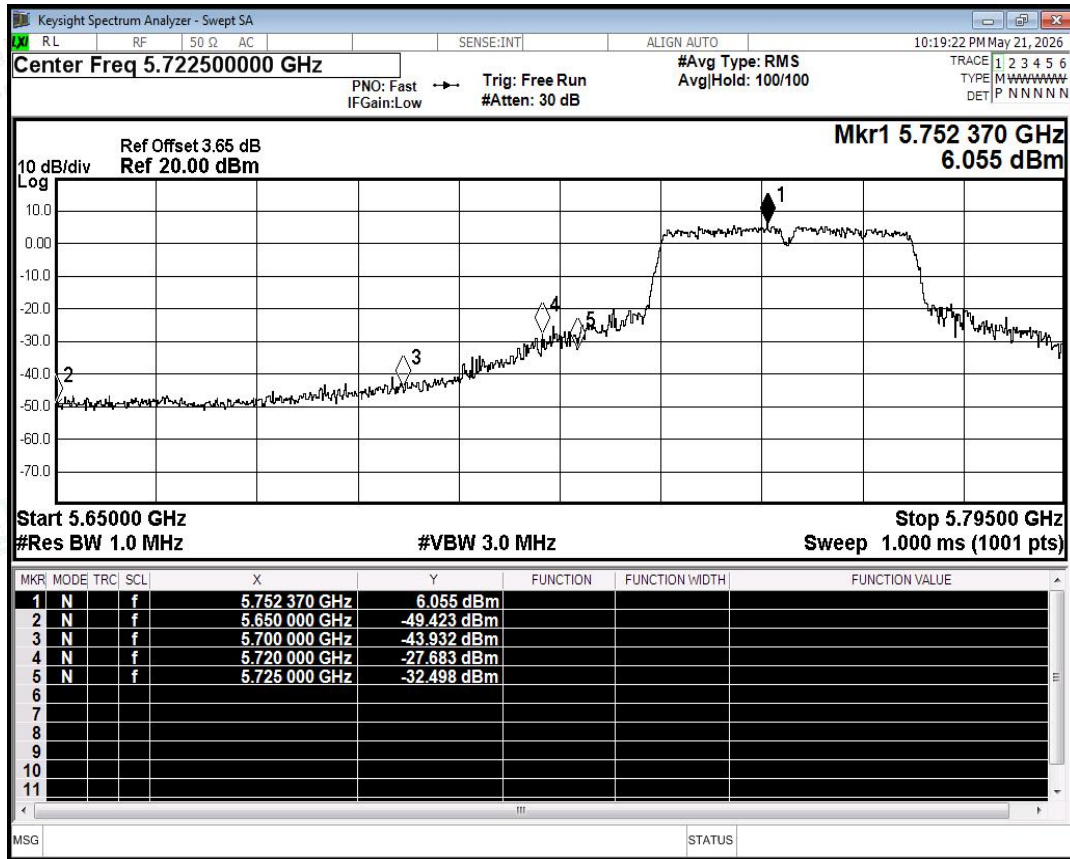

Restrict Band NVNT ac40 5755MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

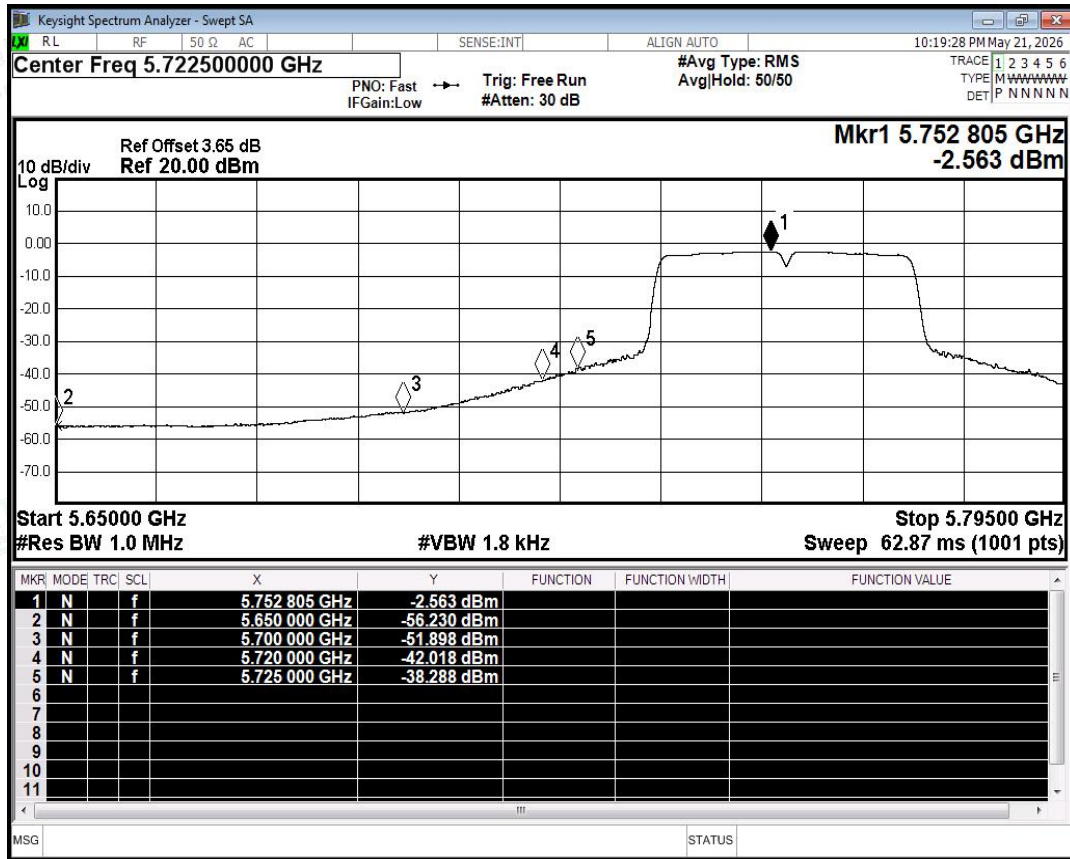

Restrict Band NVNT ac40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

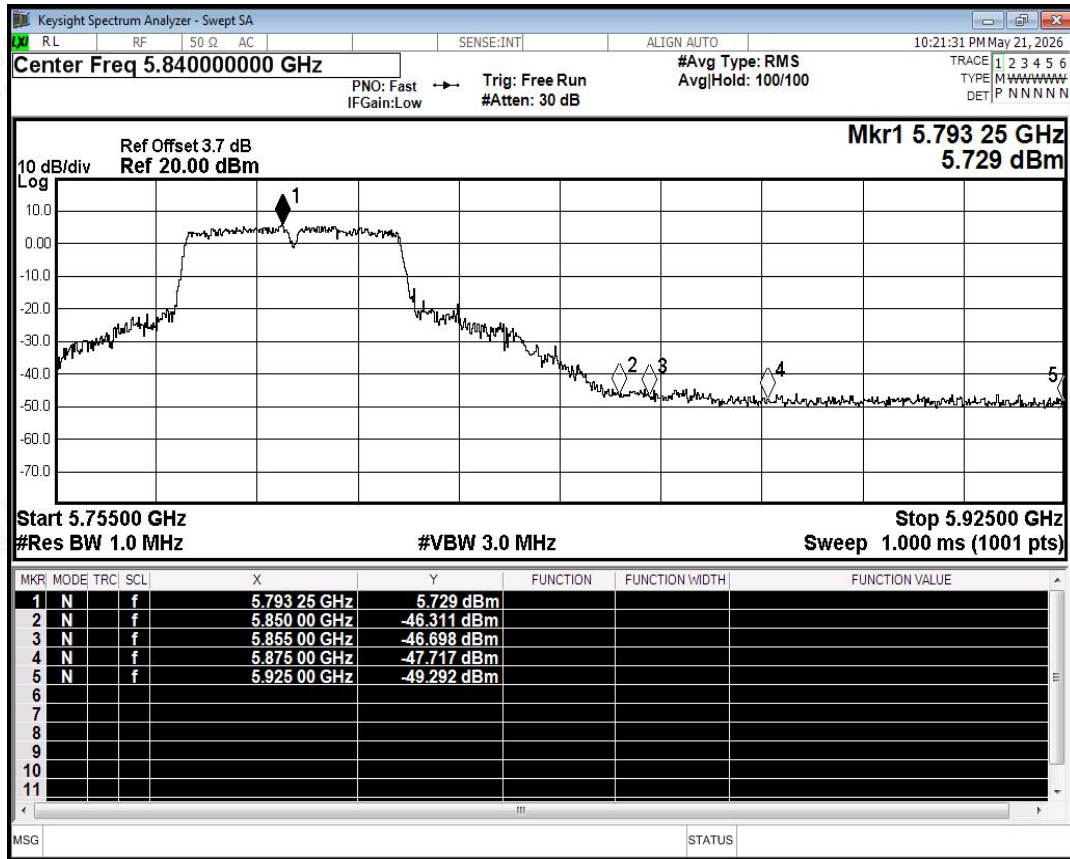

Restrict Band NVNT ac40 5795MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

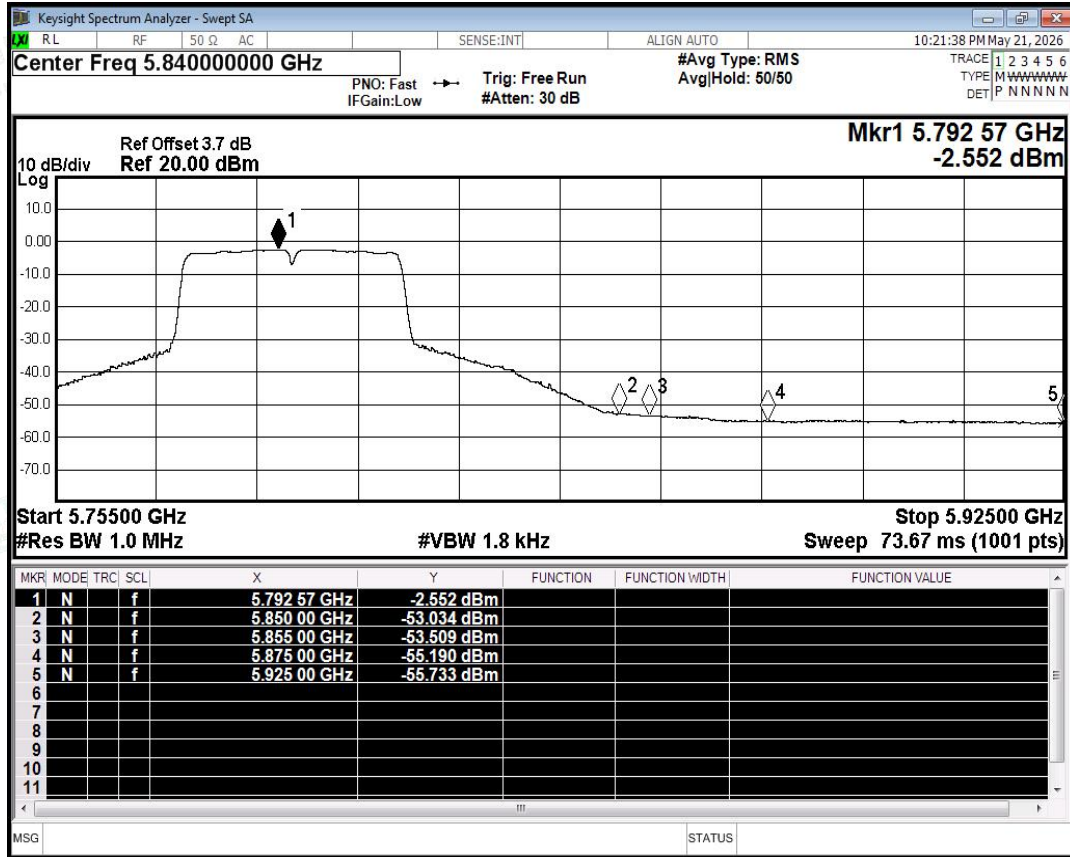

Restrict Band NVNT ac40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

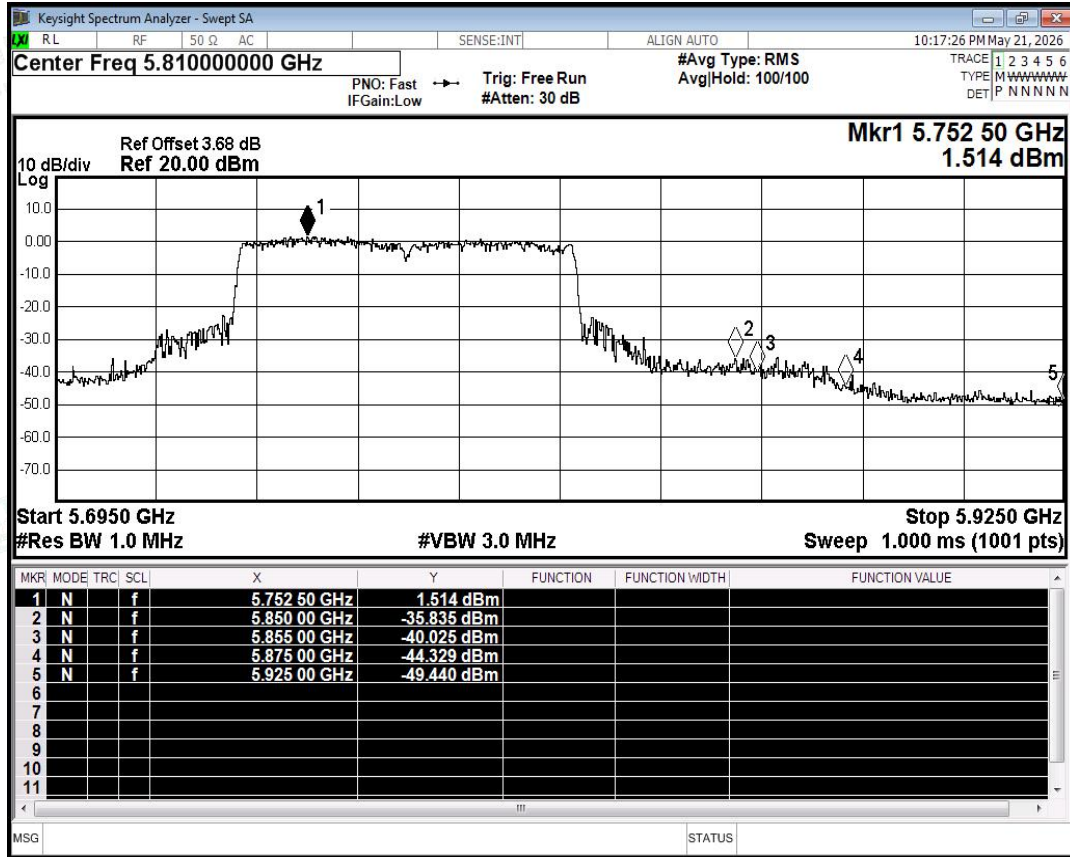

Restrict Band NVNT ac80 5775MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

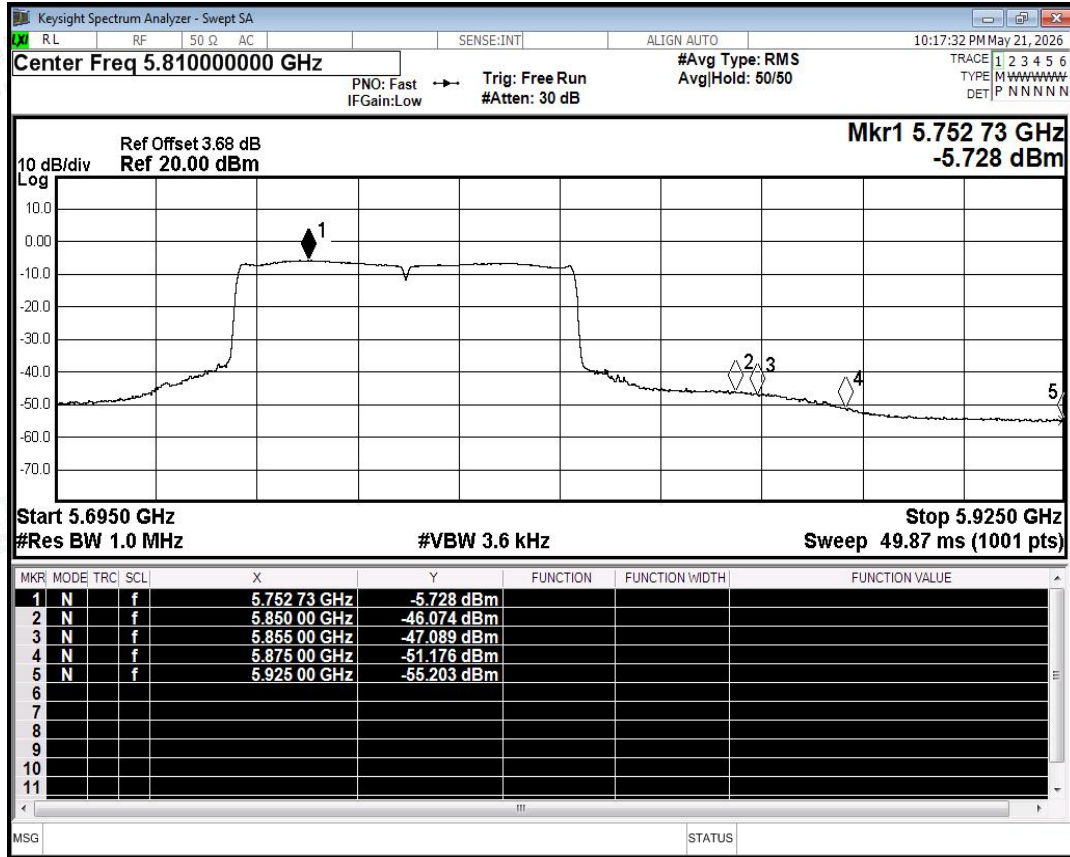

Restrict Band NVNT ac80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

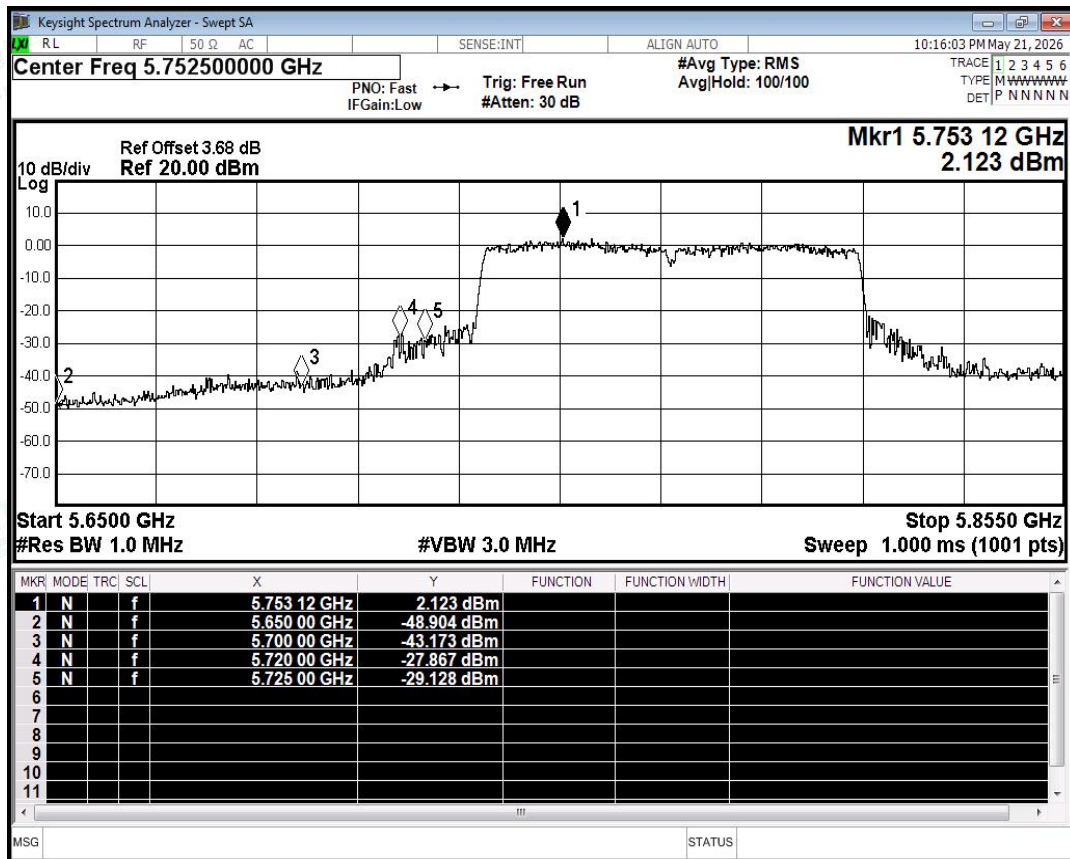

Restrict Band NVNT ac80 5775MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

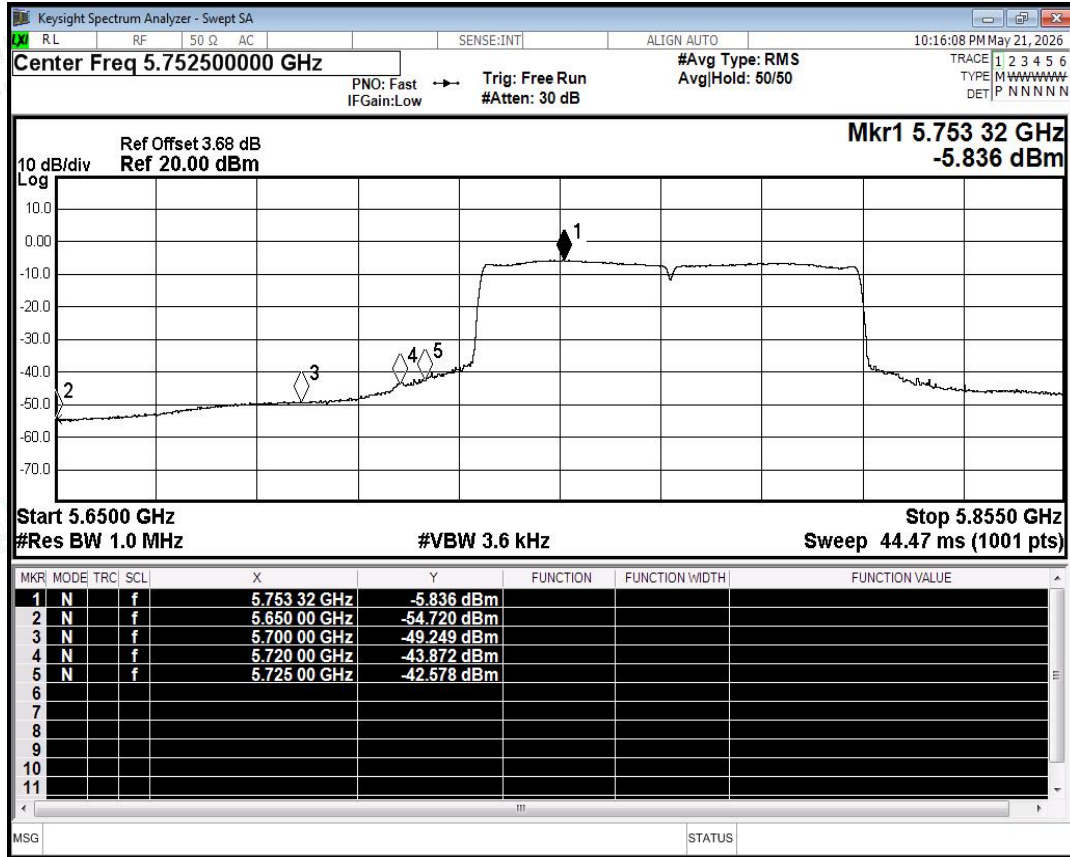

Restrict Band NVNT ac80 5775MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5745	0	0	25	Pass
NVNT	a	5785	Ant1	5785	0	0	25	Pass
NVNT	a	5825	Ant1	5825	0	0	25	Pass
NVNT	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant1	5825	0	0	25	Pass
NVNT	n40	5755	Ant1	5755	0	0	25	Pass
NVNT	n40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac80	5775	Ant1	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity