



NVNT	ac20	5180	Ant1	5150	-47.45	2.17	49.95	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-49.34	2.17	48.06	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-54.85	2.17	42.55	Average	54	Pass
NVNT	ac20	5240	Ant1	5435.52	-46.51	2.17	50.89	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350.32	-54.67	2.17	42.73	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-49.65	2.17	47.75	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-56.79	2.17	40.61	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-51.31	2.17	46.09	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.49	2.17	38.91	Average	54	Pass
NVNT	ac40	5190	Ant1	5149.7	-42.12	2.17	55.28	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-48.7	2.17	48.70	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-41.83	2.17	55.57	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-48.49	2.17	48.91	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-47.23	2.17	50.17	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-55.38	2.17	42.02	Average	54	Pass
NVNT	ac40	5230	Ant1	5455.95	-45.91	2.17	51.49	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5352	-55.03	2.17	42.37	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.74	2.17	48.66	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-55.88	2.17	41.52	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-50.66	2.17	46.74	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-55.47	2.17	41.93	Average	54	Pass
NVNT	ac80	5210	Ant1	5444.16	-46.91	2.17	50.49	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5369.91	-55.2	2.17	42.20	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.72	2.17	48.68	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-55.91	2.17	41.49	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-51.84	2.17	45.56	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.1	2.17	39.30	Average	54	Pass
NVNT	ac80	5210	Ant1	5149.38	-41.82	2.17	55.58	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-47.88	2.17	49.52	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-42.58	2.17	54.82	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-47.84	2.17	49.56	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

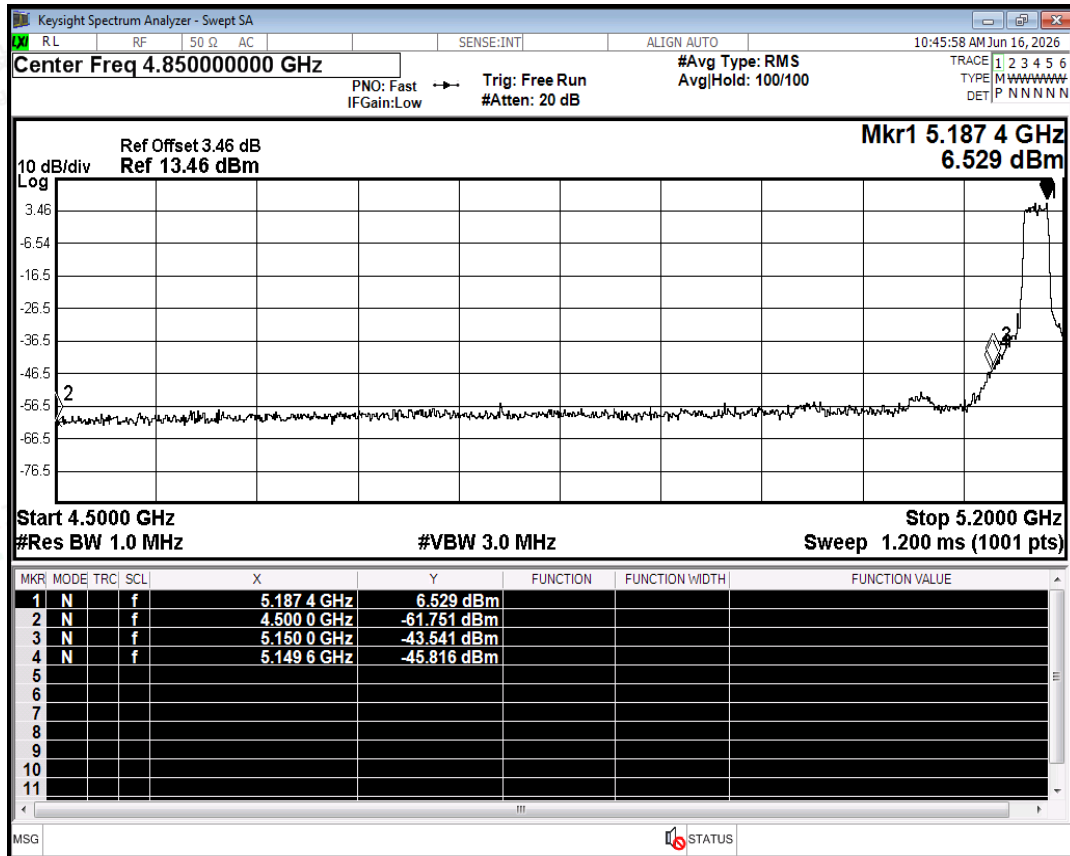

Restrict Band NVNT a 5180MHz Ant1 Peak

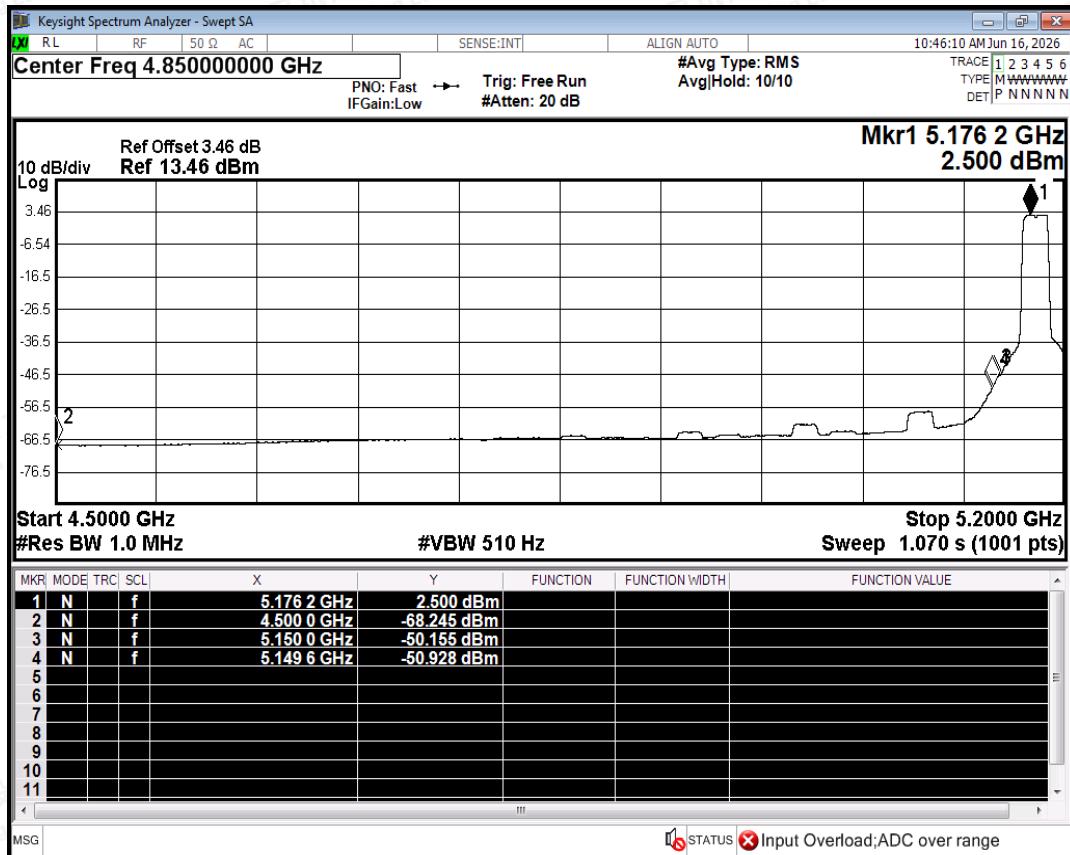

Restrict Band NVNT a 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

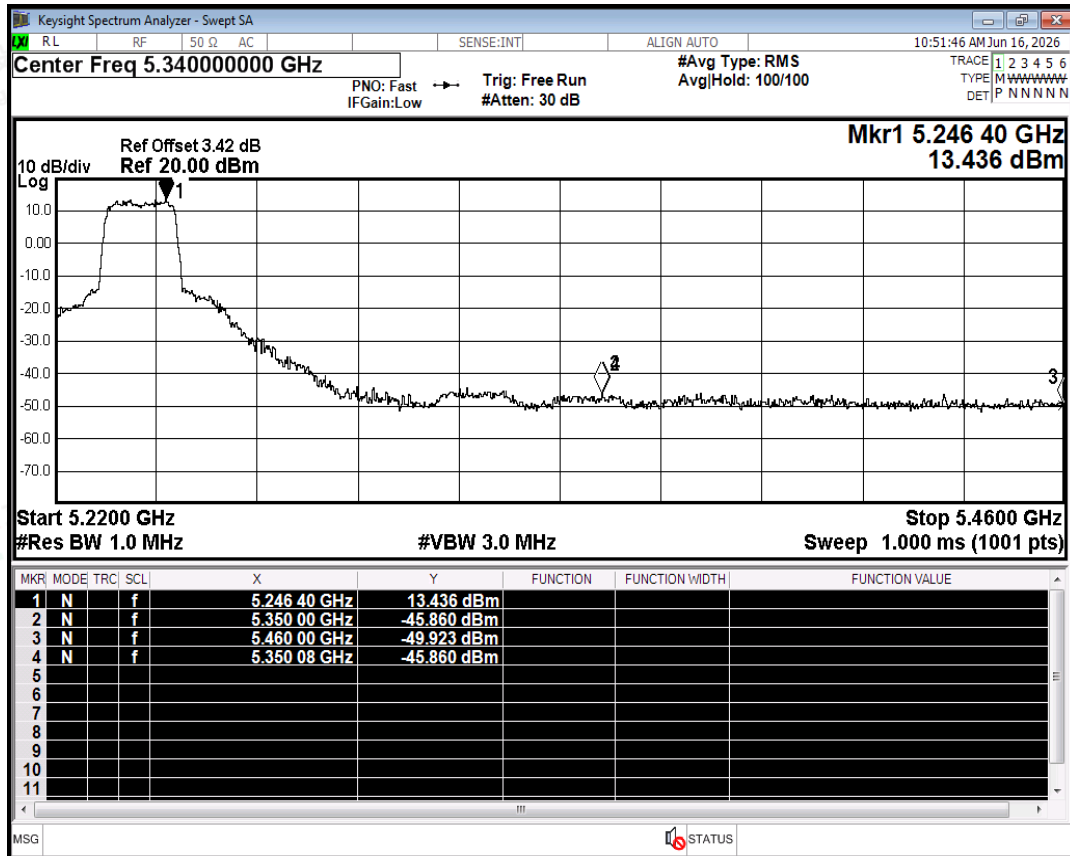

Restrict Band NVNT a 5240MHz Ant1 Peak

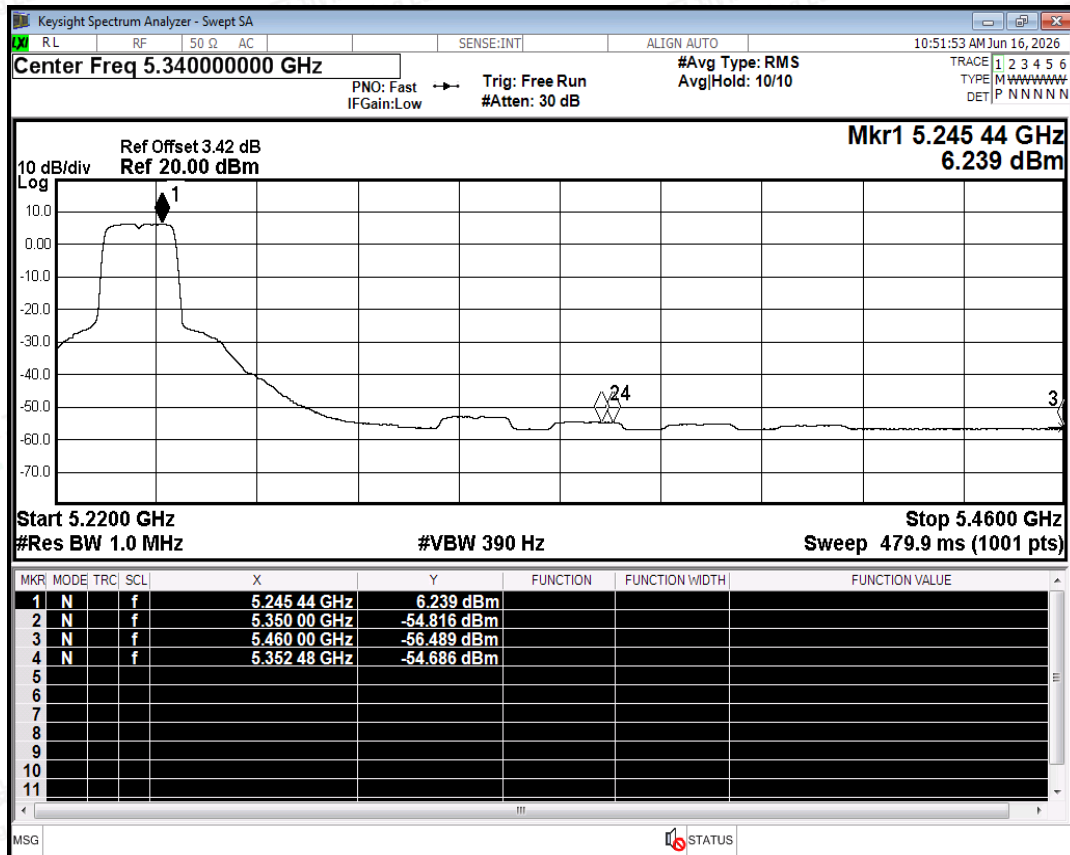

Restrict Band NVNT a 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

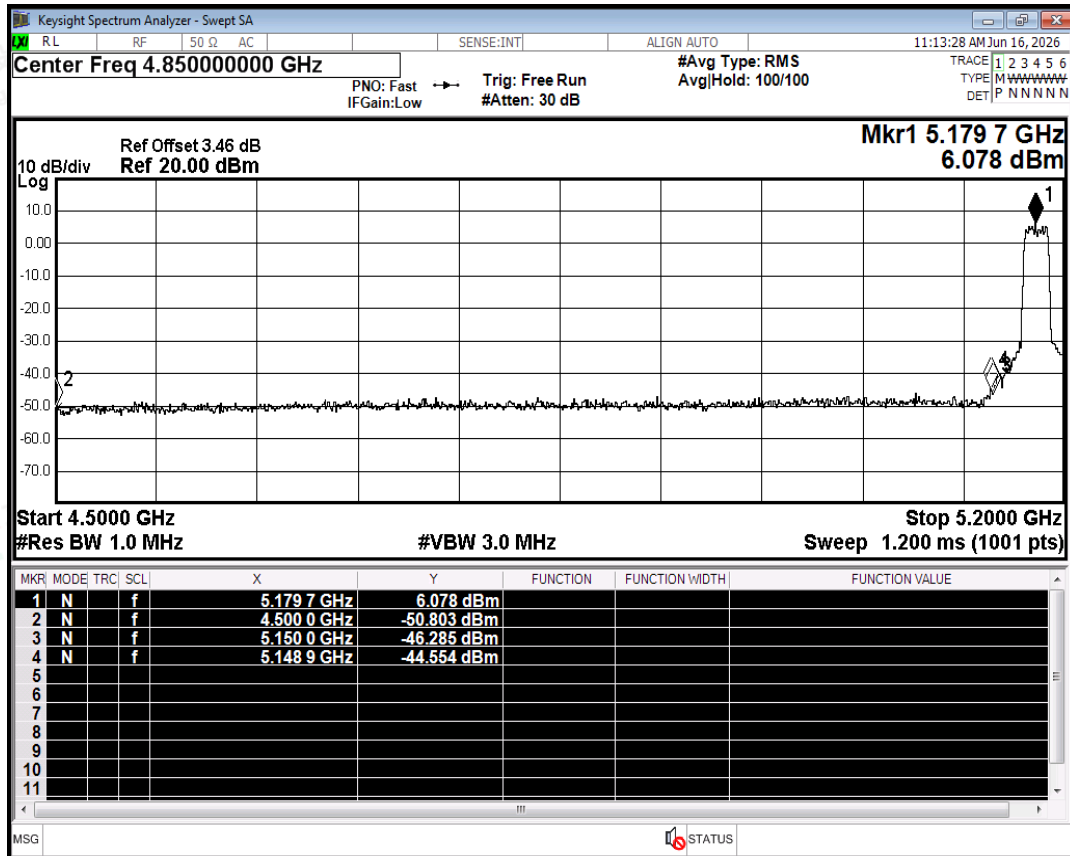

Restrict Band NVNT n20 5180MHz Ant1 Peak

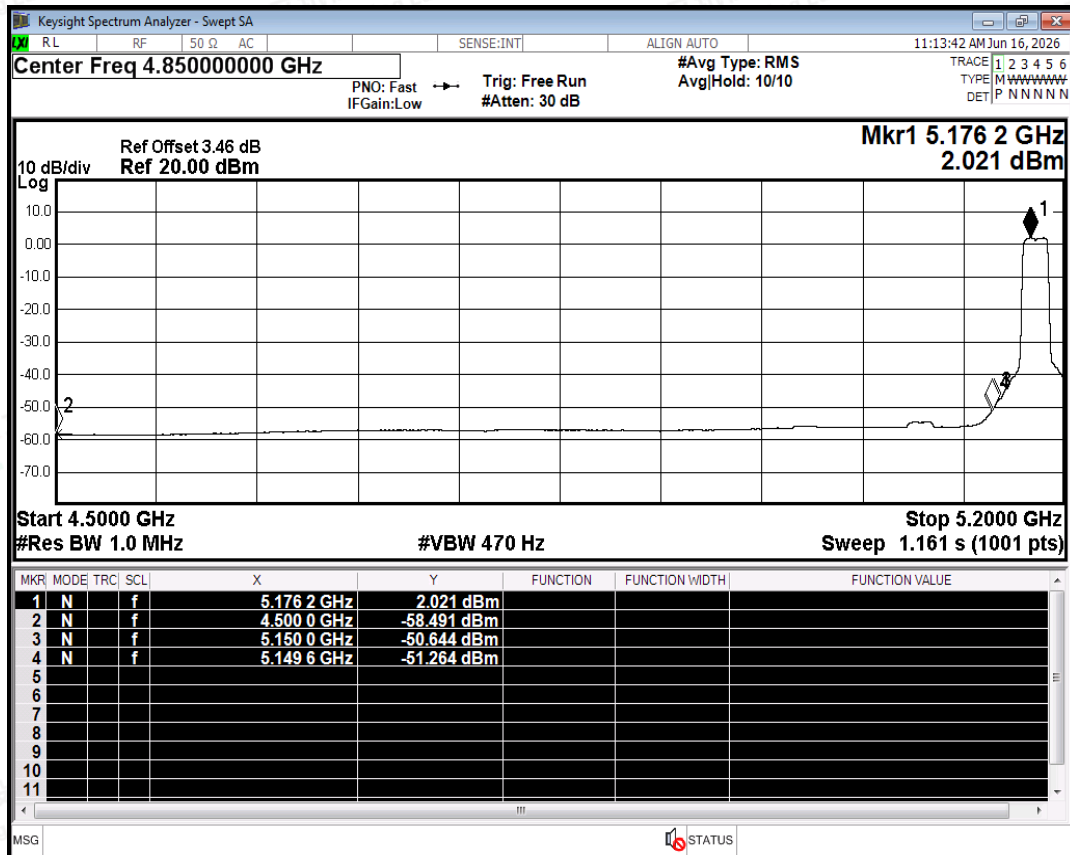

Restrict Band NVNT n20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

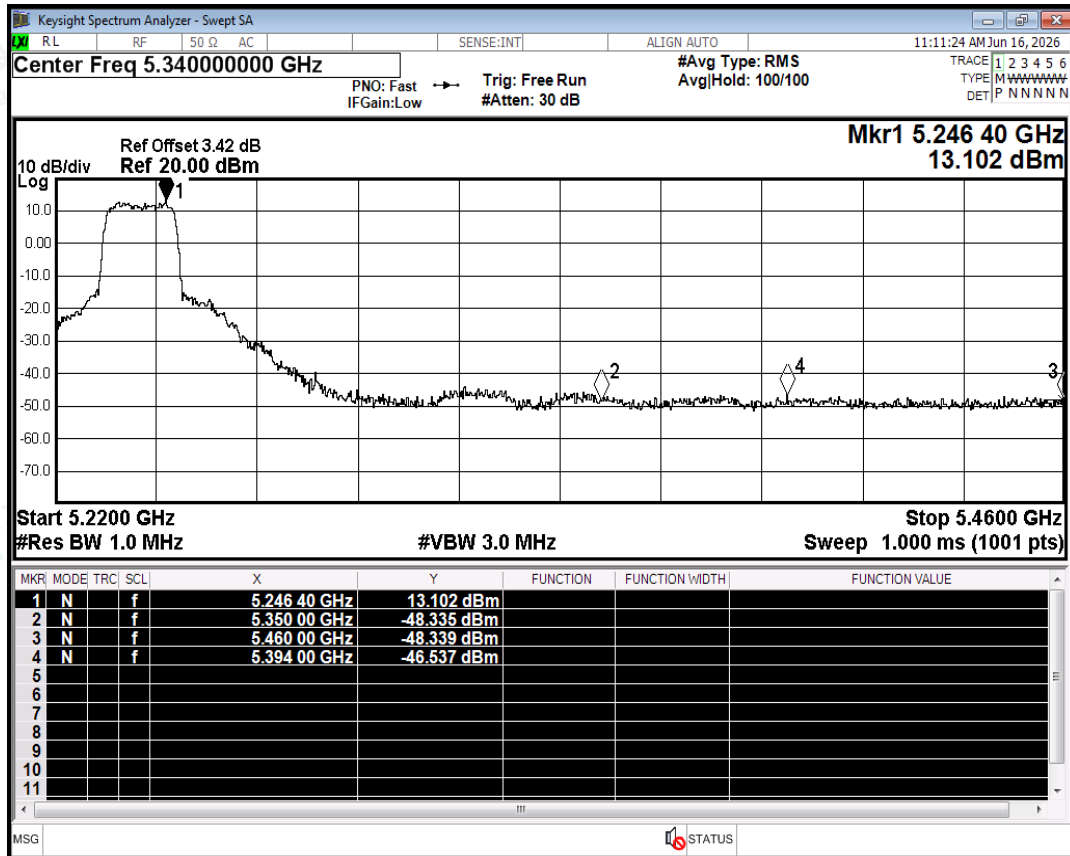

Restrict Band NVNT n20 5240MHz Ant1 Peak

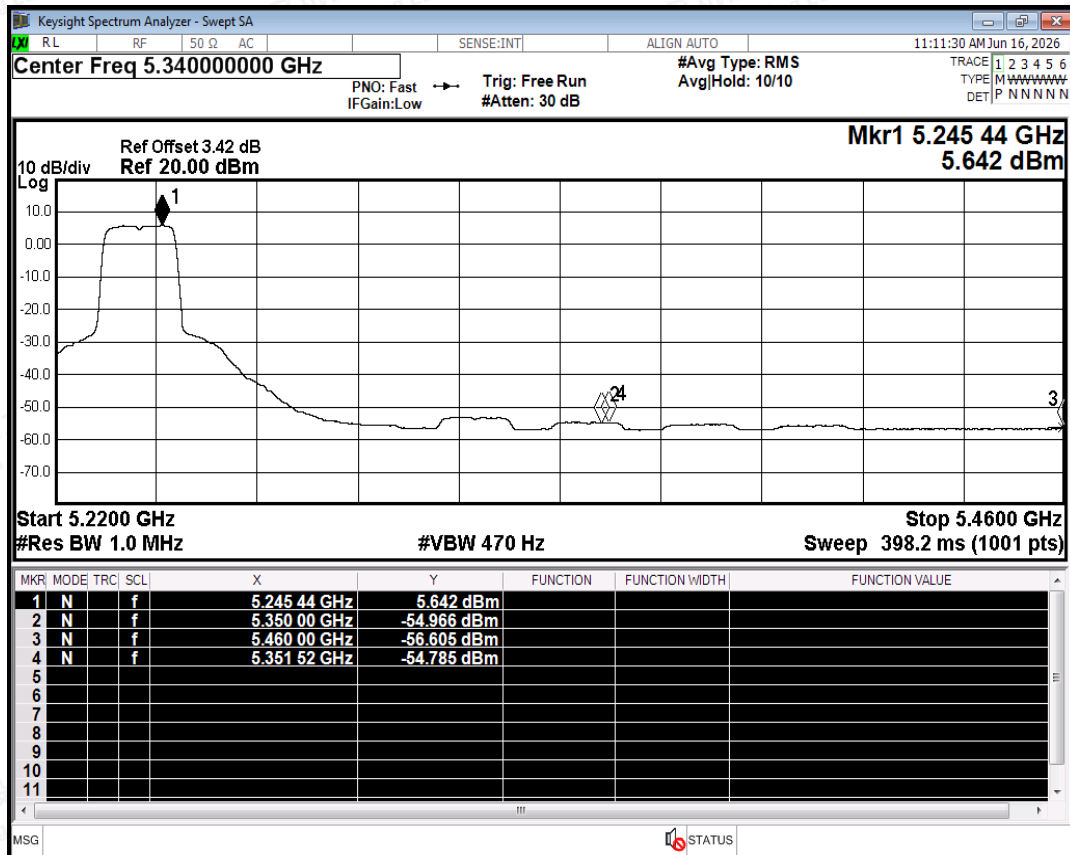

Restrict Band NVNT n20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

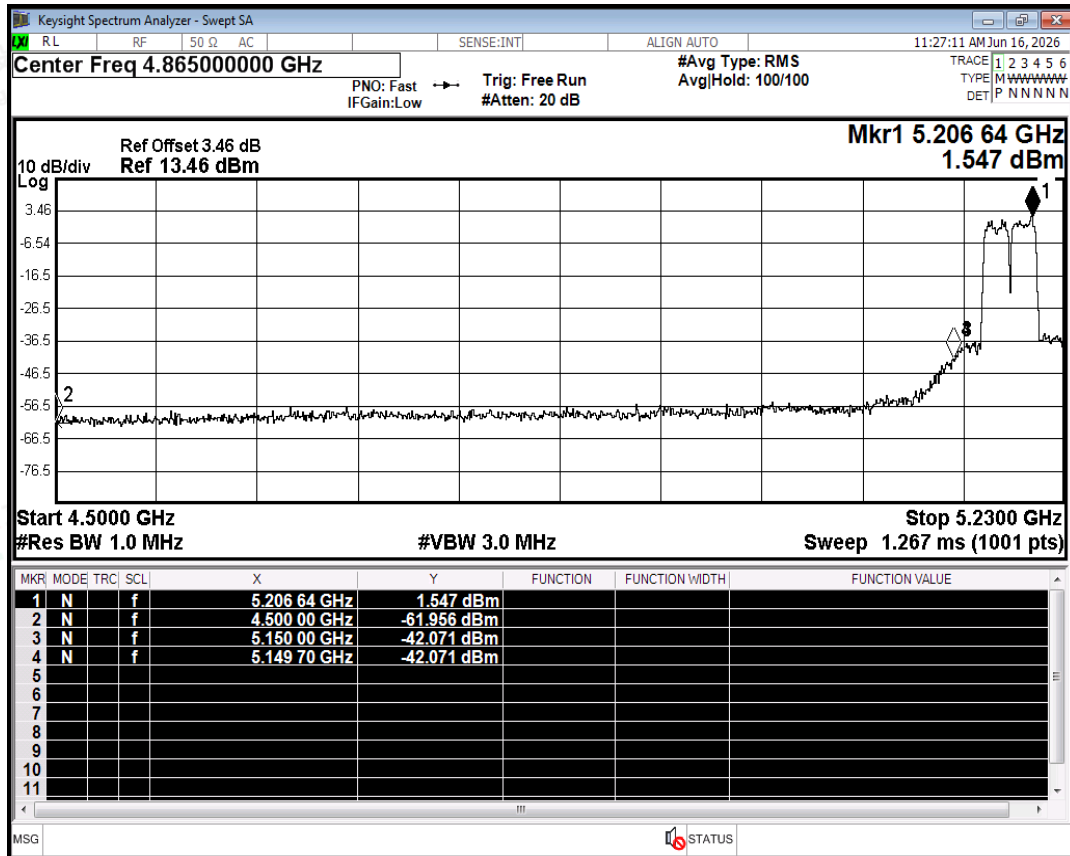

Restrict Band NVNT n40 5190MHz Ant1 Peak

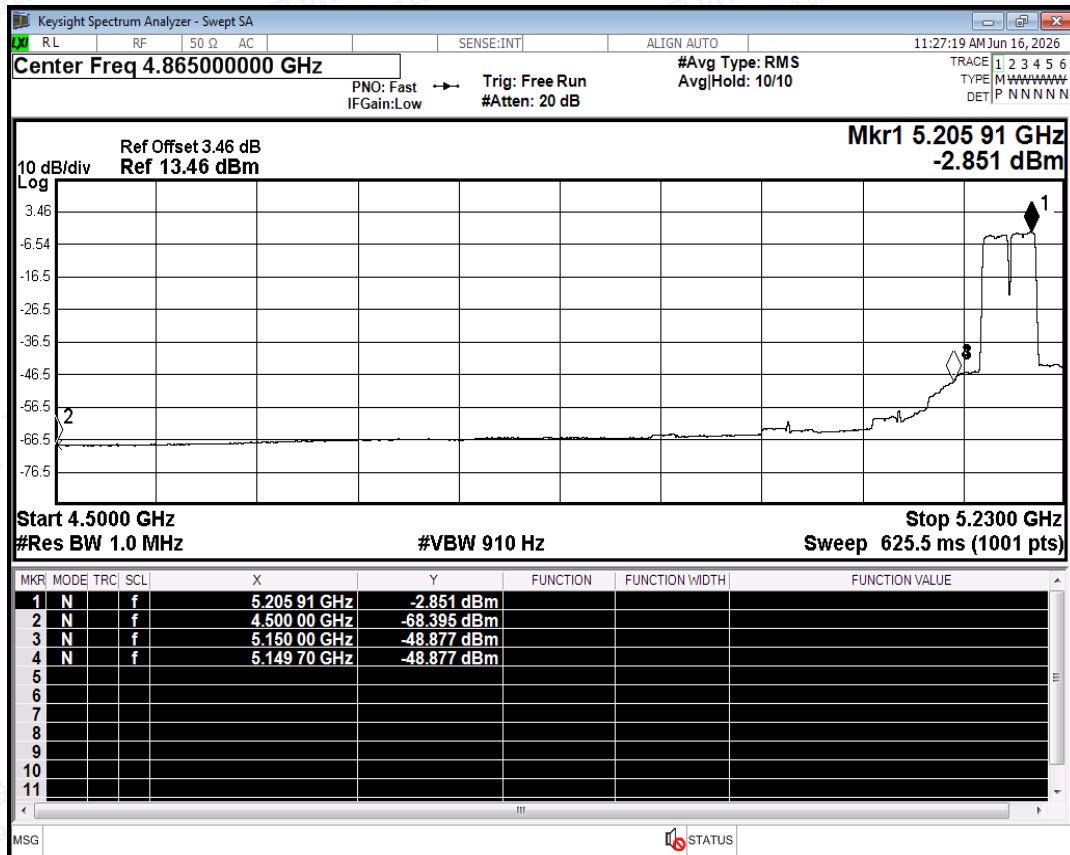

Restrict Band NVNT n40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

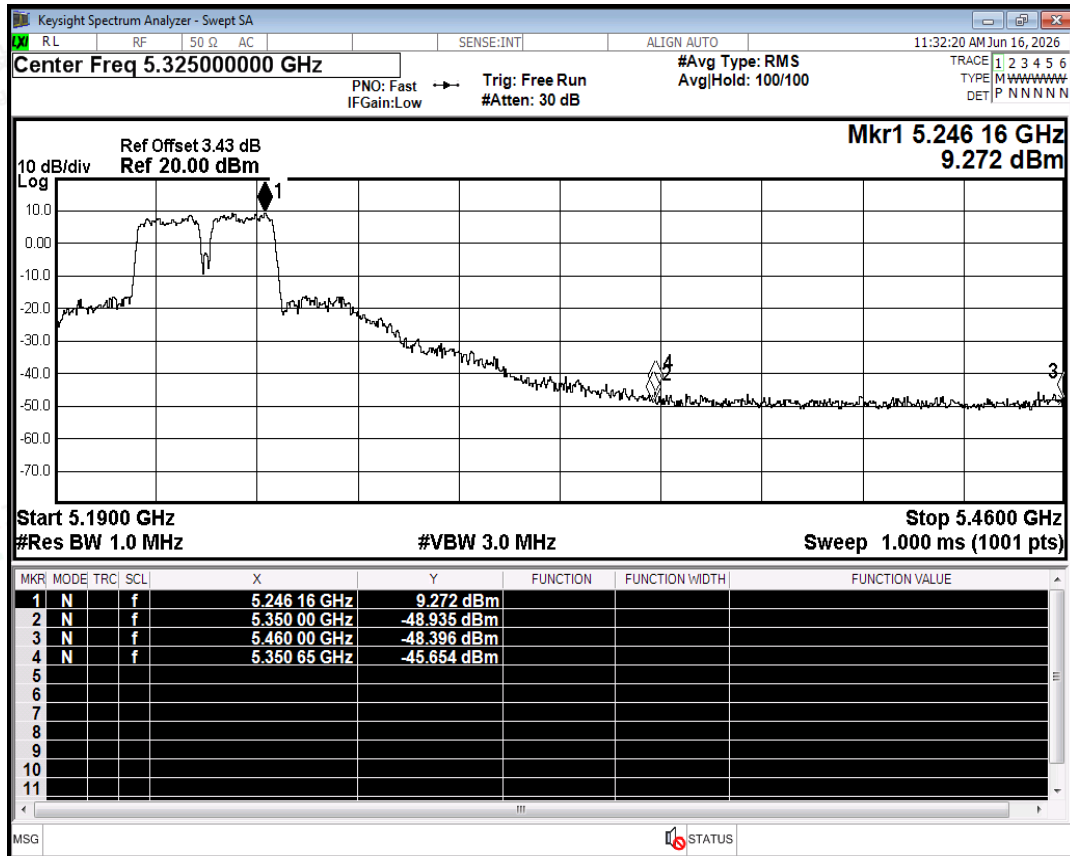

Restrict Band NVNT n40 5230MHz Ant1 Peak

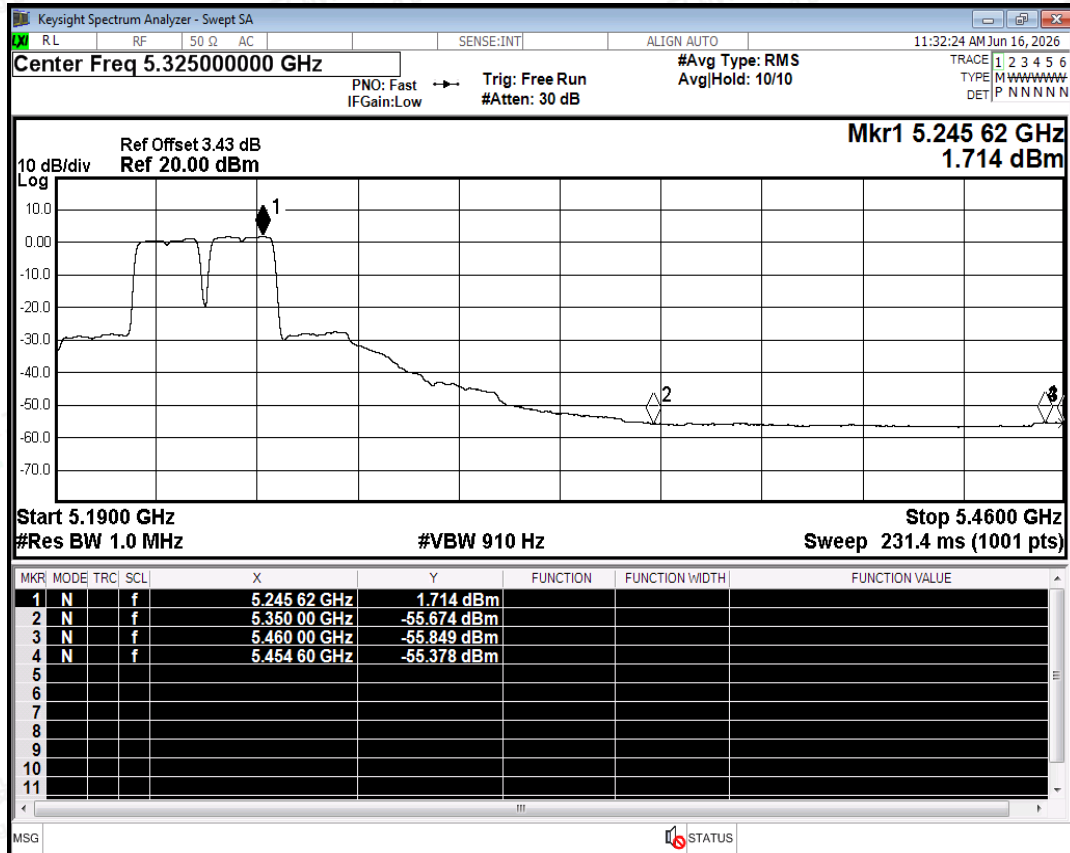

Restrict Band NVNT n40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

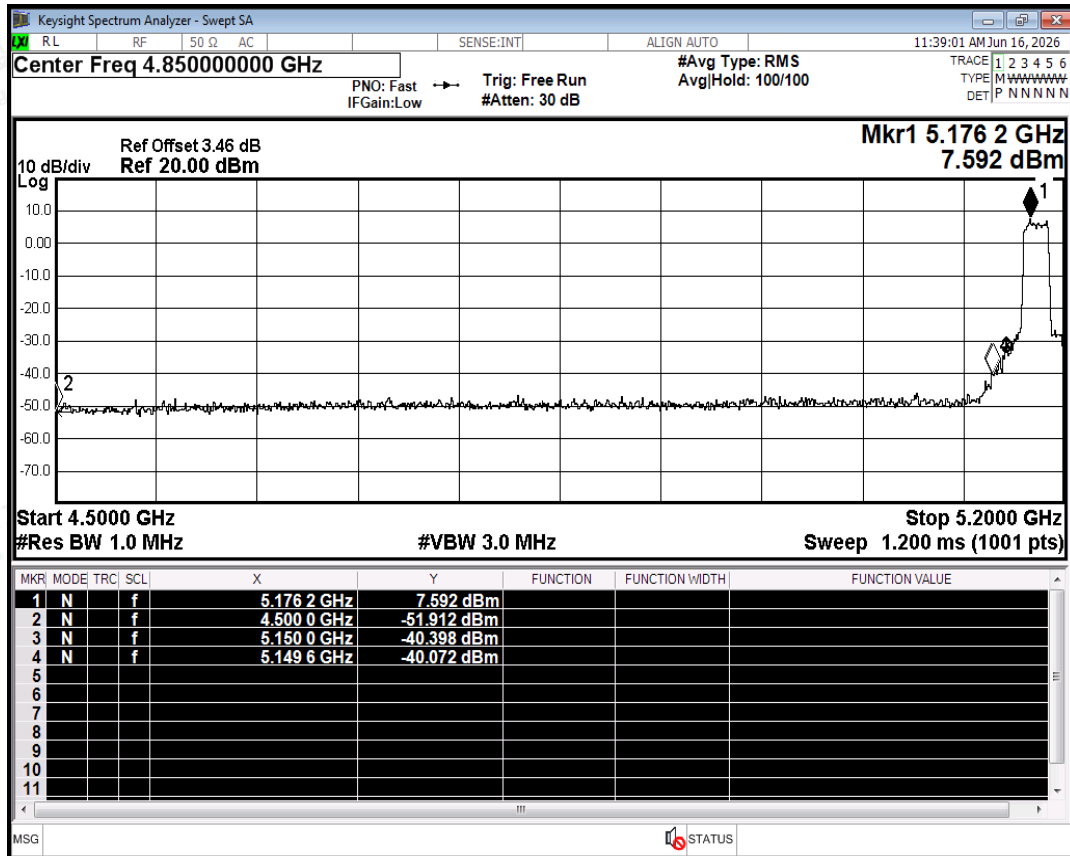

Restrict Band NVNT ac20 5180MHz Ant1 Peak

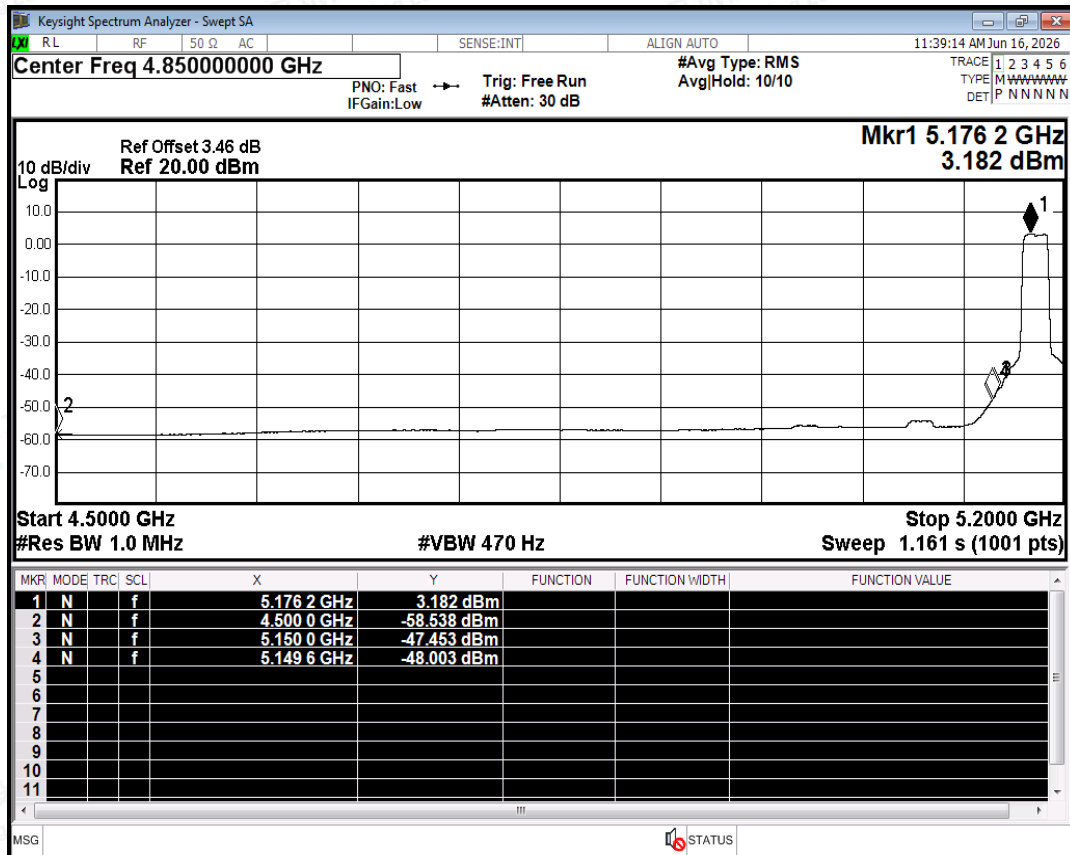

Restrict Band NVNT ac20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

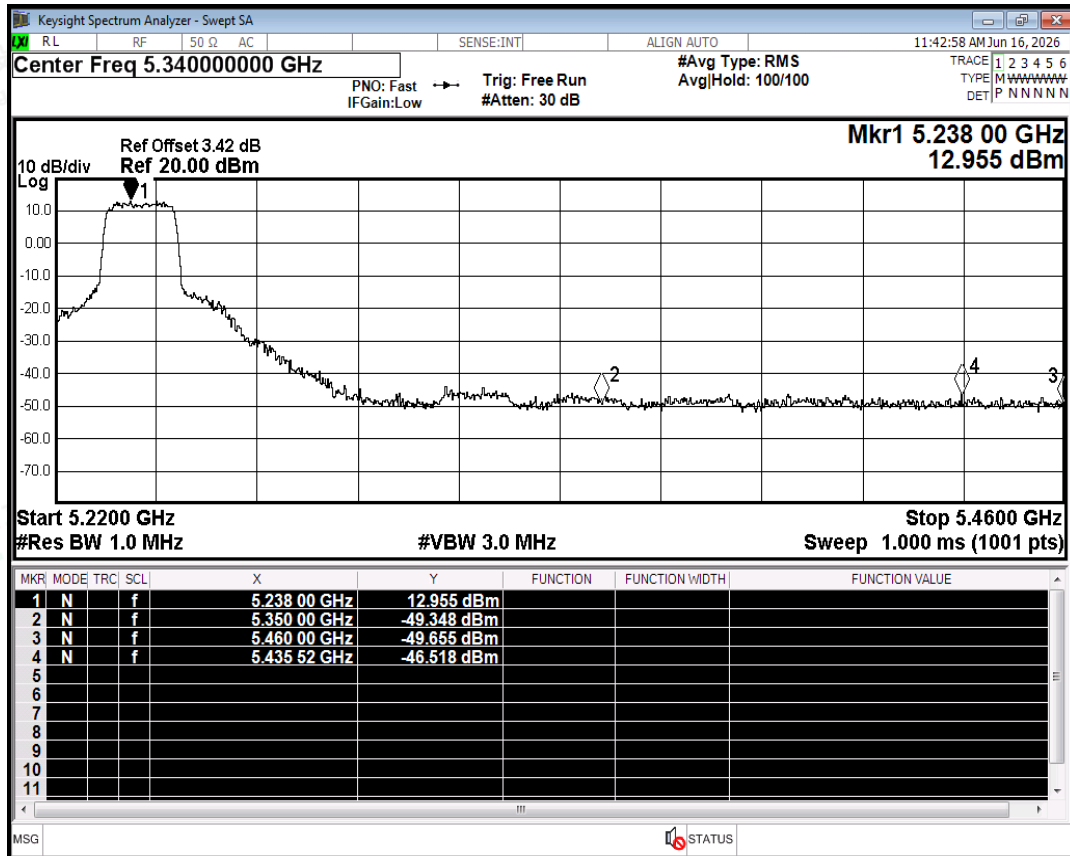

Restrict Band NVNT ac20 5240MHz Ant1 Peak

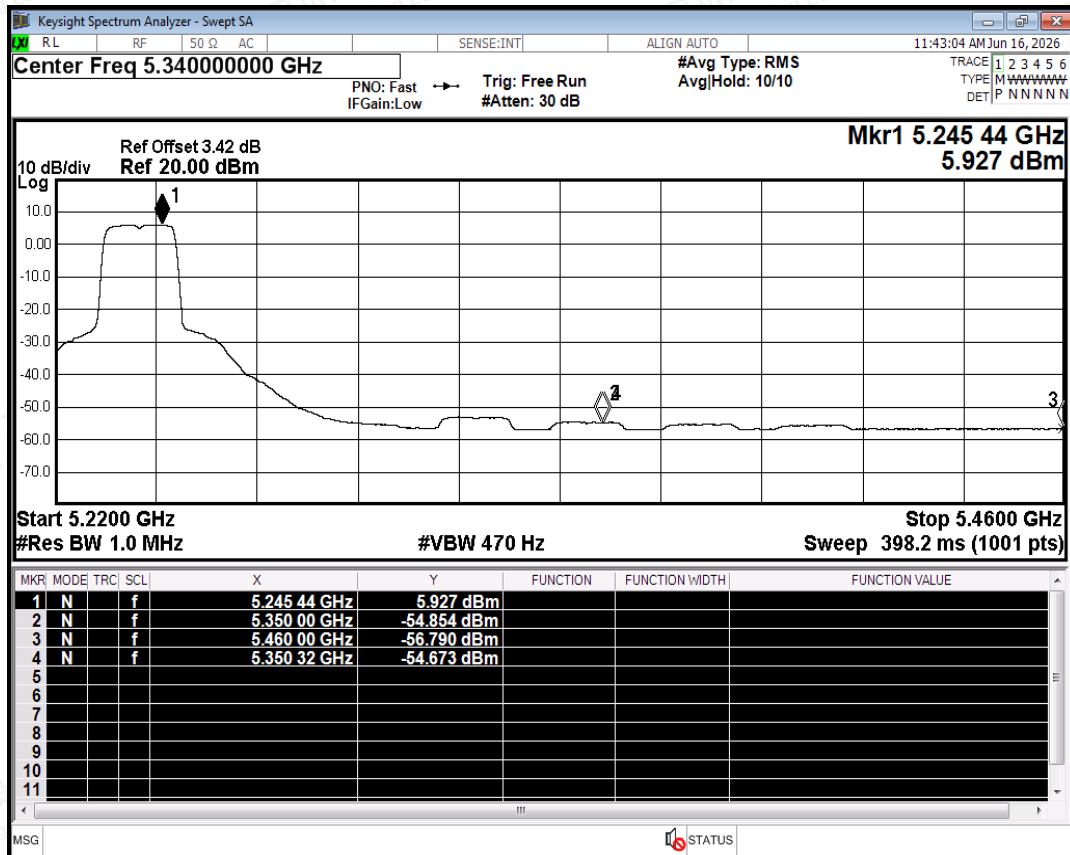

Restrict Band NVNT ac20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

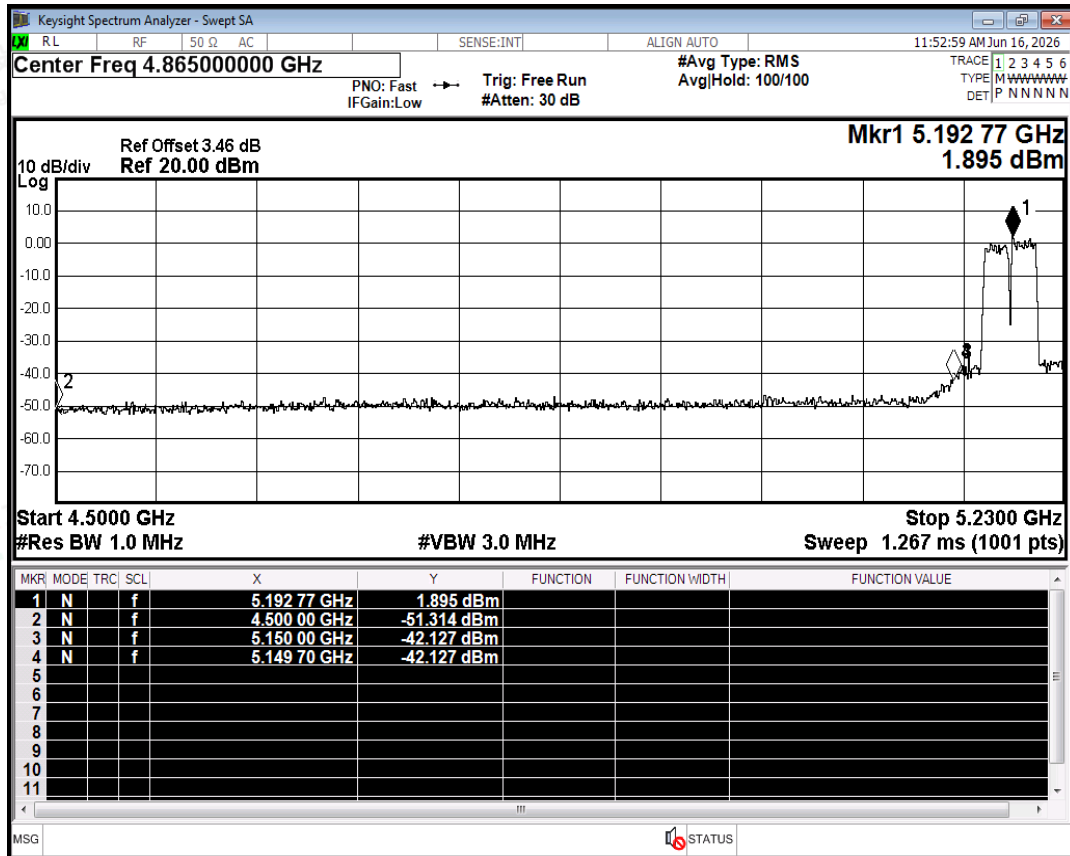

Restrict Band NVNT ac40 5190MHz Ant1 Peak

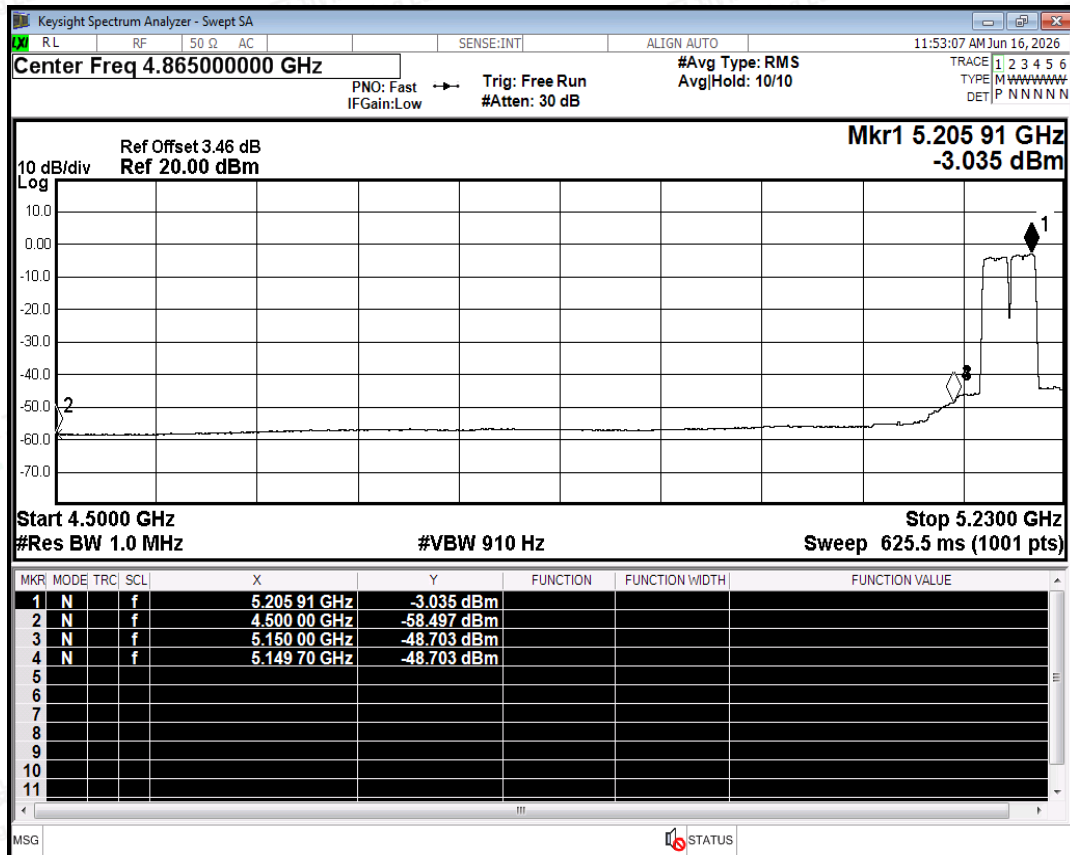

Restrict Band NVNT ac40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

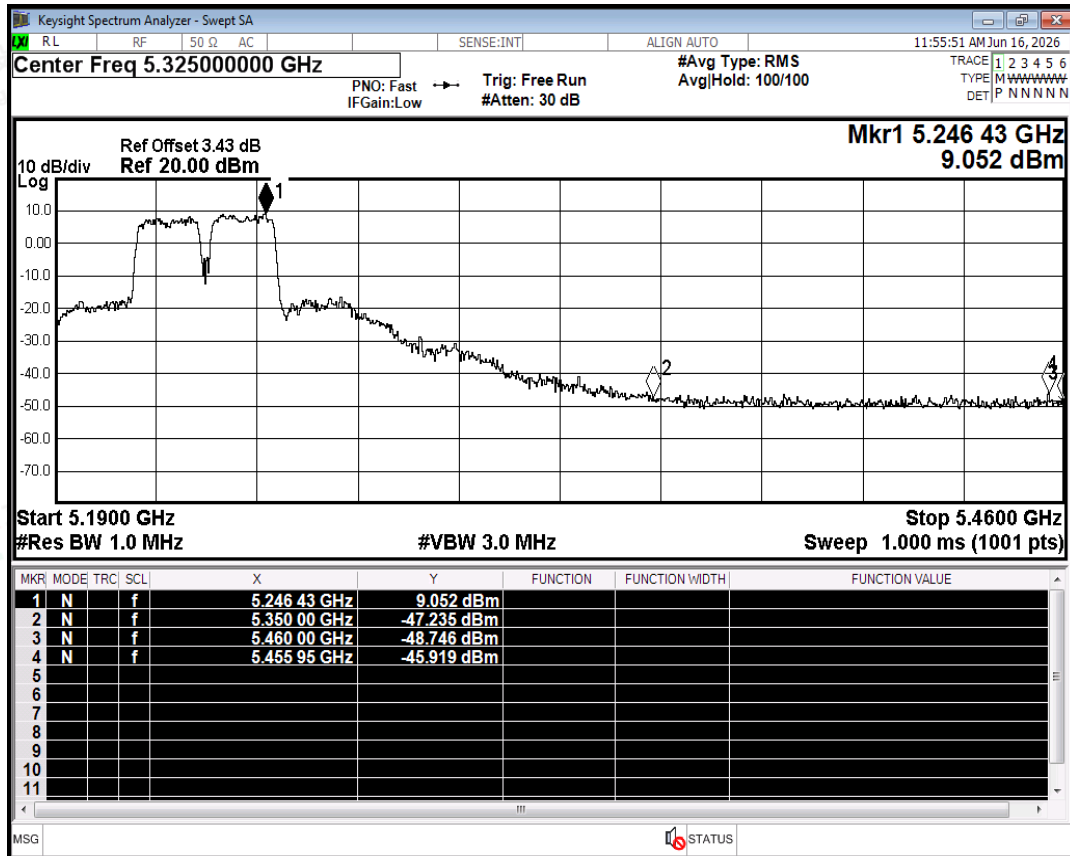

Restrict Band NVNT ac40 5230MHz Ant1 Peak

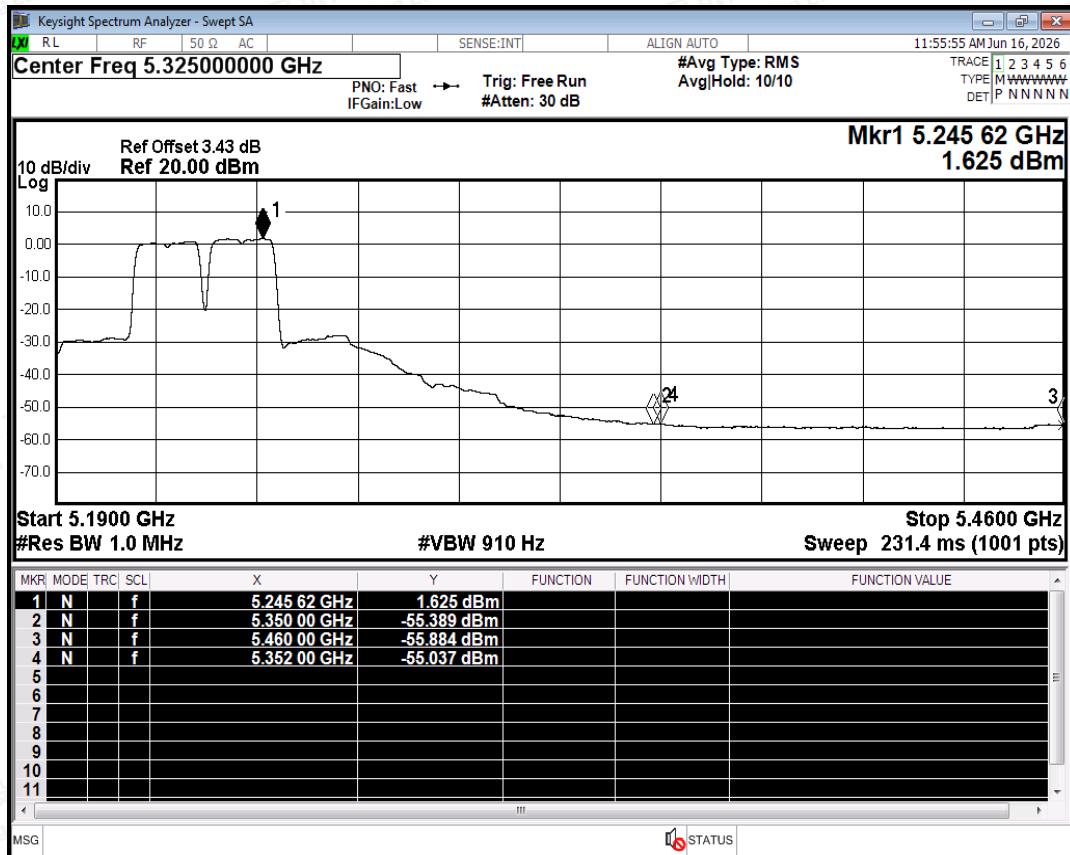

Restrict Band NVNT ac40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

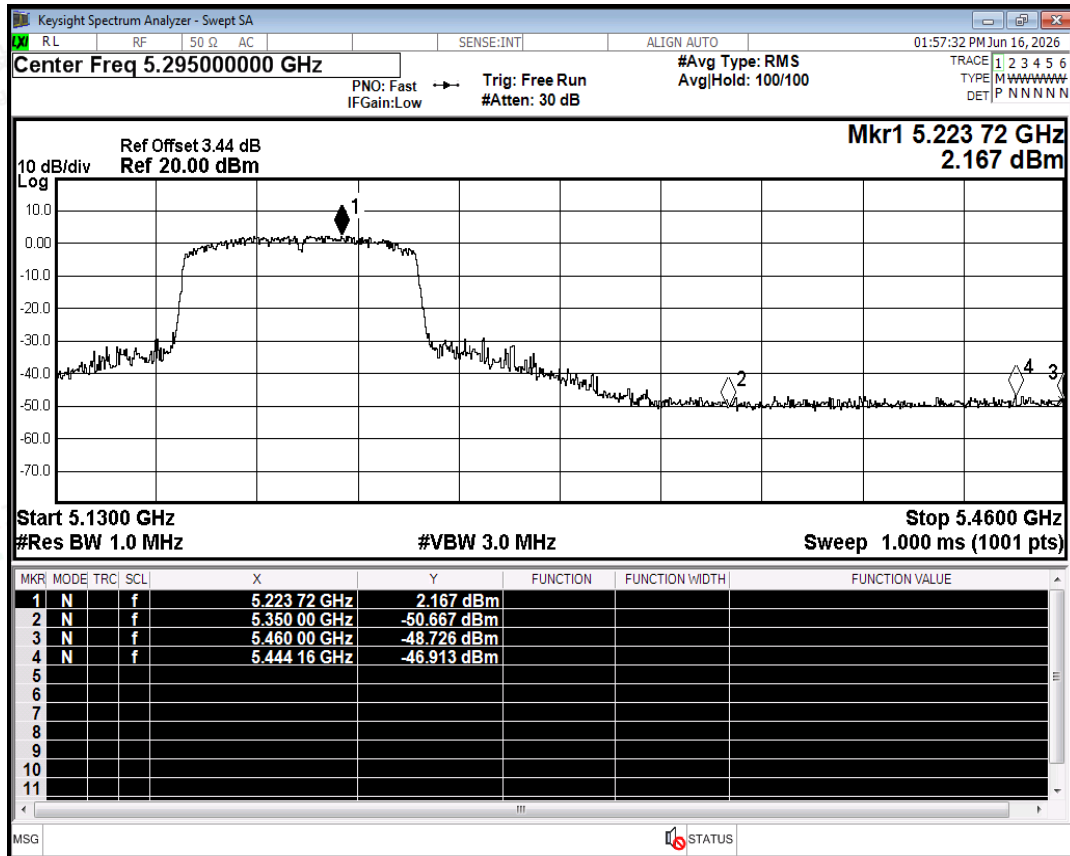

Restrict Band NVNT ac80 5210MHz Ant1 Peak

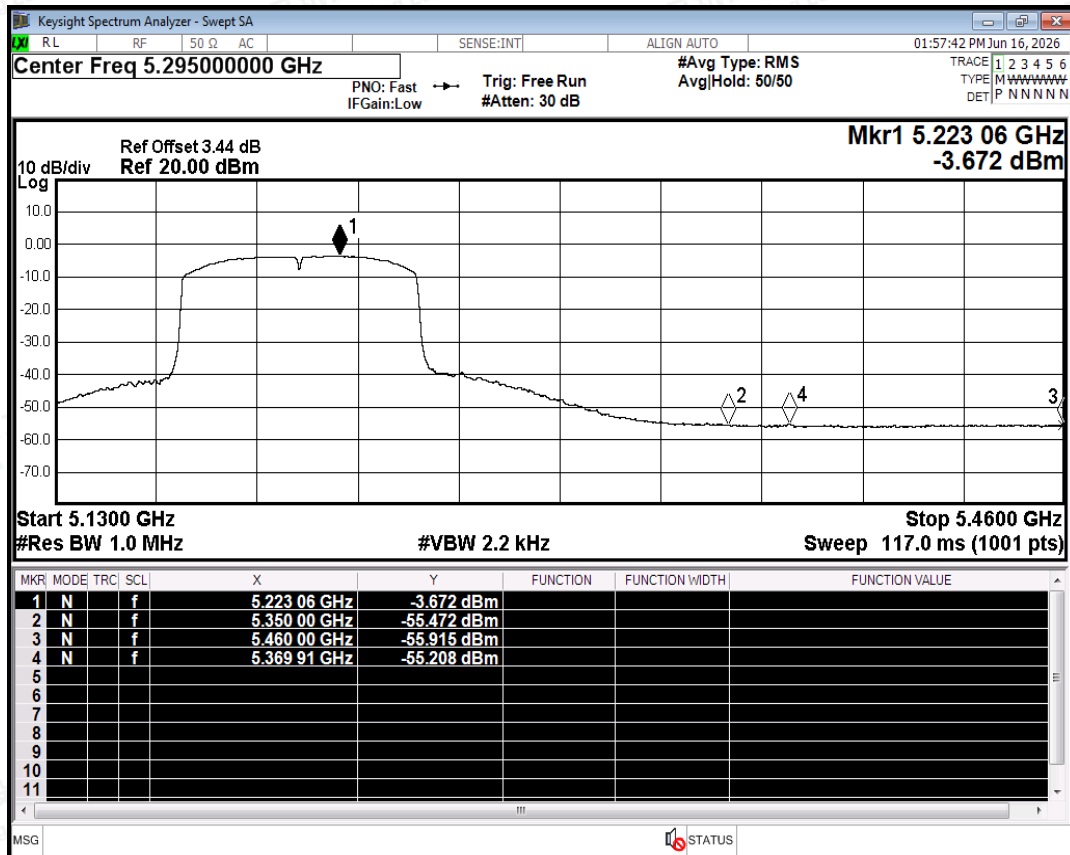

Restrict Band NVNT ac80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

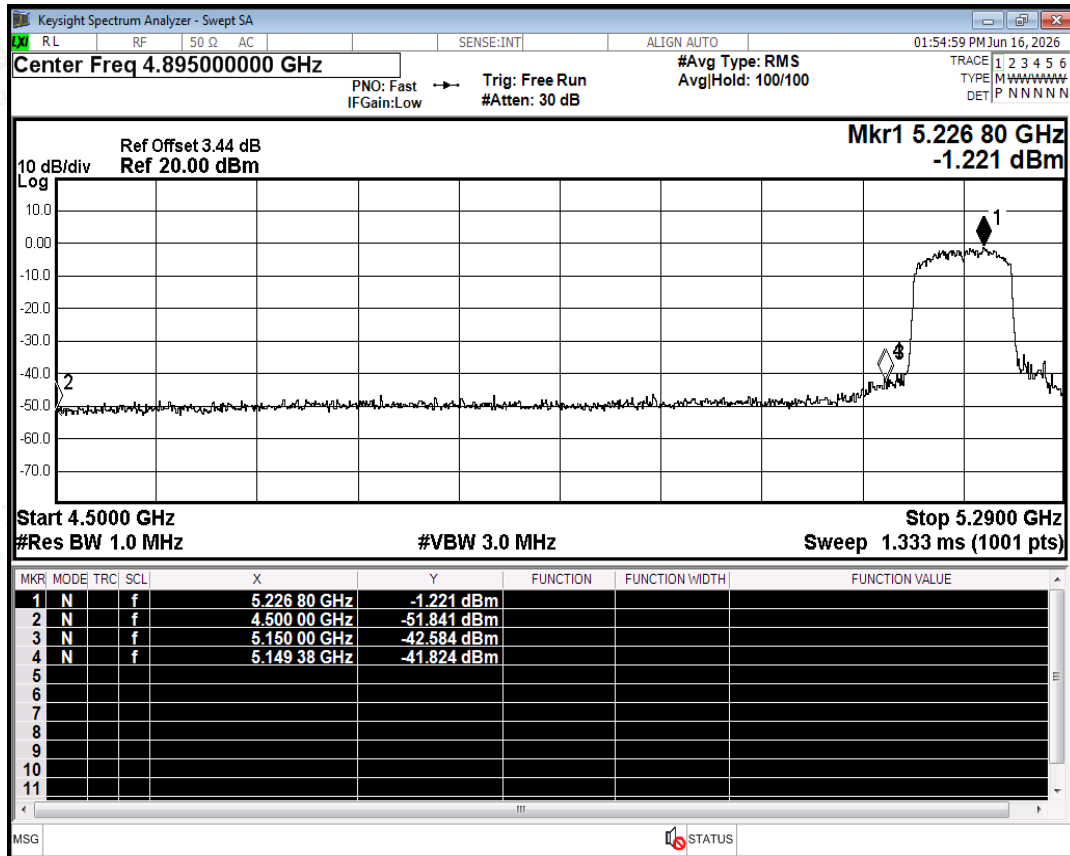

Restrict Band NVNT ac80 5210MHz Ant1 Peak

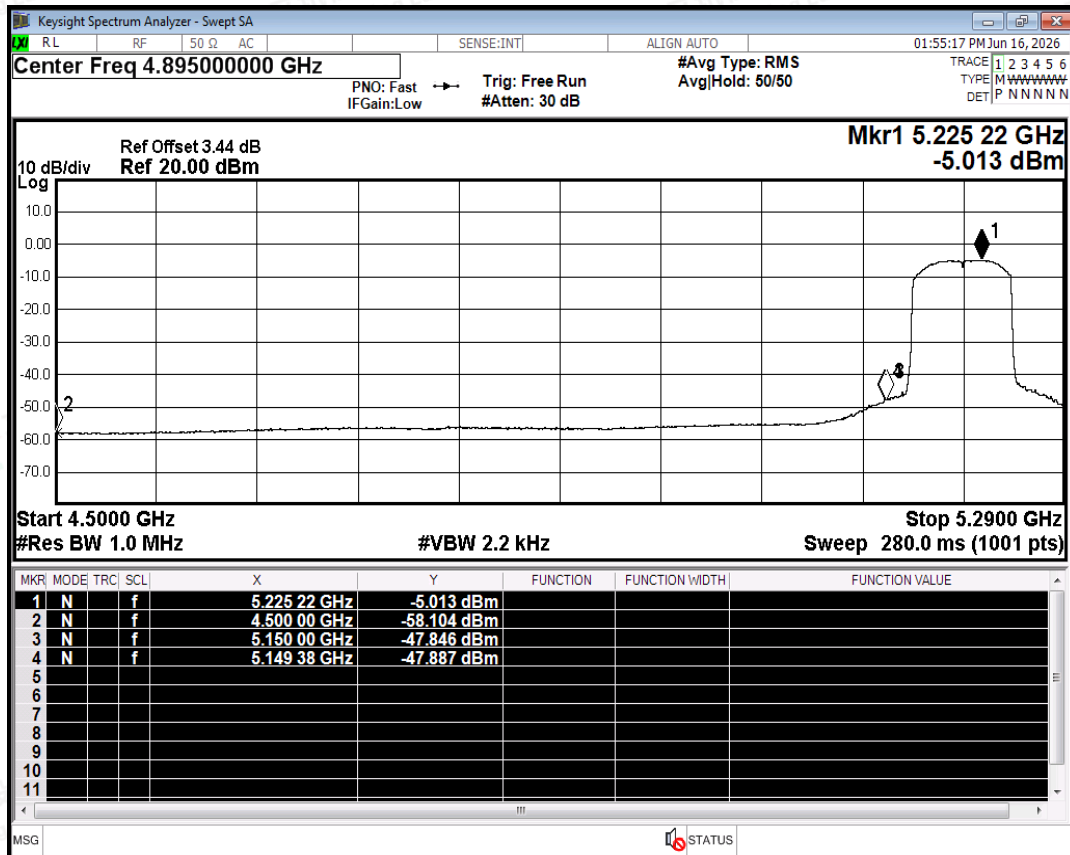

Restrict Band NVNT ac80 5210MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant0 Power (dBm)	Ant1 Power (dBm)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-49.99	-51.02	6.04	53.80	Peak	68.2	Pass
NVNT	n20	5180	-58.39	-58.57	6.04	45.80	Average	54	Pass
NVNT	n20	5180	-37.98	-44.77	6.04	64.11	Peak	68.2	Pass
NVNT	n20	5180	-54.46	-51.31	6.04	51.67	Average	54	Pass
NVNT	n20	5180	-40.01	-46.42	6.04	62.15	Peak	68.2	Pass
NVNT	n20	5180	-54.07	-50.74	6.04	52.18	Average	54	Pass
NVNT	n20	5240	-49.07	-48.43	6.04	55.54	Peak	68.2	Pass
NVNT	n20	5240	-56.92	-55.11	6.04	48.36	Average	54	Pass
NVNT	n20	5240	-46.76	-46.73	6.04	57.53	Peak	68.2	Pass
NVNT	n20	5240	-56.18	-54.95	6.04	48.76	Average	54	Pass
NVNT	n20	5240	-50.72	-48.39	6.04	54.88	Peak	68.2	Pass
NVNT	n20	5240	-56.80	-56.67	6.04	47.54	Average	54	Pass
NVNT	n40	5190	-50.82	-62.02	6.04	50.77	Peak	68.2	Pass
NVNT	n40	5190	-58.48	-68.46	6.04	43.20	Average	54	Pass
NVNT	n40	5190	-41.34	-52.16	6.04	60.27	Peak	68.2	Pass
NVNT	n40	5190	-56.34	-48.99	6.04	53.01	Average	54	Pass
NVNT	n40	5190	-41.82	-42.76	6.04	62.01	Peak	68.2	Pass
NVNT	n40	5190	-55.73	-48.66	6.04	53.39	Average	54	Pass
NVNT	n40	5230	-49.90	-49.09	6.04	54.80	Peak	68.2	Pass
NVNT	n40	5230	-56.69	-55.83	6.04	48.04	Average	54	Pass
NVNT	n40	5230	-46.86	-45.76	6.04	58.00	Peak	68.2	Pass
NVNT	n40	5230	-55.95	-55.58	6.04	48.52	Average	54	Pass
NVNT	n40	5230	-49.62	-48.43	6.04	55.29	Peak	68.2	Pass
NVNT	n40	5230	-56.51	-55.96	6.04	48.05	Average	54	Pass
NVNT	ac20	5180	-52.62	-52.14	6.04	51.90	Peak	68.2	Pass
NVNT	ac20	5180	-58.49	-58.71	6.04	45.68	Average	54	Pass
NVNT	ac20	5180	-38.29	-40.25	6.04	65.12	Peak	68.2	Pass
NVNT	ac20	5180	-54.51	-58.11	6.04	48.33	Average	54	Pass
NVNT	ac20	5180	-38.12	-40.55	6.04	65.11	Peak	68.2	Pass
NVNT	ac20	5180	-54.00	-57.63	6.04	48.83	Average	54	Pass
NVNT	ac20	5240	-49.99	-49.54	6.04	54.52	Peak	68.2	Pass
NVNT	ac20	5240	-56.89	-54.97	6.04	48.45	Average	54	Pass
NVNT	ac20	5240	-46.46	-46.68	6.04	57.71	Peak	68.2	Pass
NVNT	ac20	5240	-56.30	-54.85	6.04	48.76	Average	54	Pass
NVNT	ac20	5240	-48.67	-49.84	6.04	55.06	Peak	68.2	Pass
NVNT	ac20	5240	-56.86	-56.88	6.04	47.41	Average	54	Pass
NVNT	ac40	5190	-52.09	-51.42	6.04	52.54	Peak	68.2	Pass
NVNT	ac40	5190	-58.39	-58.65	6.04	45.76	Average	54	Pass
NVNT	ac40	5190	-37.03	-42.27	6.04	65.37	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-55.45	-58.91	6.04	47.43	Average	54	Pass
NVNT	ac40	5190	-36.88	-42.03	6.04	65.55	Peak	68.2	Pass
NVNT	ac40	5190	-55.08	-58.61	6.04	47.78	Average	54	Pass
NVNT	ac40	5230	-49.43	-47.46	6.04	55.94	Peak	68.2	Pass
NVNT	ac40	5230	-56.77	-55.54	6.04	48.17	Average	54	Pass
NVNT	ac40	5230	-47.23	-46.10	6.04	57.65	Peak	68.2	Pass
NVNT	ac40	5230	-55.99	-55.12	6.04	48.74	Average	54	Pass
NVNT	ac40	5230	-49.59	-48.83	6.04	55.08	Peak	68.2	Pass
NVNT	ac40	5230	-56.52	-55.97	6.04	48.04	Average	54	Pass
NVNT	ac80	5210	-48.85	-50.73	6.04	54.59	Peak	68.2	Pass
NVNT	ac80	5210	-56.01	-55.59	6.04	48.48	Average	54	Pass
NVNT	ac80	5210	-45.78	-46.94	6.04	57.96	Peak	68.2	Pass
NVNT	ac80	5210	-55.71	-55.28	6.04	48.79	Average	54	Pass
NVNT	ac80	5210	-49.25	-48.80	6.04	55.26	Peak	68.2	Pass
NVNT	ac80	5210	-56.41	-55.94	6.04	48.11	Average	54	Pass
NVNT	ac80	5210	-51.76	-52.05	6.04	52.38	Peak	68.2	Pass
NVNT	ac80	5210	-58.16	-58.18	6.04	46.11	Average	54	Pass
NVNT	ac80	5210	-37.63	-41.86	6.04	65.03	Peak	68.2	Pass
NVNT	ac80	5210	-54.59	-58.03	6.04	48.30	Average	54	Pass
NVNT	ac80	5210	-38.31	-42.68	6.04	64.31	Peak	68.2	Pass
NVNT	ac80	5210	-53.57	-57.88	6.04	49.07	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant0	5180.04	40000	7.72	25	Pass
NVNT	a	5200	Ant0	5200.02	20000	3.85	25	Pass
NVNT	a	5240	Ant0	5240.02	20000	3.82	25	Pass
NVNT	n20	5180	Ant0	5180.04	40000	7.72	25	Pass
NVNT	n20	5200	Ant0	5200.04	40000	7.69	25	Pass
NVNT	n20	5240	Ant0	5240.02	20000	3.82	25	Pass
NVNT	n40	5190	Ant0	5190.08	80000	15.41	25	Pass
NVNT	n40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac20	5180	Ant0	5180.04	40000	7.72	25	Pass
NVNT	ac20	5200	Ant0	5200.02	20000	3.85	25	Pass
NVNT	ac20	5240	Ant0	5240.06	60000	11.45	25	Pass
NVNT	ac40	5190	Ant0	5190.04	40000	7.71	25	Pass
NVNT	ac40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac80	5210	Ant0	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

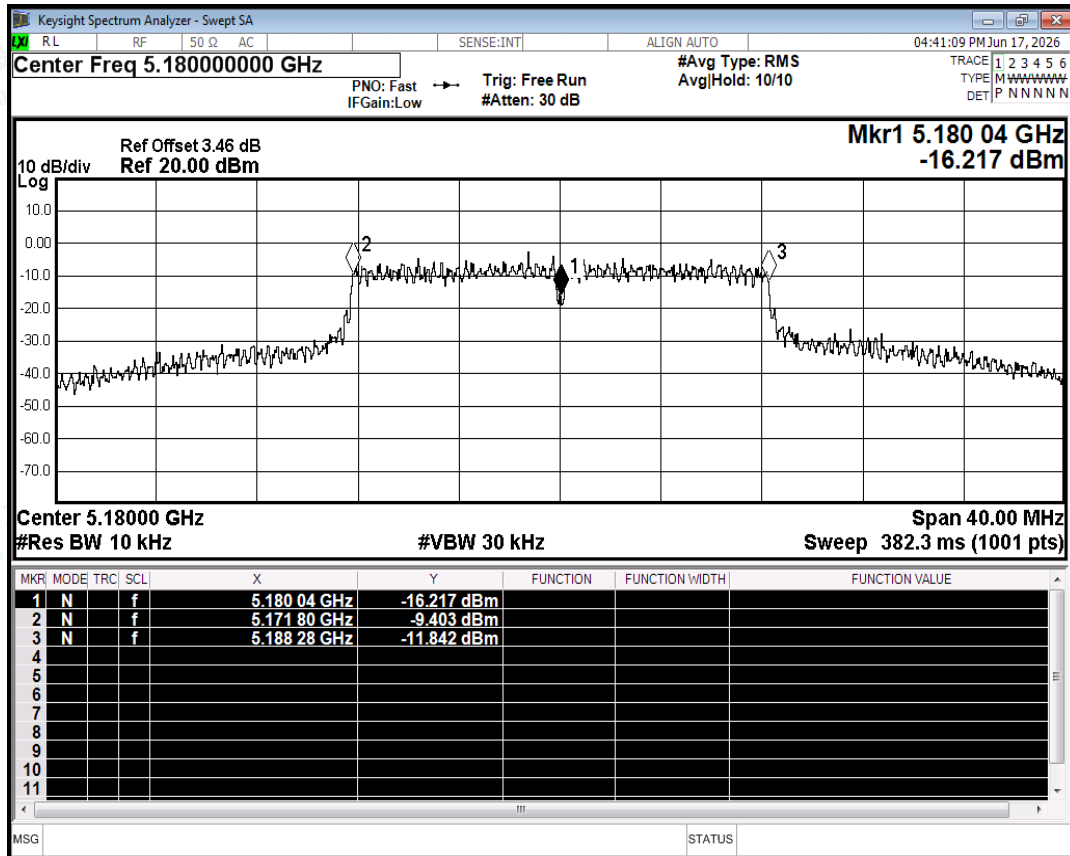

Freq. Stability NVNT a 5180MHz Ant0

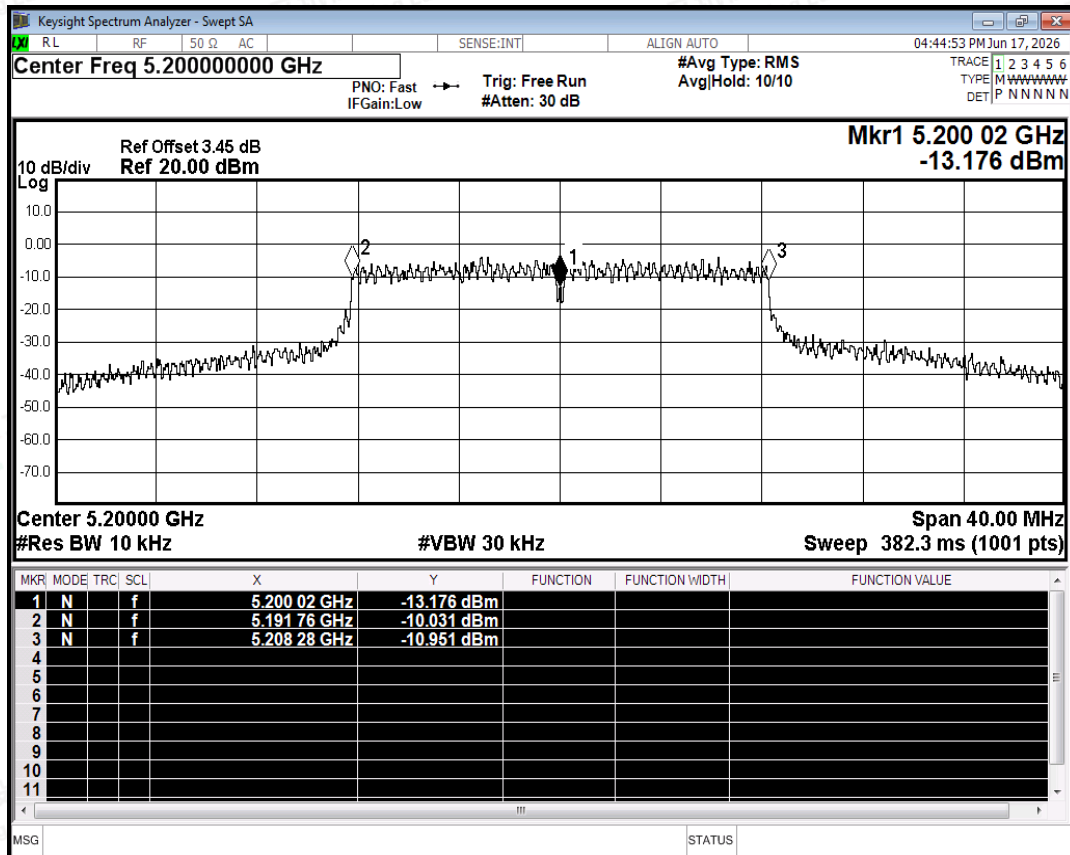

Freq. Stability NVNT a 5200MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

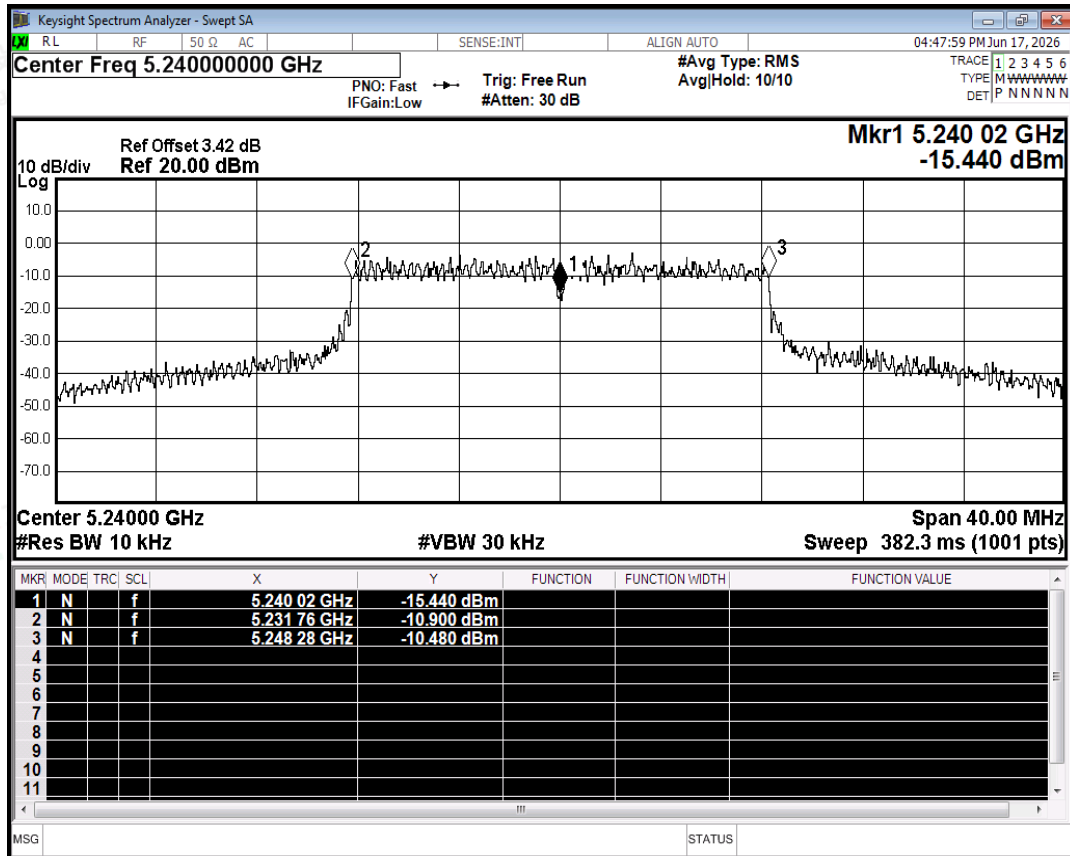

Freq. Stability NVNT a 5240MHz Ant0

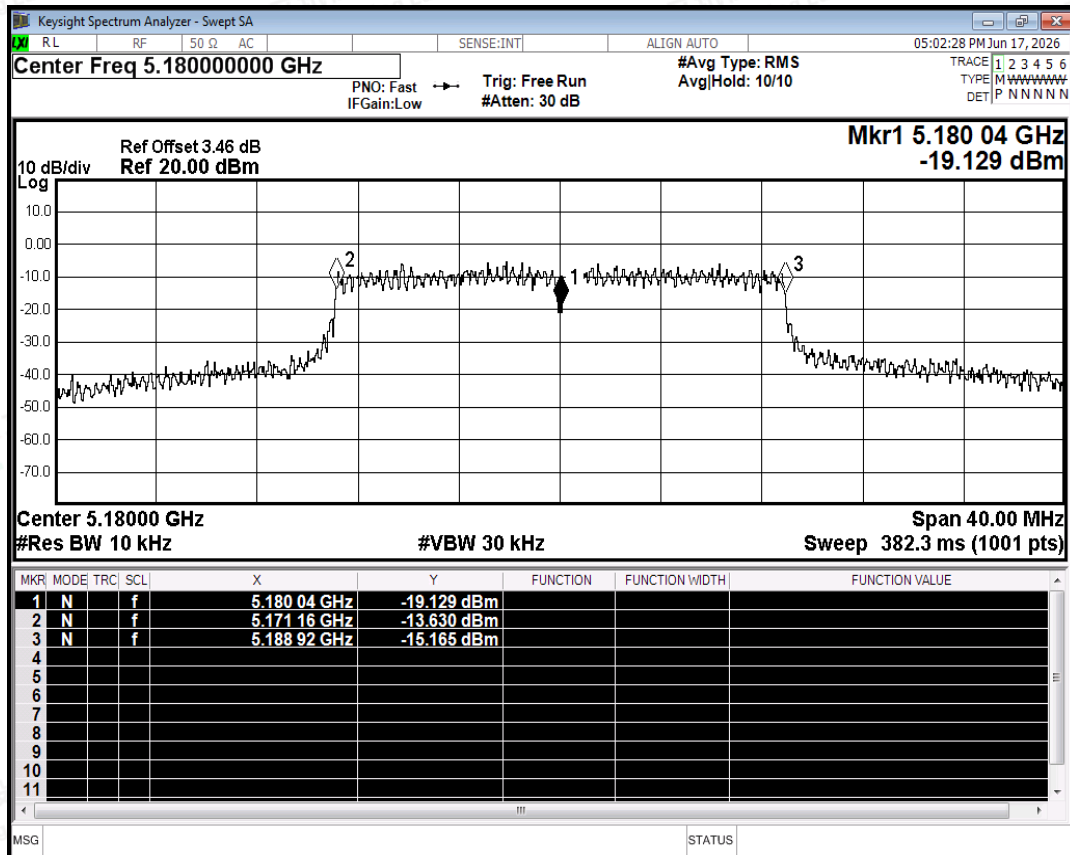

Freq. Stability NVNT n20 5180MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

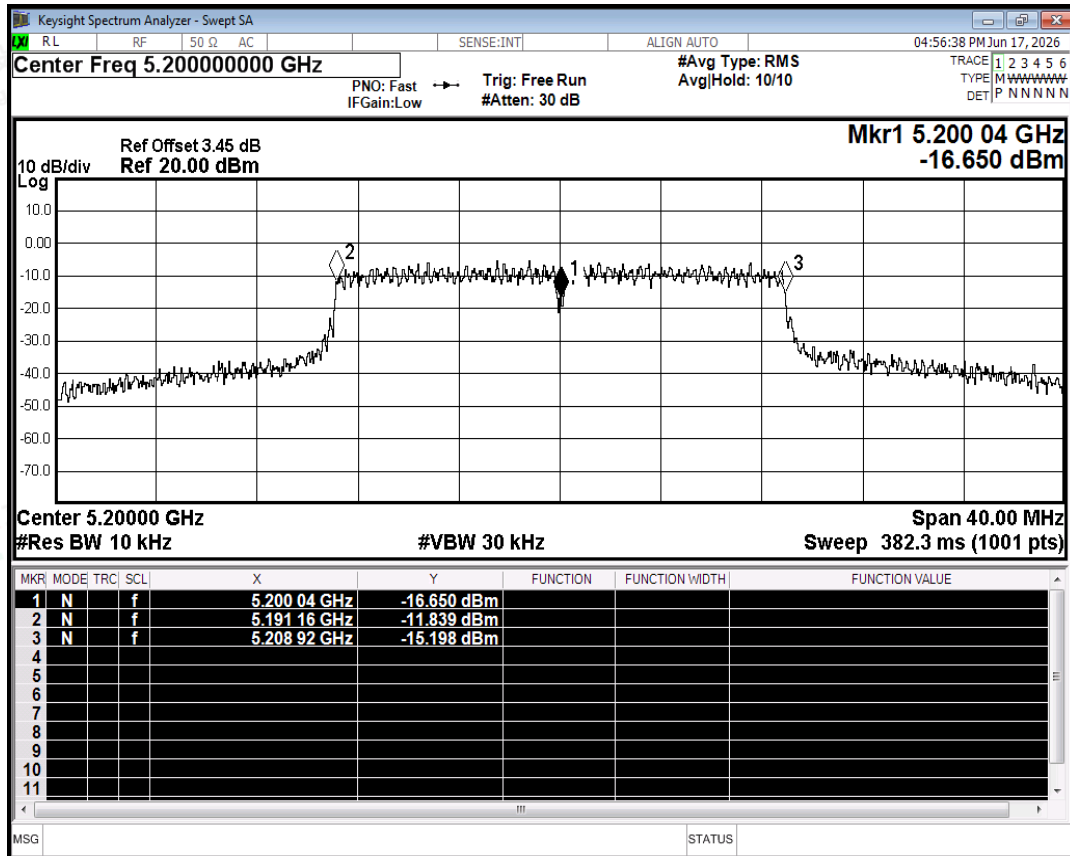

Freq. Stability NVNT n20 5200MHz Ant0

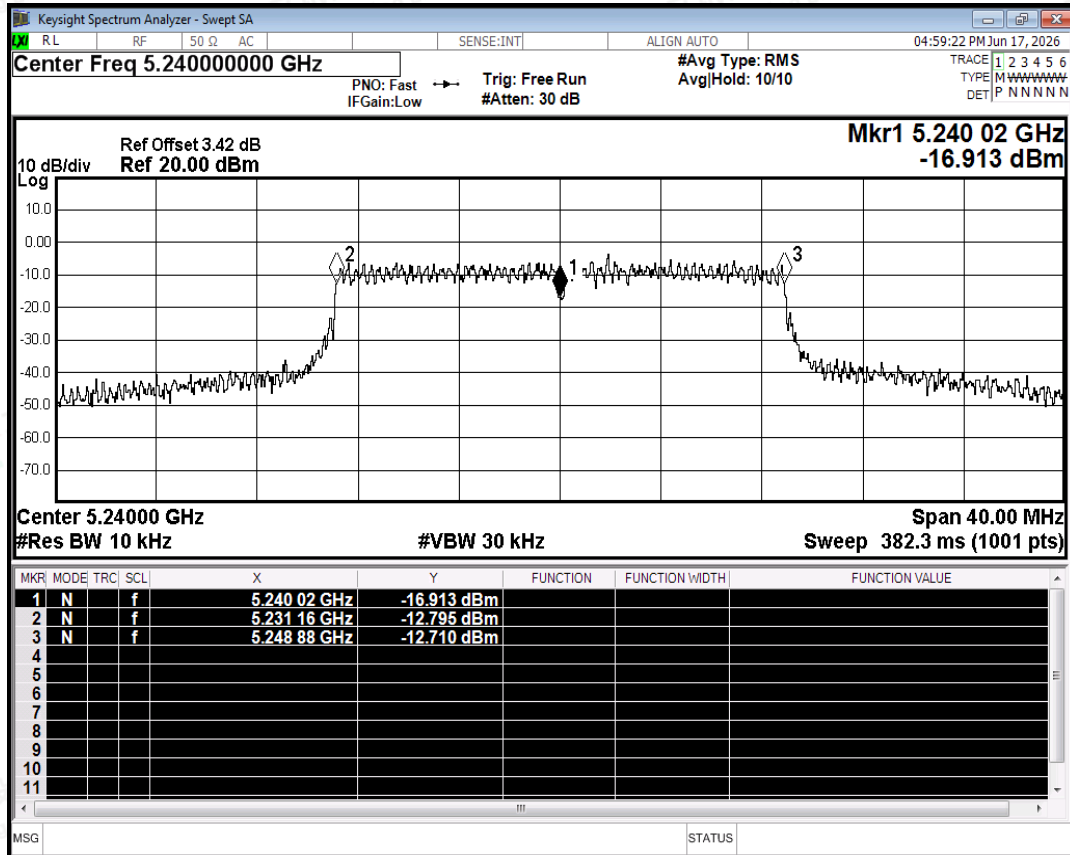

Freq. Stability NVNT n20 5240MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

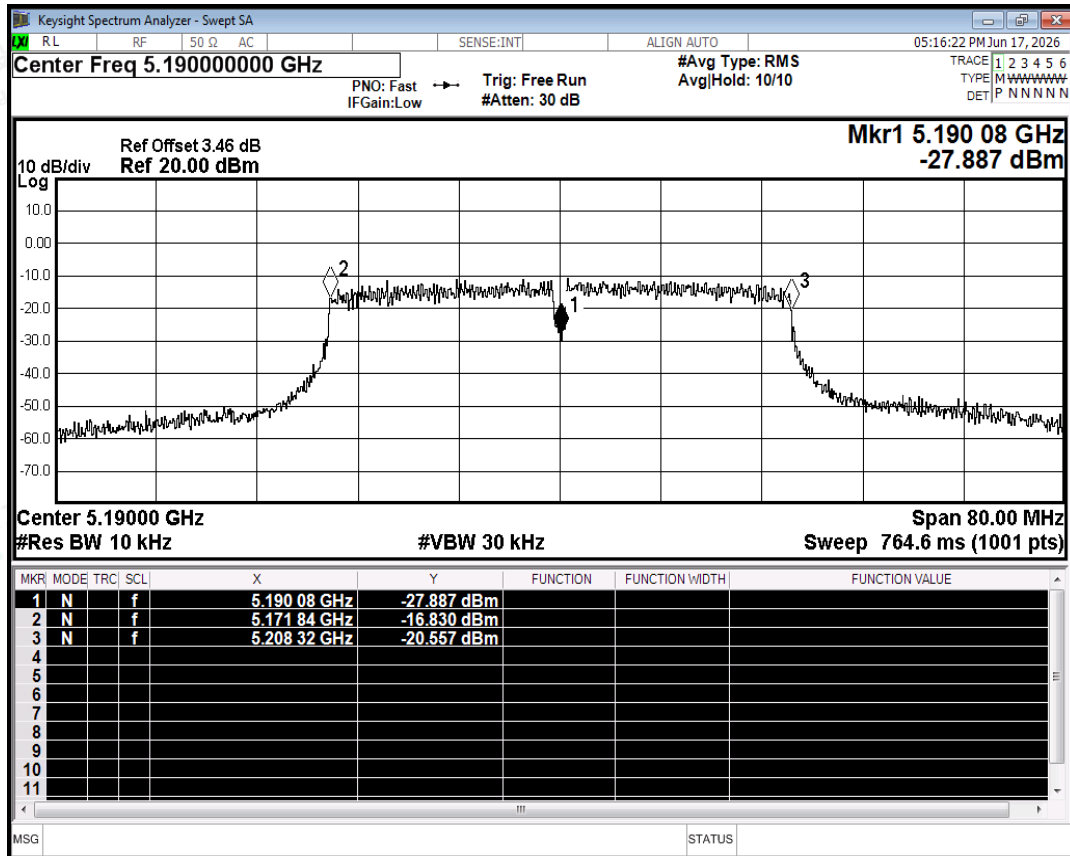

Freq. Stability NVNT n40 5190MHz Ant0

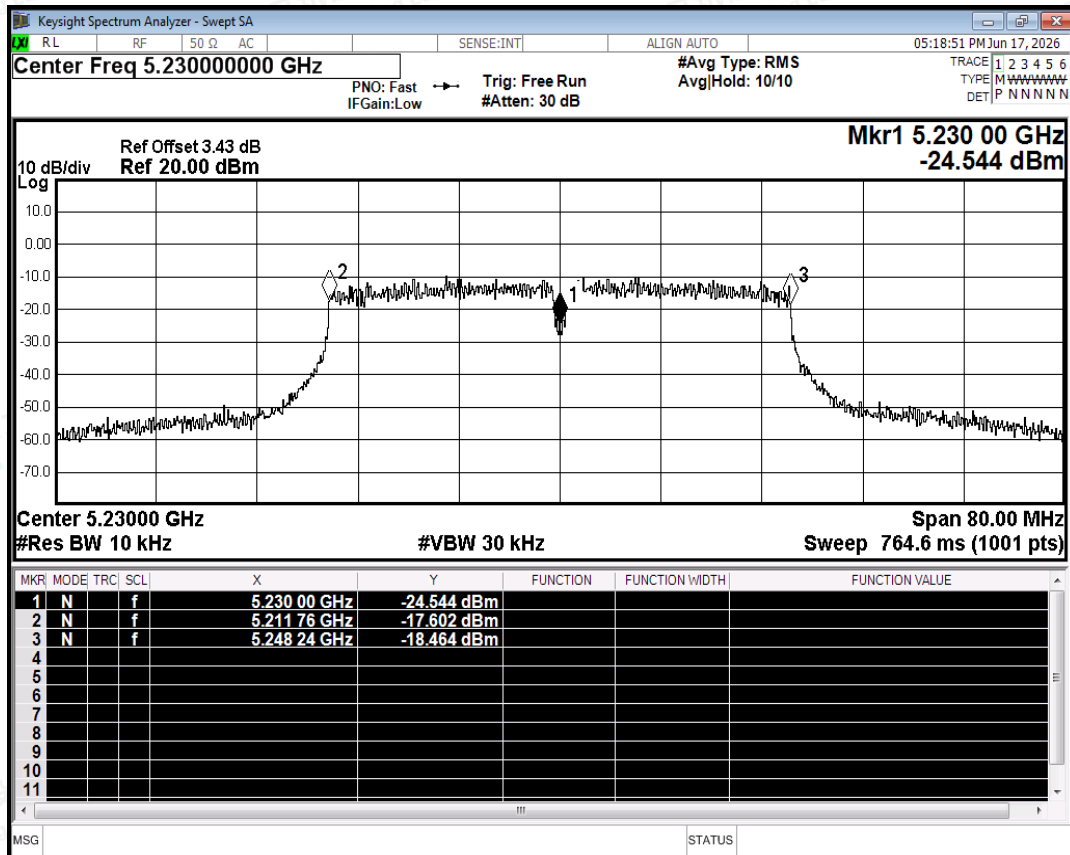

Freq. Stability NVNT n40 5230MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

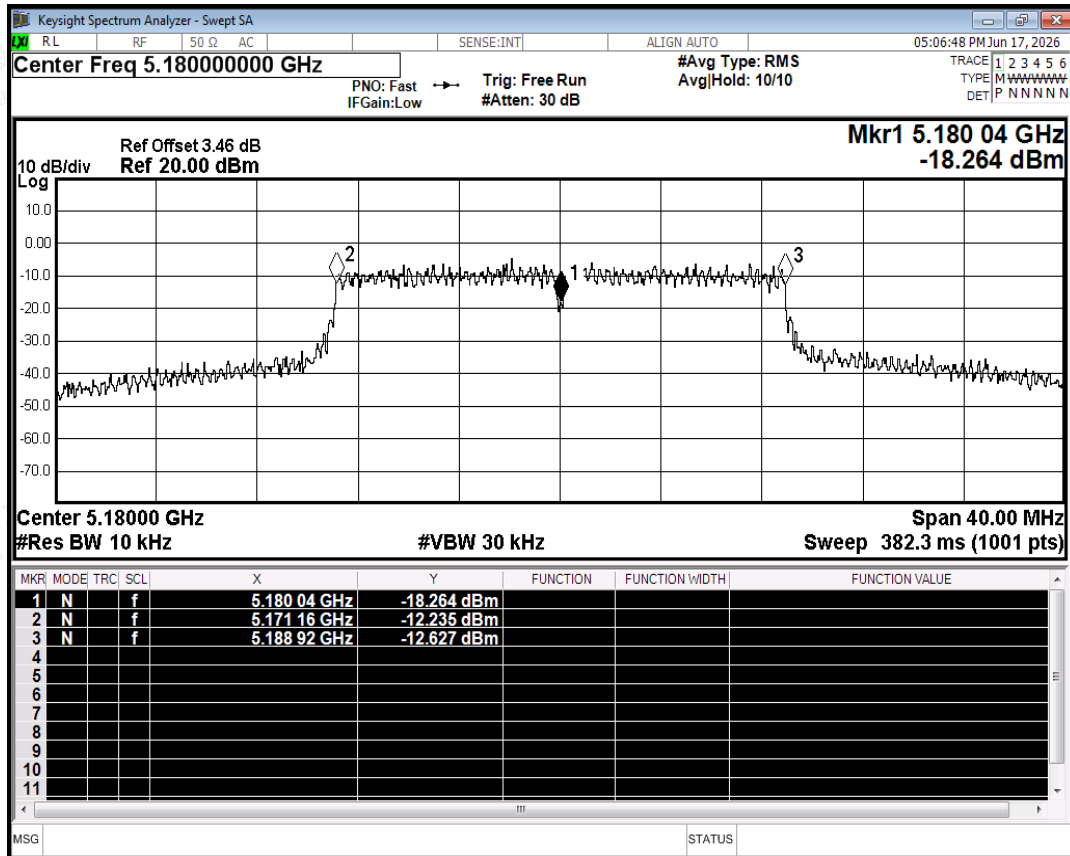

Freq. Stability NVNT ac20 5180MHz Ant0

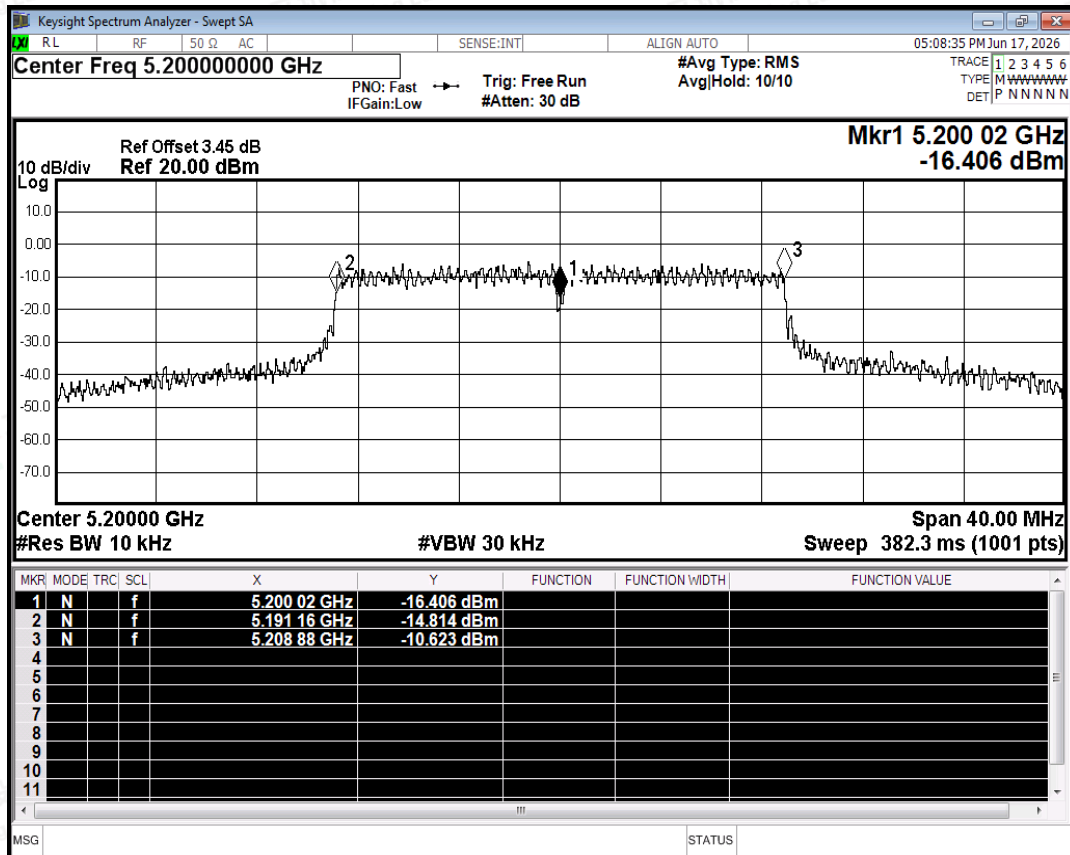

Freq. Stability NVNT ac20 5200MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

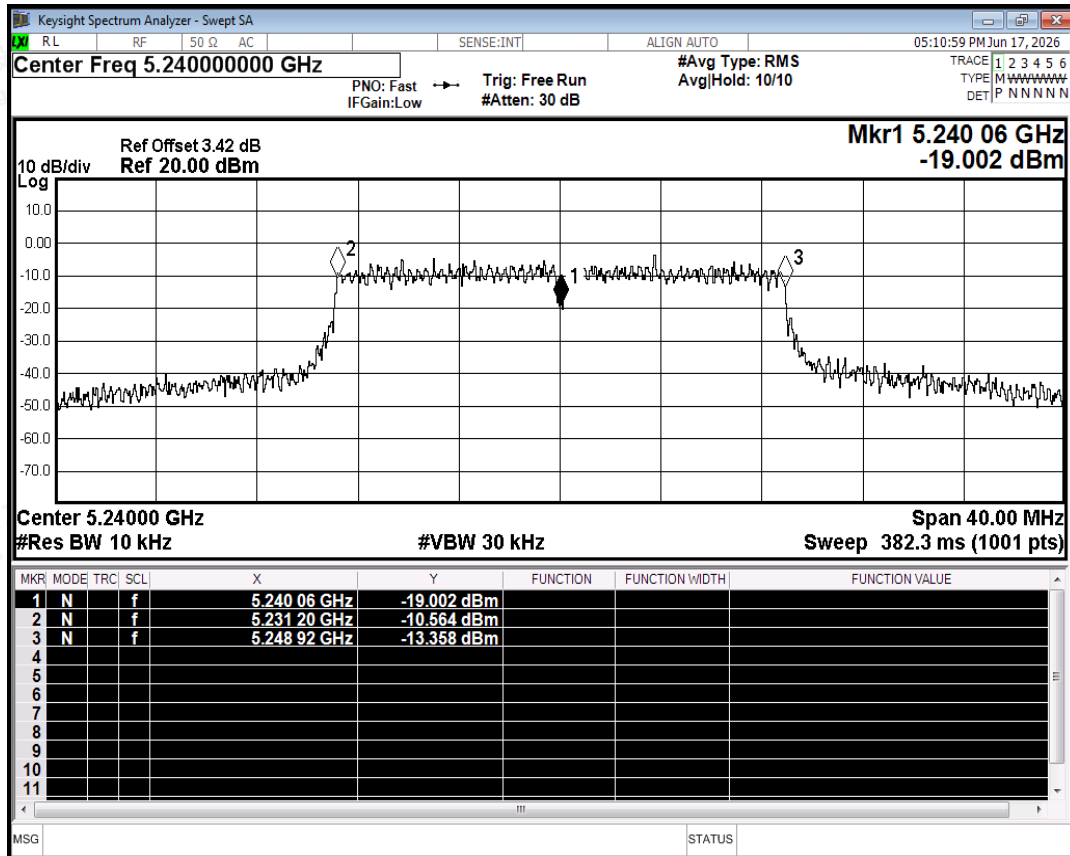

Freq. Stability NVNT ac20 5240MHz Ant0

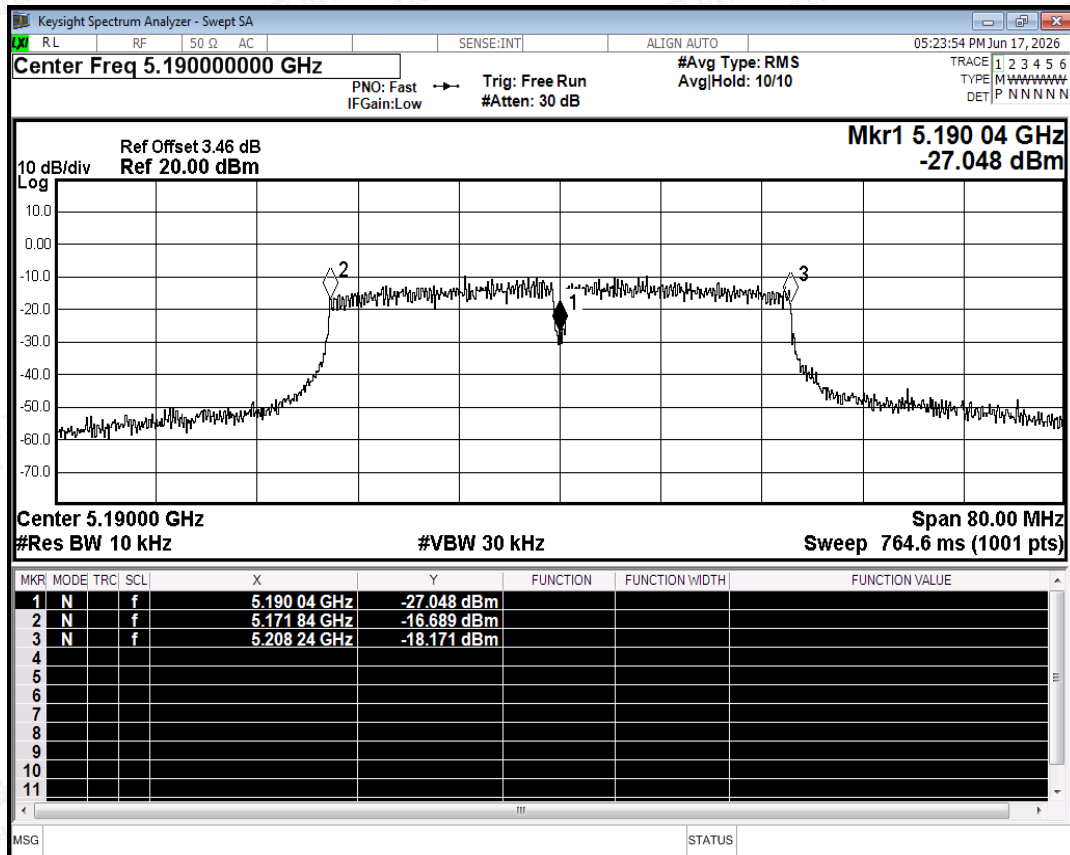

Freq. Stability NVNT ac40 5190MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

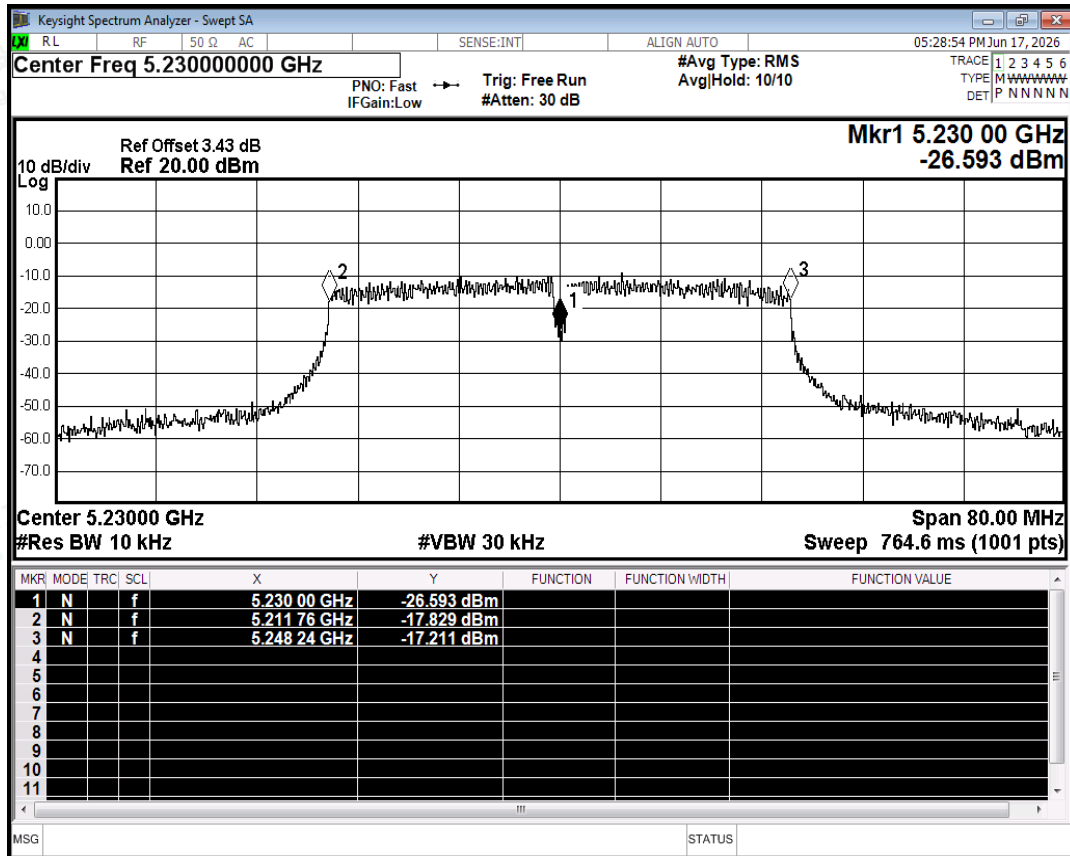

Freq. Stability NVNT ac40 5230MHz Ant0

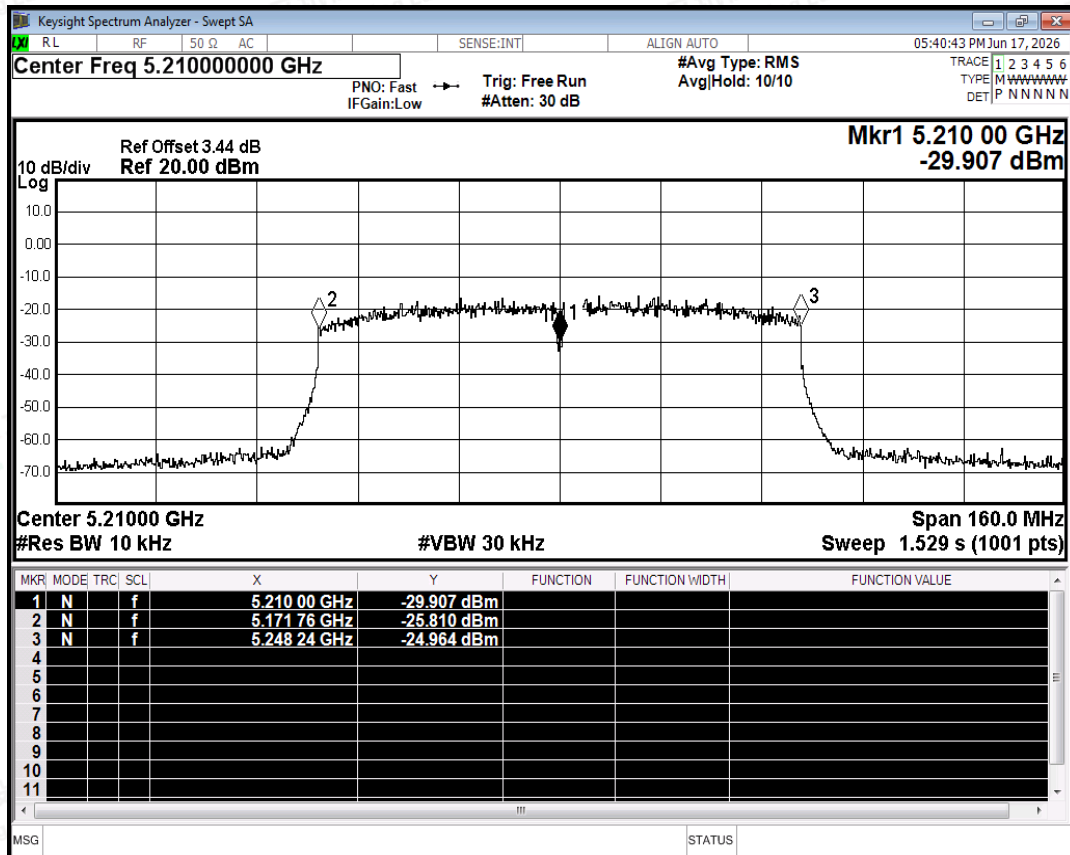

Freq. Stability NVNT ac80 5210MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5200.04	40000	7.69	25	Pass
NVNT	a	5240	Ant1	5240.04	40000	7.63	25	Pass
NVNT	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
NVNT	n20	5200	Ant1	5200.06	60000	11.54	25	Pass
NVNT	n20	5240	Ant1	5240.06	60000	11.45	25	Pass
NVNT	n40	5190	Ant1	5190.08	80000	15.41	25	Pass
NVNT	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
NVNT	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
NVNT	ac20	5200	Ant1	5200.06	60000	11.54	25	Pass
NVNT	ac20	5240	Ant1	5240.08	80000	15.27	25	Pass
NVNT	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
NVNT	ac40	5230	Ant1	5230.08	80000	15.3	25	Pass
NVNT	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass



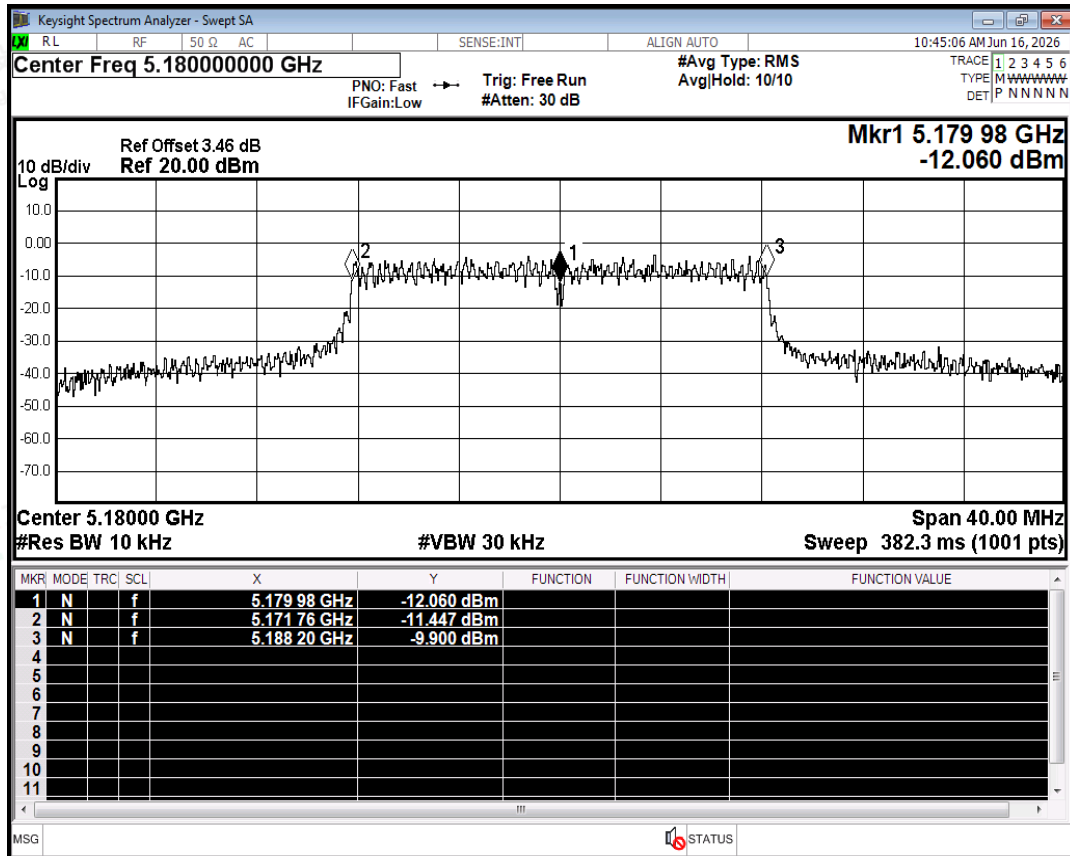

Freq. Stability NVNT a 5180MHz Ant1

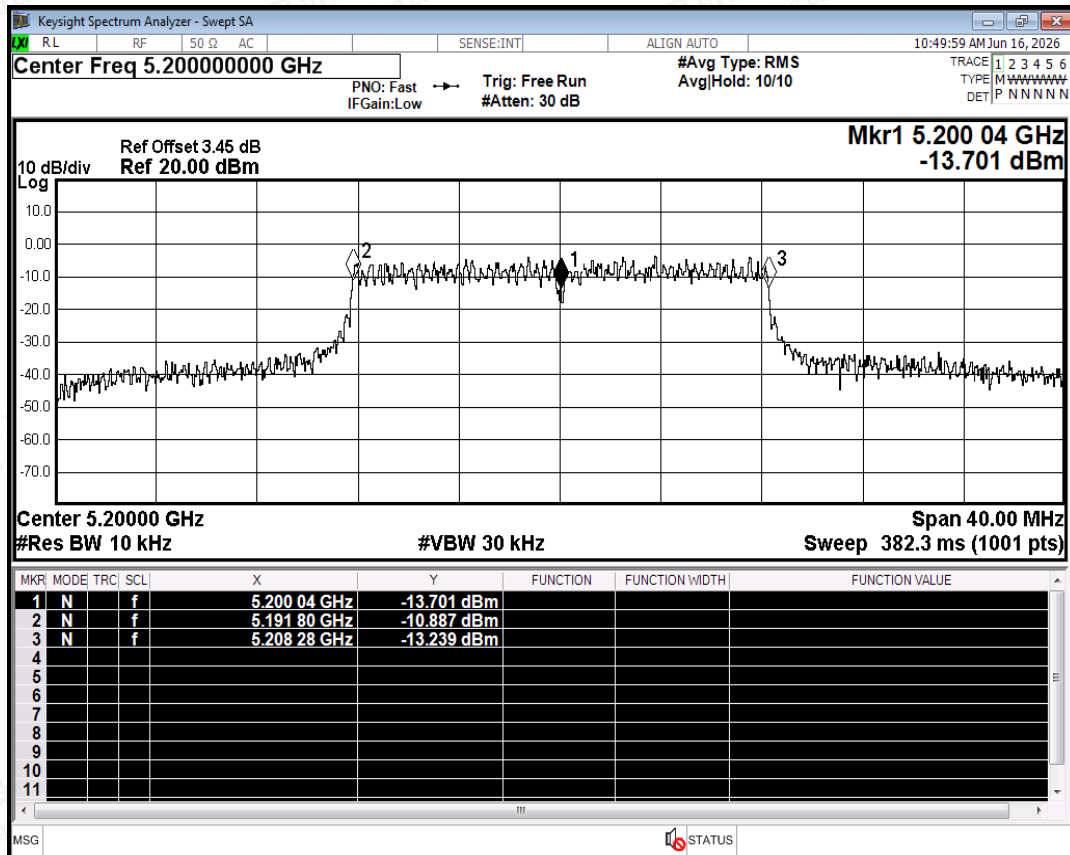

Freq. Stability NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

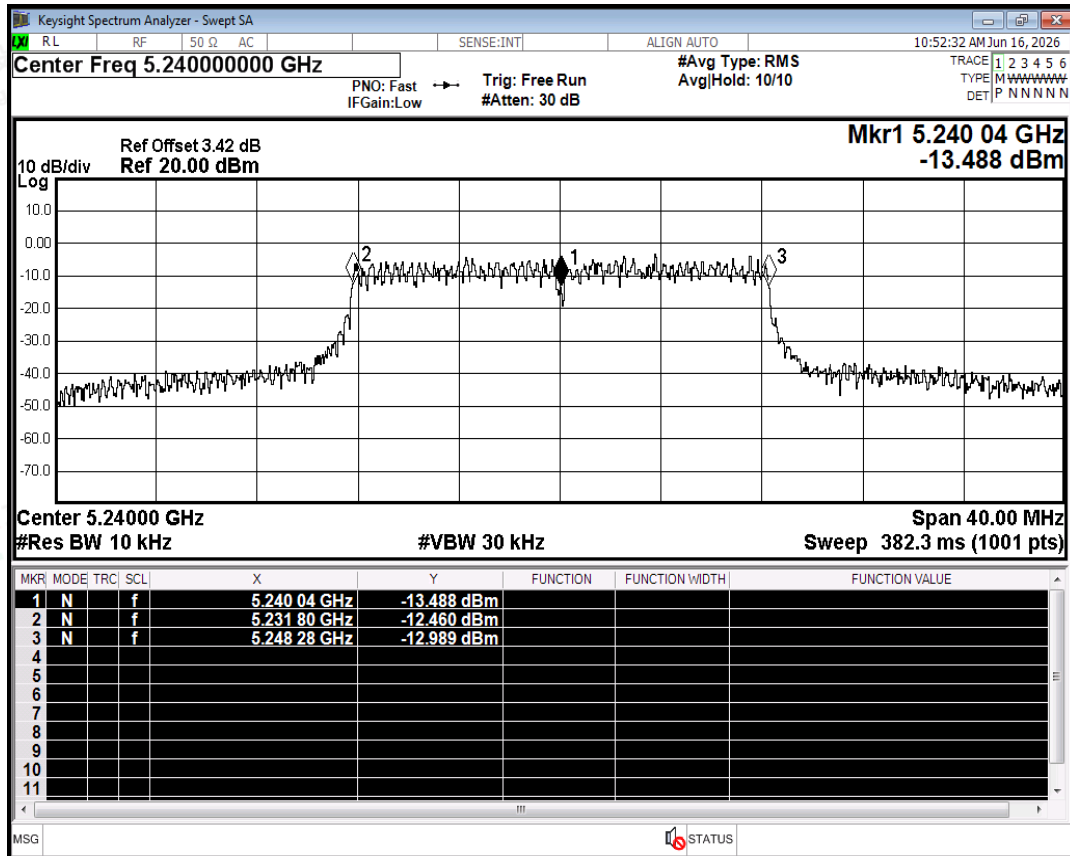

Freq. Stability NVNT a 5240MHz Ant1

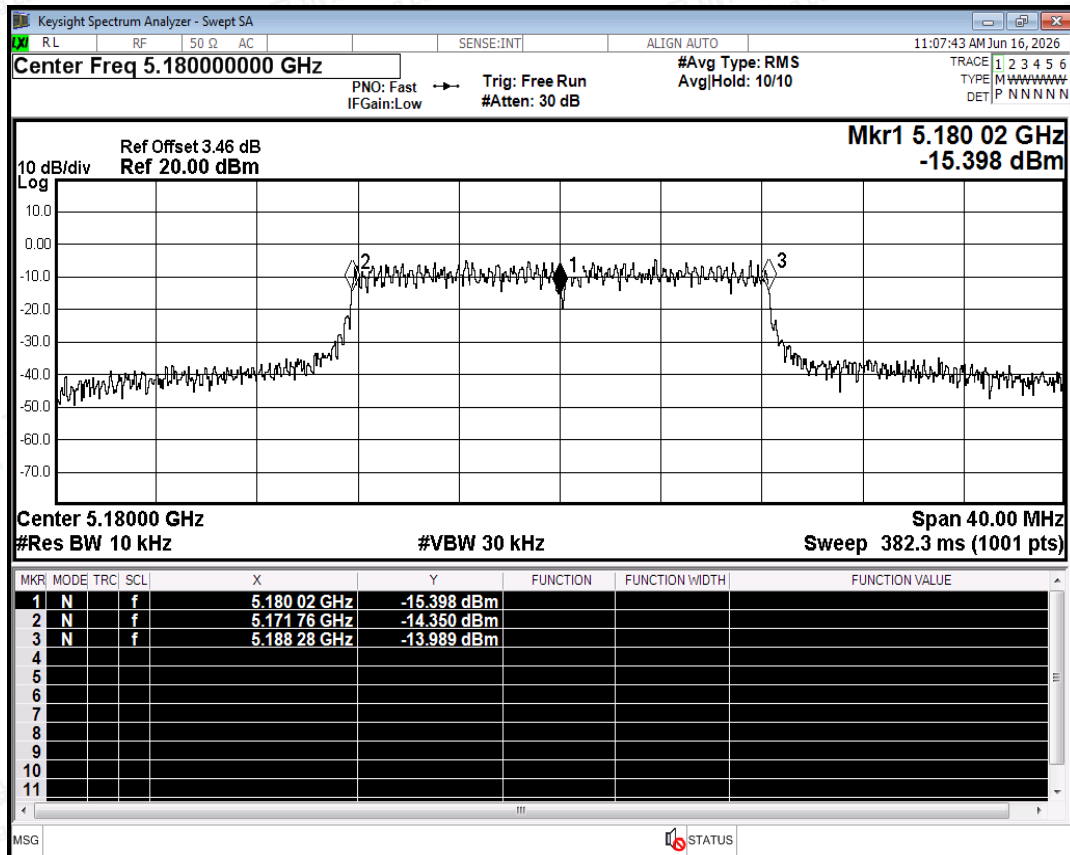

Freq. Stability NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

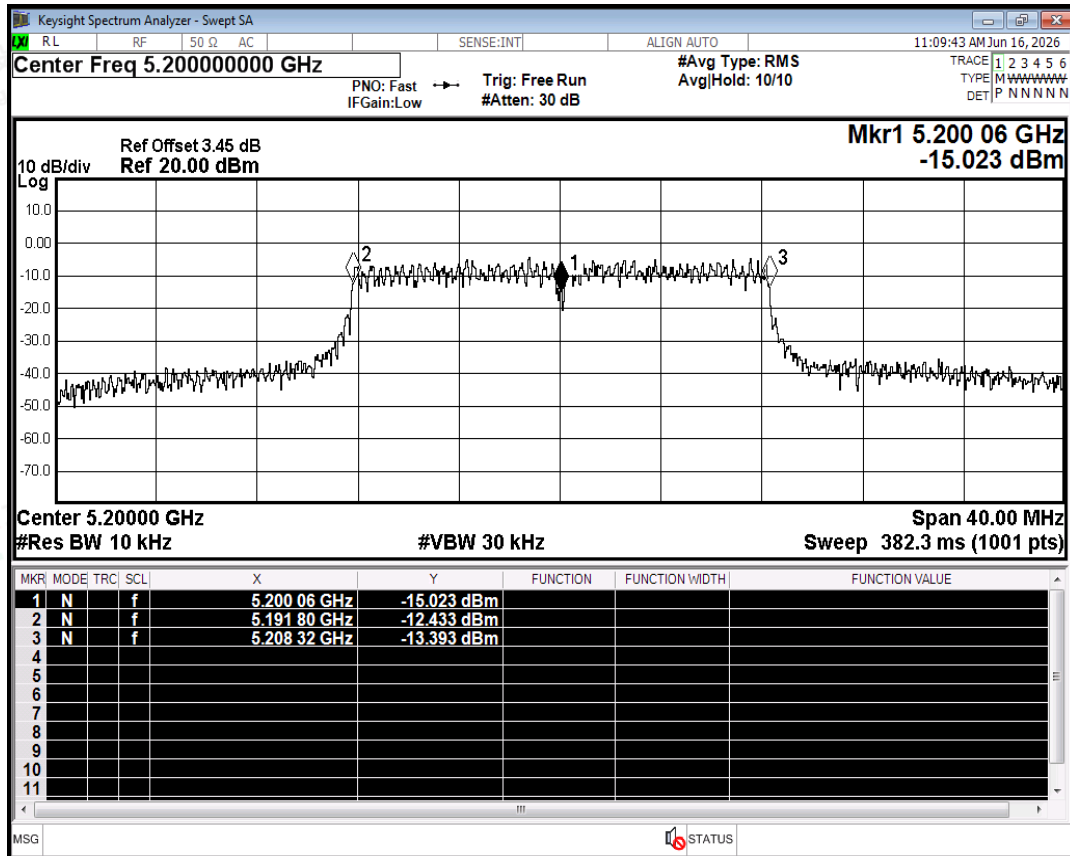

Freq. Stability NVNT n20 5200MHz Ant1

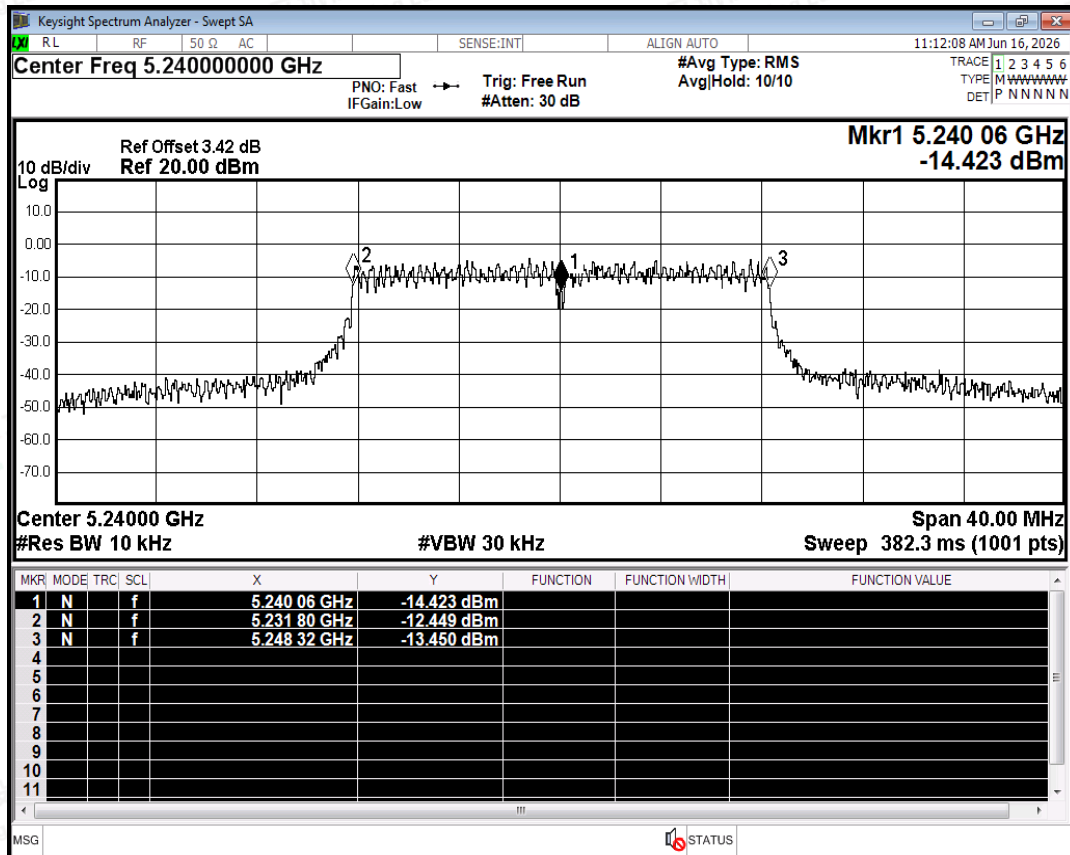

Freq. Stability NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

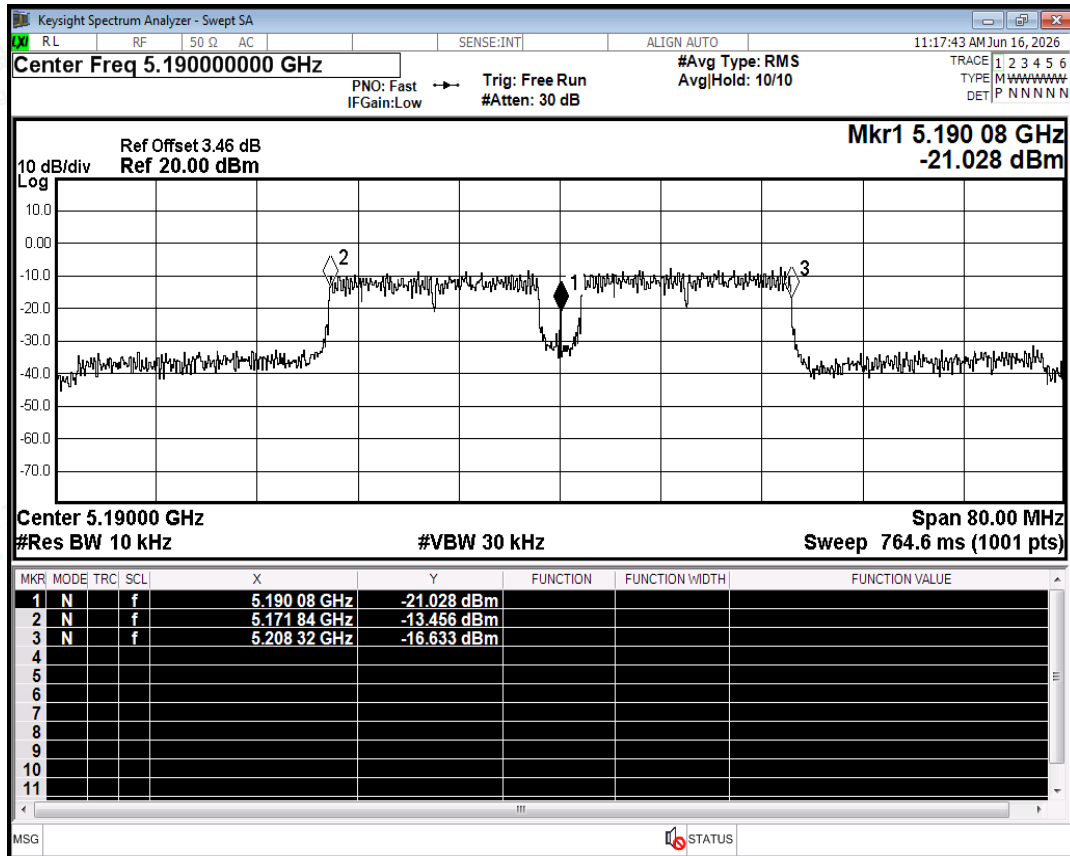

Freq. Stability NVNT n40 5190MHz Ant1

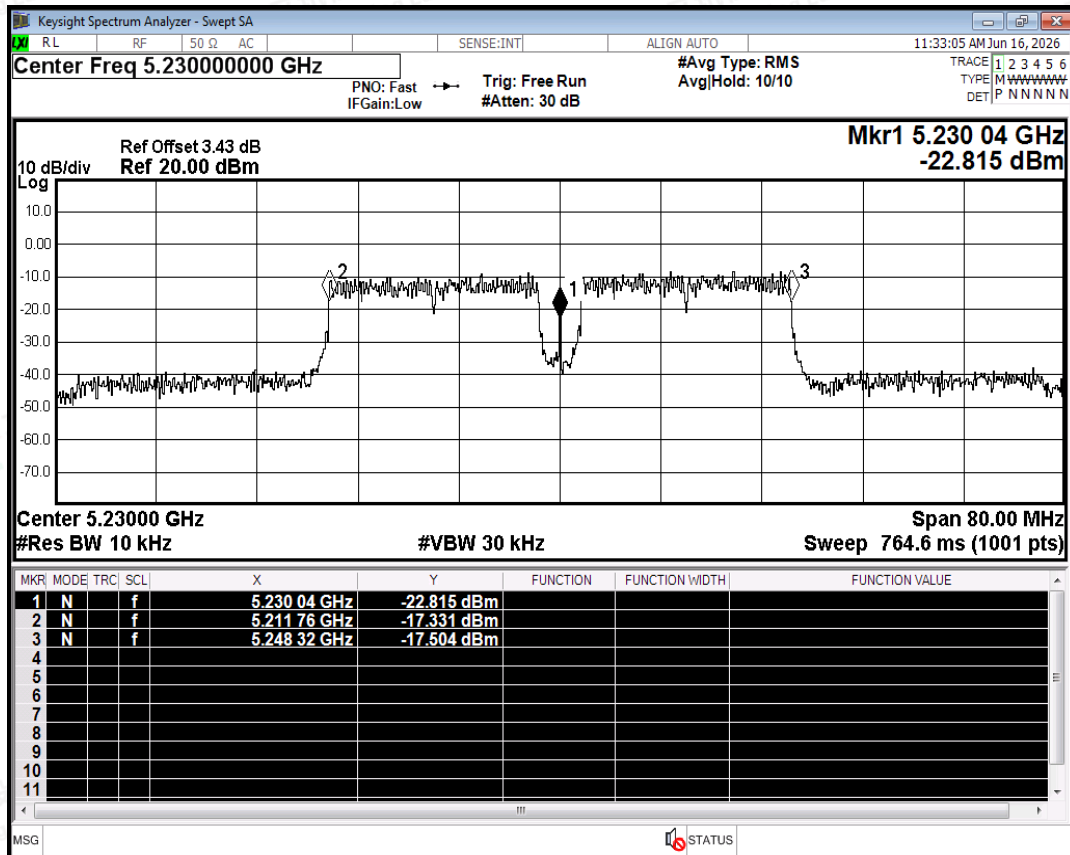

Freq. Stability NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

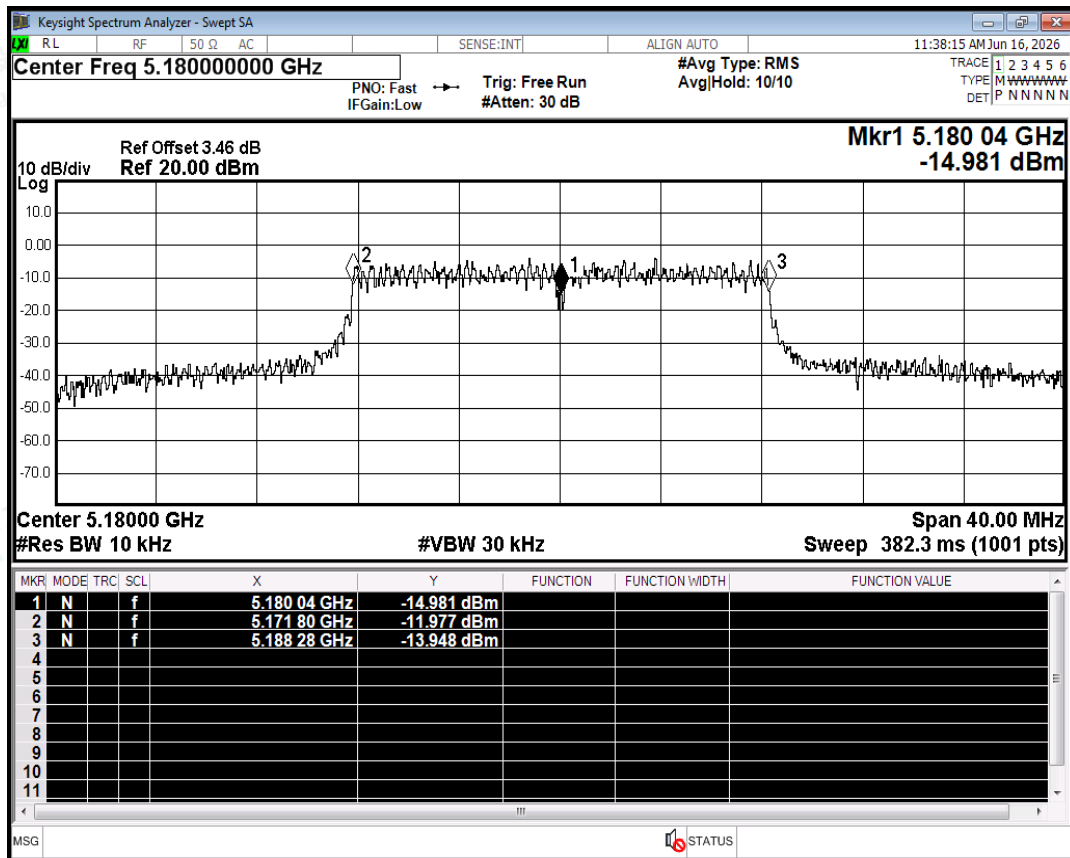

Freq. Stability NVNT ac20 5180MHz Ant1

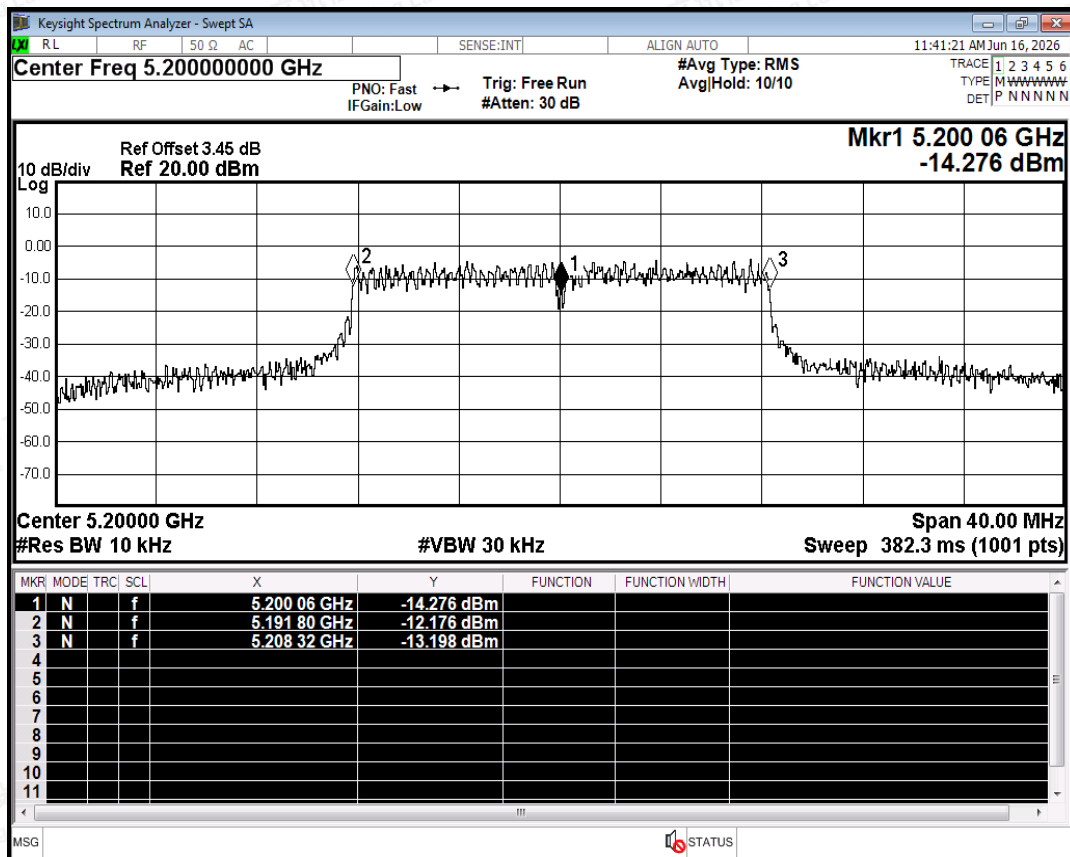

Freq. Stability NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

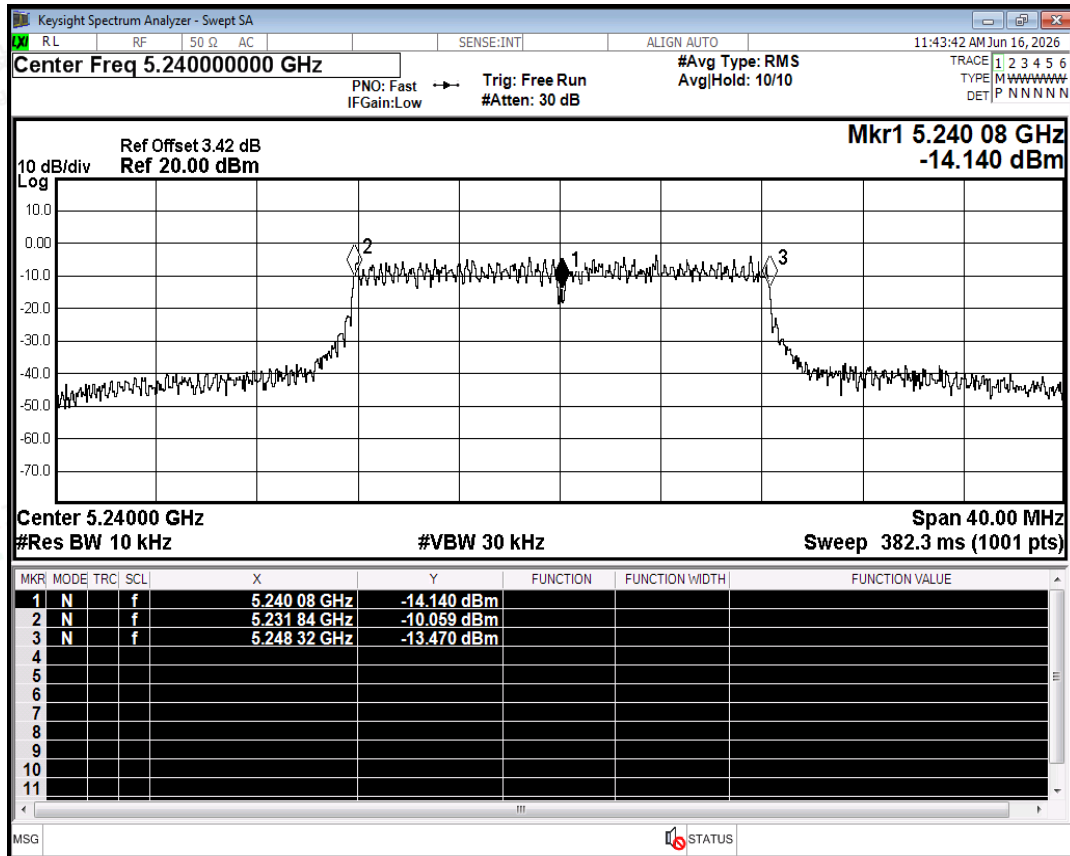

Freq. Stability NVNT ac20 5240MHz Ant1

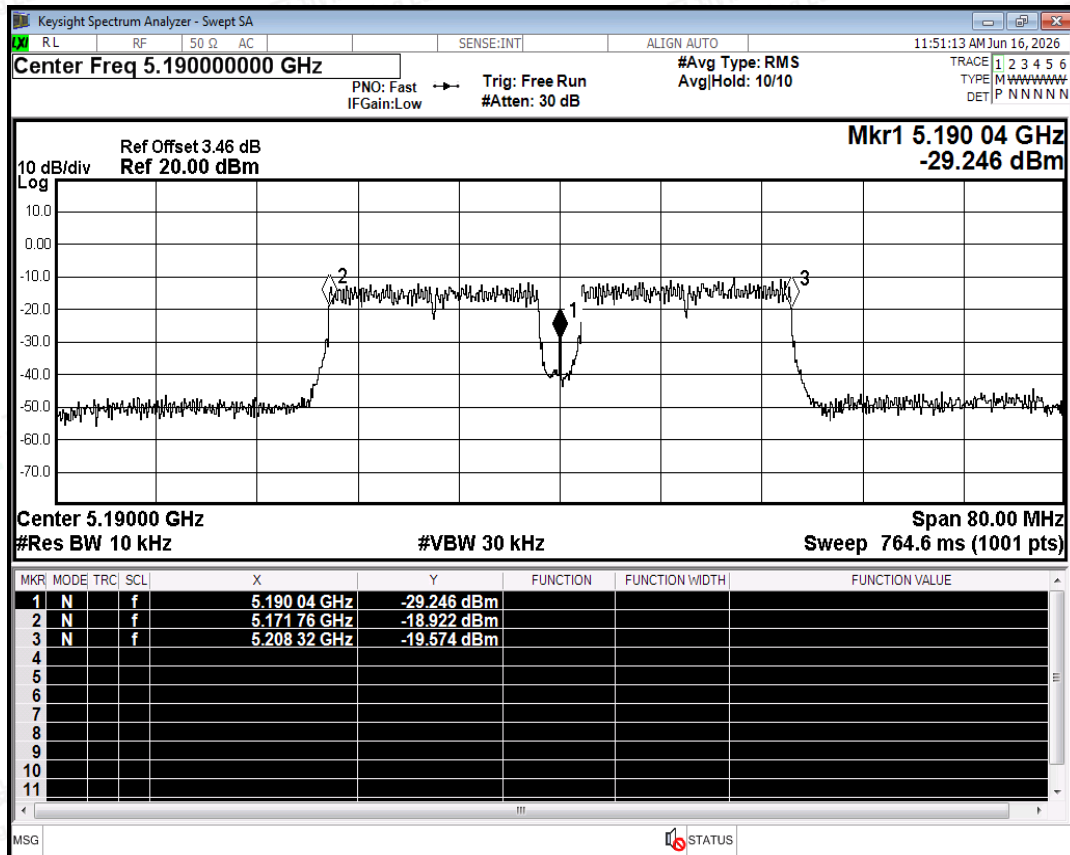

Freq. Stability NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

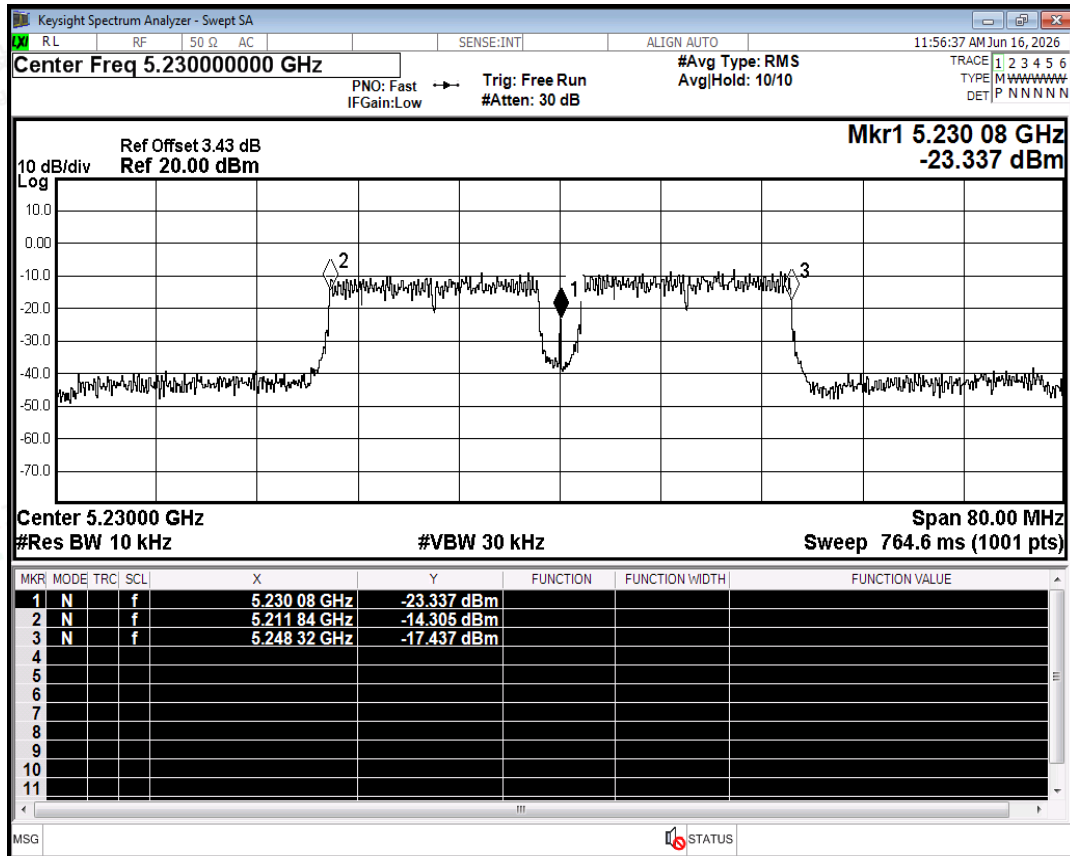

Freq. Stability NVNT ac40 5230MHz Ant1

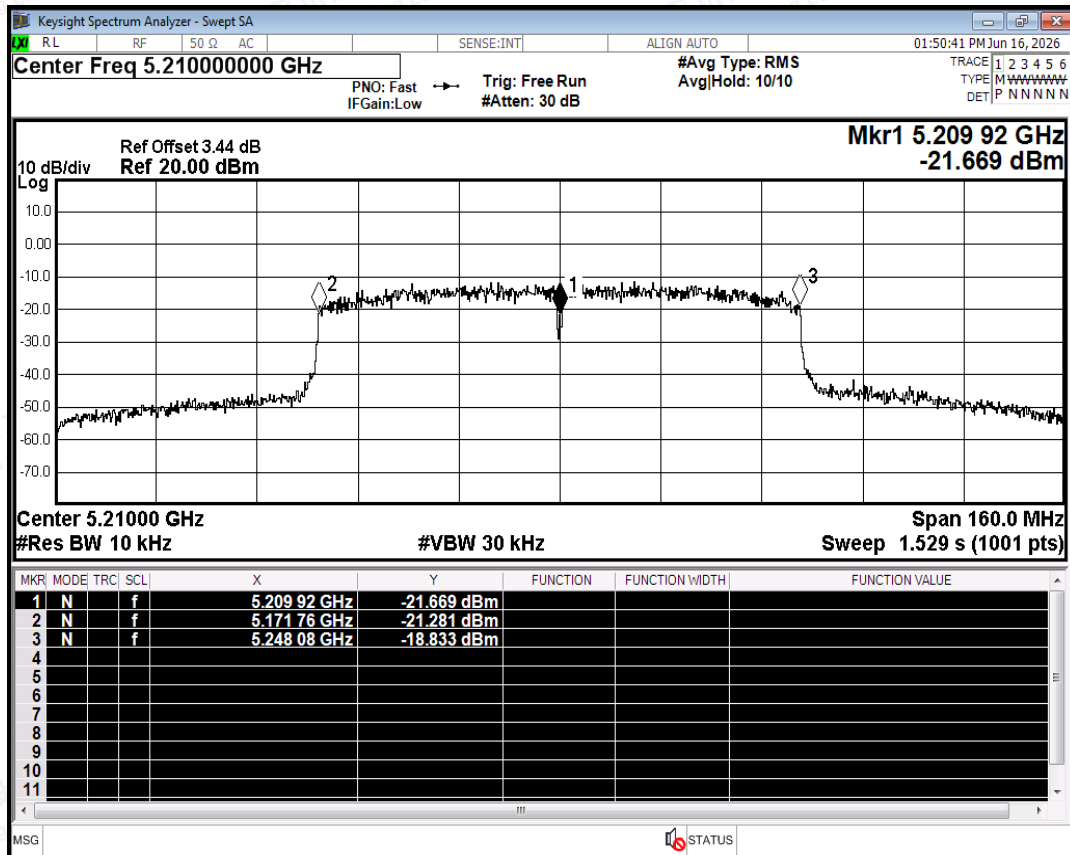

Freq. Stability NVNT ac80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant0	93.64	0.29	0.49
NVNT	a	5200	Ant0	94.5	0.25	0.49
NVNT	a	5240	Ant0	92.83	0.32	0.48
NVNT	n20	5180	Ant0	91.43	0.39	0.52
NVNT	n20	5200	Ant0	89.3	0.49	0.52
NVNT	n20	5240	Ant0	95.05	0.22	0.52
NVNT	n40	5190	Ant0	82.46	0.84	1.06
NVNT	n40	5230	Ant0	89.62	0.48	1.05
NVNT	ac20	5180	Ant0	92.34	0.35	0.52
NVNT	ac20	5200	Ant0	93.69	0.28	0.52
NVNT	ac20	5240	Ant0	93.24	0.3	0.52
NVNT	ac40	5190	Ant0	79.17	1.01	1.05
NVNT	ac40	5230	Ant0	81.2	0.9	1.05
NVNT	ac80	5210	Ant0	71.88	1.43	2.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

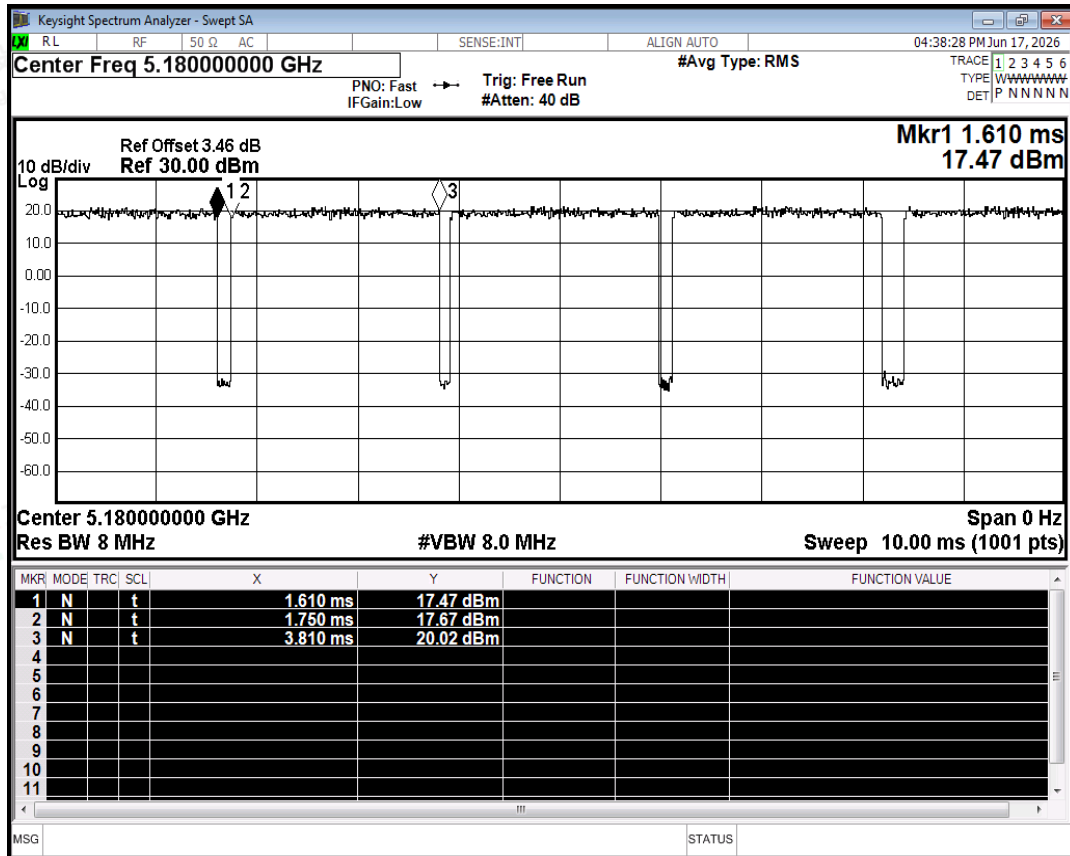

Duty Cycle NVNT a 5180MHz Ant0

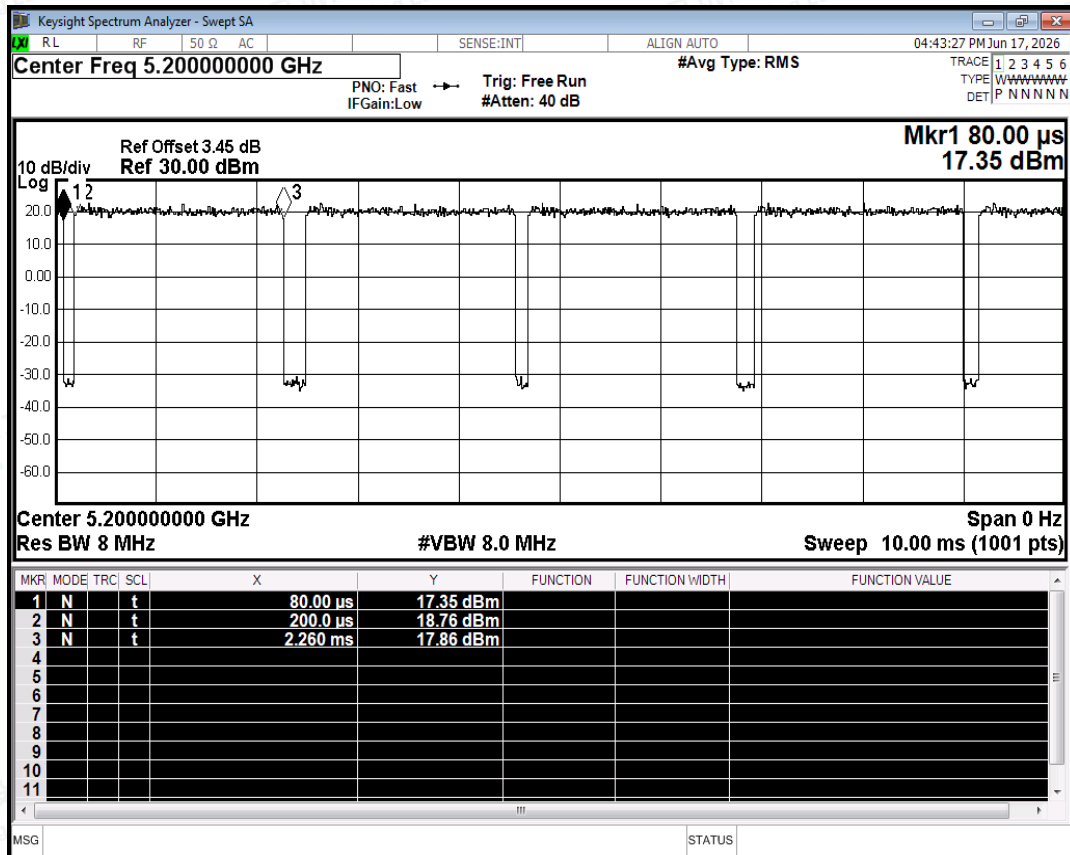

Duty Cycle NVNT a 5200MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

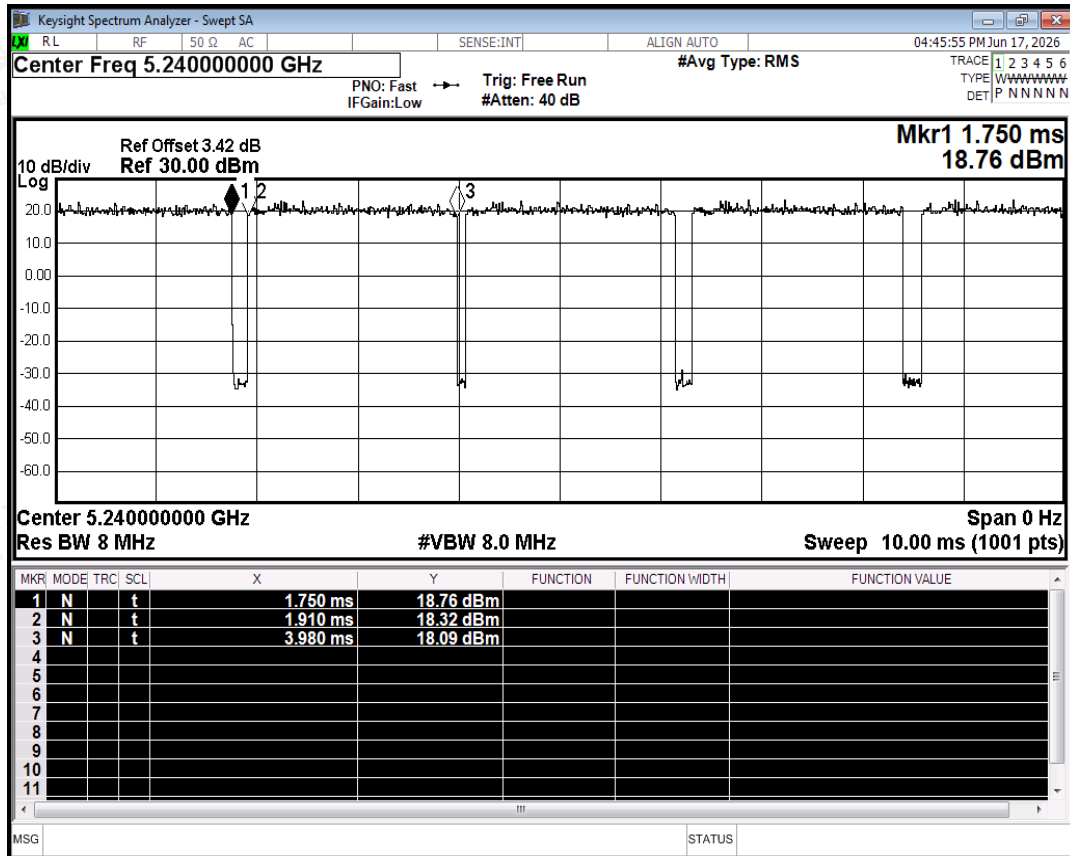

Duty Cycle NVNT a 5240MHz Ant0

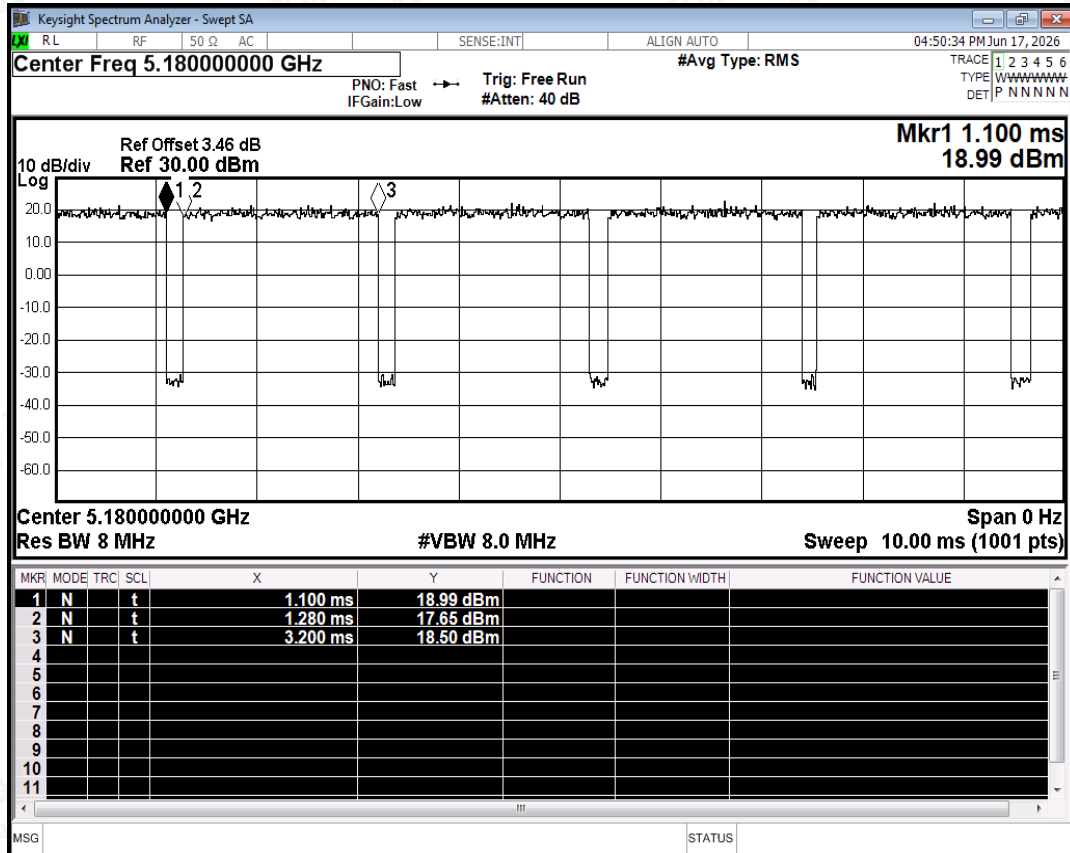

Duty Cycle NVNT n20 5180MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

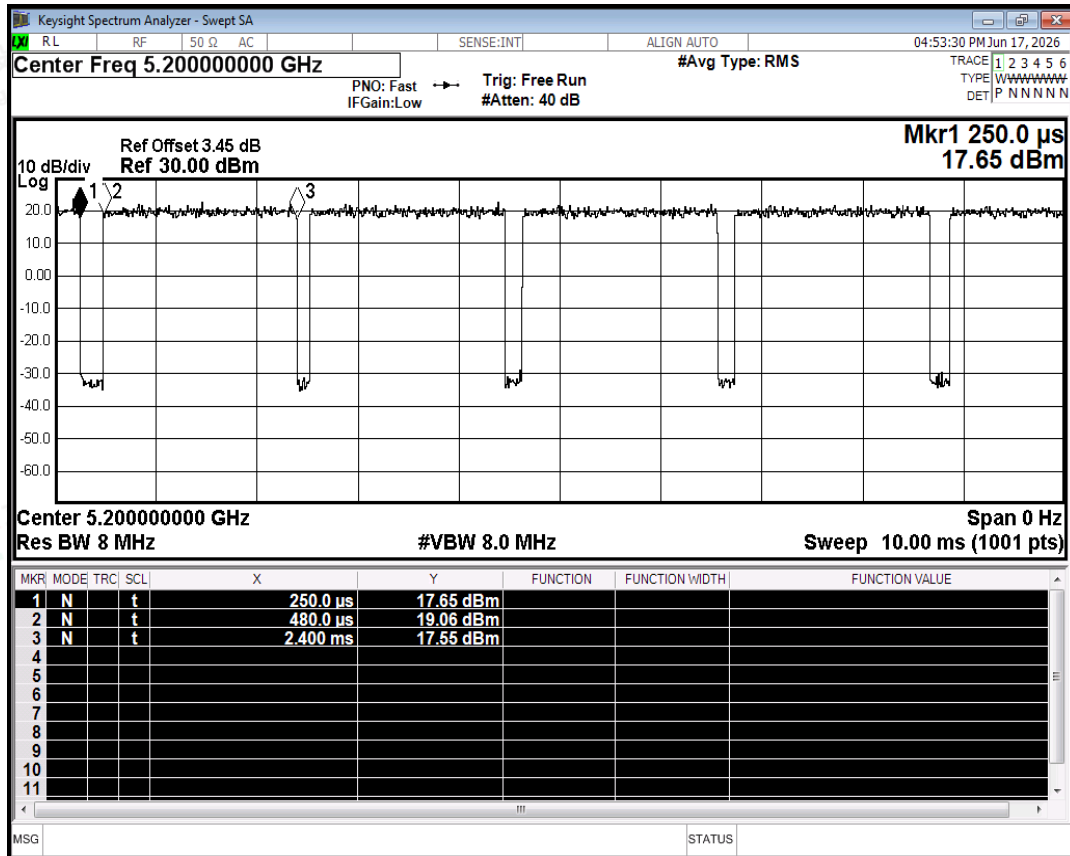

Duty Cycle NVNT n20 5200MHz Ant0

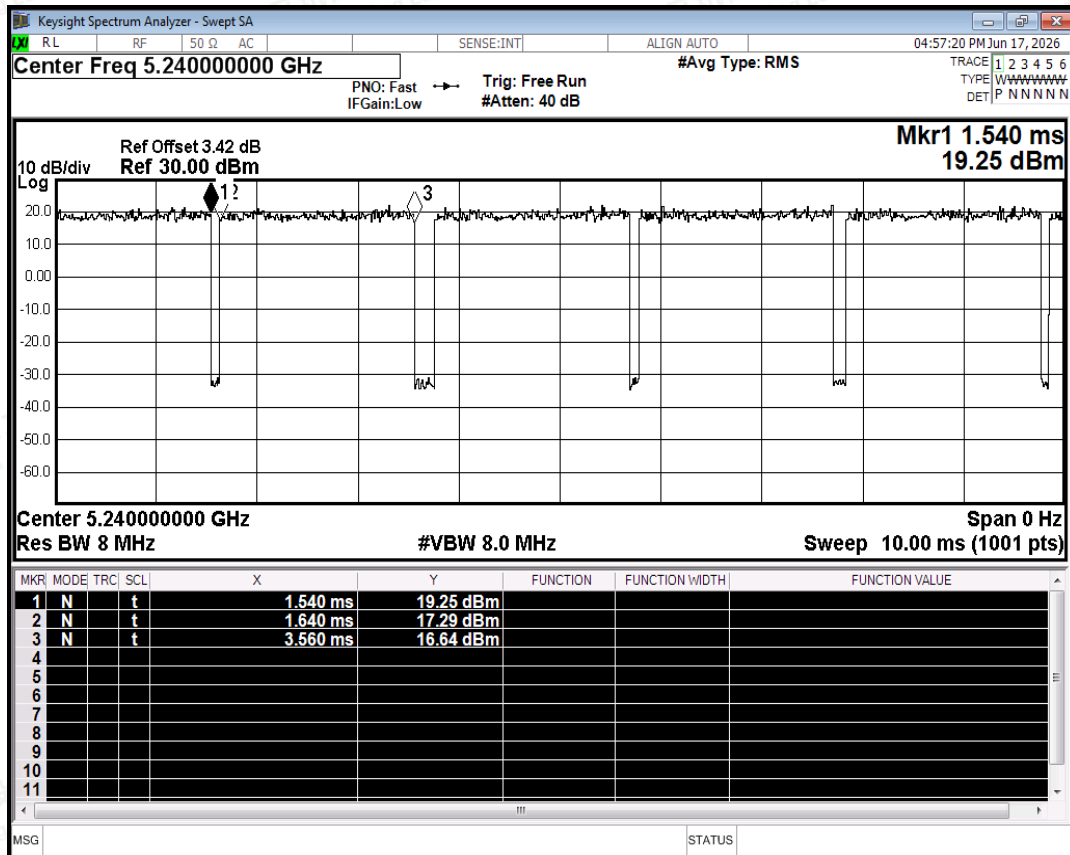

Duty Cycle NVNT n20 5240MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

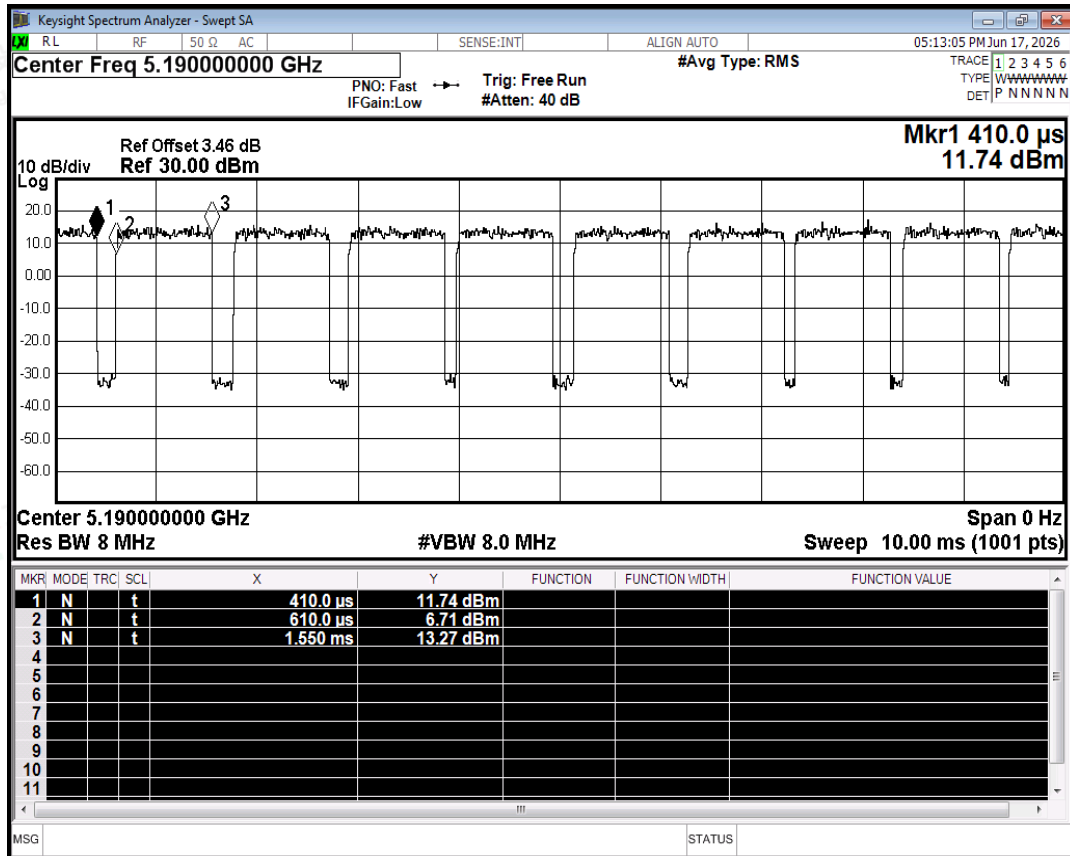

Duty Cycle NVNT n40 5190MHz Ant0

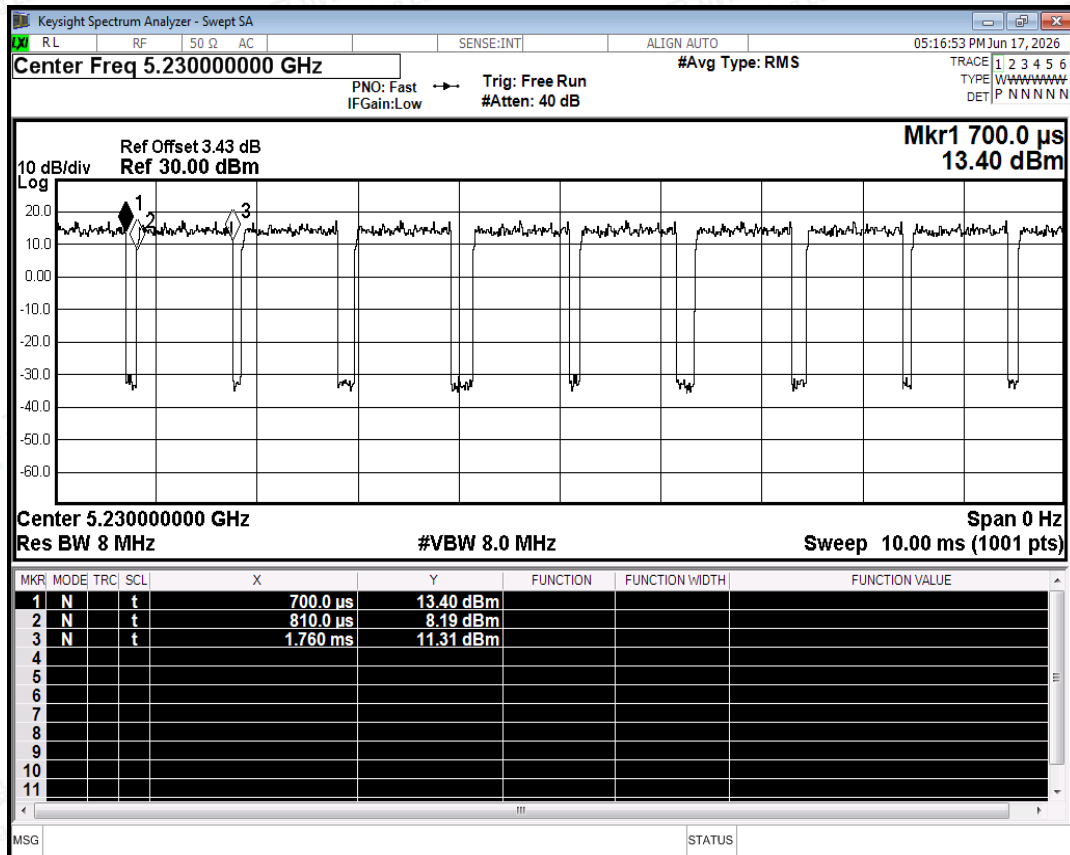

Duty Cycle NVNT n40 5230MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

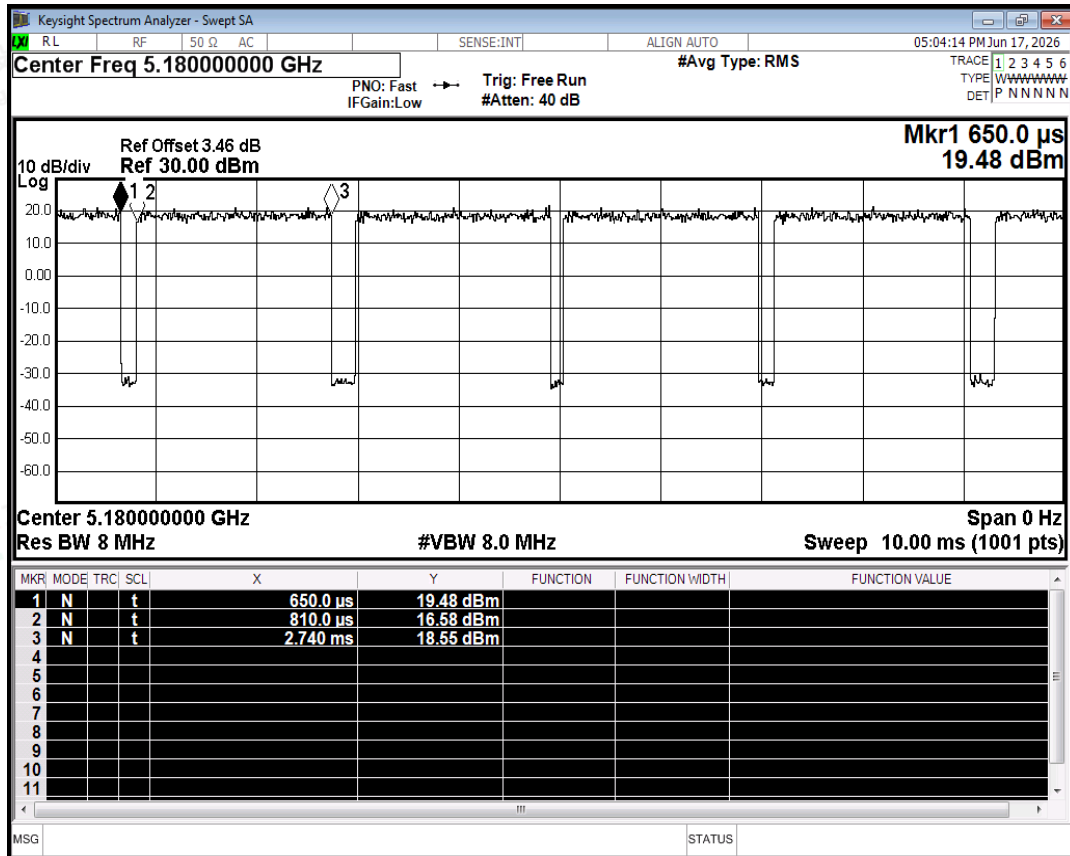

Duty Cycle NVNT ac20 5180MHz Ant0

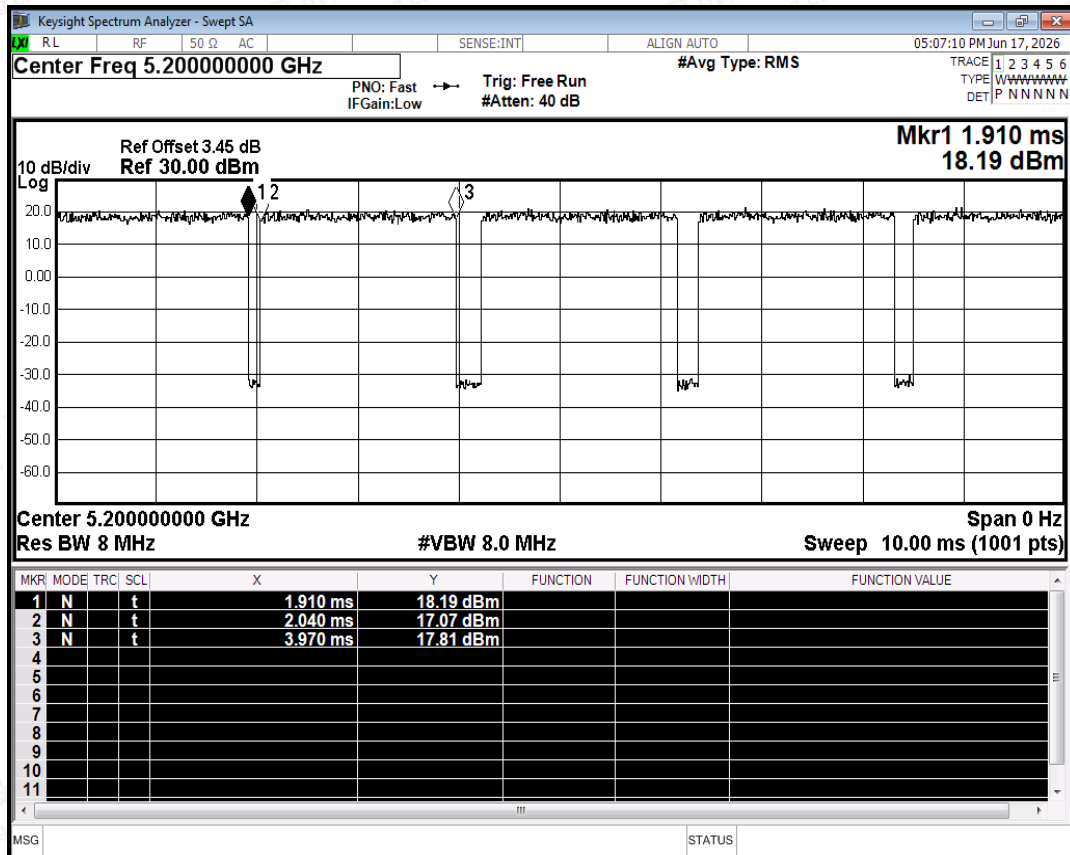

Duty Cycle NVNT ac20 5200MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

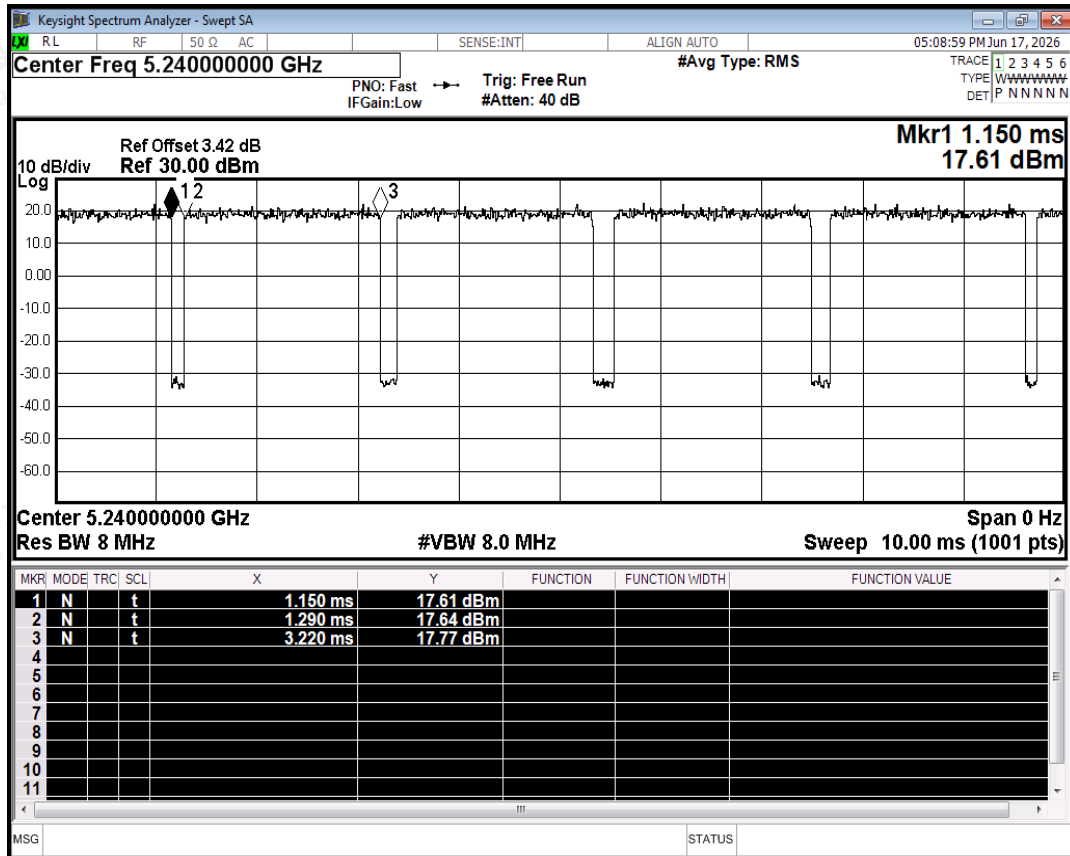

Duty Cycle NVNT ac20 5240MHz Ant0

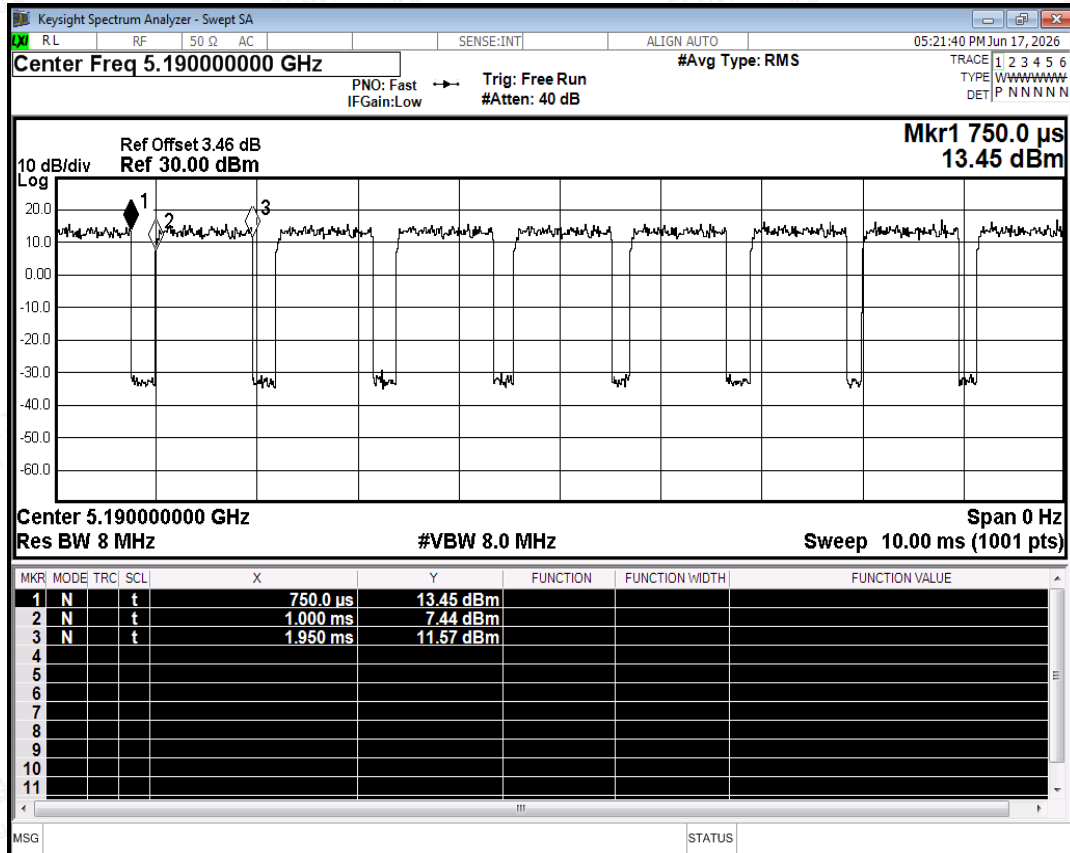

Duty Cycle NVNT ac40 5190MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

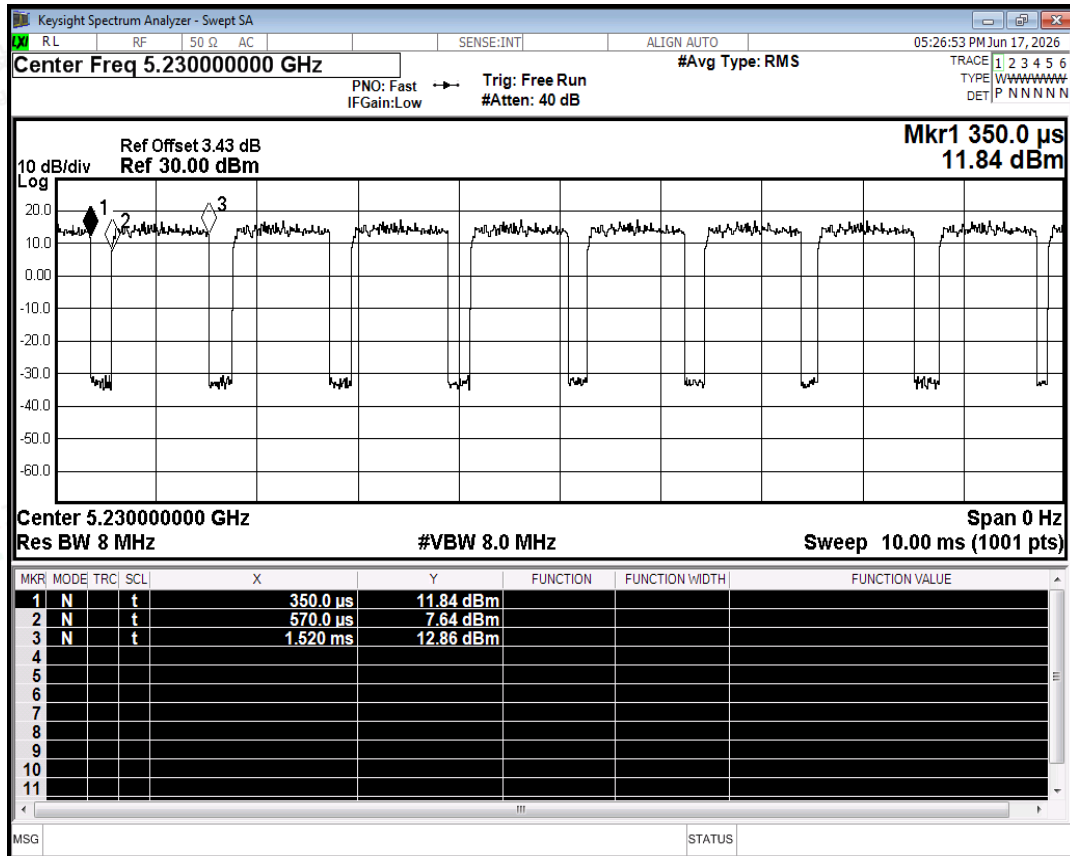

Duty Cycle NVNT ac40 5230MHz Ant0

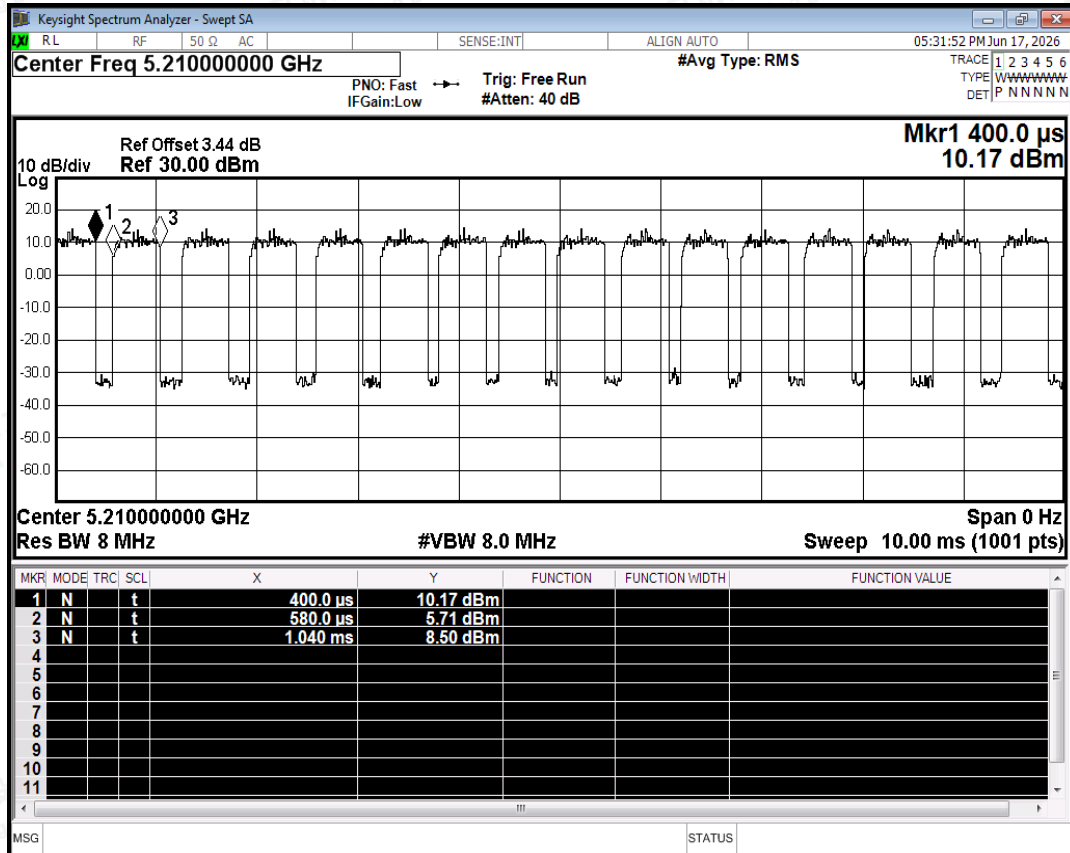

Duty Cycle NVNT ac80 5210MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	100	0	0
NVNT	a	5200	Ant1	100	0	0
NVNT	a	5240	Ant1	100	0	0
NVNT	n20	5180	Ant1	100	0	0
NVNT	n20	5200	Ant1	100	0	0
NVNT	n20	5240	Ant1	100	0	0
NVNT	n40	5190	Ant1	100	0	0
NVNT	n40	5230	Ant1	100	0	0
NVNT	ac20	5180	Ant1	100	0	0
NVNT	ac20	5200	Ant1	100	0	0
NVNT	ac20	5240	Ant1	100	0	0
NVNT	ac40	5190	Ant1	100	0	0
NVNT	ac40	5230	Ant1	100	0	0
NVNT	ac80	5210	Ant1	75.41	1.23	2.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

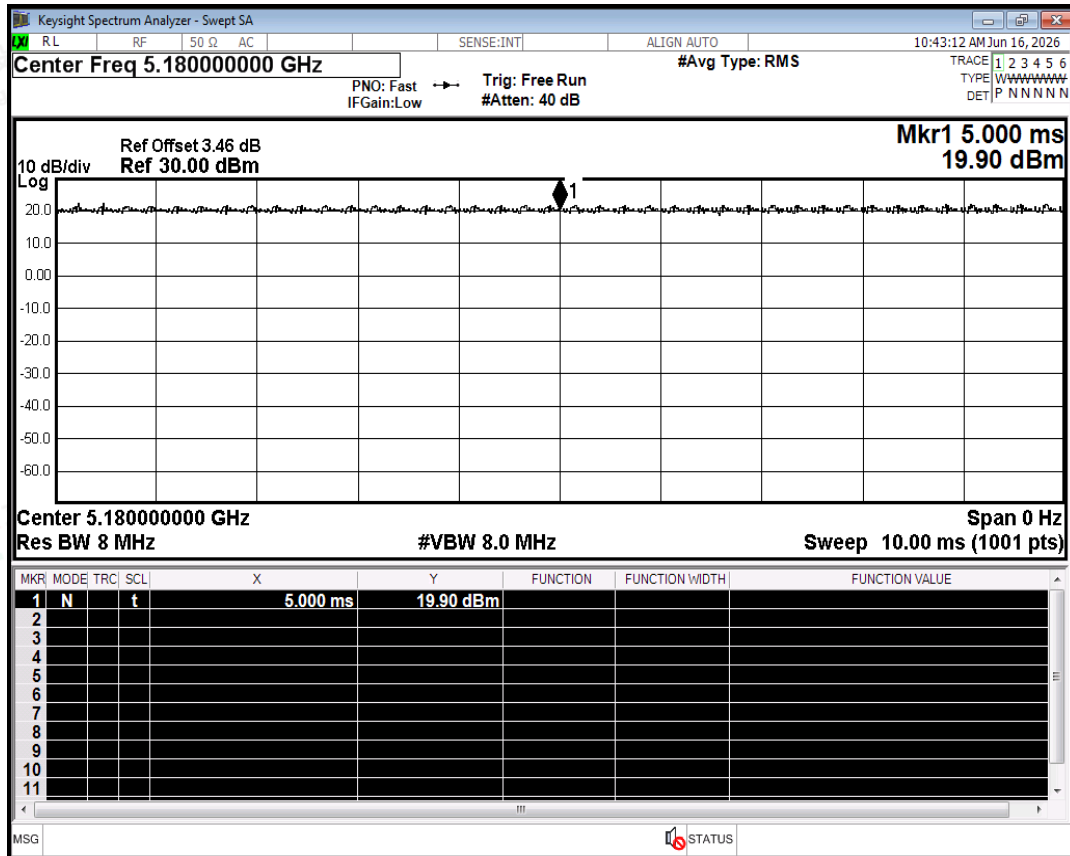

Duty Cycle NVNT a 5180MHz Ant1

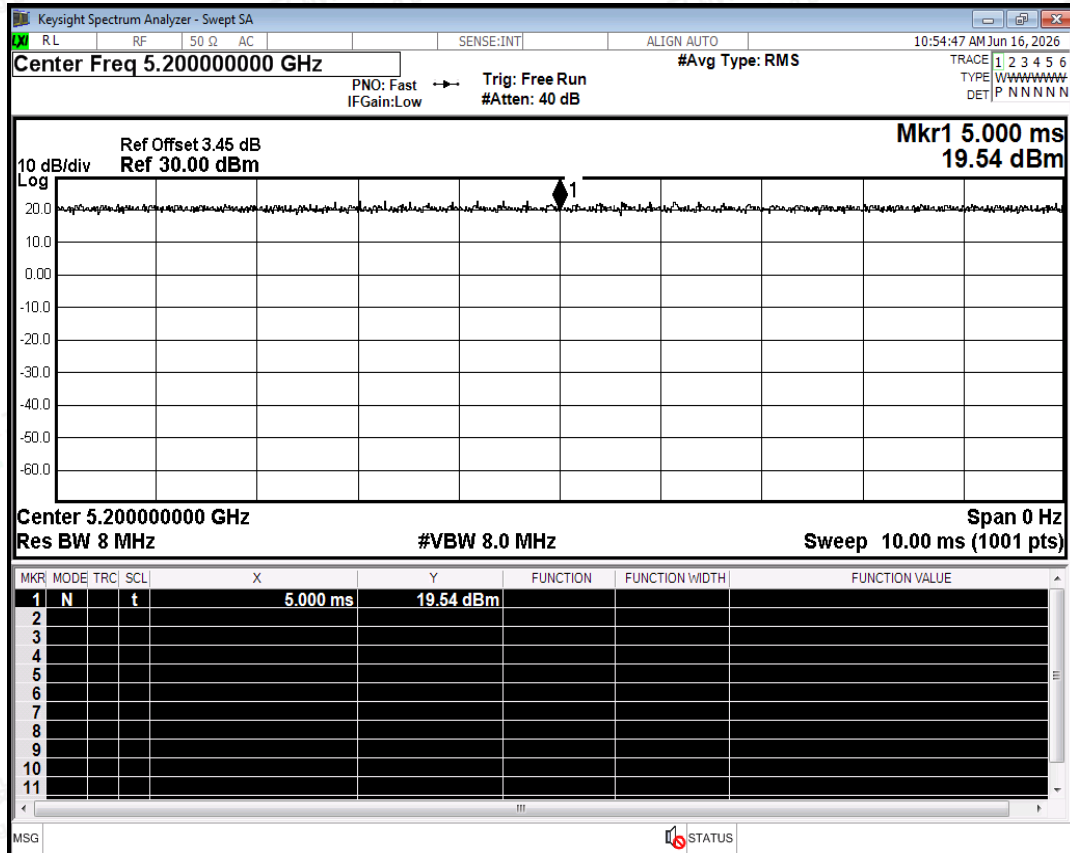

Duty Cycle NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

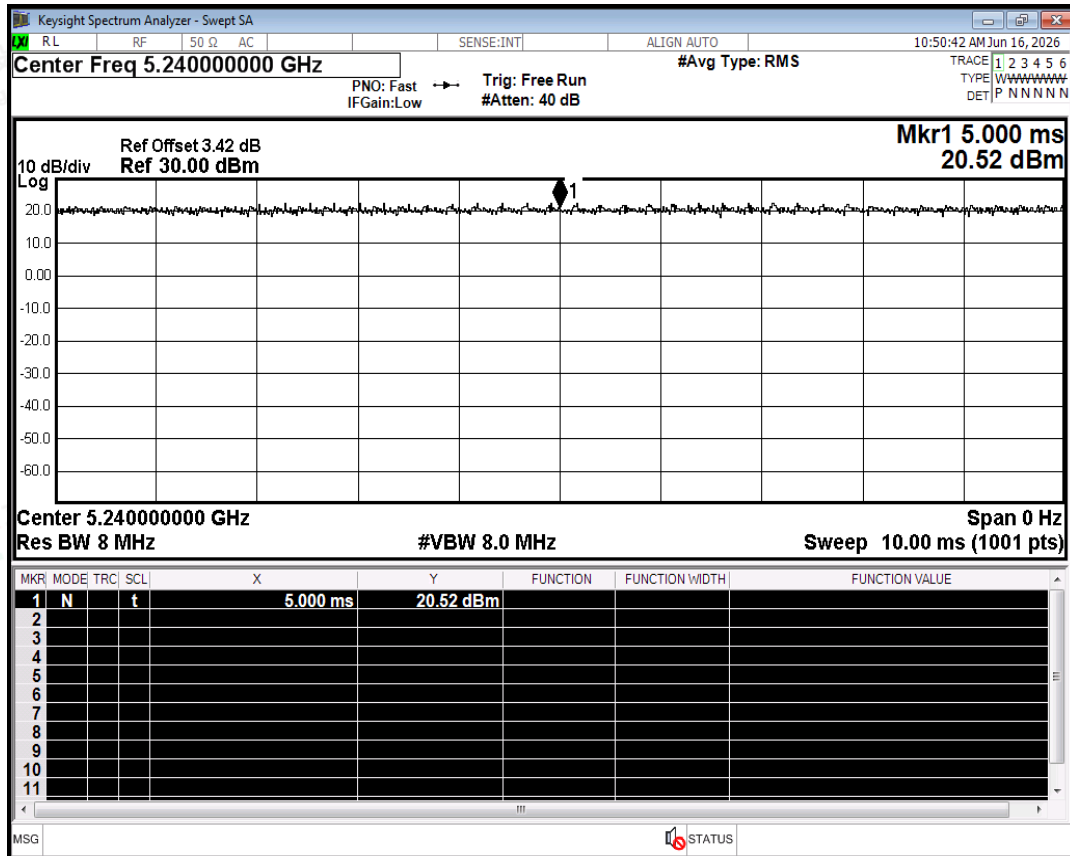

Duty Cycle NVNT a 5240MHz Ant1

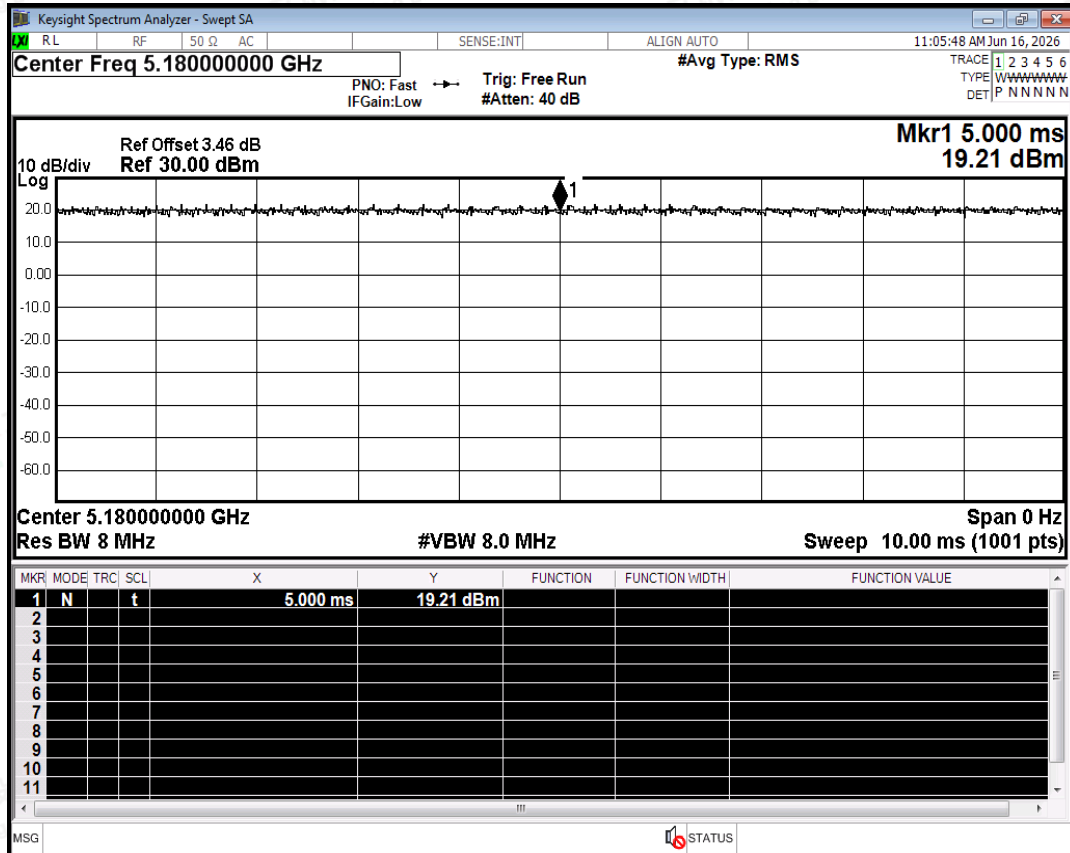

Duty Cycle NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

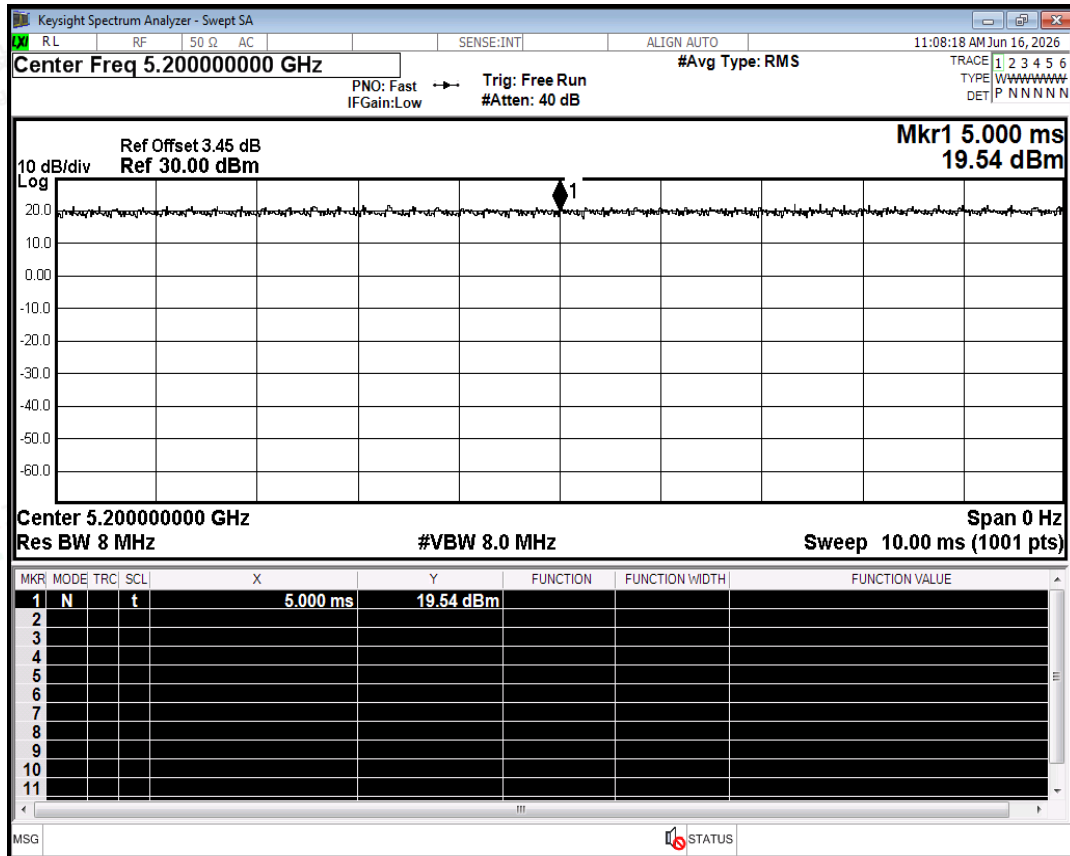

Duty Cycle NVNT n20 5200MHz Ant1

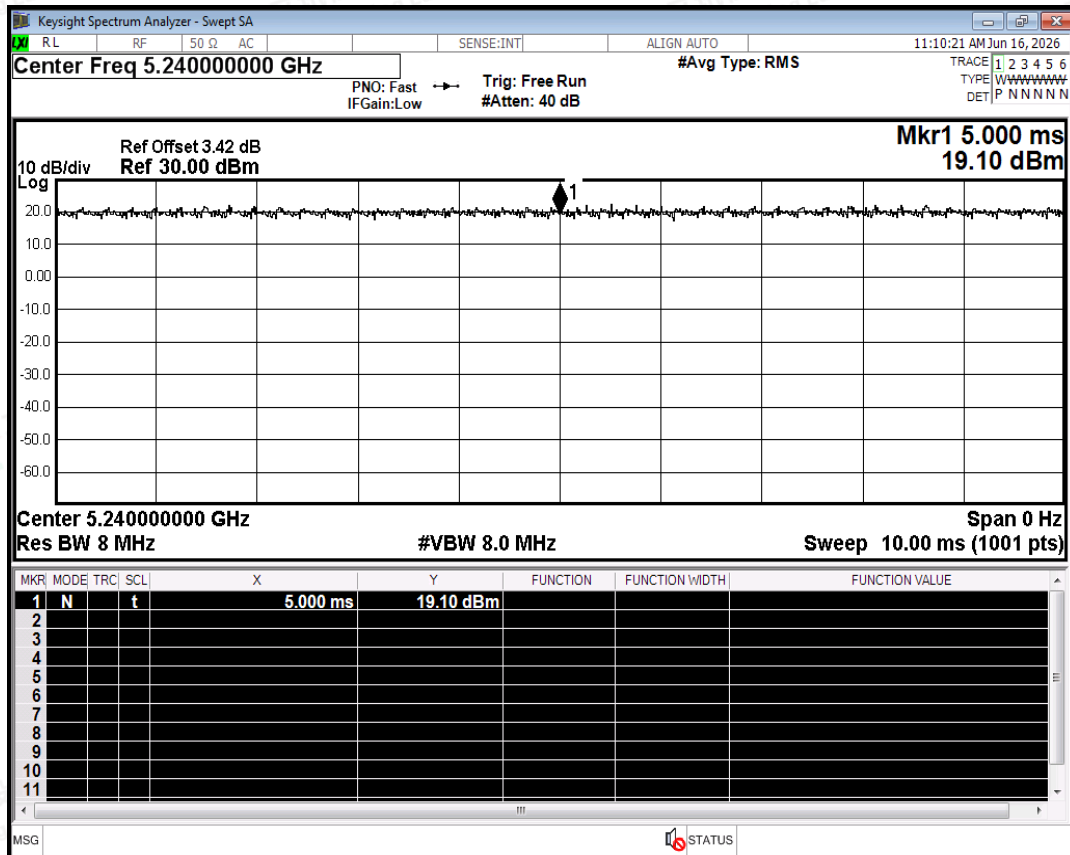

Duty Cycle NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

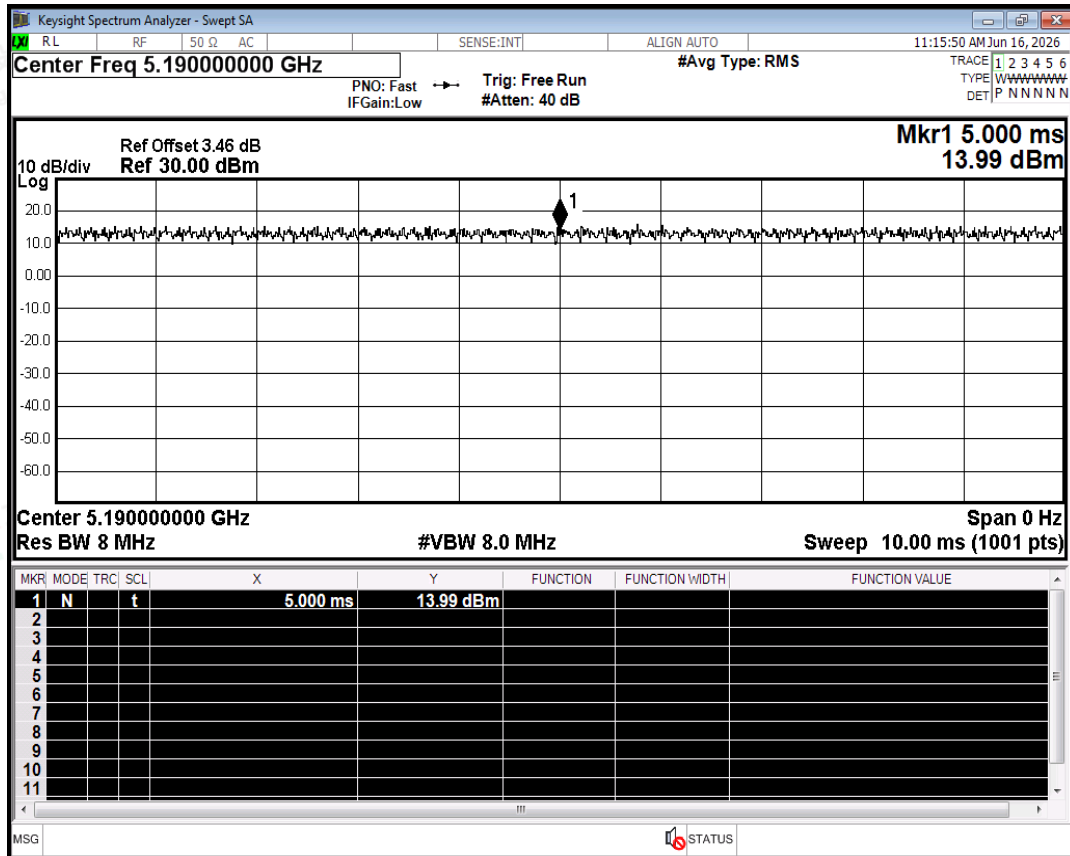

Duty Cycle NVNT n40 5190MHz Ant1

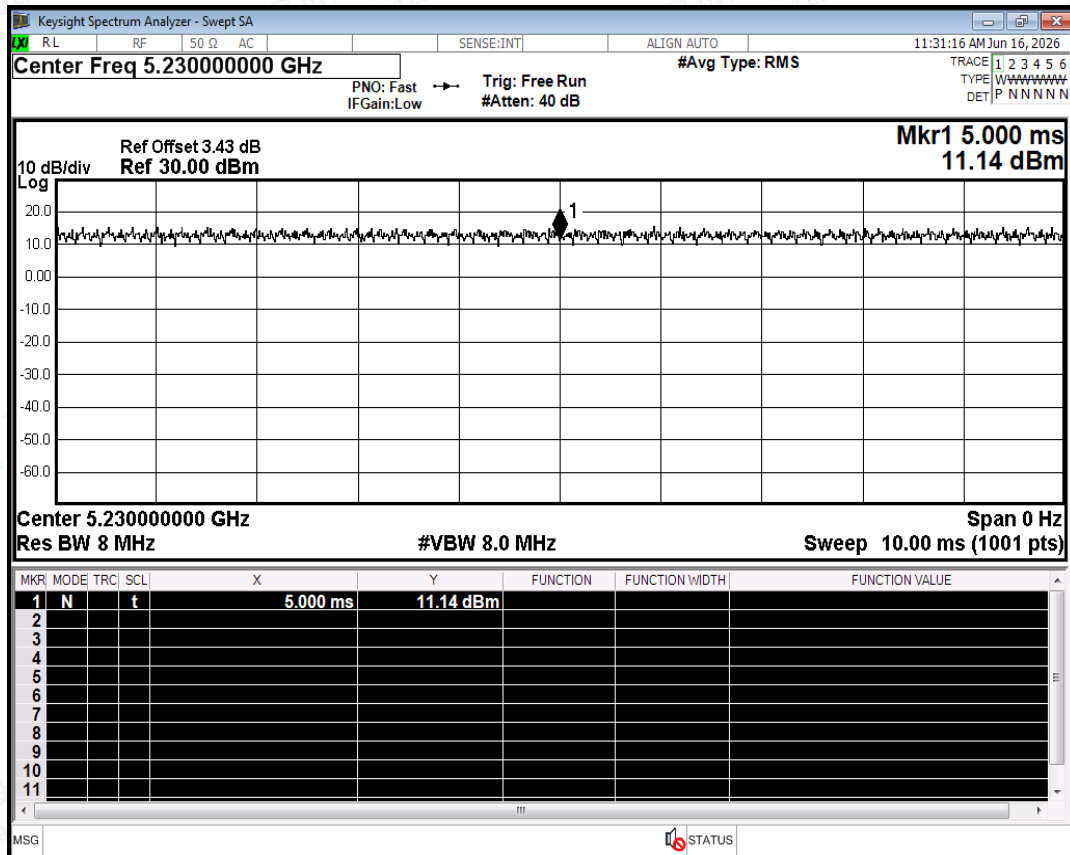

Duty Cycle NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

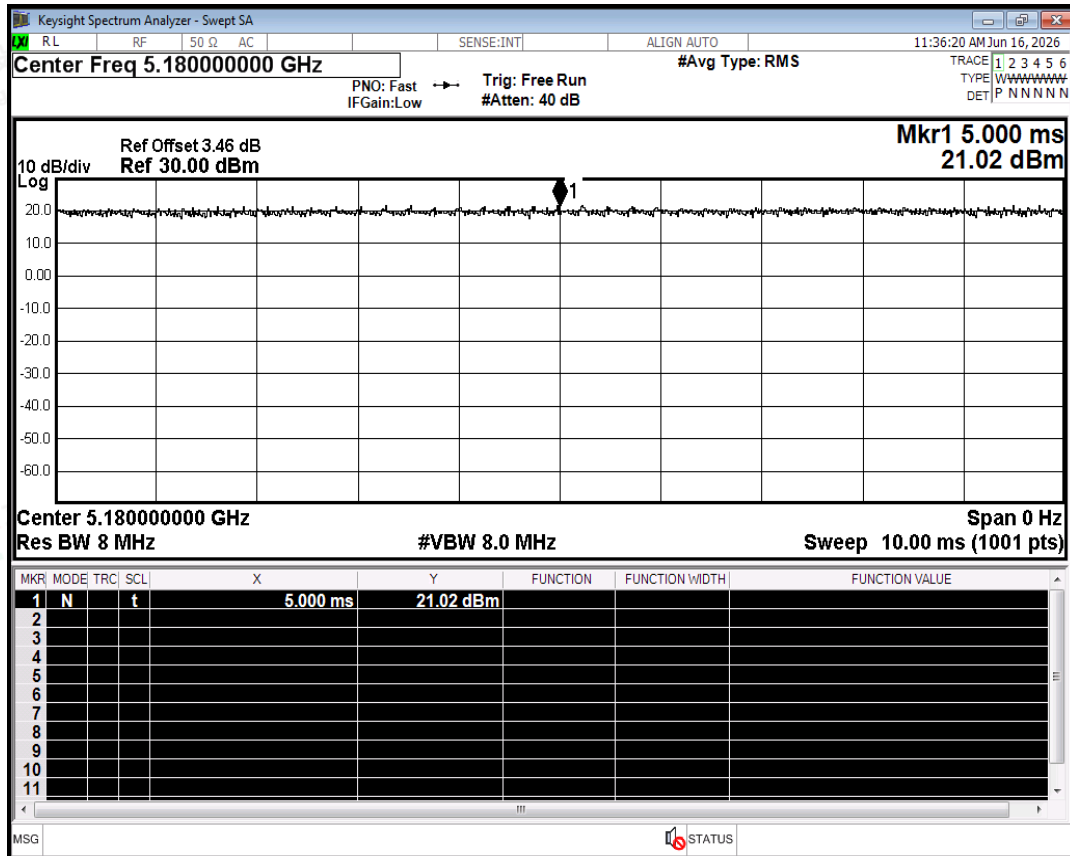

Duty Cycle NVNT ac20 5180MHz Ant1

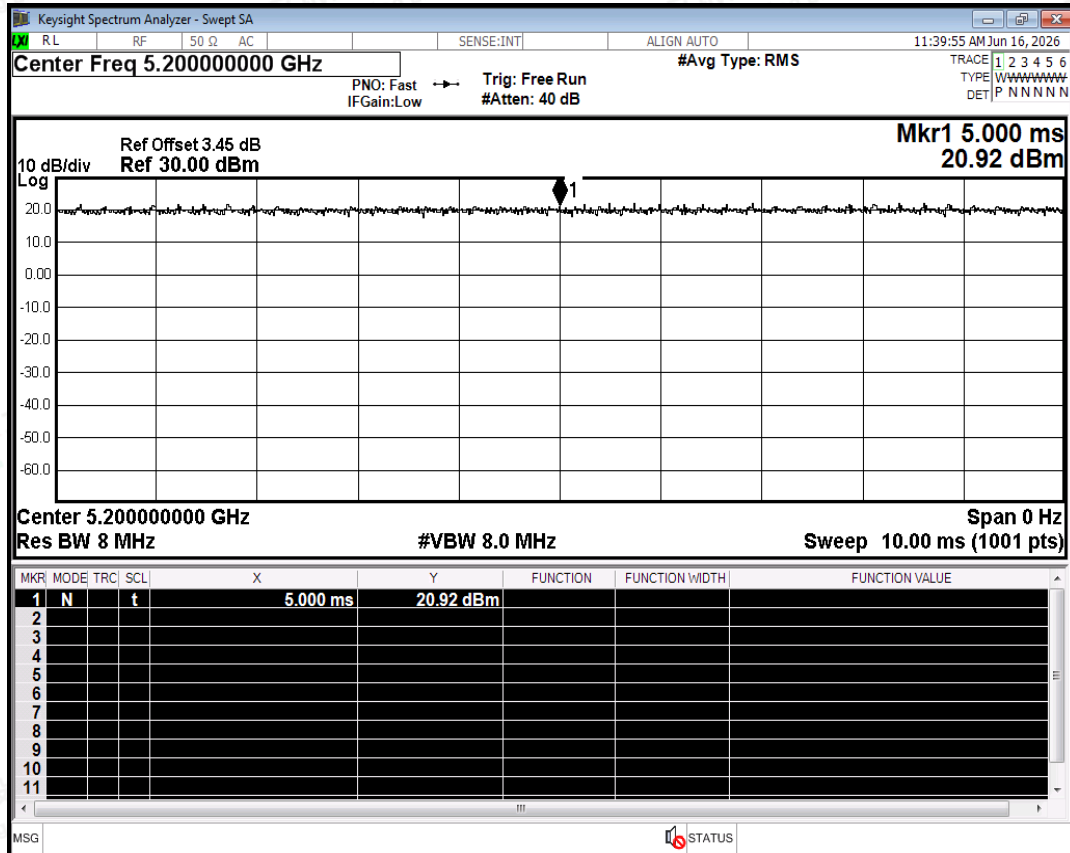

Duty Cycle NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

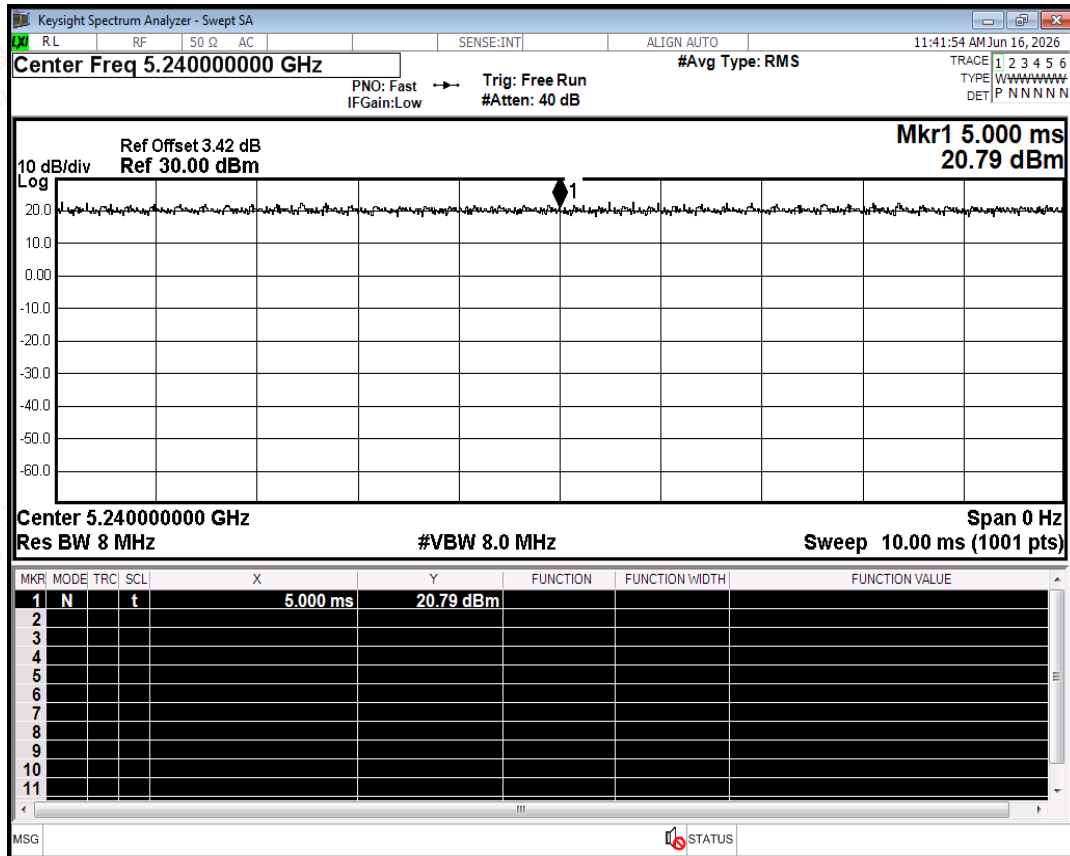

Duty Cycle NVNT ac20 5240MHz Ant1

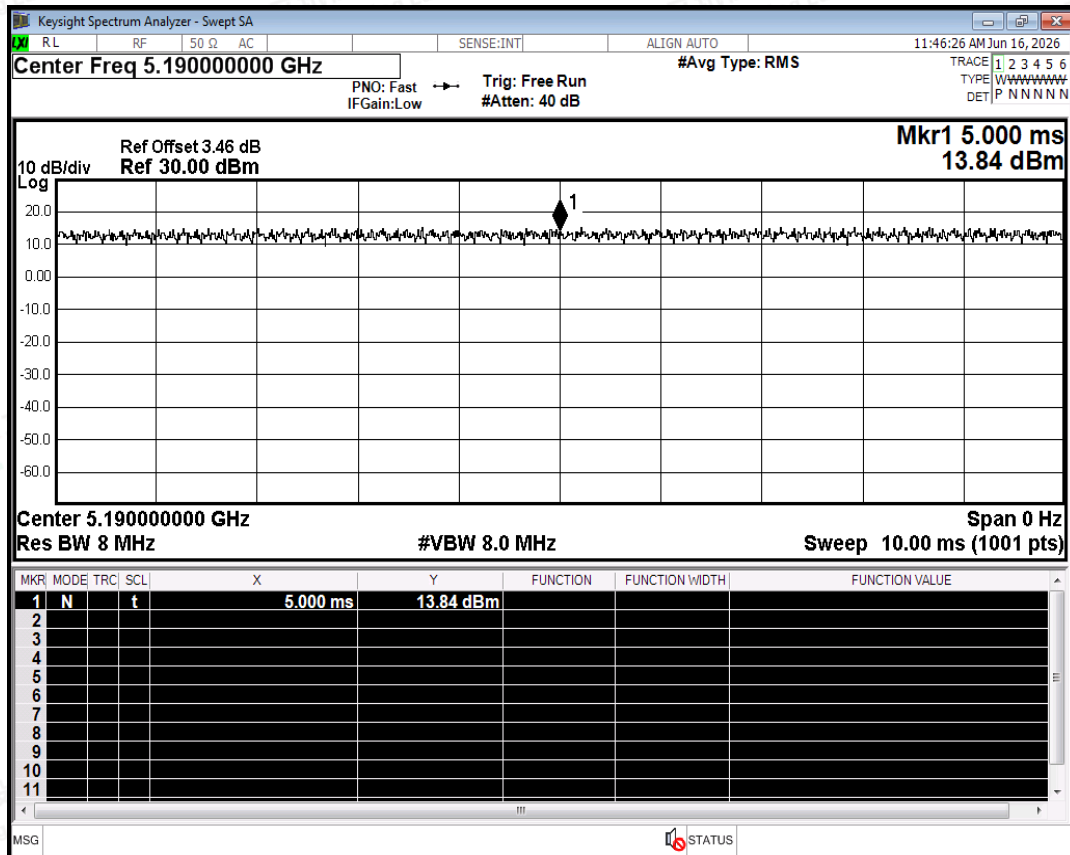

Duty Cycle NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

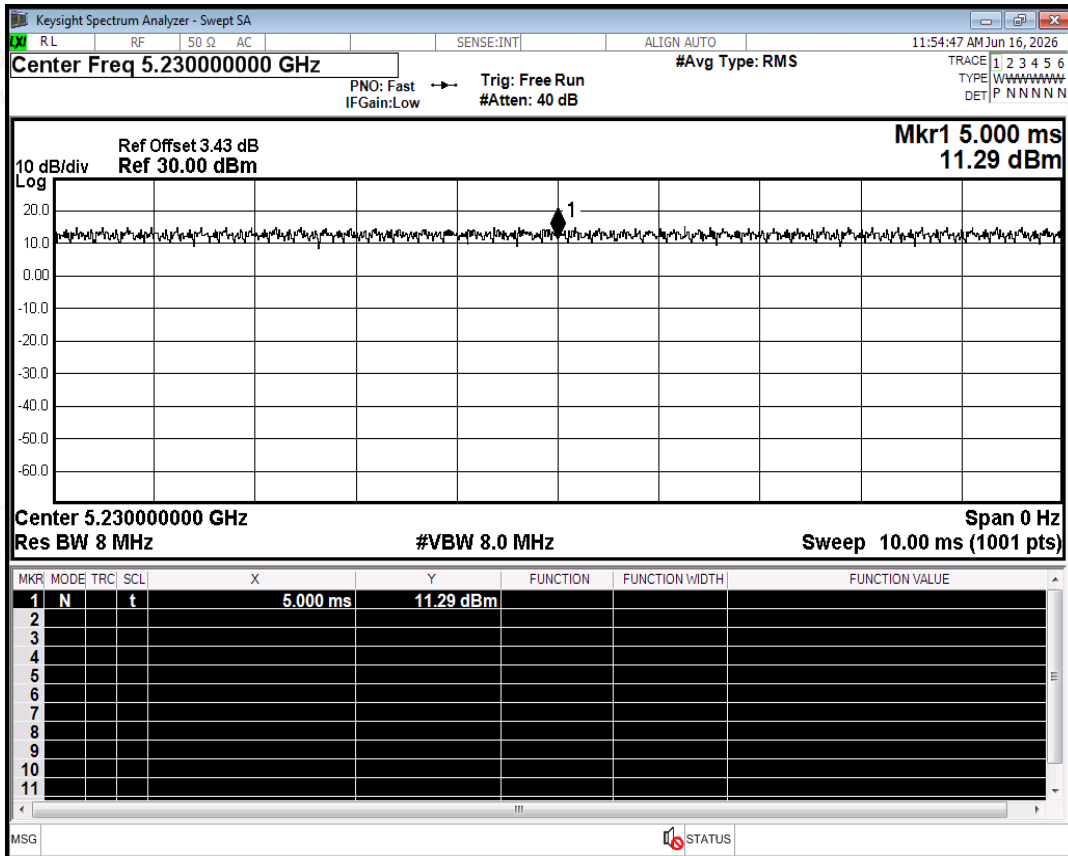

Duty Cycle NVNT ac40 5230MHz Ant1

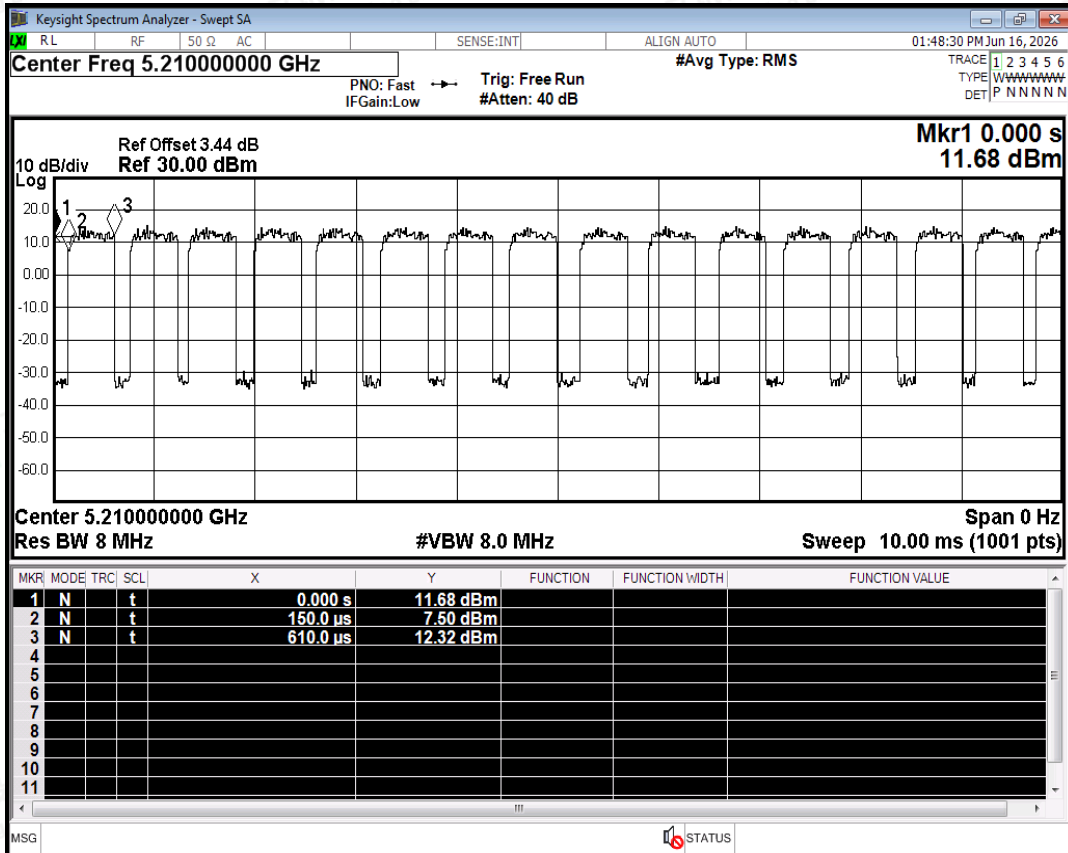

Duty Cycle NVNT ac80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity