





Restrict Band NVNT a 5700MHz Ant1 Peak

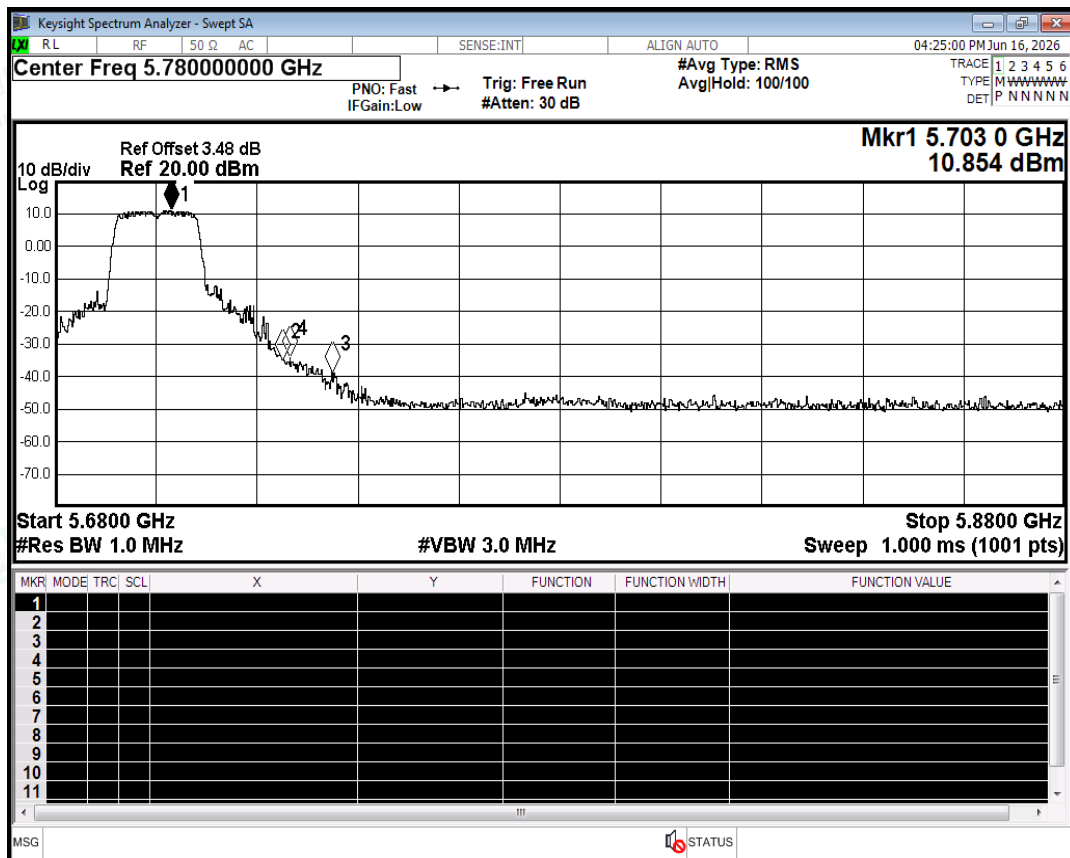

Restrict Band NVNT a 5700MHz Ant1 Average

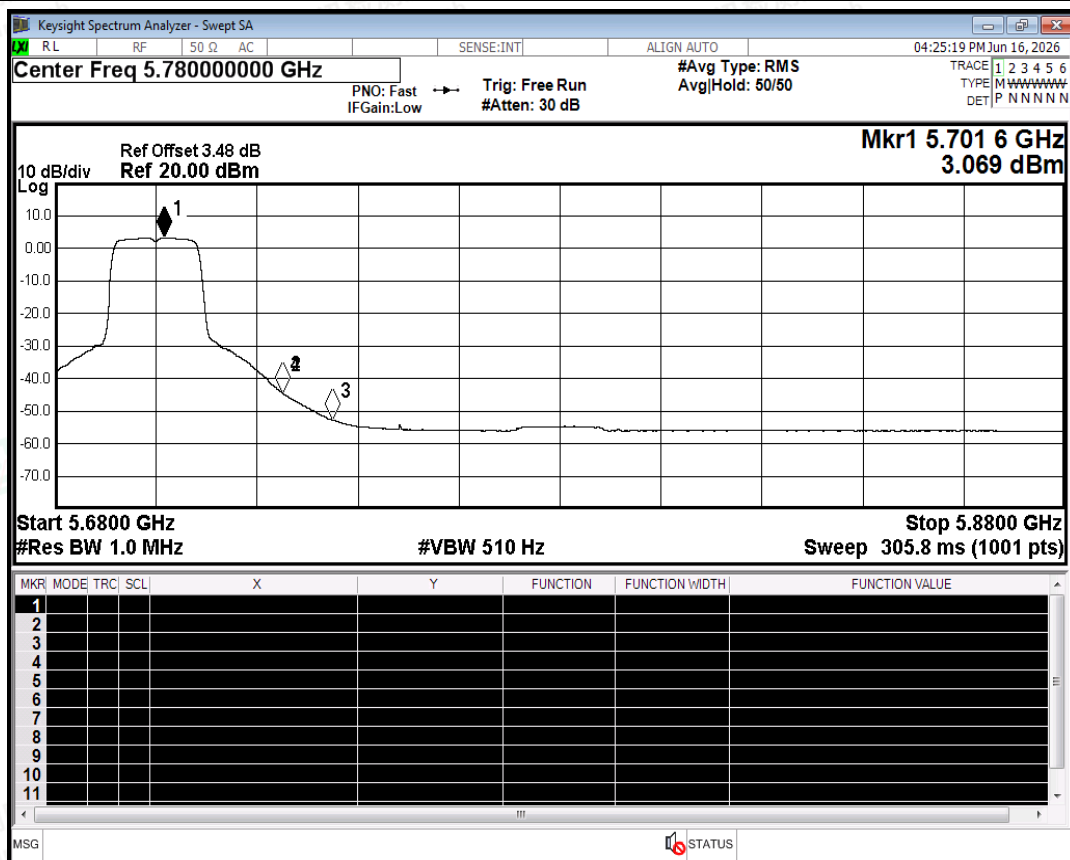


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

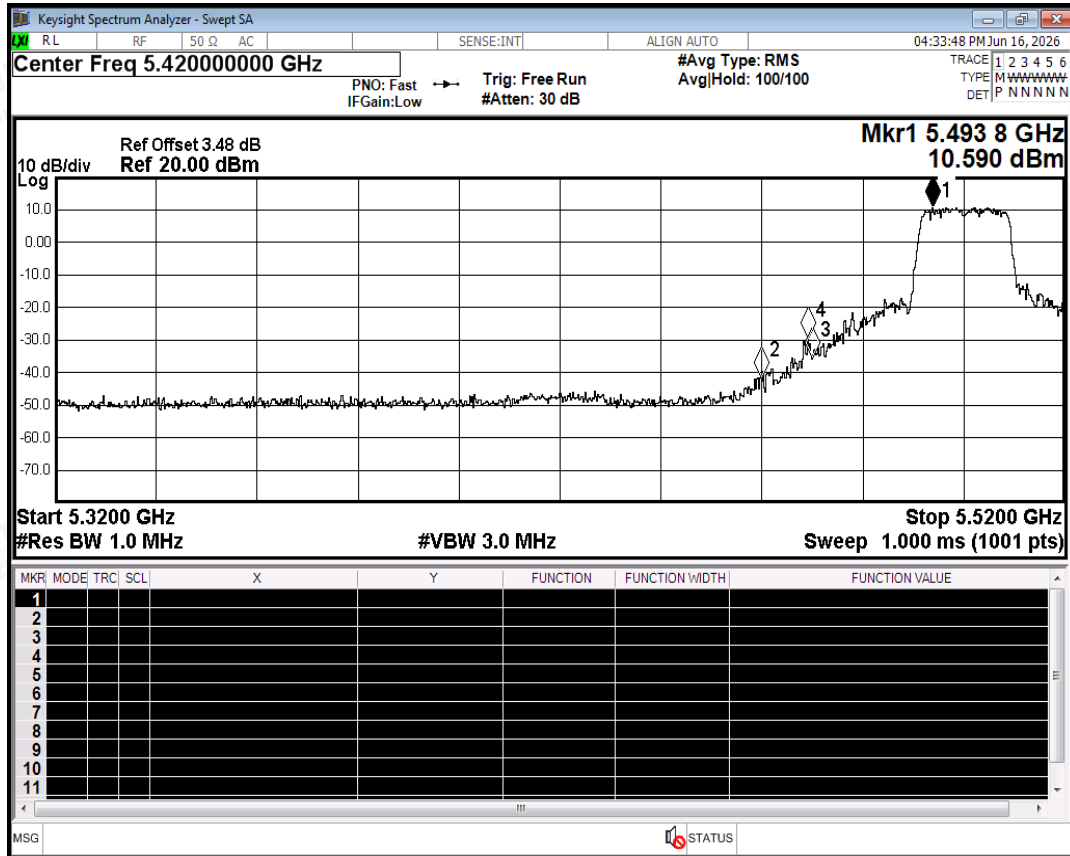

Restrict Band NVNT n20 5500MHz Ant1 Peak

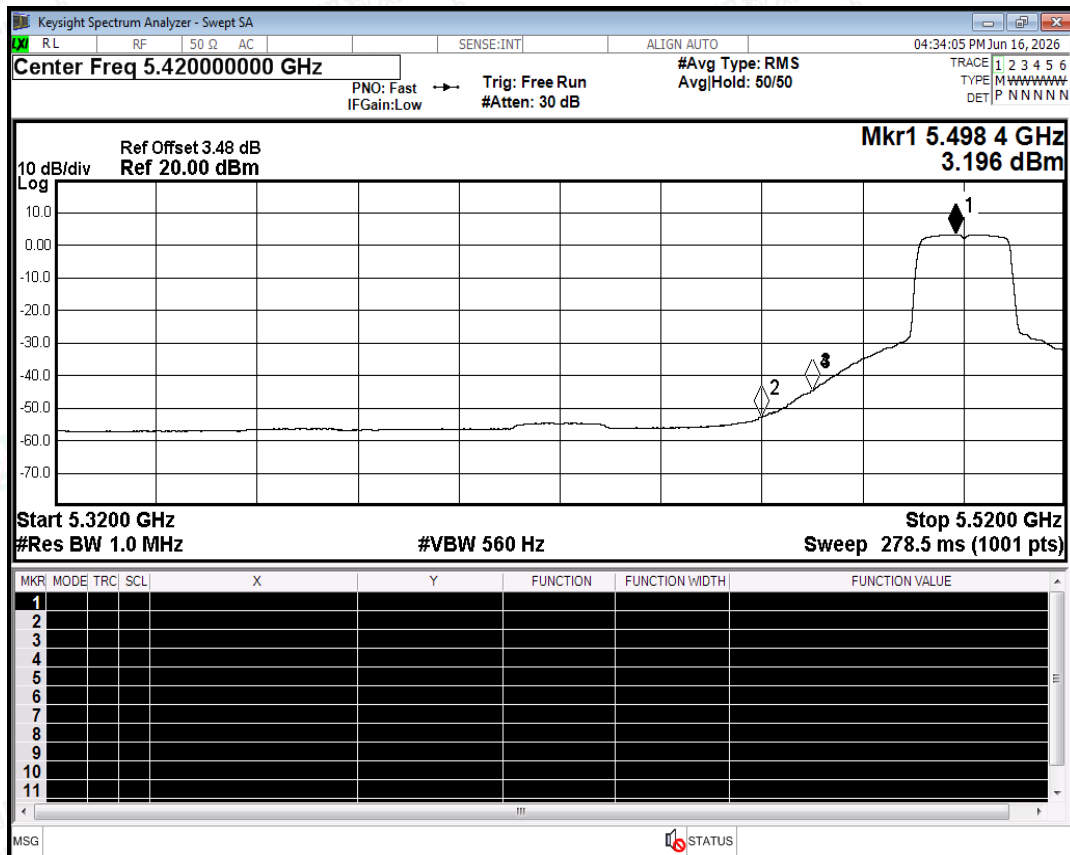

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

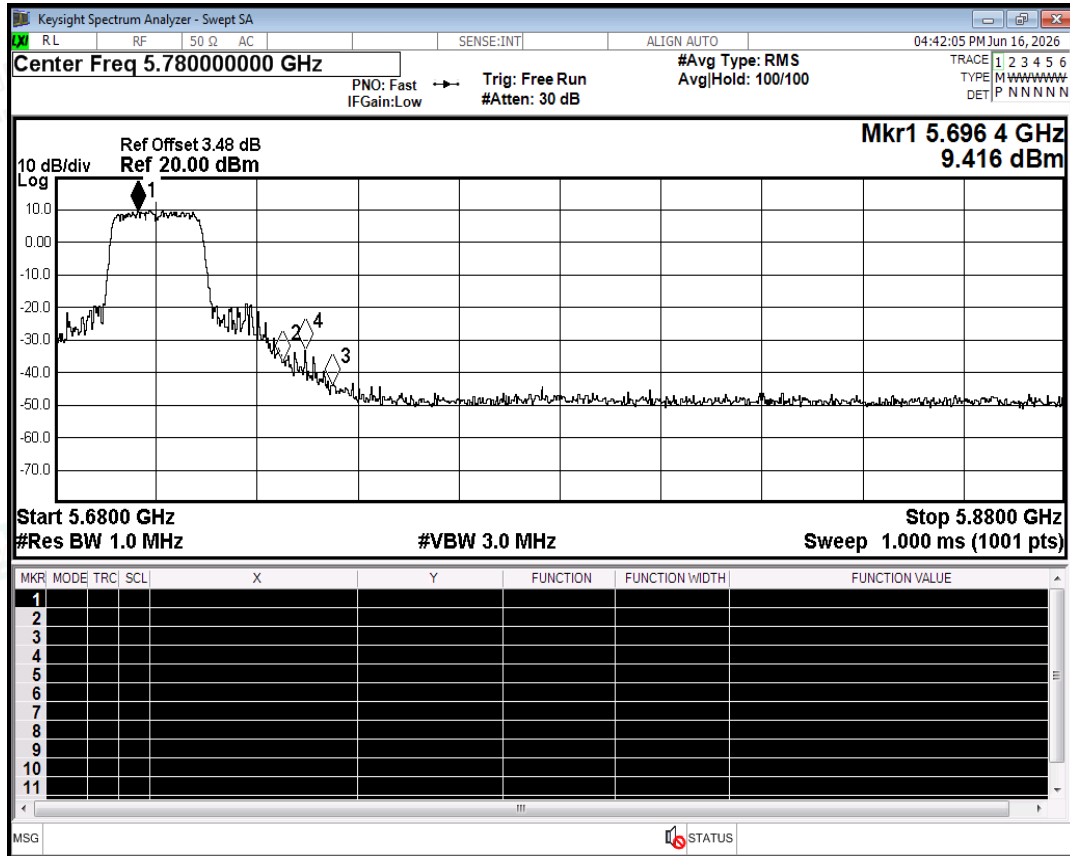

Restrict Band NVNT n20 5700MHz Ant1 Peak

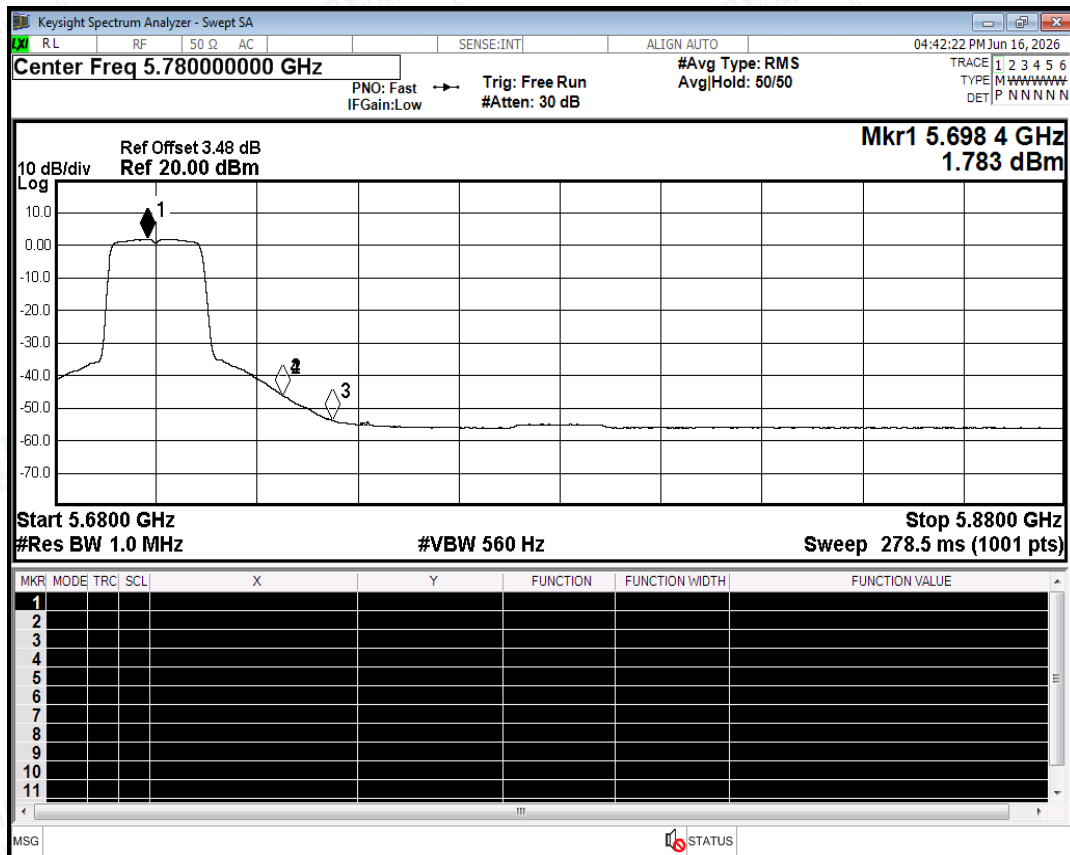

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

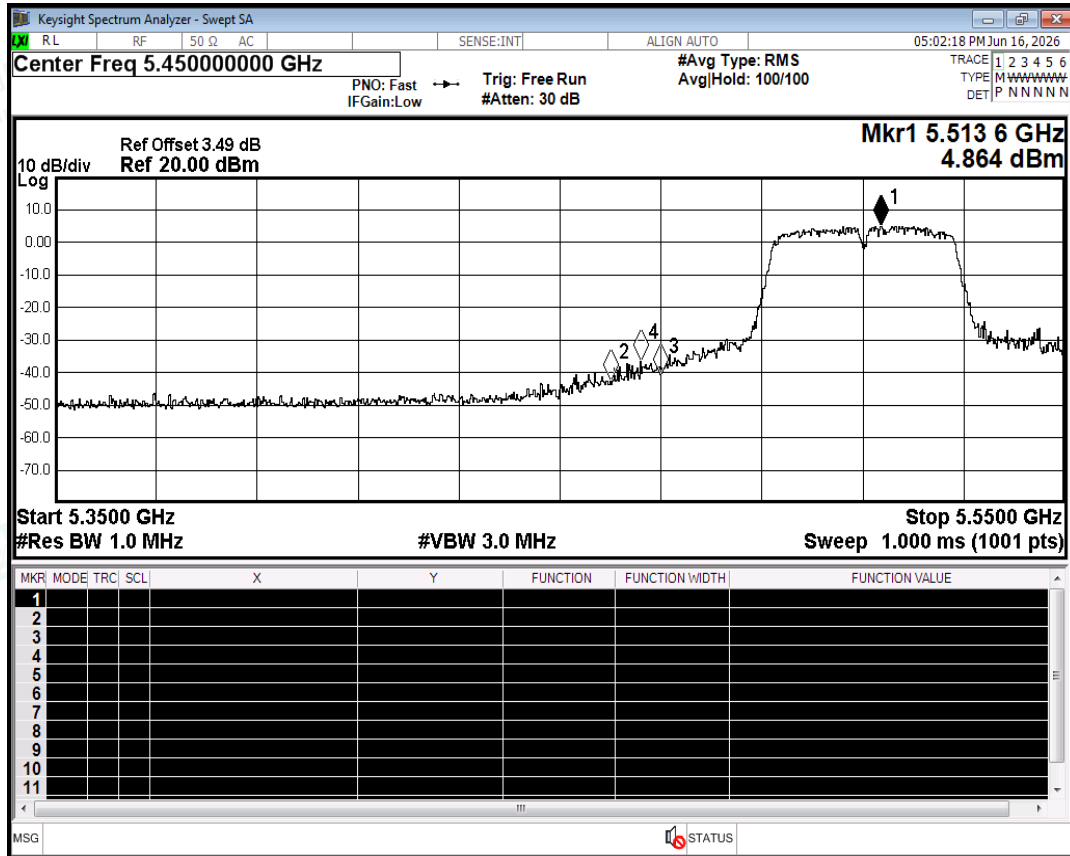

Restrict Band NVNT n40 5510MHz Ant1 Peak

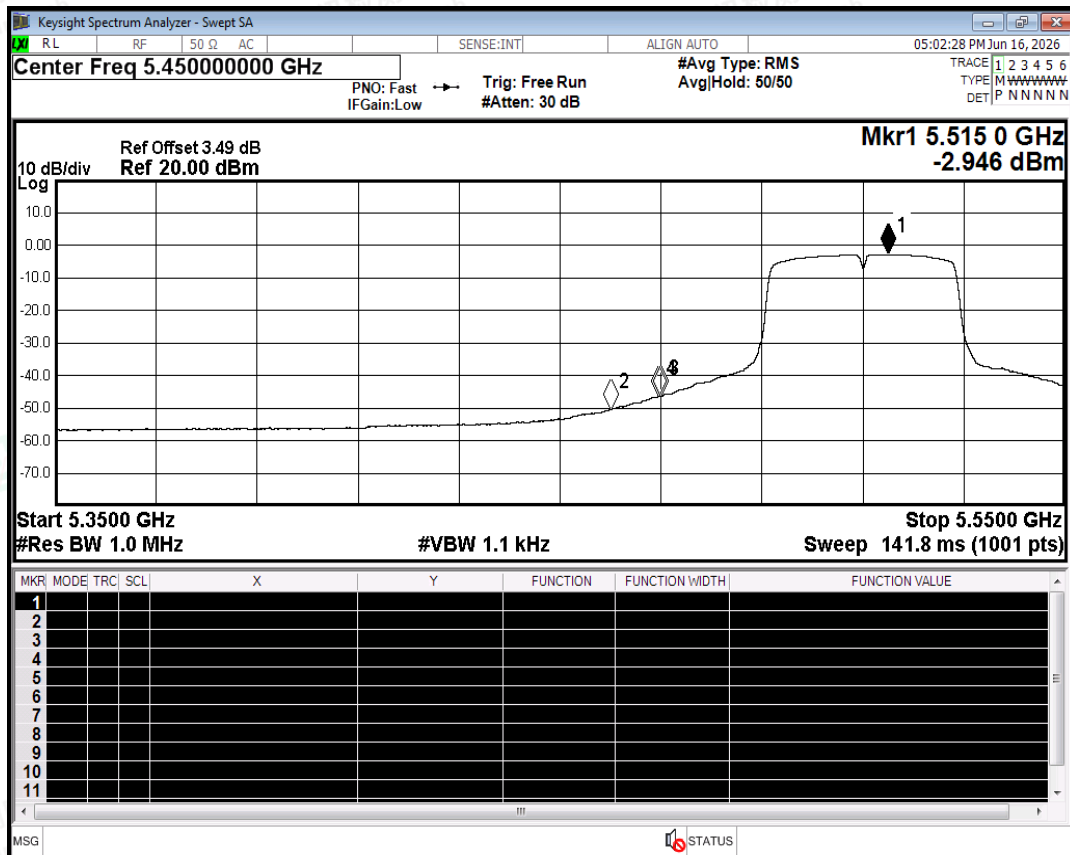

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

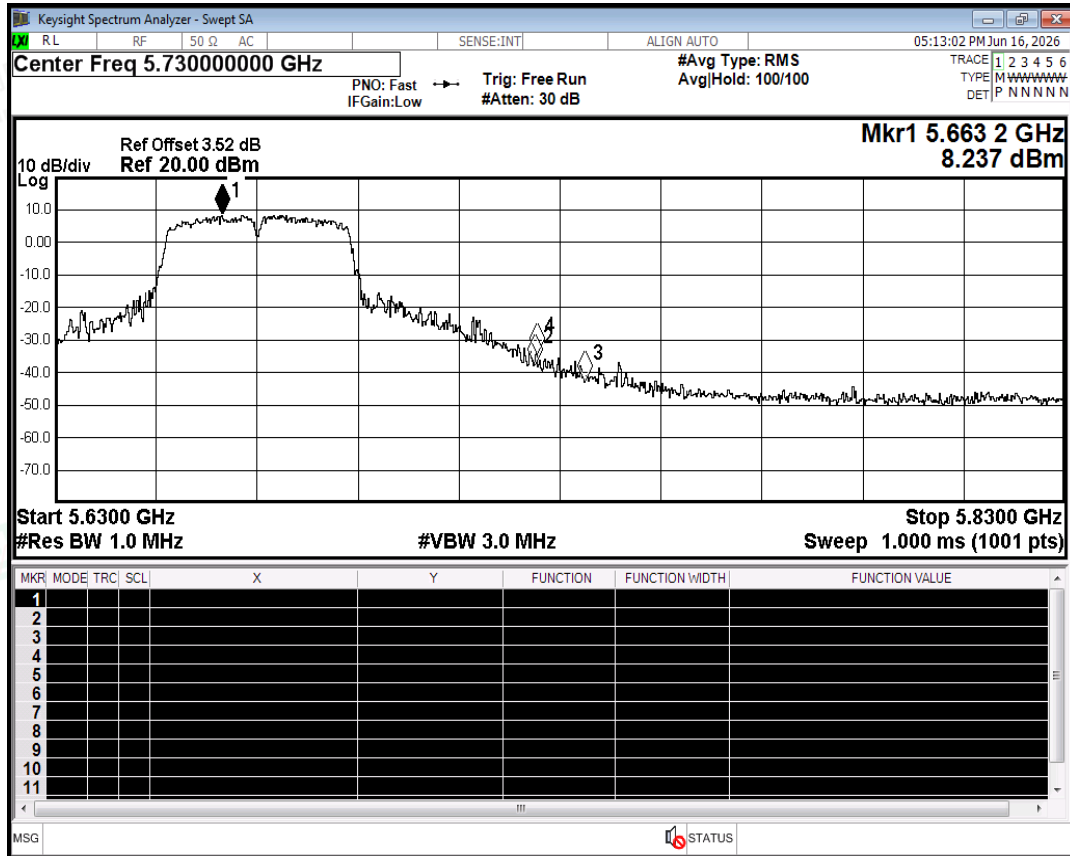

Restrict Band NVNT n40 5670MHz Ant1 Peak

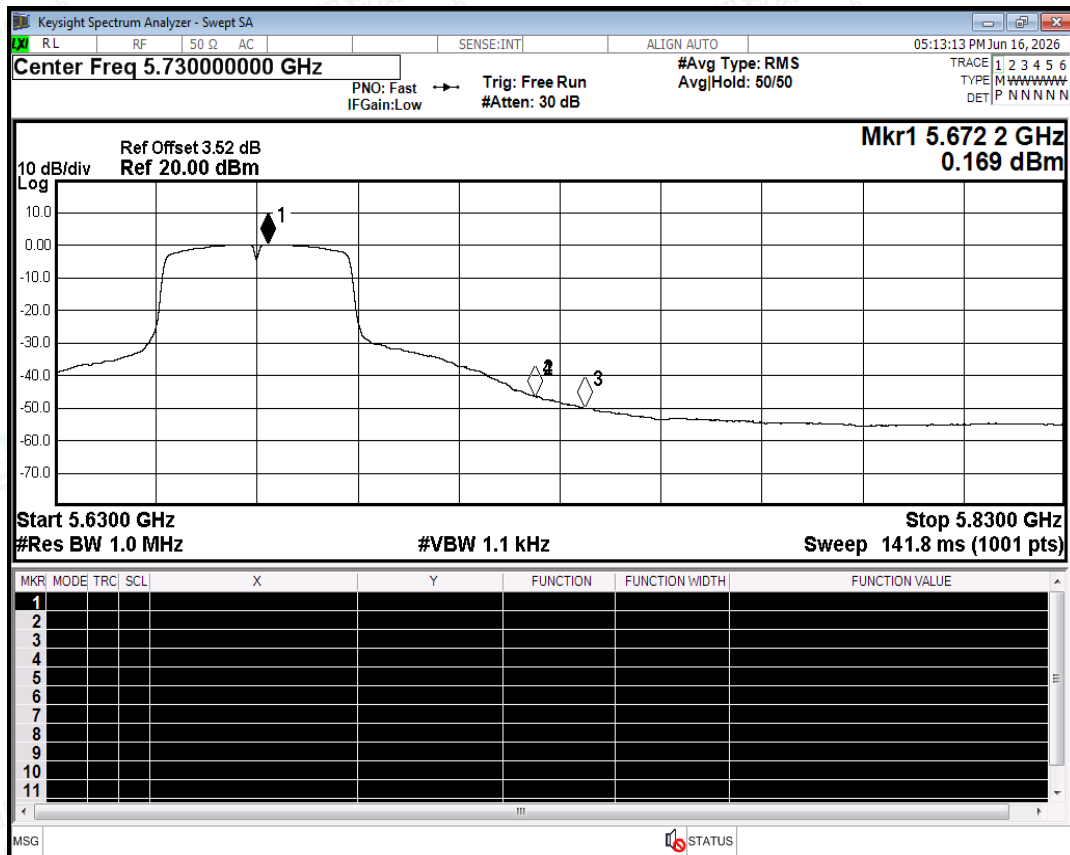

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

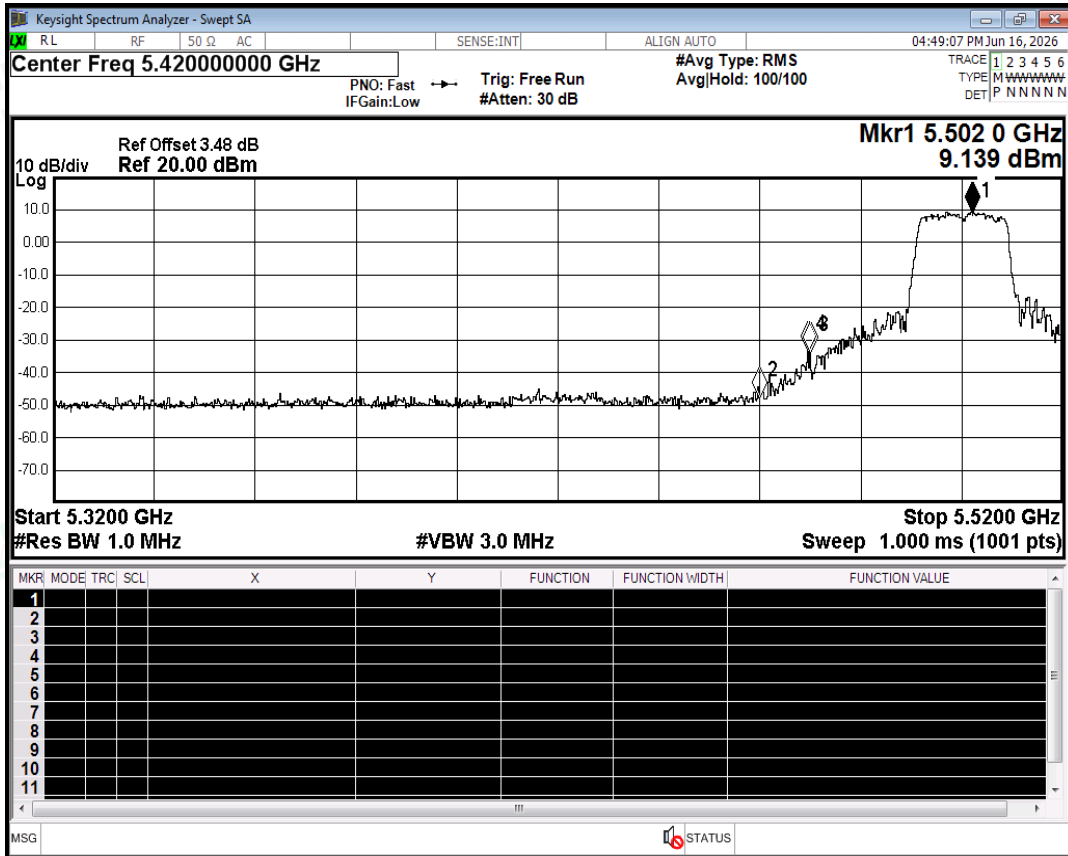

Restrict Band NVNT ac20 5500MHz Ant1 Peak

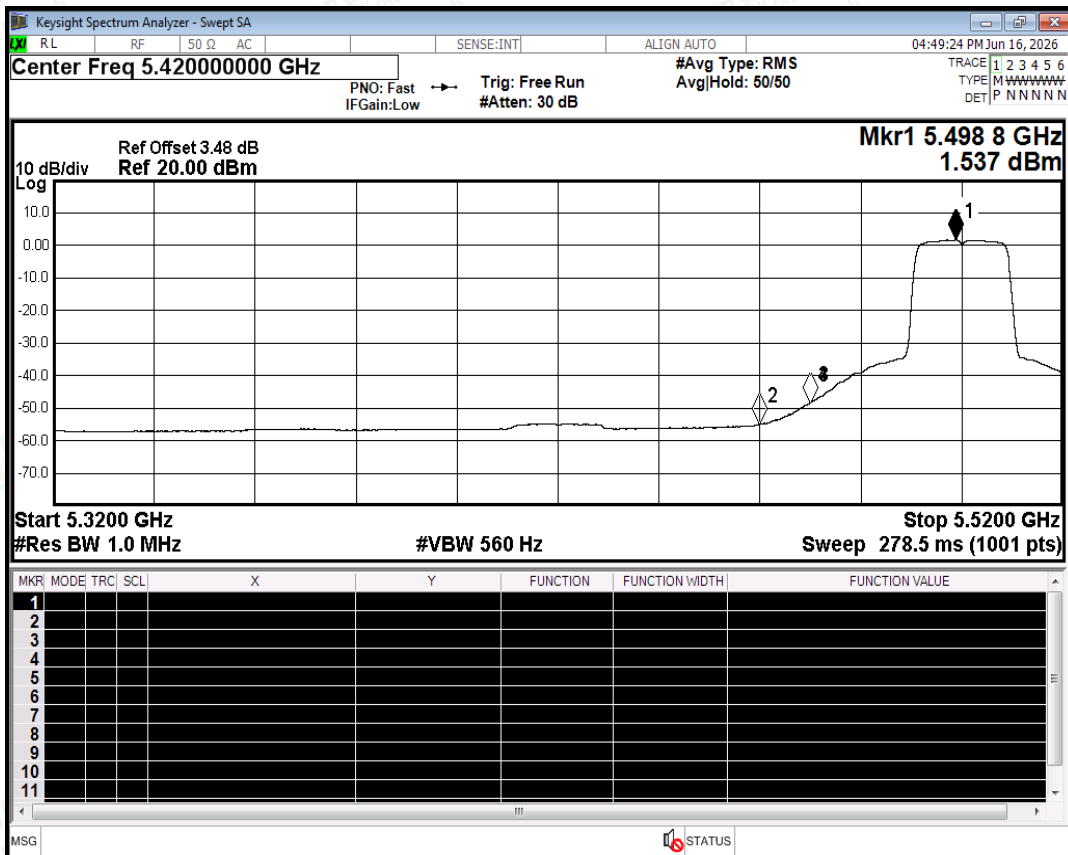

Restrict Band NVNT ac20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

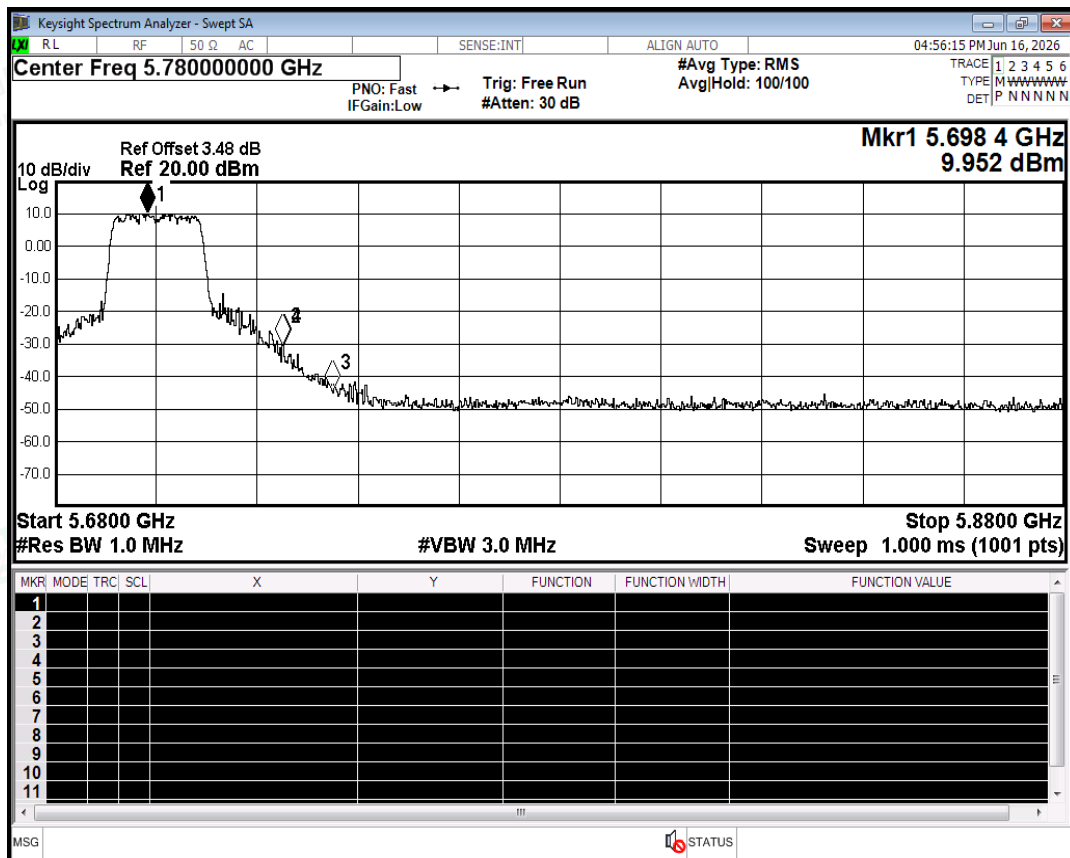

Restrict Band NVNT ac20 5700MHz Ant1 Peak

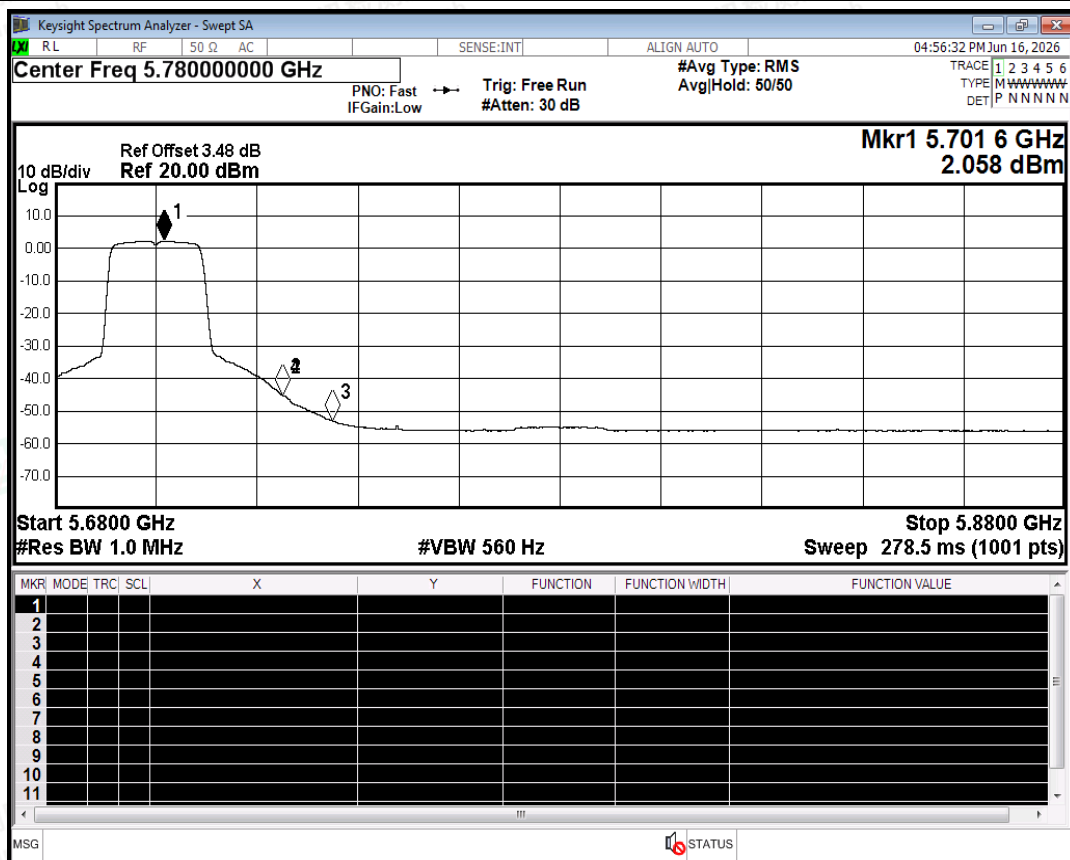

Restrict Band NVNT ac20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

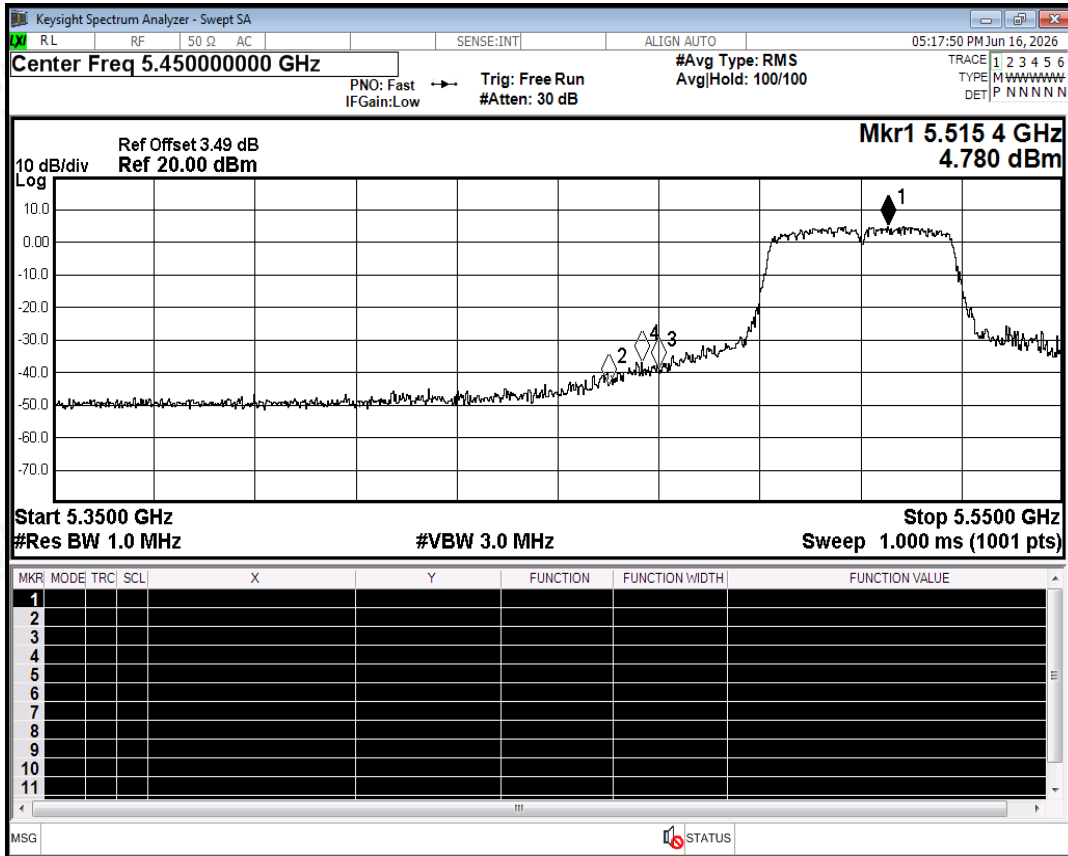

Restrict Band NVNT ac40 5510MHz Ant1 Peak

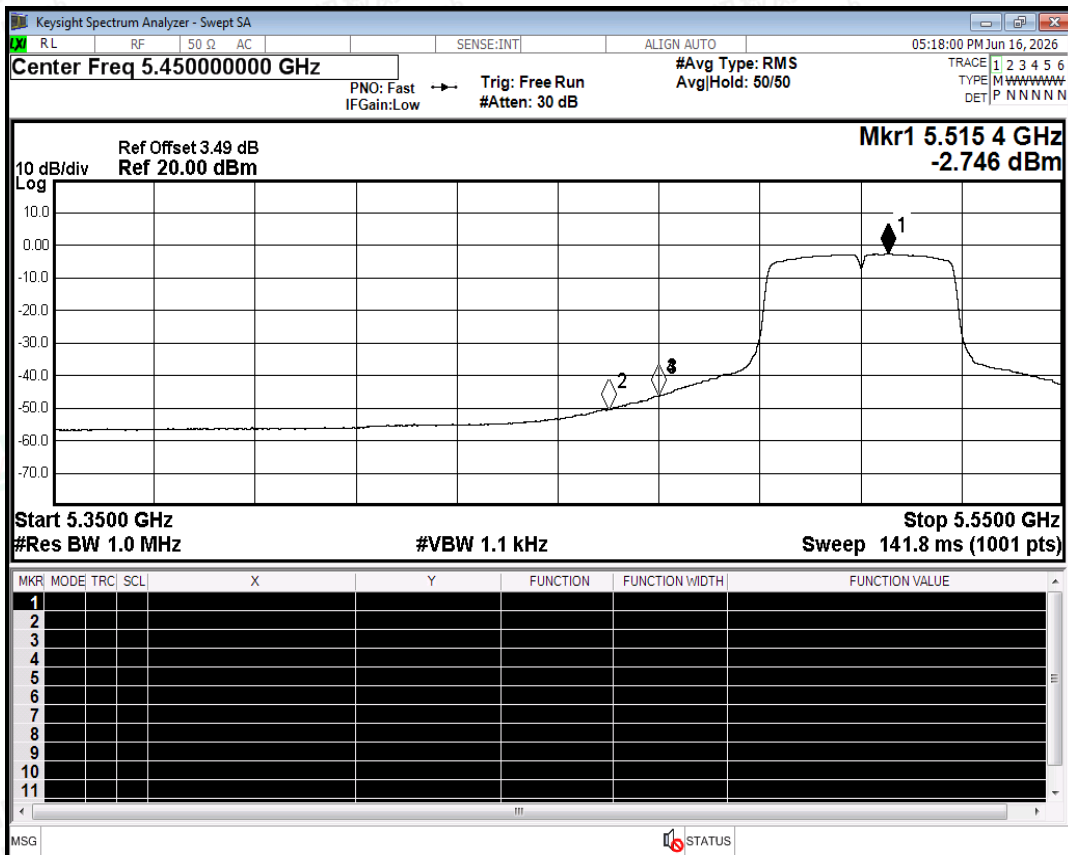

Restrict Band NVNT ac40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

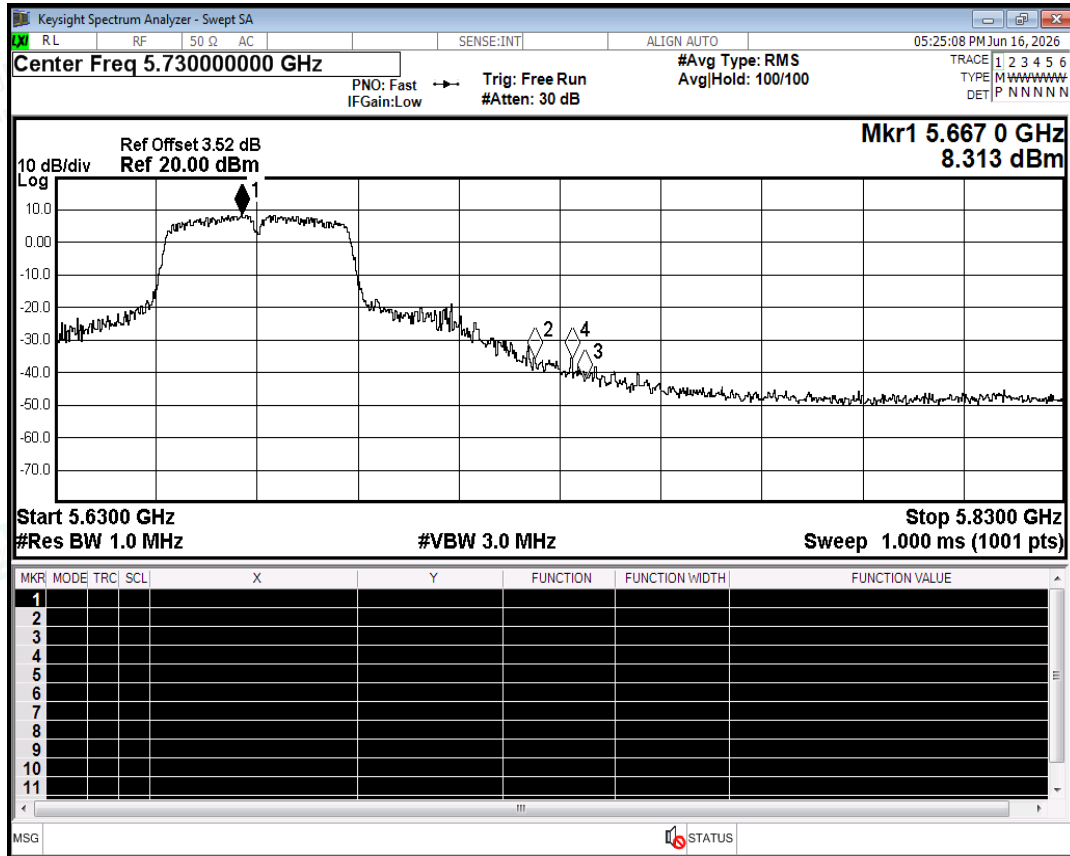

Restrict Band NVNT ac40 5670MHz Ant1 Peak

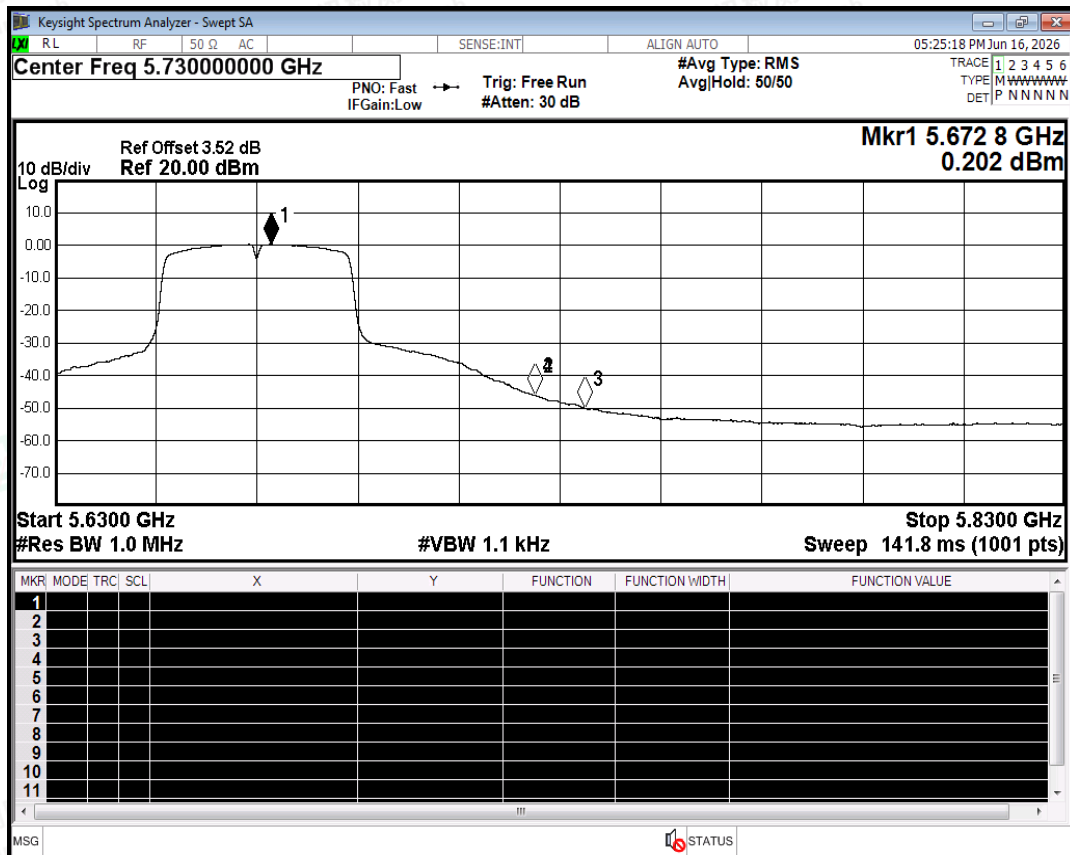

Restrict Band NVNT ac40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

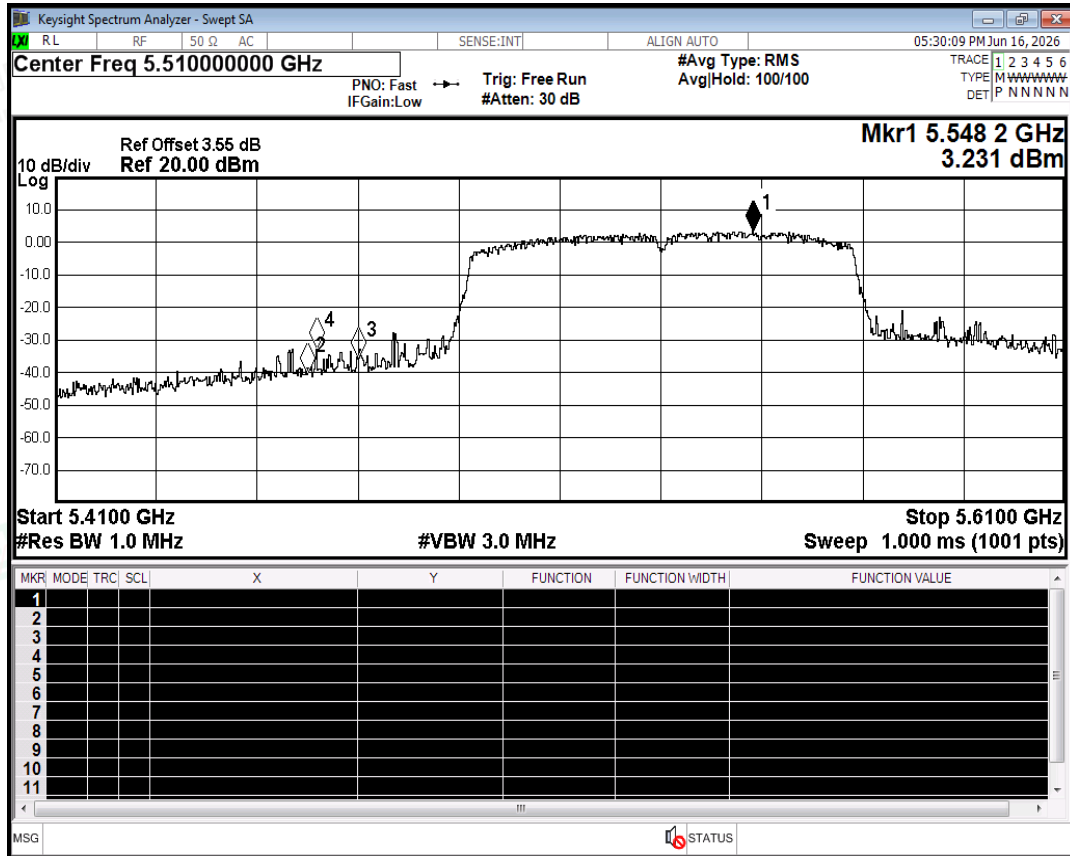

Restrict Band NVNT ac80 5530MHz Ant1 Peak

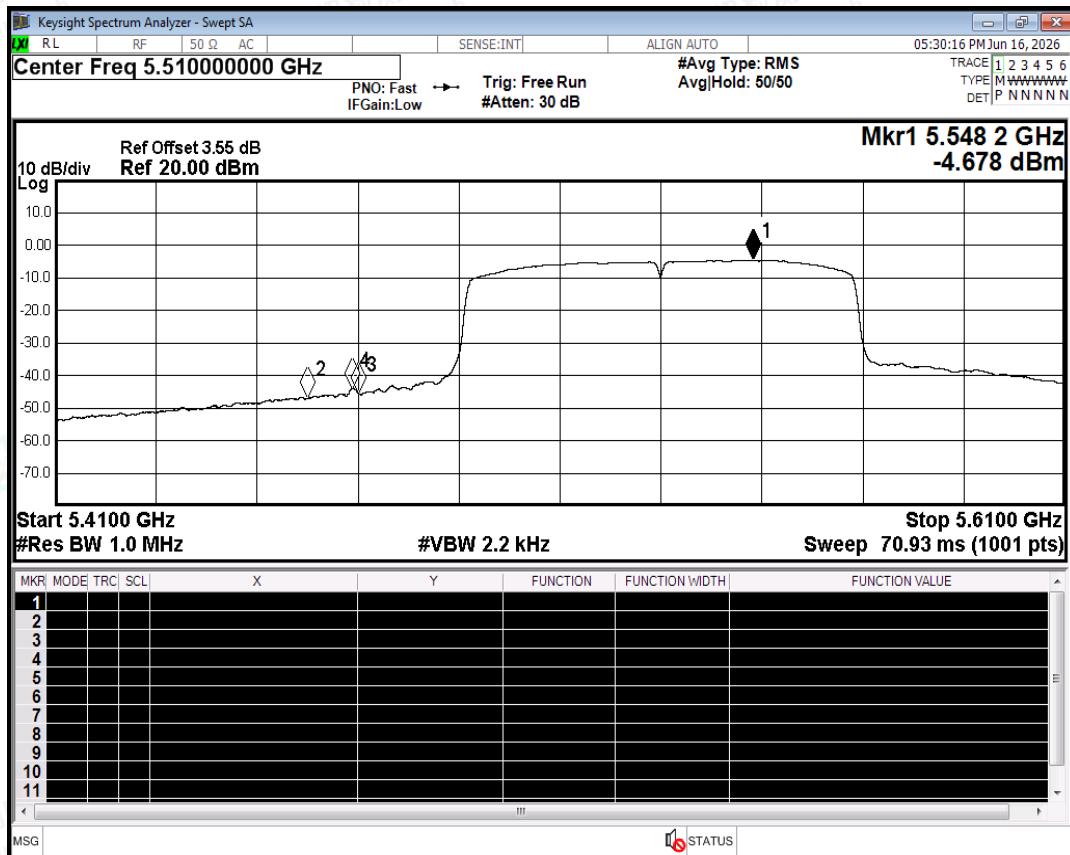

Restrict Band NVNT ac80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

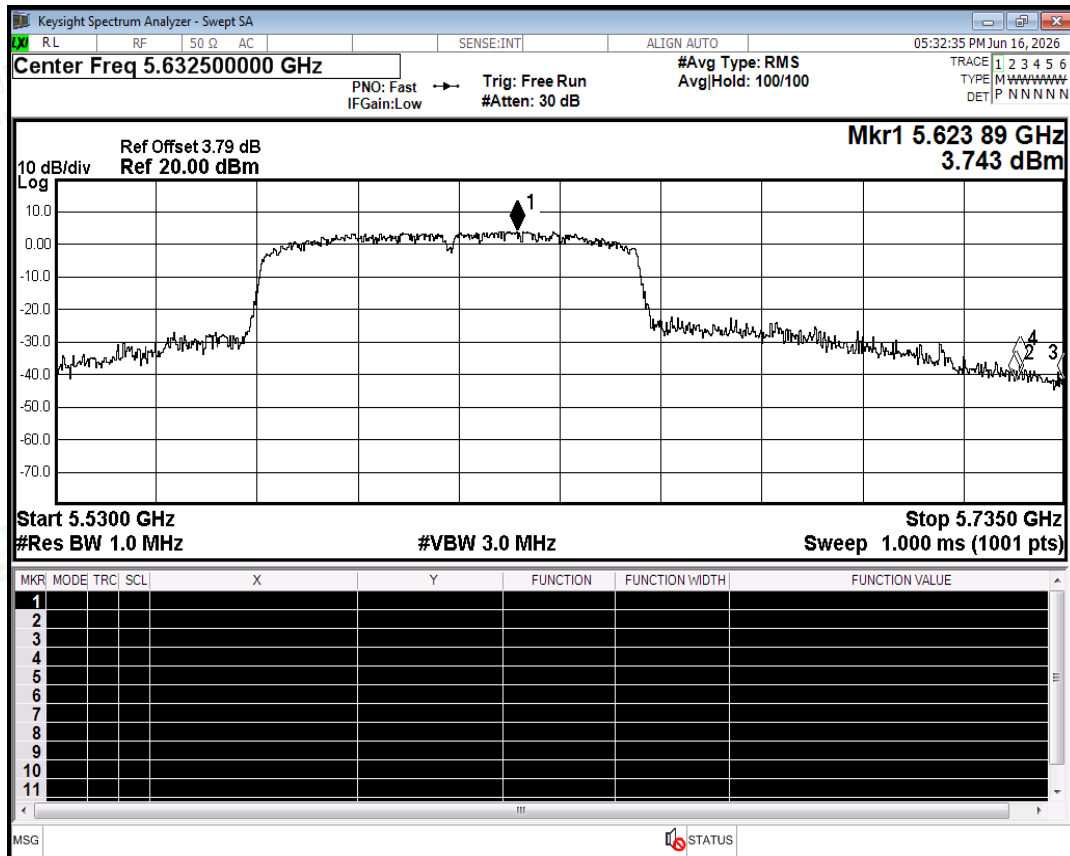

Restrict Band NVNT ac80 5610MHz Ant1 Peak

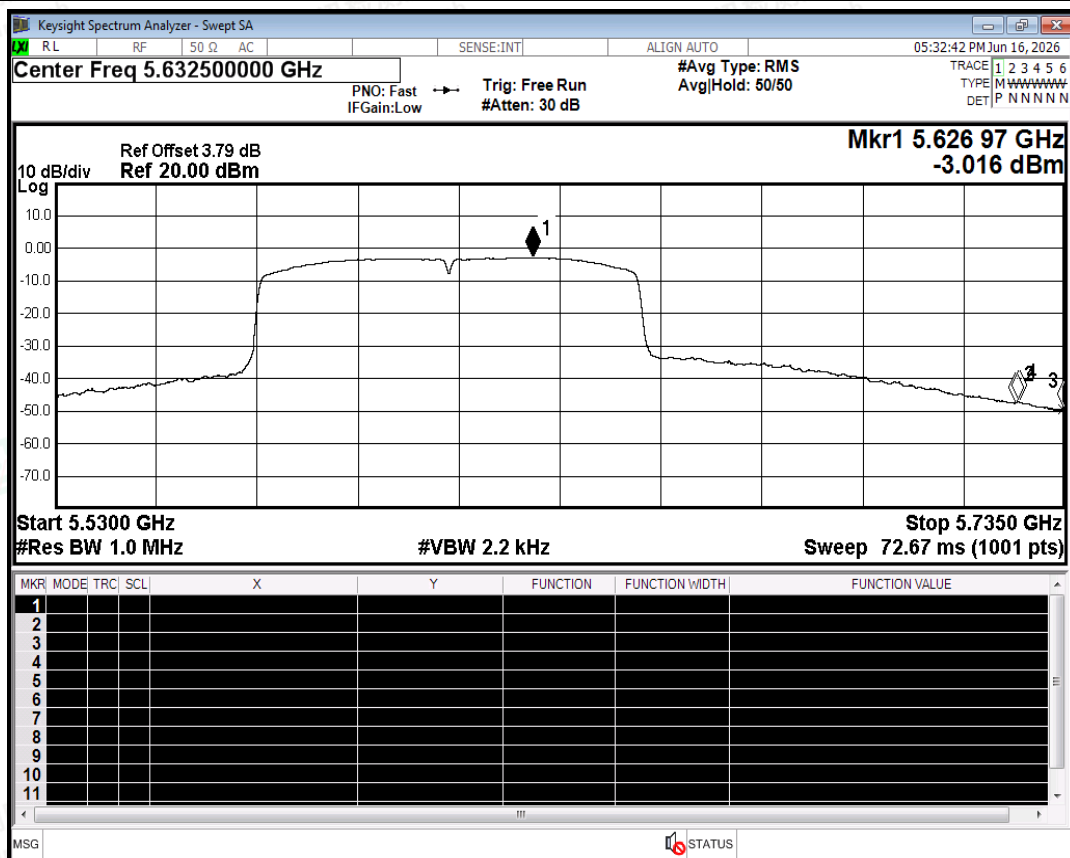

Restrict Band NVNT ac80 5610MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Ant0 Power (dBm)	Ant1 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	-48.99	-42.05	6.04	60.02	Peak	68.2	Pass
NVNT	n20	5500	-55.57	-53.16	6.04	50.08	Average	54	Pass
NVNT	n20	5500	-45.55	-50.00	6.04	57.05	Peak	68.2	Pass
NVNT	n20	5500	-49.00	-54.92	6.04	53.26	Average	54	Pass
NVNT	n20	5500	-40.14	-35.99	6.04	66.69	Peak	68.2	Pass
NVNT	n20	5500	-48.98	-55.06	6.04	53.24	Average	54	Pass
NVNT	n20	5700	-35.74	-37.08	6.04	67.92	Peak	68.2	Pass
NVNT	n20	5700	-54.49	-56.46	6.04	48.91	Average	54	Pass
NVNT	n20	5700	-43.21	-43.48	6.04	60.93	Peak	68.2	Pass
NVNT	n20	5700	-54.33	-56.41	6.04	49.03	Average	54	Pass
NVNT	n20	5700	-45.20	-44.19	6.04	59.61	Peak	68.2	Pass
NVNT	n20	5700	-52.96	-54.23	6.04	50.73	Average	54	Pass
NVNT	n40	5510	-44.79	-42.96	6.04	60.50	Peak	68.2	Pass
NVNT	n40	5510	-51.67	-50.81	6.04	53.06	Average	54	Pass
NVNT	n40	5510	-44.50	-46.74	6.04	58.80	Peak	68.2	Pass
NVNT	n40	5510	-57.46	-56.80	6.04	47.16	Average	54	Pass
NVNT	n40	5510	-39.12	-41.08	6.04	64.29	Peak	68.2	Pass
NVNT	n40	5510	-57.54	-56.79	6.04	47.13	Average	54	Pass
NVNT	n40	5670	-37.98	-37.93	6.04	66.32	Peak	68.2	Pass
NVNT	n40	5670	-56.55	-56.77	6.04	47.62	Average	54	Pass
NVNT	n40	5670	-37.12	-44.63	6.04	64.86	Peak	68.2	Pass
NVNT	n40	5670	-56.43	-56.76	6.04	47.69	Average	54	Pass
NVNT	n40	5670	-42.17	-43.19	6.04	61.63	Peak	68.2	Pass
NVNT	n40	5670	-50.50	-55.36	6.04	51.99	Average	54	Pass
NVNT	ac20	5500	-48.81	-48.20	6.04	55.78	Peak	68.2	Pass
NVNT	ac20	5500	-56.08	-55.30	6.04	48.61	Average	54	Pass
NVNT	ac20	5500	-39.94	-43.92	6.04	62.79	Peak	68.2	Pass
NVNT	ac20	5500	-52.05	-58.67	6.04	50.07	Average	54	Pass
NVNT	ac20	5500	-43.22	-34.38	6.04	67.42	Peak	68.2	Pass
NVNT	ac20	5500	-52.20	-58.68	6.04	49.95	Average	54	Pass
NVNT	ac20	5700	-38.21	-40.61	6.04	65.03	Peak	68.2	Pass
NVNT	ac20	5700	-58.50	-55.52	6.04	47.52	Average	54	Pass
NVNT	ac20	5700	-46.33	-40.44	6.04	61.82	Peak	68.2	Pass
NVNT	ac20	5700	-58.61	-55.36	6.04	47.59	Average	54	Pass
NVNT	ac20	5700	-47.01	-44.76	6.04	58.54	Peak	68.2	Pass
NVNT	ac20	5700	-54.73	-53.31	6.04	50.32	Average	54	Pass
NVNT	ac40	5510	-40.88	-44.19	6.04	62.05	Peak	68.2	Pass
NVNT	ac40	5510	-49.59	-55.79	6.04	52.61	Average	54	Pass
NVNT	ac40	5510	-42.79	-47.10	6.04	59.85	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	-55.56	-56.63	6.04	48.22	Average	54	Pass
NVNT	ac40	5510	-36.78	-39.10	6.04	66.49	Peak	68.2	Pass
NVNT	ac40	5510	-55.52	-56.64	6.04	48.23	Average	54	Pass
NVNT	ac40	5670	-36.20	-46.00	6.04	65.50	Peak	68.2	Pass
NVNT	ac40	5670	-55.00	-56.35	6.04	48.66	Average	54	Pass
NVNT	ac40	5670	-41.00	-45.81	6.04	61.51	Peak	68.2	Pass
NVNT	ac40	5670	-55.01	-56.22	6.04	48.70	Average	54	Pass
NVNT	ac40	5670	-39.94	-42.84	6.04	63.13	Peak	68.2	Pass
NVNT	ac40	5670	-49.00	-55.32	6.04	53.18	Average	54	Pass
NVNT	ac80	5530	-36.07	-40.84	6.04	66.45	Peak	68.2	Pass
NVNT	ac80	5530	-56.08	-57.33	6.04	47.62	Average	54	Pass
NVNT	ac80	5530	-51.35	-43.13	6.04	58.75	Peak	68.2	Pass
NVNT	ac80	5530	-53.61	-54.37	6.04	50.30	Average	54	Pass
NVNT	ac80	5530	-35.72	-46.07	6.04	65.93	Peak	68.2	Pass
NVNT	ac80	5530	-53.58	-55.68	6.04	49.77	Average	54	Pass
NVNT	ac80	5610	-40.70	-42.07	6.04	62.95	Peak	68.2	Pass
NVNT	ac80	5610	-57.17	-57.78	6.04	46.81	Average	54	Pass
NVNT	ac80	5610	-36.52	-37.92	6.04	67.11	Peak	68.2	Pass
NVNT	ac80	5610	-57.04	-57.25	6.04	47.13	Average	54	Pass
NVNT	ac80	5610	-37.77	-42.51	6.04	64.75	Peak	68.2	Pass
NVNT	ac80	5610	-48.83	-59.79	6.04	52.77	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant0	5500.06	60000	10.91	25	Pass
NVNT	a	5580	Ant0	5580.06	60000	10.75	25	Pass
NVNT	a	5700	Ant0	5700.04	40000	7.02	25	Pass
NVNT	n20	5500	Ant0	5500	0	0	25	Pass
NVNT	n20	5580	Ant0	5580.02	20000	3.58	25	Pass
NVNT	n20	5700	Ant0	5700	0	0	25	Pass
NVNT	n40	5510	Ant0	5510.04	40000	7.26	25	Pass
NVNT	n40	5550	Ant0	5550.04	40000	7.21	25	Pass
NVNT	n40	5670	Ant0	5670.04	40000	7.05	25	Pass
NVNT	ac20	5500	Ant0	5500.06	60000	10.91	25	Pass
NVNT	ac20	5580	Ant0	5580.04	40000	7.17	25	Pass
NVNT	ac20	5700	Ant0	5700	0	0	25	Pass
NVNT	ac40	5510	Ant0	5510	0	0	25	Pass
NVNT	ac40	5550	Ant0	5550	0	0	25	Pass
NVNT	ac40	5670	Ant0	5670	0	0	25	Pass
NVNT	ac80	5530	Ant0	5530	0	0	25	Pass
NVNT	ac80	5610	Ant0	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

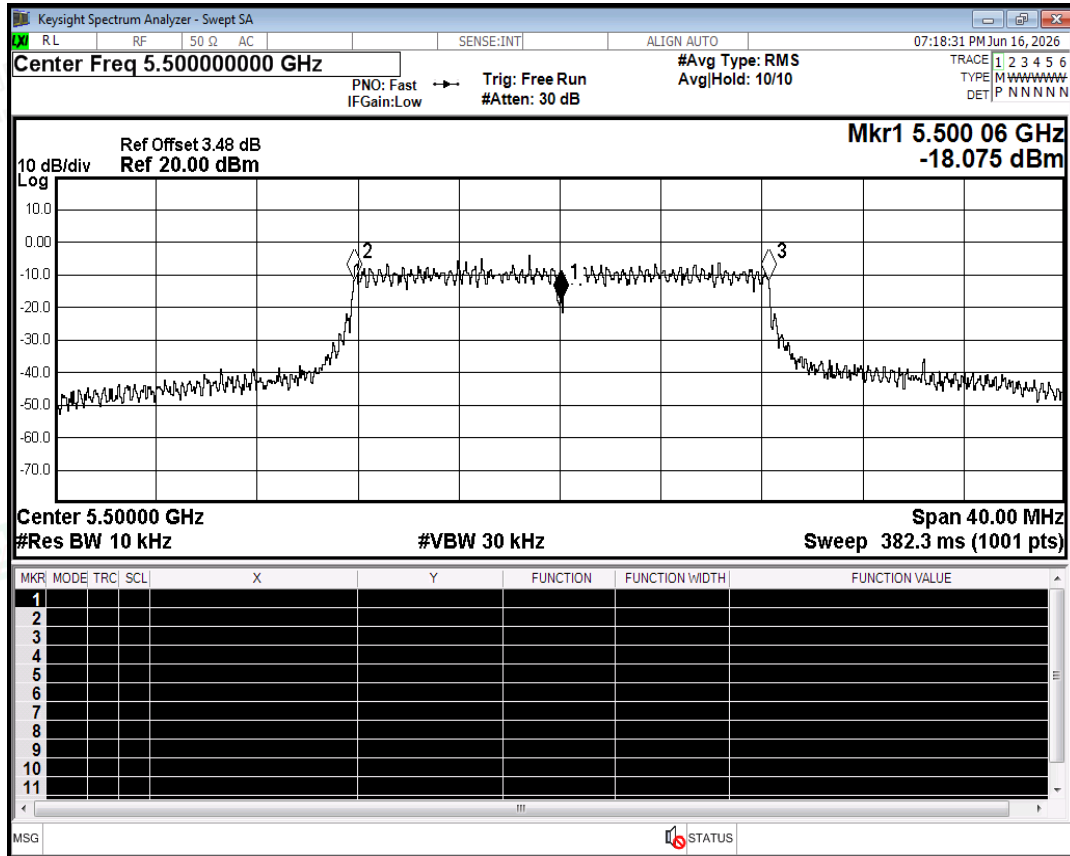

Freq. Stability NVNT a 5500MHz Ant0

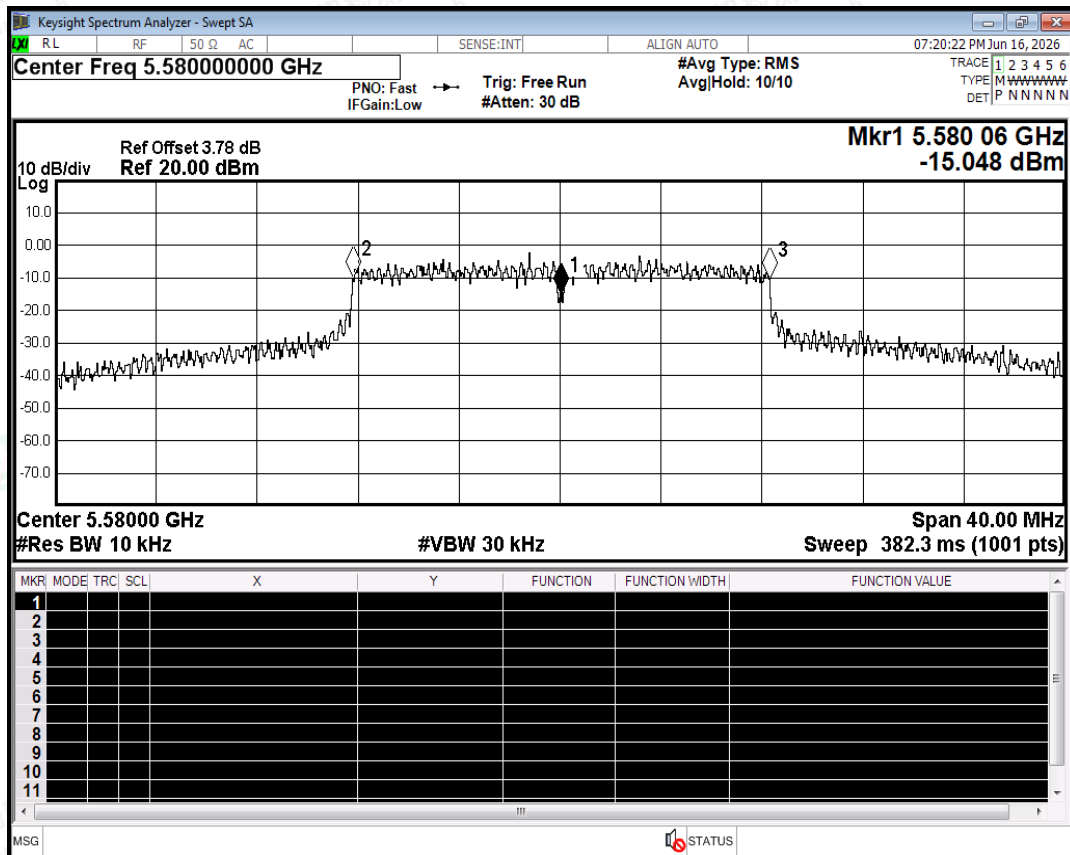

Freq. Stability NVNT a 5580MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

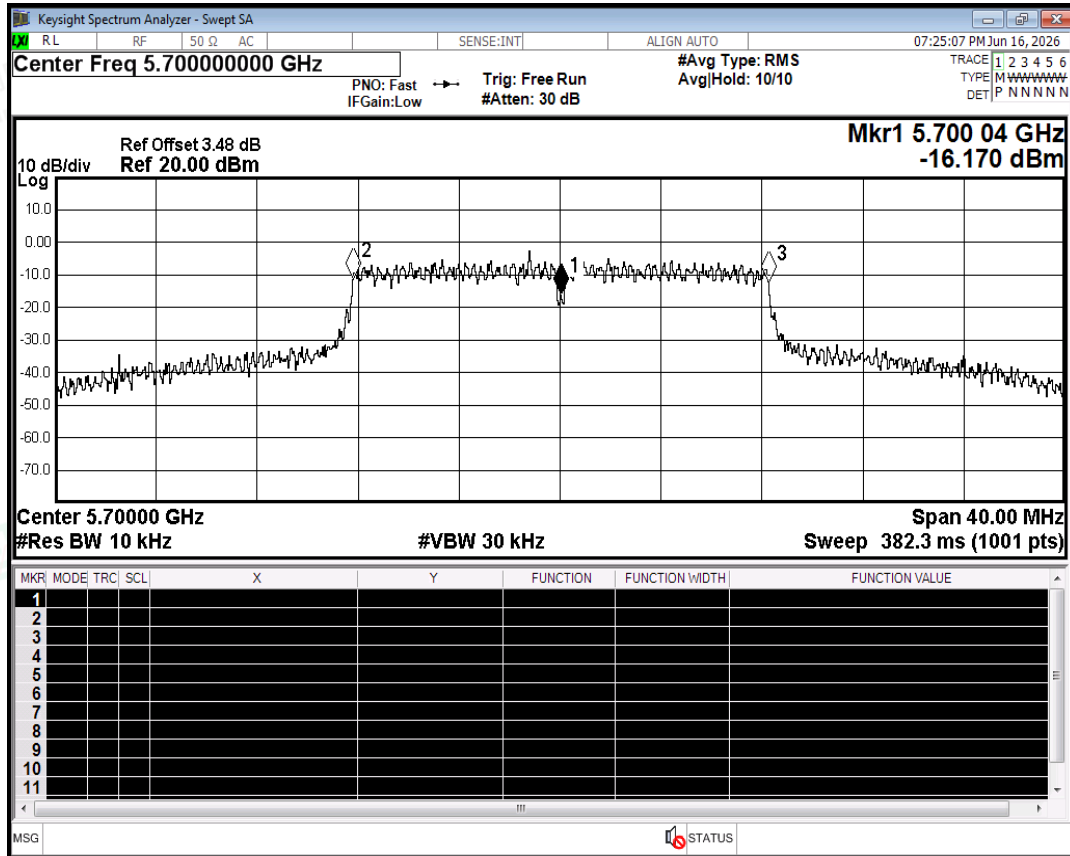

Freq. Stability NVNT a 5700MHz Ant0

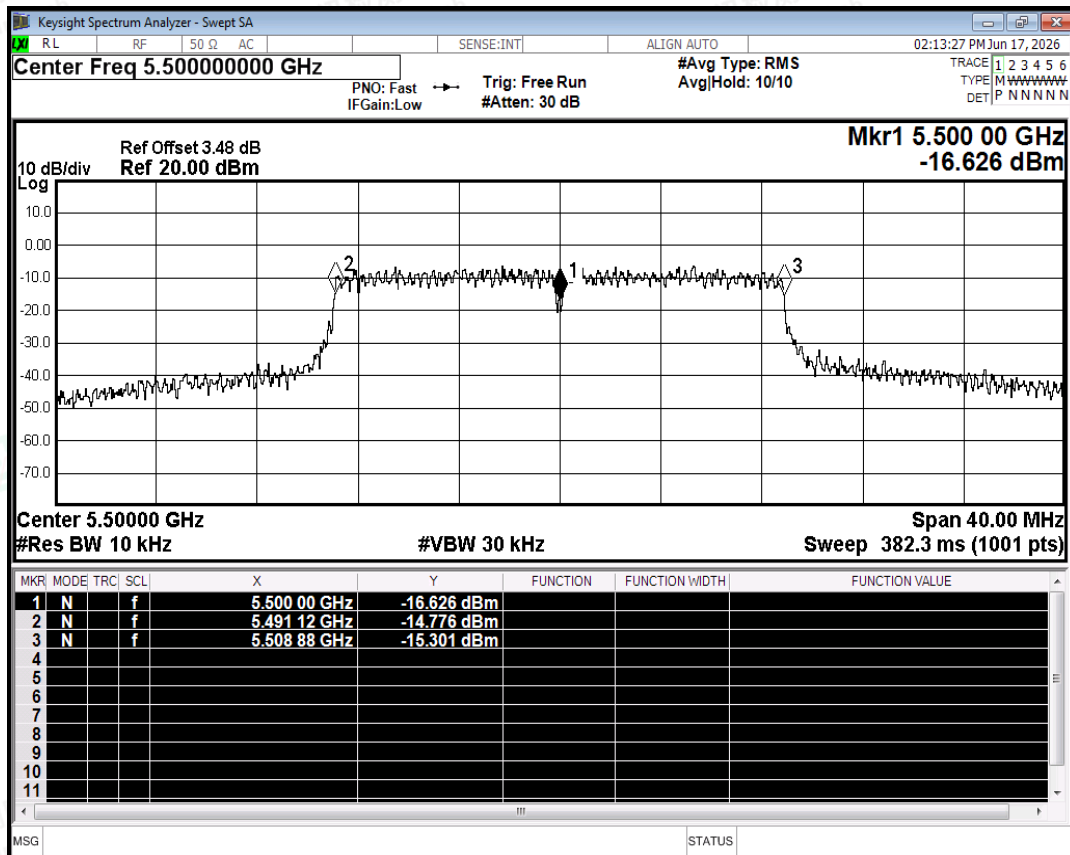

Freq. Stability NVNT n20 5500MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

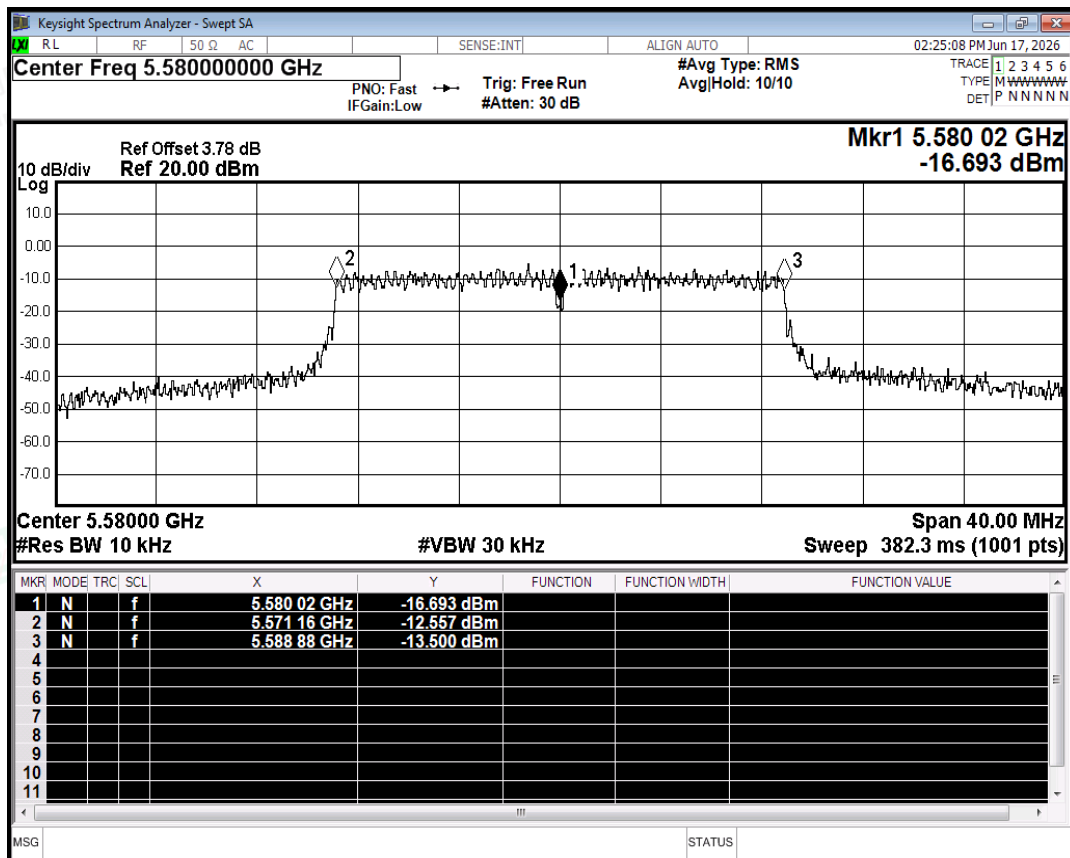

Freq. Stability NVNT n20 5580MHz Ant0

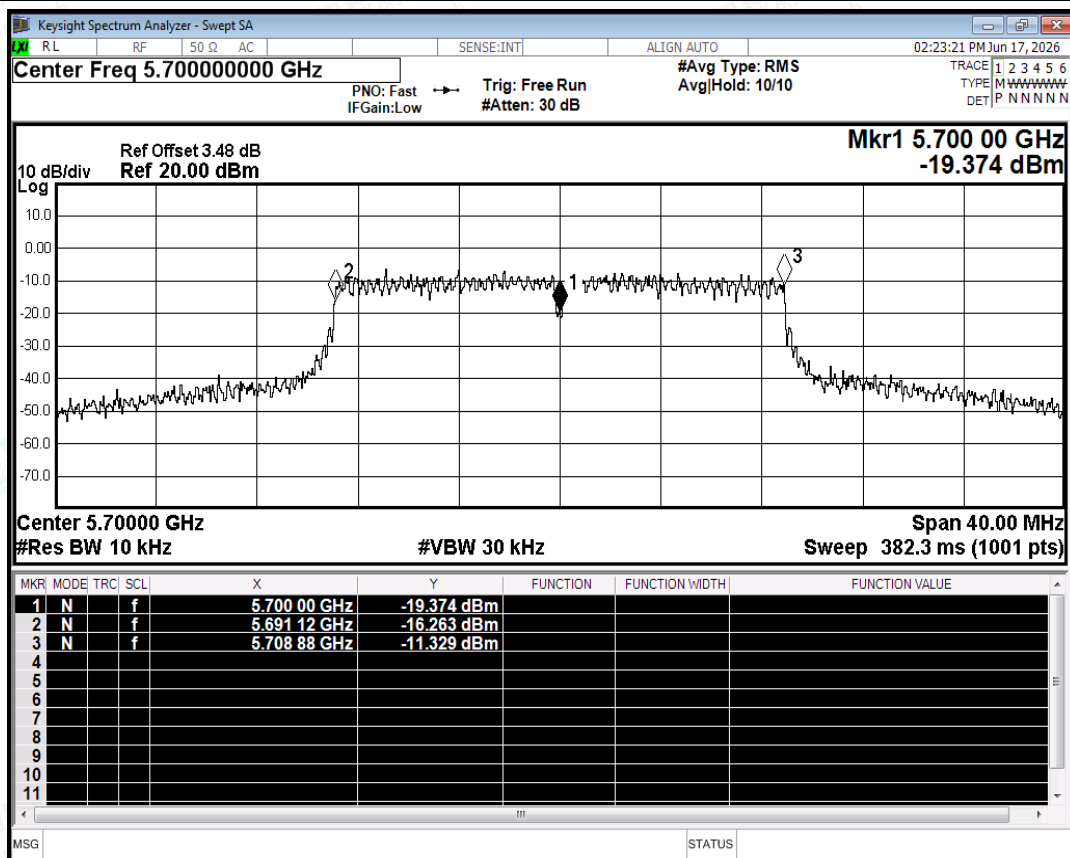

Freq. Stability NVNT n20 5700MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

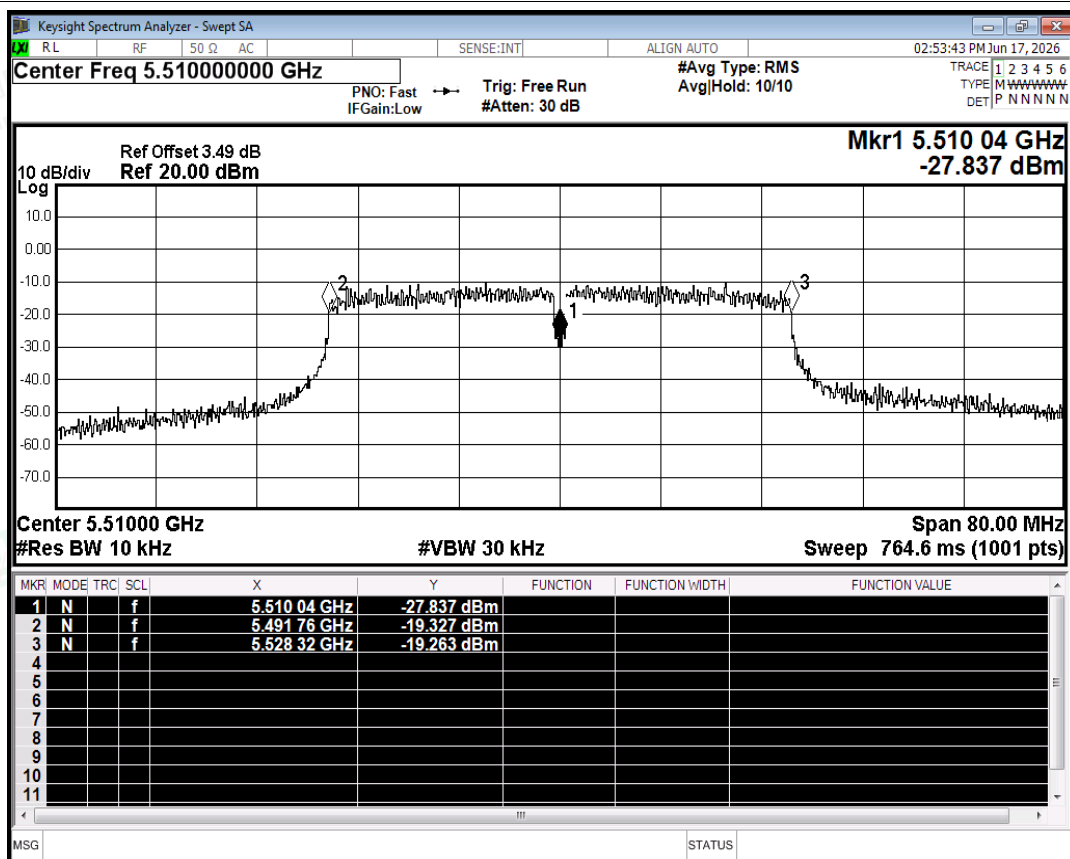

Freq. Stability NVNT n40 5510MHz Ant0

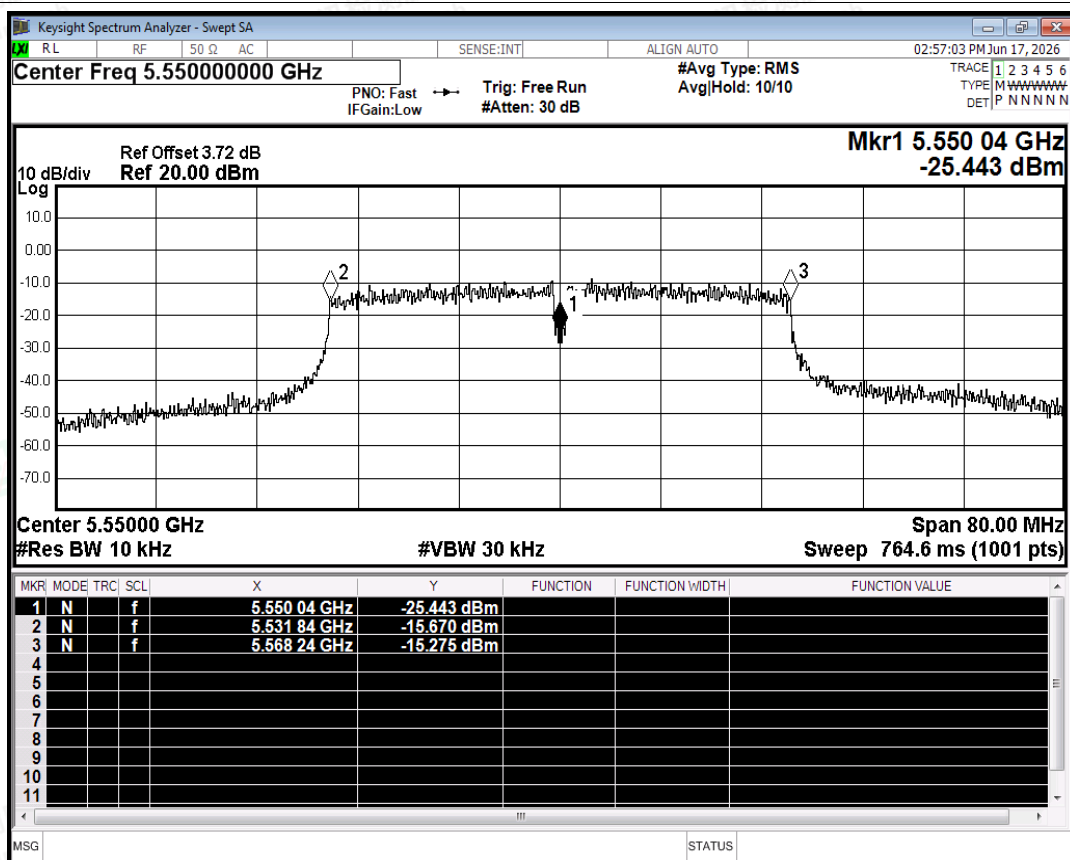

Freq. Stability NVNT n40 5550MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

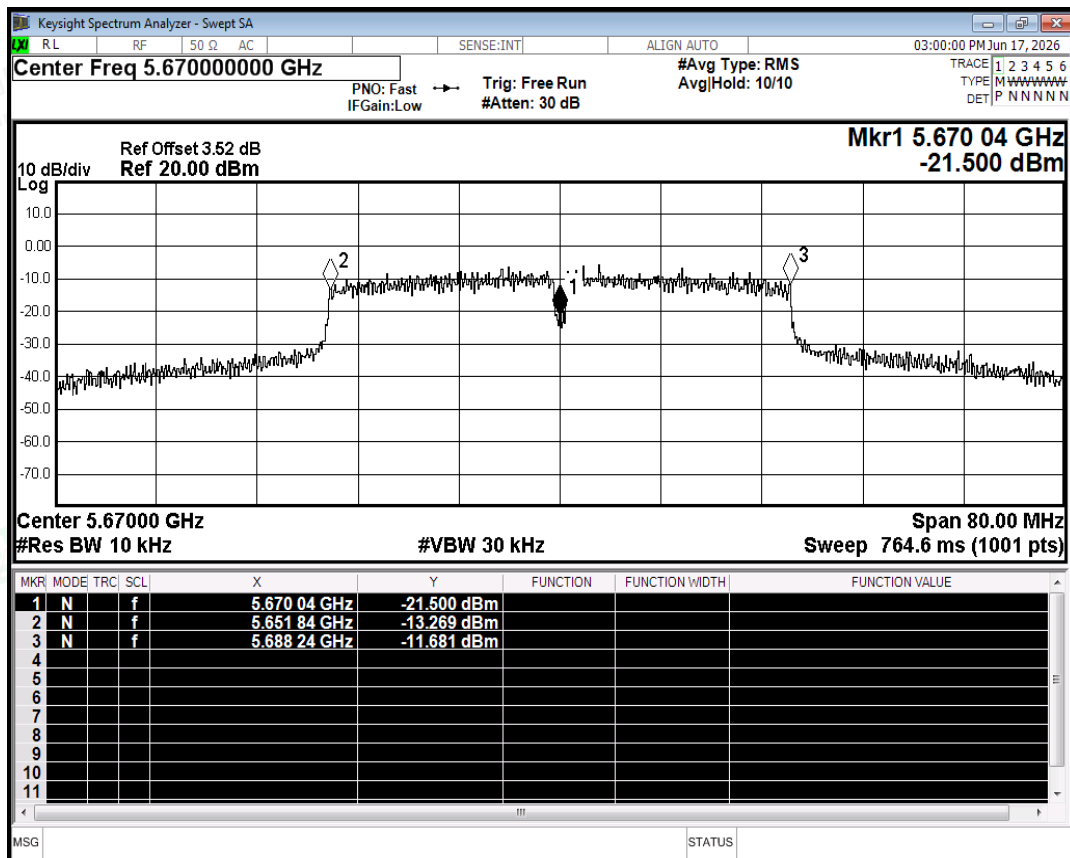

Freq. Stability NVNT n40 5670MHz Ant0

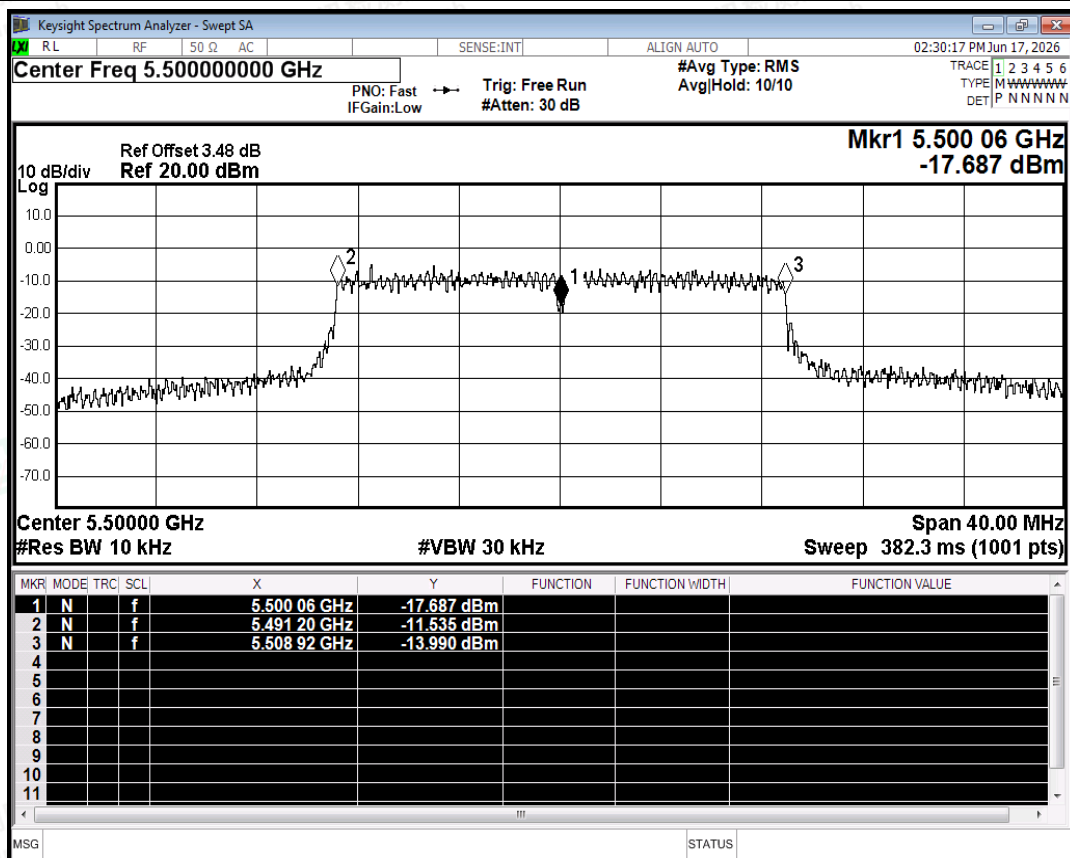

Freq. Stability NVNT ac20 5500MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

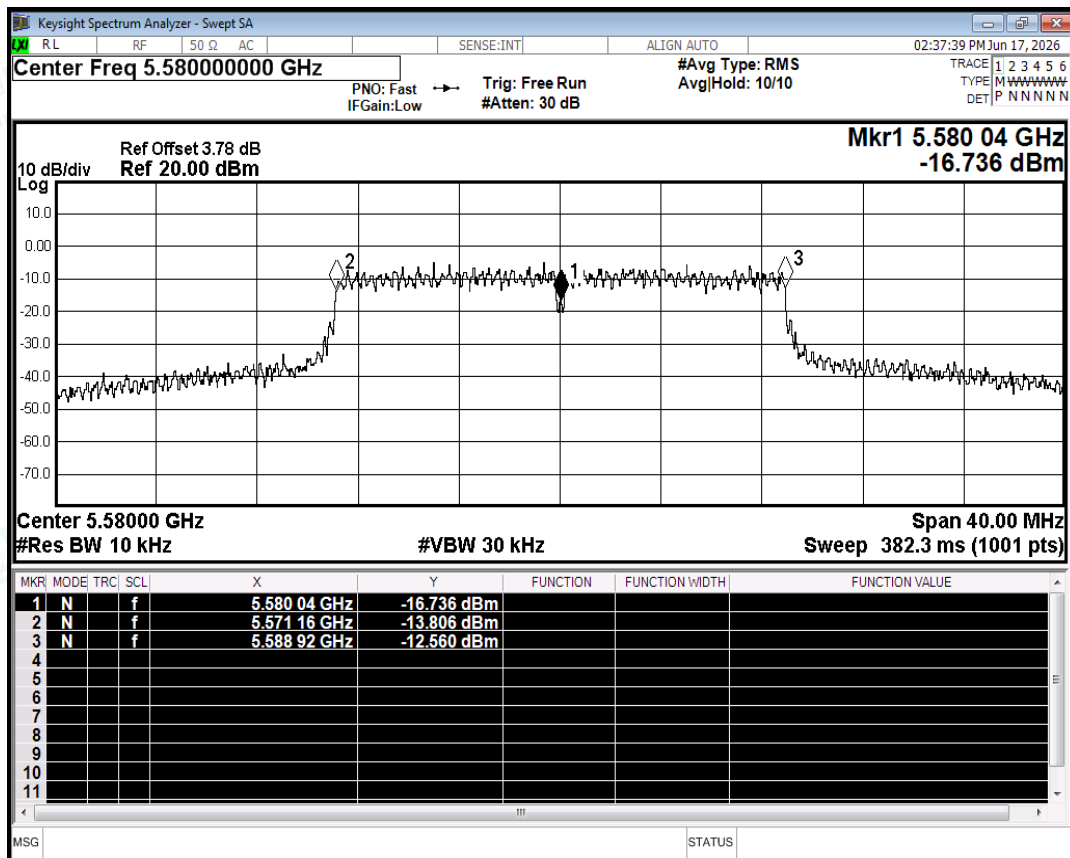

Freq. Stability NVNT ac20 5580MHz Ant0

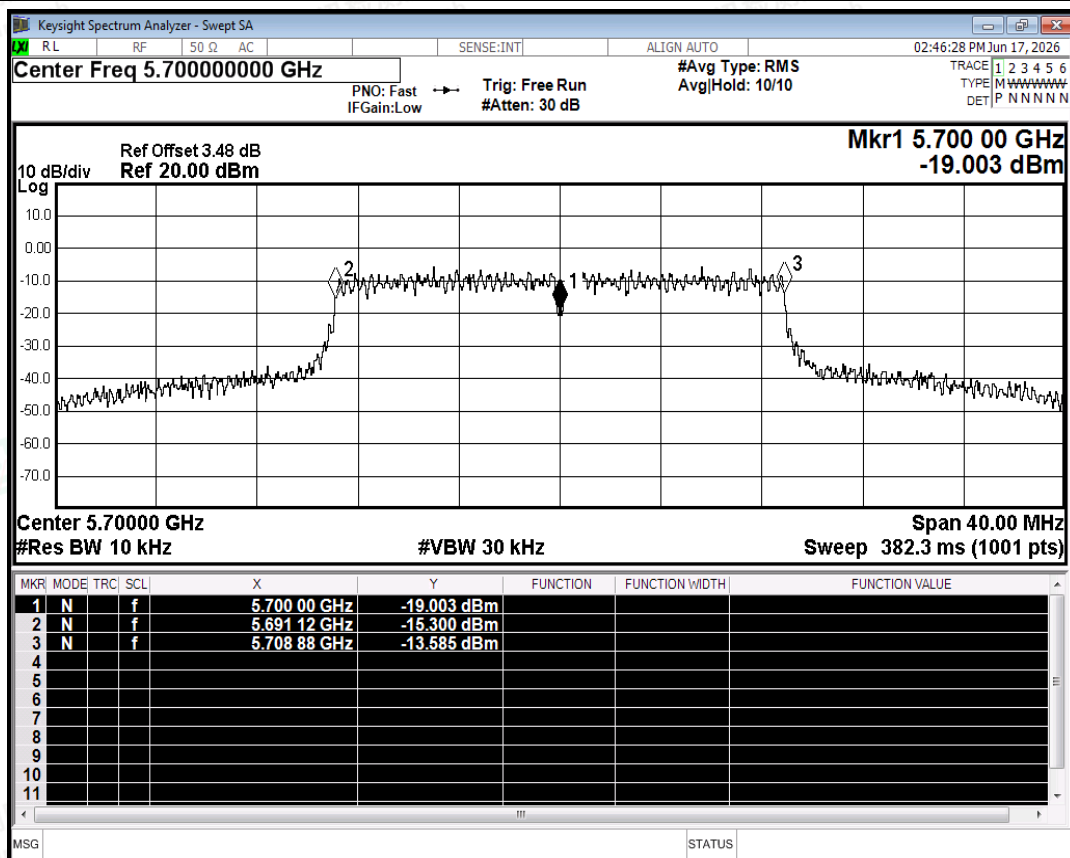

Freq. Stability NVNT ac20 5700MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

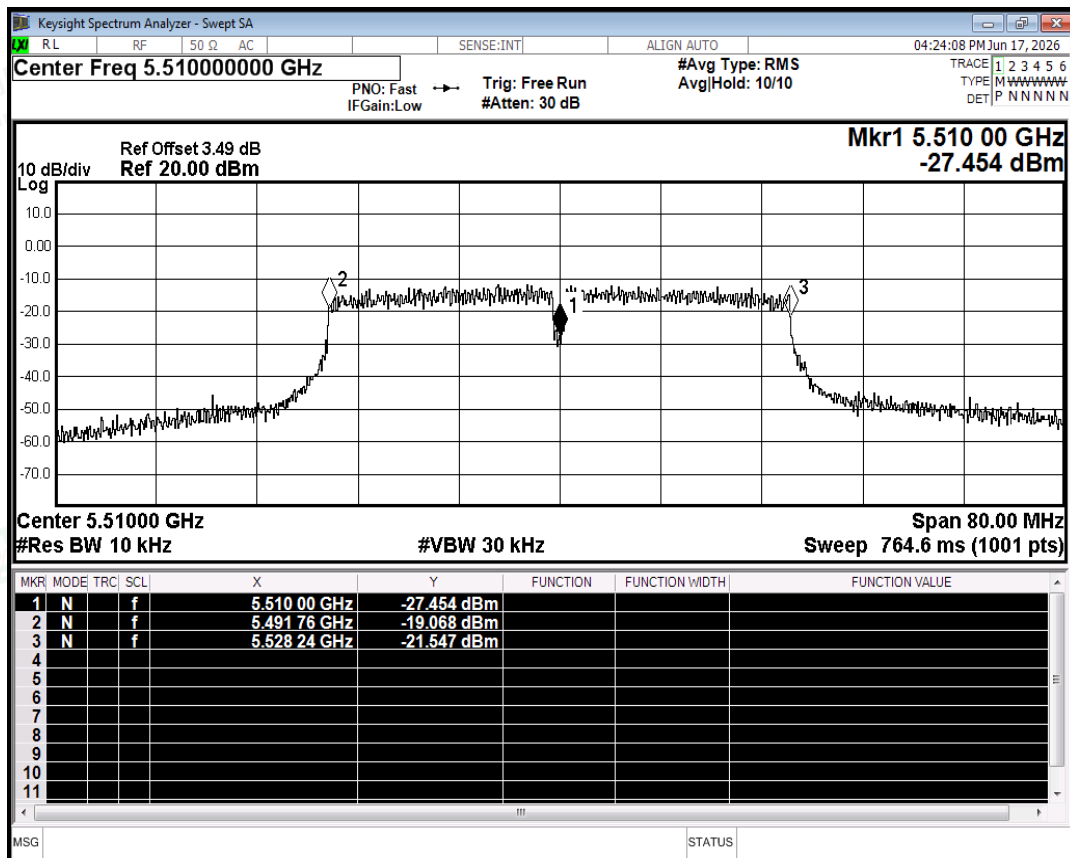

Freq. Stability NVNT ac40 5510MHz Ant0

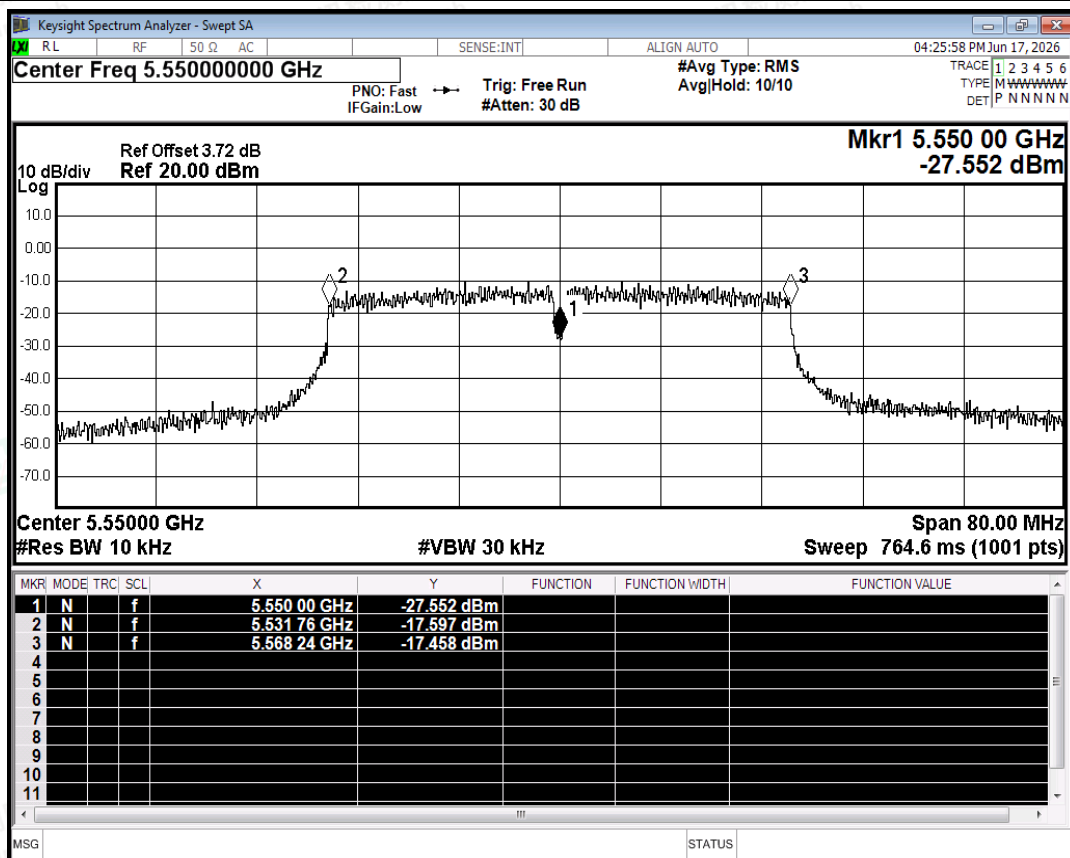

Freq. Stability NVNT ac40 5550MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

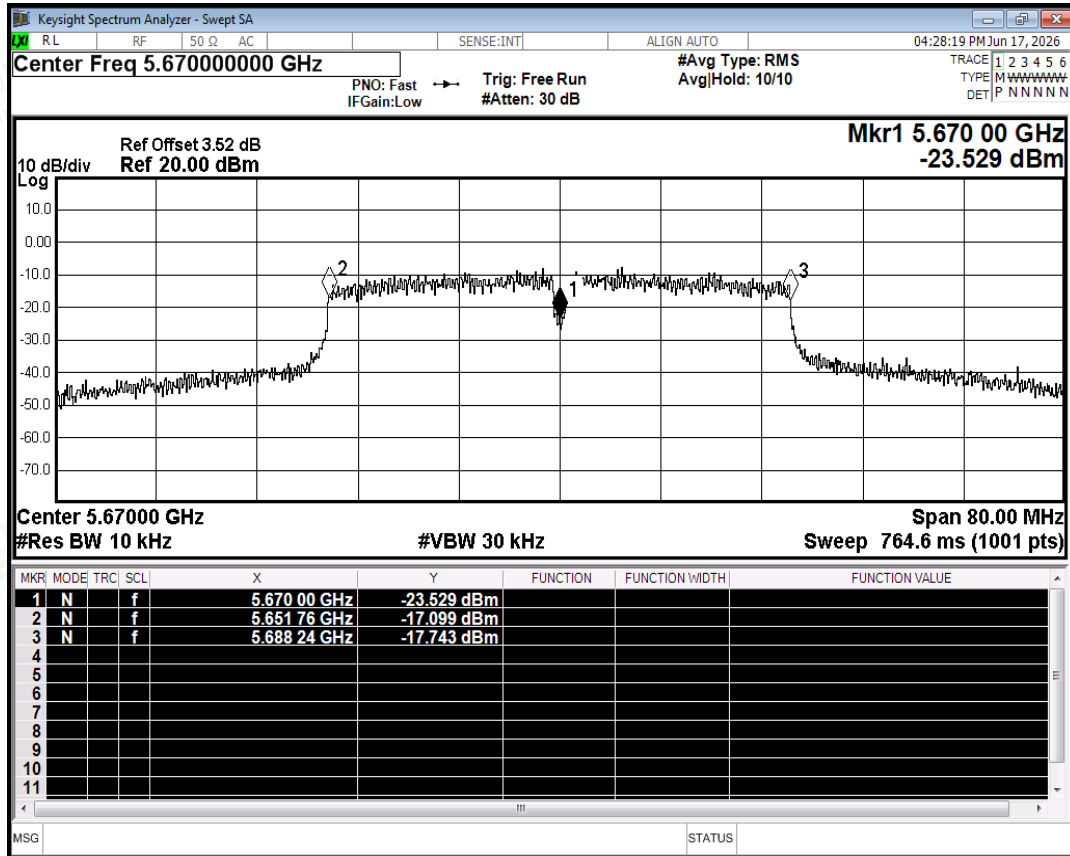

Freq. Stability NVNT ac40 5670MHz Ant0

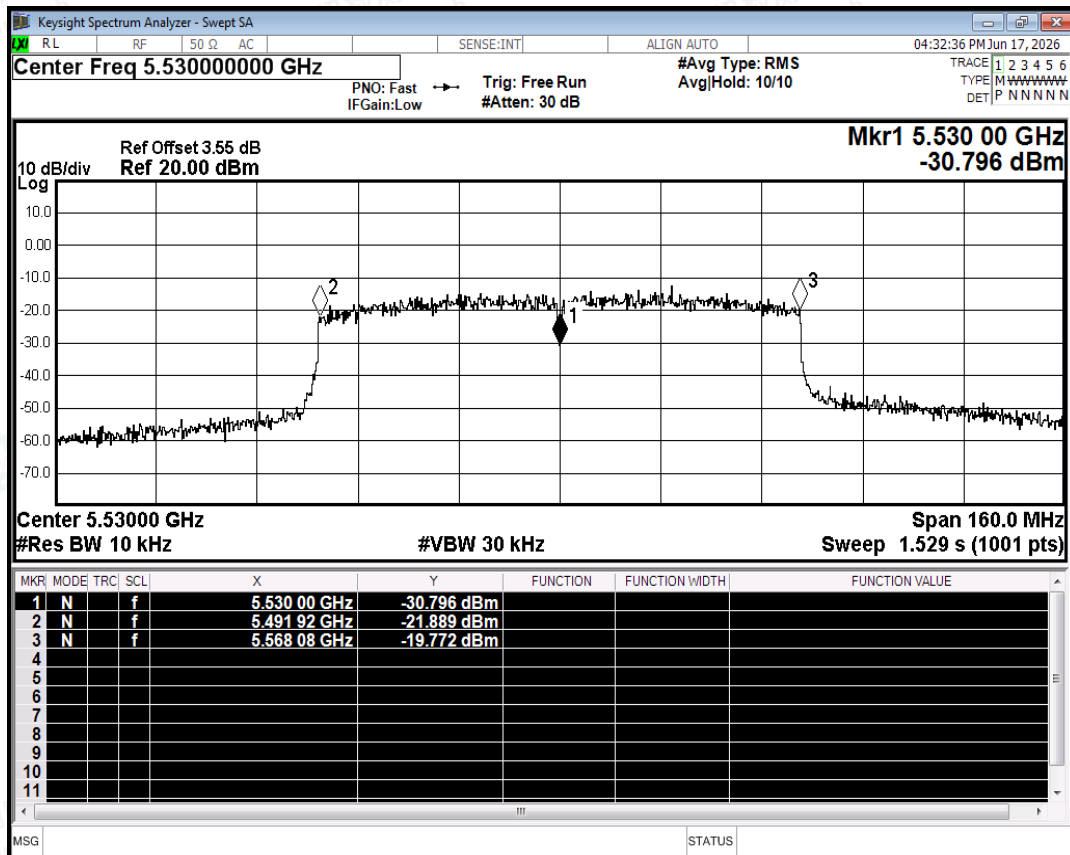

Freq. Stability NVNT ac80 5530MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

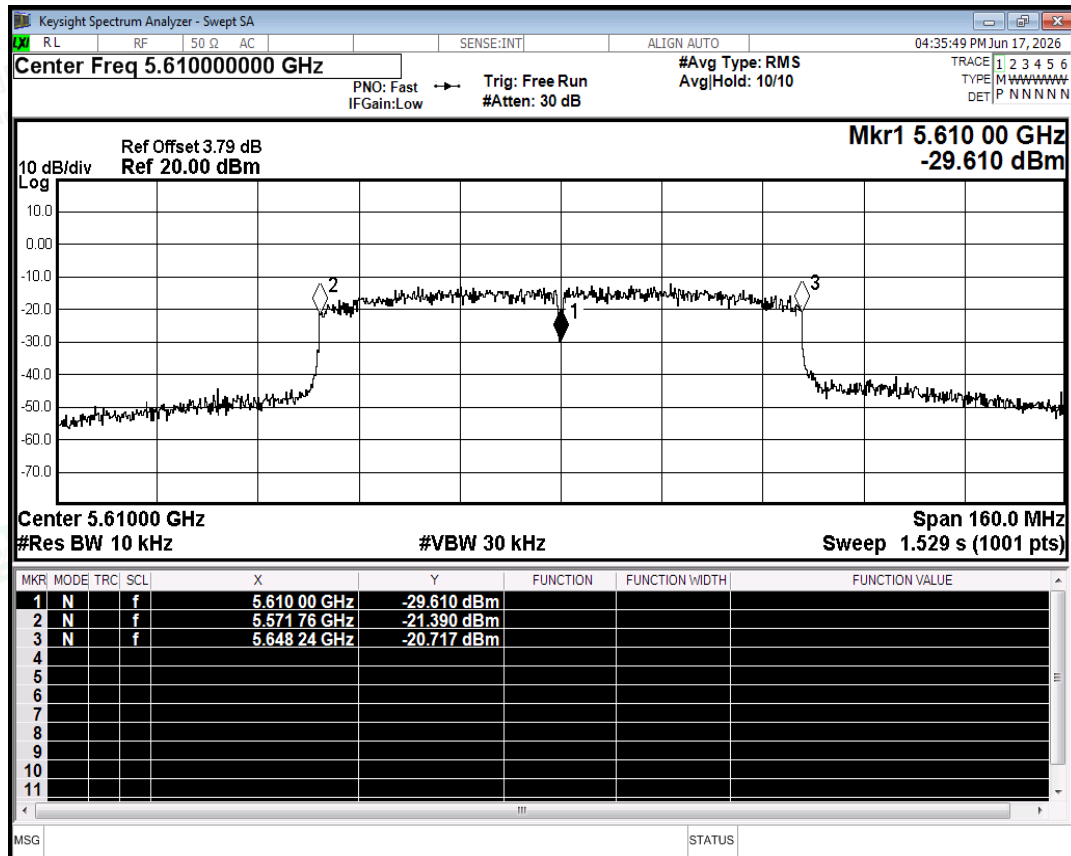

Freq. Stability NVNT ac80 5610MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5500.06	60000	10.91	25	Pass
NVNT	a	5580	Ant1	5580.06	60000	10.75	25	Pass
NVNT	a	5700	Ant1	5700.06	60000	10.53	25	Pass
NVNT	n20	5500	Ant1	5500.12	120000	21.82	25	Pass
NVNT	n20	5580	Ant1	5580.06	60000	10.75	25	Pass
NVNT	n20	5700	Ant1	5700.08	80000	14.04	25	Pass
NVNT	n40	5510	Ant1	5510.08	80000	14.52	25	Pass
NVNT	n40	5550	Ant1	5550.04	40000	7.21	25	Pass
NVNT	n40	5670	Ant1	5670.04	40000	7.05	25	Pass
NVNT	ac20	5500	Ant1	5500.08	80000	14.55	25	Pass
NVNT	ac20	5580	Ant1	5580.06	60000	10.75	25	Pass
NVNT	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
NVNT	ac40	5510	Ant1	5510.08	80000	14.52	25	Pass
NVNT	ac40	5550	Ant1	5550.08	80000	14.41	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
NVNT	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

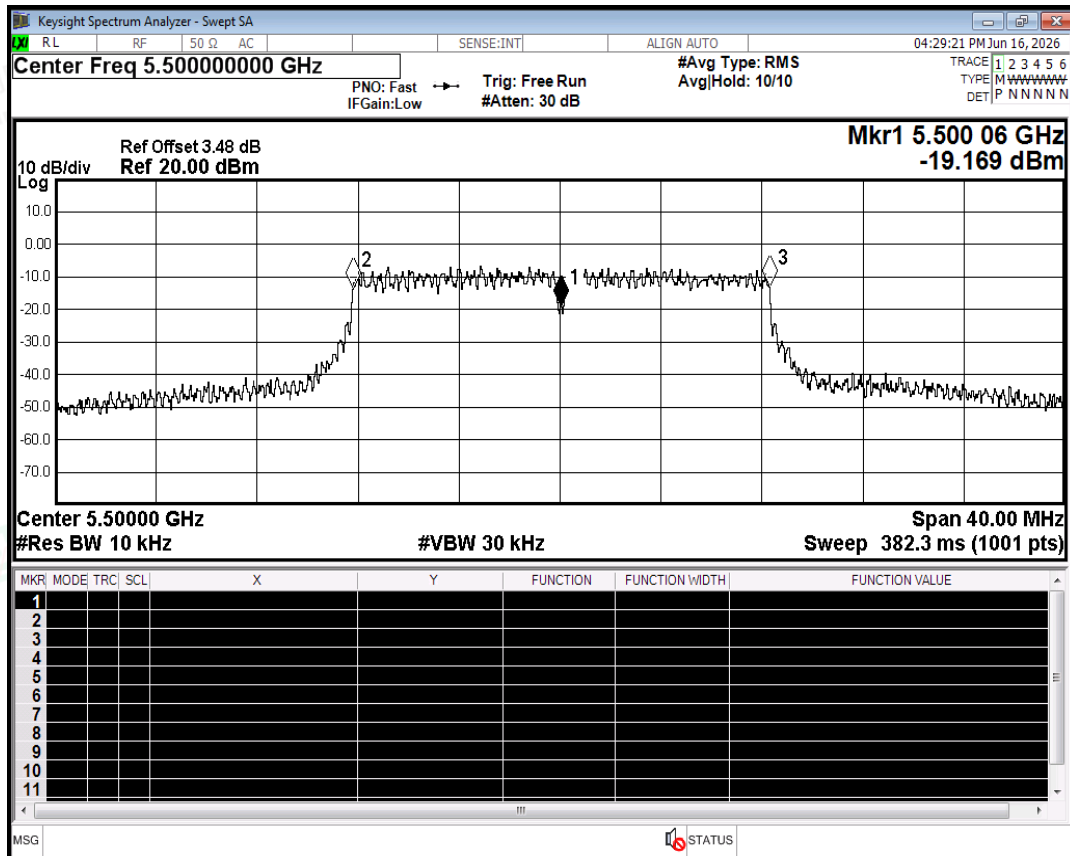

Freq. Stability NVNT a 5500MHz Ant1

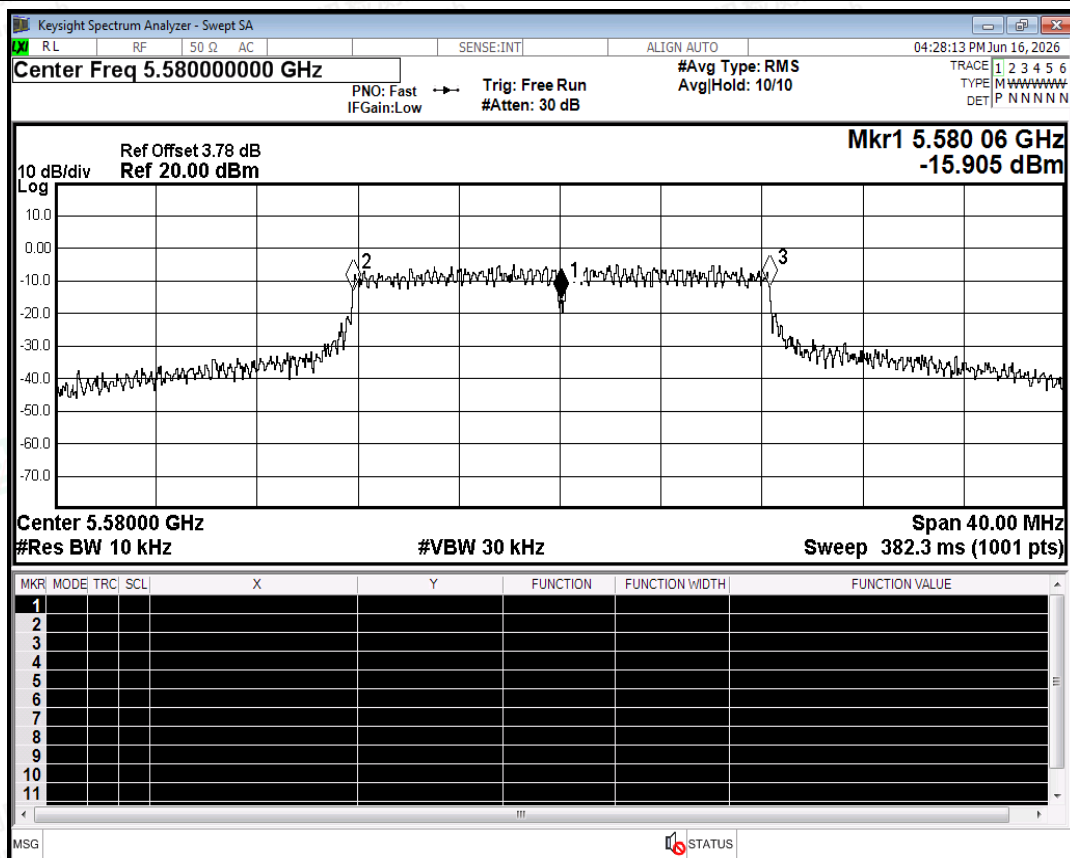

Freq. Stability NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

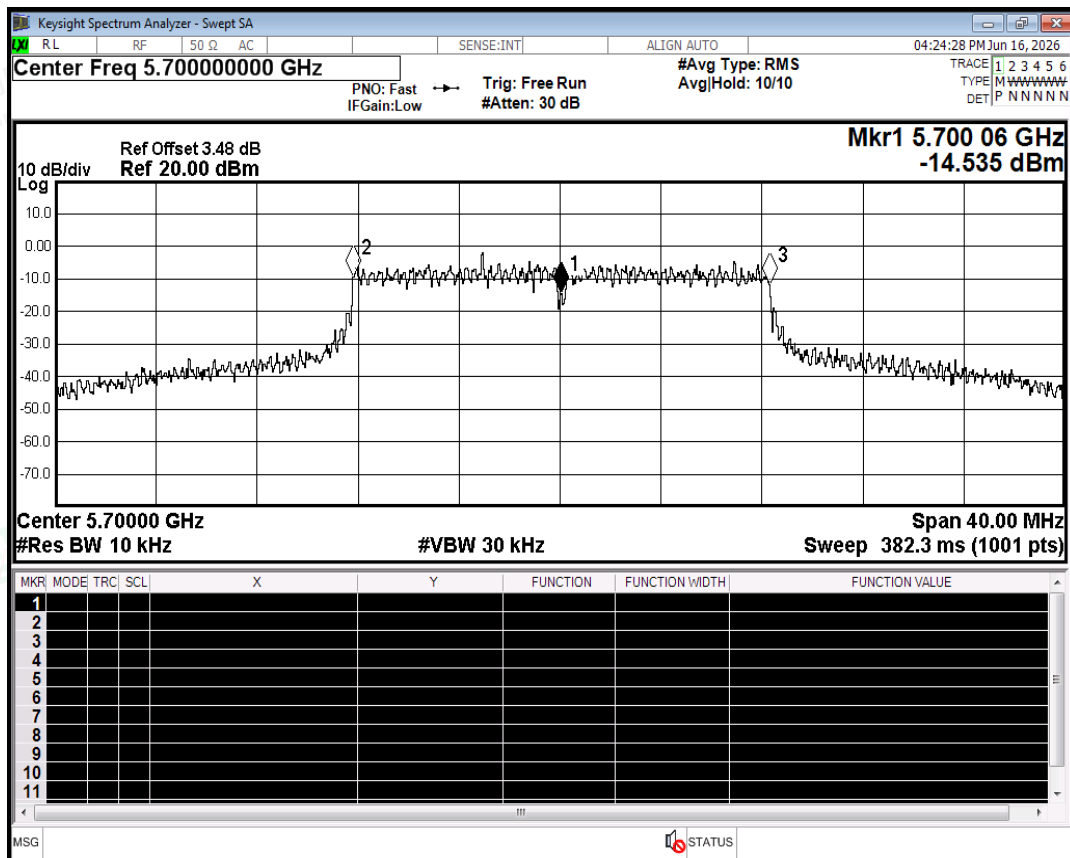

Freq. Stability NVNT a 5700MHz Ant1

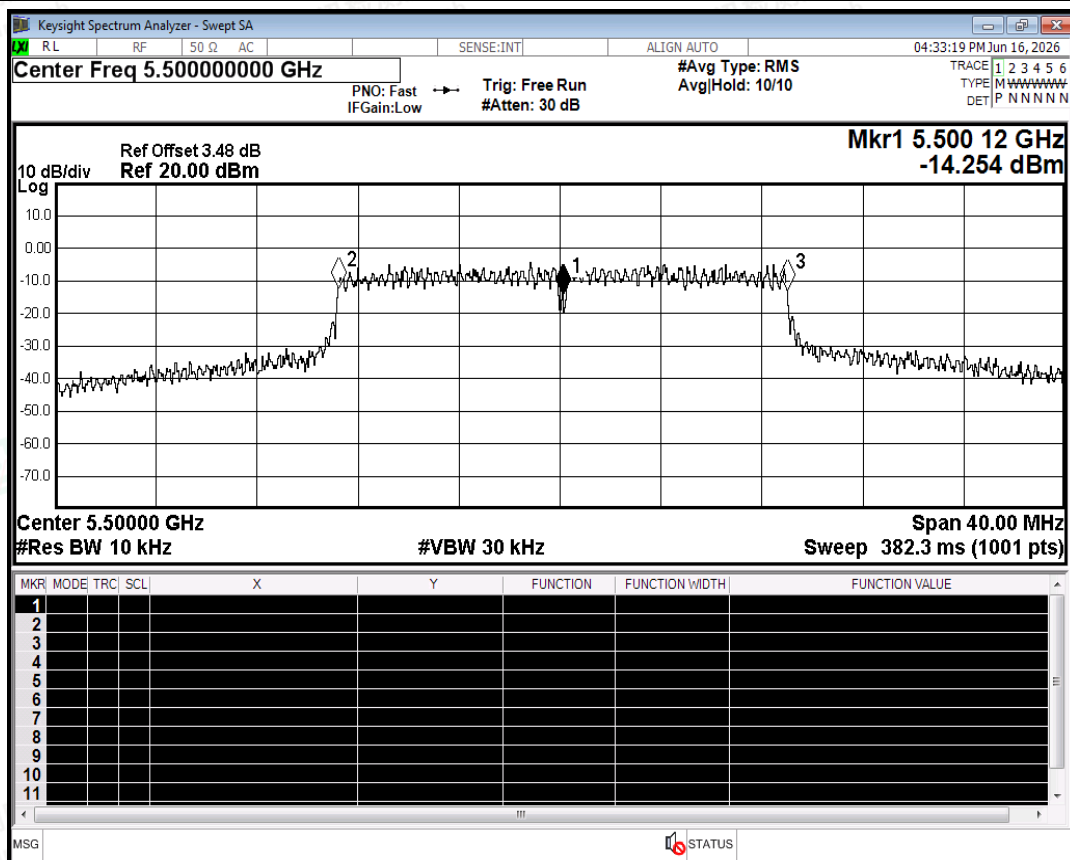

Freq. Stability NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

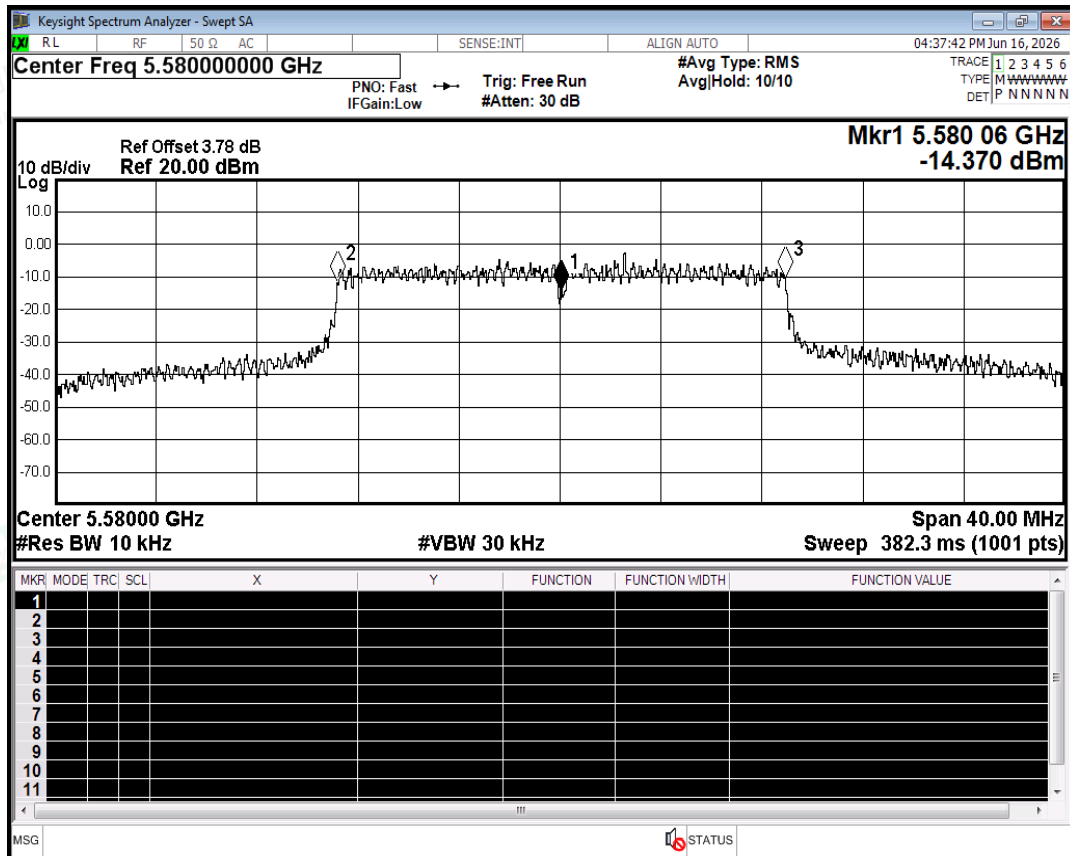

Freq. Stability NVNT n20 5580MHz Ant1

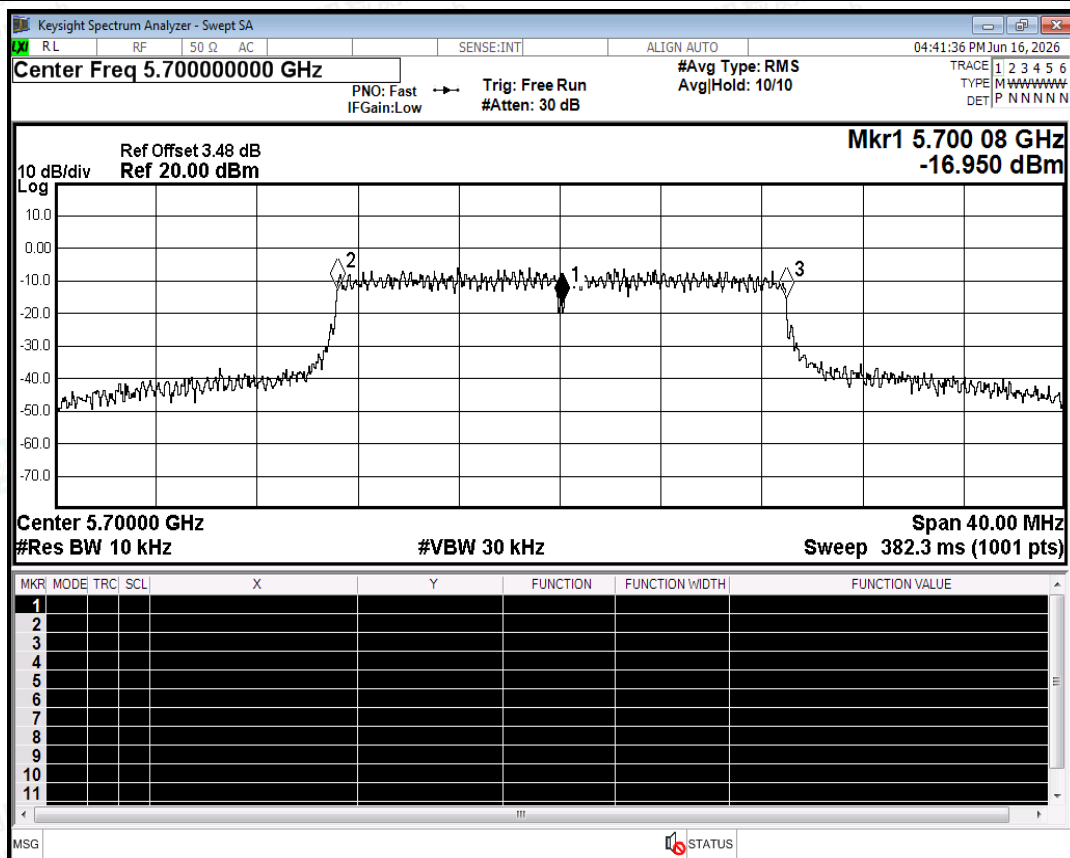

Freq. Stability NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

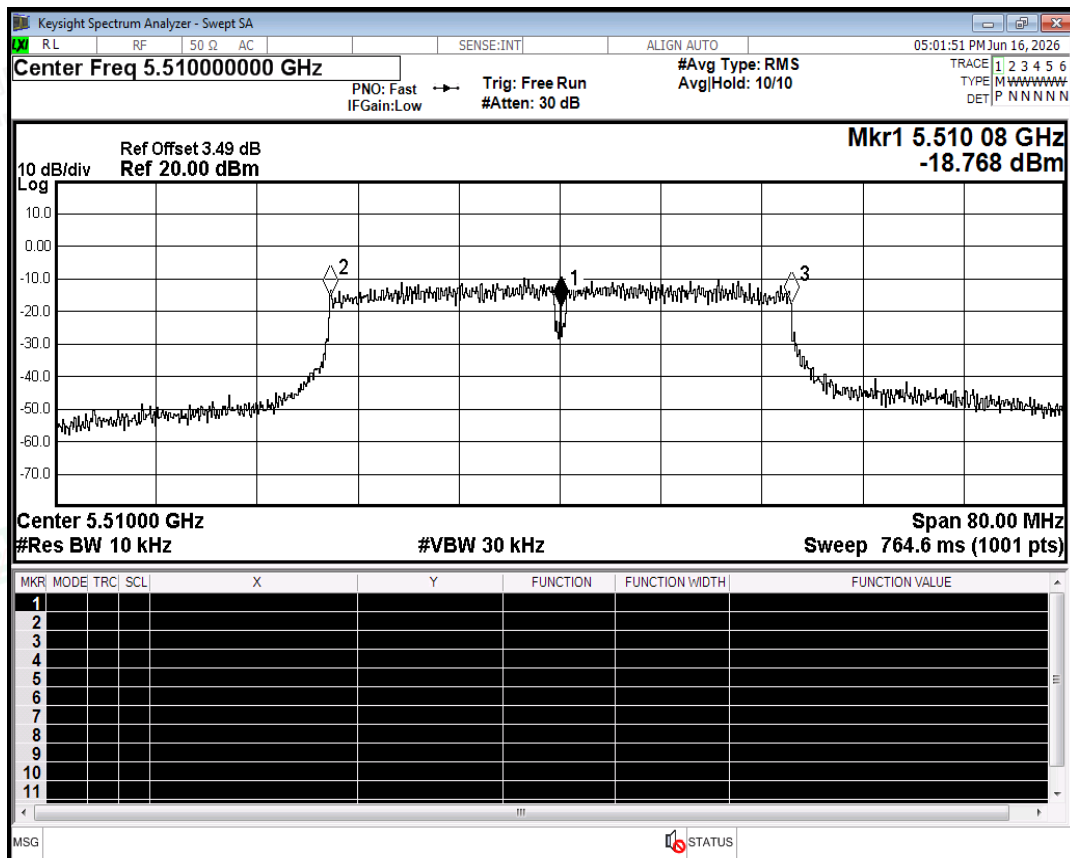

Freq. Stability NVNT n40 5510MHz Ant1

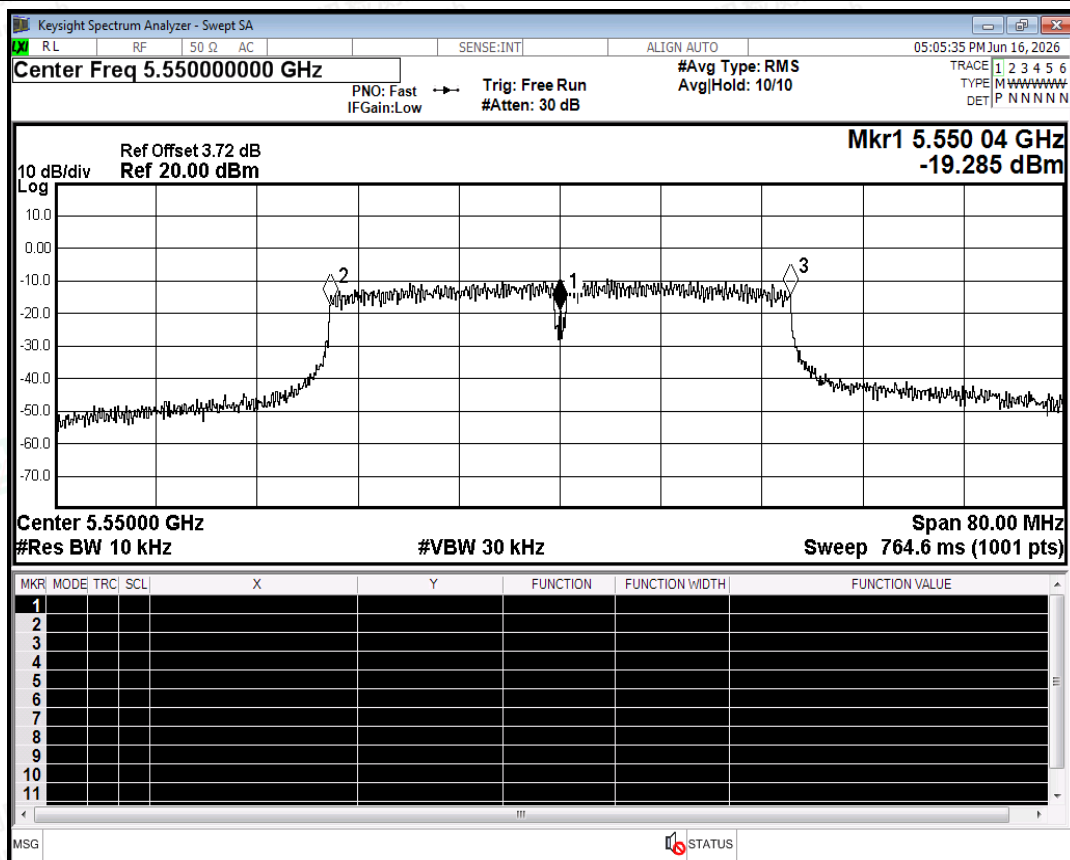

Freq. Stability NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

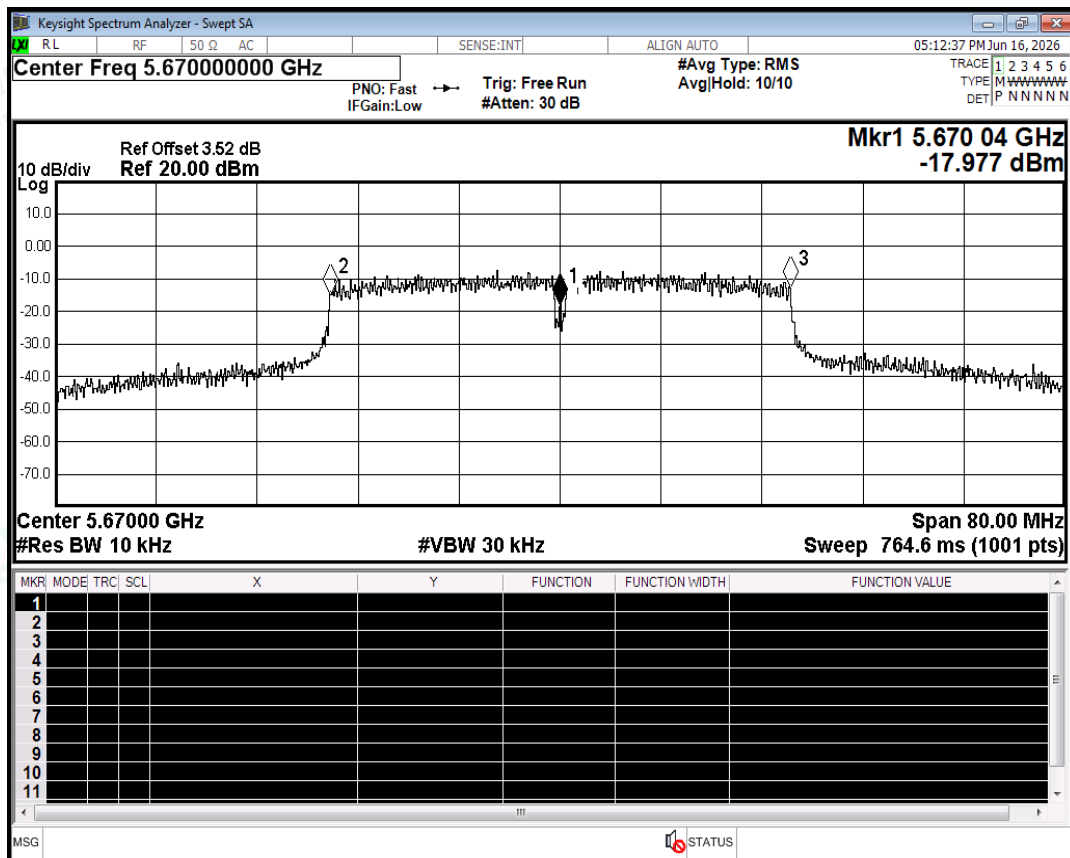

Freq. Stability NVNT n40 5670MHz Ant1

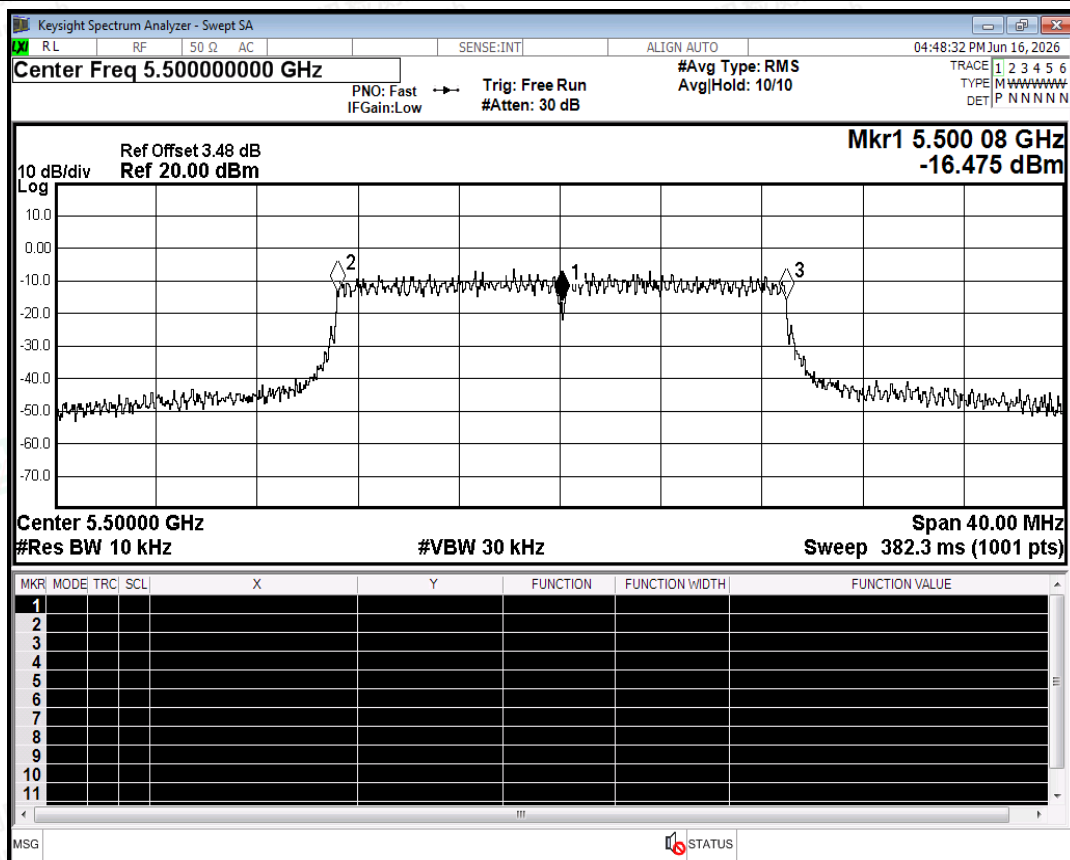

Freq. Stability NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

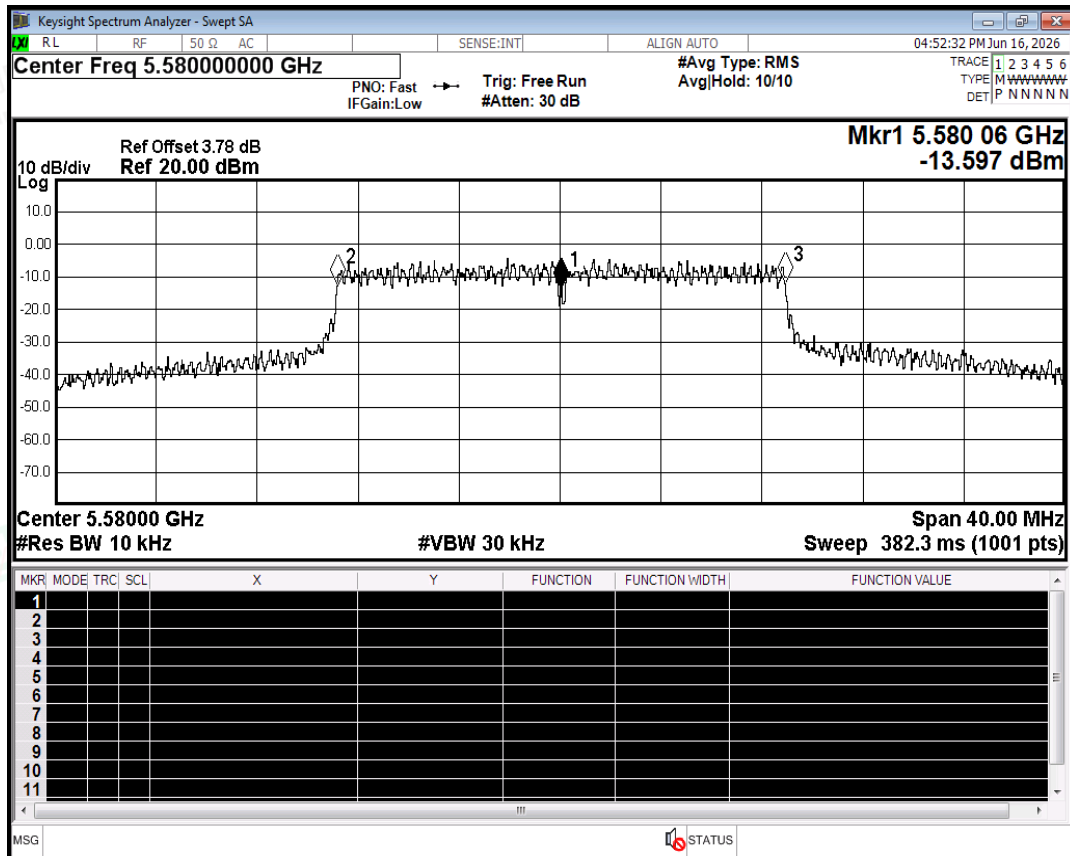

Freq. Stability NVNT ac20 5580MHz Ant1

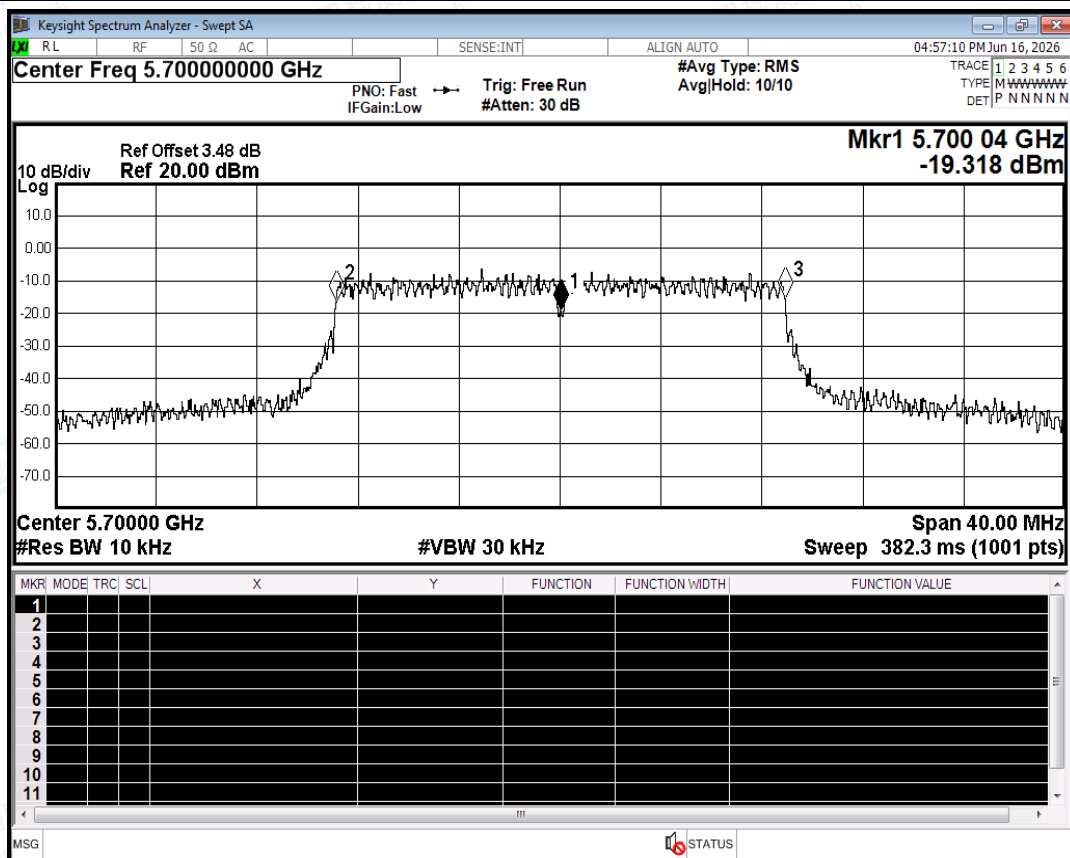

Freq. Stability NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

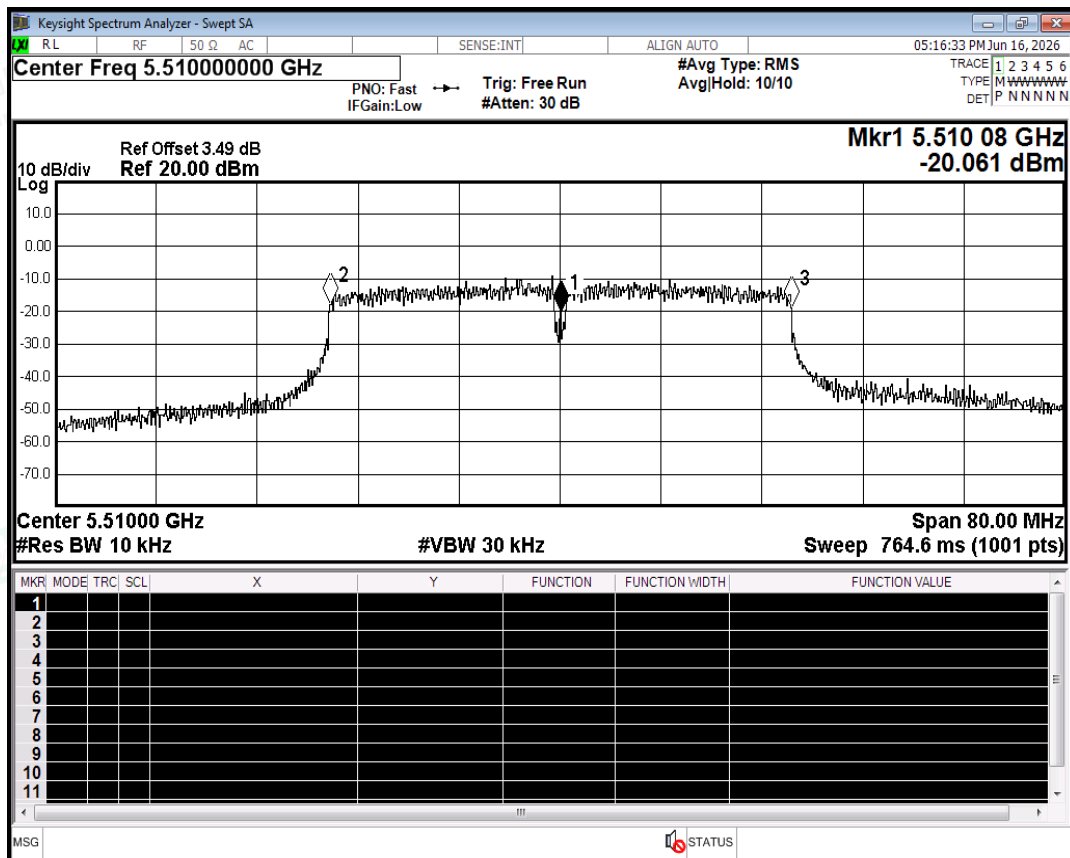

Freq. Stability NVNT ac40 5510MHz Ant1

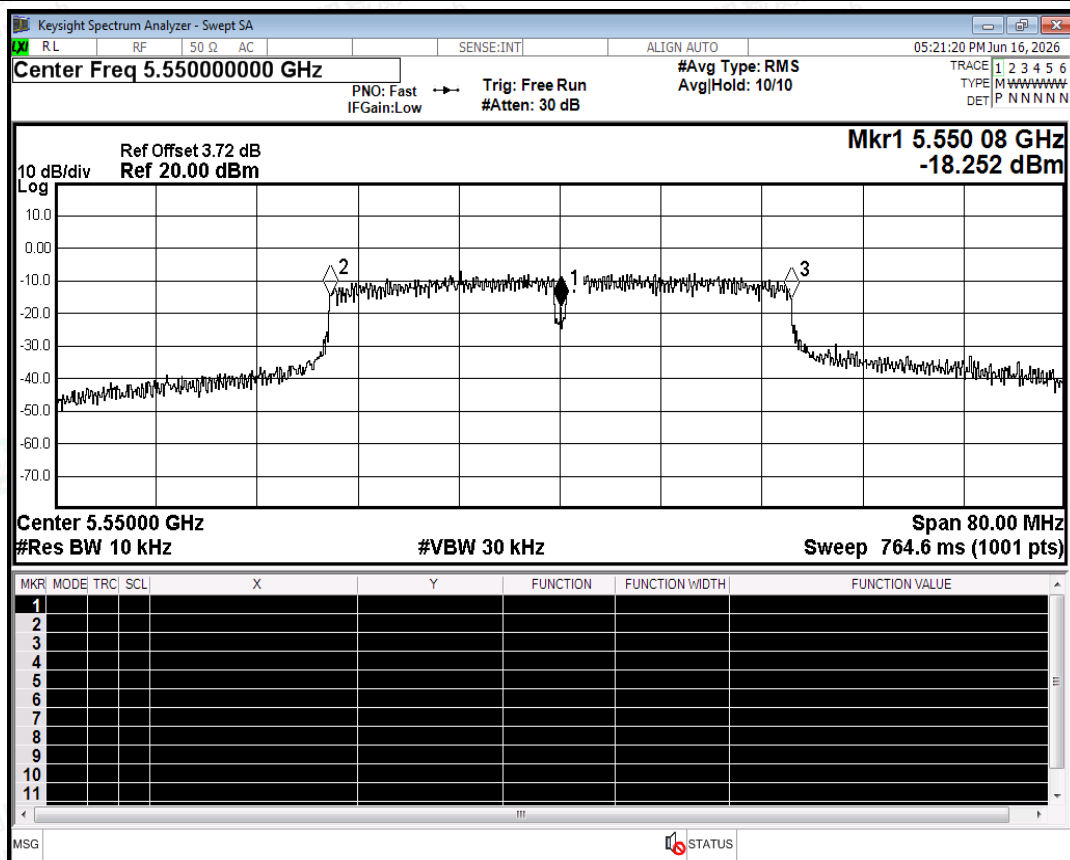

Freq. Stability NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

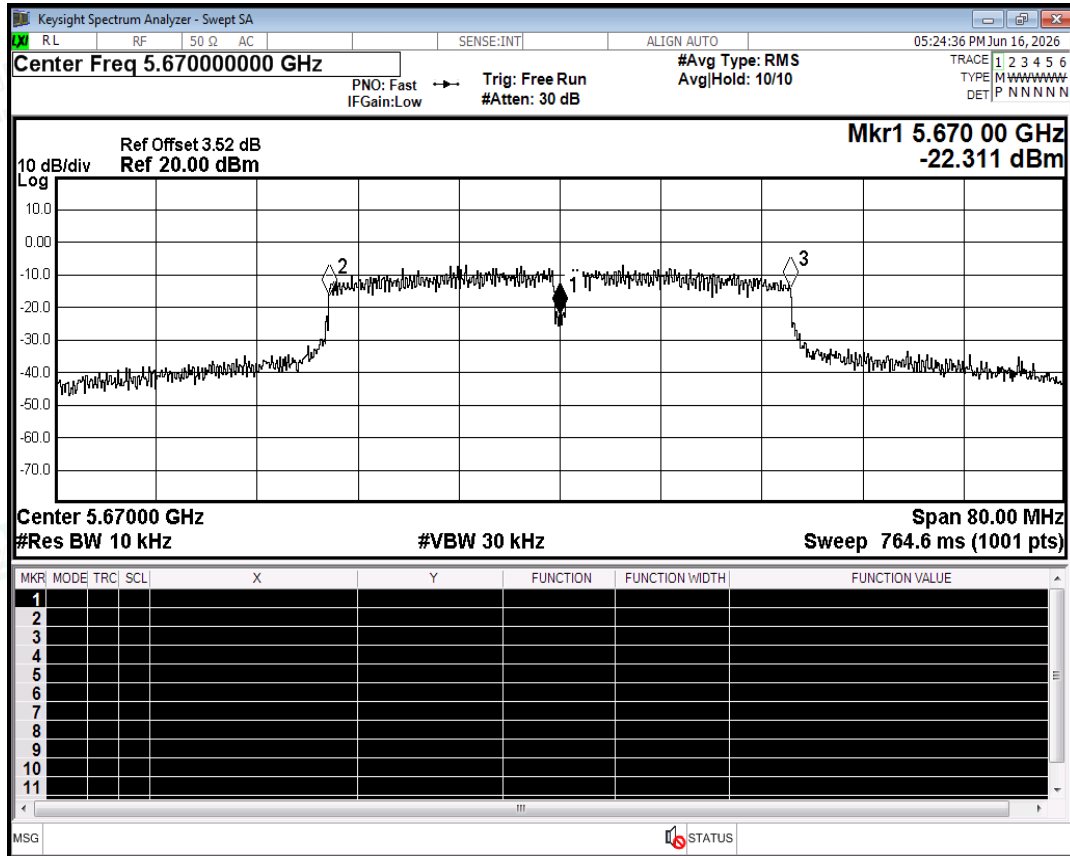

Freq. Stability NVNT ac40 5670MHz Ant1

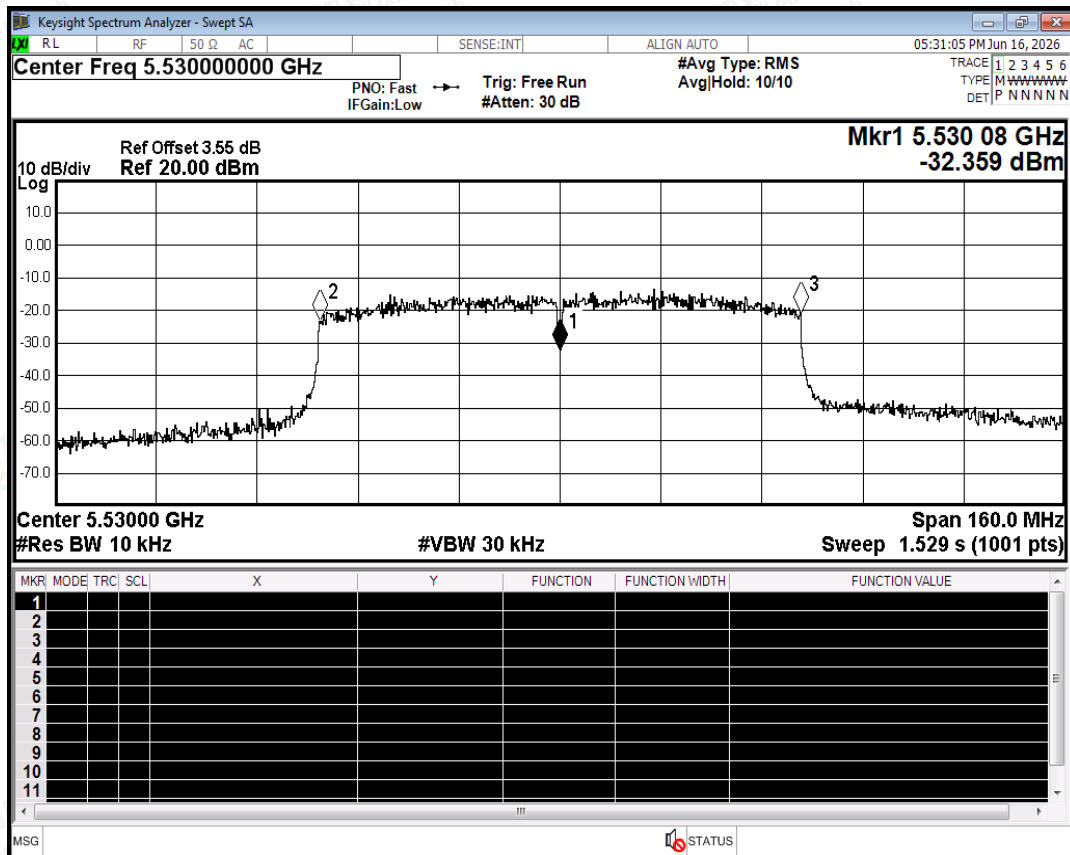

Freq. Stability NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

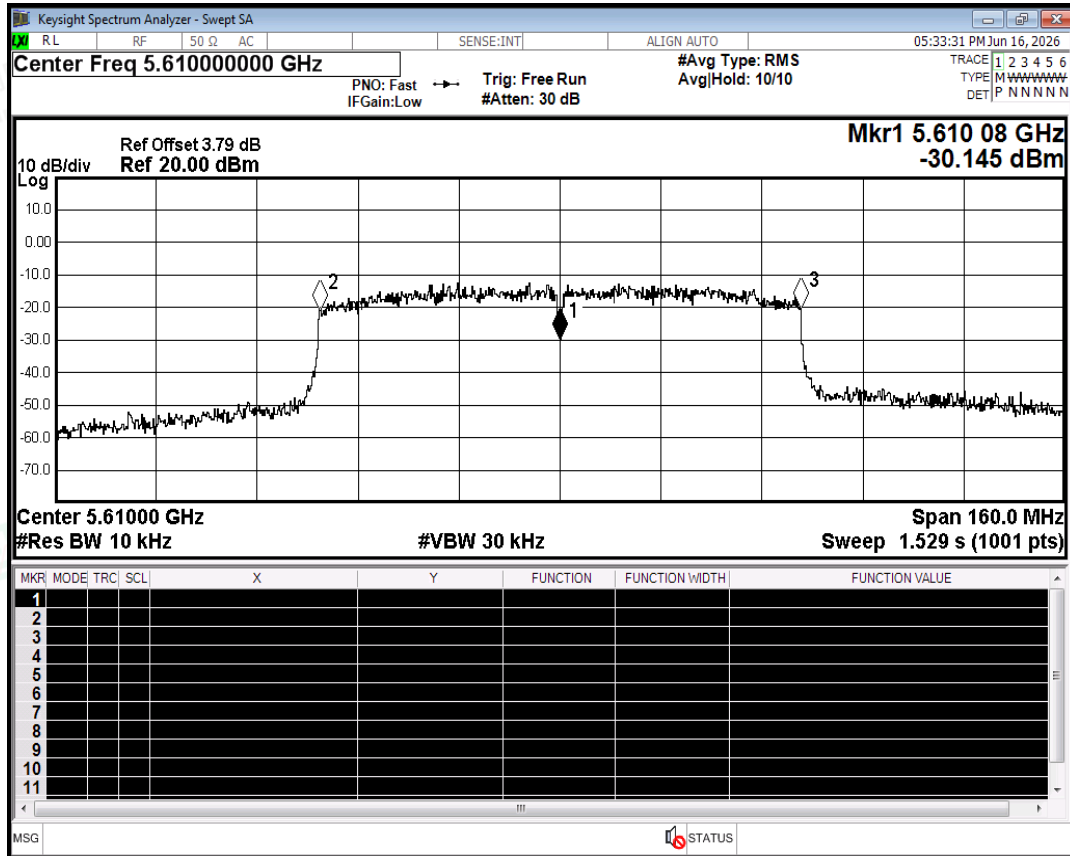

Freq. Stability NVNT ac80 5610MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant0	93.67	0.28	0.48
NVNT	a	5580	Ant0	95.37	0.21	0.49
NVNT	a	5700	Ant0	90.75	0.42	0.49
NVNT	n20	5500	Ant0	92.75	0.33	0.52
NVNT	n20	5580	Ant0	91	0.41	0.52
NVNT	n20	5700	Ant0	91.43	0.39	0.52
NVNT	n40	5510	Ant0	81.9	0.87	1.05
NVNT	n40	5550	Ant0	83.19	0.8	1.06
NVNT	n40	5670	Ant0	81.03	0.91	1.06
NVNT	ac20	5500	Ant0	92.34	0.35	0.52
NVNT	ac20	5580	Ant0	93.24	0.3	0.52
NVNT	ac20	5700	Ant0	91.47	0.39	0.52
NVNT	ac40	5510	Ant0	86.49	0.63	1.04
NVNT	ac40	5550	Ant0	79.17	1.01	1.05
NVNT	ac40	5670	Ant0	83.33	0.79	1.05
NVNT	ac80	5530	Ant0	67.65	1.7	2.17
NVNT	ac80	5610	Ant0	67.65	1.7	2.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

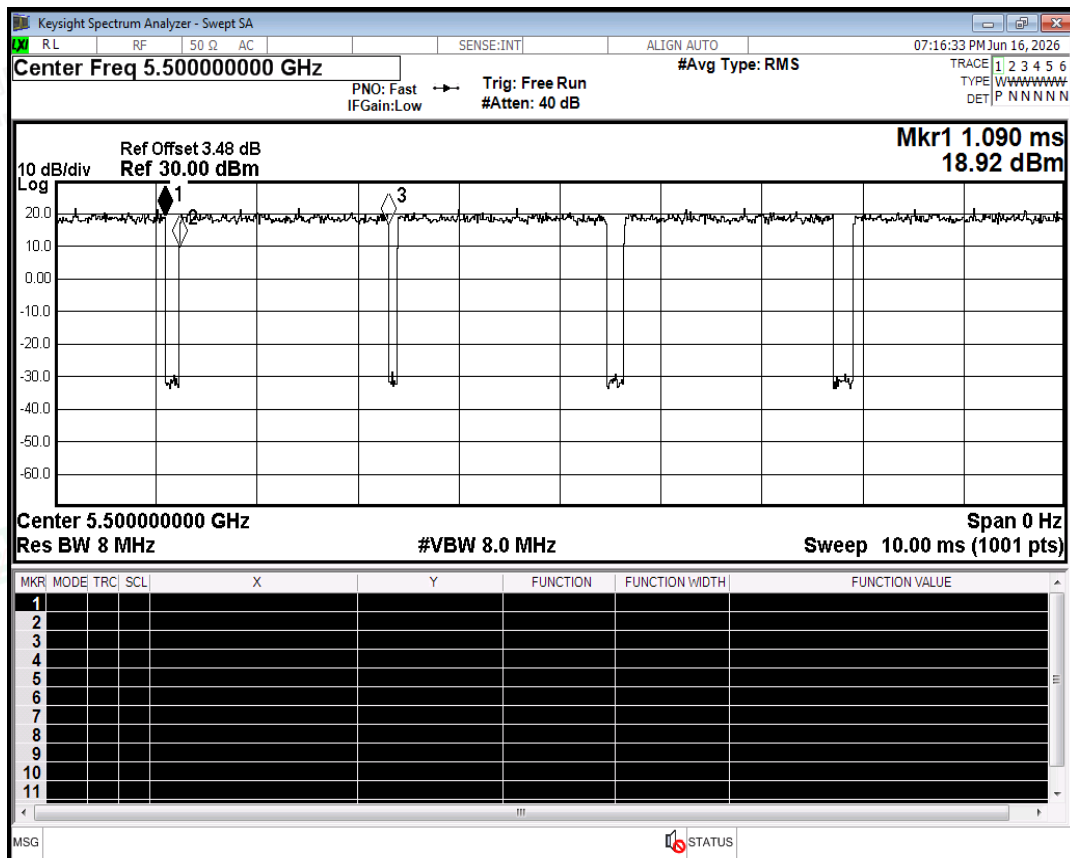

Duty Cycle NVNT a 5500MHz Ant0

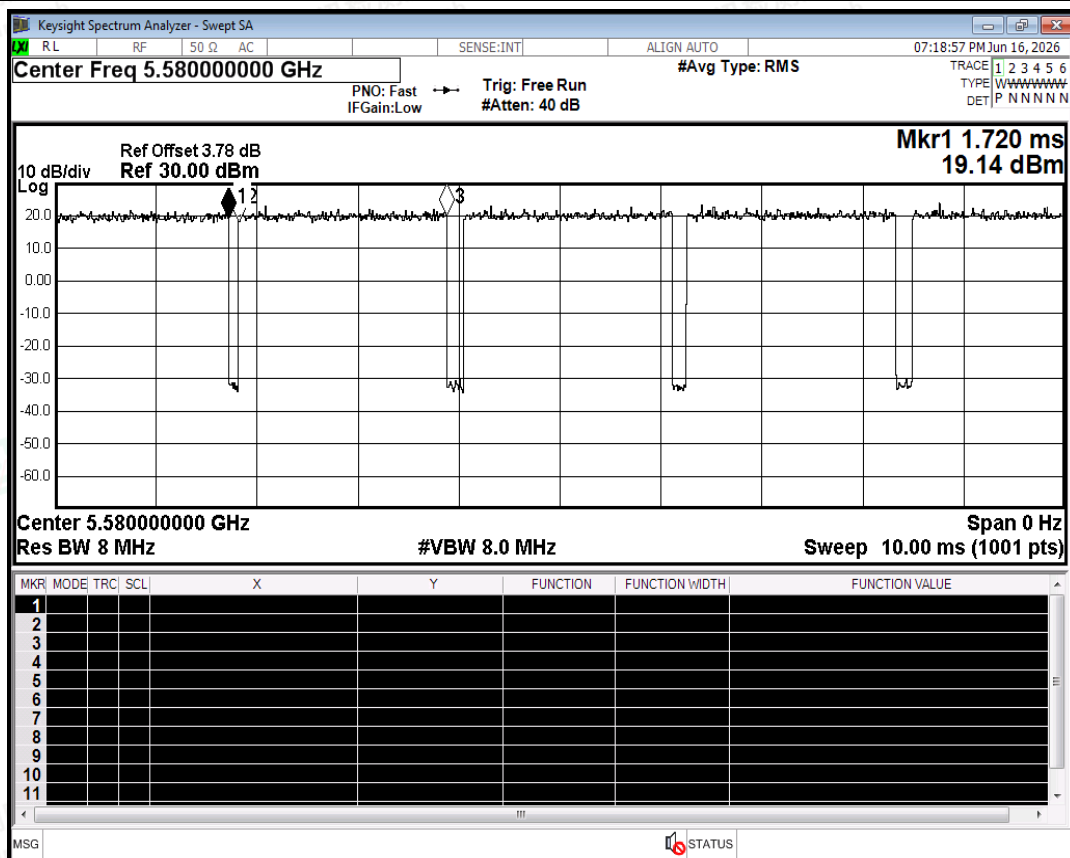

Duty Cycle NVNT a 5580MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

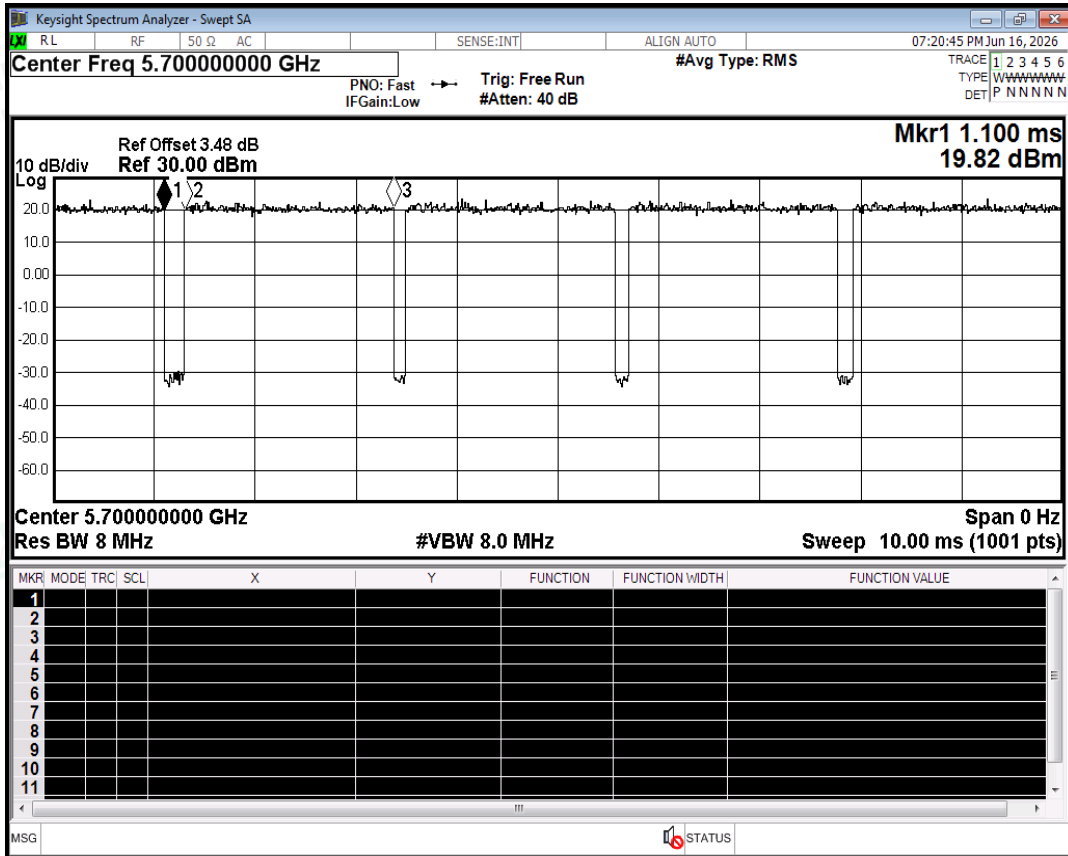

Duty Cycle NVNT a 5700MHz Ant0

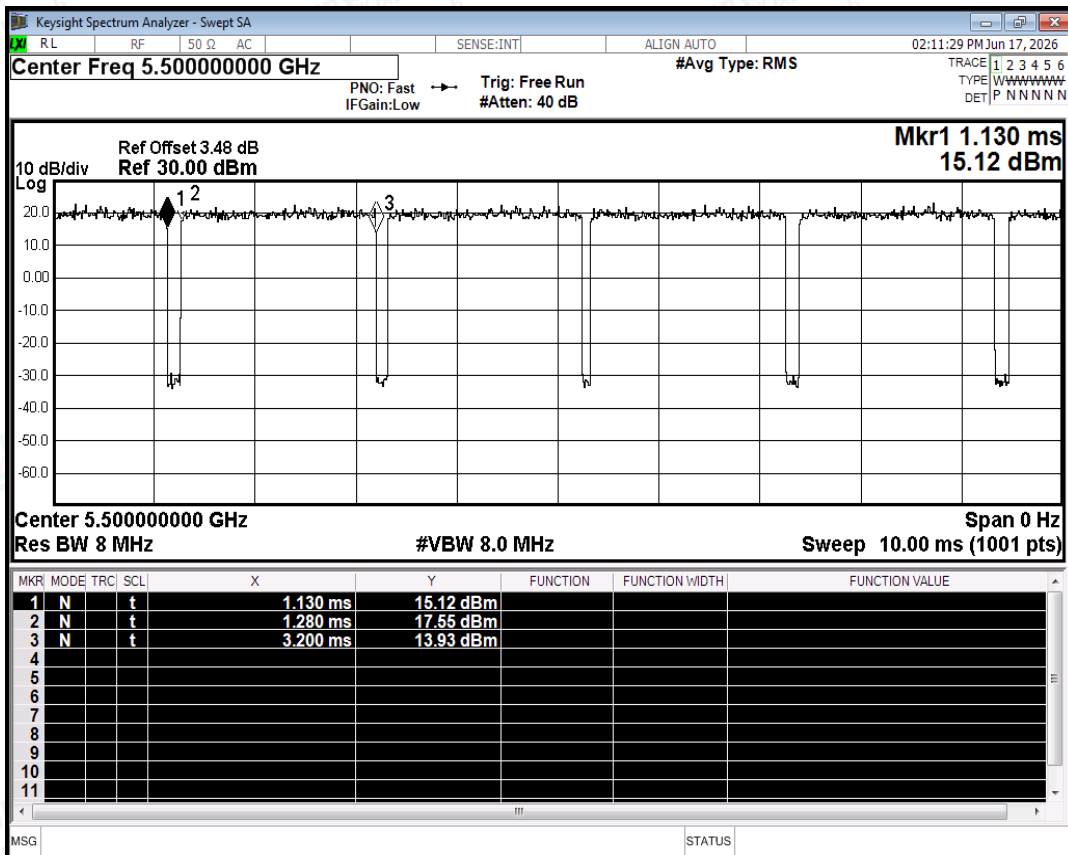

Duty Cycle NVNT n20 5500MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

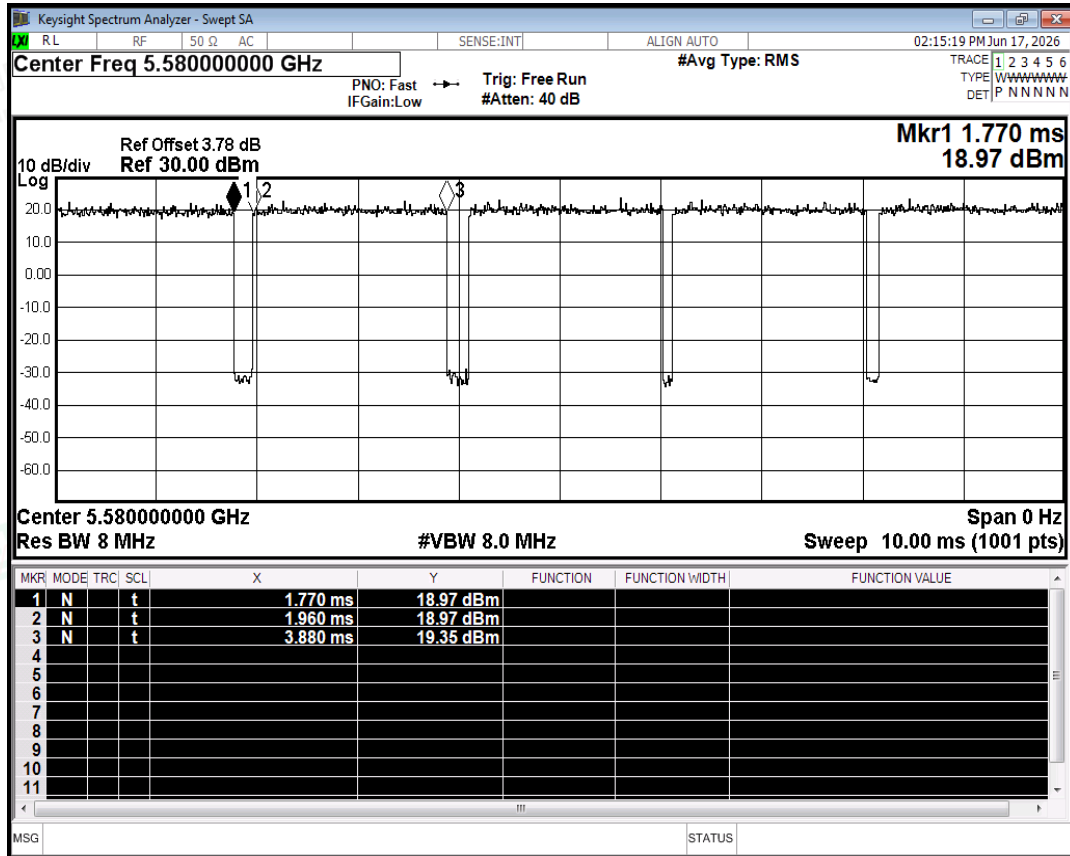

Duty Cycle NVNT n20 5580MHz Ant0

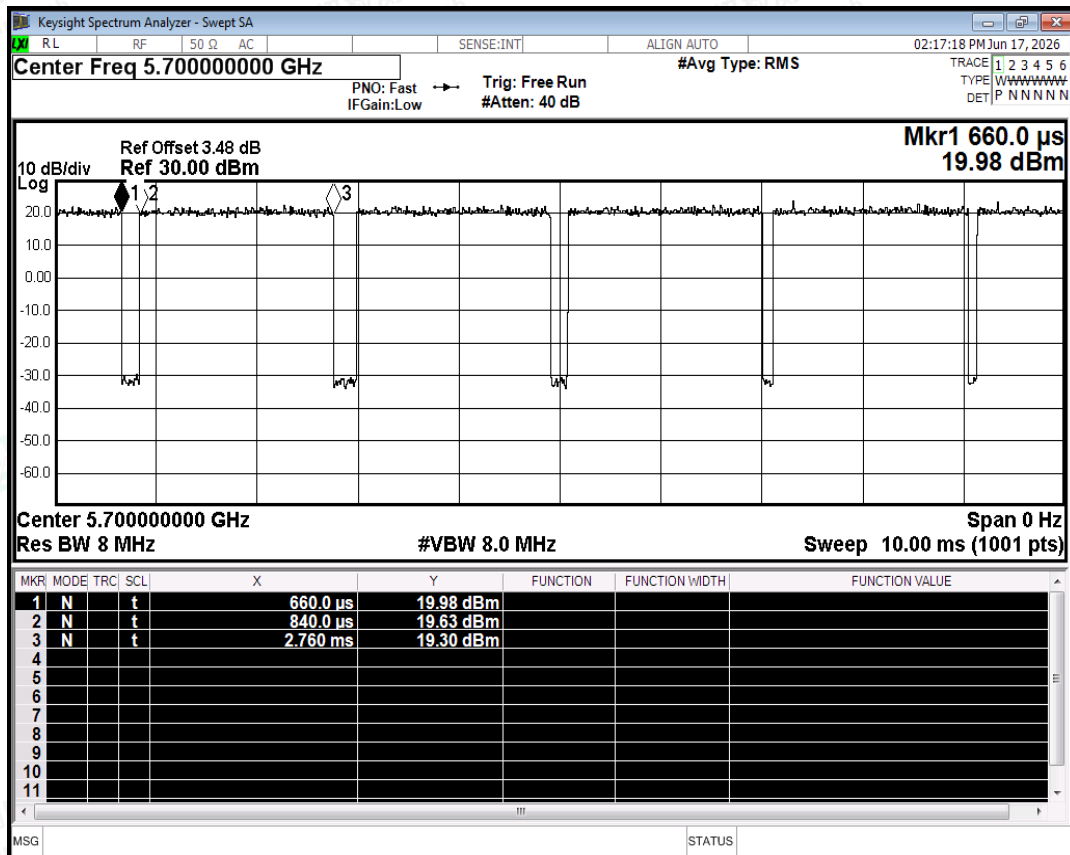

Duty Cycle NVNT n20 5700MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

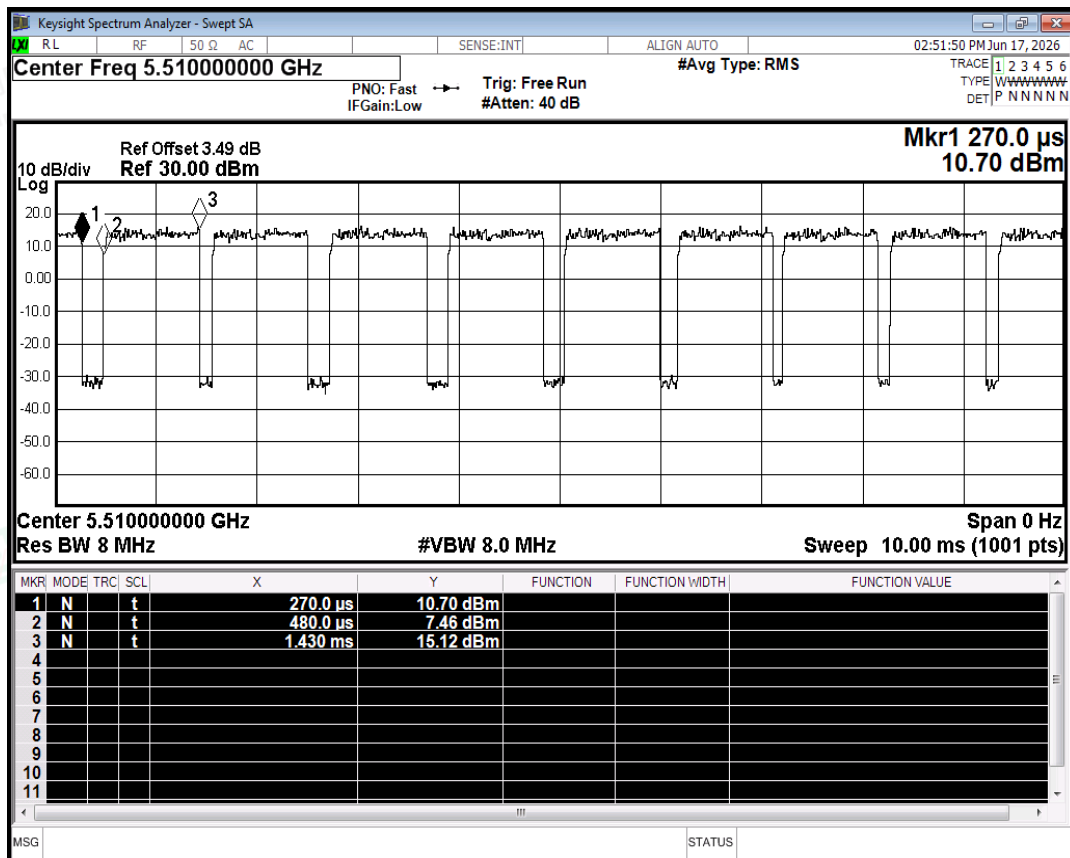

Duty Cycle NVNT n40 5510MHz Ant0

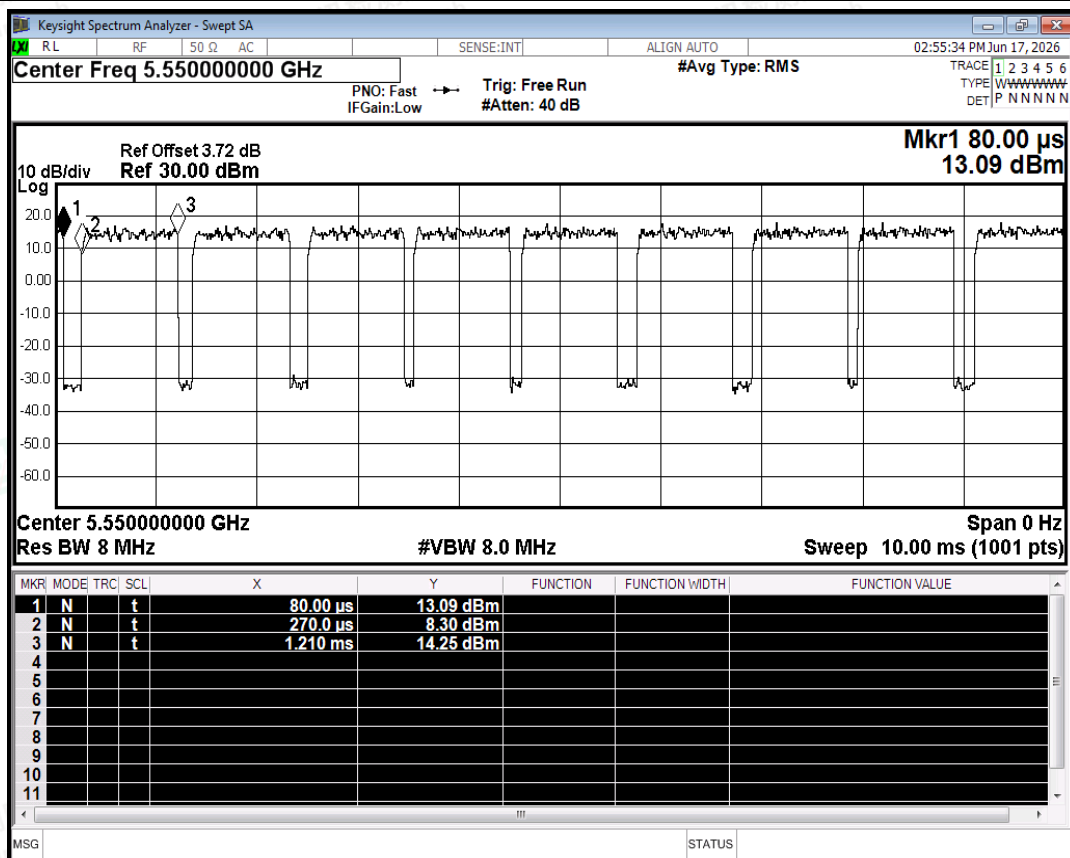

Duty Cycle NVNT n40 5550MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

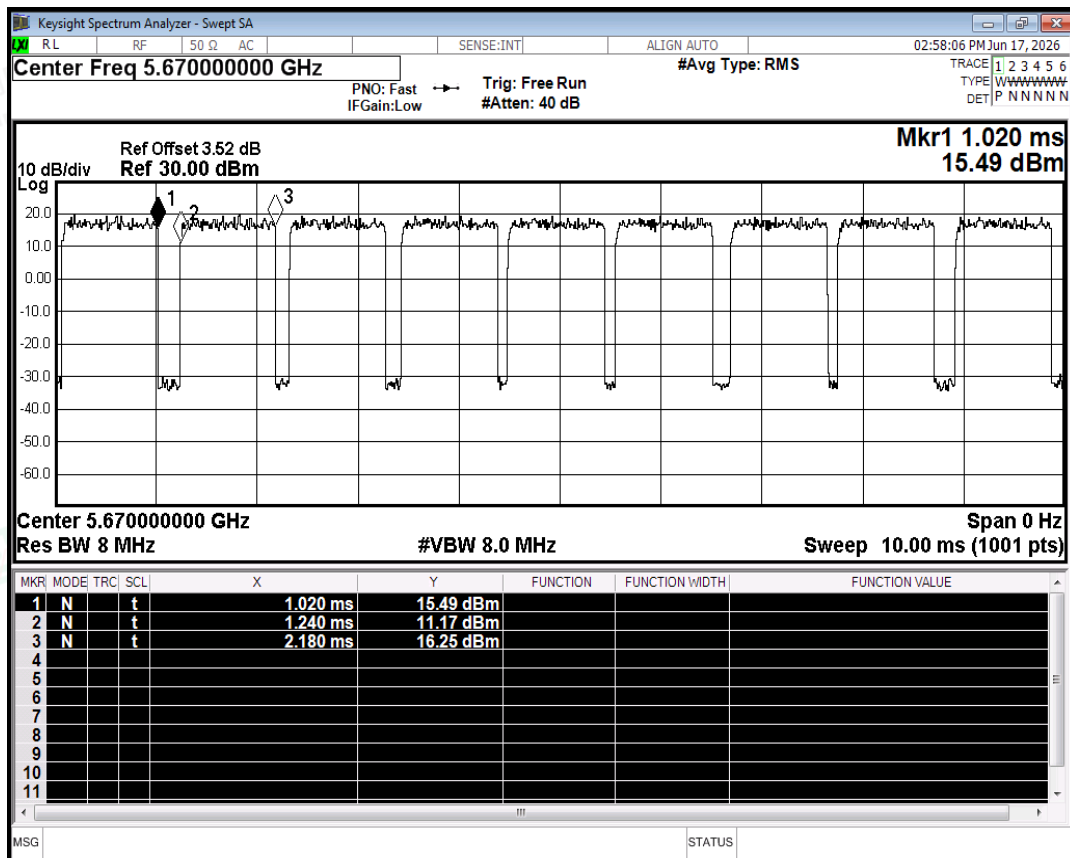

Duty Cycle NVNT n40 5670MHz Ant0

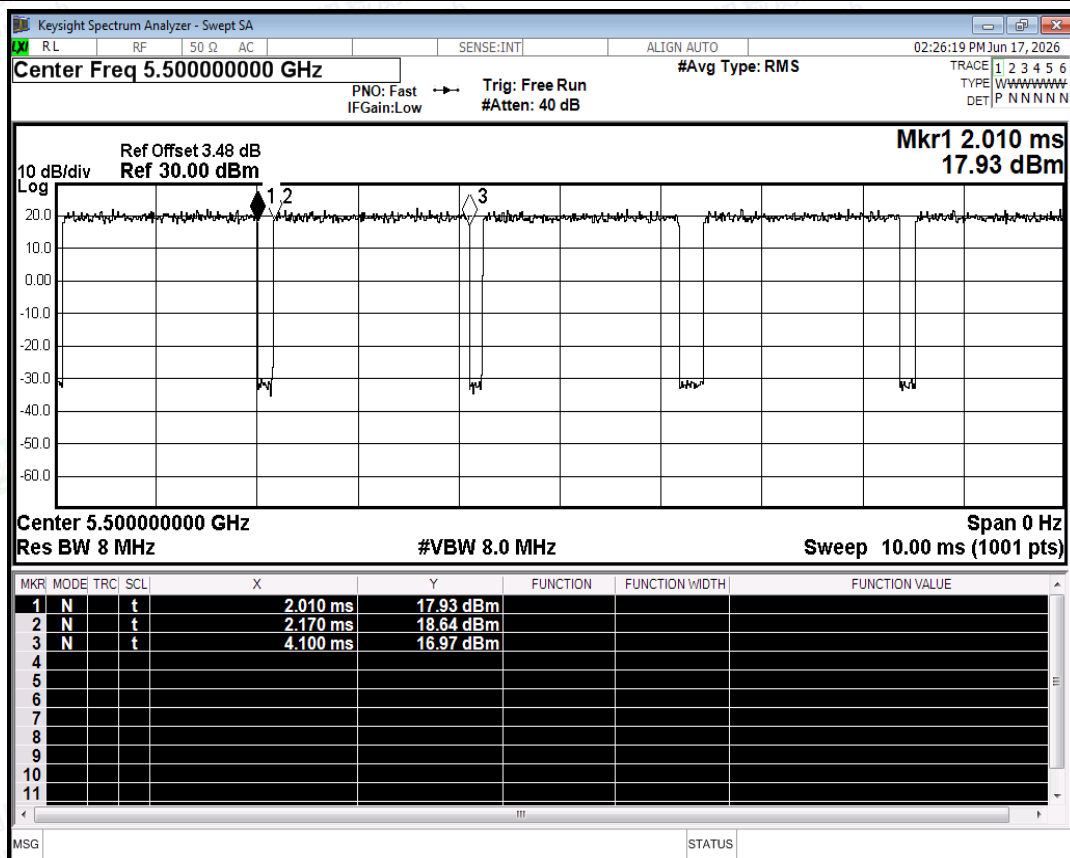

Duty Cycle NVNT ac20 5500MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

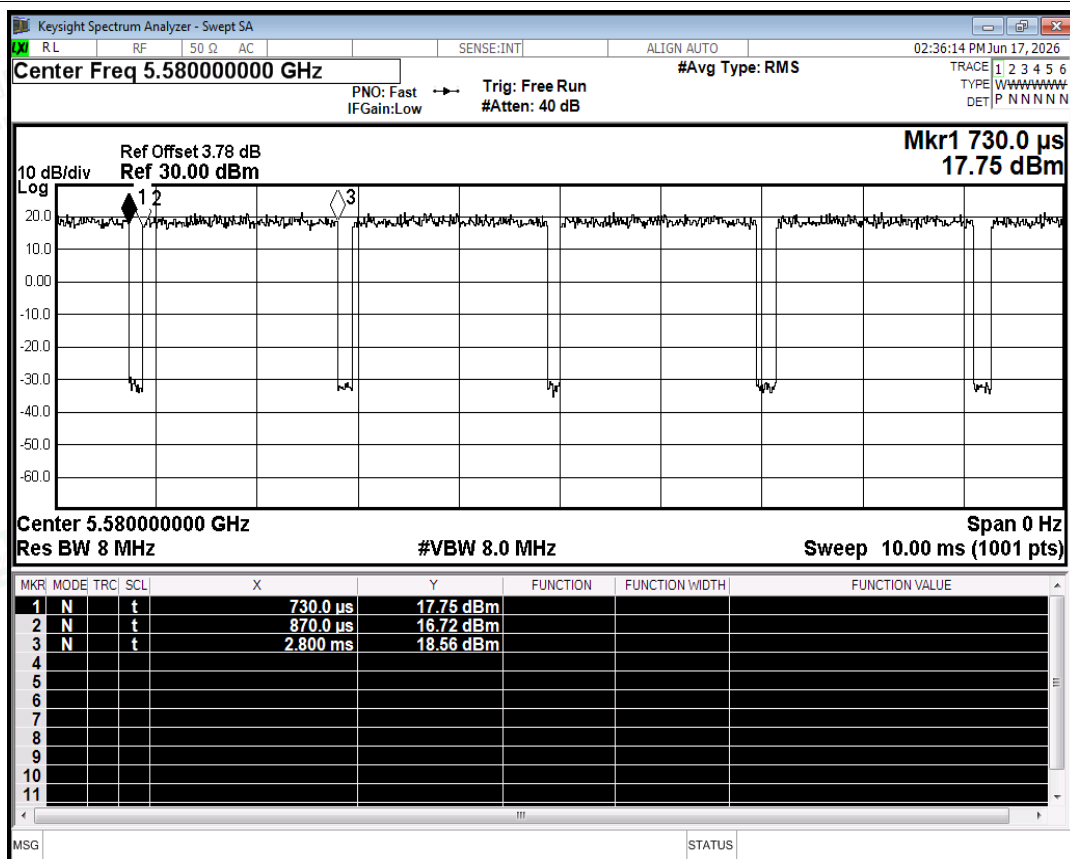

Duty Cycle NVNT ac20 5580MHz Ant0

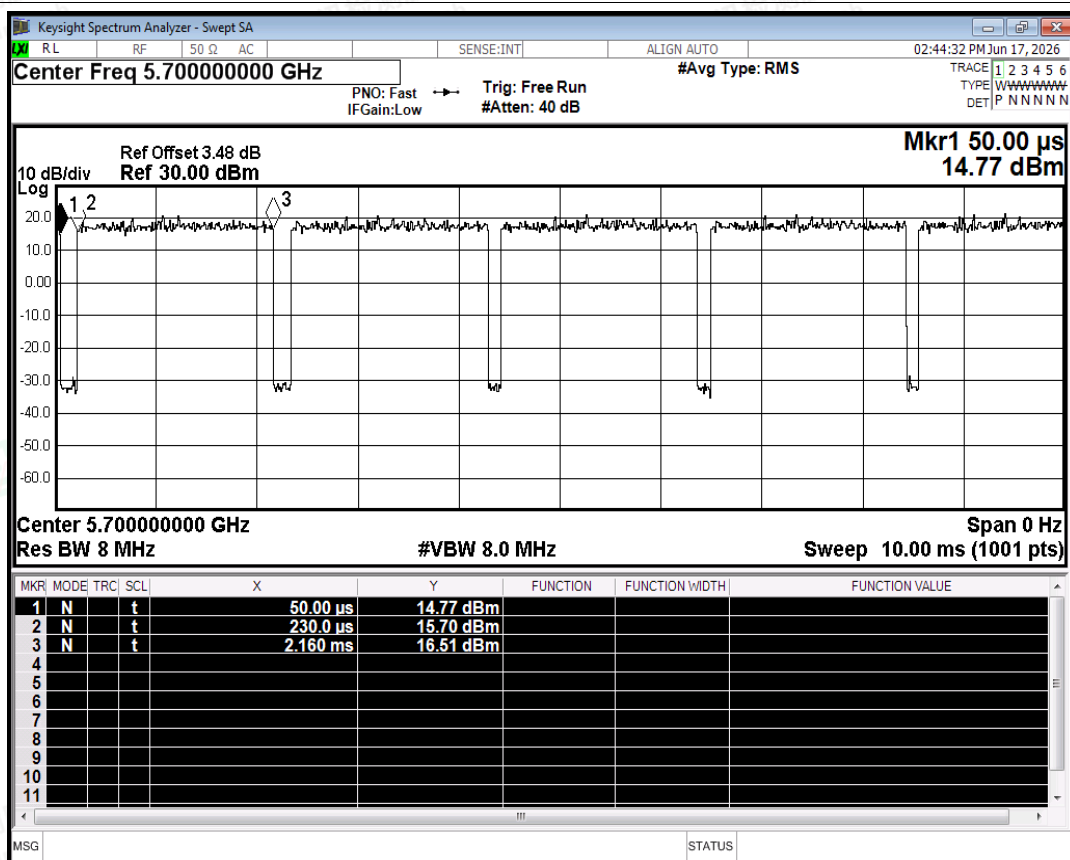

Duty Cycle NVNT ac20 5700MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

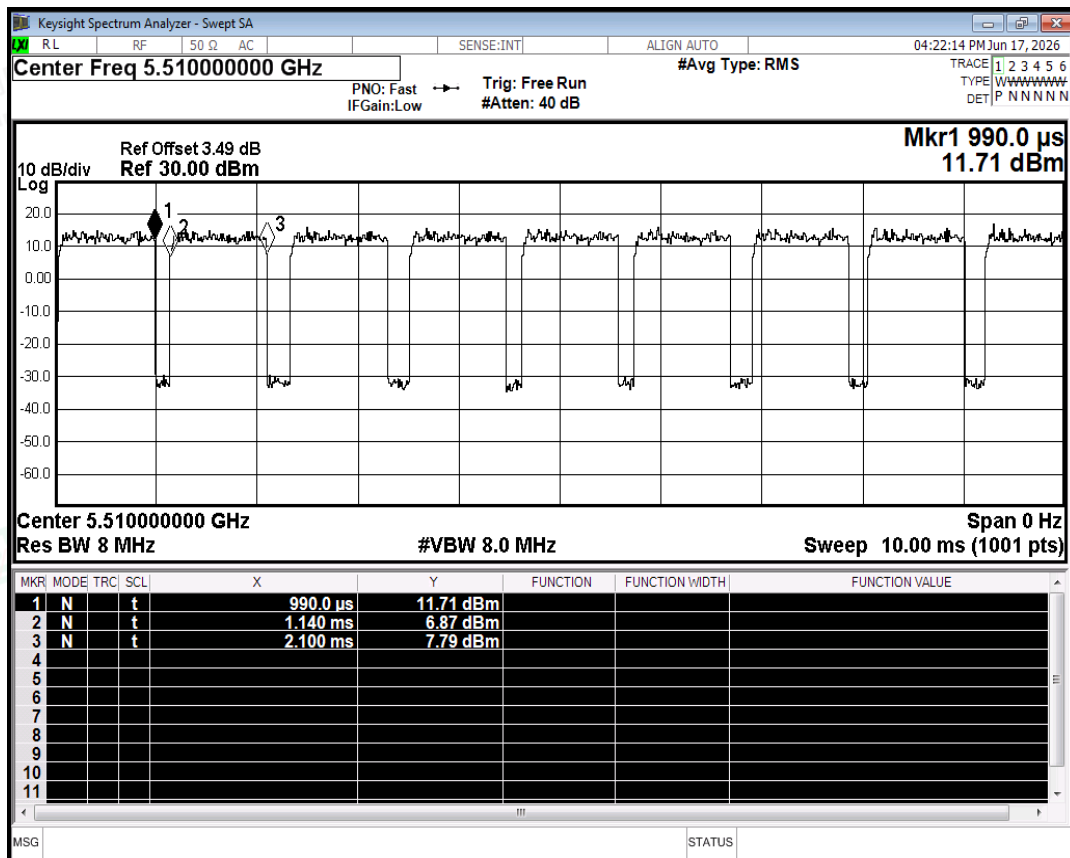

Duty Cycle NVNT ac40 5510MHz Ant0

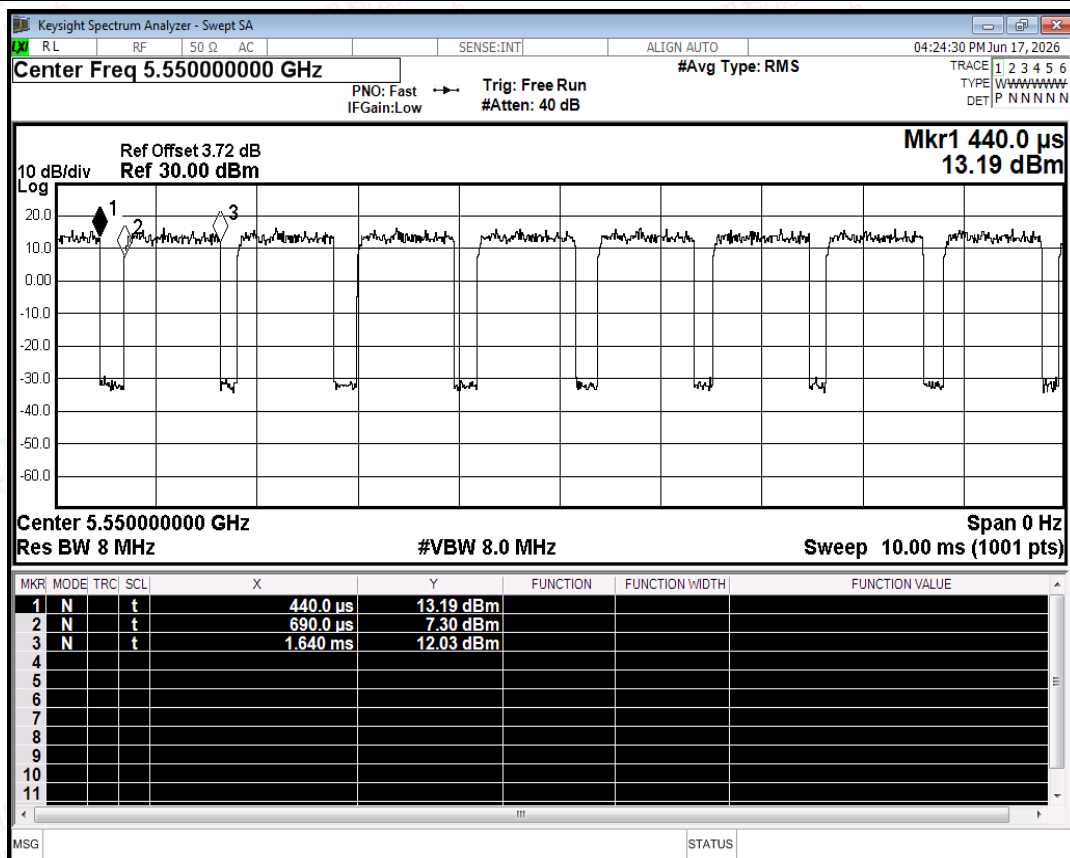

Duty Cycle NVNT ac40 5550MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

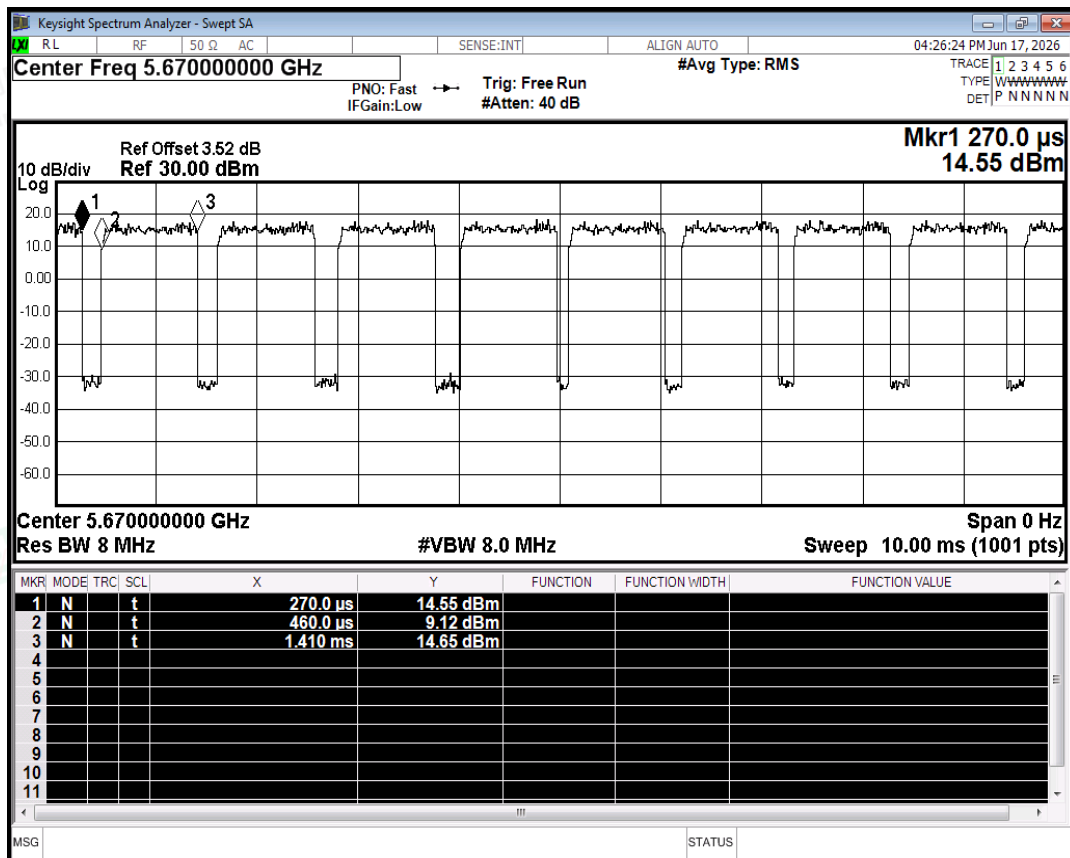

Duty Cycle NVNT ac40 5670MHz Ant0

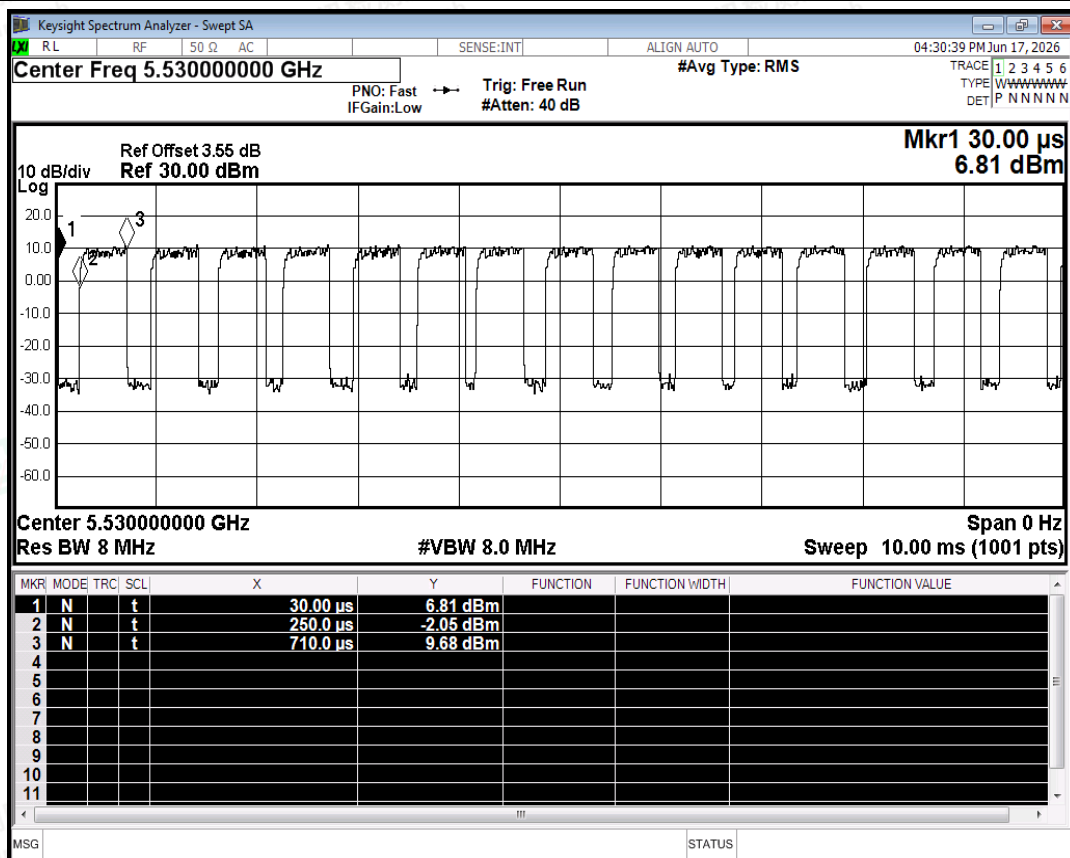

Duty Cycle NVNT ac80 5530MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

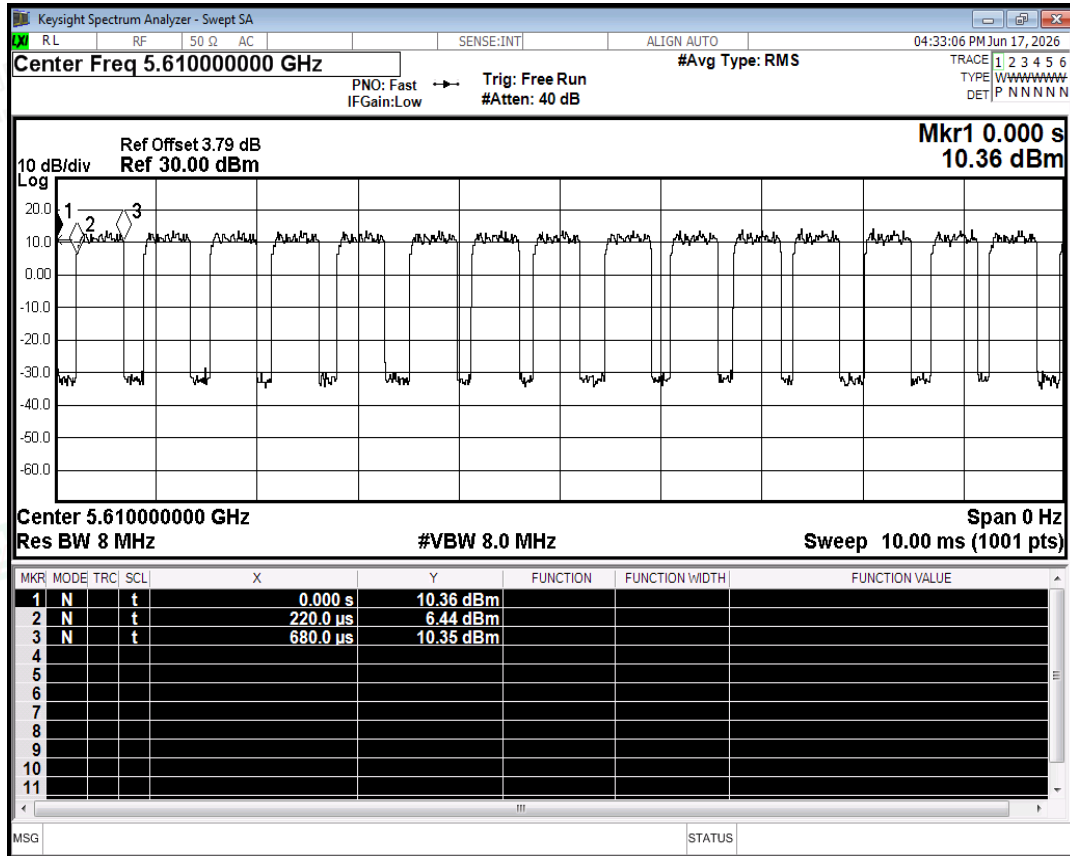

Duty Cycle NVNT ac80 5610MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	94.93	0.23	0.49
NVNT	a	5580	Ant1	90	0.46	0.48
NVNT	a	5700	Ant1	91.56	0.38	0.49
NVNT	n20	5500	Ant1	93.2	0.31	0.52
NVNT	n20	5580	Ant1	91.43	0.39	0.52
NVNT	n20	5700	Ant1	94.58	0.24	0.52
NVNT	n40	5510	Ant1	83.19	0.8	1.06
NVNT	n40	5550	Ant1	84.07	0.75	1.05
NVNT	n40	5670	Ant1	87.16	0.6	1.05
NVNT	ac20	5500	Ant1	91.04	0.41	0.52
NVNT	ac20	5580	Ant1	91.04	0.41	0.52
NVNT	ac20	5700	Ant1	91.47	0.39	0.52
NVNT	ac40	5510	Ant1	80.51	0.94	1.05
NVNT	ac40	5550	Ant1	80.51	0.94	1.05
NVNT	ac40	5670	Ant1	81.2	0.9	1.05
NVNT	ac80	5530	Ant1	73.02	1.37	2.17
NVNT	ac80	5610	Ant1	65.71	1.82	2.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

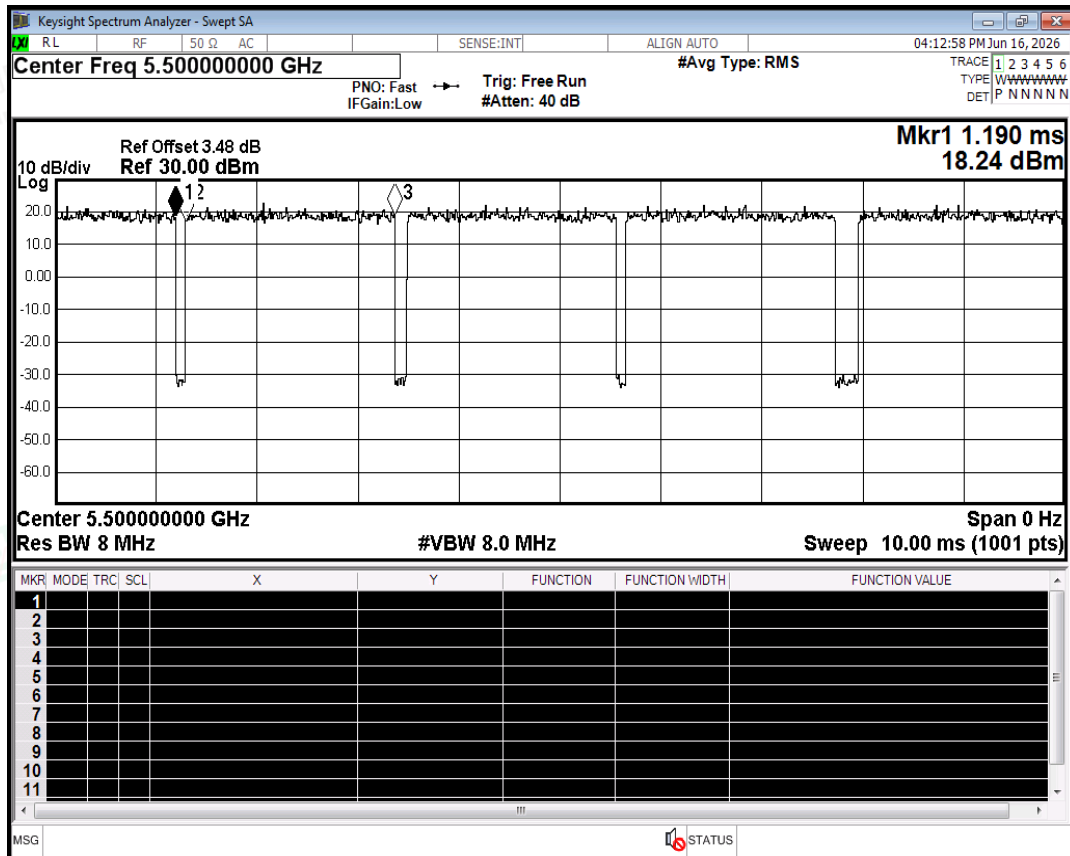

Duty Cycle NVNT a 5500MHz Ant1

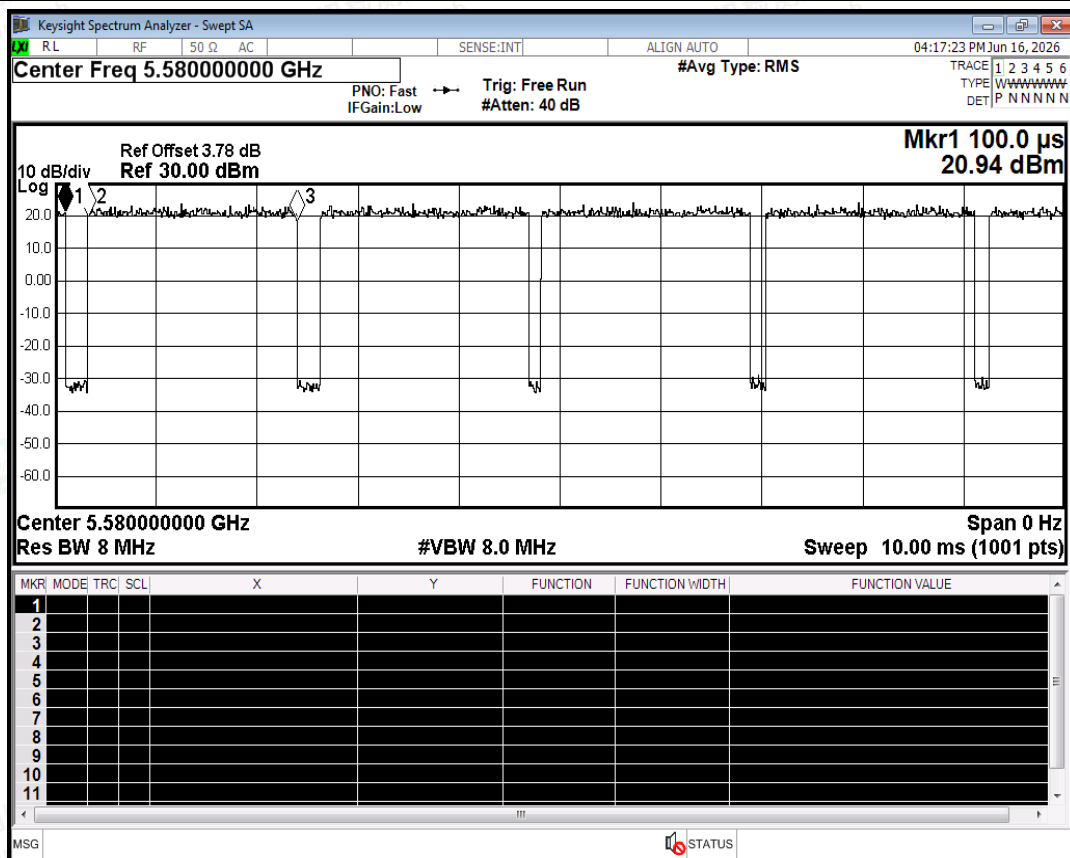

Duty Cycle NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

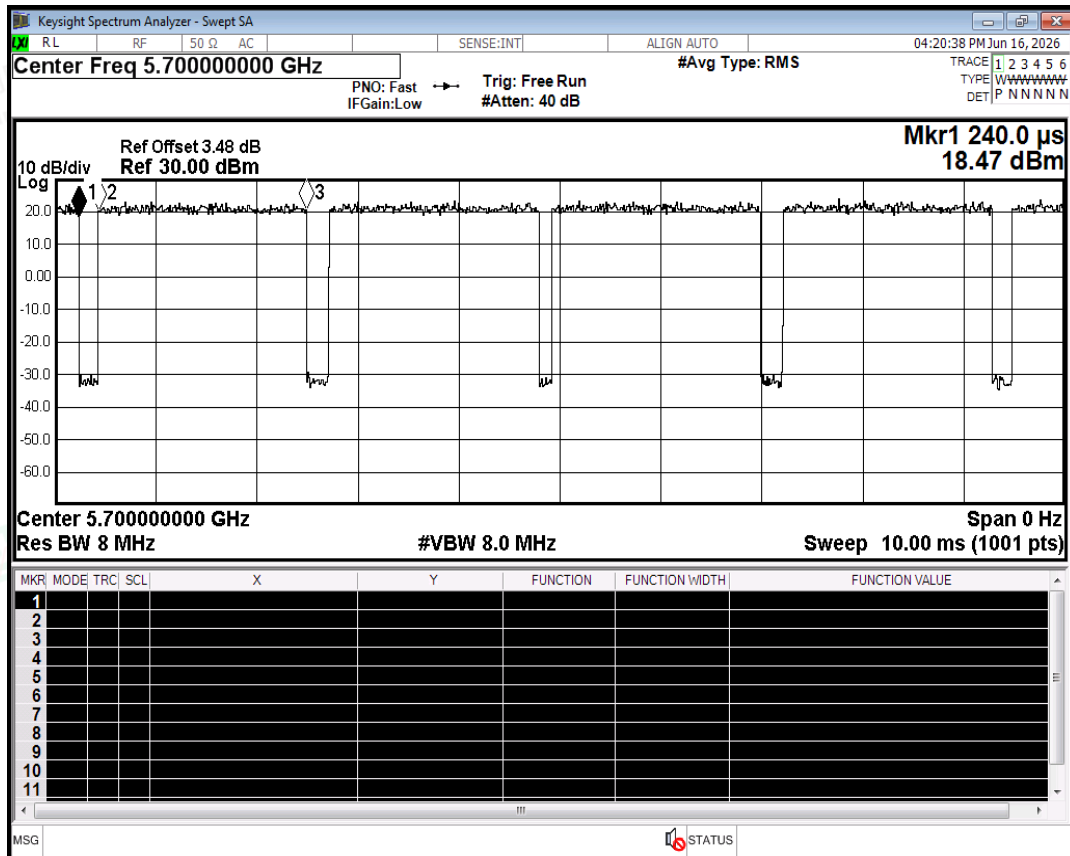

Duty Cycle NVNT a 5700MHz Ant1

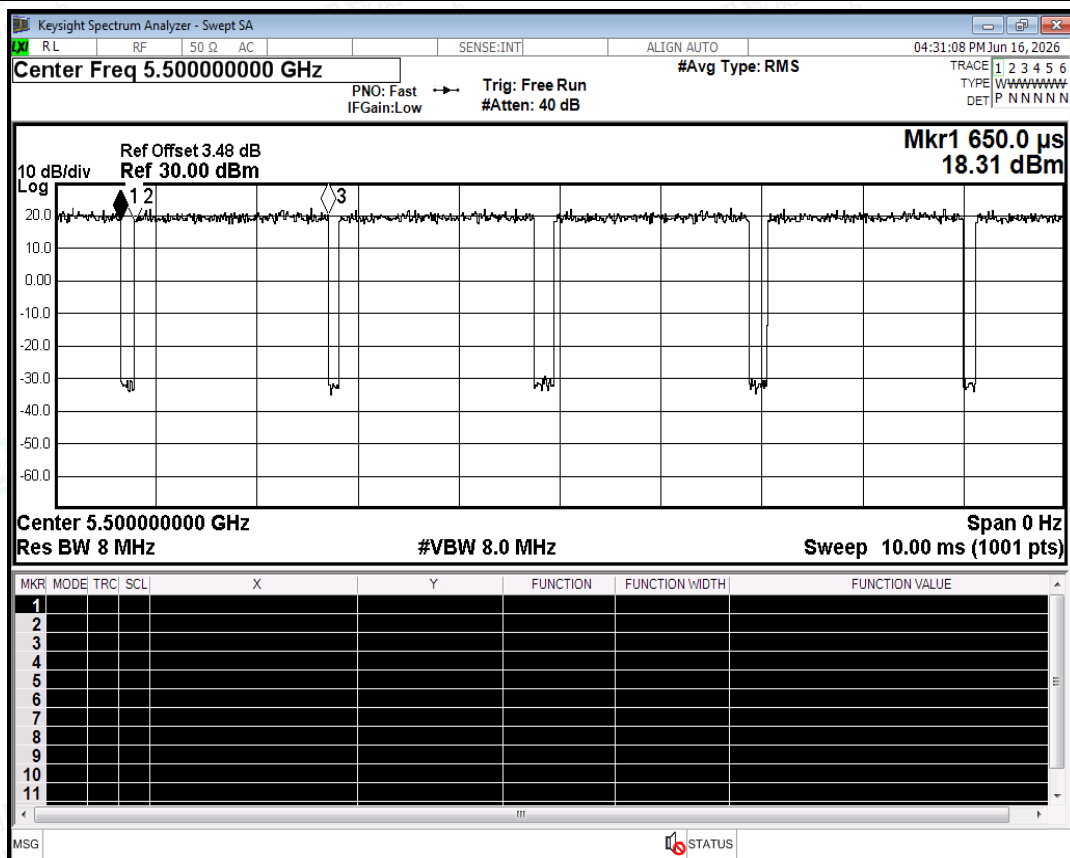

Duty Cycle NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

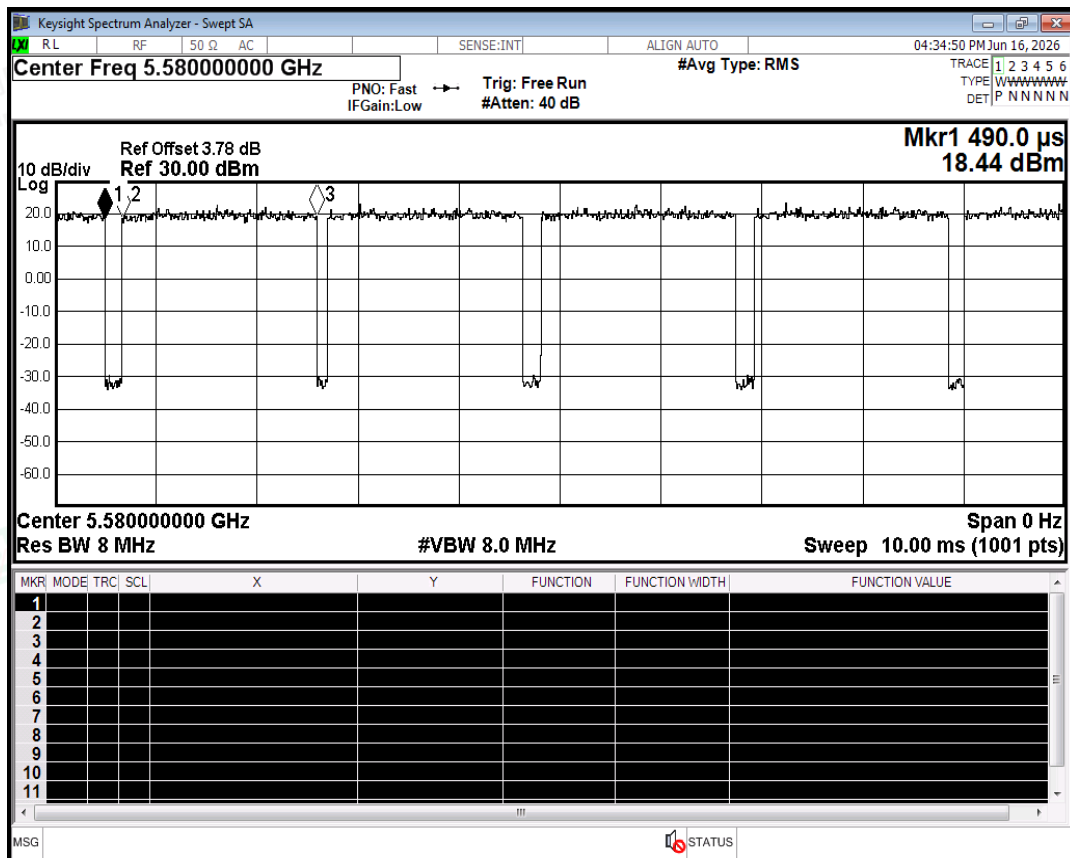

Duty Cycle NVNT n20 5580MHz Ant1

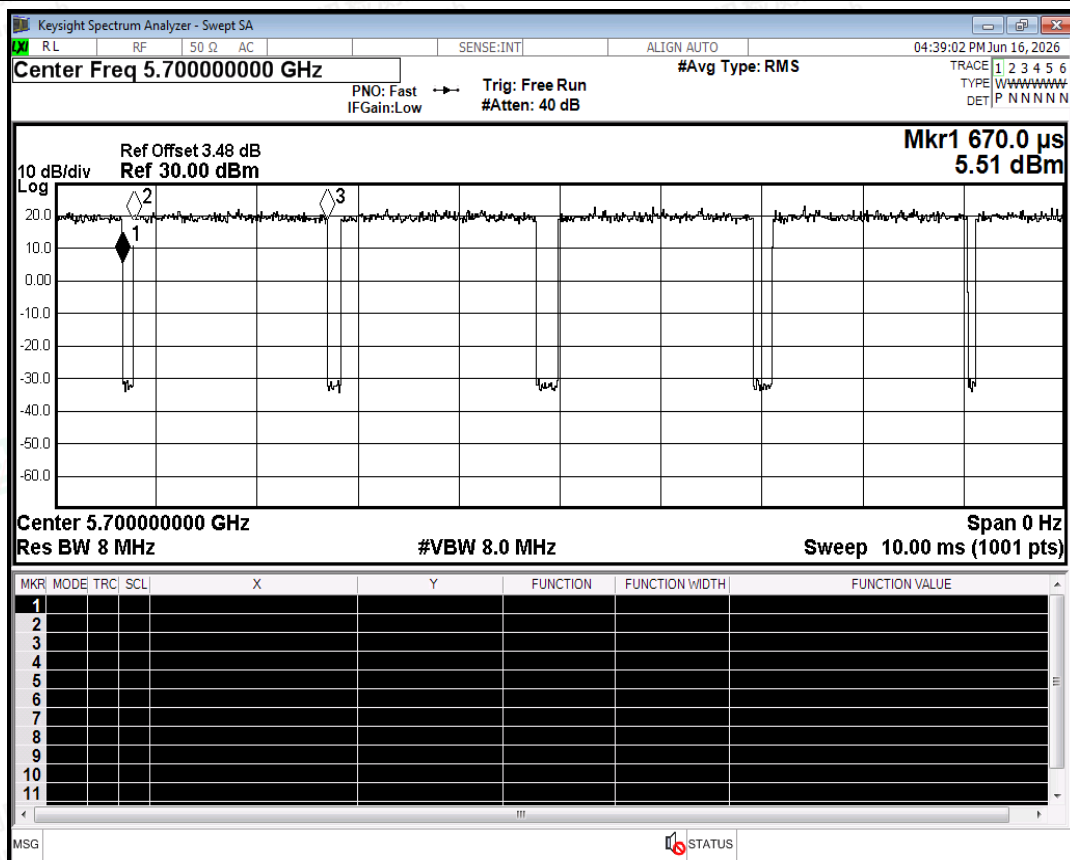

Duty Cycle NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

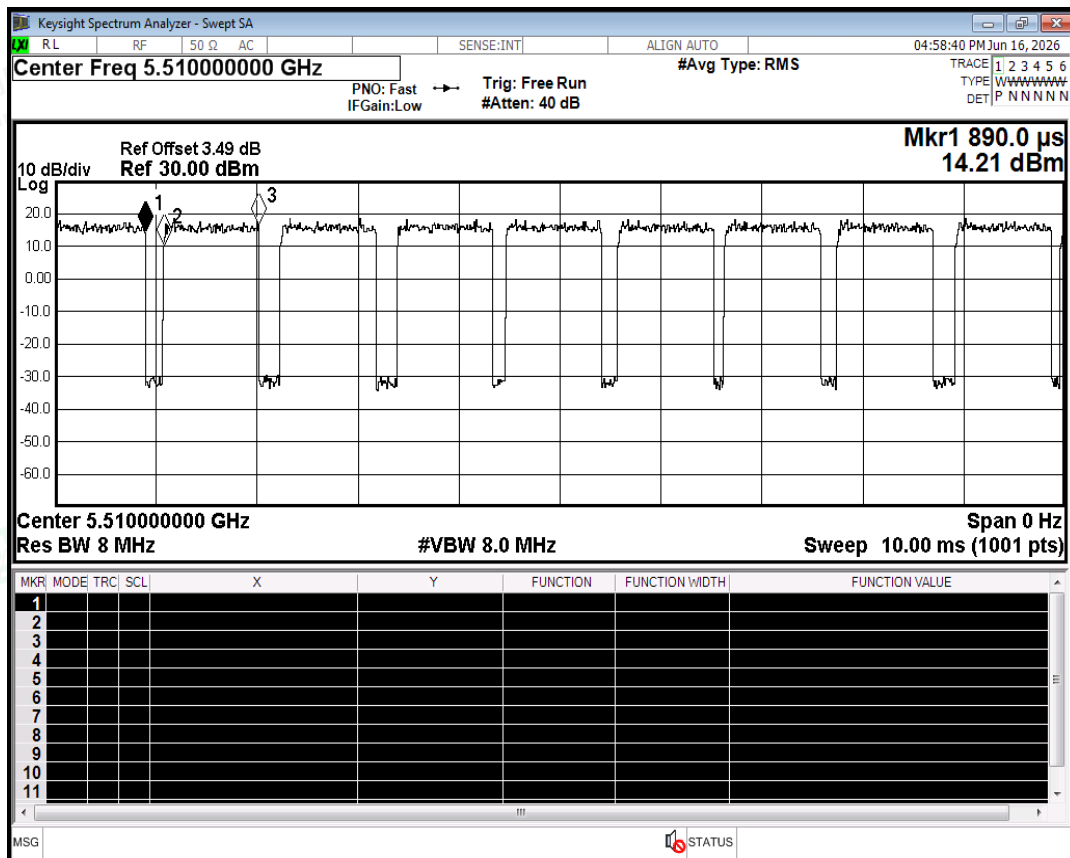

Duty Cycle NVNT n40 5510MHz Ant1

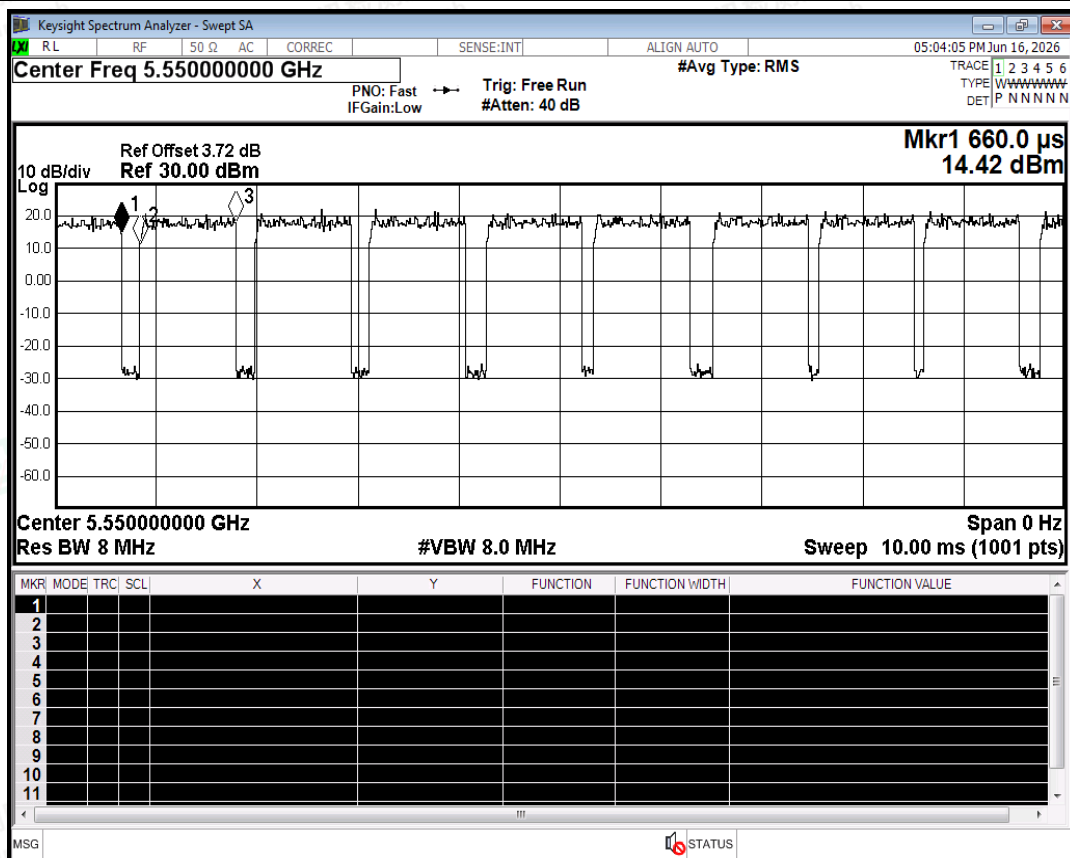

Duty Cycle NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

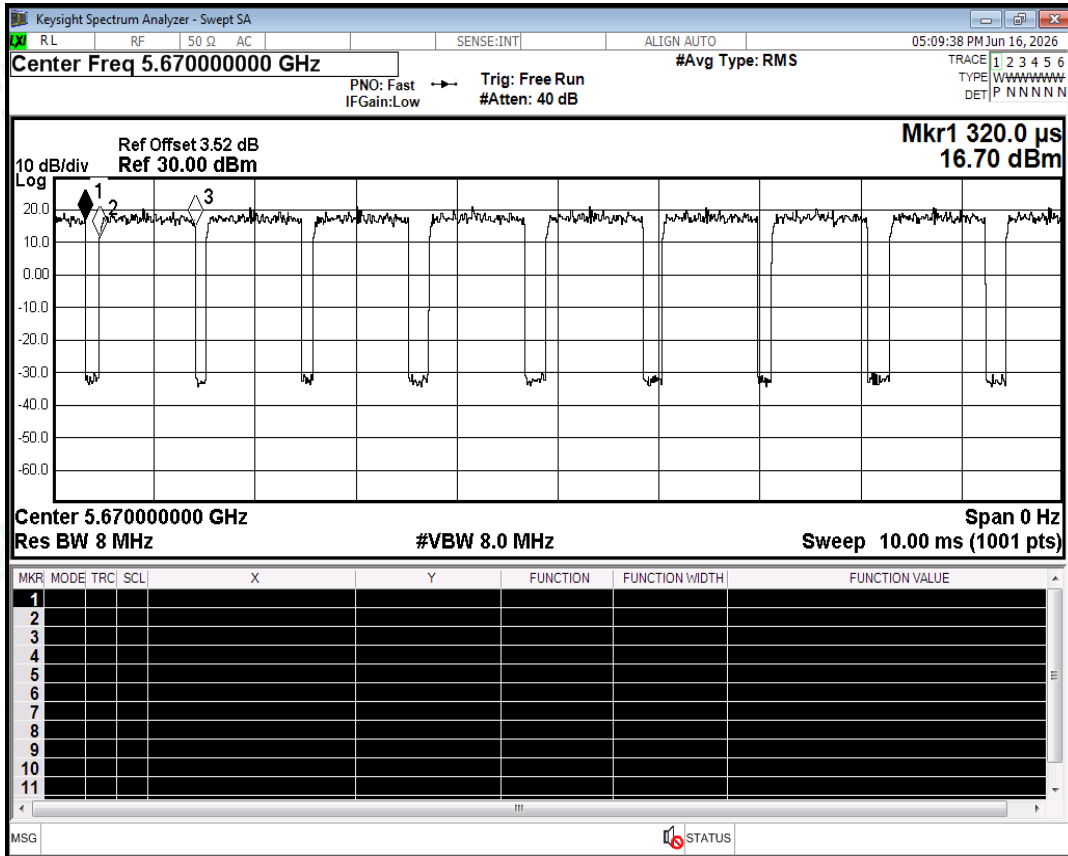

Duty Cycle NVNT n40 5670MHz Ant1

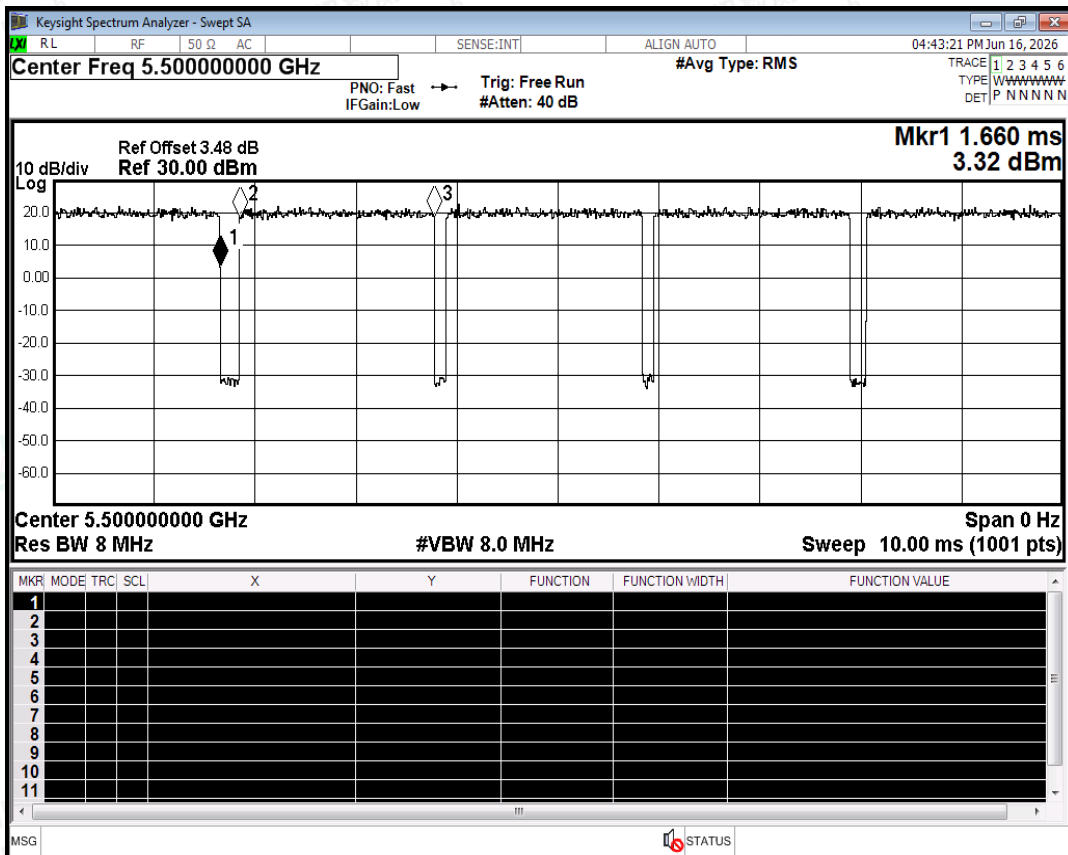

Duty Cycle NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

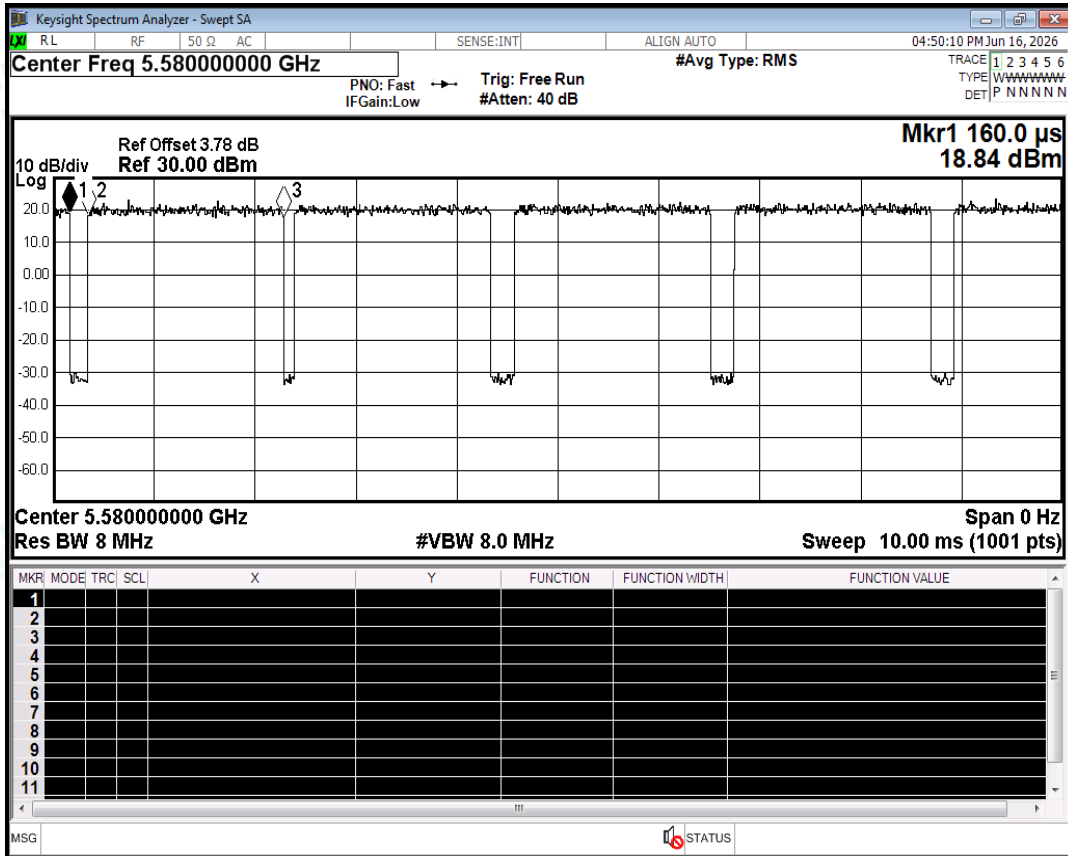

Duty Cycle NVNT ac20 5580MHz Ant1

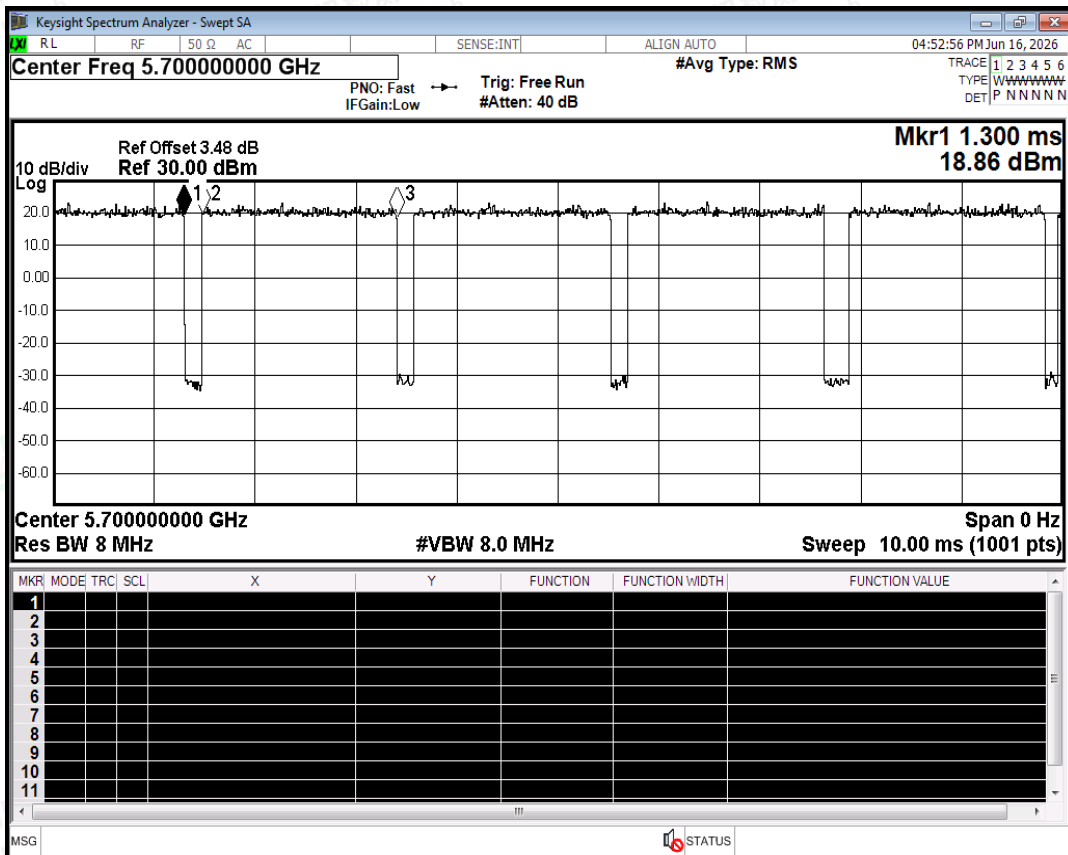

Duty Cycle NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

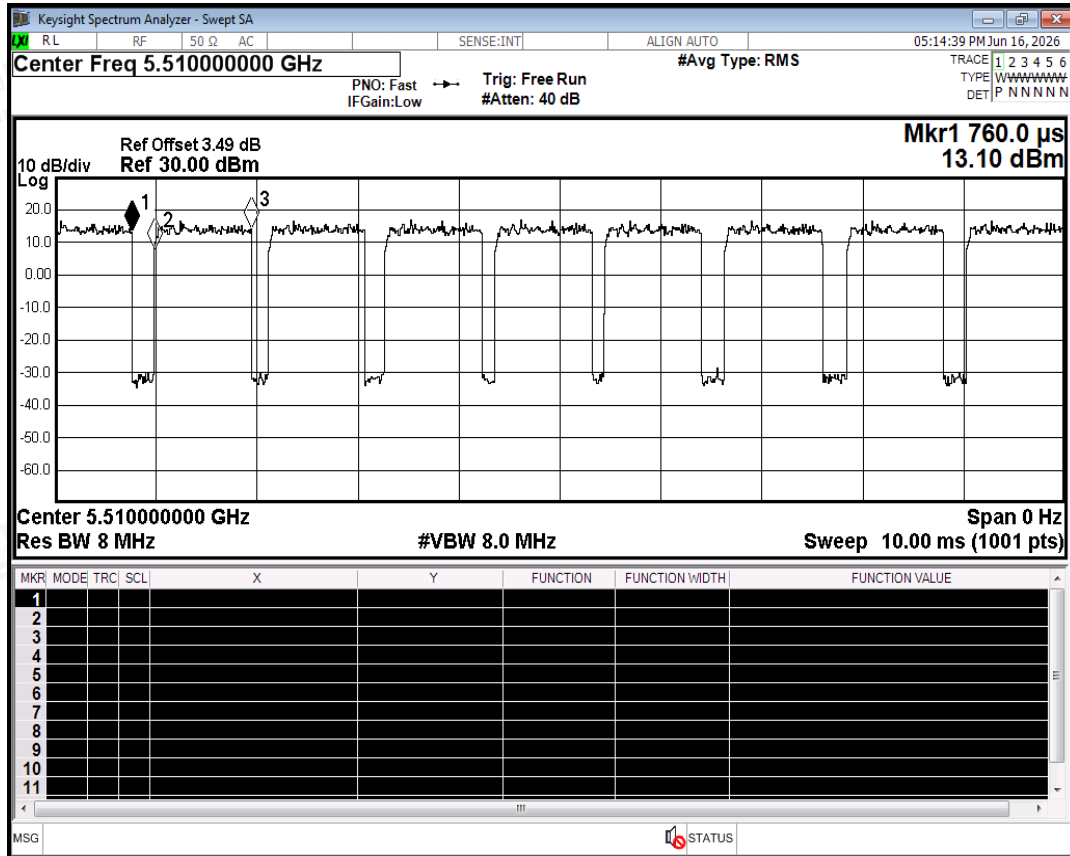

Duty Cycle NVNT ac40 5510MHz Ant1

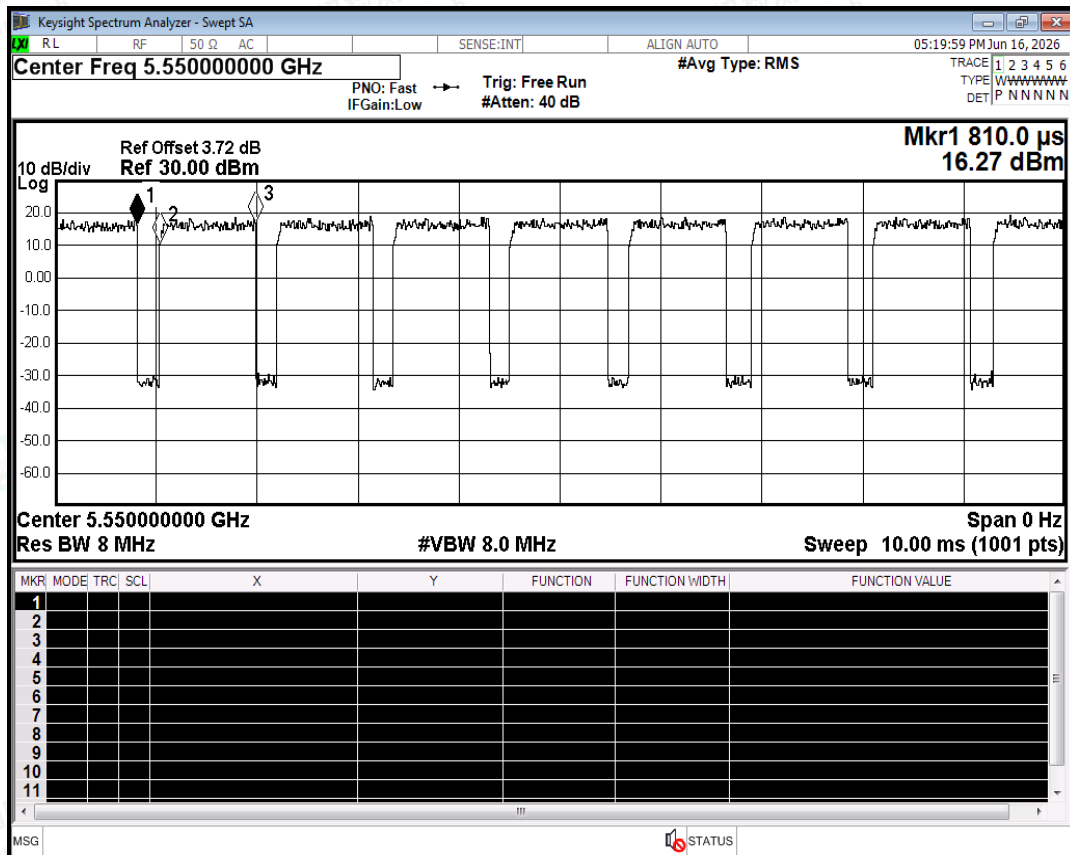

Duty Cycle NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

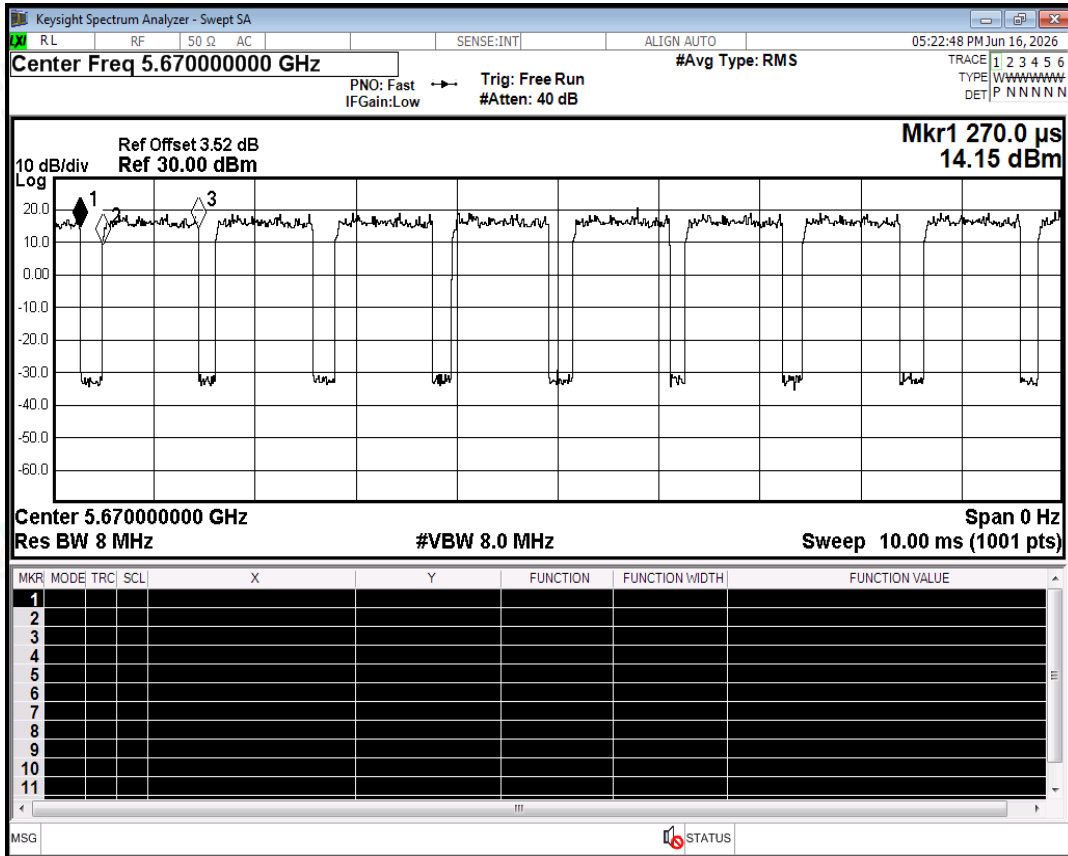

Duty Cycle NVNT ac40 5670MHz Ant1

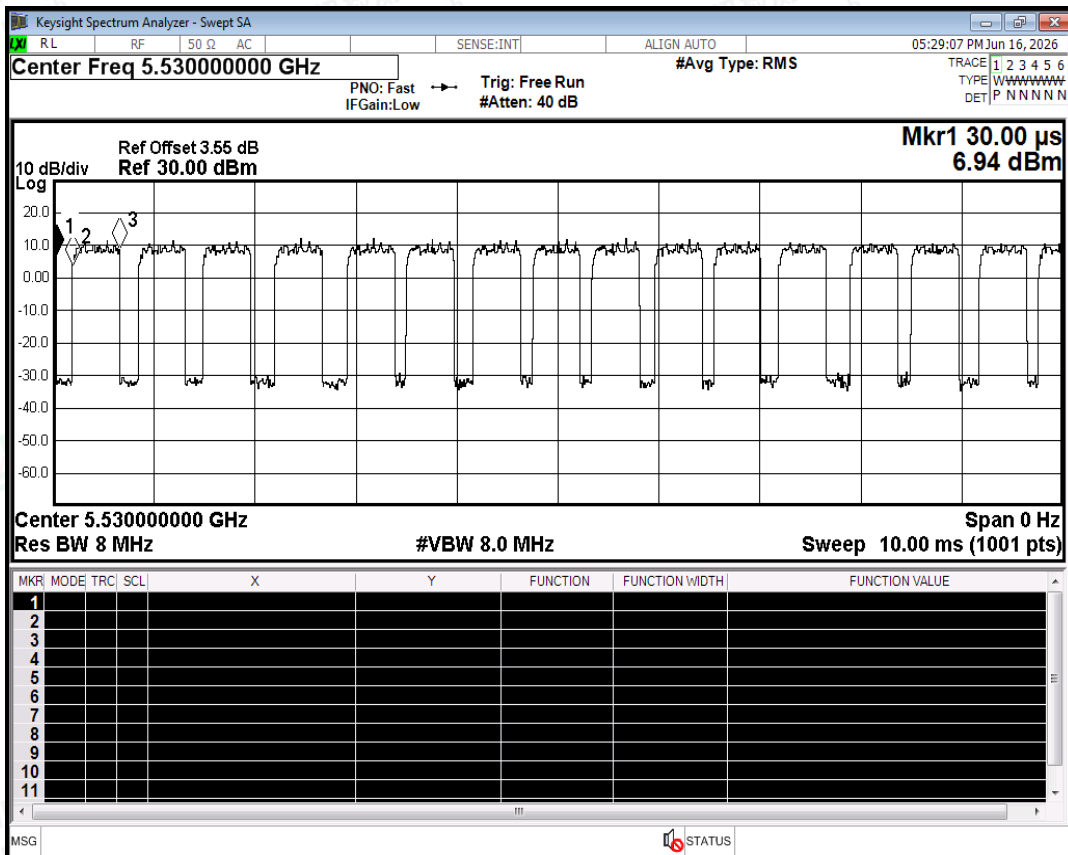

Duty Cycle NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

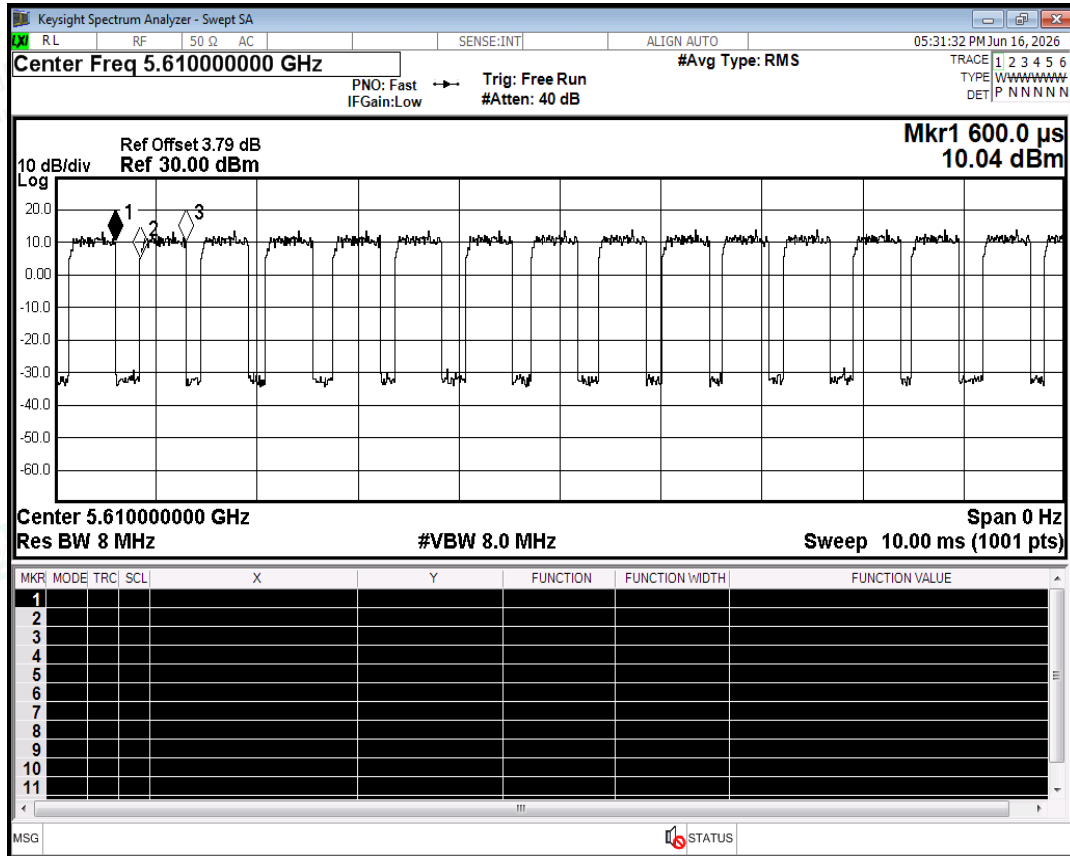

Duty Cycle NVNT ac80 5610MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity