



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	EIRP (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	5650	-48.92	2.17	-46.75	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-56.58	2.17	-54.41	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-40.24	2.17	-38.07	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-51.46	2.17	-49.29	Average	10	Pass
NVNT	a	5745	Ant1	5720	-29.95	2.17	-27.78	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-37.25	2.17	-35.08	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-18.9	2.17	-16.73	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-29.08	2.17	-26.91	Average	27	Pass
NVNT	a	5825	Ant1	5850	-30.5	2.17	-28.33	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-38.91	2.17	-36.74	Average	27	Pass
NVNT	a	5825	Ant1	5855	-34.2	2.17	-32.03	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-43.43	2.17	-41.26	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-47.34	2.17	-45.17	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-54.68	2.17	-52.51	Average	10	Pass
NVNT	a	5825	Ant1	5925	-47.8	2.17	-45.63	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-55.89	2.17	-53.72	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-50.2	2.17	-48.03	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-56.76	2.17	-54.59	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-43.24	2.17	-41.07	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-52.83	2.17	-50.66	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-28.58	2.17	-26.41	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-37.6	2.17	-35.43	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-19.78	2.17	-17.61	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-31.92	2.17	-29.75	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-27.52	2.17	-25.35	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-36.78	2.17	-34.61	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-34.44	2.17	-32.27	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-41.9	2.17	-39.73	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-45.97	2.17	-43.80	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-54.3	2.17	-52.13	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-49.49	2.17	-47.32	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-55.69	2.17	-53.52	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-48.39	2.17	-46.22	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-55.7	2.17	-53.53	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-35.33	2.17	-33.16	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-43.89	2.17	-41.72	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-23.43	2.17	-21.26	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-33.35	2.17	-31.18	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-18.21	2.17	-16.04	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-32.08	2.17	-29.91	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-36.33	2.17	-34.16	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5795	Ant1	5850	-46.87	2.17	-44.70	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-38.88	2.17	-36.71	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-49.16	2.17	-46.99	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-46.88	2.17	-44.71	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-53.61	2.17	-51.44	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-49.29	2.17	-47.12	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-55.56	2.17	-53.39	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-48.48	2.17	-46.31	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-56.68	2.17	-54.51	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-43.39	2.17	-41.22	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-52.04	2.17	-49.87	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-26.27	2.17	-24.10	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-36.41	2.17	-34.24	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-18.97	2.17	-16.80	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-30.27	2.17	-28.10	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-29.09	2.17	-26.92	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-38.5	2.17	-36.33	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-33.57	2.17	-31.40	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-43.3	2.17	-41.13	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-48.15	2.17	-45.98	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-54.85	2.17	-52.68	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-47.67	2.17	-45.50	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-55.77	2.17	-53.60	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-48.84	2.17	-46.67	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-55.67	2.17	-53.50	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-37.43	2.17	-35.26	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-44.13	2.17	-41.96	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-18.6	2.17	-16.43	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-34.36	2.17	-32.19	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-23.8	2.17	-21.63	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-32.87	2.17	-30.70	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-37.27	2.17	-35.10	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-46.73	2.17	-44.56	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-40.42	2.17	-38.25	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-48.97	2.17	-46.80	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-47.41	2.17	-45.24	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-53.63	2.17	-51.46	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-48.33	2.17	-46.16	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-55.43	2.17	-53.26	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-29.68	2.17	-27.51	Peak	27	Pass
NVNT	ac80	5775	Ant1	5850	-39.81	2.17	-37.64	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-32.49	2.17	-30.32	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-41.21	2.17	-39.04	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-39.69	2.17	-37.52	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant1	5875	-46.98	2.17	-44.81	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-47.84	2.17	-45.67	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-53.87	2.17	-51.70	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-44.56	2.17	-42.39	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-50.92	2.17	-48.75	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-29.91	2.17	-27.74	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-38.78	2.17	-36.61	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-27.34	2.17	-25.17	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-35.53	2.17	-33.36	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-28.33	2.17	-26.16	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-35.72	2.17	-33.55	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

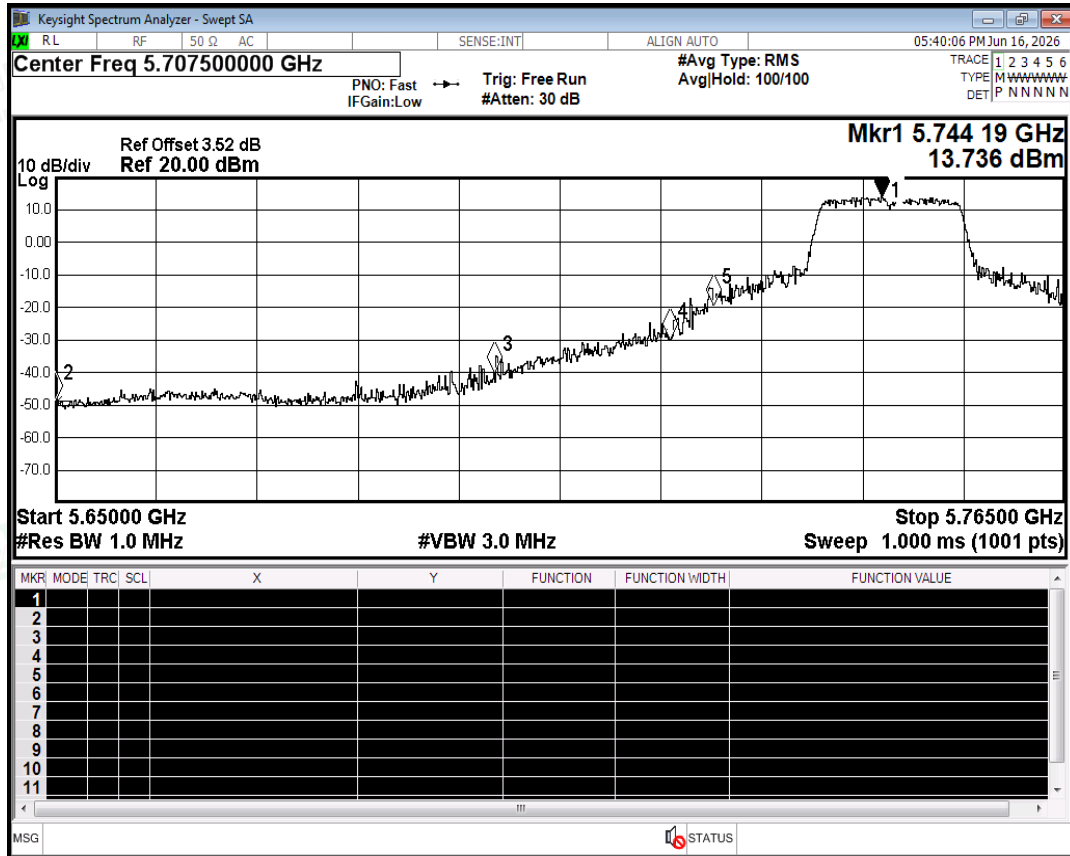

Restrict Band NVNT a 5745MHz Ant1 Peak

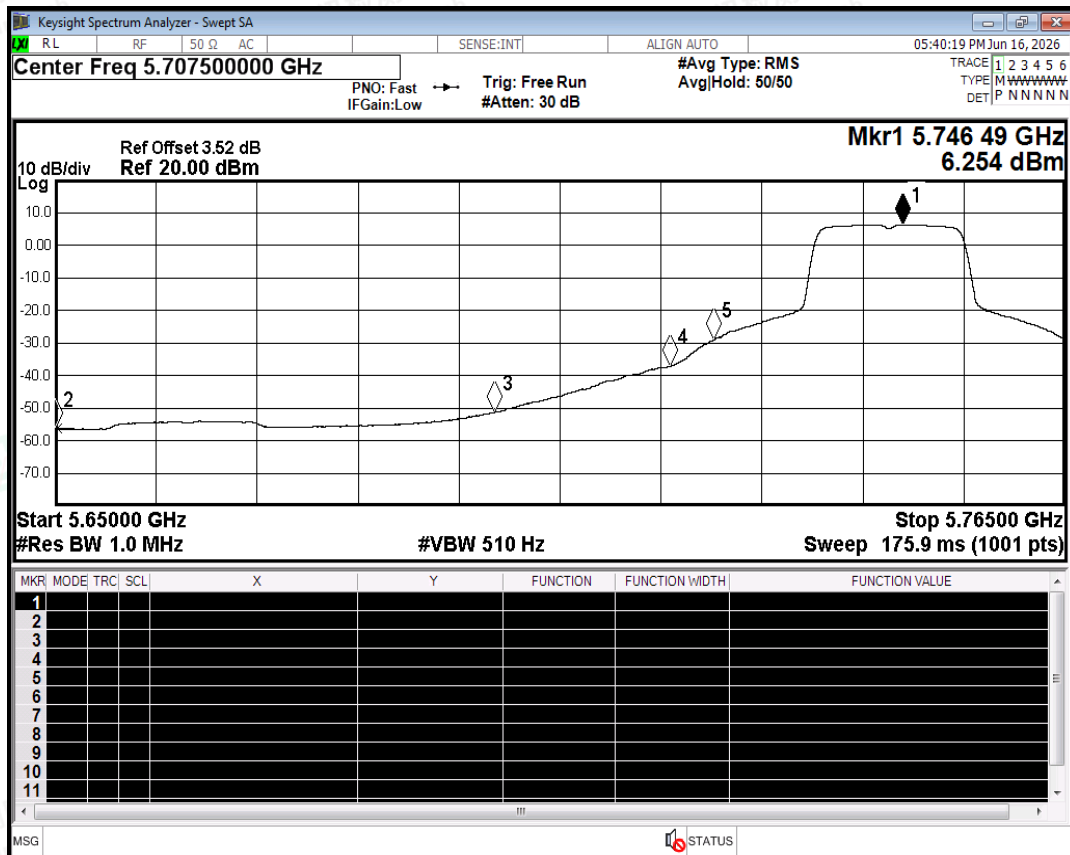

Restrict Band NVNT a 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

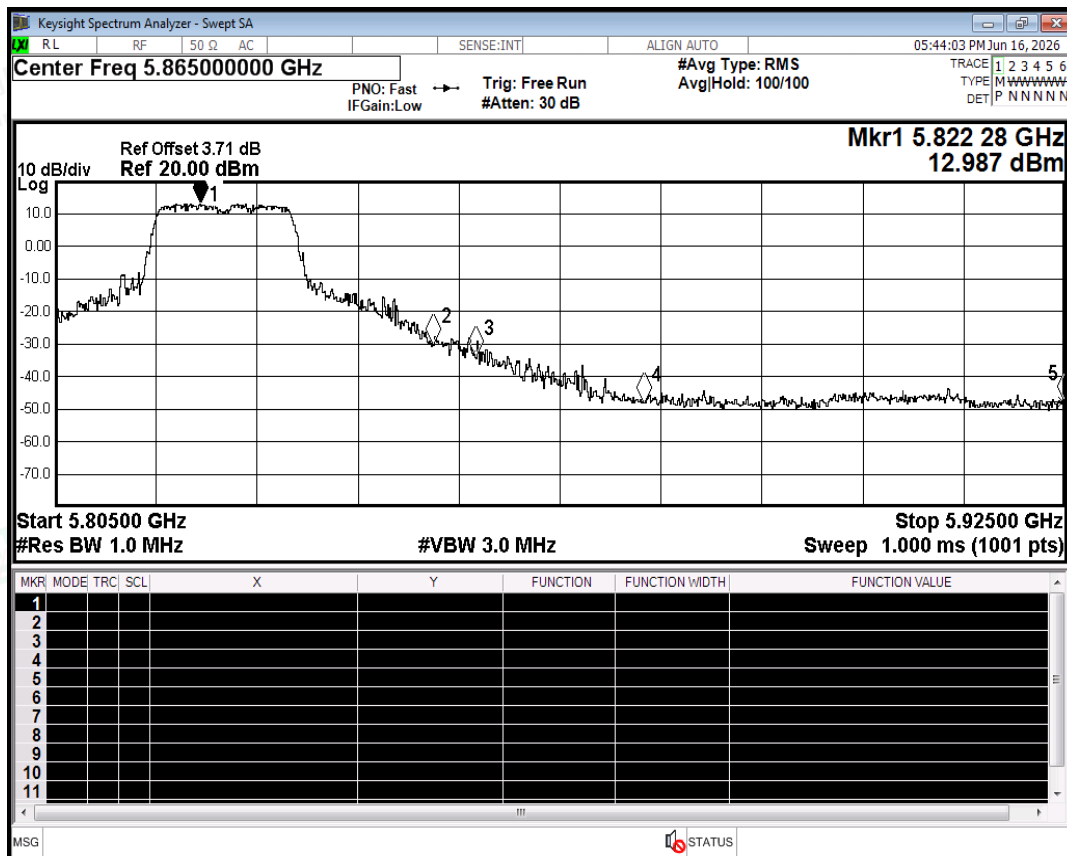


Restrict Band NVNT a 5825MHz Ant1 Peak

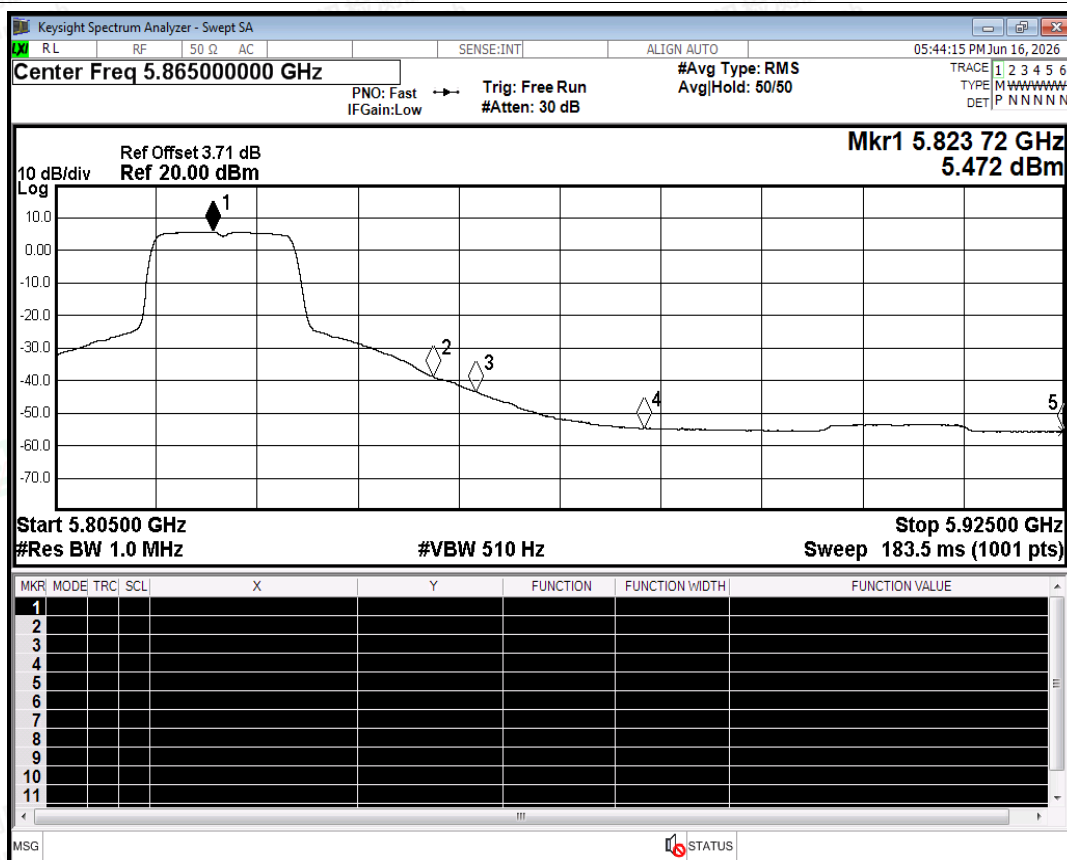


Restrict Band NVNT a 5825MHz Ant1 Average



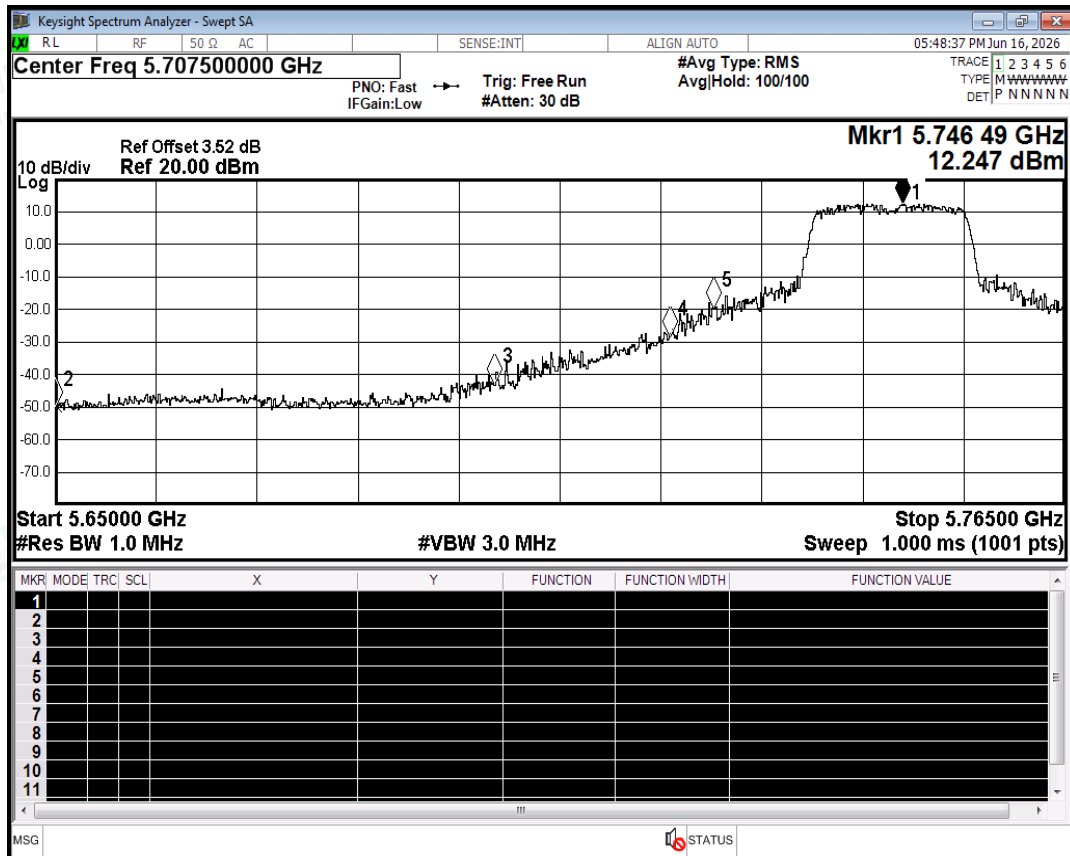

Restrict Band NVNT n20 5745MHz Ant1 Peak

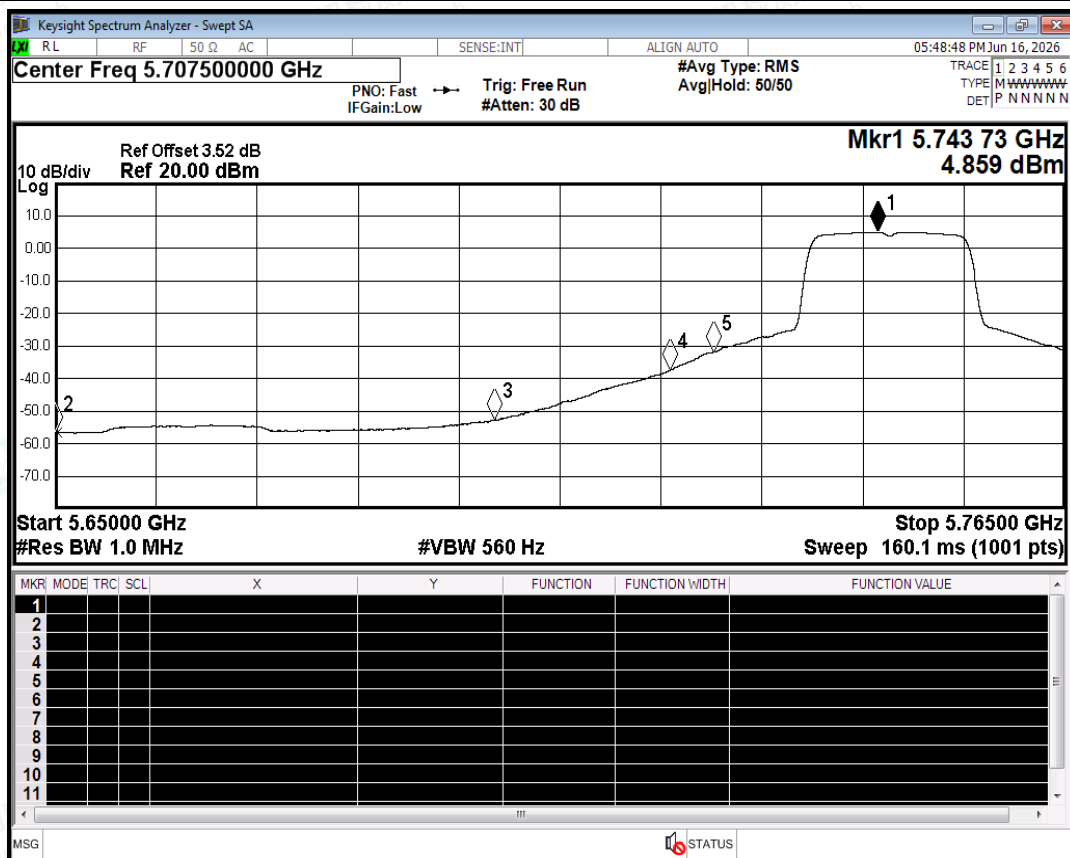

Restrict Band NVNT n20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

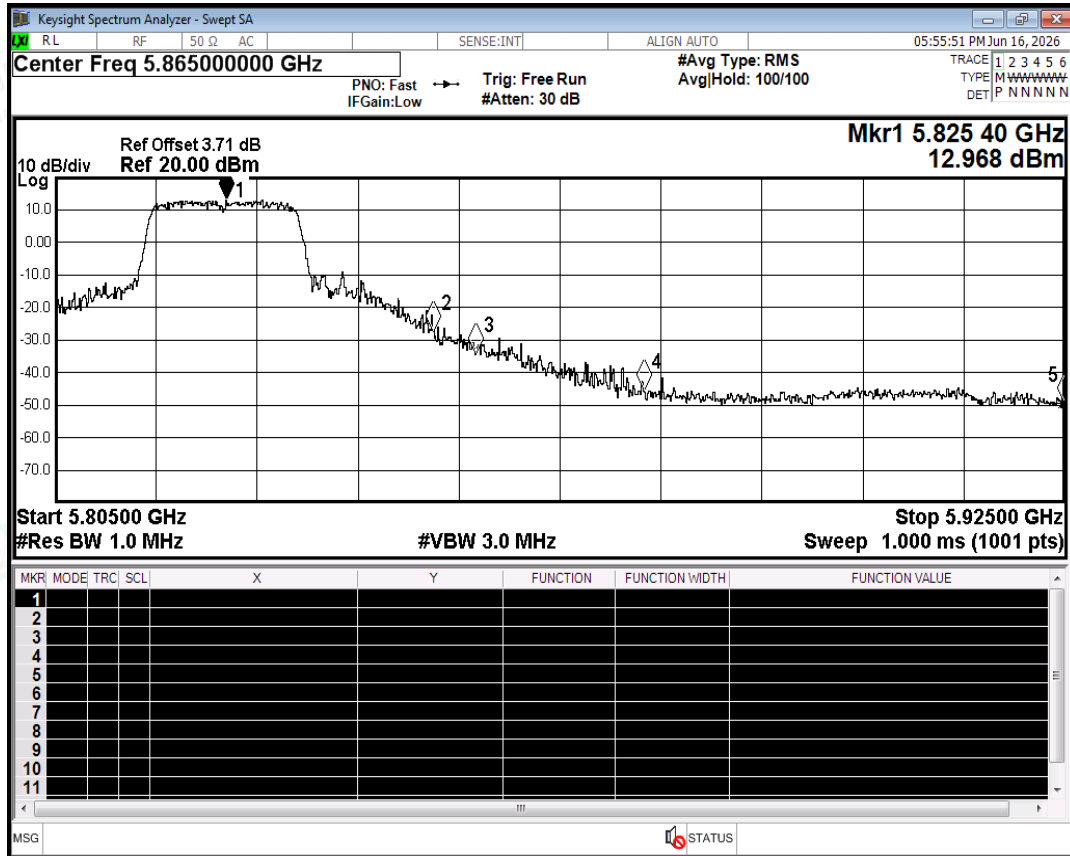

Restrict Band NVNT n20 5825MHz Ant1 Peak

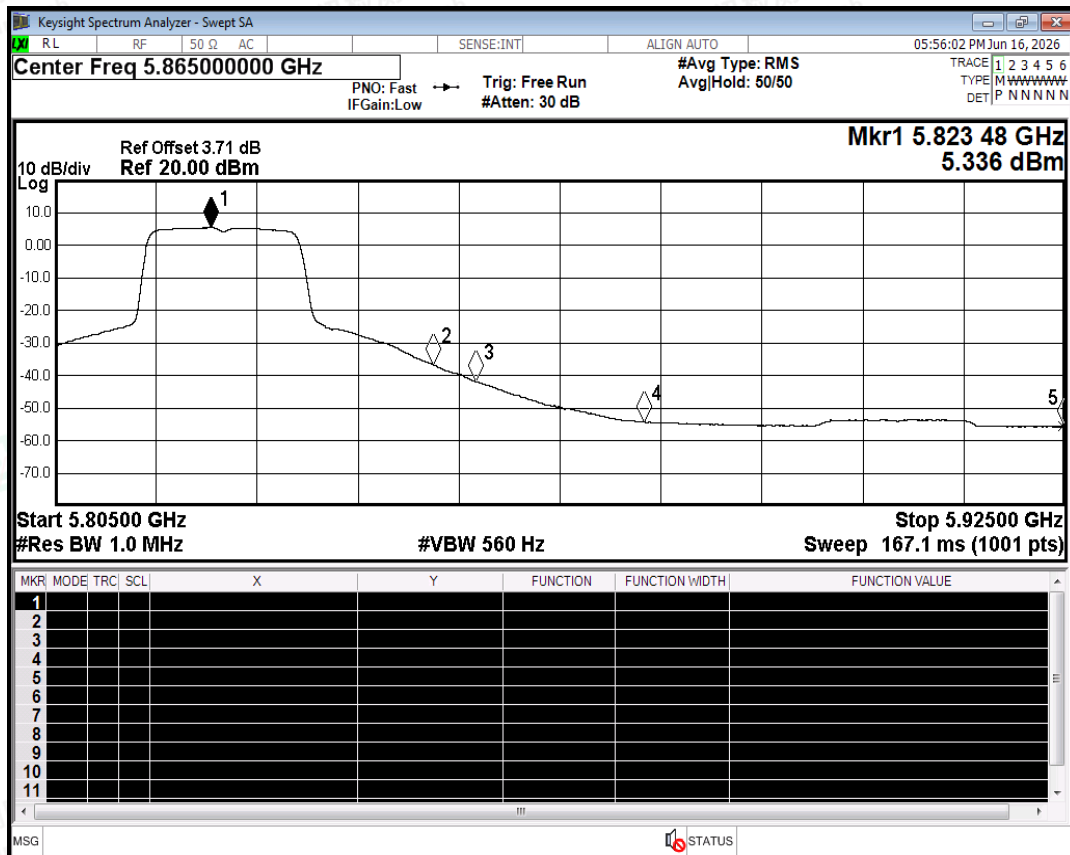

Restrict Band NVNT n20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

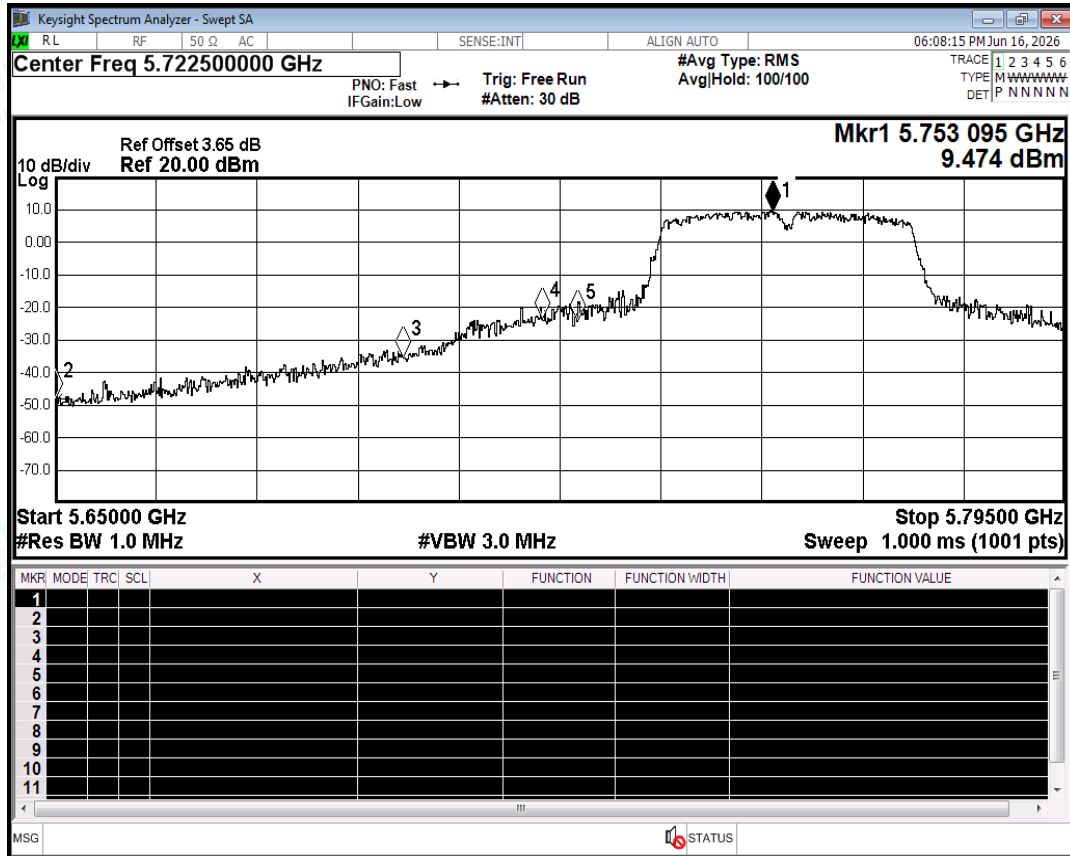

Restrict Band NVNT n40 5755MHz Ant1 Peak

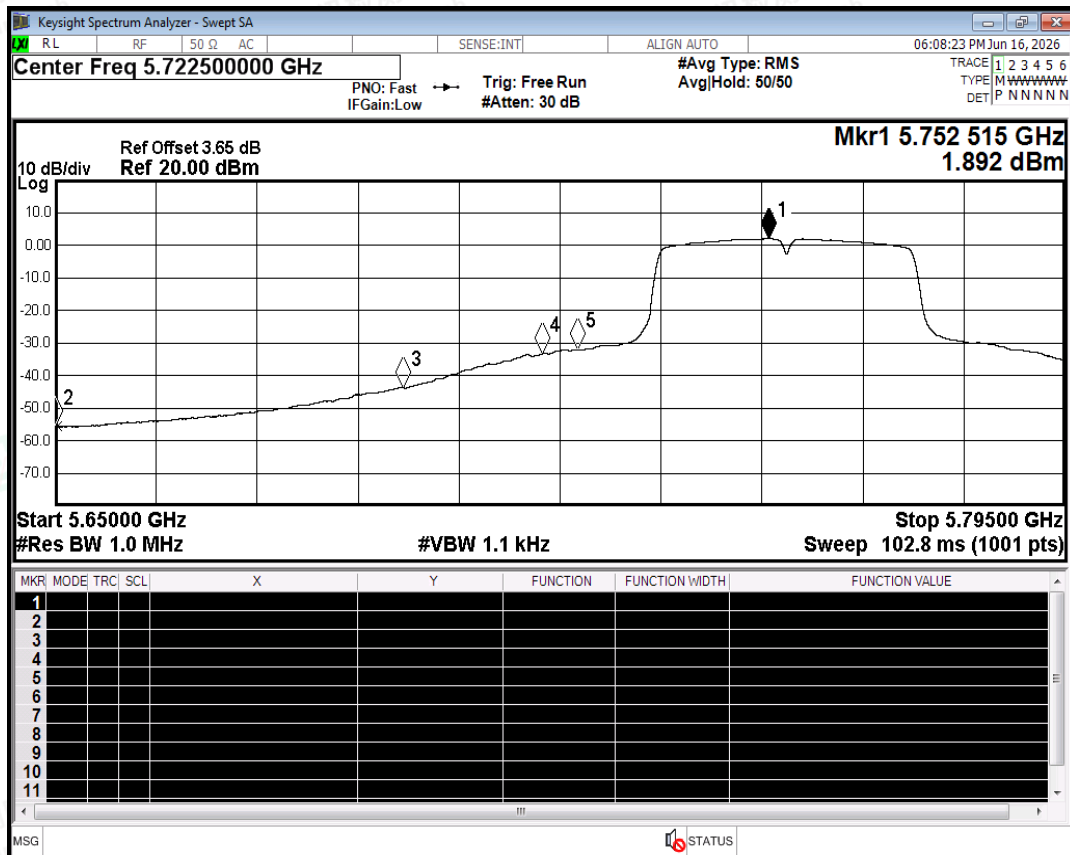

Restrict Band NVNT n40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

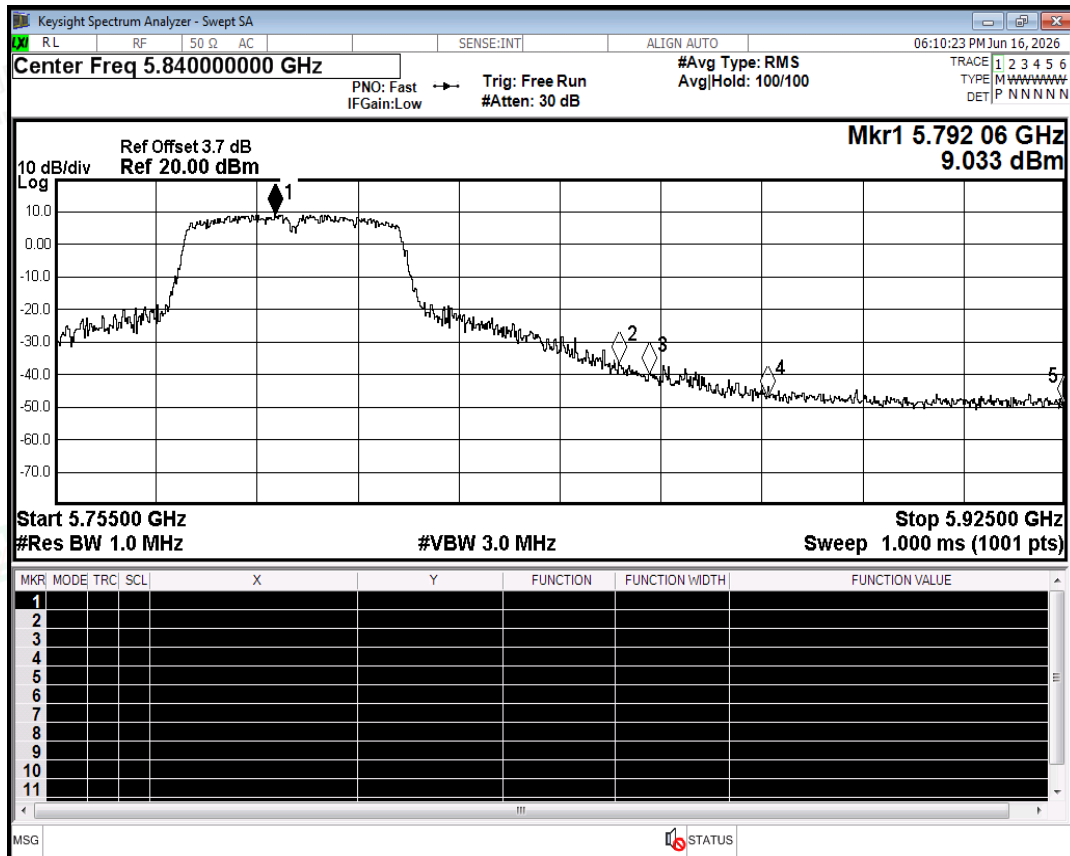

Restrict Band NVNT n40 5795MHz Ant1 Peak

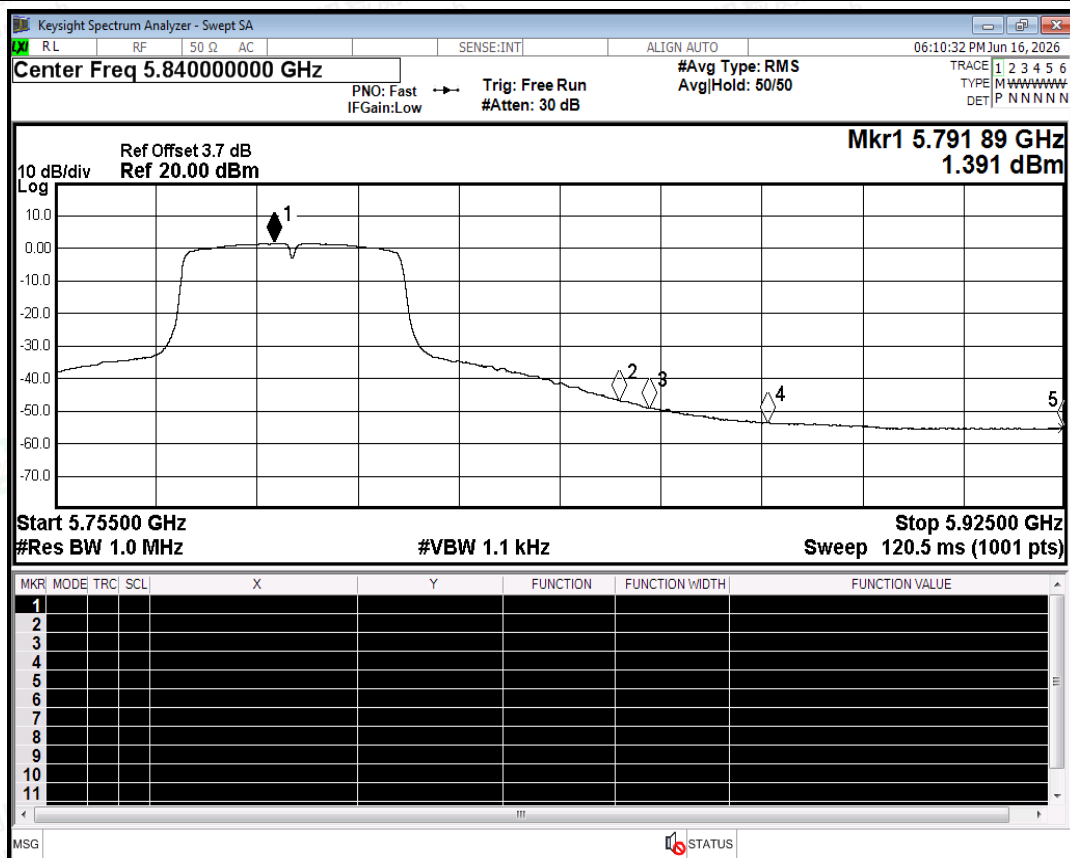

Restrict Band NVNT n40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

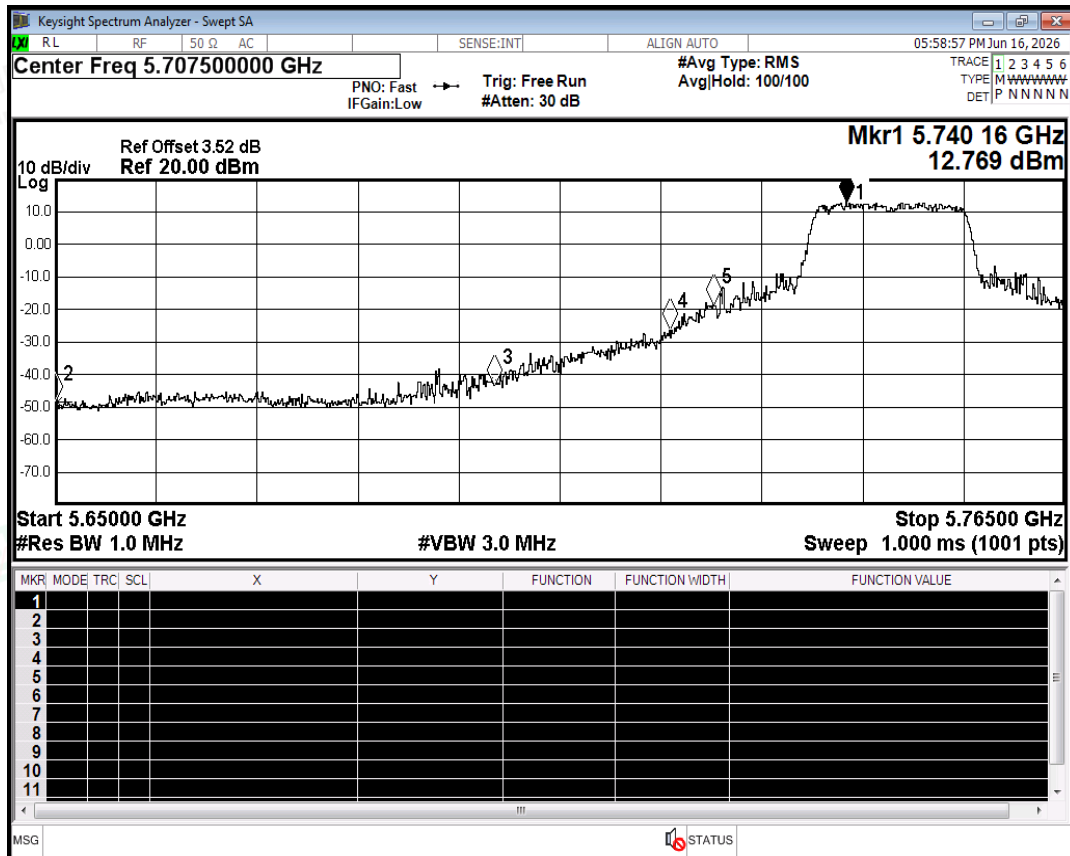

Restrict Band NVNT ac20 5745MHz Ant1 Peak

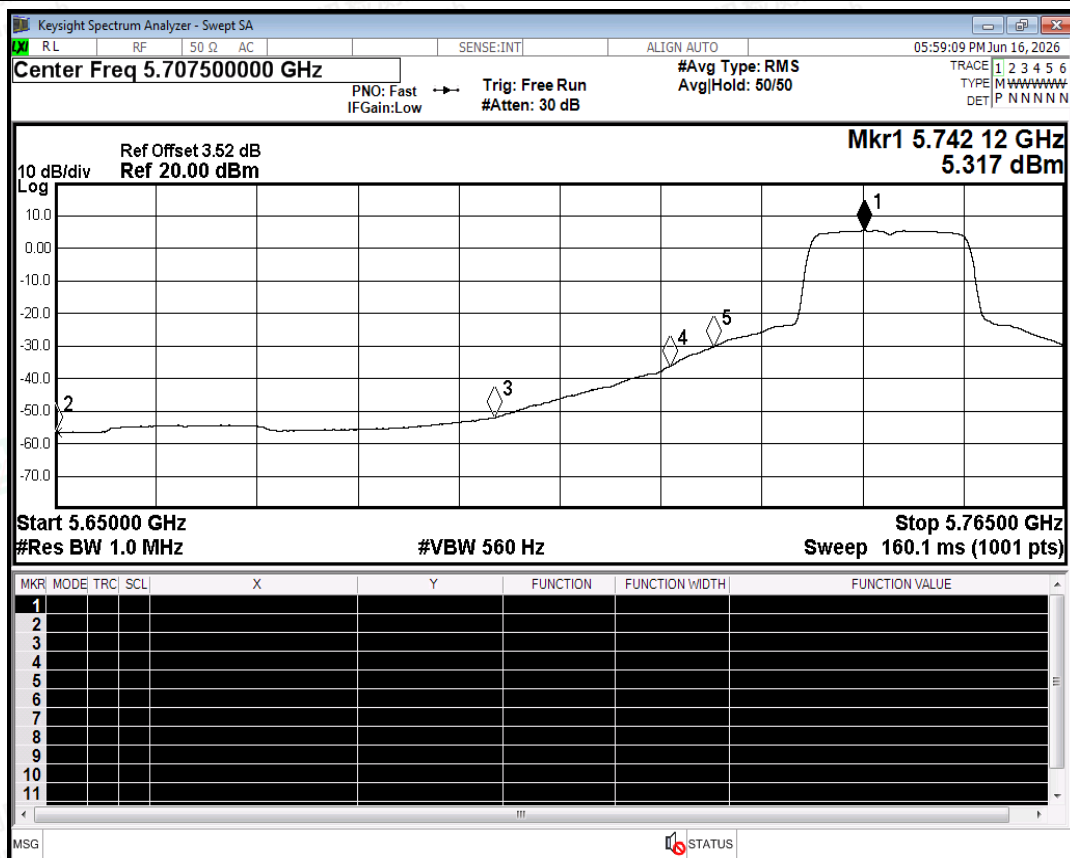

Restrict Band NVNT ac20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

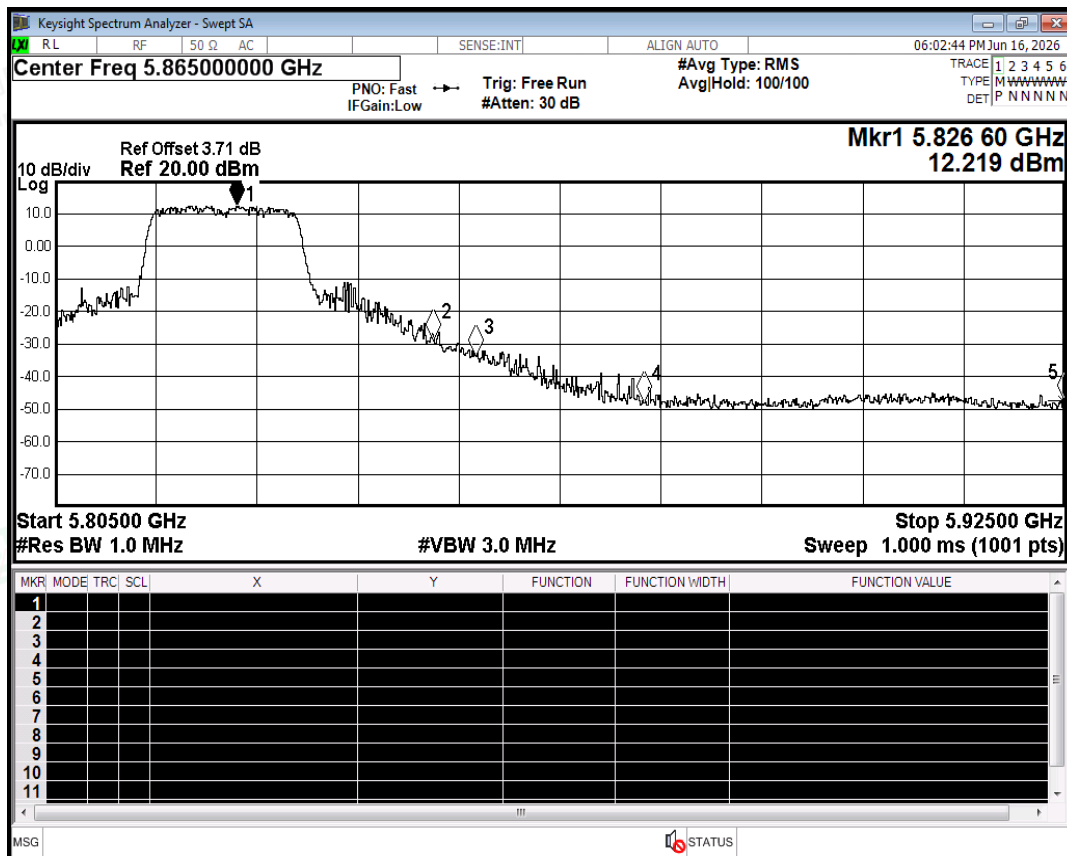


Restrict Band NVNT ac20 5825MHz Ant1 Peak

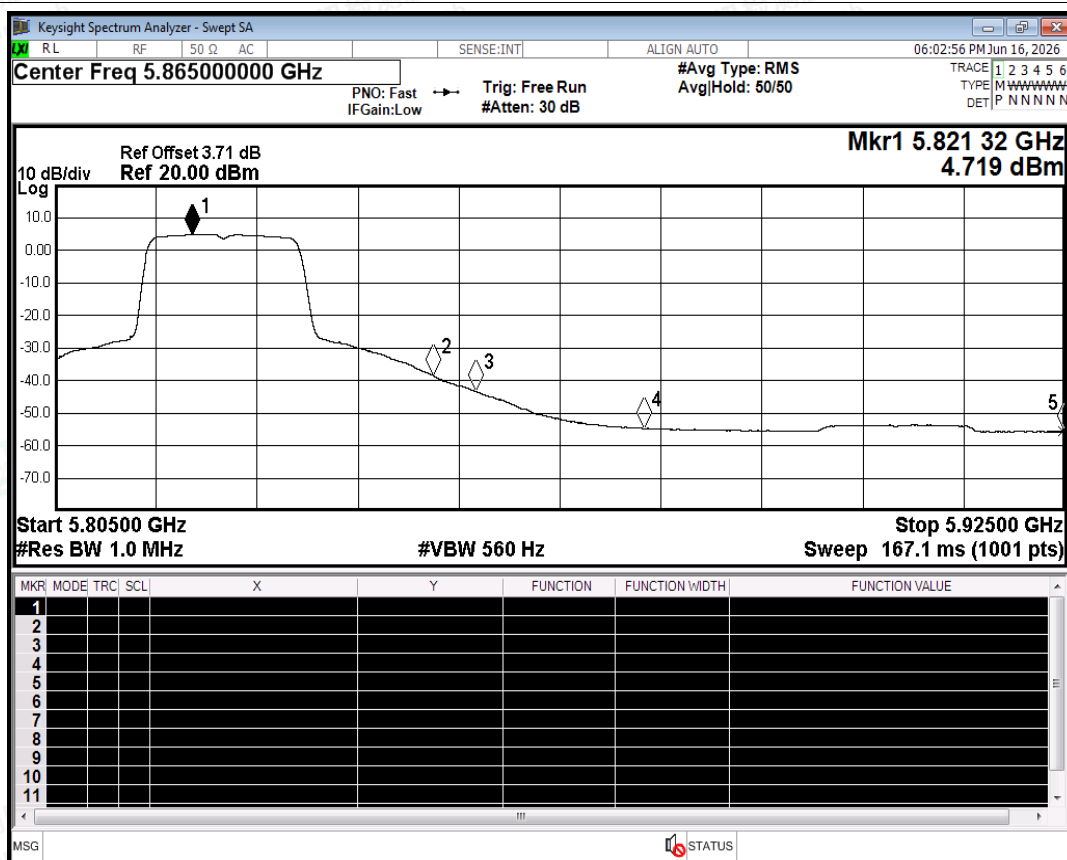


Restrict Band NVNT ac20 5825MHz Ant1 Average



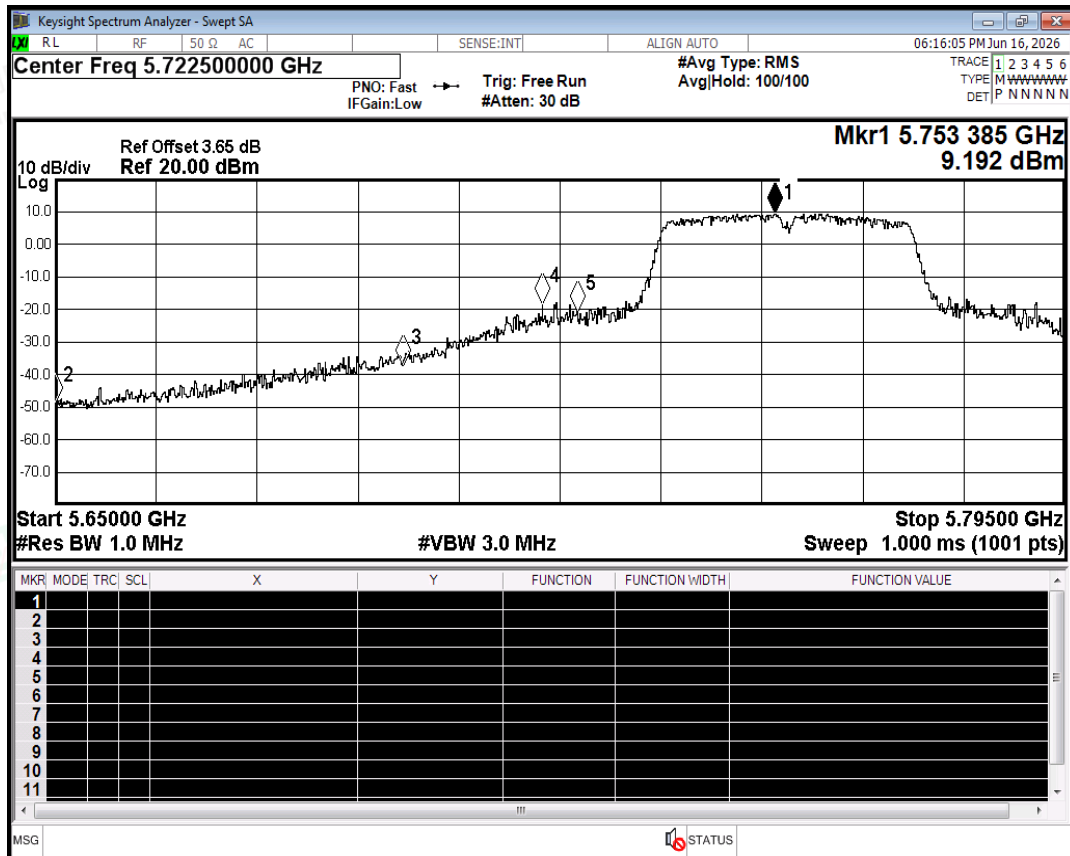

Restrict Band NVNT ac40 5755MHz Ant1 Peak

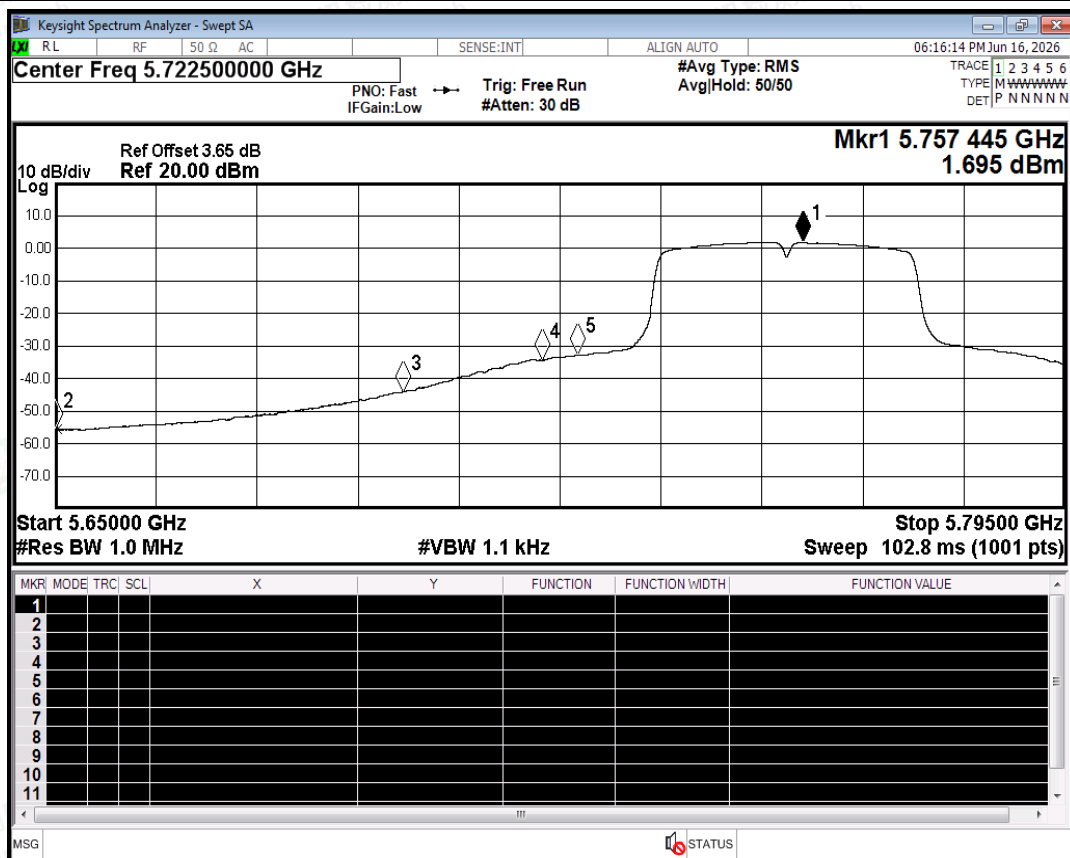

Restrict Band NVNT ac40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

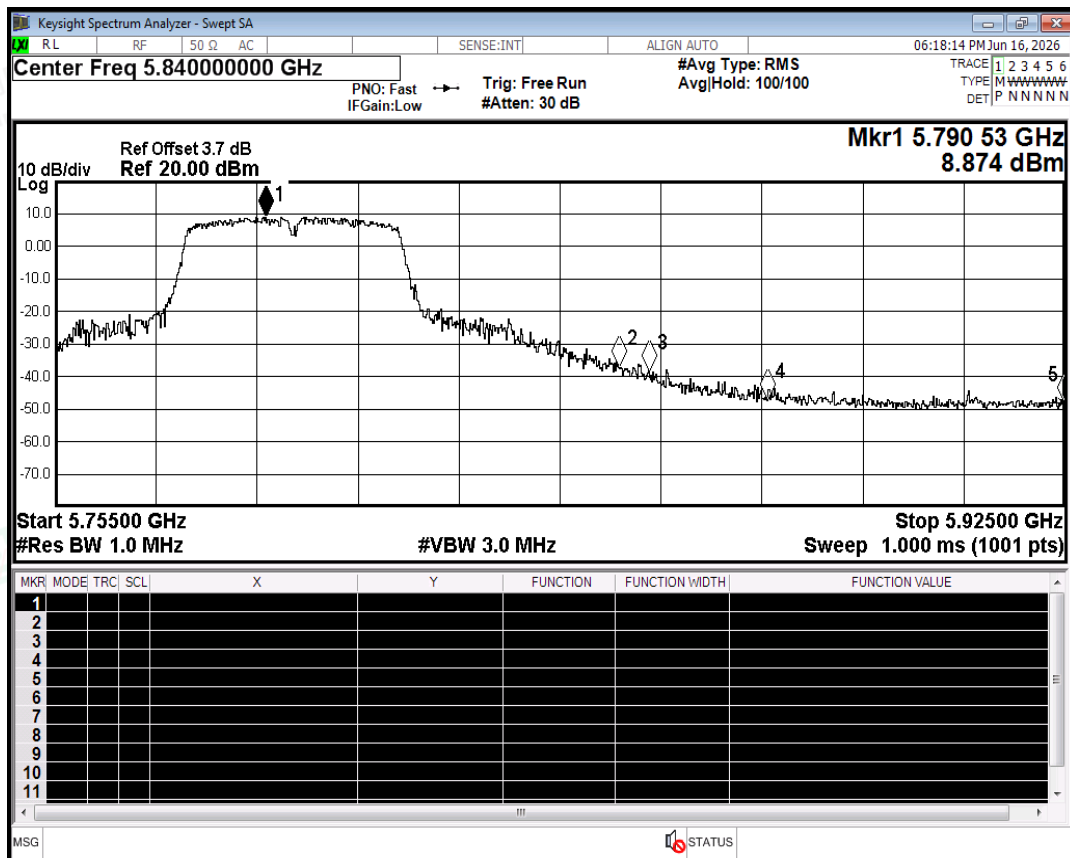

Restrict Band NVNT ac40 5795MHz Ant1 Peak

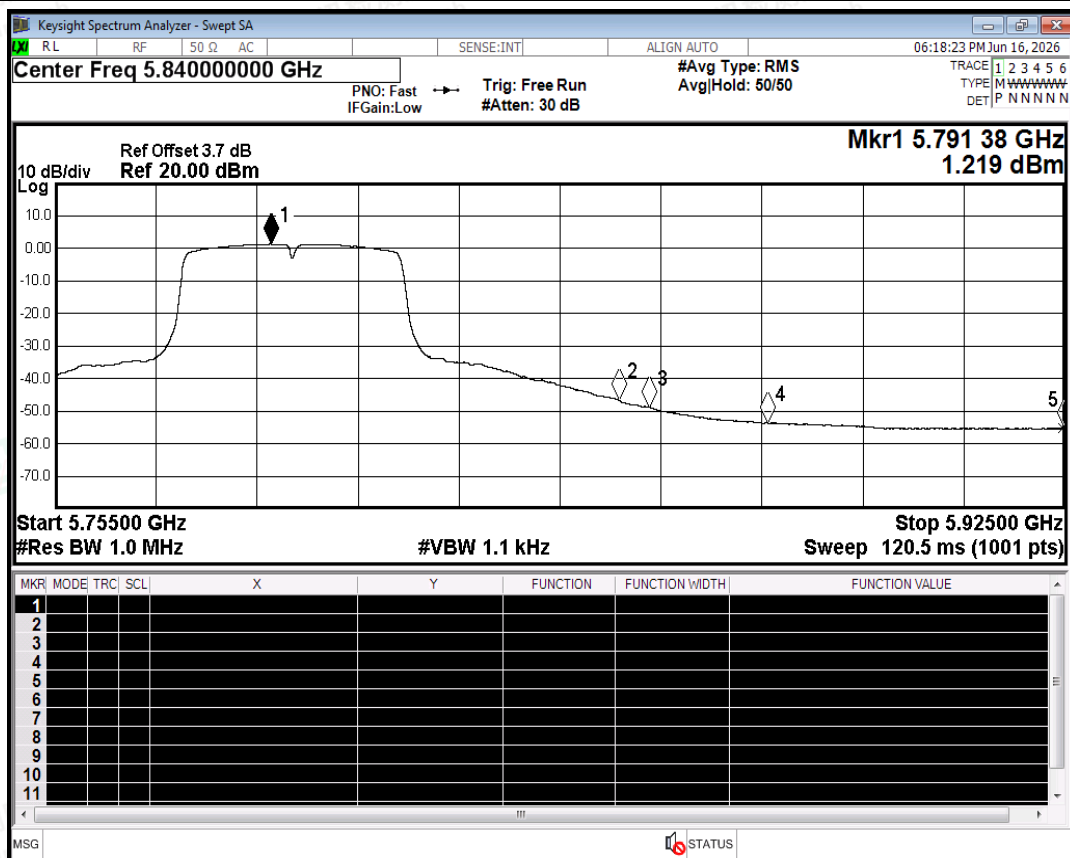

Restrict Band NVNT ac40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

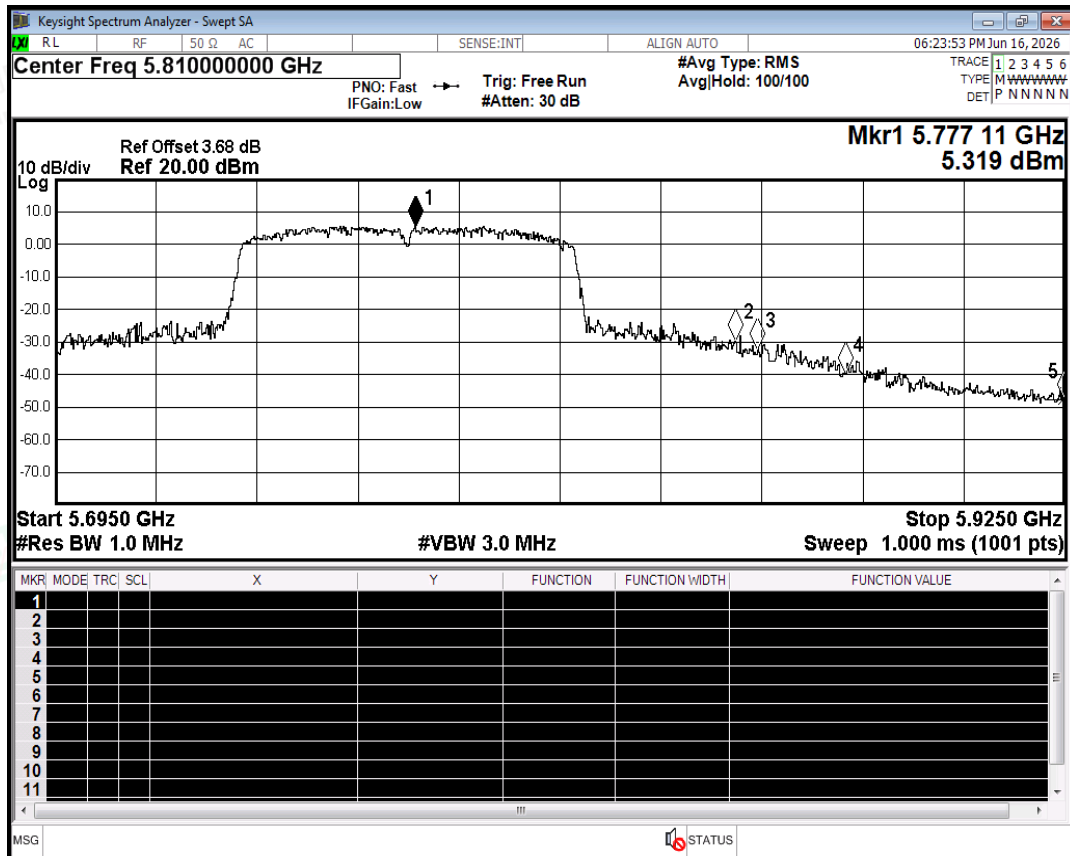


Restrict Band NVNT ac80 5775MHz Ant1 Peak

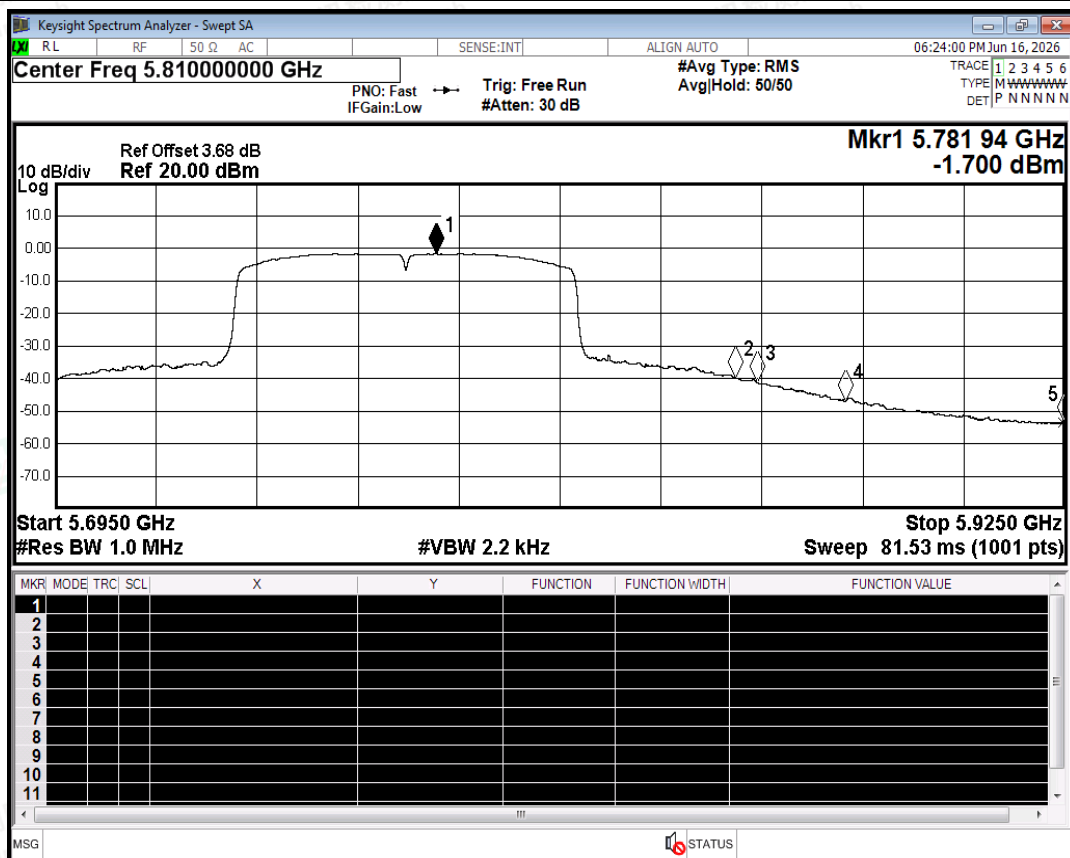


Restrict Band NVNT ac80 5775MHz Ant1 Average



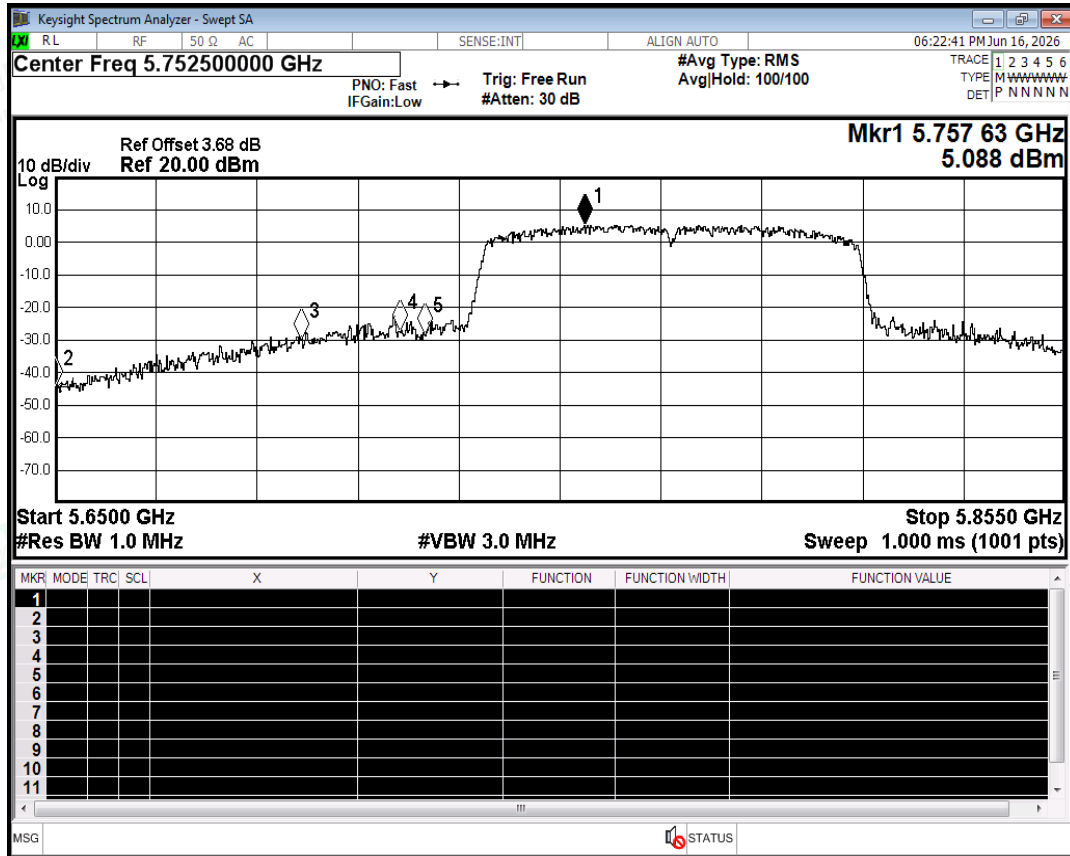

Restrict Band NVNT ac80 5775MHz Ant1 Peak

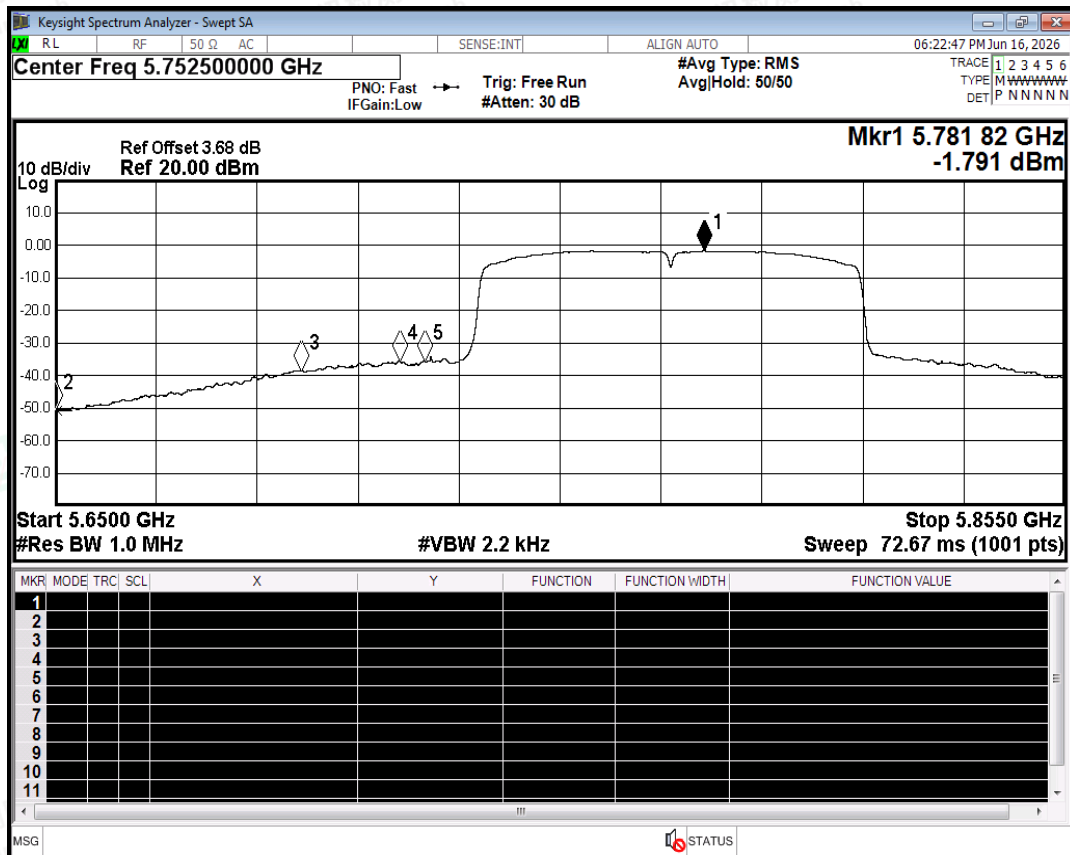

Restrict Band NVNT ac80 5775MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Ant0 Power (dBm)	Ant1 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5745	-50.86	-50.2	6.04	-41.47	Peak	-27	Pass
NVNT	n20	5745	-56.51	-56.76	6.04	-47.58	Average	-27	Pass
NVNT	n20	5745	-41.18	-43.24	6.04	-33.04	Peak	10	Pass
NVNT	n20	5745	-52.16	-52.83	6.04	-43.43	Average	10	Pass
NVNT	n20	5745	-29.04	-28.58	6.04	-19.75	Peak	15.6	Pass
NVNT	n20	5745	-37.87	-37.6	6.04	-28.68	Average	15.6	Pass
NVNT	n20	5745	-19.94	-19.78	6.04	-10.81	Peak	27	Pass
NVNT	n20	5745	-29.72	-31.92	6.04	-21.63	Average	27	Pass
NVNT	n20	5825	-29.36	-27.52	6.04	-19.29	Peak	27	Pass
NVNT	n20	5825	-39.4	-36.78	6.04	-28.85	Average	27	Pass
NVNT	n20	5825	-35.01	-34.44	6.04	-25.67	Peak	15.6	Pass
NVNT	n20	5825	-44.37	-41.9	6.04	-33.91	Average	15.6	Pass
NVNT	n20	5825	-48.21	-45.97	6.04	-37.90	Peak	10	Pass
NVNT	n20	5825	-54.53	-54.3	6.04	-45.36	Average	10	Pass
NVNT	n20	5825	-48.81	-49.49	6.04	-40.09	Peak	-27	Pass
NVNT	n20	5825	-55.62	-55.69	6.04	-46.60	Average	-27	Pass
NVNT	n40	5755	-49.37	-48.39	6.04	-39.80	Peak	-27	Pass
NVNT	n40	5755	-55.66	-55.7	6.04	-46.63	Average	-27	Pass
NVNT	n40	5755	-36.3	-35.33	6.04	-26.74	Peak	10	Pass
NVNT	n40	5755	-44.23	-43.89	6.04	-35.01	Average	10	Pass
NVNT	n40	5755	-19.04	-23.43	6.04	-11.65	Peak	15.6	Pass
NVNT	n40	5755	-32	-33.35	6.04	-23.57	Average	15.6	Pass
NVNT	n40	5755	-19.4	-18.21	6.04	-9.71	Peak	27	Pass
NVNT	n40	5755	-30.93	-32.08	6.04	-22.42	Average	27	Pass
NVNT	n40	5795	-38.79	-36.33	6.04	-28.34	Peak	27	Pass
NVNT	n40	5795	-47.11	-46.87	6.04	-37.94	Average	27	Pass
NVNT	n40	5795	-39.14	-38.88	6.04	-29.96	Peak	15.6	Pass
NVNT	n40	5795	-49.09	-49.16	6.04	-40.07	Average	15.6	Pass
NVNT	n40	5795	-47.27	-46.88	6.04	-38.02	Peak	10	Pass
NVNT	n40	5795	-53.98	-53.61	6.04	-44.74	Average	10	Pass
NVNT	n40	5795	-49.27	-49.29	6.04	-40.23	Peak	-27	Pass
NVNT	n40	5795	-55.62	-55.56	6.04	-46.54	Average	-27	Pass
NVNT	ac20	5745	-50.45	-48.48	6.04	-40.30	Peak	-27	Pass
NVNT	ac20	5745	-56.45	-56.68	6.04	-47.51	Average	-27	Pass
NVNT	ac20	5745	-43.46	-43.39	6.04	-34.37	Peak	10	Pass
NVNT	ac20	5745	-51.98	-52.04	6.04	-42.96	Average	10	Pass
NVNT	ac20	5745	-27.53	-26.27	6.04	-17.80	Peak	15.6	Pass
NVNT	ac20	5745	-37.38	-36.41	6.04	-27.82	Average	15.6	Pass
NVNT	ac20	5745	-17.86	-18.97	6.04	-9.33	Peak	27	Pass





NVNT	ac20	5745	-29.2	-30.27	6.04	-20.65	Average	27	Pass
NVNT	ac20	5825	-31.04	-29.09	6.04	-20.91	Peak	27	Pass
NVNT	ac20	5825	-39.56	-38.5	6.04	-29.95	Average	27	Pass
NVNT	ac20	5825	-35.21	-33.57	6.04	-25.26	Peak	15.6	Pass
NVNT	ac20	5825	-44.52	-43.3	6.04	-34.82	Average	15.6	Pass
NVNT	ac20	5825	-46.83	-48.15	6.04	-38.39	Peak	10	Pass
NVNT	ac20	5825	-54.16	-54.85	6.04	-45.44	Average	10	Pass
NVNT	ac20	5825	-47.82	-47.67	6.04	-38.69	Peak	-27	Pass
NVNT	ac20	5825	-55.65	-55.77	6.04	-46.66	Average	-27	Pass
NVNT	ac40	5755	-49.7	-48.84	6.04	-40.20	Peak	-27	Pass
NVNT	ac40	5755	-55.47	-55.67	6.04	-46.52	Average	-27	Pass
NVNT	ac40	5755	-36.26	-37.43	6.04	-27.76	Peak	10	Pass
NVNT	ac40	5755	-44.32	-44.13	6.04	-35.17	Average	10	Pass
NVNT	ac40	5755	-21.97	-18.6	6.04	-10.92	Peak	15.6	Pass
NVNT	ac40	5755	-32.56	-34.36	6.04	-24.32	Average	15.6	Pass
NVNT	ac40	5755	-23.15	-23.8	6.04	-14.41	Peak	27	Pass
NVNT	ac40	5755	-30.75	-32.87	6.04	-22.63	Average	27	Pass
NVNT	ac40	5795	-39.11	-37.27	6.04	-29.04	Peak	27	Pass
NVNT	ac40	5795	-47.32	-46.73	6.04	-37.96	Average	27	Pass
NVNT	ac40	5795	-42.35	-40.42	6.04	-32.23	Peak	15.6	Pass
NVNT	ac40	5795	-49.37	-48.97	6.04	-40.12	Average	15.6	Pass
NVNT	ac40	5795	-45.84	-47.41	6.04	-37.50	Peak	10	Pass
NVNT	ac40	5795	-53.89	-53.63	6.04	-44.71	Average	10	Pass
NVNT	ac40	5795	-47.64	-48.33	6.04	-38.92	Peak	-27	Pass
NVNT	ac40	5795	-55.55	-55.43	6.04	-46.44	Average	-27	Pass
NVNT	ac80	5775	-29.2	-29.68	6.04	-20.38	Peak	27	Pass
NVNT	ac80	5775	-38.99	-39.81	6.04	-30.33	Average	27	Pass
NVNT	ac80	5775	-32.34	-32.49	6.04	-23.36	Peak	15.6	Pass
NVNT	ac80	5775	-40.33	-41.21	6.04	-31.70	Average	15.6	Pass
NVNT	ac80	5775	-40.07	-39.69	6.04	-30.83	Peak	10	Pass
NVNT	ac80	5775	-45.92	-46.98	6.04	-37.37	Average	10	Pass
NVNT	ac80	5775	-45.34	-47.84	6.04	-37.36	Peak	-27	Pass
NVNT	ac80	5775	-53.44	-53.87	6.04	-44.60	Average	-27	Pass
NVNT	ac80	5775	-42.72	-44.56	6.04	-34.49	Peak	-27	Pass
NVNT	ac80	5775	-50.28	-50.92	6.04	-41.54	Average	-27	Pass
NVNT	ac80	5775	-29.47	-29.91	6.04	-20.63	Peak	10	Pass
NVNT	ac80	5775	-37.46	-38.78	6.04	-29.02	Average	10	Pass
NVNT	ac80	5775	-26.19	-27.34	6.04	-17.68	Peak	15.6	Pass
NVNT	ac80	5775	-34.57	-35.53	6.04	-25.97	Average	15.6	Pass
NVNT	ac80	5775	-22.7	-28.33	6.04	-15.61	Peak	27	Pass
NVNT	ac80	5775	-33.61	-35.72	6.04	-25.49	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




G.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant0	5745.08	80000	13.93	25	Pass
NVNT	a	5785	Ant0	5785.06	60000	10.37	25	Pass
NVNT	a	5825	Ant0	5825.08	80000	13.73	25	Pass
NVNT	n20	5745	Ant0	5745.08	80000	13.93	25	Pass
NVNT	n20	5785	Ant0	5785.08	80000	13.83	25	Pass
NVNT	n20	5825	Ant0	5825.06	60000	10.3	25	Pass
NVNT	n40	5755	Ant0	5755.04	40000	6.95	25	Pass
NVNT	n40	5795	Ant0	5795.04	40000	6.9	25	Pass
NVNT	ac20	5745	Ant0	5745.08	80000	13.93	25	Pass
NVNT	ac20	5785	Ant0	5785.08	80000	13.83	25	Pass
NVNT	ac20	5825	Ant0	5825.06	60000	10.3	25	Pass
NVNT	ac40	5755	Ant0	5755.04	40000	6.95	25	Pass
NVNT	ac40	5795	Ant0	5795.04	40000	6.9	25	Pass
NVNT	ac80	5775	Ant0	5775.08	80000	13.85	25	Pass



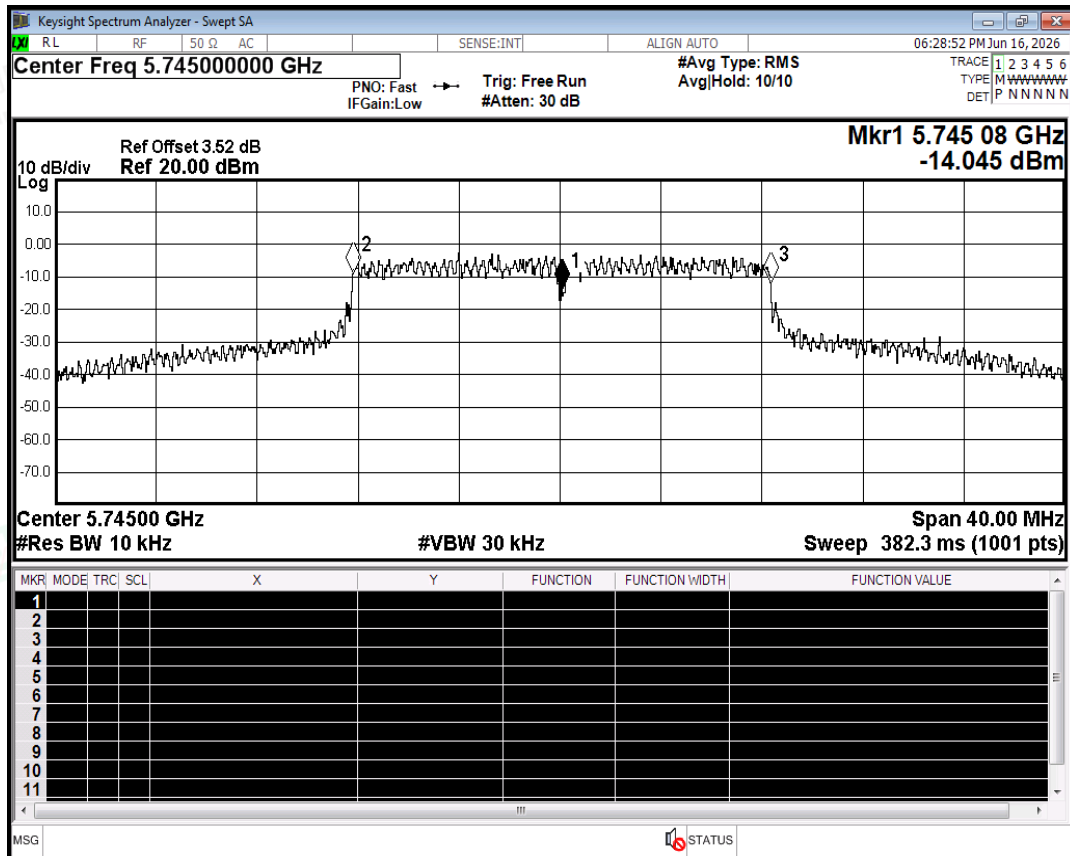

Freq. Stability NVNT a 5745MHz Ant0

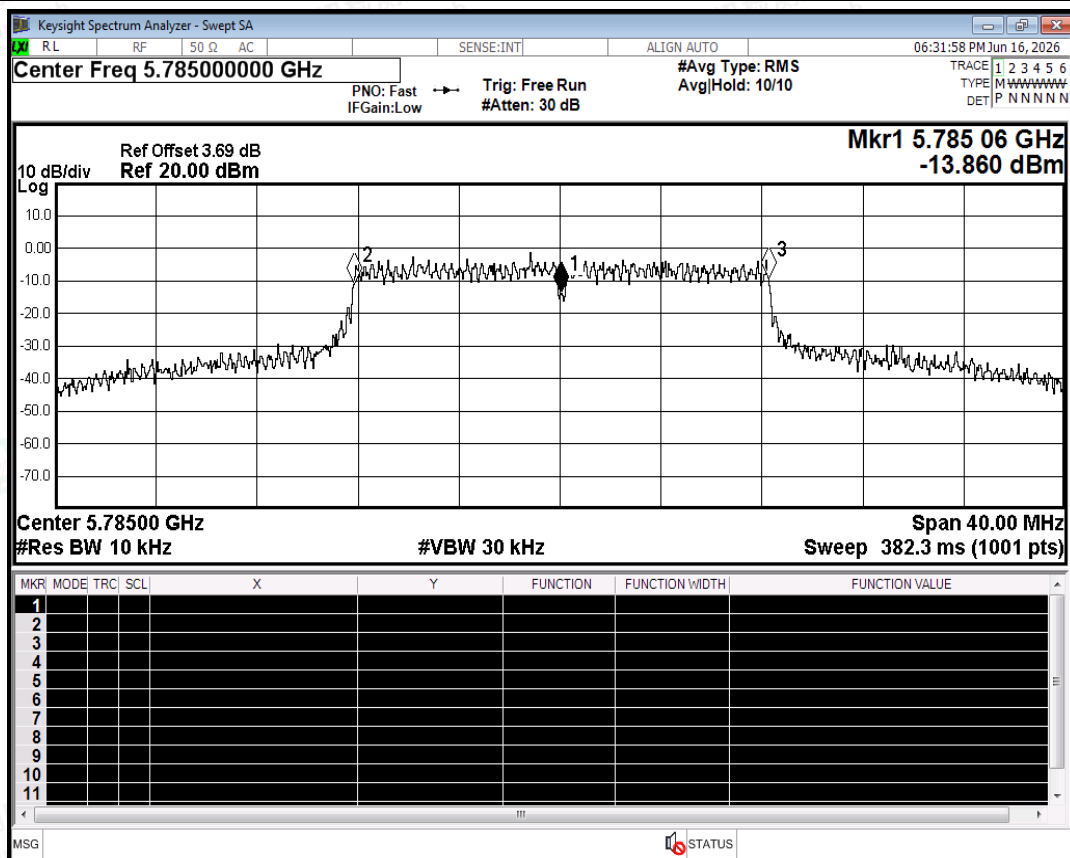

Freq. Stability NVNT a 5785MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

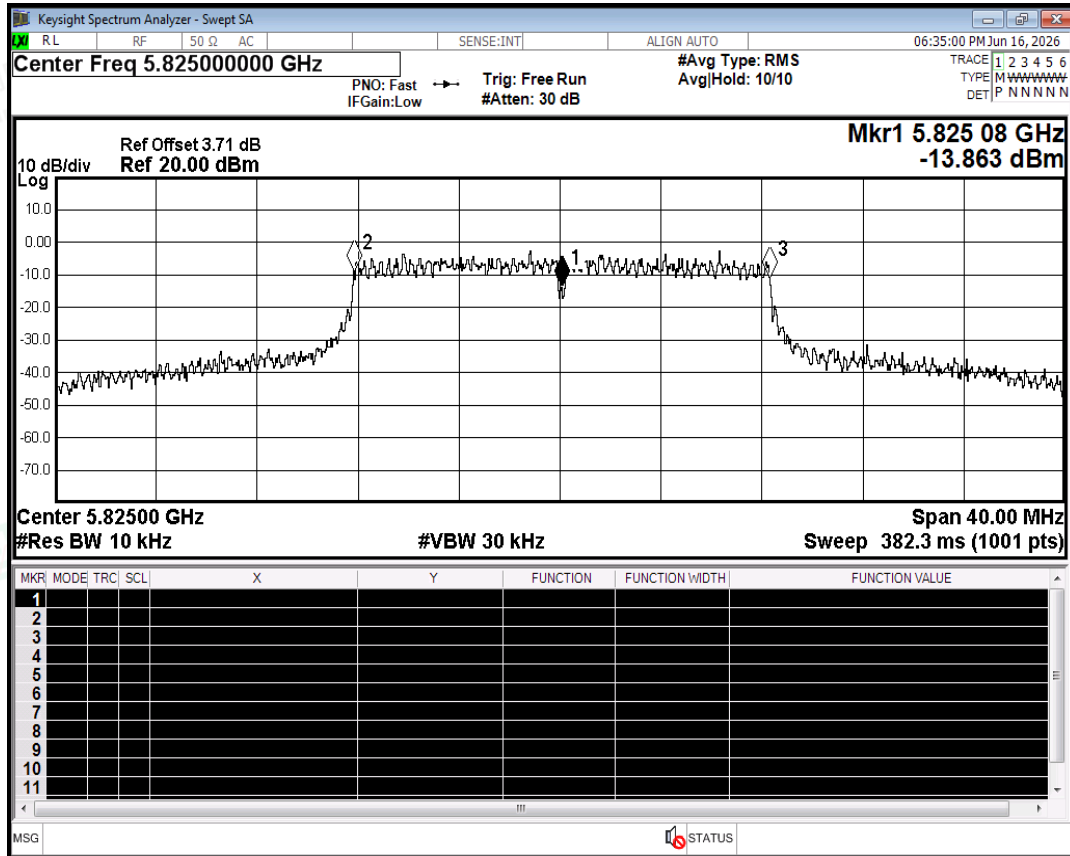

Freq. Stability NVNT a 5825MHz Ant0

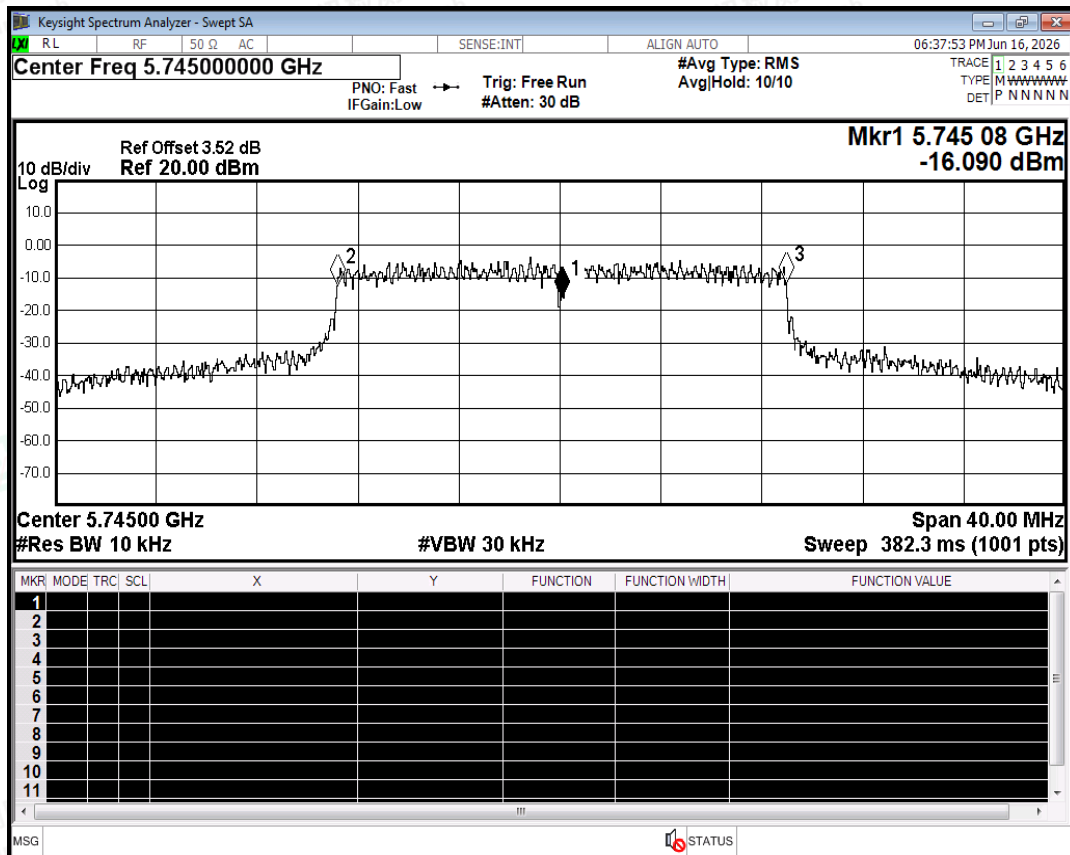

Freq. Stability NVNT n20 5745MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

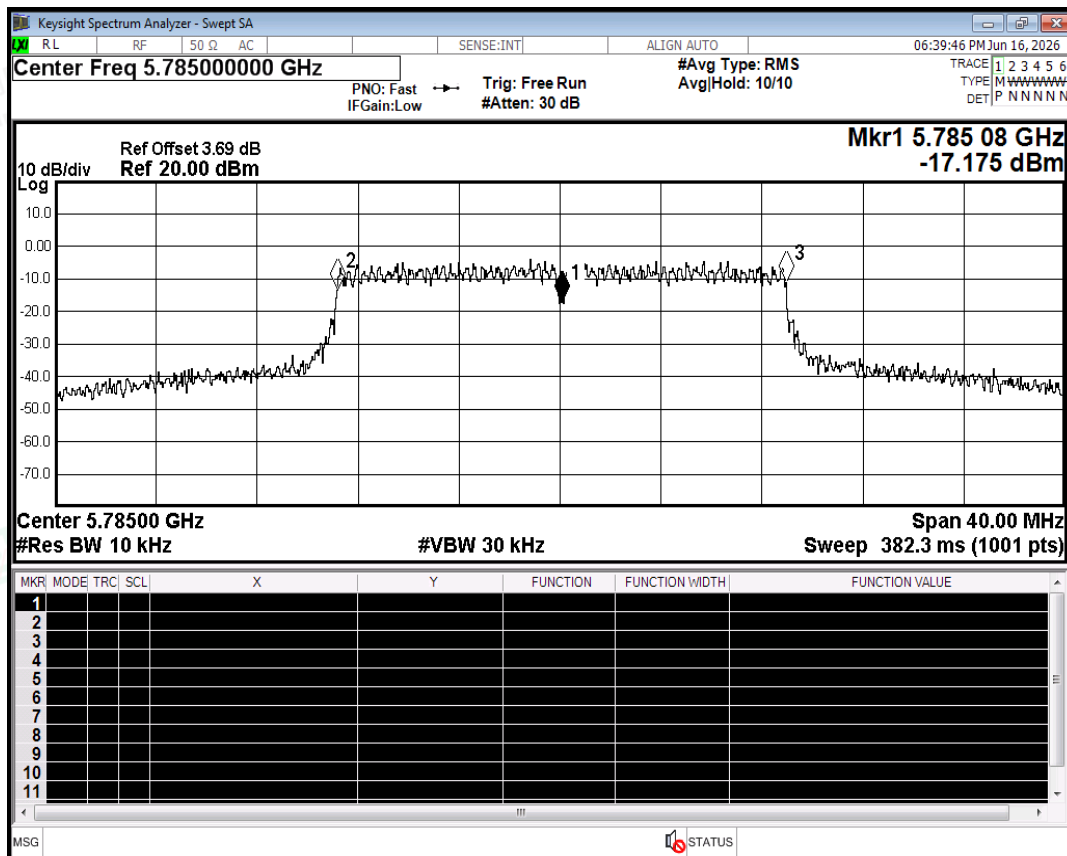


Freq. Stability NVNT n20 5785MHz Ant0

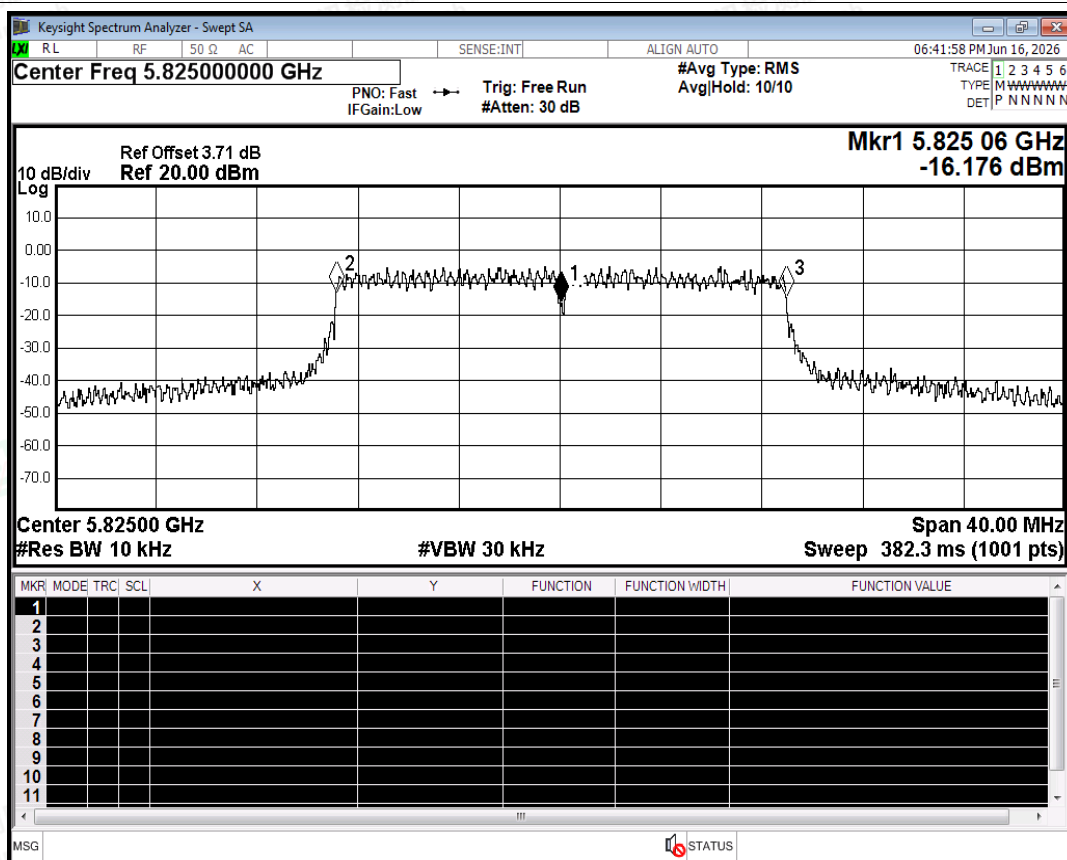


Freq. Stability NVNT n20 5825MHz Ant0



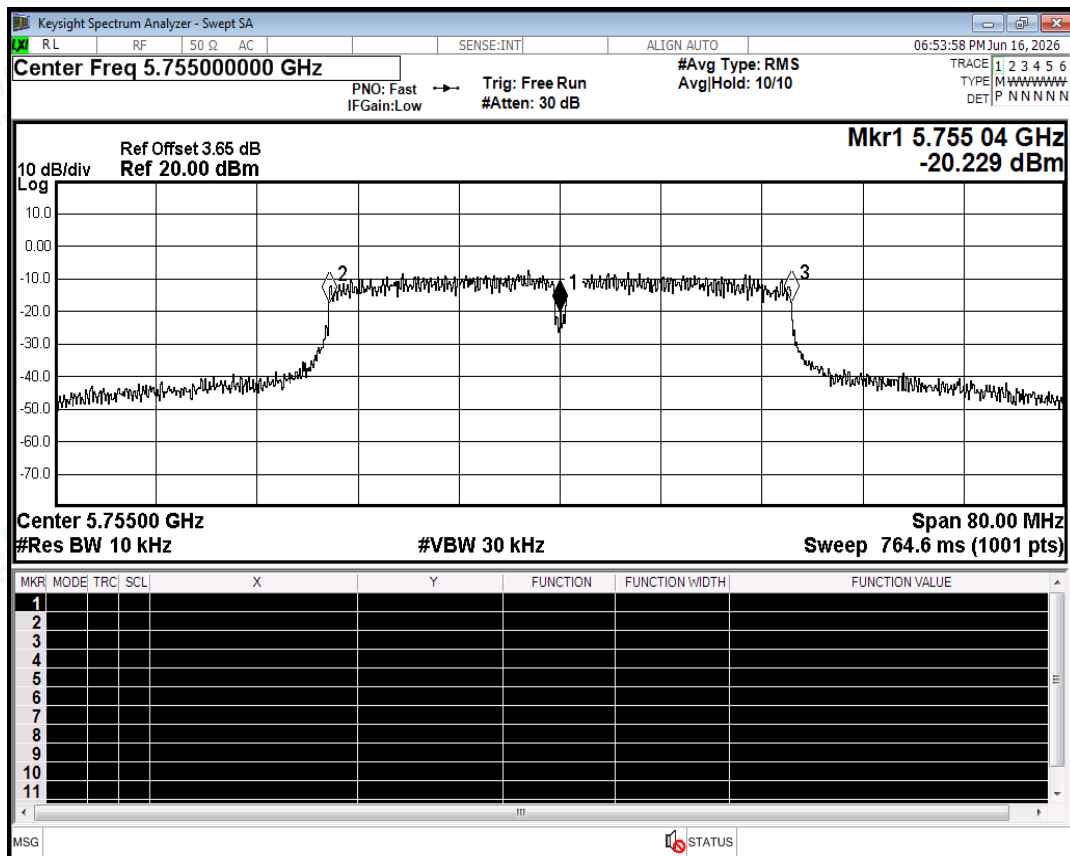

Freq. Stability NVNT n40 5755MHz Ant0

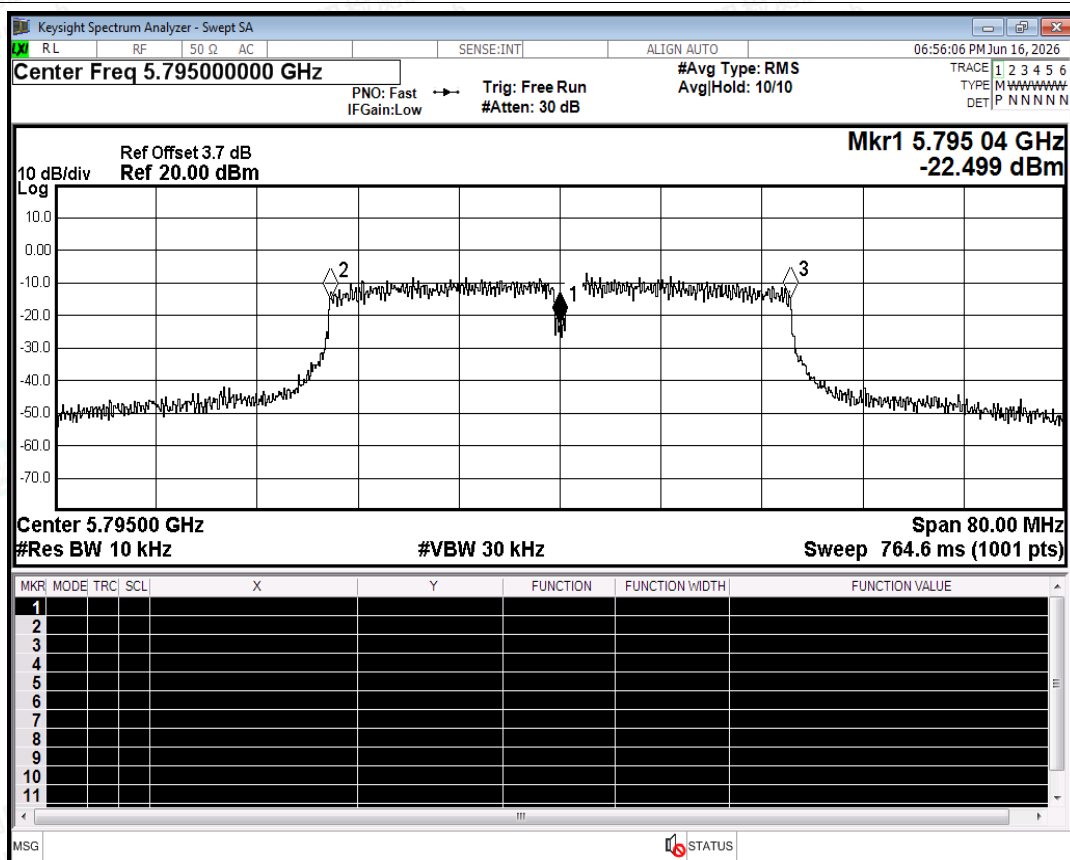

Freq. Stability NVNT n40 5795MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

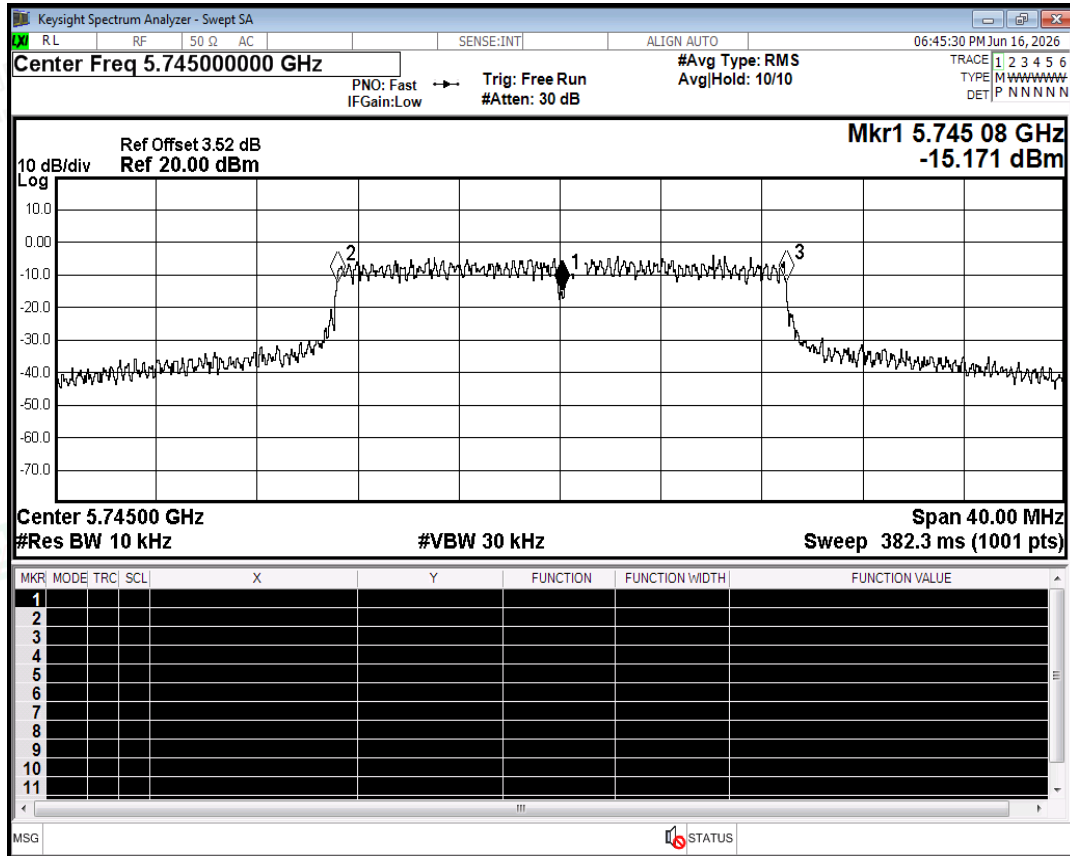

Freq. Stability NVNT ac20 5745MHz Ant0

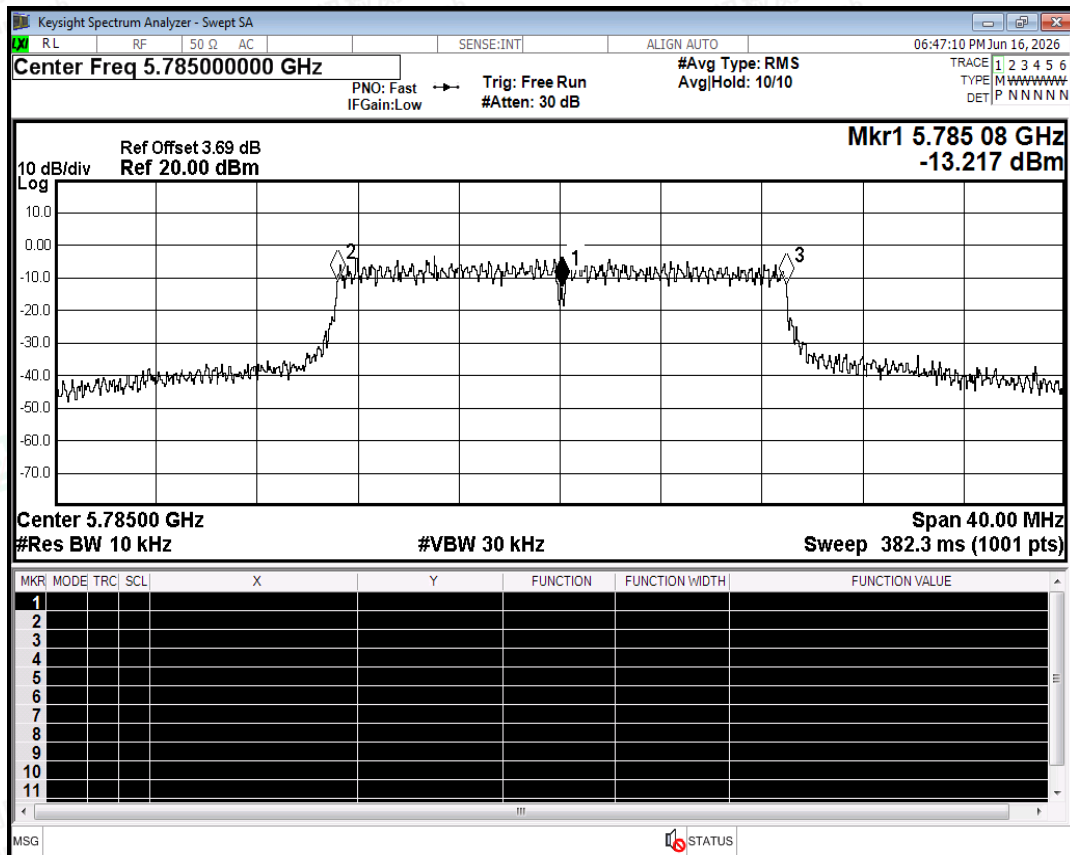

Freq. Stability NVNT ac20 5785MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

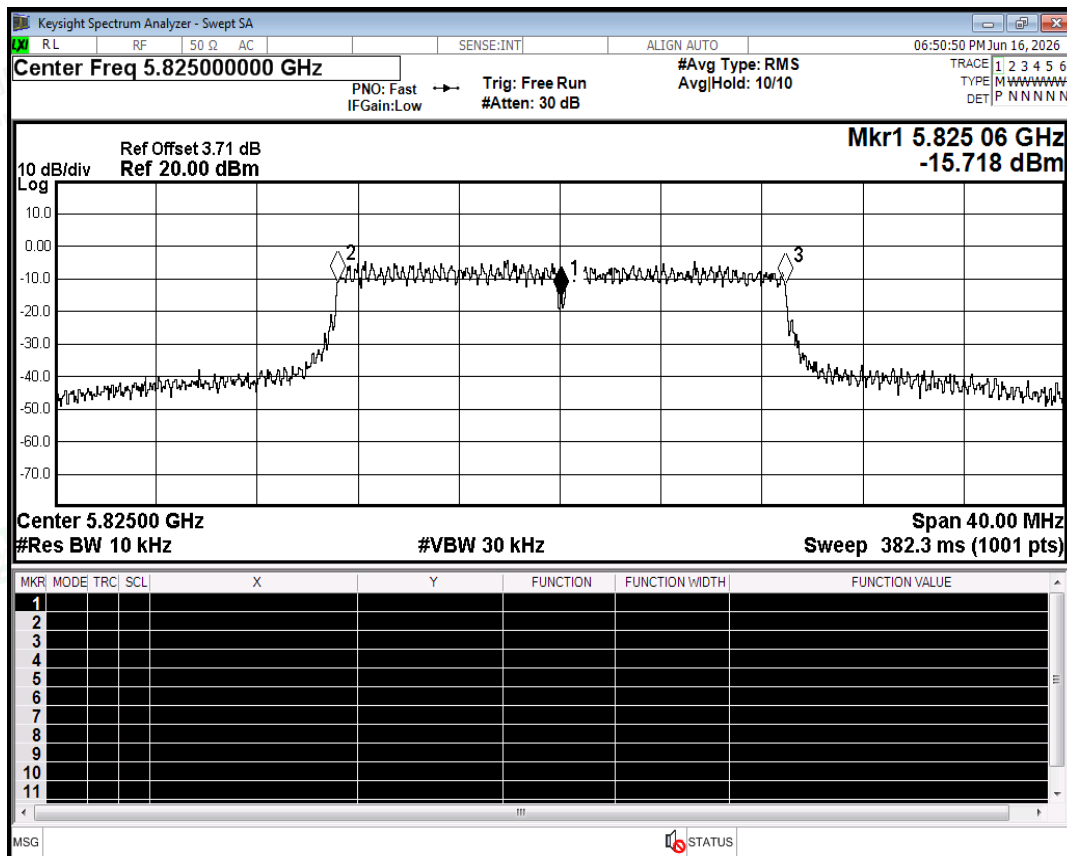


Freq. Stability NVNT ac20 5825MHz Ant0

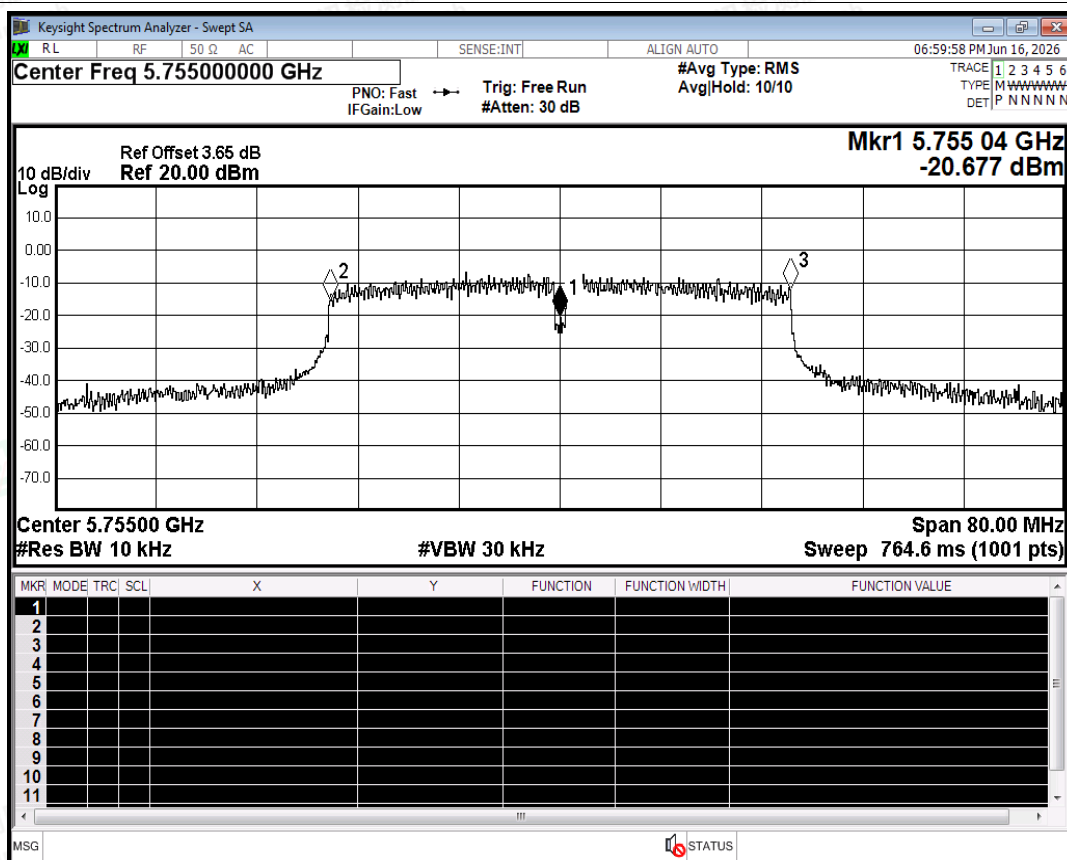


Freq. Stability NVNT ac40 5755MHz Ant0



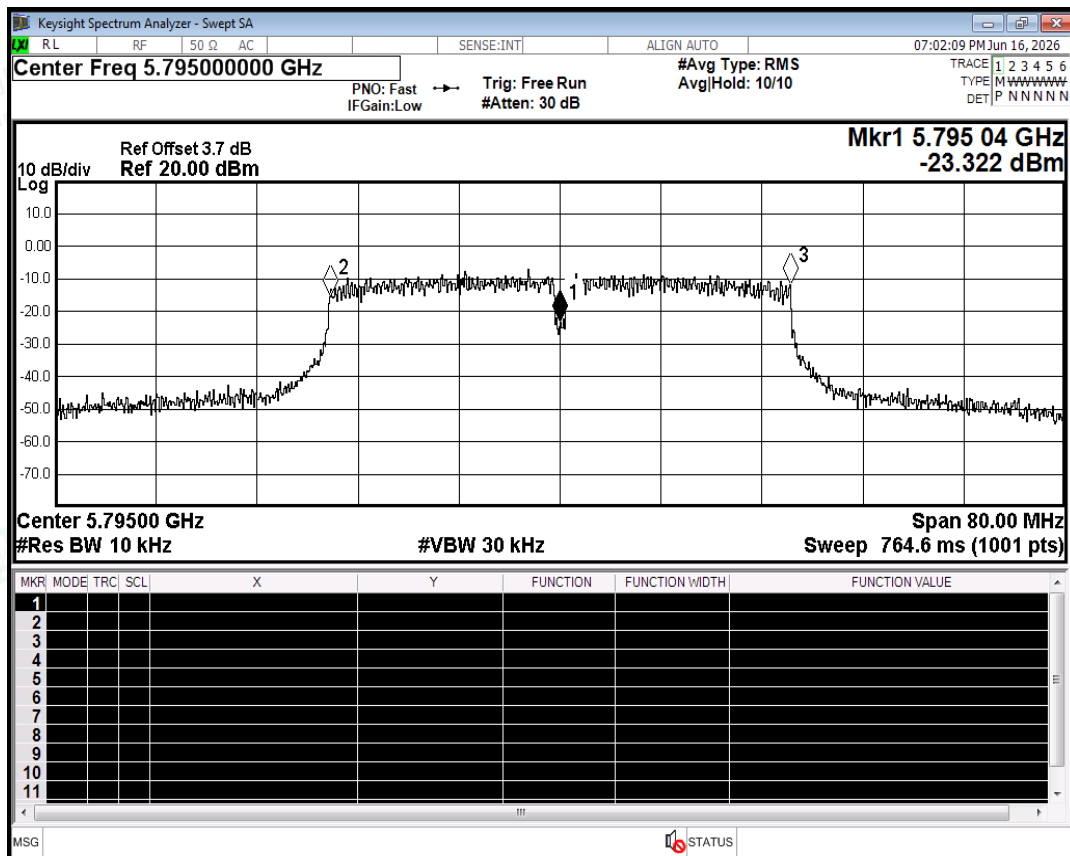

Freq. Stability NVNT ac40 5795MHz Ant0

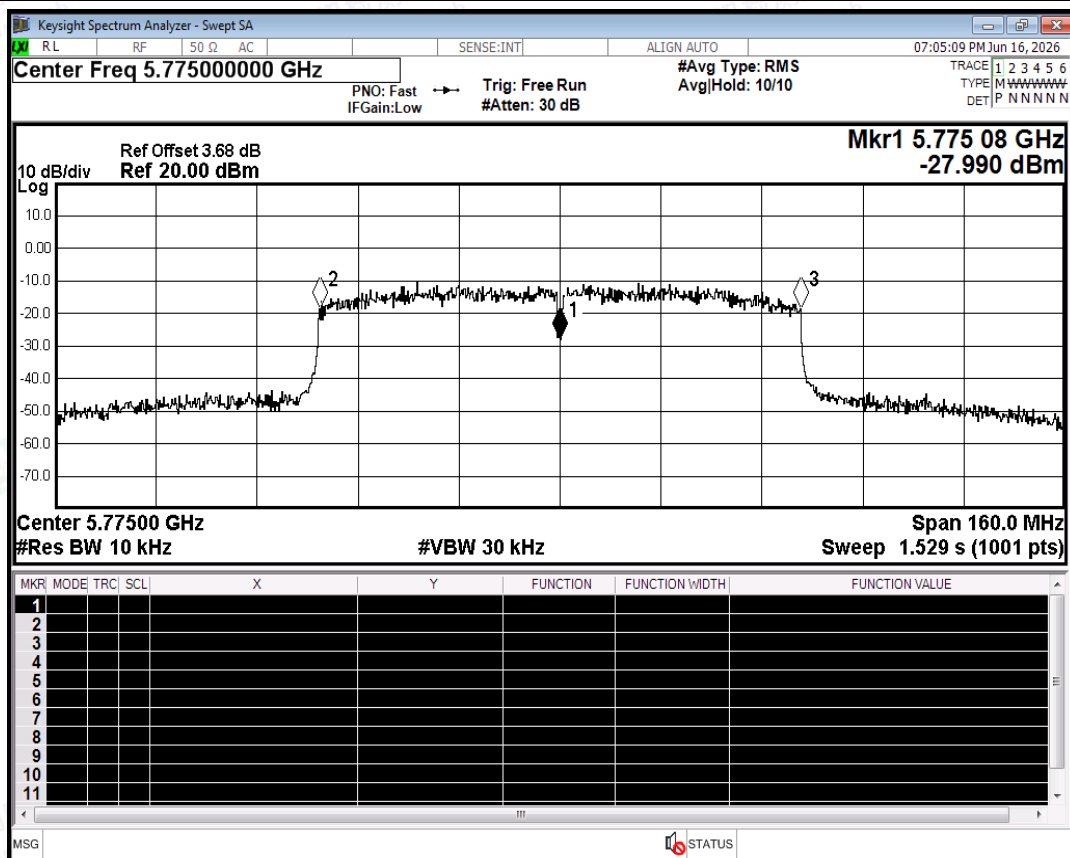

Freq. Stability NVNT ac80 5775MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5745.04	40000	6.96	25	Pass
NVNT	a	5785	Ant1	5785.08	80000	13.83	25	Pass
NVNT	a	5825	Ant1	5825.06	60000	10.3	25	Pass
NVNT	n20	5745	Ant1	5745.06	60000	10.44	25	Pass
NVNT	n20	5785	Ant1	5785.04	40000	6.91	25	Pass
NVNT	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
NVNT	n40	5755	Ant1	5755.08	80000	13.9	25	Pass
NVNT	n40	5795	Ant1	5795.08	80000	13.81	25	Pass
NVNT	ac20	5745	Ant1	5745.06	60000	10.44	25	Pass
NVNT	ac20	5785	Ant1	5785.08	80000	13.83	25	Pass
NVNT	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
NVNT	ac40	5755	Ant1	5755.08	80000	13.9	25	Pass
NVNT	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
NVNT	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass



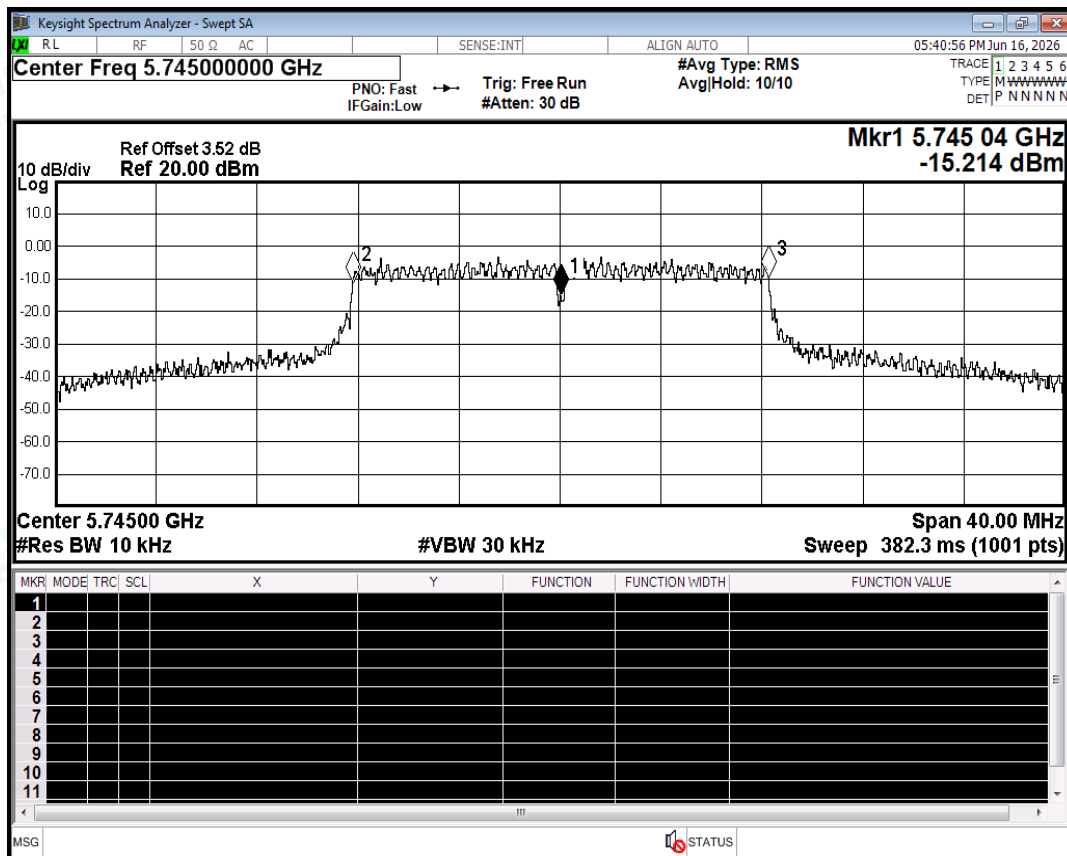


Freq. Stability NVNT a 5745MHz Ant1

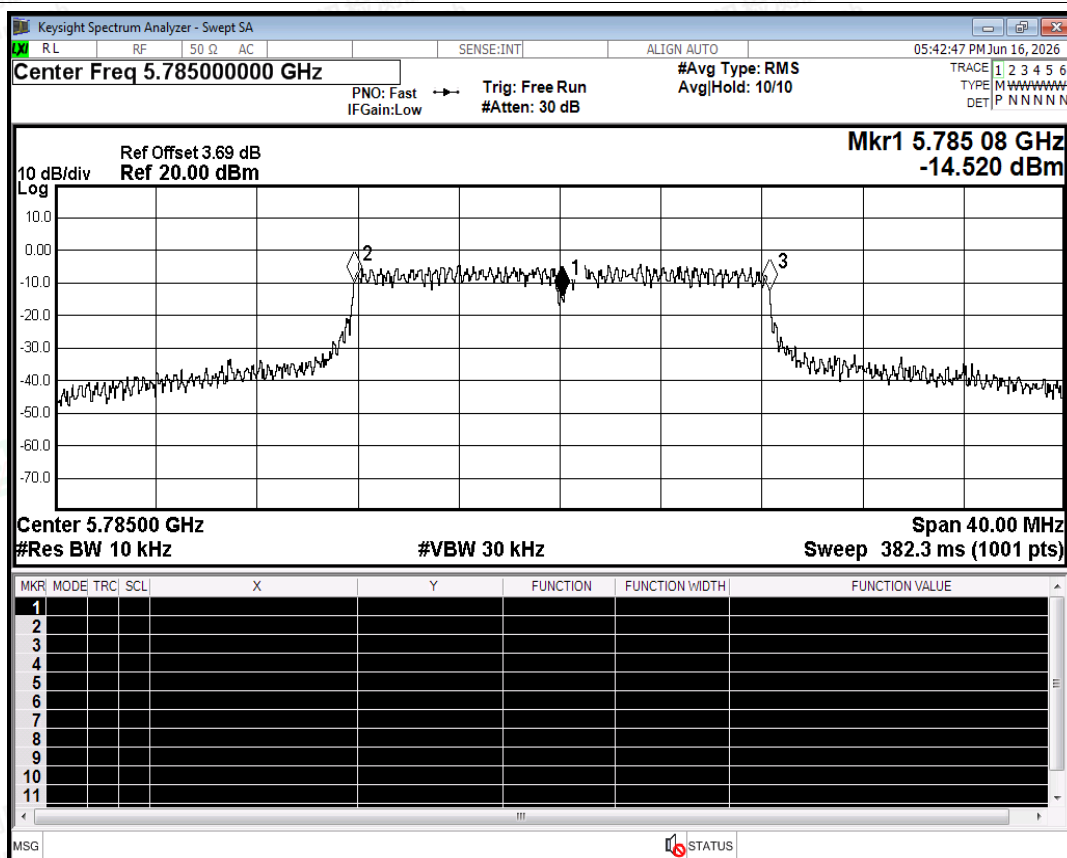


Freq. Stability NVNT a 5785MHz Ant1



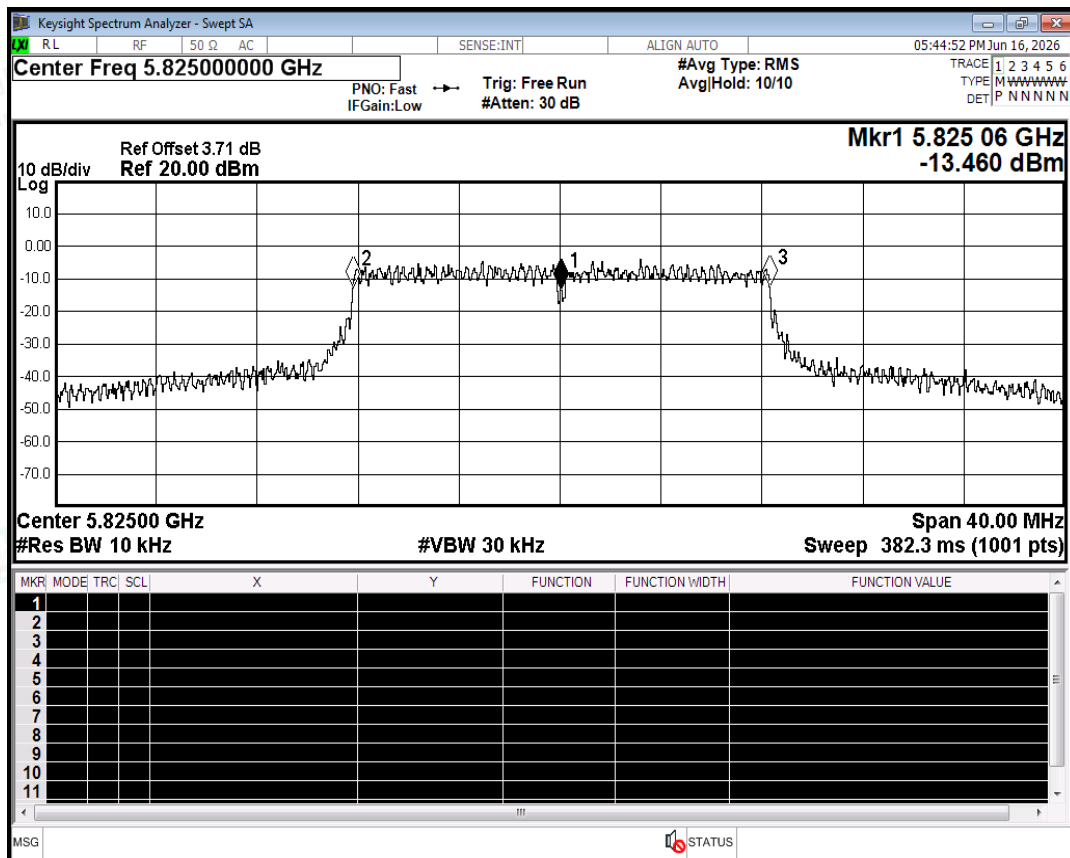

Freq. Stability NVNT a 5825MHz Ant1

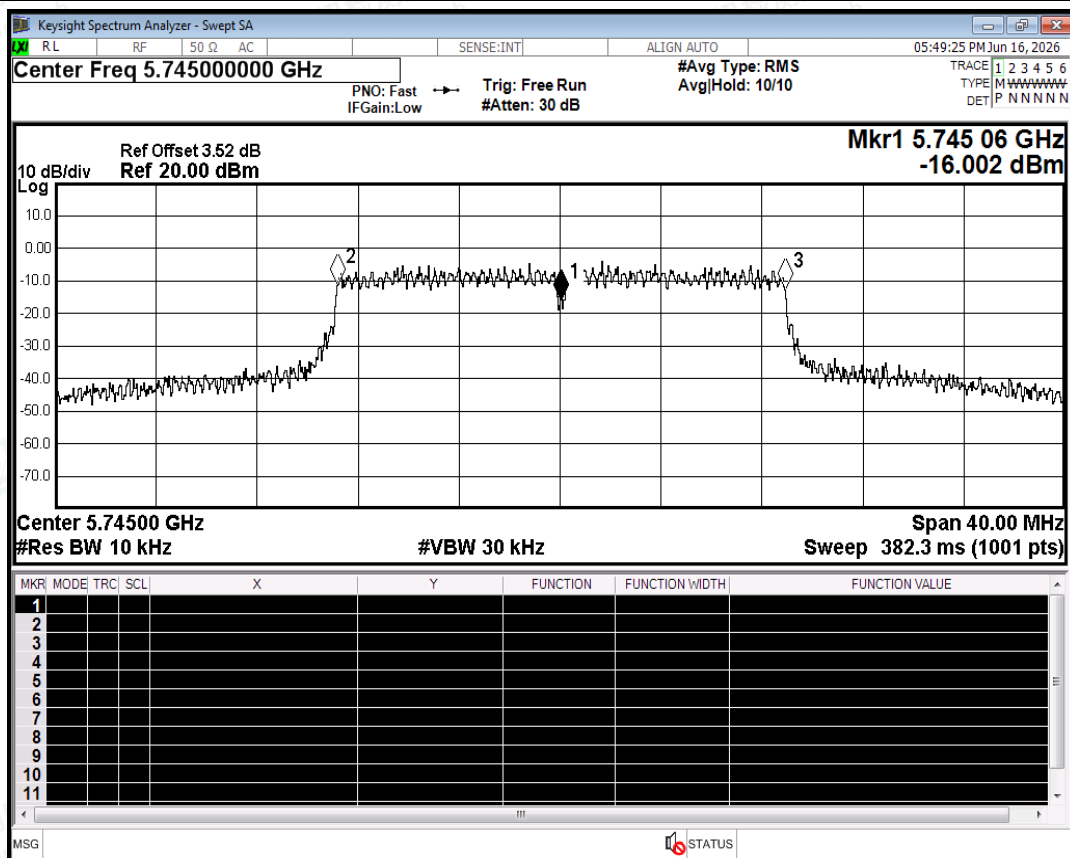

Freq. Stability NVNT n20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

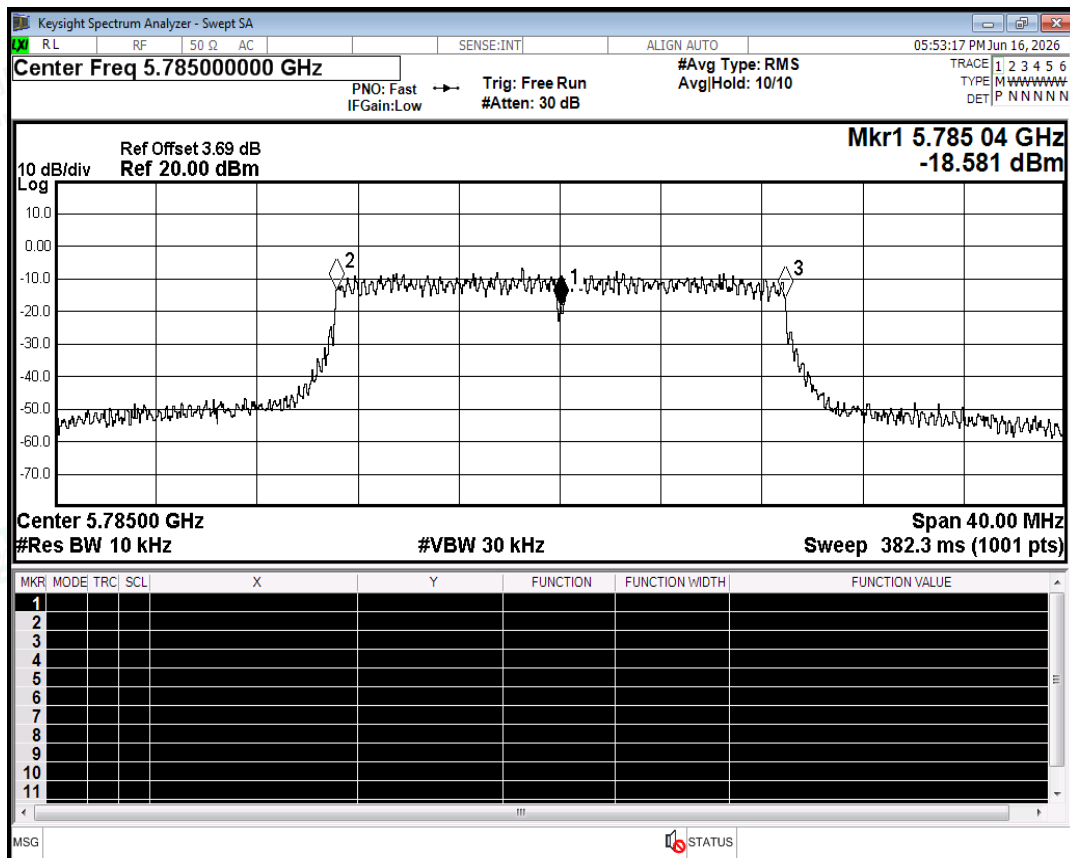

Freq. Stability NVNT n20 5785MHz Ant1

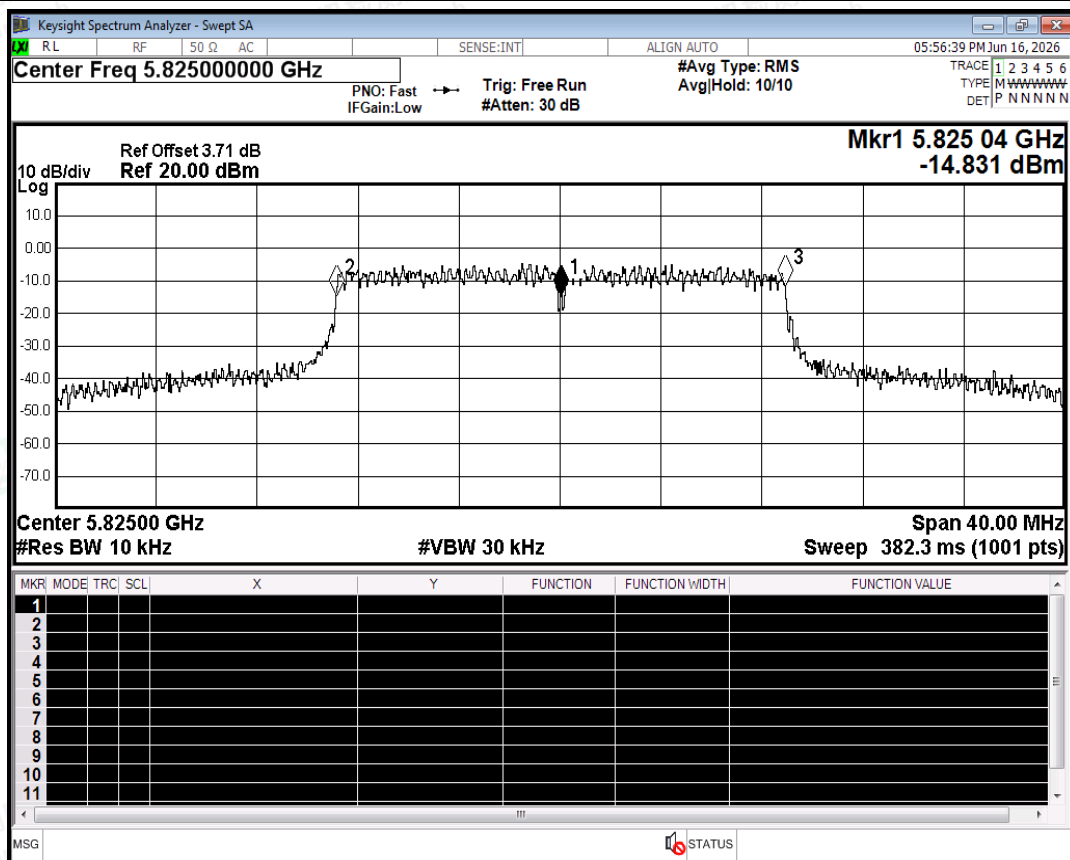

Freq. Stability NVNT n20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

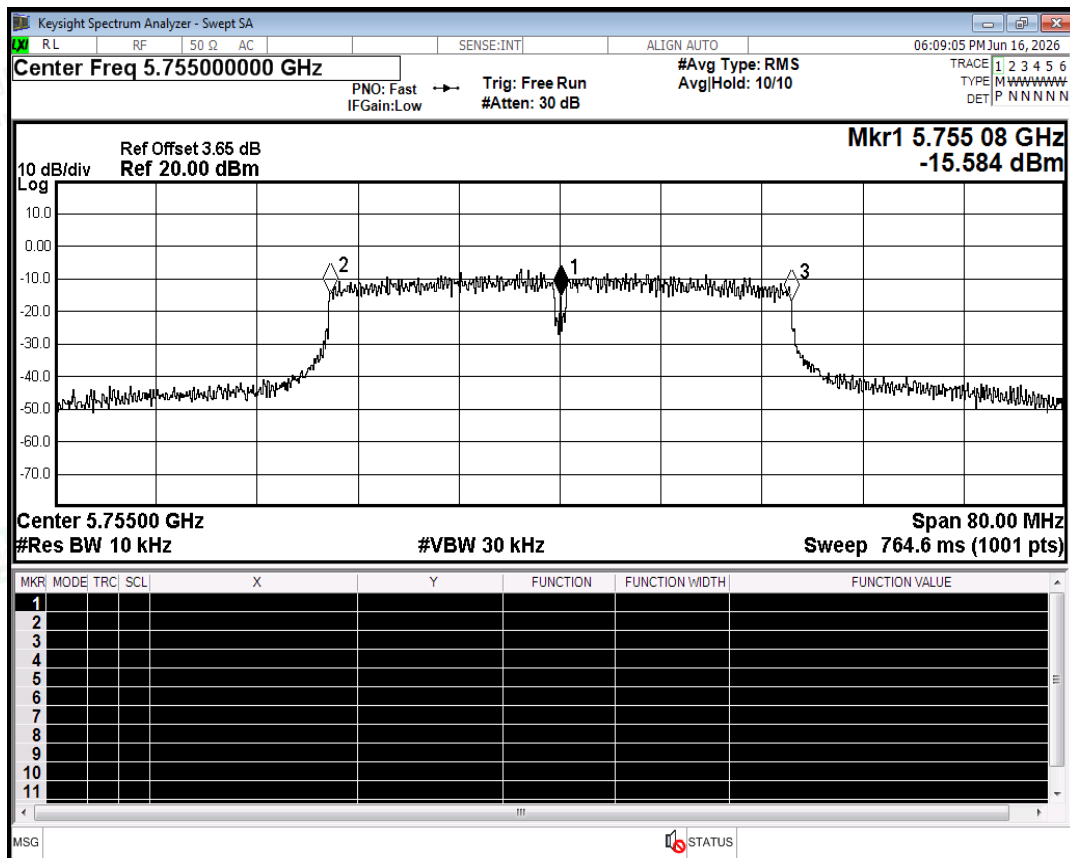

Freq. Stability NVNT n40 5755MHz Ant1

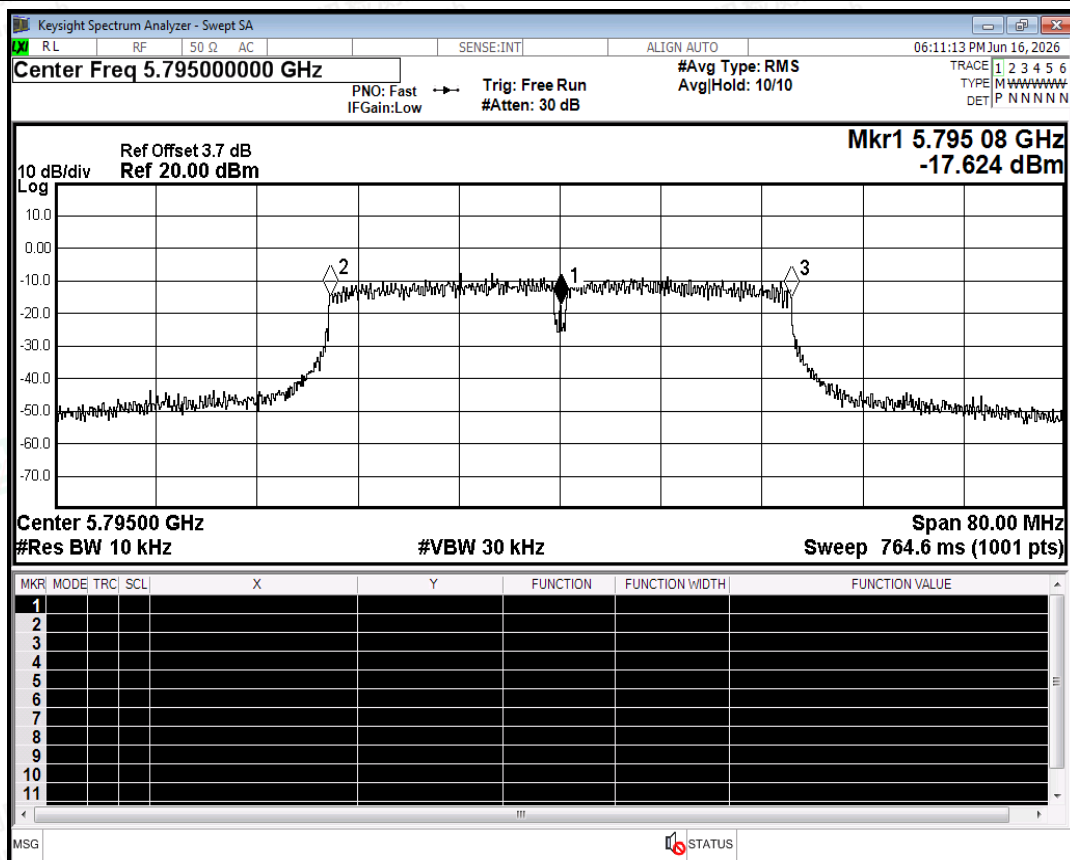

Freq. Stability NVNT n40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

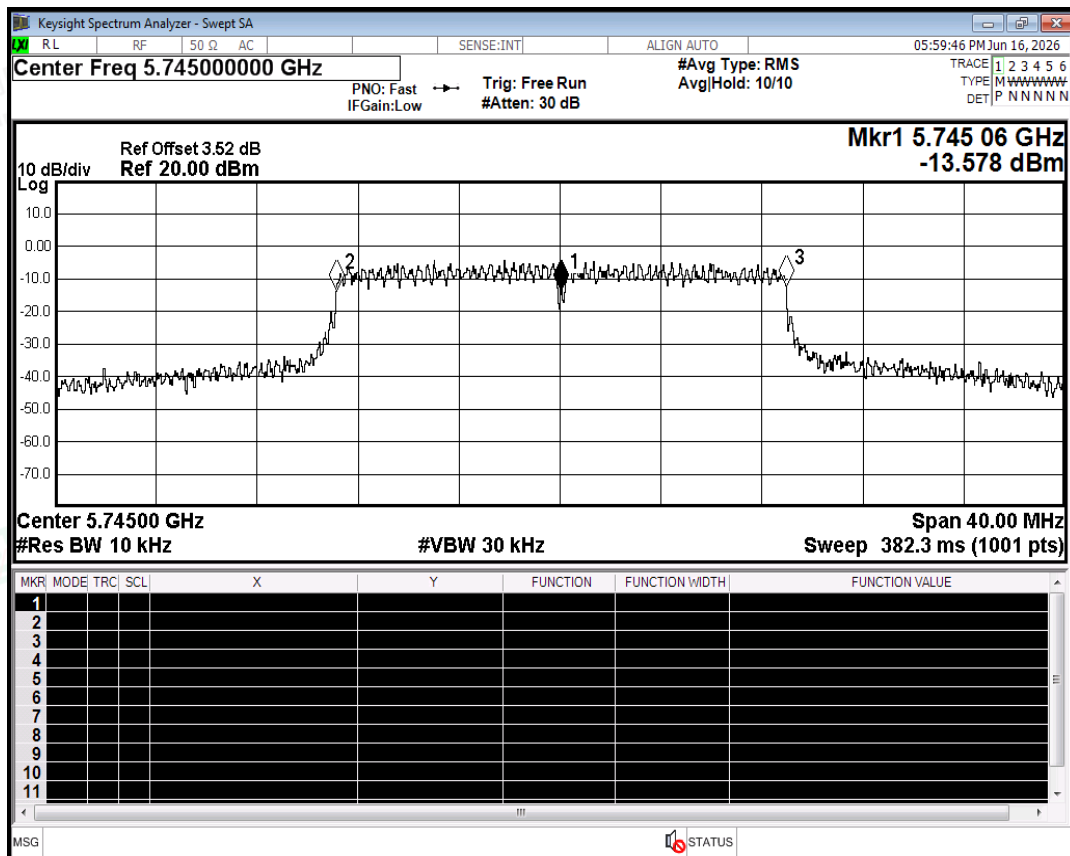


Freq. Stability NVNT ac20 5745MHz Ant1

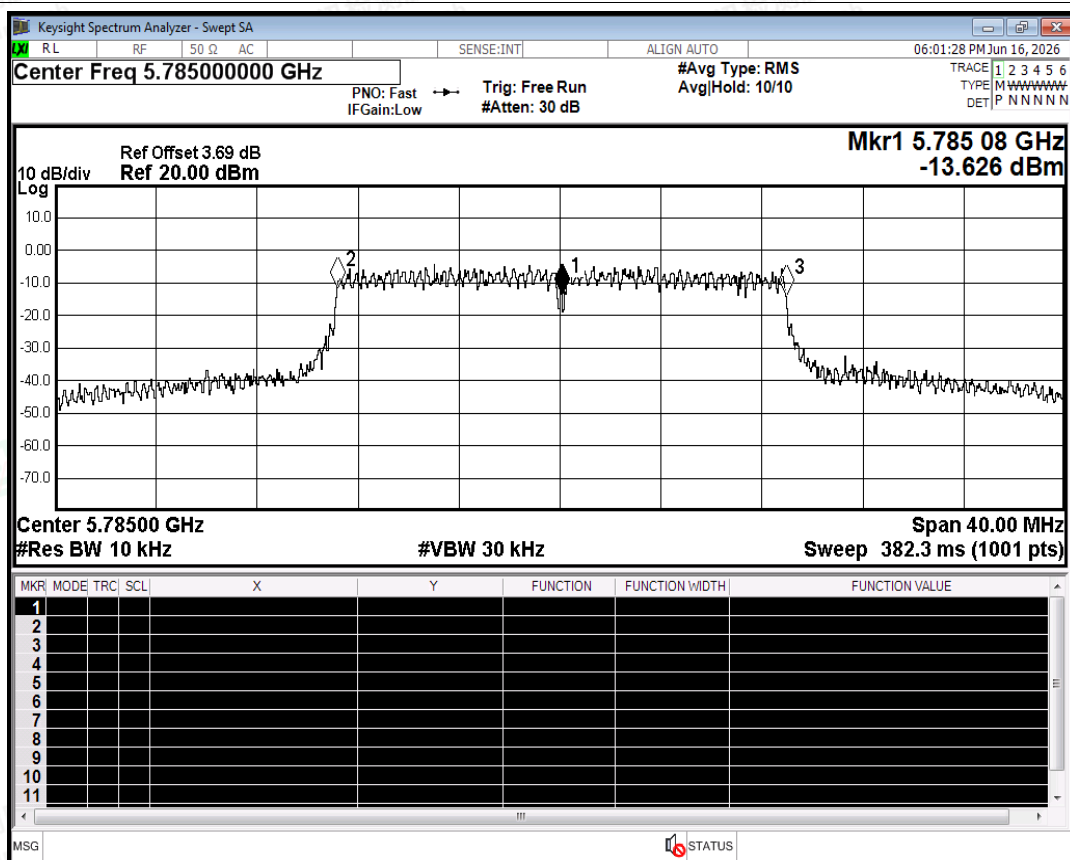


Freq. Stability NVNT ac20 5785MHz Ant1



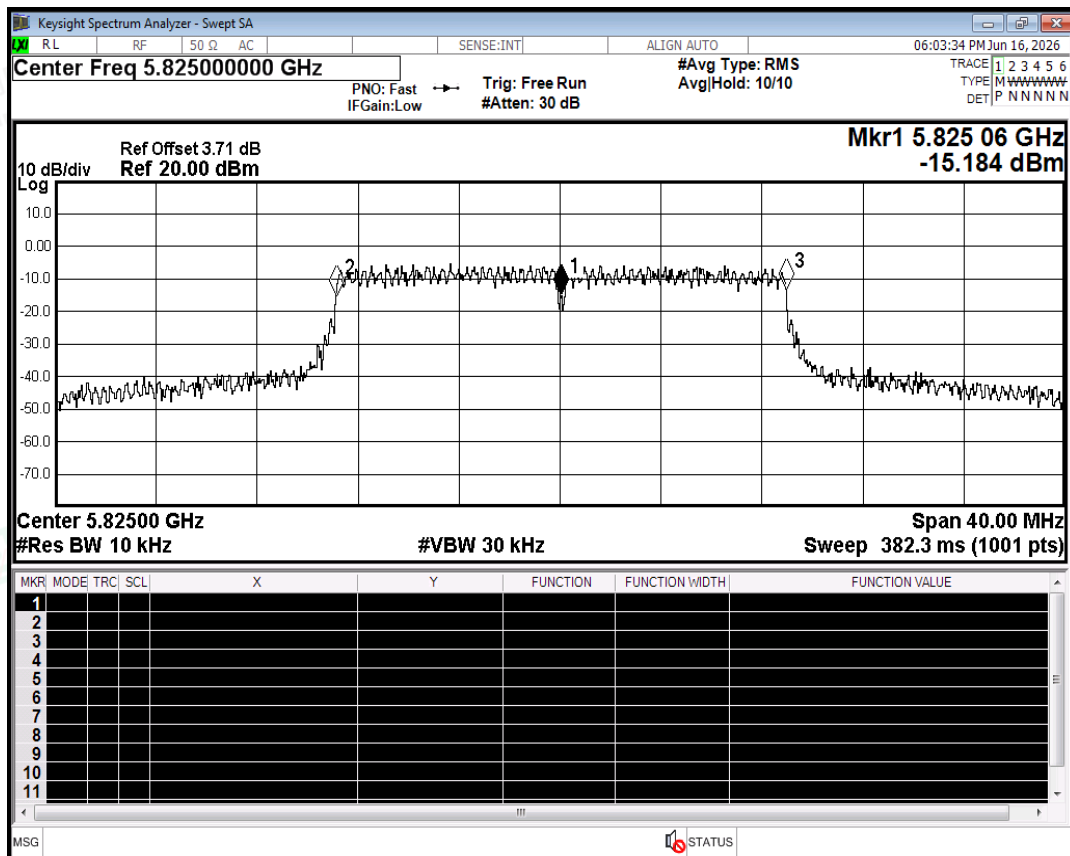

Freq. Stability NVNT ac20 5825MHz Ant1

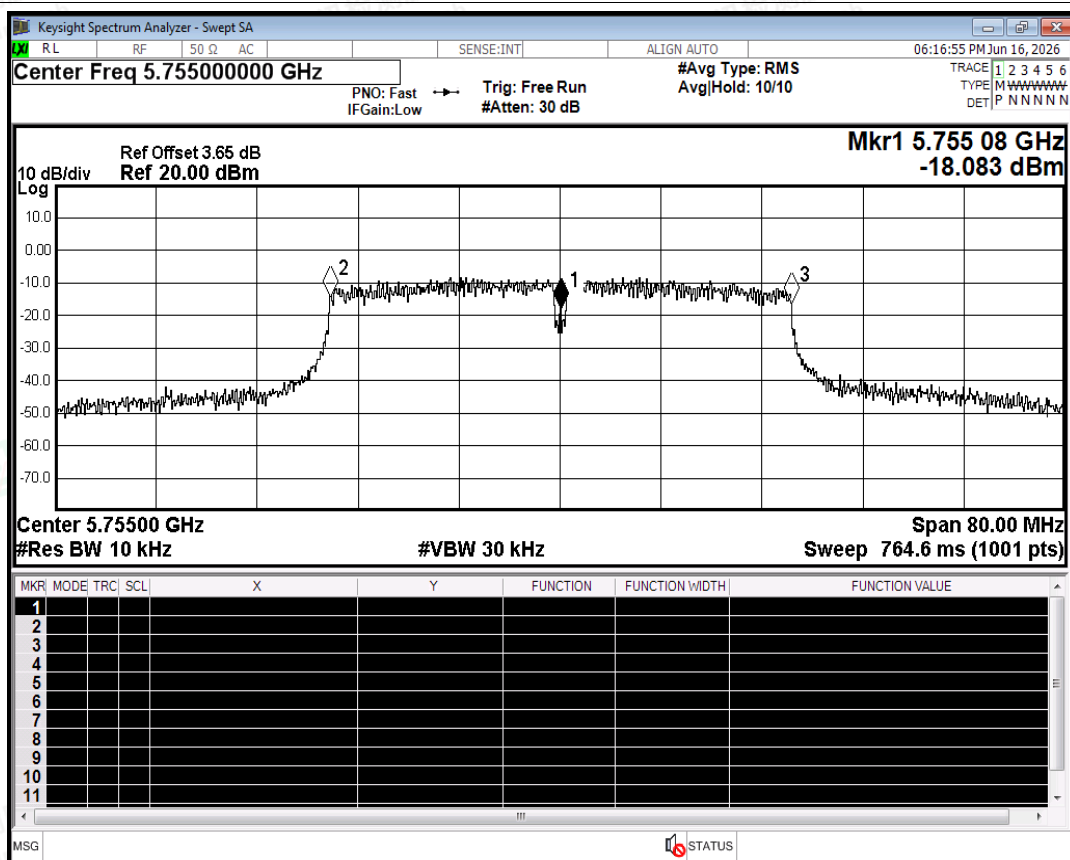

Freq. Stability NVNT ac40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

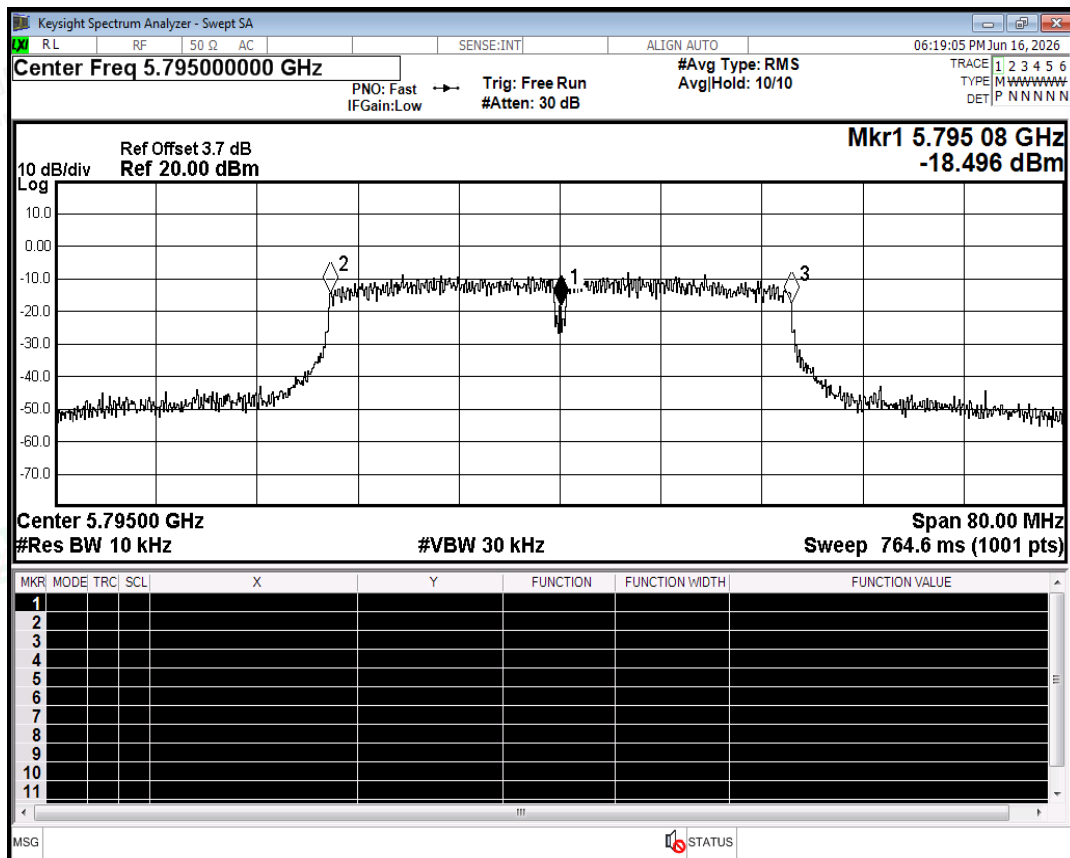

Freq. Stability NVNT ac40 5795MHz Ant1

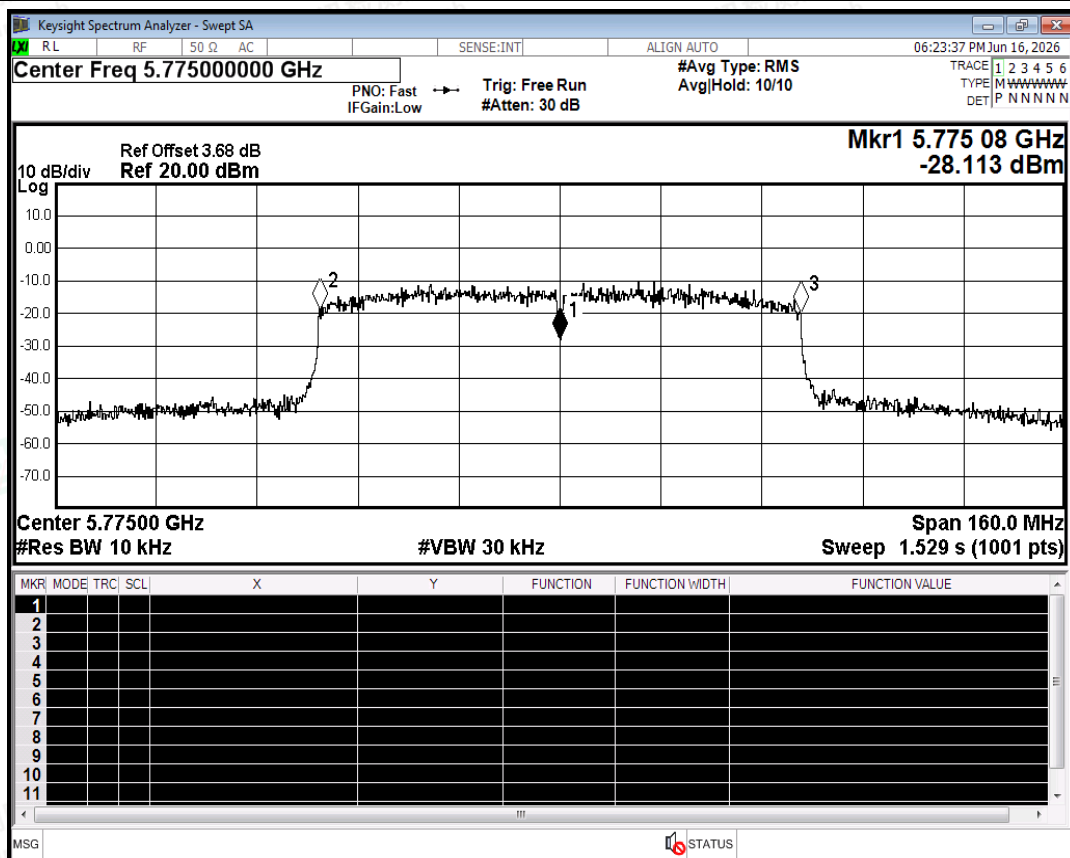

Freq. Stability NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant0	91.19	0.4	0.48
NVNT	a	5785	Ant0	94.95	0.22	0.48
NVNT	a	5825	Ant0	95.39	0.2	0.48
NVNT	n20	5745	Ant0	95.05	0.22	0.52
NVNT	n20	5785	Ant0	94.12	0.26	0.52
NVNT	n20	5825	Ant0	95.05	0.22	0.52
NVNT	n40	5755	Ant0	81.9	0.87	1.05
NVNT	n40	5795	Ant0	88.79	0.52	1.05
NVNT	ac20	5745	Ant0	88.99	0.51	0.52
NVNT	ac20	5785	Ant0	92.79	0.33	0.52
NVNT	ac20	5825	Ant0	93.72	0.28	0.52
NVNT	ac40	5755	Ant0	83.48	0.78	1.04
NVNT	ac40	5795	Ant0	88.07	0.55	1.04
NVNT	ac80	5775	Ant0	68.66	1.63	2.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

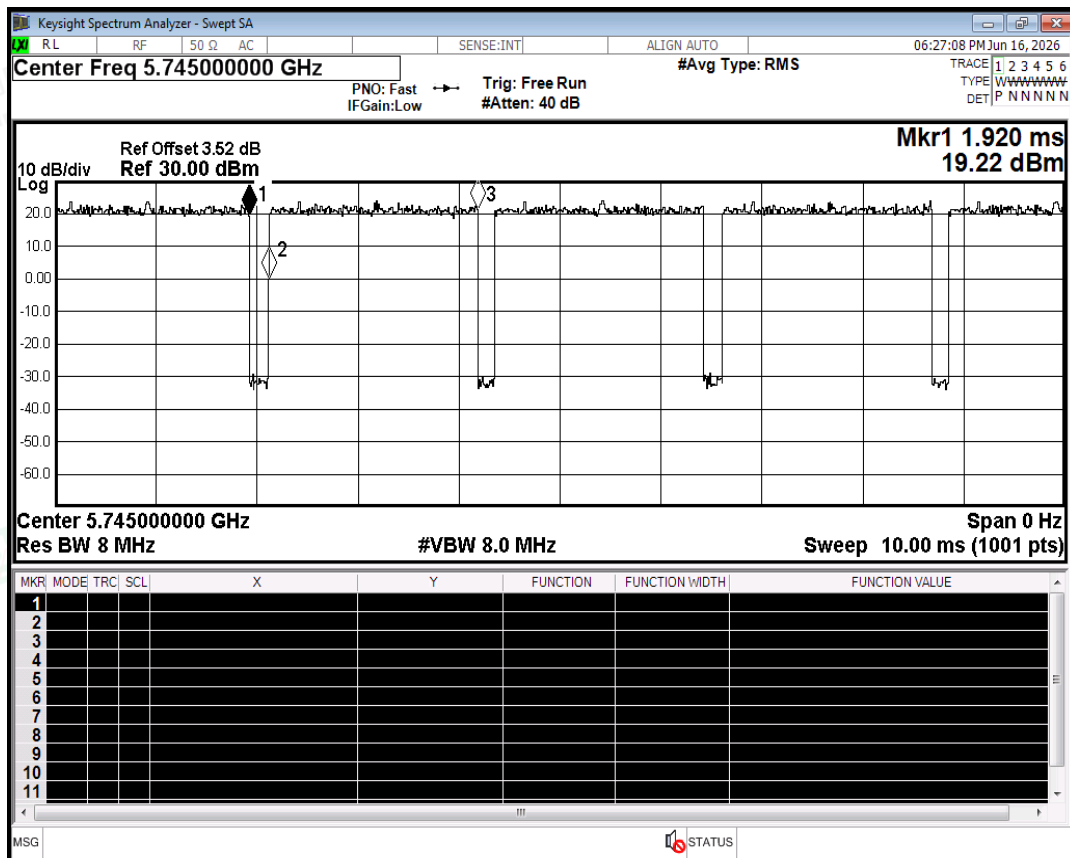

Duty Cycle NVNT a 5745MHz Ant0

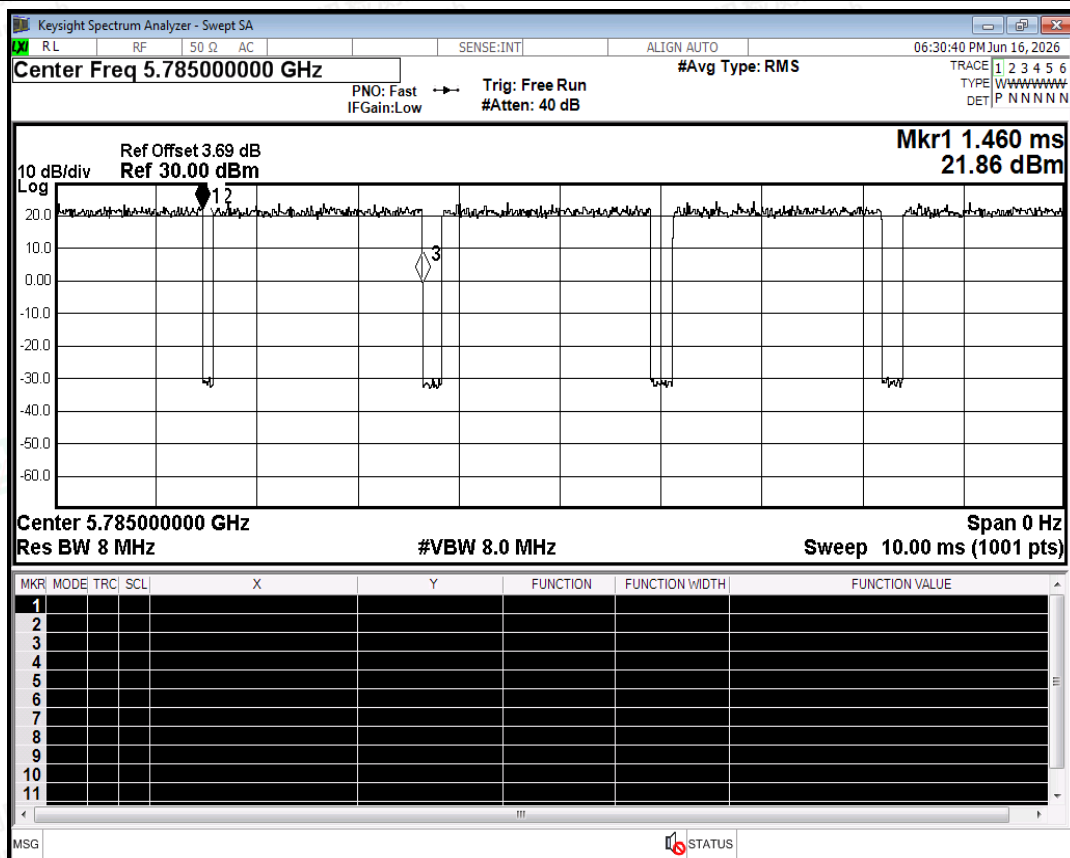

Duty Cycle NVNT a 5785MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

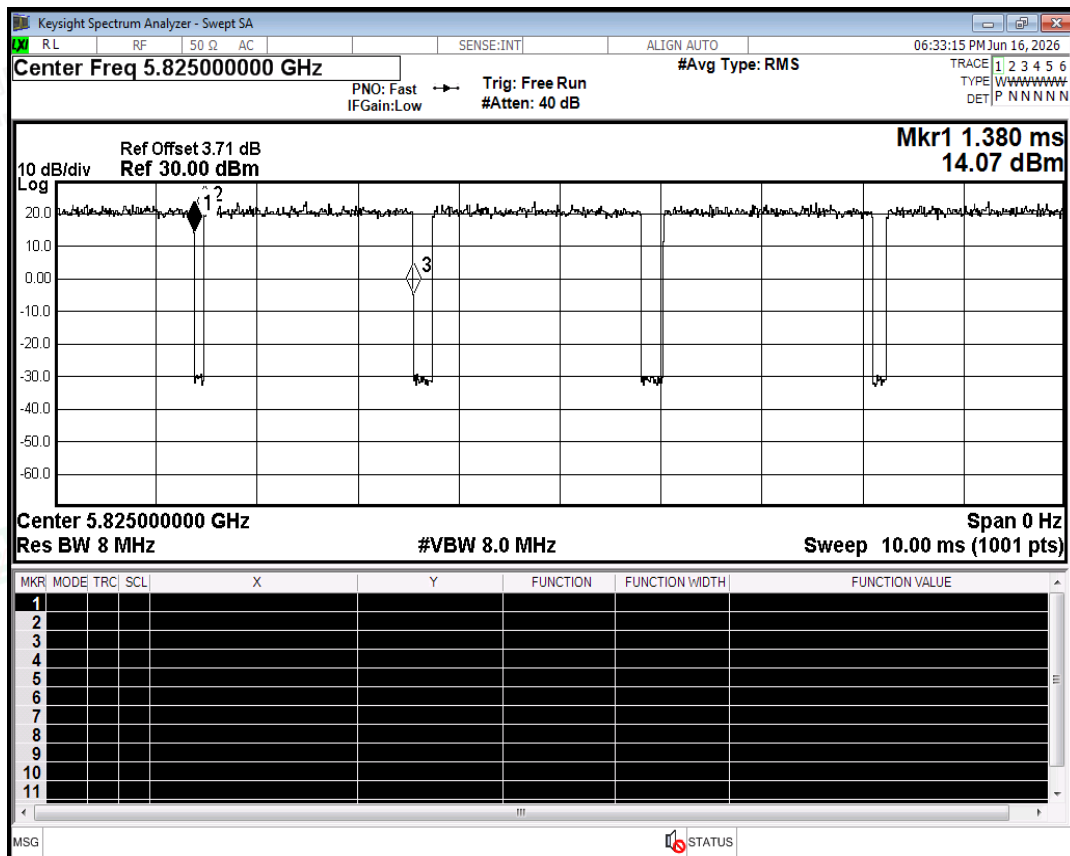

Duty Cycle NVNT a 5825MHz Ant0

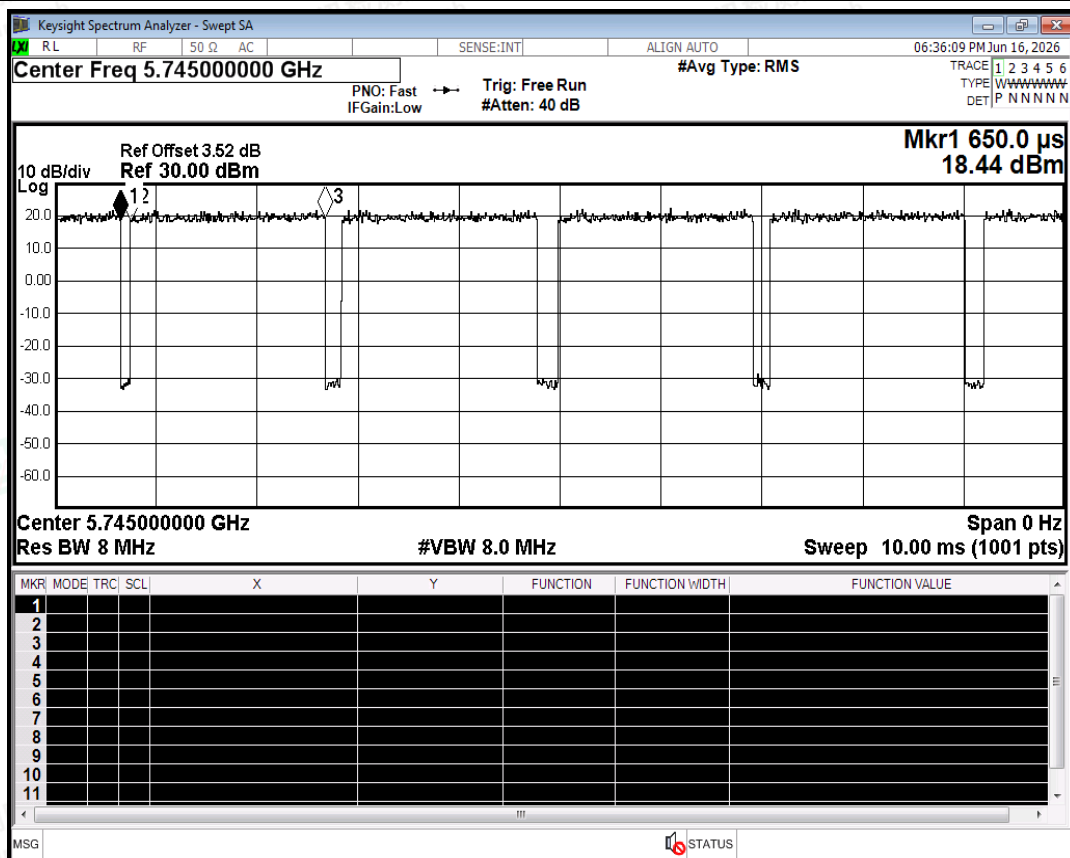

Duty Cycle NVNT n20 5745MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

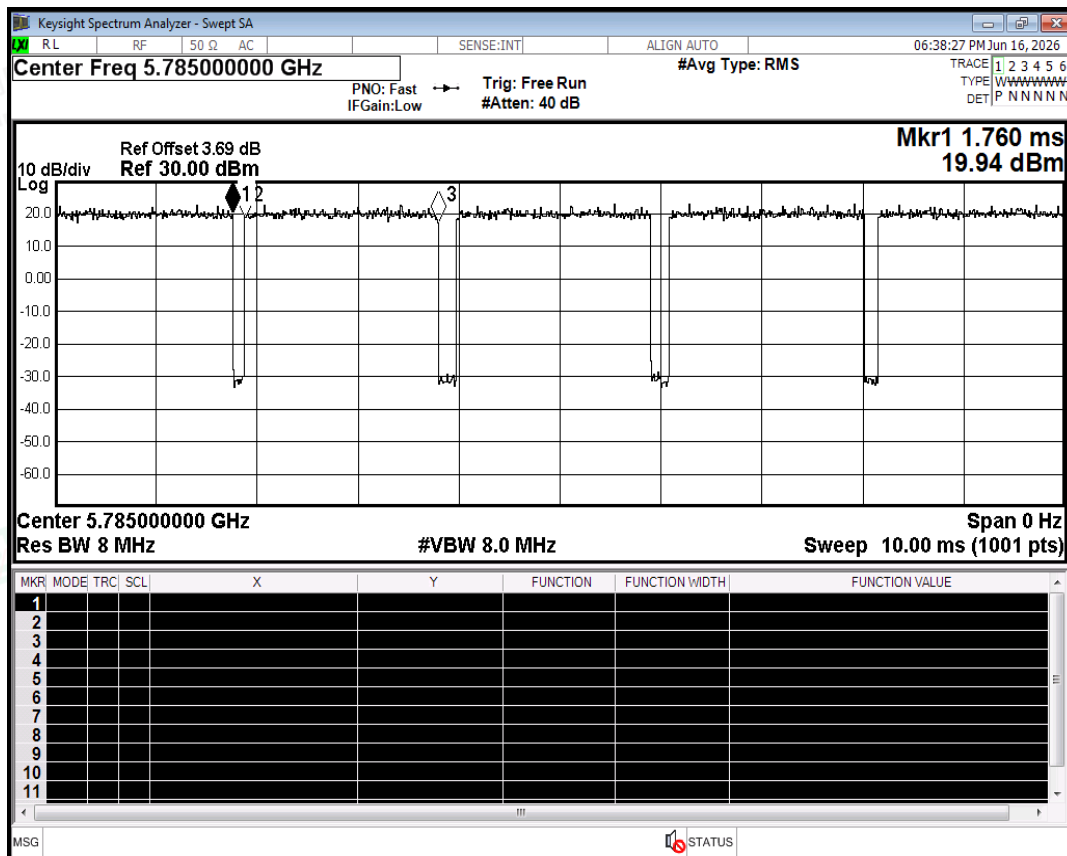


Duty Cycle NVNT n20 5785MHz Ant0

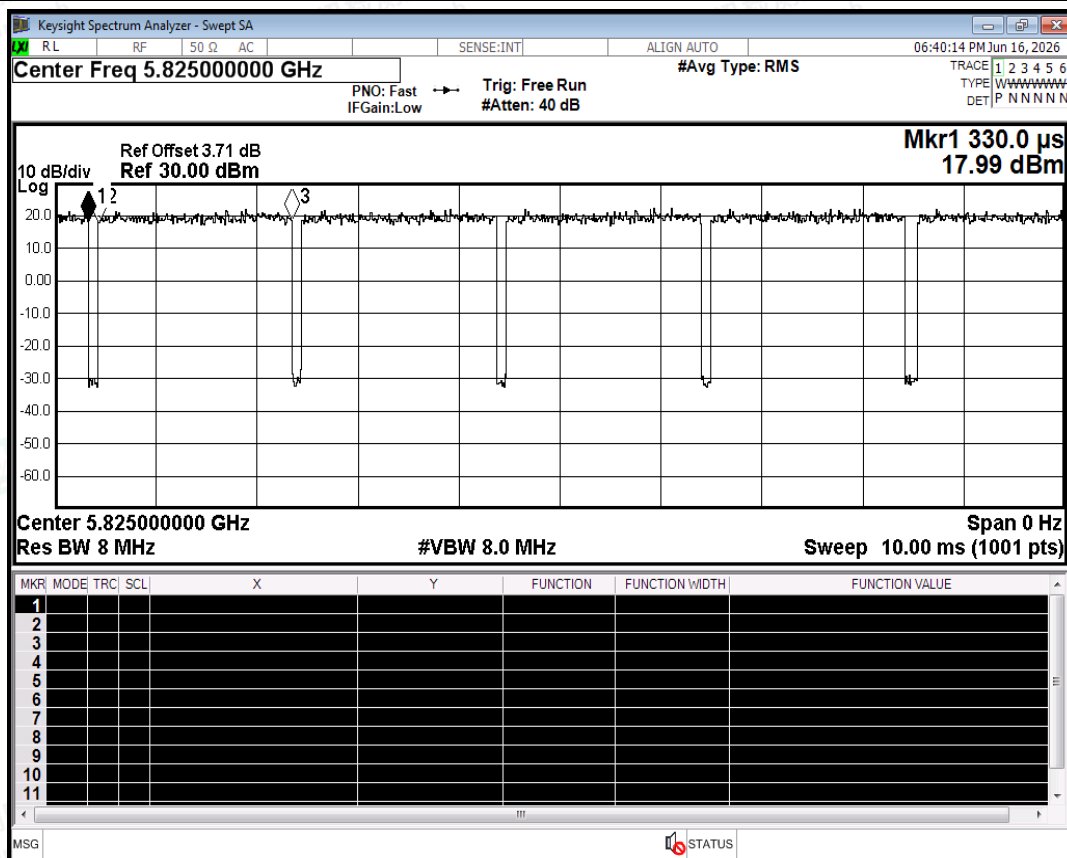


Duty Cycle NVNT n20 5825MHz Ant0



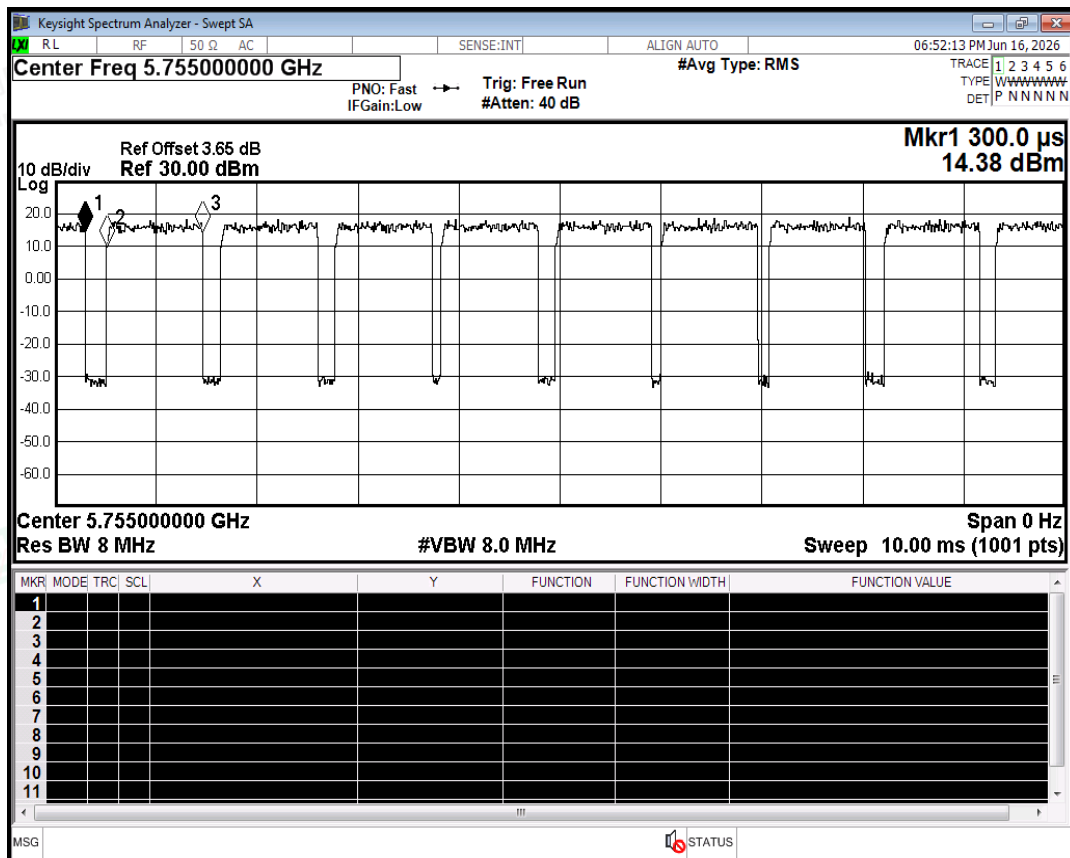


Duty Cycle NVNT n40 5755MHz Ant0

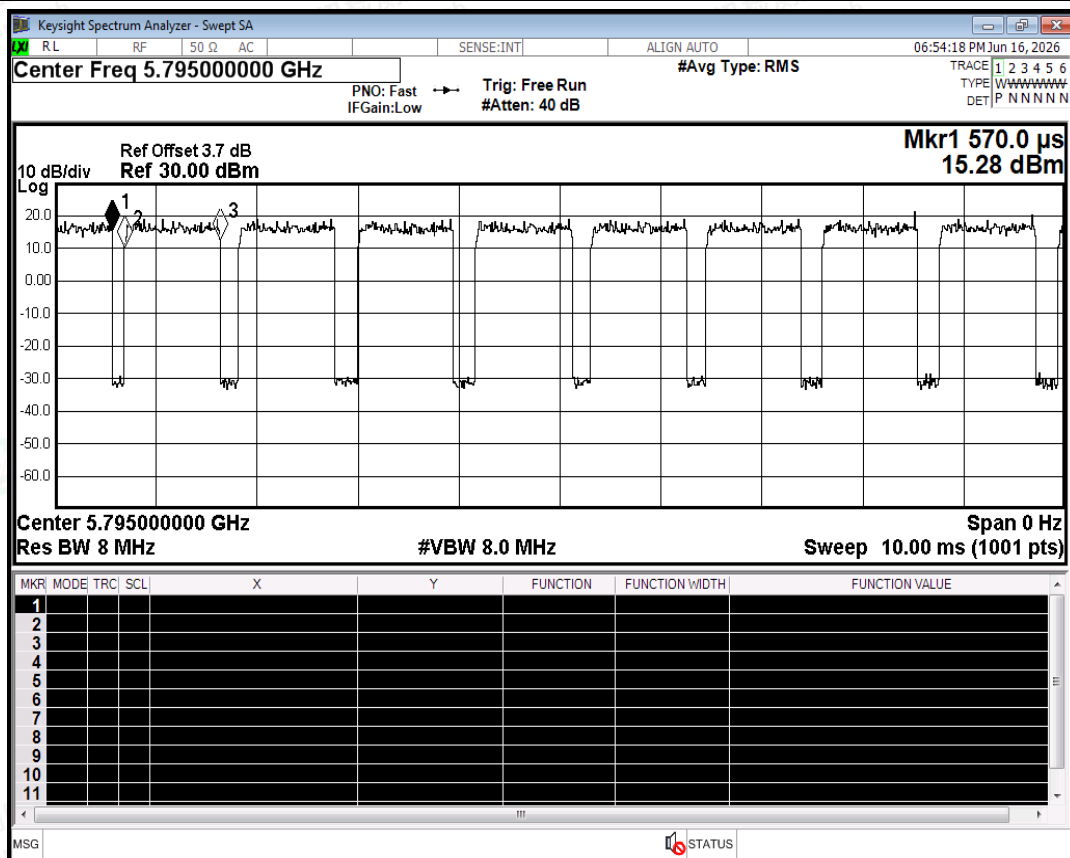


Duty Cycle NVNT n40 5795MHz Ant0



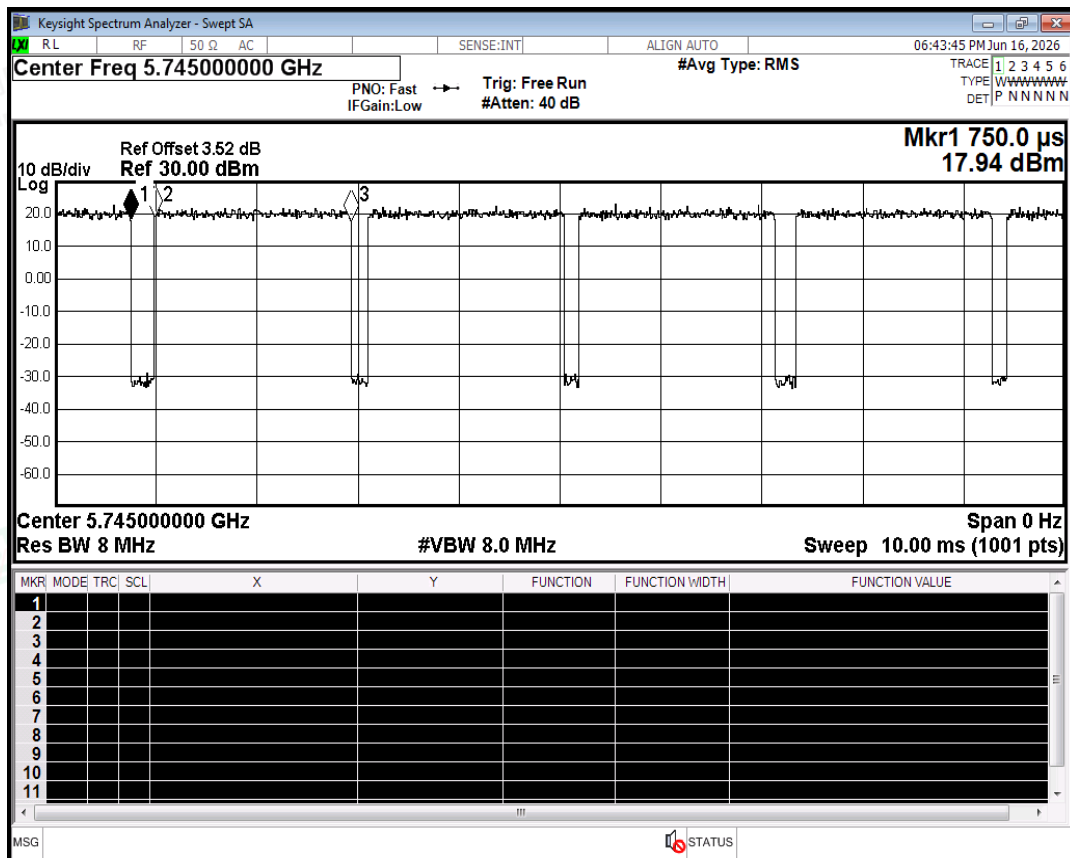

Duty Cycle NVNT ac20 5745MHz Ant0

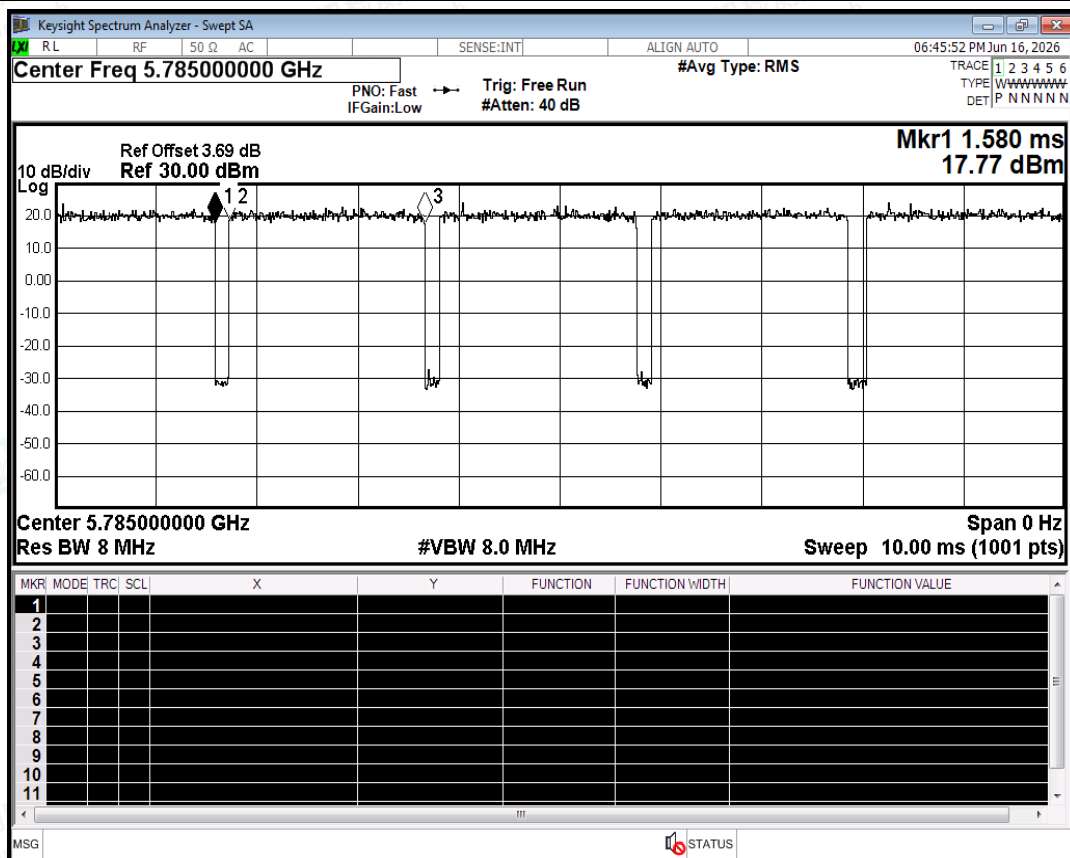

Duty Cycle NVNT ac20 5785MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

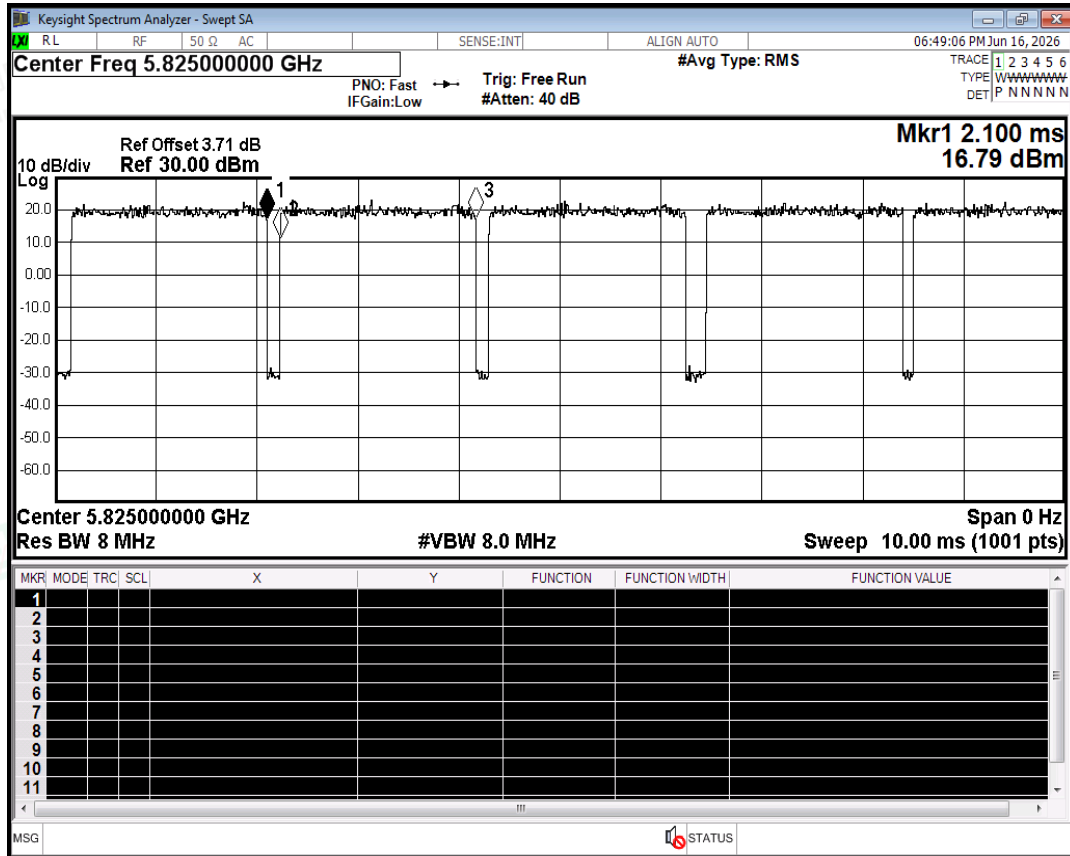

Duty Cycle NVNT ac20 5825MHz Ant0

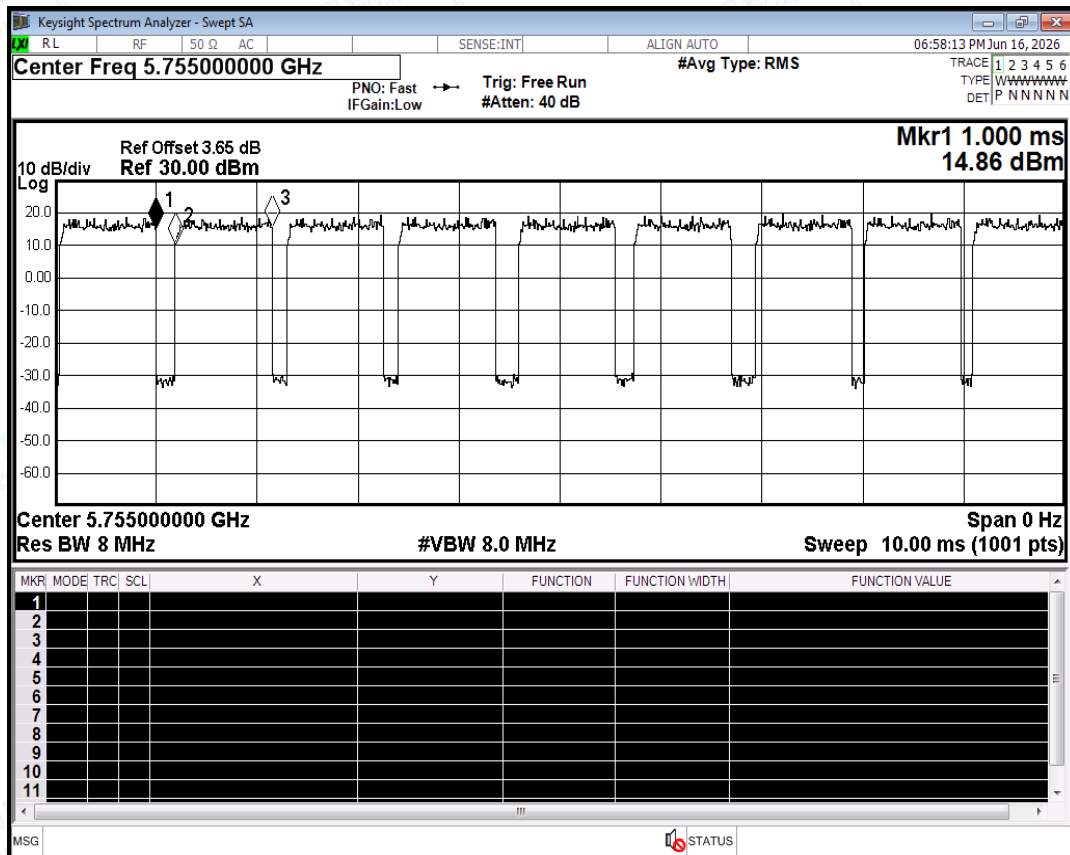

Duty Cycle NVNT ac40 5755MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

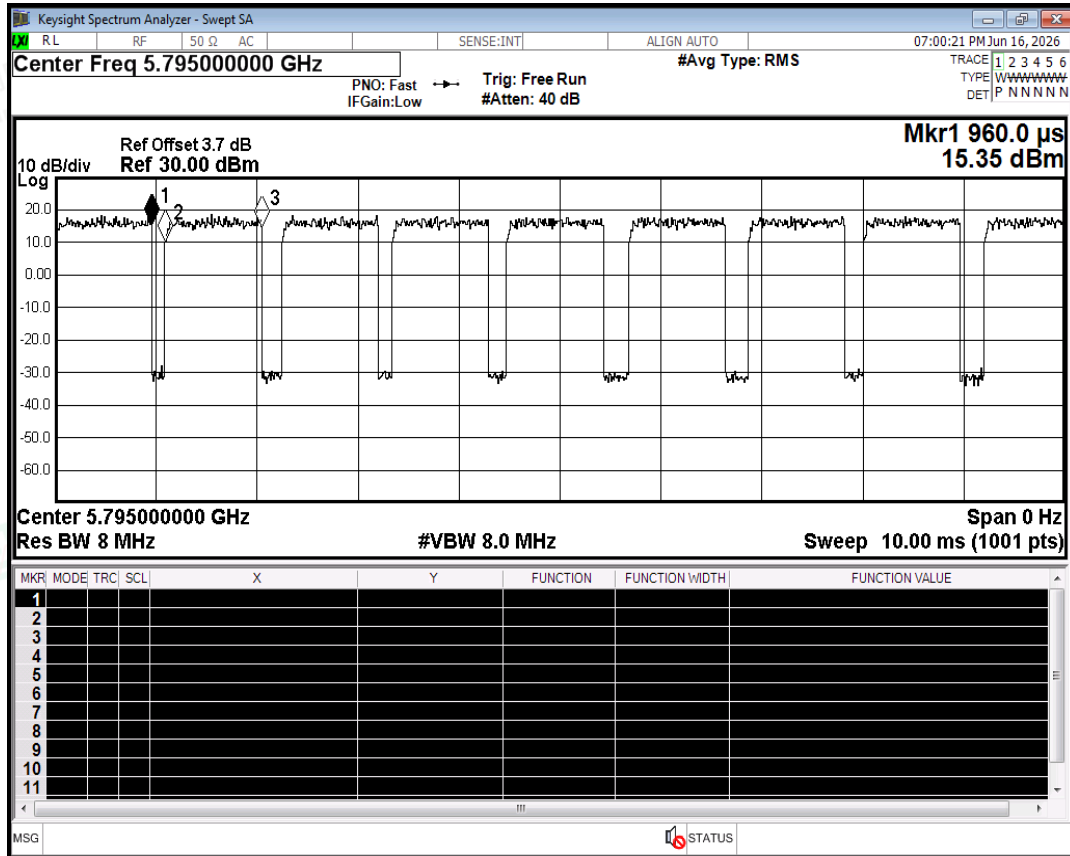

Duty Cycle NVNT ac40 5795MHz Ant0

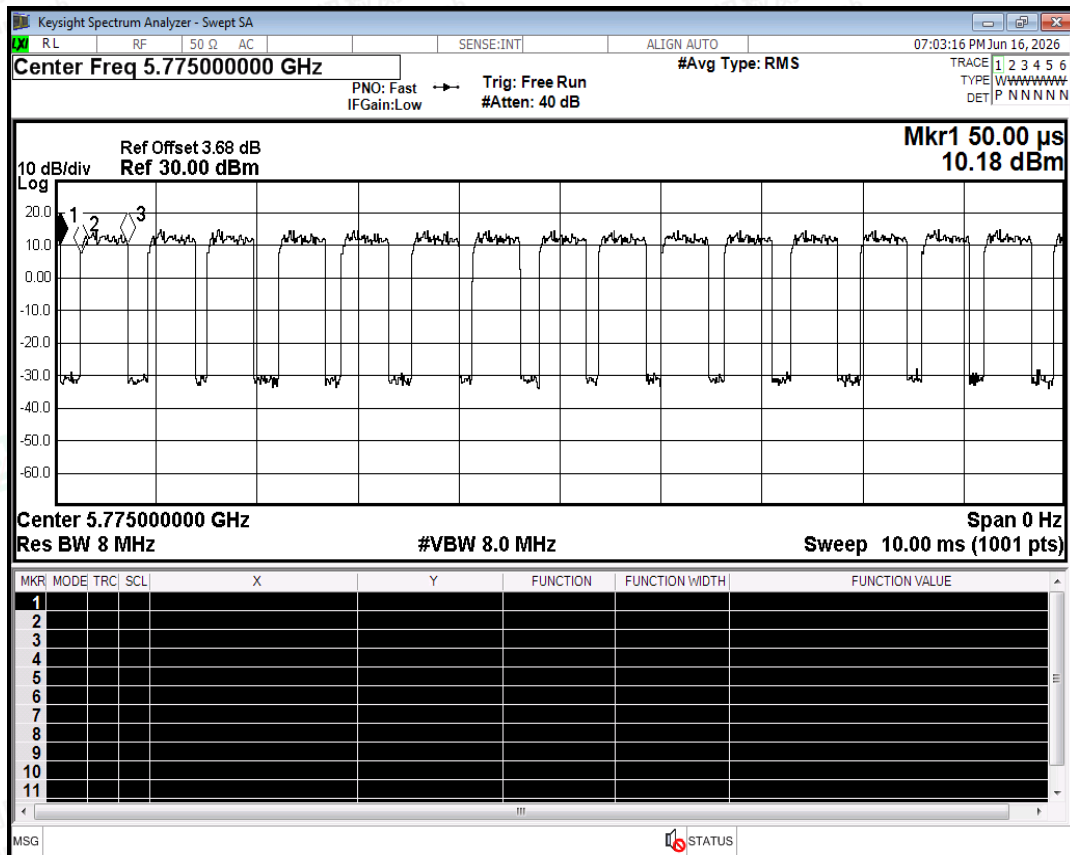

Duty Cycle NVNT ac80 5775MHz Ant0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant1	89.96	0.46	0.49
NVNT	a	5785	Ant1	93.24	0.3	0.48
NVNT	a	5825	Ant1	94.06	0.27	0.49
NVNT	n20	5745	Ant1	93.66	0.28	0.52
NVNT	n20	5785	Ant1	90.61	0.43	0.52
NVNT	n20	5825	Ant1	91.04	0.41	0.52
NVNT	n40	5755	Ant1	81.03	0.91	1.06
NVNT	n40	5795	Ant1	87.04	0.6	1.06
NVNT	ac20	5745	Ant1	88.53	0.53	0.52
NVNT	ac20	5785	Ant1	88.94	0.51	0.52
NVNT	ac20	5825	Ant1	89.77	0.47	0.52
NVNT	ac40	5755	Ant1	85.71	0.67	1.04
NVNT	ac40	5795	Ant1	80.51	0.94	1.05
NVNT	ac80	5775	Ant1	68.66	1.63	2.17



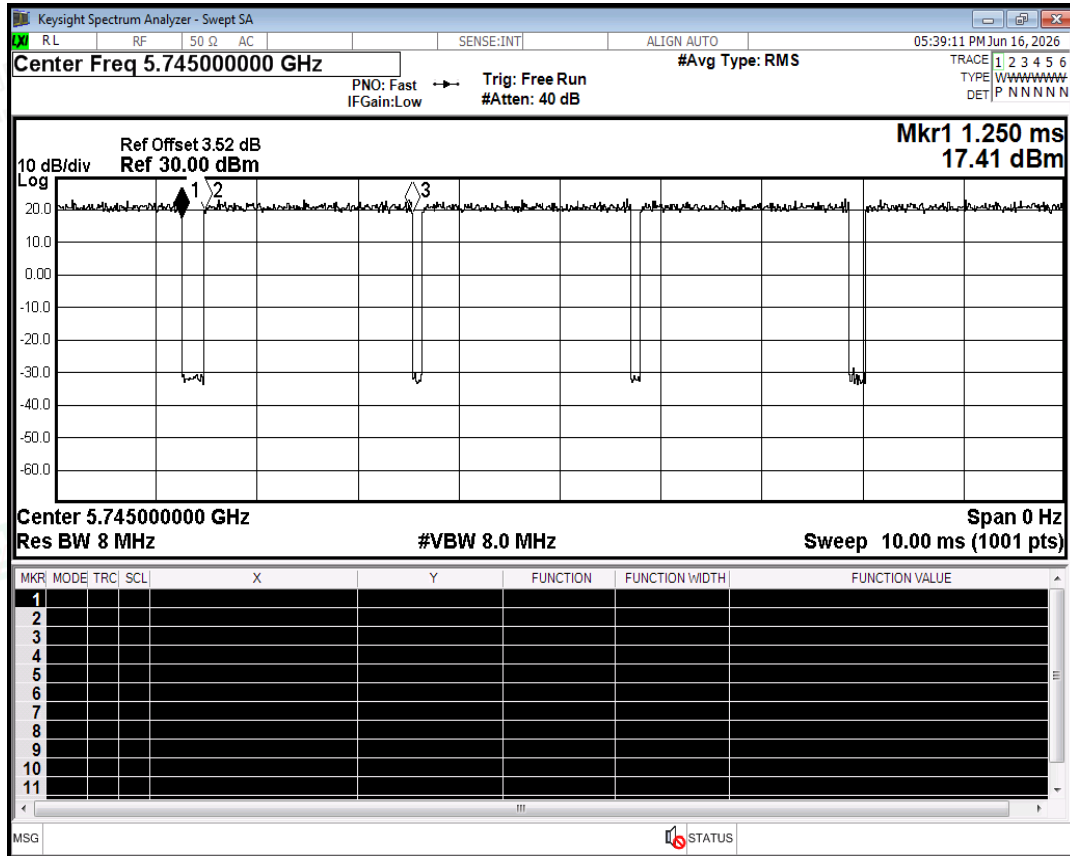

Duty Cycle NVNT a 5745MHz Ant1

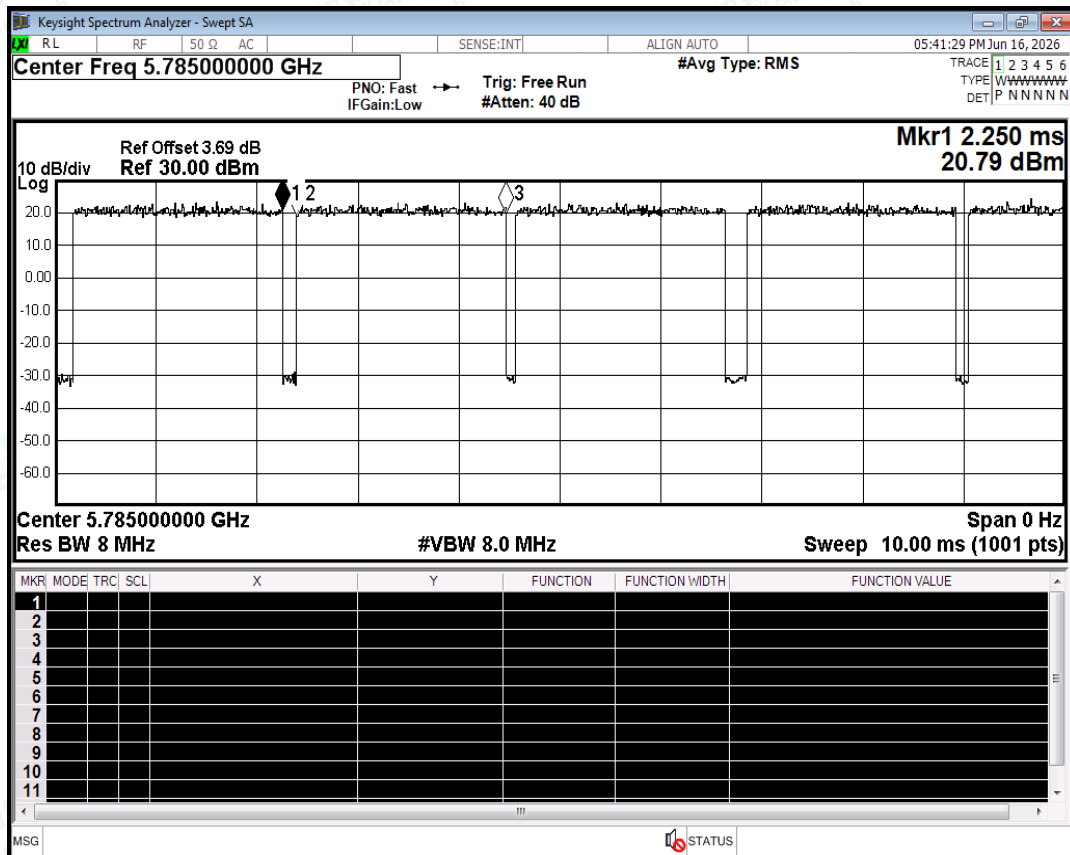

Duty Cycle NVNT a 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

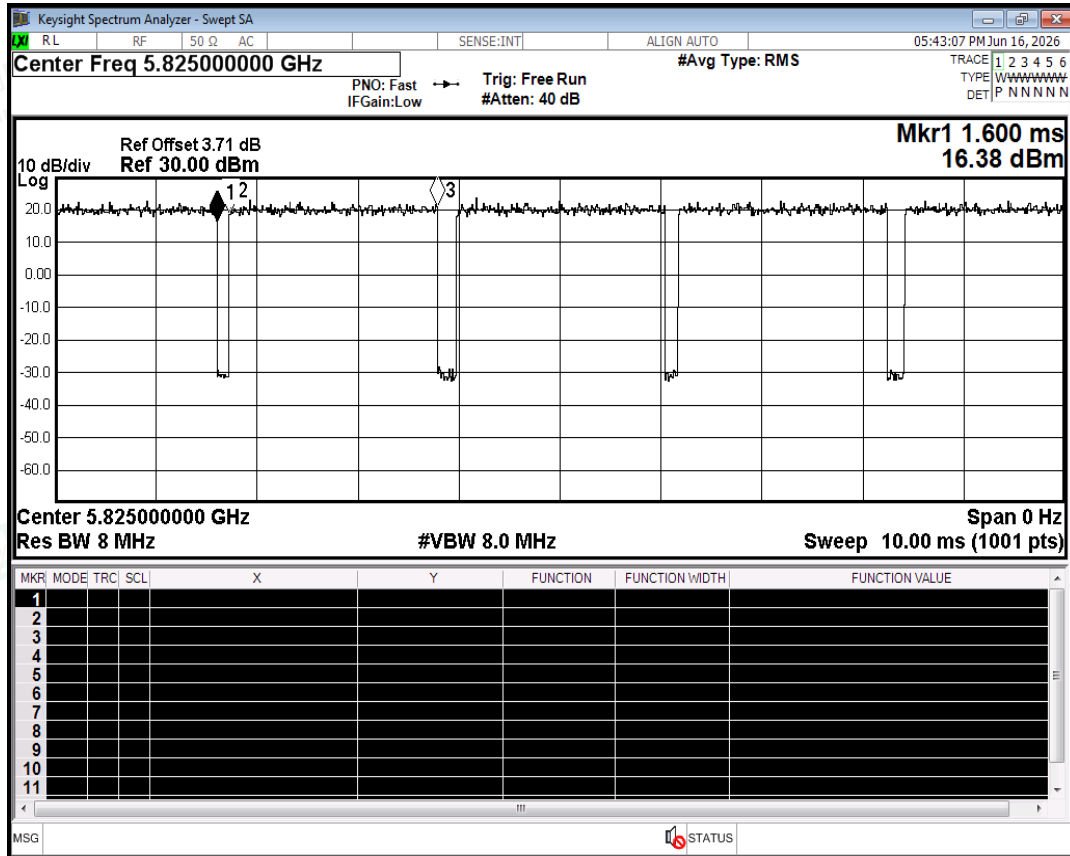

Duty Cycle NVNT a 5825MHz Ant1

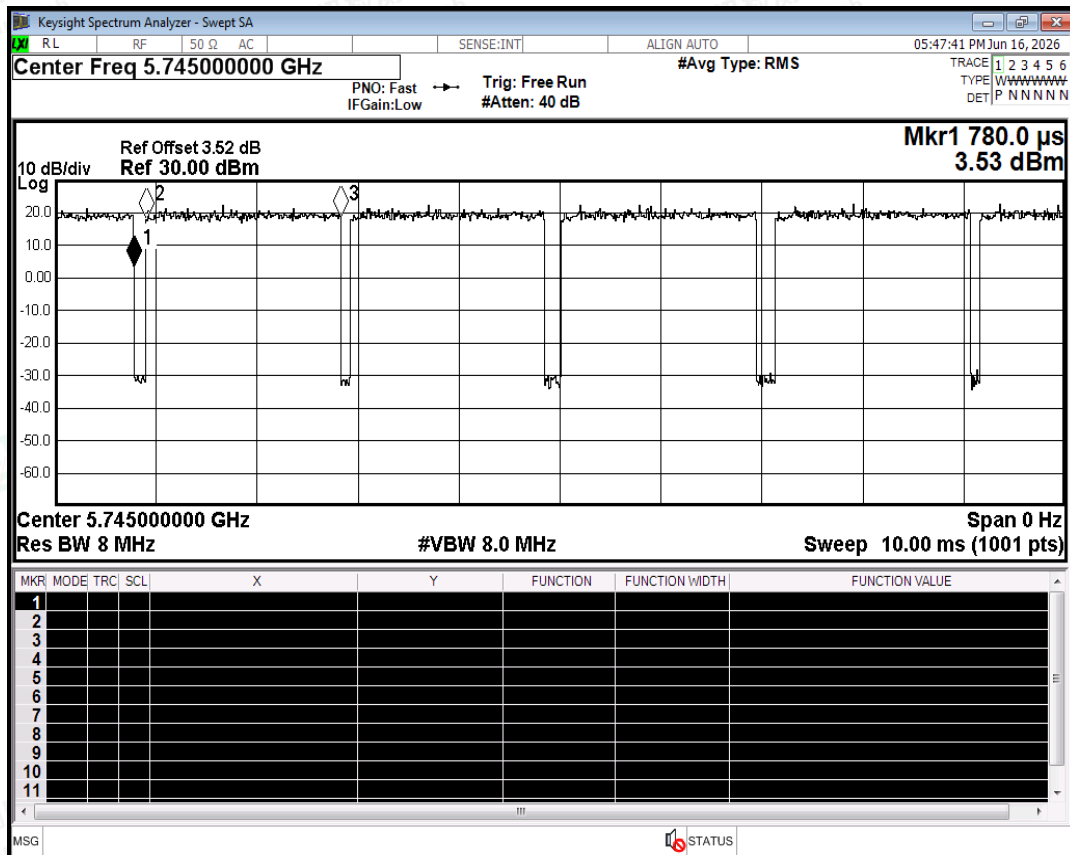

Duty Cycle NVNT n20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

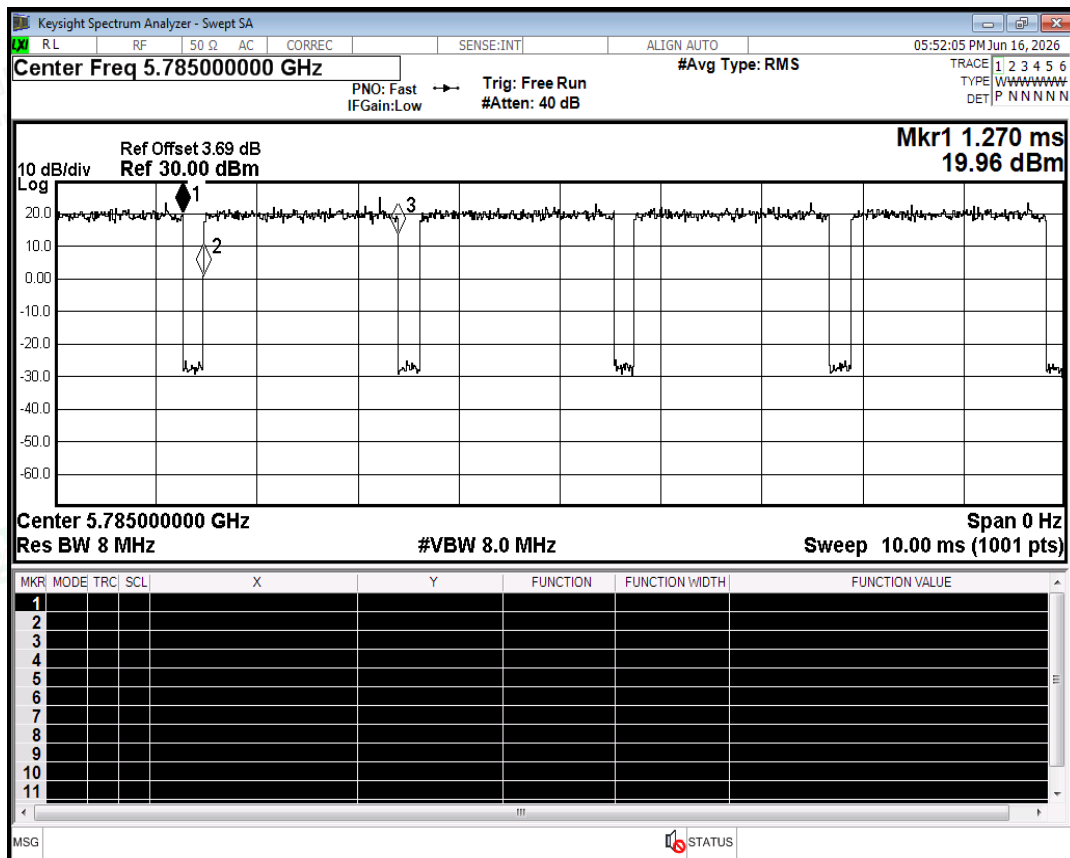

Duty Cycle NVNT n20 5785MHz Ant1

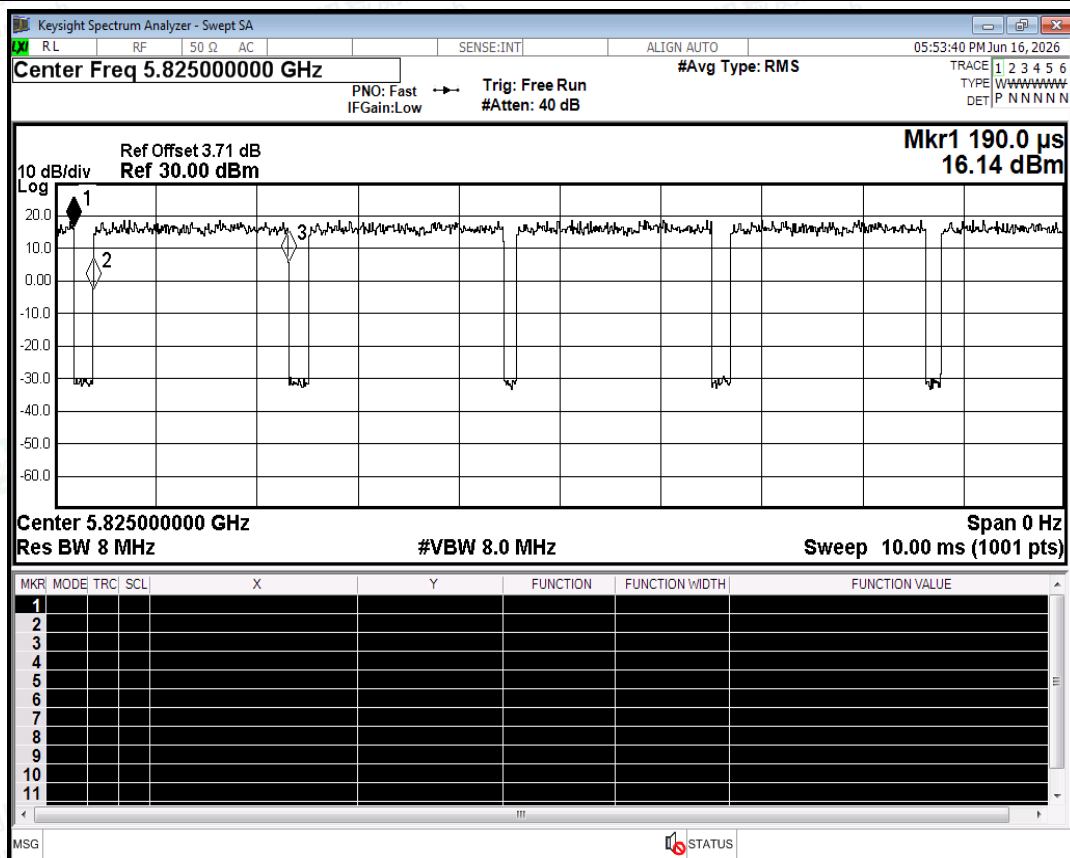

Duty Cycle NVNT n20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

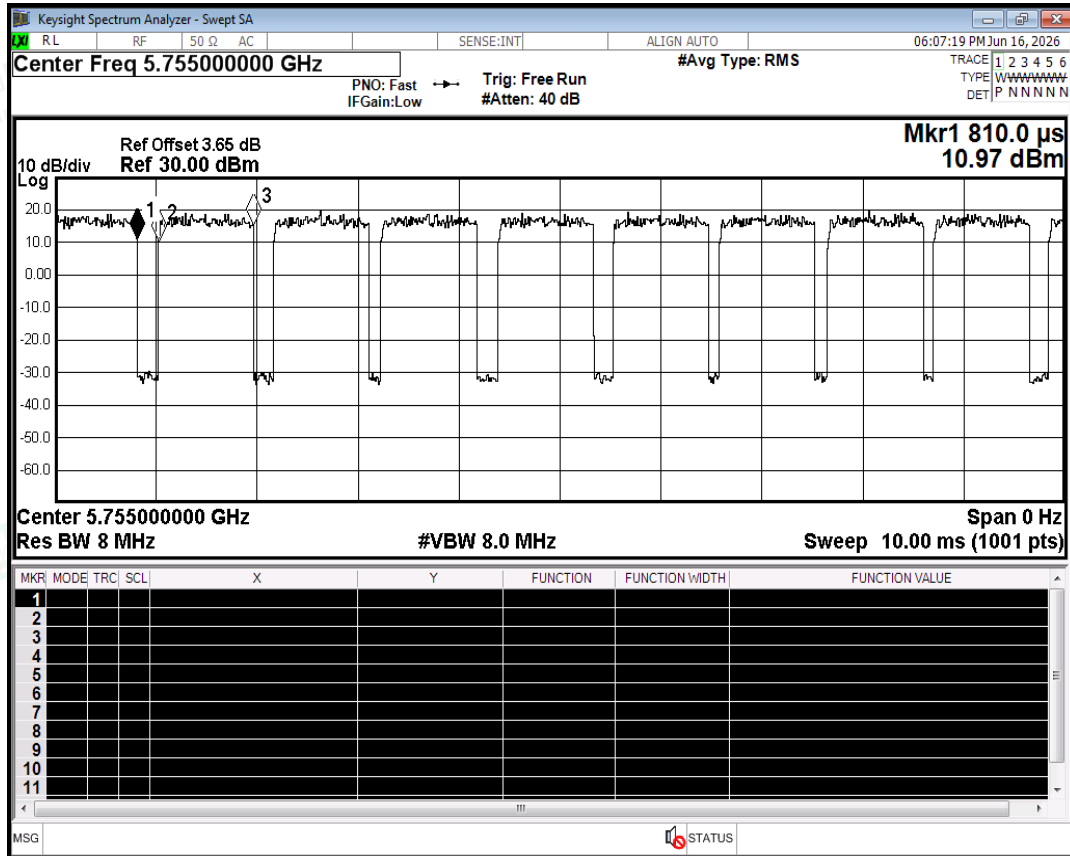

Duty Cycle NVNT n40 5755MHz Ant1

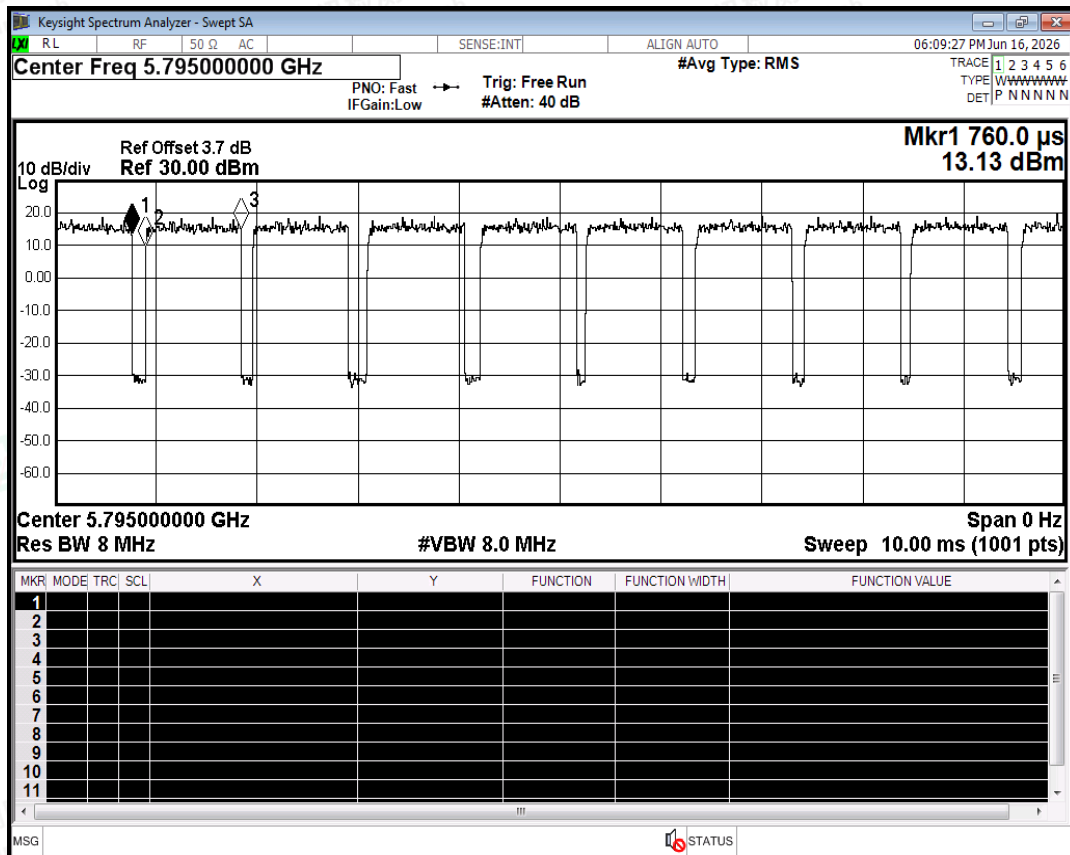

Duty Cycle NVNT n40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

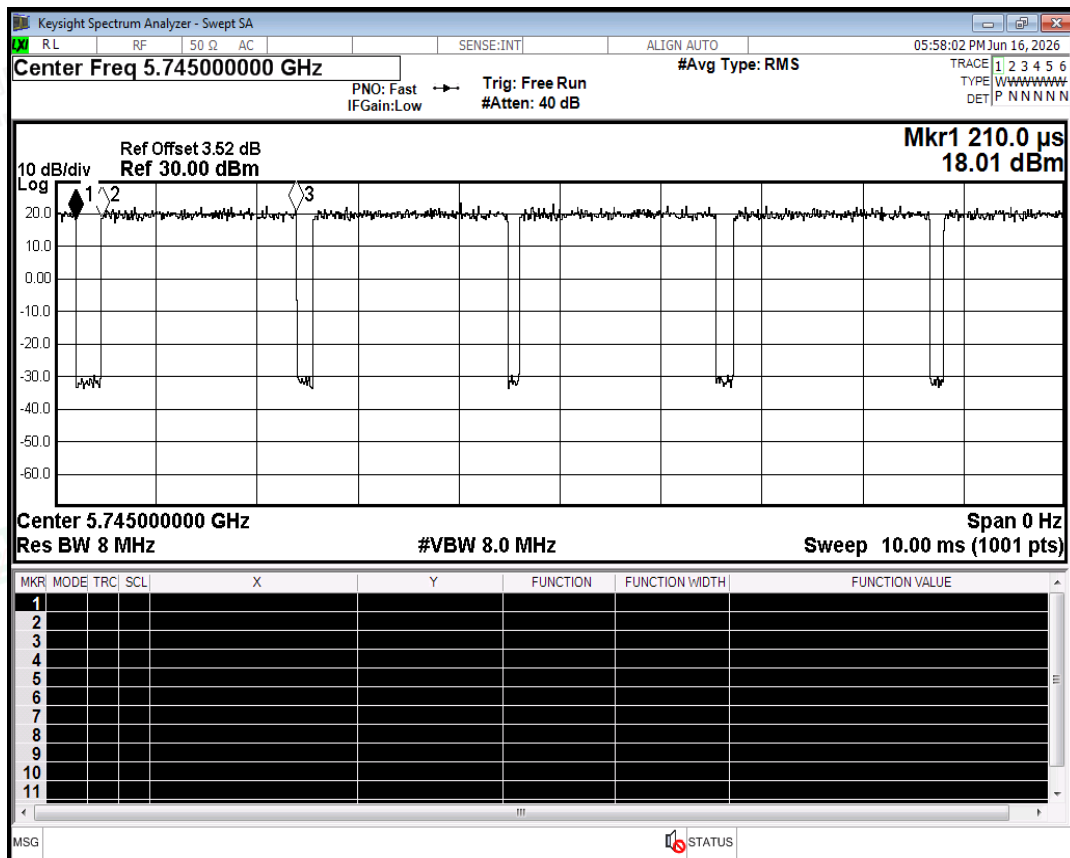

Duty Cycle NVNT ac20 5745MHz Ant1

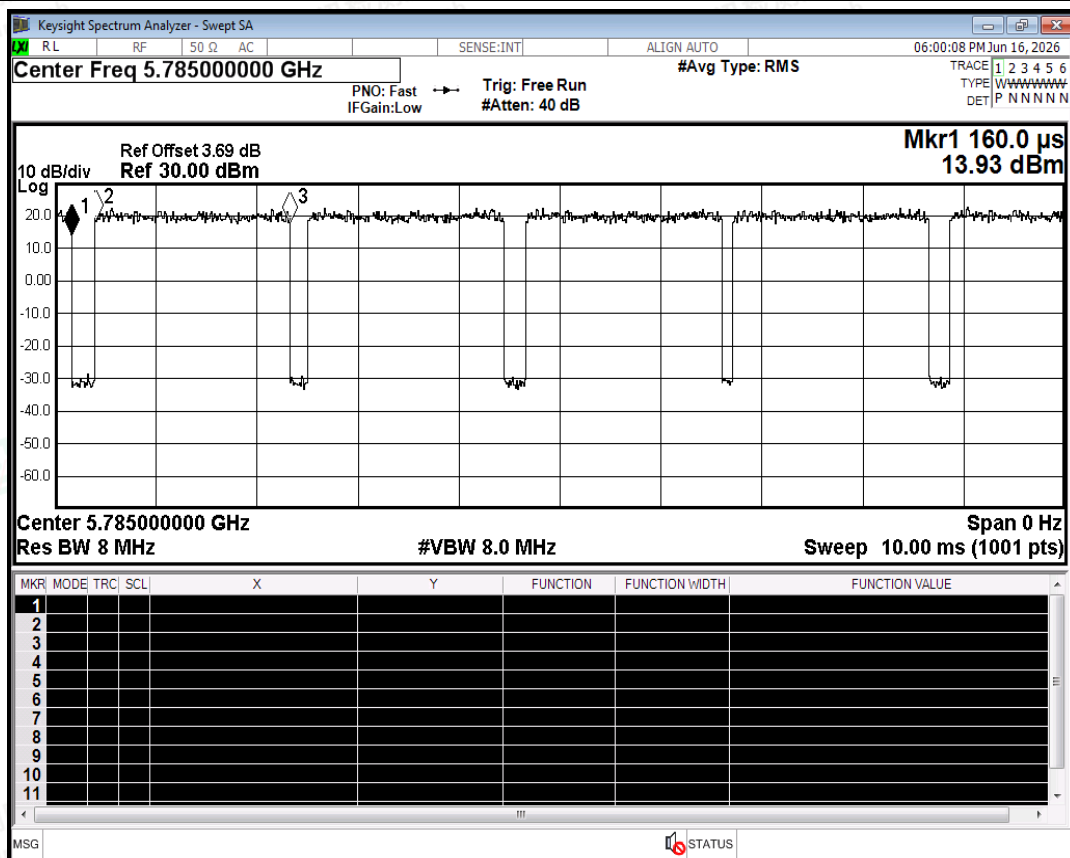

Duty Cycle NVNT ac20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

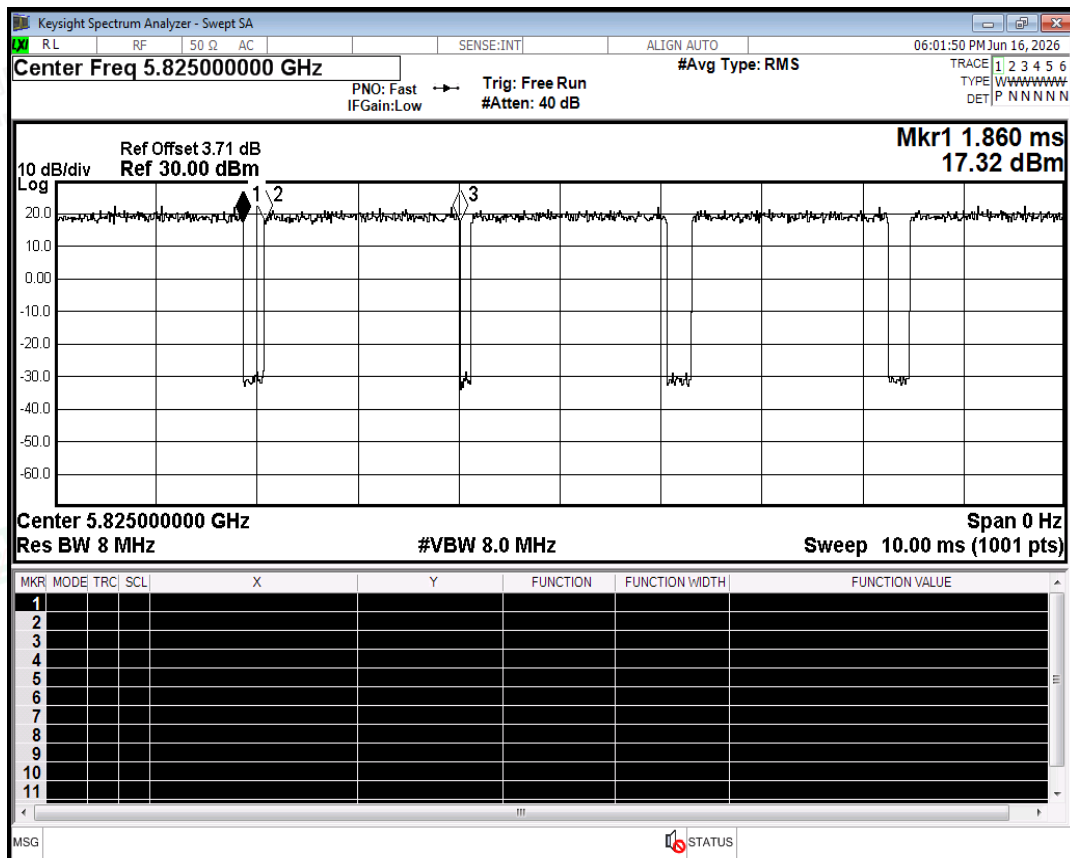

Duty Cycle NVNT ac20 5825MHz Ant1

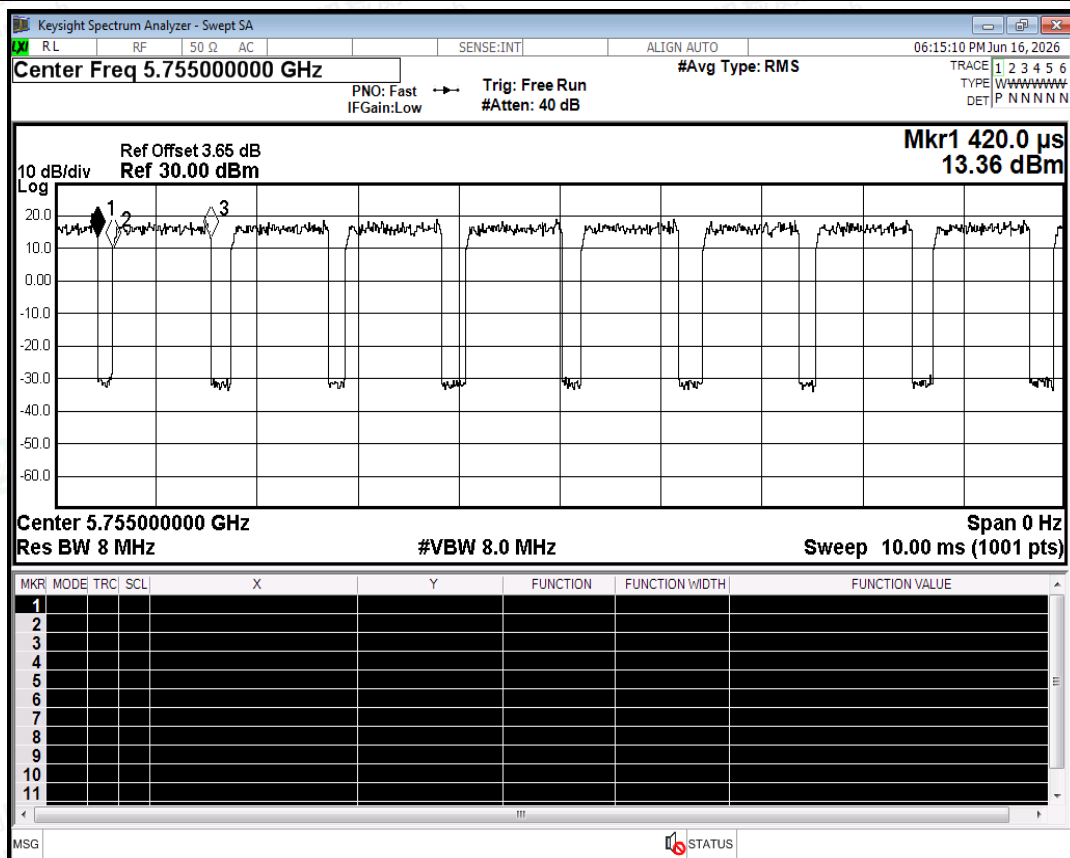

Duty Cycle NVNT ac40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

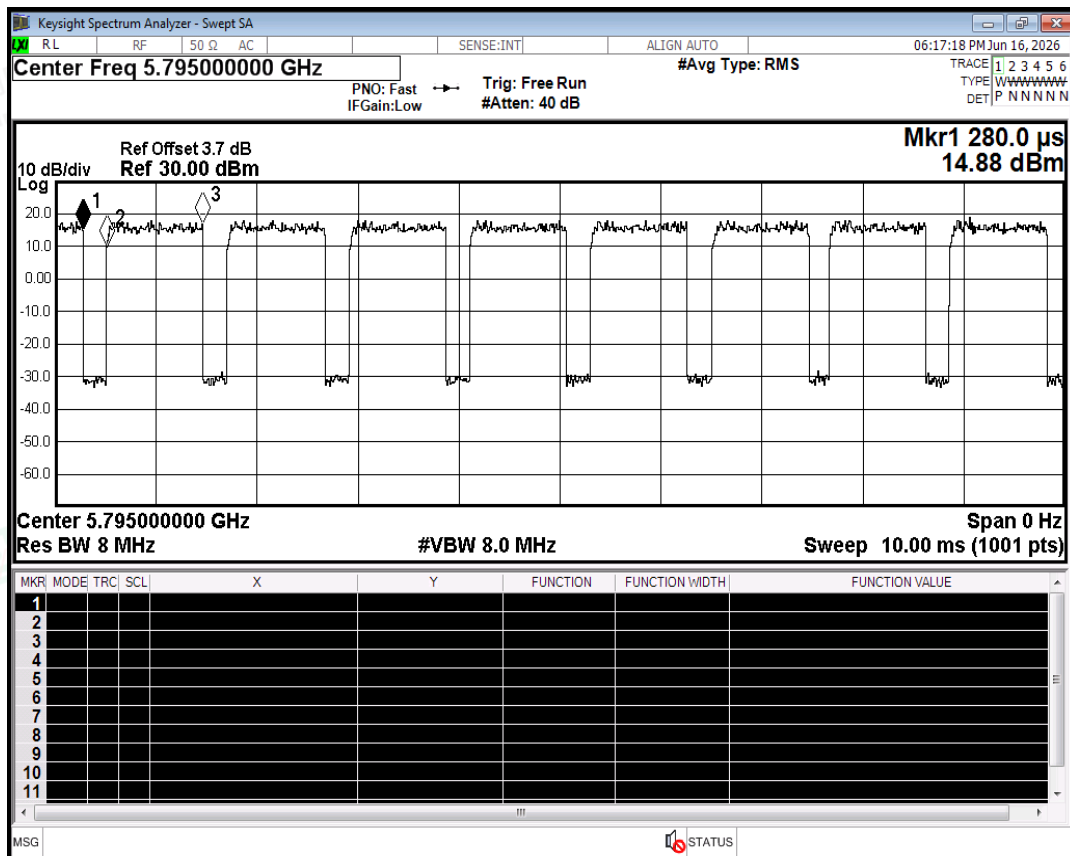

Duty Cycle NVNT ac40 5795MHz Ant1

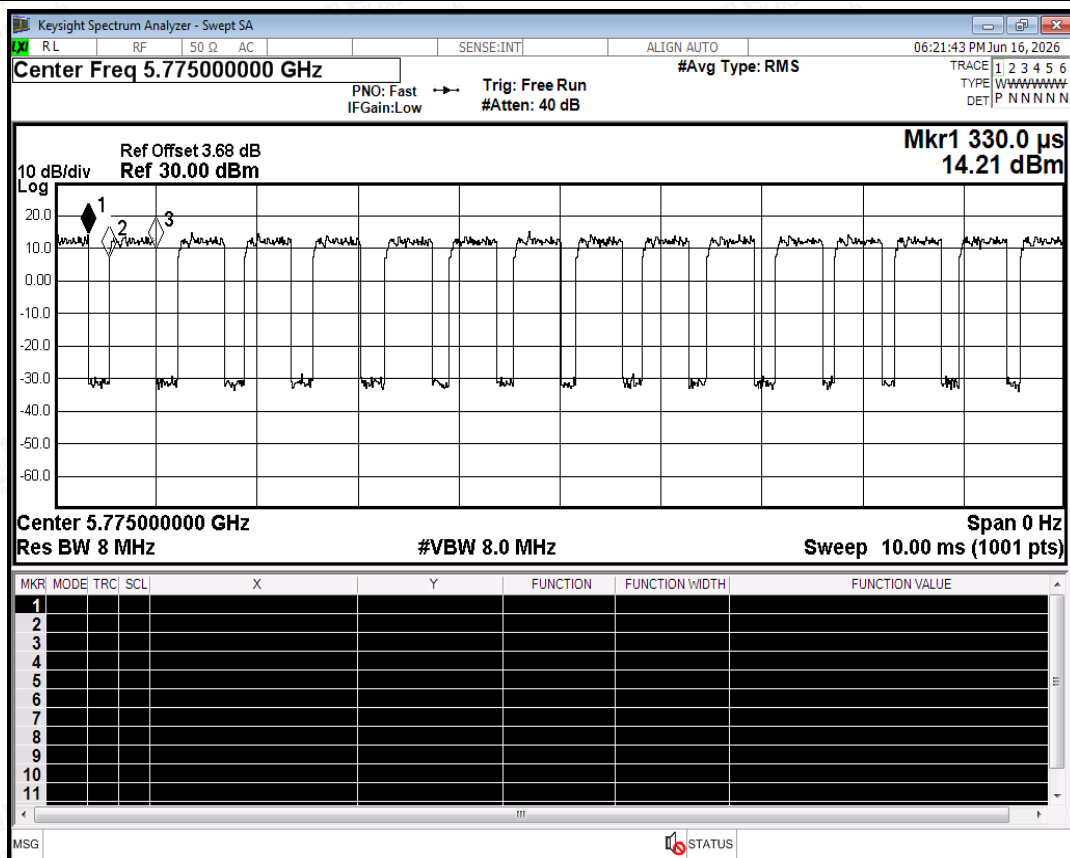

Duty Cycle NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity