

Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	6.82	99.27	0.03	6.85	≤23.98	PASS
11A	Ant2	5180	7.42	99.27	0.03	7.45	≤23.98	PASS
11A	Ant1	5220	6.33	99.27	0.03	6.36	≤23.98	PASS
11A	Ant2	5220	6.85	99.27	0.03	6.88	≤23.98	PASS
11A	Ant1	5240	5.43	99.27	0.03	5.46	≤23.98	PASS
11A	Ant2	5240	6.28	99.27	0.03	6.31	≤23.98	PASS
11N20MIMO	Ant1	5180	4.37	99.14	0.04	4.41	≤23.98	PASS
11N20MIMO	Ant2	5180	4.34	99.13	0.04	4.38	≤23.98	PASS
11N20MIMO	total	5180	---	---	---	7.41	≤23.98	PASS
11N20MIMO	Ant1	5220	3.80	99.13	0.04	3.84	≤23.98	PASS
11N20MIMO	Ant2	5220	3.77	99.14	0.04	3.81	≤23.98	PASS
11N20MIMO	total	5220	---	---	---	6.84	≤23.98	PASS
11N20MIMO	Ant1	5240	3.24	99.14	0.04	3.28	≤23.98	PASS
11N20MIMO	Ant2	5240	3.26	99.14	0.04	3.30	≤23.98	PASS
11N20MIMO	total	5240	---	---	---	6.30	≤23.98	PASS
11N40MIMO	Ant1	5190	4.01	98.28	0.08	4.09	≤23.98	PASS
11N40MIMO	Ant2	5190	4.01	98.28	0.08	4.09	≤23.98	PASS
11N40MIMO	total	5190	---	---	---	7.10	≤23.98	PASS
11N40MIMO	Ant1	5230	2.91	98.28	0.08	2.99	≤23.98	PASS
11N40MIMO	Ant2	5230	2.95	98.28	0.08	3.03	≤23.98	PASS
11N40MIMO	total	5230	---	---	---	6.02	≤23.98	PASS
11AC20MIMO	Ant1	5180	4.24	99.14	0.04	4.28	≤23.98	PASS
11AC20MIMO	Ant2	5180	4.18	99.14	0.04	4.22	≤23.98	PASS
11AC20MIMO	total	5180	---	---	---	7.26	≤23.98	PASS
11AC20MIMO	Ant1	5220	3.81	99.14	0.04	3.85	≤23.98	PASS
11AC20MIMO	Ant2	5220	3.81	99.14	0.04	3.85	≤23.98	PASS
11AC20MIMO	total	5220	---	---	---	6.86	≤23.98	PASS
11AC20MIMO	Ant1	5240	3.29	99.14	0.04	3.33	≤23.98	PASS
11AC20MIMO	Ant2	5240	3.31	99.14	0.04	3.35	≤23.98	PASS
11AC20MIMO	total	5240	---	---	---	6.35	≤23.98	PASS
11AC40MIMO	Ant1	5190	4.18	98.31	0.07	4.25	≤23.98	PASS
11AC40MIMO	Ant2	5190	4.06	98.28	0.08	4.14	≤23.98	PASS
11AC40MIMO	total	5190	---	---	---	7.21	≤23.98	PASS
11AC40MIMO	Ant1	5230	3.14	98.31	0.07	3.21	≤23.98	PASS
11AC40MIMO	Ant2	5230	3.04	98.31	0.07	3.11	≤23.98	PASS
11AC40MIMO	total	5230	---	---	---	6.17	≤23.98	PASS

11AC80MIMO	Ant1	5210	3.49	96.67	0.15	3.64	≤23.98	PASS
11AC80MIMO	Ant2	5210	3.39	96.55	0.15	3.54	≤23.98	PASS
11AC80MIMO	total	5210	---	---	---	6.60	≤23.98	PASS

Note: The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs Channel Power

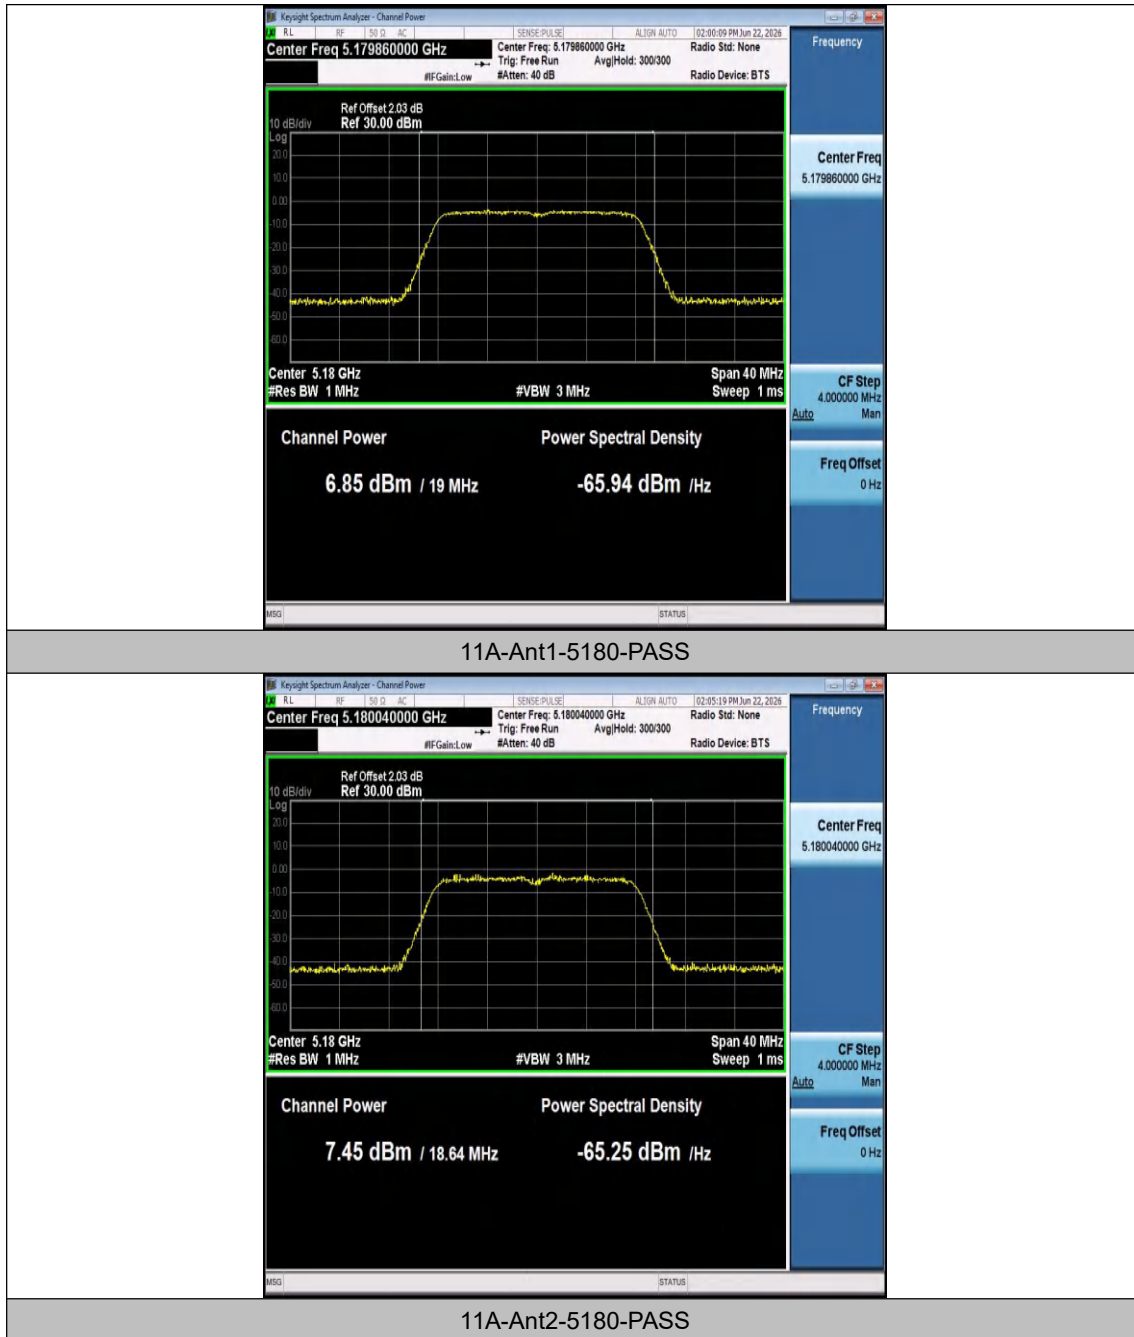

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

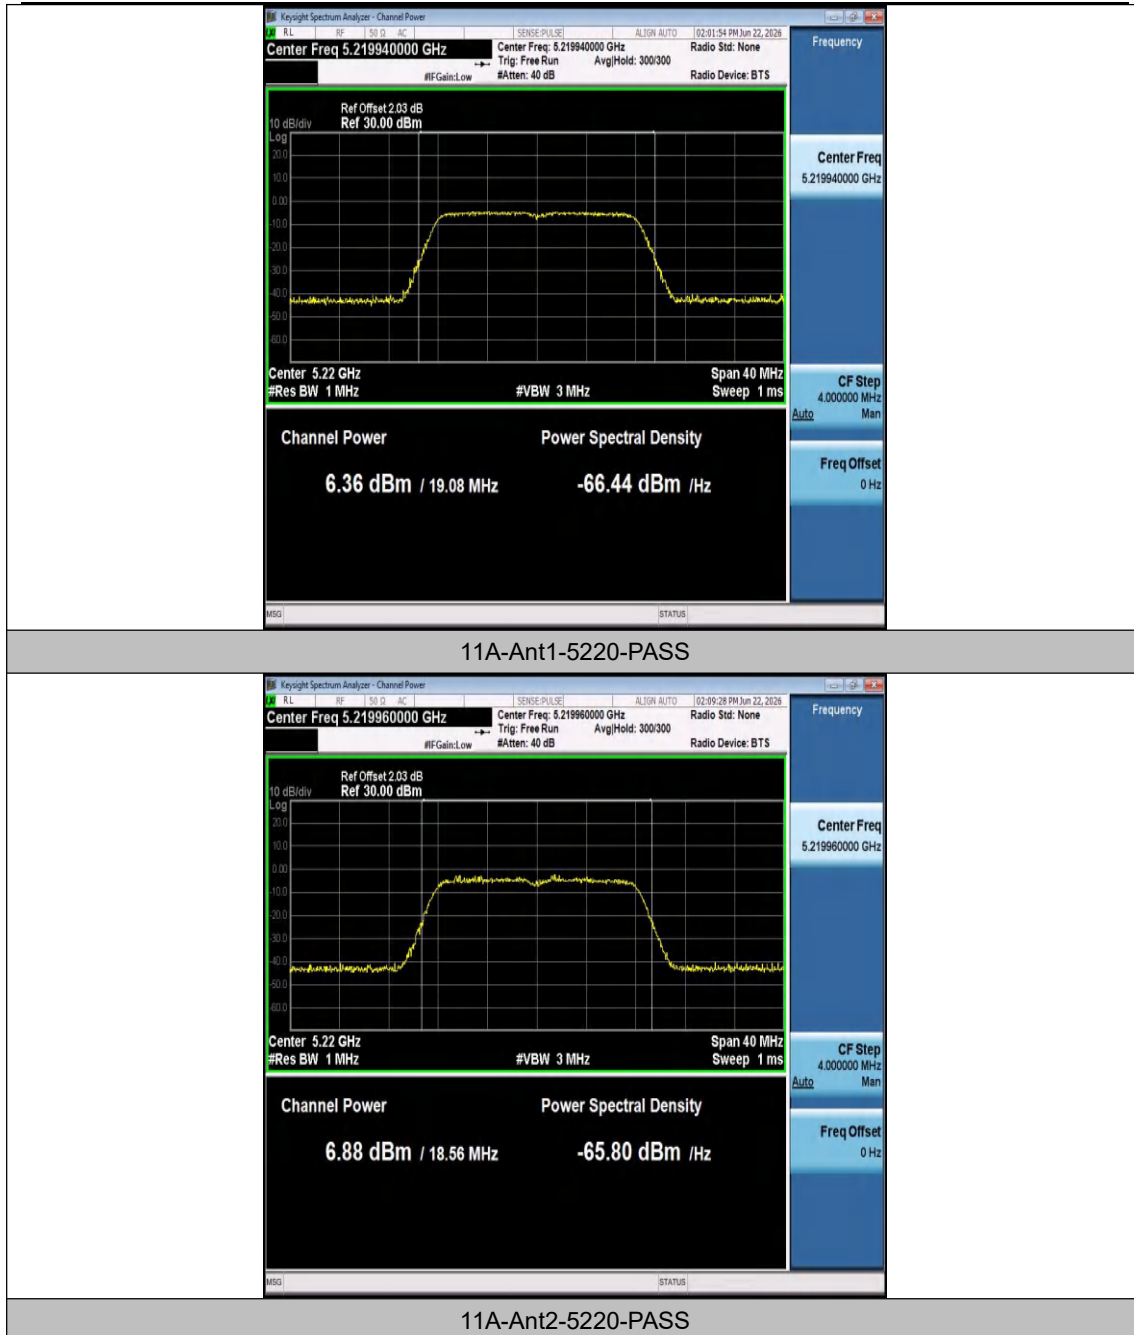

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

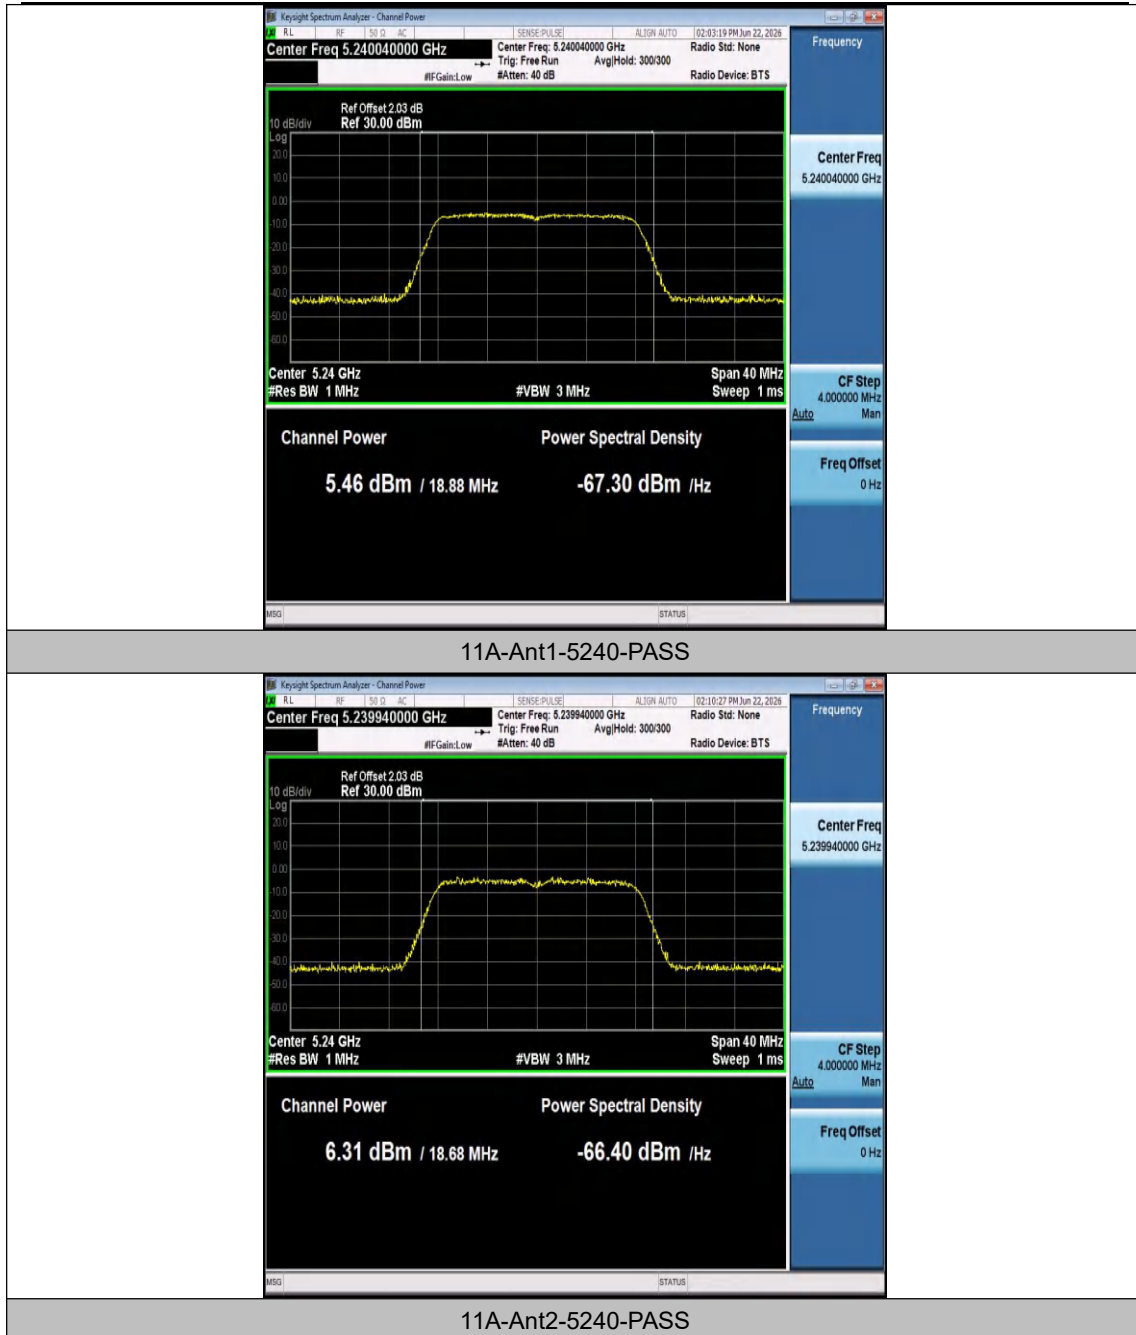

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

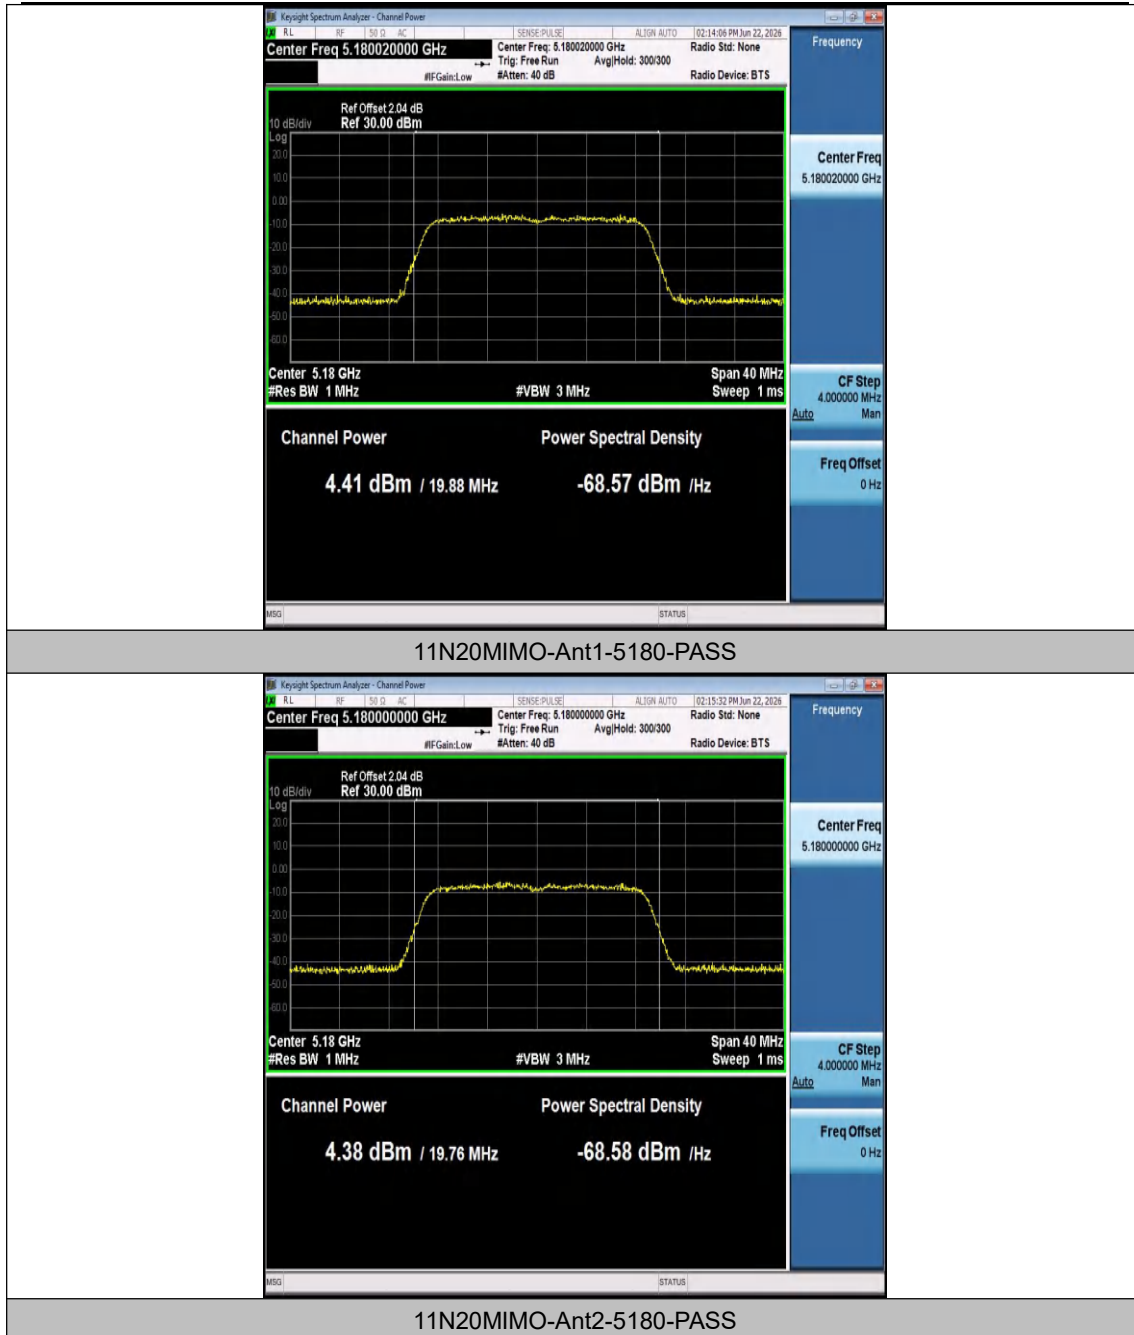

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

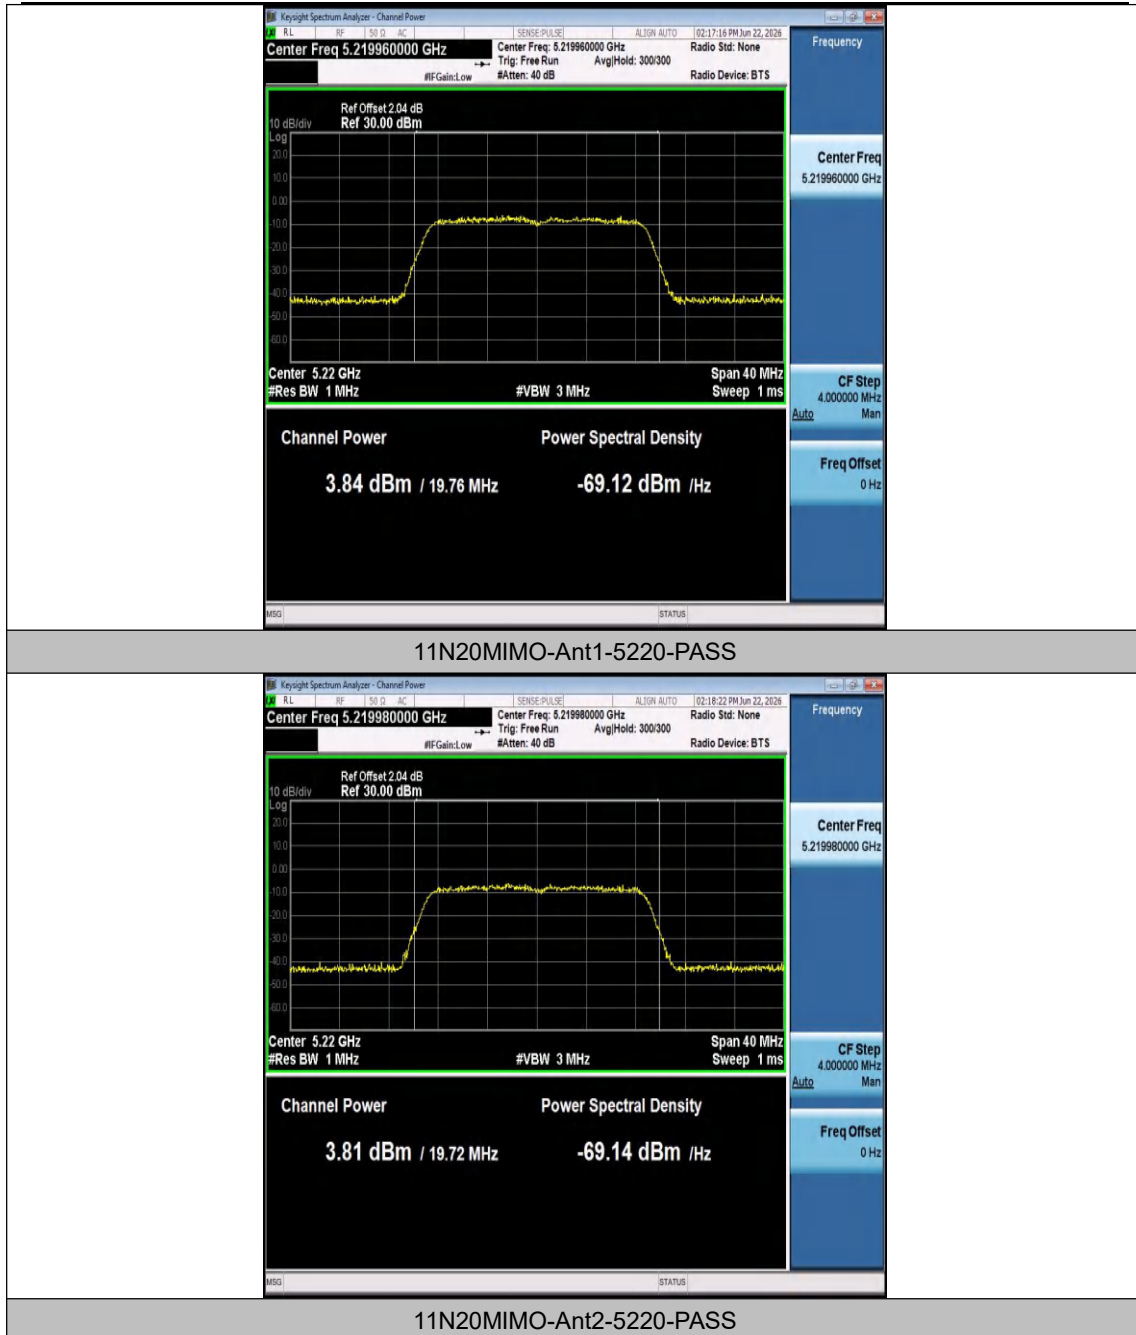

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

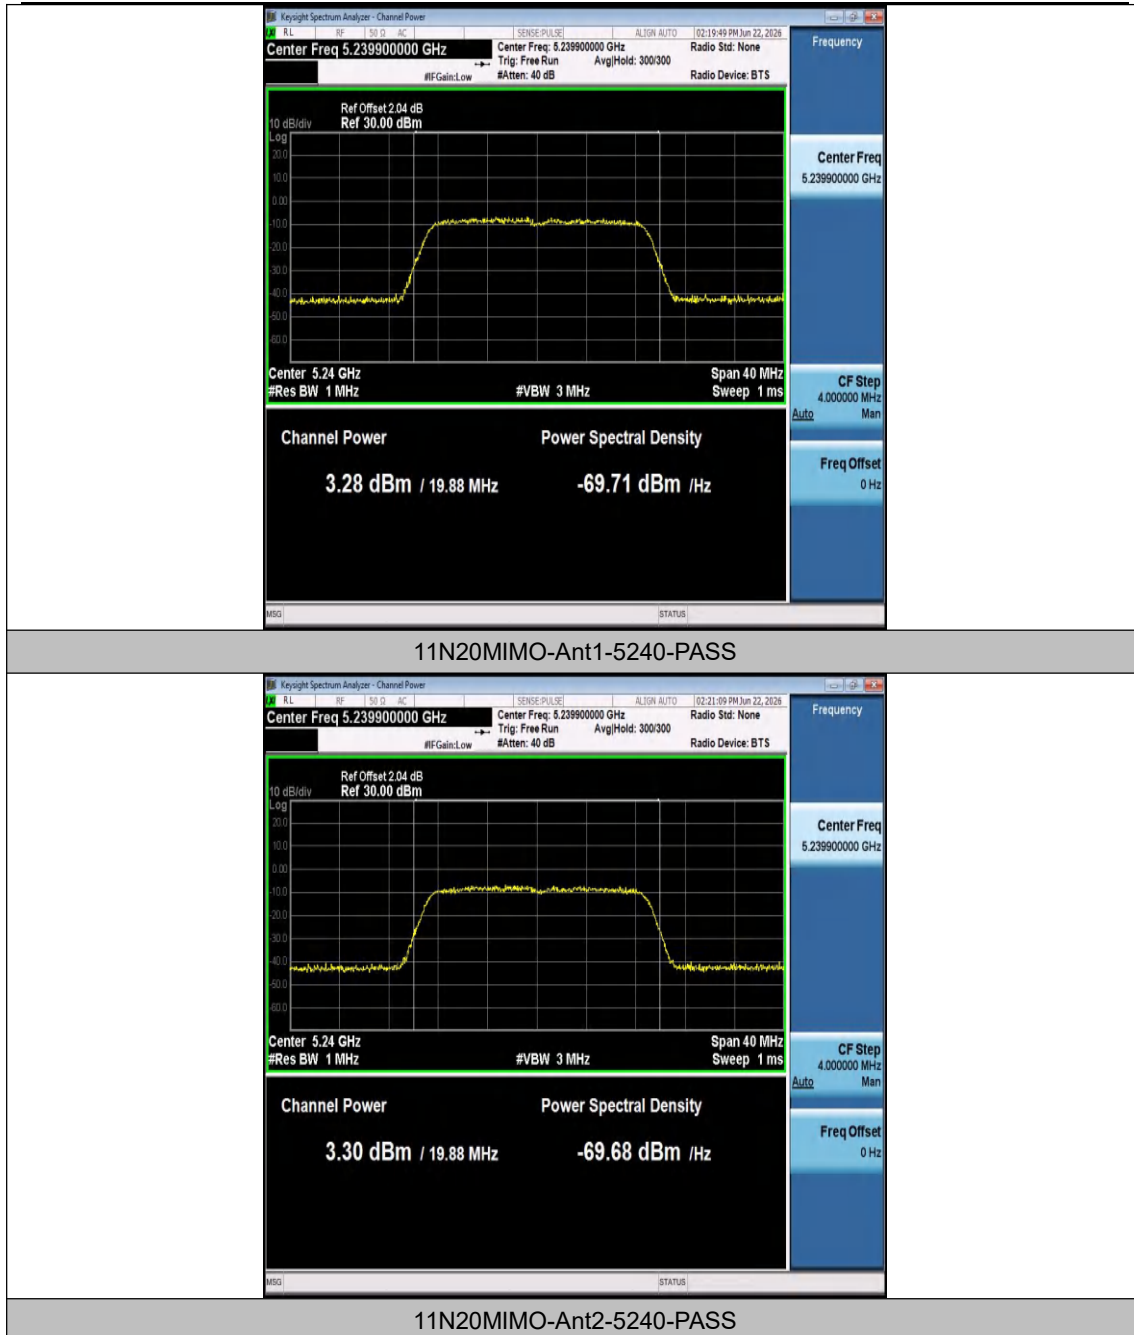


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

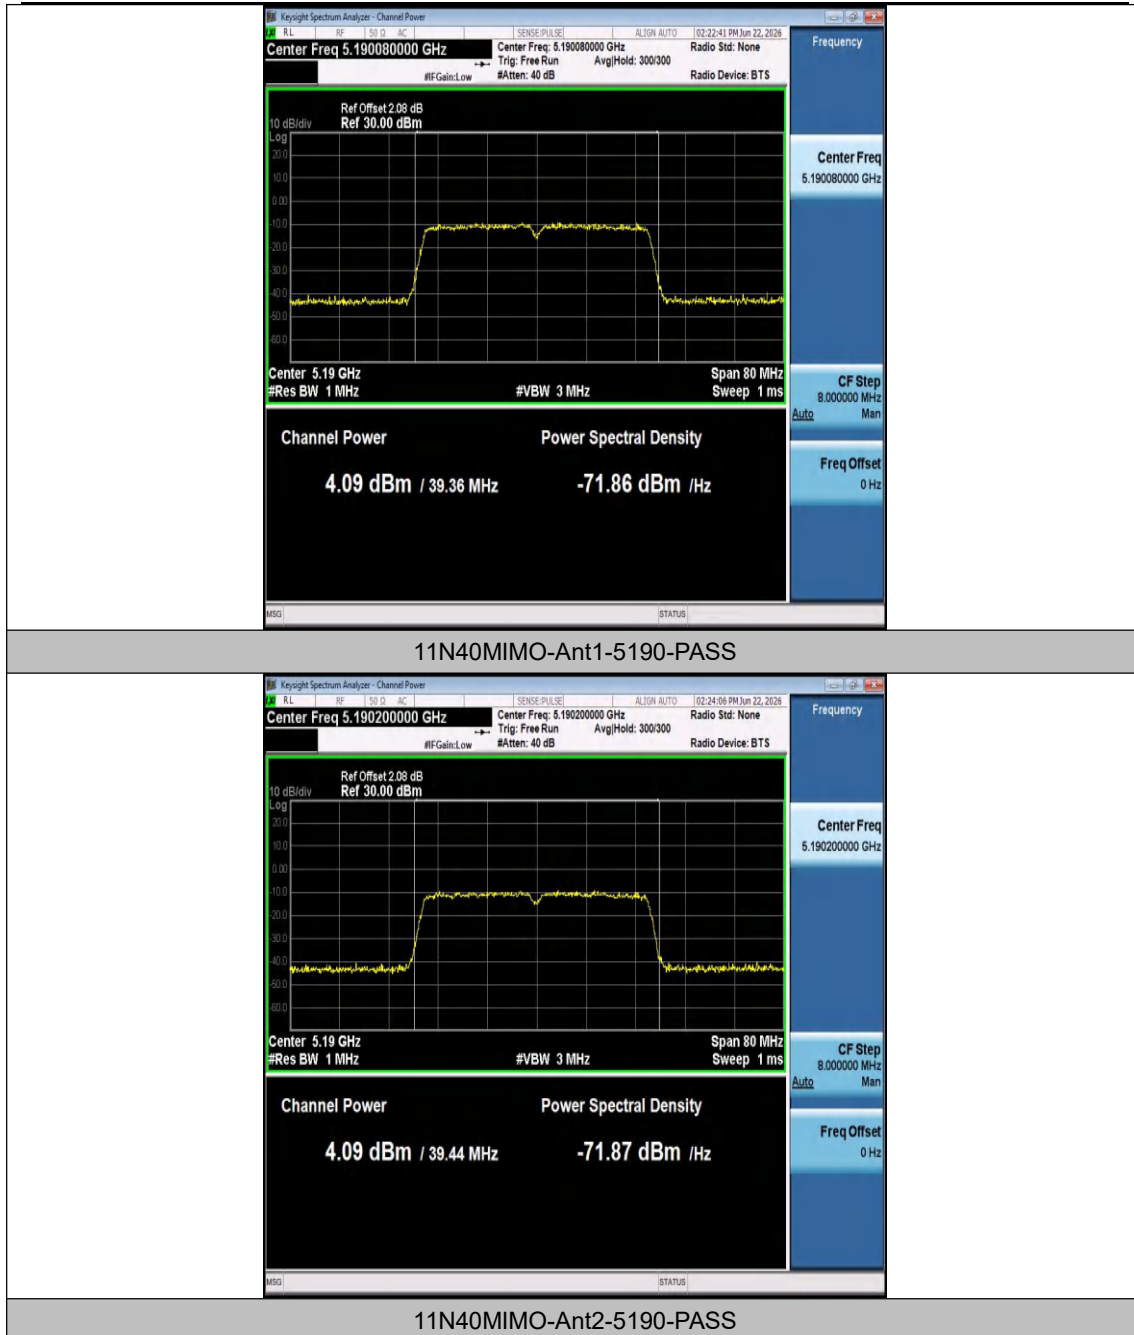


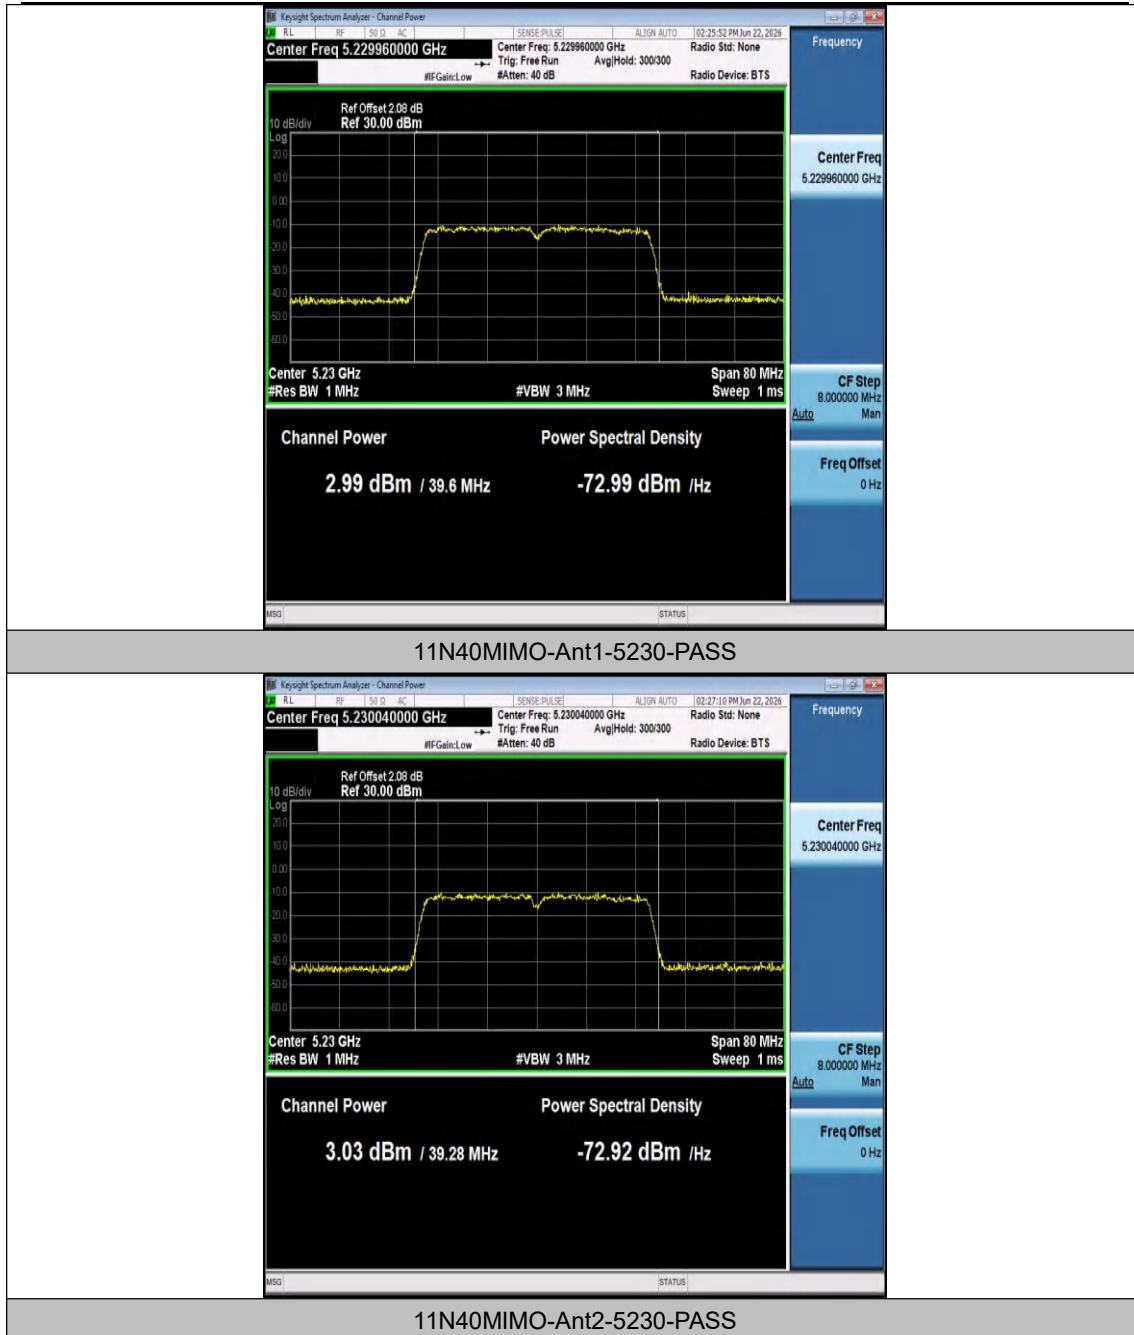


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

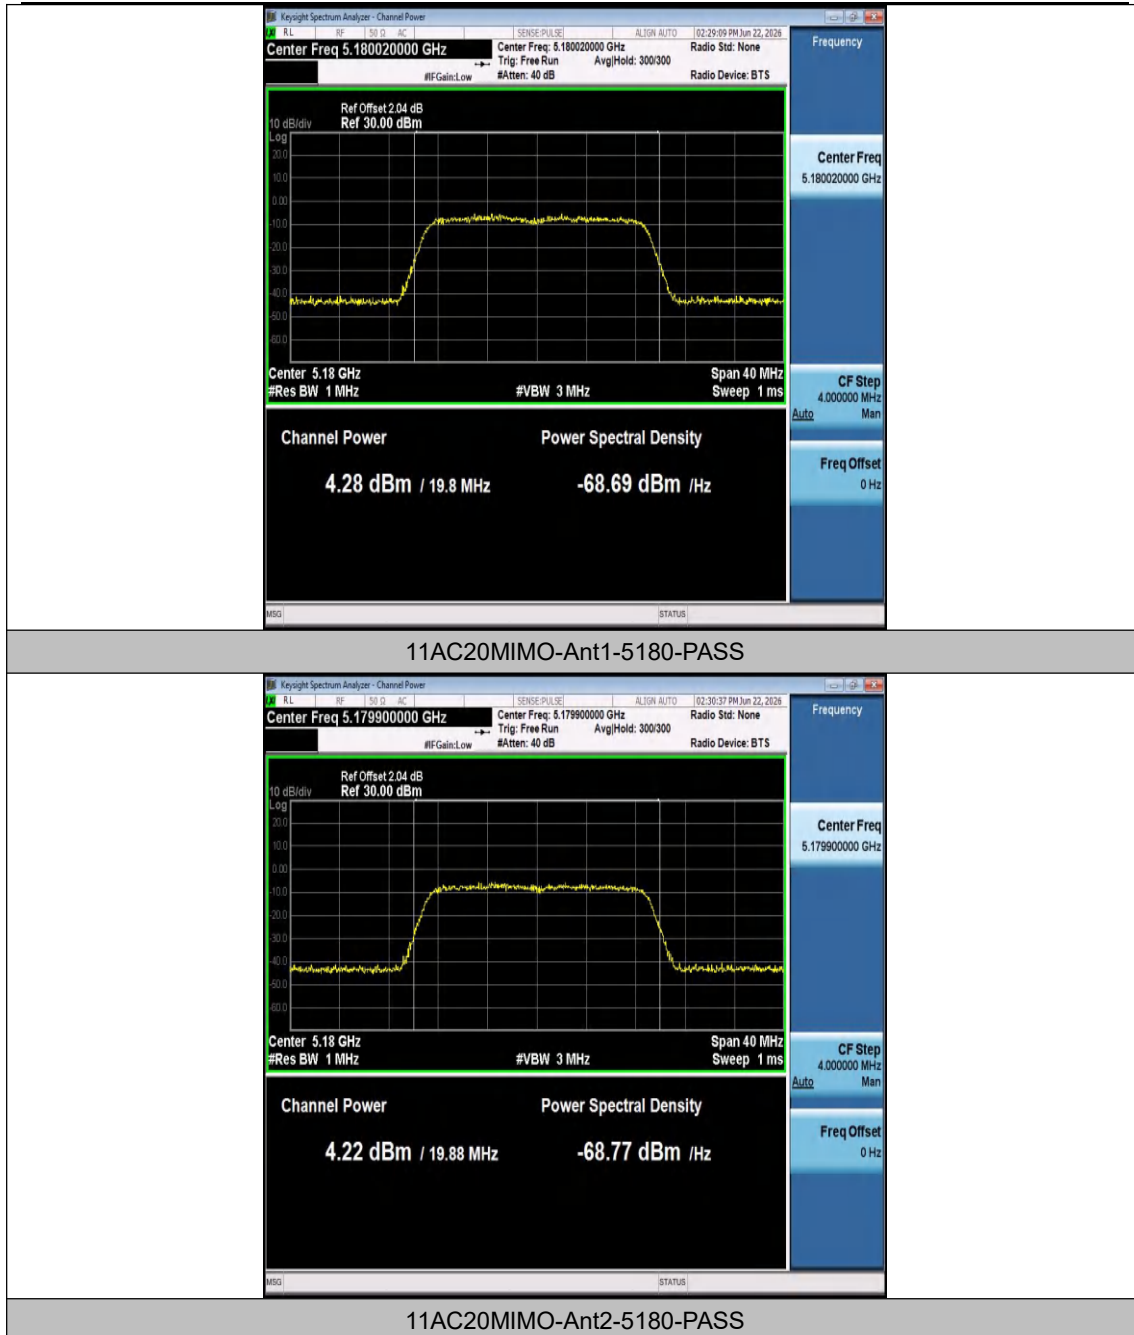


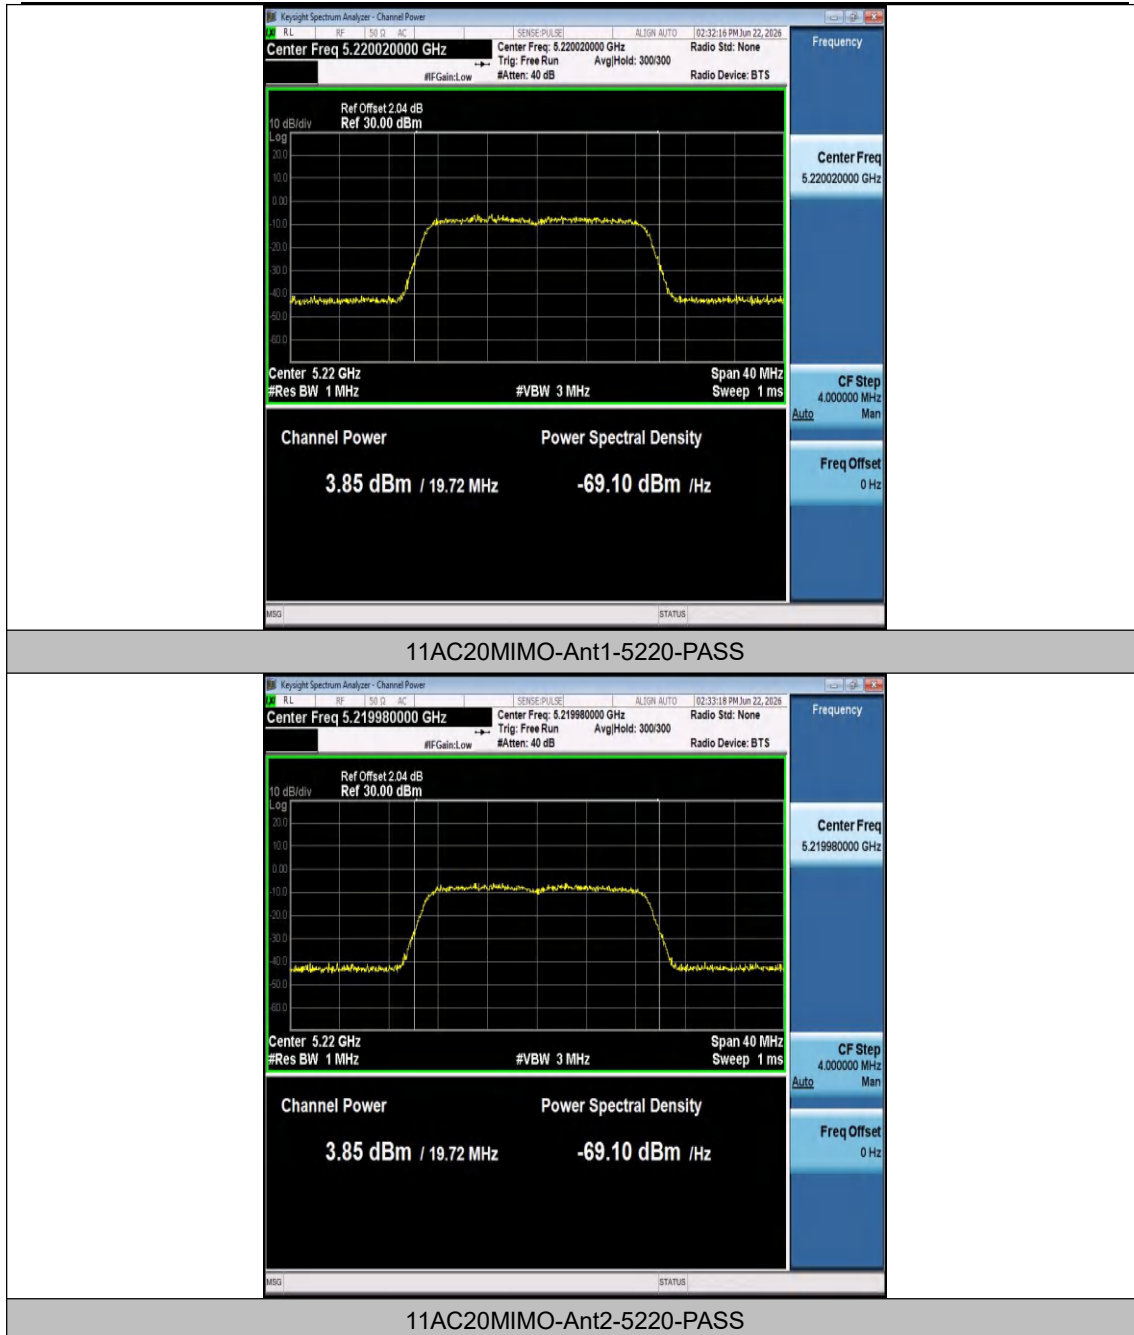

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

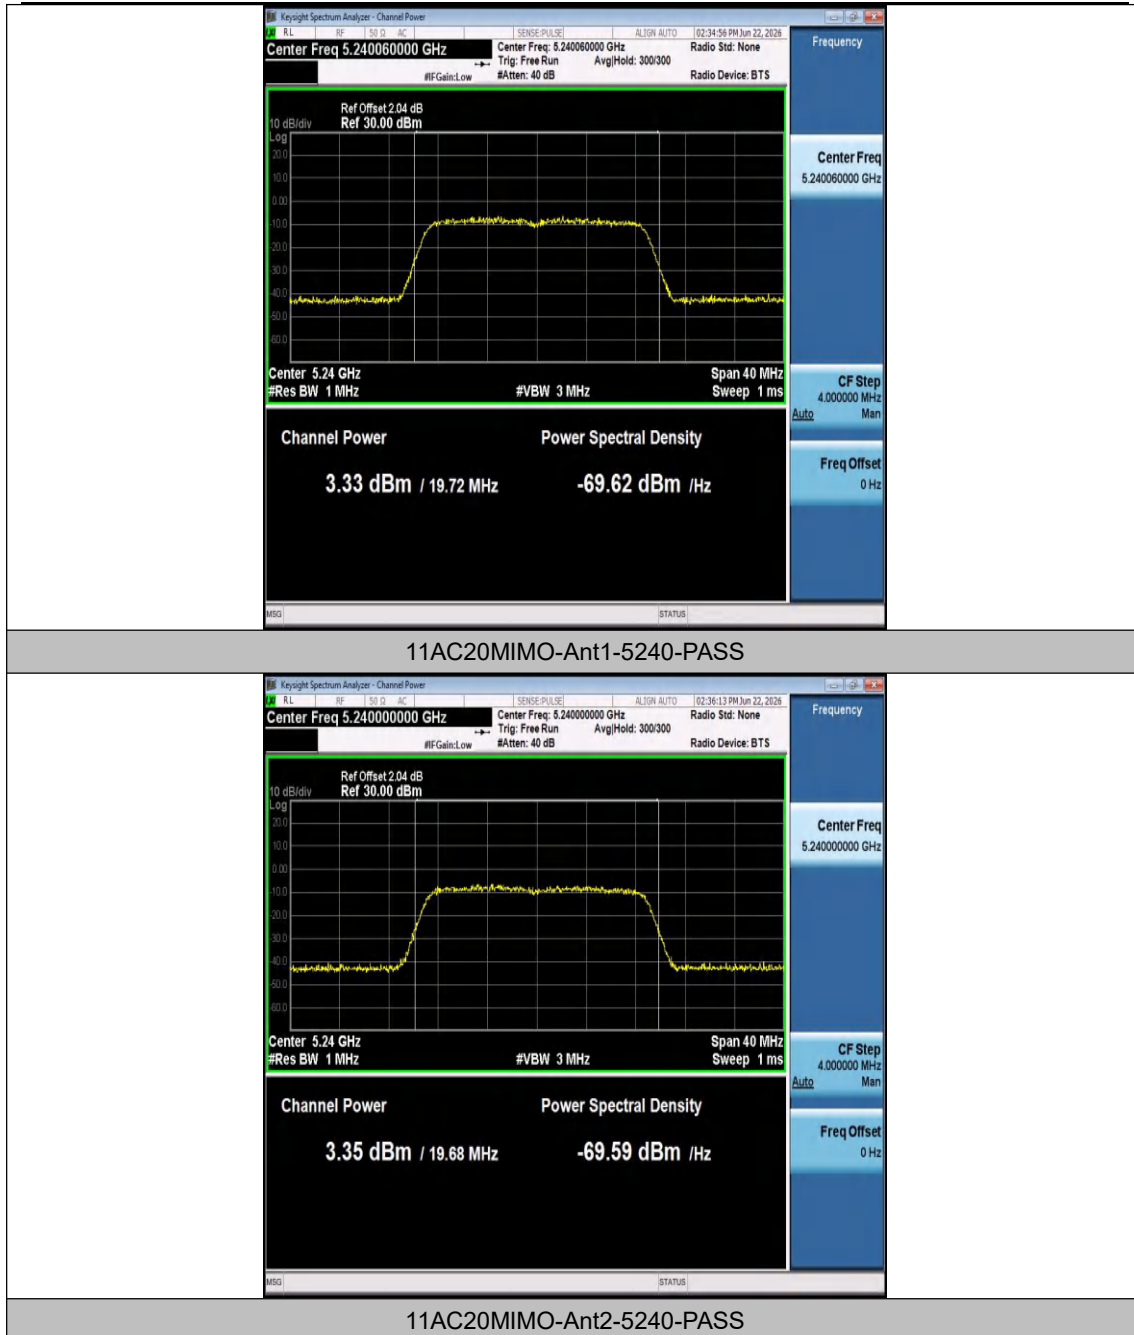

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

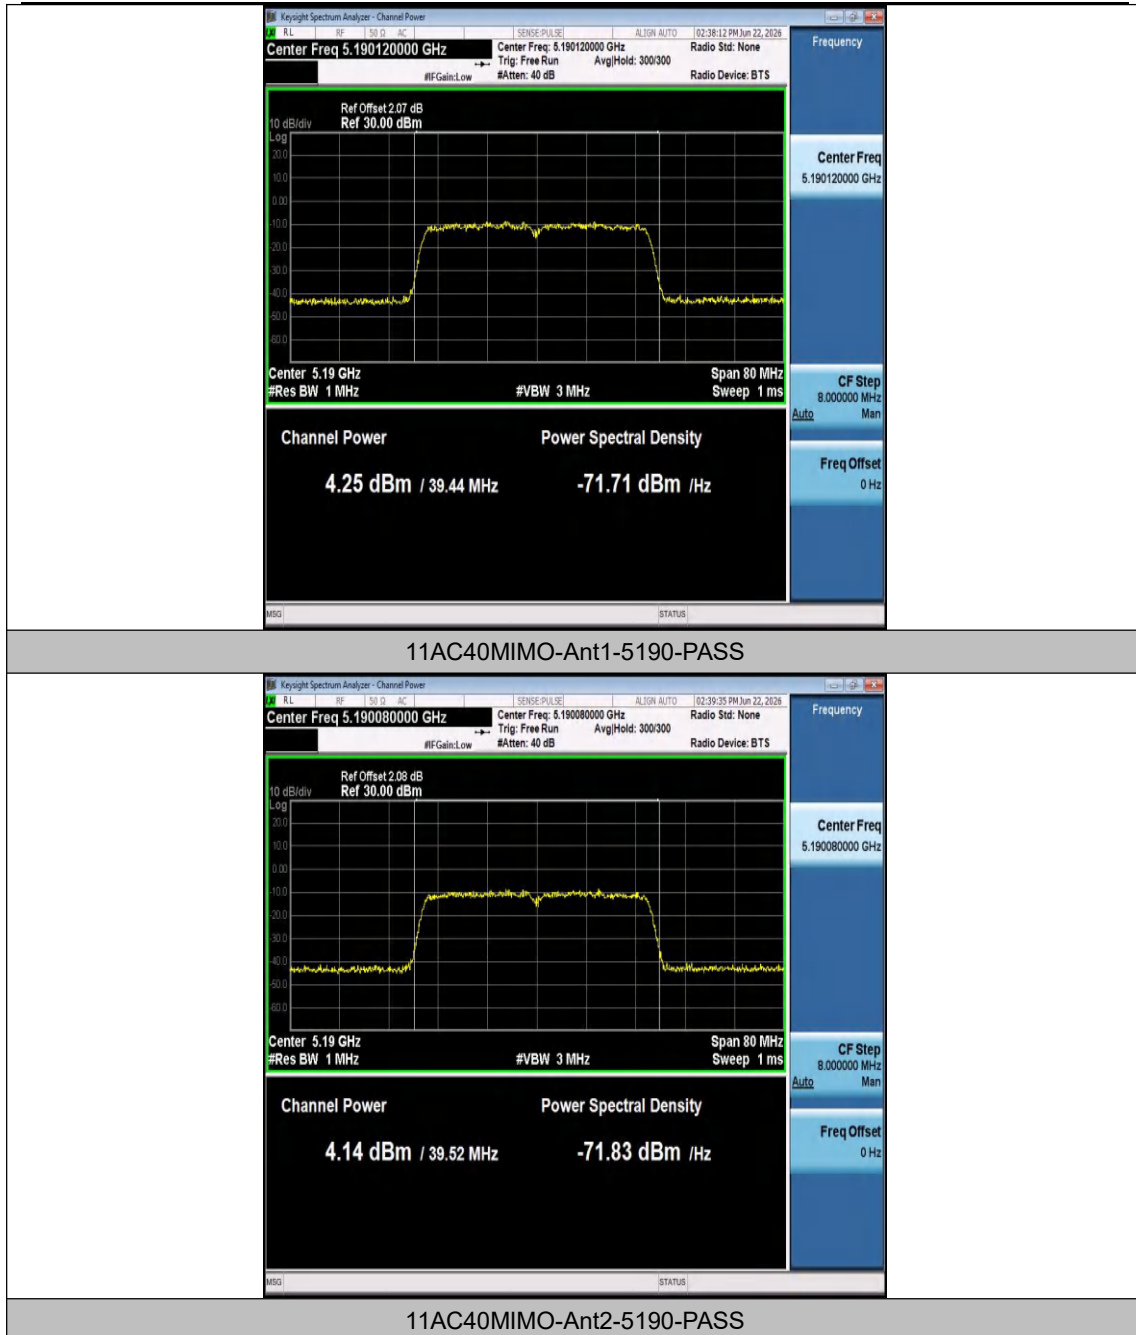

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

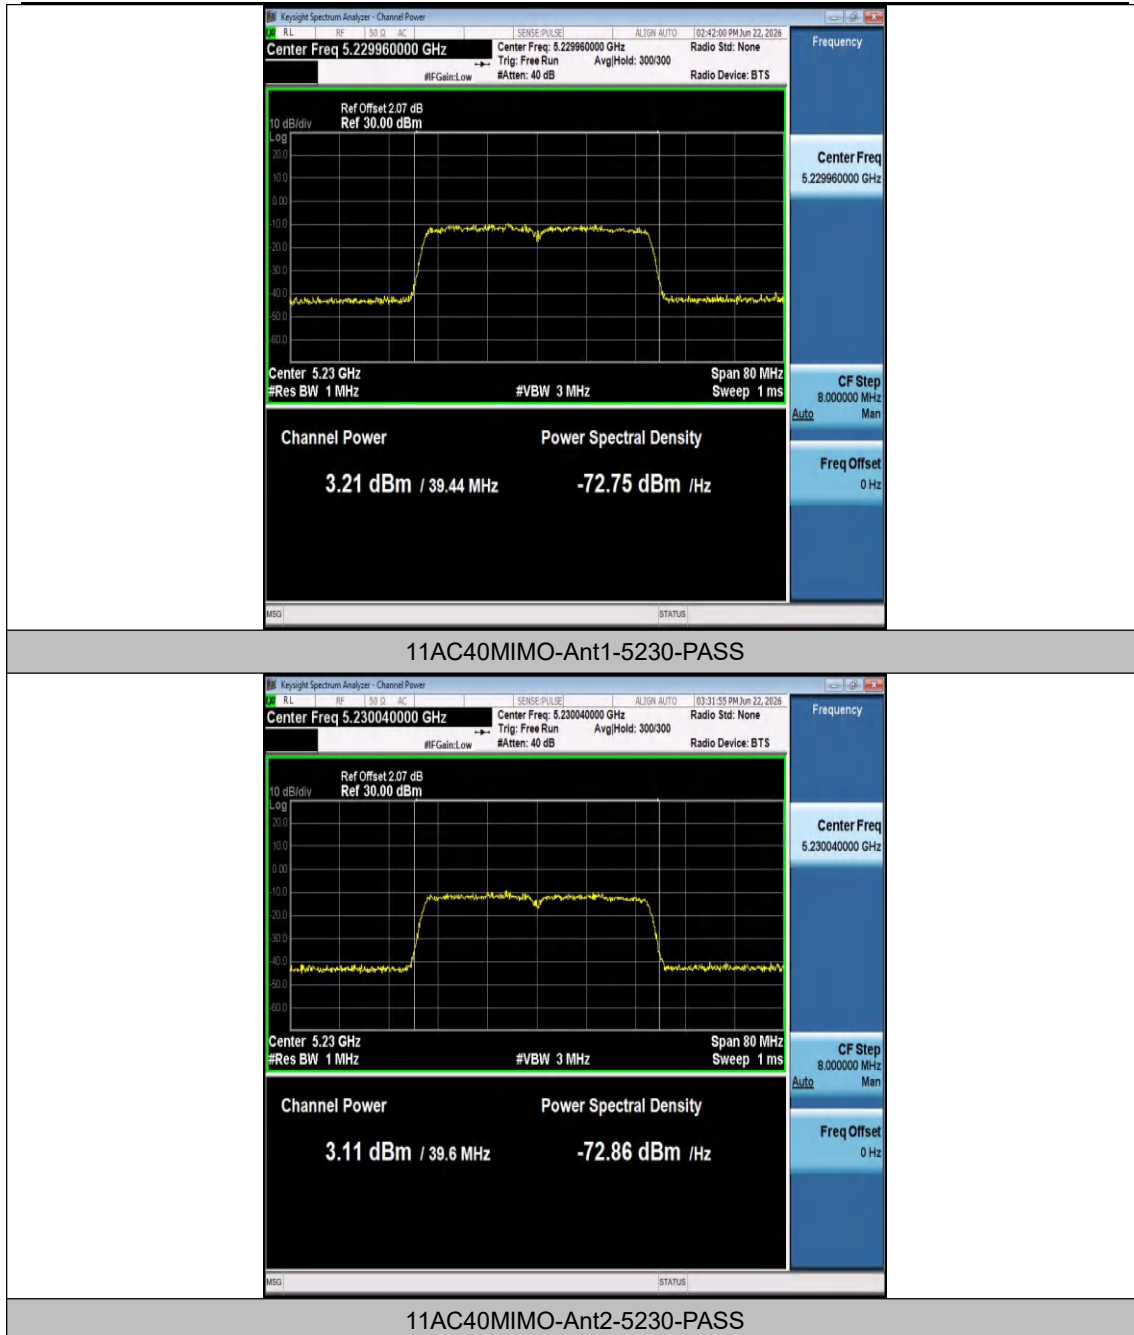

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

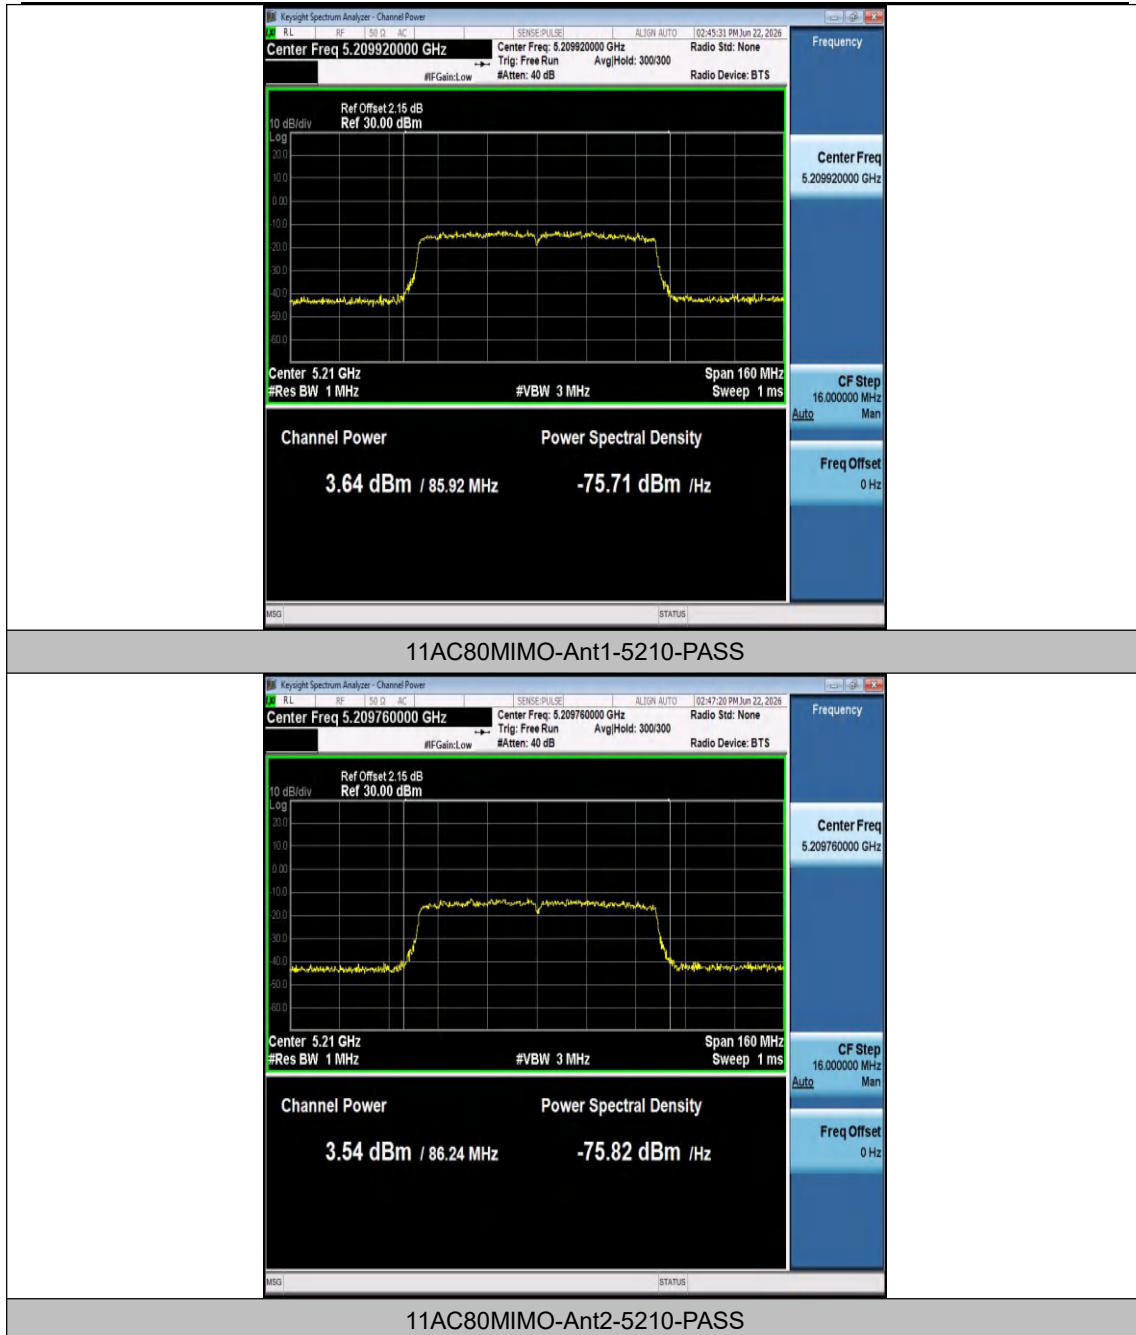

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dB]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-9.24	0.03	-9.21	≤11.00	PASS
11A	Ant2	5180	-8.97	0.03	-8.94	≤11.00	PASS
11A	Ant1	5220	-9.68	0.03	-9.65	≤11.00	PASS
11A	Ant2	5220	-9.57	0.03	-9.54	≤11.00	PASS
11A	Ant1	5240	-10.54	0.03	-10.51	≤11.00	PASS
11A	Ant2	5240	-10.08	0.03	-10.05	≤11.00	PASS
11N20MIMO	Ant1	5180	-12.39	0.04	-12.35	≤11.00	PASS
11N20MIMO	Ant2	5180	-12.23	0.04	-12.19	≤11.00	PASS
11N20MIMO	total	5180	---	---	-9.26	≤11.00	PASS
11N20MIMO	Ant1	5220	-12.72	0.04	-12.68	≤11.00	PASS
11N20MIMO	Ant2	5220	-12.76	0.04	-12.72	≤11.00	PASS
11N20MIMO	total	5220	---	---	-9.69	≤11.00	PASS
11N20MIMO	Ant1	5240	-13.20	0.04	-13.16	≤11.00	PASS
11N20MIMO	Ant2	5240	-13.34	0.04	-13.30	≤11.00	PASS
11N20MIMO	total	5240	---	---	-10.22	≤11.00	PASS
11N40MIMO	Ant1	5190	-15.57	0.08	-15.49	≤11.00	PASS
11N40MIMO	Ant2	5190	-15.57	0.08	-15.49	≤11.00	PASS
11N40MIMO	total	5190	---	---	-12.48	≤11.00	PASS
11N40MIMO	Ant1	5230	-16.58	0.08	-16.50	≤11.00	PASS
11N40MIMO	Ant2	5230	-16.62	0.08	-16.54	≤11.00	PASS
11N40MIMO	total	5230	---	---	-13.51	≤11.00	PASS
11AC20MIMO	Ant1	5180	-12.38	0.04	-12.34	≤11.00	PASS
11AC20MIMO	Ant2	5180	-12.37	0.04	-12.33	≤11.00	PASS
11AC20MIMO	total	5180	---	---	-9.32	≤11.00	PASS
11AC20MIMO	Ant1	5220	-12.75	0.04	-12.71	≤11.00	PASS
11AC20MIMO	Ant2	5220	-12.86	0.04	-12.82	≤11.00	PASS
11AC20MIMO	total	5220	---	---	-9.75	≤11.00	PASS
11AC20MIMO	Ant1	5240	-13.07	0.04	-13.03	≤11.00	PASS
11AC20MIMO	Ant2	5240	-13.33	0.04	-13.29	≤11.00	PASS
11AC20MIMO	total	5240	---	---	-10.15	≤11.00	PASS
11AC40MIMO	Ant1	5190	-15.68	0.07	-15.61	≤11.00	PASS
11AC40MIMO	Ant2	5190	-15.72	0.08	-15.64	≤11.00	PASS
11AC40MIMO	total	5190	---	---	-12.61	≤11.00	PASS
11AC40MIMO	Ant1	5230	-16.66	0.07	-16.59	≤11.00	PASS
11AC40MIMO	Ant2	5230	-16.69	0.07	-16.62	≤11.00	PASS
11AC40MIMO	total	5230	---	---	-13.59	≤11.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC80MIMO	Ant1	5210	-19.49	0.15	-19.34	≤11.00	PASS
11AC80MIMO	Ant2	5210	-19.34	0.15	-19.19	≤11.00	PASS
11AC80MIMO	total	5210	---	---	-16.25	≤11.00	PASS

Note: The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs B1

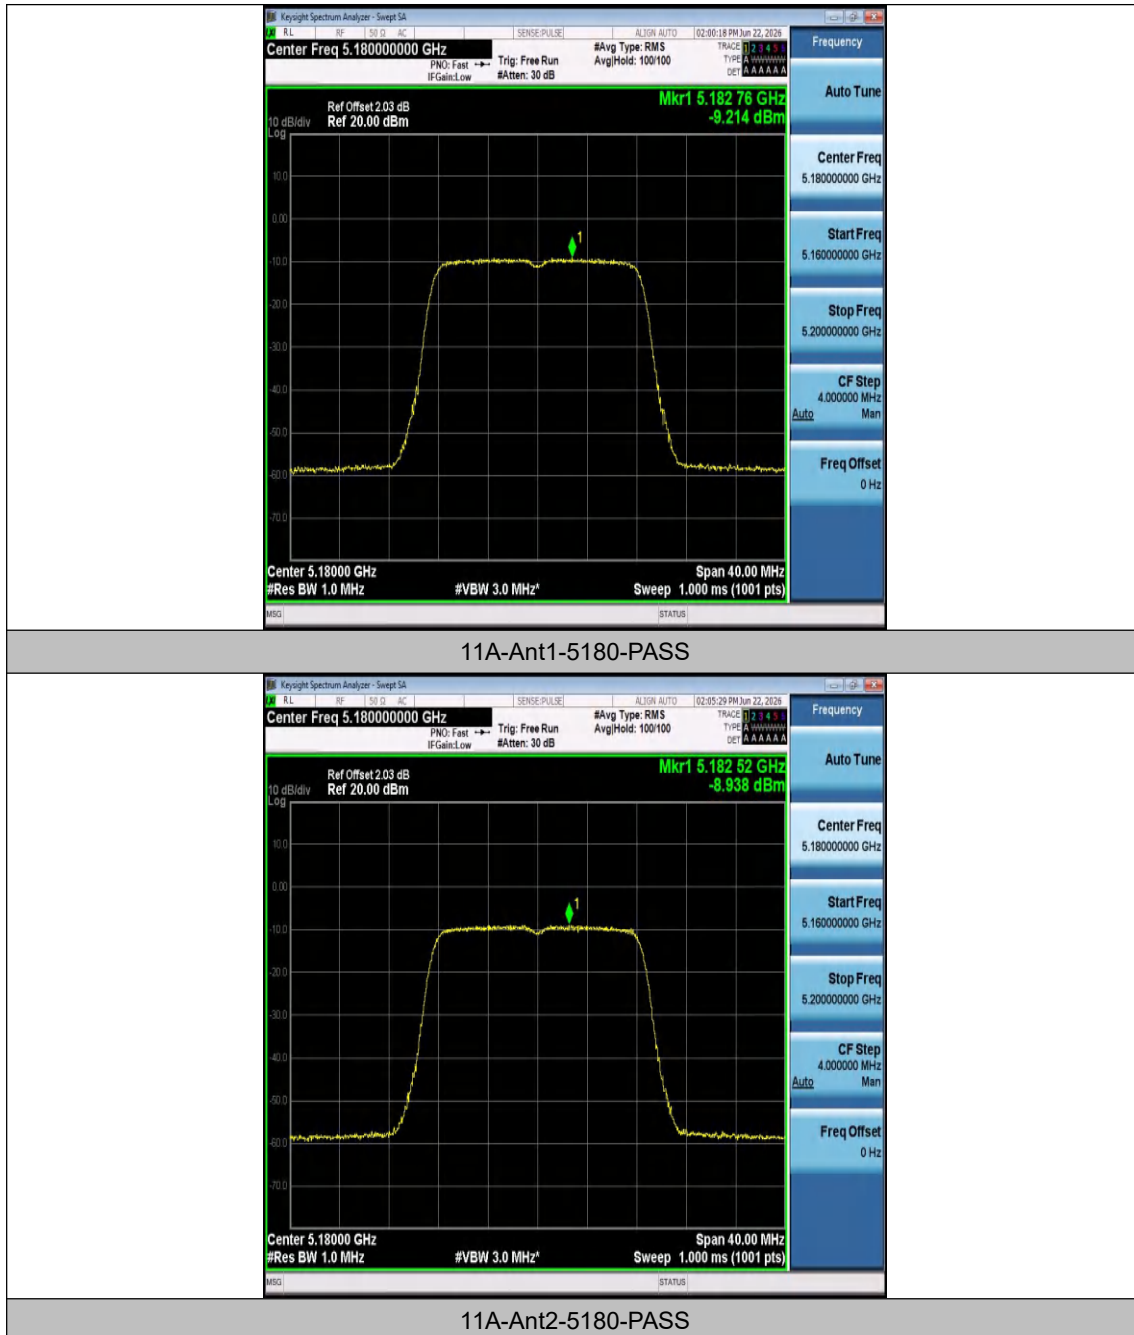

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

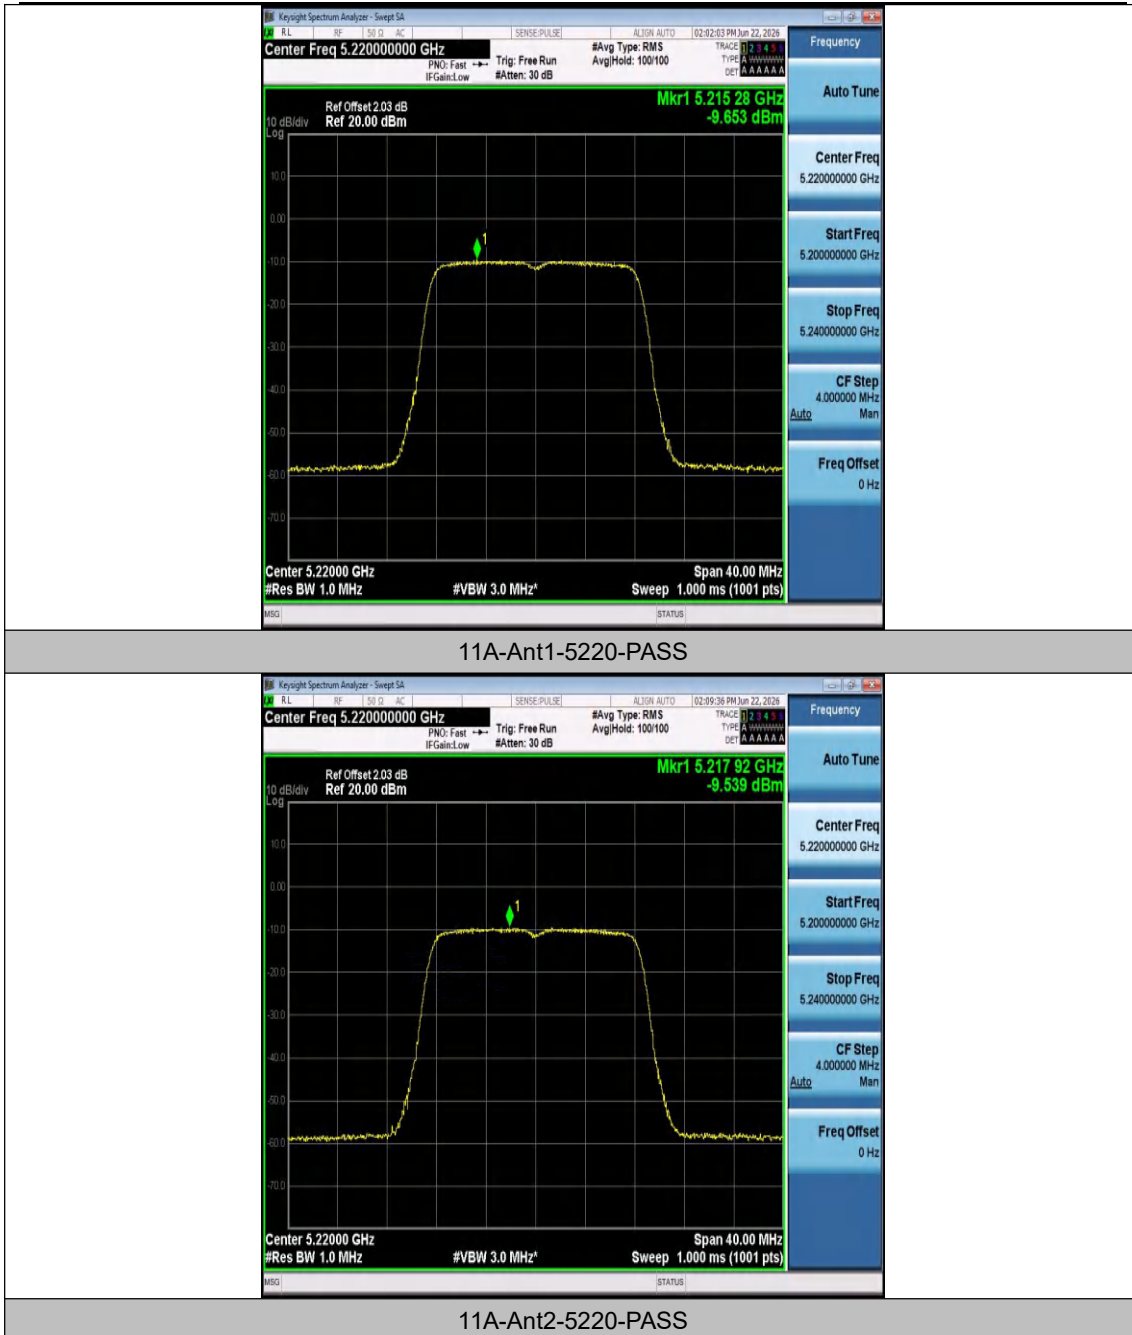

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

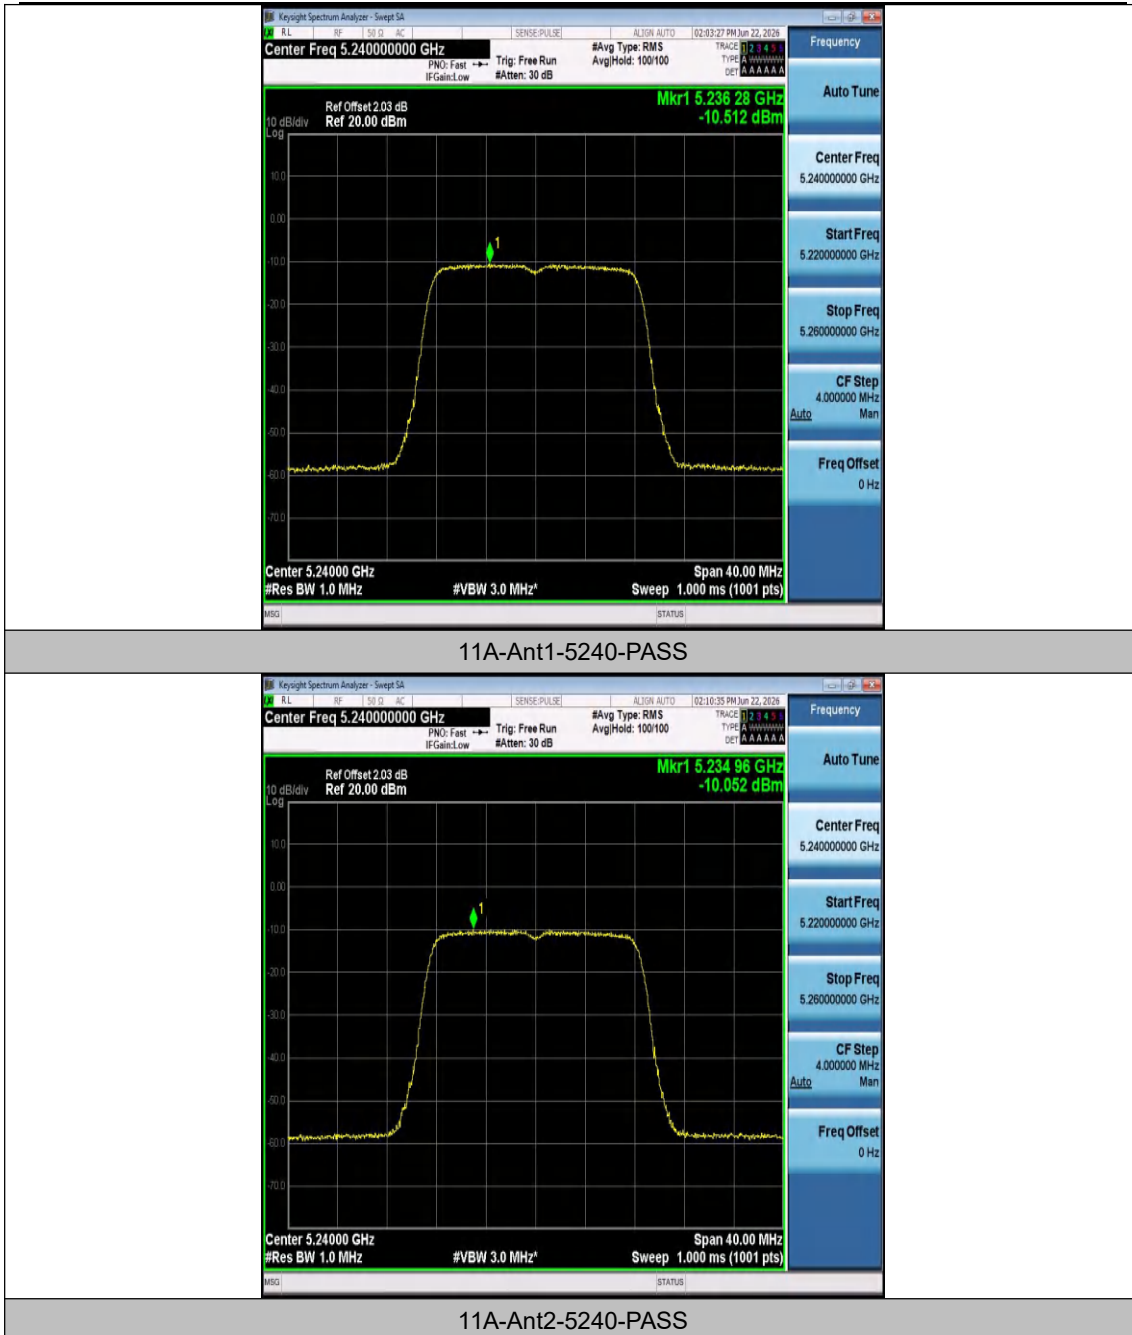

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

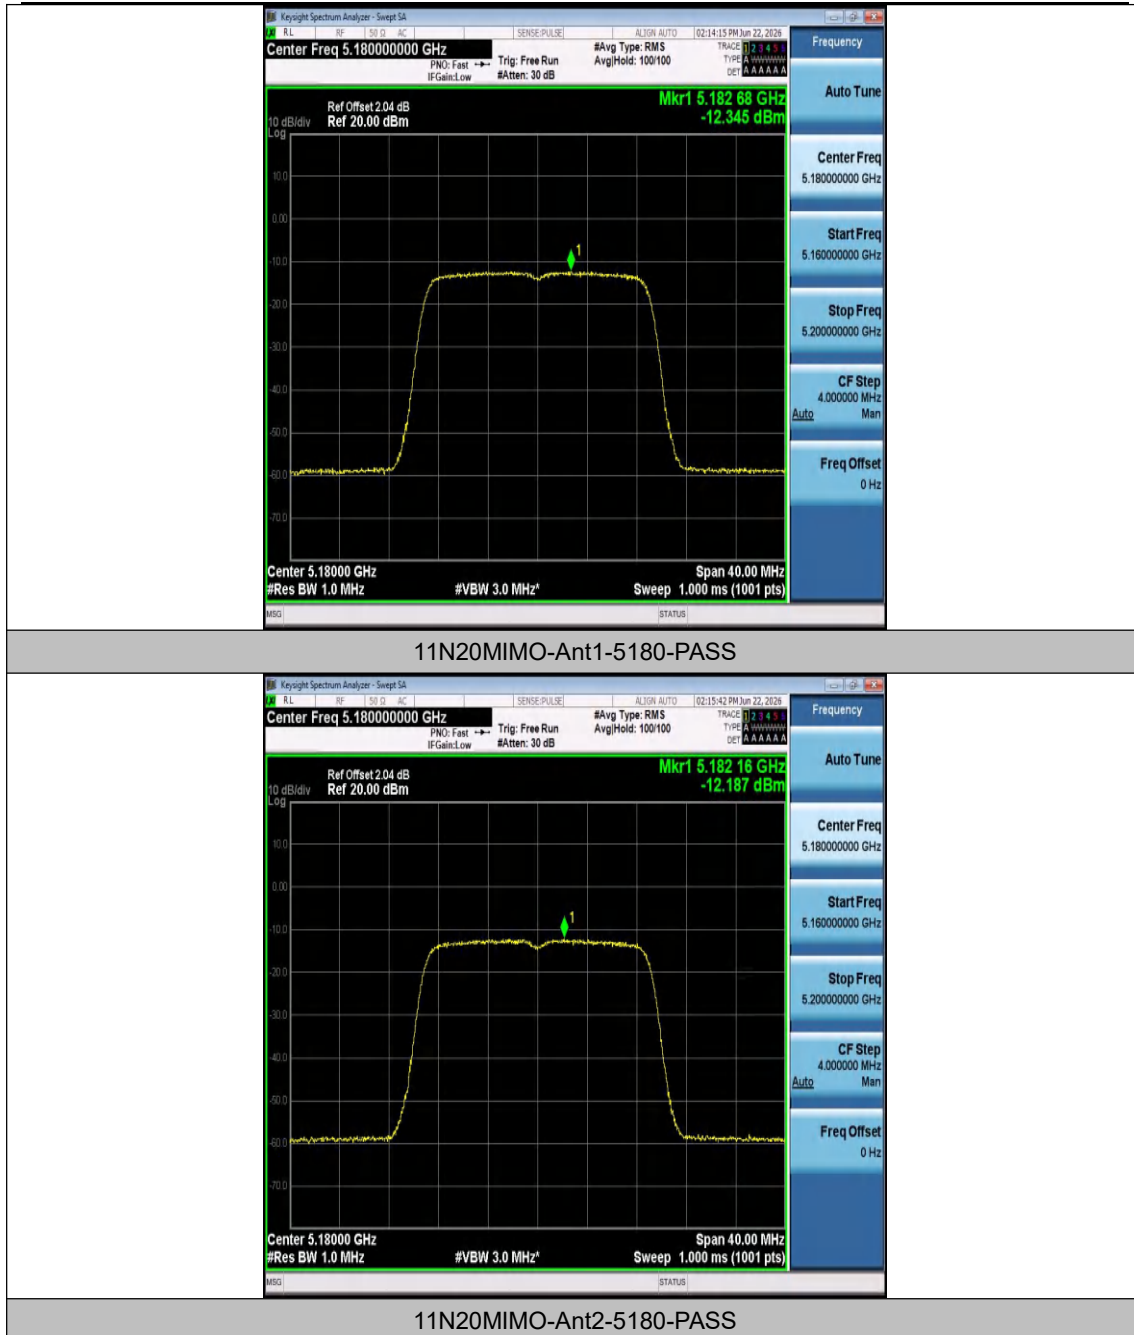

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

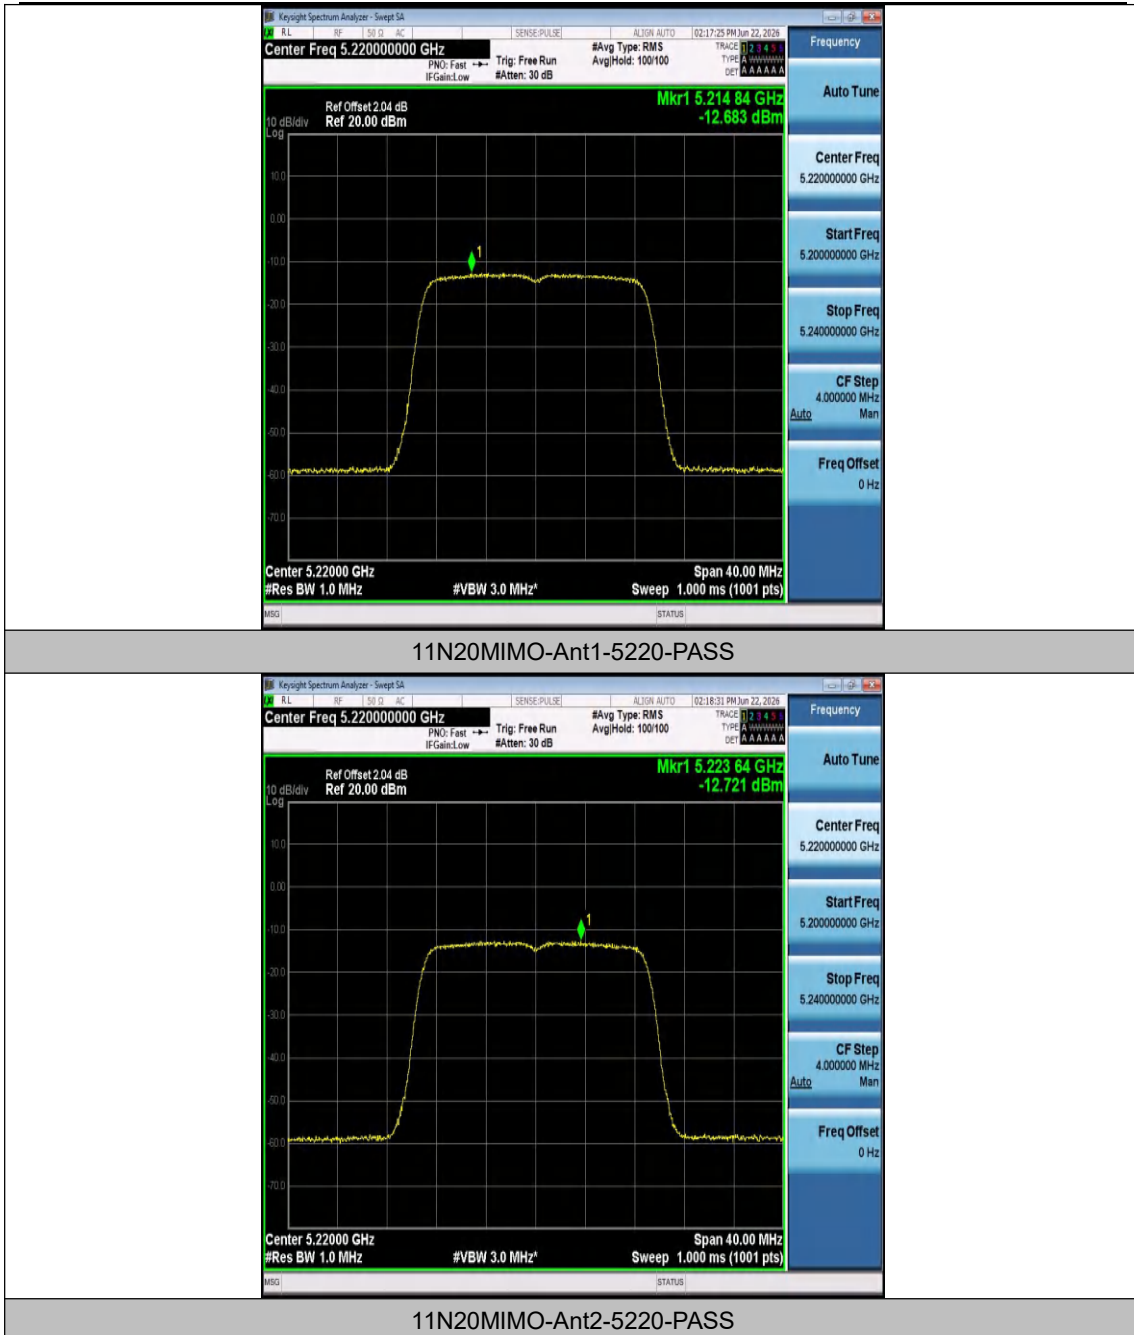

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

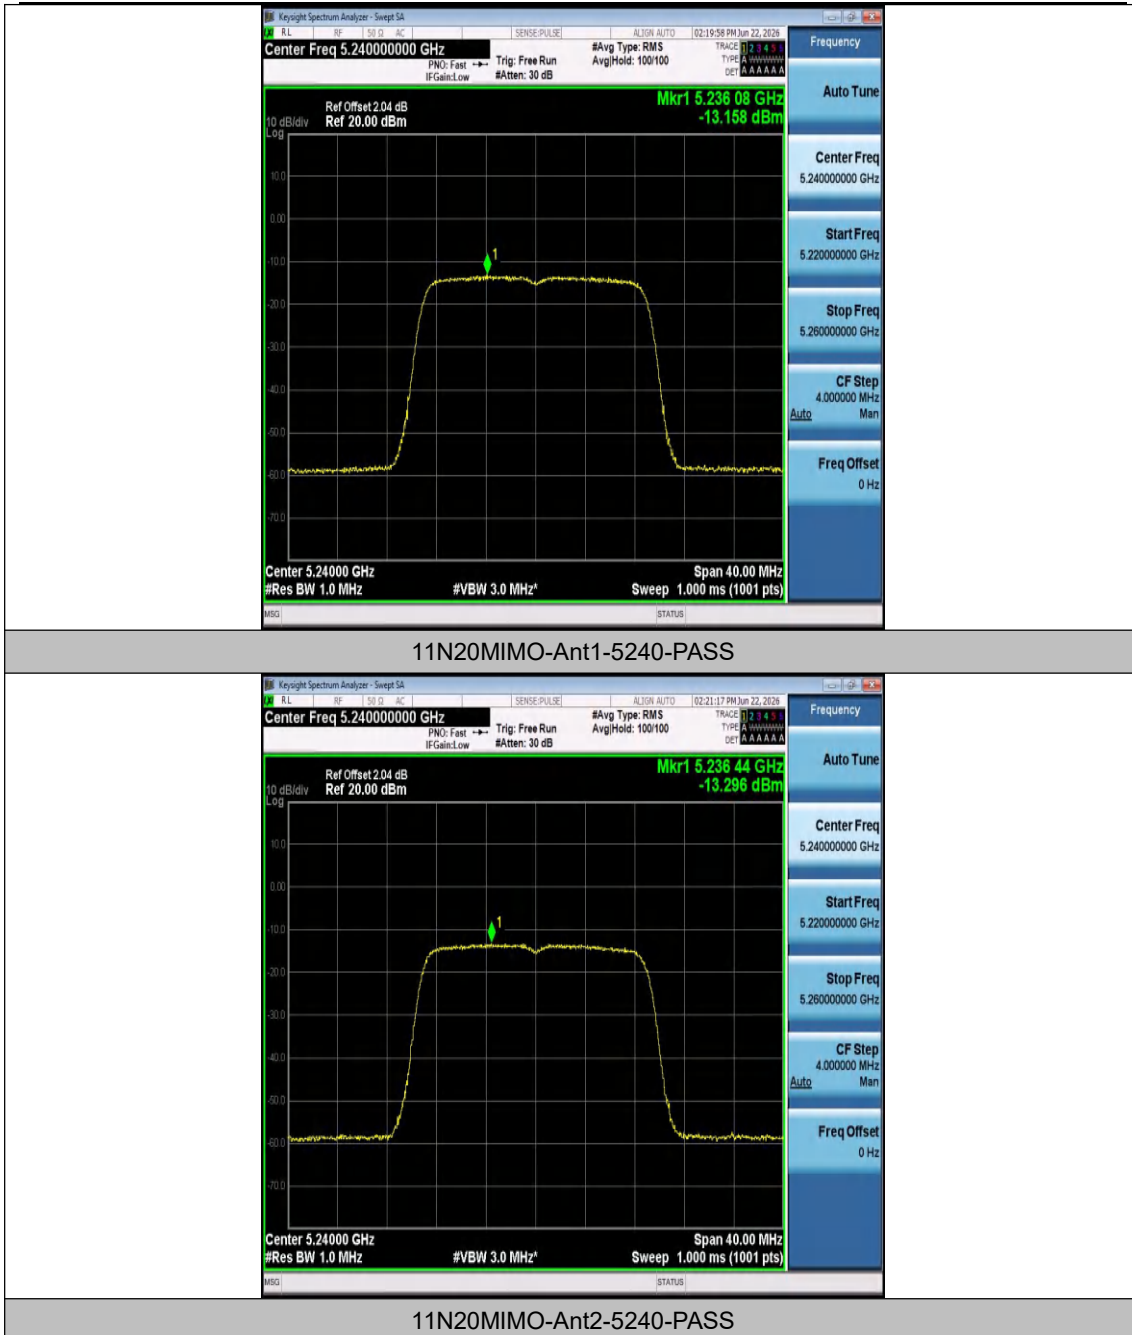

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

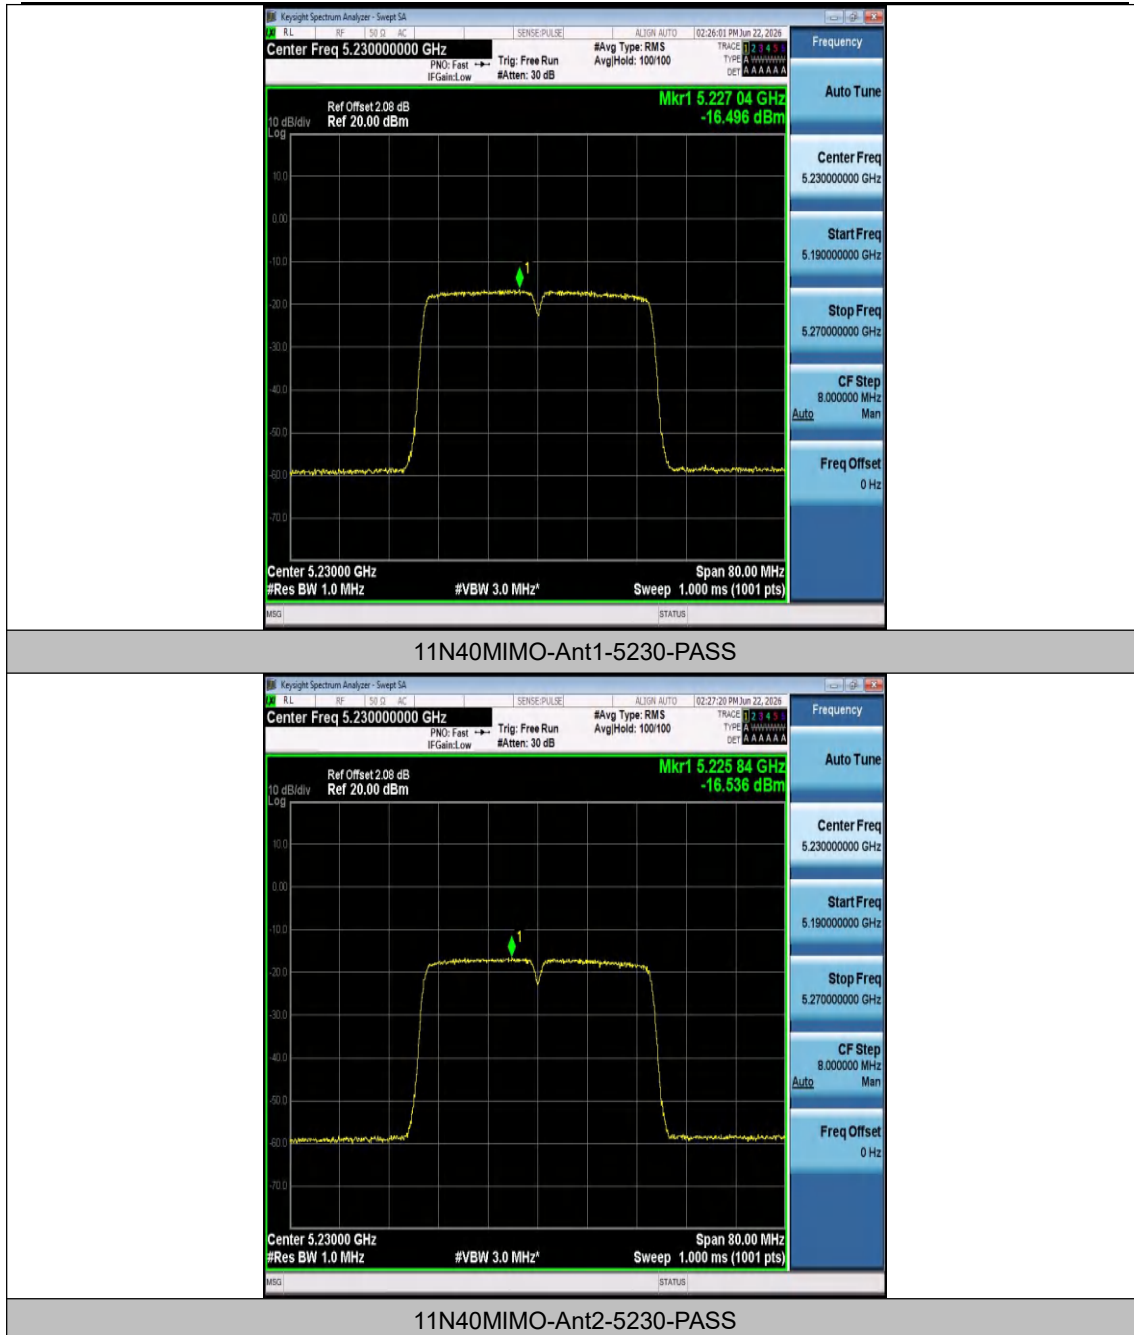

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

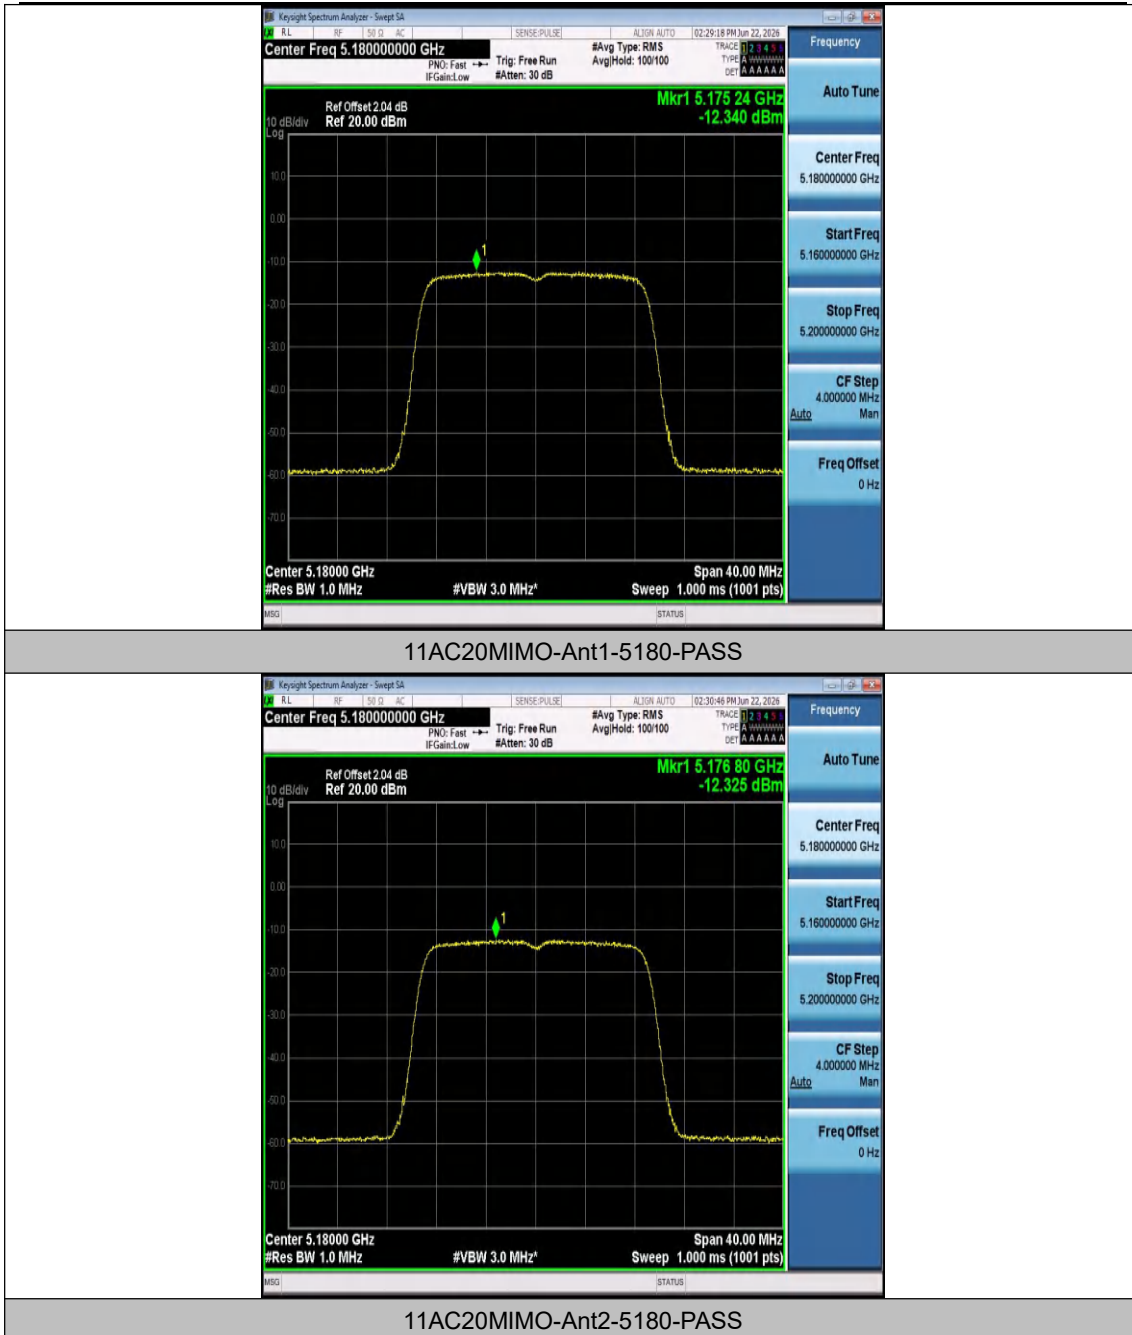

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

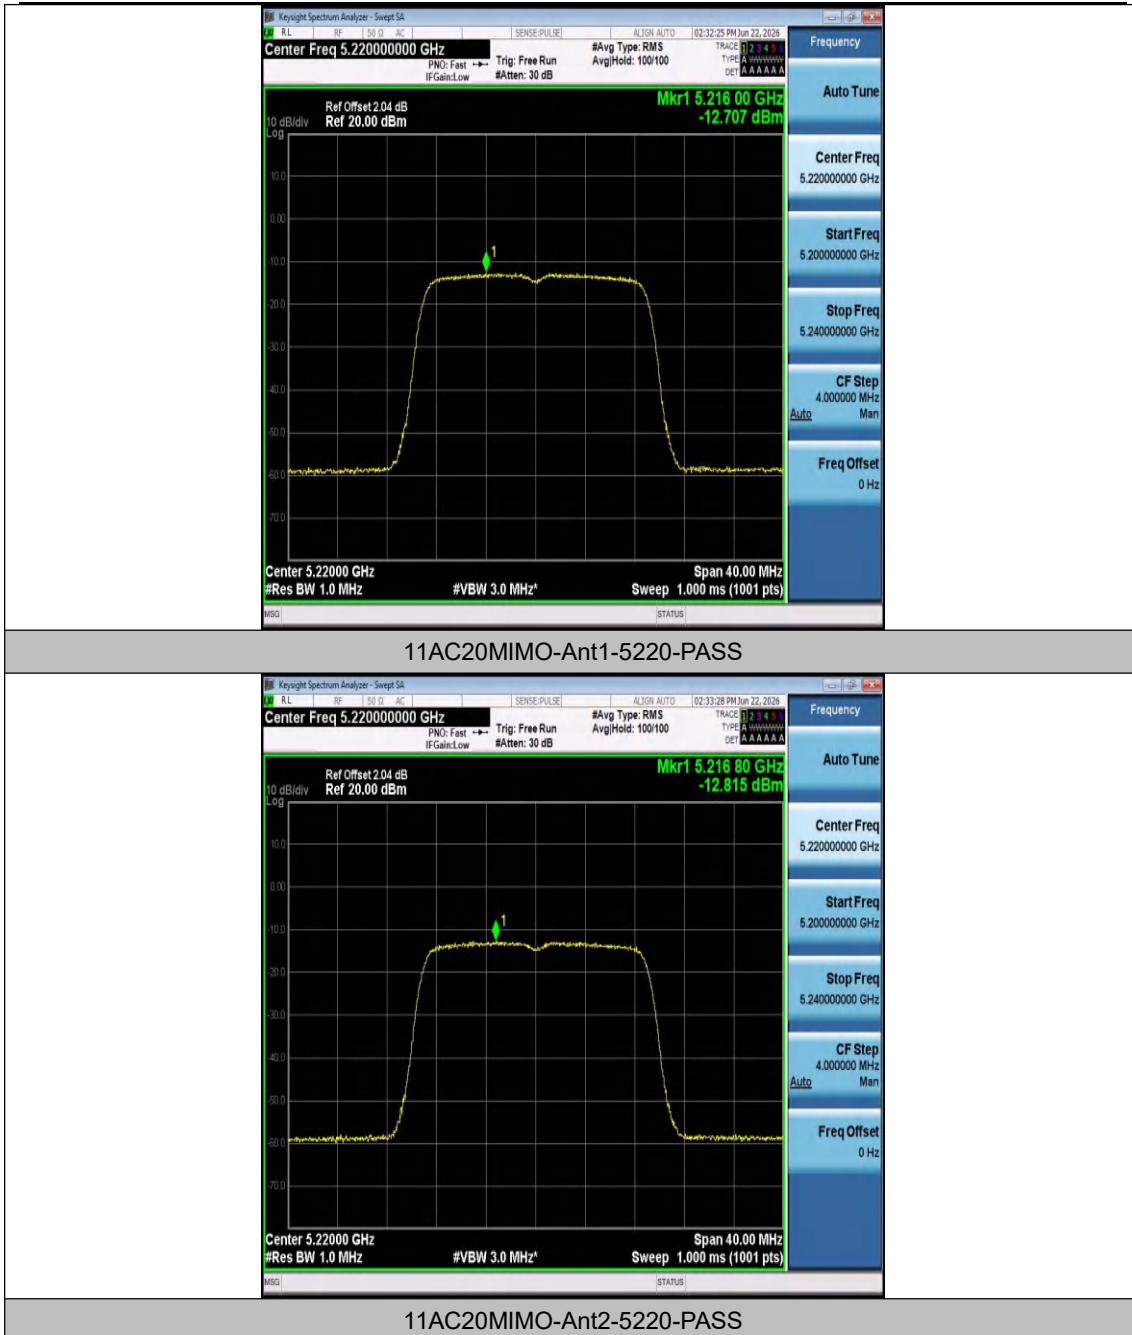

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

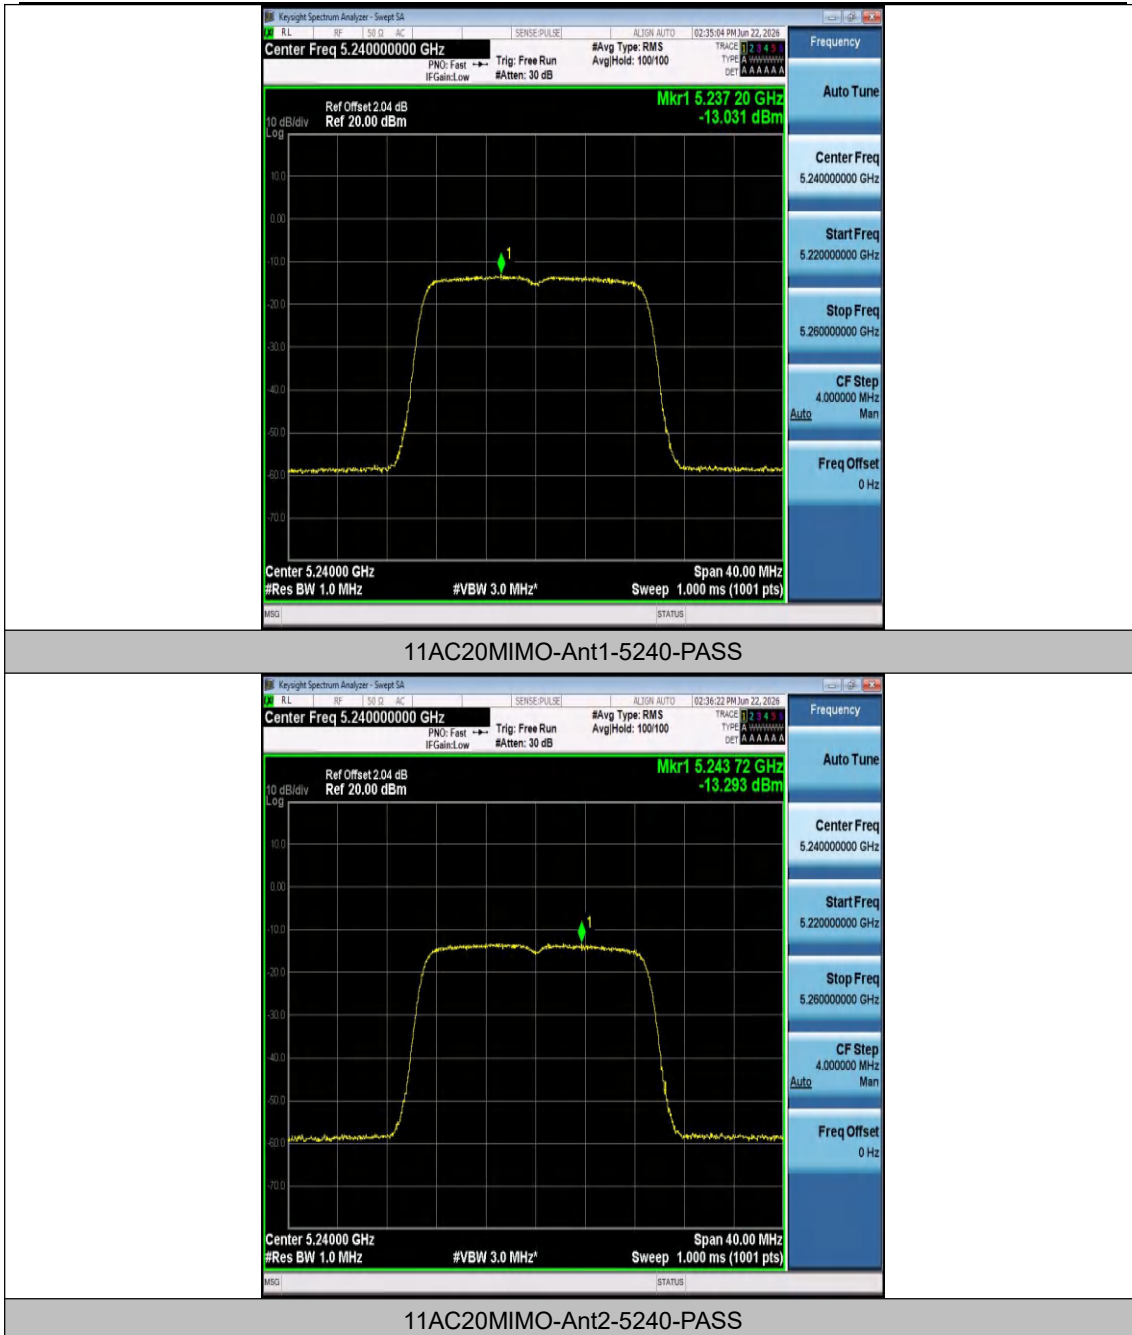

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

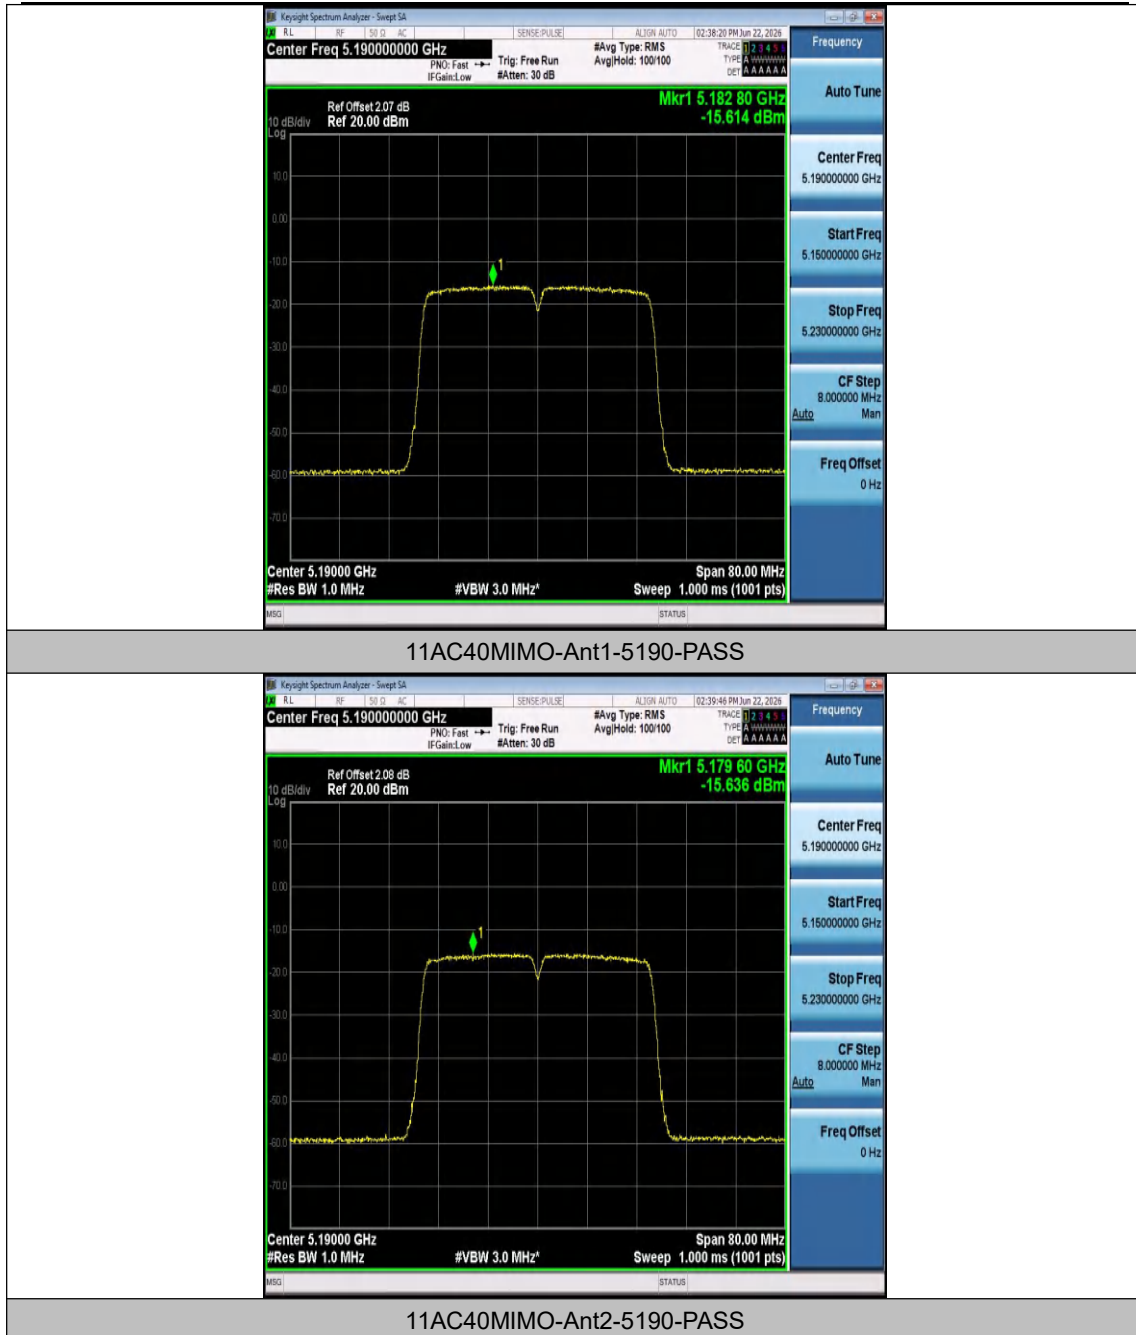

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

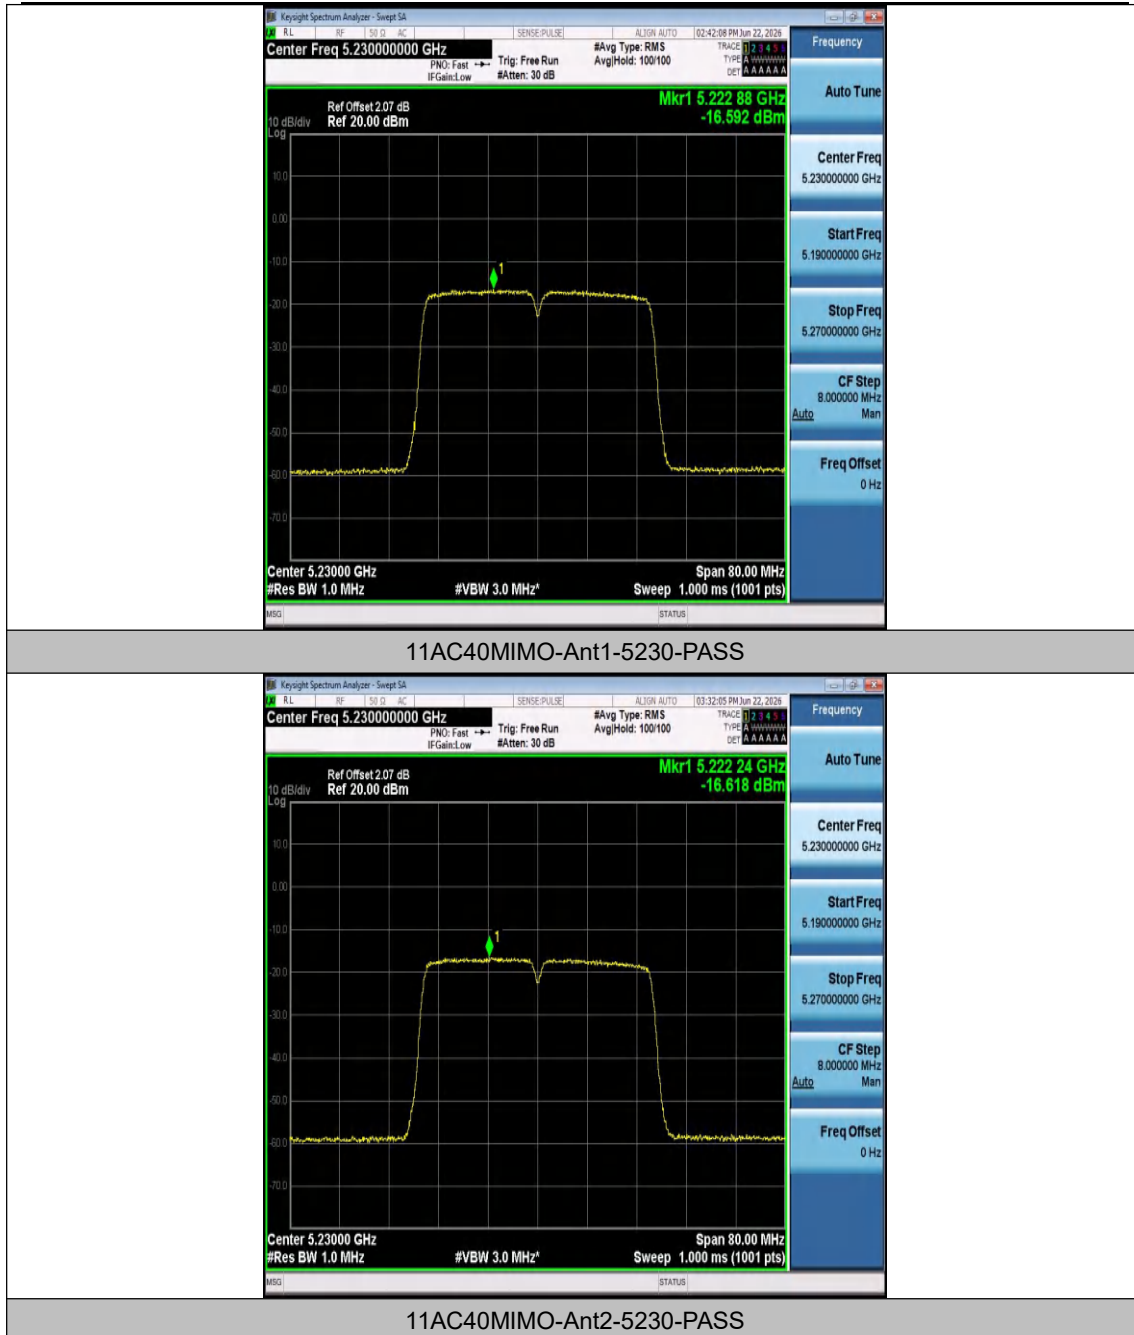

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

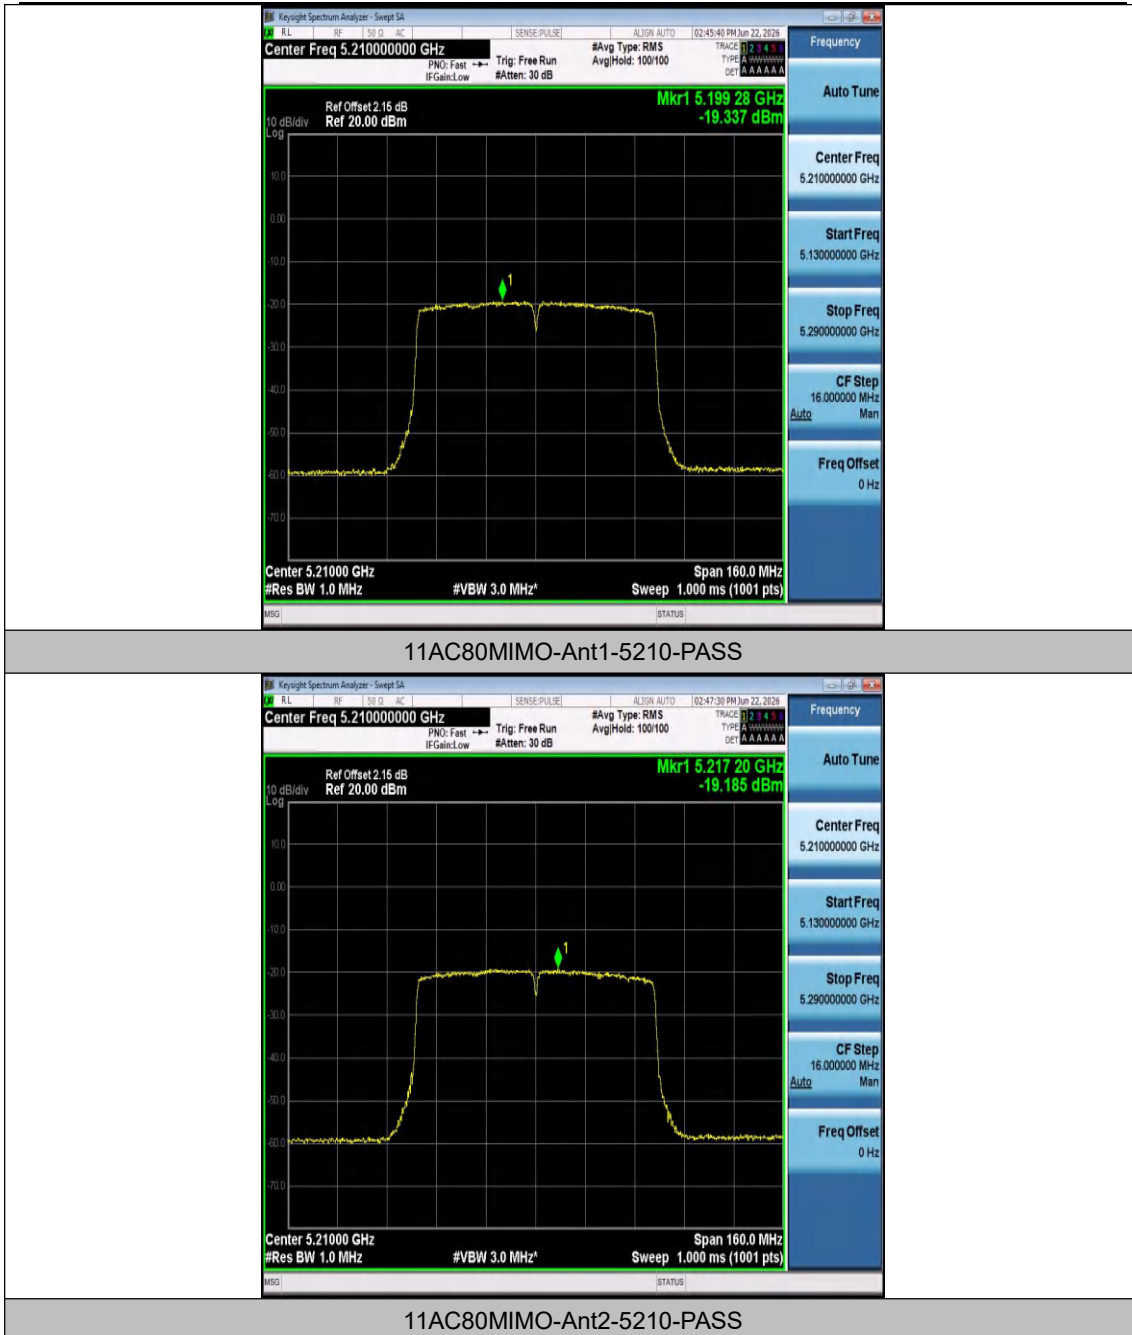

Appendix E: Band edge measurements


Test Result B1


Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-43.89	≤-27	PASS
11A	Ant2	Low	5180	-44.78	≤-27	PASS
11A	Ant1	High	5240	-44.45	≤-27	PASS
11A	Ant2	High	5240	-45.51	≤-27	PASS
11N20MIMO	Ant1	Low	5180	-44.59	≤-27	PASS
11N20MIMO	Ant2	Low	5180	-43.98	≤-27	PASS
11N20MIMO	Ant1	High	5240	-45.07	≤-27	PASS
11N20MIMO	Ant2	High	5240	-44.3	≤-27	PASS
11N40MIMO	Ant1	Low	5190	-44.49	≤-27	PASS
11N40MIMO	Ant2	Low	5190	-44.15	≤-27	PASS
11N40MIMO	Ant1	High	5230	-45.28	≤-27	PASS
11N40MIMO	Ant2	High	5230	-44.64	≤-27	PASS
11AC20MIMO	Ant1	Low	5180	-44.77	≤-27	PASS
11AC20MIMO	Ant2	Low	5180	-44.57	≤-27	PASS
11AC20MIMO	Ant1	High	5240	-45.13	≤-27	PASS
11AC20MIMO	Ant2	High	5240	-44.15	≤-27	PASS
11AC40MIMO	Ant1	Low	5190	-44.16	≤-27	PASS
11AC40MIMO	Ant2	Low	5190	-44.63	≤-27	PASS
11AC40MIMO	Ant1	High	5230	-45.4	≤-27	PASS
11AC40MIMO	Ant2	High	5230	-45.42	≤-27	PASS
11AC80MIMO	Ant1	Low	5210	-44.34	≤-27	PASS
11AC80MIMO	Ant1	High	5210	-45.11	≤-27	PASS
11AC80MIMO	Ant2	Low	5210	-44.04	≤-27	PASS
11AC80MIMO	Ant2	High	5210	-45.14	≤-27	PASS


Note:


1. The margin plus the antenna gain also meets the limit.
2. Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Graphs B1

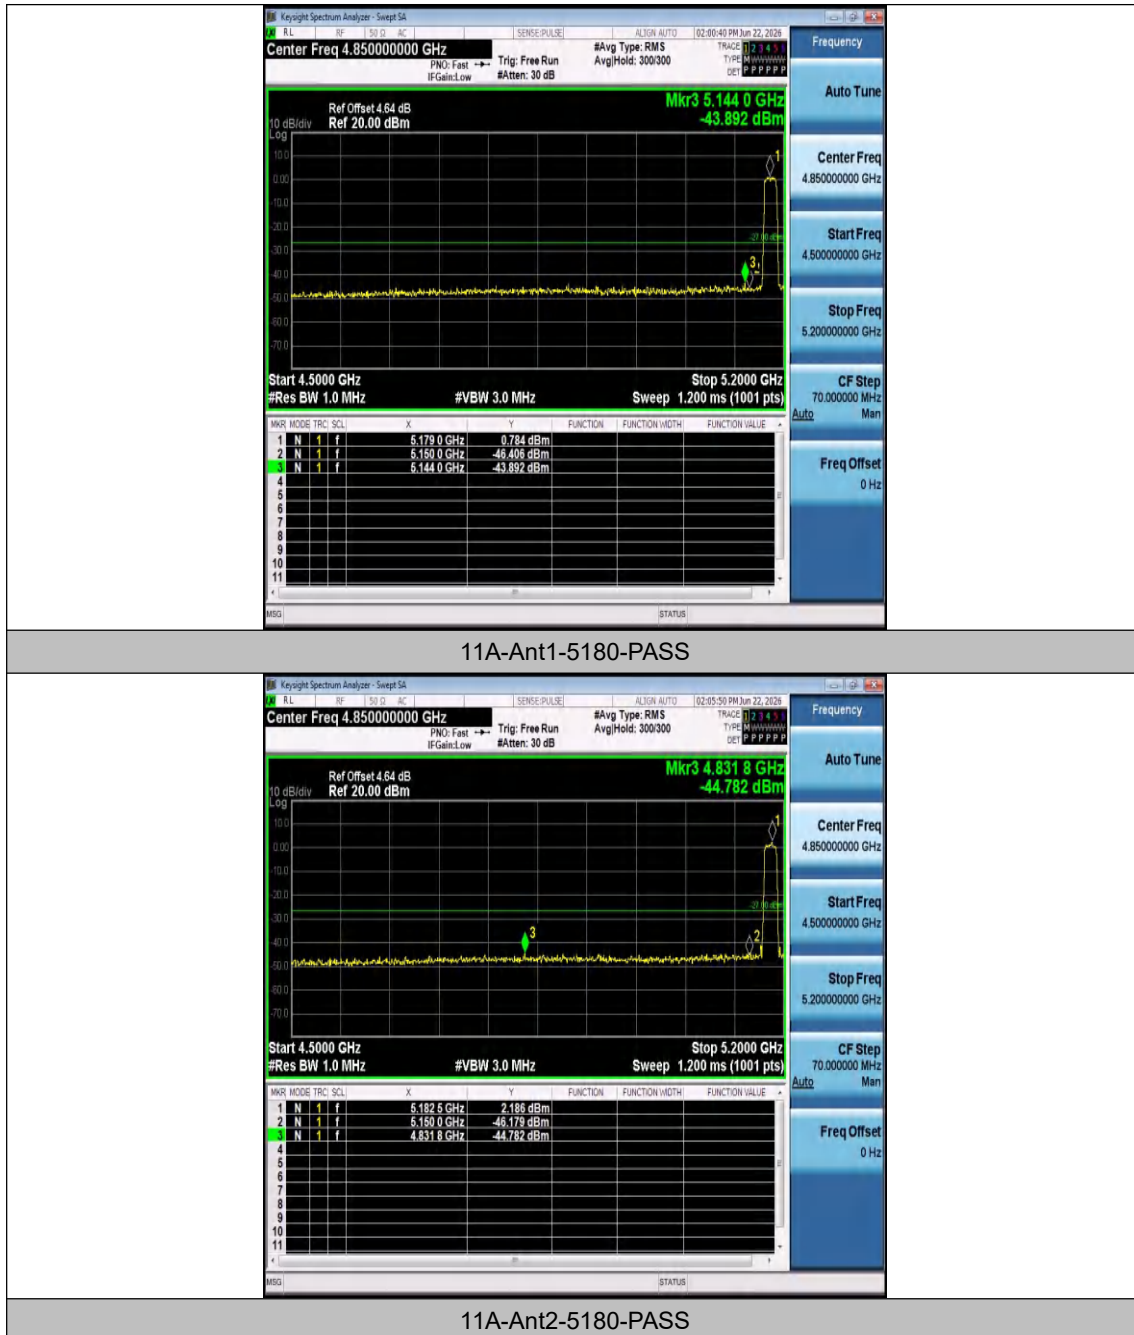


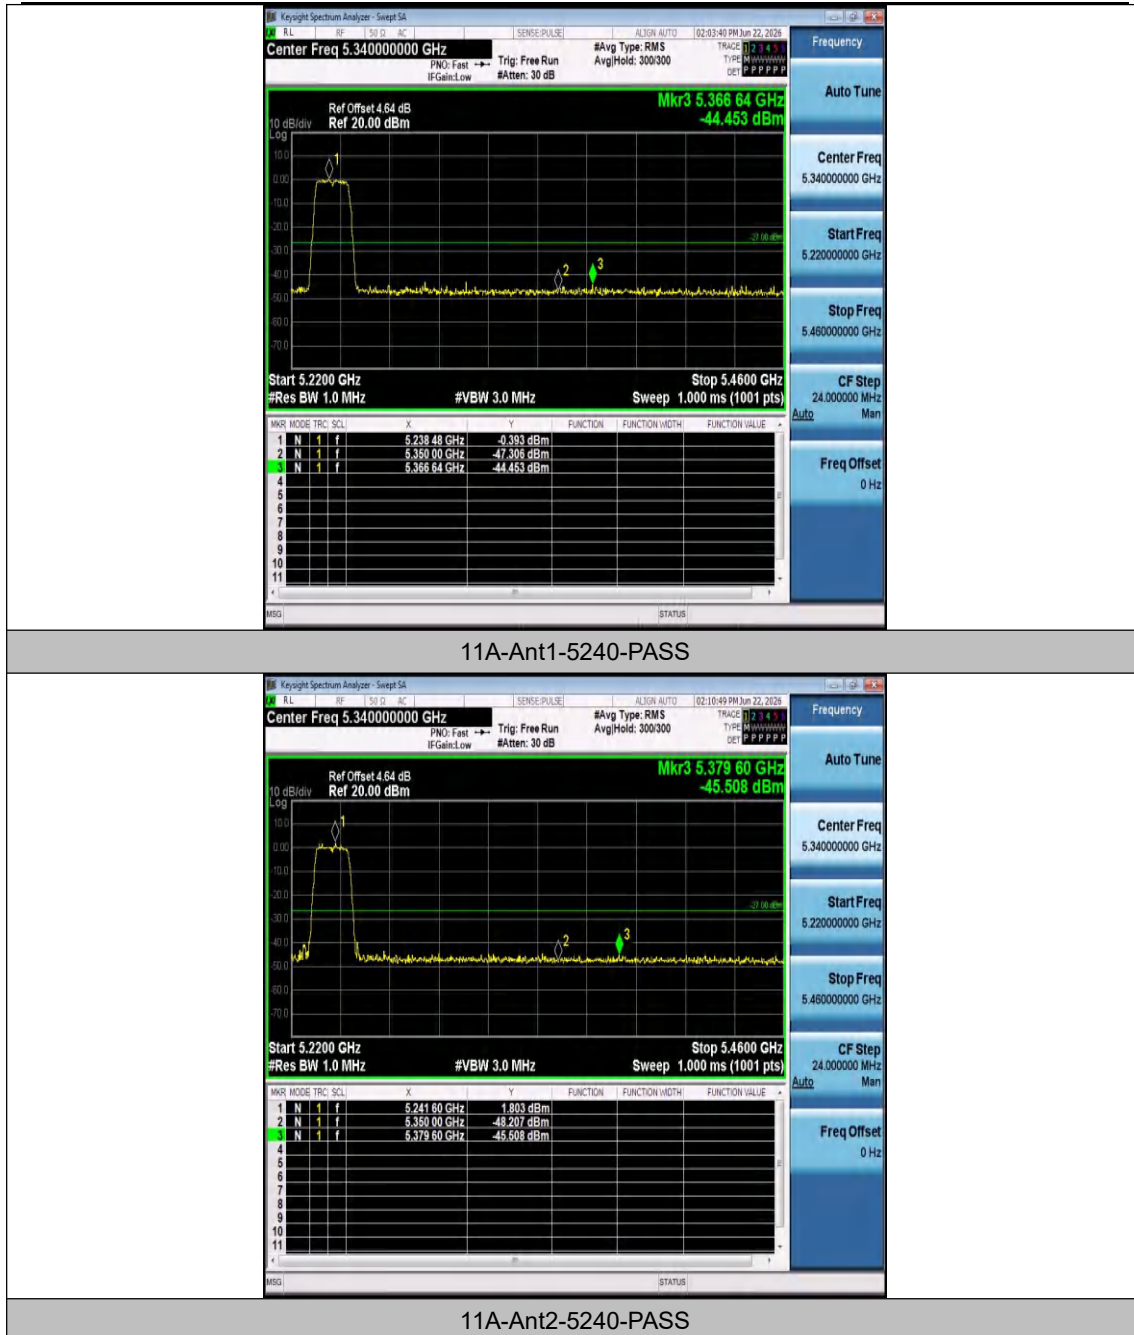


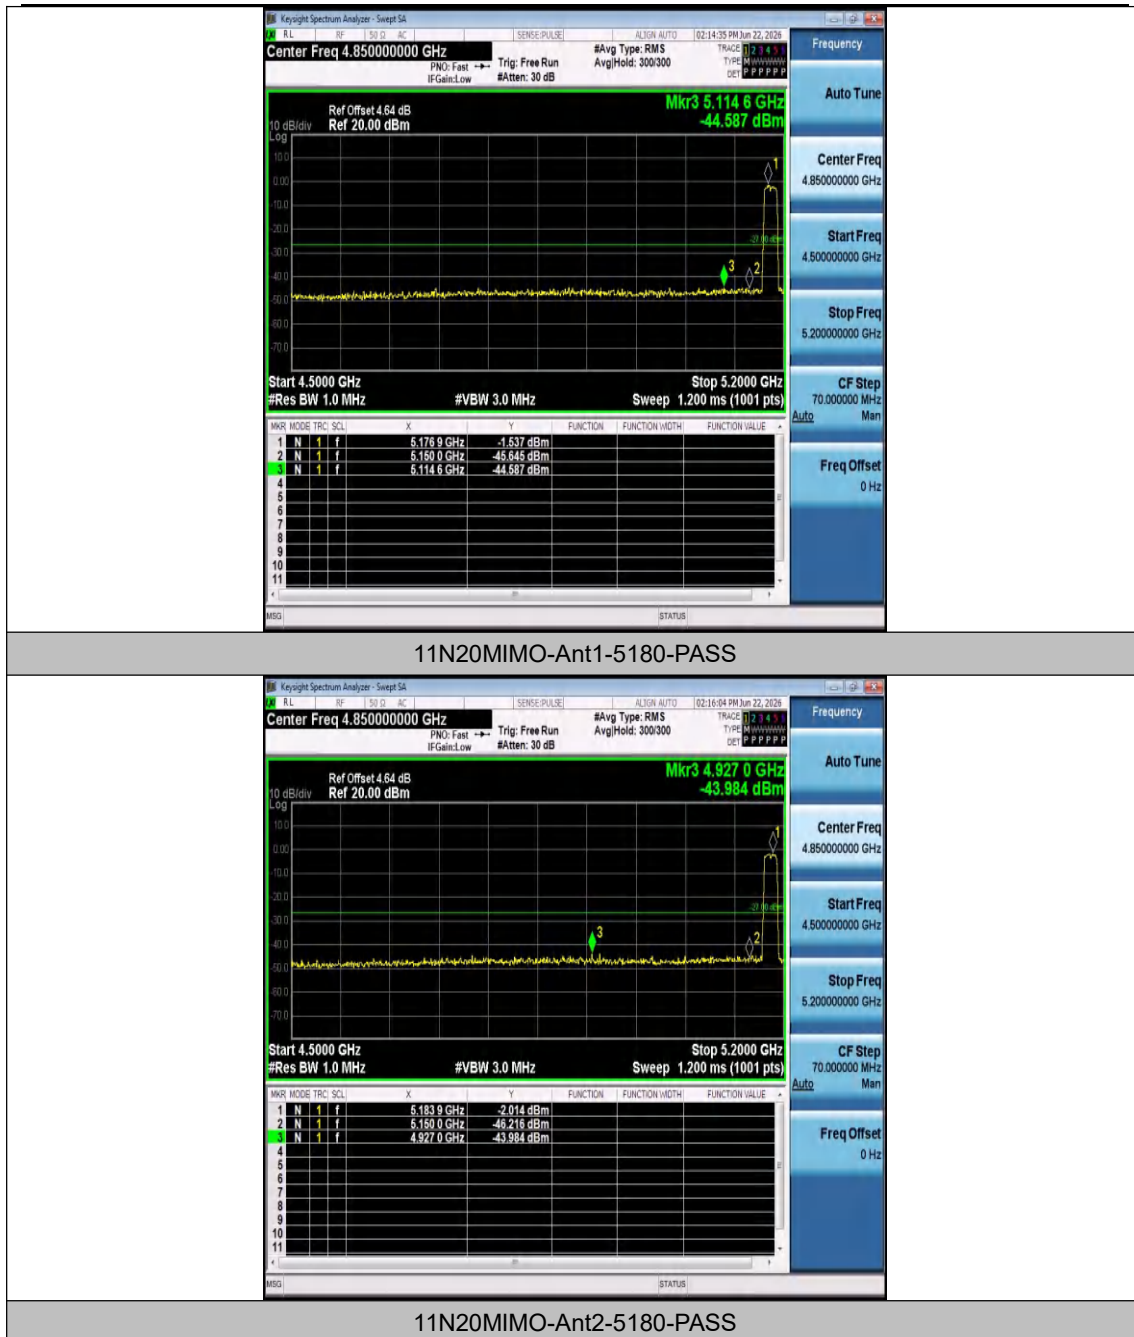


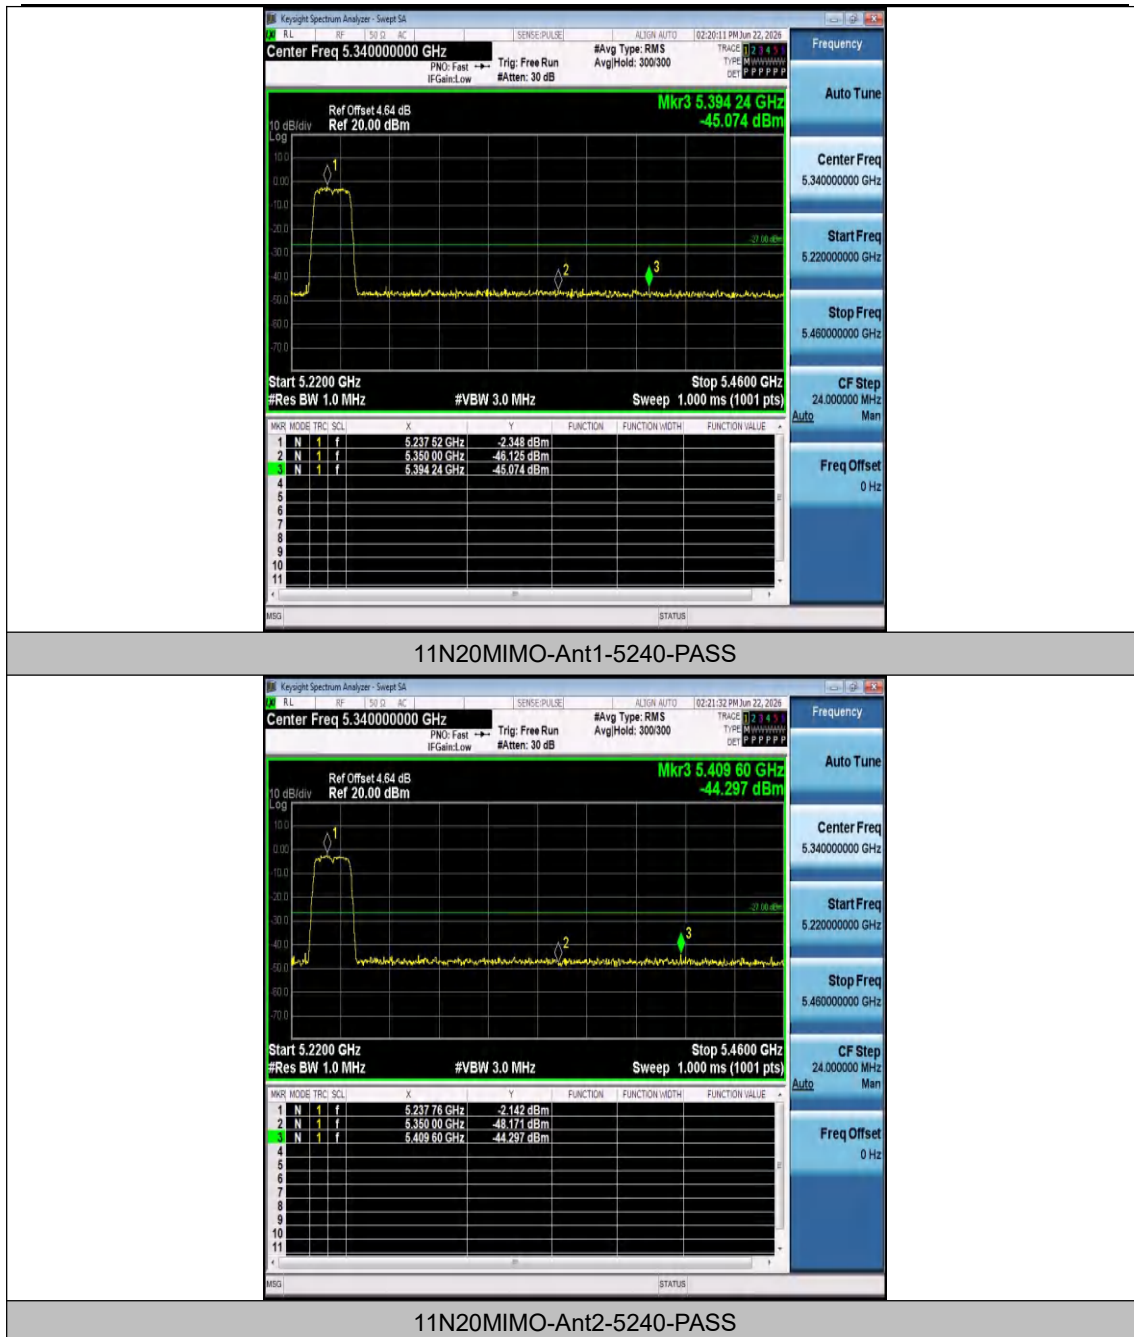


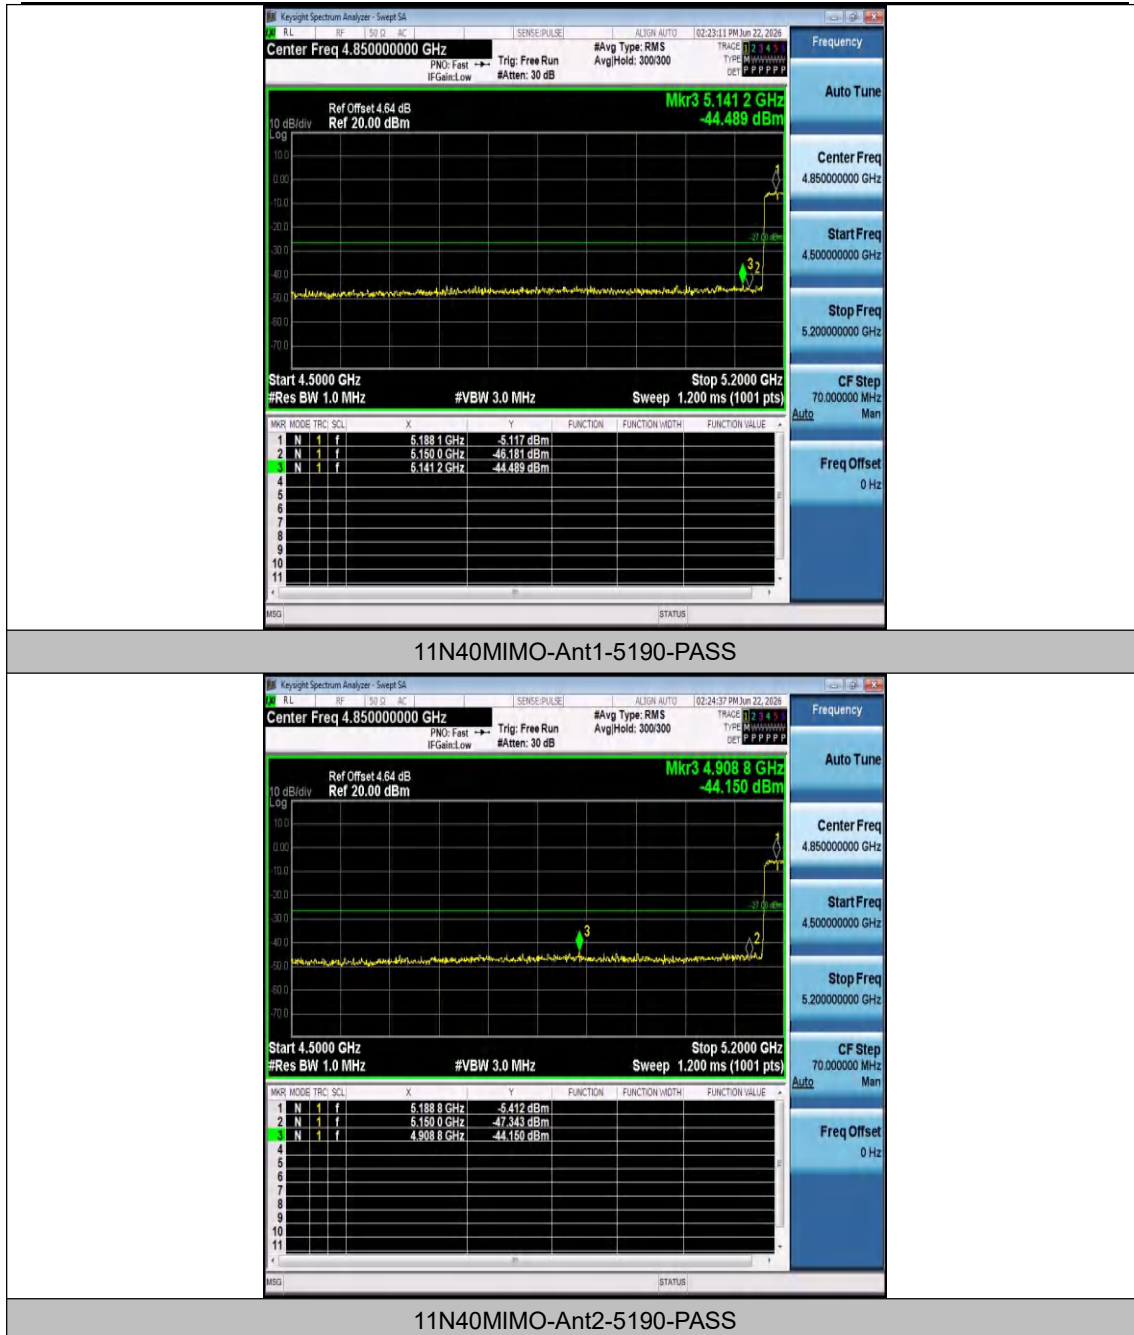


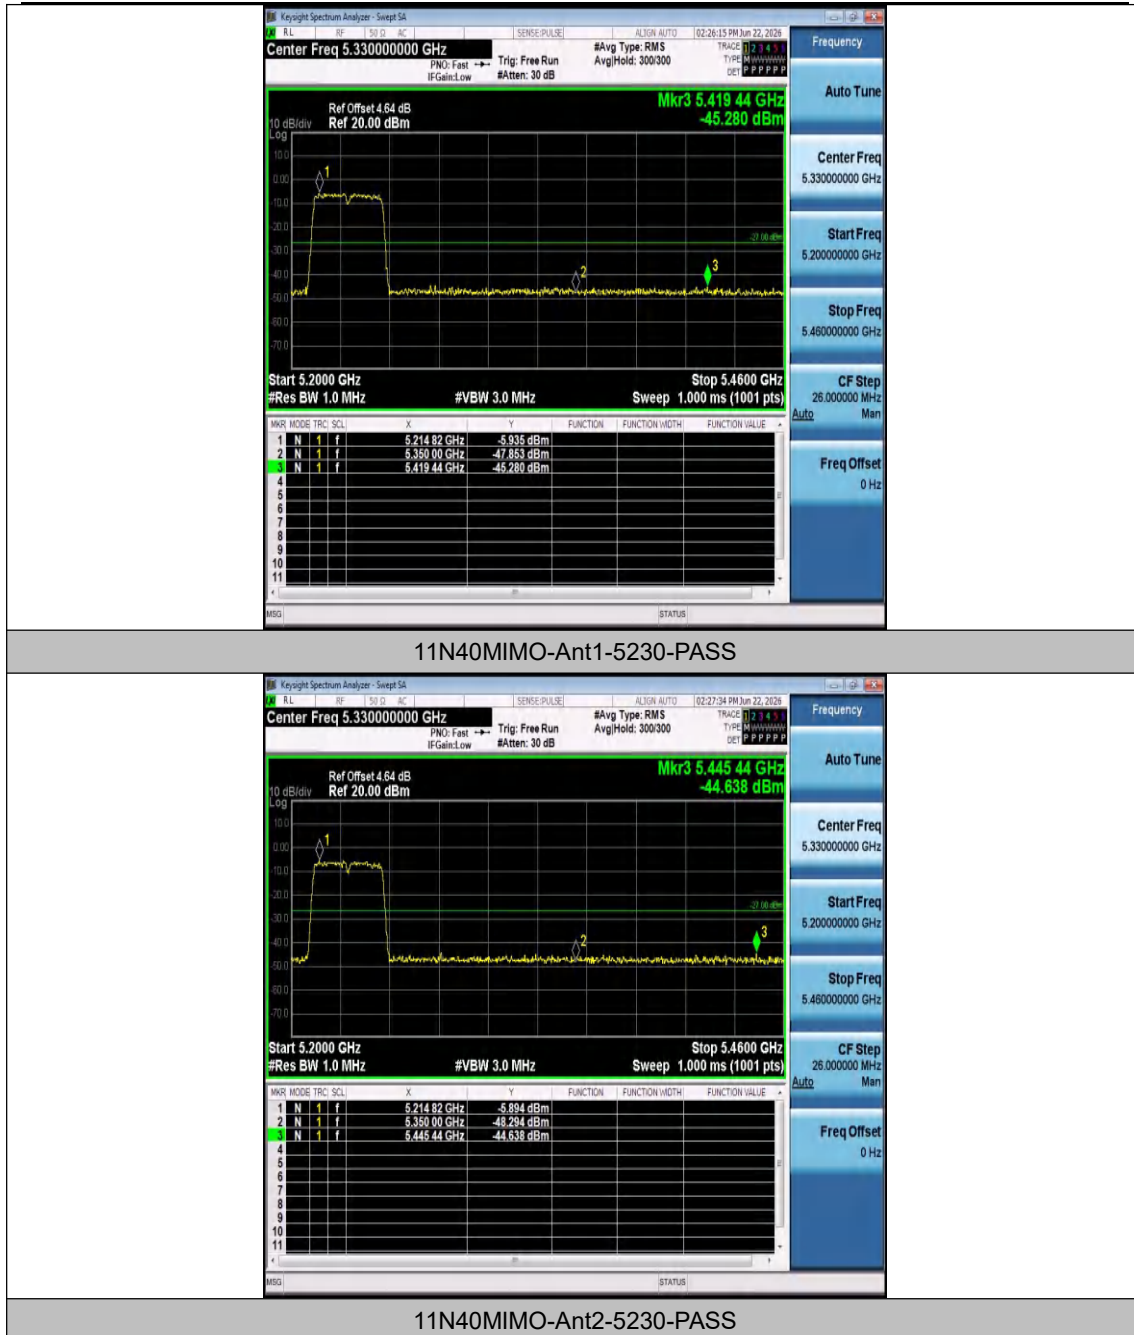


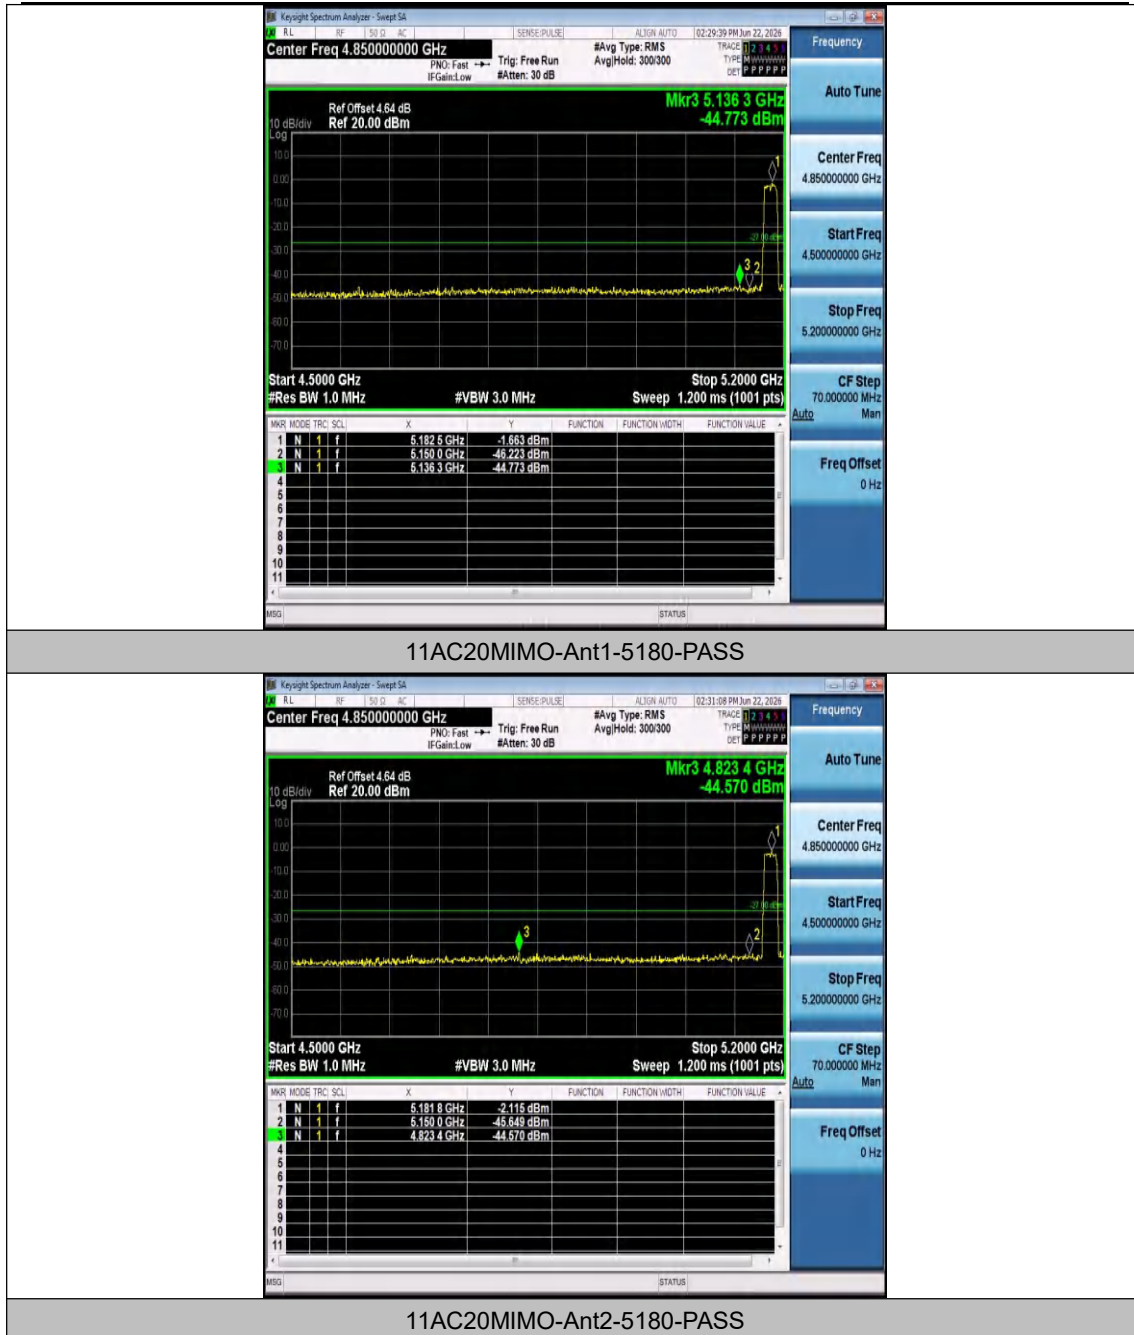


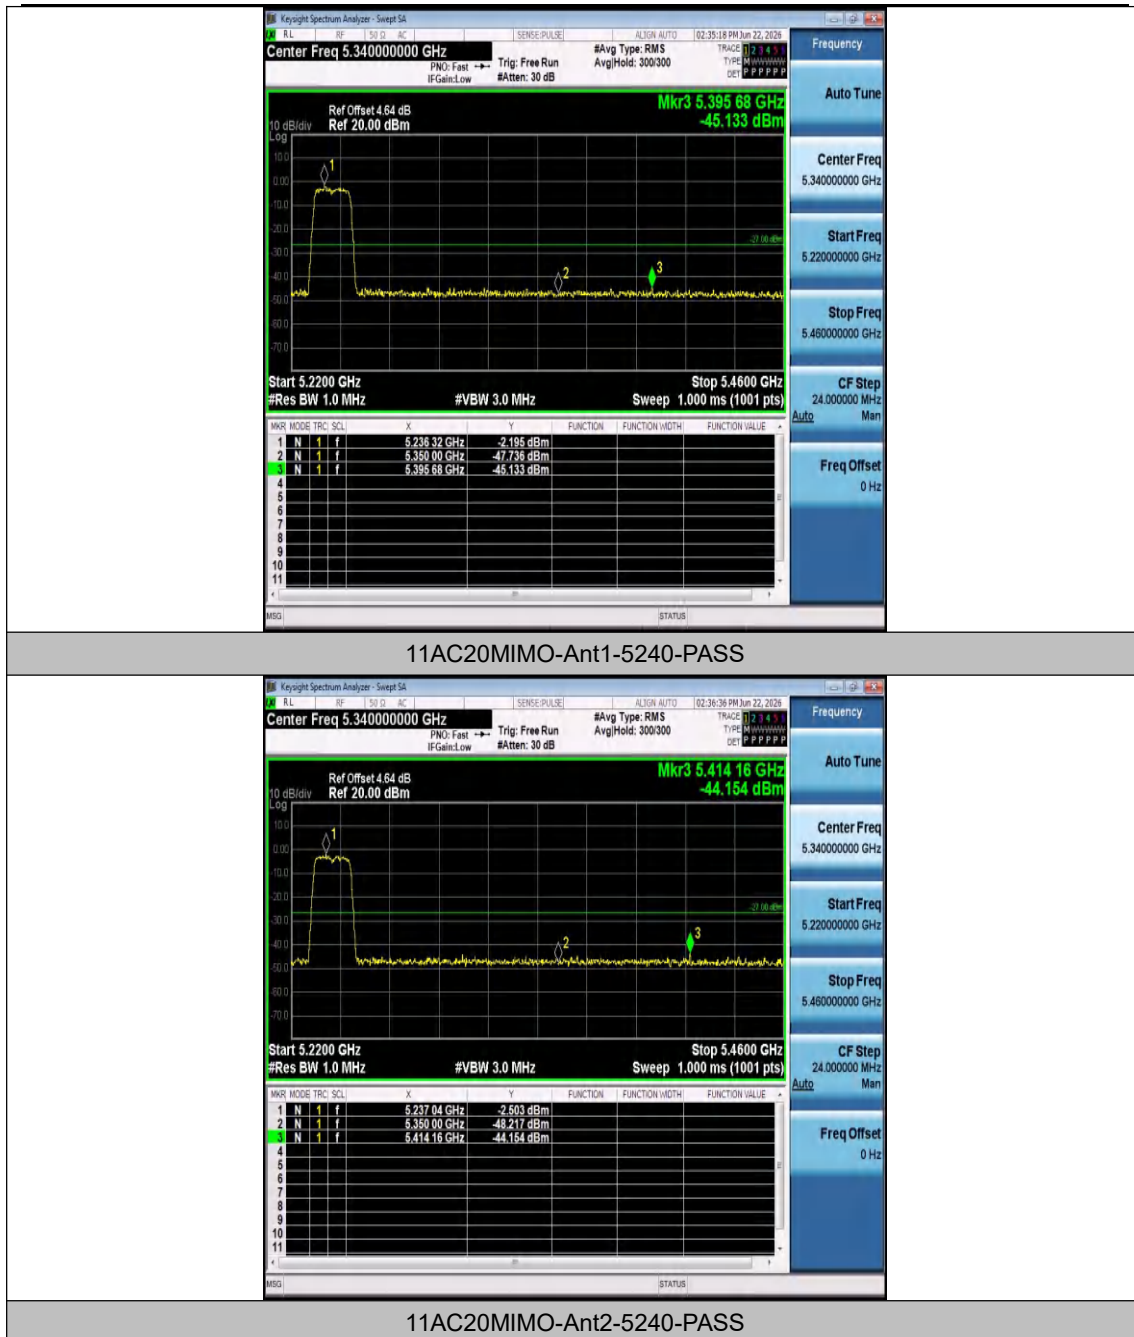

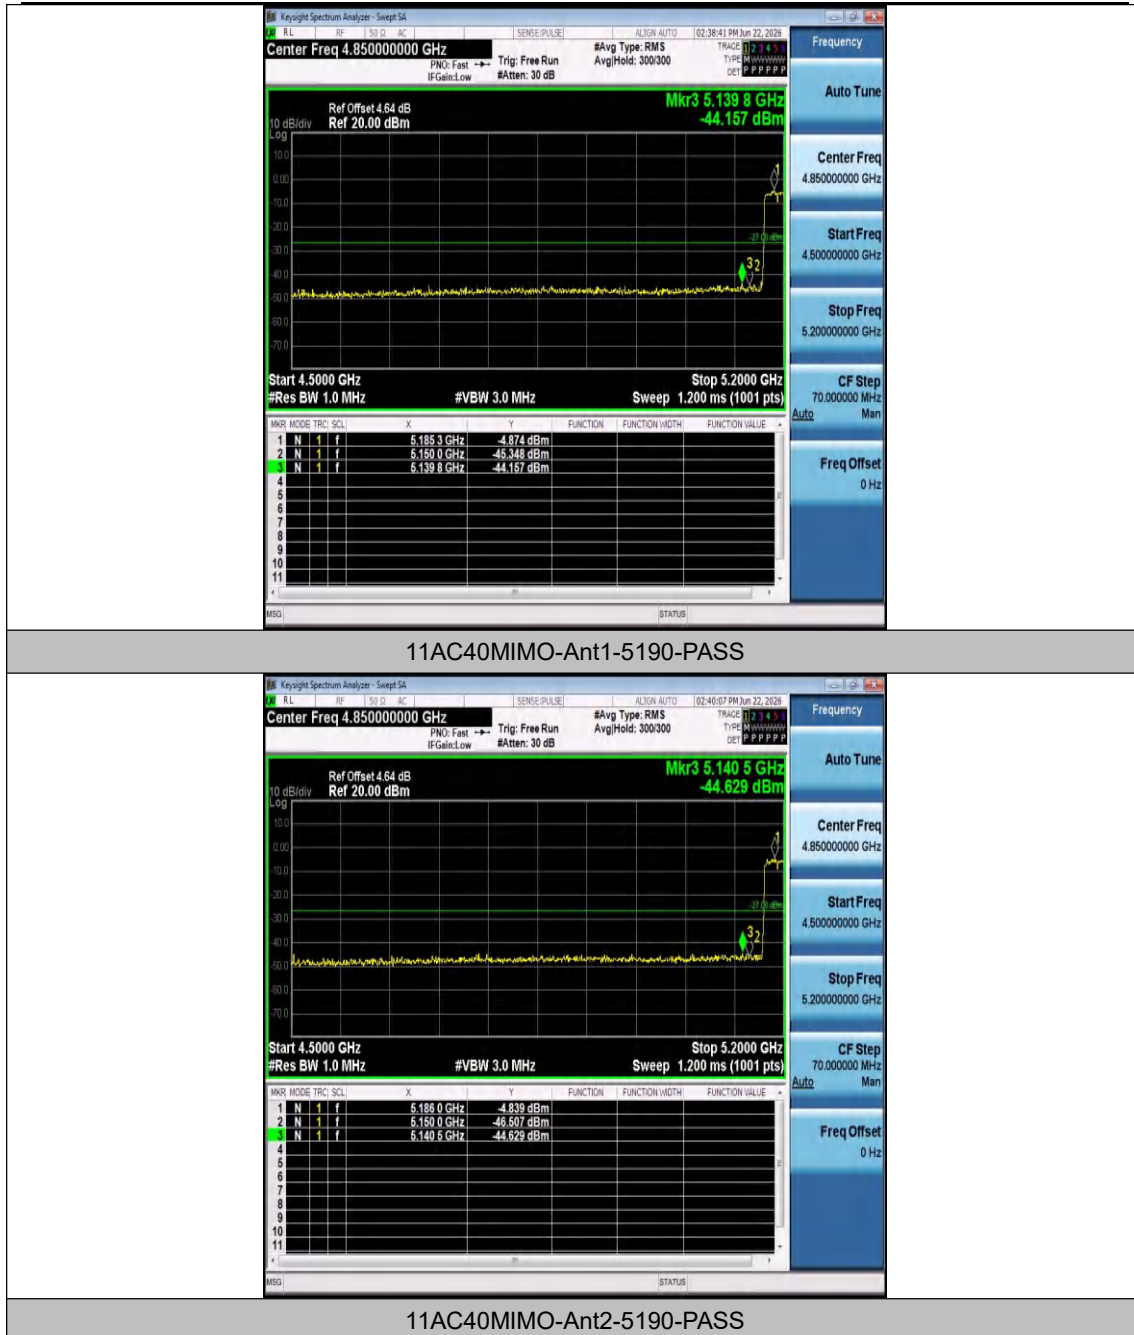

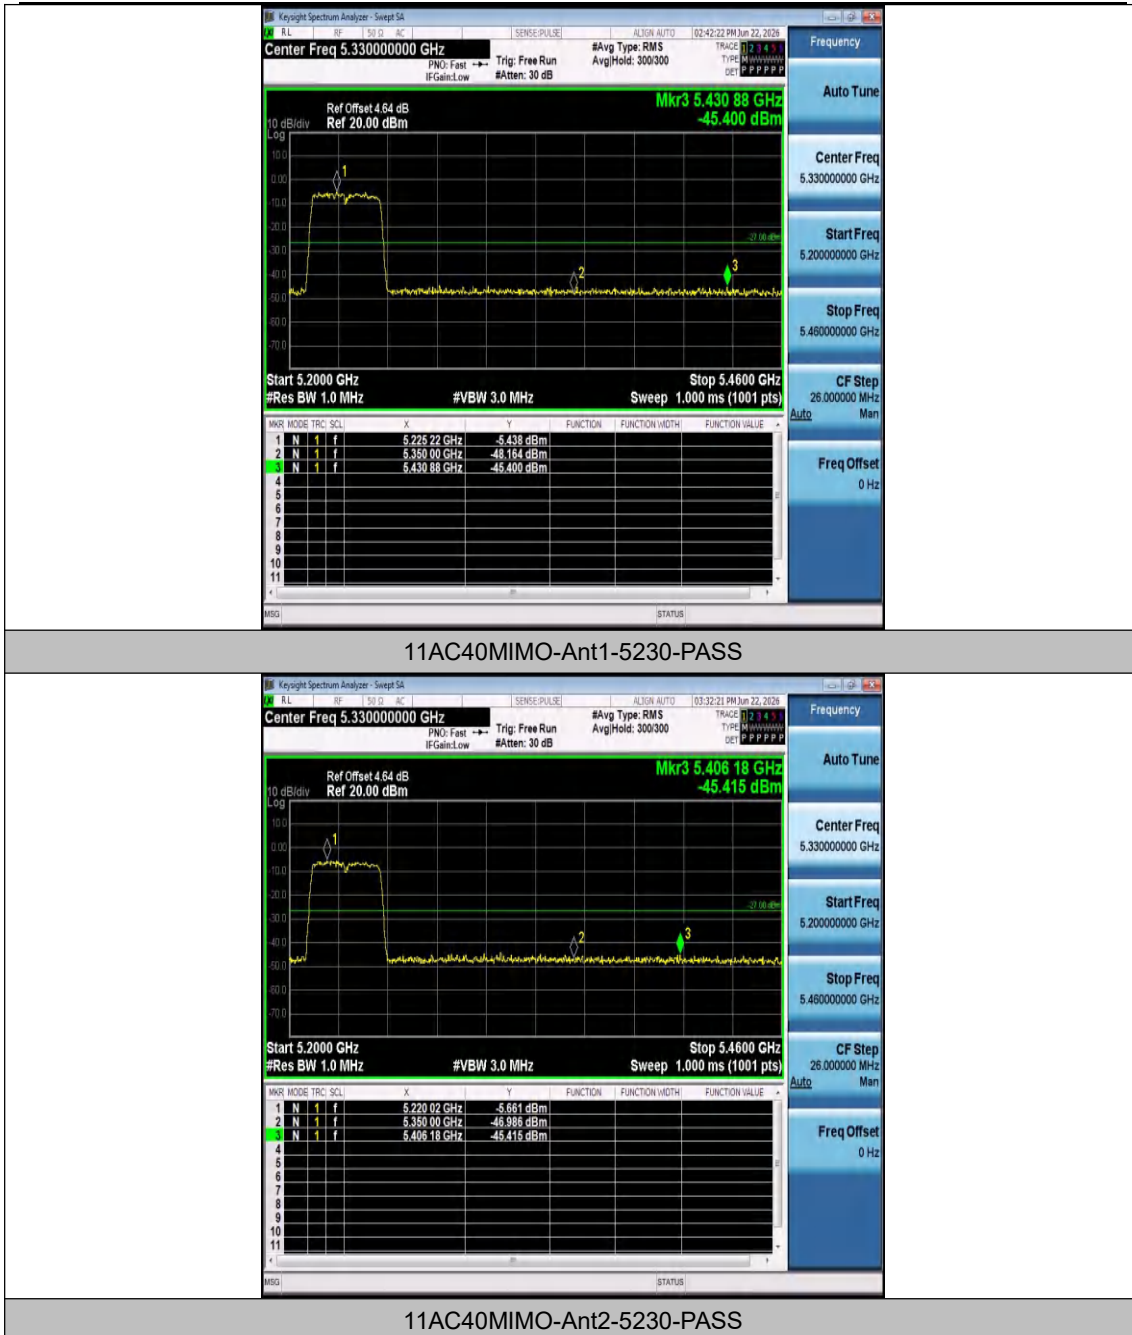

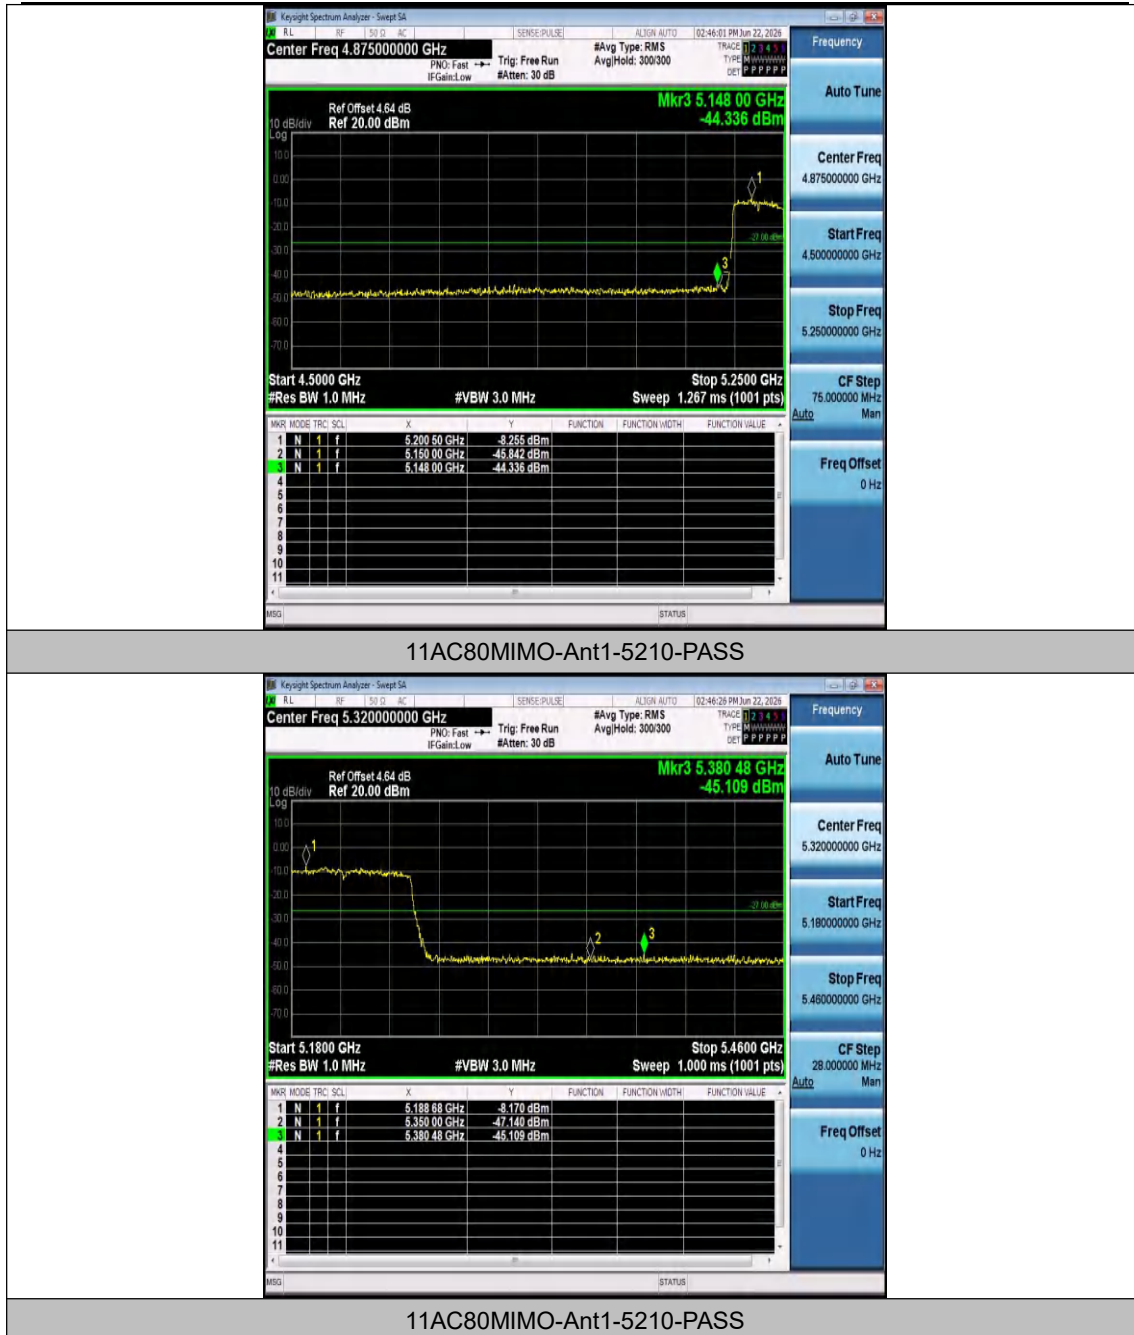

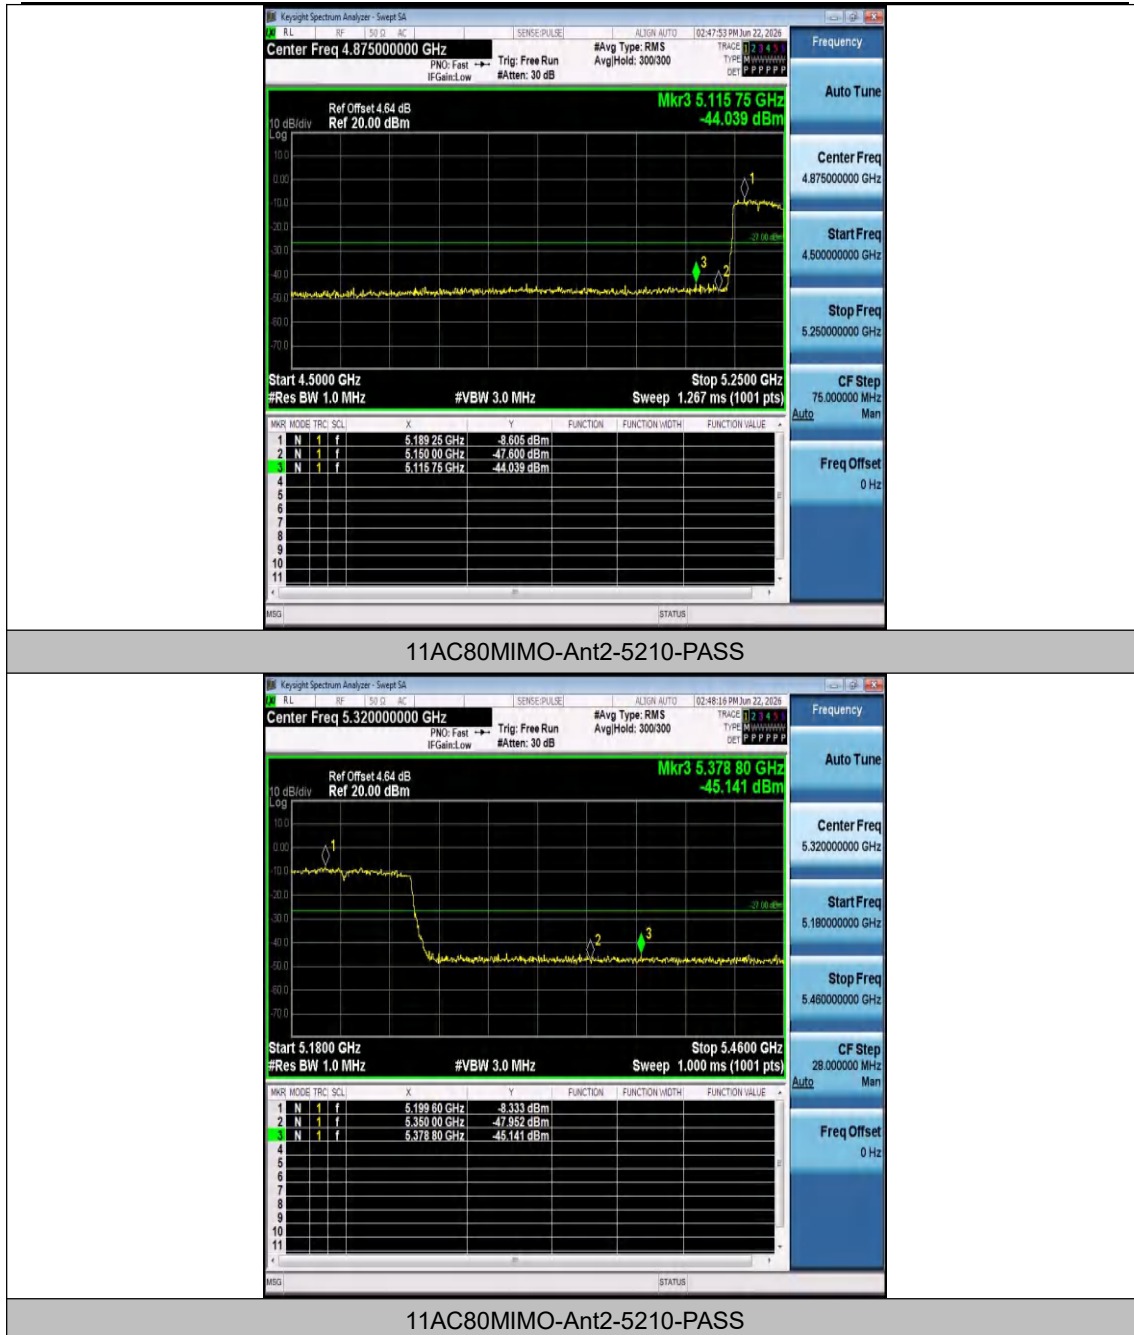

---END---