



Band 2, Normal**1RB was the worst case**

1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)

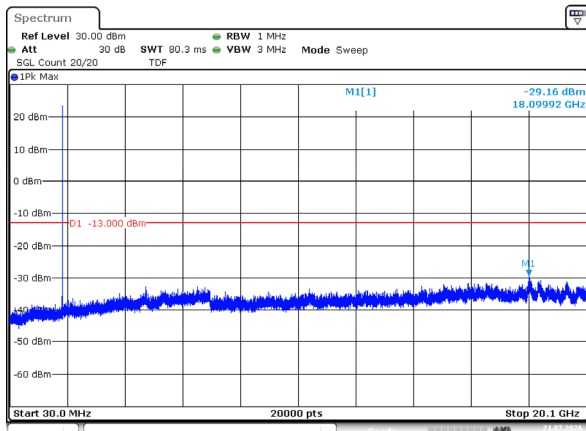


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:42:32

1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

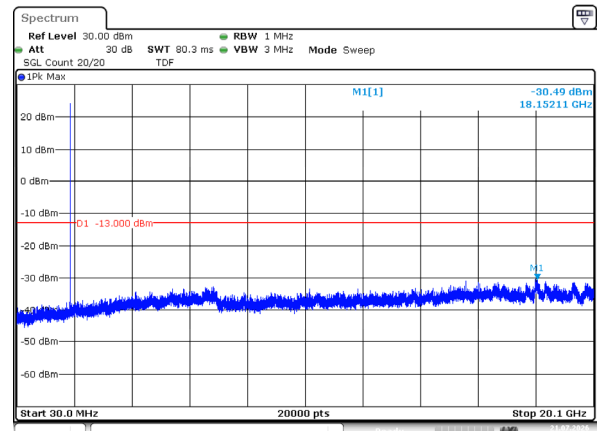


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:43:26

1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)

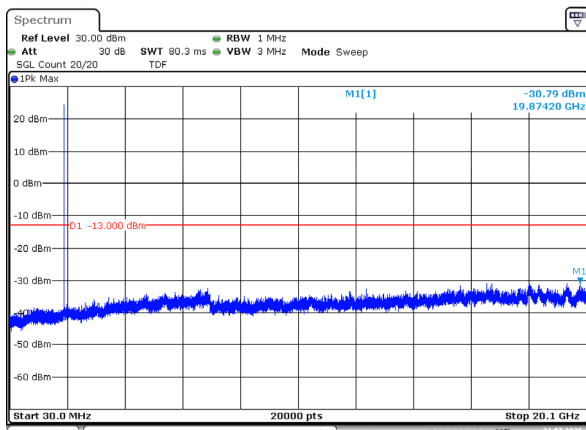


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:44:18

3MHz_Low_QPSK_1@0(30MHz~20.1GHz)

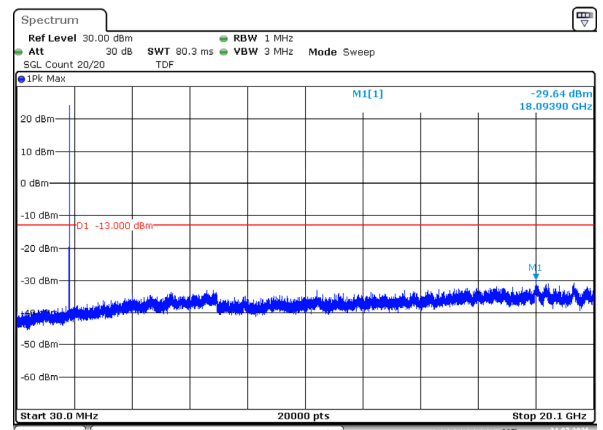


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:46:05

3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

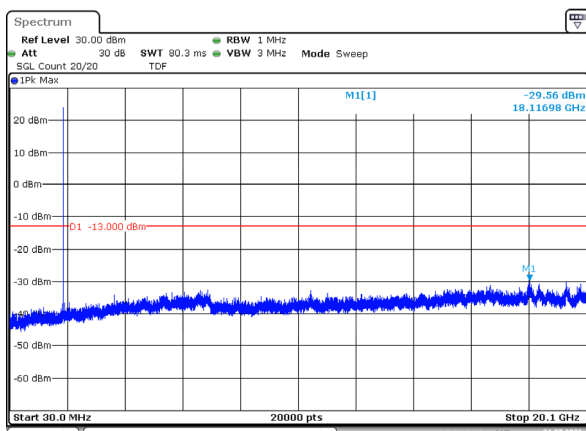


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:46:59

3MHz_High_QPSK_1@0(30MHz~20.1GHz)

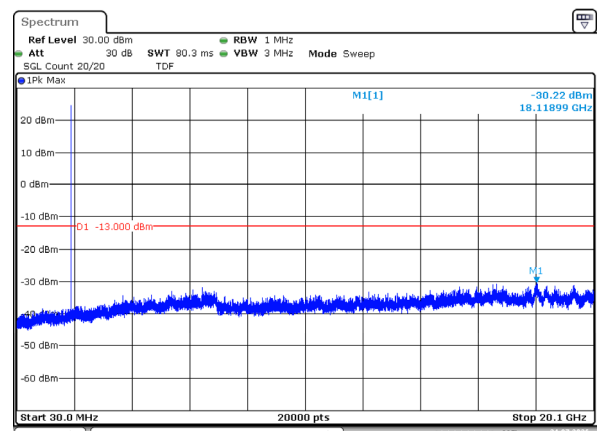


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 11:47:52

5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

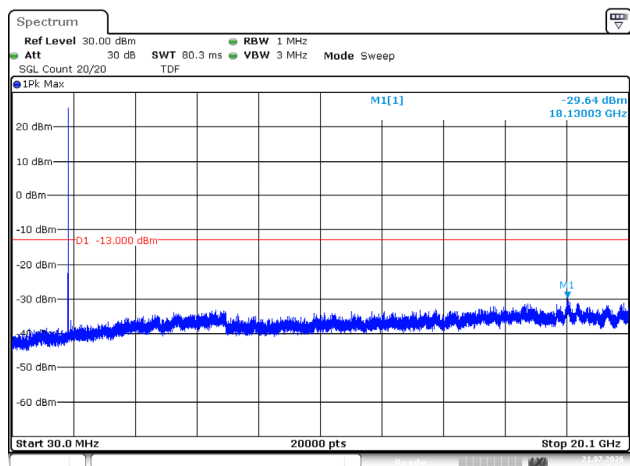


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 11:49:51

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

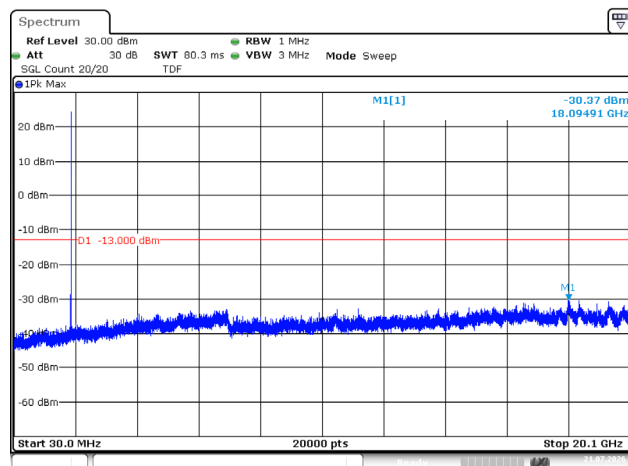


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 11:50:42

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

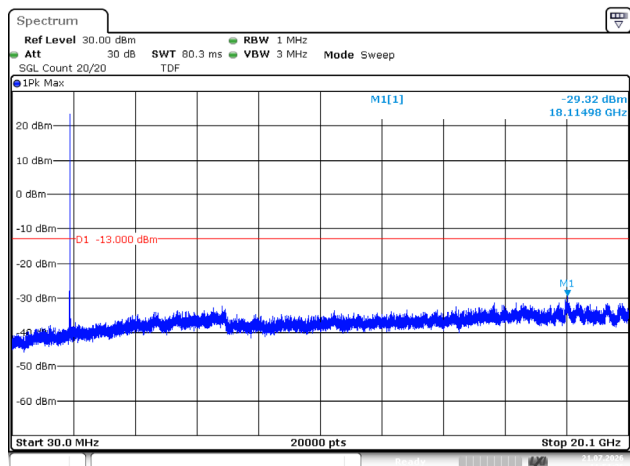


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 11:51:36

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

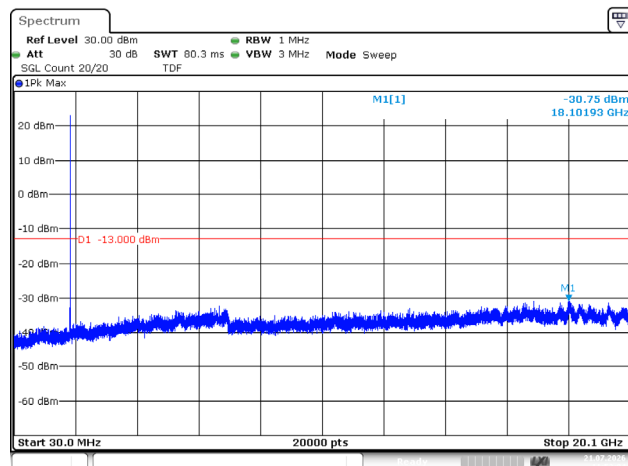


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 11:53:03

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

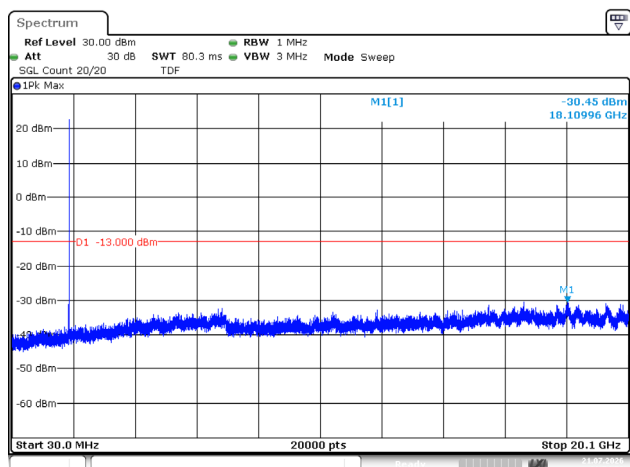


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 11:54:52

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

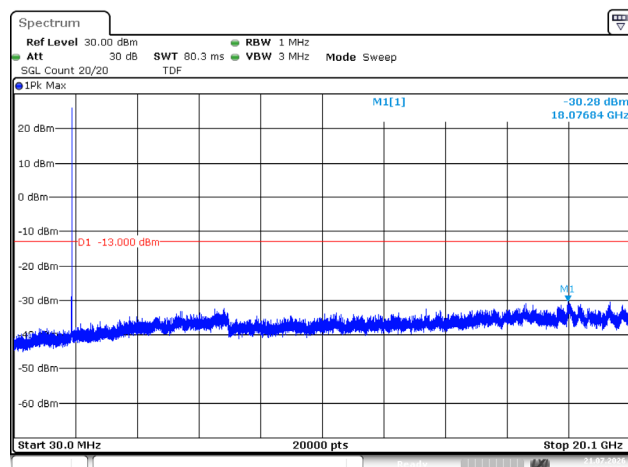


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:02:58

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

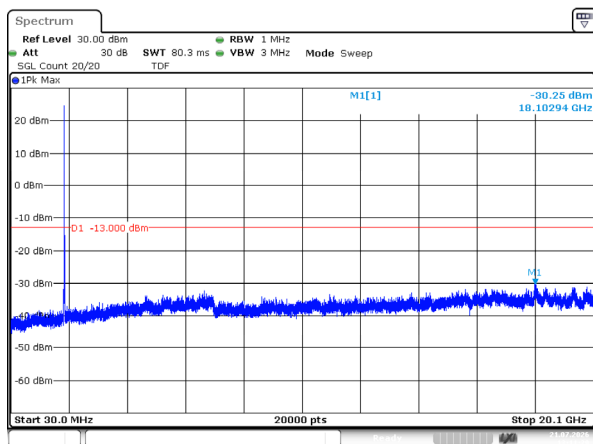


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:11:29

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

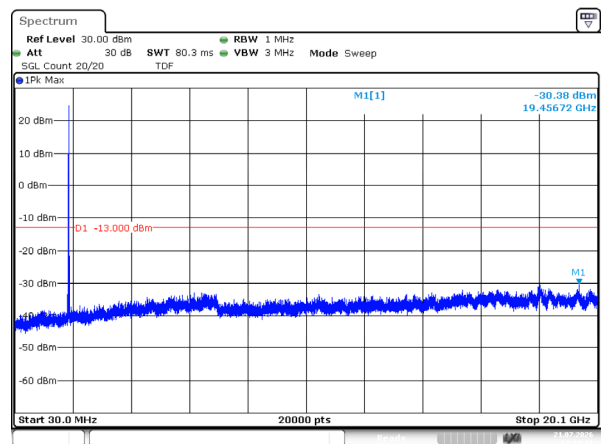


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:13:20

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

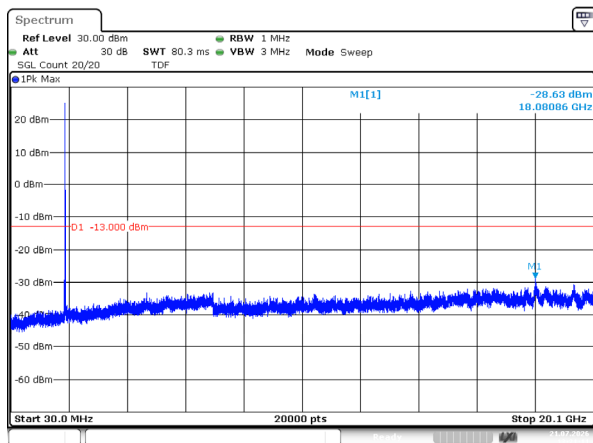


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:21:11

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

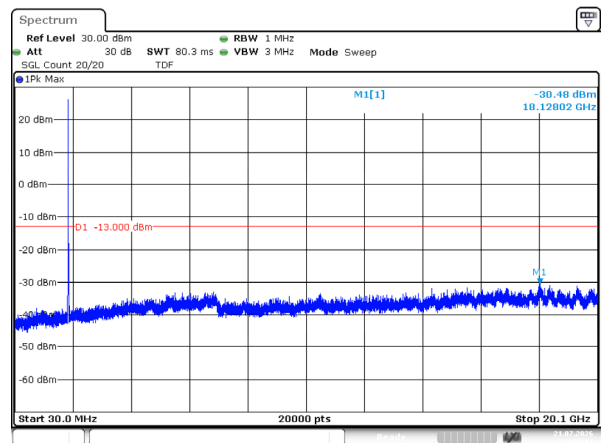


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:28:14

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

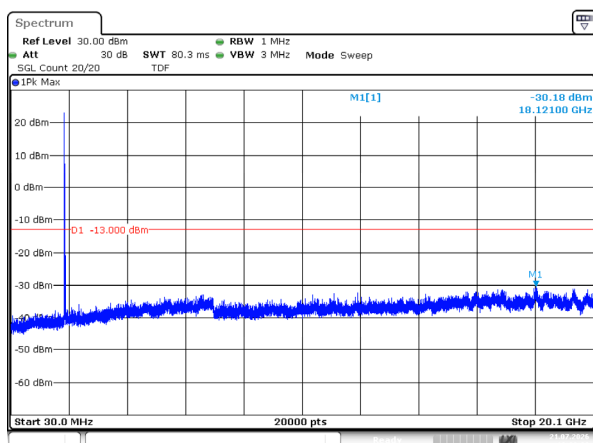

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:30:07

20MHz_High_QPSK_1@0(30MHz~20.1GHz)

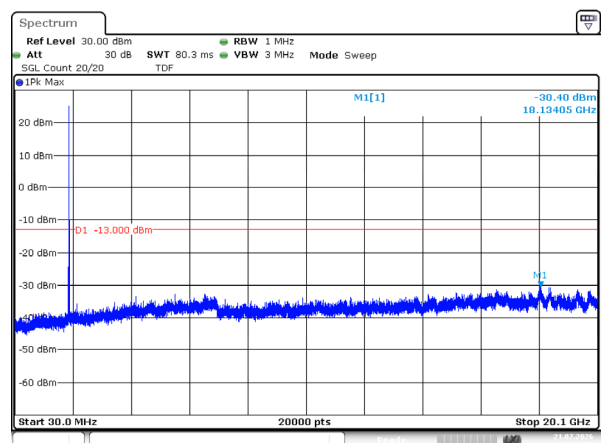

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:32:00

FCC Part 27

Band 4, Normal

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.42	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-29.42	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.26	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.31	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-29.88	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.14	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.02	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.38	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.53	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.43	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.45	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.55GHz)	-29.63	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-29.03	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-31.23	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.55GHz)	-29.61	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-29.98	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-28.92	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.55GHz)	-29.54	See Graphs	Pass

Band 7, Normal

Mode	Value (dBm)	Limit	Verdict
5MHz_Low_QPSK_1@0(30MHz~1GHz)	-42.48	See Graphs	Pass
5MHz_Low_QPSK_1@0(1GHz~15GHz)	-36.15	See Graphs	Pass
5MHz_Low_QPSK_1@0(15GHz~25.025GHz)	-37.90	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~1GHz)	-42.74	See Graphs	Pass
5MHz_Middle_QPSK_1@0(1GHz~15GHz)	-36.27	See Graphs	Pass
5MHz_Middle_QPSK_1@0(15GHz~25.35GHz)	-37.15	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~1GHz)	-42.59	See Graphs	Pass
5MHz_High_QPSK_1@0(1GHz~15GHz)	-36.37	See Graphs	Pass
5MHz_High_QPSK_1@0(15GHz~25.675GHz)	-37.86	See Graphs	Pass

Mode	Value (dBm)	Limit	Verdict
10MHz_Low_QPSK_1@0(30MHz~1GHz)	-42.56	See Graphs	Pass
10MHz_Low_QPSK_1@0(1GHz~15GHz)	-35.49	See Graphs	Pass
10MHz_Low_QPSK_1@0(15GHz~25.05GHz)	-38.02	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~1GHz)	-42.72	See Graphs	Pass
10MHz_Middle_QPSK_1@0(1GHz~15GHz)	-36.77	See Graphs	Pass
10MHz_Middle_QPSK_1@0(15GHz~25.35GHz)	-38.17	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~1GHz)	-42.35	See Graphs	Pass
10MHz_High_QPSK_1@0(1GHz~15GHz)	-36.53	See Graphs	Pass
10MHz_High_QPSK_1@0(15GHz~25.65GHz)	-38.19	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~1GHz)	-42.91	See Graphs	Pass
15MHz_Low_QPSK_1@0(1GHz~15GHz)	-35.80	See Graphs	Pass
15MHz_Low_QPSK_1@0(15GHz~25.075GHz)	-38.25	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~1GHz)	-42.06	See Graphs	Pass
15MHz_Middle_QPSK_1@0(1GHz~15GHz)	-36.42	See Graphs	Pass
15MHz_Middle_QPSK_1@0(15GHz~25.35GHz)	-38.14	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~1GHz)	-41.15	See Graphs	Pass
15MHz_High_QPSK_1@0(1GHz~15GHz)	-36.77	See Graphs	Pass
15MHz_High_QPSK_1@0(15GHz~25.625GHz)	-37.83	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~1GHz)	-43.01	See Graphs	Pass
20MHz_Low_QPSK_1@0(1GHz~15GHz)	-33.52	See Graphs	Pass
20MHz_Low_QPSK_1@0(15GHz~25.1GHz)	-38.22	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~1GHz)	-41.90	See Graphs	Pass
20MHz_Middle_QPSK_1@0(1GHz~15GHz)	-35.71	See Graphs	Pass
20MHz_Middle_QPSK_1@0(15GHz~25.35GHz)	-37.72	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~1GHz)	-42.66	See Graphs	Pass
20MHz_High_QPSK_1@0(1GHz~15GHz)	-36.45	See Graphs	Pass
20MHz_High_QPSK_1@0(15GHz~25.6GHz)	-38.21	See Graphs	Pass

Band 66, Normal


Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-30.51	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-29.41	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.39	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.00	See Graphs	Pass

Mode	Value (dBm)	Limit	Verdict
3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-30.50	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.41	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-30.93	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-30.58	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.8GHz)	-29.39	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-29.99	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-30.72	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.56	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-30.72	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-29.96	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.73	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-30.43	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-30.52	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.24	See Graphs	Pass

Note:1RB was the worst case.


Band 4, Normal**1RB was the worst case**

1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)

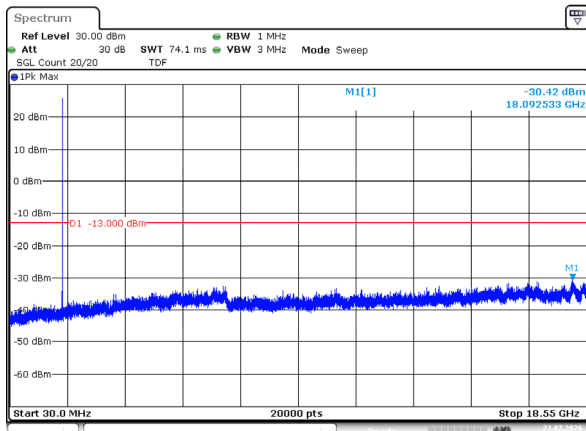


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:34:09

1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

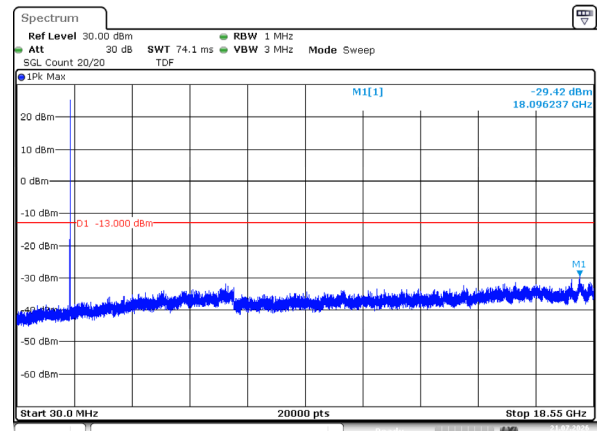


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:35:02

1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)

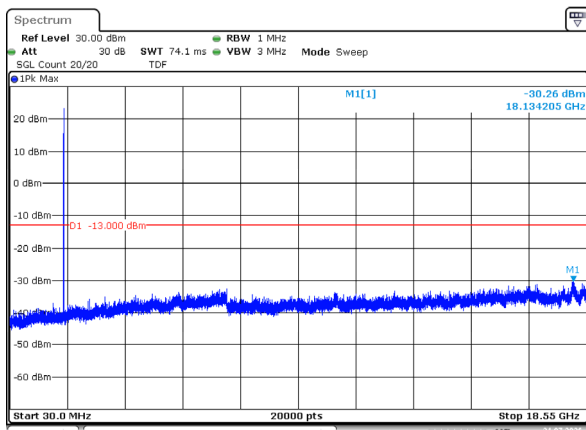


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:35:56

3MHz_Low_QPSK_1@0(30MHz~18.55GHz)

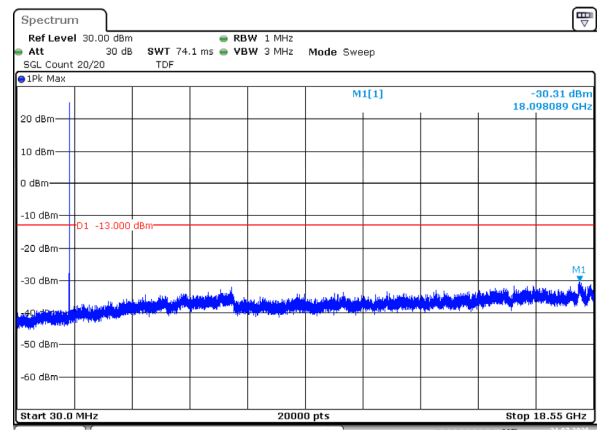


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:38:01

3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

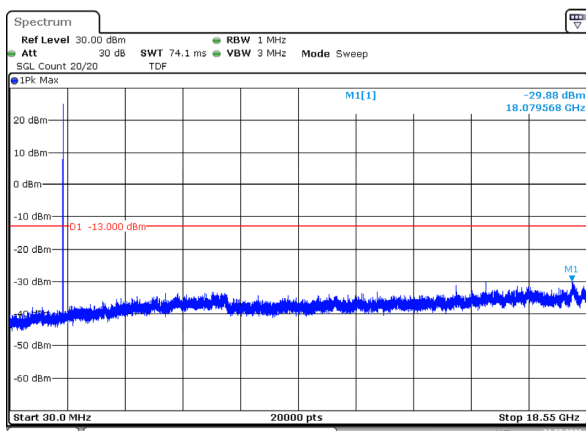


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:38:56

3MHz_High_QPSK_1@0(30MHz~18.55GHz)

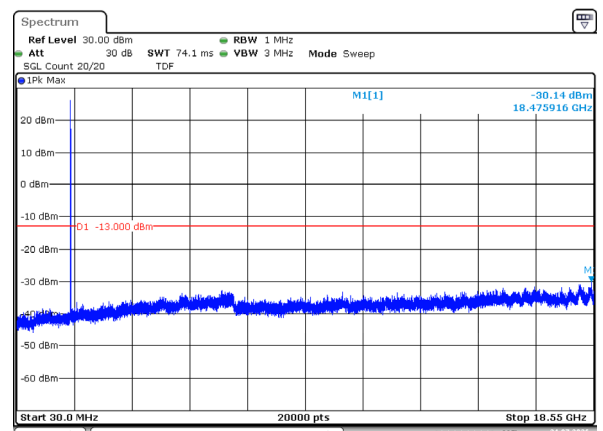


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:39:51

5MHz_Low_QPSK_1@0(30MHz~18.55GHz)

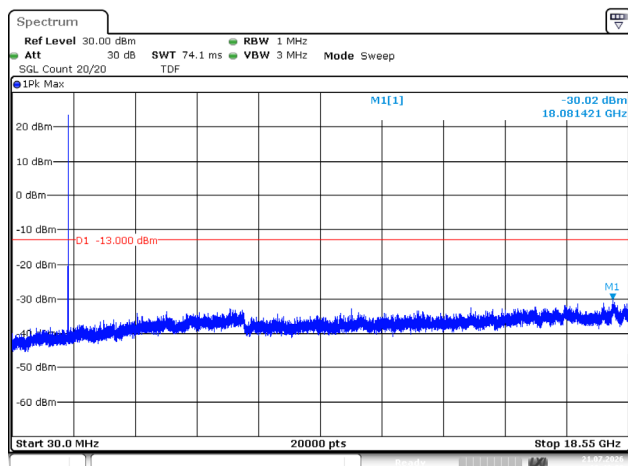


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:42:00

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

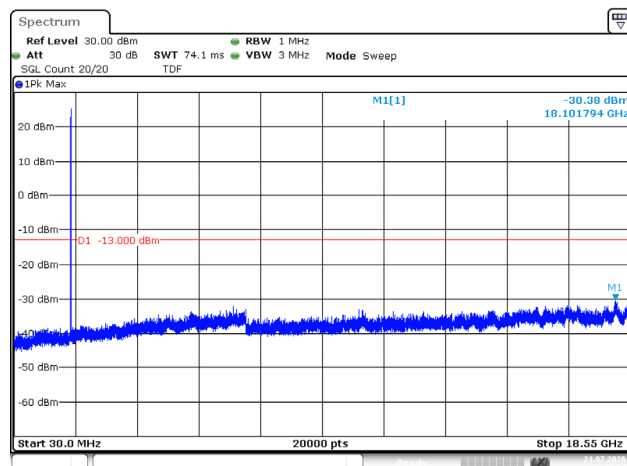


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:42:54

5MHz_High_QPSK_1@0(30MHz~18.55GHz)

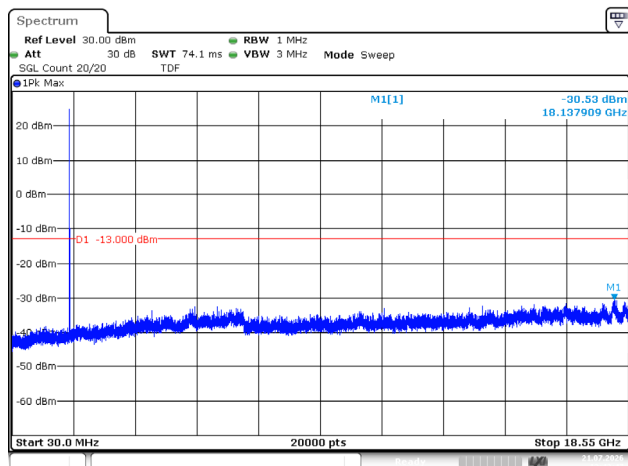


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:43:47

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

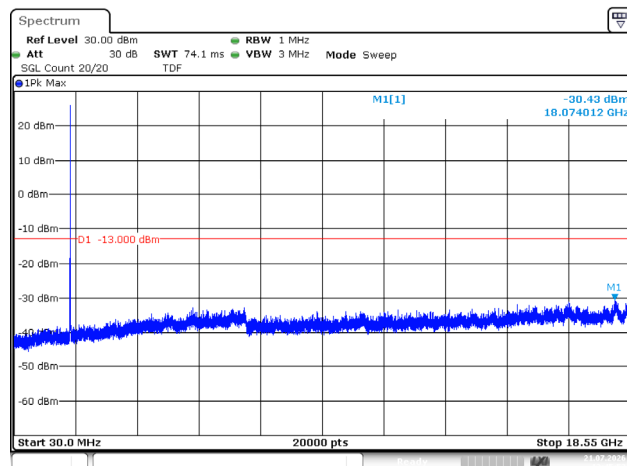


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:45:53

10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

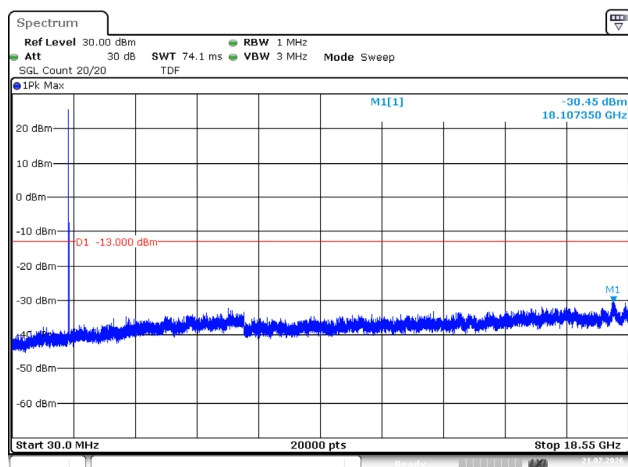


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:47:41

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

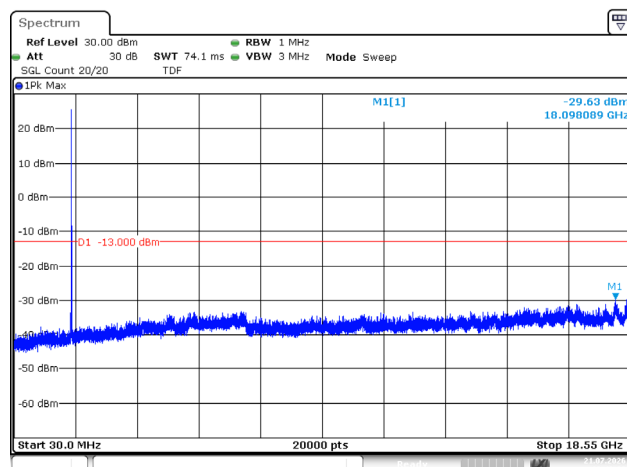


ProjectNo.: 2607V37545E-RF Tester:Braylon Ma
Date: 21.JUL.2026 13:49:28

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

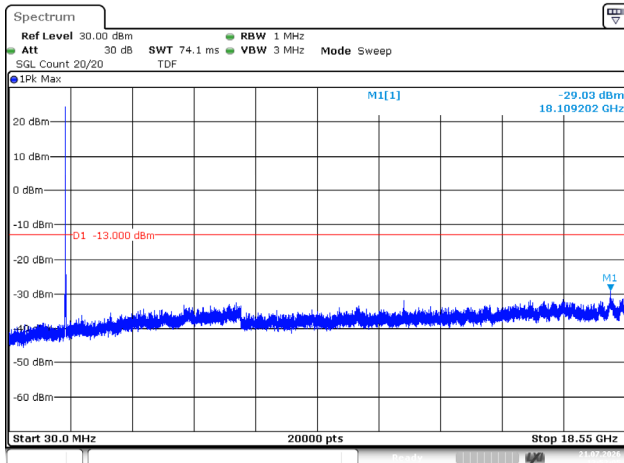


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:52:05

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

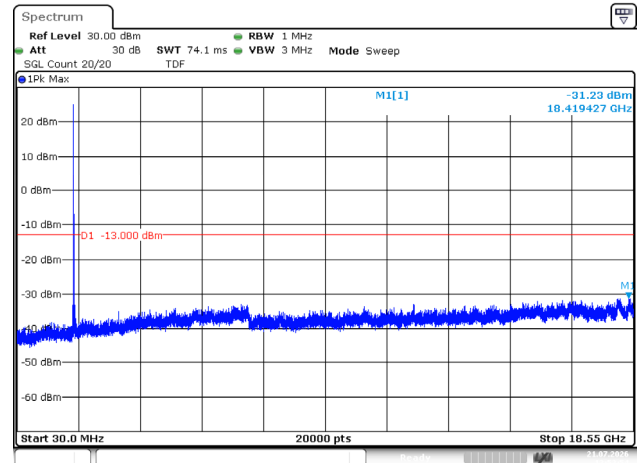


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:53:53

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

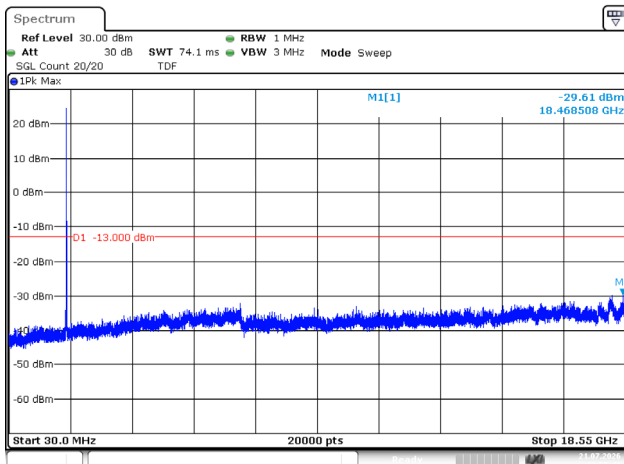


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:55:40

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

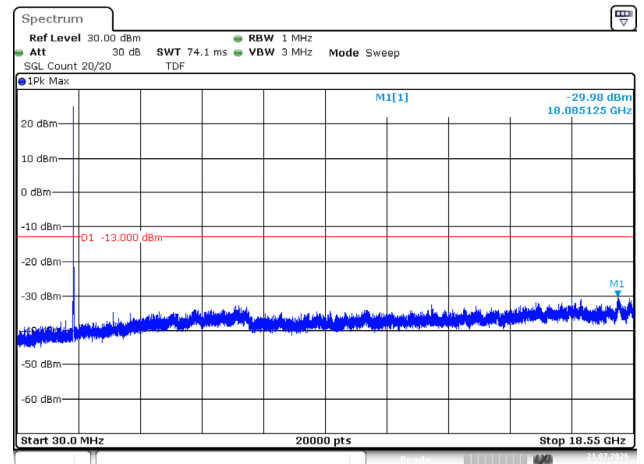


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 13:58:43

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

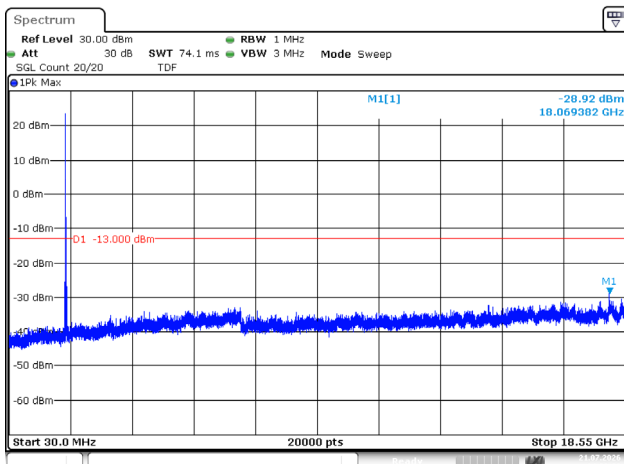

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:00:31


20MHz_High_QPSK_1@0(30MHz~18.55GHz)

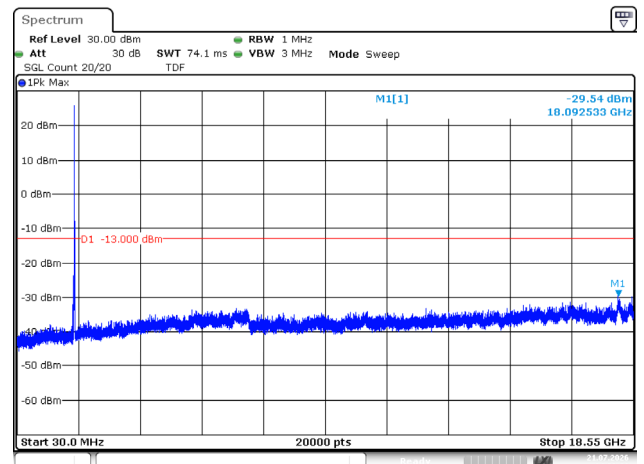

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:02:20


Band 7, Normal**1RB was the worst case**

5MHz_Low_QPSK_1@0(30MHz~1GHz)

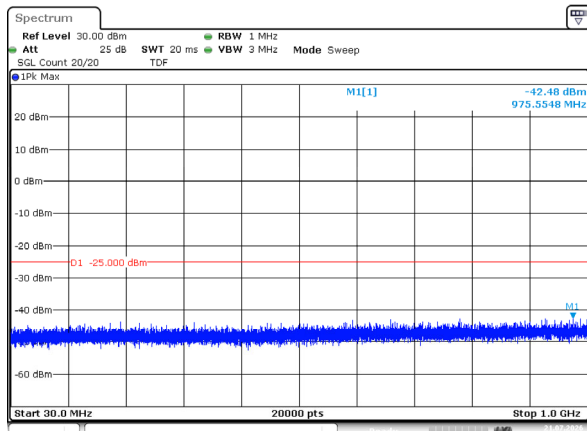


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:48:58

5MHz_Low_QPSK_1@0(1GHz~15GHz)

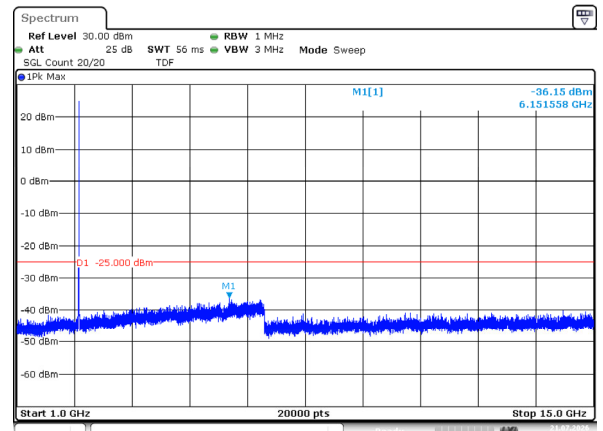


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:49:11

5MHz_Low_QPSK_1@0(15GHz~25.025GHz)

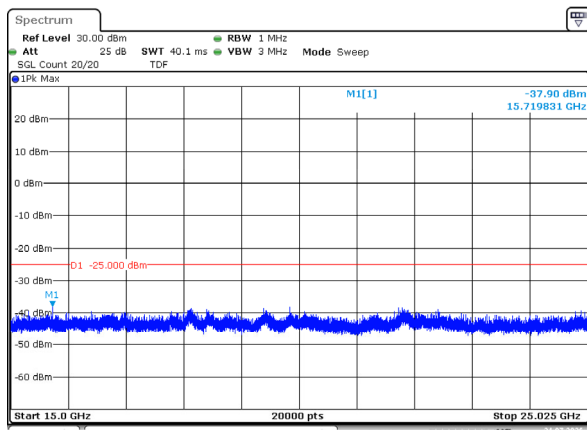


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:49:24

5MHz_Middle_QPSK_1@0(30MHz~1GHz)

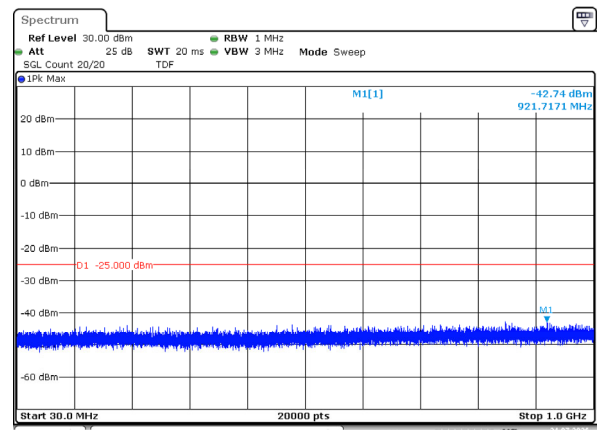


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:50:35

5MHz_Middle_QPSK_1@0(1GHz~15GHz)

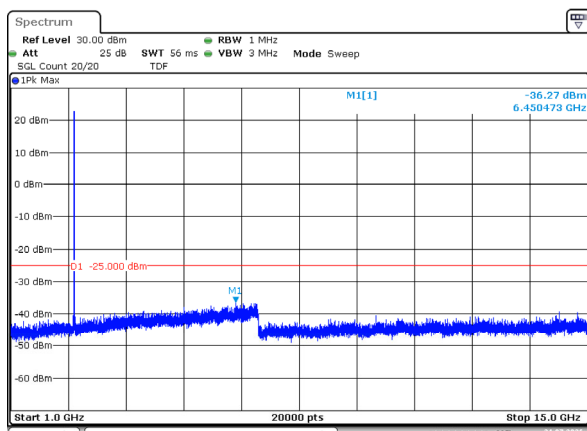


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:50:49

5MHz_Middle_QPSK_1@0(15GHz~25.35GHz)

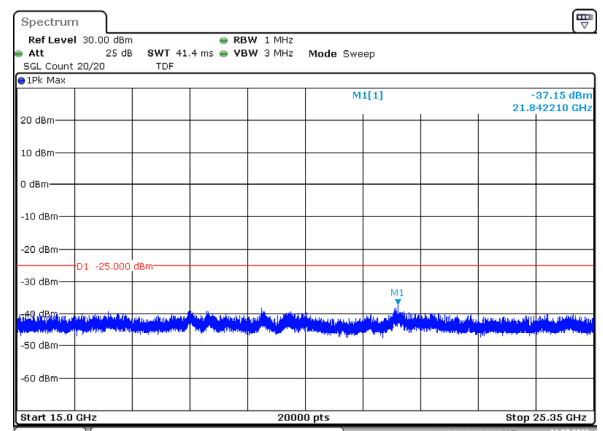


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:51:01

5MHz_High_QPSK_1@0(30MHz~1GHz)

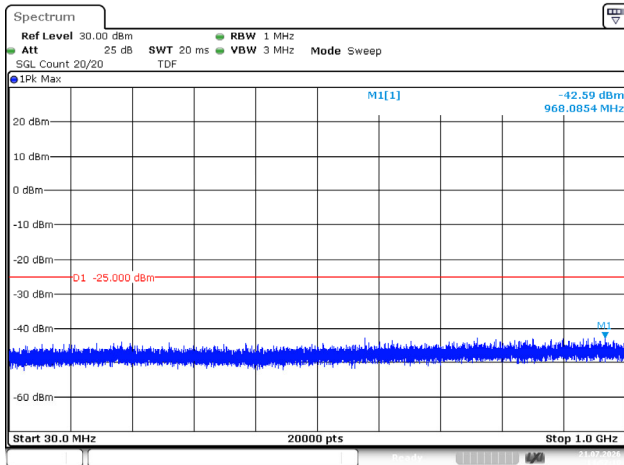


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:52:10

5MHz_High_QPSK_1@0(1GHz~15GHz)

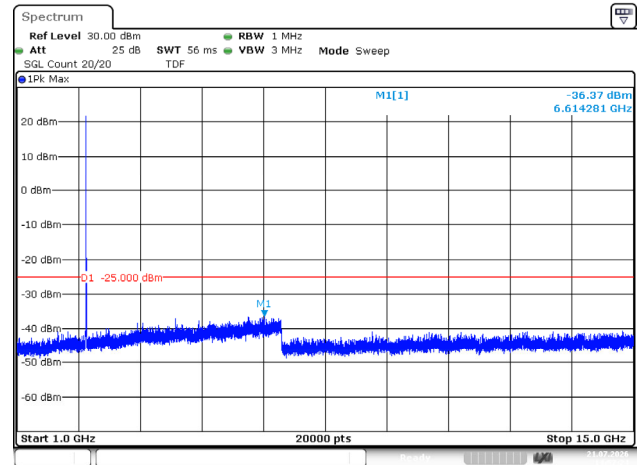


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:52:23

5MHz_High_QPSK_1@0(15GHz~25.675GHz)

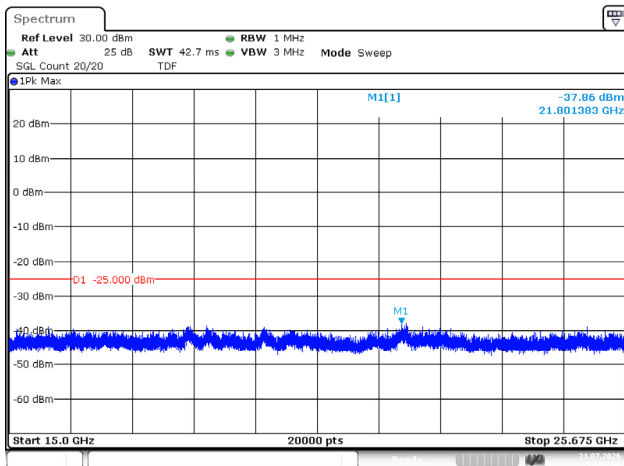


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:52:36

10MHz_Low_QPSK_1@0(30MHz~1GHz)

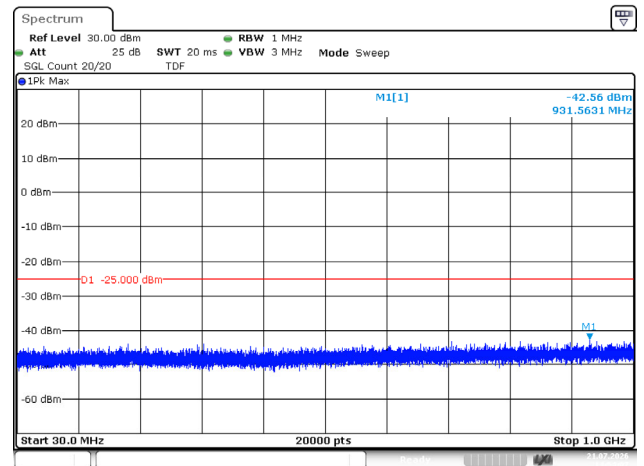


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:54:06

10MHz_Low_QPSK_1@0(1GHz~15GHz)

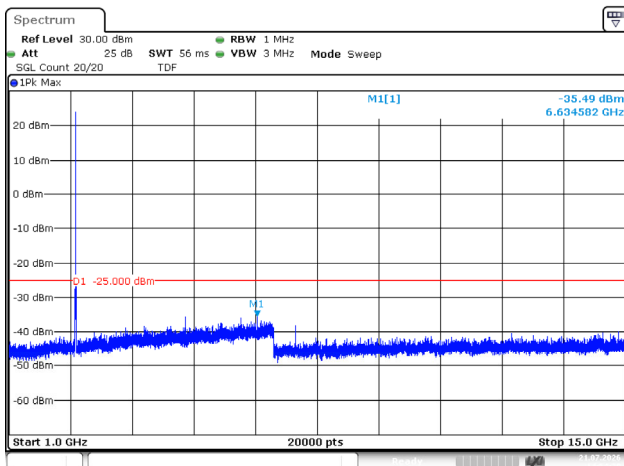


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:54:20

10MHz_Low_QPSK_1@0(15GHz~25.05GHz)

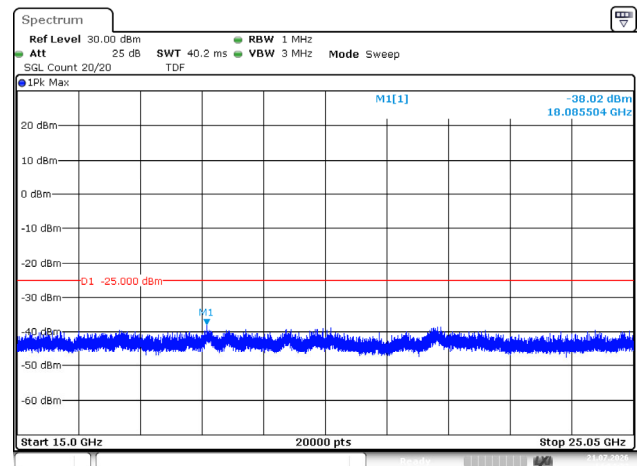


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:54:32

10MHz_Middle_QPSK_1@0(30MHz~1GHz)

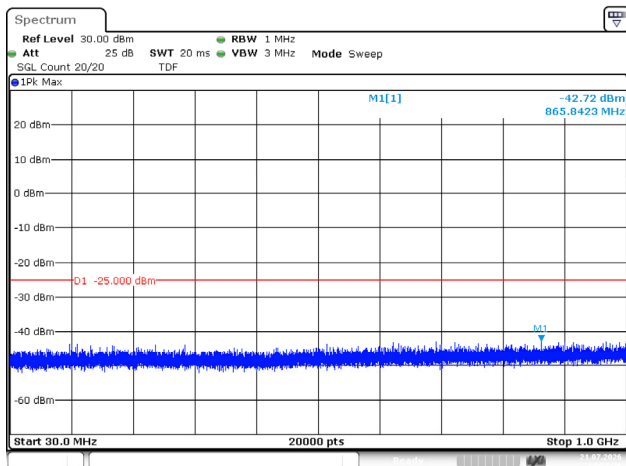


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:57:26

10MHz_Middle_QPSK_1@0(1GHz~15GHz)

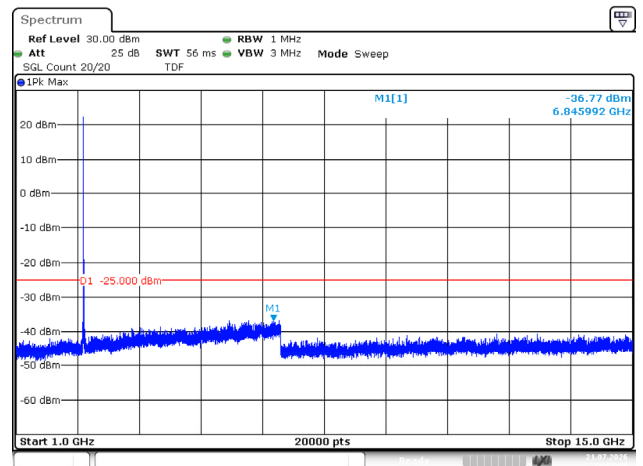


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:57:40

10MHz_Middle_QPSK_1@0(15GHz~25.35GHz)

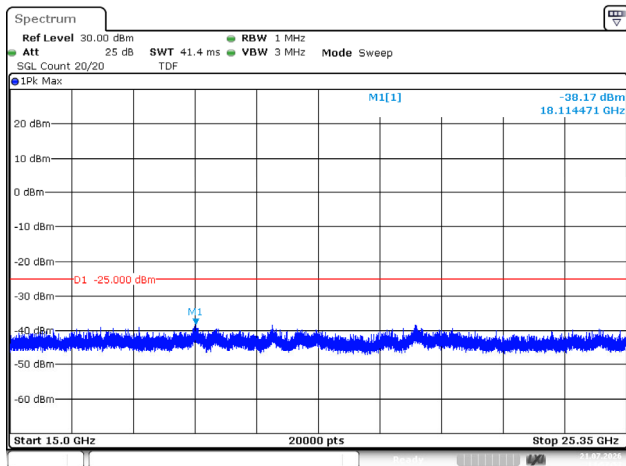


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 14:57:53

10MHz_High_QPSK_1@0(30MHz~1GHz)

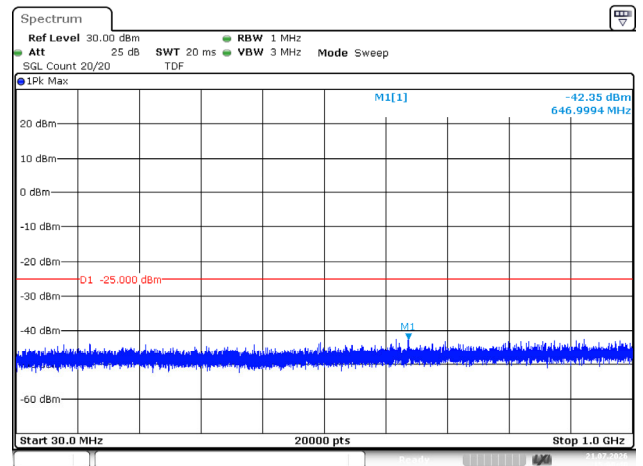


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:00:40

10MHz_High_QPSK_1@0(1GHz~15GHz)

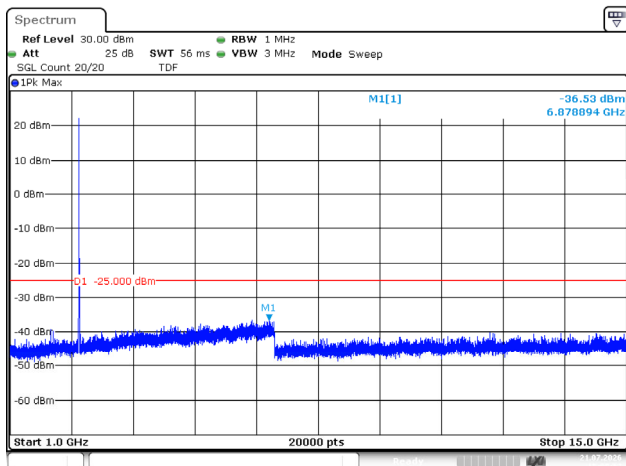


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:00:53

10MHz_High_QPSK_1@0(15GHz~25.65GHz)

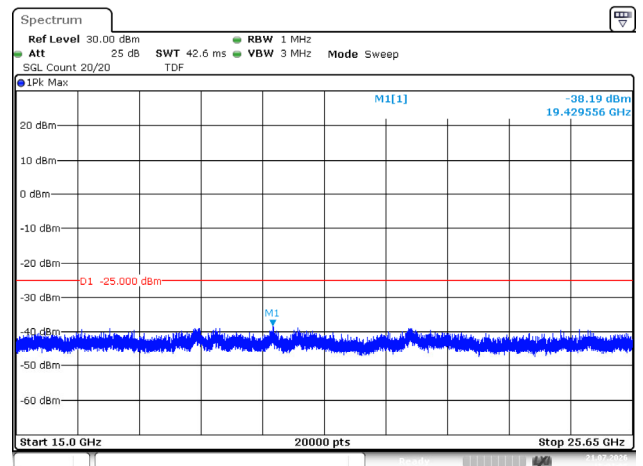


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:01:05

15MHz_Low_QPSK_1@0(30MHz~1GHz)

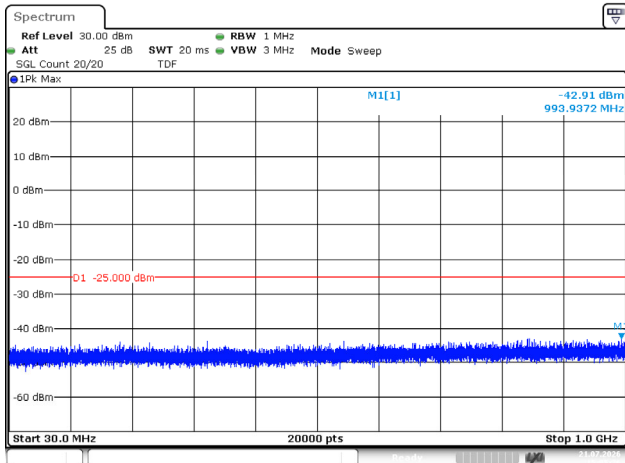


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:05:27

15MHz_Low_QPSK_1@0(1GHz~15GHz)

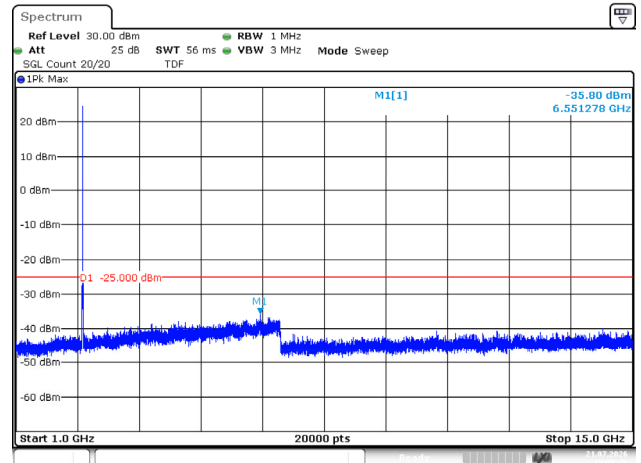


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:05:40

15MHz_Low_QPSK_1@0(15GHz~25.075GHz)

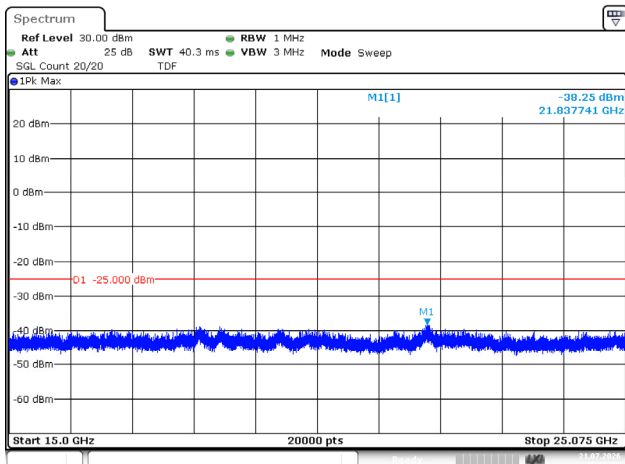


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:05:52

15MHz_Middle_QPSK_1@0(30MHz~1GHz)

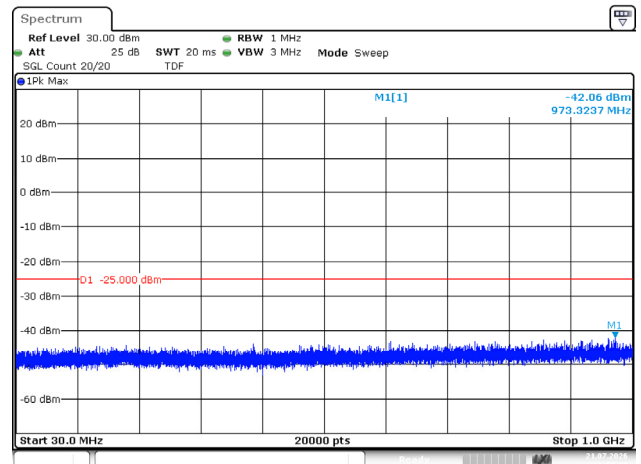


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:06:40

15MHz_Middle_QPSK_1@0(1GHz~15GHz)

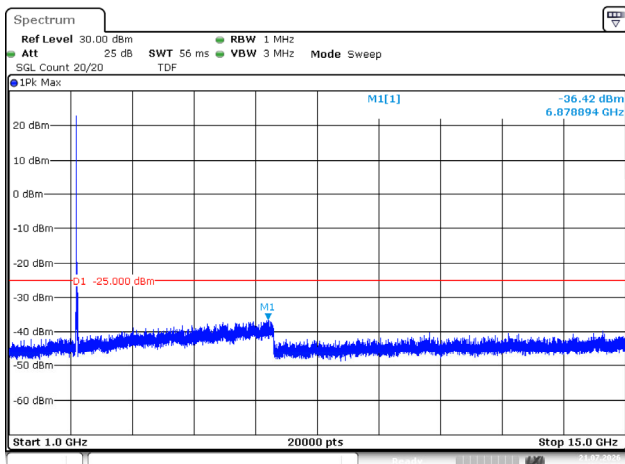


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:08:54

15MHz_Middle_QPSK_1@0(15GHz~25.35GHz)

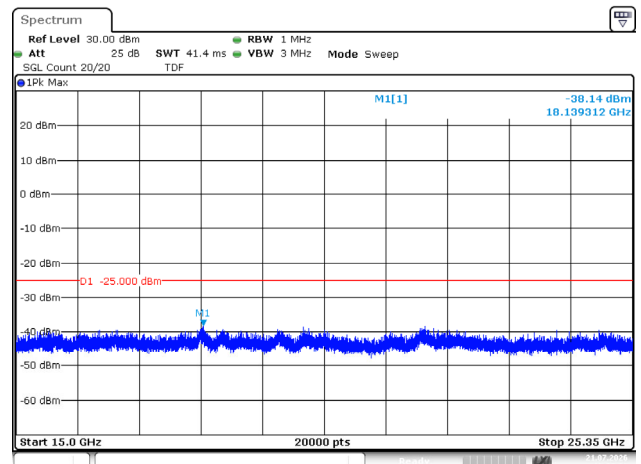


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:09:06

15MHz_High_QPSK_1@0(30MHz~1GHz)

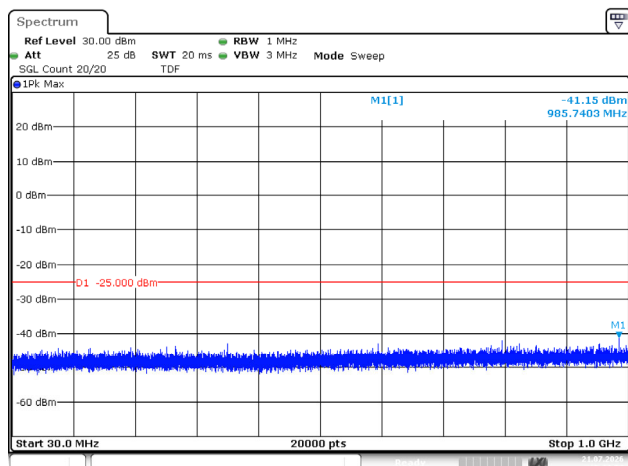


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:11:52

15MHz_High_QPSK_1@0(1GHz~15GHz)

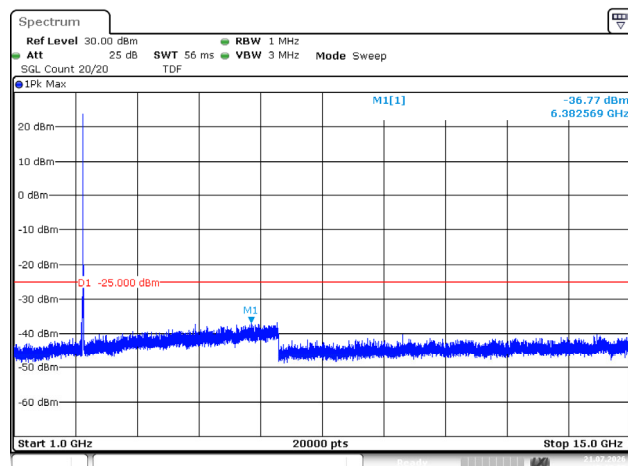


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:12:05

15MHz_High_QPSK_1@0(15GHz~25.625GHz)

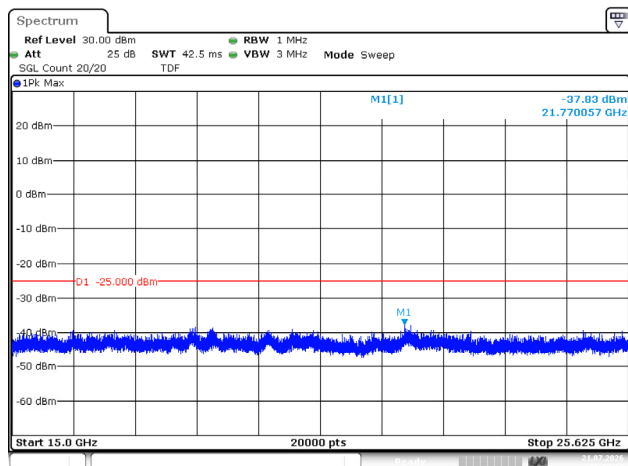


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:12:18

20MHz_Low_QPSK_1@0(30MHz~1GHz)

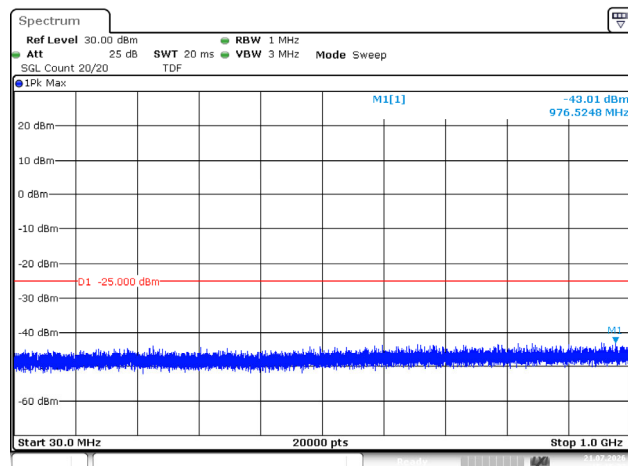


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:15:23

20MHz_Low_QPSK_1@0(1GHz~15GHz)

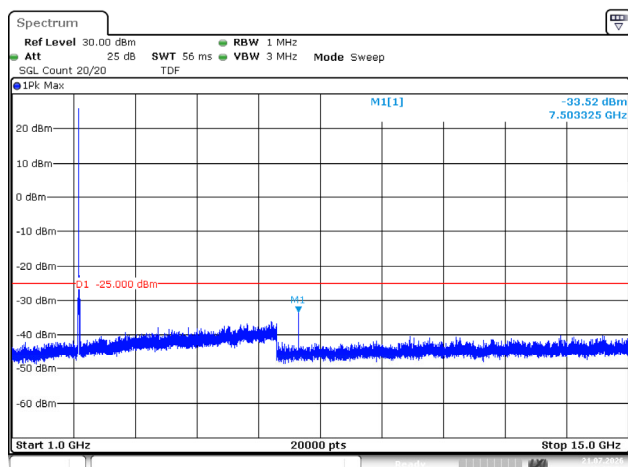


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:15:36

20MHz_Low_QPSK_1@0(15GHz~25.1GHz)

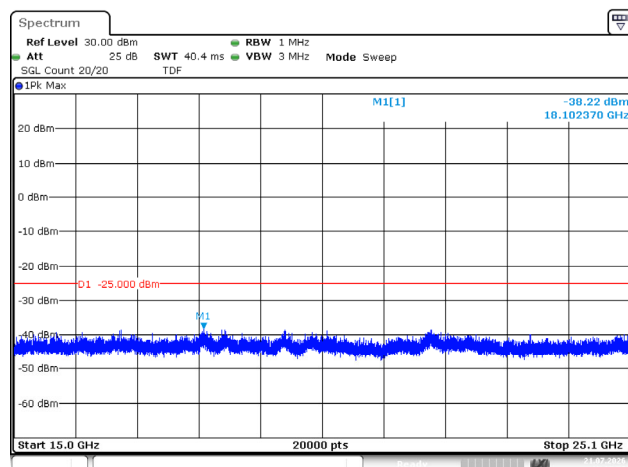


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:15:49

20MHz_Middle_QPSK_1@0(30MHz~1GHz)

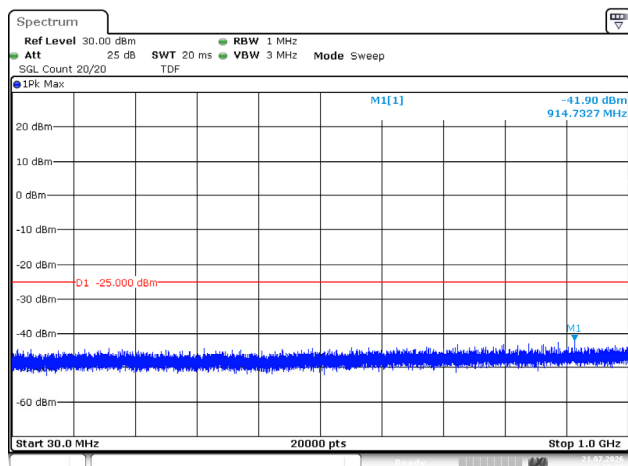


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:18:35

20MHz_Middle_QPSK_1@0(1GHz~15GHz)

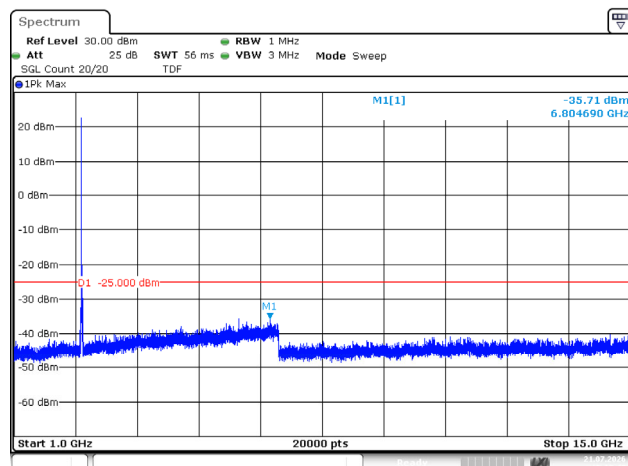


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:18:49

20MHz_Middle_QPSK_1@0(15GHz~25.35GHz)

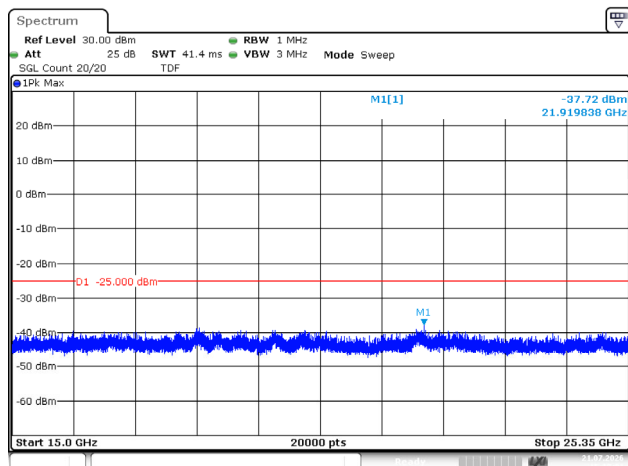


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:19:02

20MHz_High_QPSK_1@0(30MHz~1GHz)

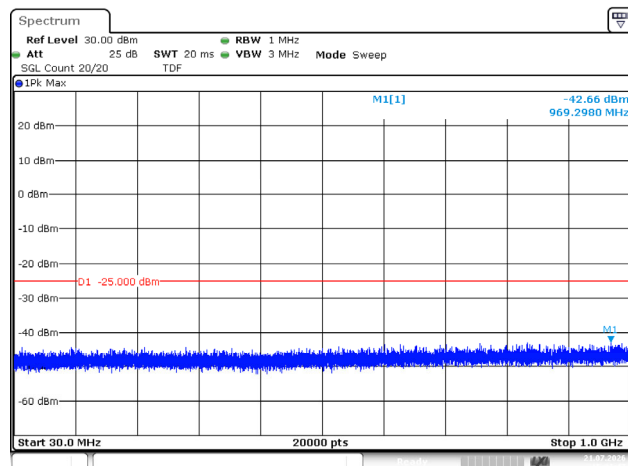


ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:21:47

20MHz_High_QPSK_1@0(1GHz~15GHz)

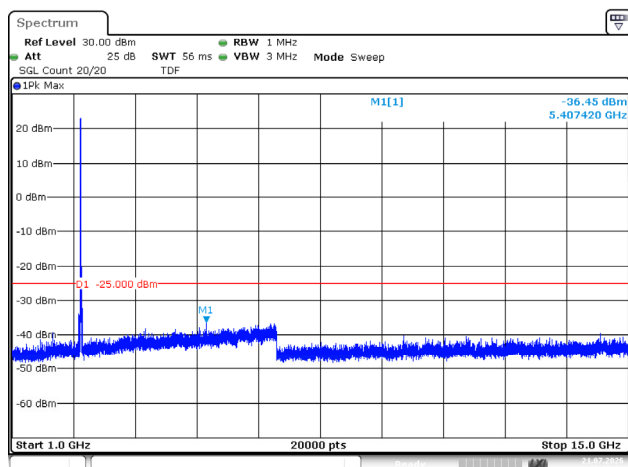

ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:22:00


20MHz_High_QPSK_1@0(15GHz~25.6GHz)

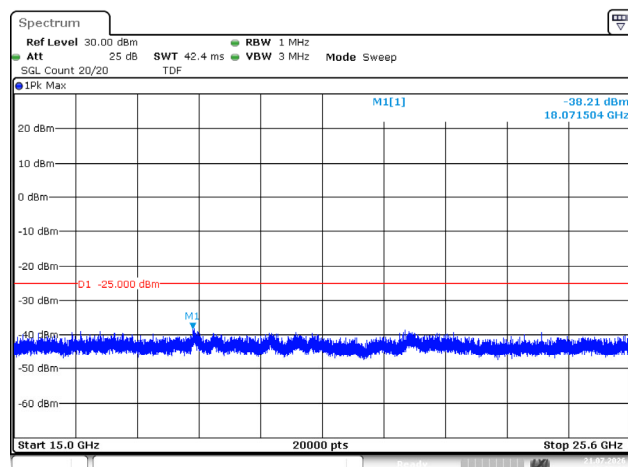

ProjectNo.: 2607V37545E-RF Tester: Baylon Ma
Date: 21.JUL.2026 15:22:13


Band 66, Normal**1RB was the worst case**

1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)

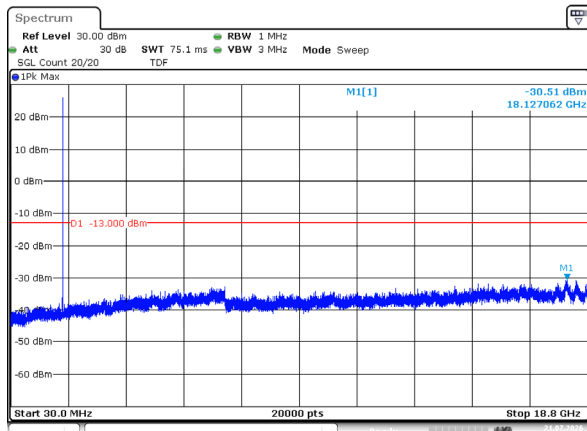


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:19:34

1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

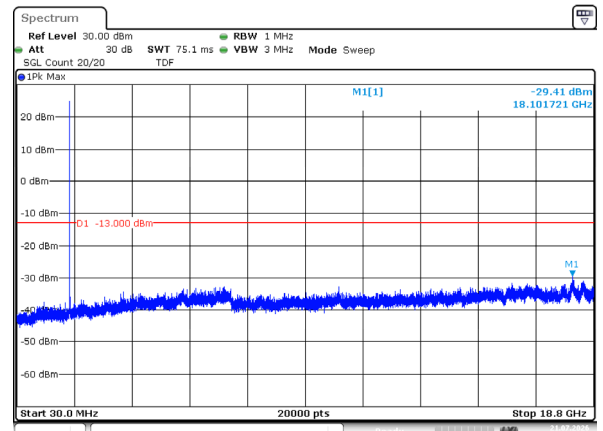


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:20:26

1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)

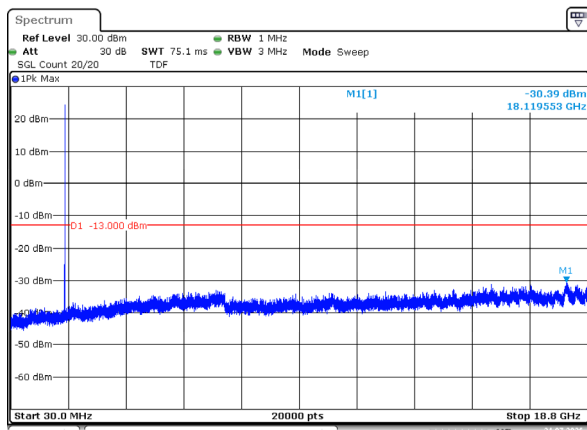


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:21:17

3MHz_Low_QPSK_1@0(30MHz~18.8GHz)

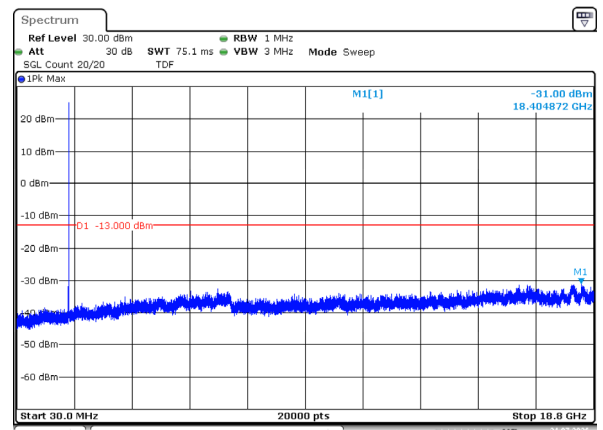


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:22:14

3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

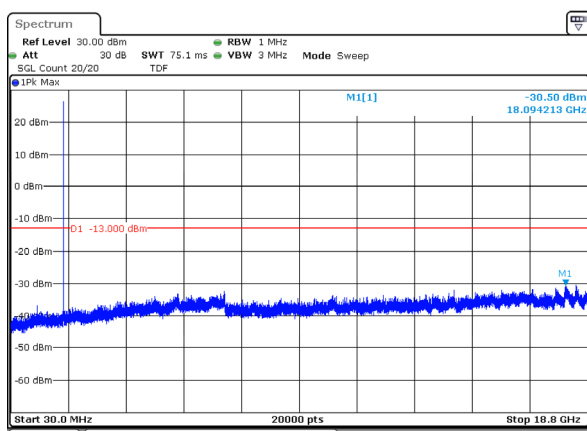


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:23:08

3MHz_High_QPSK_1@0(30MHz~18.8GHz)

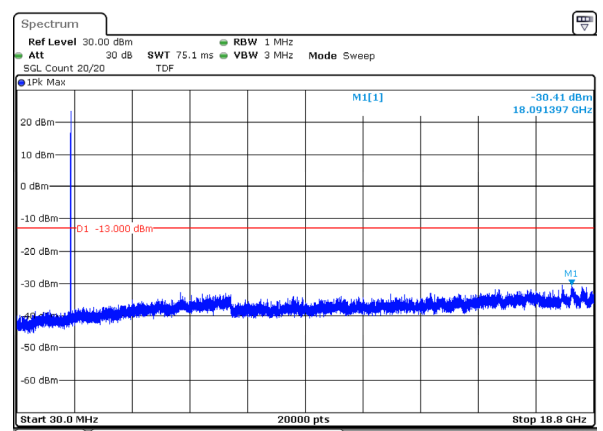


ProjectNo.: 2607V37545E-RF Tester: Breydon Ma
Date: 21.JUL.2026 14:24:01

5MHz_Low_QPSK_1@0(30MHz~18.8GHz)

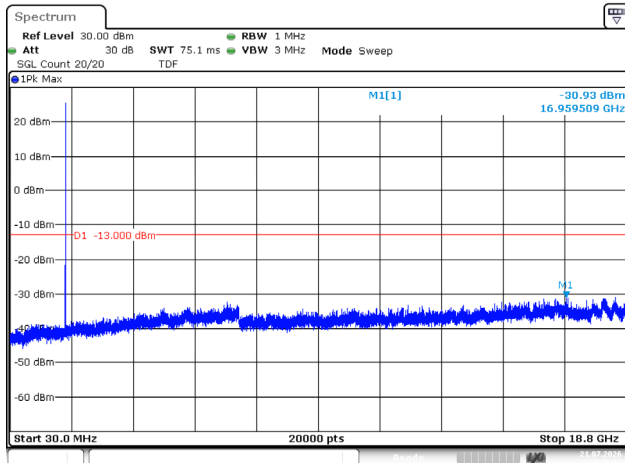


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:25:33

5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

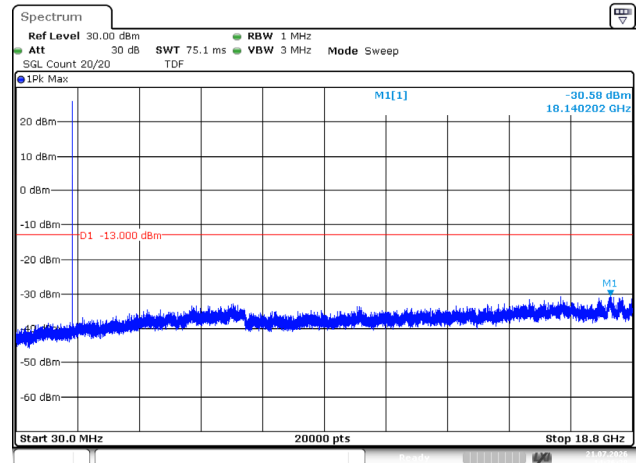


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:26:28

5MHz_High_QPSK_1@0(30MHz~18.8GHz)

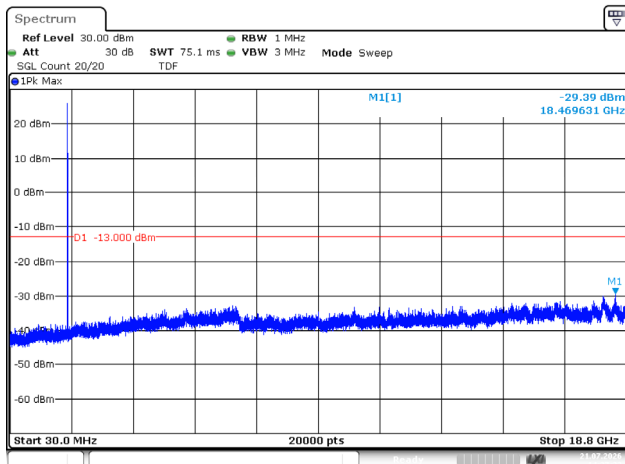


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:27:21

10MHz_Low_QPSK_1@0(30MHz~18.8GHz)

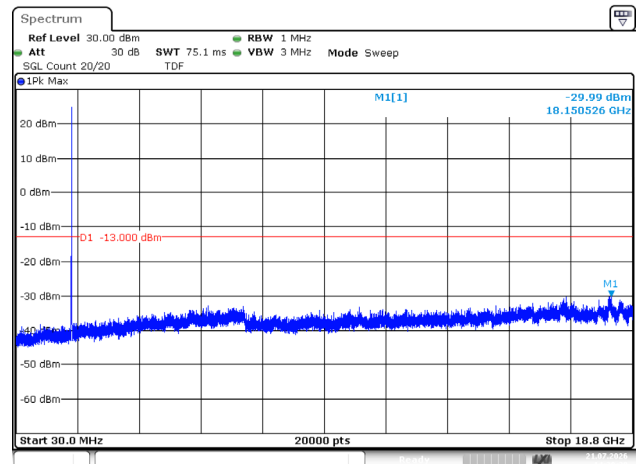


ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:28:19

10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

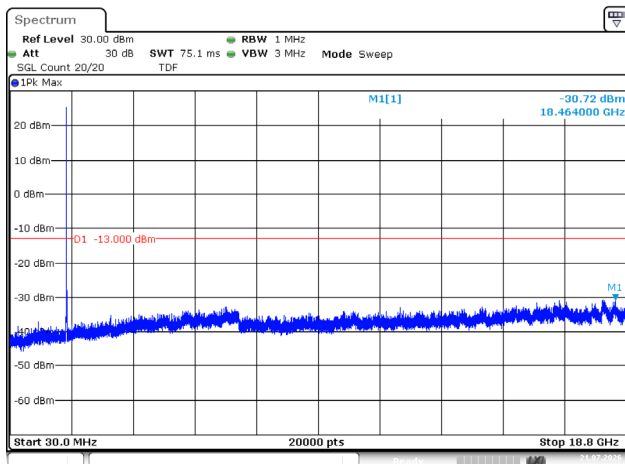

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:30:08

10MHz_High_QPSK_1@0(30MHz~18.8GHz)

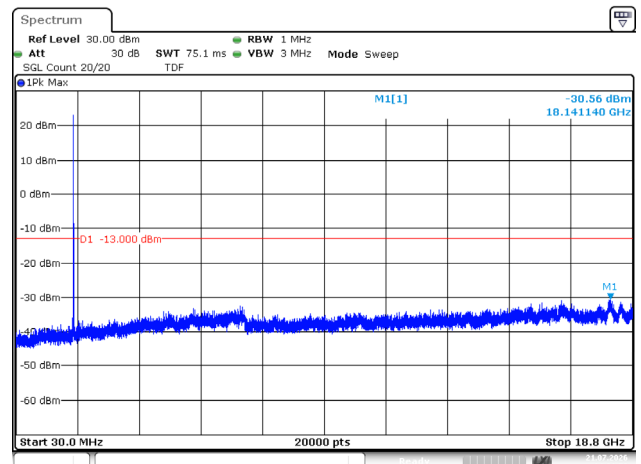

ProjectNo.: 2607V37545E-RF Tester: Braylon Ma
Date: 21.JUL.2026 14:31:55