



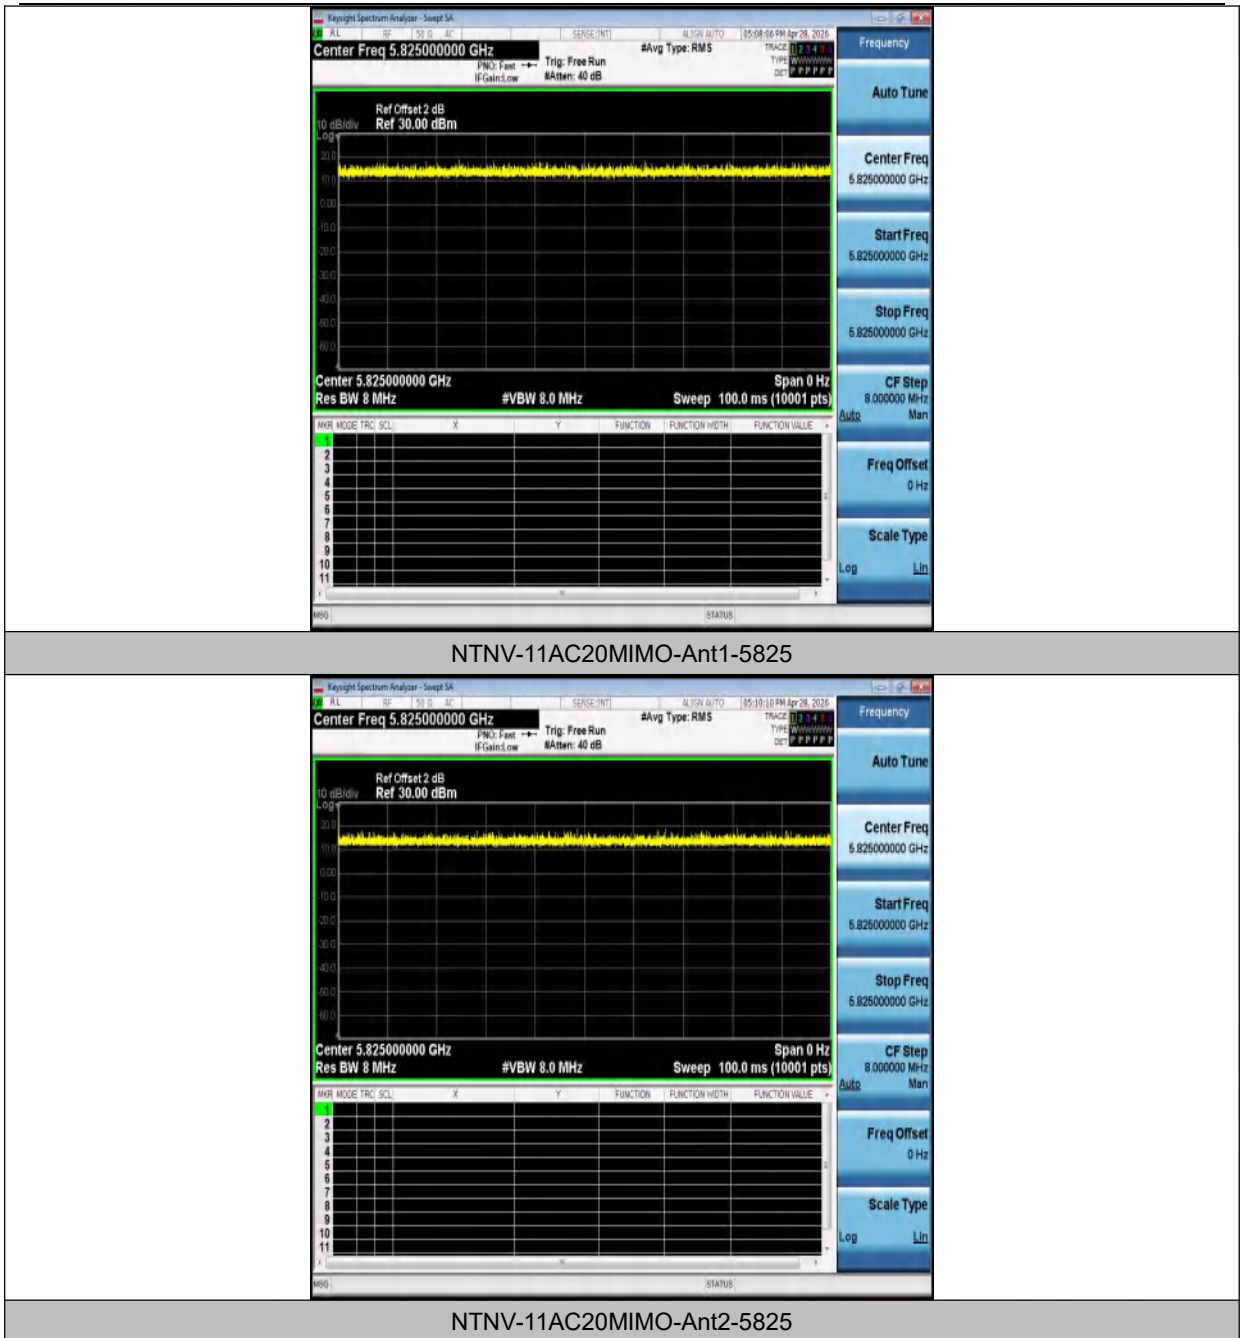

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

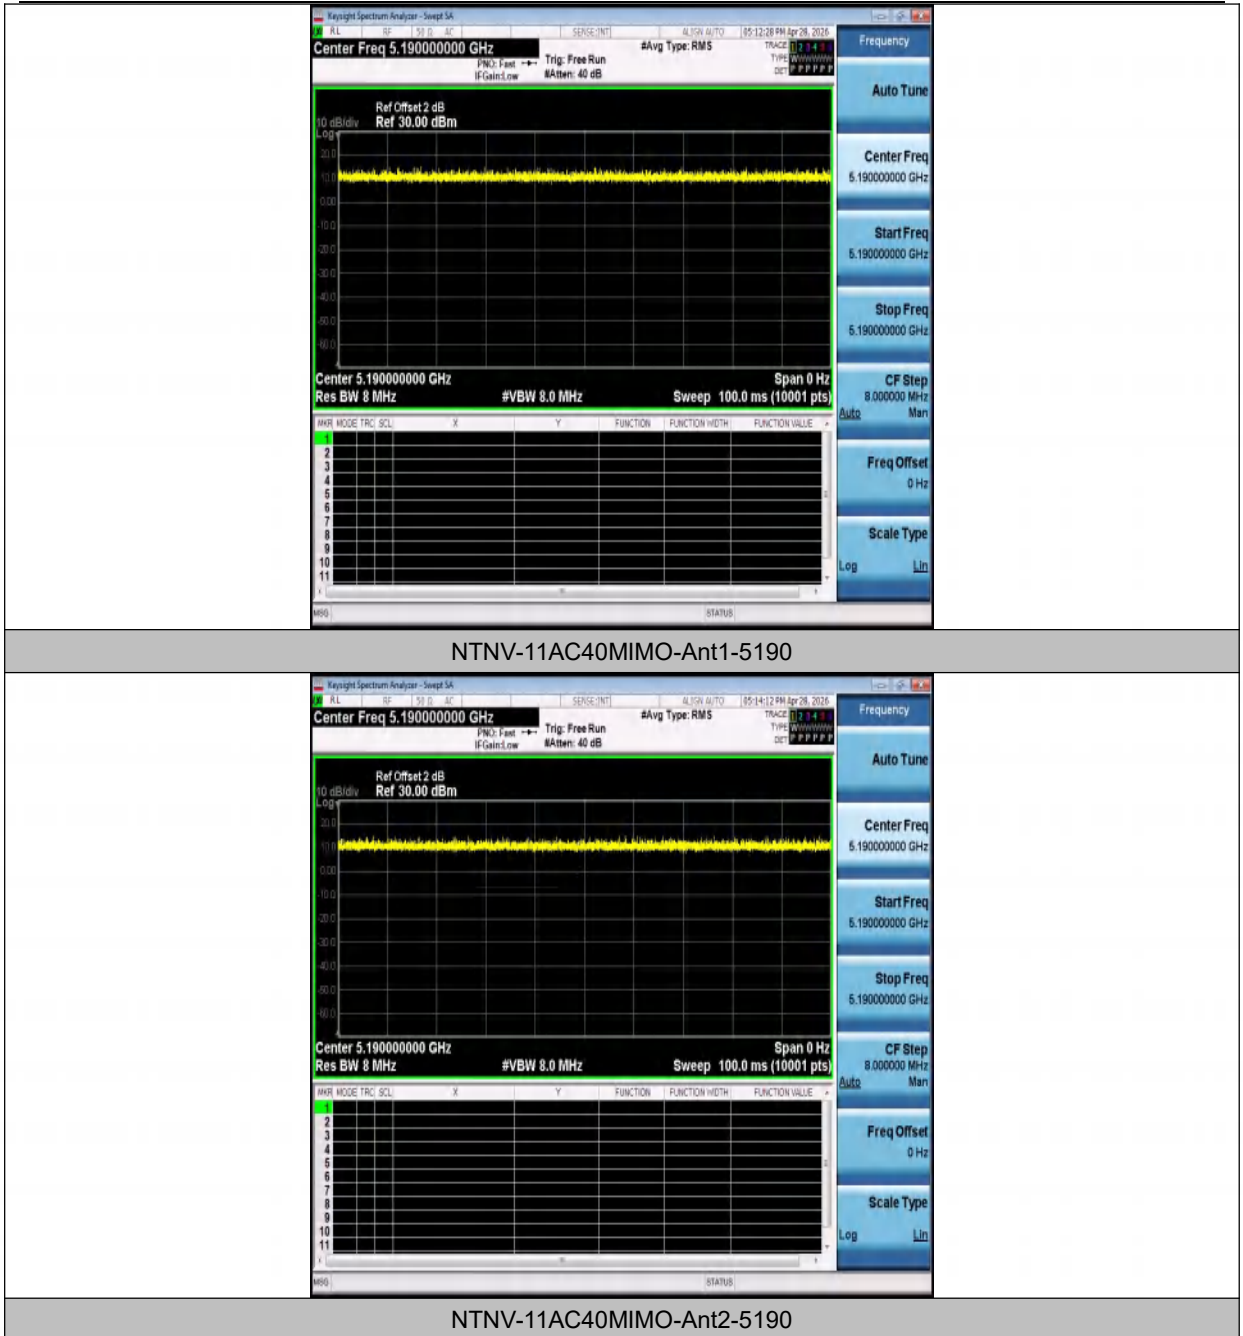

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

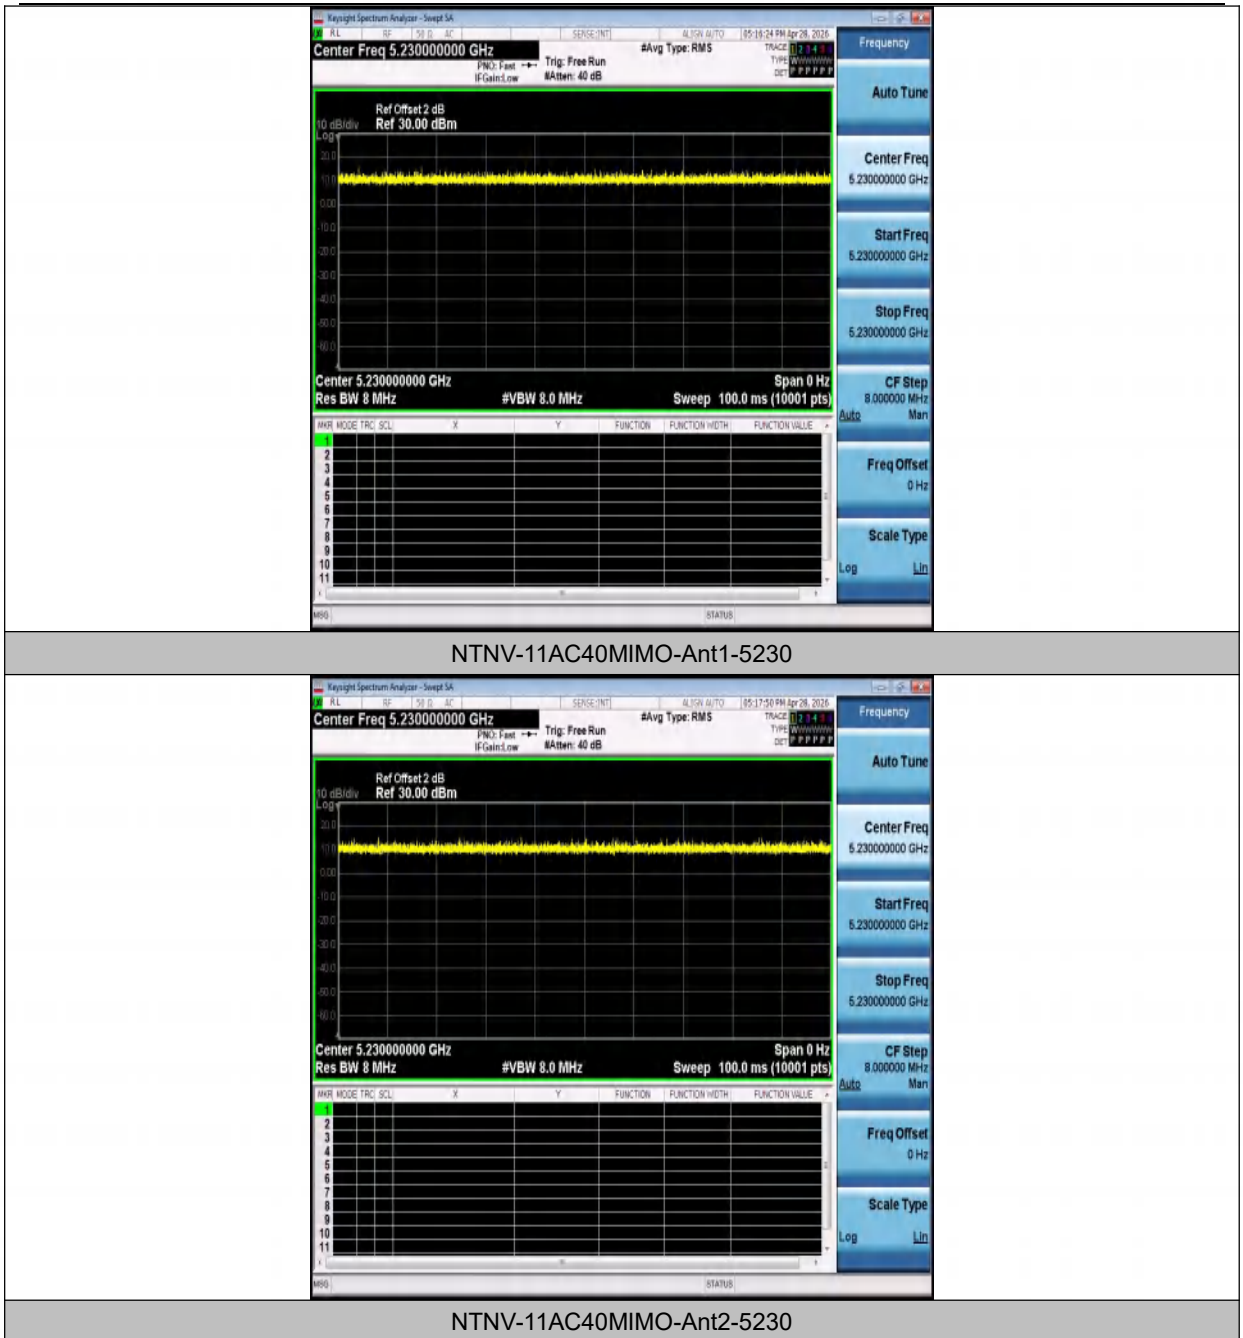

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

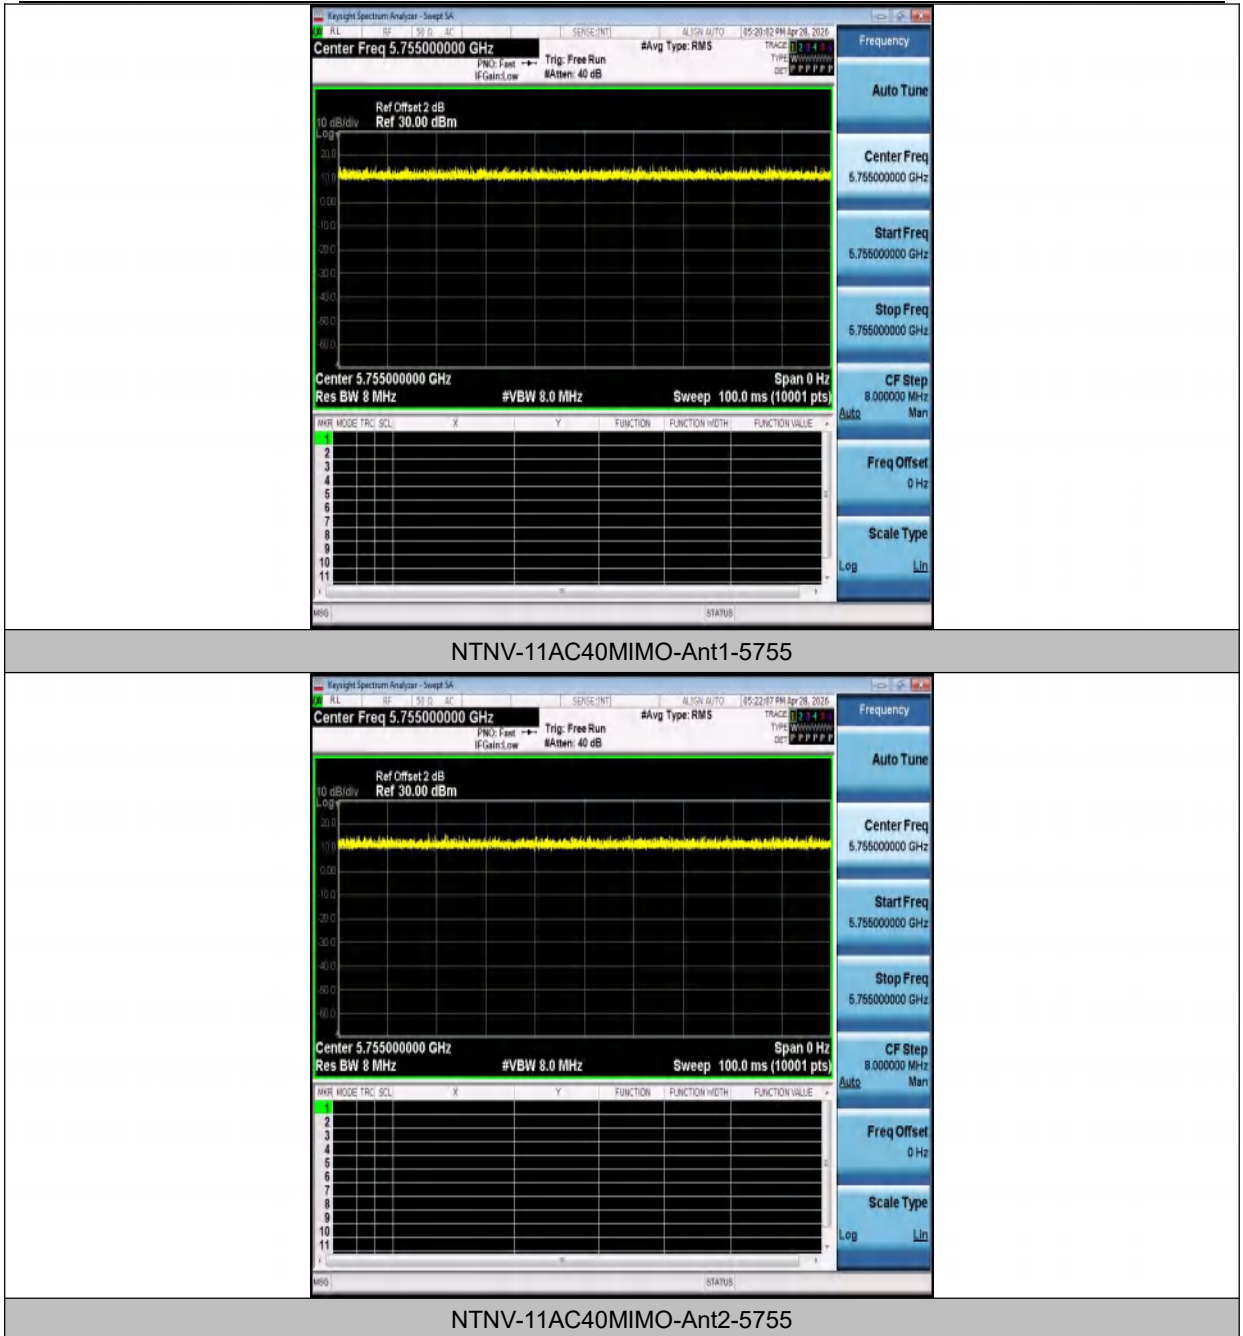

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

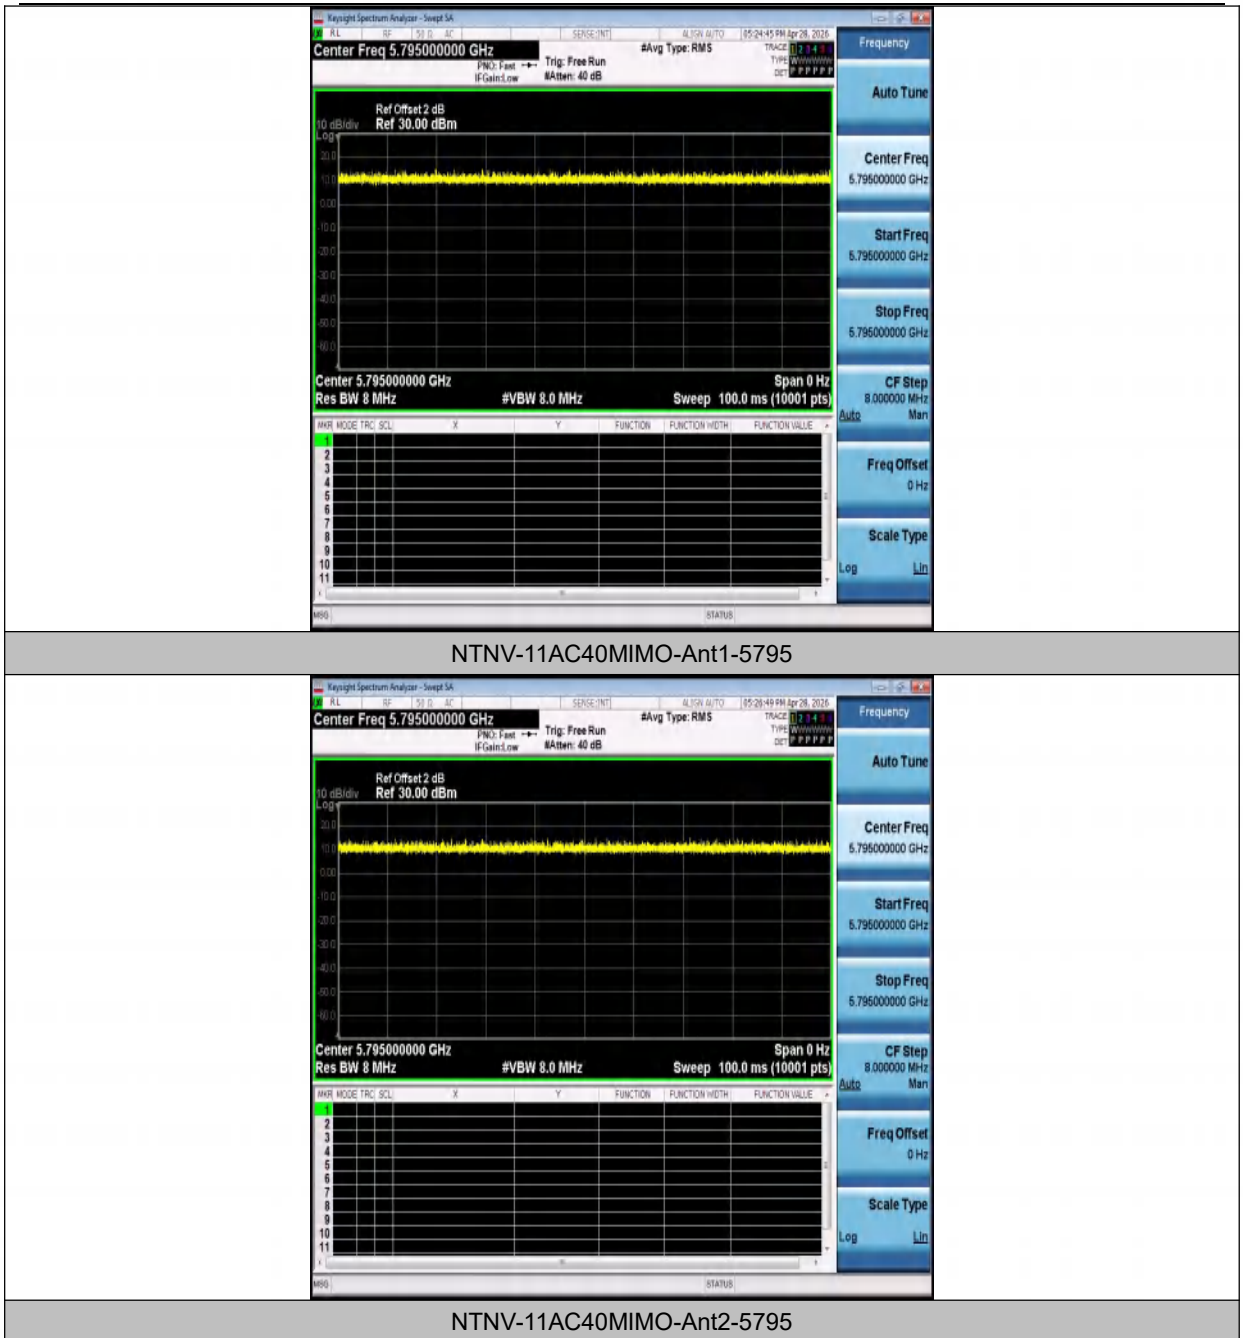

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

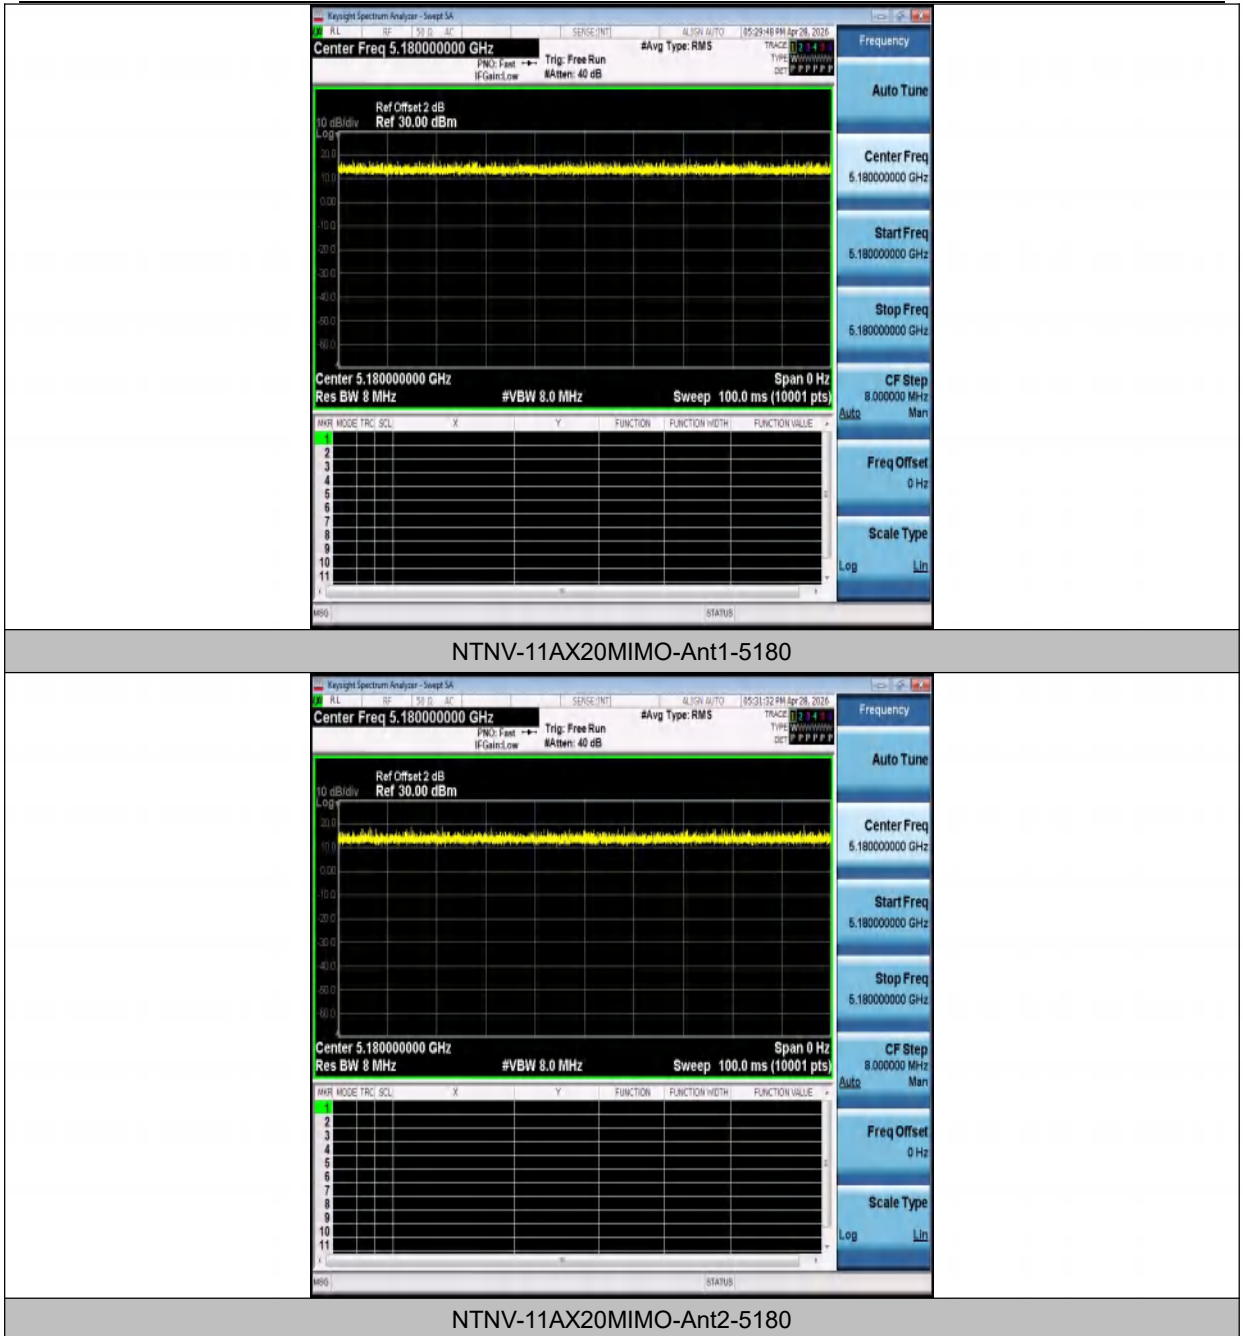

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

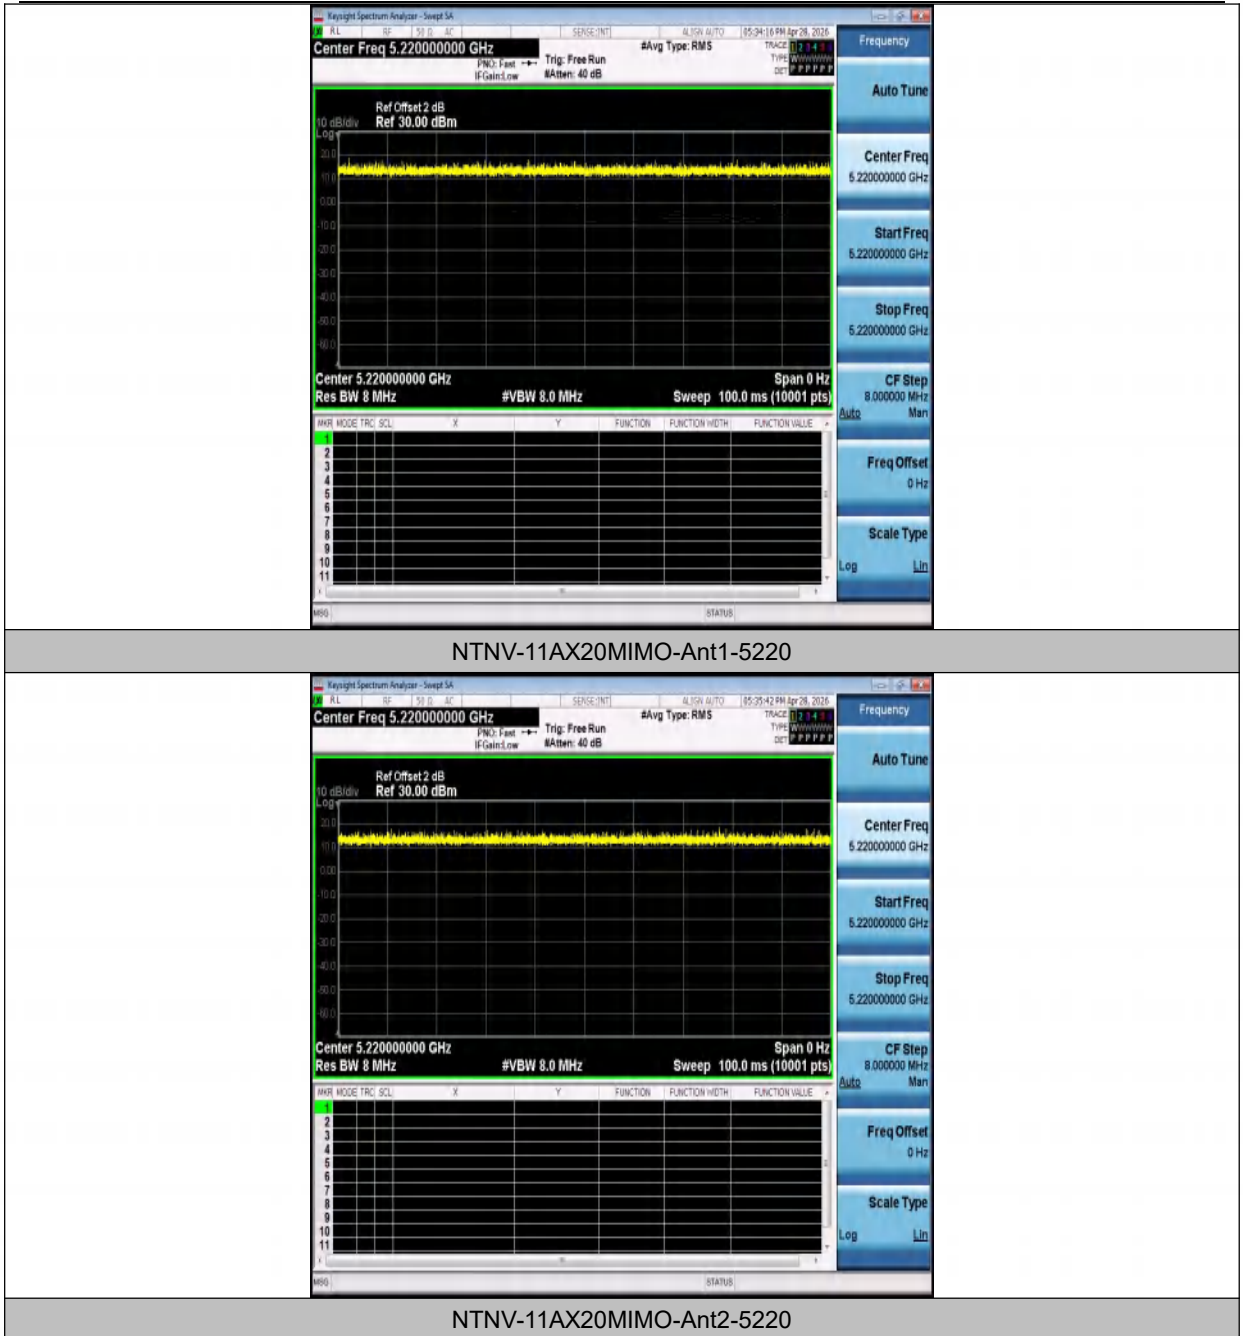

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

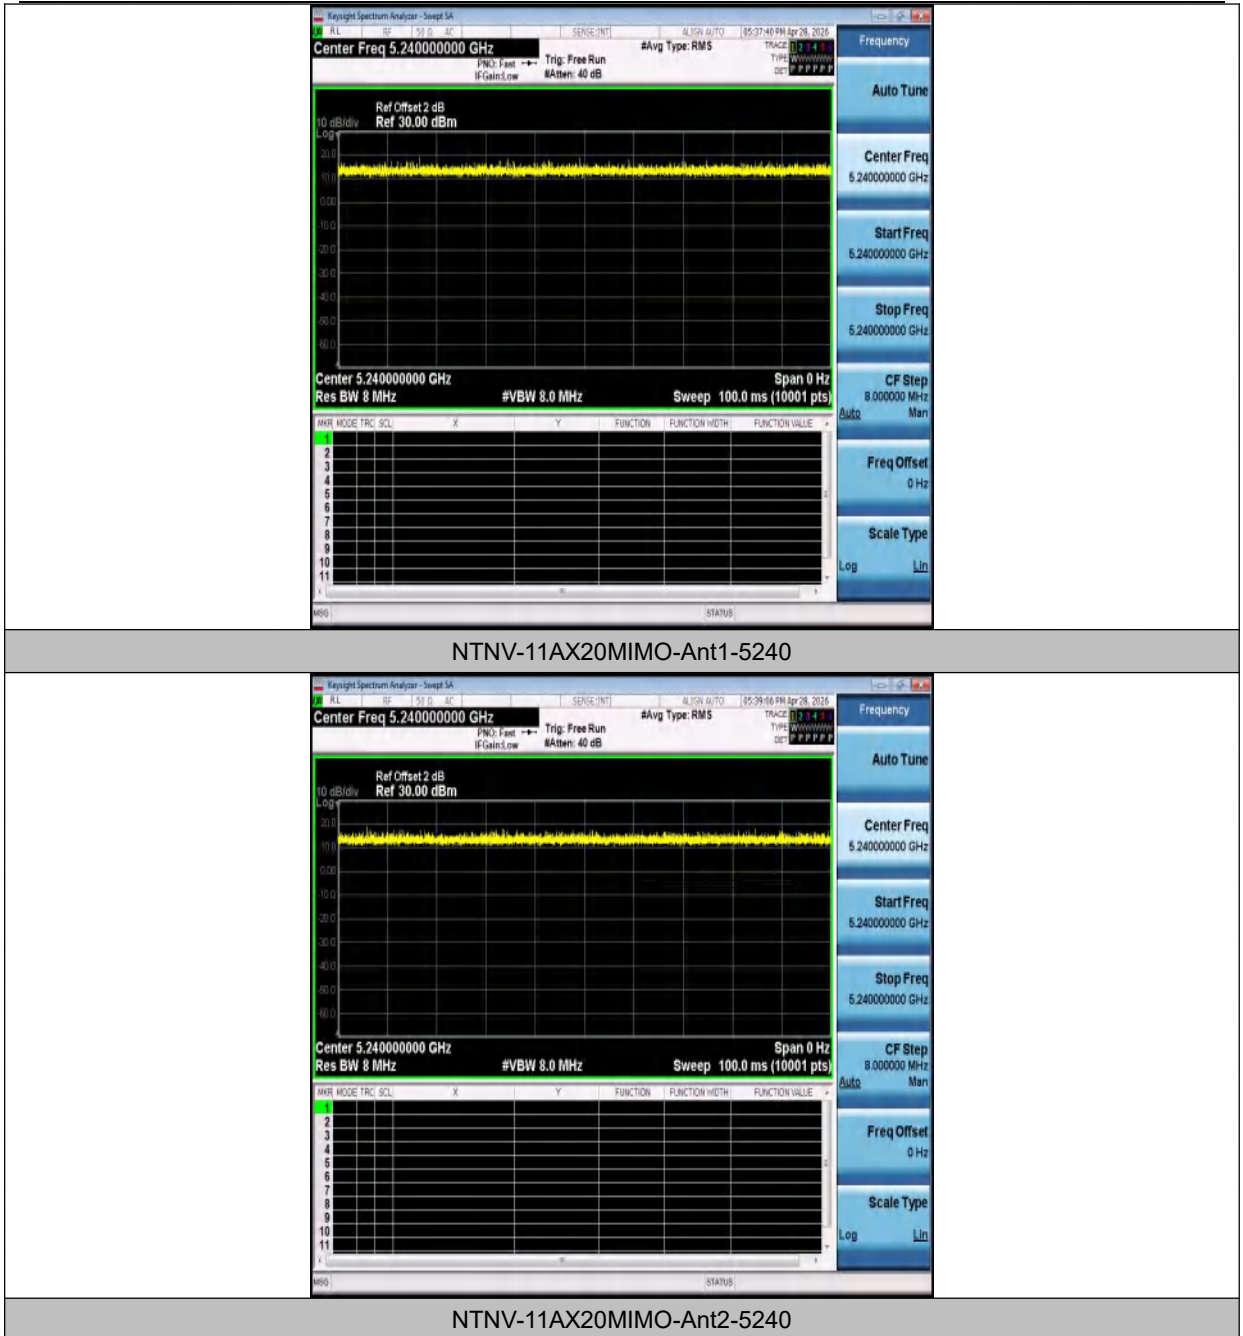

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

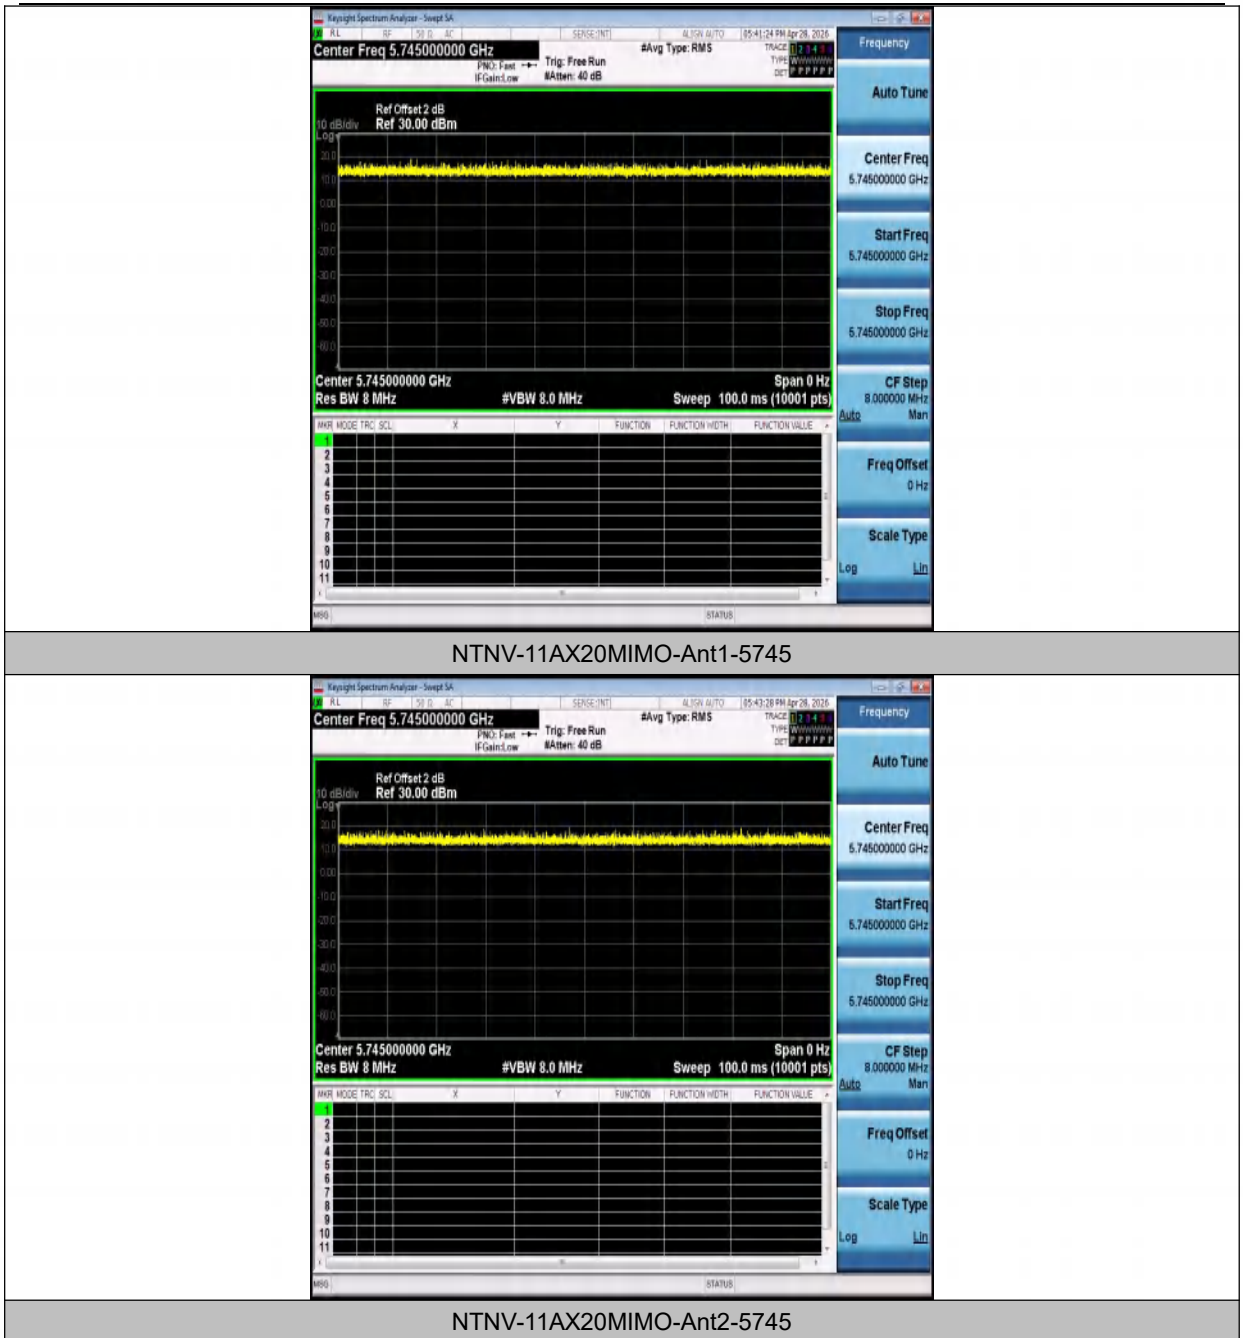

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

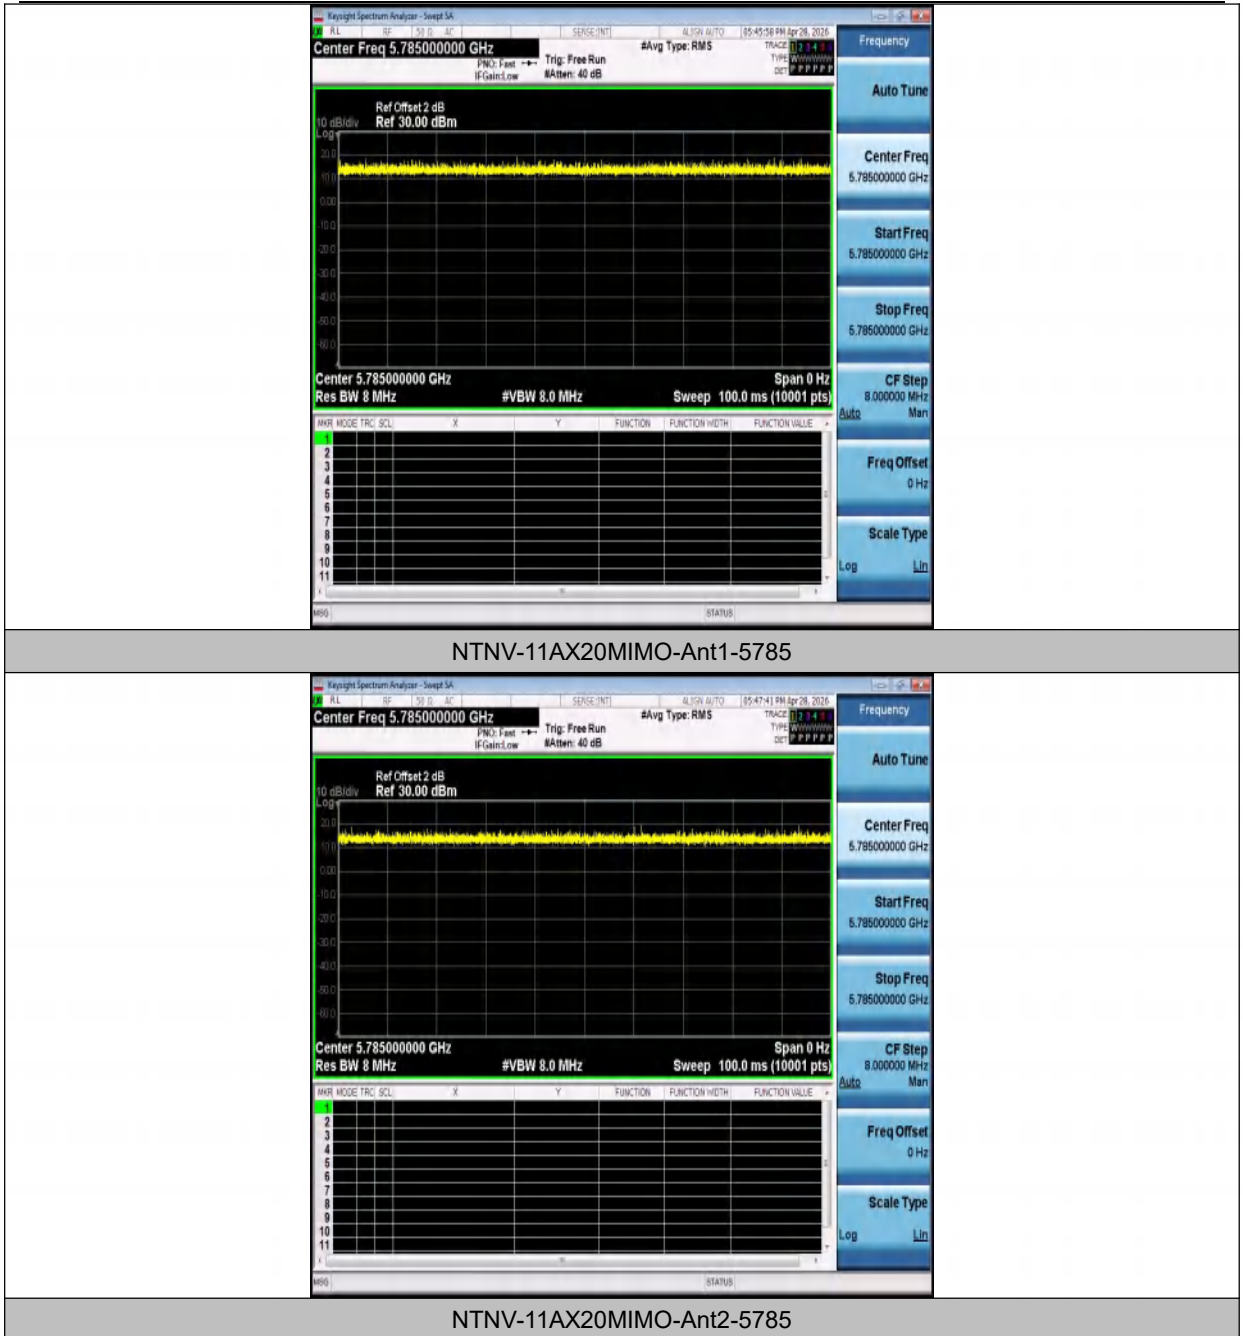

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

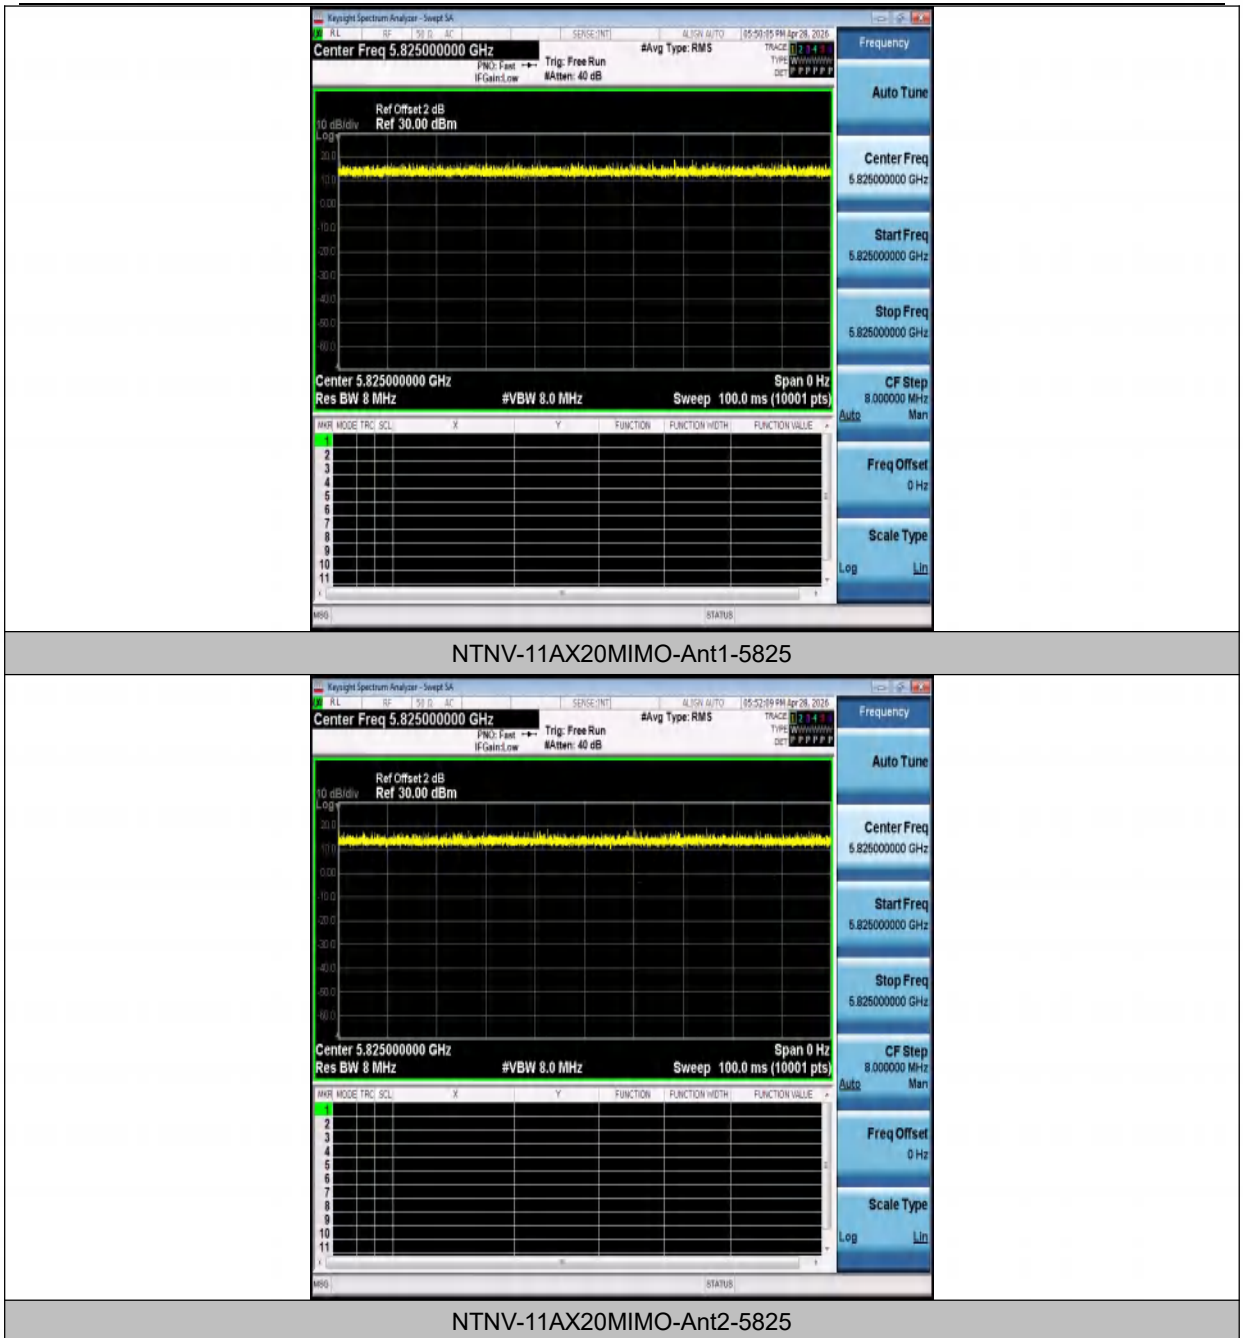

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

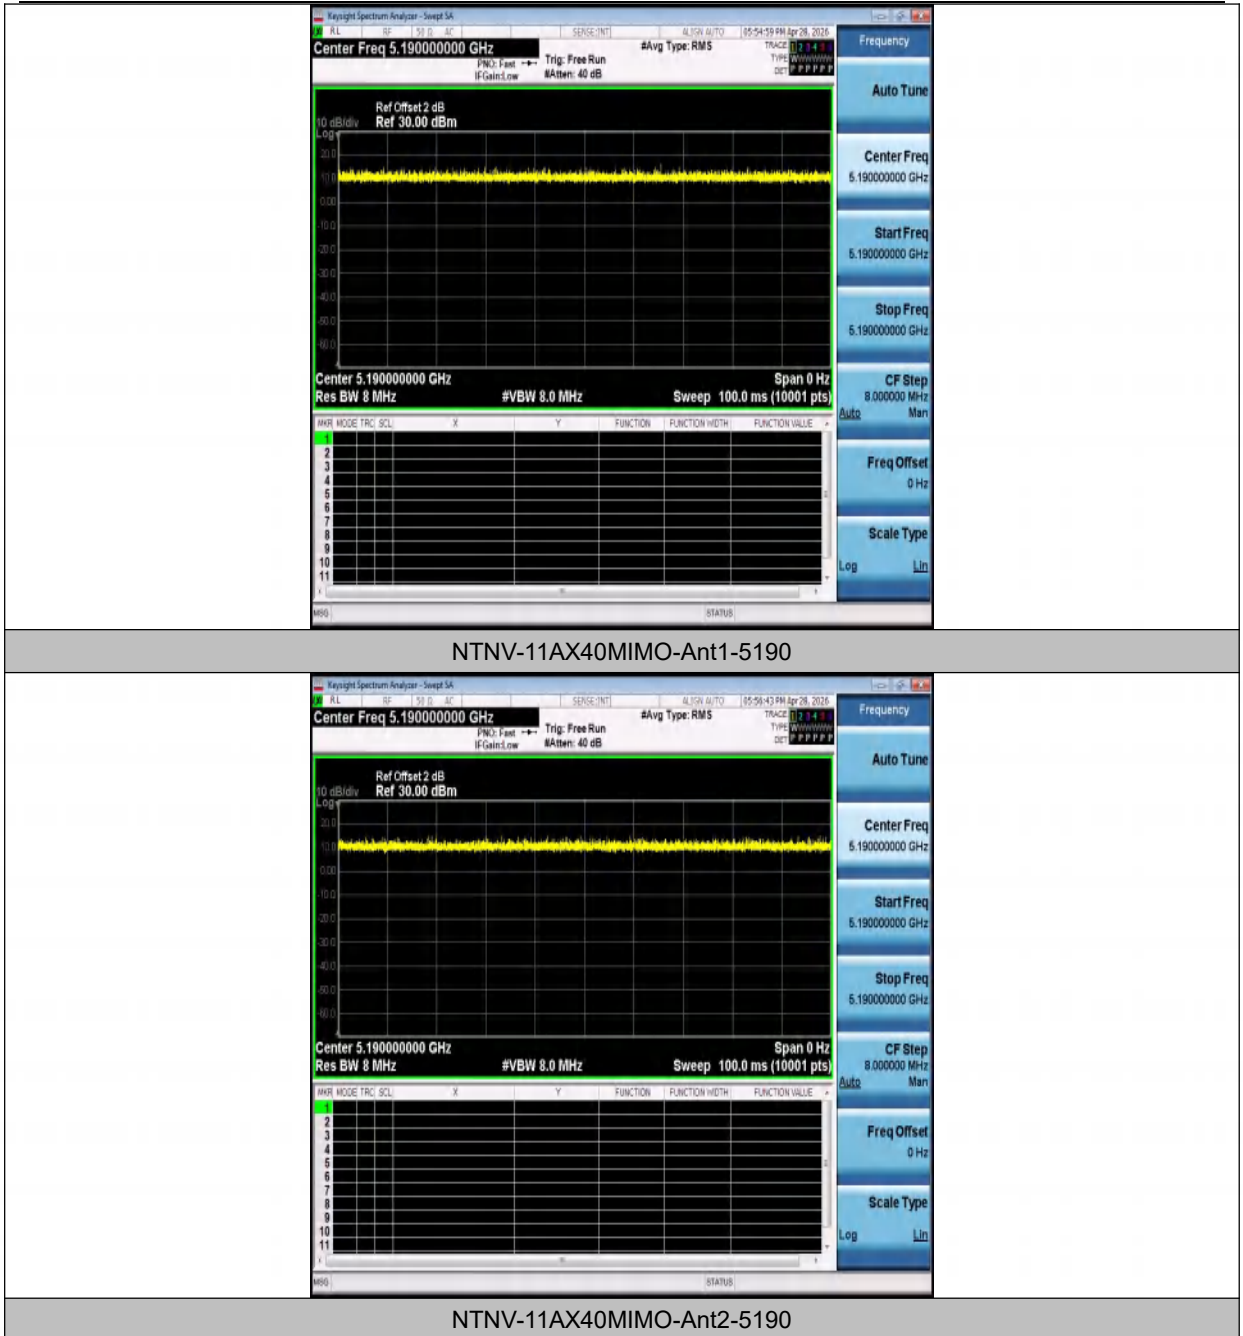

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

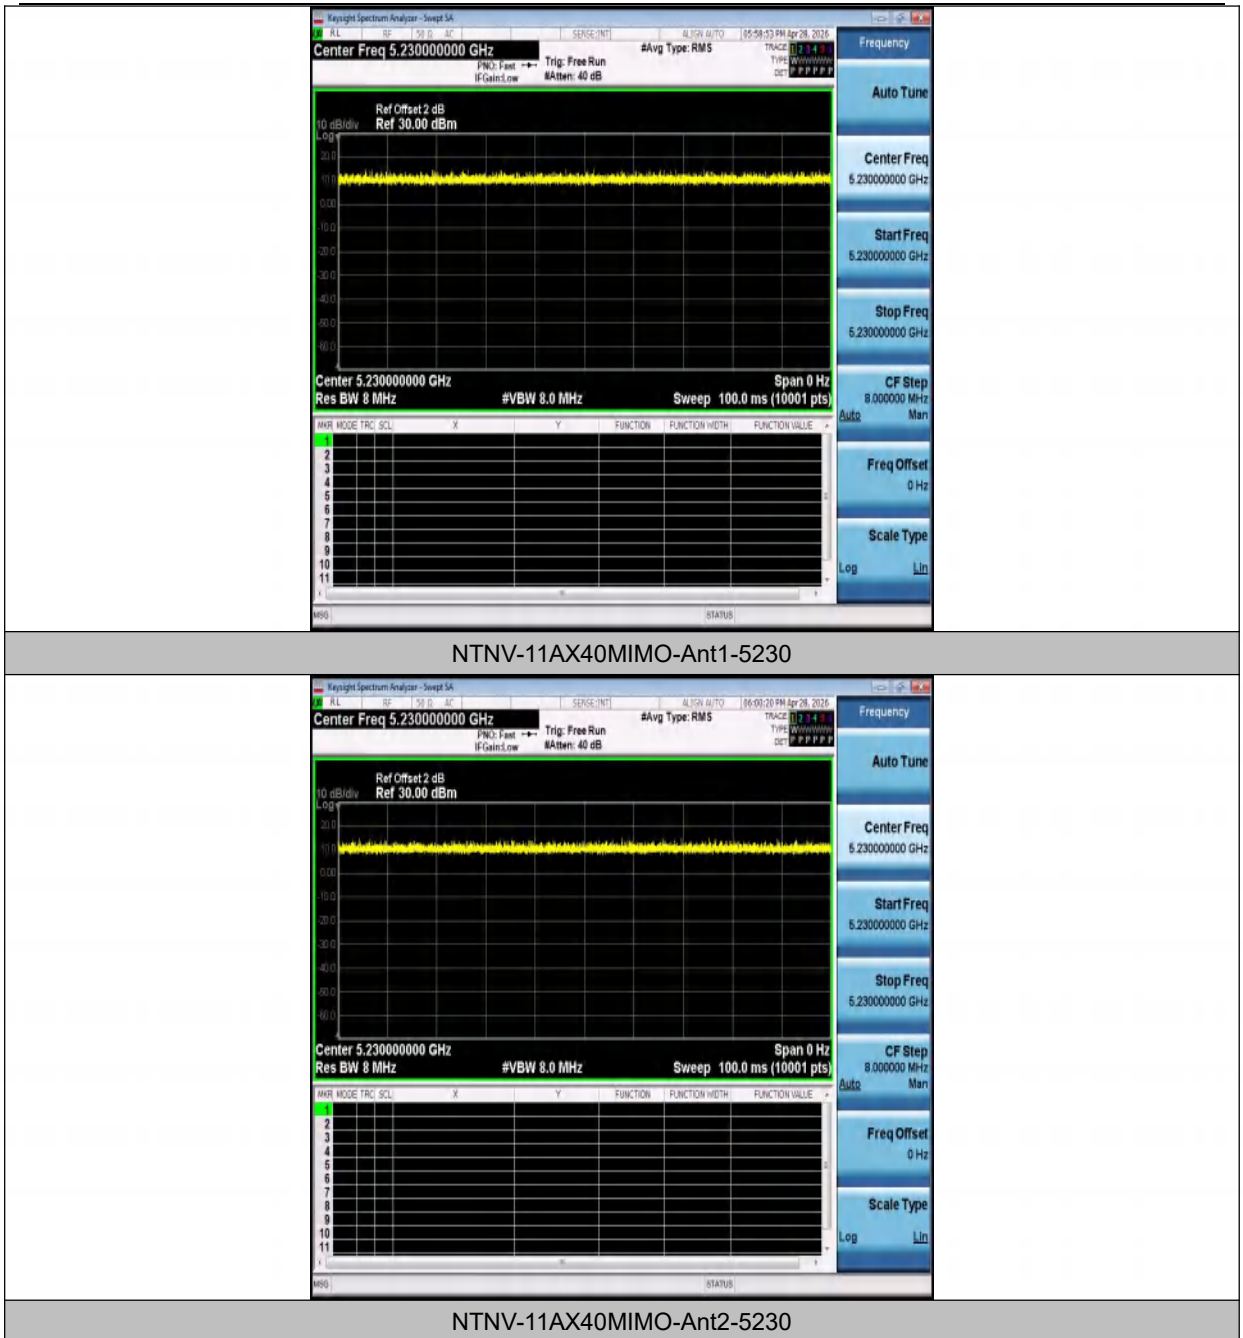

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

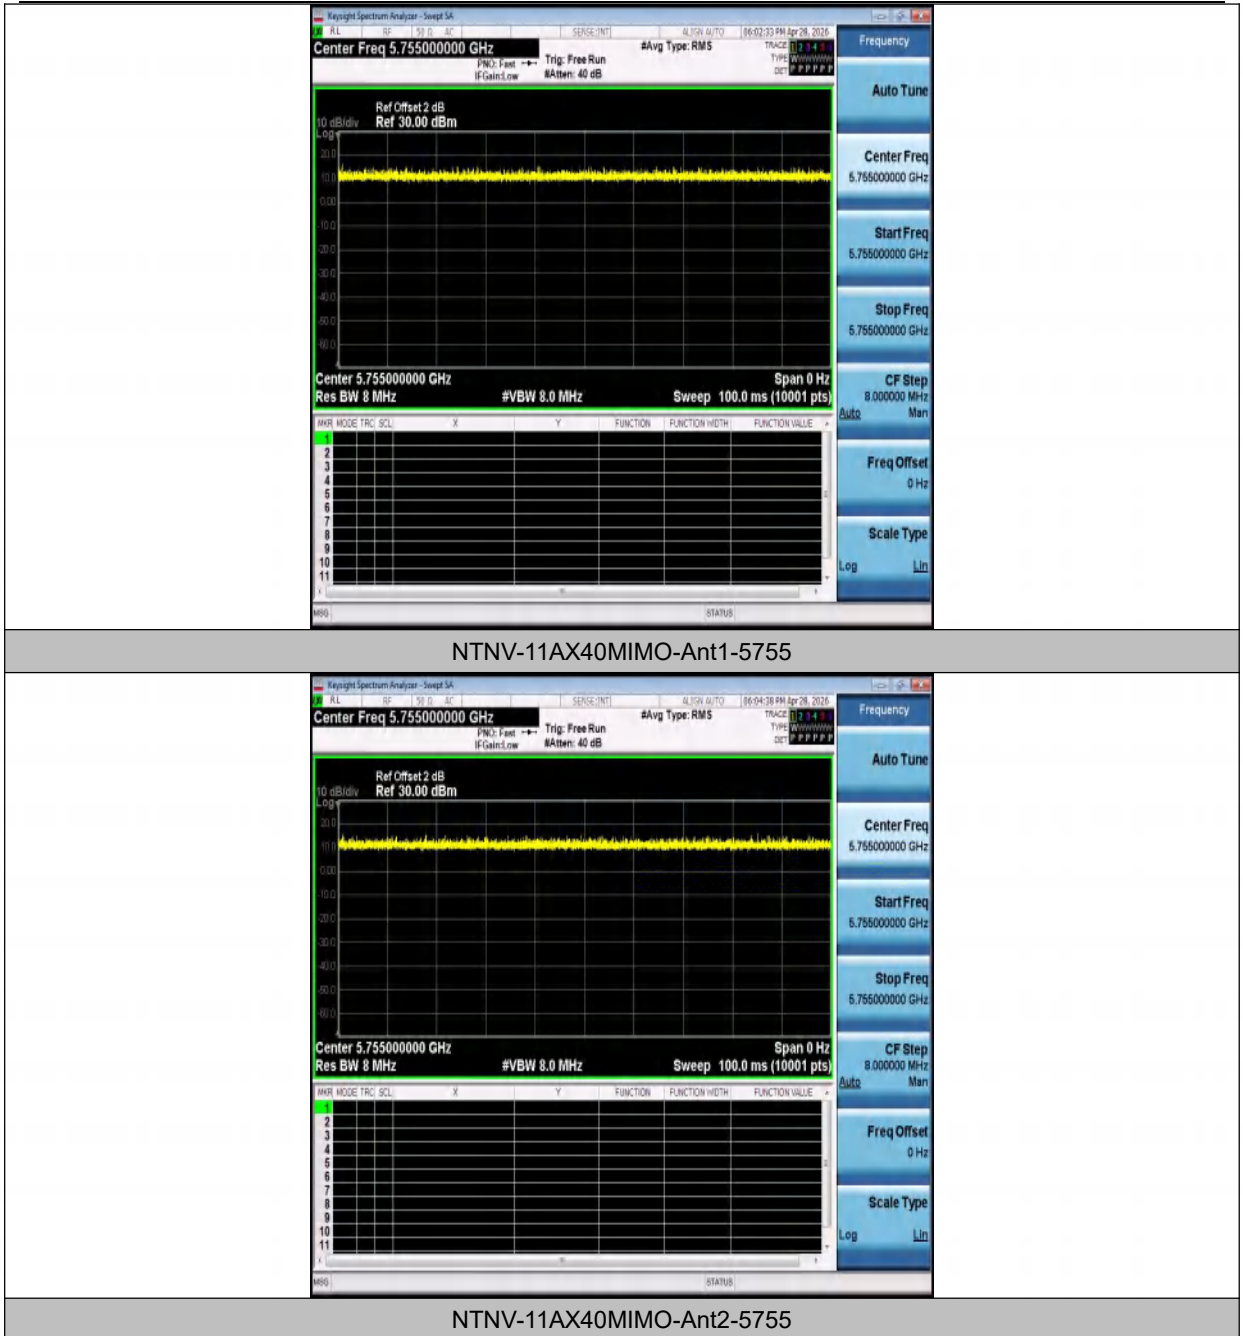

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

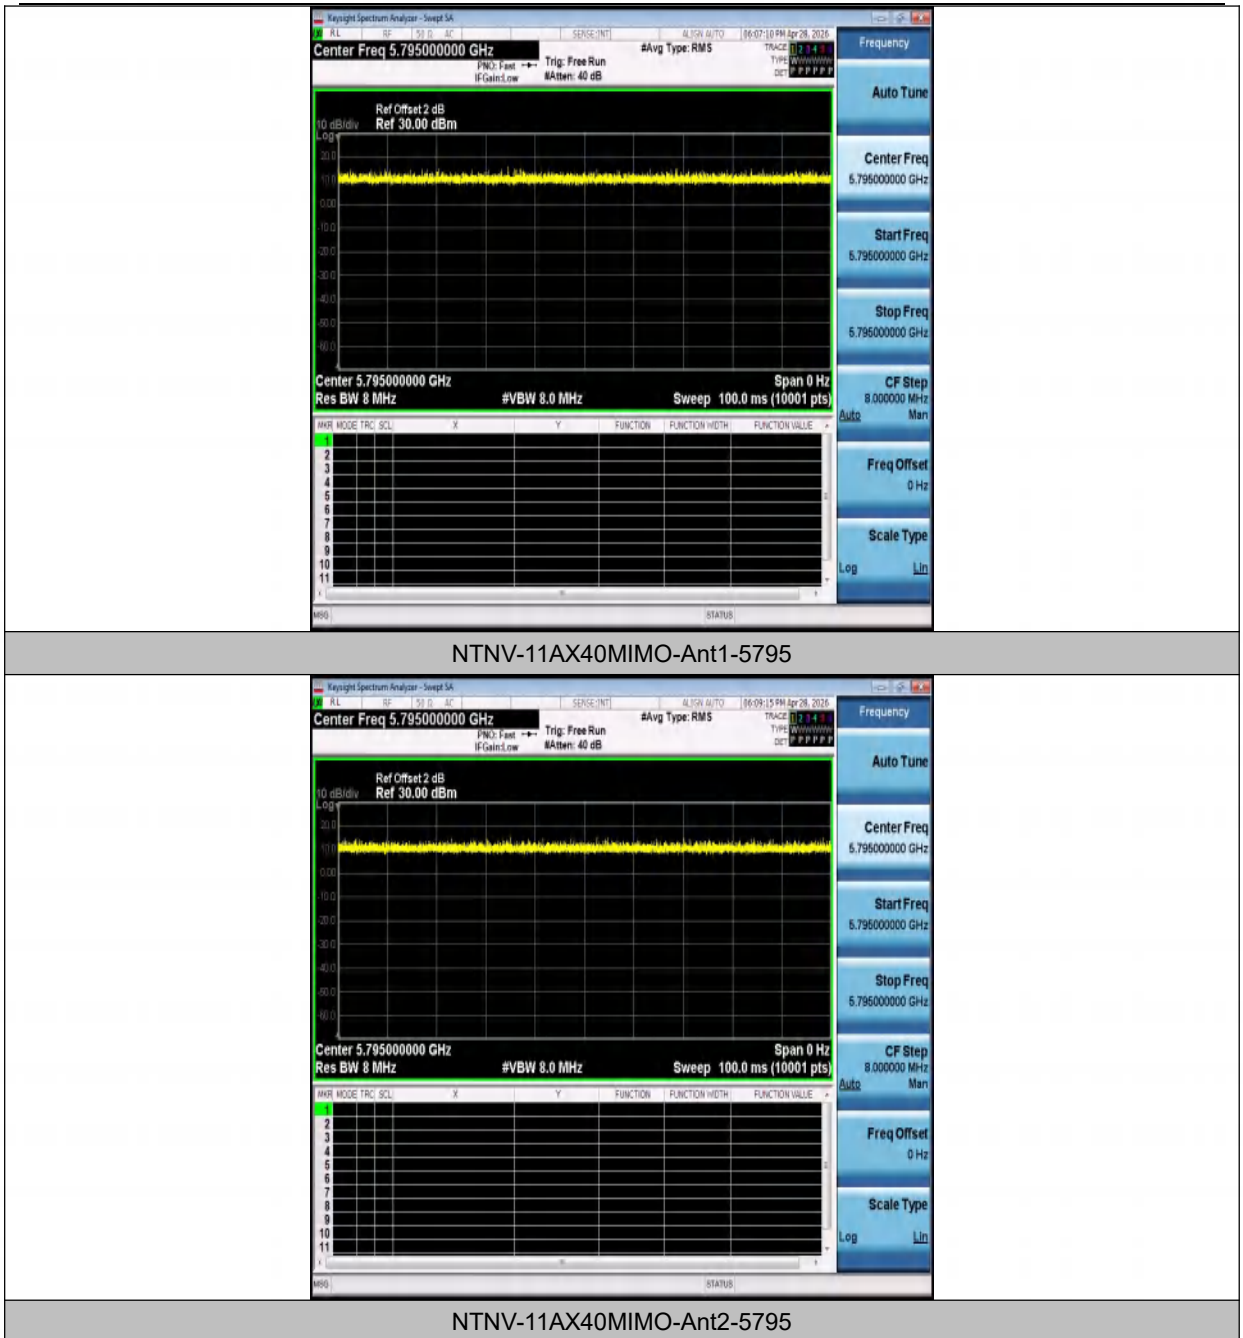

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	14.46	≤23.98	PASS
11A	Ant2	5180	14.43	≤23.98	PASS
11A	Ant1	5220	13.64	≤23.98	PASS
11A	Ant2	5220	13.72	≤23.98	PASS
11A	Ant1	5240	13.51	≤23.98	PASS
11A	Ant2	5240	13.66	≤23.98	PASS
11A	Ant1	5745	14.23	≤30.00	PASS
11A	Ant2	5745	14.41	≤30.00	PASS
11A	Ant1	5785	14.03	≤30.00	PASS
11A	Ant2	5785	14.12	≤30.00	PASS
11A	Ant1	5825	14.02	≤30.00	PASS
11A	Ant2	5825	13.98	≤30.00	PASS
11N20MIMO	Ant1	5180	14.28	≤23.98	PASS
11N20MIMO	Ant2	5180	14.27	≤23.98	PASS
11N20MIMO	total	5180	17.29	≤23.98	PASS
11N20MIMO	Ant1	5220	13.68	≤23.98	PASS
11N20MIMO	Ant2	5220	13.63	≤23.98	PASS
11N20MIMO	total	5220	16.67	≤23.98	PASS
11N20MIMO	Ant1	5240	13.45	≤23.98	PASS
11N20MIMO	Ant2	5240	13.43	≤23.98	PASS
11N20MIMO	total	5240	16.45	≤23.98	PASS
11N20MIMO	Ant1	5745	14.25	≤30.00	PASS
11N20MIMO	Ant2	5745	14.29	≤30.00	PASS
11N20MIMO	total	5745	17.28	≤30.00	PASS
11N20MIMO	Ant1	5785	14.09	≤30.00	PASS
11N20MIMO	Ant2	5785	14.10	≤30.00	PASS
11N20MIMO	total	5785	17.11	≤30.00	PASS
11N20MIMO	Ant1	5825	13.82	≤30.00	PASS
11N20MIMO	Ant2	5825	13.78	≤30.00	PASS
11N20MIMO	total	5825	16.81	≤30.00	PASS
11N40MIMO	Ant1	5190	13.95	≤23.98	PASS
11N40MIMO	Ant2	5190	13.88	≤23.98	PASS
11N40MIMO	total	5190	16.93	≤23.98	PASS
11N40MIMO	Ant1	5230	13.35	≤23.98	PASS
11N40MIMO	Ant2	5230	13.34	≤23.98	PASS

11N40MIMO	total	5230	16.36	≤23.98	PASS
11N40MIMO	Ant1	5755	14.49	≤30.00	PASS
11N40MIMO	Ant2	5755	14.46	≤30.00	PASS
11N40MIMO	total	5755	17.49	≤30.00	PASS
11N40MIMO	Ant1	5795	13.87	≤30.00	PASS
11N40MIMO	Ant2	5795	13.87	≤30.00	PASS
11N40MIMO	total	5795	16.88	≤30.00	PASS
11AC20MIMO	Ant1	5180	14.16	≤23.98	PASS
11AC20MIMO	Ant2	5180	14.17	≤23.98	PASS
11AC20MIMO	total	5180	17.18	≤23.98	PASS
11AC20MIMO	Ant1	5220	13.67	≤23.98	PASS
11AC20MIMO	Ant2	5220	13.63	≤23.98	PASS
11AC20MIMO	total	5220	16.66	≤23.98	PASS
11AC20MIMO	Ant1	5240	13.49	≤23.98	PASS
11AC20MIMO	Ant2	5240	13.52	≤23.98	PASS
11AC20MIMO	total	5240	16.52	≤23.98	PASS
11AC20MIMO	Ant1	5745	14.23	≤30.00	PASS
11AC20MIMO	Ant2	5745	14.25	≤30.00	PASS
11AC20MIMO	total	5745	17.25	≤30.00	PASS
11AC20MIMO	Ant1	5785	14.00	≤30.00	PASS
11AC20MIMO	Ant2	5785	14.06	≤30.00	PASS
11AC20MIMO	total	5785	17.04	≤30.00	PASS
11AC20MIMO	Ant1	5825	13.90	≤30.00	PASS
11AC20MIMO	Ant2	5825	13.91	≤30.00	PASS
11AC20MIMO	total	5825	16.92	≤30.00	PASS
11AC40MIMO	Ant1	5190	14.01	≤23.98	PASS
11AC40MIMO	Ant2	5190	13.97	≤23.98	PASS
11AC40MIMO	total	5190	17.00	≤23.98	PASS
11AC40MIMO	Ant1	5230	13.23	≤23.98	PASS
11AC40MIMO	Ant2	5230	13.38	≤23.98	PASS
11AC40MIMO	total	5230	16.32	≤23.98	PASS
11AC40MIMO	Ant1	5755	14.45	≤30.00	PASS
11AC40MIMO	Ant2	5755	14.56	≤30.00	PASS
11AC40MIMO	total	5755	17.52	≤30.00	PASS
11AC40MIMO	Ant1	5795	13.90	≤30.00	PASS
11AC40MIMO	Ant2	5795	13.83	≤30.00	PASS
11AC40MIMO	total	5795	16.88	≤30.00	PASS
11AX20MIMO	Ant1	5180	14.22	≤23.98	PASS
11AX20MIMO	Ant2	5180	14.24	≤23.98	PASS
11AX20MIMO	total	5180	17.24	≤23.98	PASS
11AX20MIMO	Ant1	5220	13.66	≤23.98	PASS
11AX20MIMO	Ant2	5220	13.66	≤23.98	PASS

11AX20MIMO	total	5220	16.67	≤23.98	PASS
11AX20MIMO	Ant1	5240	13.42	≤23.98	PASS
11AX20MIMO	Ant2	5240	13.47	≤23.98	PASS
11AX20MIMO	total	5240	16.46	≤23.98	PASS
11AX20MIMO	Ant1	5745	14.35	≤30.00	PASS
11AX20MIMO	Ant2	5745	14.41	≤30.00	PASS
11AX20MIMO	total	5745	17.39	≤30.00	PASS
11AX20MIMO	Ant1	5785	14.11	≤30.00	PASS
11AX20MIMO	Ant2	5785	14.03	≤30.00	PASS
11AX20MIMO	total	5785	17.08	≤30.00	PASS
11AX20MIMO	Ant1	5825	13.89	≤30.00	PASS
11AX20MIMO	Ant2	5825	13.93	≤30.00	PASS
11AX20MIMO	total	5825	16.92	≤30.00	PASS
11AX40MIMO	Ant1	5190	13.97	≤23.98	PASS
11AX40MIMO	Ant2	5190	13.91	≤23.98	PASS
11AX40MIMO	total	5190	16.95	≤23.98	PASS
11AX40MIMO	Ant1	5230	13.22	≤23.98	PASS
11AX40MIMO	Ant2	5230	13.32	≤23.98	PASS
11AX40MIMO	total	5230	16.28	≤23.98	PASS
11AX40MIMO	Ant1	5755	14.07	≤30.00	PASS
11AX40MIMO	Ant2	5755	14.32	≤30.00	PASS
11AX40MIMO	total	5755	17.21	≤30.00	PASS
11AX40MIMO	Ant1	5795	13.93	≤30.00	PASS
11AX40MIMO	Ant2	5795	13.92	≤30.00	PASS
11AX40MIMO	total	5795	16.94	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-0.25	≤11.00	PASS
11A	Ant2	5180	-0.43	≤11.00	PASS
11A	Ant1	5220	-0.89	≤11.00	PASS
11A	Ant2	5220	-0.95	≤11.00	PASS
11A	Ant1	5240	-1.35	≤11.00	PASS
11A	Ant2	5240	-0.79	≤11.00	PASS
11N20MIMO	Ant1	5180	-0.64	≤11.00	PASS
11N20MIMO	Ant2	5180	-0.64	≤11.00	PASS
11N20MIMO	total	5180	2.37	≤11.00	PASS
11N20MIMO	Ant1	5220	-1.35	≤11.00	PASS
11N20MIMO	Ant2	5220	-1.10	≤11.00	PASS
11N20MIMO	total	5220	1.79	≤11.00	PASS
11N20MIMO	Ant1	5240	-1.40	≤11.00	PASS
11N20MIMO	Ant2	5240	-1.54	≤11.00	PASS
11N20MIMO	total	5240	1.54	≤11.00	PASS
11N40MIMO	Ant1	5190	-3.73	≤11.00	PASS
11N40MIMO	Ant2	5190	-3.79	≤11.00	PASS
11N40MIMO	total	5190	-0.75	≤11.00	PASS
11N40MIMO	Ant1	5230	-4.30	≤11.00	PASS
11N40MIMO	Ant2	5230	-4.44	≤11.00	PASS
11N40MIMO	total	5230	-1.36	≤11.00	PASS
11AC20MIMO	Ant1	5180	-0.47	≤11.00	PASS
11AC20MIMO	Ant2	5180	-0.85	≤11.00	PASS
11AC20MIMO	total	5180	2.35	≤11.00	PASS
11AC20MIMO	Ant1	5220	-1.41	≤11.00	PASS
11AC20MIMO	Ant2	5220	-1.24	≤11.00	PASS
11AC20MIMO	total	5220	1.69	≤11.00	PASS
11AC20MIMO	Ant1	5240	-1.33	≤11.00	PASS
11AC20MIMO	Ant2	5240	-1.41	≤11.00	PASS
11AC20MIMO	total	5240	1.64	≤11.00	PASS
11AC40MIMO	Ant1	5190	-3.85	≤11.00	PASS
11AC40MIMO	Ant2	5190	-3.91	≤11.00	PASS
11AC40MIMO	total	5190	-0.87	≤11.00	PASS
11AC40MIMO	Ant1	5230	-4.42	≤11.00	PASS
11AC40MIMO	Ant2	5230	-4.50	≤11.00	PASS
11AC40MIMO	total	5230	-1.45	≤11.00	PASS
11AX20MIMO	Ant1	5180	-0.64	≤11.00	PASS

11AX20MIMO	Ant2	5180	-0.45	≤11.00	PASS
11AX20MIMO	total	5180	2.47	≤11.00	PASS
11AX20MIMO	Ant1	5220	-1.16	≤11.00	PASS
11AX20MIMO	Ant2	5220	-1.12	≤11.00	PASS
11AX20MIMO	total	5220	1.87	≤11.00	PASS
11AX20MIMO	Ant1	5240	-1.37	≤11.00	PASS
11AX20MIMO	Ant2	5240	-1.59	≤11.00	PASS
11AX20MIMO	total	5240	1.53	≤11.00	PASS
11AX40MIMO	Ant1	5190	-3.74	≤11.00	PASS
11AX40MIMO	Ant2	5190	-3.86	≤11.00	PASS
11AX40MIMO	total	5190	-0.79	≤11.00	PASS
11AX40MIMO	Ant1	5230	-4.55	≤11.00	PASS
11AX40MIMO	Ant2	5230	-4.53	≤11.00	PASS
11AX40MIMO	total	5230	-1.53	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency[MHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-3.22	≤30.00	PASS
11A	Ant2	5745	-2.99	≤30.00	PASS
11A	Ant1	5785	-3.58	≤30.00	PASS
11A	Ant2	5785	-3.38	≤30.00	PASS
11A	Ant1	5825	-3.61	≤30.00	PASS
11A	Ant2	5825	-3.29	≤30.00	PASS
11N20MIMO	Ant1	5745	-3.46	≤30.00	PASS
11N20MIMO	Ant2	5745	-3.51	≤30.00	PASS
11N20MIMO	total	5745	3.01	≤30.00	PASS
11N20MIMO	Ant1	5785	-3.61	≤30.00	PASS
11N20MIMO	Ant2	5785	-3.19	≤30.00	PASS
11N20MIMO	total	5785	3.01	≤30.00	PASS
11N20MIMO	Ant1	5825	-3.93	≤30.00	PASS
11N20MIMO	Ant2	5825	-4.02	≤30.00	PASS
11N20MIMO	total	5825	3.01	≤30.00	PASS
11N40MIMO	Ant1	5755	-6.10	≤30.00	PASS
11N40MIMO	Ant2	5755	-6.07	≤30.00	PASS
11N40MIMO	total	5755	3.01	≤30.00	PASS
11N40MIMO	Ant1	5795	-6.77	≤30.00	PASS
11N40MIMO	Ant2	5795	-6.89	≤30.00	PASS
11N40MIMO	total	5795	3.01	≤30.00	PASS
11AC20MIMO	Ant1	5745	-3.51	≤30.00	PASS
11AC20MIMO	Ant2	5745	-3.29	≤30.00	PASS
11AC20MIMO	total	5745	3.01	≤30.00	PASS
11AC20MIMO	Ant1	5785	-3.49	≤30.00	PASS
11AC20MIMO	Ant2	5785	-3.68	≤30.00	PASS
11AC20MIMO	total	5785	3.01	≤30.00	PASS
11AC20MIMO	Ant1	5825	-3.72	≤30.00	PASS
11AC20MIMO	Ant2	5825	-3.81	≤30.00	PASS
11AC20MIMO	total	5825	3.01	≤30.00	PASS
11AC40MIMO	Ant1	5755	-5.85	≤30.00	PASS
11AC40MIMO	Ant2	5755	-6.26	≤30.00	PASS
11AC40MIMO	total	5755	3.01	≤30.00	PASS
11AC40MIMO	Ant1	5795	-6.96	≤30.00	PASS
11AC40MIMO	Ant2	5795	-6.74	≤30.00	PASS
11AC40MIMO	total	5795	3.01	≤30.00	PASS
11AX20MIMO	Ant1	5745	-3.21	≤30.00	PASS
11AX20MIMO	Ant2	5745	-3.26	≤30.00	PASS
11AX20MIMO	total	5745	3.01	≤30.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	Ant1	5785	-3.55	≤30.00	PASS
11AX20MIMO	Ant2	5785	-3.36	≤30.00	PASS
11AX20MIMO	total	5785	3.01	≤30.00	PASS
11AX20MIMO	Ant1	5825	-3.63	≤30.00	PASS
11AX20MIMO	Ant2	5825	-3.73	≤30.00	PASS
11AX20MIMO	total	5825	3.01	≤30.00	PASS
11AX40MIMO	Ant1	5755	-6.52	≤30.00	PASS
11AX40MIMO	Ant2	5755	-6.44	≤30.00	PASS
11AX40MIMO	total	5755	3.01	≤30.00	PASS
11AX40MIMO	Ant1	5795	-6.77	≤30.00	PASS
11AX40MIMO	Ant2	5795	-6.96	≤30.00	PASS
11AX40MIMO	total	5795	3.01	≤30.00	PASS

Note: 1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (2.22dB)


Test Graphs B1

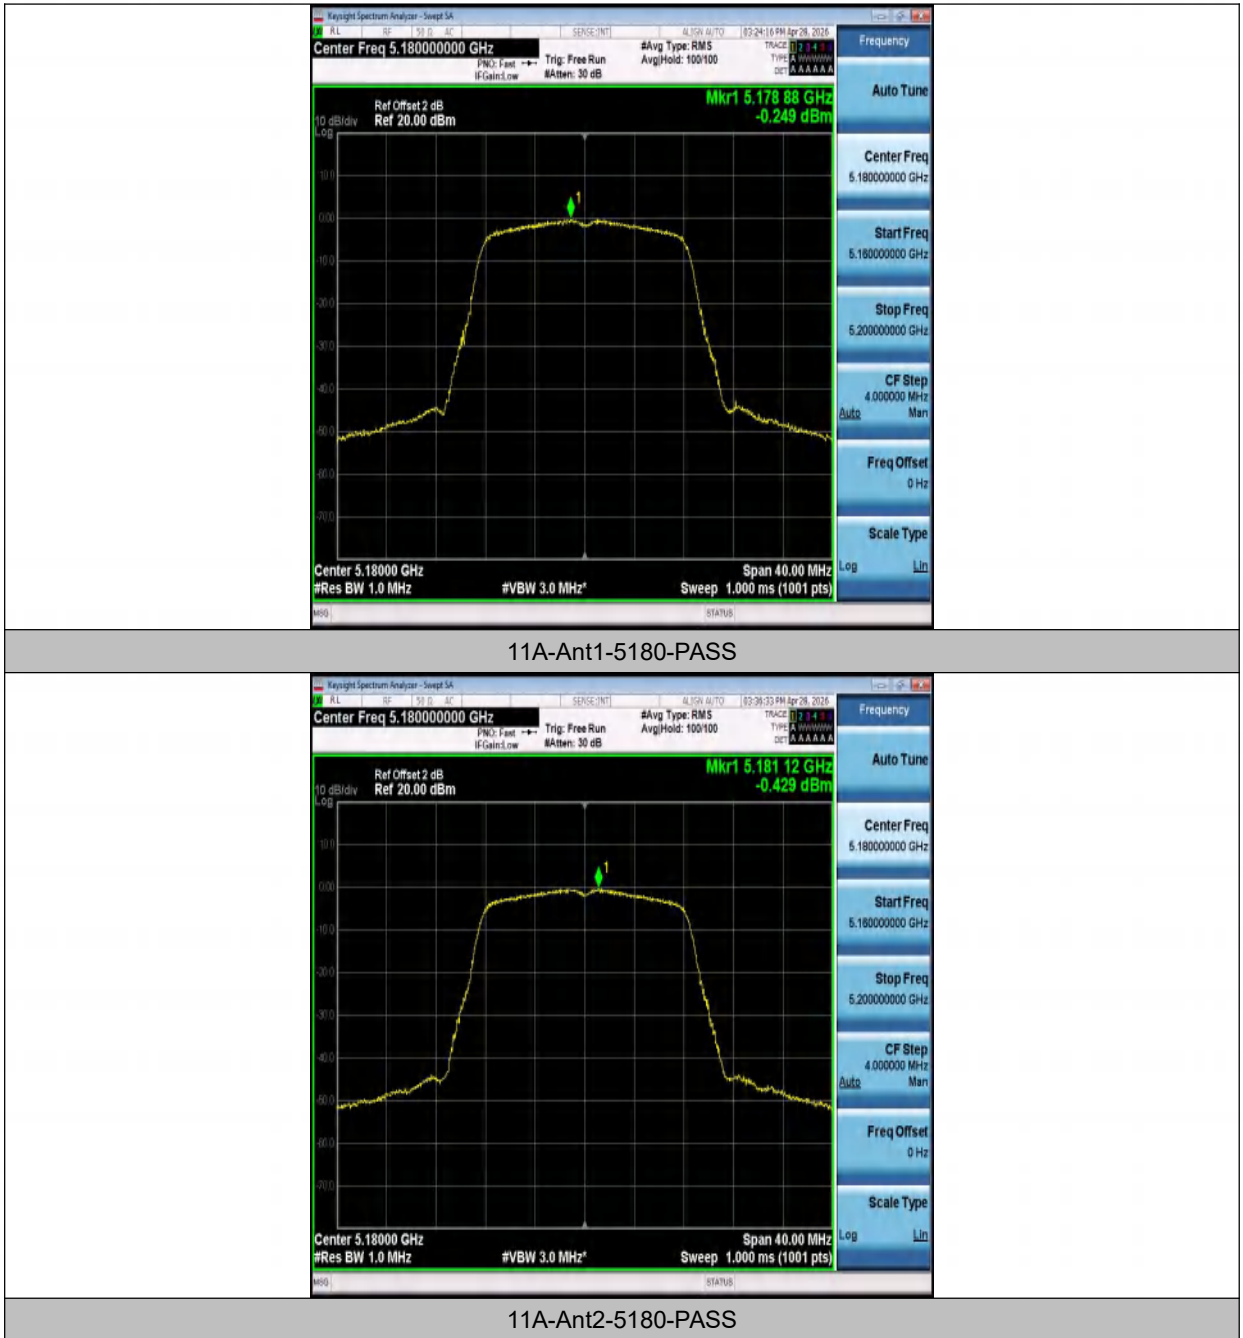

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

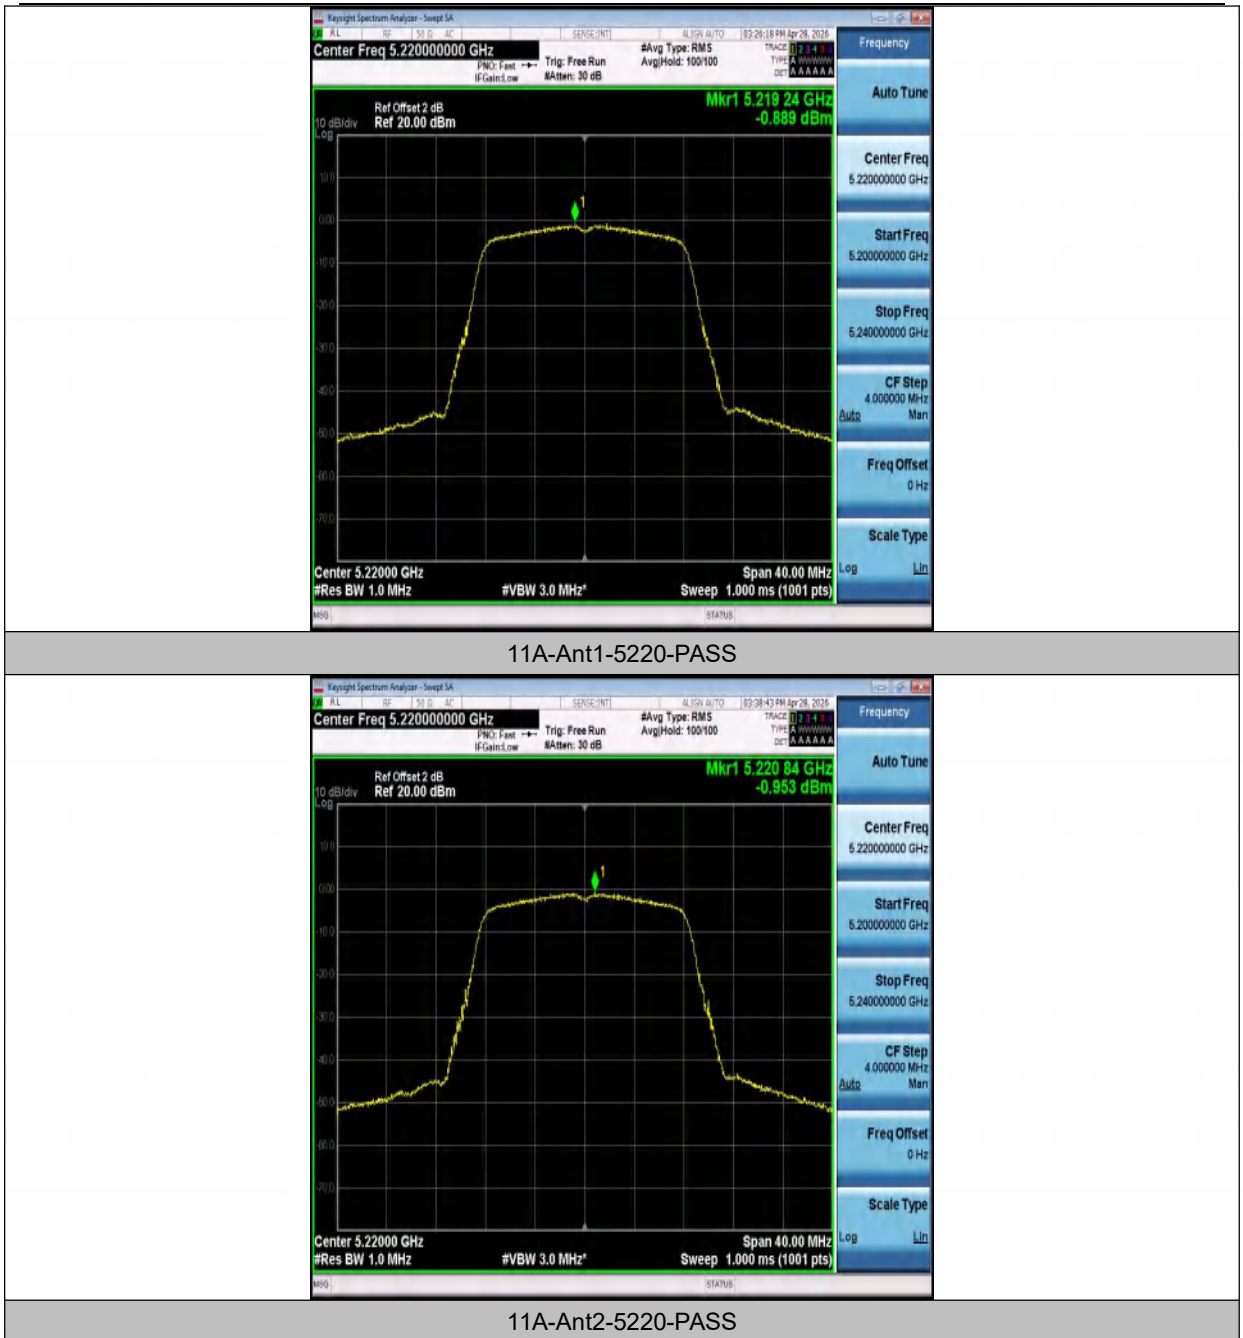

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

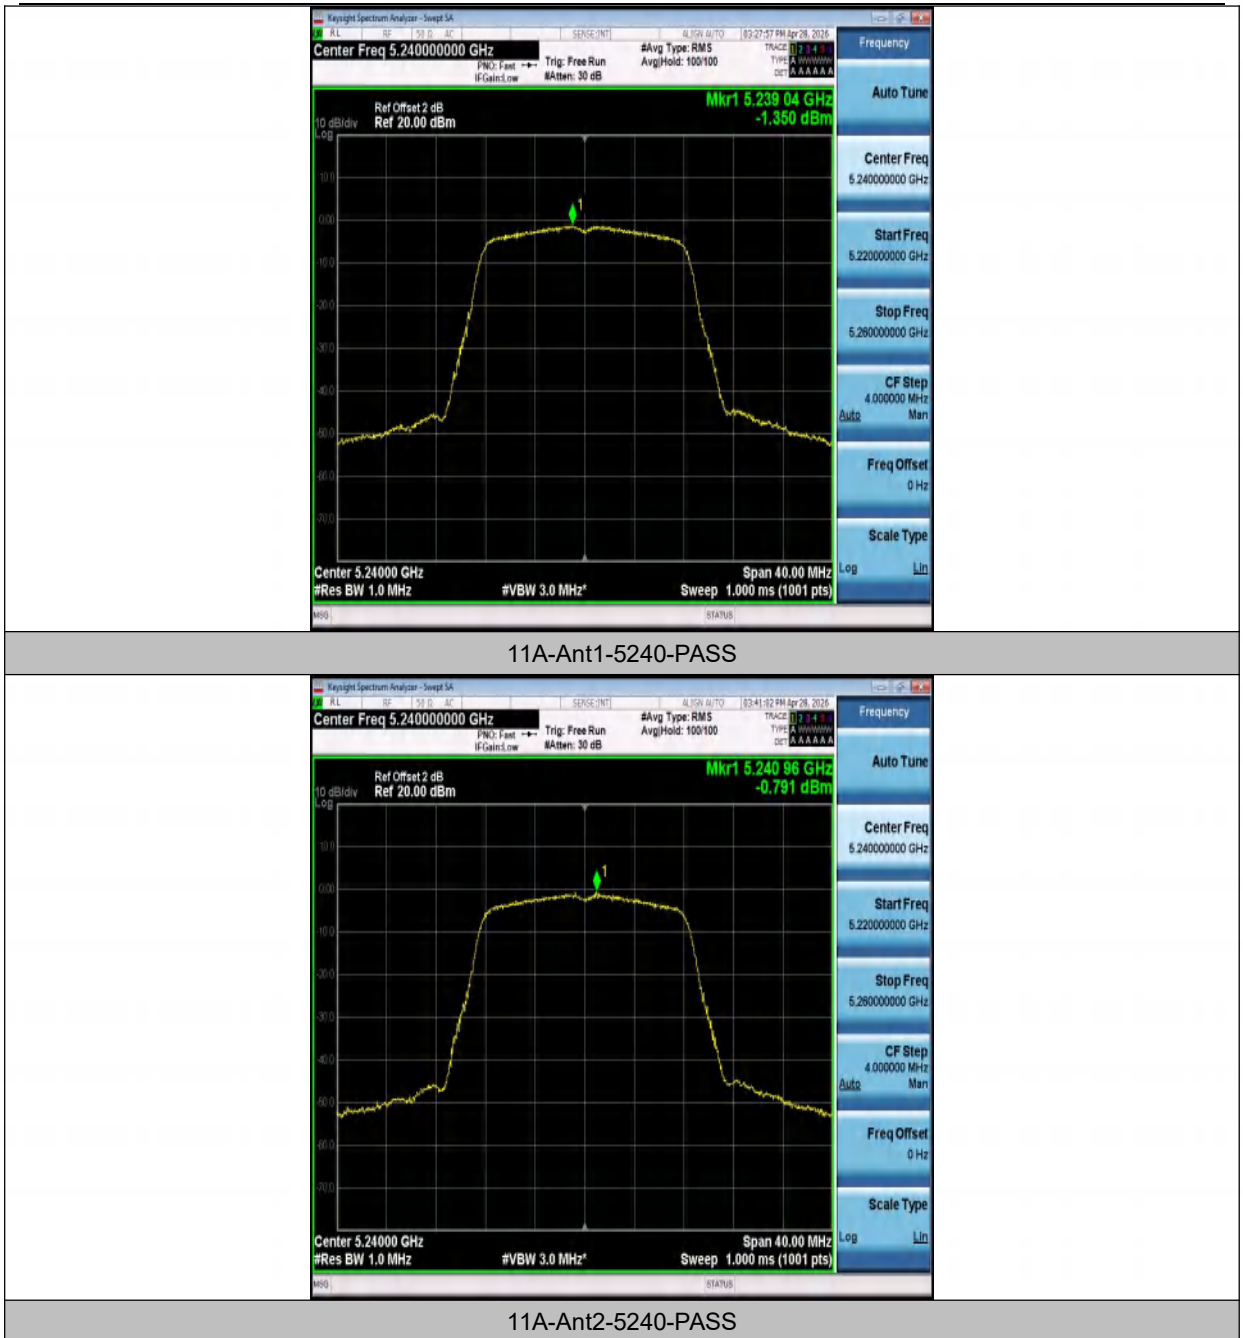

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

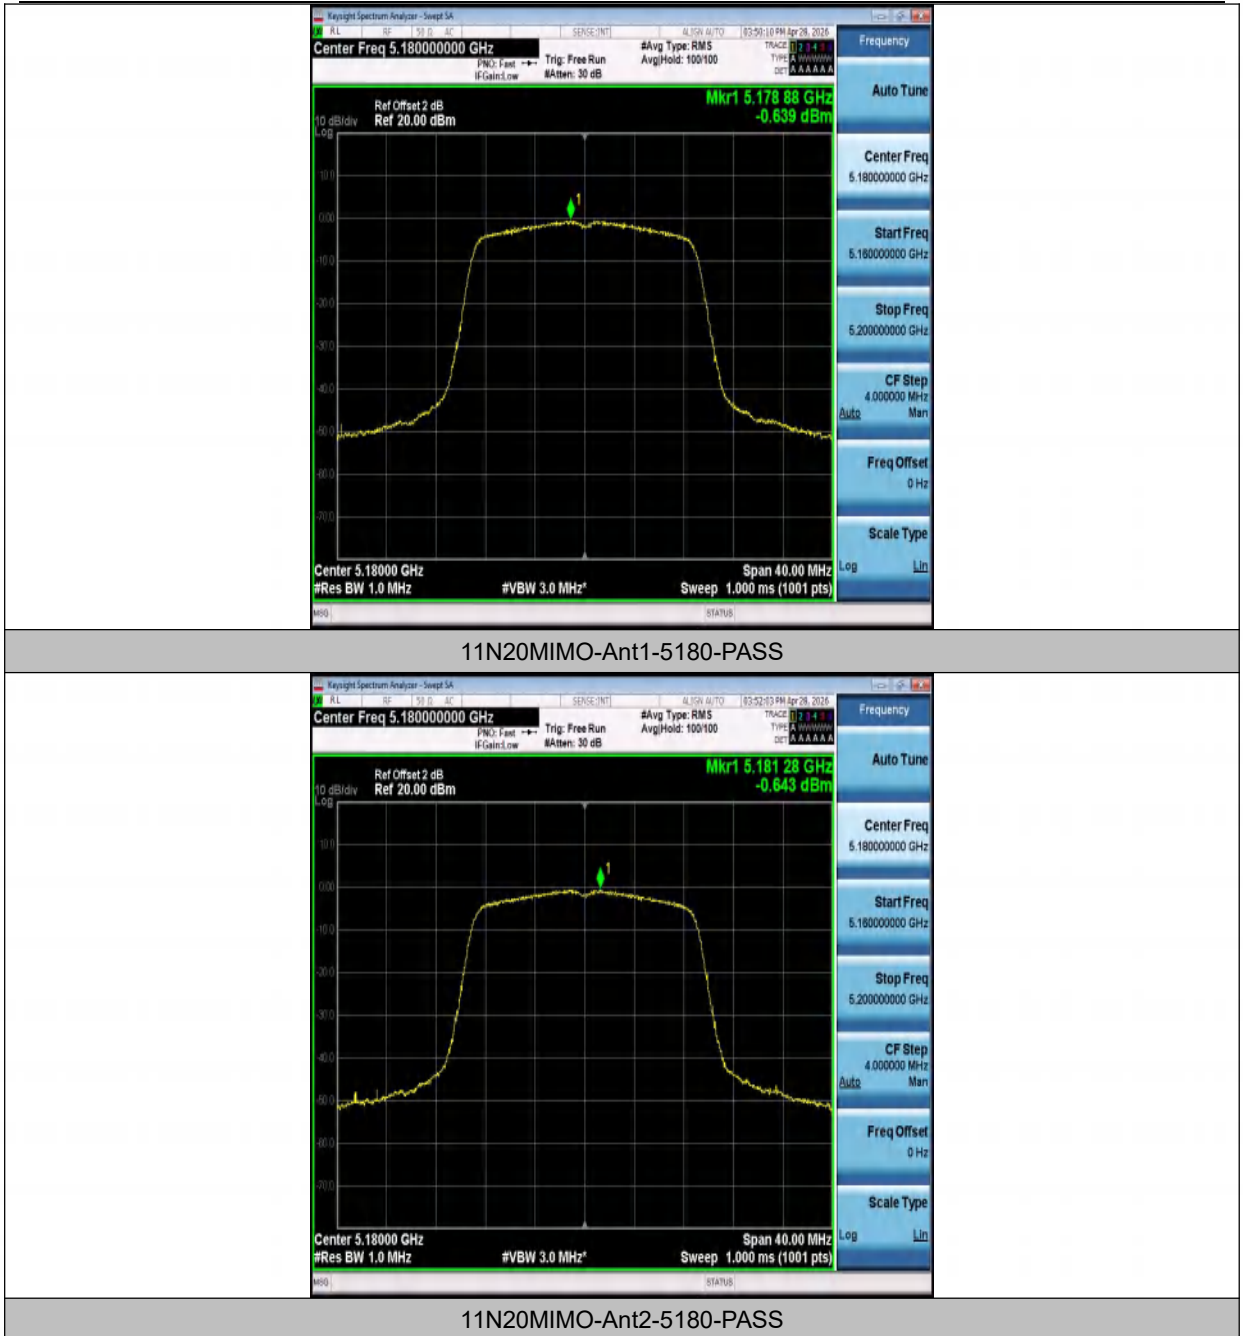

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

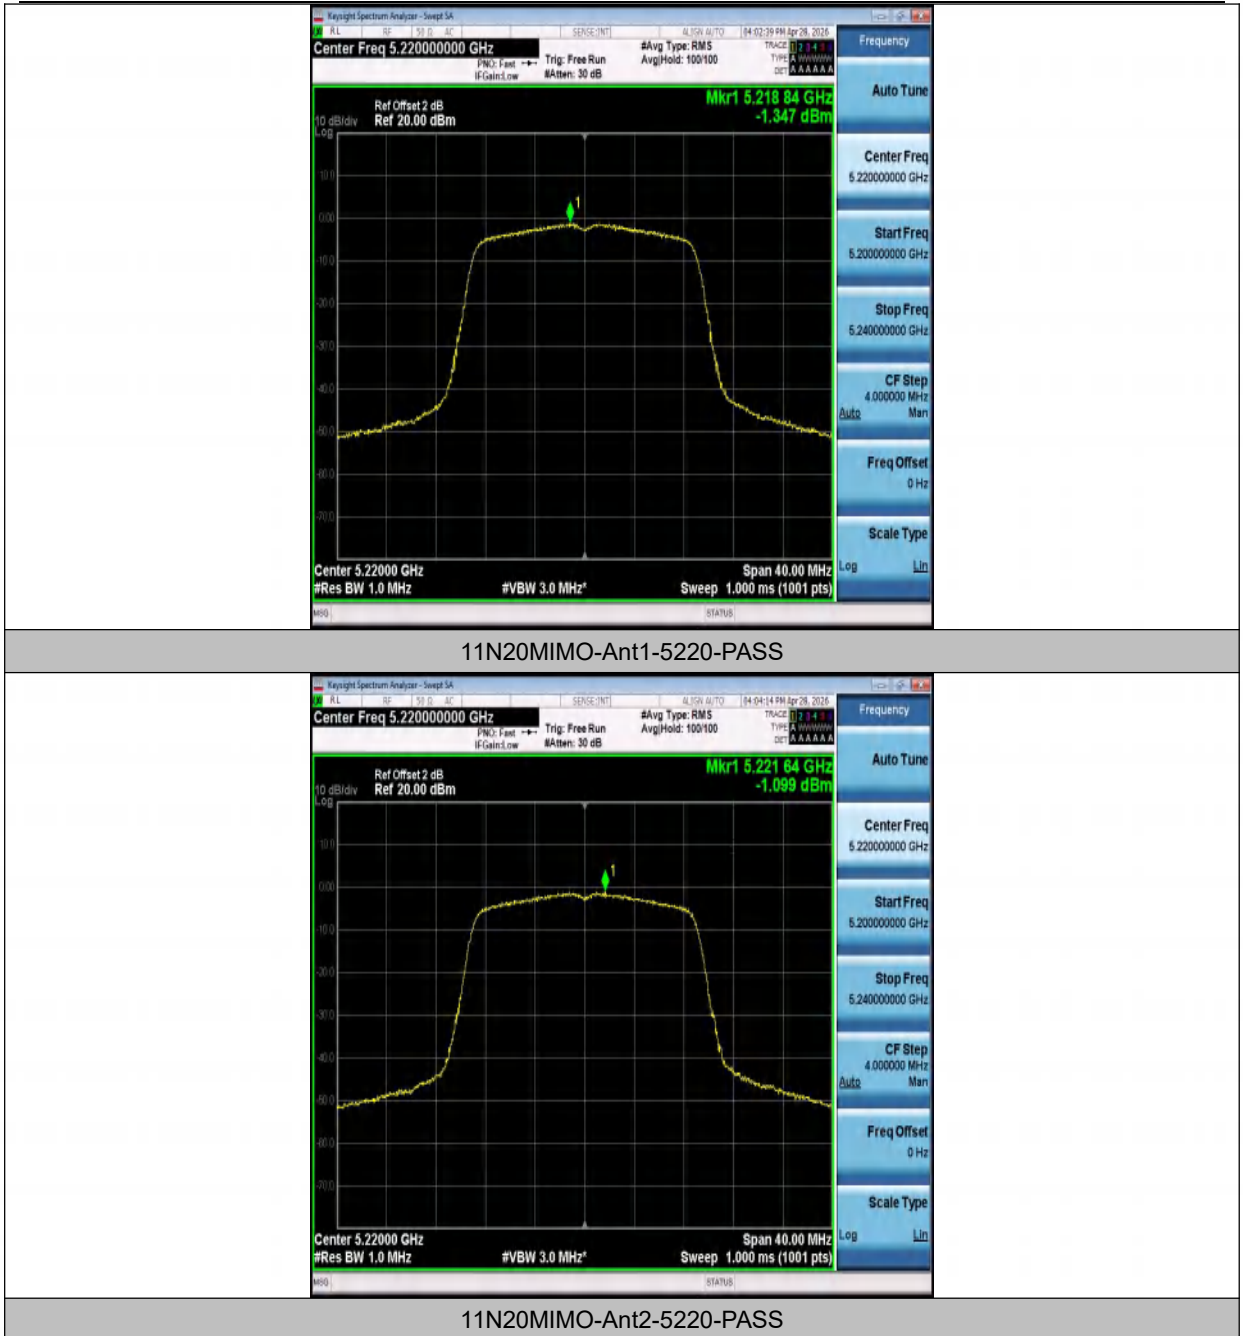

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

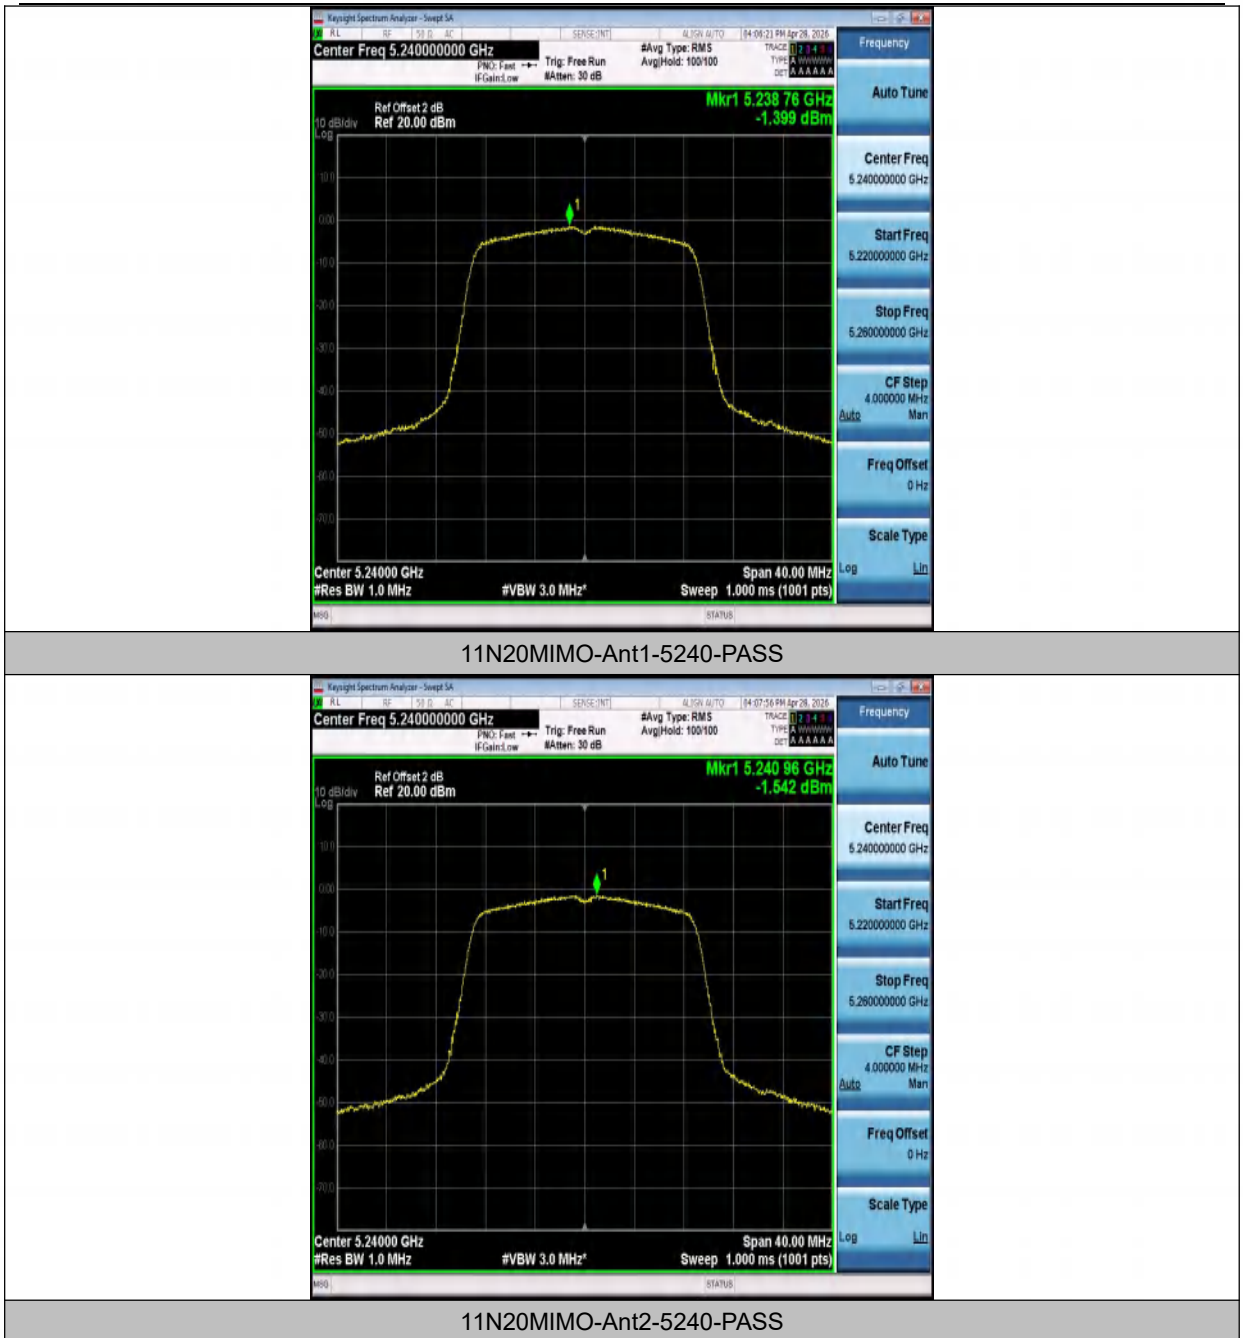

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

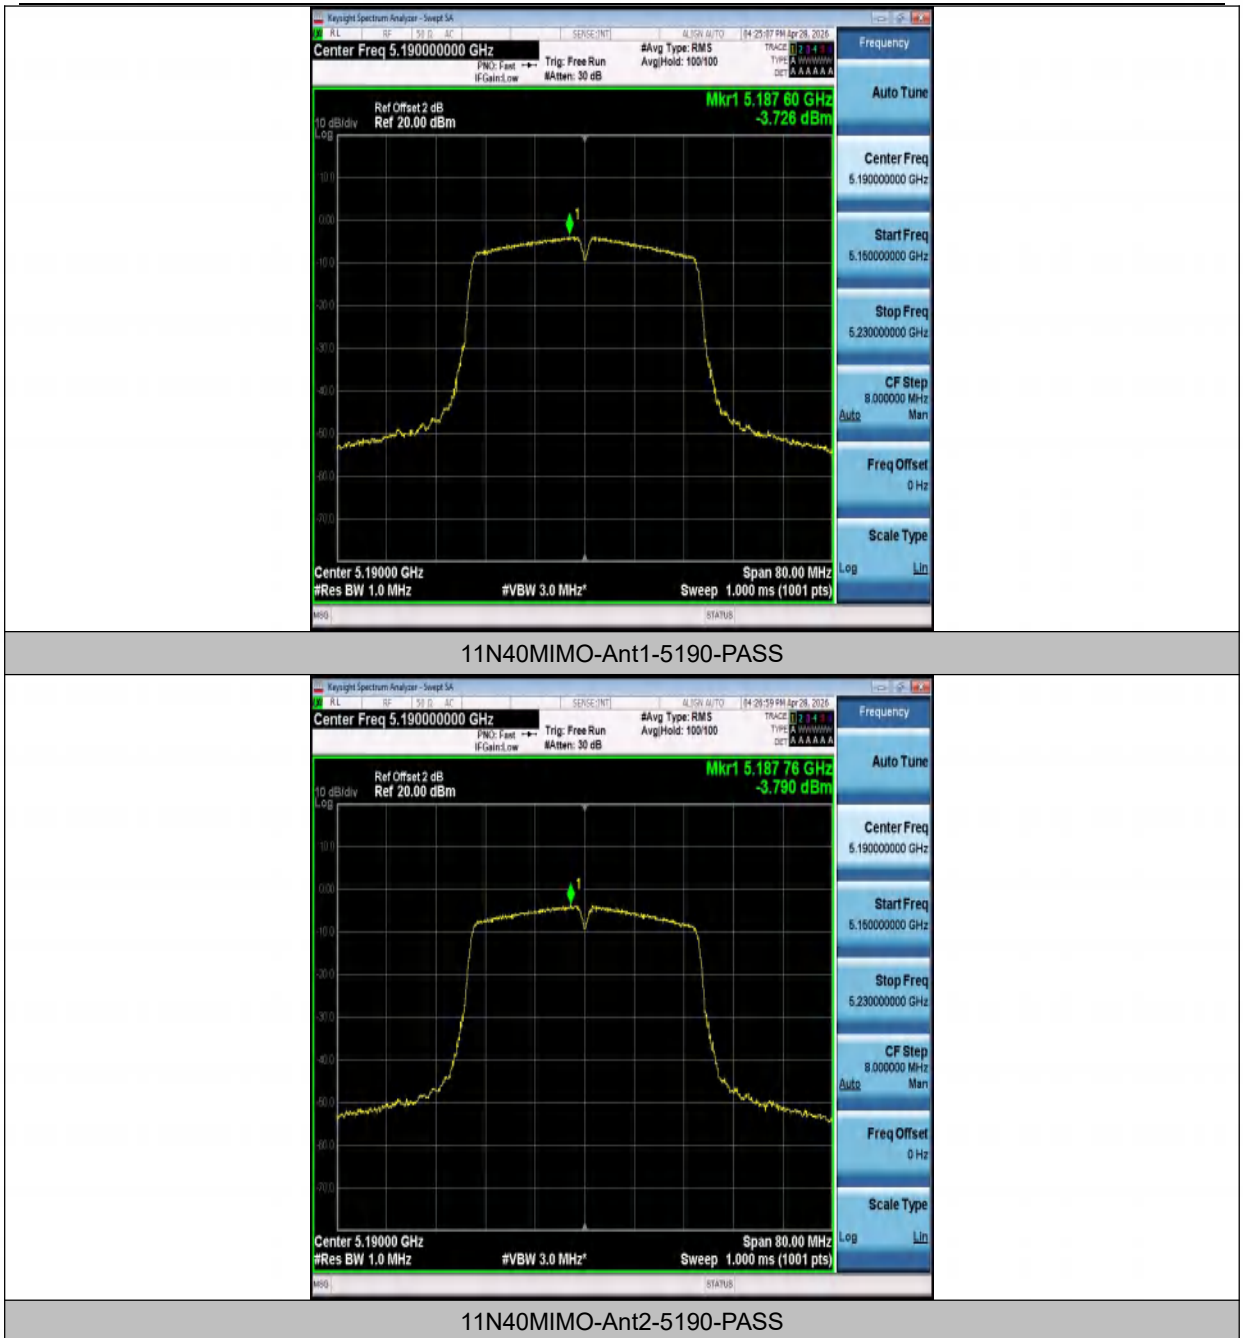

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

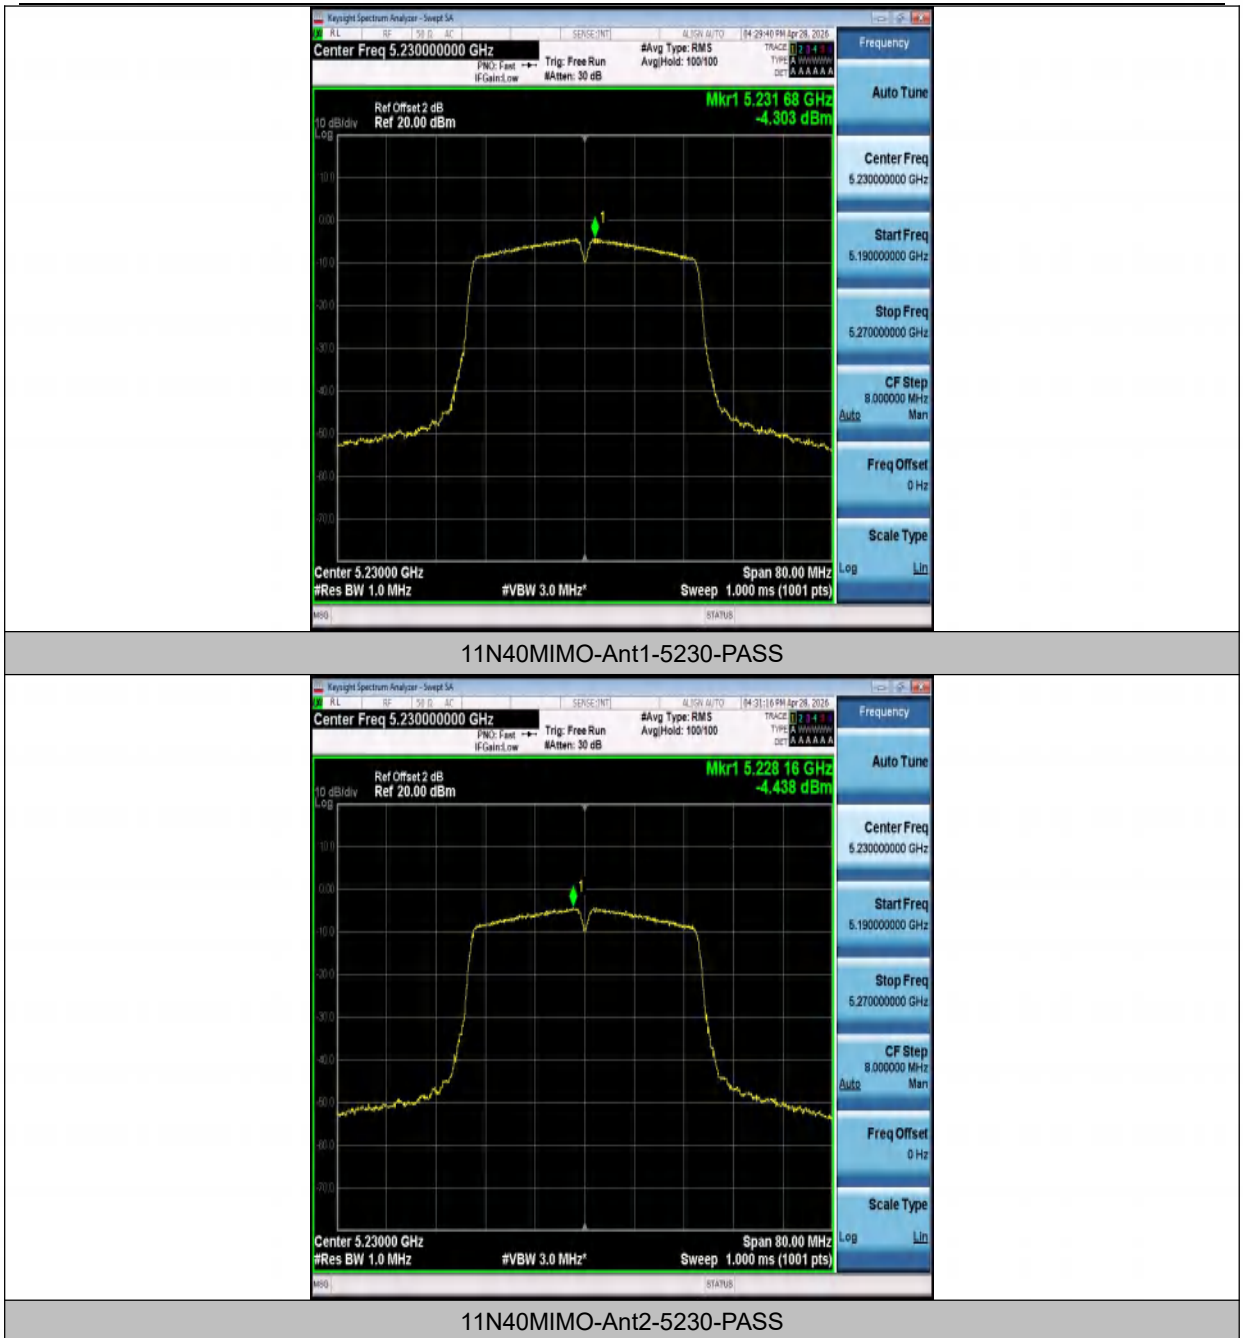

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

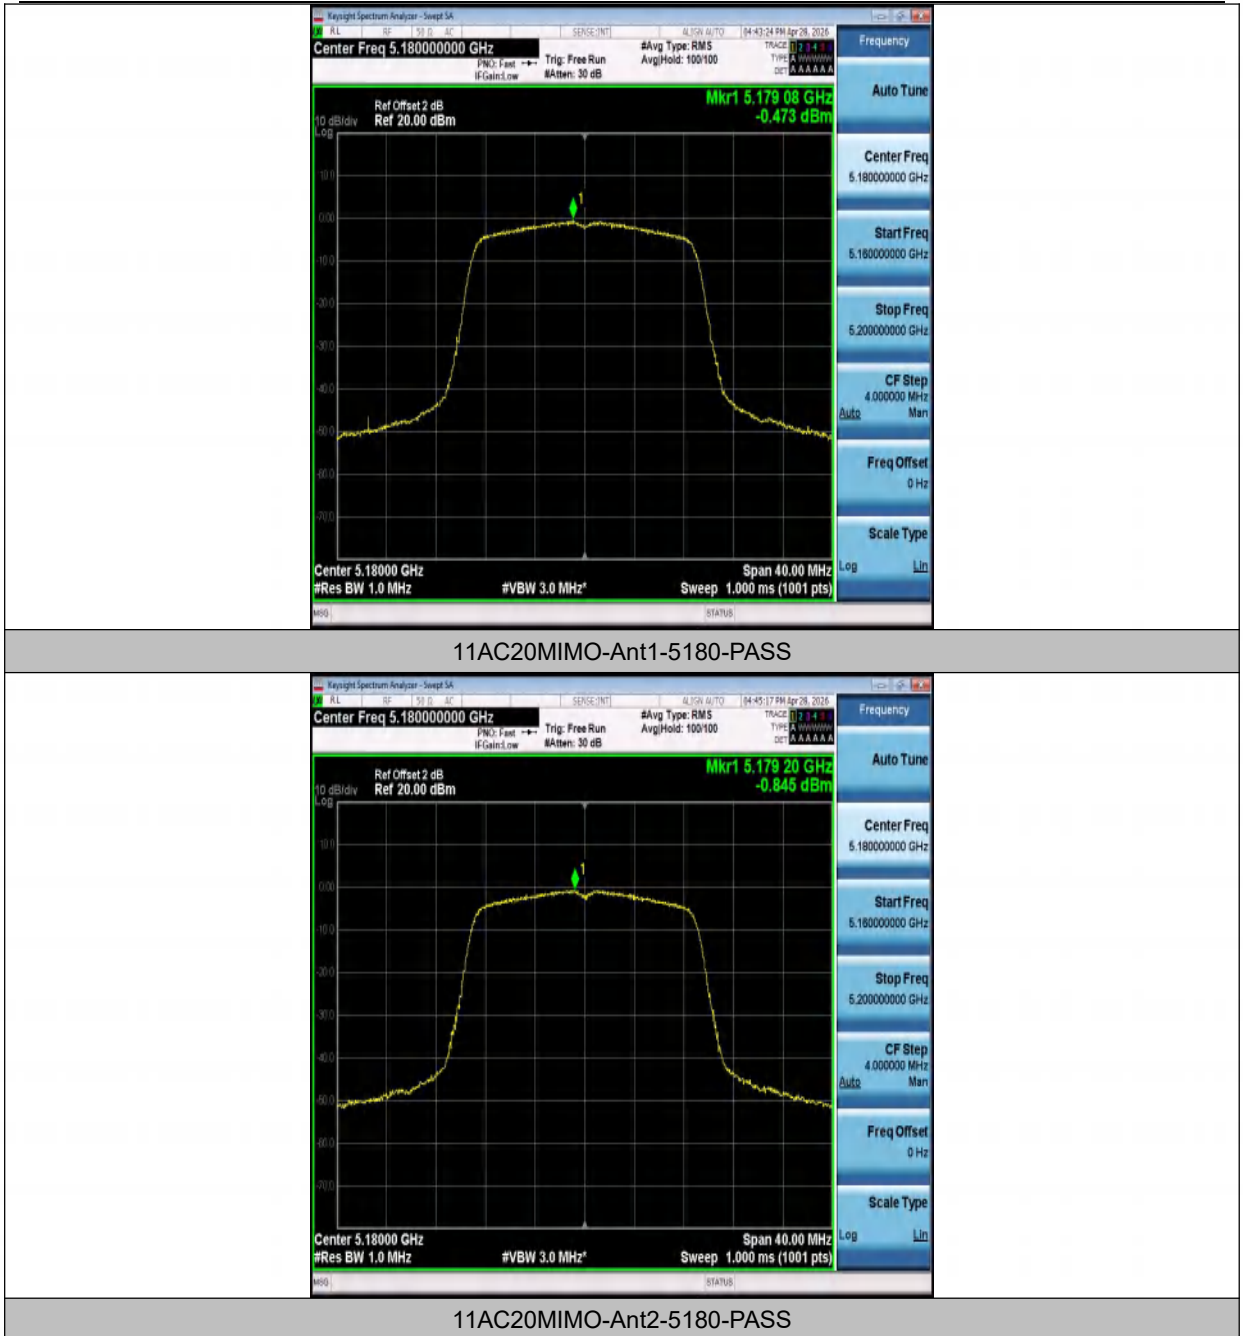

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

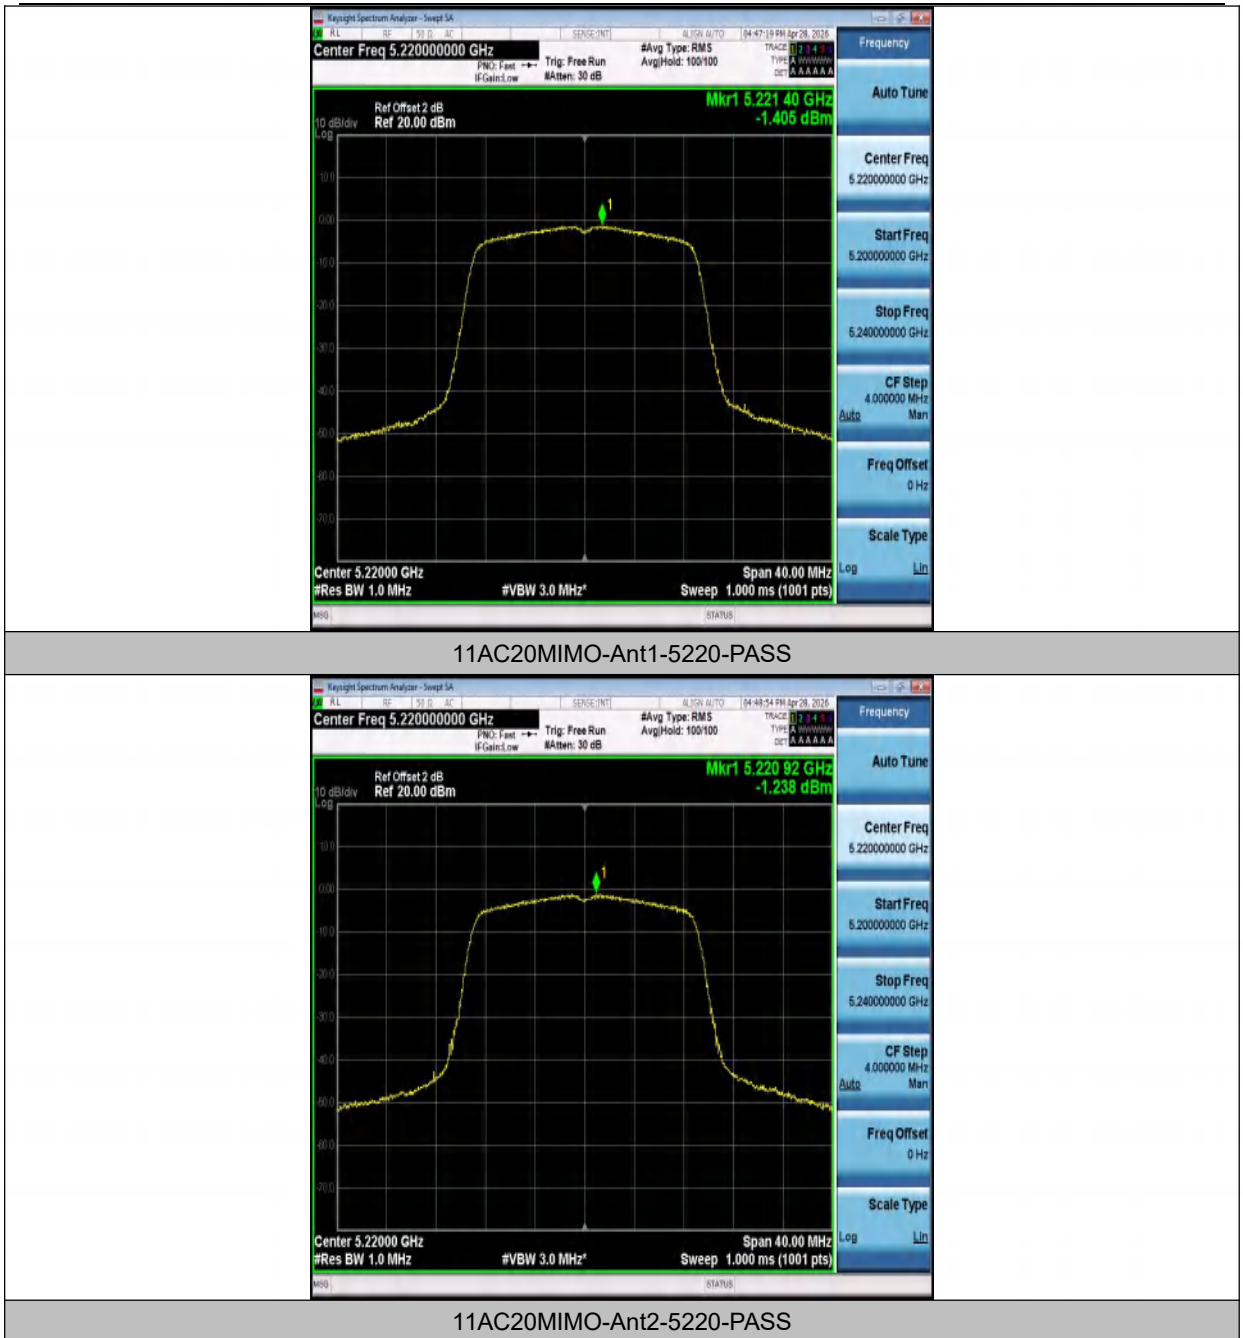

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

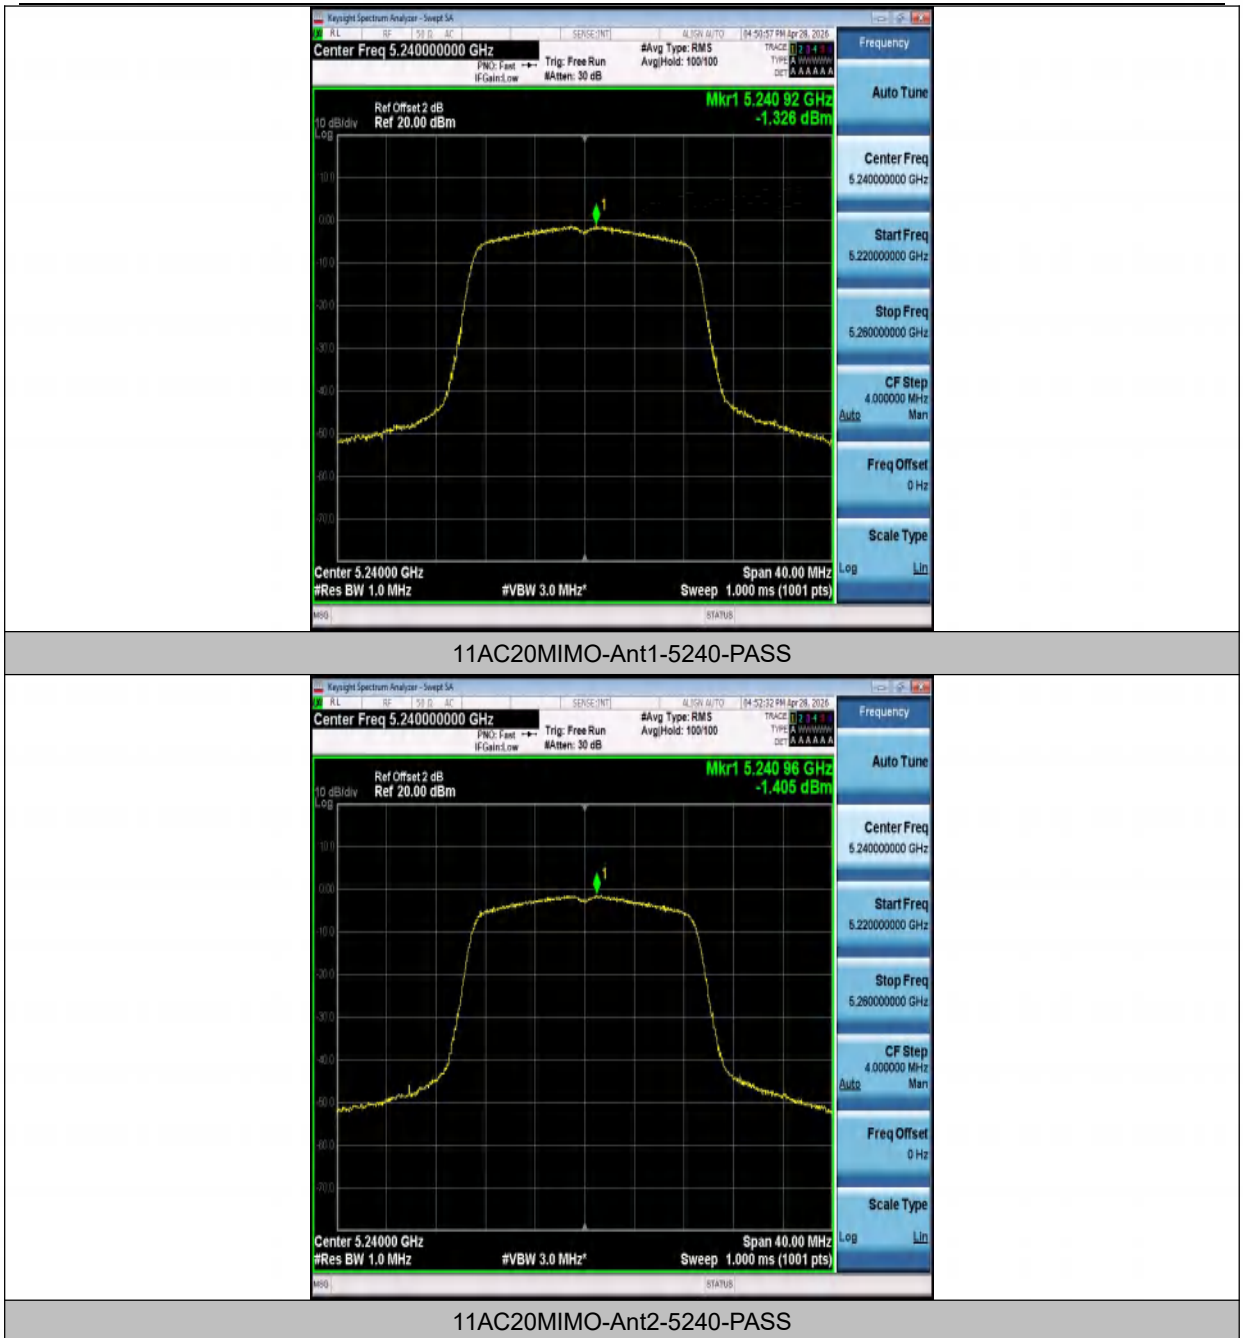

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

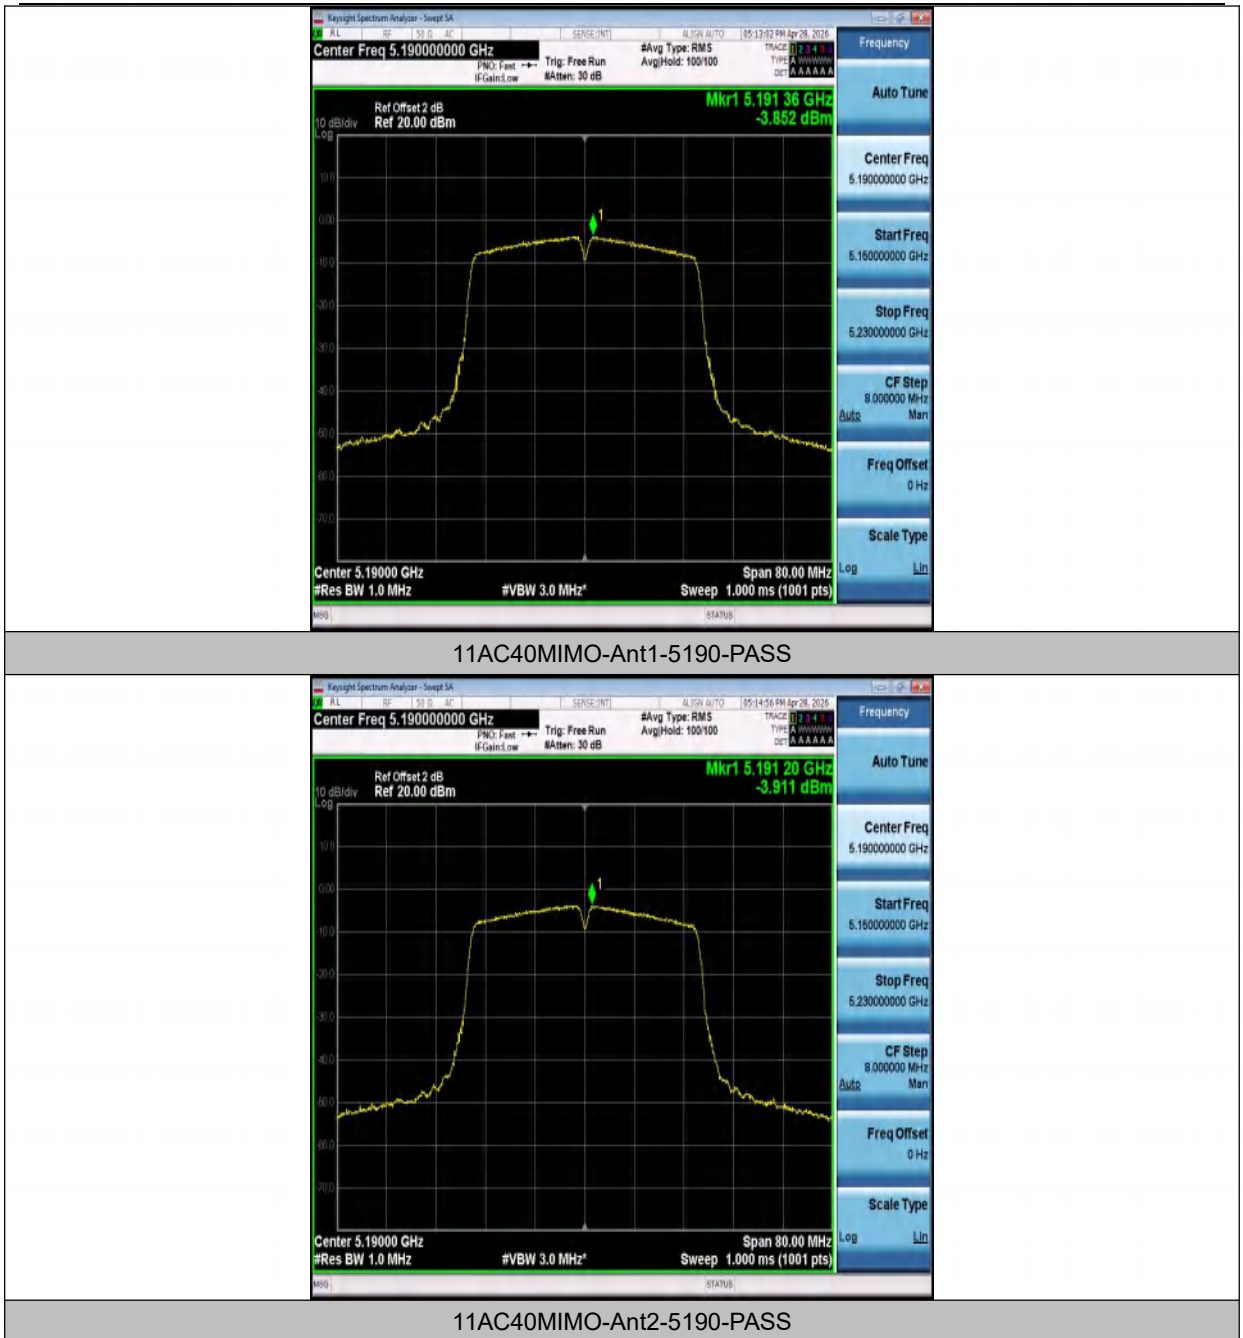

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

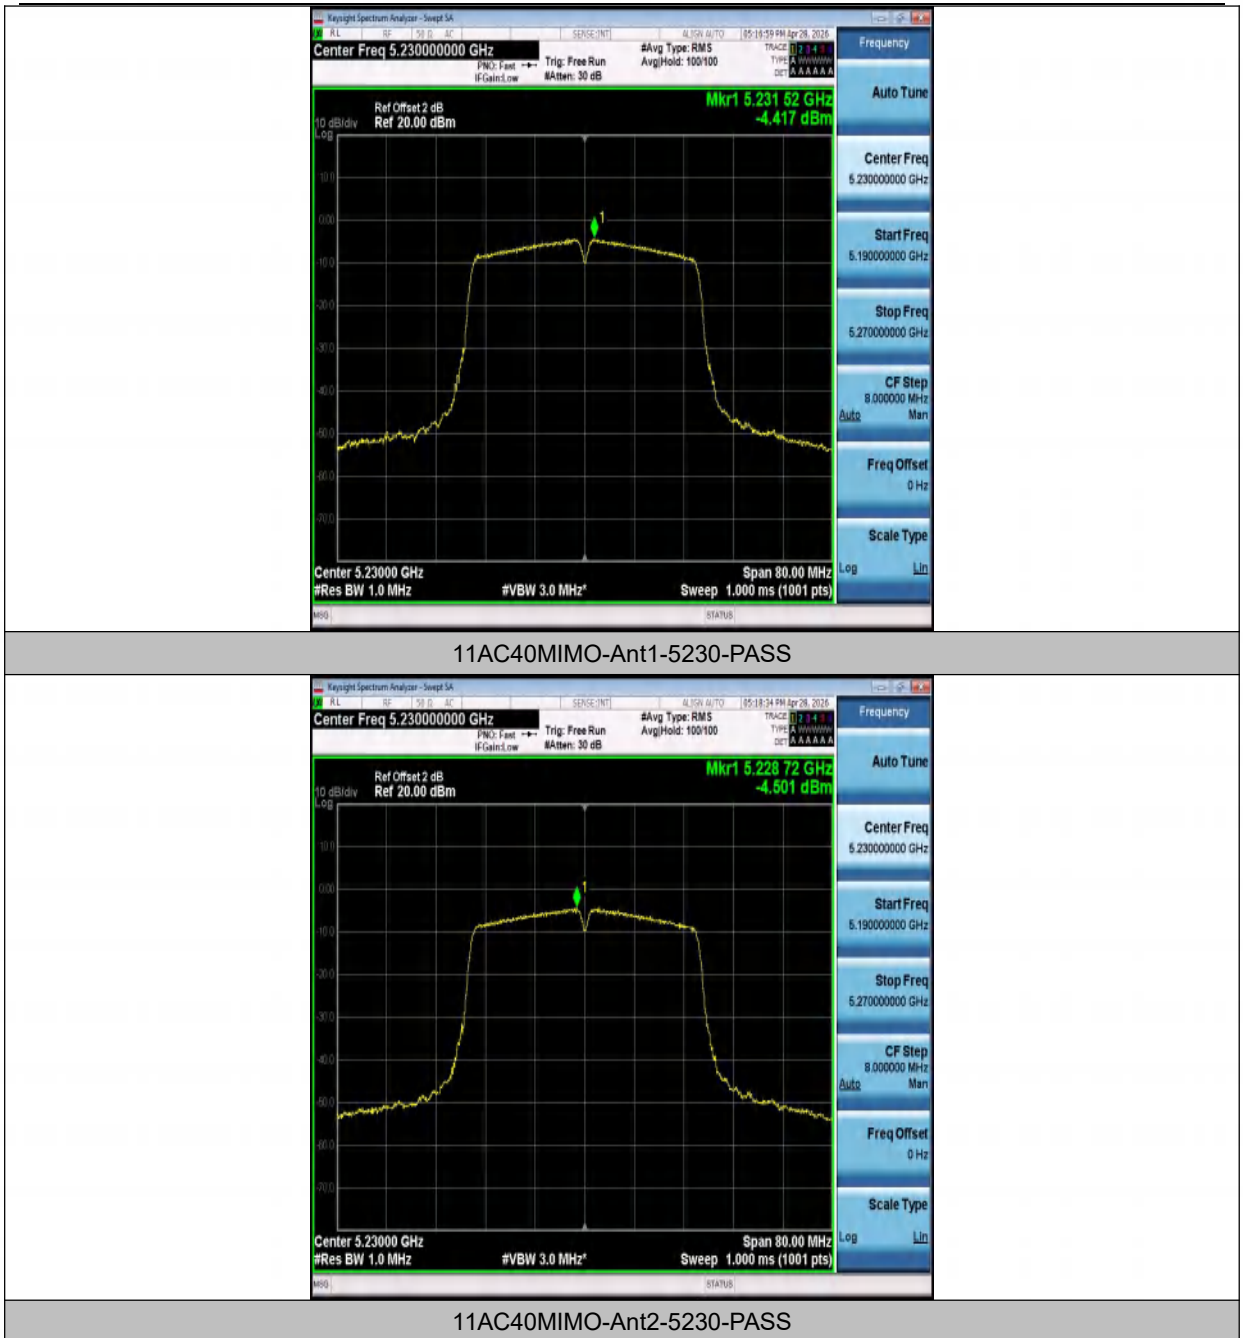

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

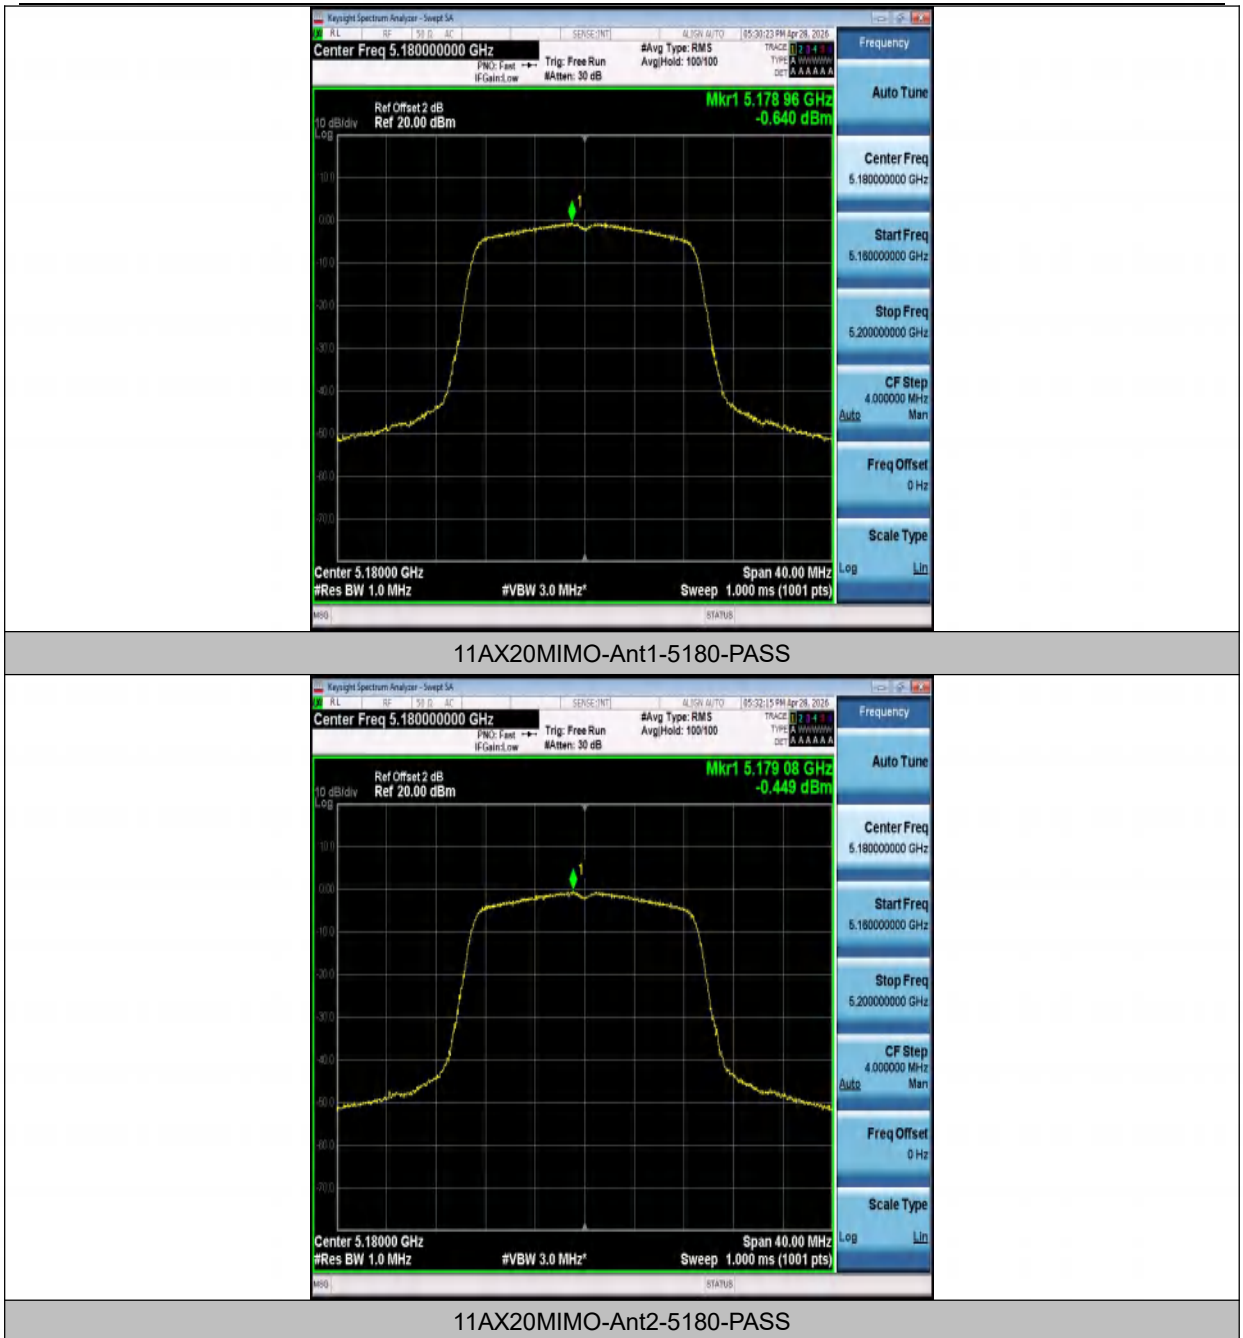

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

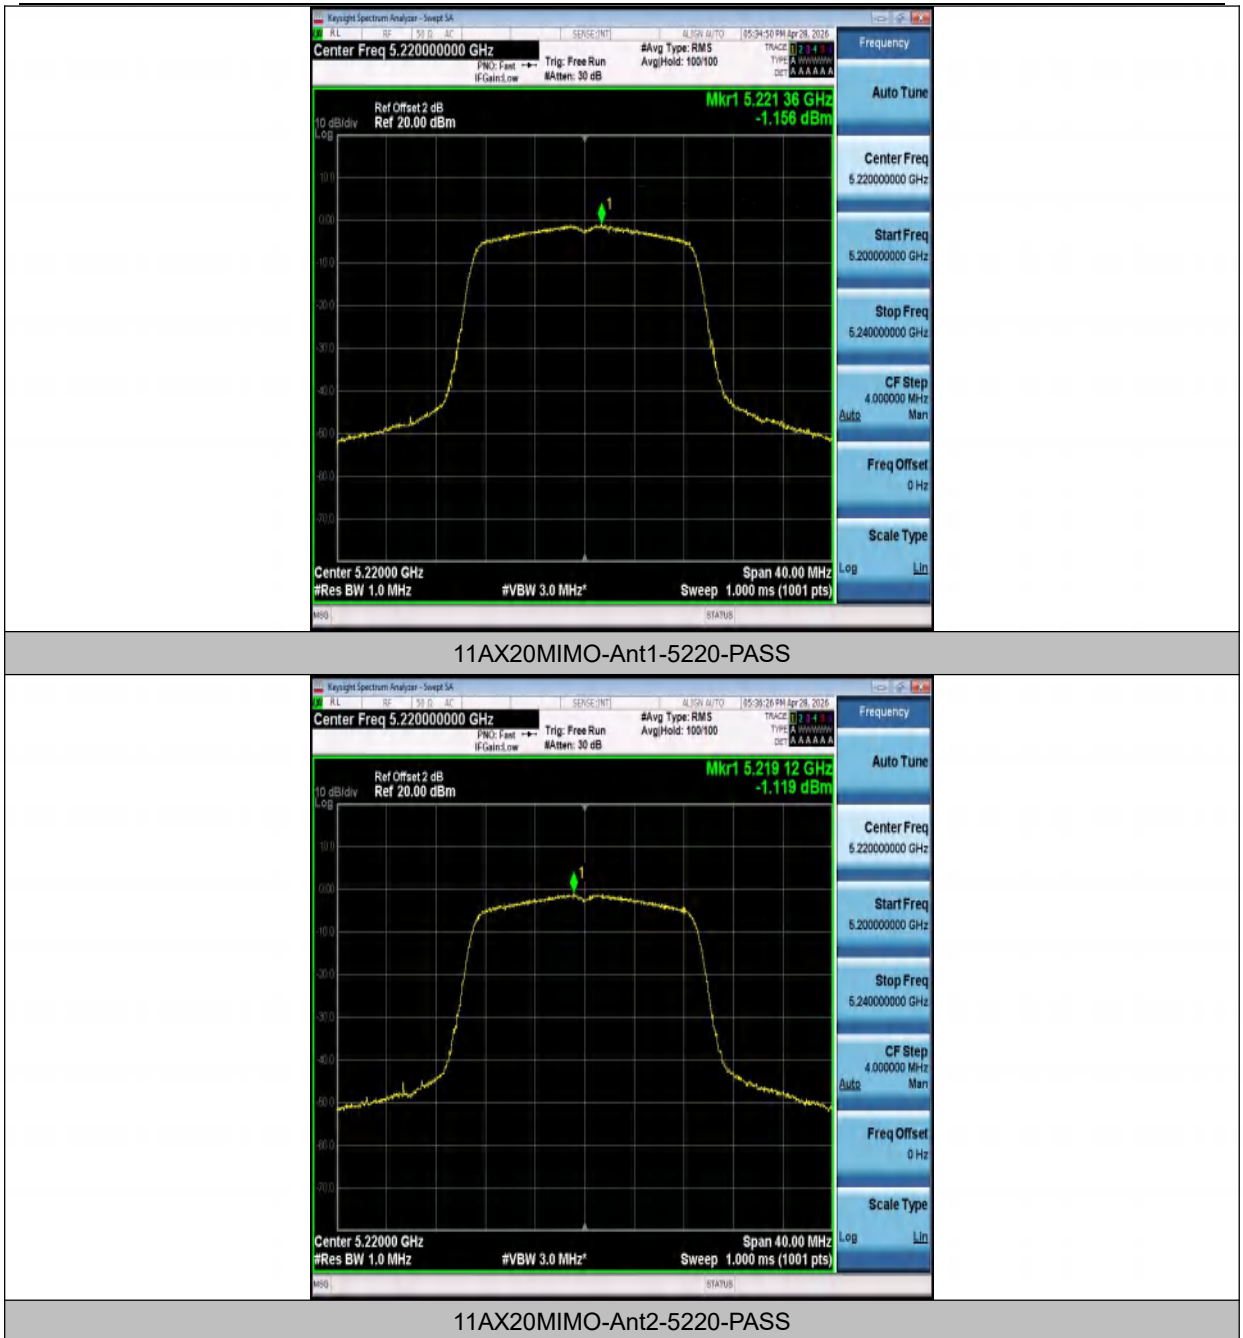

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

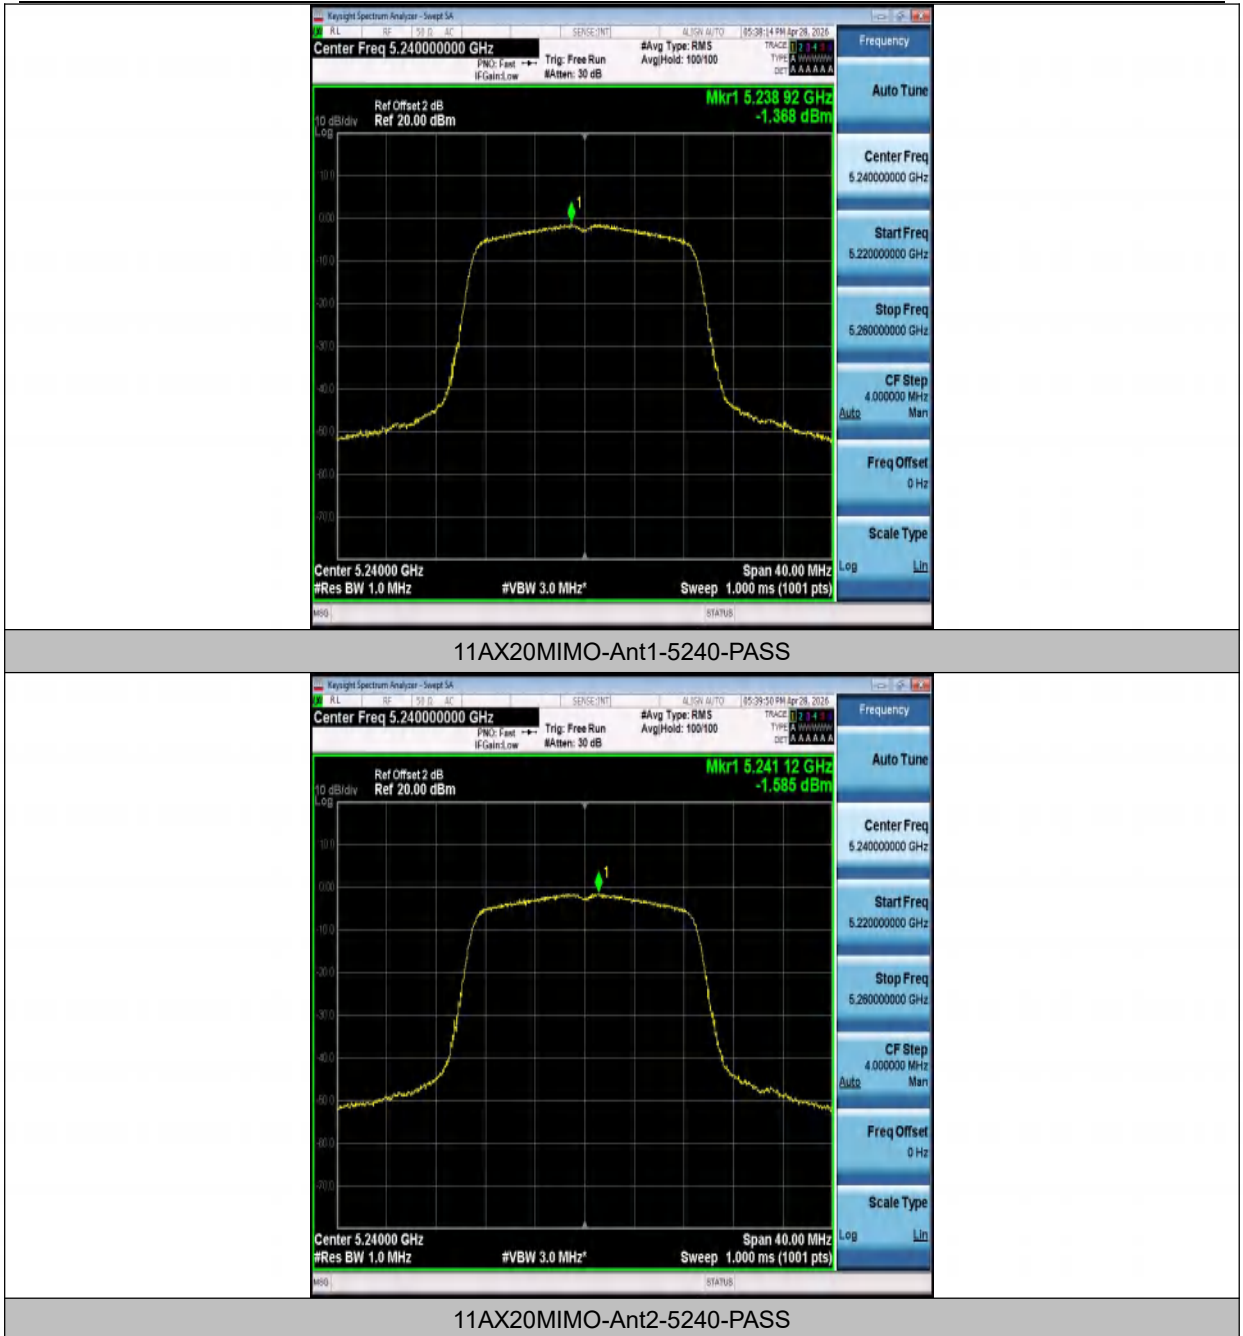

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

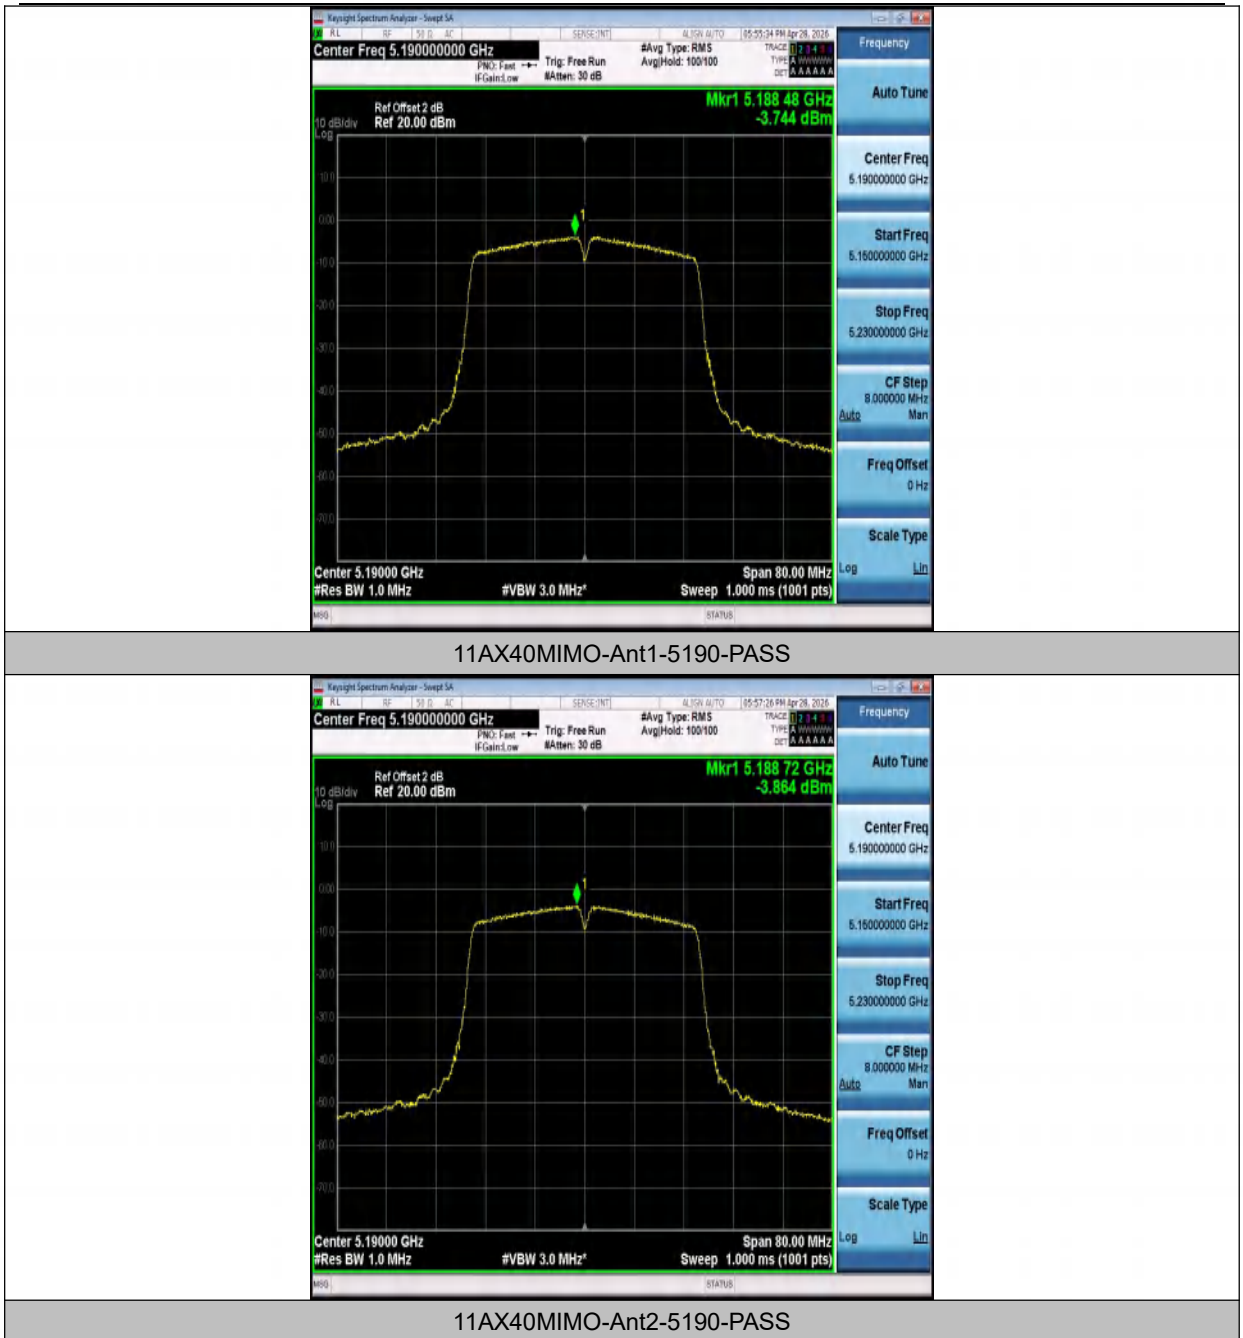

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

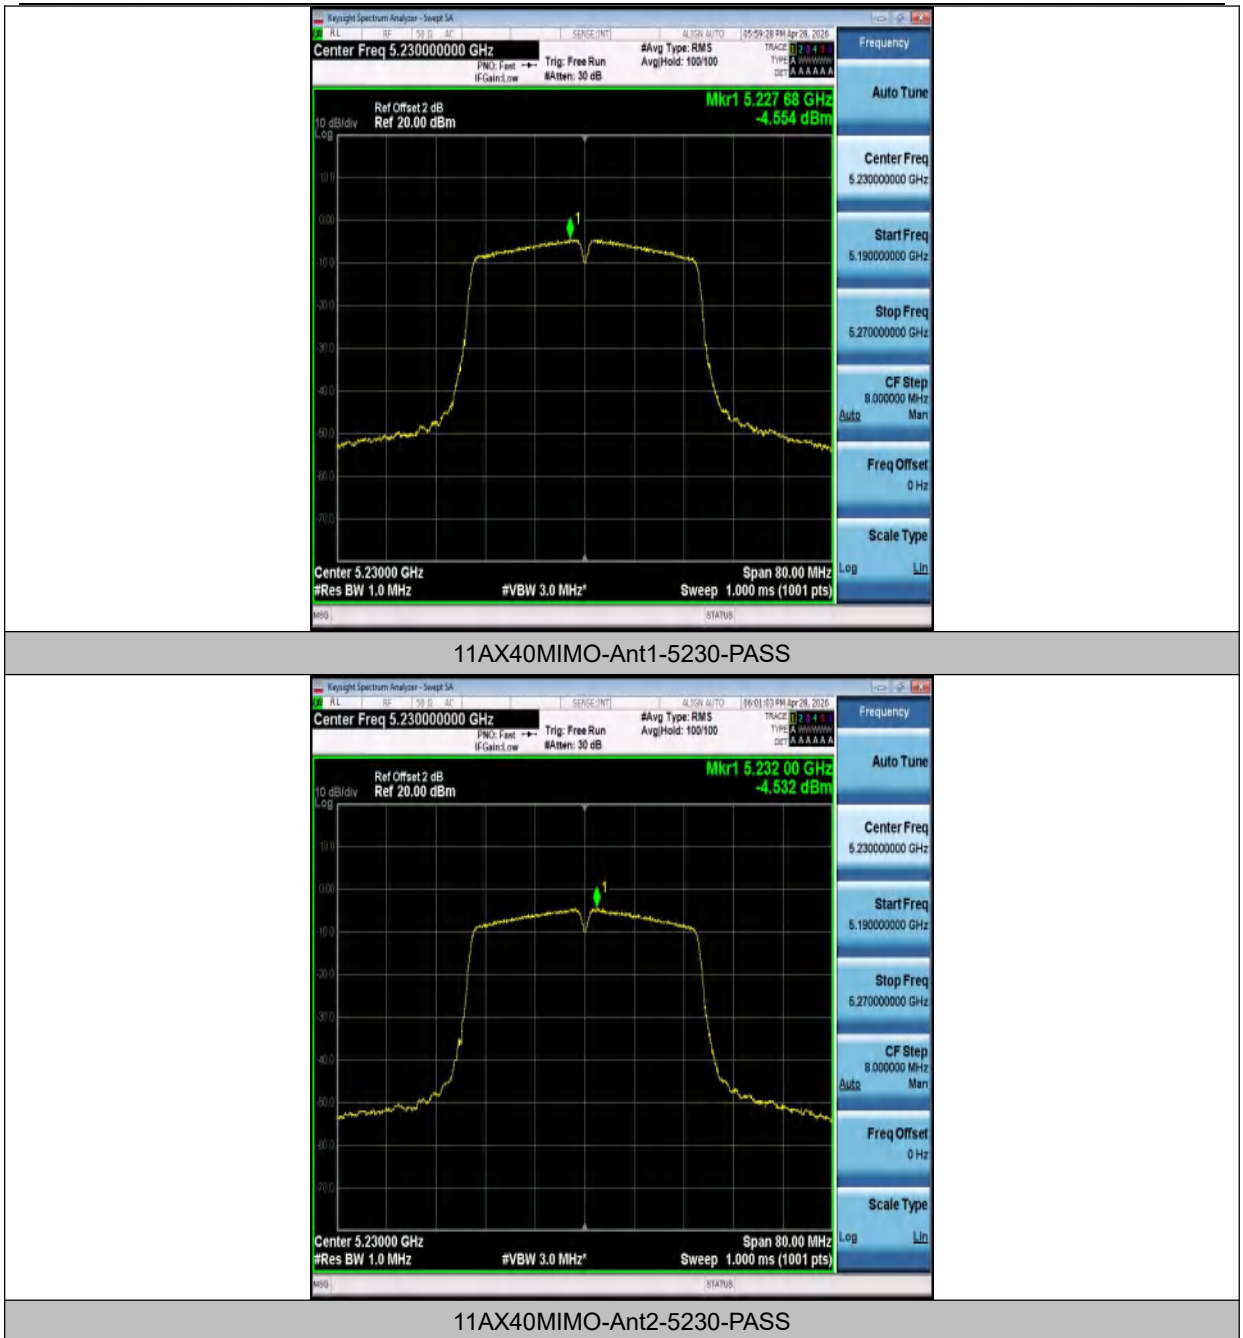


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

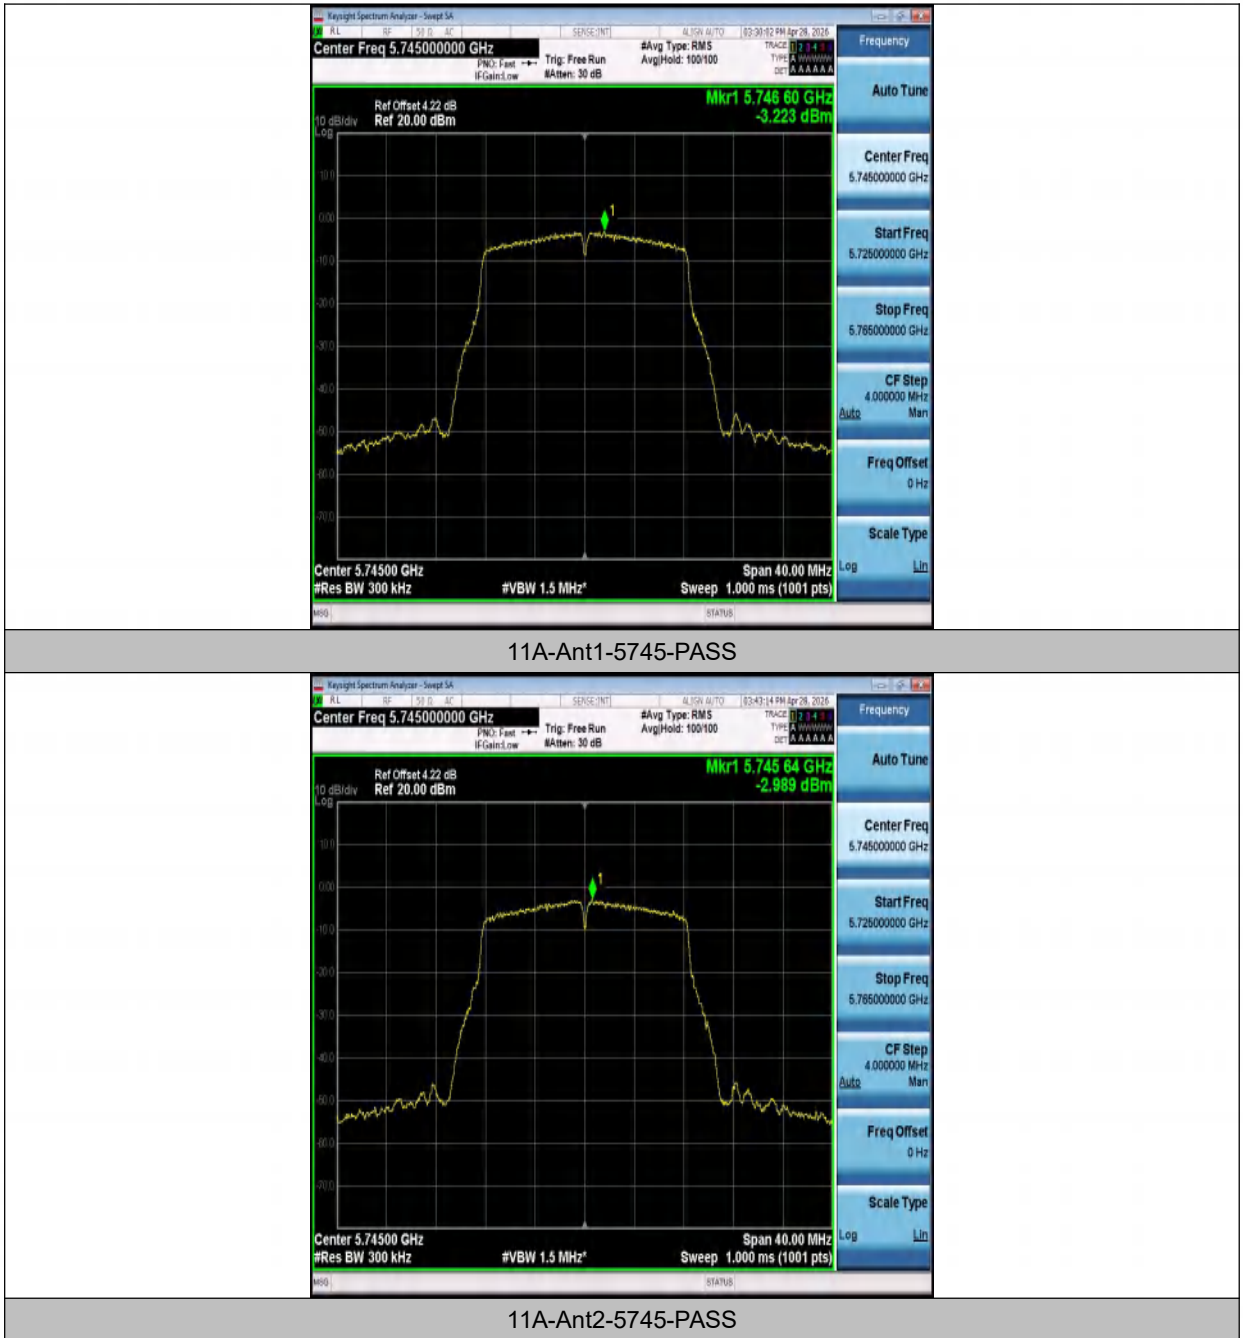

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

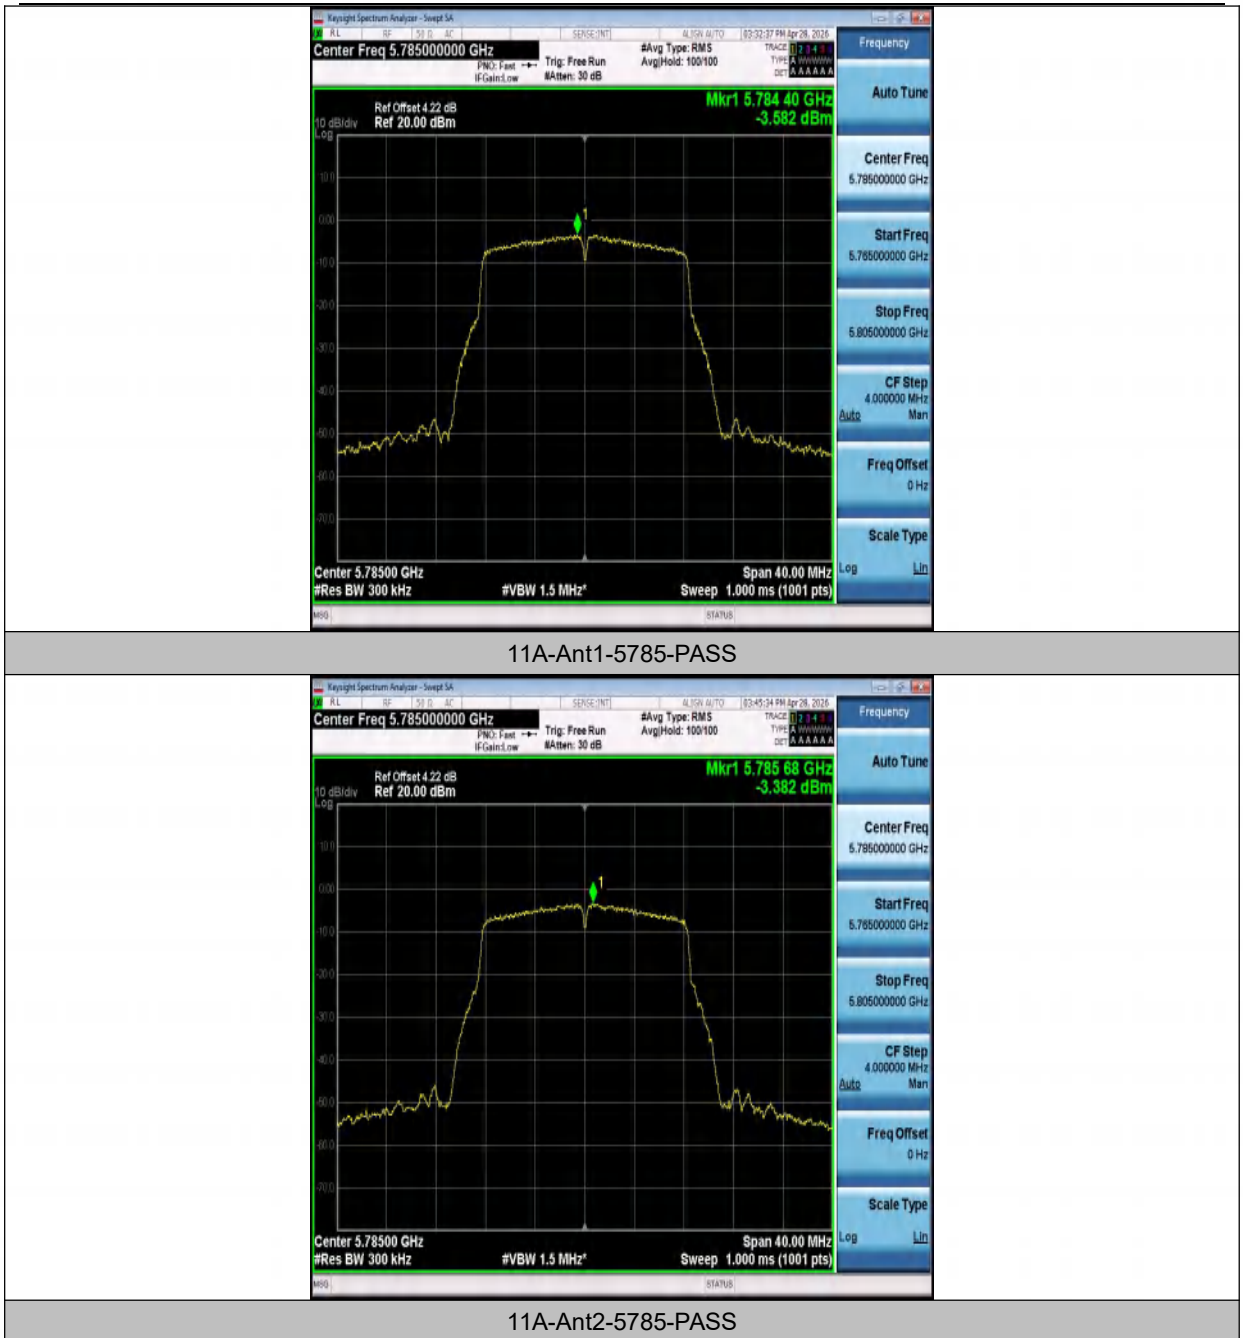

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

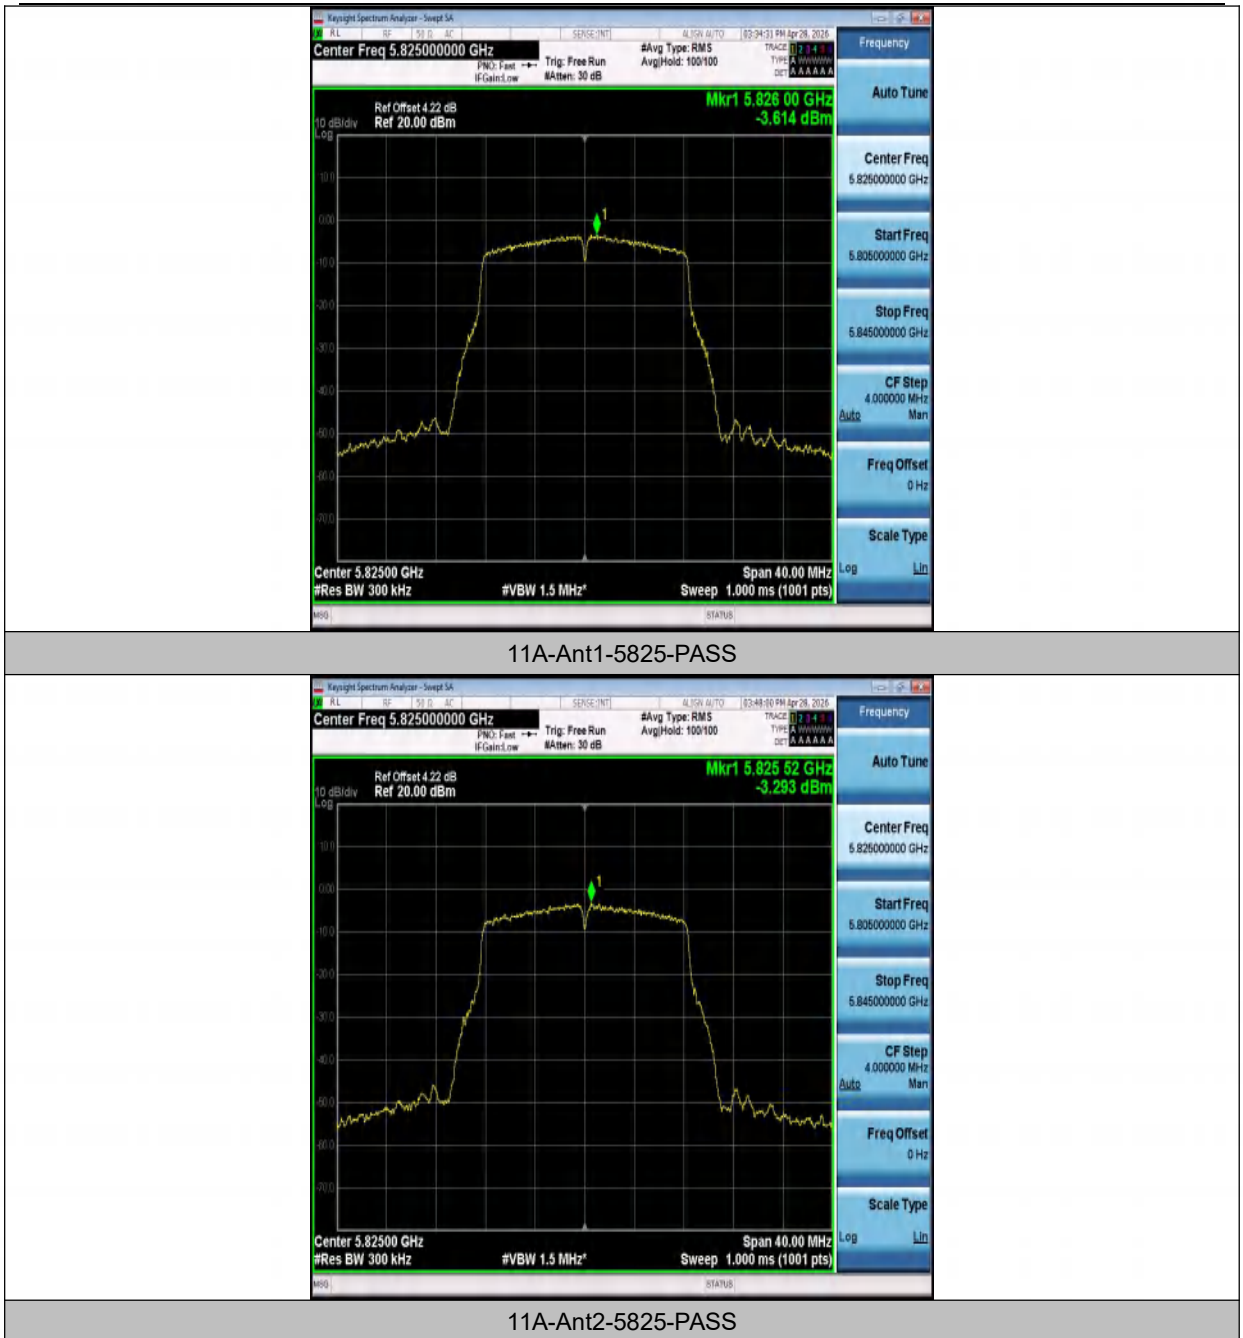

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

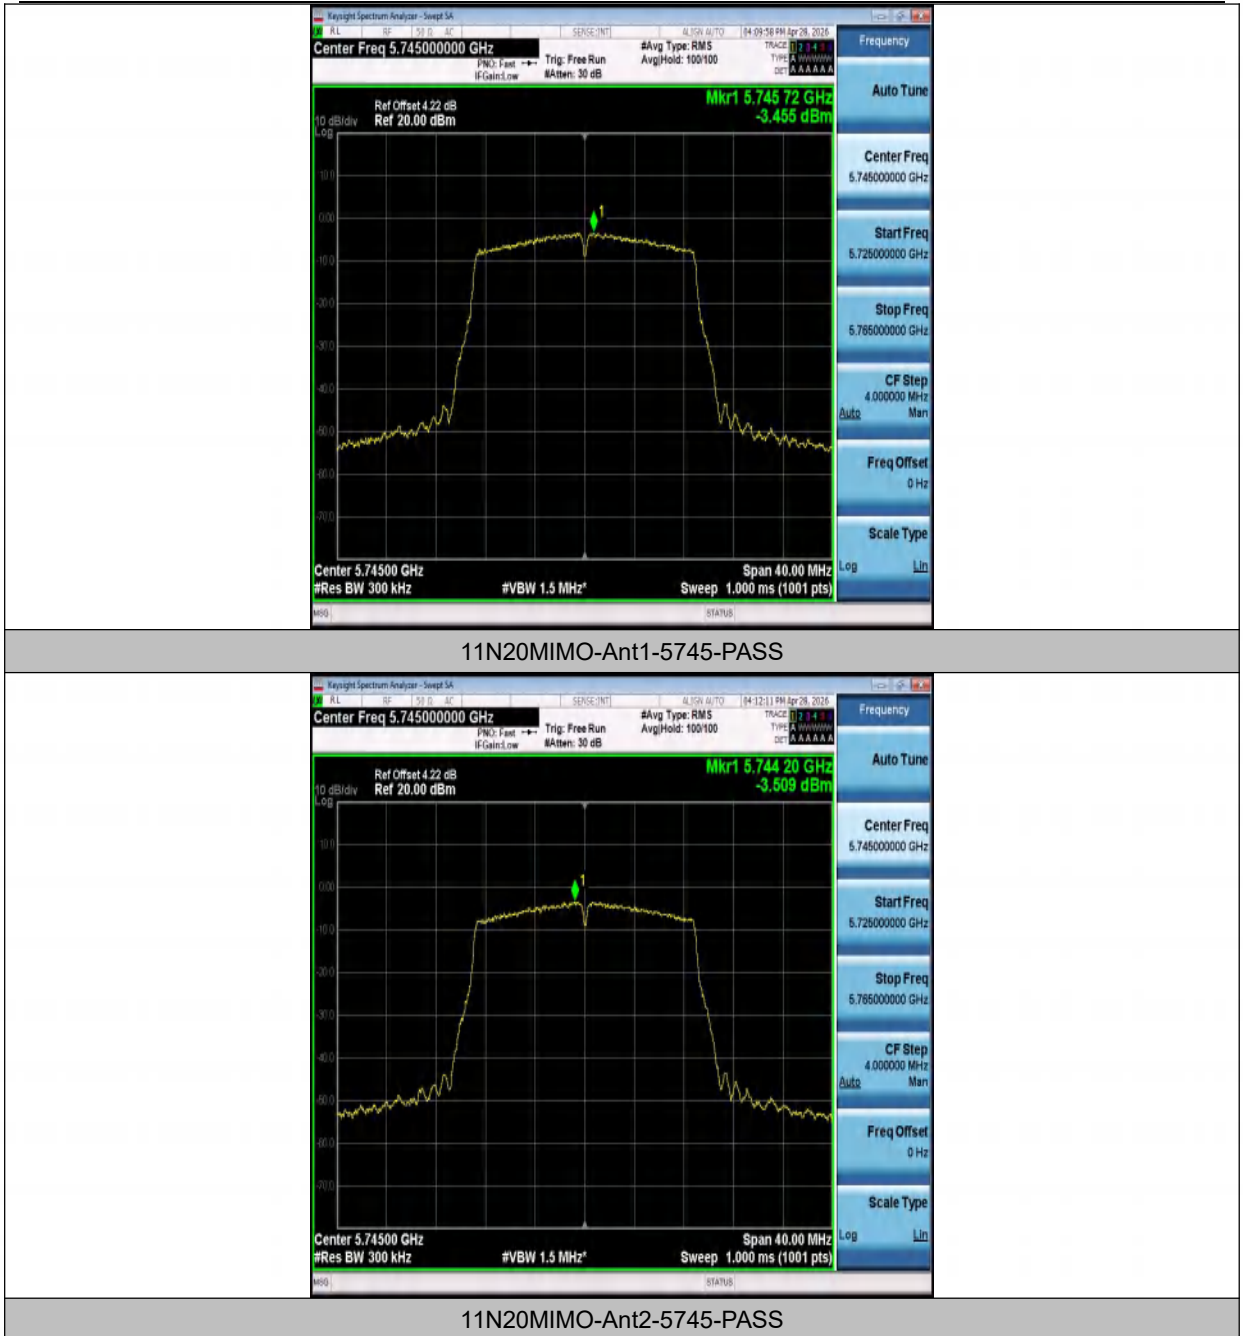

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

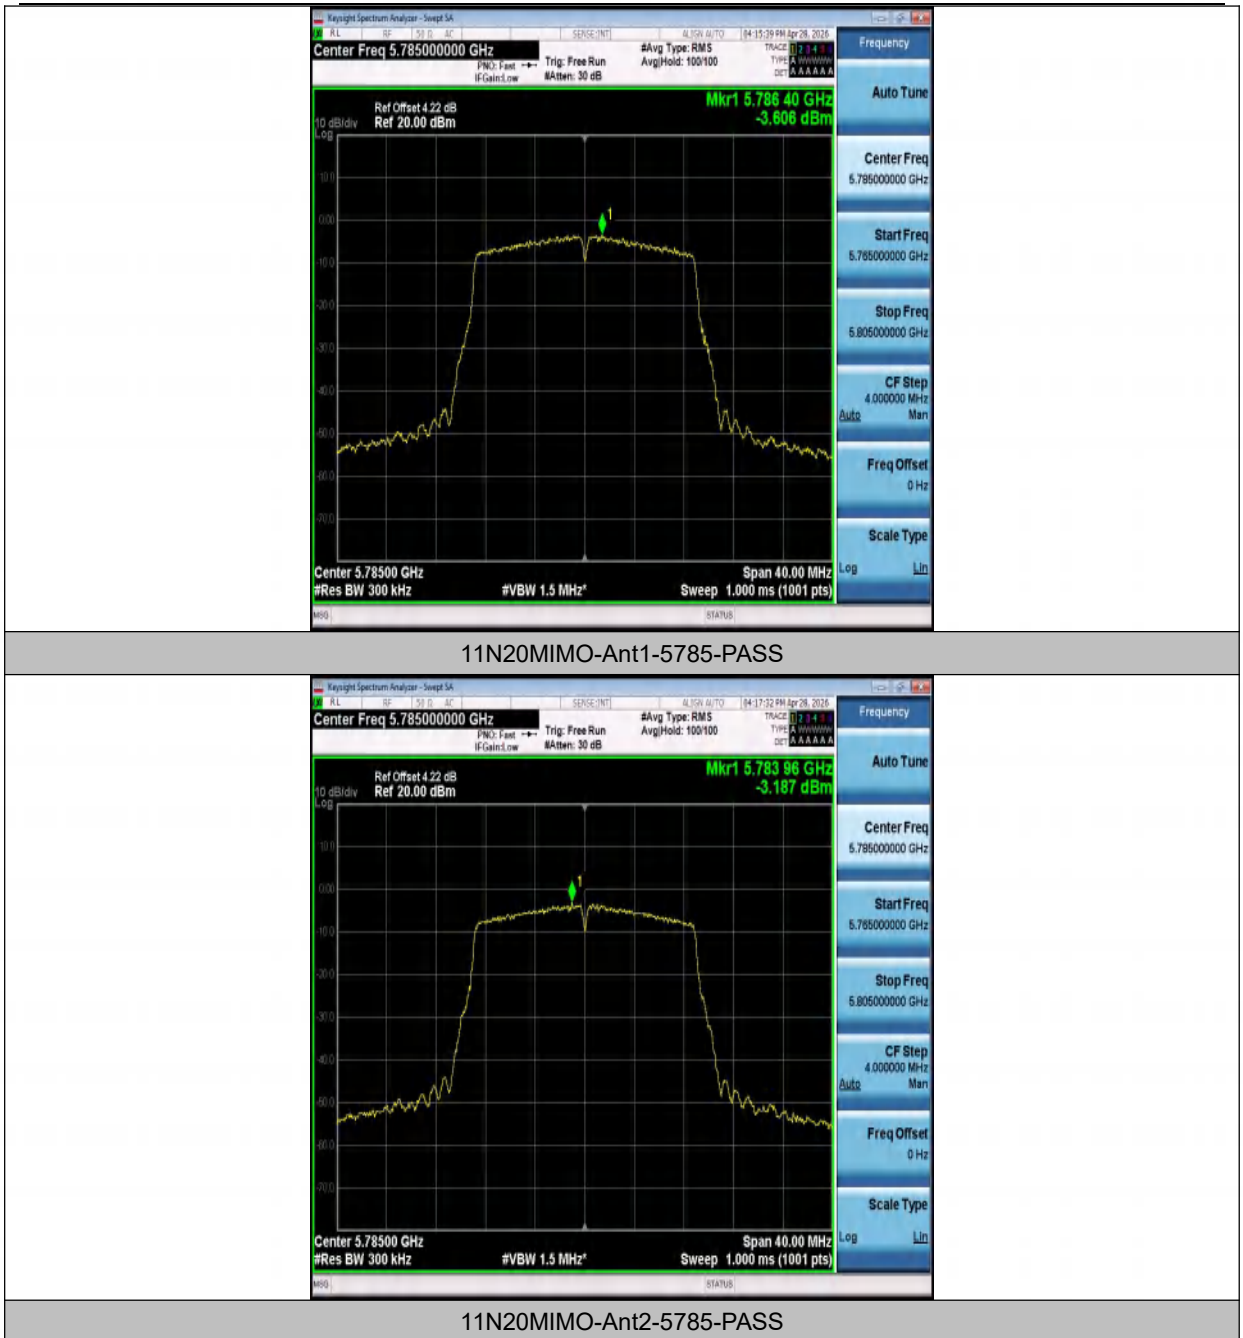

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

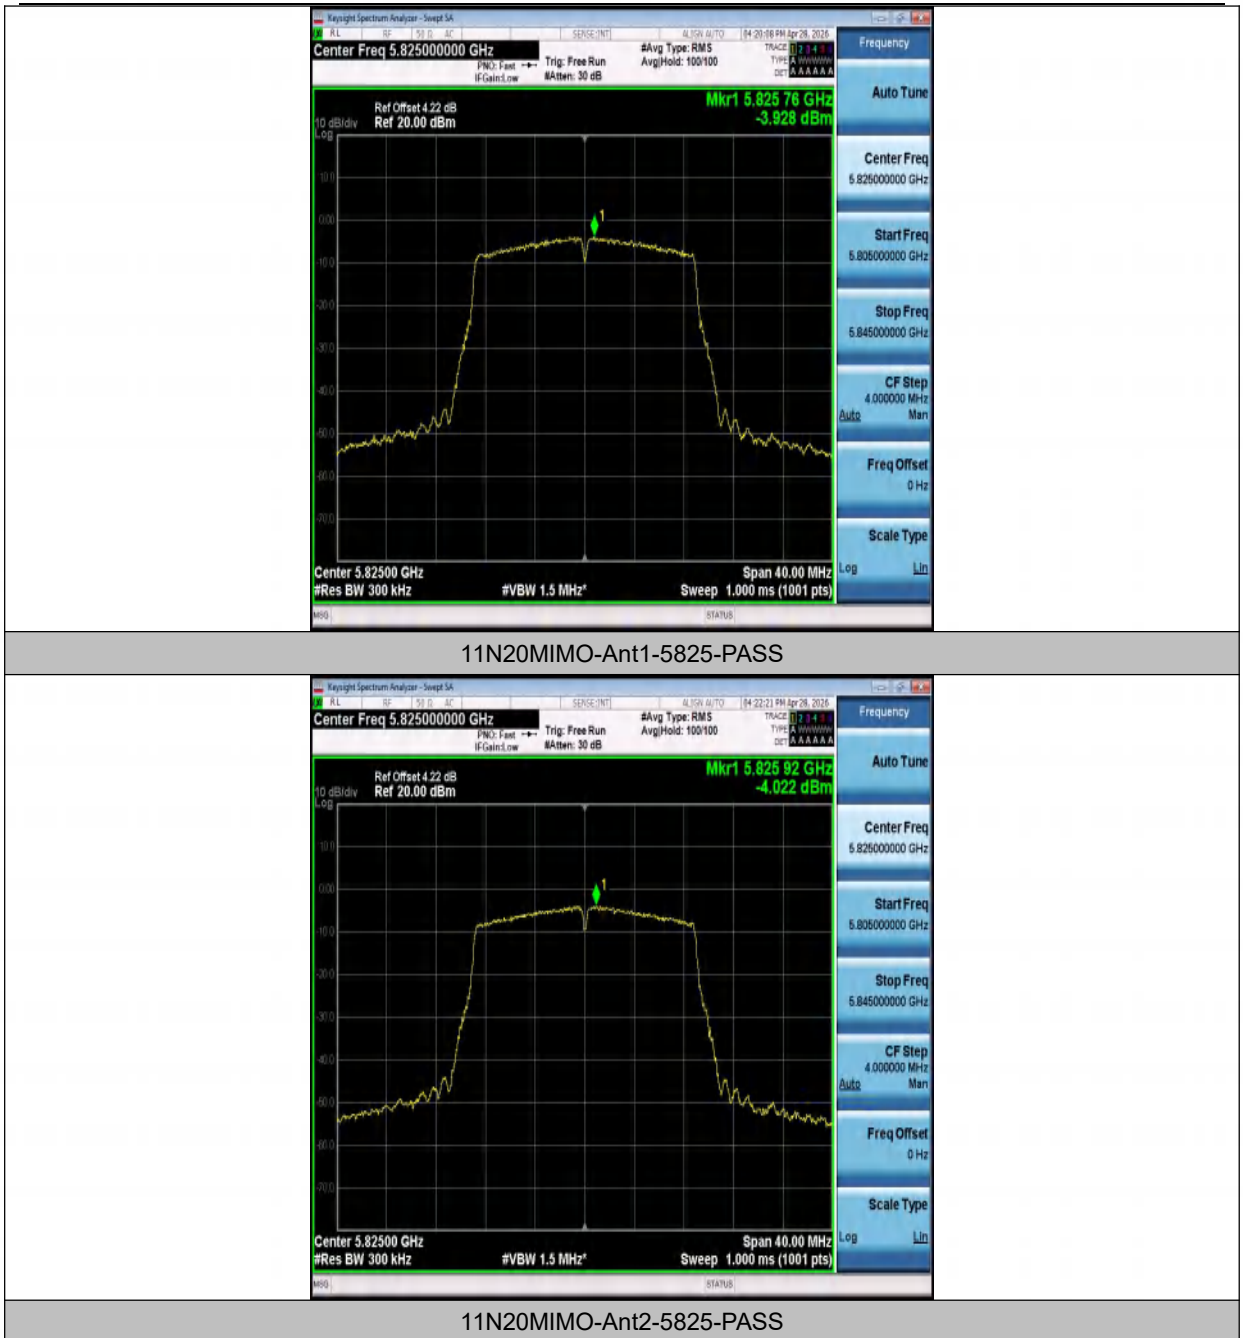

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

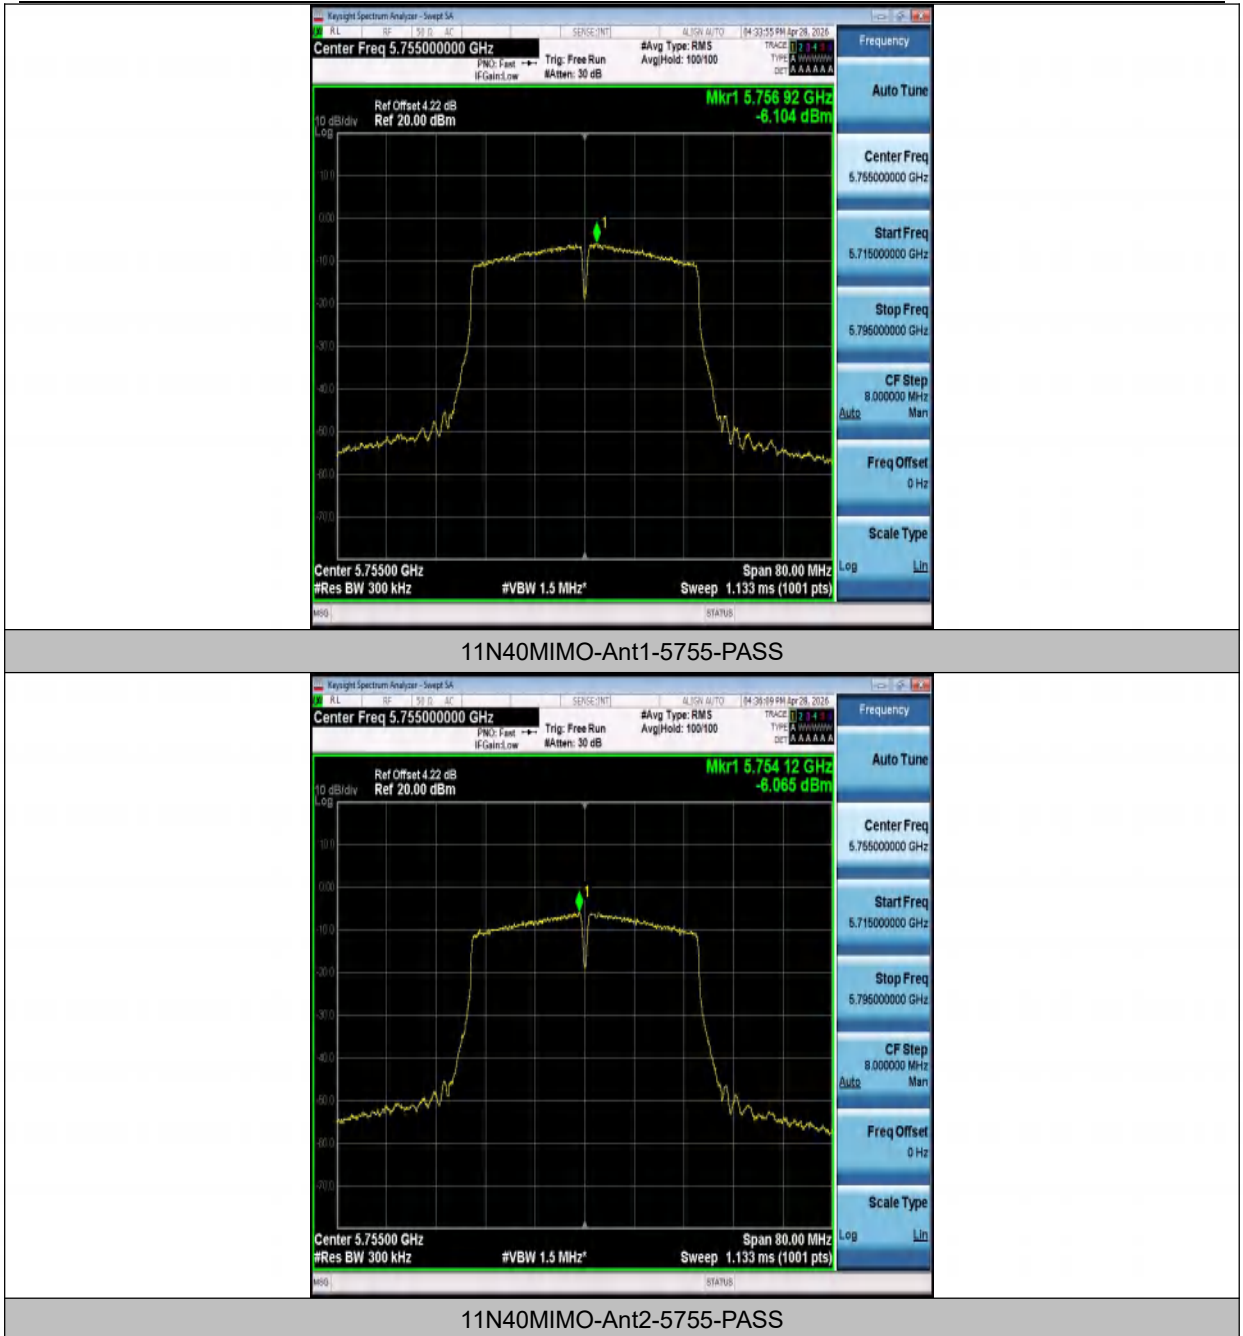

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

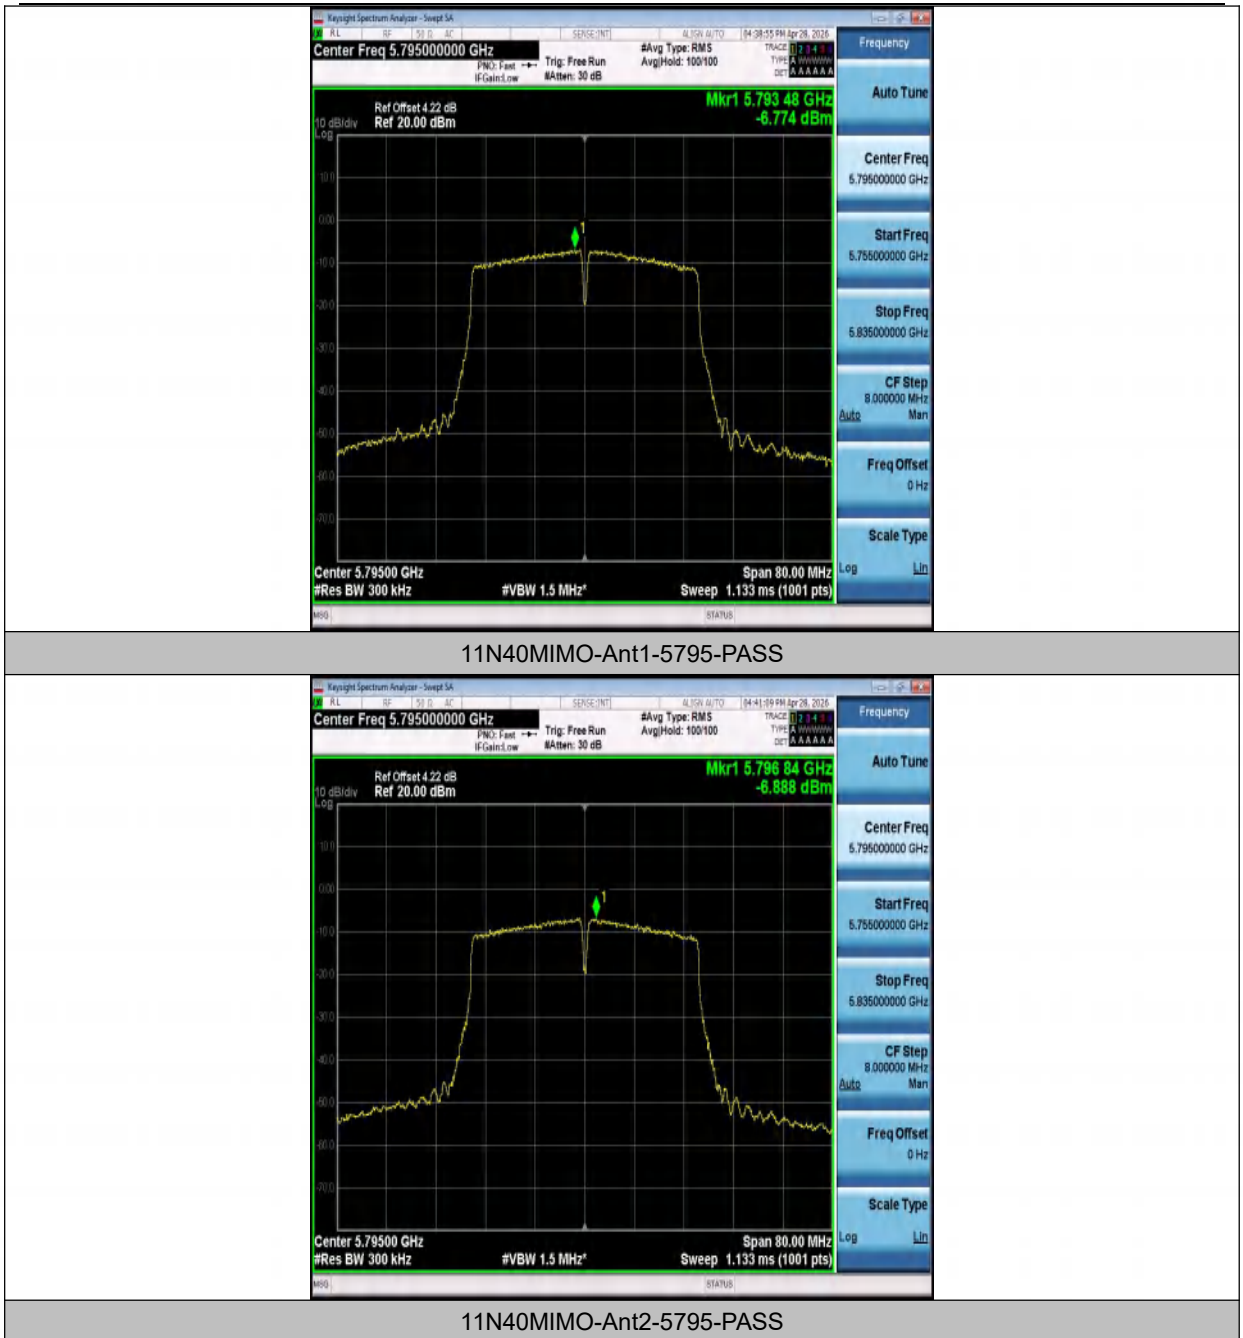

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

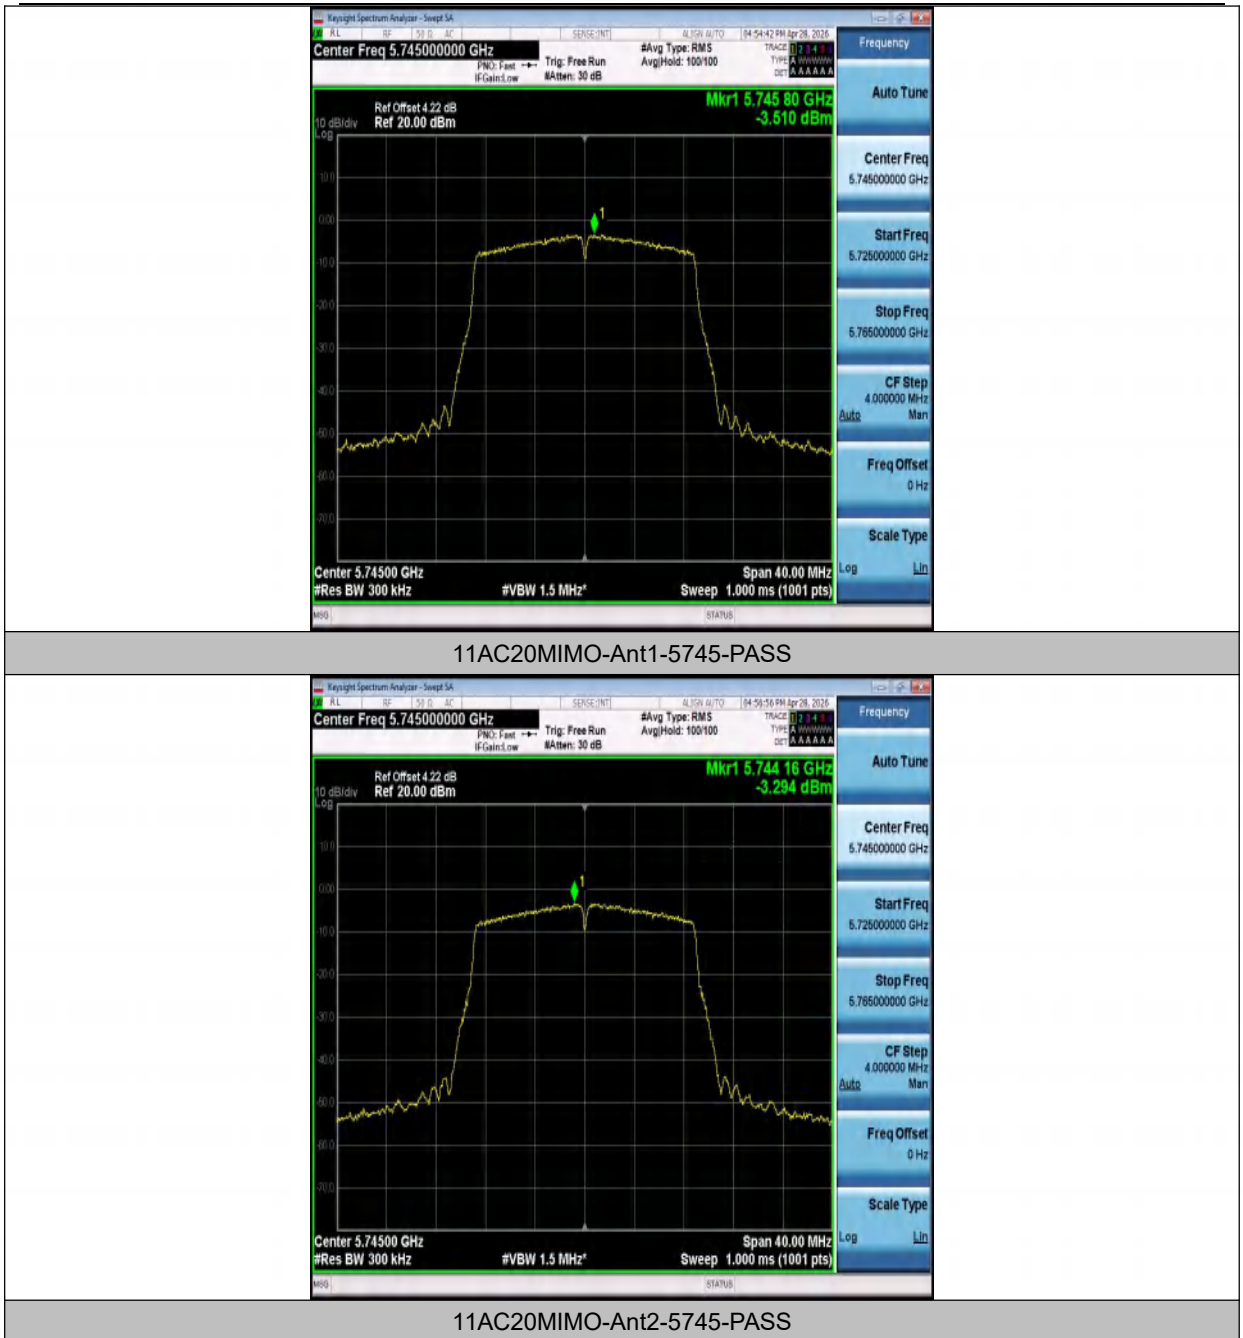

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

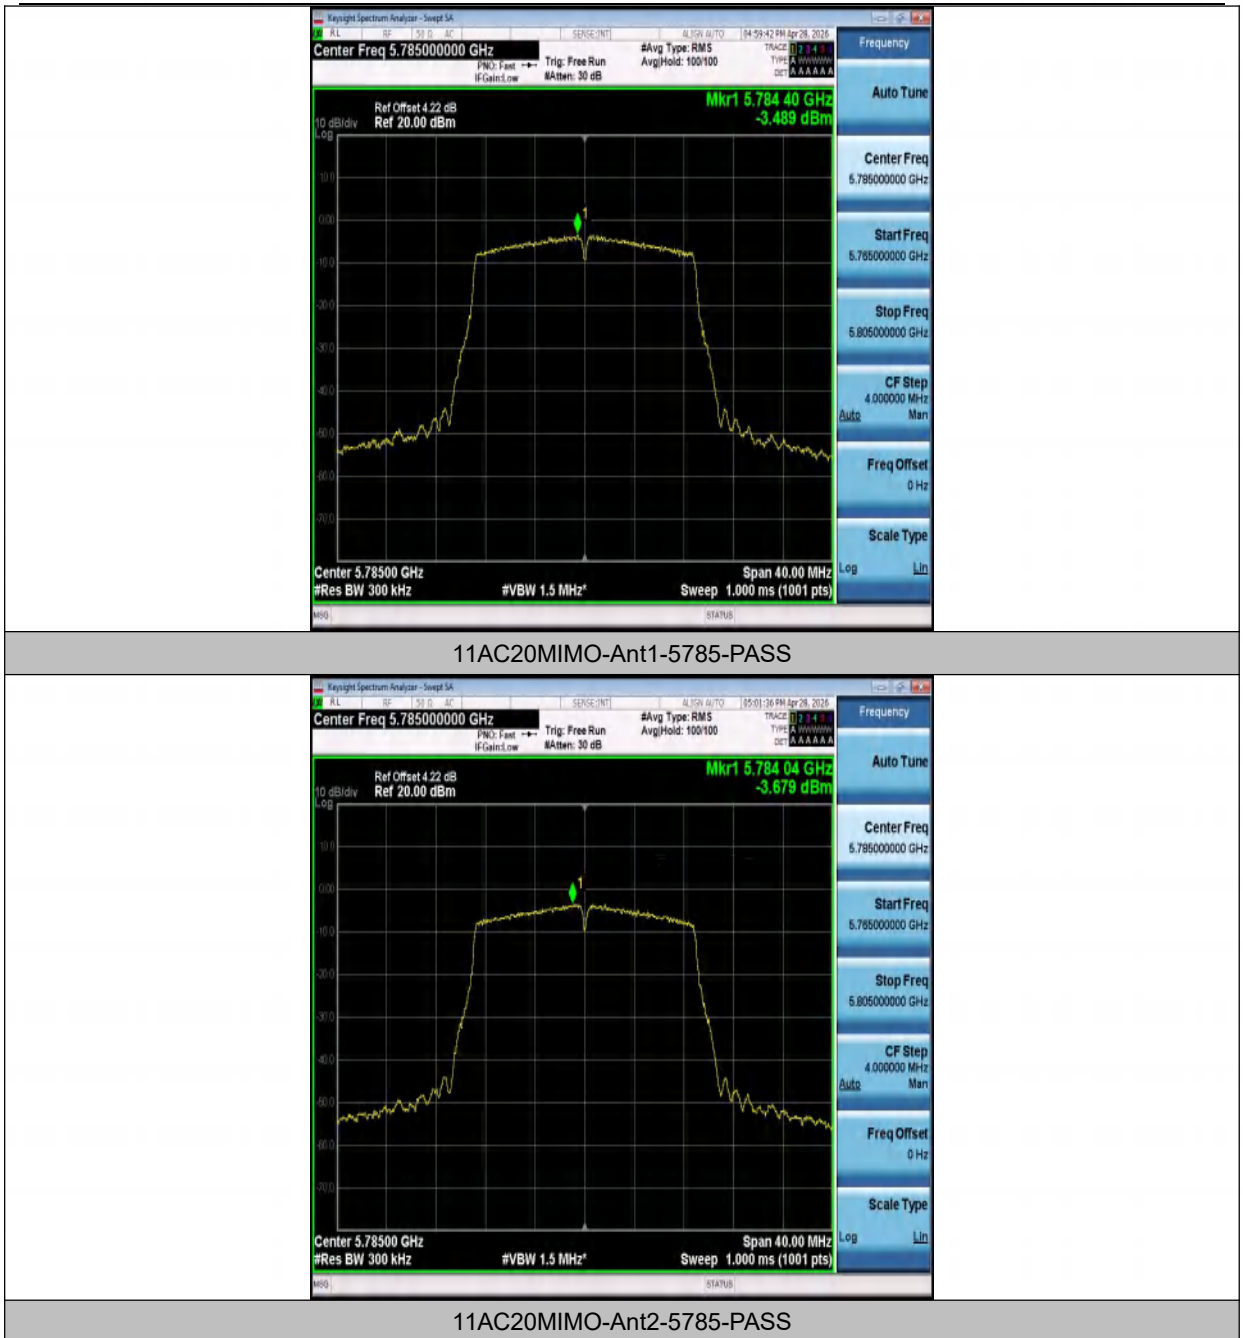

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

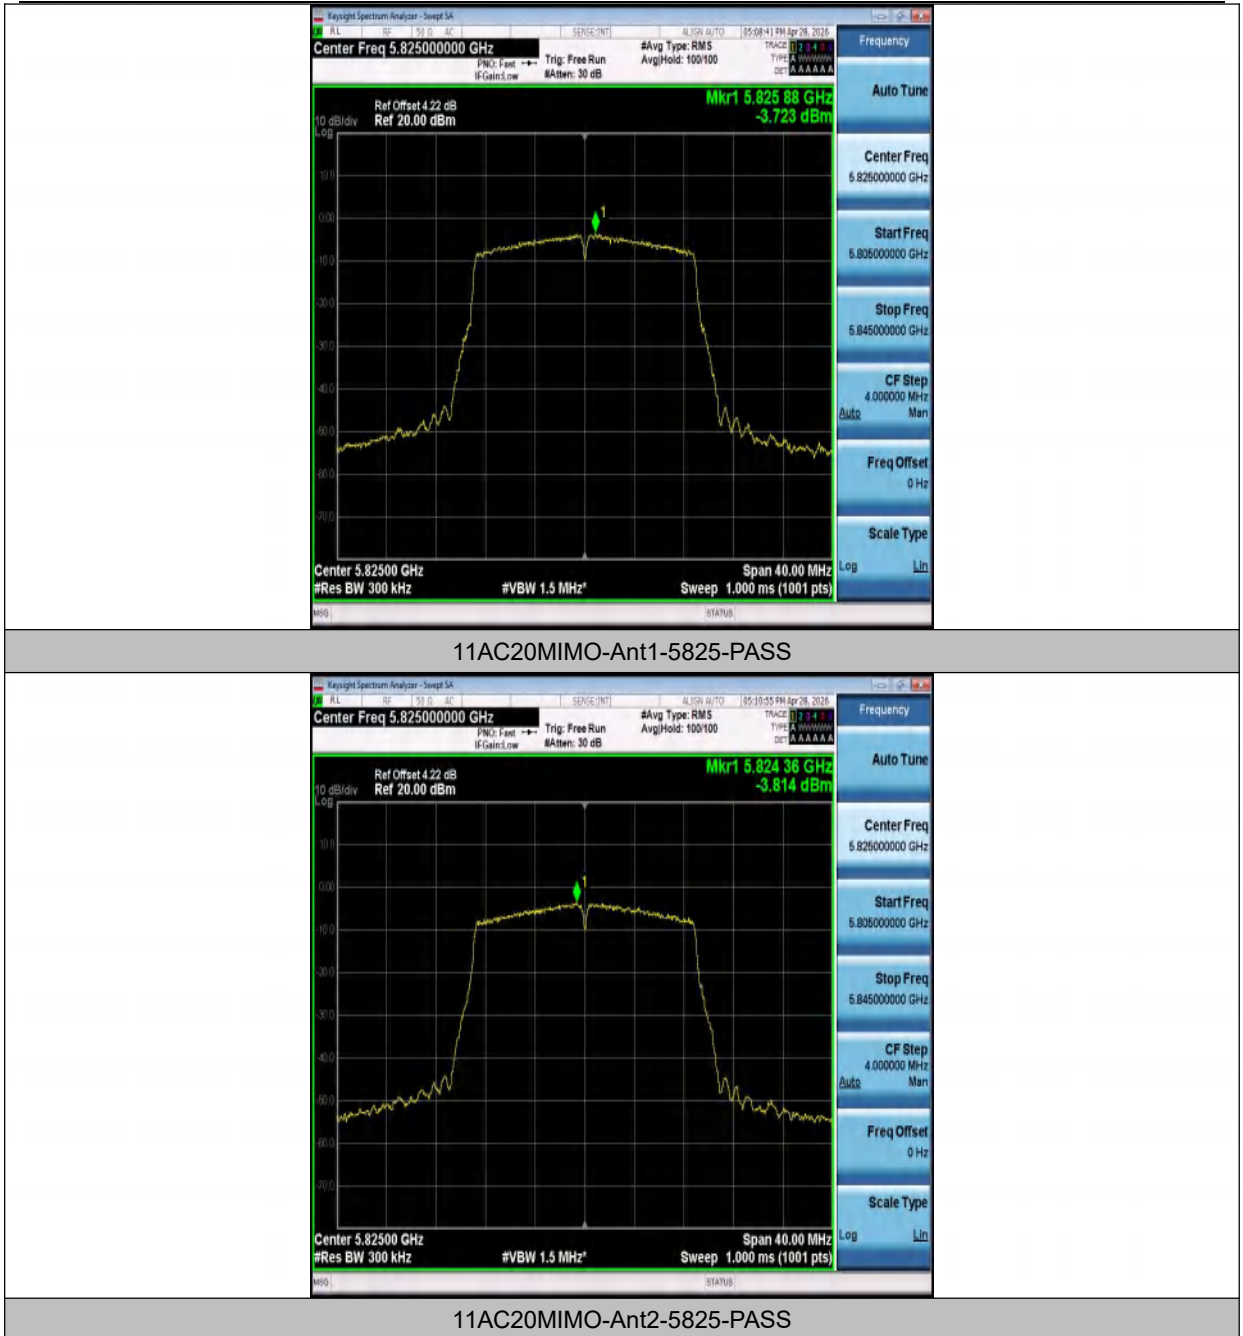

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

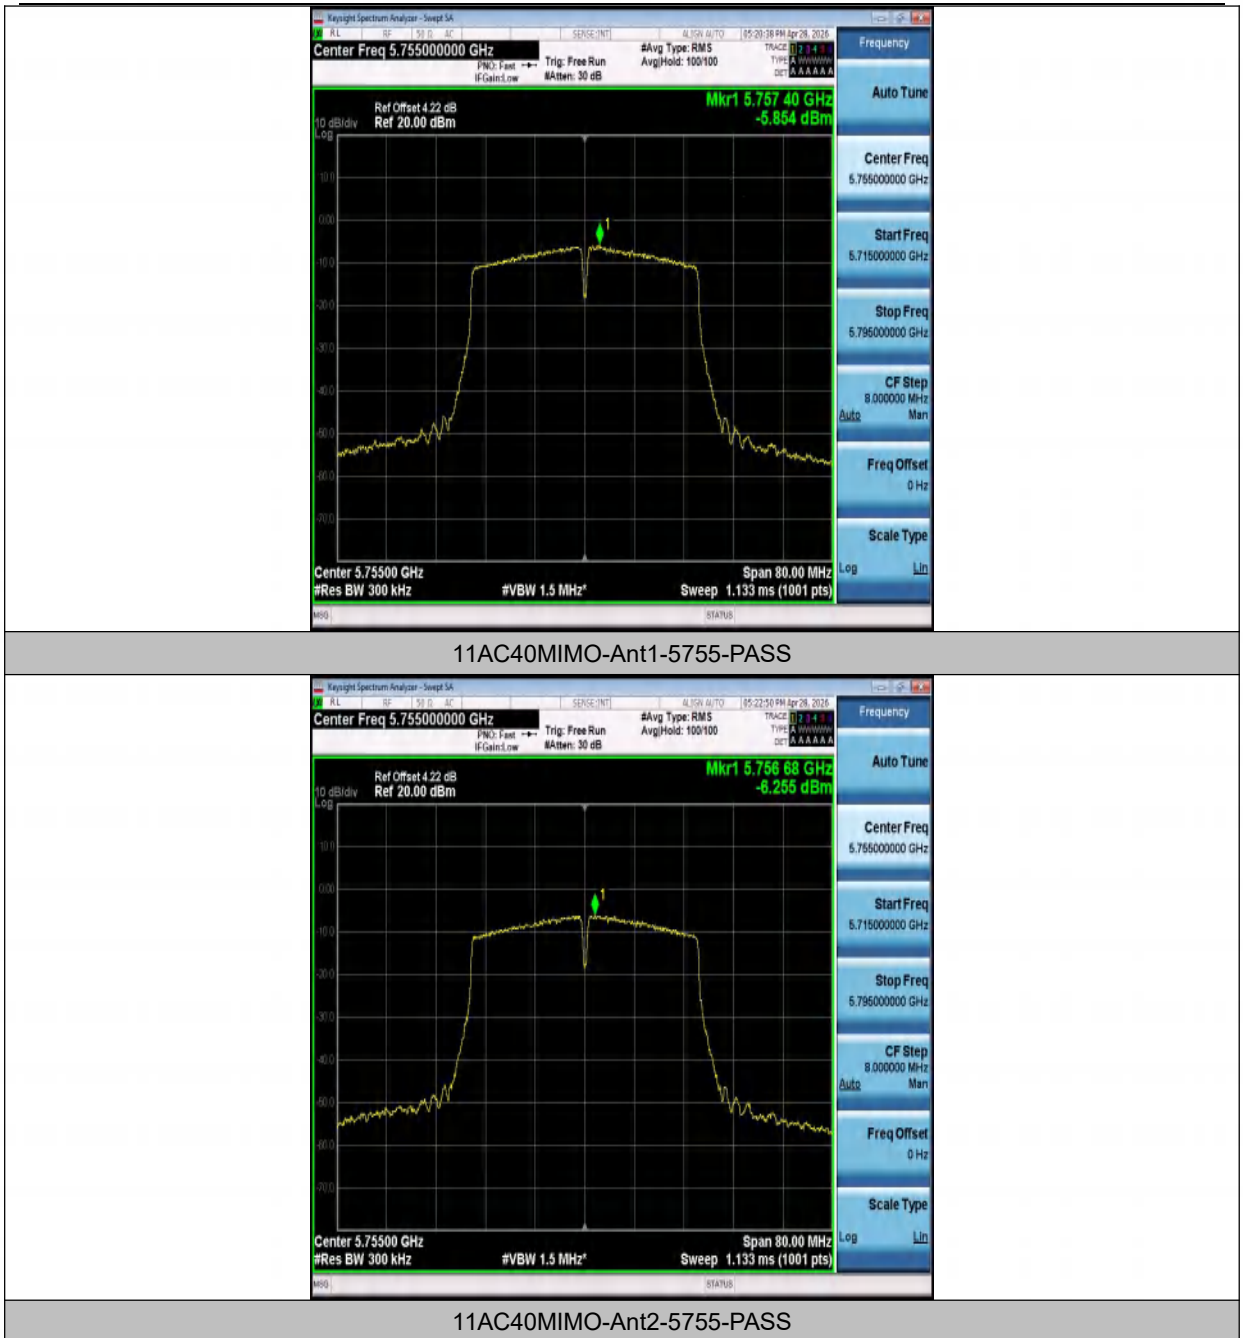

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

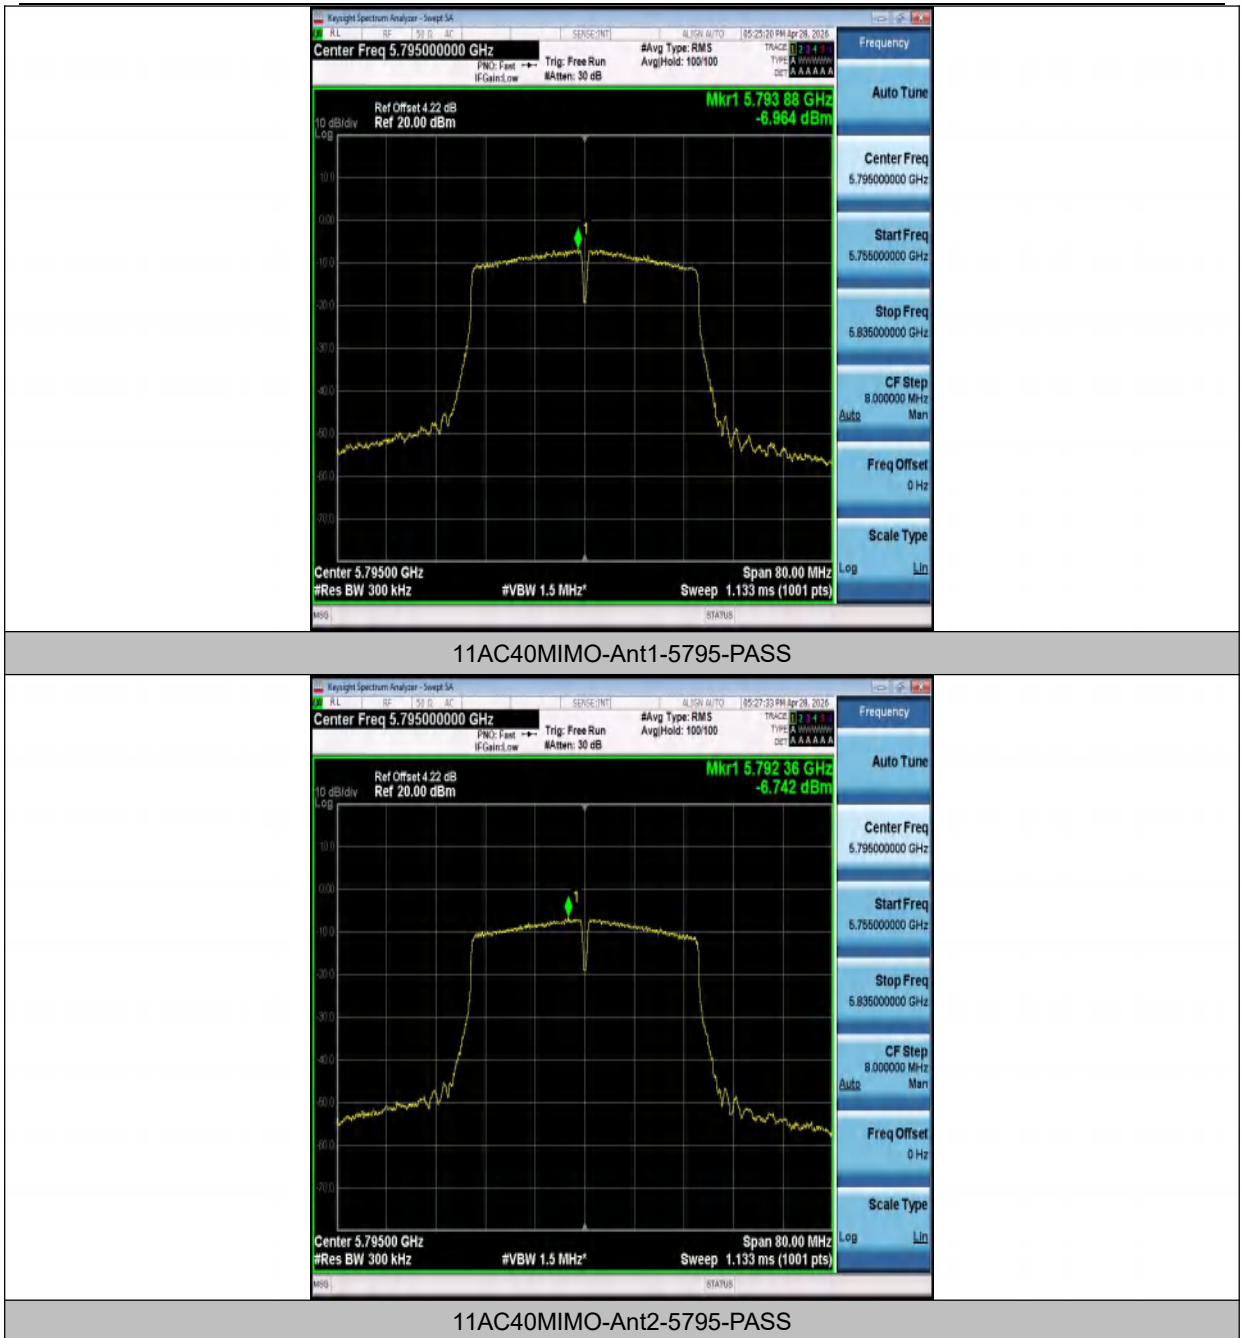

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

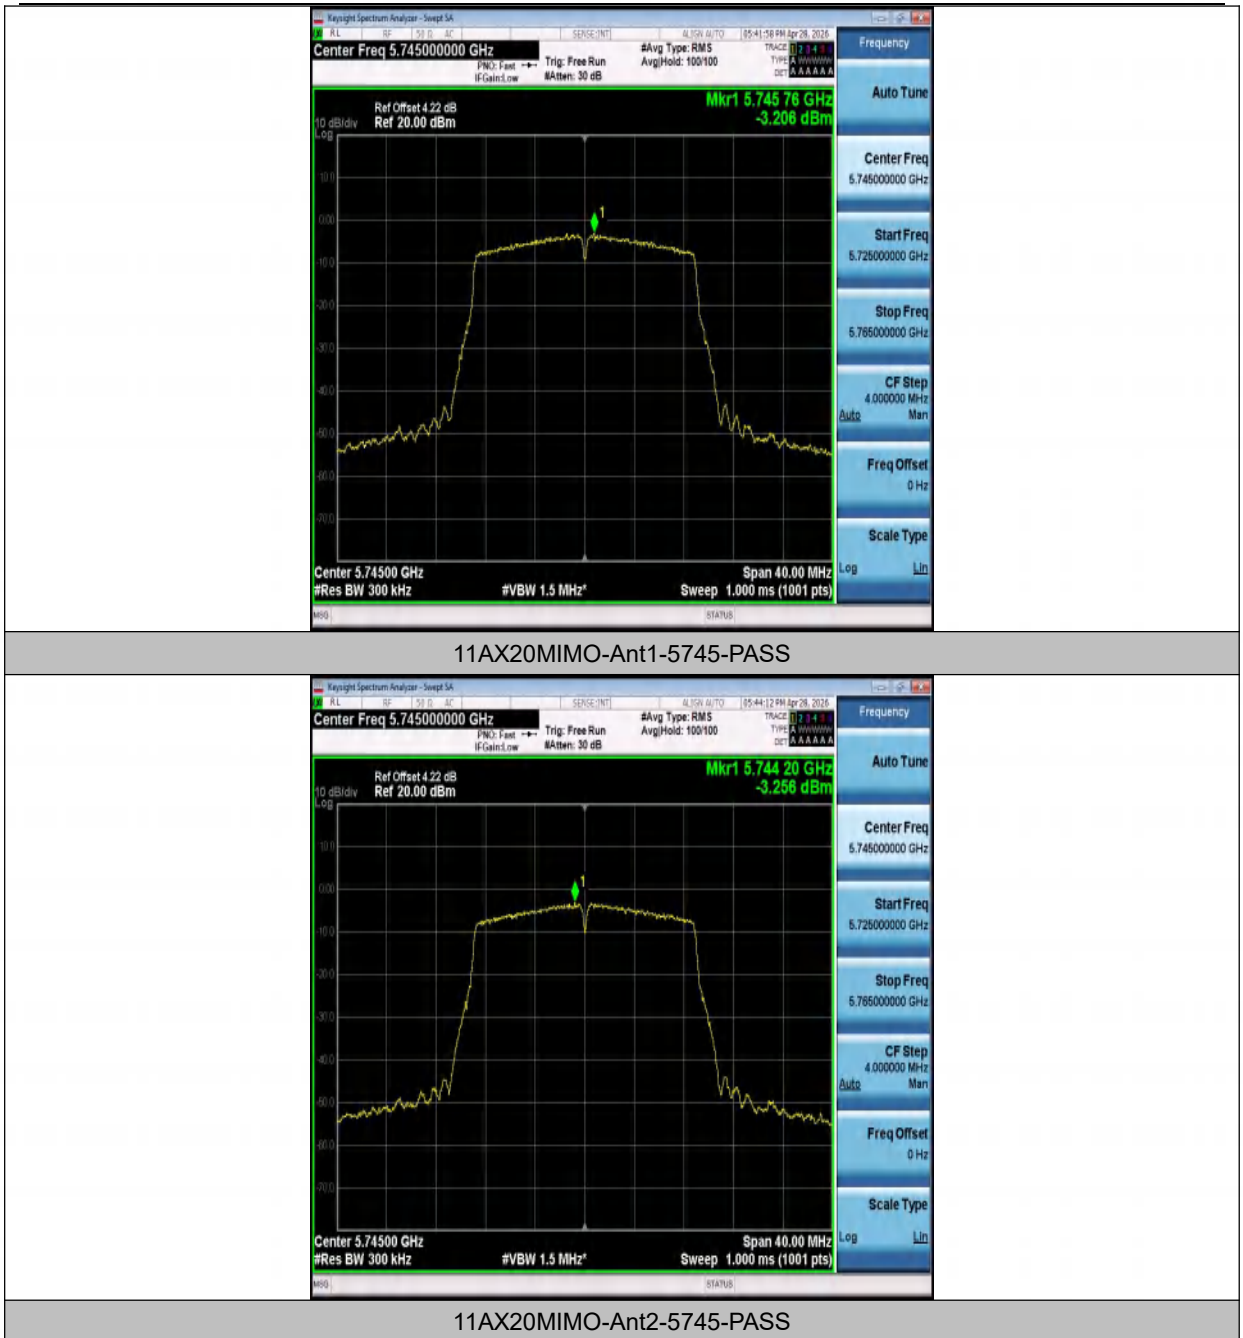

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

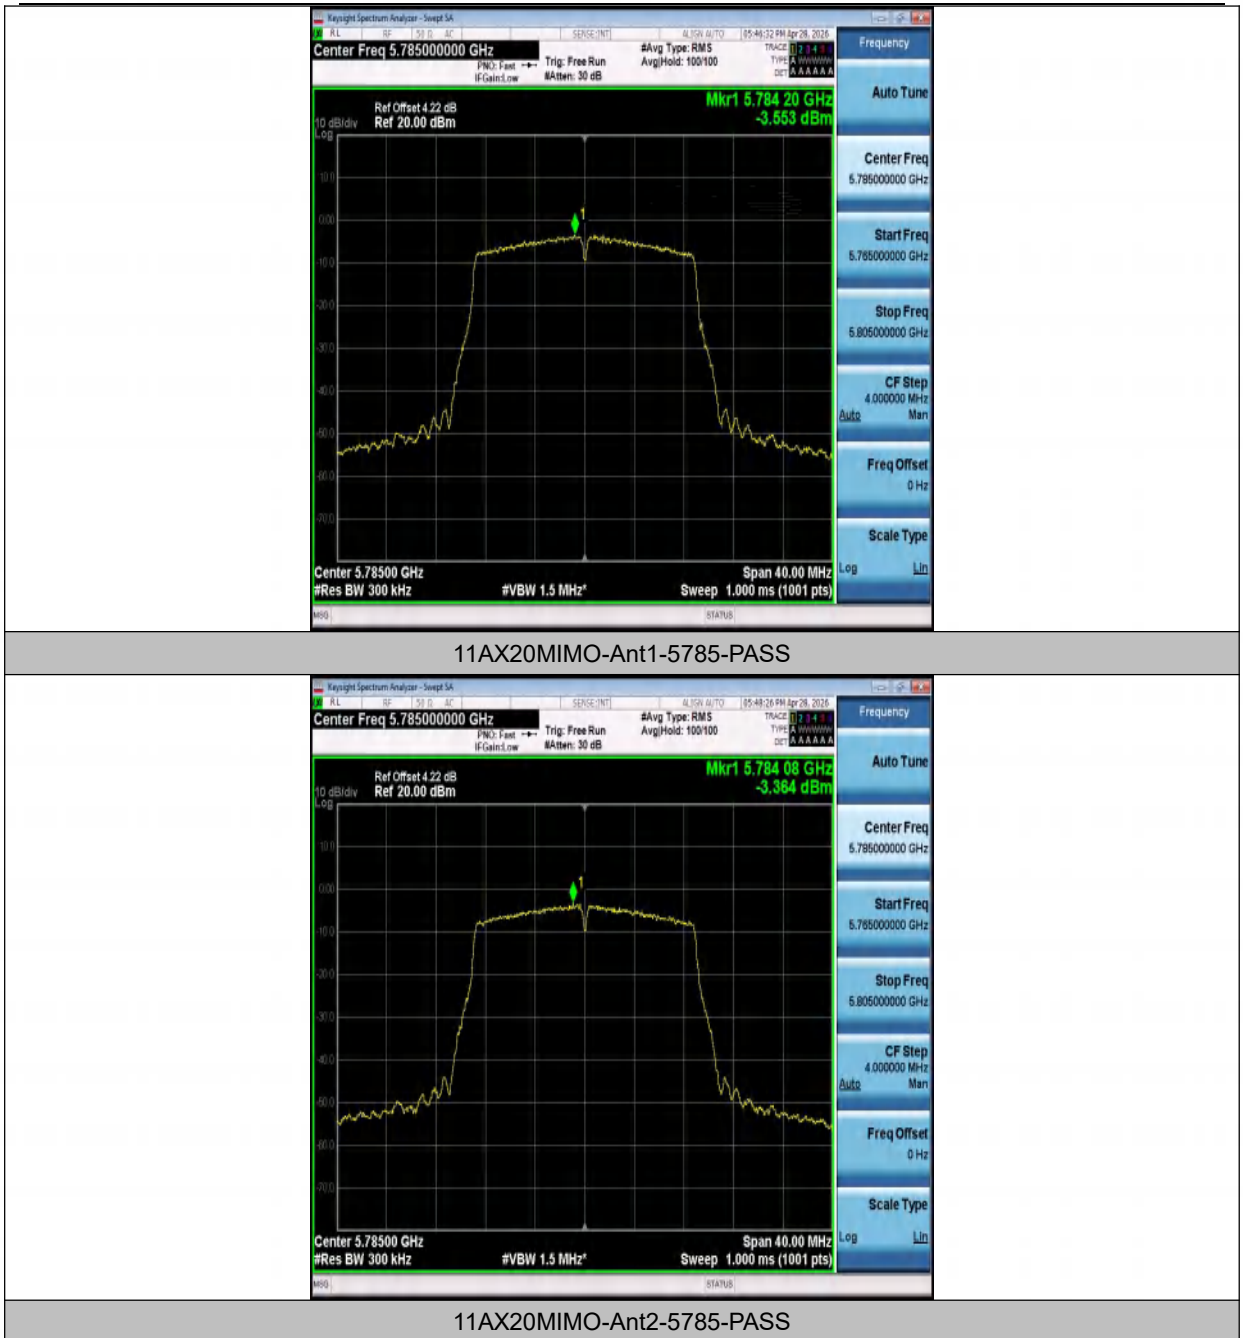

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

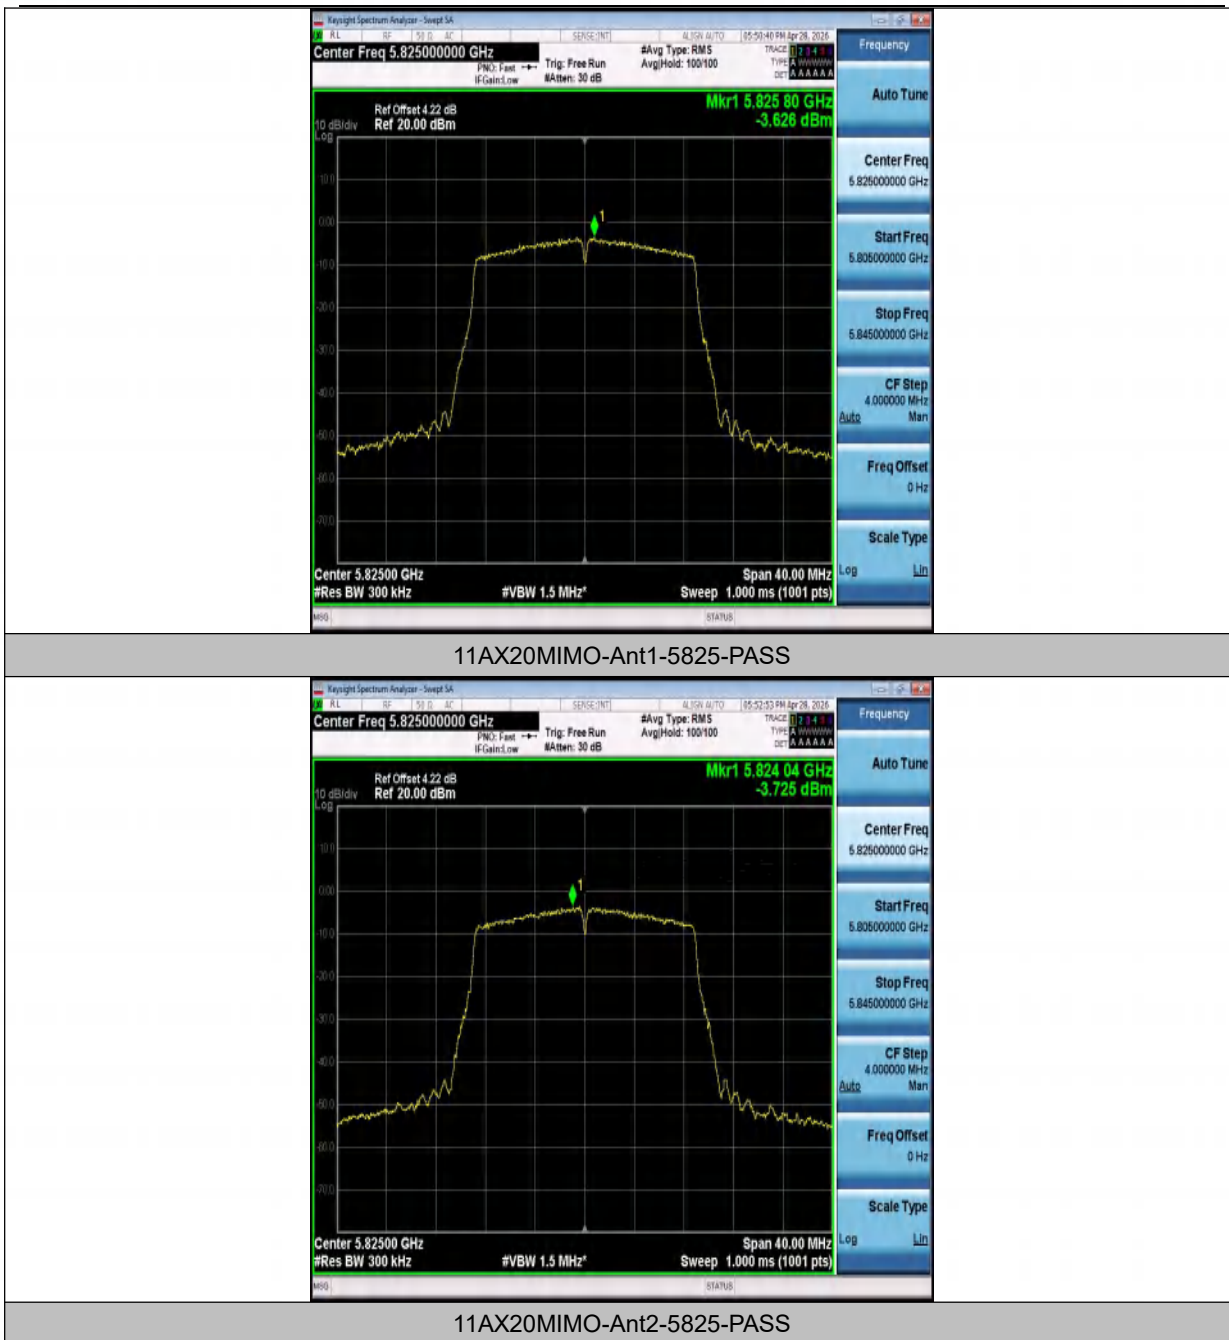

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

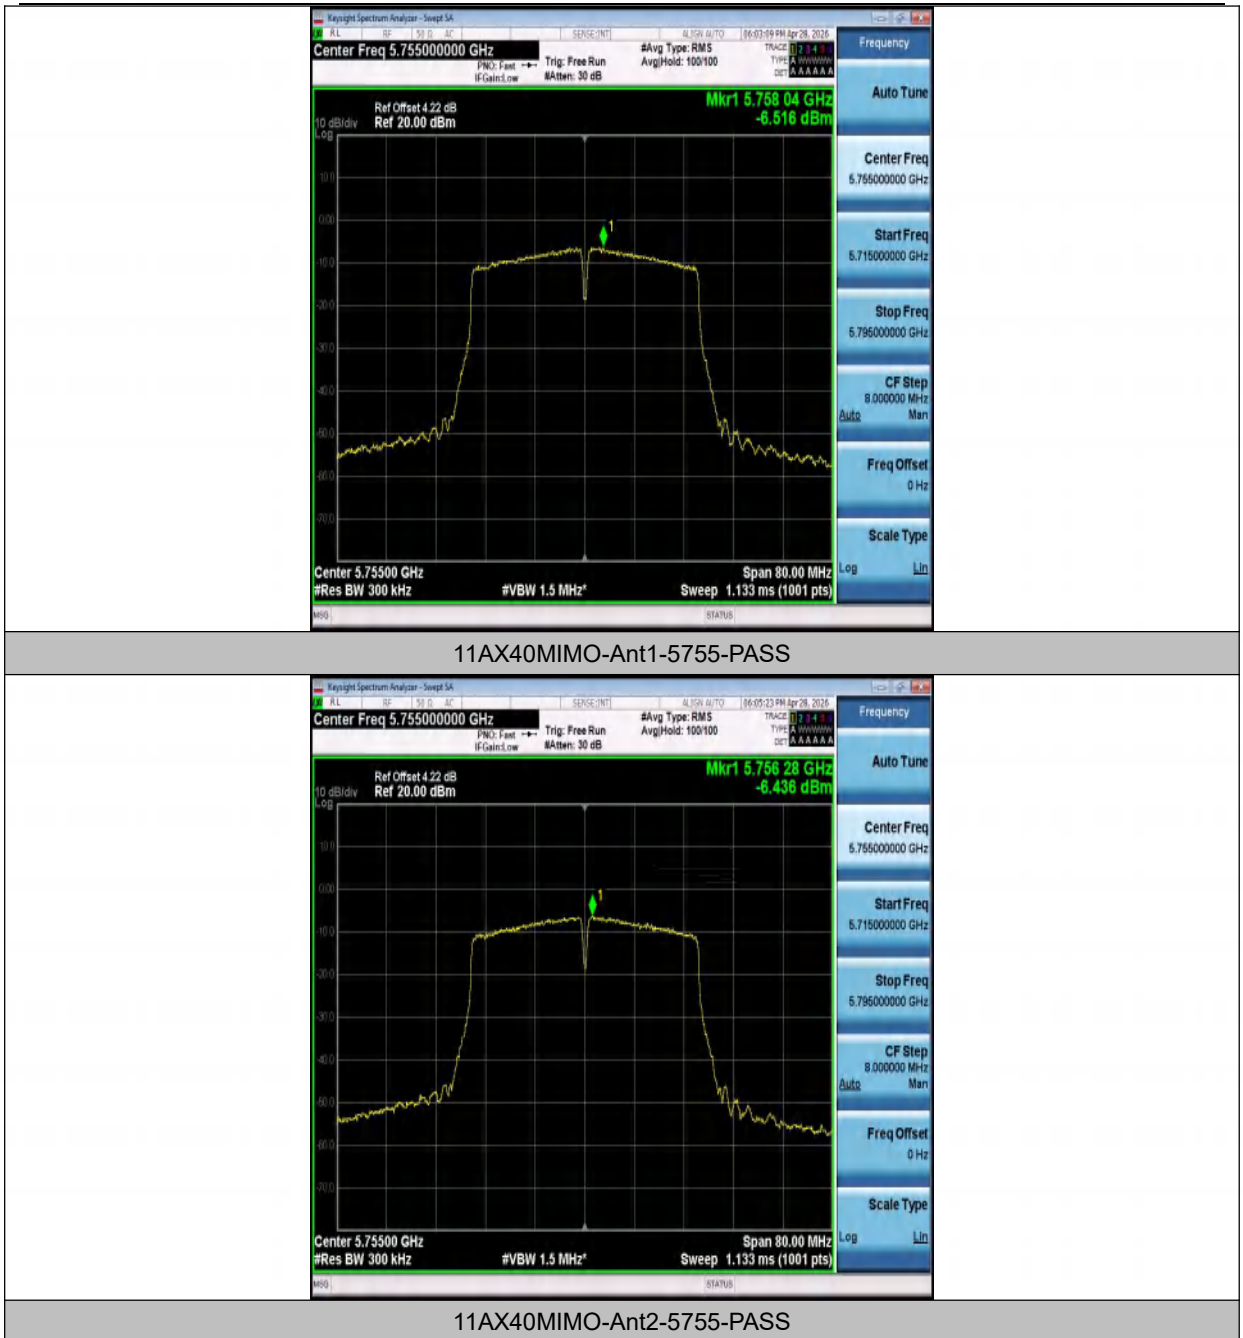

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

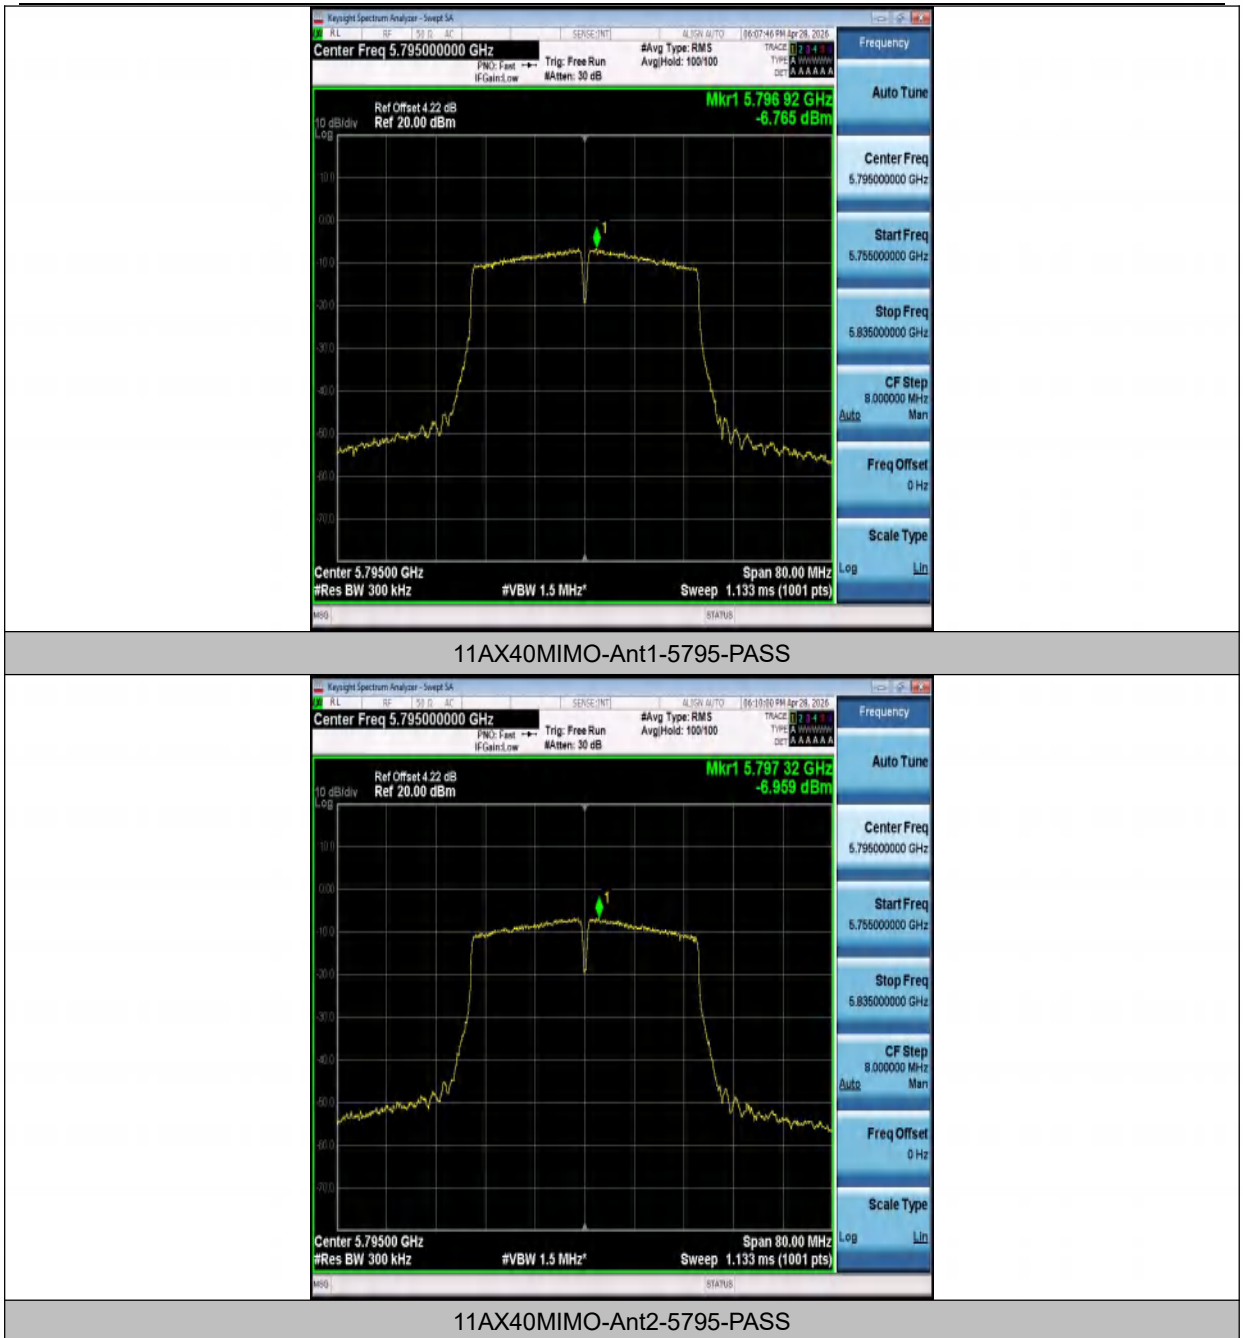

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-42.69	≤-27	PASS
11A	Ant2	Low	5180	-42.36	≤-27	PASS
11N20MIMO	Ant1	Low	5180	-43.25	≤-27	PASS
11N20MIMO	Ant2	Low	5180	-42.44	≤-27	PASS
11N40MIMO	Ant1	Low	5190	-38.94	≤-27	PASS
11N40MIMO	Ant2	Low	5190	-39.02	≤-27	PASS
11AC20MIMO	Ant1	Low	5180	-42.5	≤-27	PASS
11AC20MIMO	Ant2	Low	5180	-43.28	≤-27	PASS
11AC40MIMO	Ant1	Low	5190	-35.31	≤-27	PASS
11AC40MIMO	Ant2	Low	5190	-42.99	≤-27	PASS
11AX20MIMO	Ant1	Low	5180	-43.17	≤-27	PASS
11AX20MIMO	Ant2	Low	5180	-43.66	≤-27	PASS
11AX40MIMO	Ant1	Low	5190	-41.06	≤-27	PASS
11AX40MIMO	Ant2	Low	5190	-39.94	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-36.8	≤19.49	PASS
11A	Ant1	Low	5745	5700~5720	-42.24	≤11.86	PASS
11A	Ant1	Low	5745	5650~5700	-45.39	≤-26.96	PASS
11A	Ant1	Low	5745	5760~5650	-44.19	≤-27	PASS
11A	Ant2	Low	5745	5720~5725	-42.96	≤16.08	PASS
11A	Ant2	Low	5745	5700~5720	-43.8	≤10.25	PASS
11A	Ant2	Low	5745	5650~5700	-45.5	≤-26.70	PASS
11A	Ant2	Low	5745	5760~5650	-44.83	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-43.57	≤16.34	PASS
11A	Ant1	High	5825	5855~5875	-43.35	≤10.66	PASS
11A	Ant1	High	5825	5875~5925	-45.98	≤-26.51	PASS
11A	Ant1	High	5825	5925~5935	-44.25	≤-27	PASS
11A	Ant2	High	5825	5850~5855	-43.09	≤16.03	PASS
11A	Ant2	High	5825	5855~5875	-44.18	≤10.36	PASS
11A	Ant2	High	5825	5875~5925	-46.31	≤-26.81	PASS
11A	Ant2	High	5825	5925~5935	-45.06	≤-27	PASS
11N20MIMO	Ant1	Low	5745	5720~5725	-40.32	≤15.82	PASS

11N20MIMO	Ant1	Low	5745	5700~5720	-41.88	≤10.02	PASS
11N20MIMO	Ant1	Low	5745	5650~5700	-44.14	≤-26.45	PASS
11N20MIMO	Ant1	Low	5745	5760~5650	-43.8	≤-27	PASS
11N20MIMO	Ant2	Low	5745	5720~5725	-39.69	≤17.39	PASS
11N20MIMO	Ant2	Low	5745	5700~5720	-43.19	≤10.31	PASS
11N20MIMO	Ant2	Low	5745	5650~5700	-43.18	≤-26.53	PASS
11N20MIMO	Ant2	Low	5745	5760~5650	-44.76	≤-27	PASS
11N20MIMO	Ant1	High	5825	5850~5855	-42.55	≤16.96	PASS
11N20MIMO	Ant1	High	5825	5855~5875	-44.09	≤10.51	PASS
11N20MIMO	Ant1	High	5825	5875~5925	-44.92	≤-26.61	PASS
11N20MIMO	Ant1	High	5825	5925~5935	-45.28	≤-27	PASS
11N20MIMO	Ant2	High	5825	5850~5855	-32.92	≤24.96	PASS
11N20MIMO	Ant2	High	5825	5855~5875	-45.05	≤10.21	PASS
11N20MIMO	Ant2	High	5825	5875~5925	-45.39	≤-26.61	PASS
11N20MIMO	Ant2	High	5825	5925~5935	-44.14	≤-27	PASS
11N40MIMO	Ant1	Low	5755	5720~5725	-36.31	≤16.35	PASS
11N40MIMO	Ant1	Low	5755	5700~5720	-35.17	≤13.80	PASS
11N40MIMO	Ant1	Low	5755	5650~5700	-45.83	≤-26.90	PASS
11N40MIMO	Ant1	Low	5755	5780~5650	-44.87	≤-27	PASS
11N40MIMO	Ant2	Low	5755	5720~5725	-36.66	≤16.35	PASS
11N40MIMO	Ant2	Low	5755	5700~5720	-39.03	≤10.10	PASS
11N40MIMO	Ant2	Low	5755	5650~5700	-44.77	≤-26.50	PASS
11N40MIMO	Ant2	Low	5755	5780~5650	-43.13	≤-27	PASS
11N40MIMO	Ant1	High	5795	5850~5855	-44.68	≤15.66	PASS
11N40MIMO	Ant1	High	5795	5855~5875	-44.95	≤10.57	PASS
11N40MIMO	Ant1	High	5795	5875~5925	-45.45	≤-26.59	PASS
11N40MIMO	Ant1	High	5795	5925~5935	-44.82	≤-27	PASS
11N40MIMO	Ant2	High	5795	5850~5855	-45.47	≤15.66	PASS
11N40MIMO	Ant2	High	5795	5855~5875	-42.82	≤10.25	PASS
11N40MIMO	Ant2	High	5795	5875~5925	-46.39	≤-26.95	PASS
11N40MIMO	Ant2	High	5795	5925~5935	-45.17	≤-27	PASS
11AC20MIMO	Ant1	Low	5745	5720~5725	-29.12	≤24.99	PASS
11AC20MIMO	Ant1	Low	5745	5700~5720	-42.18	≤10.70	PASS
11AC20MIMO	Ant1	Low	5745	5650~5700	-44.52	≤-26.10	PASS
11AC20MIMO	Ant1	Low	5745	5760~5650	-44.46	≤-27	PASS
11AC20MIMO	Ant2	Low	5745	5720~5725	-41.98	≤16.34	PASS
11AC20MIMO	Ant2	Low	5745	5700~5720	-40	≤12.73	PASS
11AC20MIMO	Ant2	Low	5745	5650~5700	-44.38	≤-26.10	PASS
11AC20MIMO	Ant2	Low	5745	5760~5650	-44.52	≤-27	PASS
11AC20MIMO	Ant1	High	5825	5850~5855	-43.2	≤15.73	PASS
11AC20MIMO	Ant1	High	5825	5855~5875	-42.91	≤12.14	PASS
11AC20MIMO	Ant1	High	5825	5875~5925	-44.11	≤-26.11	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20MIMO	Ant1	High	5825	5925~5935	-44.42	≤-27	PASS
11AC20MIMO	Ant2	High	5825	5850~5855	-36.51	≤18.19	PASS
11AC20MIMO	Ant2	High	5825	5855~5875	-45.07	≤10.32	PASS
11AC20MIMO	Ant2	High	5825	5875~5925	-45.58	≤-26.21	PASS
11AC20MIMO	Ant2	High	5825	5925~5935	-44.59	≤-27	PASS
11AC40MIMO	Ant1	Low	5755	5720~5725	-38.44	≤16.04	PASS
11AC40MIMO	Ant1	Low	5755	5700~5720	-37.28	≤15.24	PASS
11AC40MIMO	Ant1	Low	5755	5650~5700	-44.05	≤-26.50	PASS
11AC40MIMO	Ant1	Low	5755	5780~5650	-43.42	≤-27	PASS
11AC40MIMO	Ant2	Low	5755	5720~5725	-38.18	≤16.66	PASS
11AC40MIMO	Ant2	Low	5755	5700~5720	-32.23	≤14.18	PASS
11AC40MIMO	Ant2	Low	5755	5650~5700	-45.97	≤-26.80	PASS
11AC40MIMO	Ant2	Low	5755	5780~5650	-45.21	≤-27	PASS
11AC40MIMO	Ant1	High	5795	5850~5855	-41.4	≤17.54	PASS
11AC40MIMO	Ant1	High	5795	5855~5875	-45.16	≤10.02	PASS
11AC40MIMO	Ant1	High	5795	5875~5925	-43.71	≤-24.27	PASS
11AC40MIMO	Ant1	High	5795	5925~5935	-44.77	≤-27	PASS
11AC40MIMO	Ant2	High	5795	5850~5855	-44.76	≤16.41	PASS
11AC40MIMO	Ant2	High	5795	5855~5875	-44.9	≤10.94	PASS
11AC40MIMO	Ant2	High	5795	5875~5925	-46.41	≤-26.46	PASS
11AC40MIMO	Ant2	High	5795	5925~5935	-44.87	≤-27	PASS
11AX20MIMO	Ant1	Low	5745	5720~5725	-38.74	≤17.39	PASS
11AX20MIMO	Ant1	Low	5745	5700~5720	-40.16	≤11.22	PASS
11AX20MIMO	Ant1	Low	5745	5650~5700	-44.54	≤-26.96	PASS
11AX20MIMO	Ant1	Low	5745	5760~5650	-43.83	≤-27	PASS
11AX20MIMO	Ant2	Low	5745	5720~5725	-39.97	≤16.34	PASS
11AX20MIMO	Ant2	Low	5745	5700~5720	-42.48	≤10.76	PASS
11AX20MIMO	Ant2	Low	5745	5650~5700	-44.98	≤-26.79	PASS
11AX20MIMO	Ant2	Low	5745	5760~5650	-44.13	≤-27	PASS
11AX20MIMO	Ant1	High	5825	5850~5855	-43.4	≤15.73	PASS
11AX20MIMO	Ant1	High	5825	5855~5875	-44.27	≤10.17	PASS
11AX20MIMO	Ant1	High	5825	5875~5925	-46.16	≤-26.81	PASS
11AX20MIMO	Ant1	High	5825	5925~5935	-44.34	≤-27	PASS
11AX20MIMO	Ant2	High	5825	5850~5855	-43.61	≤16.65	PASS
11AX20MIMO	Ant2	High	5825	5855~5875	-44.76	≤10.02	PASS
11AX20MIMO	Ant2	High	5825	5875~5925	-46.16	≤-26.91	PASS
11AX20MIMO	Ant2	High	5825	5925~5935	-44.5	≤-27	PASS
11AX40MIMO	Ant1	Low	5755	5720~5725	-38.54	≤15.74	PASS
11AX40MIMO	Ant1	Low	5755	5700~5720	-36.68	≤12.67	PASS
11AX40MIMO	Ant1	Low	5755	5650~5700	-45.69	≤-26.80	PASS
11AX40MIMO	Ant1	Low	5755	5780~5650	-44.98	≤-27	PASS
11AX40MIMO	Ant2	Low	5755	5720~5725	-37.06	≤16.66	PASS


11AX40MIMO	Ant2	Low	5755	5700~5720	-35.39	≤13.99	PASS
11AX40MIMO	Ant2	Low	5755	5650~5700	-44.67	≤-26.80	PASS
11AX40MIMO	Ant2	Low	5755	5780~5650	-44.65	≤-27	PASS
11AX40MIMO	Ant1	High	5795	5850~5855	-44.91	≤16.03	PASS
11AX40MIMO	Ant1	High	5795	5855~5875	-45.31	≤10.16	PASS
11AX40MIMO	Ant1	High	5795	5875~5925	-45.94	≤-26.83	PASS
11AX40MIMO	Ant1	High	5795	5925~5935	-44.82	≤-27	PASS
11AX40MIMO	Ant2	High	5795	5850~5855	-45.26	≤15.66	PASS
11AX40MIMO	Ant2	High	5795	5855~5875	-44.15	≤10.94	PASS
11AX40MIMO	Ant2	High	5795	5875~5925	-45.09	≤-25.00	PASS
11AX40MIMO	Ant2	High	5795	5925~5935	-44.89	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

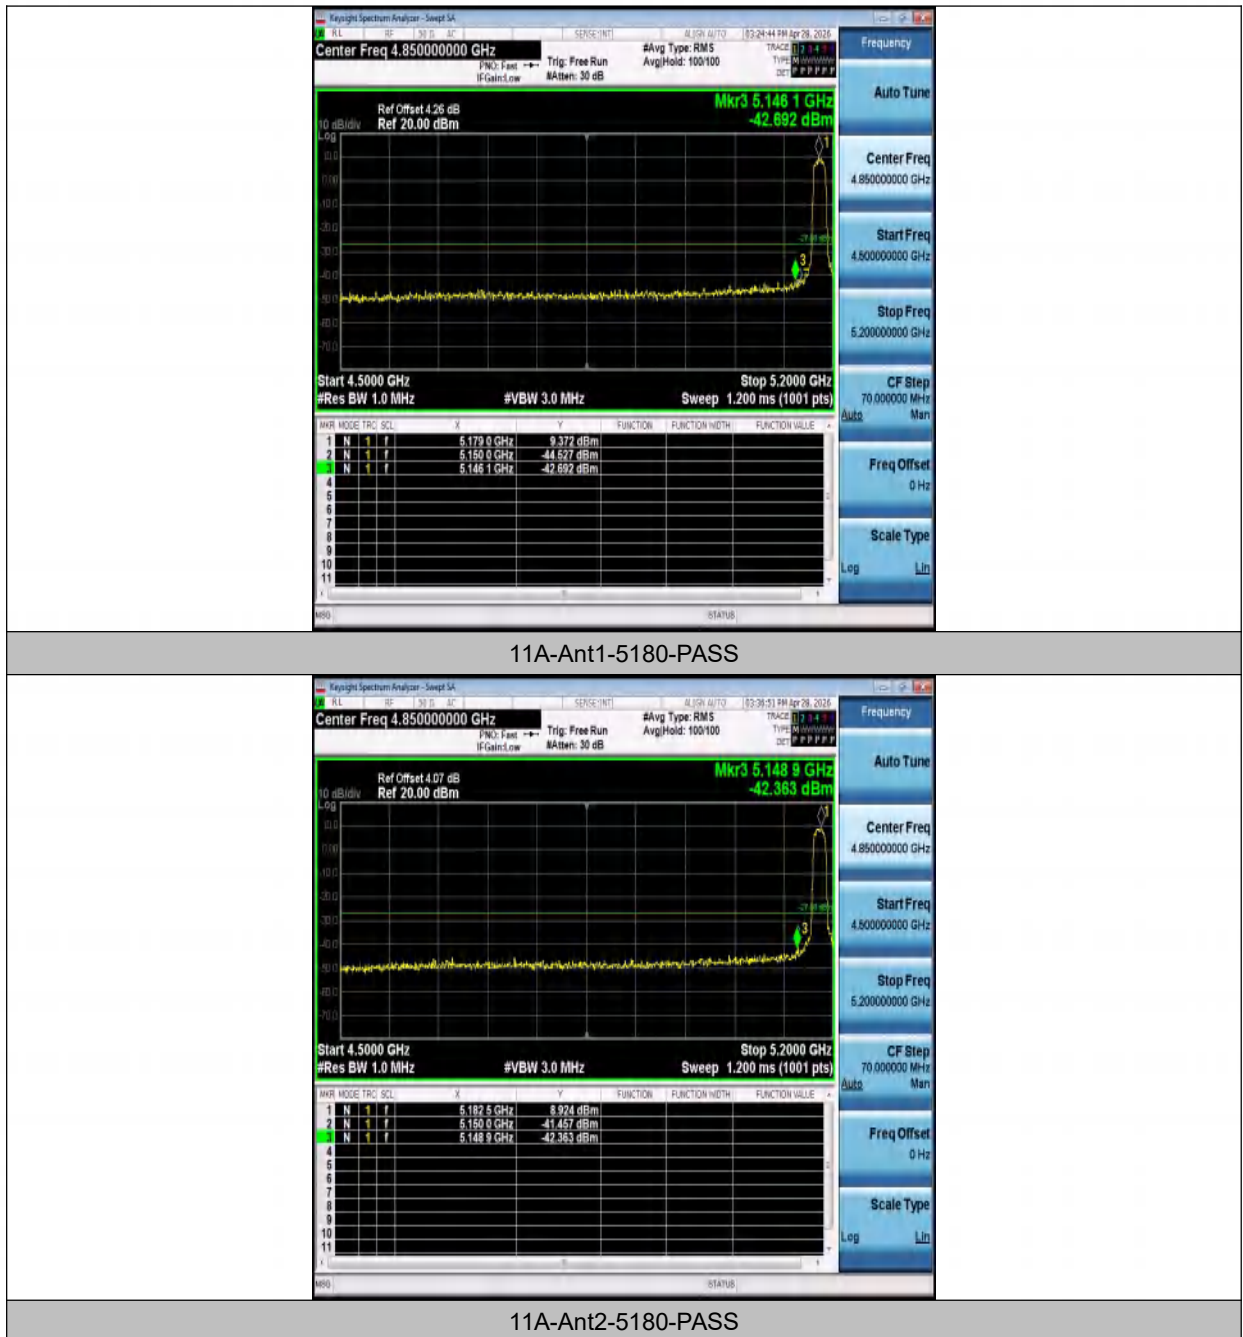





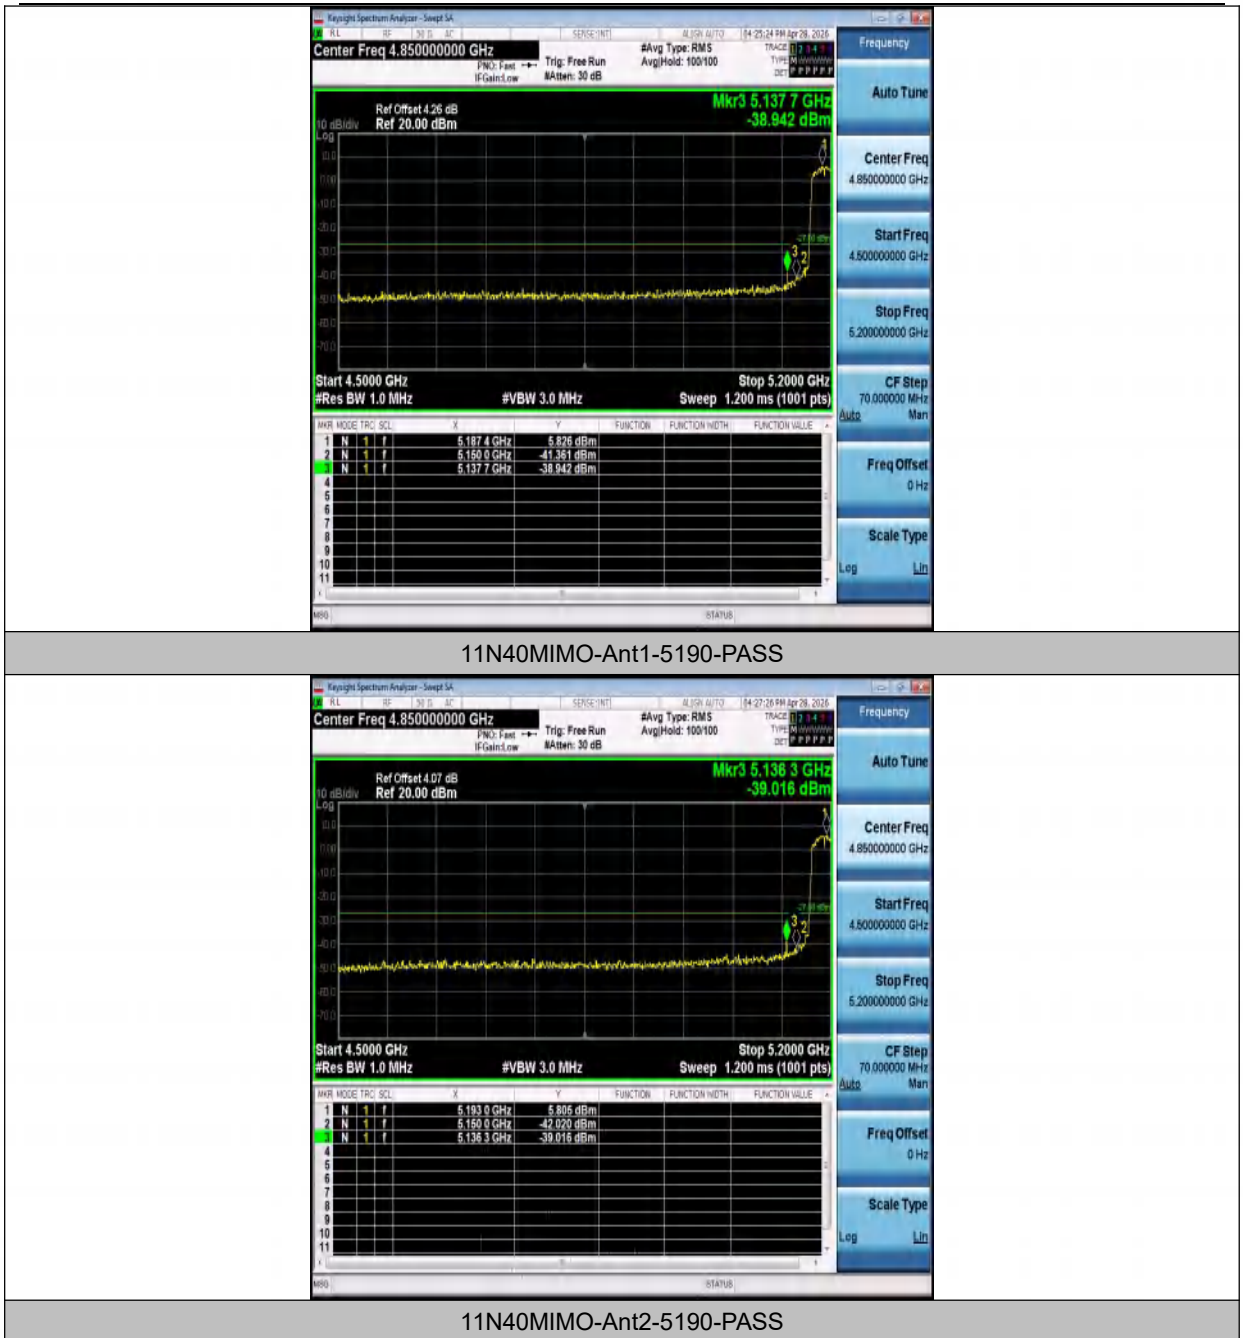

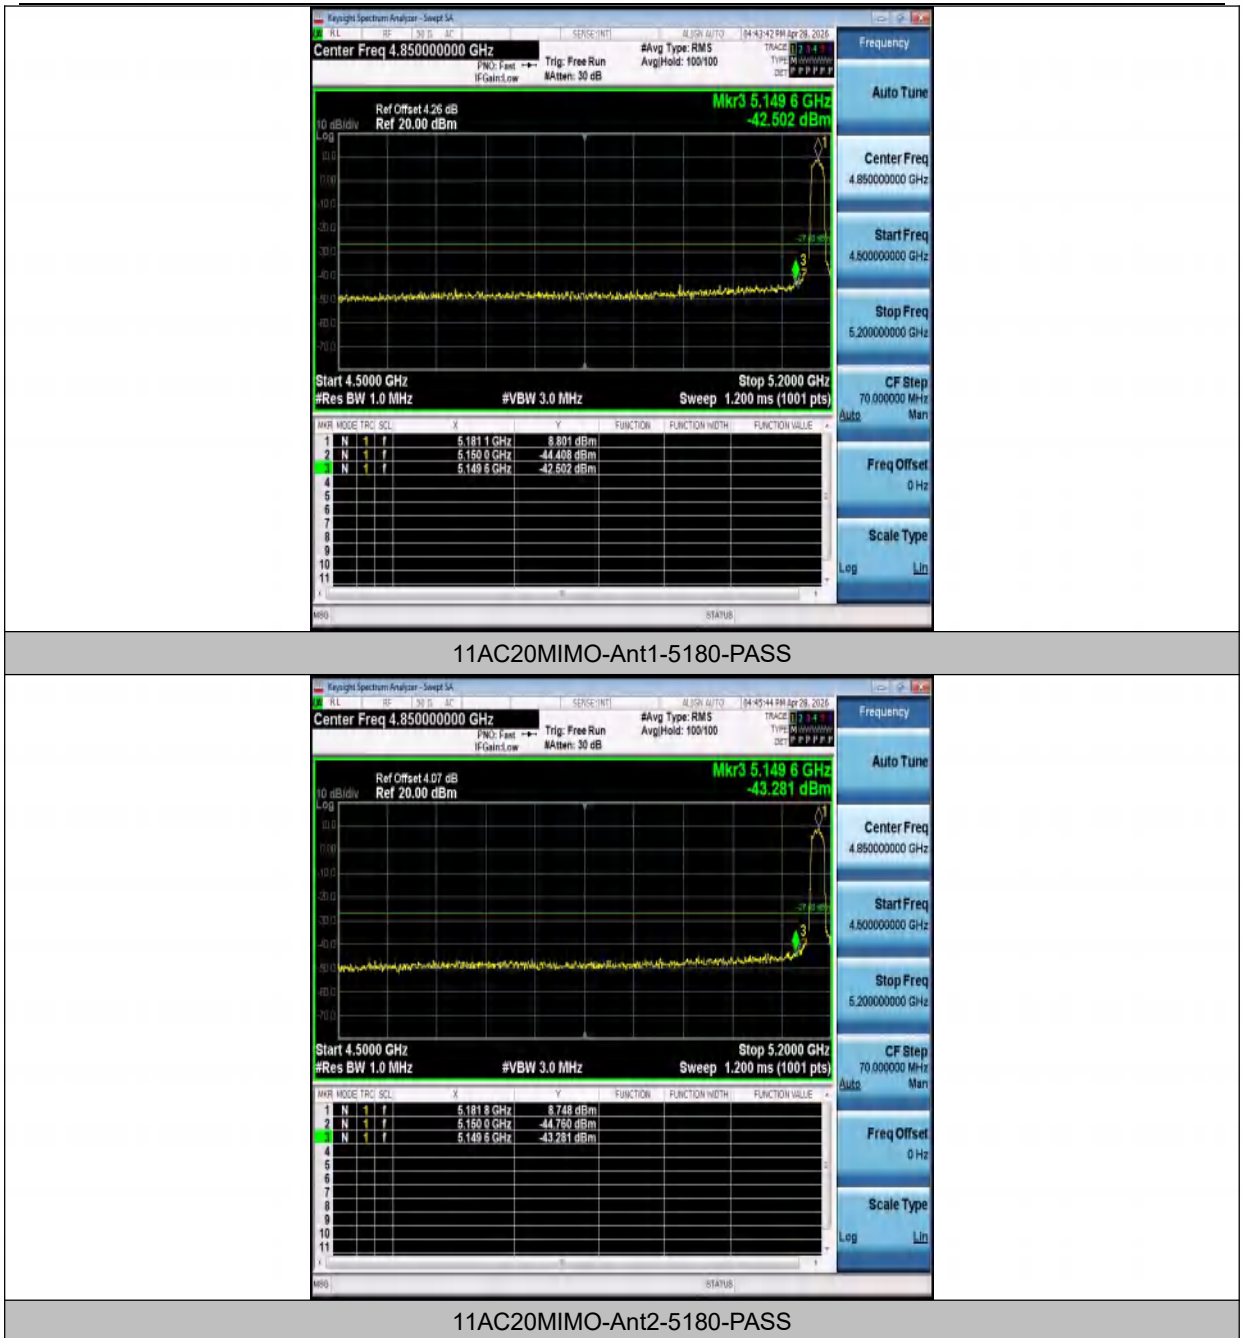

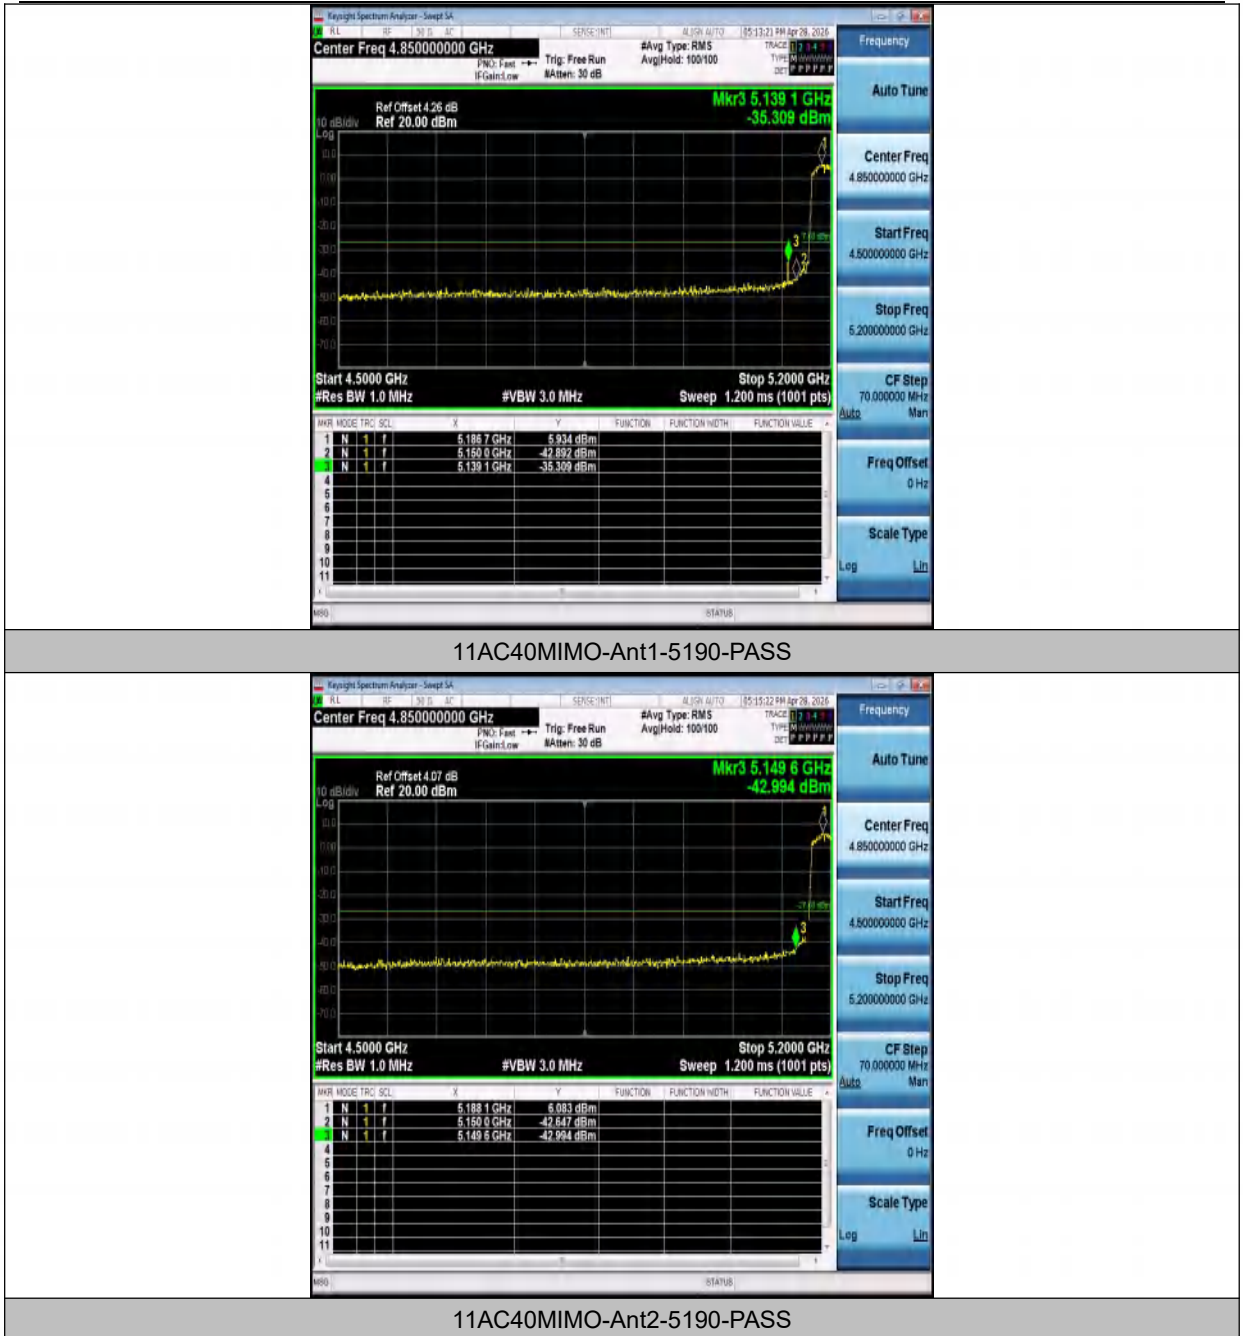

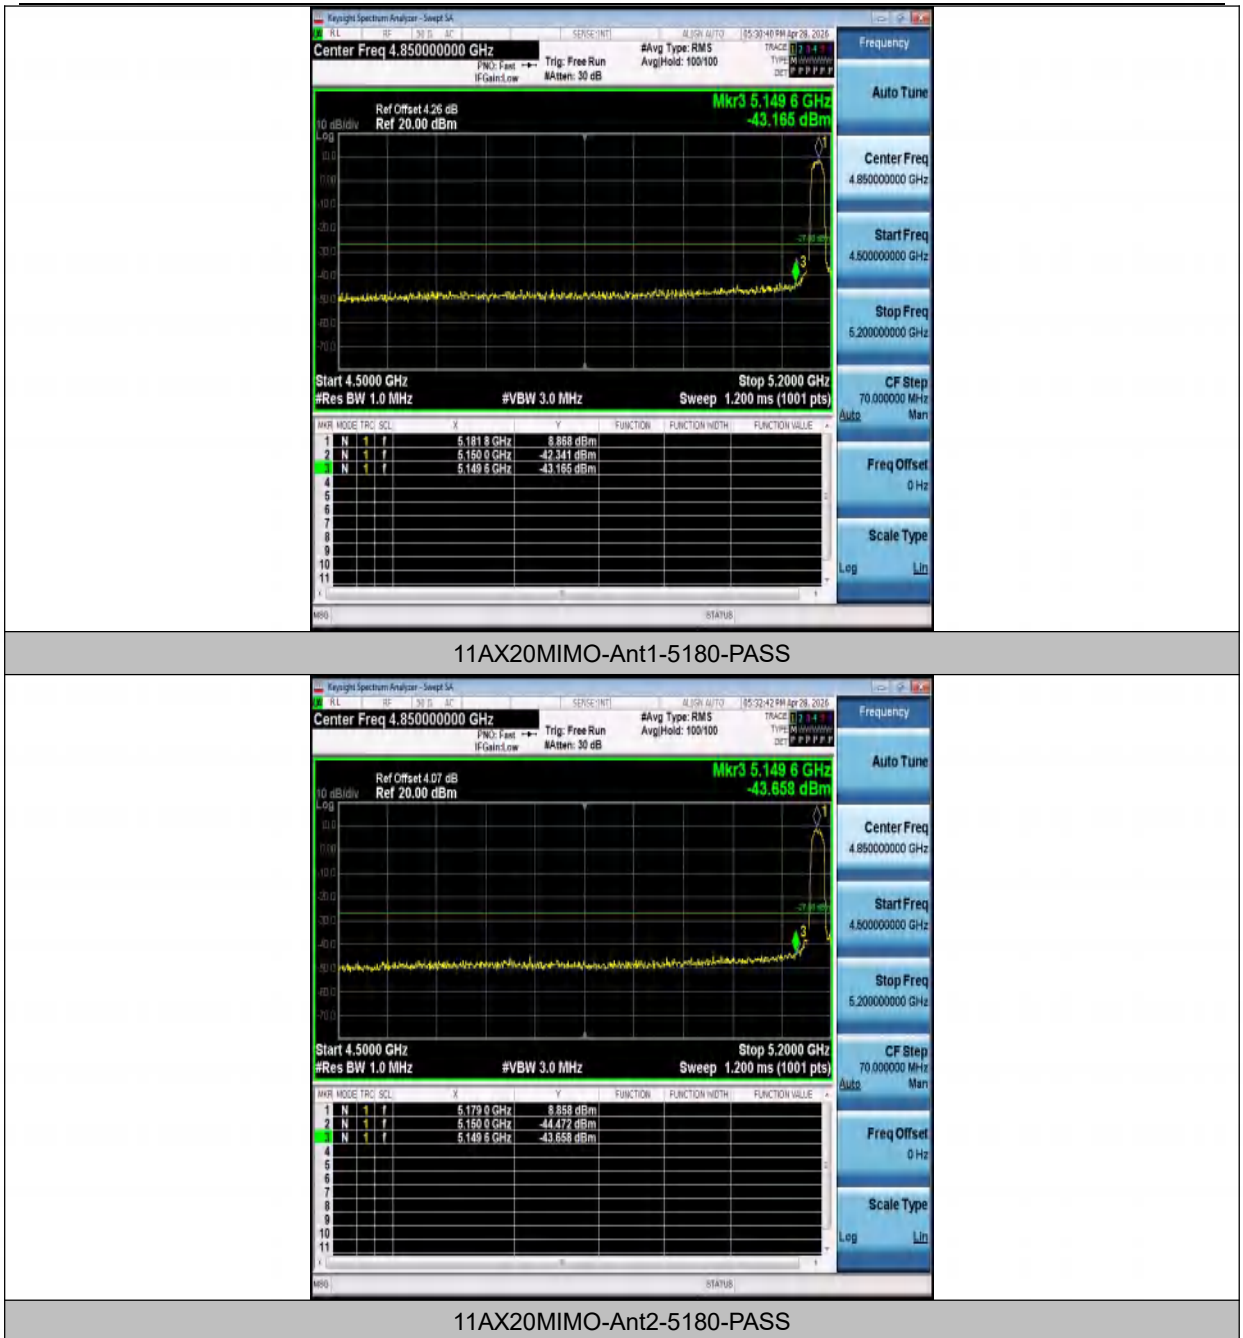

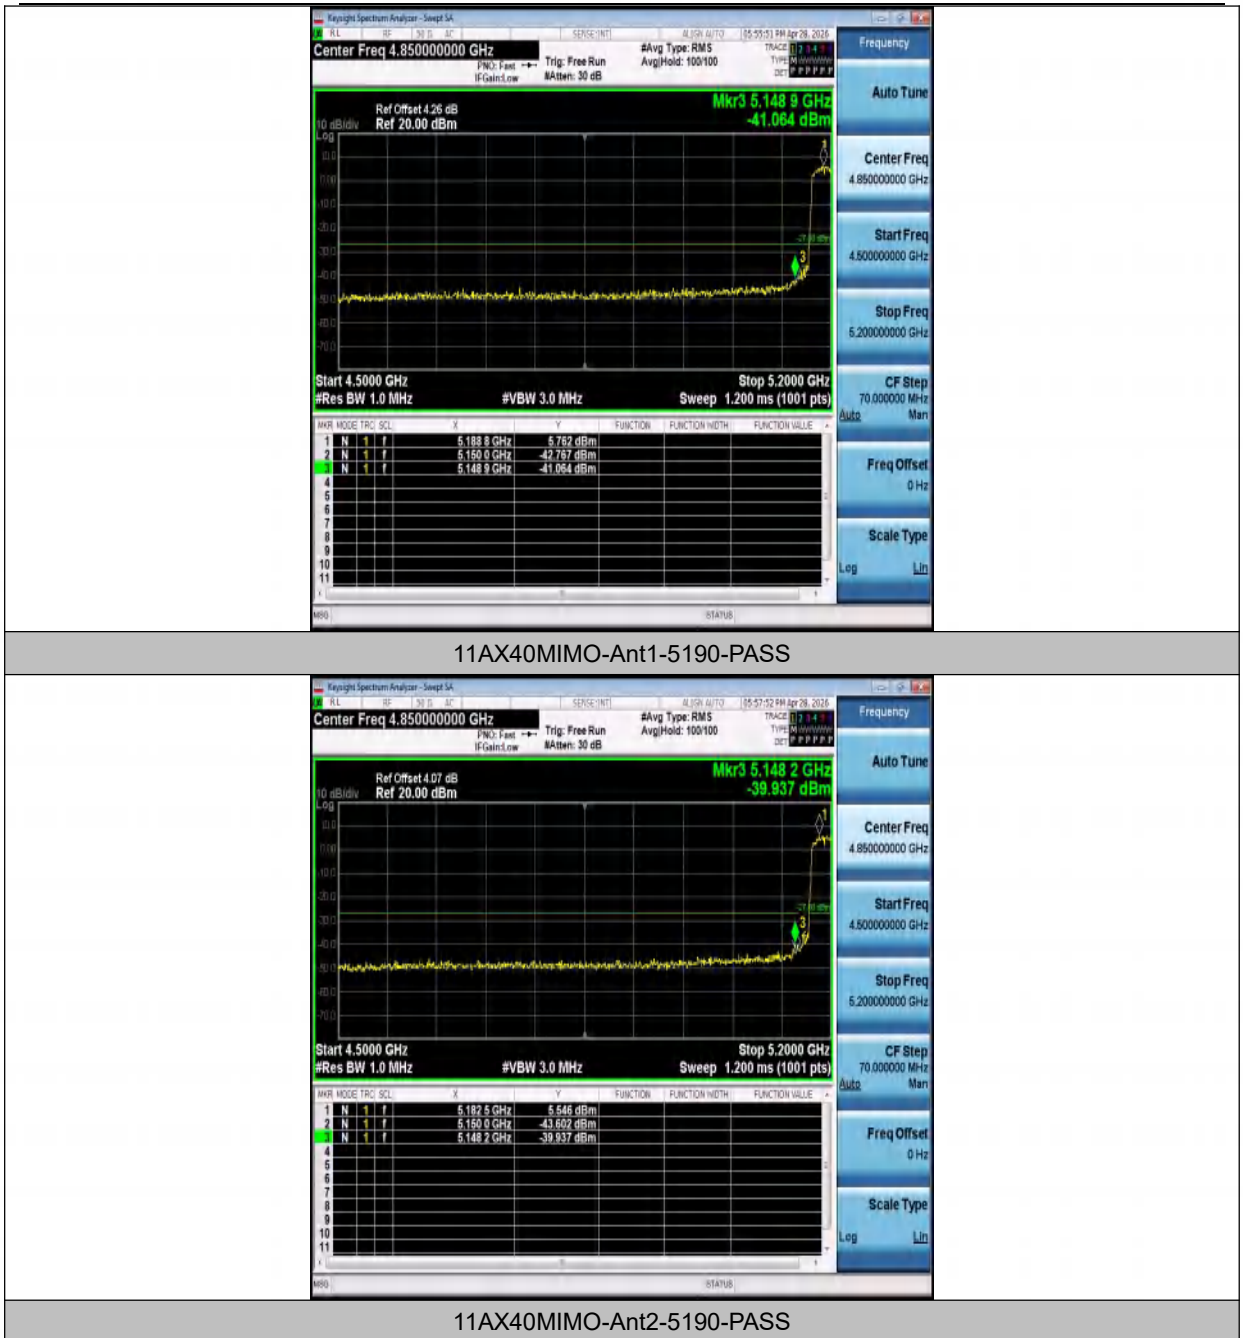

Test Graphs B4









Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com












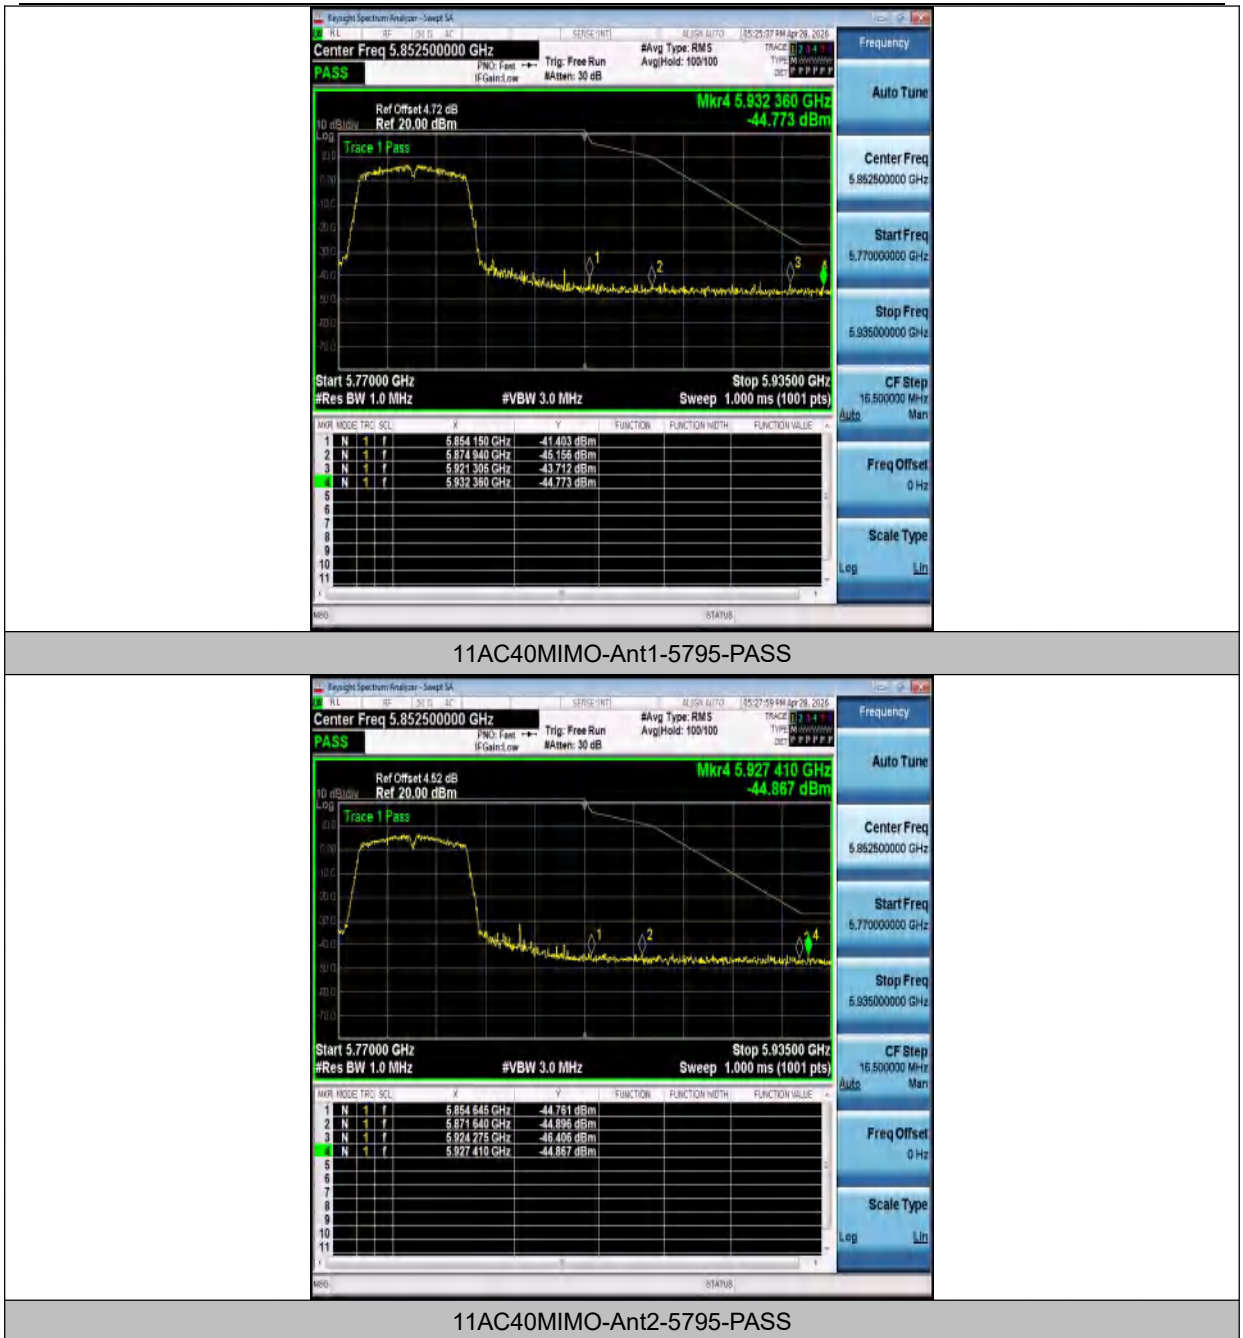









---END---