


Appendix Test Data

Report No.:	1819C60096212501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-8-25	Finish Test Date:	2026-8-31
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	28.2°C	Relative Humidity:	48%
Pressure:	101kPa		

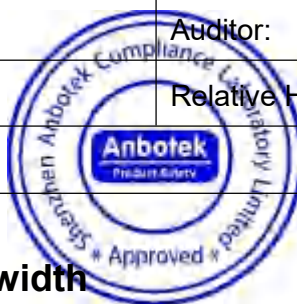


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.960	2401.520	2402.480	---	---
DH5	Ant1	2441	0.960	2440.523	2441.483	---	---
DH5	Ant1	2480	0.981	2479.487	2480.468	---	---
2DH5	Ant1	2402	1.302	2401.334	2402.636	---	---
2DH5	Ant1	2441	1.323	2440.328	2441.651	---	---
2DH5	Ant1	2480	1.314	2479.331	2480.645	---	---
3DH5	Ant1	2402	1.305	2401.340	2402.645	---	---
3DH5	Ant1	2441	1.272	2440.343	2441.615	---	---
3DH5	Ant1	2480	1.293	2479.346	2480.639	---	---

Test Graphs

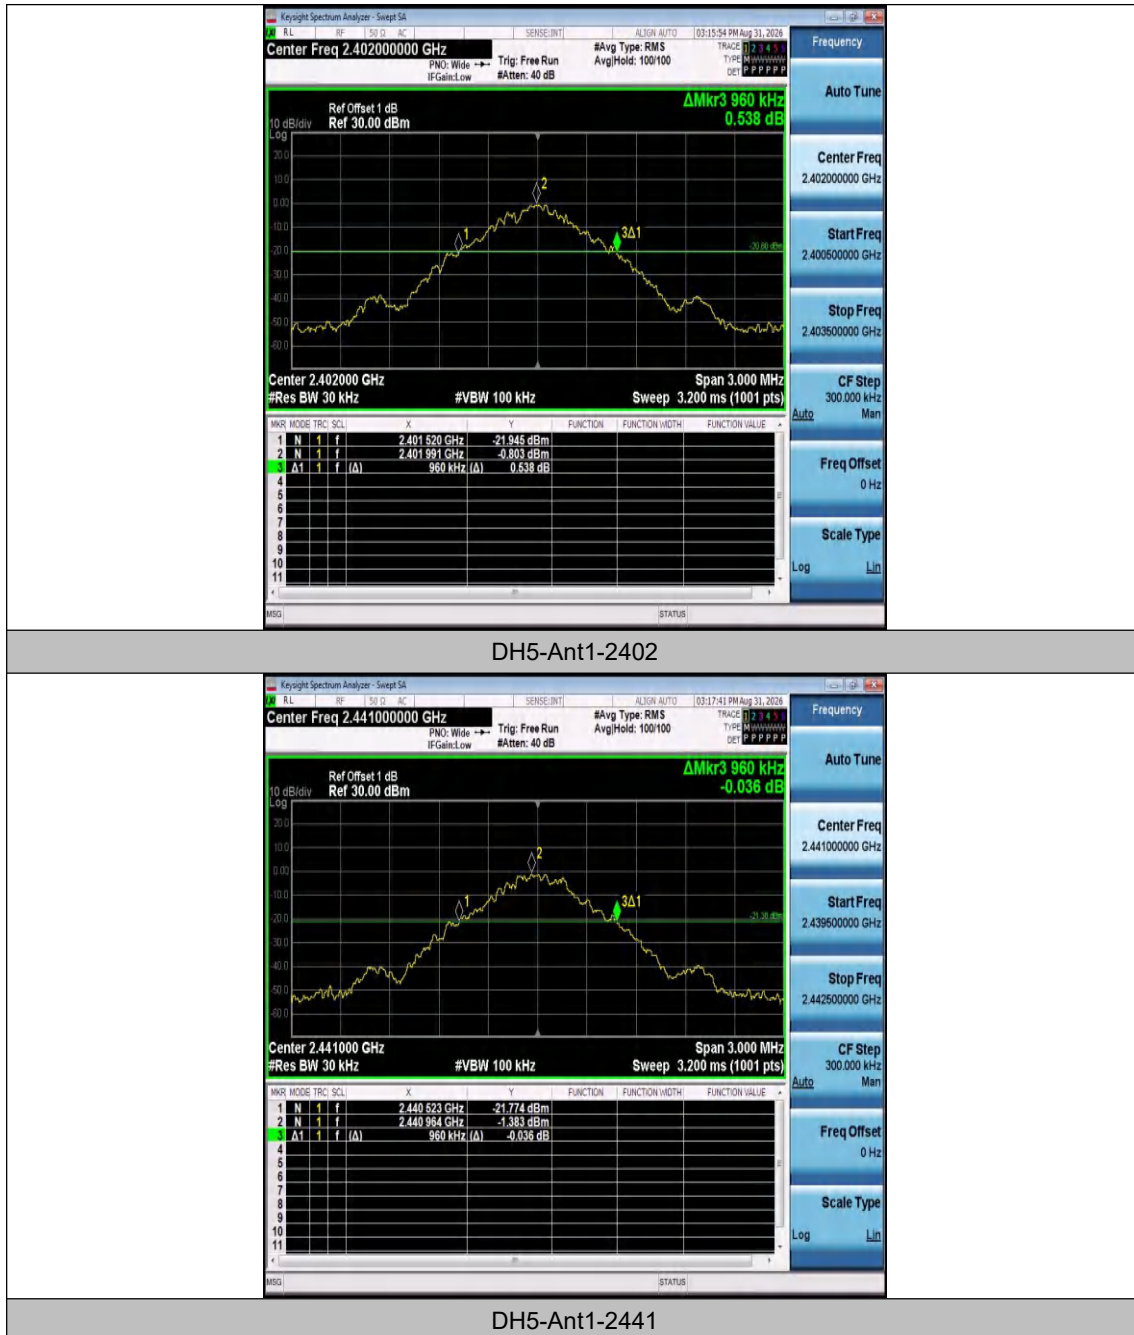

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com







Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.88704	2401.5479	2402.4350	---	---
DH5	Ant1	2441	0.88845	2440.5475	2441.4359	---	---
DH5	Ant1	2480	0.88788	2479.5423	2480.4302	---	---
2DH5	Ant1	2402	1.1962	2401.3969	2402.5931	---	---
2DH5	Ant1	2441	1.2069	2440.3906	2441.5975	---	---
2DH5	Ant1	2480	1.2008	2479.3894	2480.5902	---	---
3DH5	Ant1	2402	1.1916	2401.3966	2402.5882	---	---
3DH5	Ant1	2441	1.1972	2440.3941	2441.5913	---	---
3DH5	Ant1	2480	1.1818	2479.4020	2480.5838	---	---

Test Graphs





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	1.84	≤20.97	PASS
DH5	Ant1	2441	1.34	≤20.97	PASS
DH5	Ant1	2480	0.24	≤20.97	PASS
2DH5	Ant1	2402	2.68	≤20.97	PASS
2DH5	Ant1	2441	2.18	≤20.97	PASS
2DH5	Ant1	2480	1.09	≤20.97	PASS
3DH5	Ant1	2402	3.08	≤20.97	PASS
3DH5	Ant1	2441	2.49	≤20.97	PASS
3DH5	Ant1	2480	1.44	≤20.97	PASS

Test Graphs

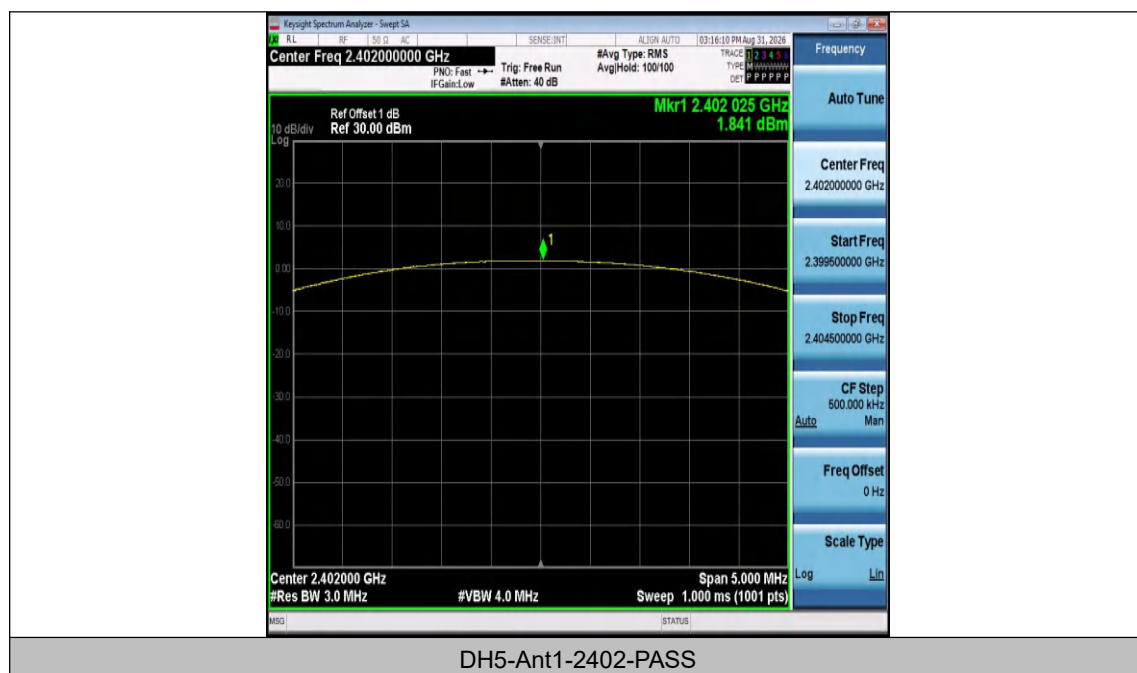


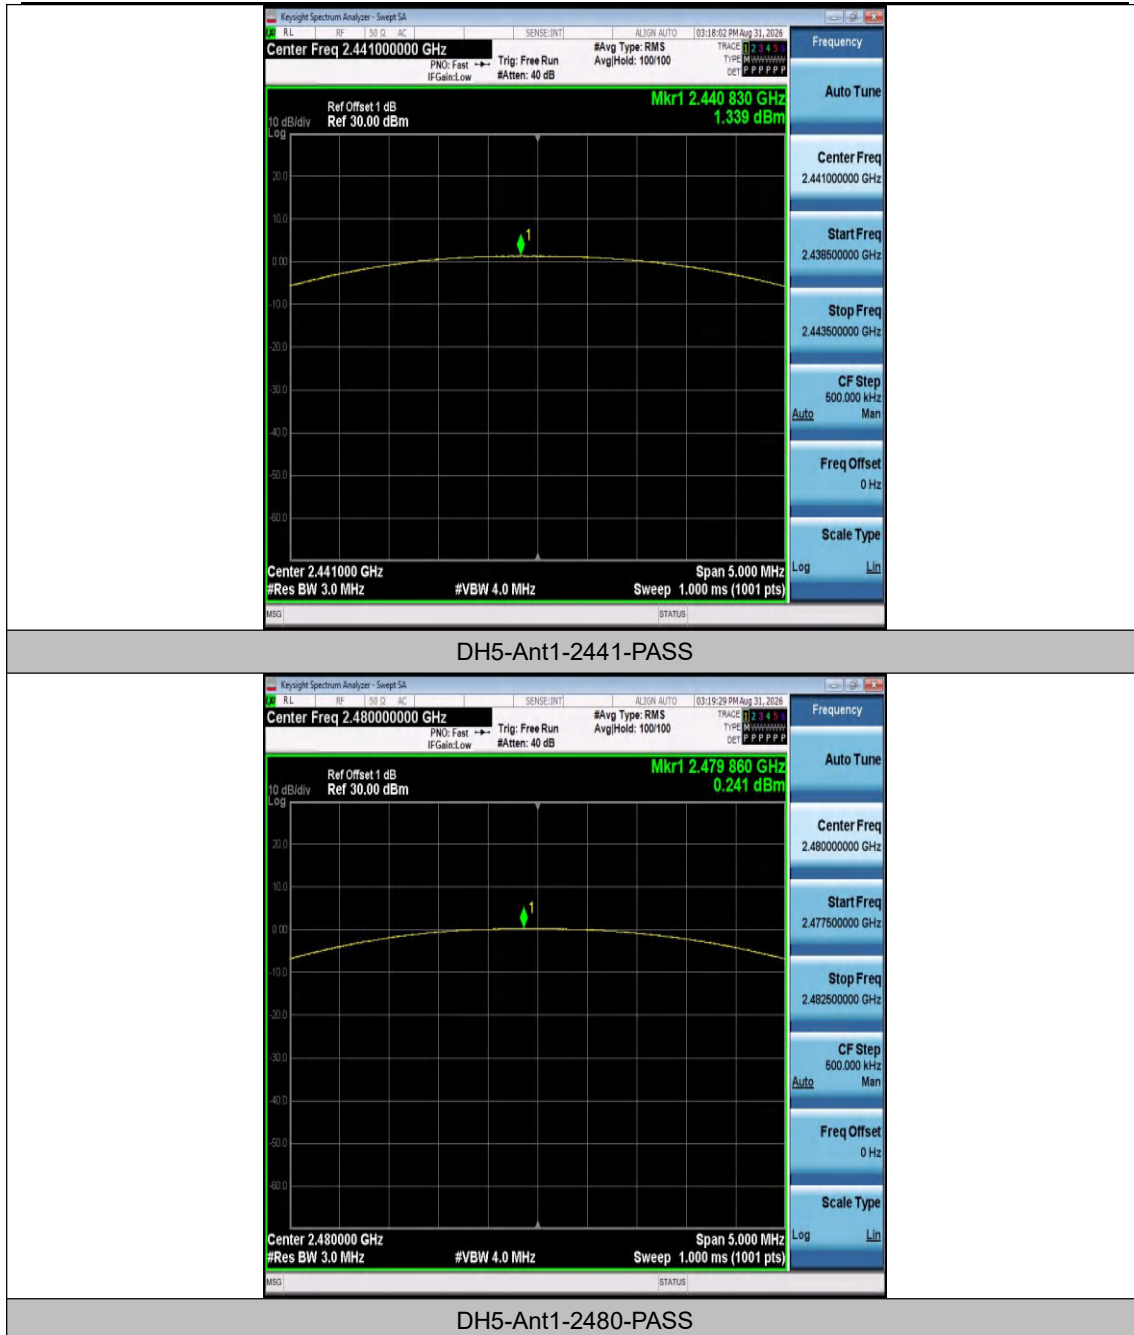

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

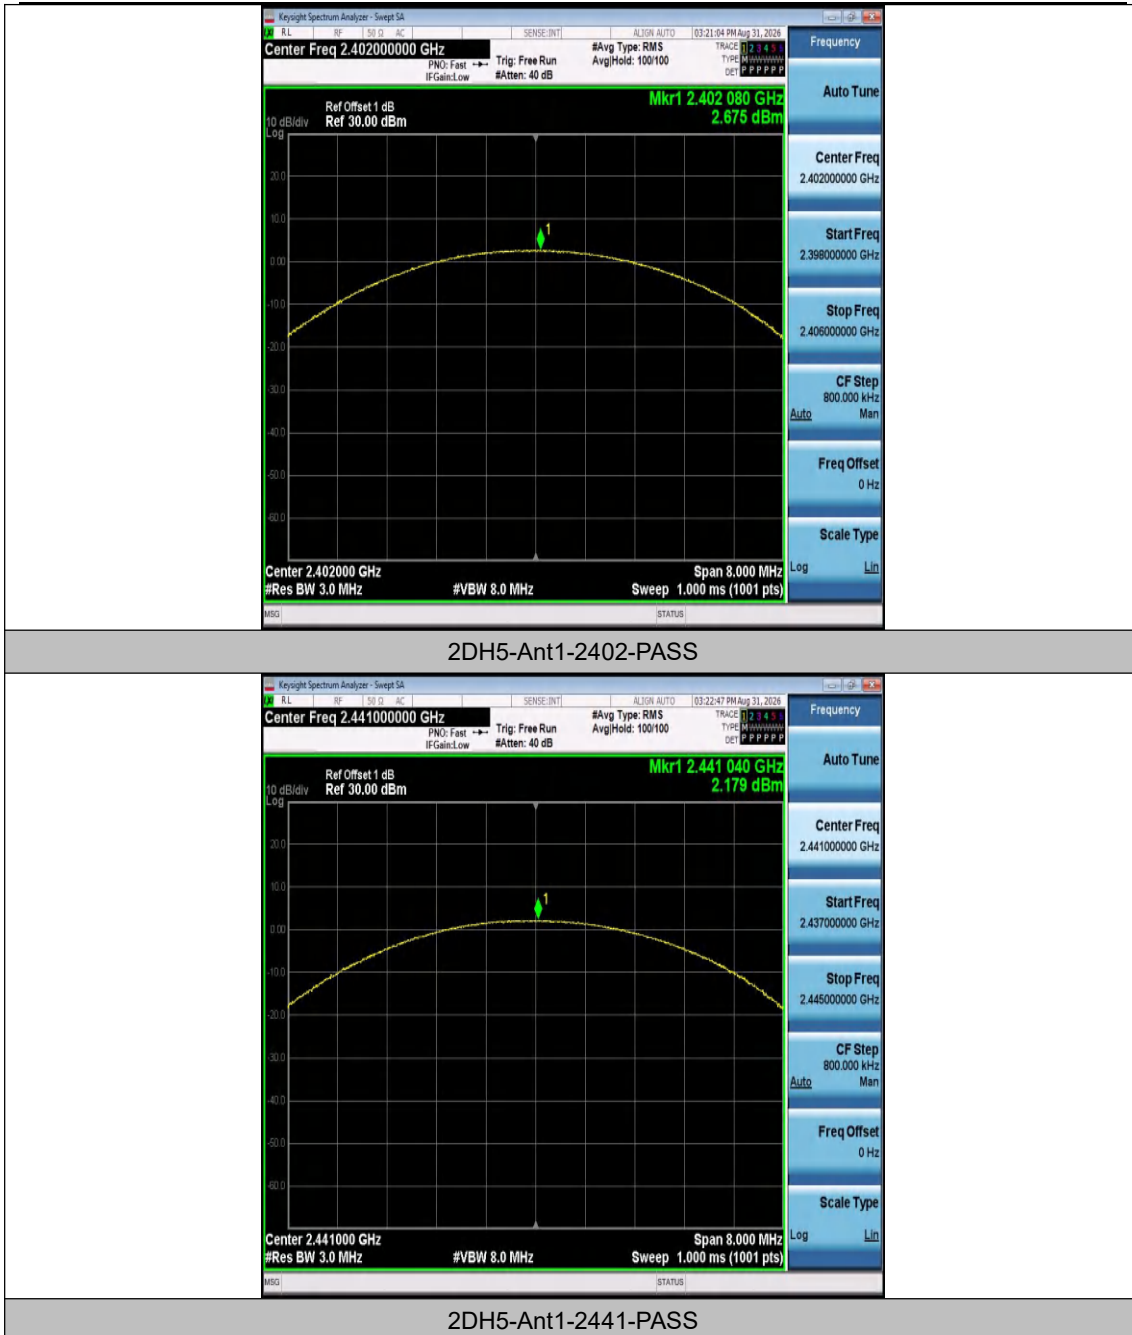

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

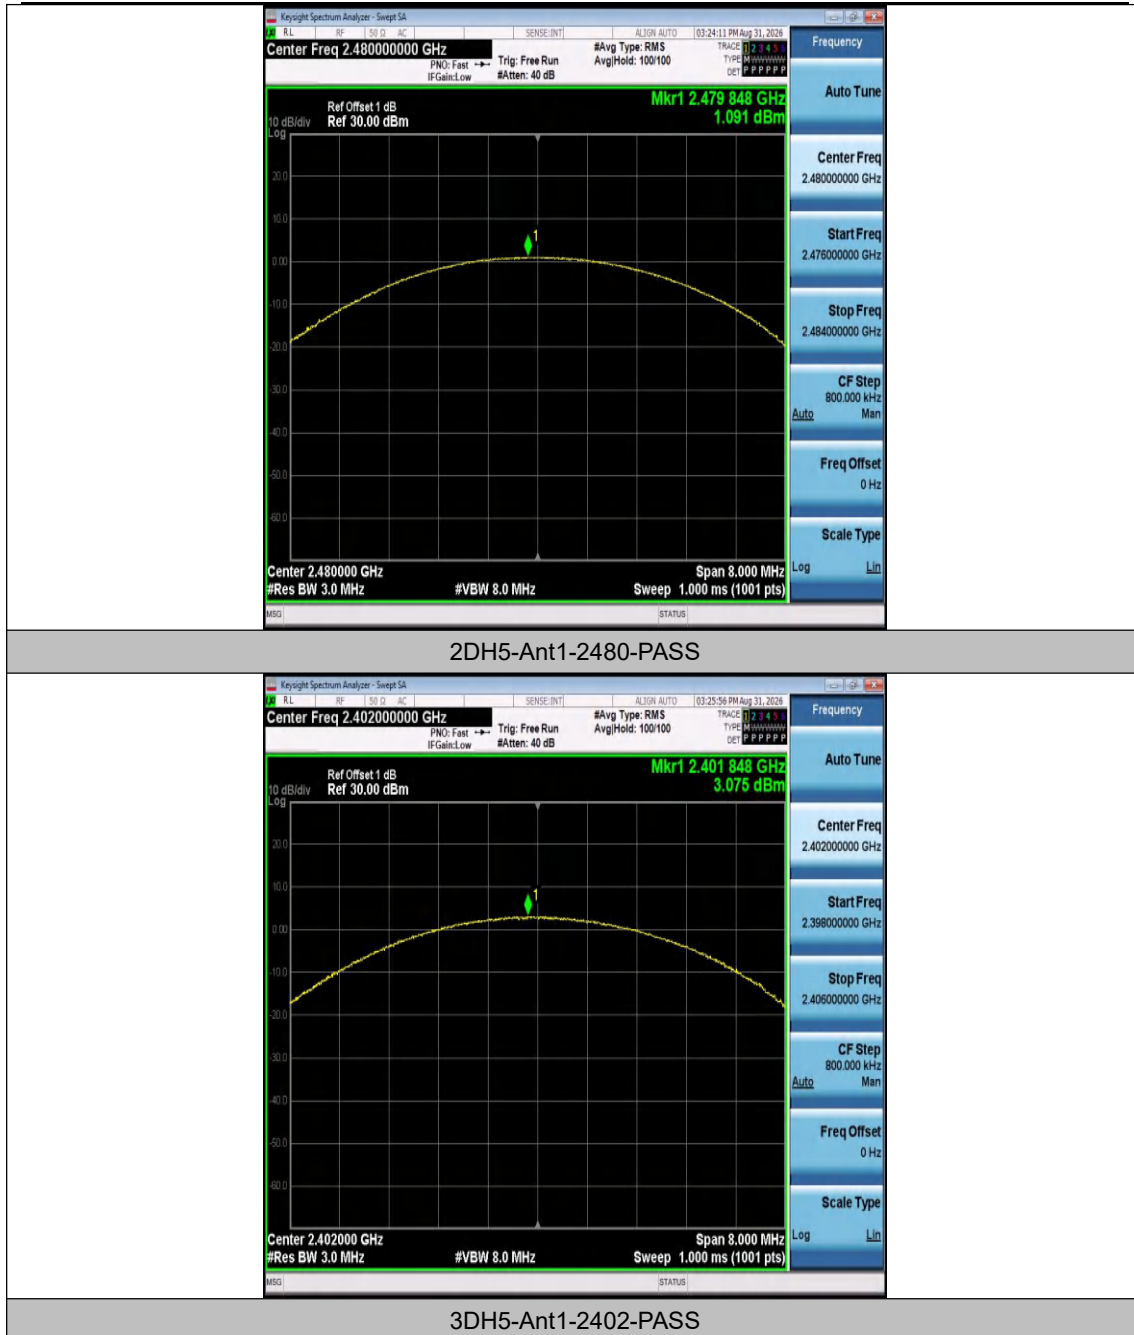

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

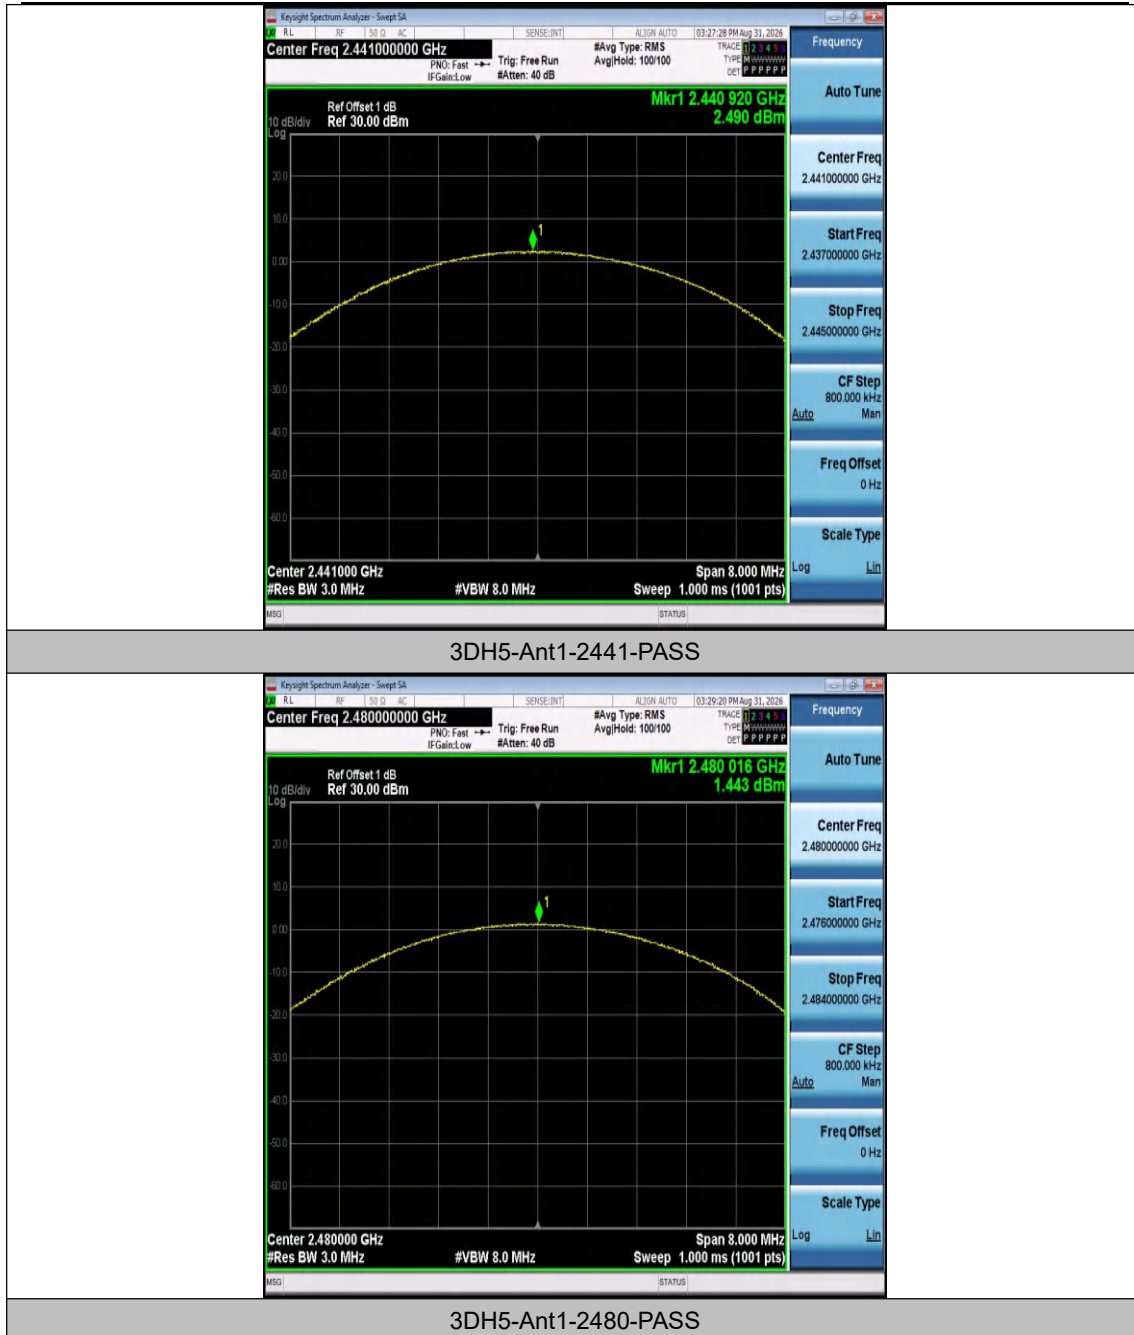

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Carrier frequency separation


Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.998	≥0.654	PASS
2DH5	Ant1	Hop	1.018	≥0.882	PASS
3DH5	Ant1	Hop	0.99	≥0.870	PASS

Note: For conducted power less than 0.125 W(20.97 dBm), the limit can be set using hopping channel carrier frequencies that are separated by 25 kHz or two thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

Test Graphs

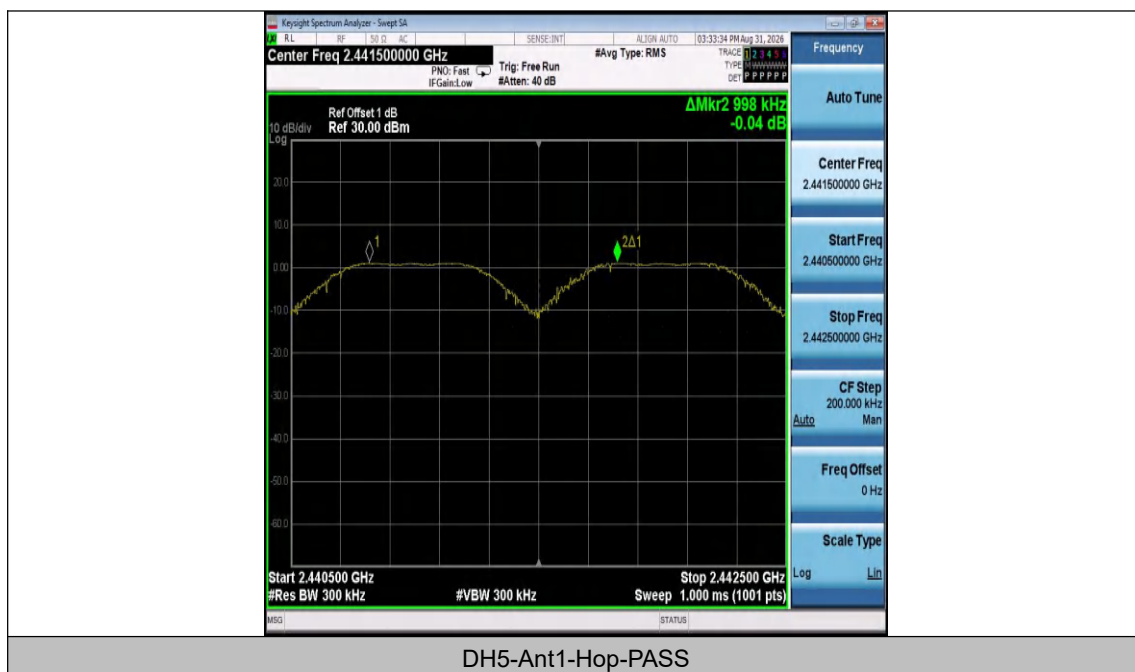

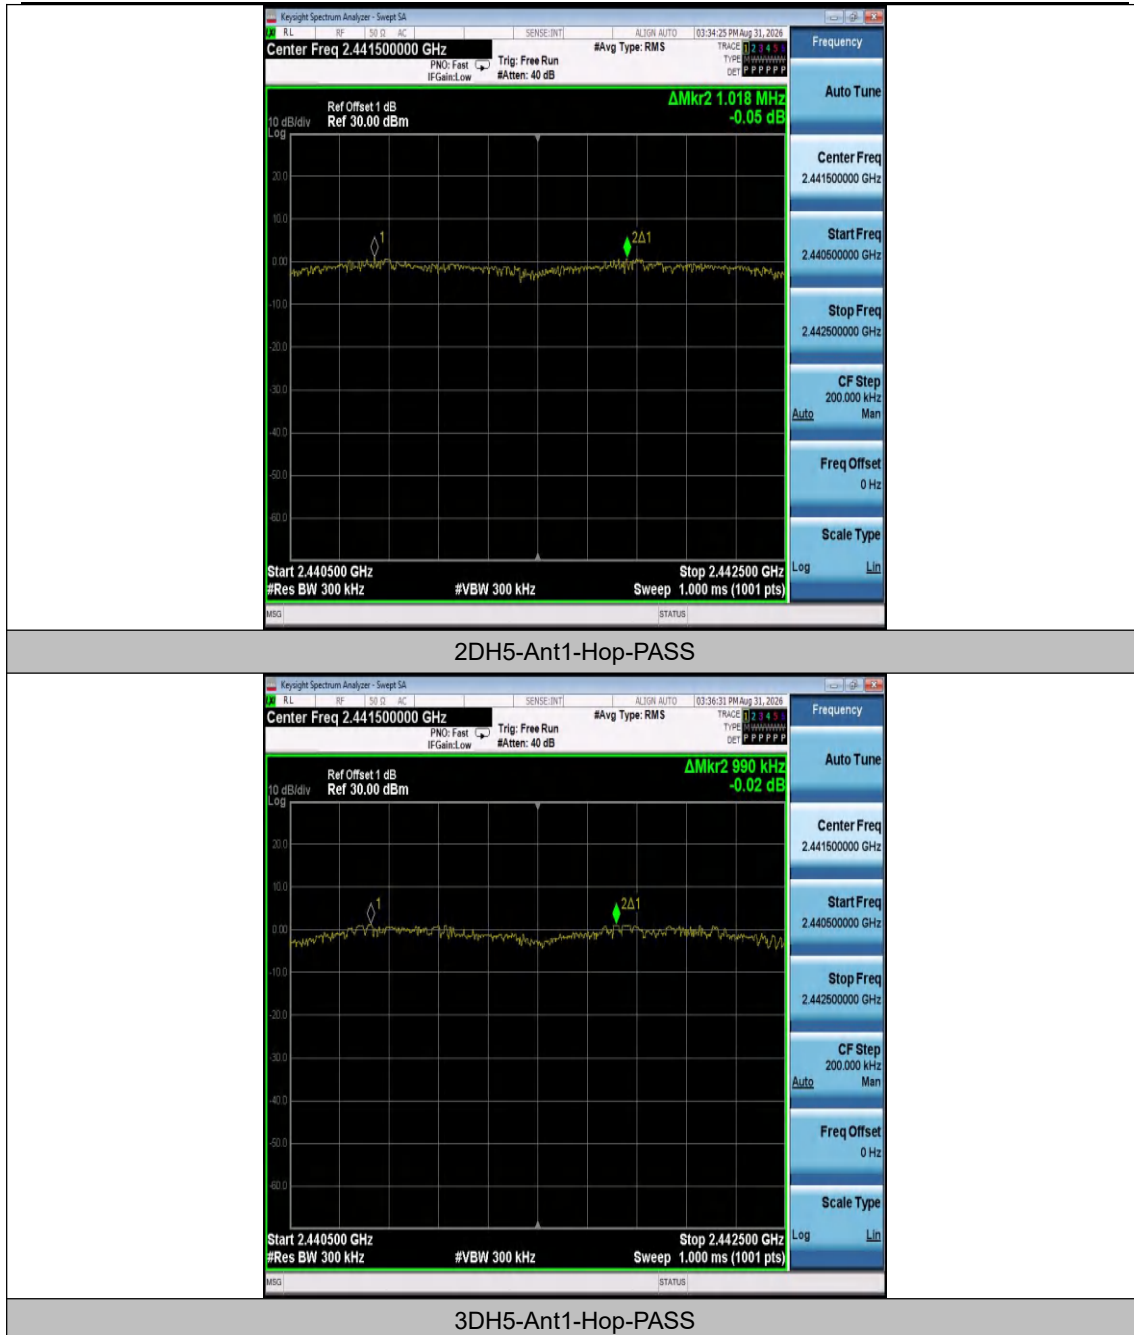

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.887	115	0.332	≤0.4	PASS
2DH5	Ant1	Hop	2.892	111	0.321	≤0.4	PASS
3DH5	Ant1	Hop	2.892	117	0.338	≤0.4	PASS


Test Graphs

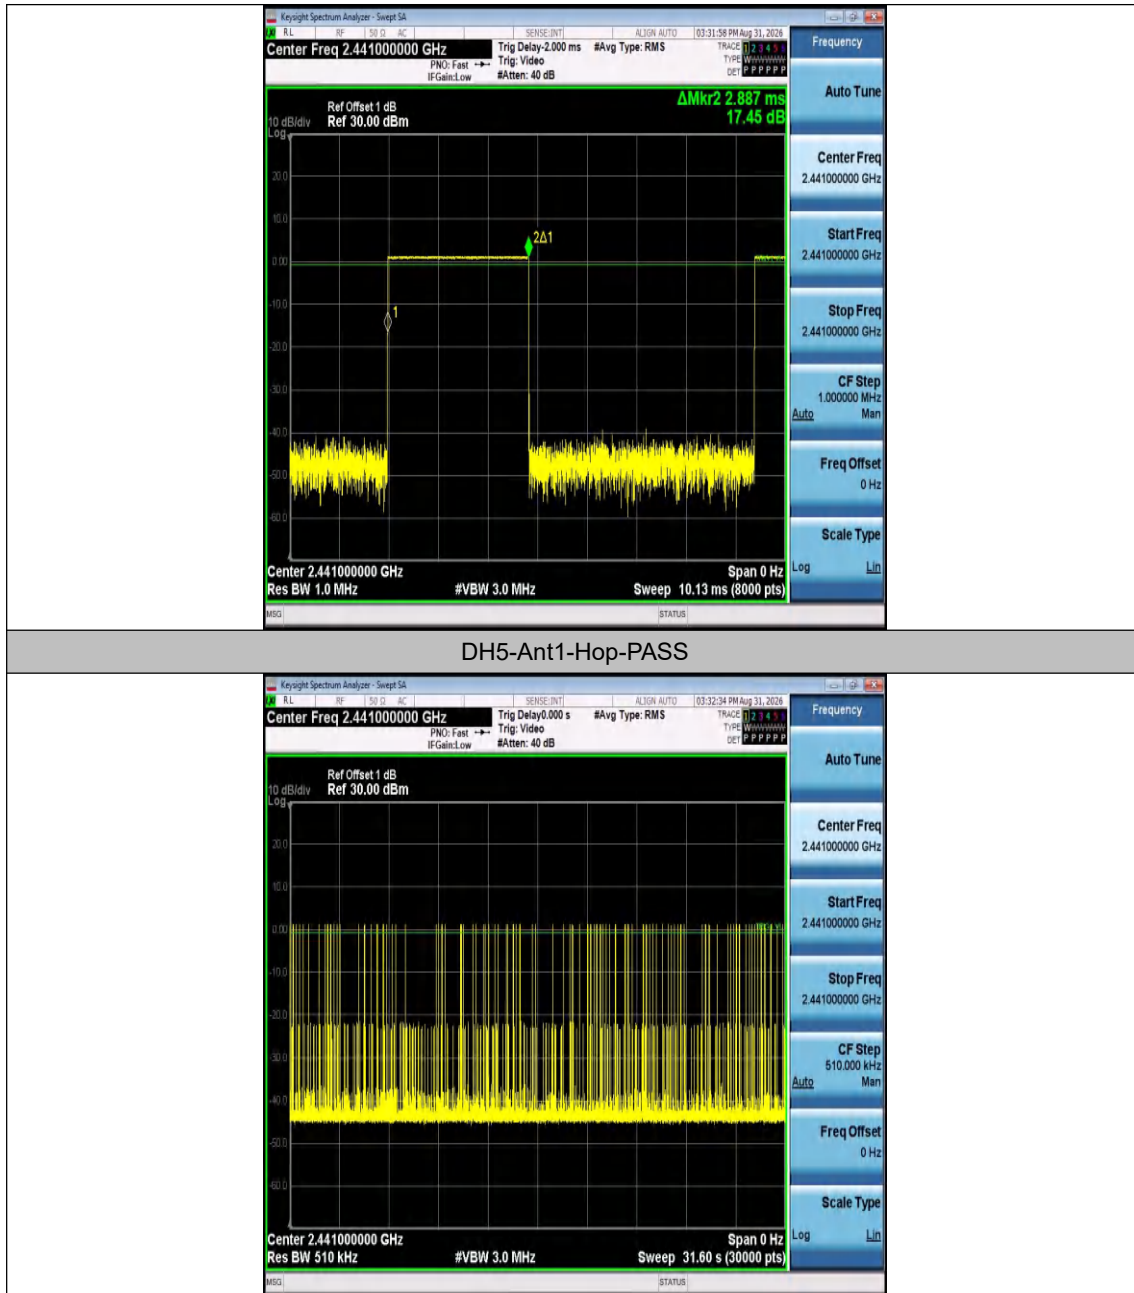

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

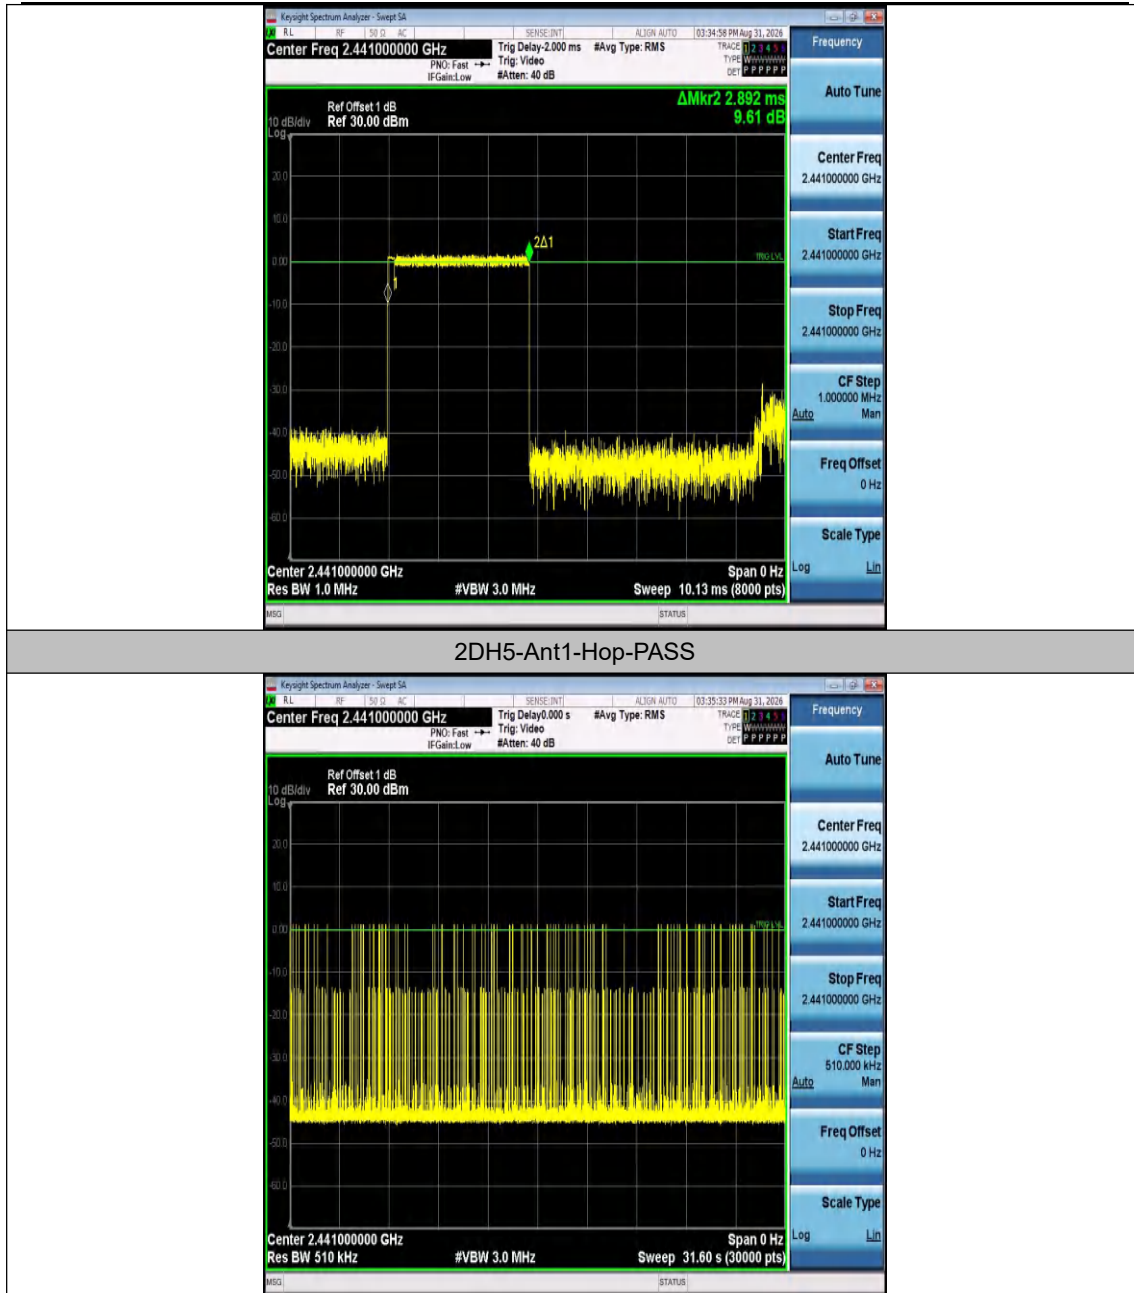

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

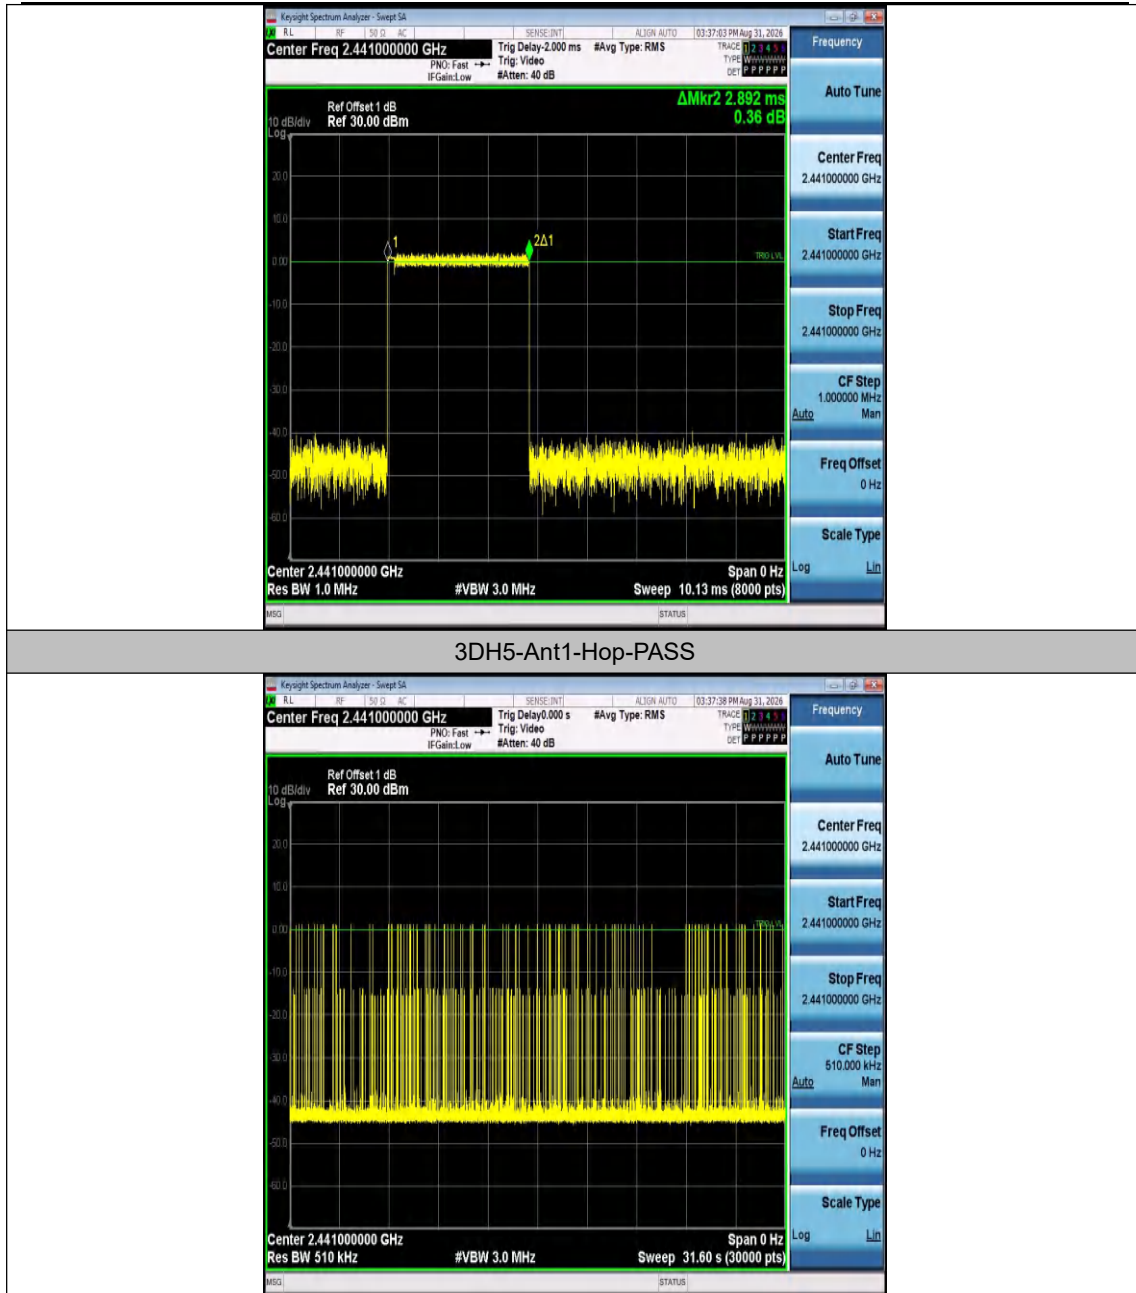

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Test Graphs

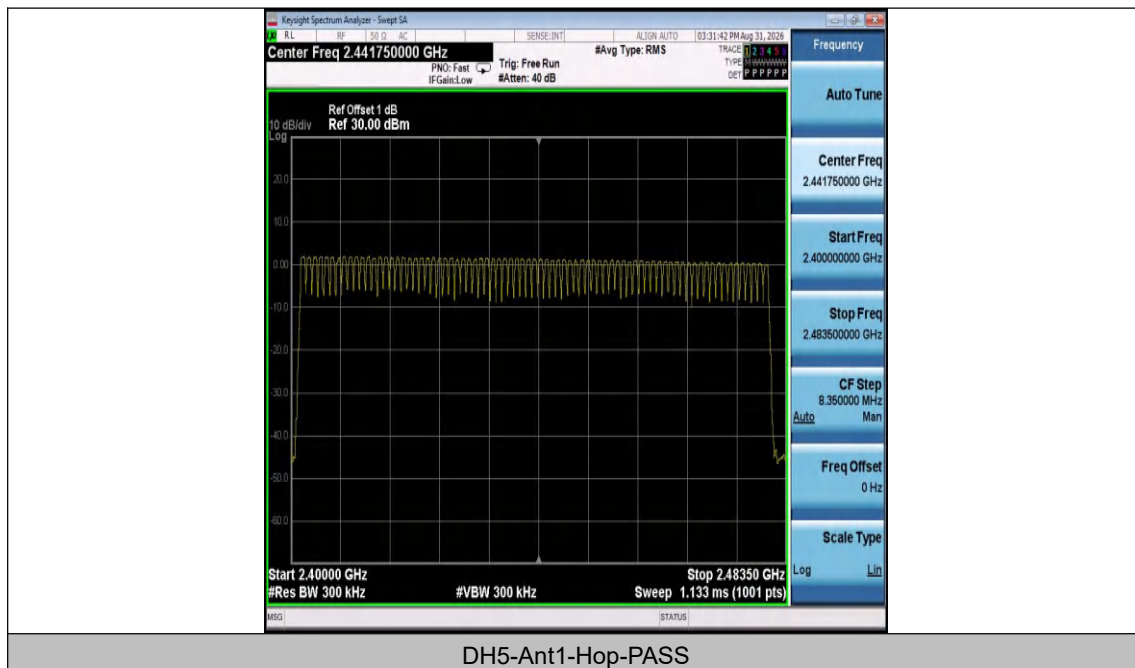

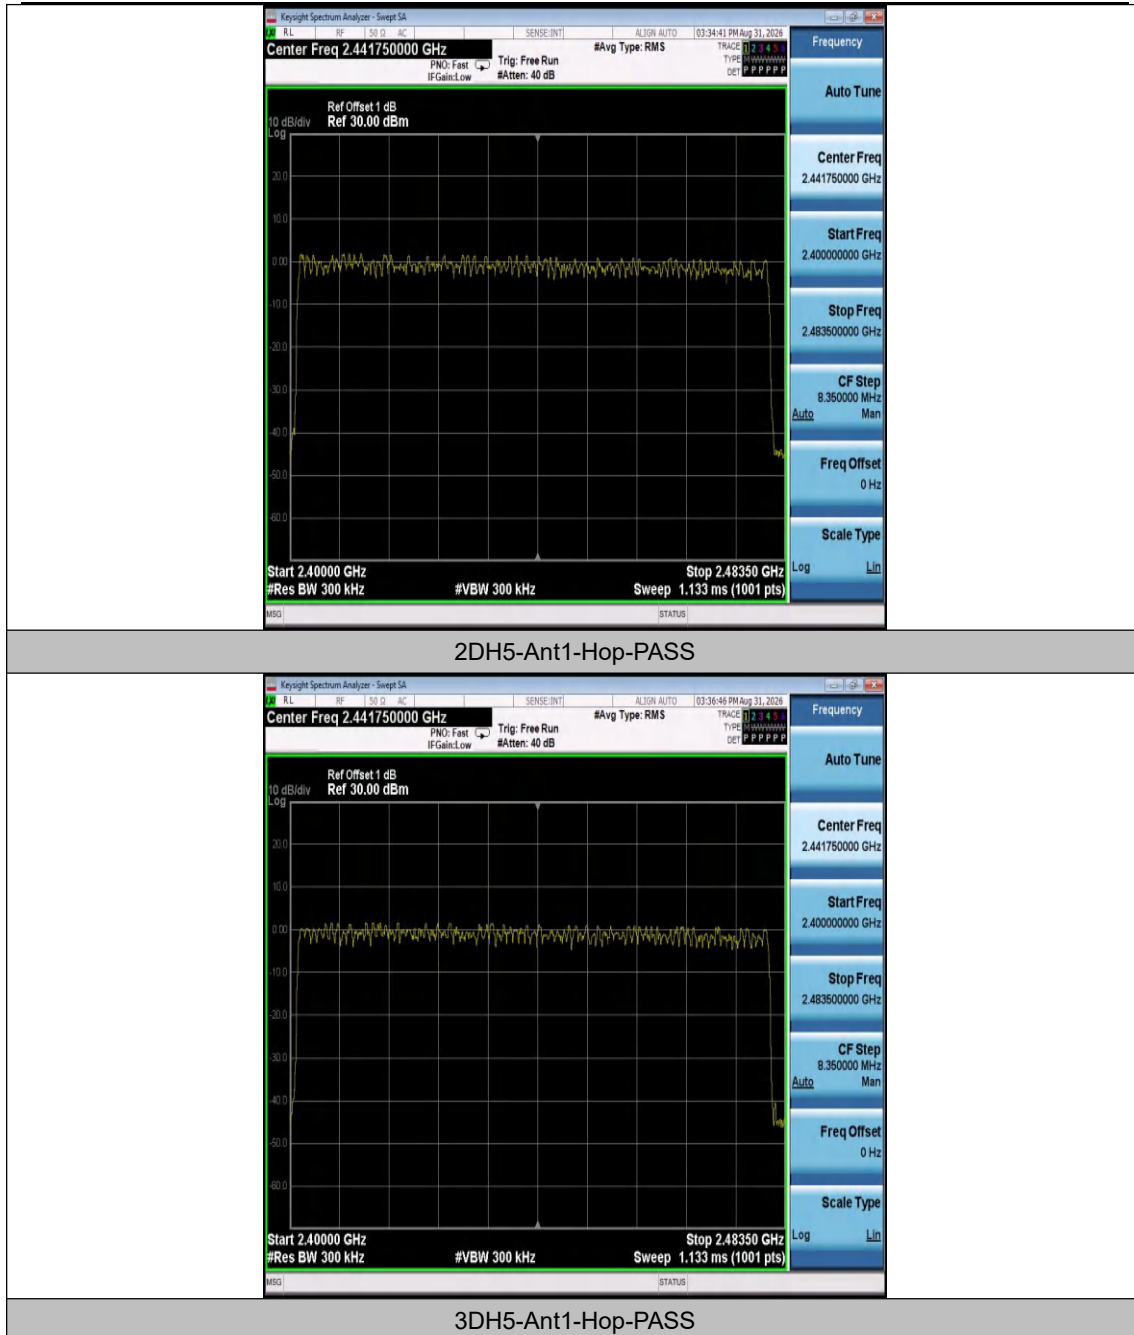

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge


Test Result


Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	1.60	-45.99	≤-18.4	PASS
DH5	Ant1	High	2480	0.16	-54.67	≤-19.85	PASS
DH5	Ant1	Low	Hop_2402	1.22	-48.55	≤-18.78	PASS
DH5	Ant1	High	Hop_2480	0.12	-52.73	≤-19.88	PASS
2DH5	Ant1	Low	2402	1.79	-45.85	≤-18.21	PASS
2DH5	Ant1	High	2480	0.05	-56.26	≤-19.95	PASS
2DH5	Ant1	Low	Hop_2402	-2.15	-50.77	≤-22.15	PASS
2DH5	Ant1	High	Hop_2480	-0.92	-54.11	≤-20.92	PASS
3DH5	Ant1	Low	2402	1.82	-47.51	≤-18.18	PASS
3DH5	Ant1	High	2480	0.02	-55.38	≤-19.98	PASS
3DH5	Ant1	Low	Hop_2402	1.40	-48.42	≤-18.6	PASS
3DH5	Ant1	High	Hop_2480	0.04	-52.36	≤-19.96	PASS


Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Graphs

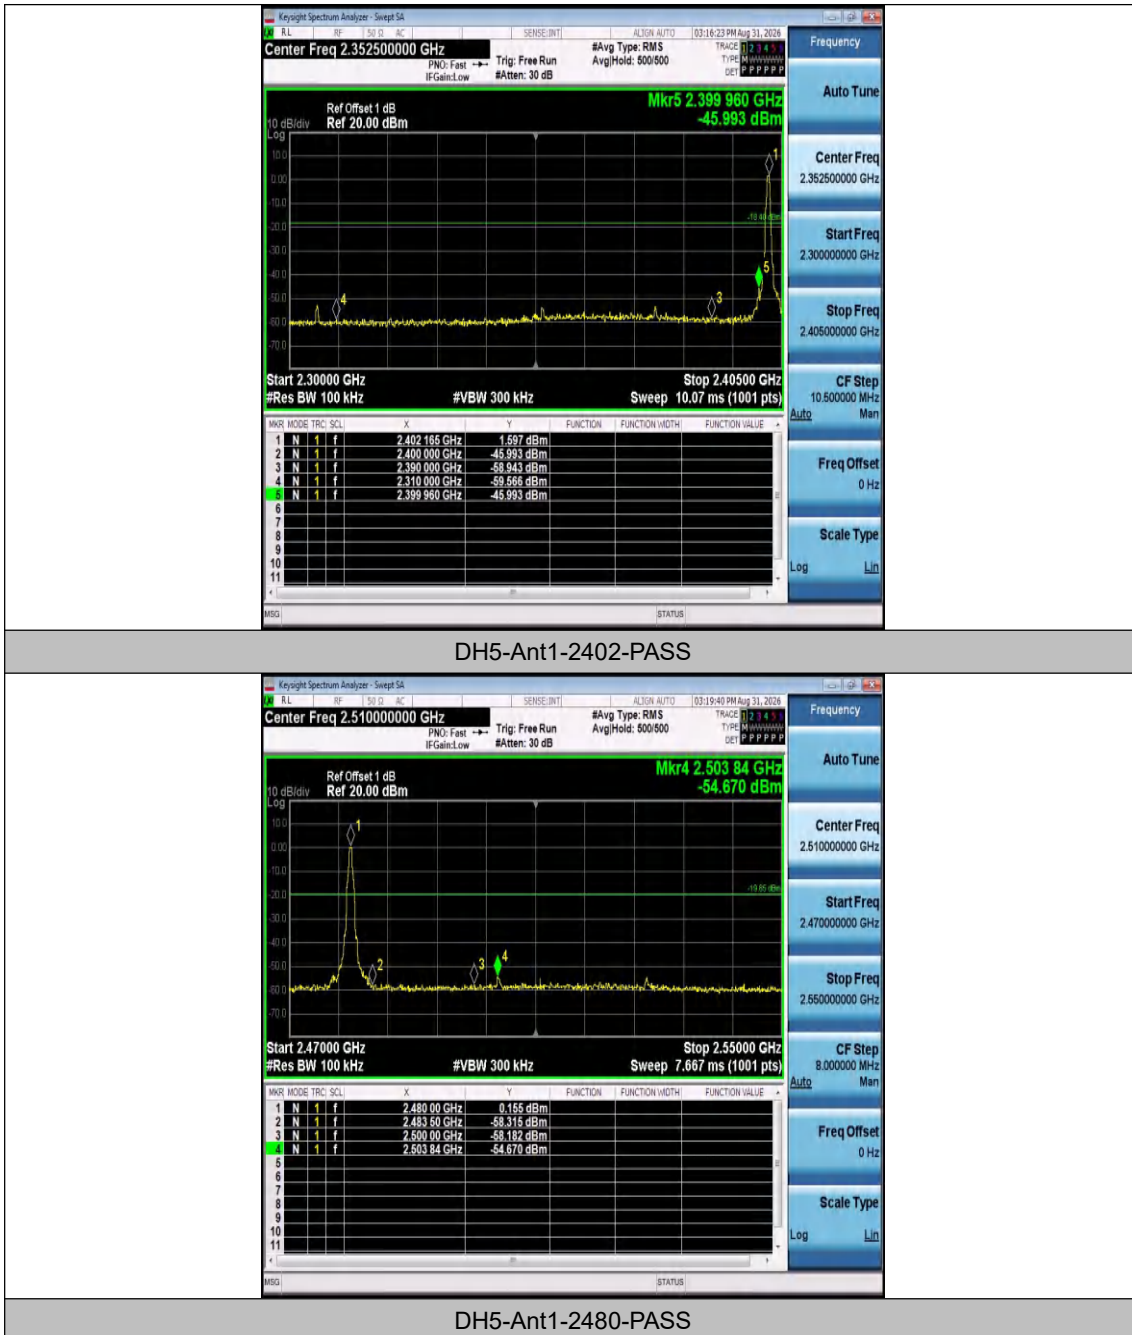


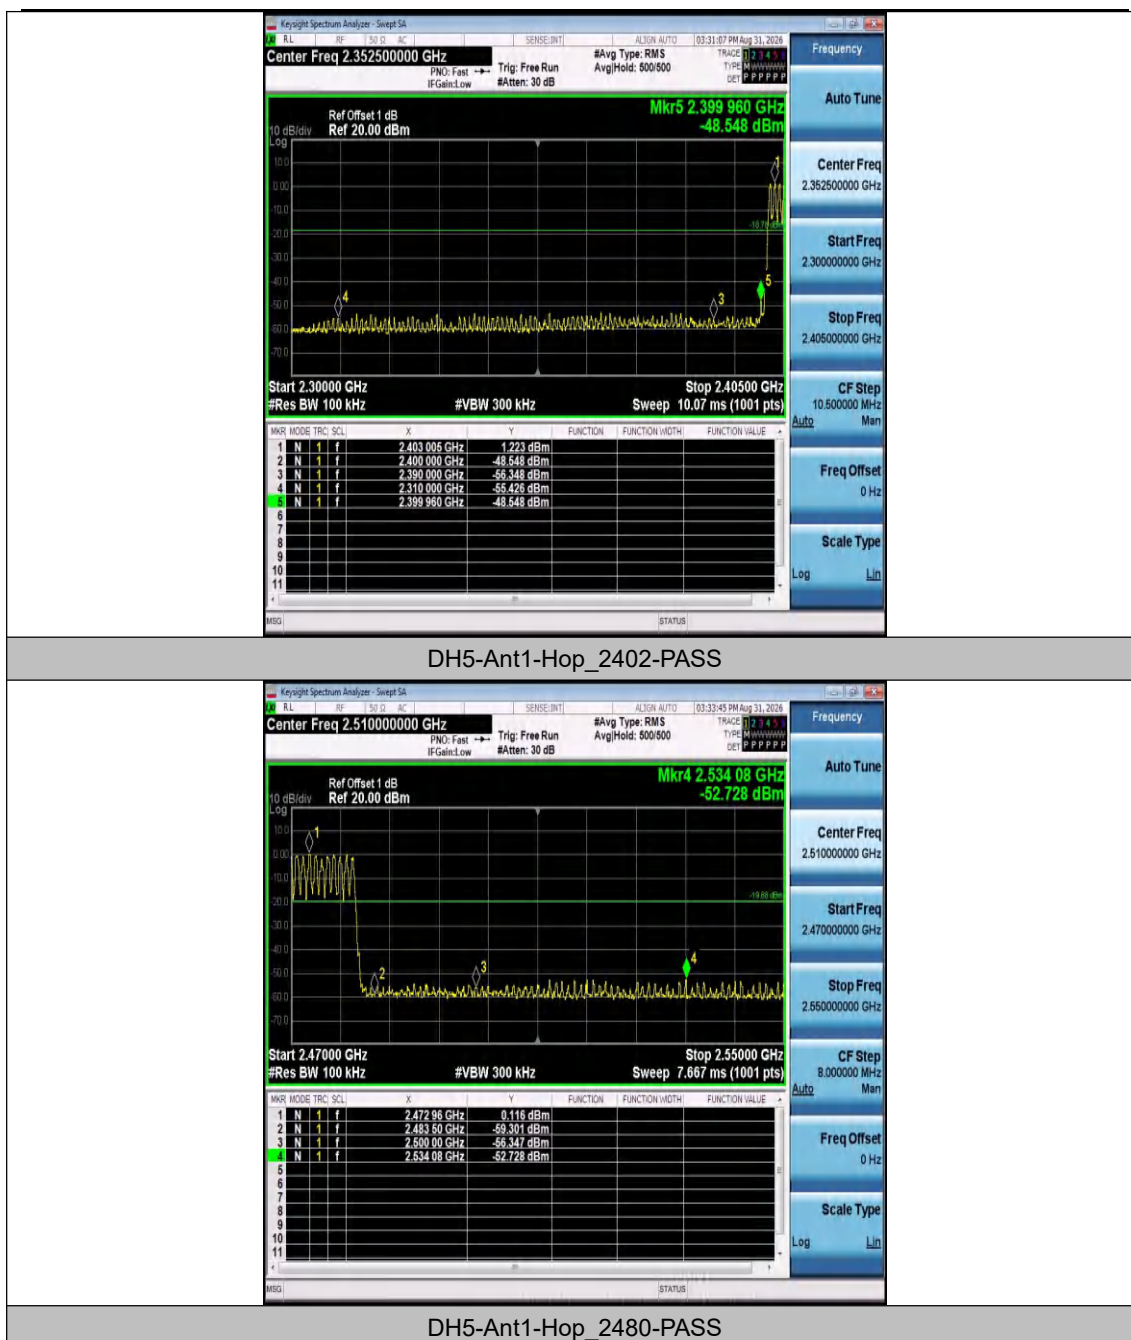

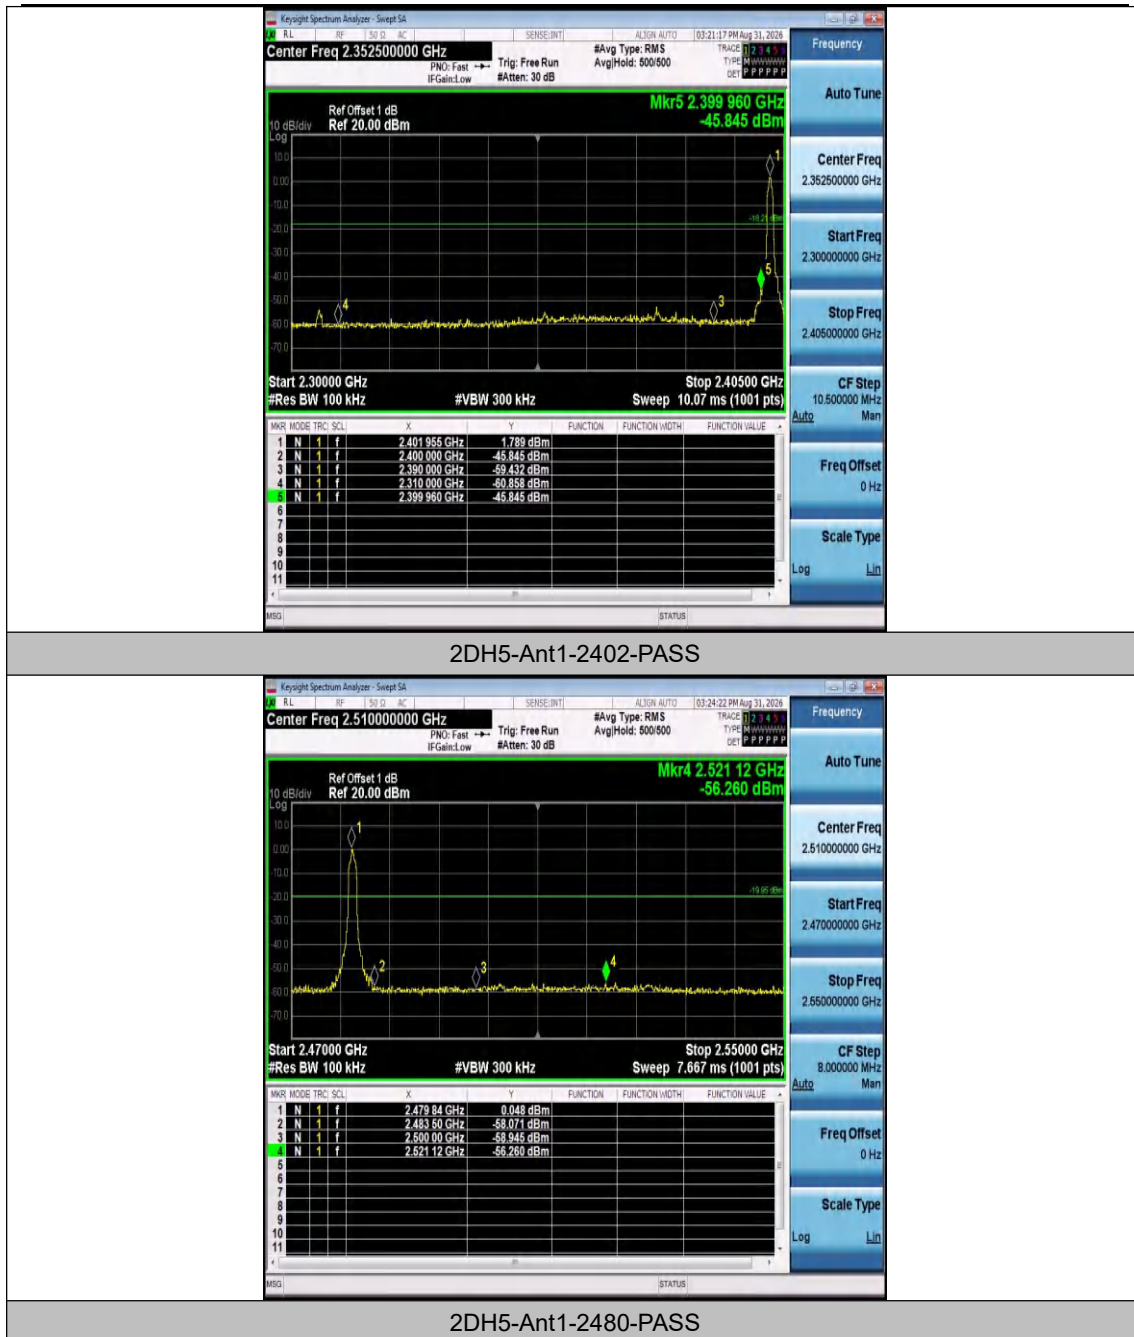

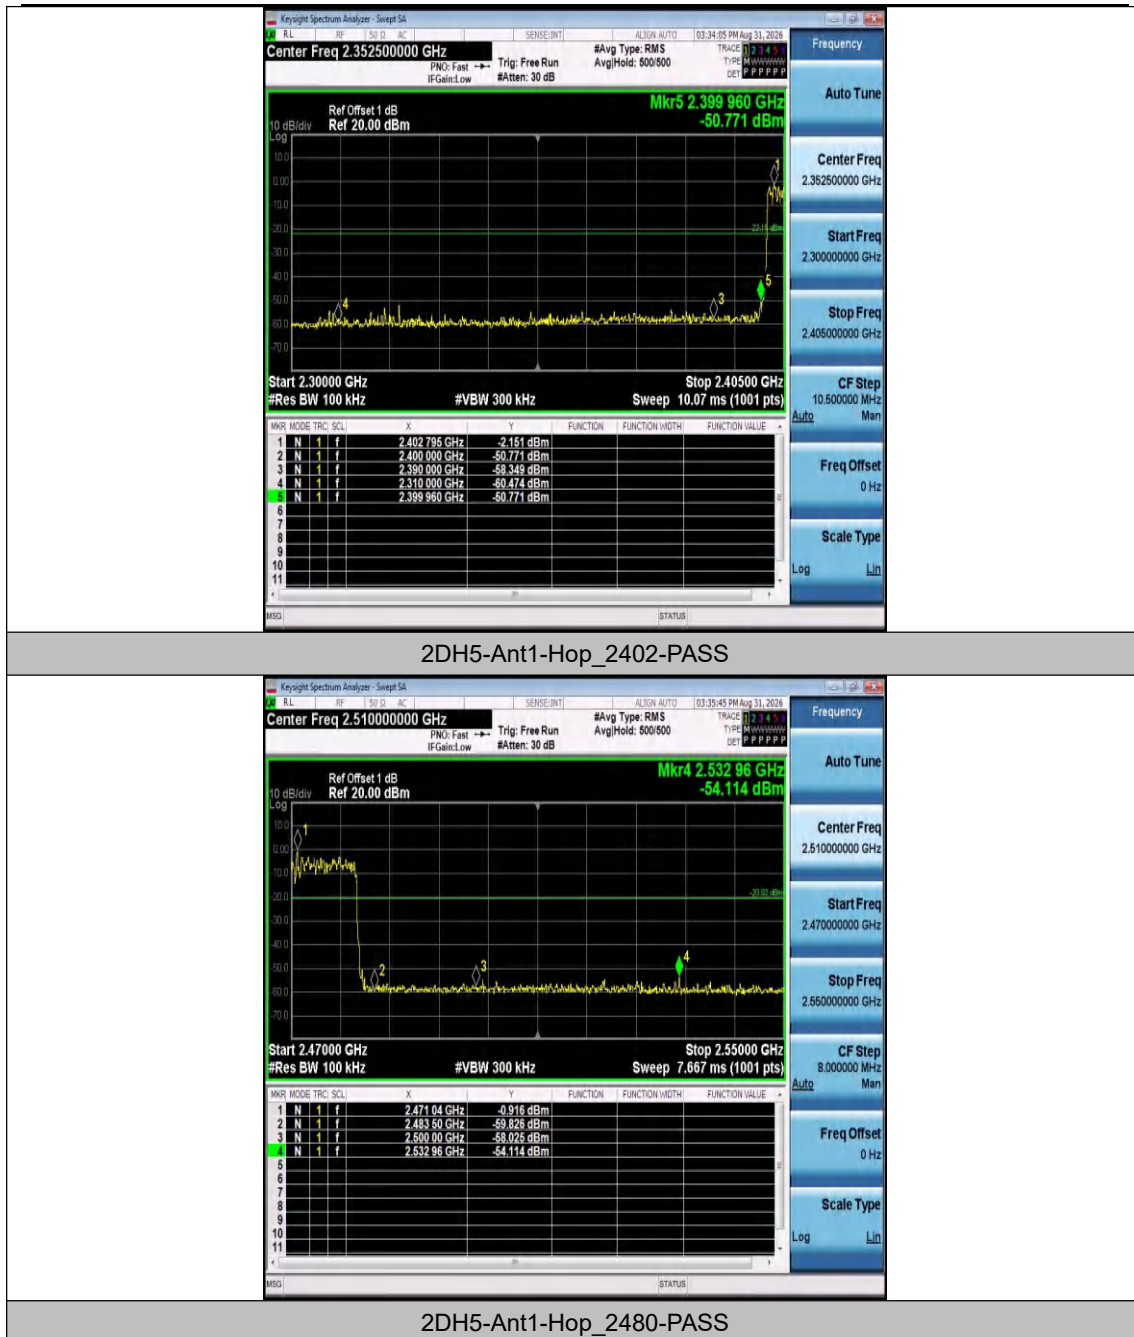

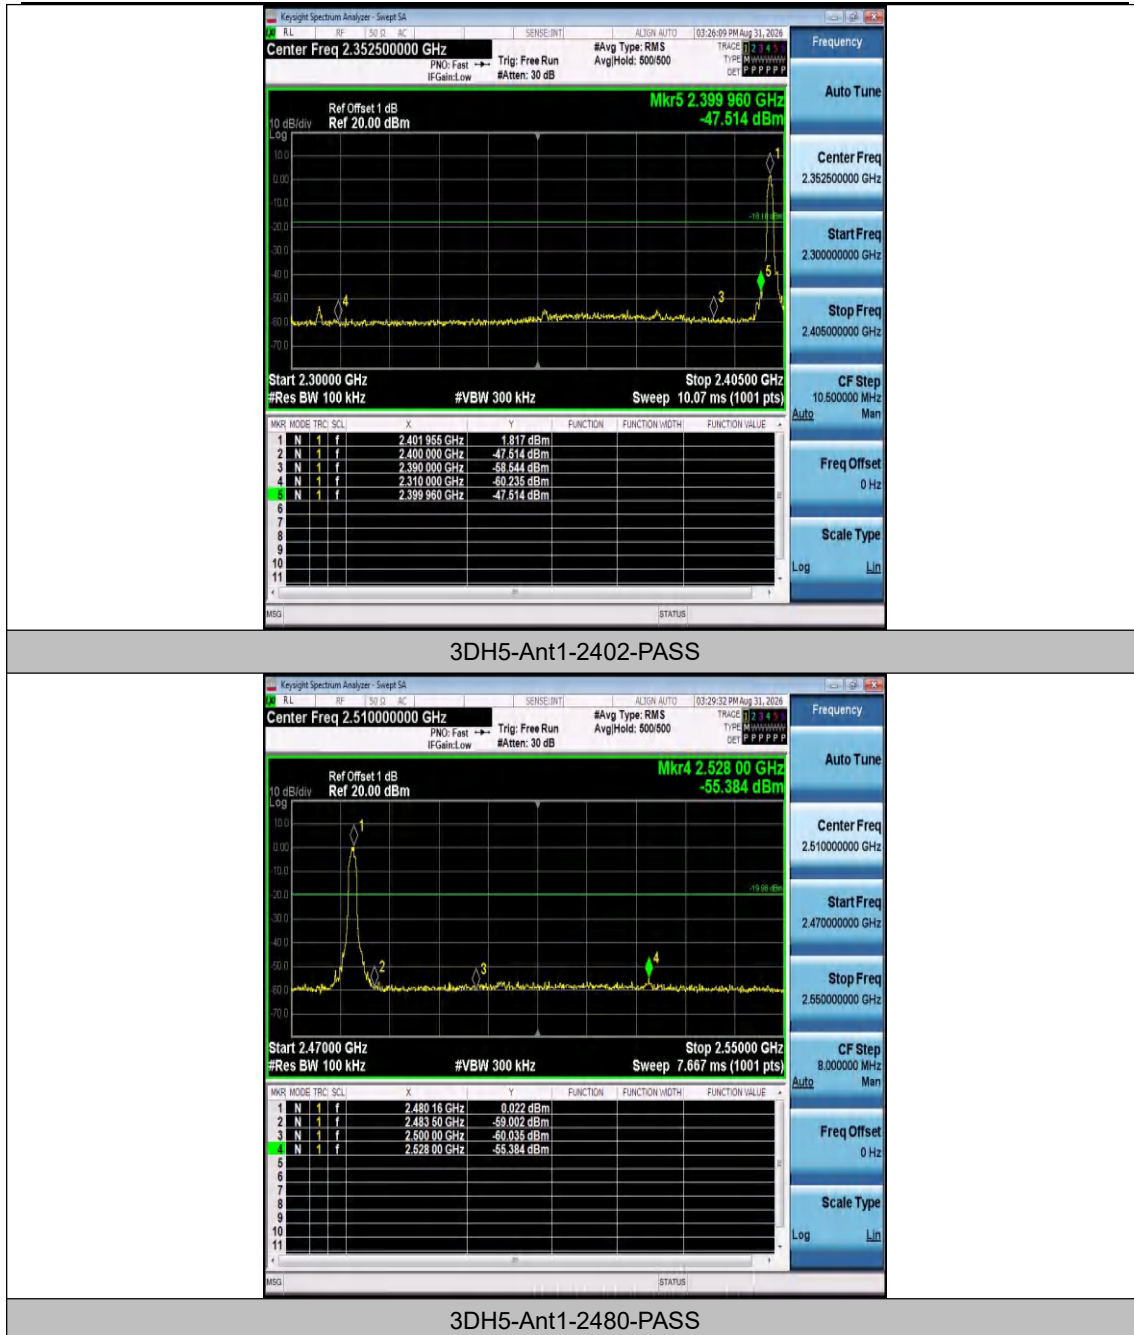

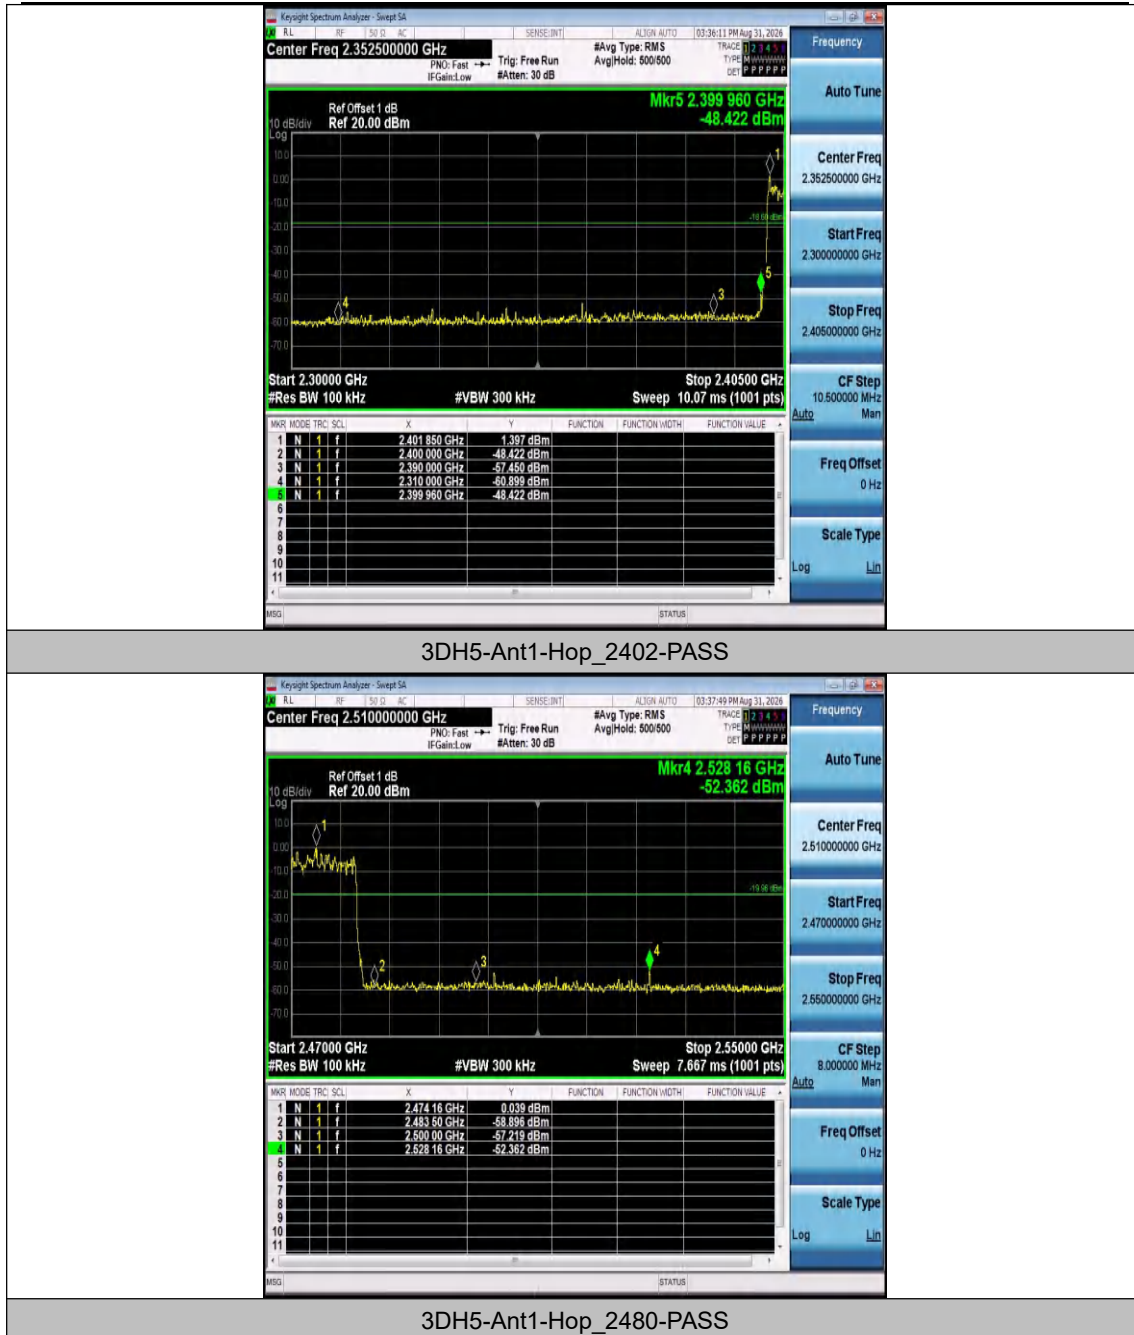

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	1.61	1.61	---	PASS
DH5	Ant1	2402	30~1000	1.61	-69.13	≤-18.39	PASS
DH5	Ant1	2402	1000~26500	1.61	-40.45	≤-18.39	PASS
DH5	Ant1	2441	0~Reference	0.95	0.95	---	PASS
DH5	Ant1	2441	30~1000	0.95	-68.78	≤-19.05	PASS
DH5	Ant1	2441	1000~26500	0.95	-36.32	≤-19.05	PASS
DH5	Ant1	2480	0~Reference	-0.23	-0.23	---	PASS
DH5	Ant1	2480	30~1000	-0.23	-68.91	≤-20.23	PASS
DH5	Ant1	2480	1000~26500	-0.23	-33.2	≤-20.23	PASS
2DH5	Ant1	2402	0~Reference	1.51	1.51	---	PASS
2DH5	Ant1	2402	30~1000	1.51	-69.28	≤-18.49	PASS
2DH5	Ant1	2402	1000~26500	1.51	-40.34	≤-18.49	PASS
2DH5	Ant1	2441	0~Reference	1.06	1.06	---	PASS
2DH5	Ant1	2441	30~1000	1.06	-70.27	≤-18.94	PASS
2DH5	Ant1	2441	1000~26500	1.06	-36.08	≤-18.94	PASS
2DH5	Ant1	2480	0~Reference	0.03	0.03	---	PASS
2DH5	Ant1	2480	30~1000	0.03	-69.65	≤-19.97	PASS
2DH5	Ant1	2480	1000~26500	0.03	-35.64	≤-19.97	PASS
3DH5	Ant1	2402	0~Reference	1.42	1.42	---	PASS
3DH5	Ant1	2402	30~1000	1.42	-70.2	≤-18.58	PASS
3DH5	Ant1	2402	1000~26500	1.42	-40.1	≤-18.58	PASS
3DH5	Ant1	2441	0~Reference	0.95	0.95	---	PASS
3DH5	Ant1	2441	30~1000	0.95	-69.6	≤-19.05	PASS
3DH5	Ant1	2441	1000~26500	0.95	-35.7	≤-19.05	PASS
3DH5	Ant1	2480	0~Reference	-0.03	-0.03	---	PASS
3DH5	Ant1	2480	30~1000	-0.03	-69.34	≤-20.03	PASS
3DH5	Ant1	2480	1000~26500	-0.03	-36.27	≤-20.03	PASS

Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

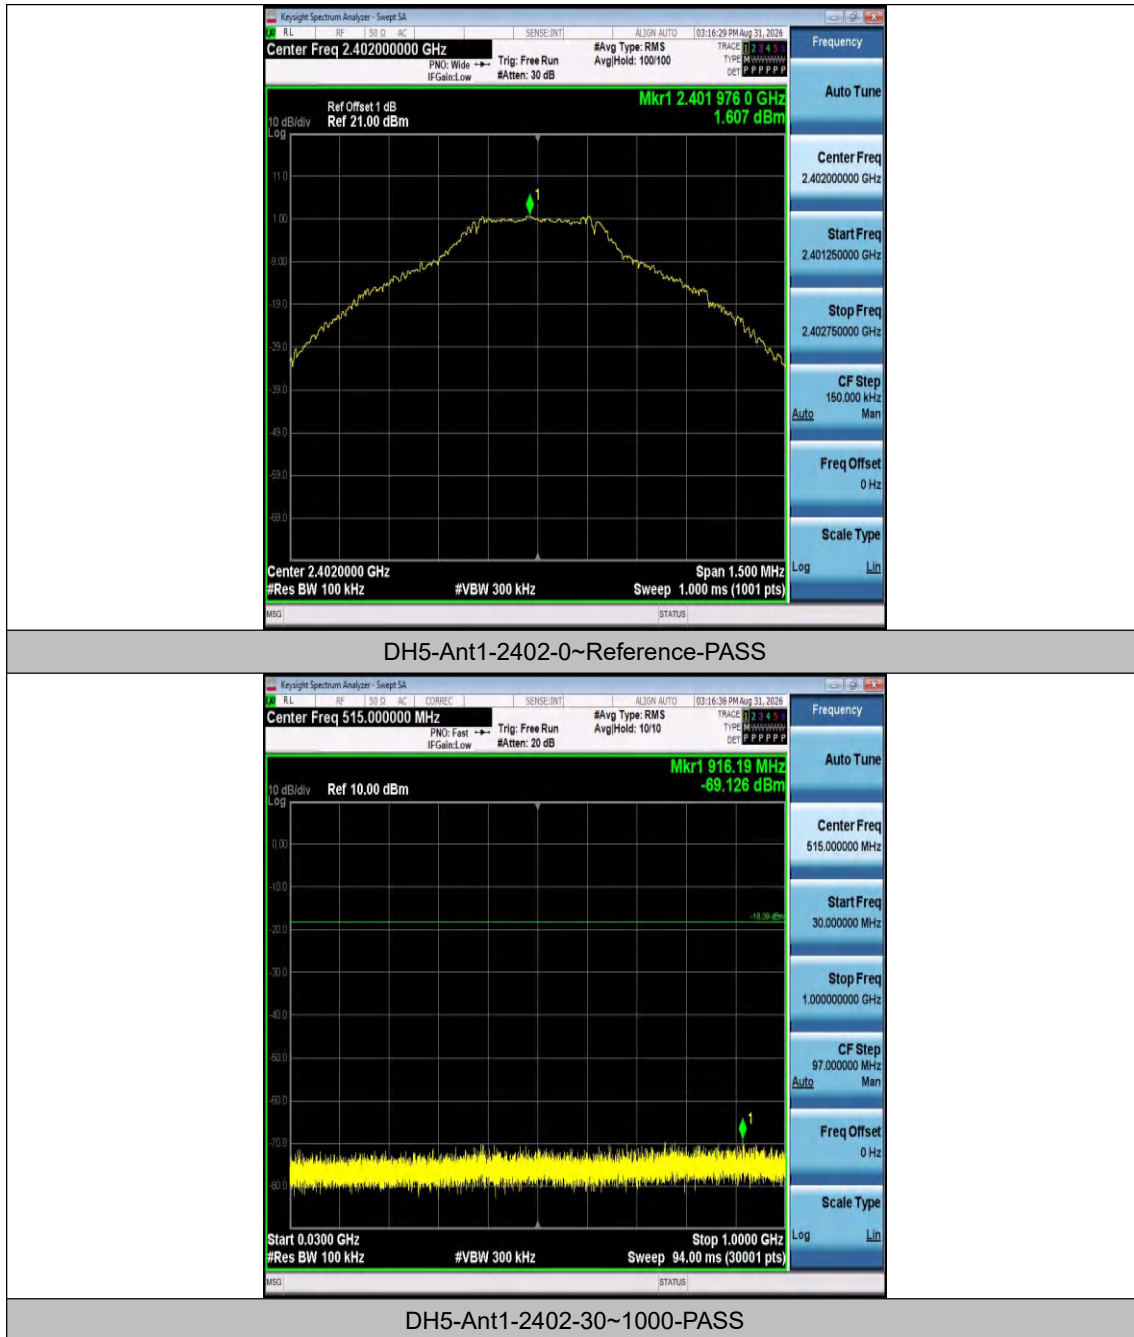


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

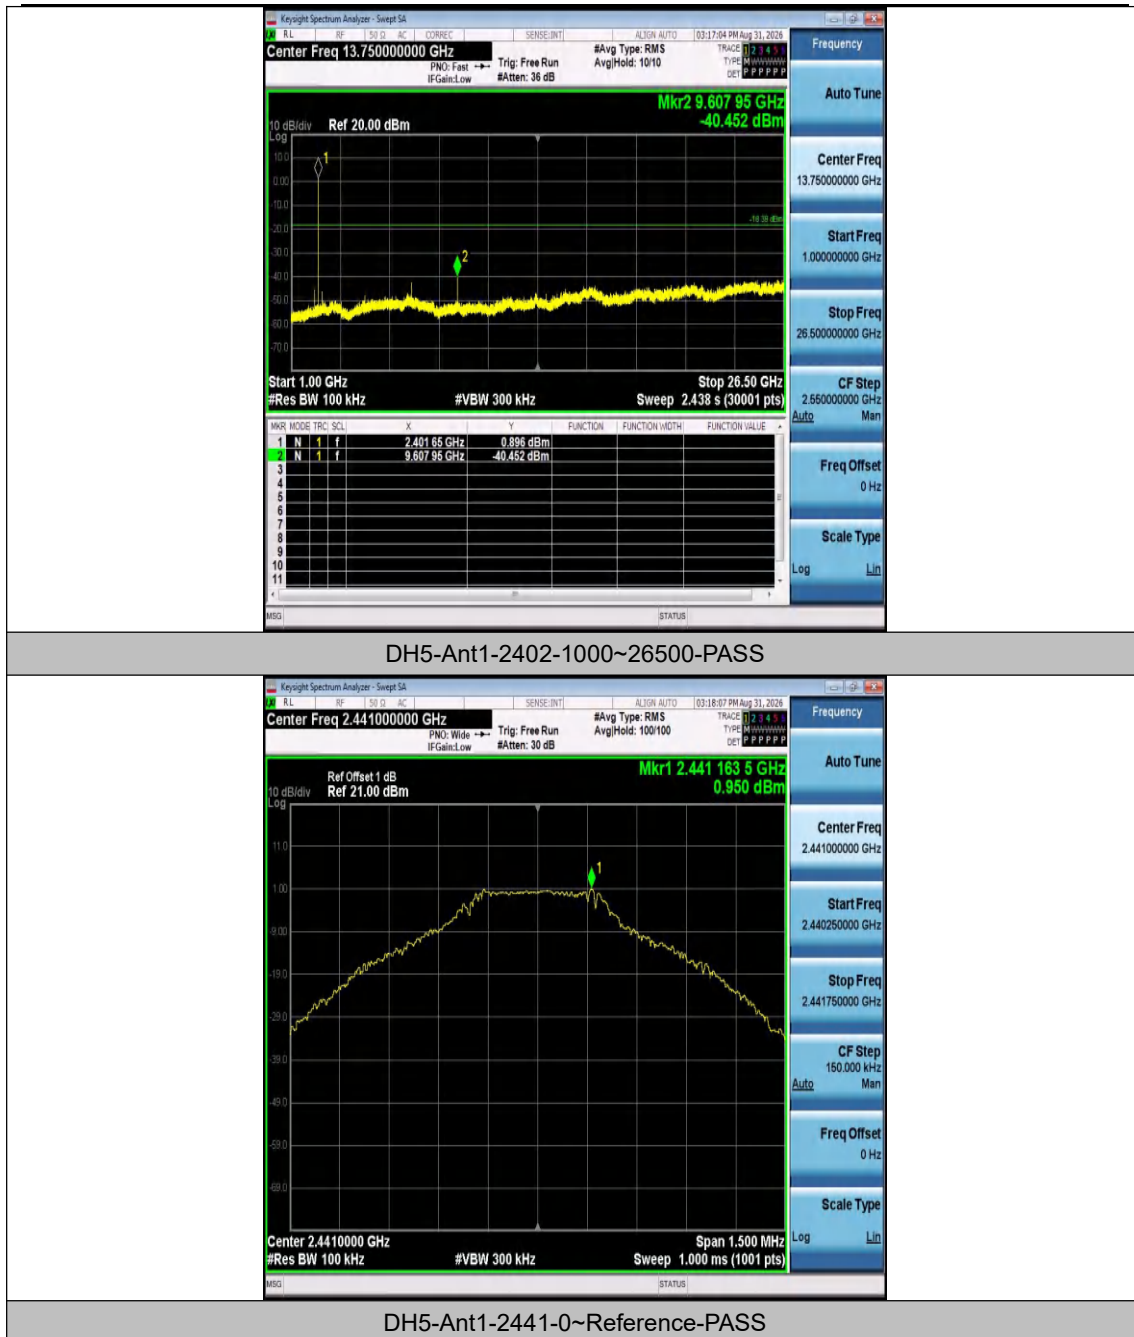


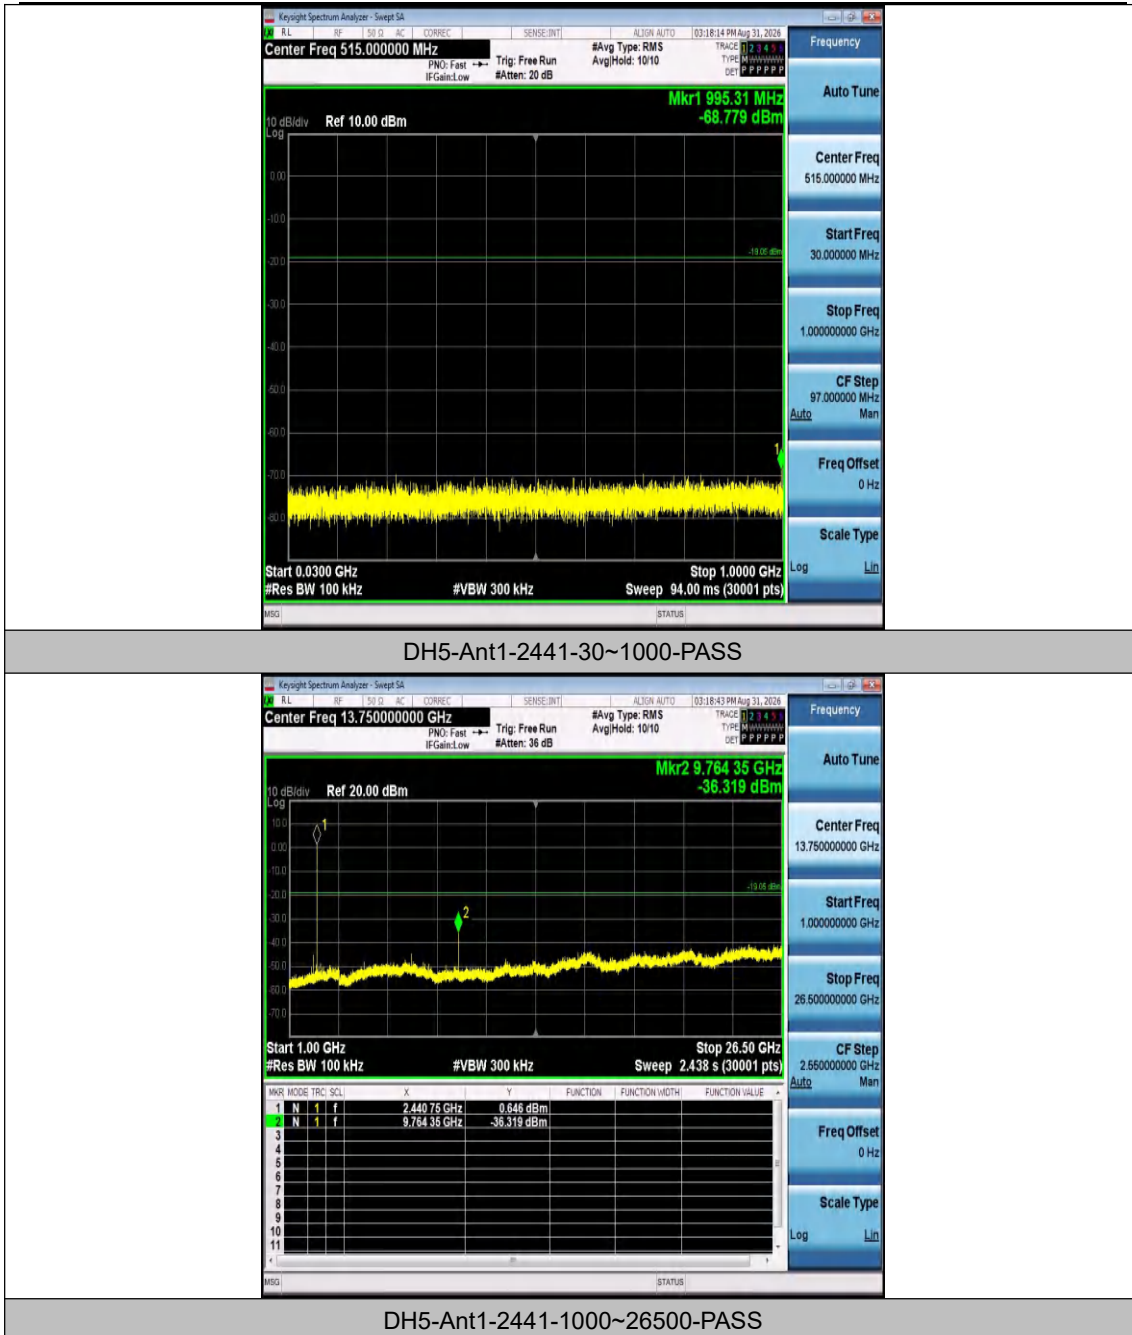

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

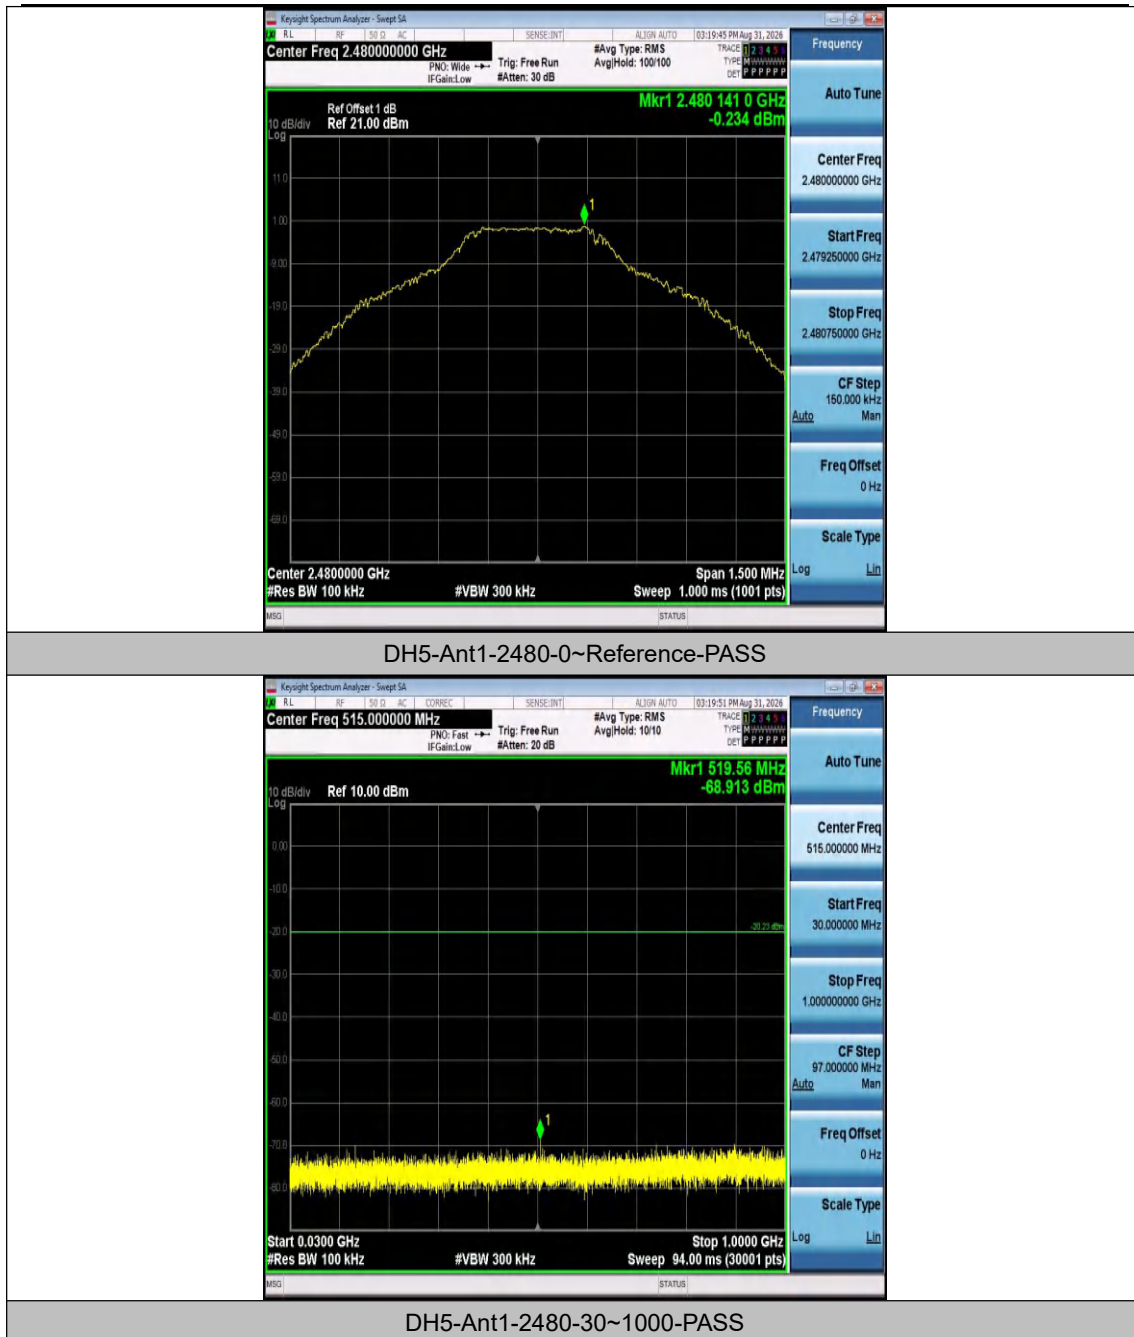


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

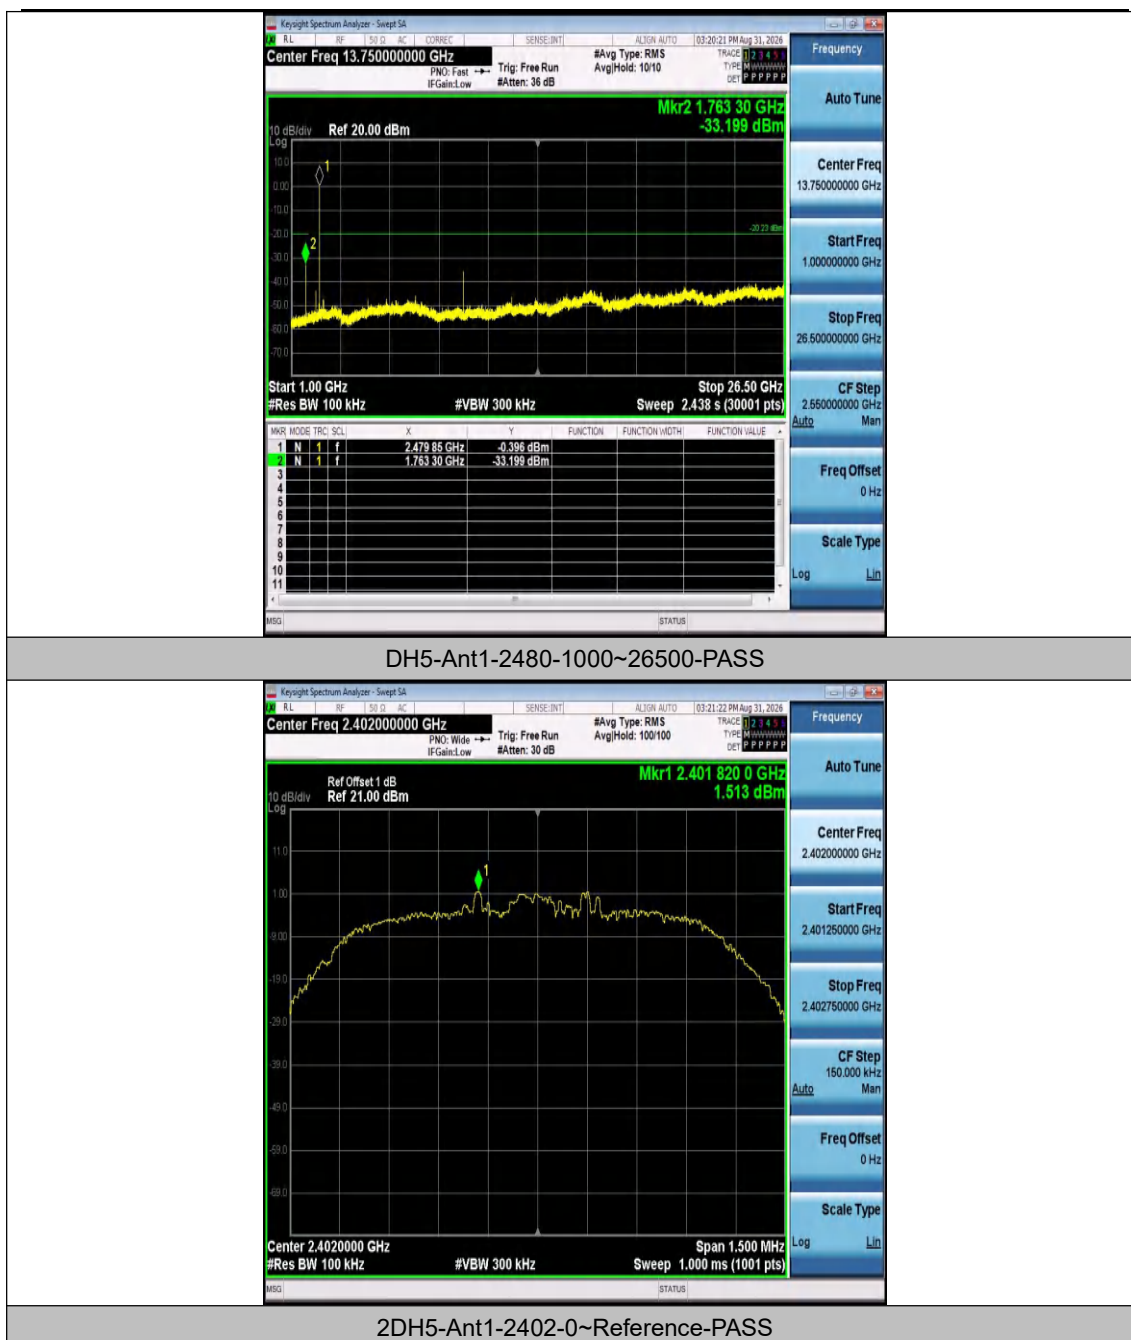


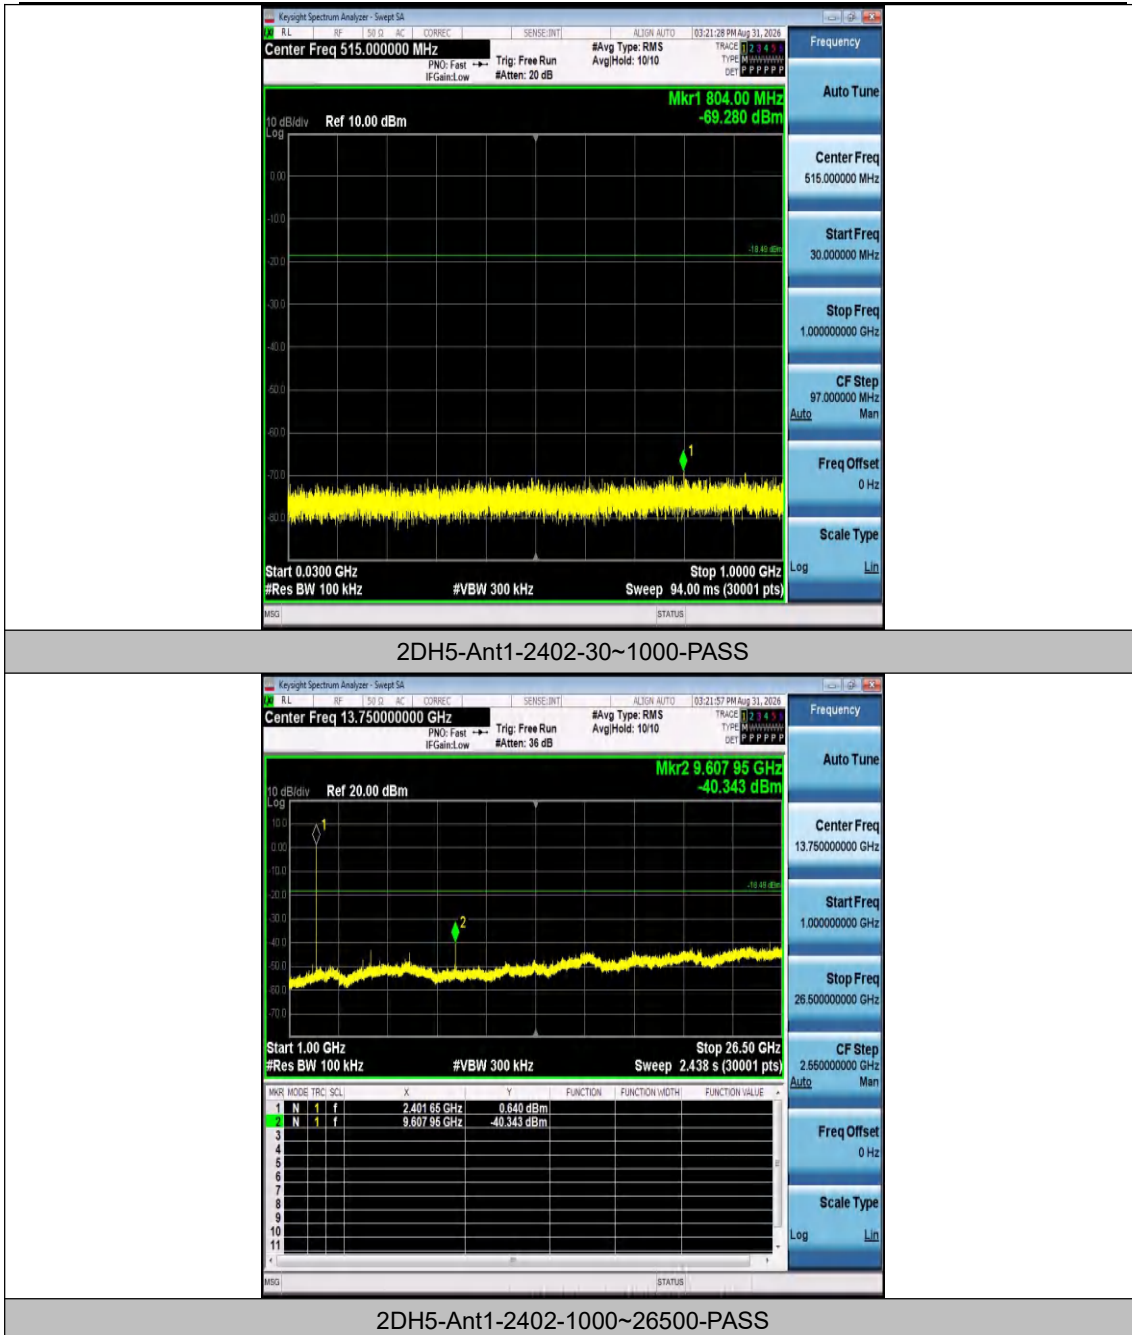

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

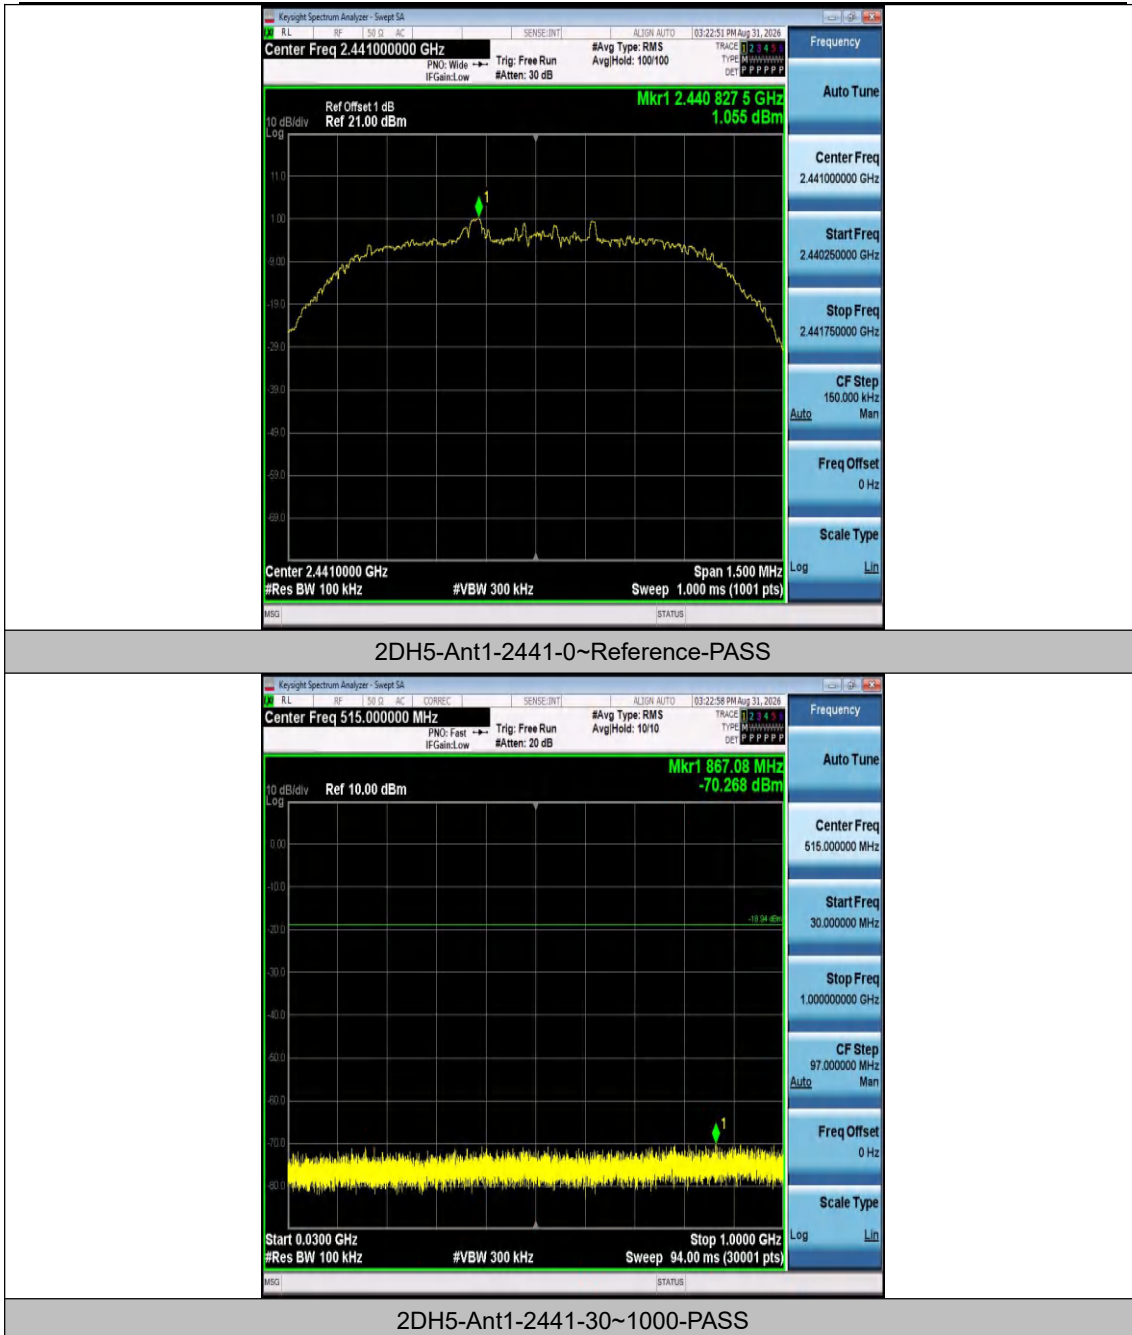


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

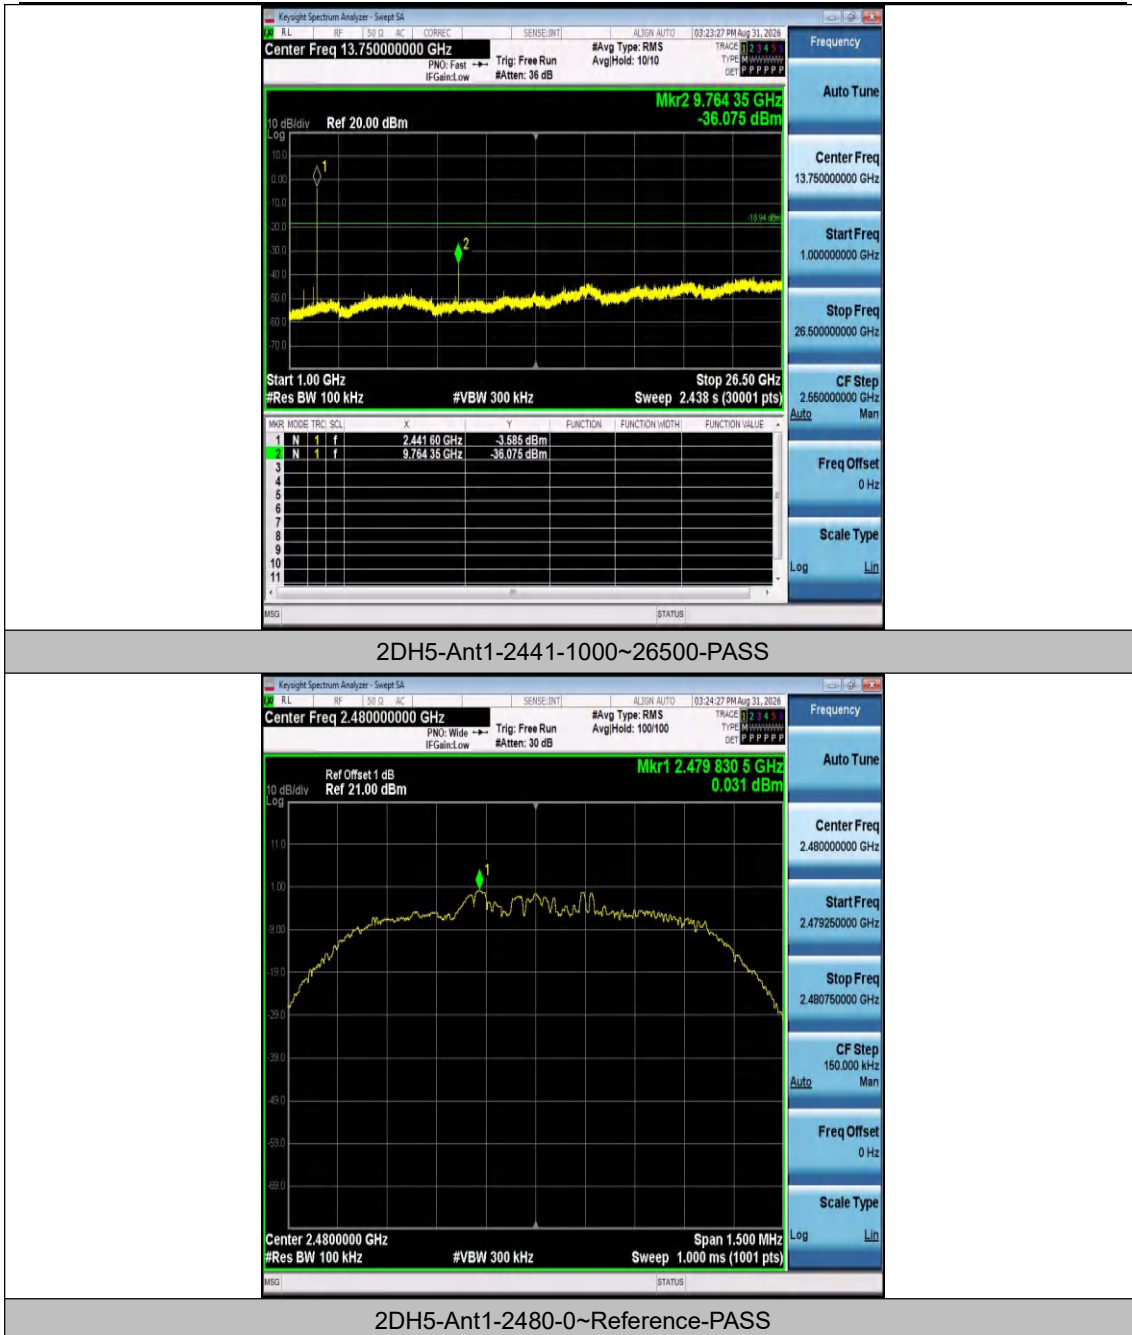


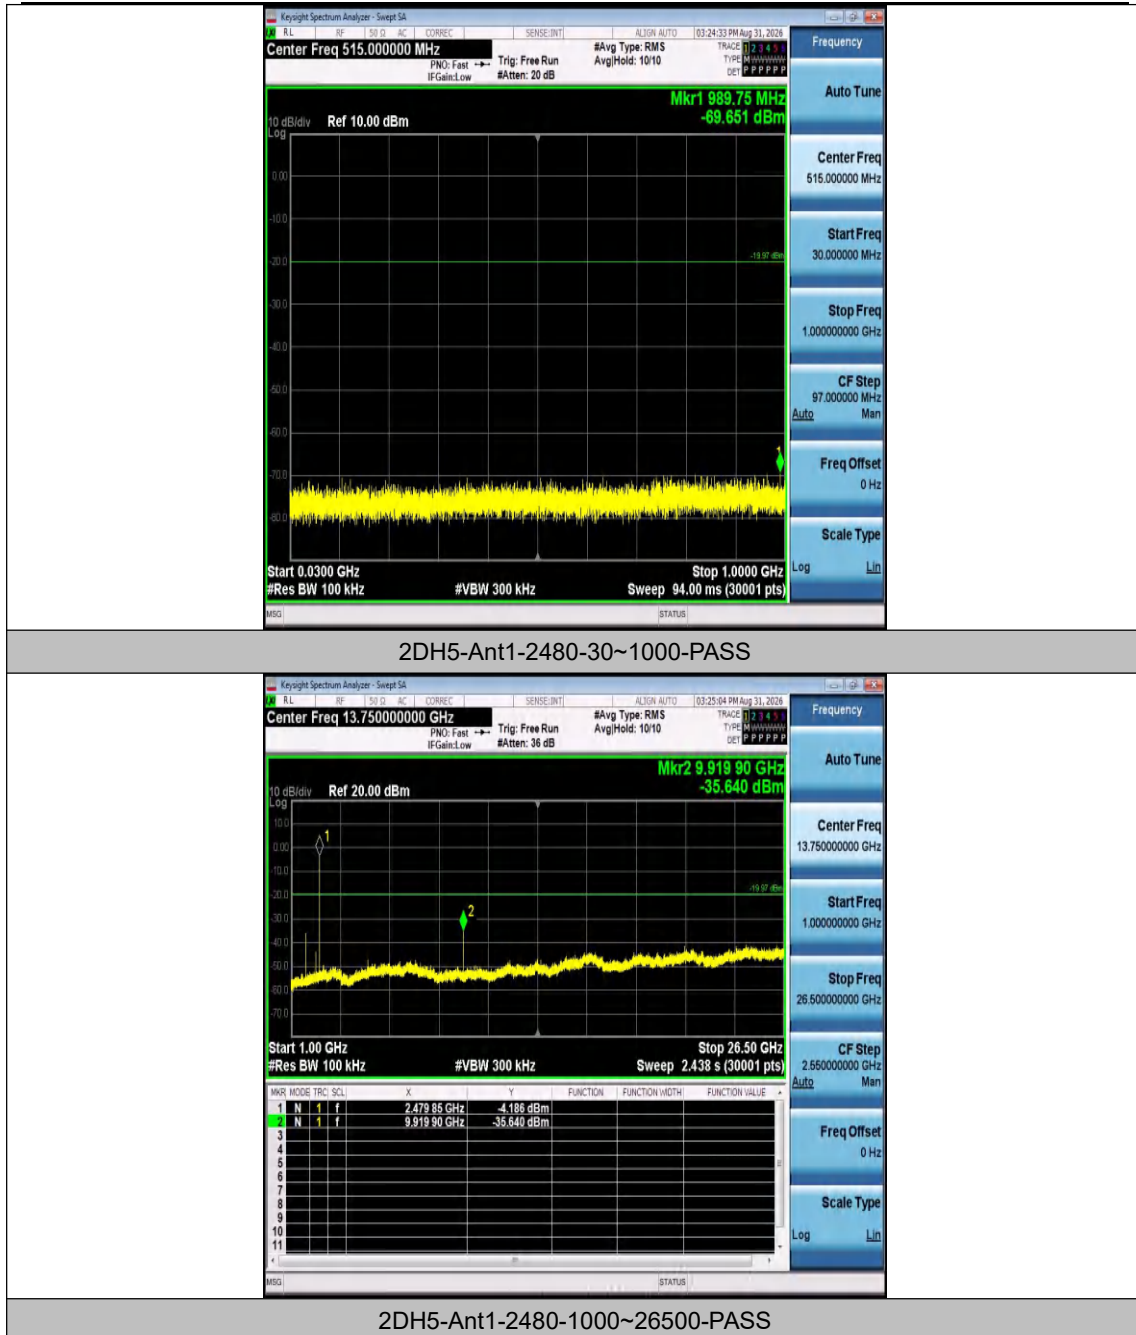

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

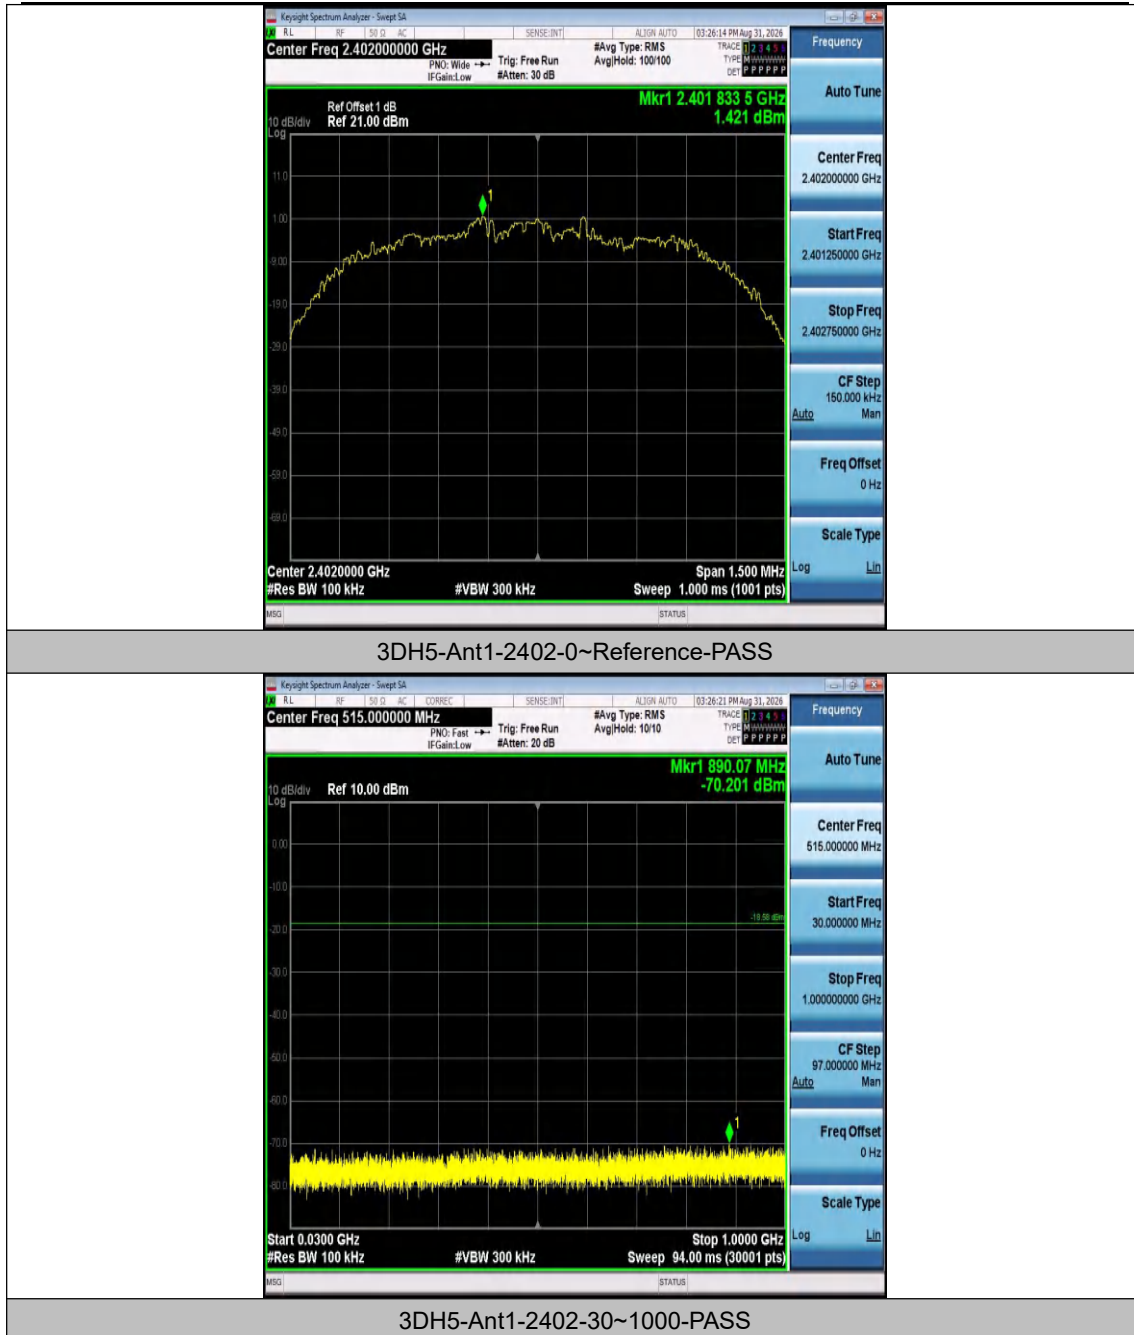

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

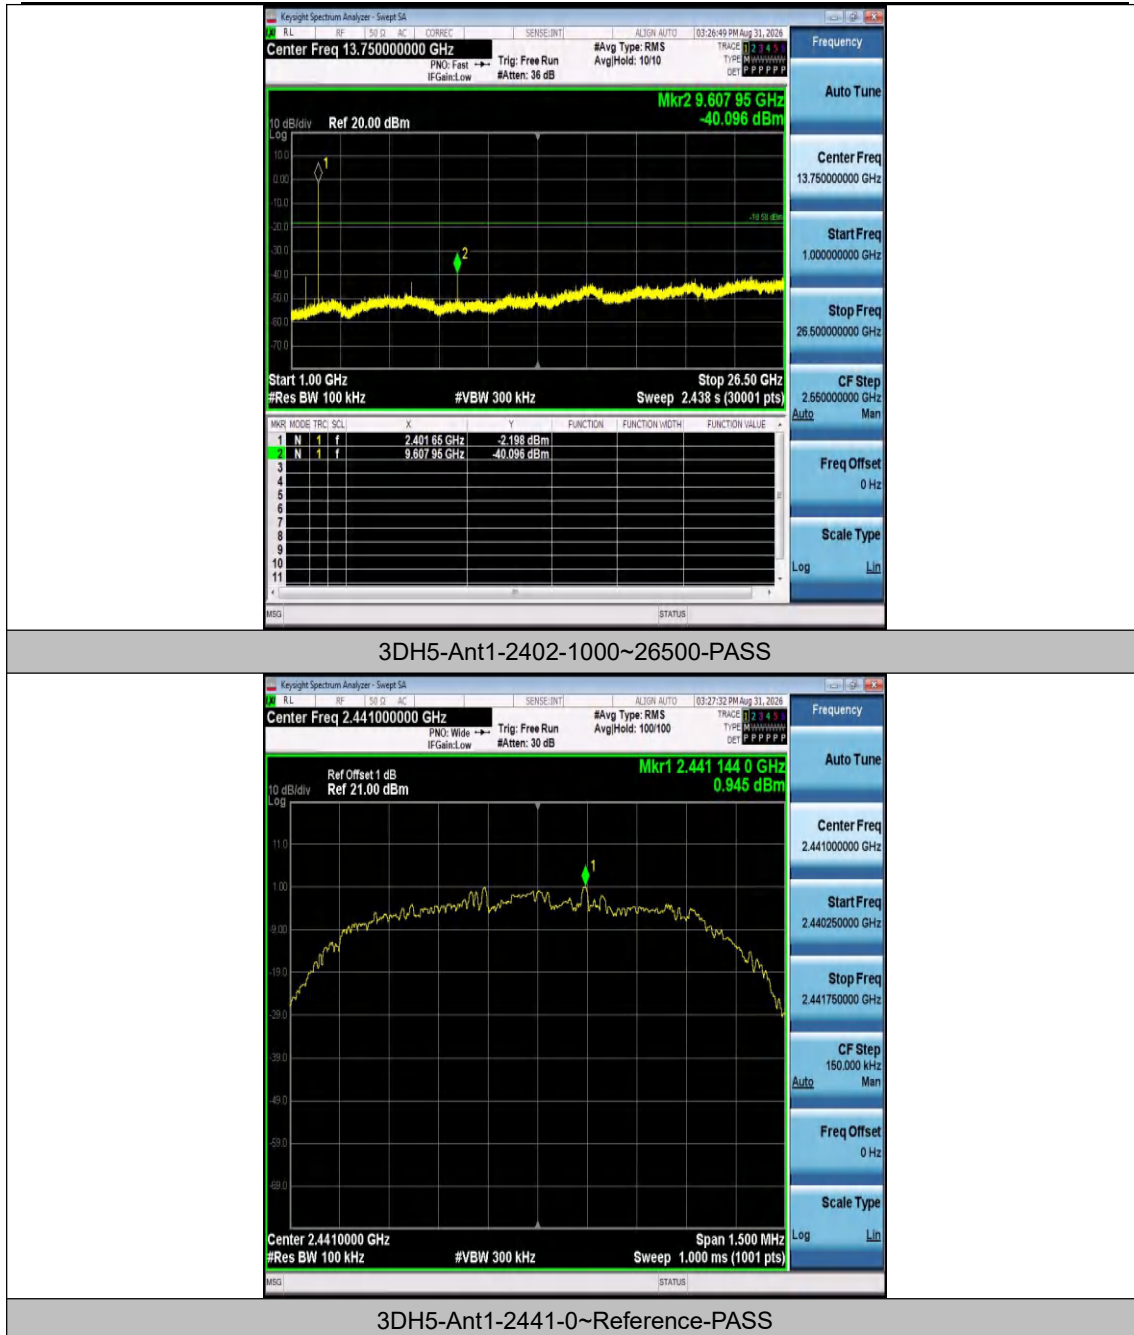

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

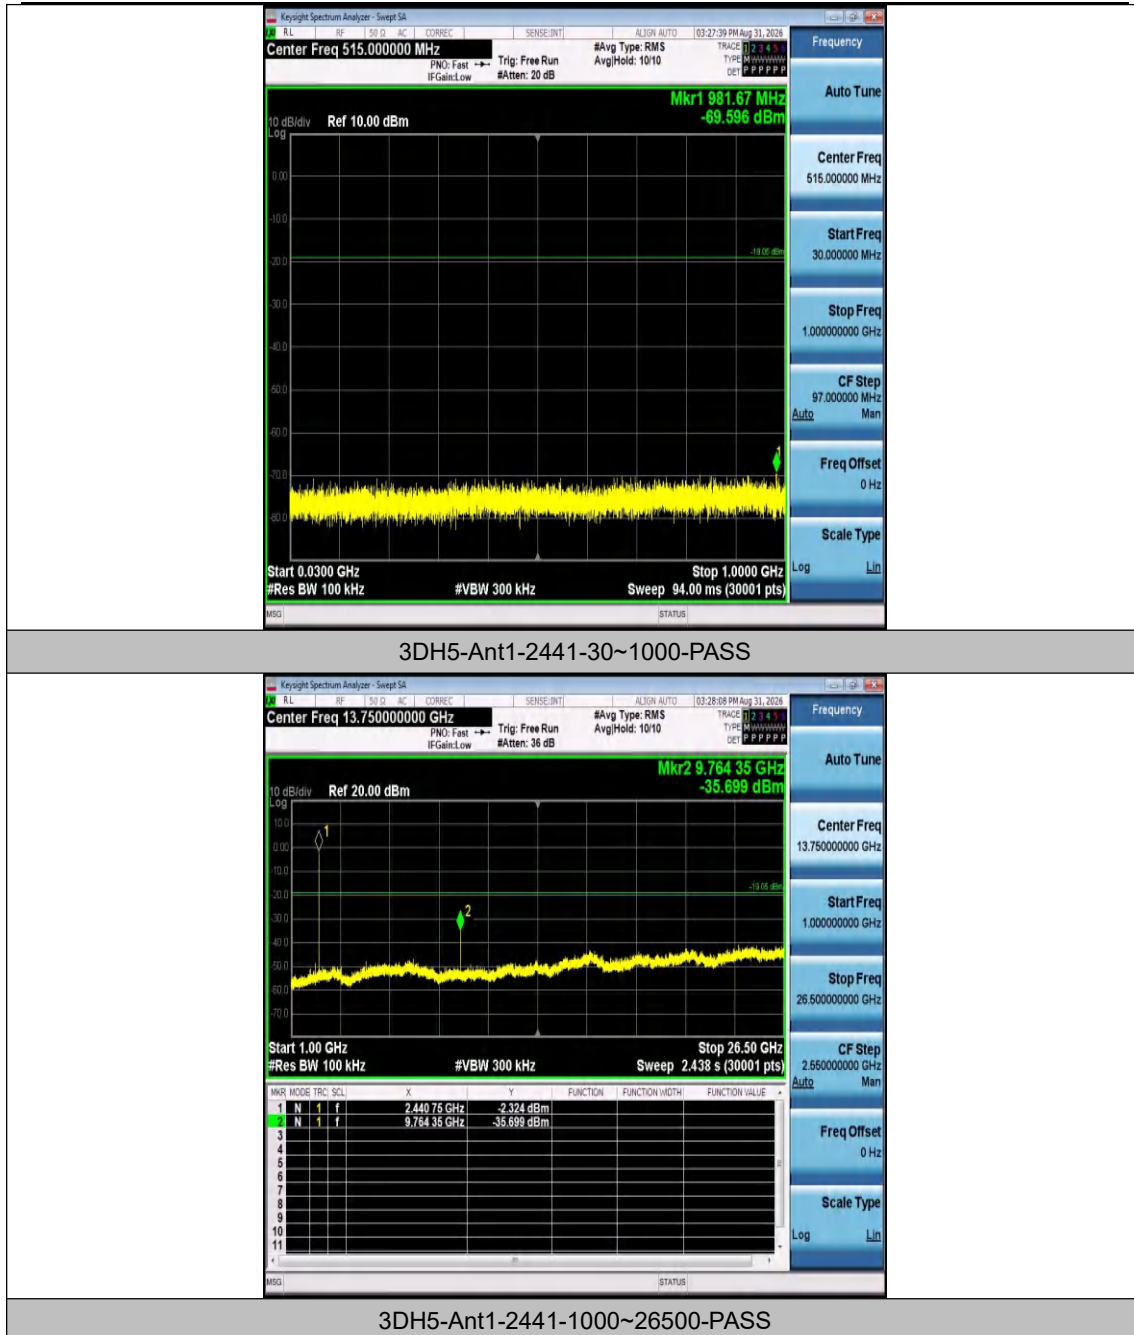

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

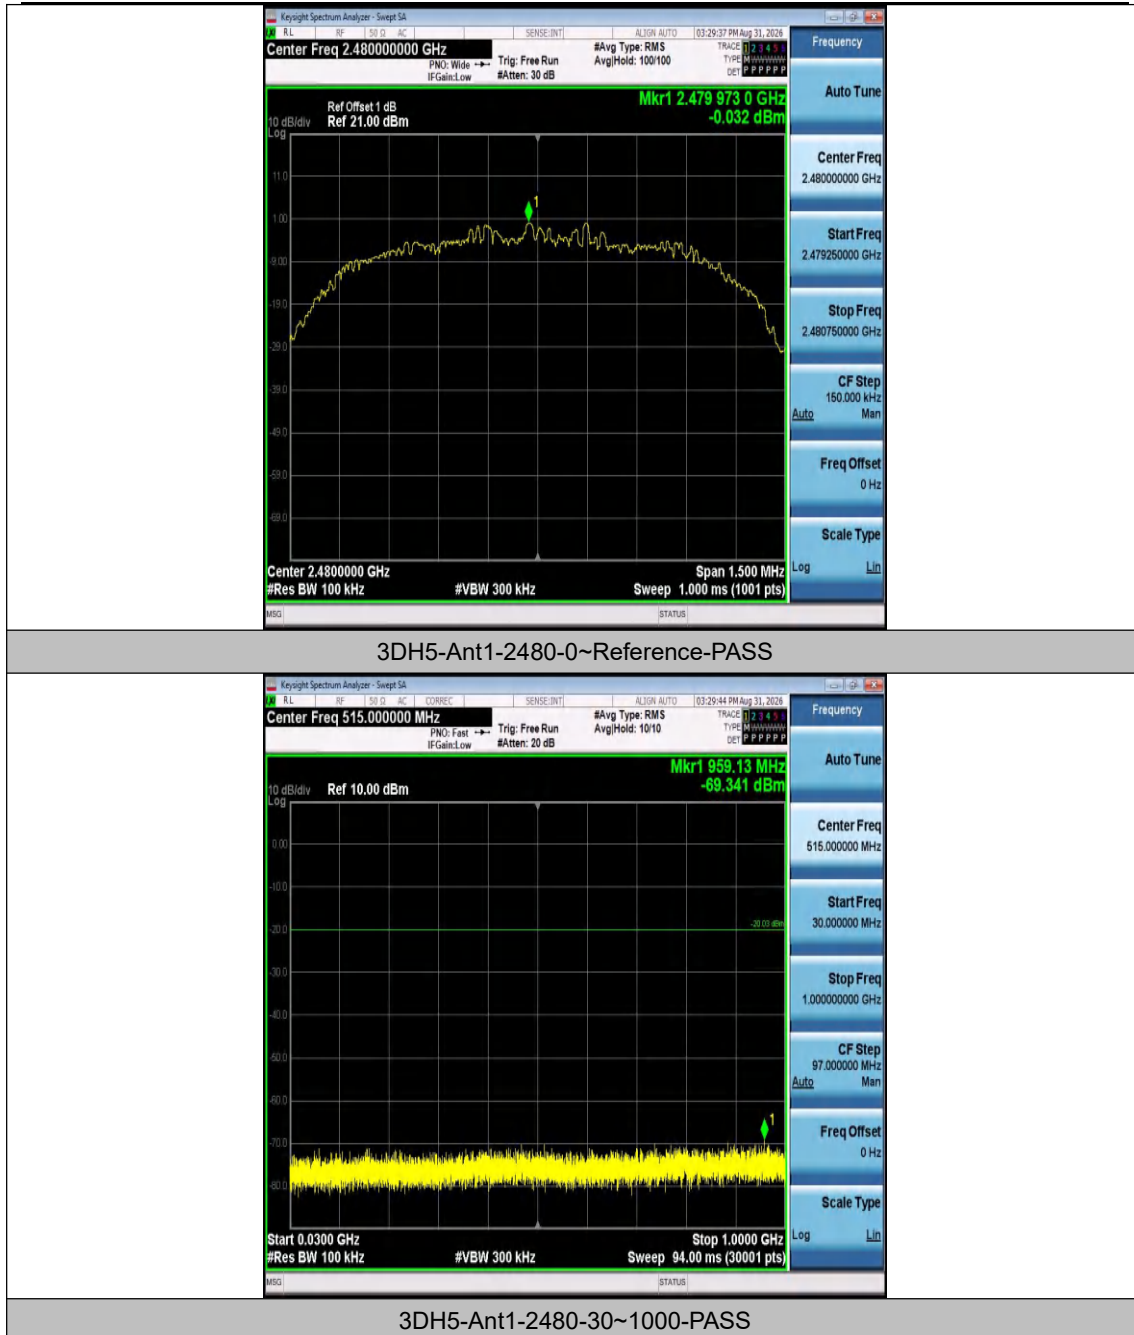

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

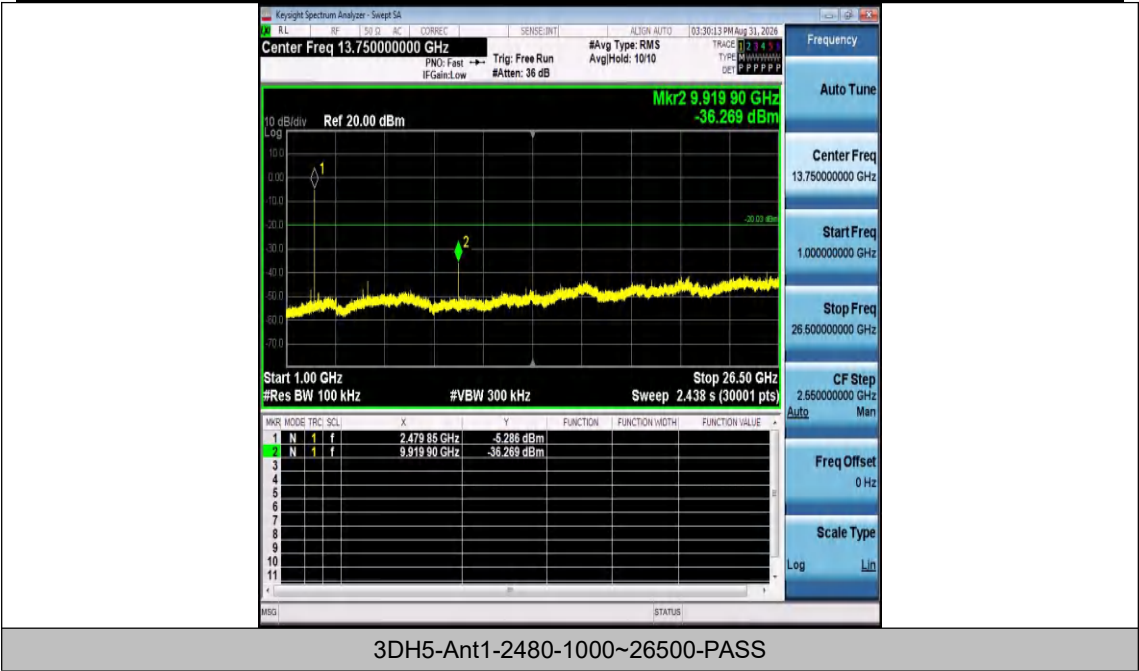

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.88	3.75	76.80	1.15
DH5	Ant1	2441	2.89	3.75	77.07	1.13
DH5	Ant1	2480	2.90	3.75	77.33	1.12
2DH5	Ant1	2402	2.90	3.75	77.33	1.12
2DH5	Ant1	2441	2.90	3.75	77.33	1.12
2DH5	Ant1	2480	2.90	3.75	77.33	1.12
3DH5	Ant1	2402	2.89	3.75	77.07	1.13
3DH5	Ant1	2441	2.89	3.75	77.07	1.13
3DH5	Ant1	2480	2.89	3.75	77.07	1.13


Test Graphs

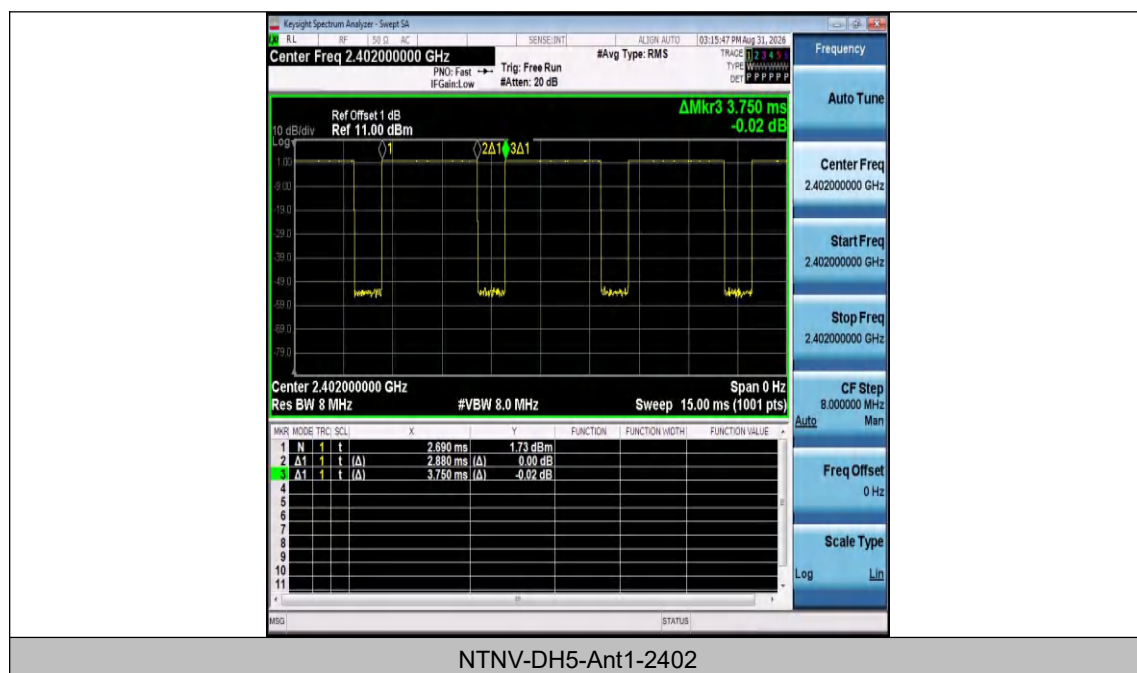

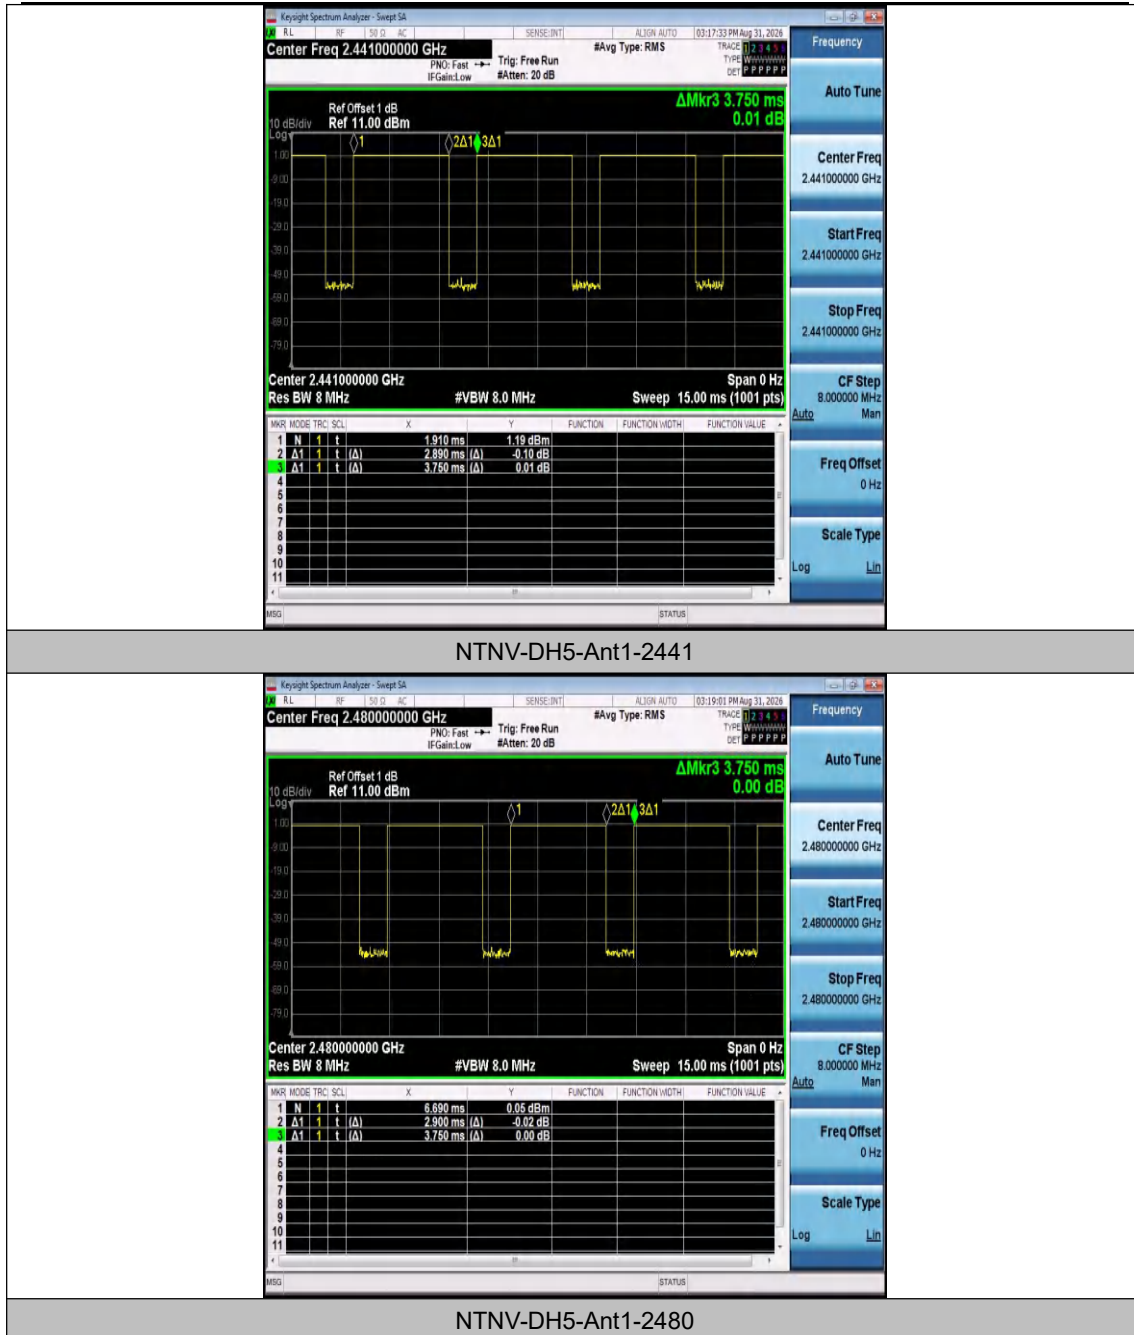

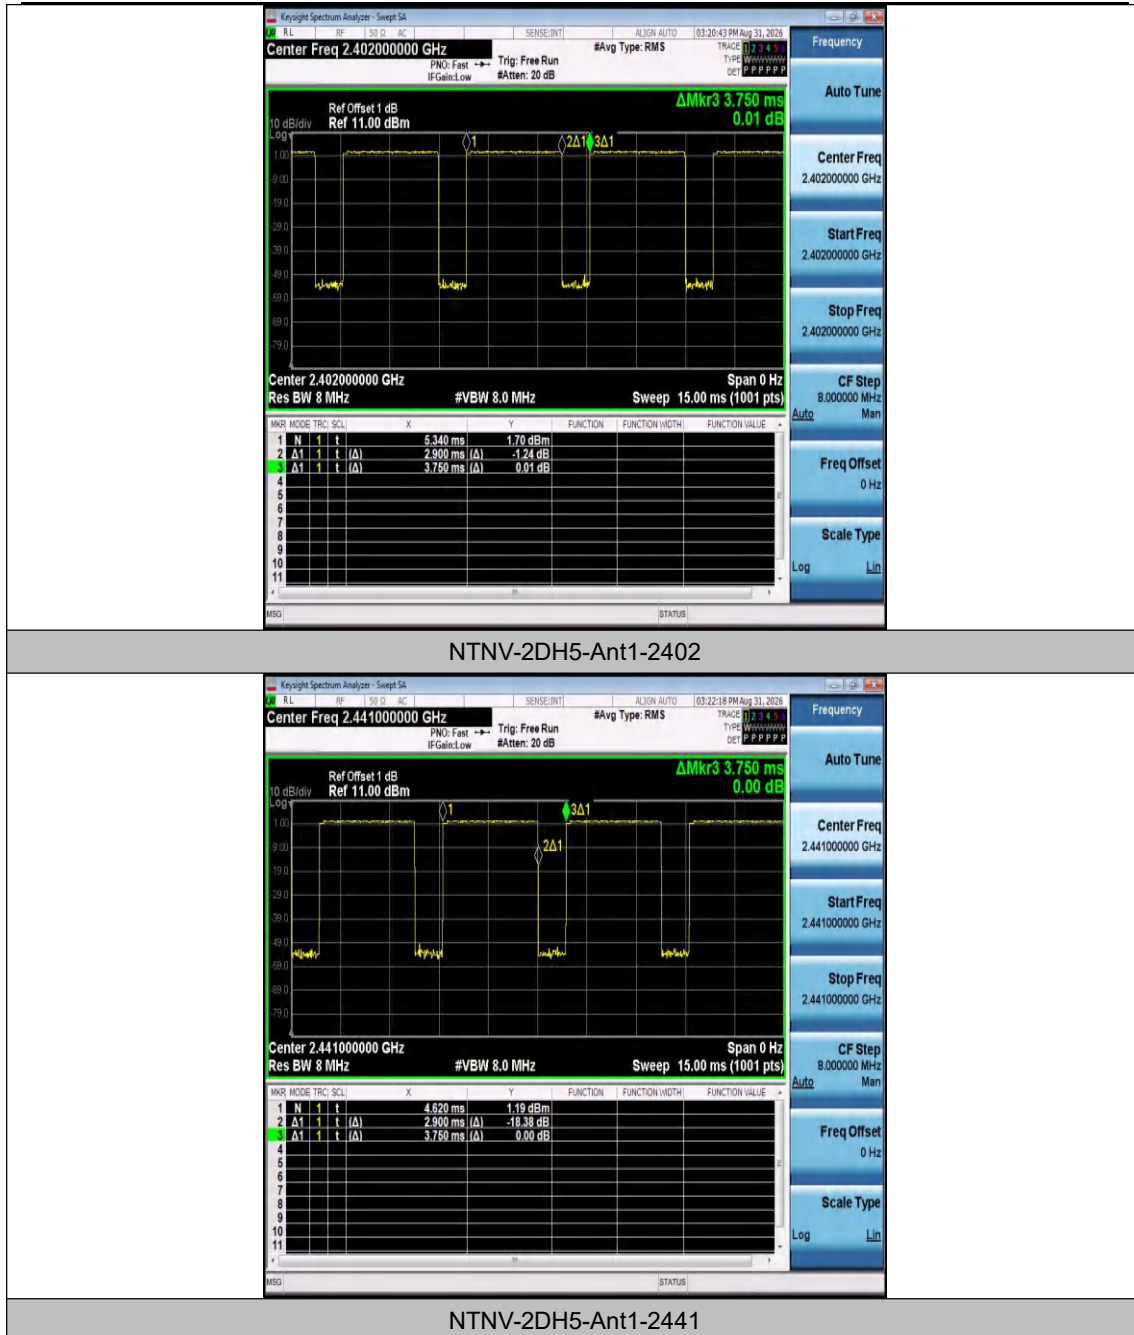

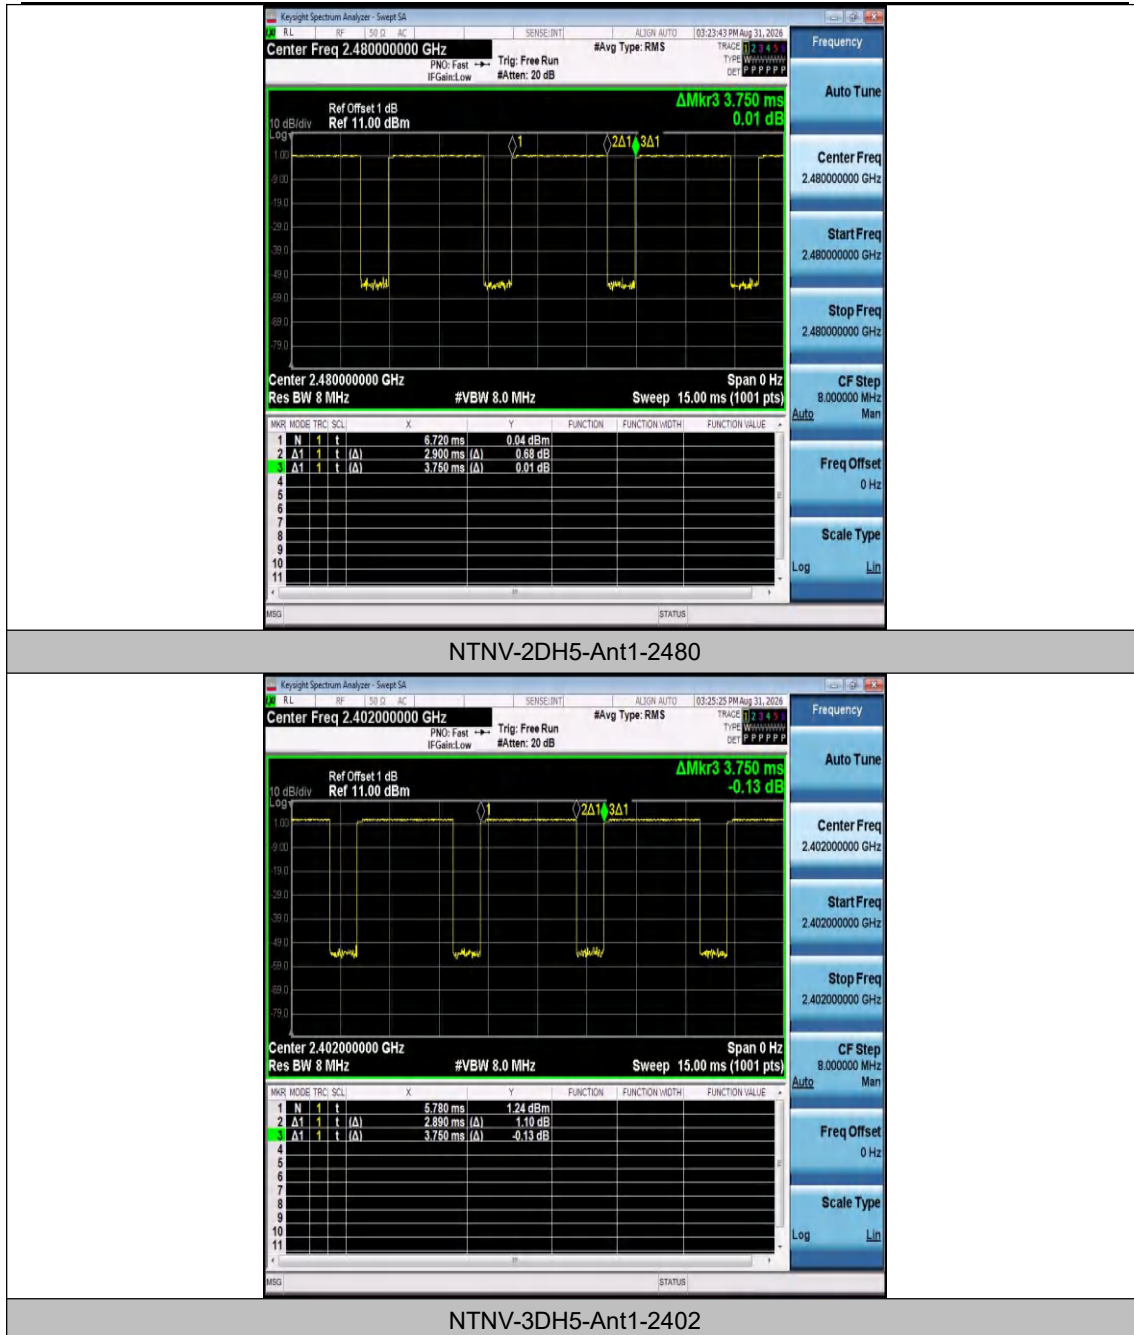

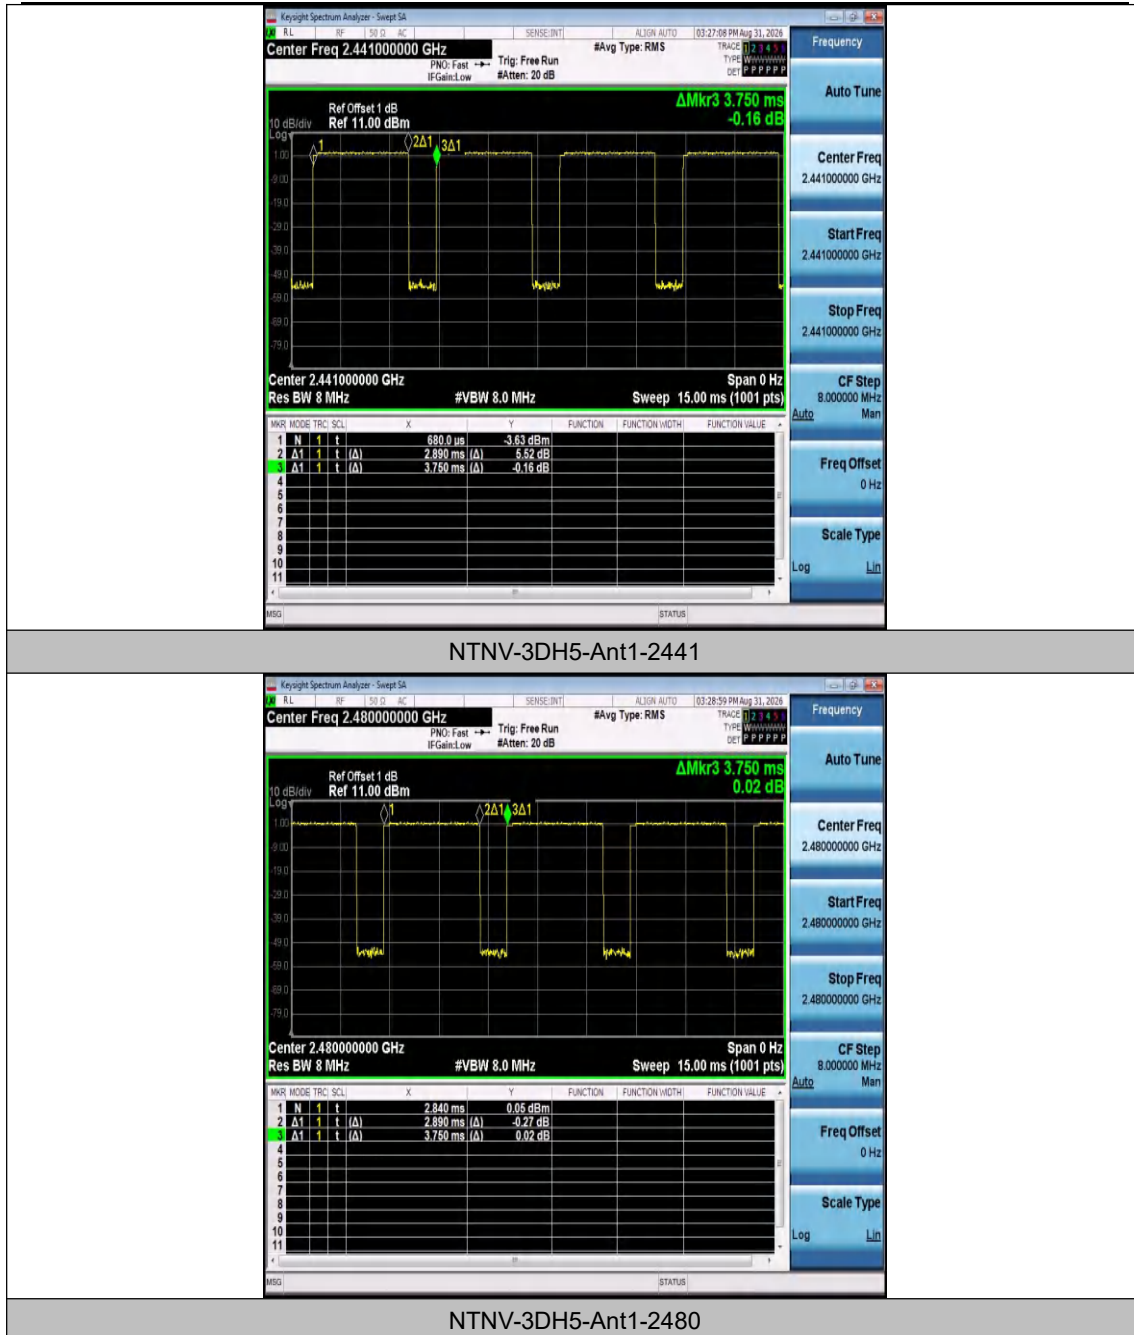

---End---