


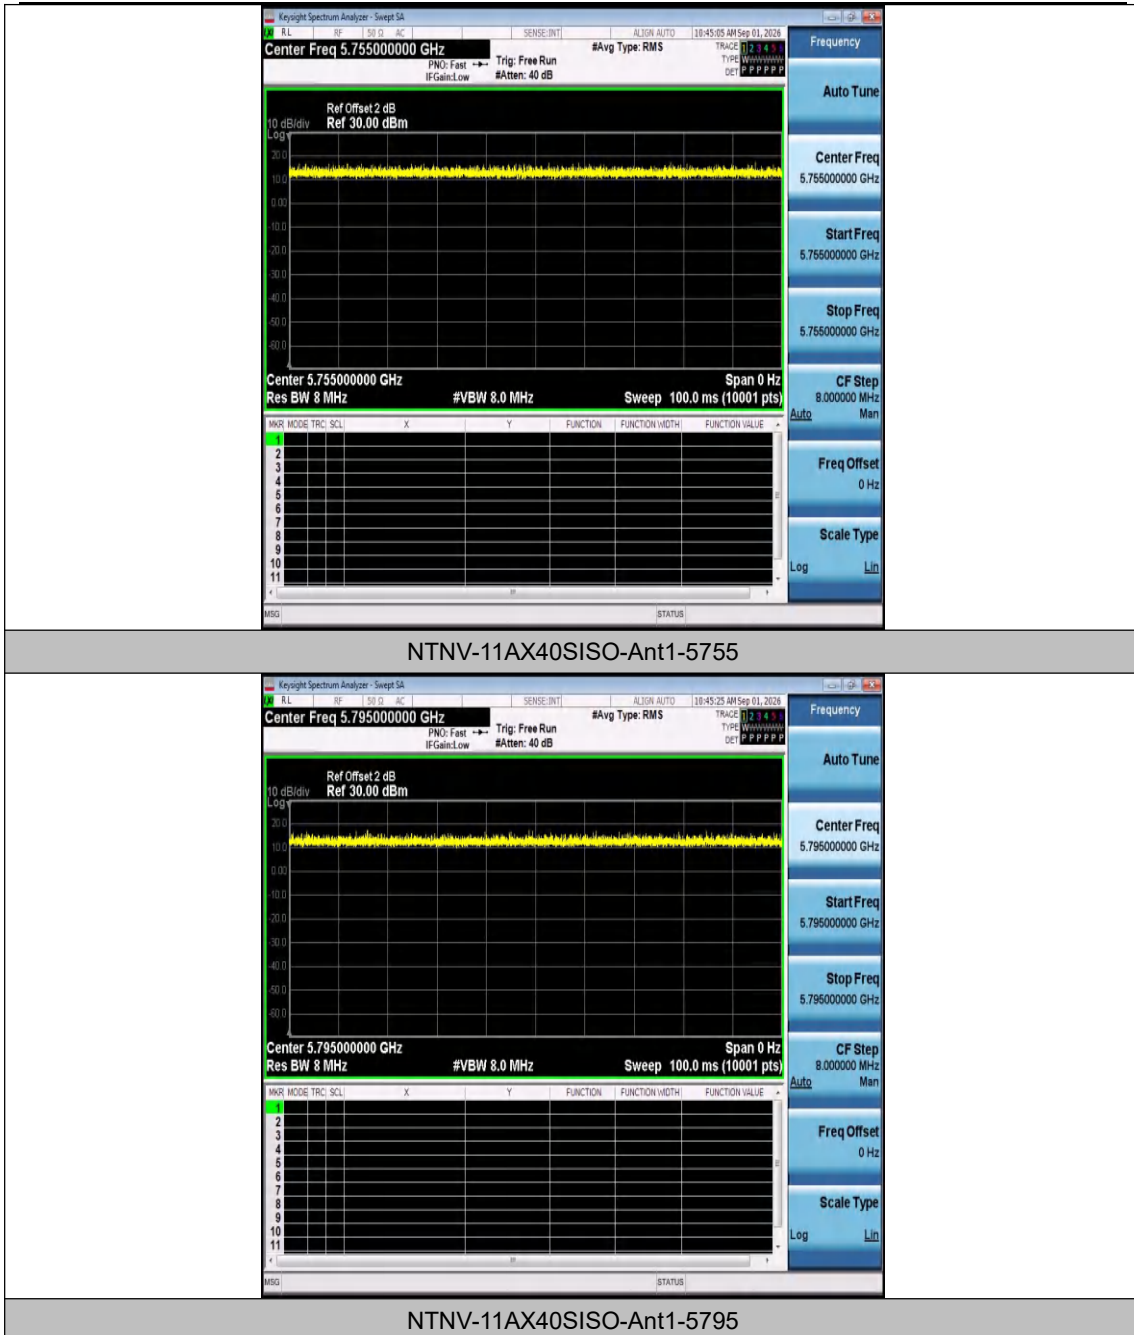

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Channel Power [dBm]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	13.99	13.99	≤23.98	PASS
11A	Ant1	5220	14.63	14.63	≤23.98	PASS
11A	Ant1	5240	14.46	14.46	≤23.98	PASS
11A	Ant1	5745	14.41	14.41	≤30.00	PASS
11A	Ant1	5785	14.40	14.40	≤30.00	PASS
11A	Ant1	5825	15.01	15.01	≤30.00	PASS
11N20SISO	Ant1	5180	13.82	13.82	≤23.98	PASS
11N20SISO	Ant1	5220	14.69	14.69	≤23.98	PASS
11N20SISO	Ant1	5240	14.73	14.73	≤23.98	PASS
11N20SISO	Ant1	5745	13.30	13.30	≤30.00	PASS
11N20SISO	Ant1	5785	13.52	13.52	≤30.00	PASS
11N20SISO	Ant1	5825	14.14	14.14	≤30.00	PASS
11N40SISO	Ant1	5190	14.05	14.05	≤23.98	PASS
11N40SISO	Ant1	5230	13.98	13.98	≤23.98	PASS
11N40SISO	Ant1	5755	13.43	13.43	≤30.00	PASS
11N40SISO	Ant1	5795	13.69	13.69	≤30.00	PASS
11AC20SISO	Ant1	5180	13.85	13.85	≤23.98	PASS
11AC20SISO	Ant1	5220	14.30	14.30	≤23.98	PASS
11AC20SISO	Ant1	5240	14.08	14.08	≤23.98	PASS
11AC20SISO	Ant1	5745	14.18	14.18	≤30.00	PASS
11AC20SISO	Ant1	5785	14.69	14.69	≤30.00	PASS
11AC20SISO	Ant1	5825	15.43	15.43	≤30.00	PASS
11AC40SISO	Ant1	5190	14.07	14.07	≤23.98	PASS
11AC40SISO	Ant1	5230	13.89	13.89	≤23.98	PASS
11AC40SISO	Ant1	5755	14.41	14.41	≤30.00	PASS
11AC40SISO	Ant1	5795	14.76	14.76	≤30.00	PASS
11AX20SISO	Ant1	5180	14.27	14.27	≤23.98	PASS
11AX20SISO	Ant1	5220	15.04	15.04	≤23.98	PASS
11AX20SISO	Ant1	5240	14.75	14.75	≤23.98	PASS
11AX20SISO	Ant1	5745	15.40	15.40	≤30.00	PASS
11AX20SISO	Ant1	5785	15.55	15.55	≤30.00	PASS
11AX20SISO	Ant1	5825	16.02	16.02	≤30.00	PASS
11AX40SISO	Ant1	5190	14.46	14.46	≤23.98	PASS
11AX40SISO	Ant1	5230	14.55	14.55	≤23.98	PASS
11AX40SISO	Ant1	5755	15.42	15.42	≤30.00	PASS
11AX40SISO	Ant1	5795	15.59	15.59	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs Channel Power



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

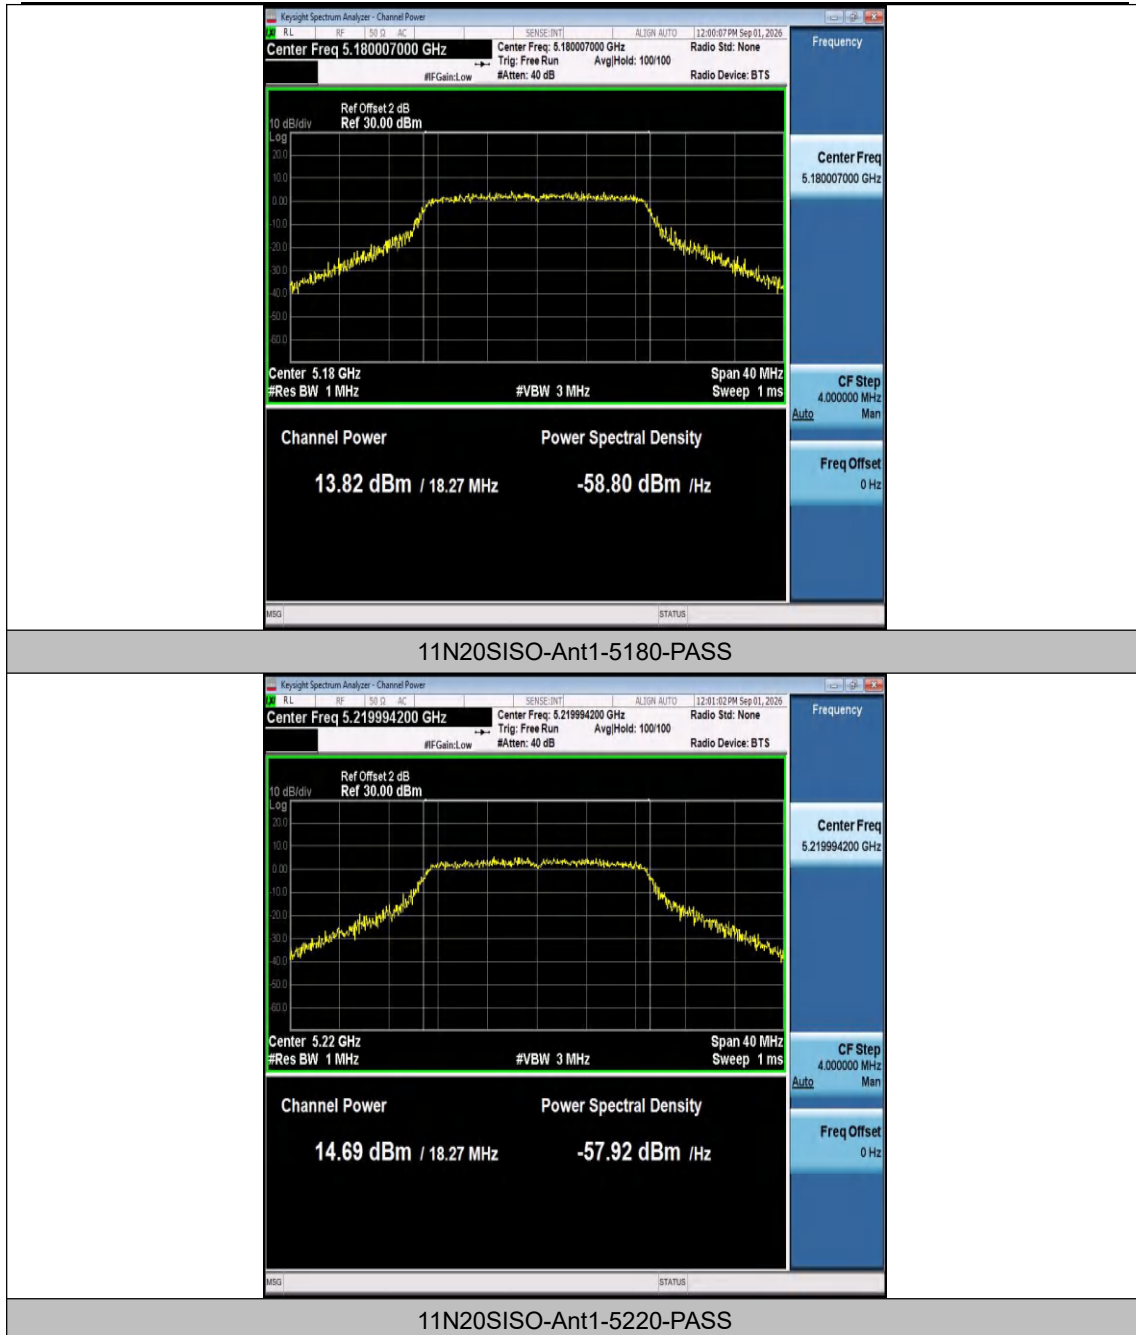

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

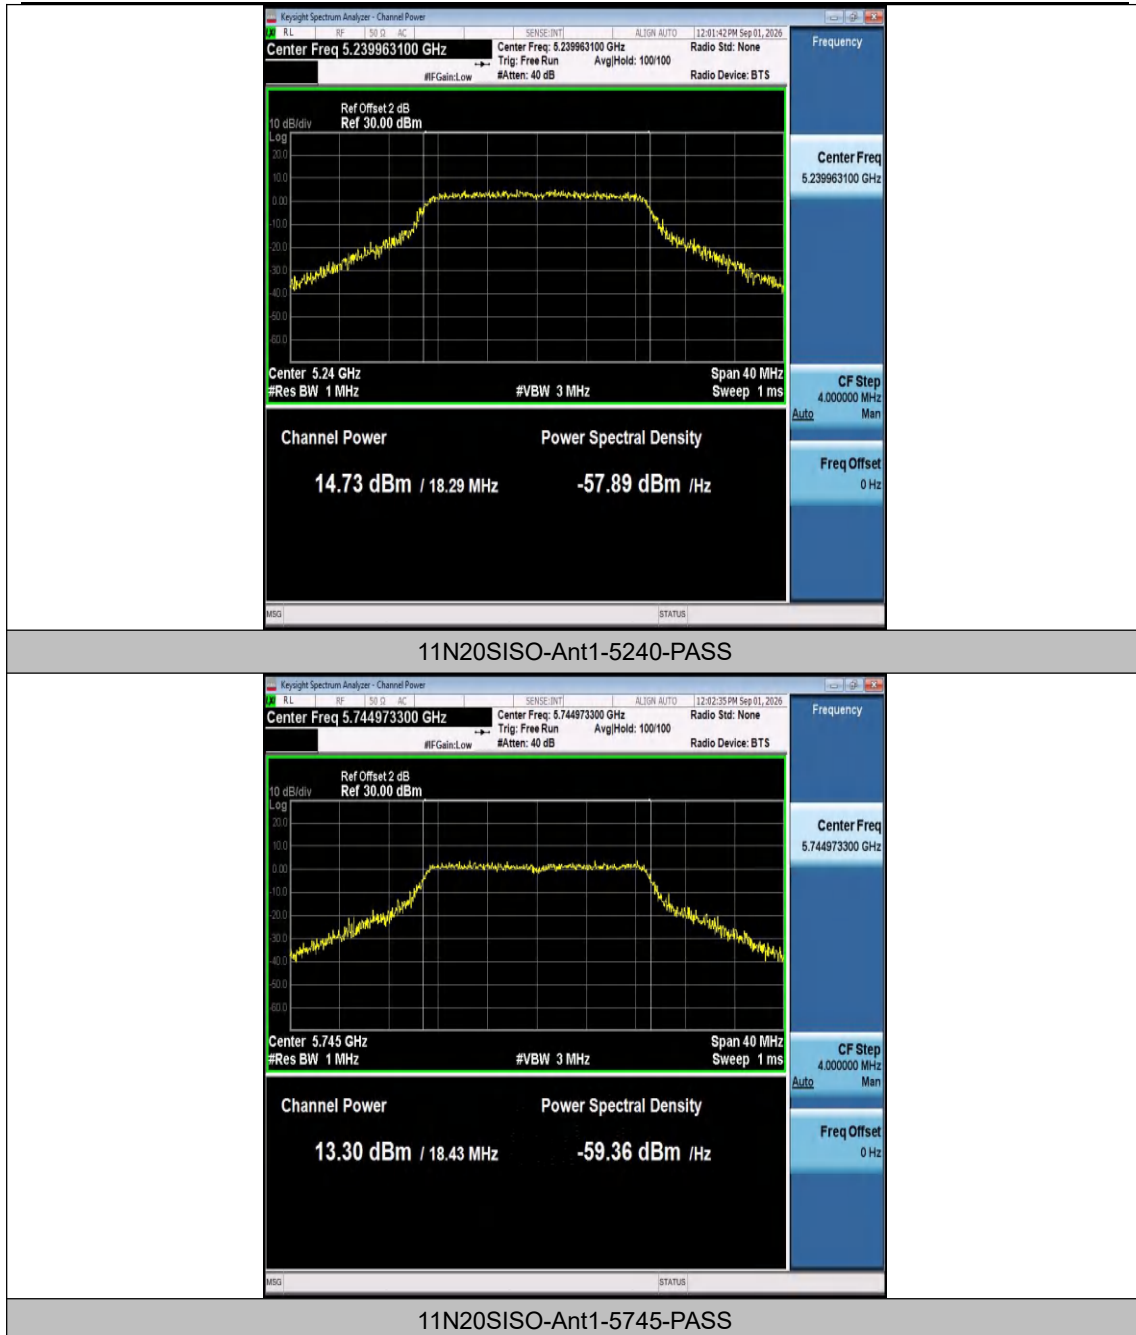


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




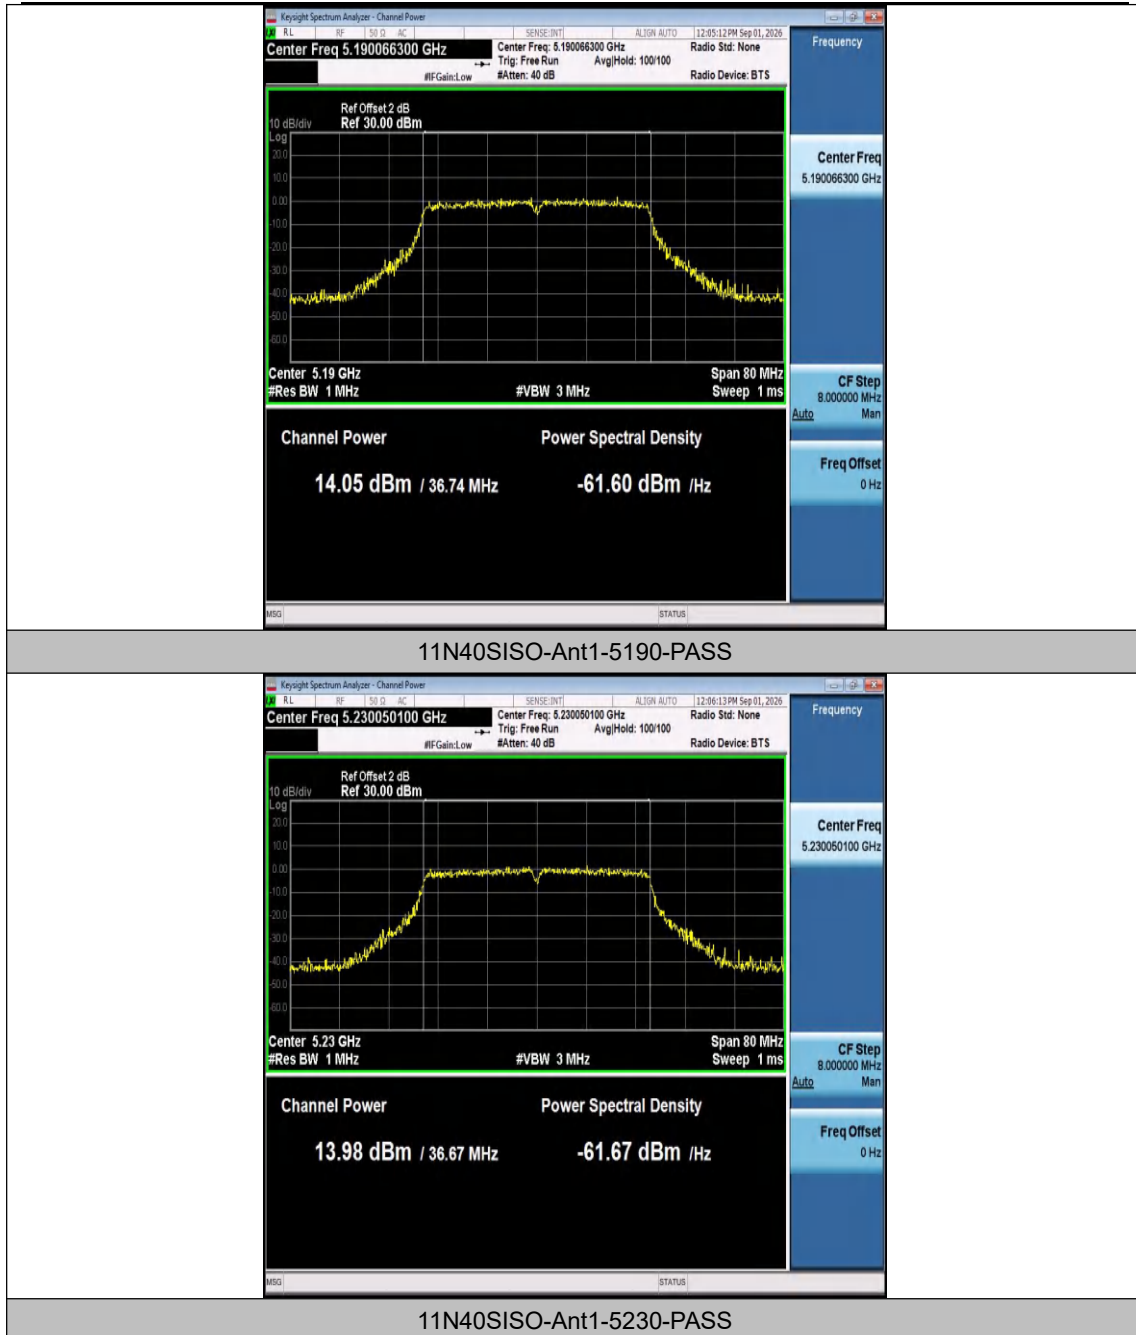

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

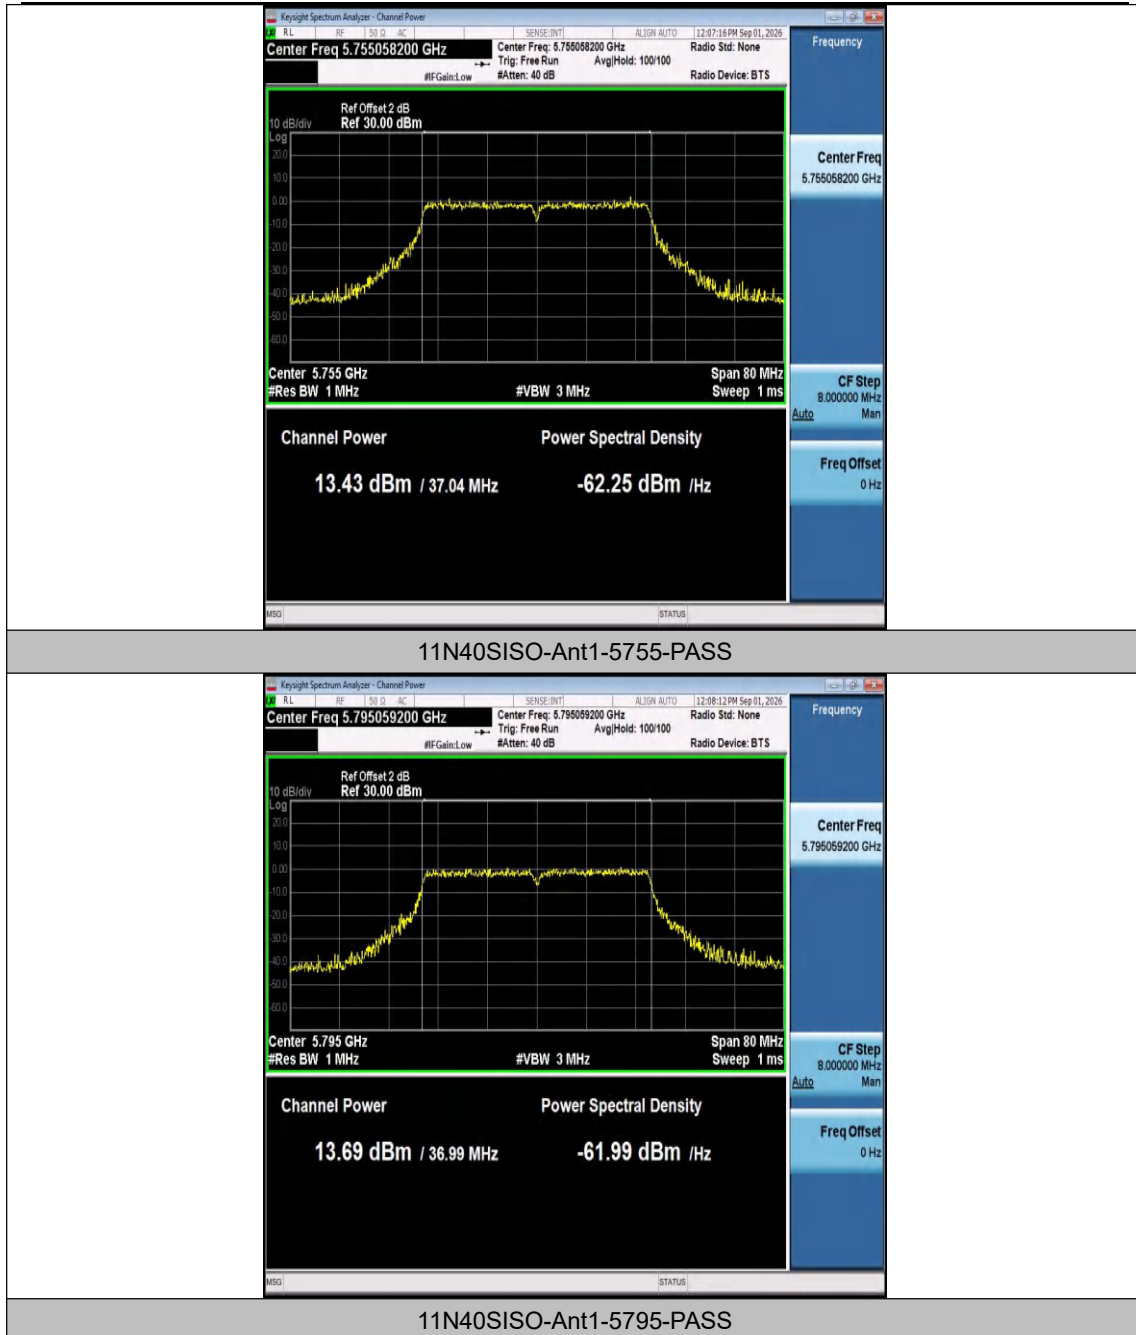


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

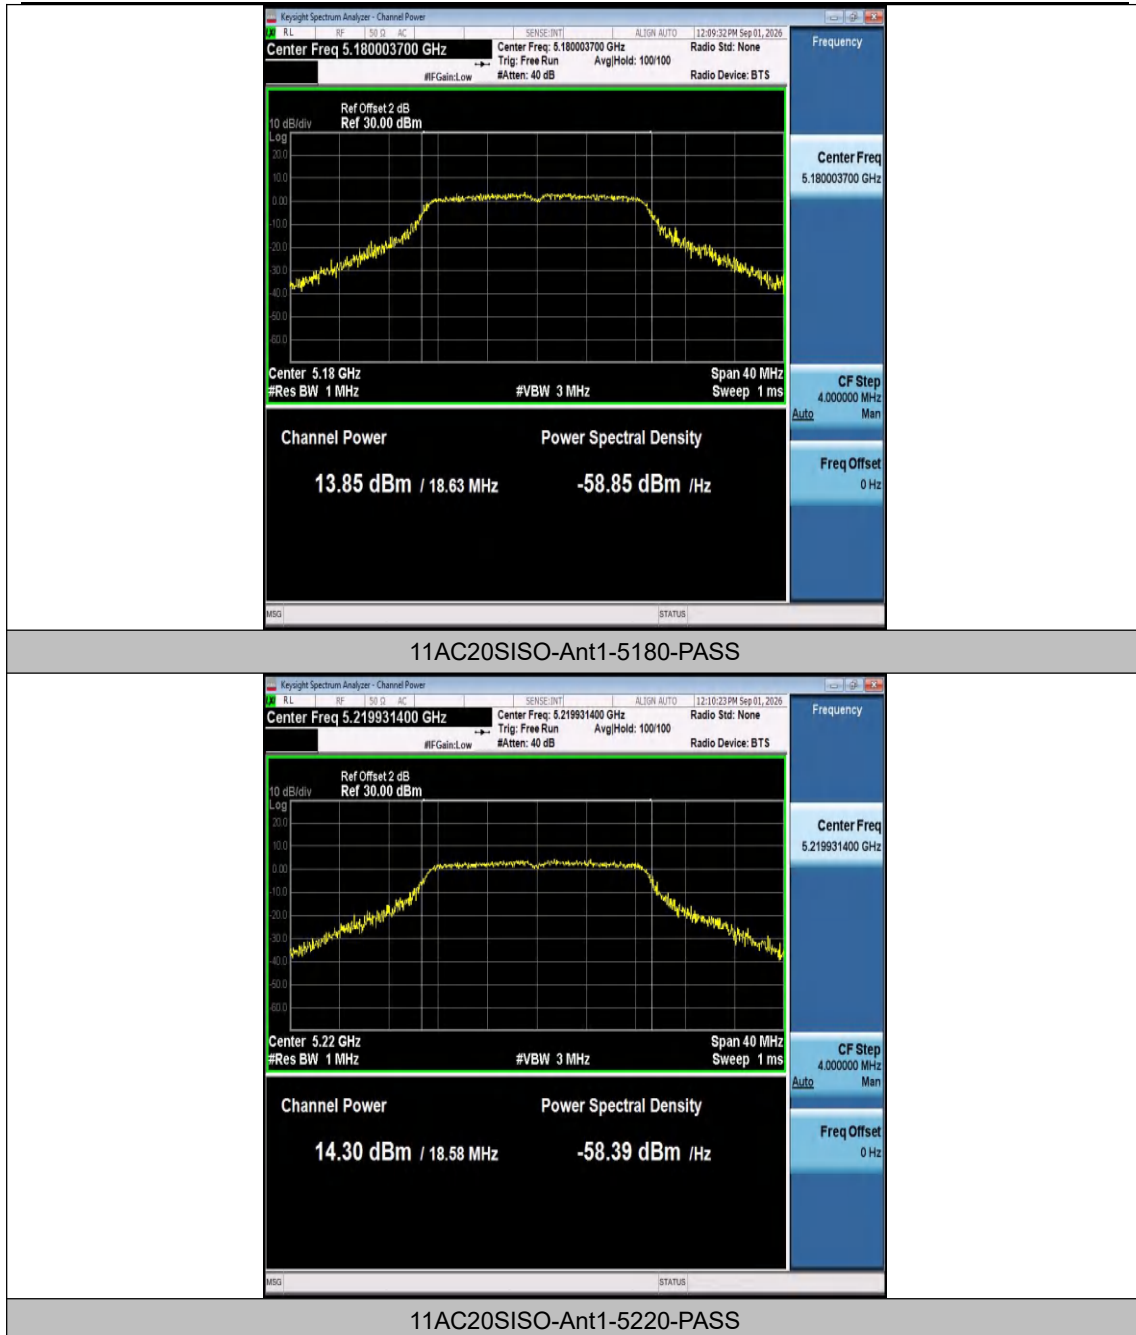


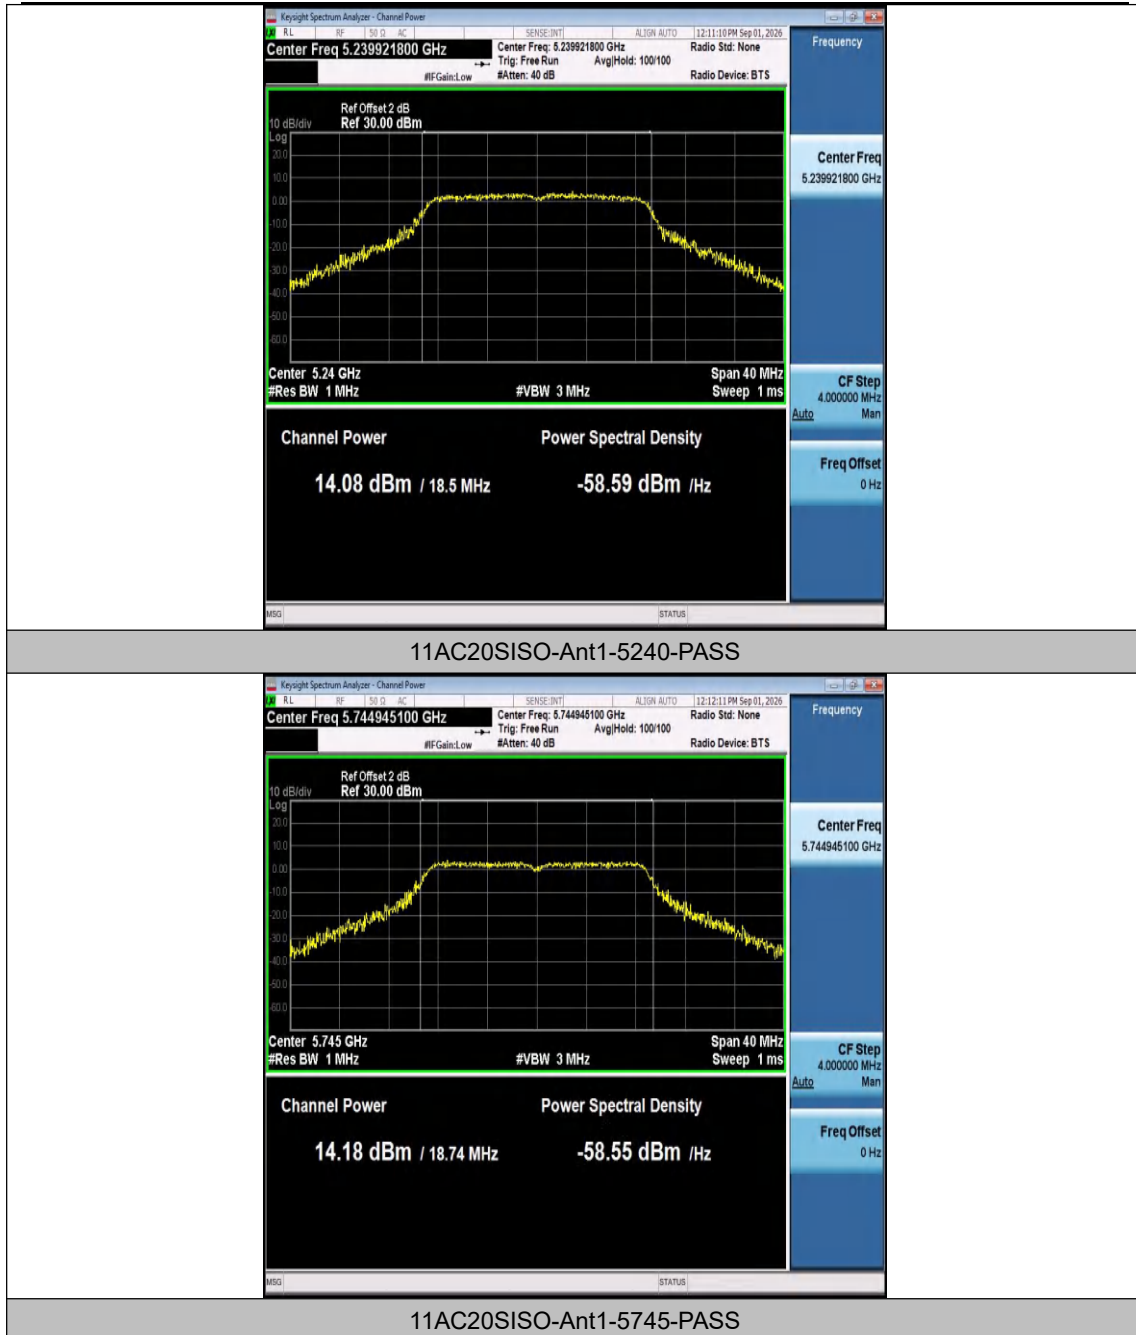



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

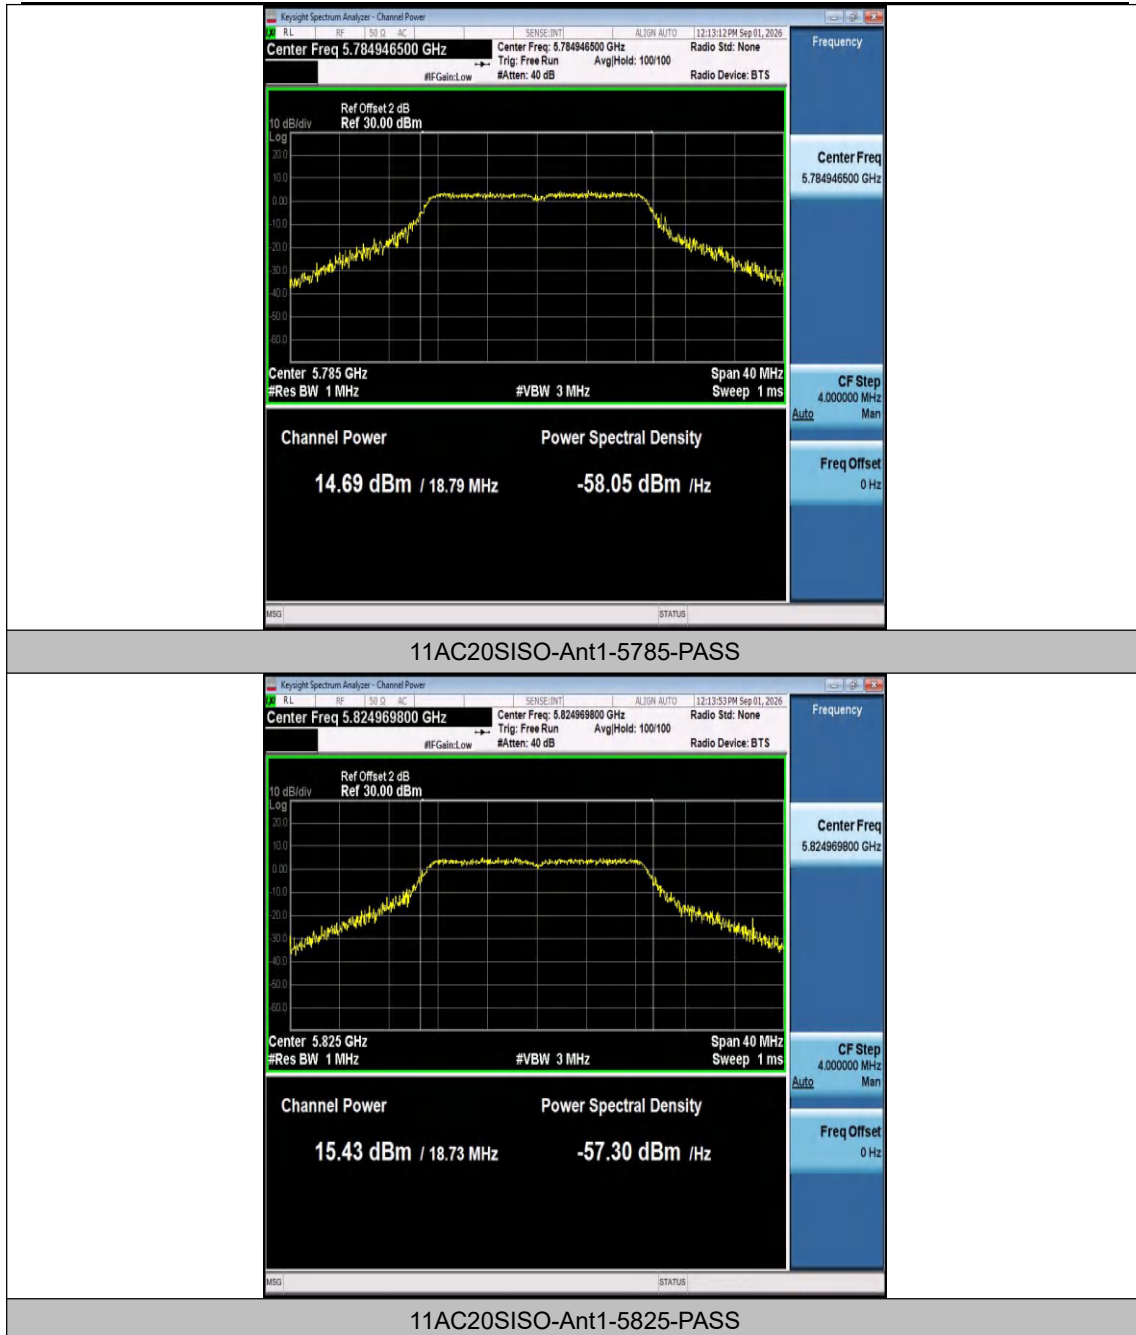

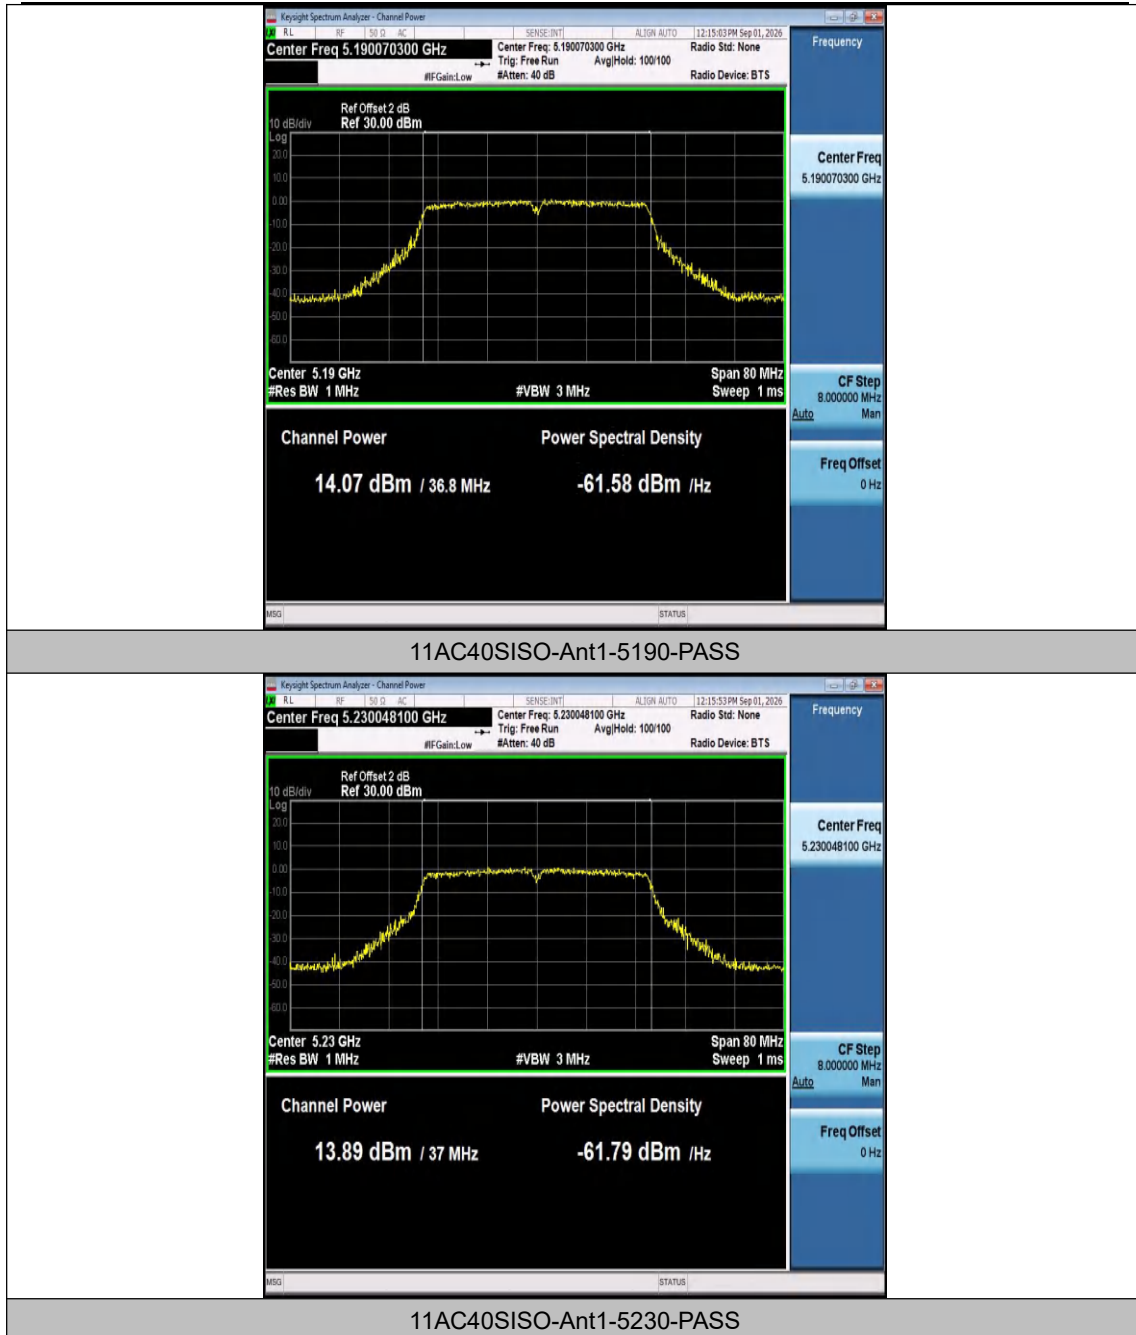


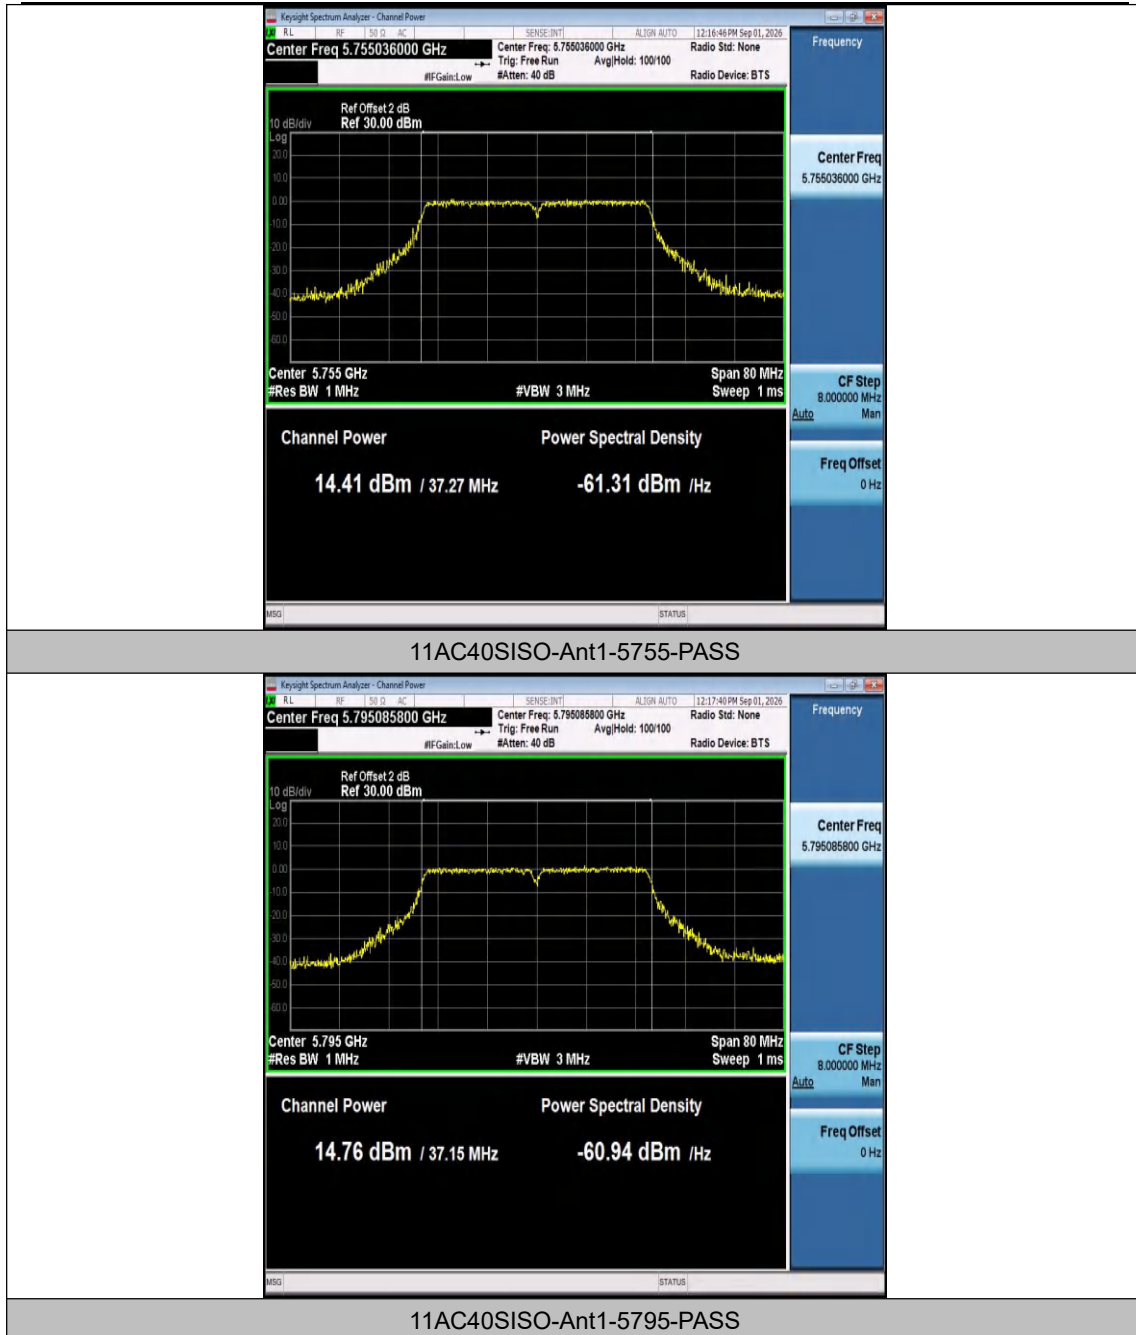

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

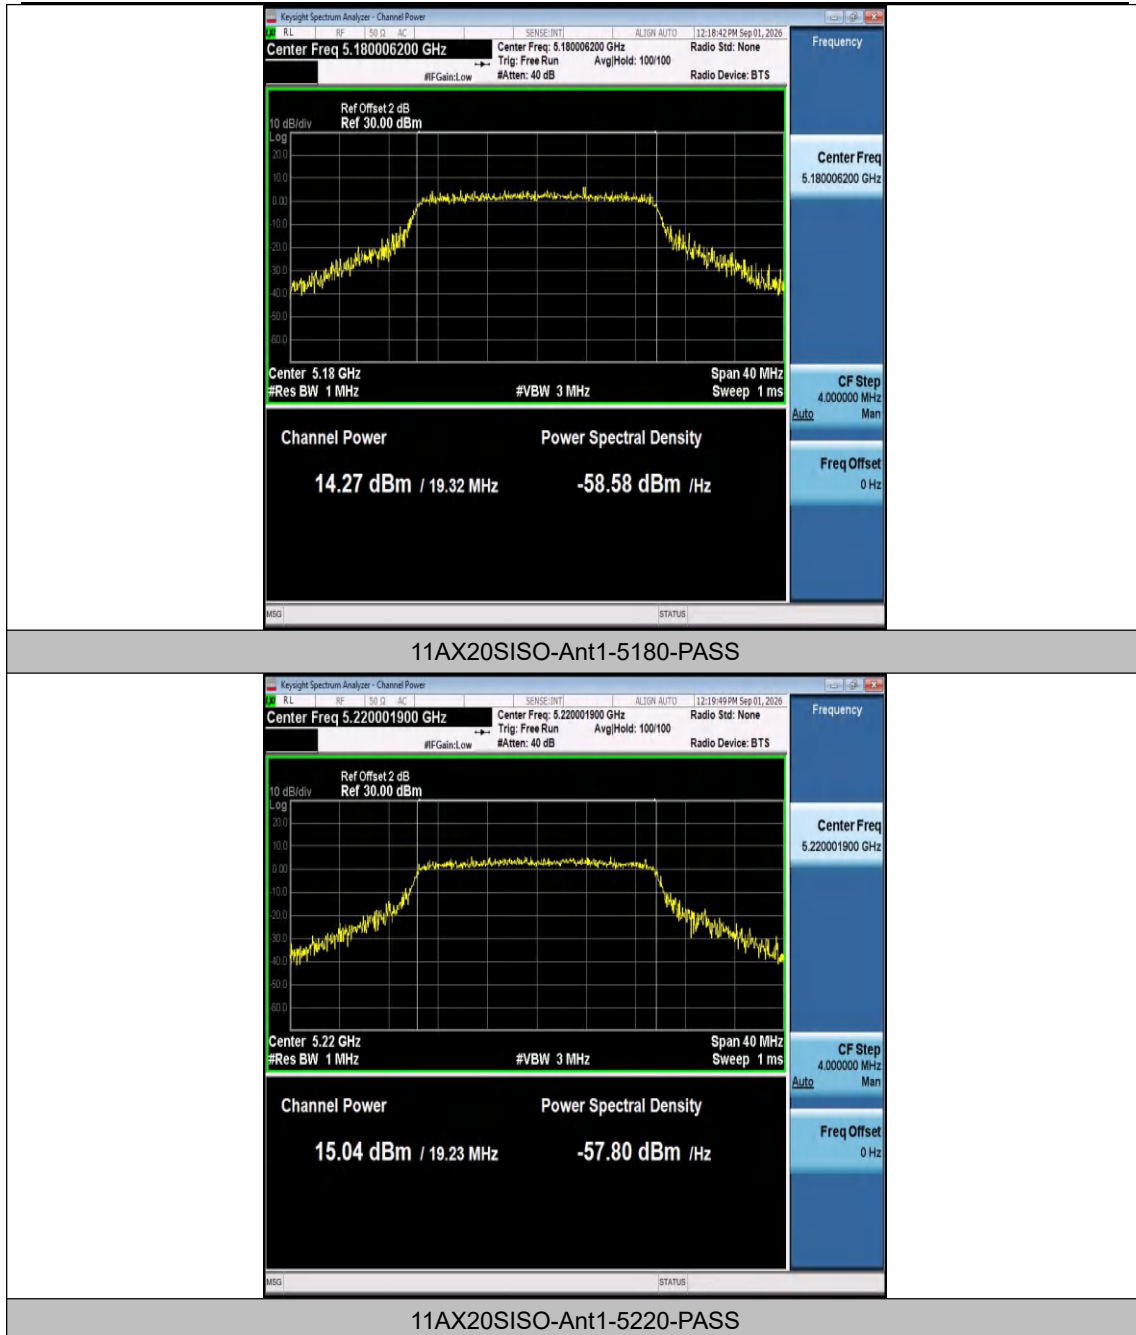

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

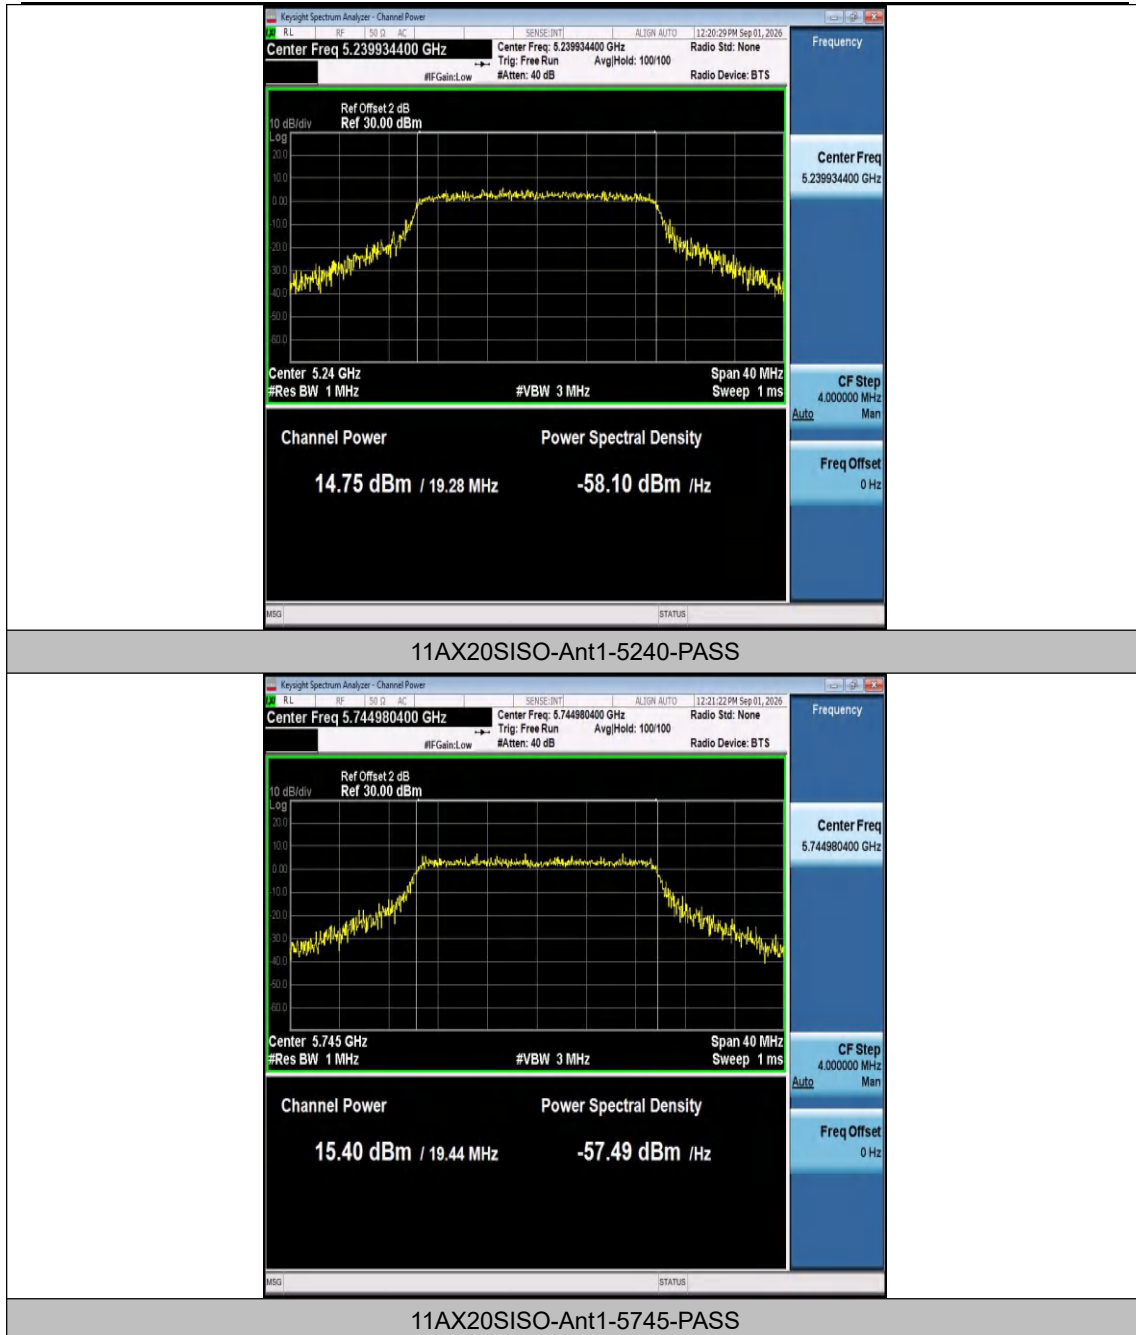

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

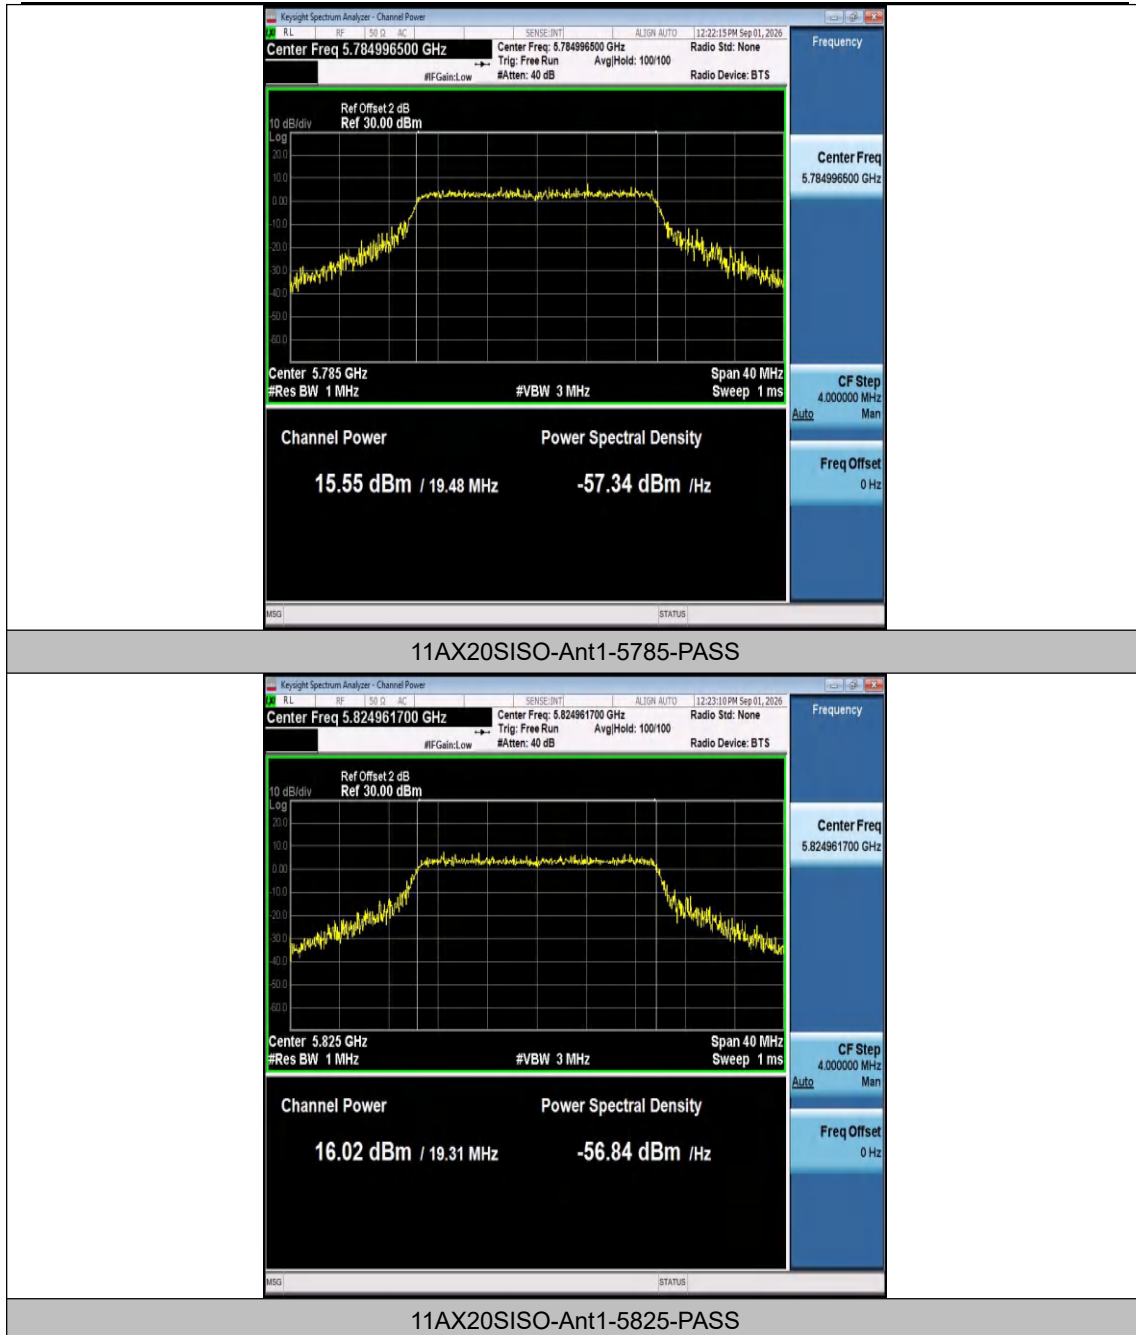


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

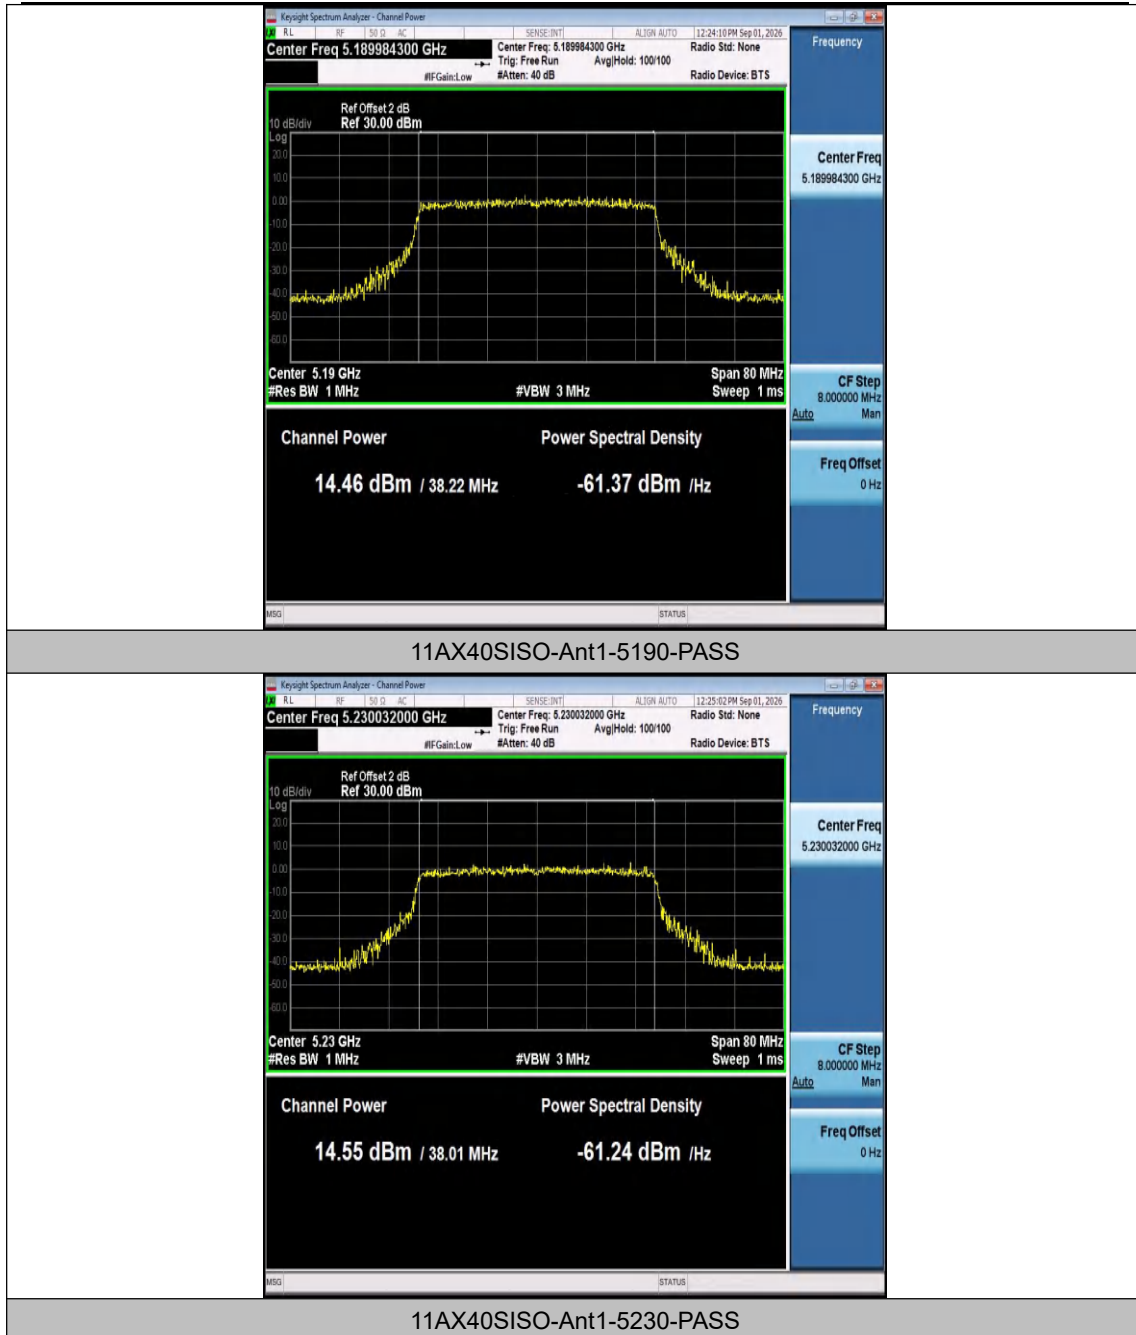

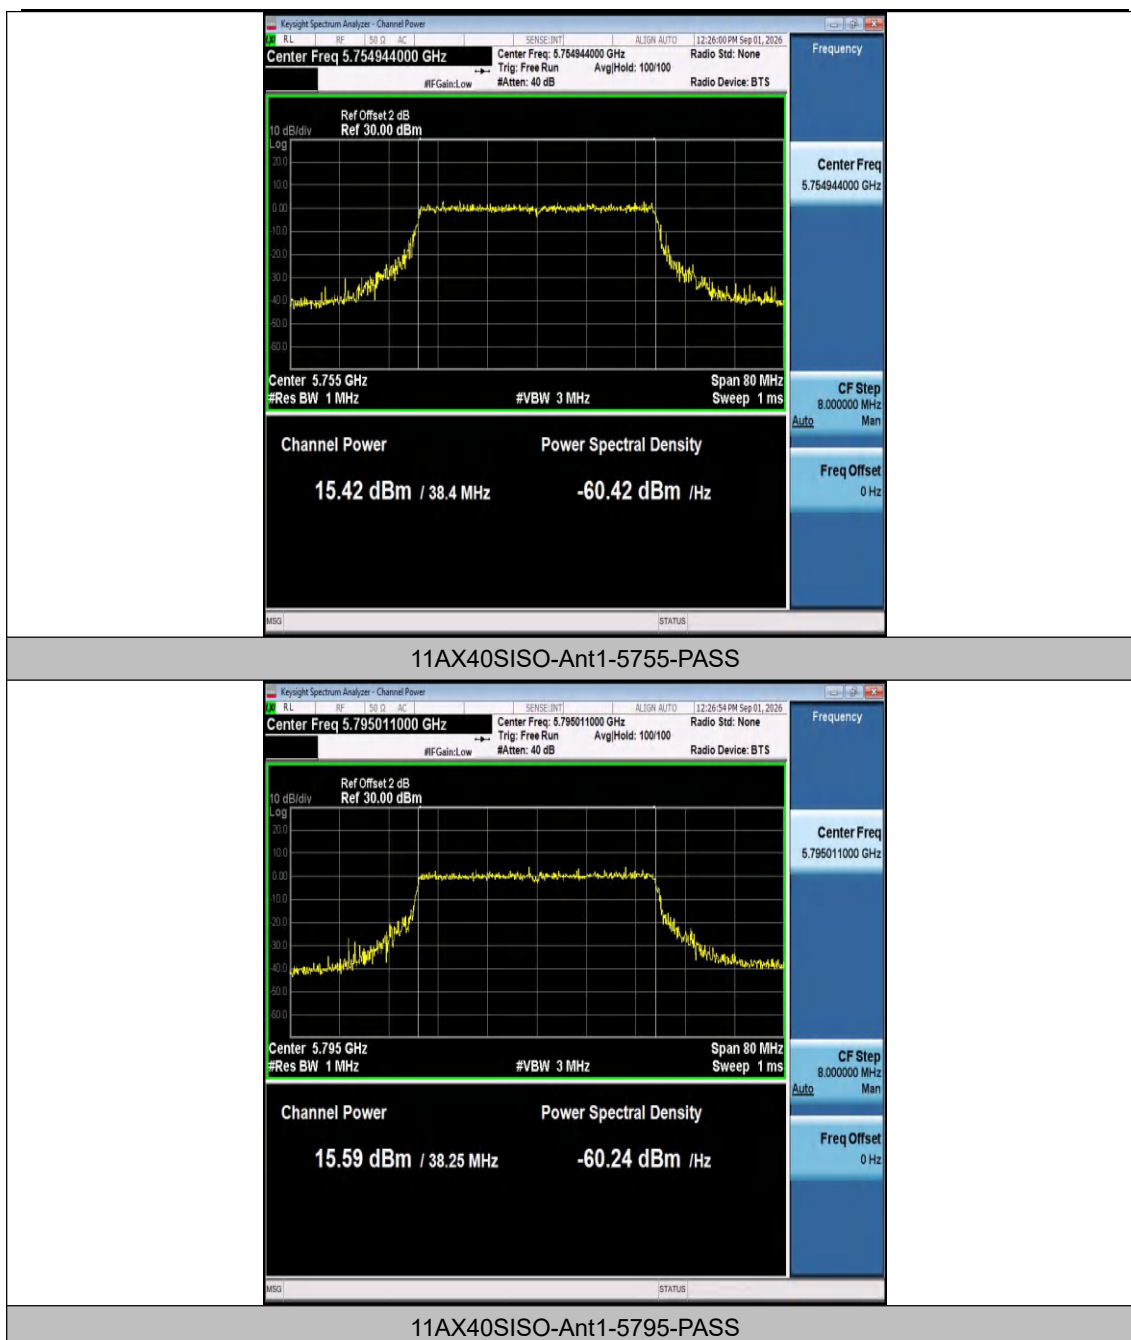

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-1.83	-1.83	≤11.00	PASS
11A	Ant1	5220	-1.06	-1.06	≤11.00	PASS
11A	Ant1	5240	-1.24	-1.24	≤11.00	PASS
11N20SISO	Ant1	5180	-2.17	-2.17	≤11.00	PASS
11N20SISO	Ant1	5220	-2.03	-2.03	≤11.00	PASS
11N20SISO	Ant1	5240	-2.73	-2.73	≤11.00	PASS
11N40SISO	Ant1	5190	-6.02	-6.02	≤11.00	PASS
11N40SISO	Ant1	5230	-5.44	-5.44	≤11.00	PASS
11AC20SISO	Ant1	5180	-1.93	-1.93	≤11.00	PASS
11AC20SISO	Ant1	5220	-1.63	-1.63	≤11.00	PASS
11AC20SISO	Ant1	5240	-1.64	-1.64	≤11.00	PASS
11AC40SISO	Ant1	5190	-4.69	-4.69	≤11.00	PASS
11AC40SISO	Ant1	5230	-5.00	-5.00	≤11.00	PASS
11AX20SISO	Ant1	5180	-2.44	-2.44	≤11.00	PASS
11AX20SISO	Ant1	5220	-1.81	-1.81	≤11.00	PASS
11AX20SISO	Ant1	5240	-2.24	-2.24	≤11.00	PASS
11AX40SISO	Ant1	5190	-5.19	-5.19	≤11.00	PASS
11AX40SISO	Ant1	5230	-5.35	-5.35	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/510KHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-4.44	-4.53	≤30.00	PASS
11A	Ant1	5785	-4.65	-4.74	≤30.00	PASS
11A	Ant1	5825	-3.89	-3.98	≤30.00	PASS
11N20SISO	Ant1	5745	-6.73	-6.82	≤30.00	PASS
11N20SISO	Ant1	5785	-6.16	-6.25	≤30.00	PASS
11N20SISO	Ant1	5825	-5.94	-6.03	≤30.00	PASS
11N40SISO	Ant1	5755	-9.63	-9.72	≤30.00	PASS
11N40SISO	Ant1	5795	-8.50	-8.59	≤30.00	PASS
11AC20SISO	Ant1	5745	-5.01	-5.10	≤30.00	PASS
11AC20SISO	Ant1	5785	-4.34	-4.43	≤30.00	PASS
11AC20SISO	Ant1	5825	-3.43	-3.52	≤30.00	PASS
11AC40SISO	Ant1	5755	-7.49	-7.58	≤30.00	PASS
11AC40SISO	Ant1	5795	-7.30	-7.39	≤30.00	PASS
11AX20SISO	Ant1	5745	-4.64	-4.73	≤30.00	PASS
11AX20SISO	Ant1	5785	-4.21	-4.30	≤30.00	PASS
11AX20SISO	Ant1	5825	-4.43	-4.52	≤30.00	PASS
11AX40SISO	Ant1	5755	-7.74	-7.83	≤30.00	PASS
11AX40SISO	Ant1	5795	-7.06	-7.15	≤30.00	PASS

Note:

- 1.The cable loss and RBW Factor are compensated in the graph.
- 2.Offset=cable loss(2dB) + RBW Factor (-0.09dB)


Test Graphs B1

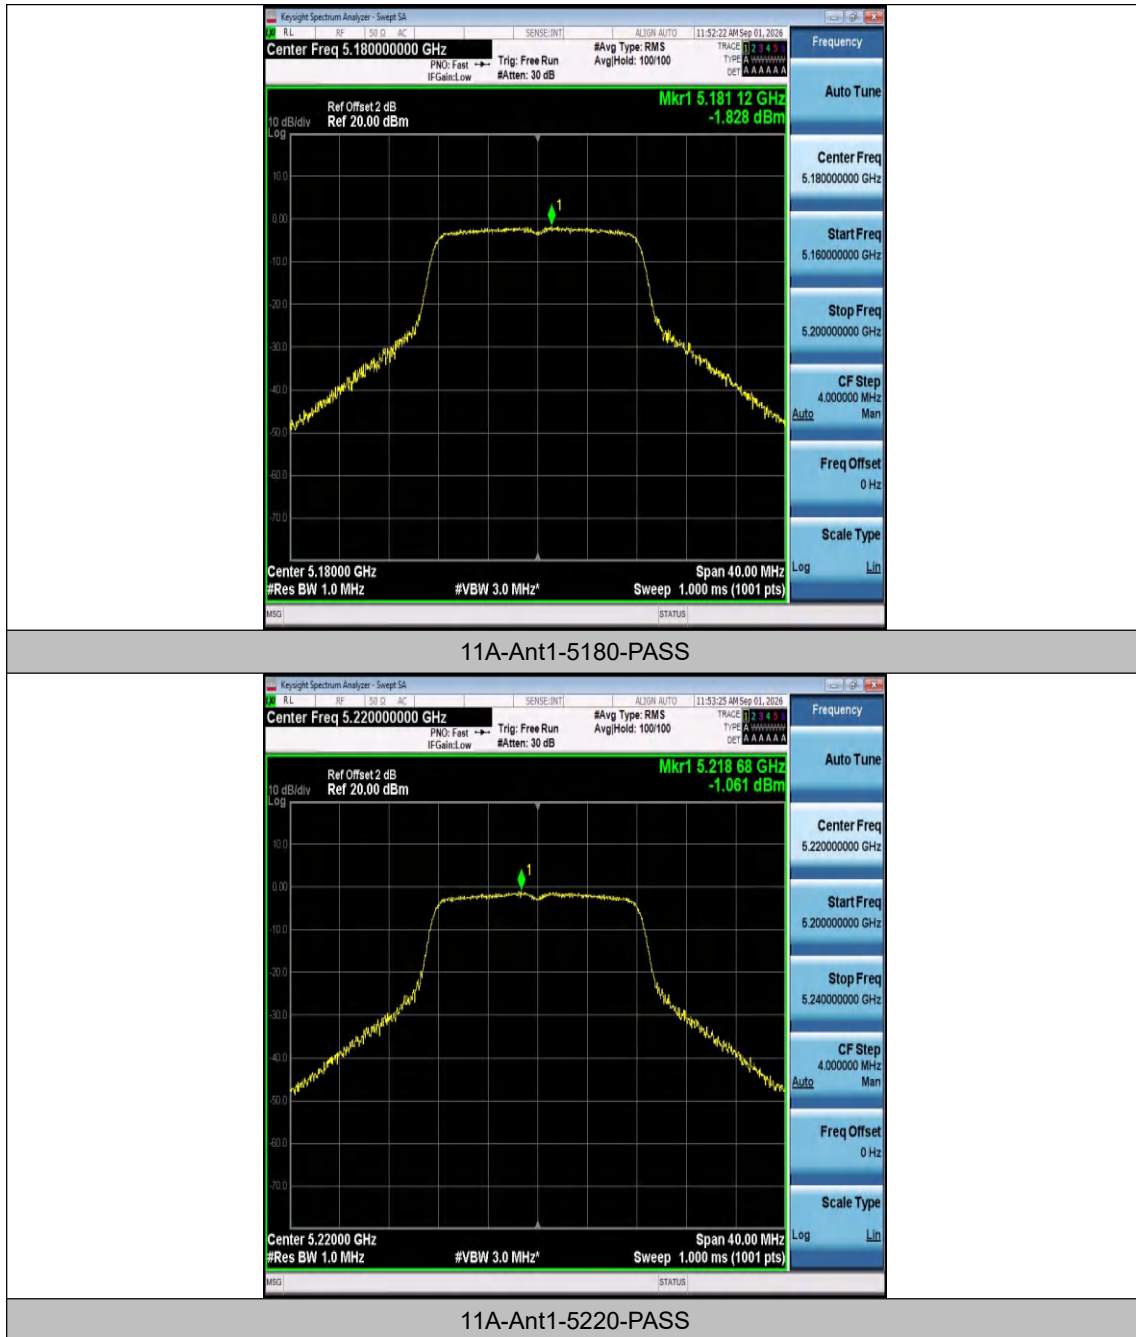

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

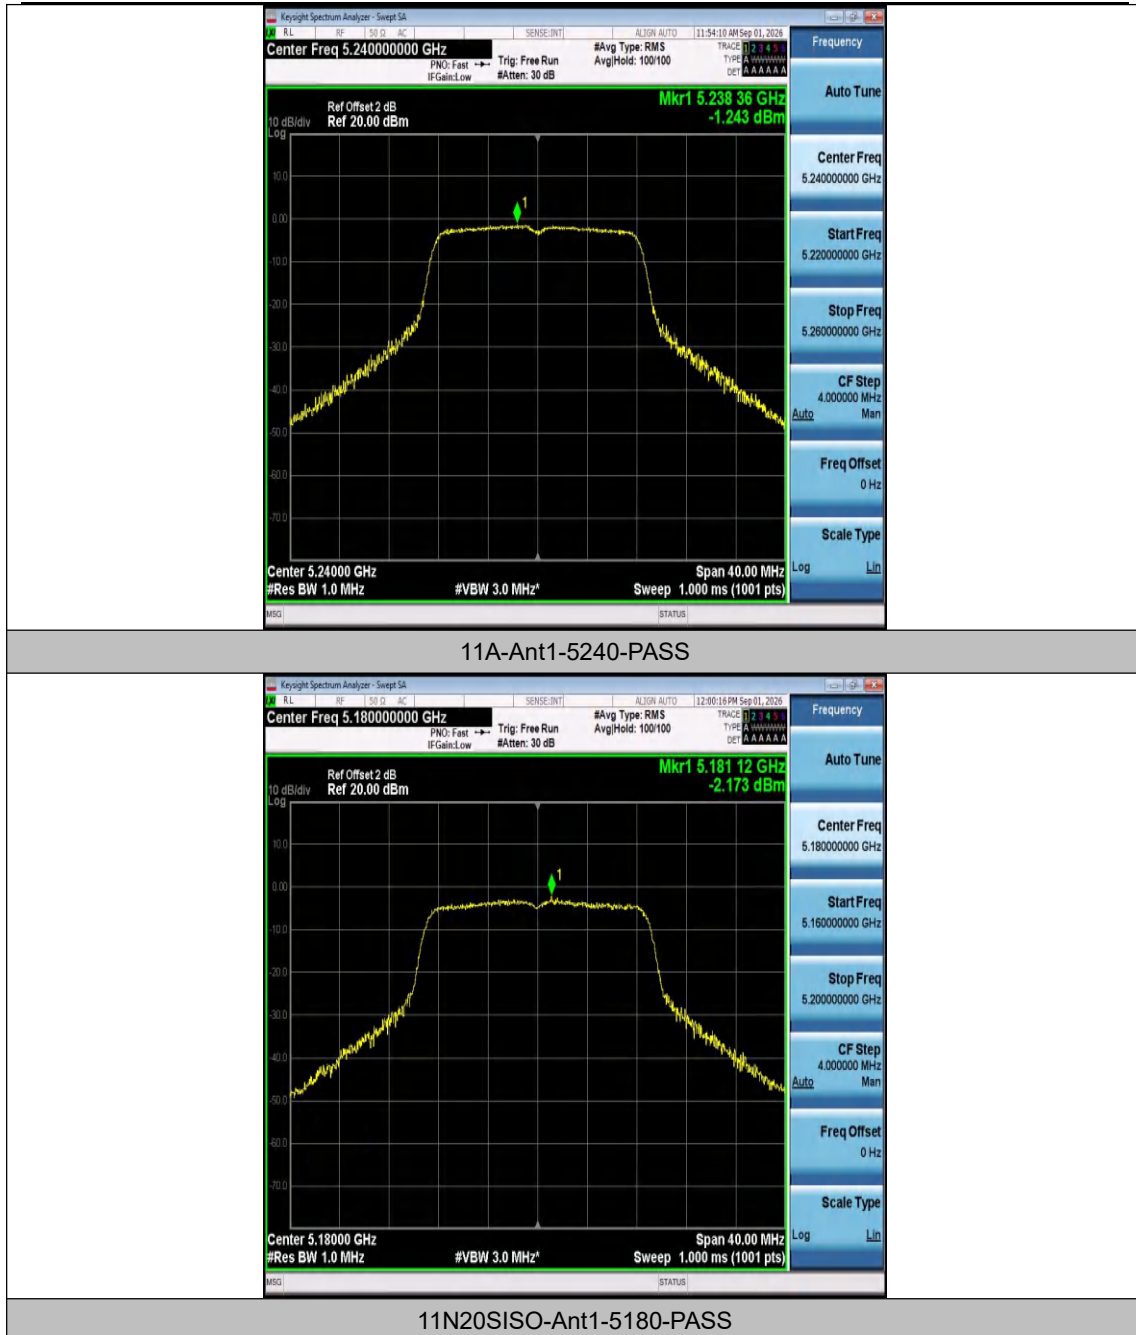

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

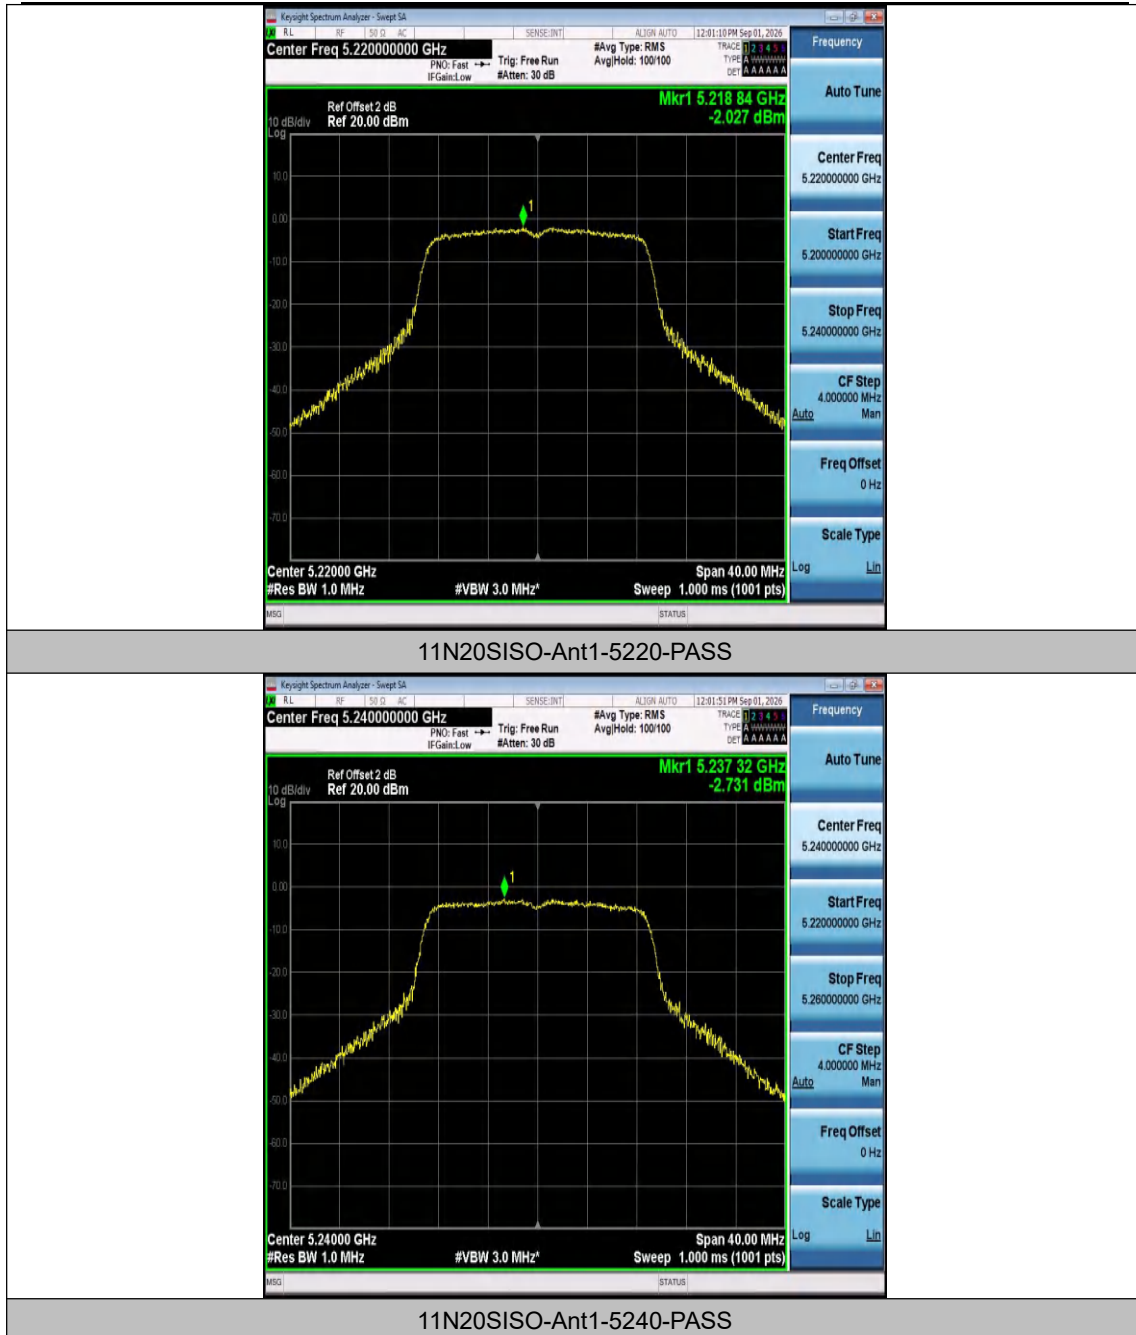

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

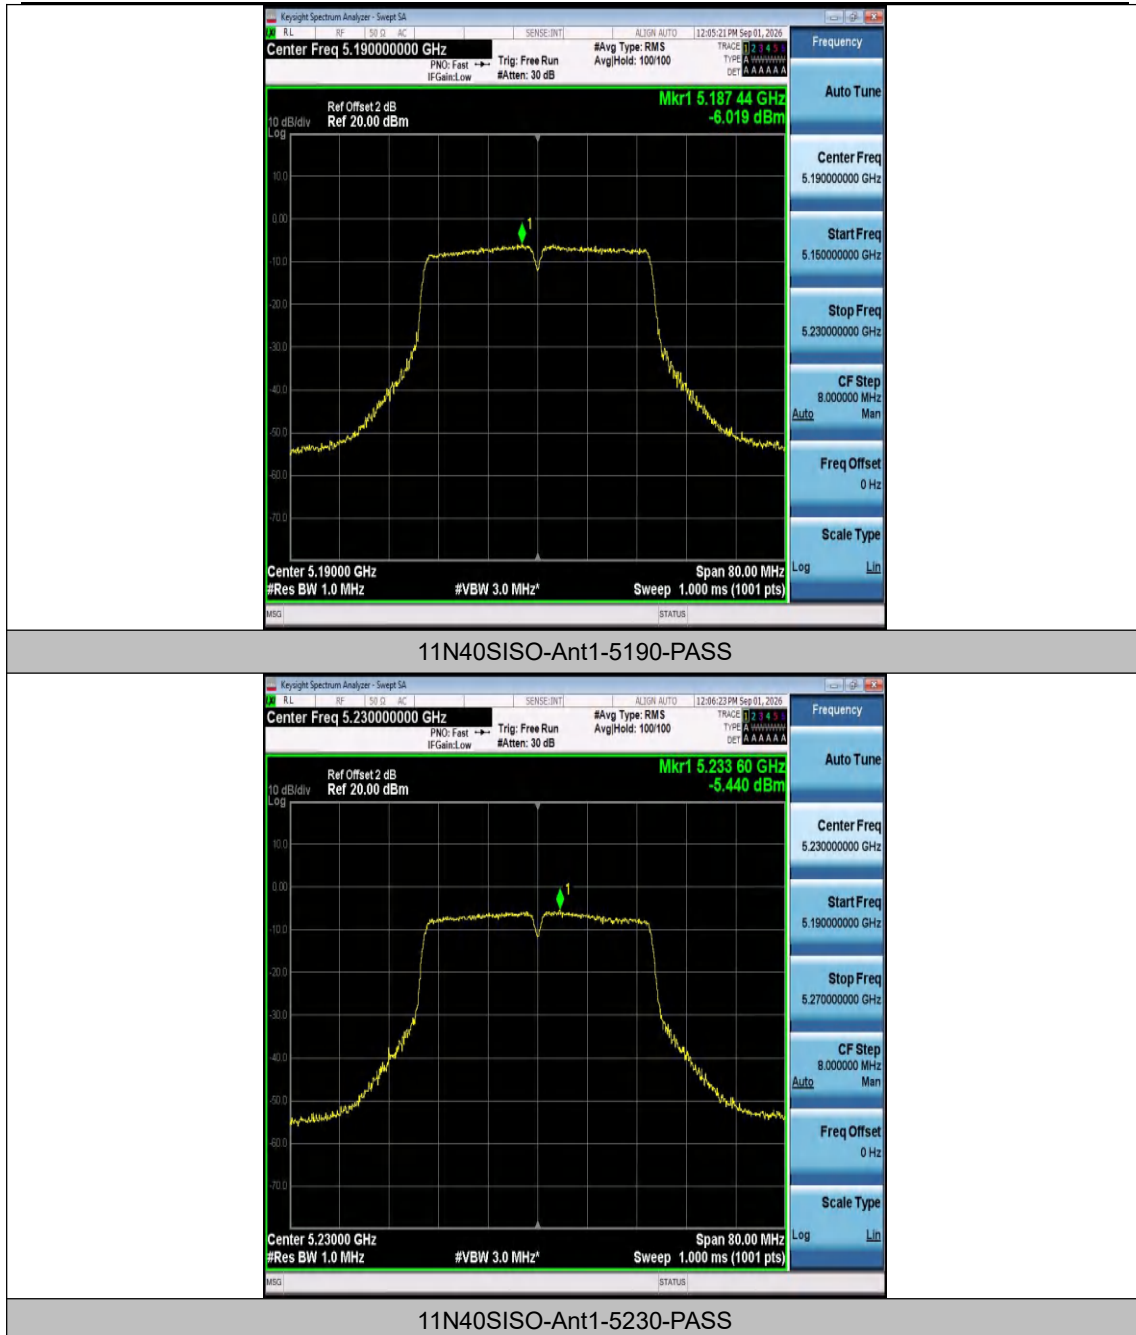

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

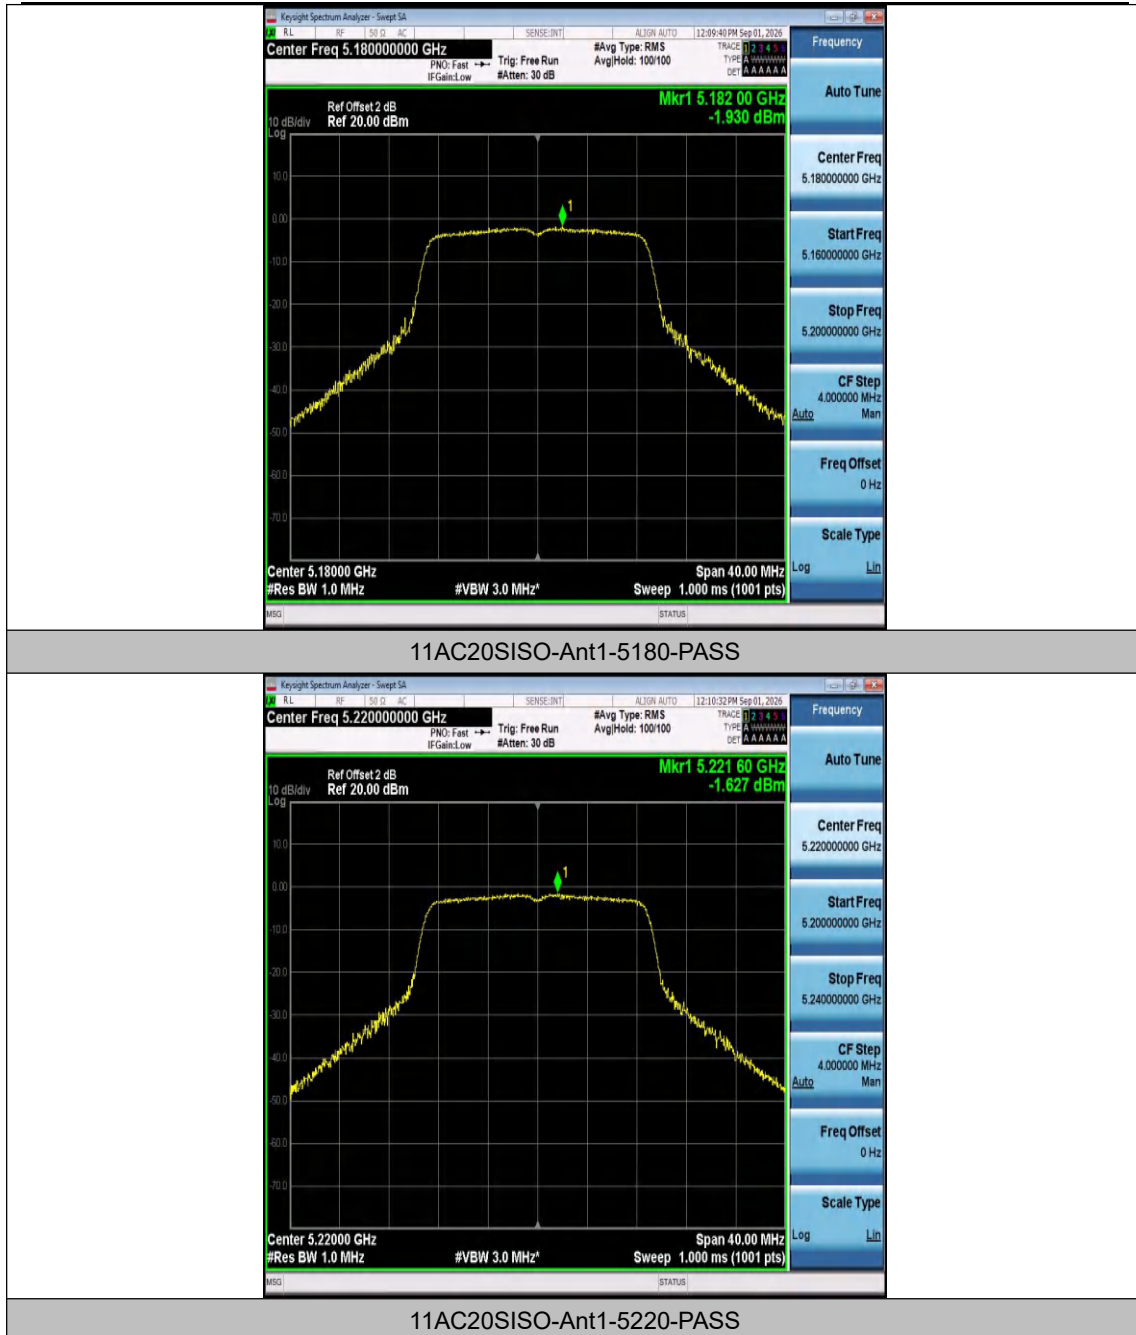

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

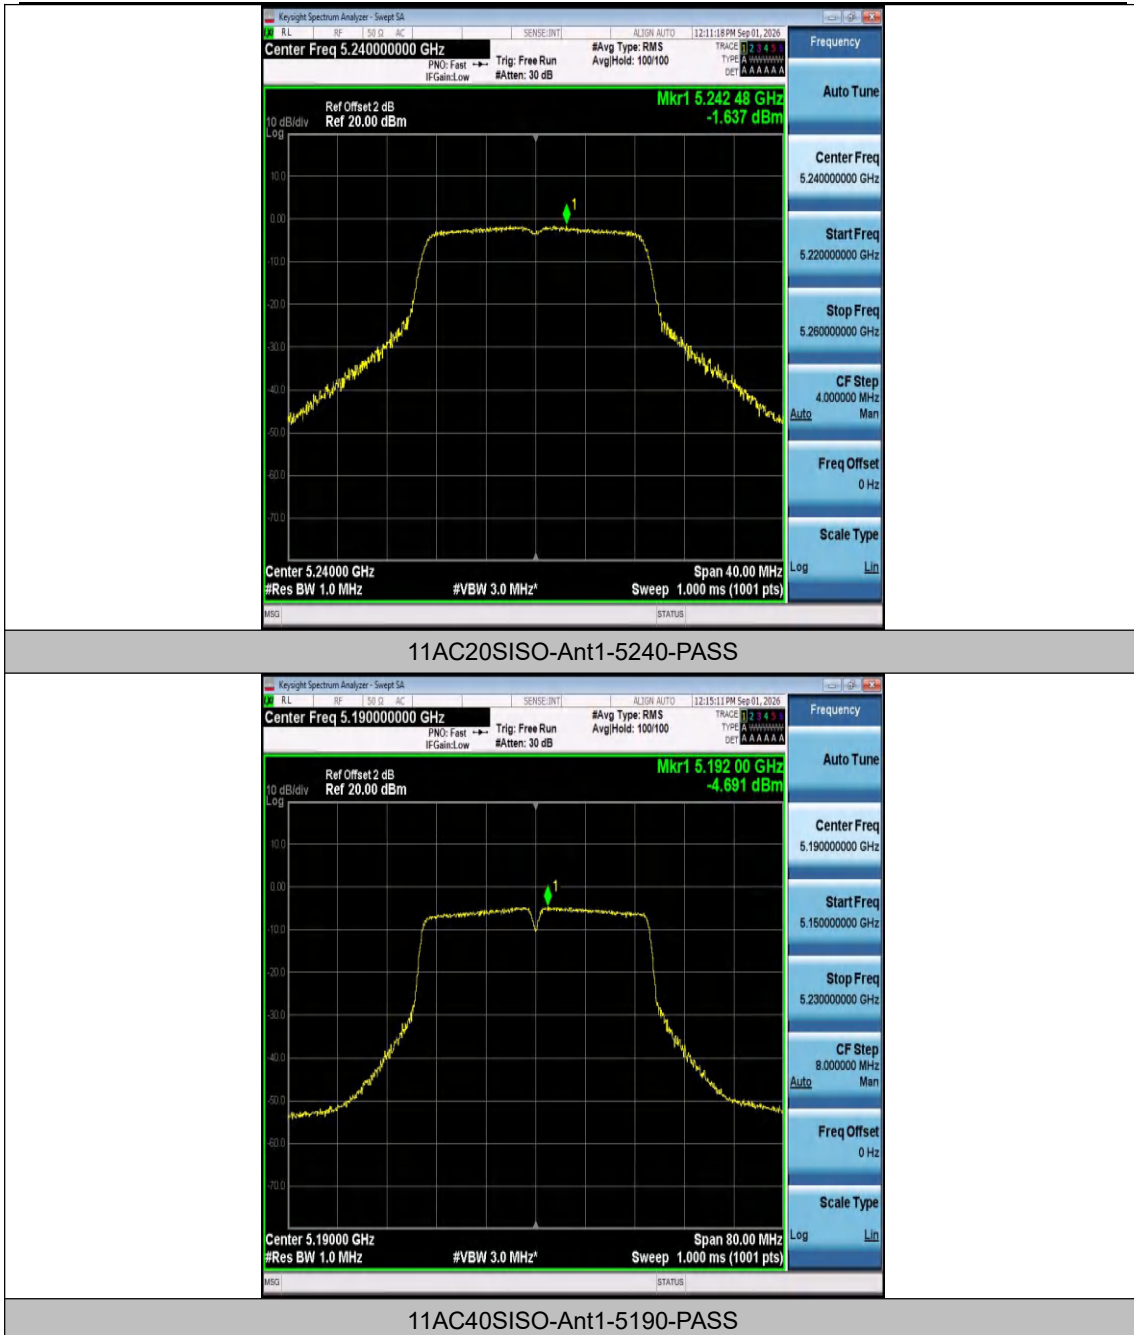

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

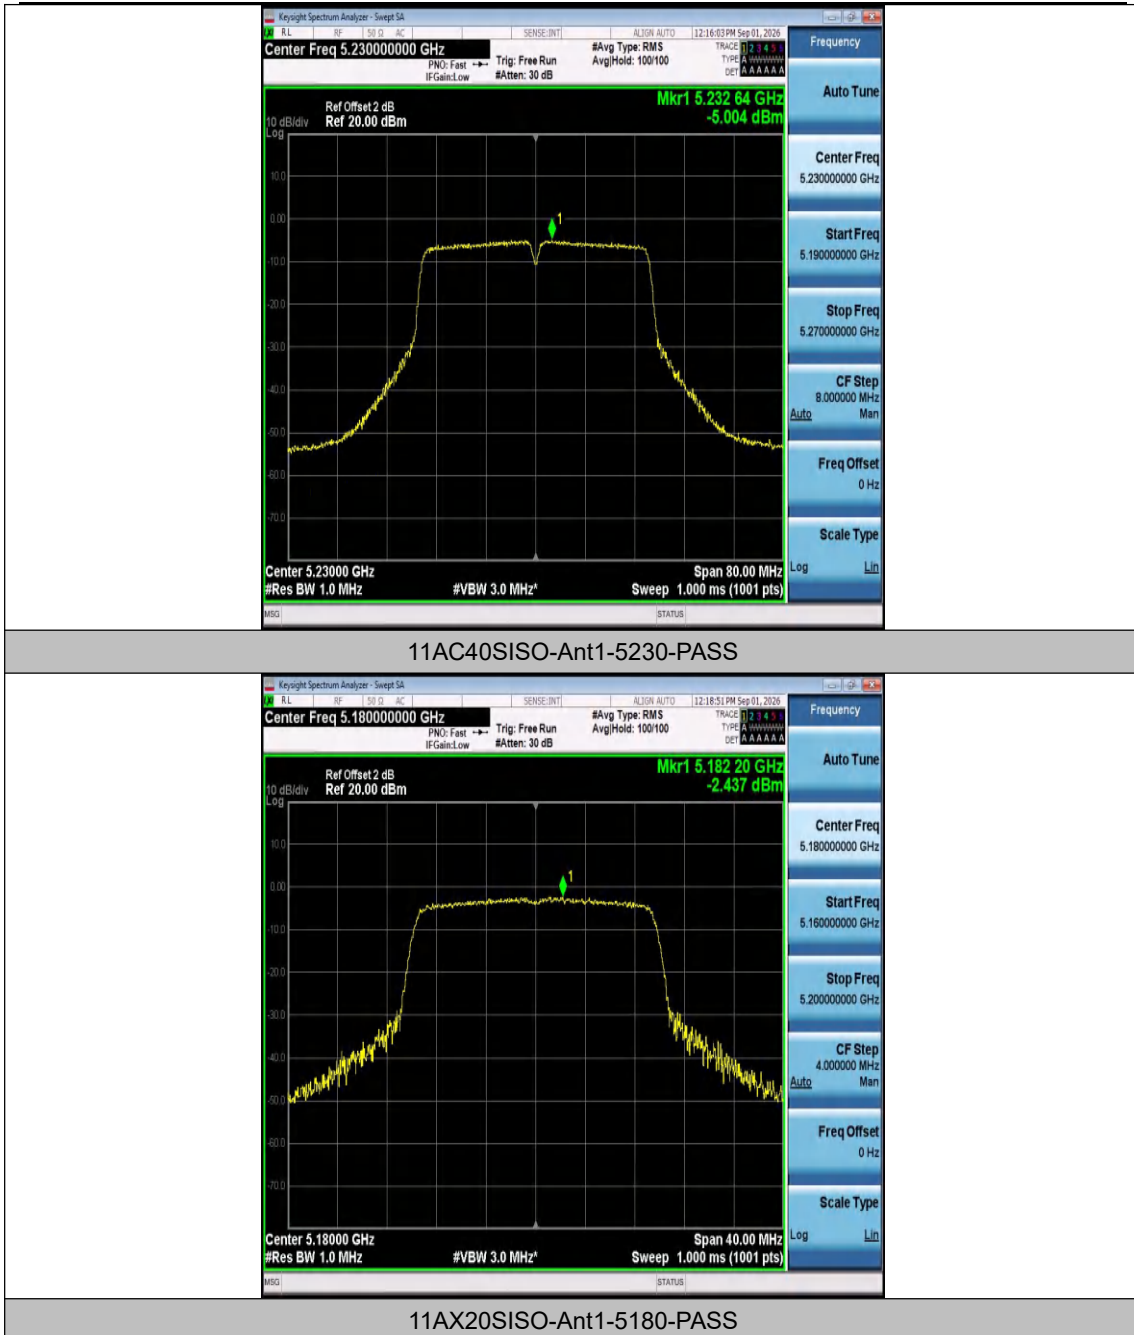

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

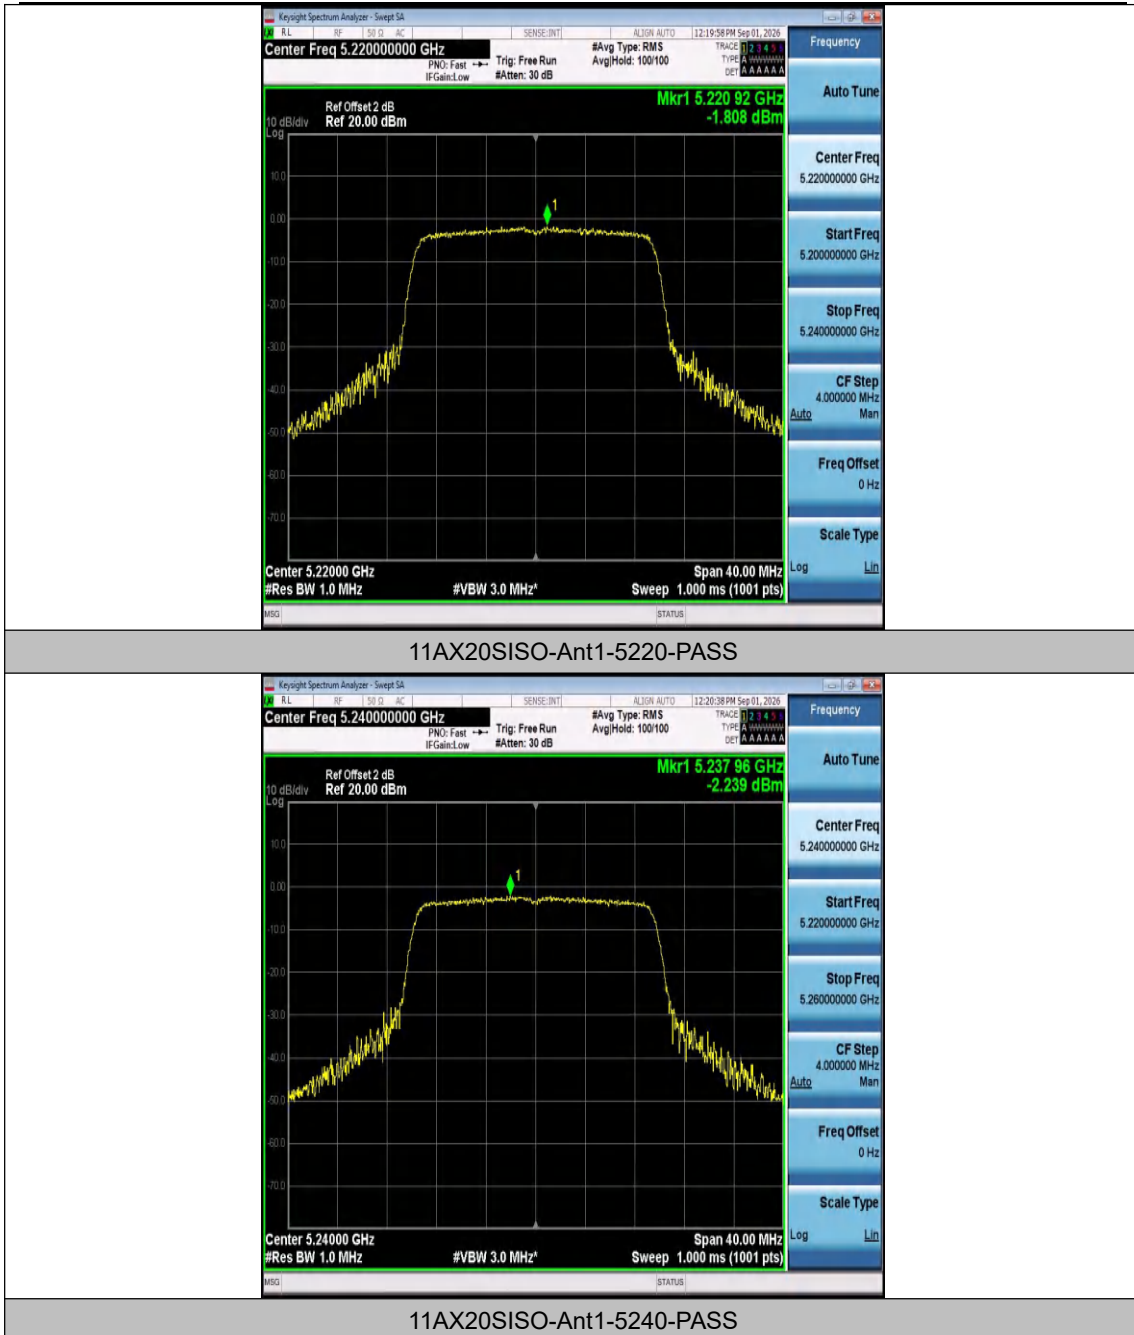

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

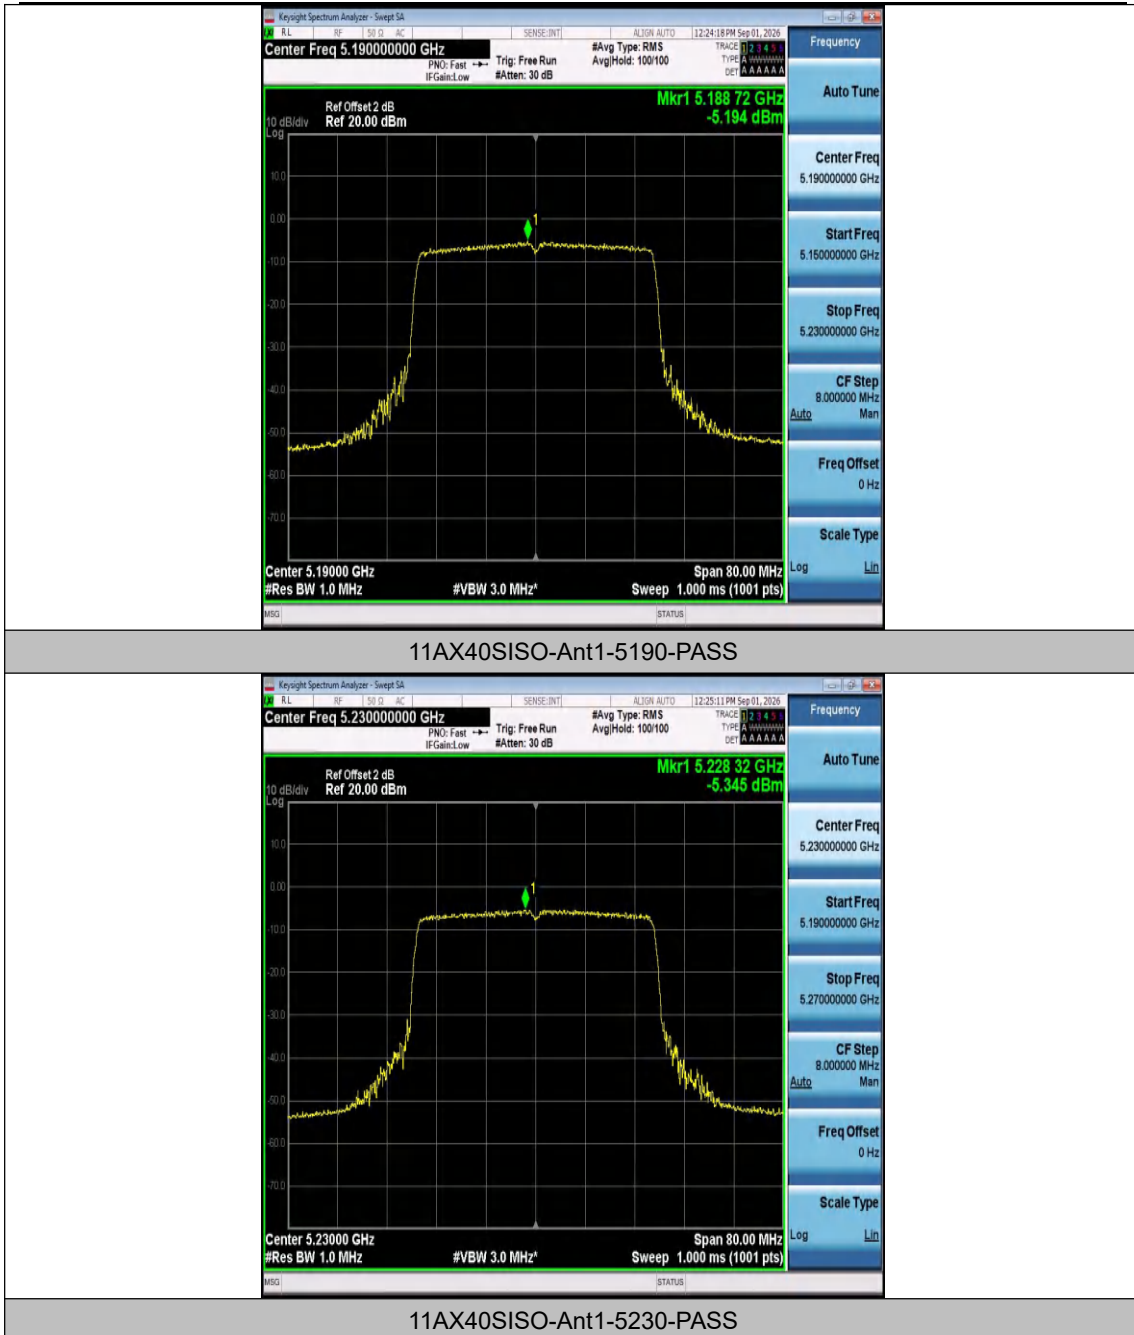


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

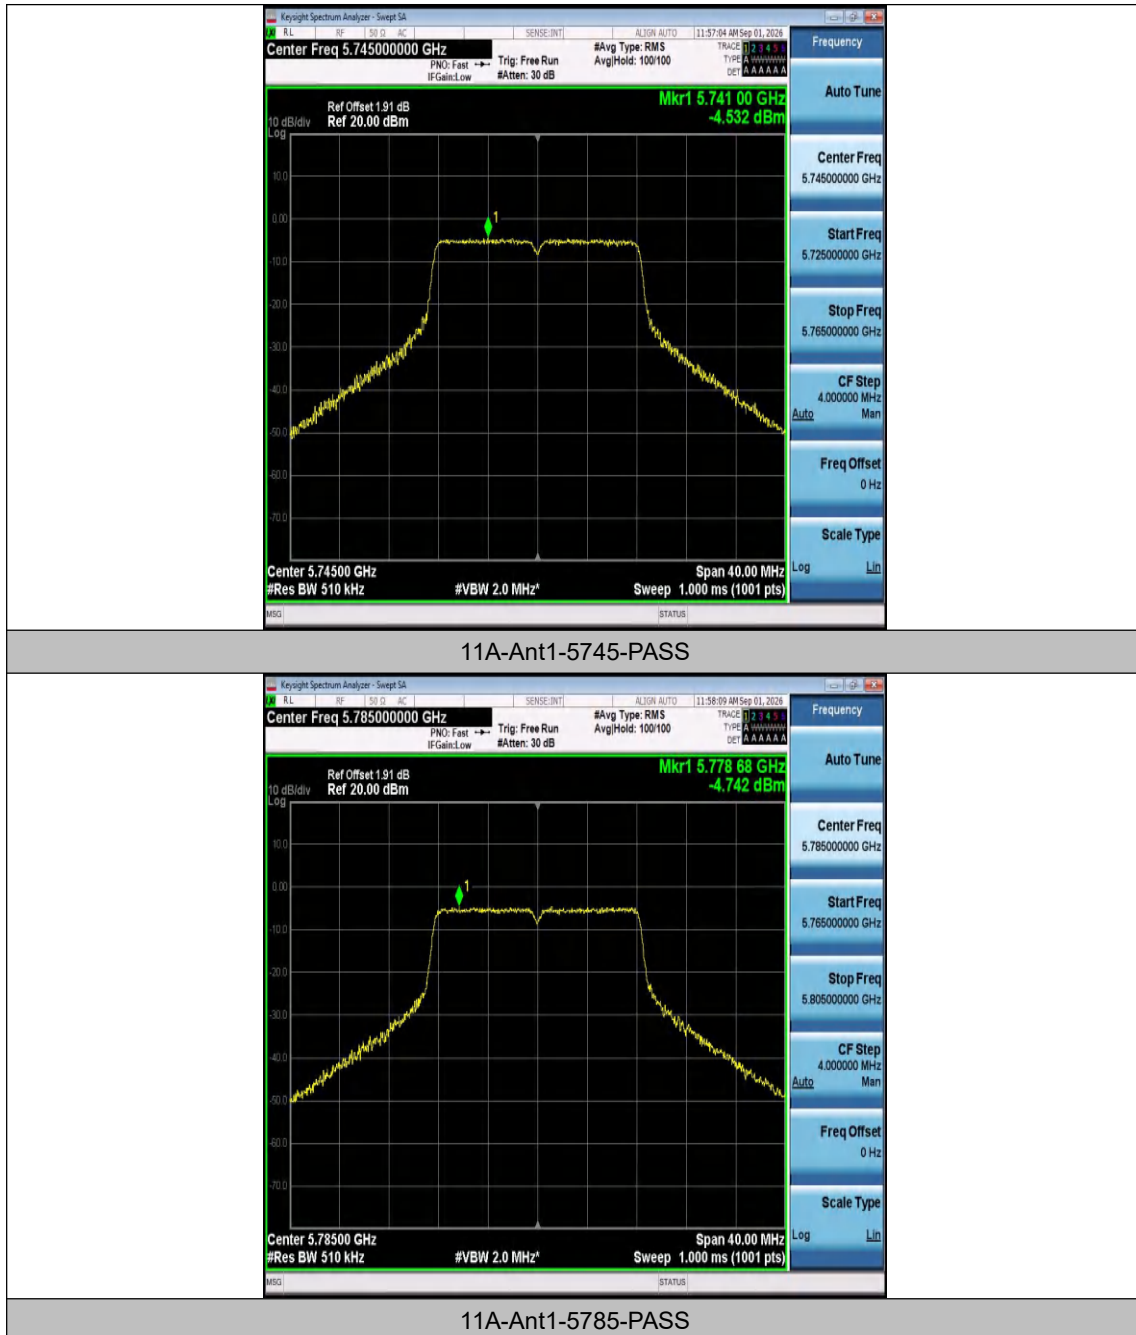

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

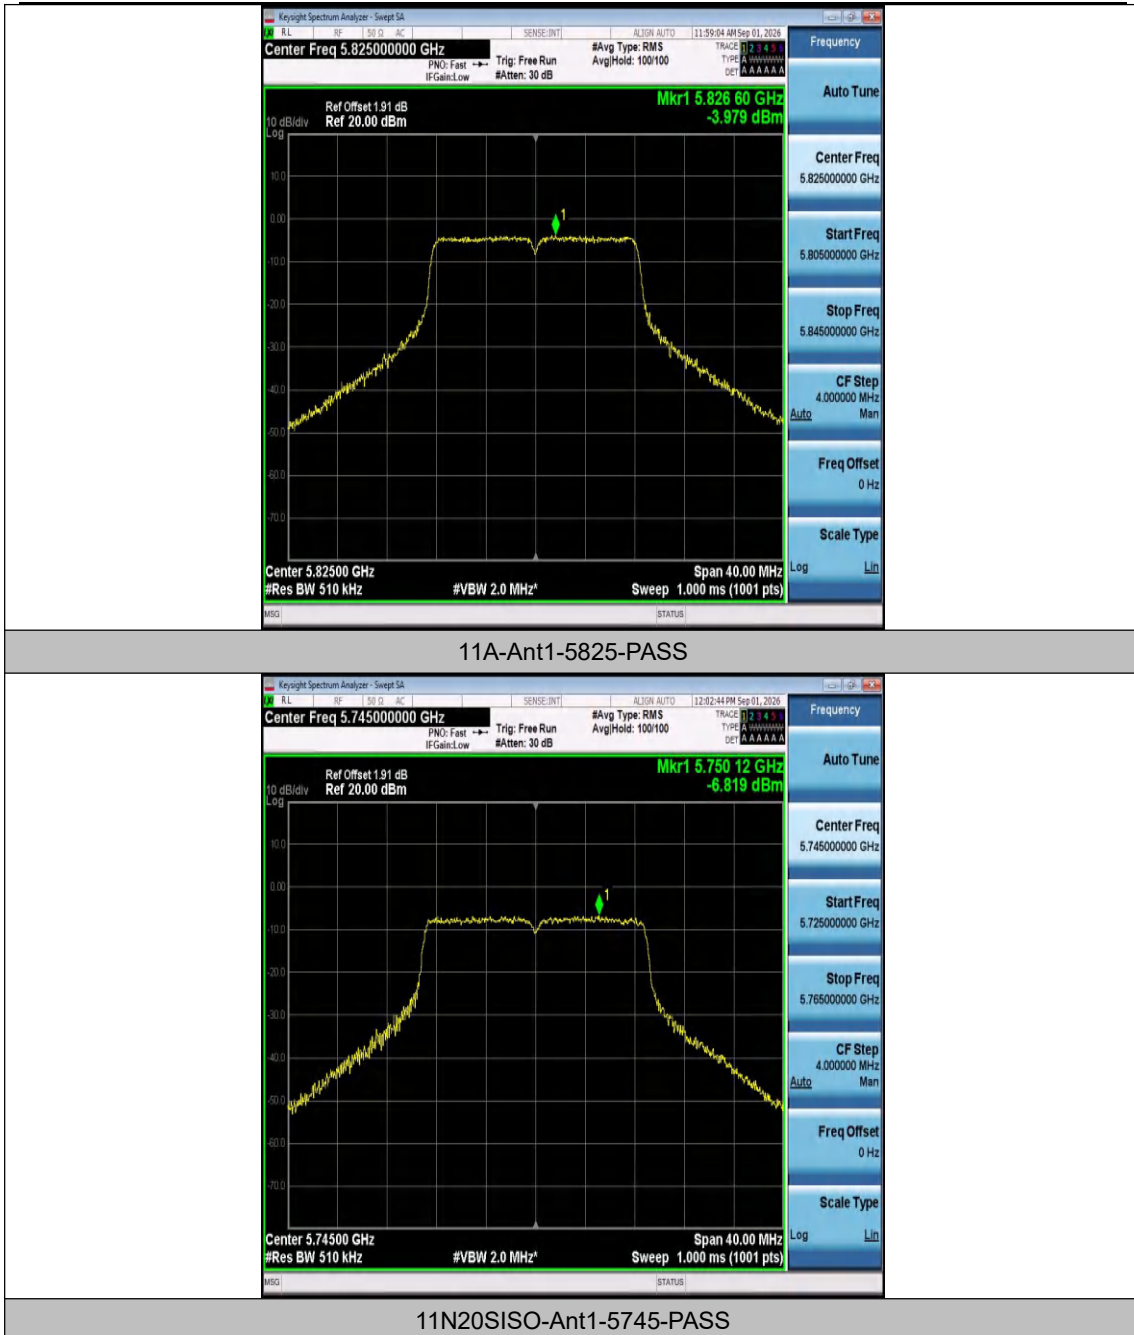

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

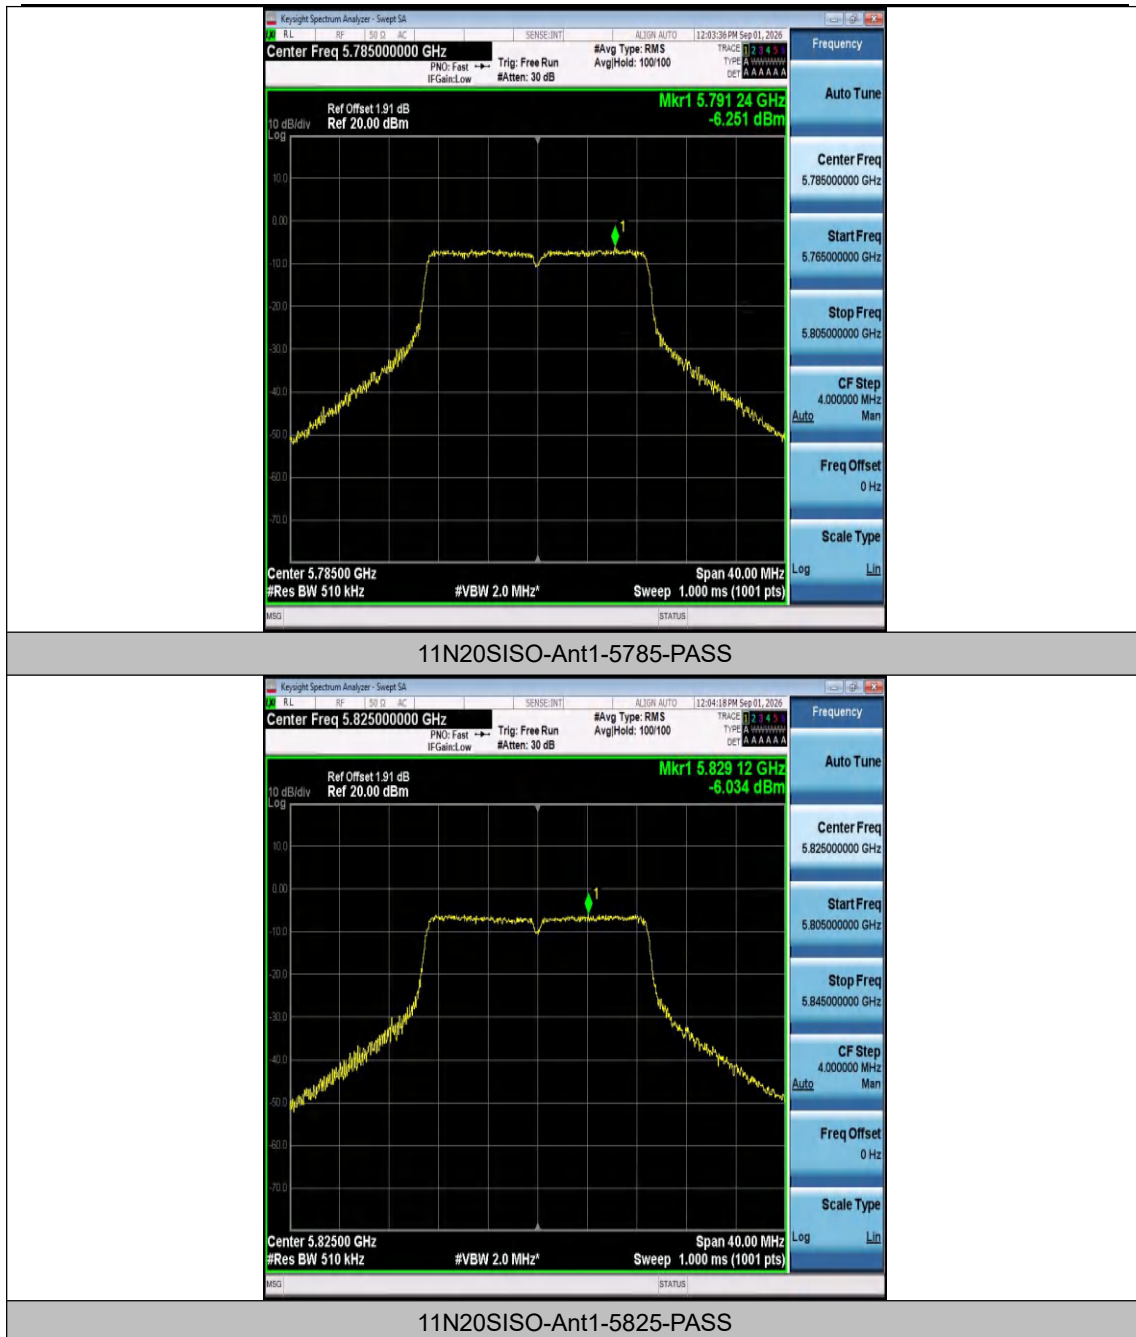

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

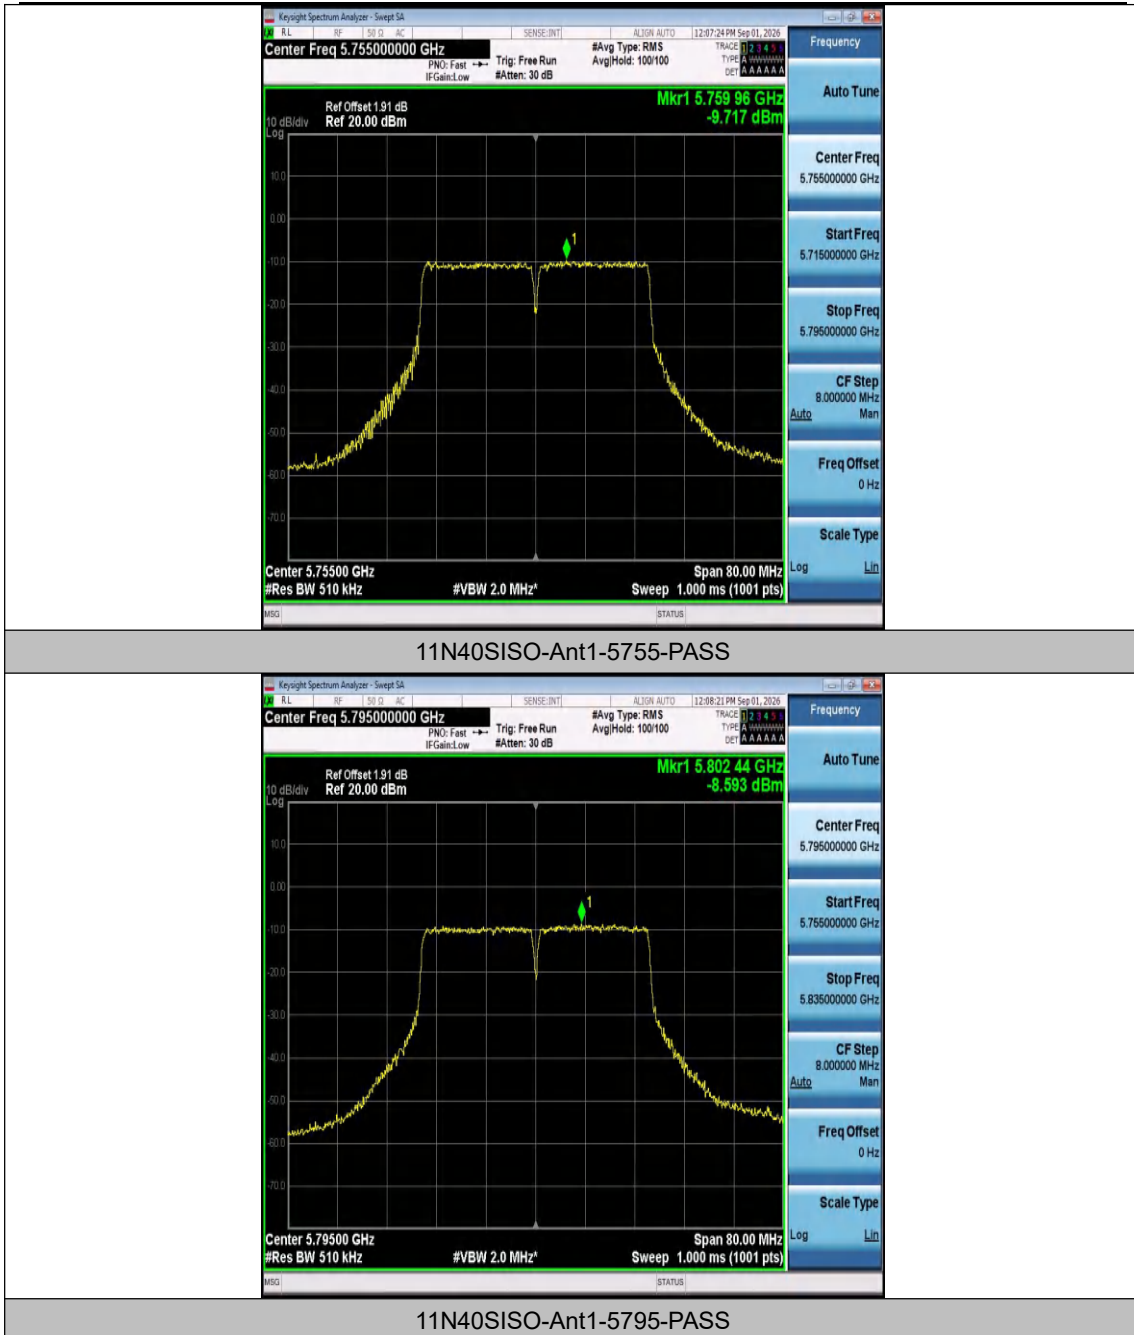

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

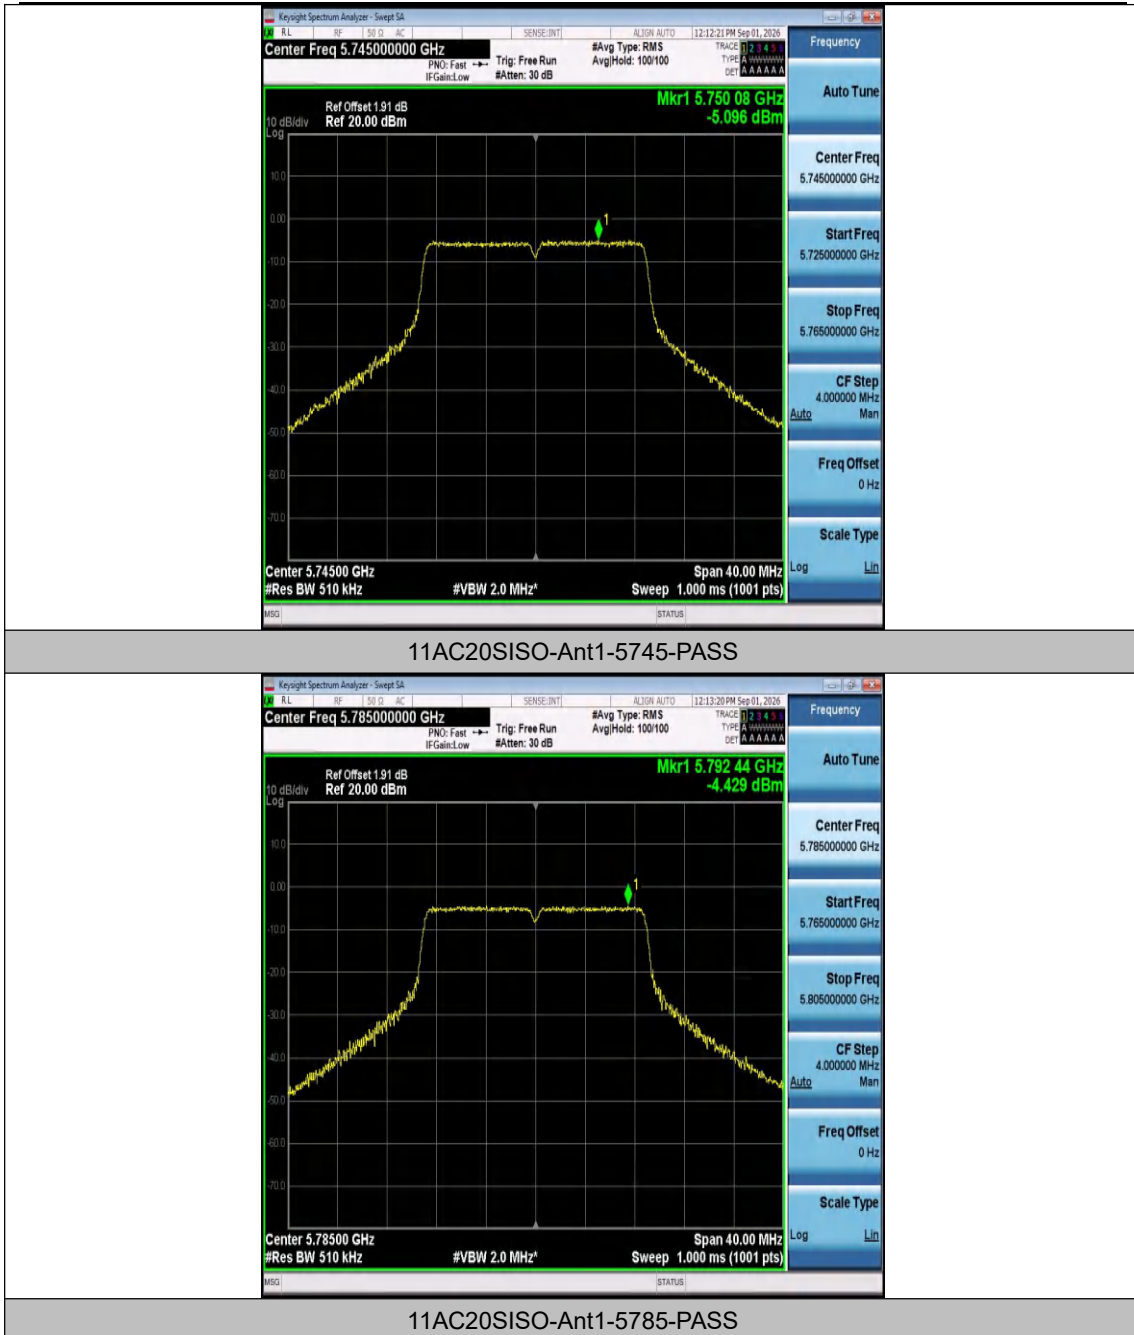

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

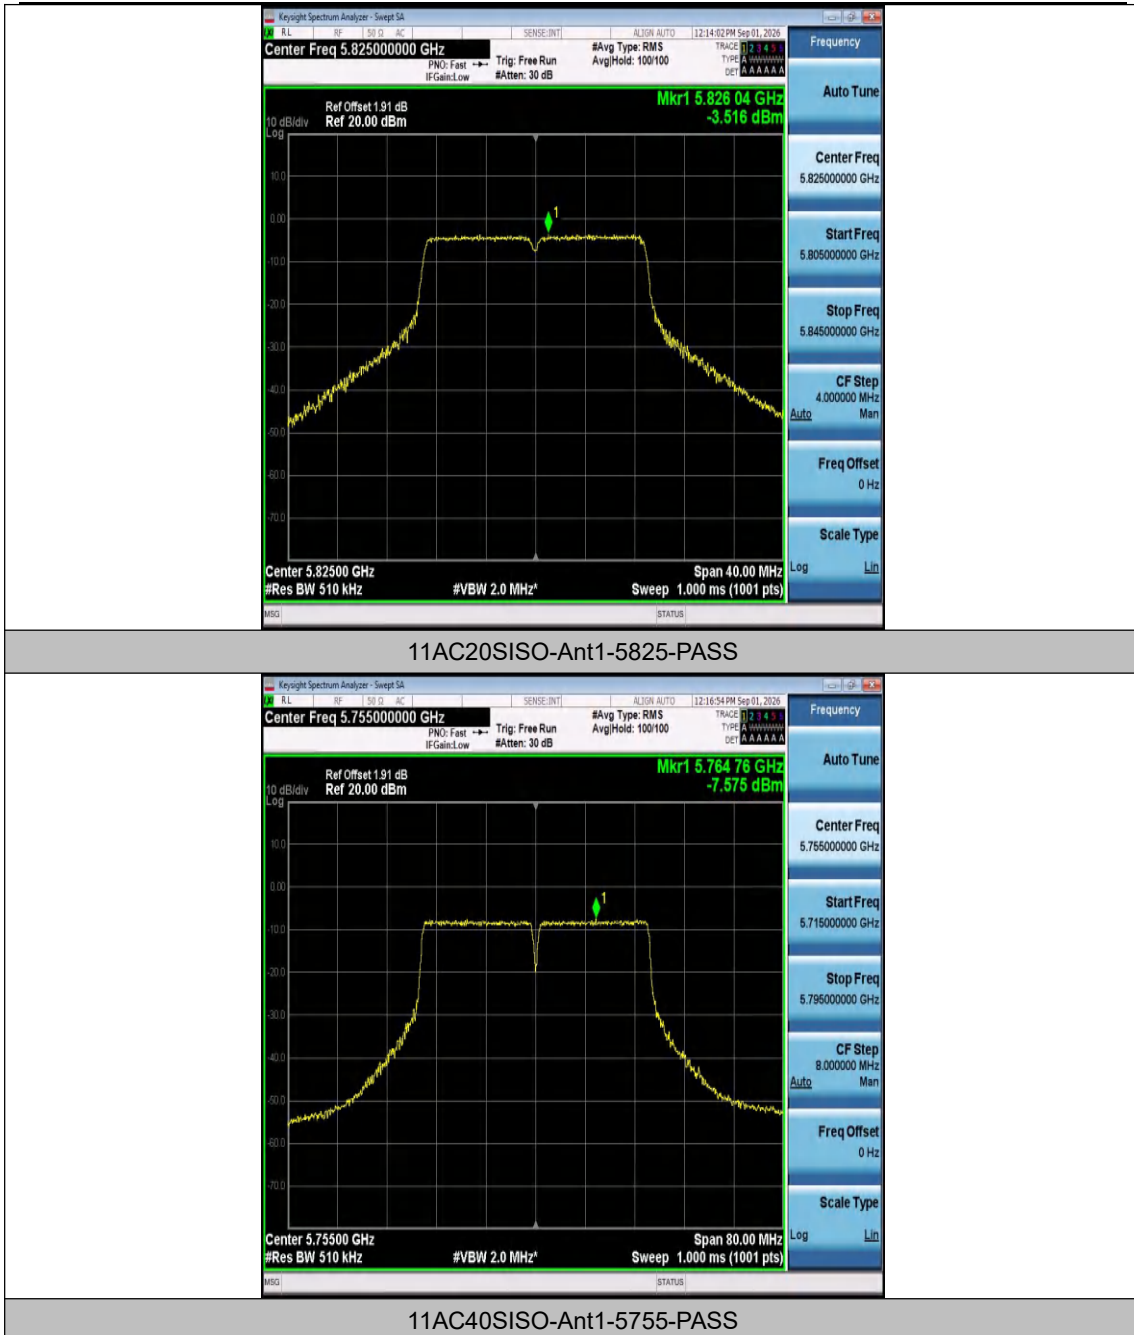

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

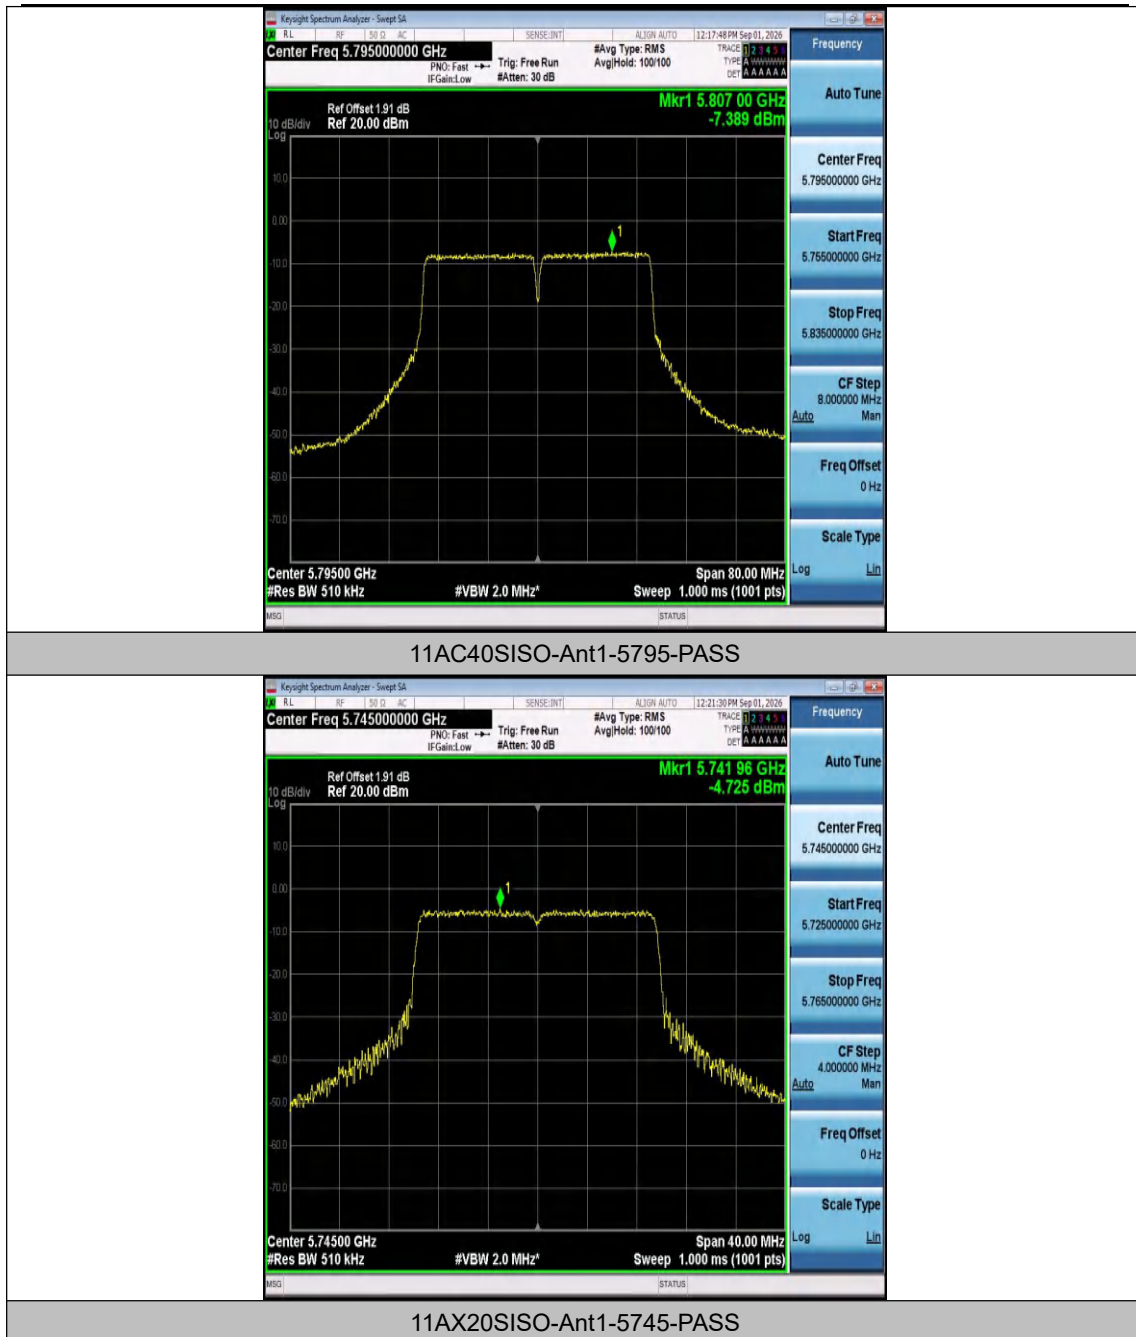

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

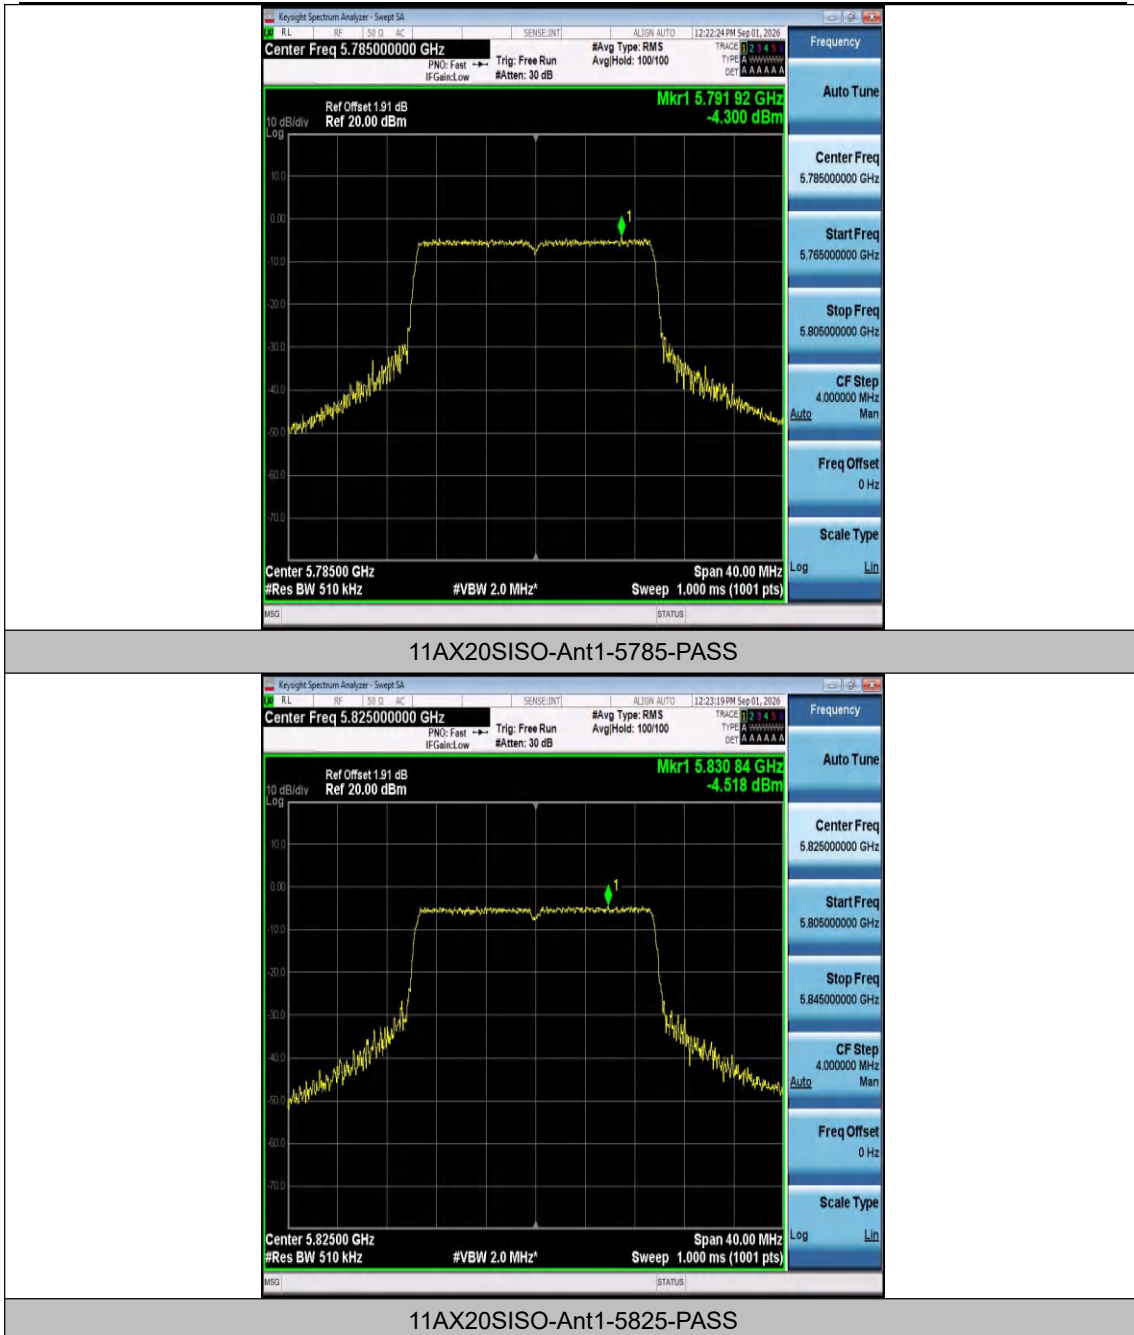

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

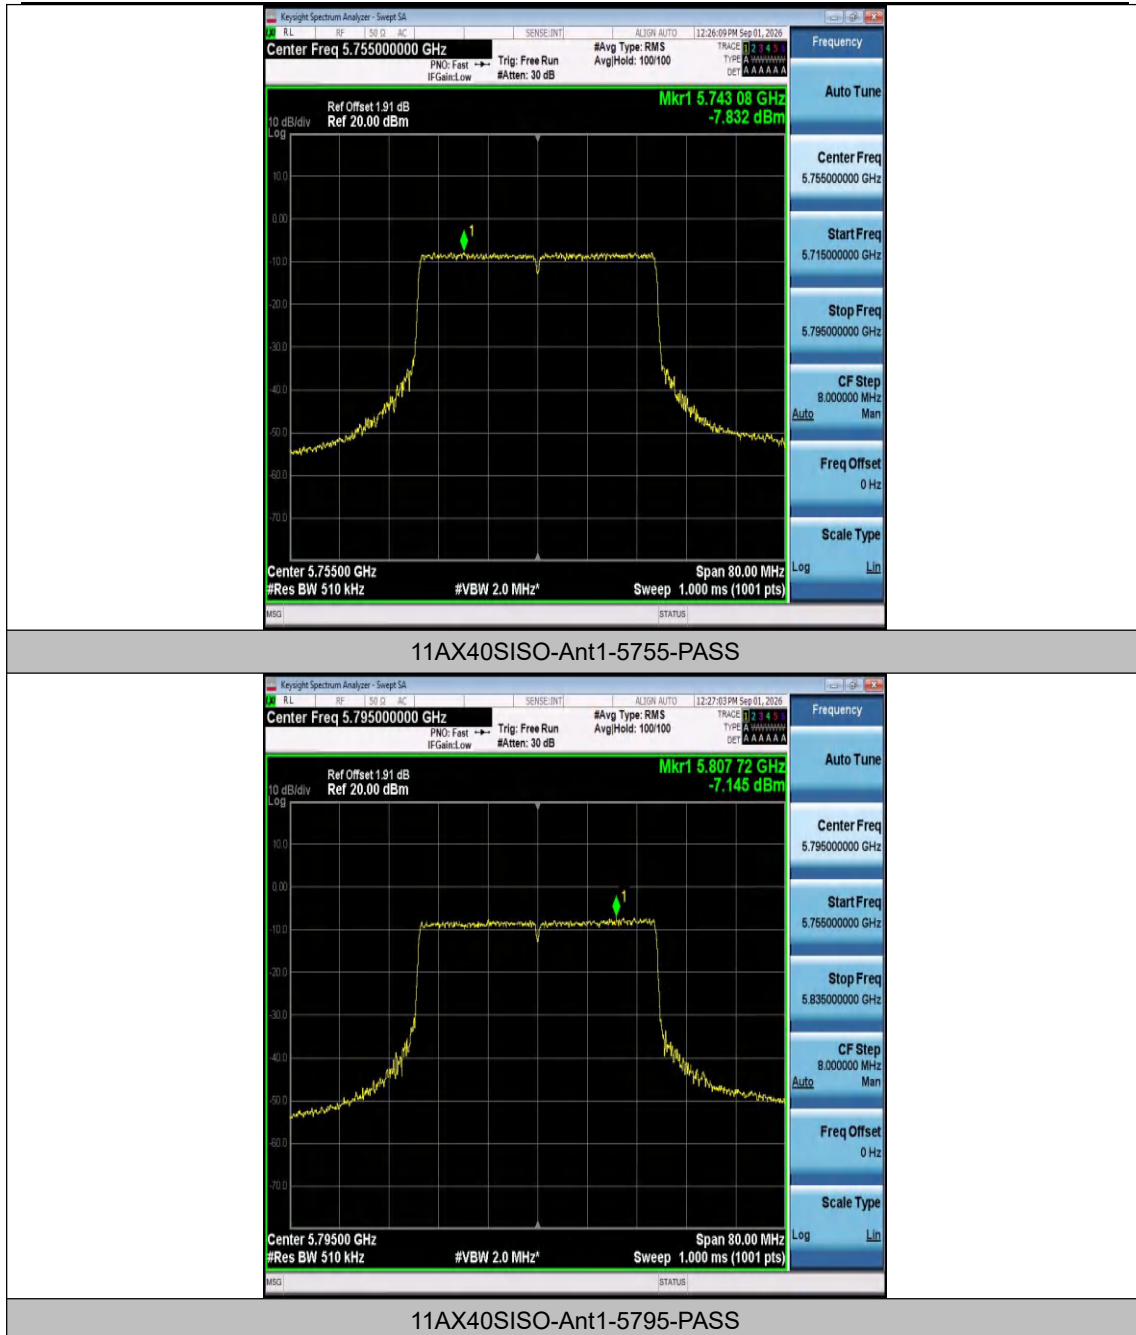

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-42.35	≤-27	PASS
11A	Ant1	High	5240	-42.67	≤-27	PASS
11N20SISO	Ant1	Low	5180	-41.87	≤-27	PASS
11N20SISO	Ant1	High	5240	-38.21	≤-27	PASS
11N40SISO	Ant1	Low	5190	-40.47	≤-27	PASS
11N40SISO	Ant1	High	5230	-38.04	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-40.56	≤-27	PASS
11AC20SISO	Ant1	High	5240	-43.88	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-41.11	≤-27	PASS
11AC40SISO	Ant1	High	5230	-43.87	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-40.34	≤-27	PASS
11AX20SISO	Ant1	High	5240	-43.41	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-36.66	≤-27	PASS
11AX40SISO	Ant1	High	5230	-43.01	≤-27	PASS

Note:

1. The margin plus the antenna gain also meets the limit.
2. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Result B4


Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-33.83	≤17.39	PASS
11A	Ant1	Low	5745	5700~5720	-36.29	≤11.57	PASS
11A	Ant1	Low	5745	5650~5700	-44.09	≤-26.79	PASS
11A	Ant1	Low	5745	5645~5650	-43.83	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-38.38	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-33.13	≤15.28	PASS
11A	Ant1	High	5825	5875~5925	-44.54	≤-26.81	PASS
11A	Ant1	High	5825	5925~5935	-44.1	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-36.95	≤16.08	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-42.03	≤10.93	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-44.35	≤-26.02	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-43.92	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-39.56	≤17.26	PASS
11N20SISO	Ant1	High	5825	5855~5875	-40.8	≤10.74	PASS
11N20SISO	Ant1	High	5825	5875~5925	-45.12	≤-26.71	PASS
11N20SISO	Ant1	High	5825	5925~5935	-43.99	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-32.48	≤17.28	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-32.85	≤15.16	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-44.97	≤-26.60	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-43.66	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-42.51	≤16.03	PASS
11N40SISO	Ant1	High	5795	5855~5875	-43.73	≤10.16	PASS
11N40SISO	Ant1	High	5795	5875~5925	-43.91	≤-26.95	PASS
11N40SISO	Ant1	High	5795	5925~5935	-43.7	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-23.9	≤26.04	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-27.68	≤15.08	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-43.6	≤-24.83	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-44.2	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-23.32	≤24.34	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-30.27	≤14.22	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-44.64	≤-26.91	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-43.15	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-34.63	≤16.04	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-30.27	≤13.99	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-45.52	≤-26.90	PASS
11AC40SISO	Ant1	Low	5755	5645~5650	-44.3	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-41.53	≤15.66	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-33.96	≤13.94	PASS


11AC40SISO	Ant1	High	5795	5875~5925	-43.61	≤-25.49	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-43.96	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-30.14	≤16.60	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-29.52	≤12.37	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-44.85	≤-26.96	PASS
11AX20SISO	Ant1	Low	5745	5645~5650	-44.57	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-34.12	≤20.34	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-32.71	≤10.25	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-43.94	≤-25.91	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-43	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-26.62	≤19.43	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-28.12	≤13.05	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-43.92	≤-25.61	PASS
11AX40SISO	Ant1	Low	5755	5645~5650	-44.05	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-31.43	≤15.66	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-30.24	≤15.56	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-41.46	≤-25.98	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-43.66	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

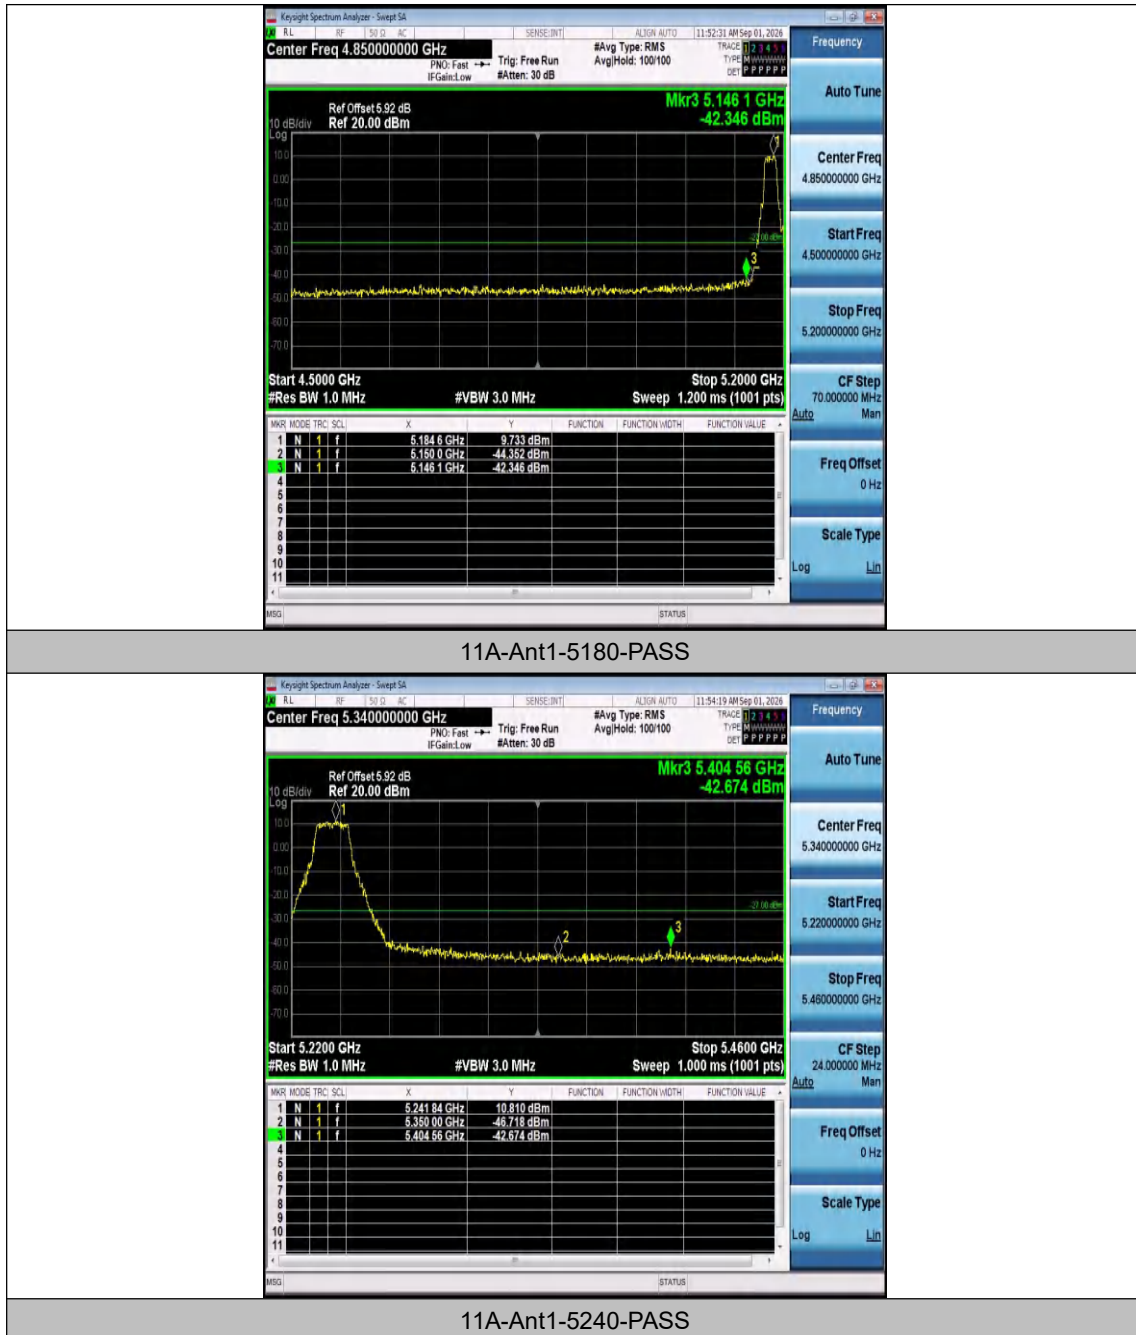


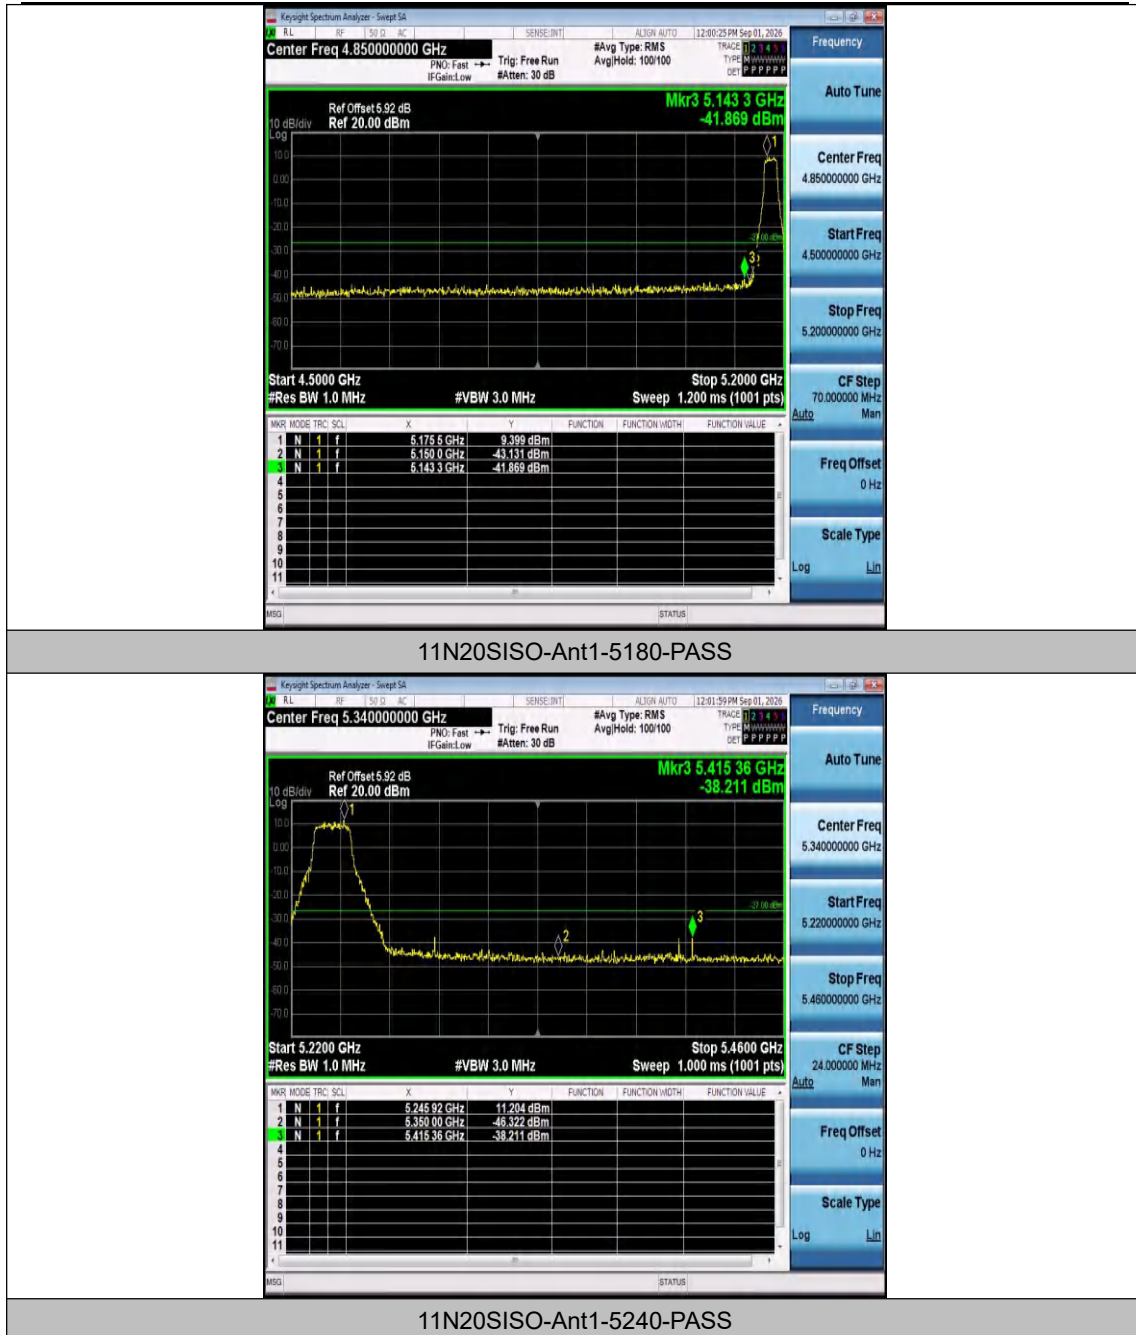

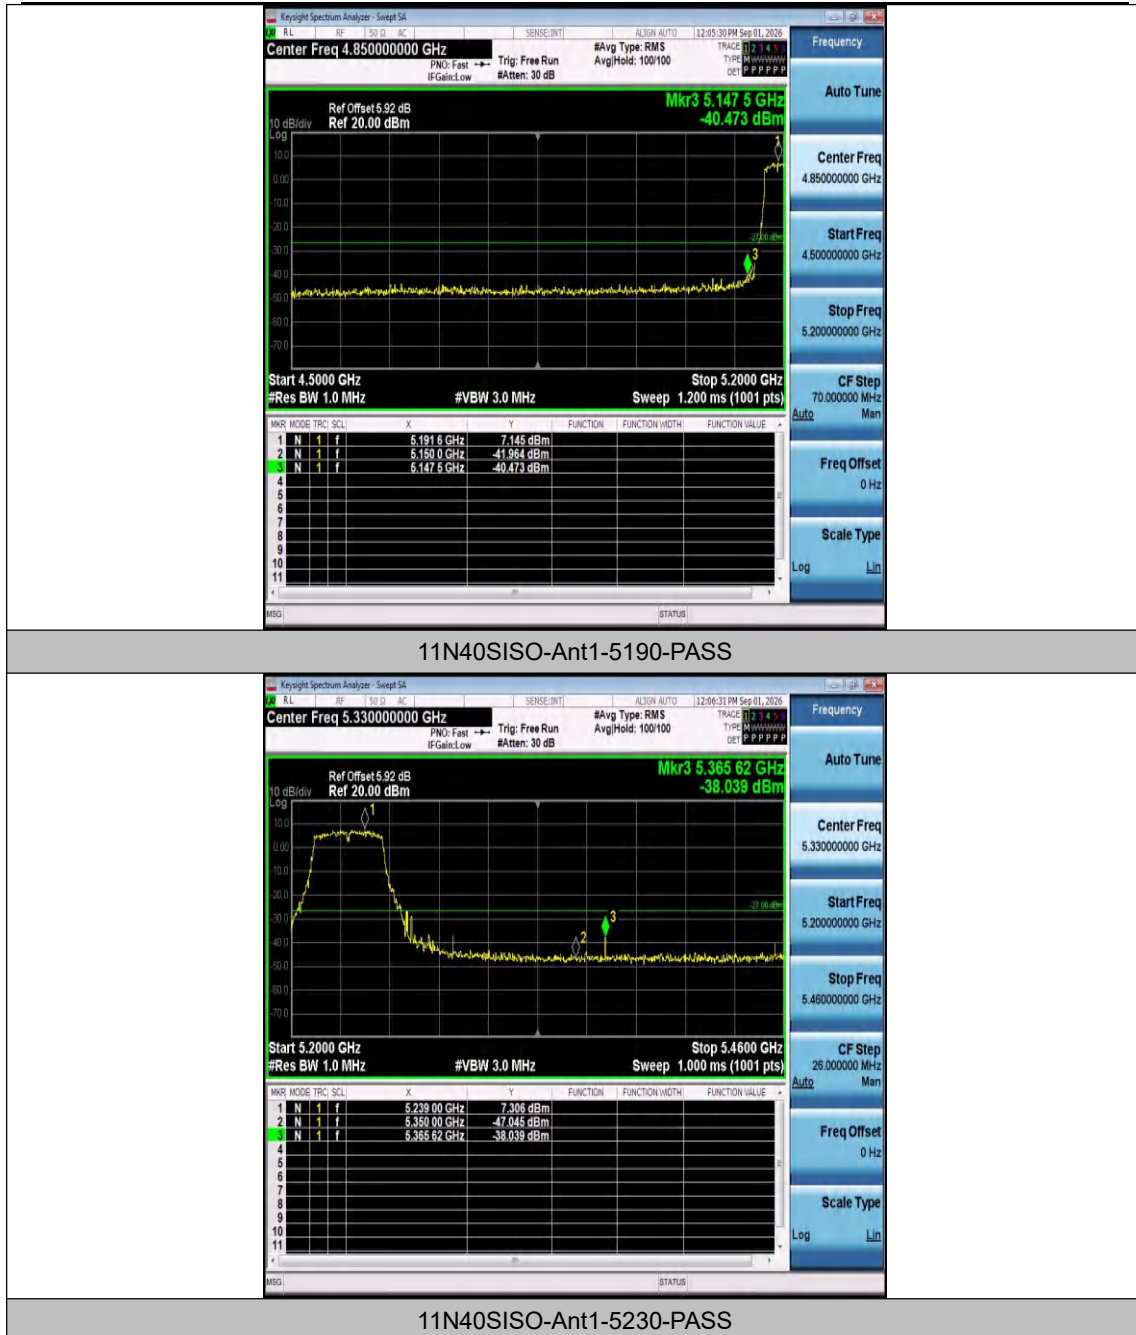

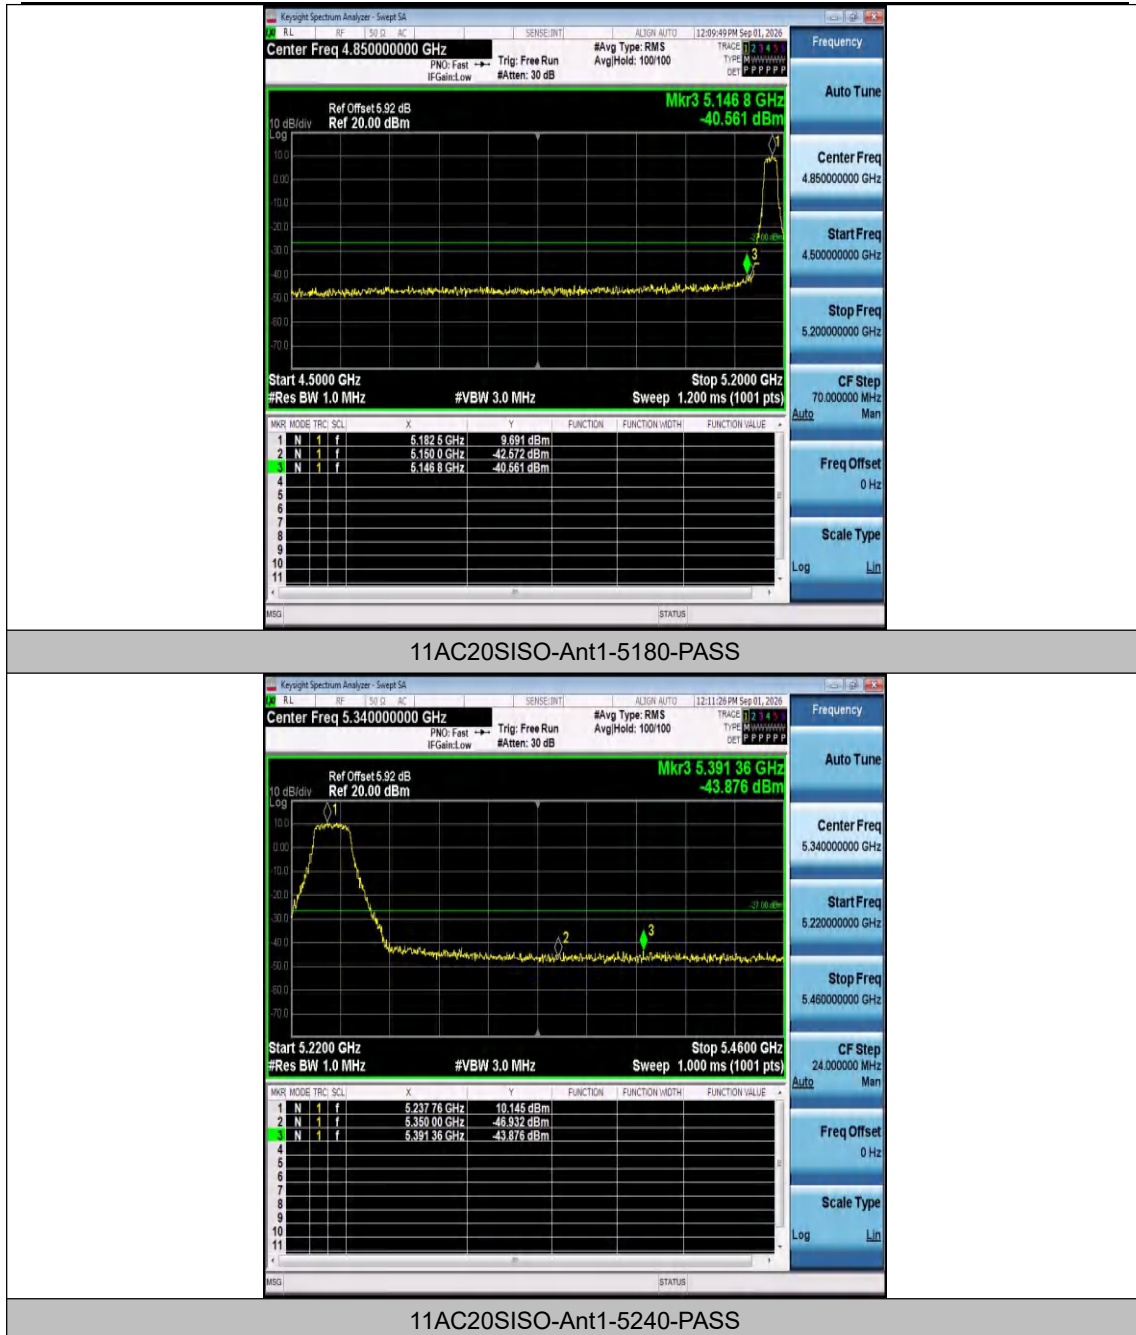

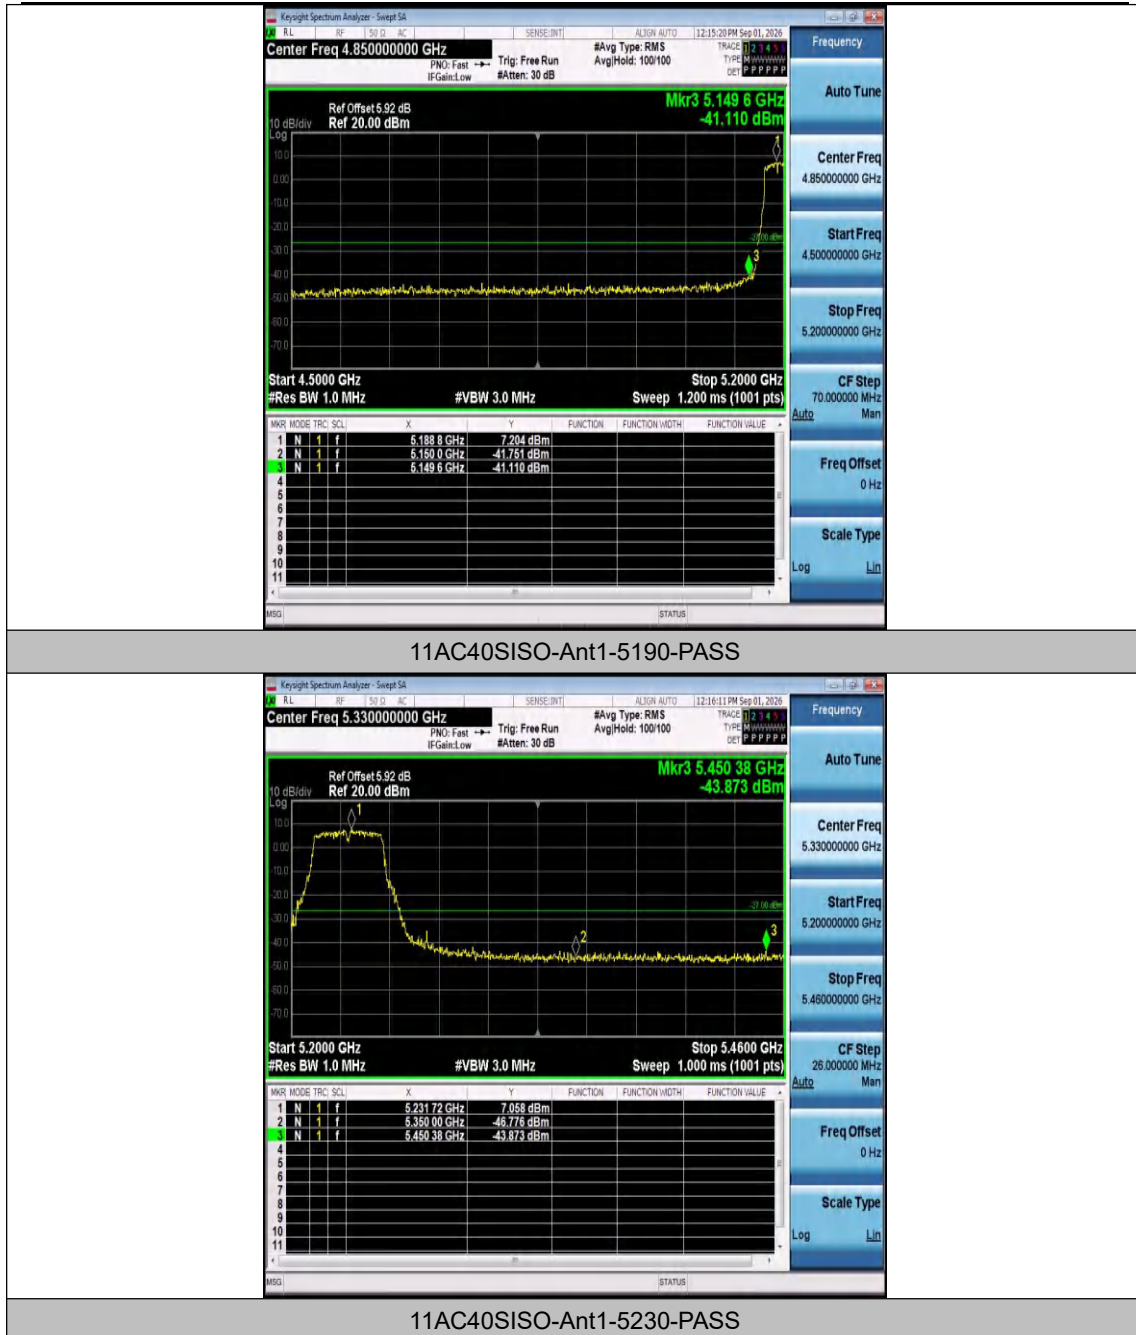


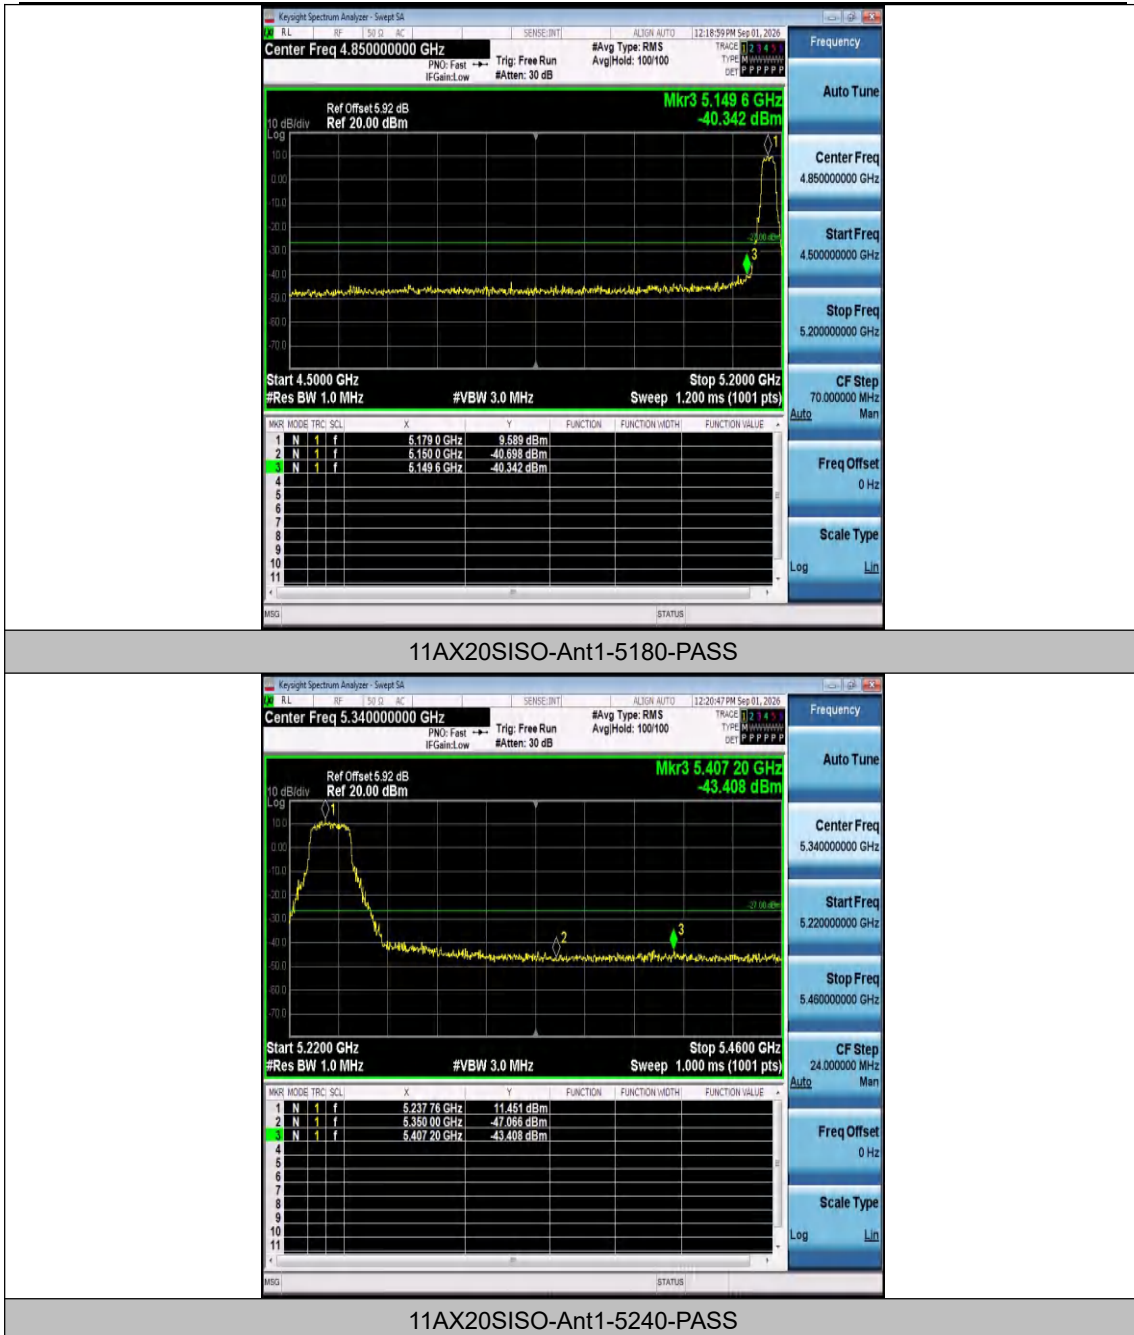

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

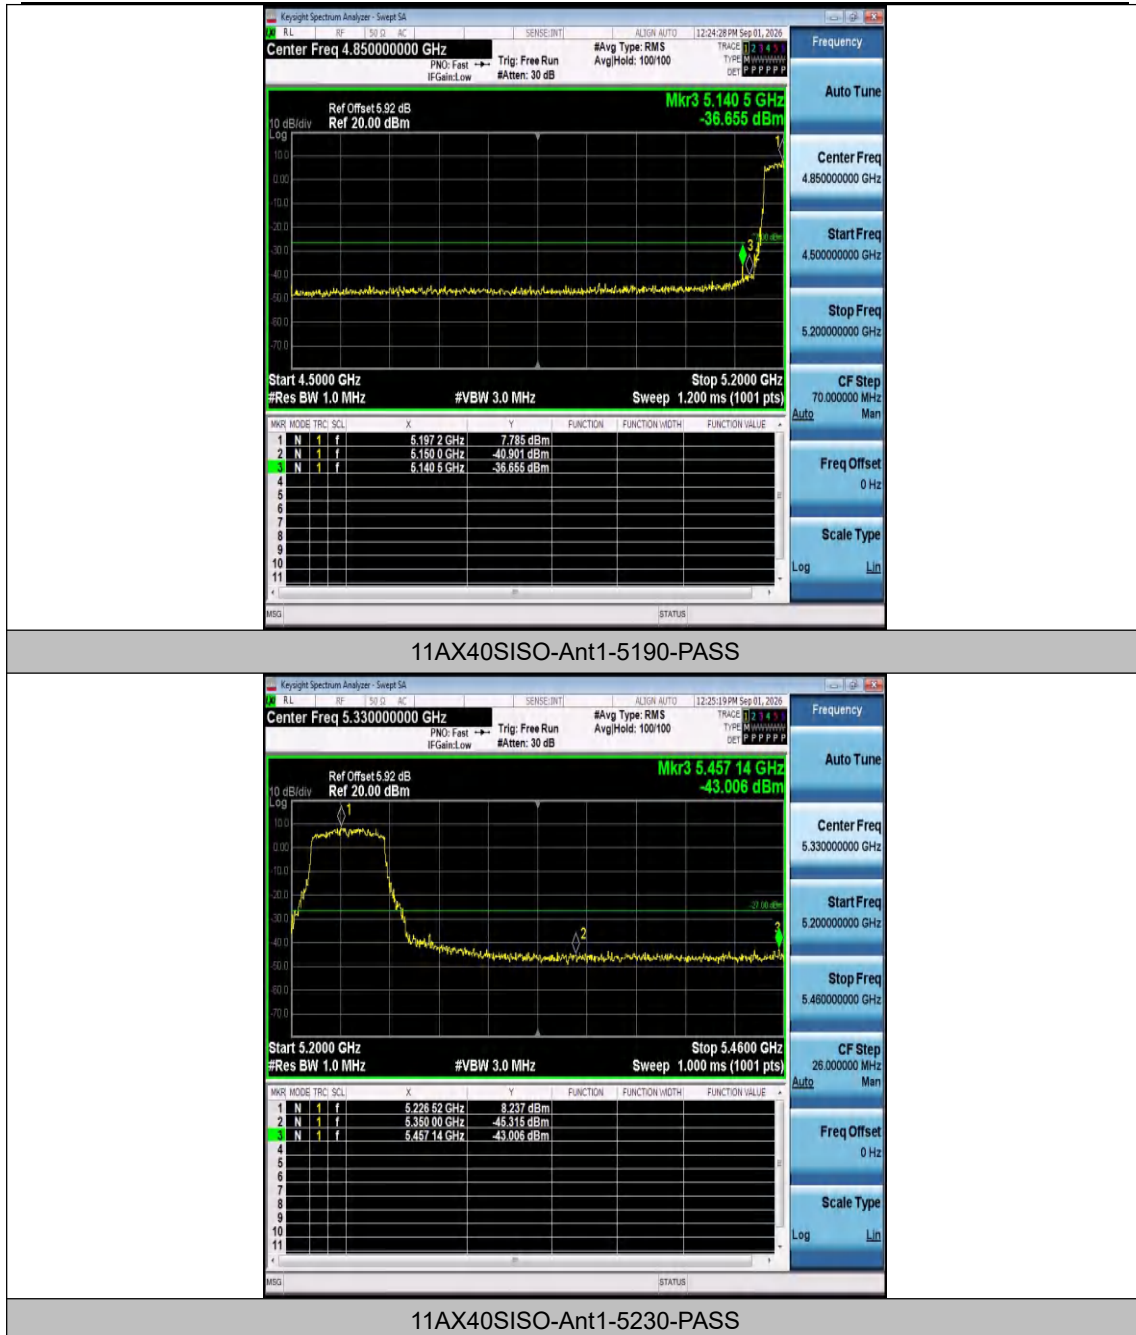

Test Graphs B4




Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




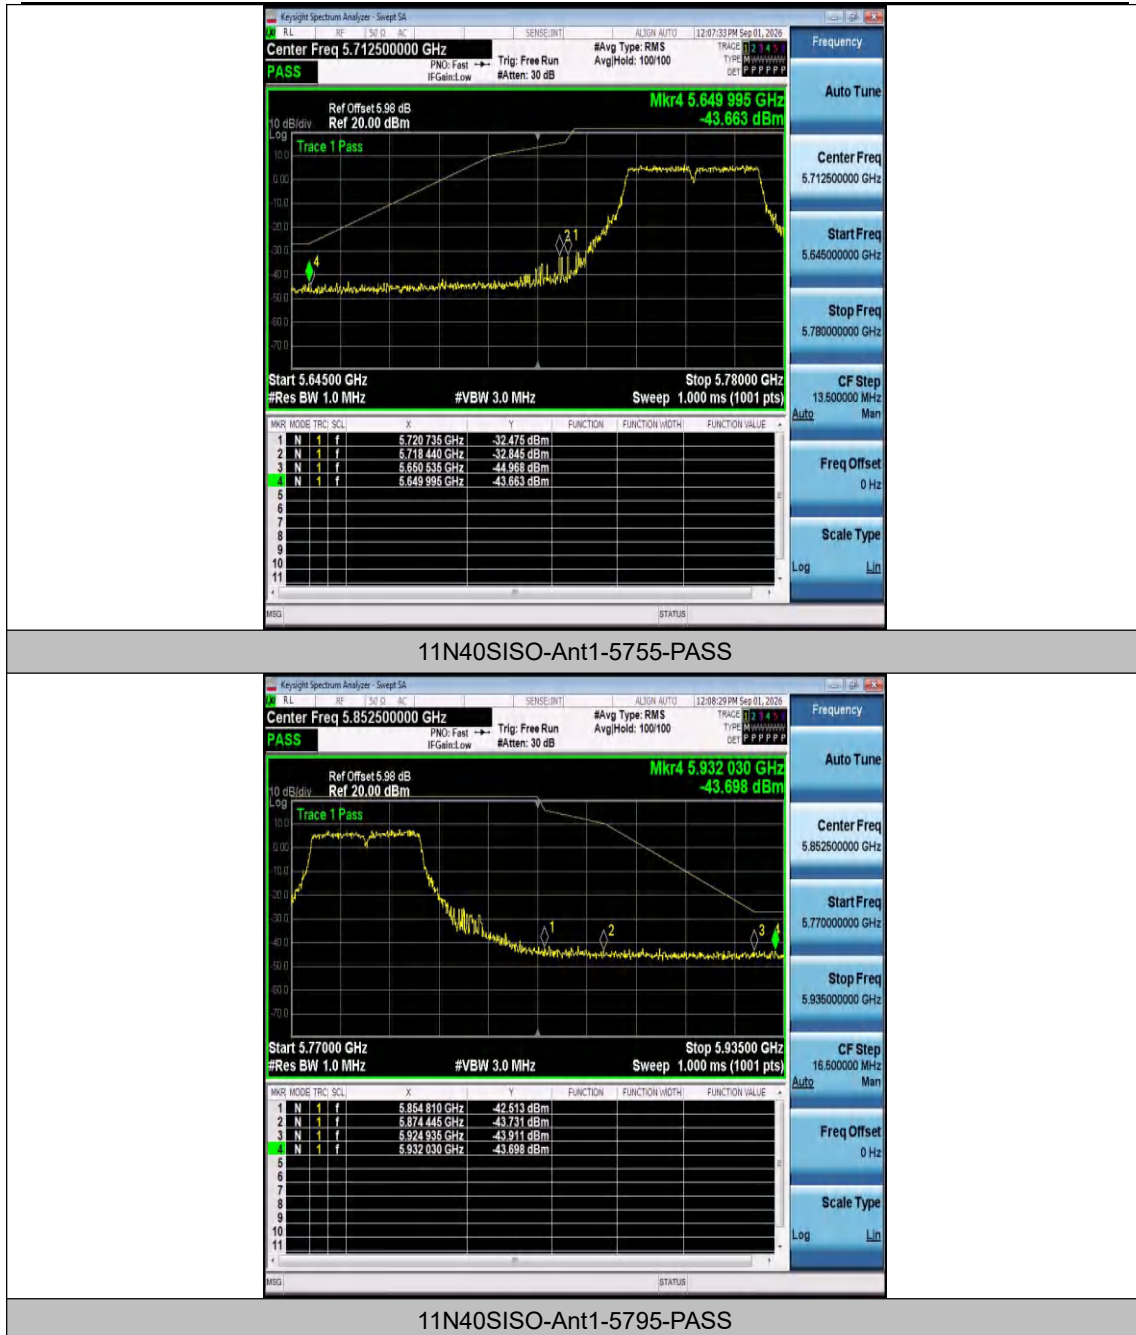



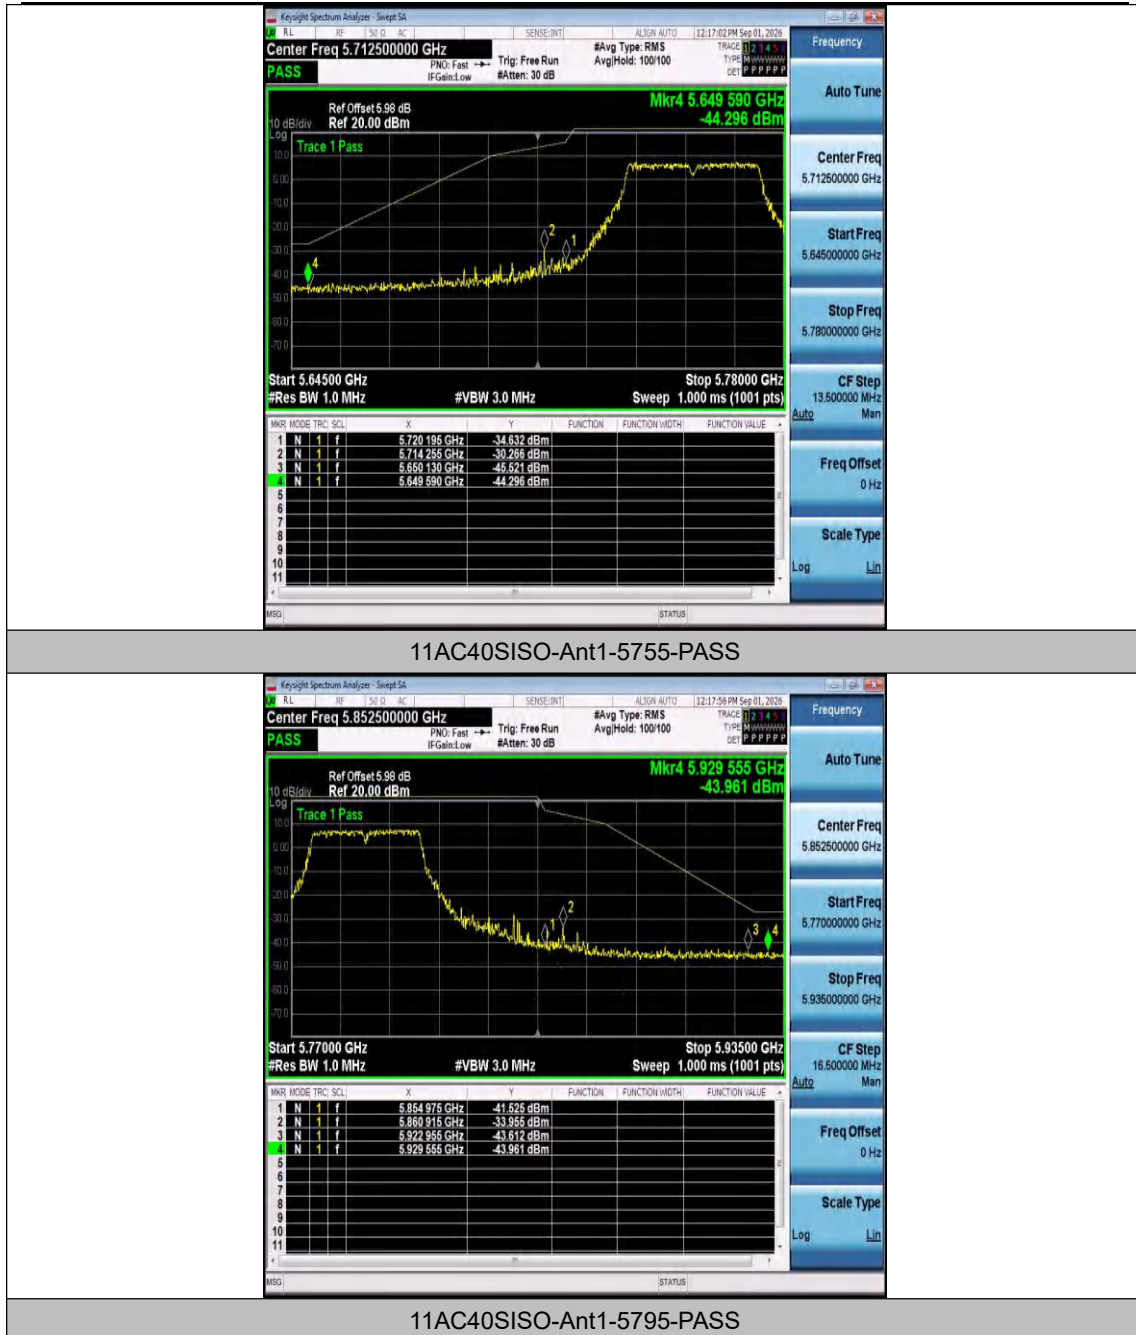



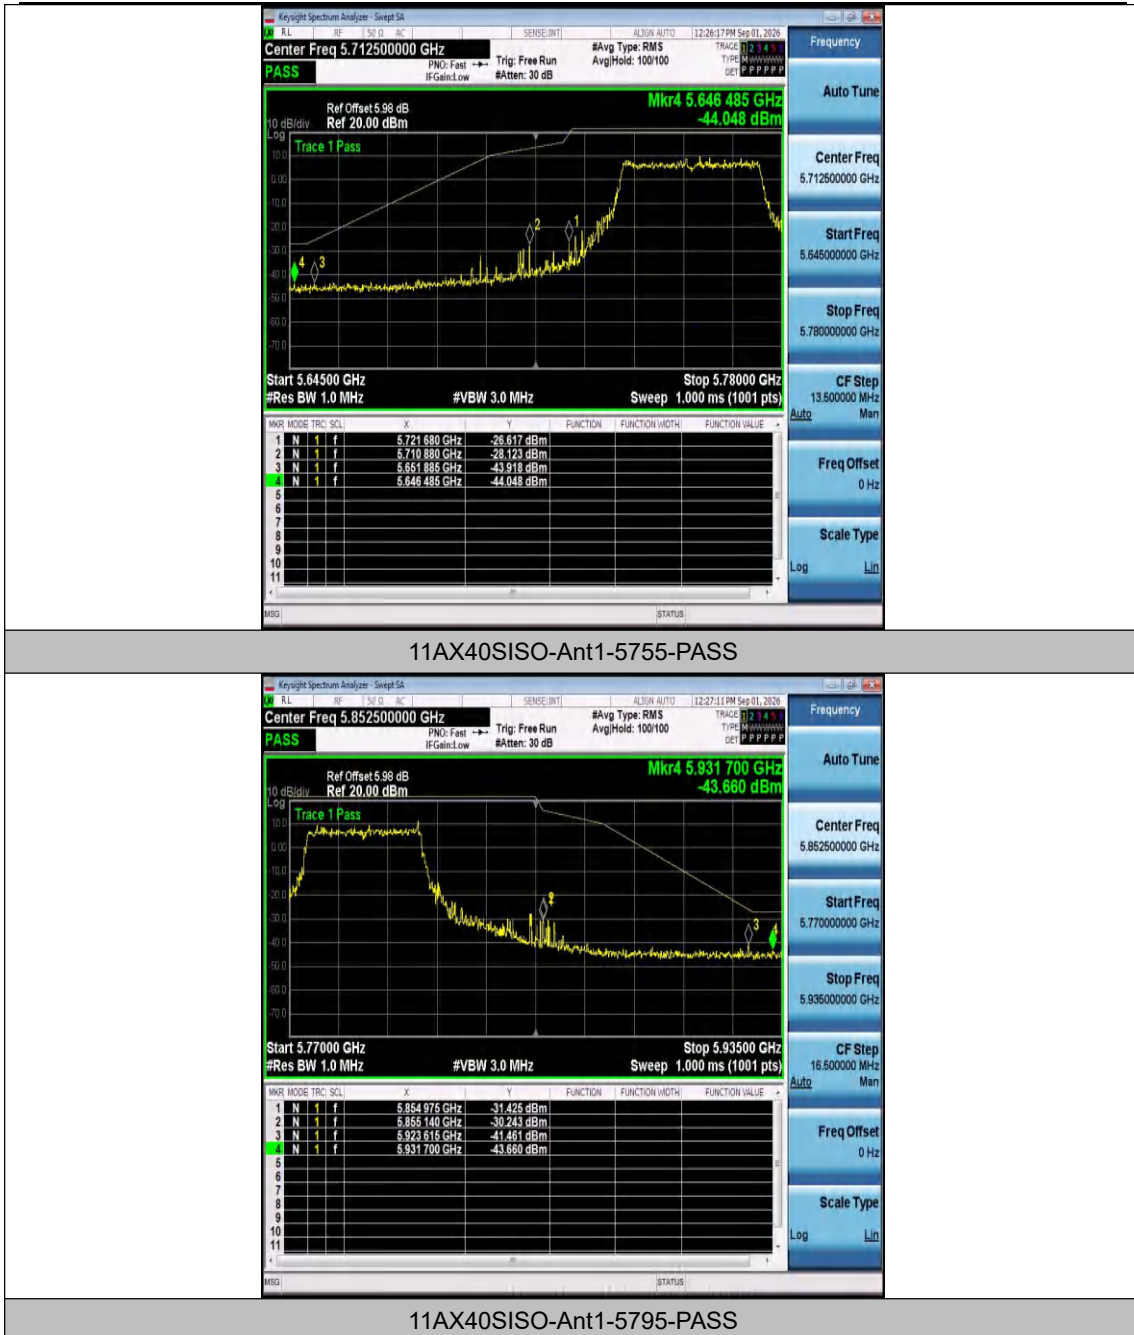

---END---