




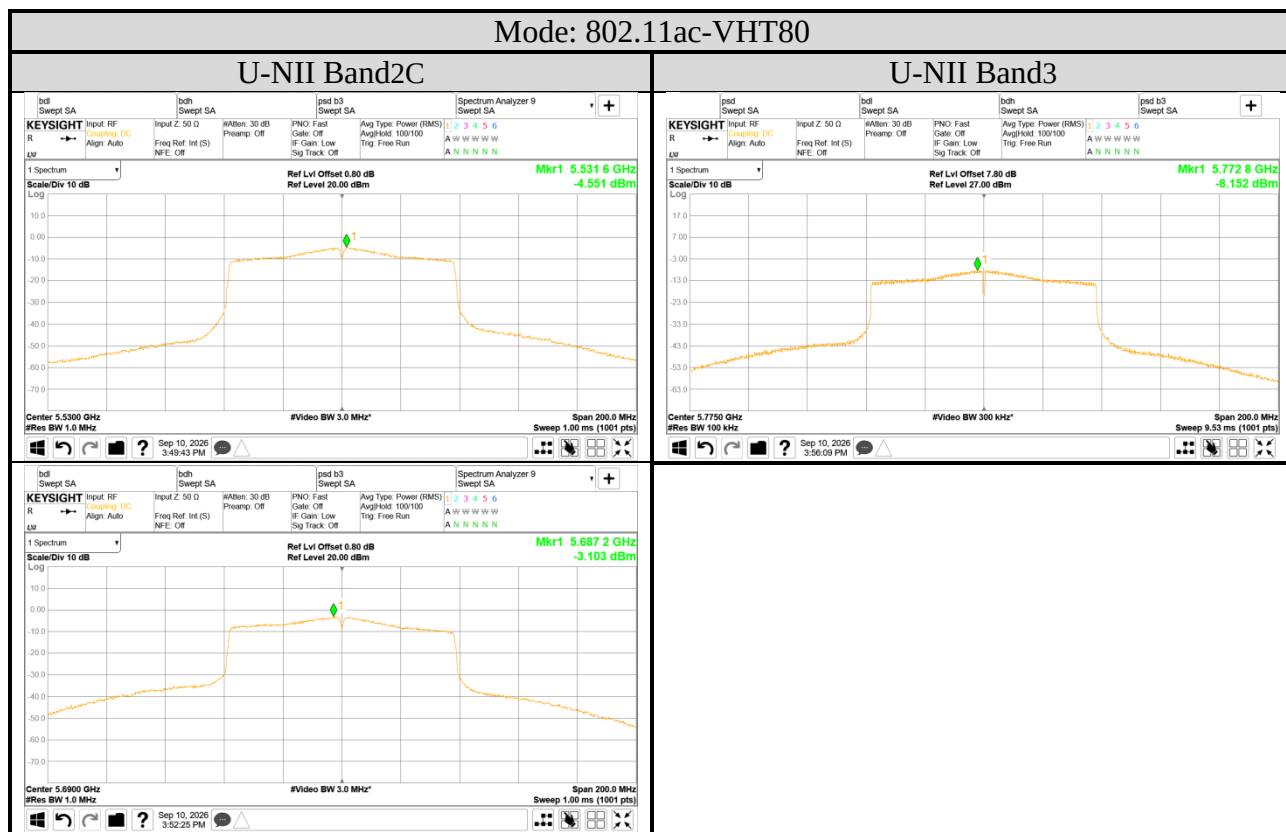


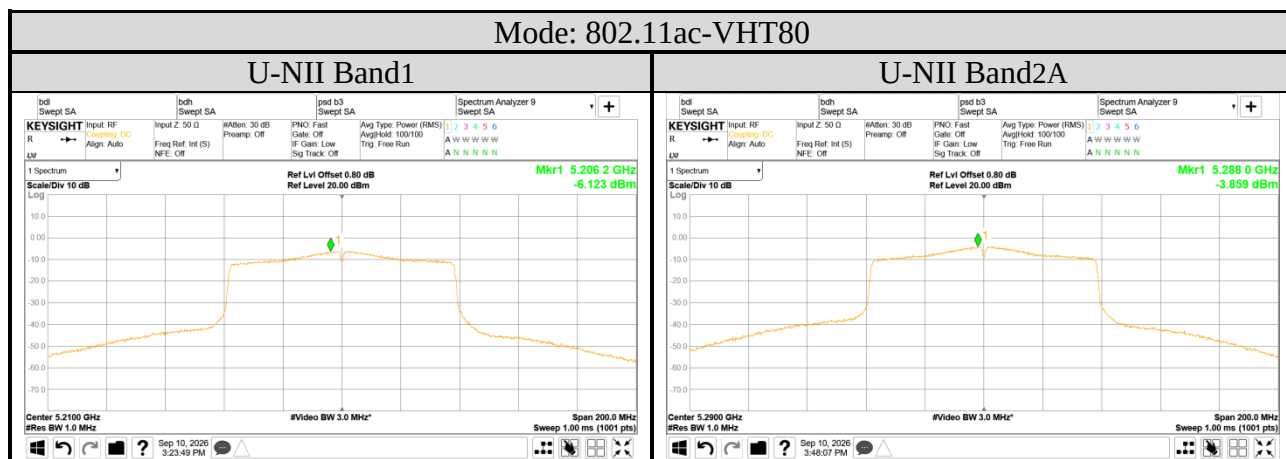



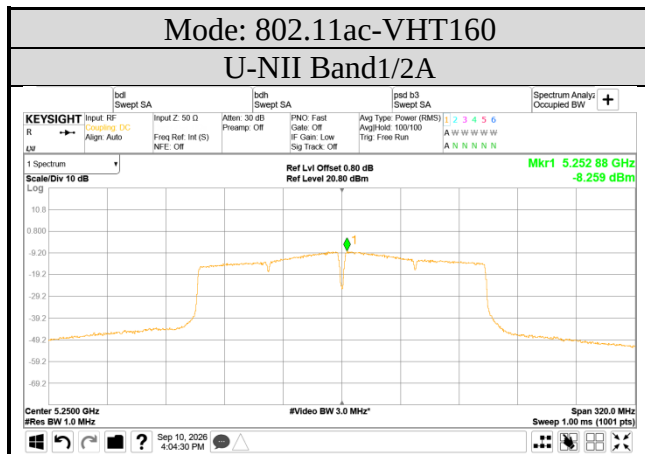


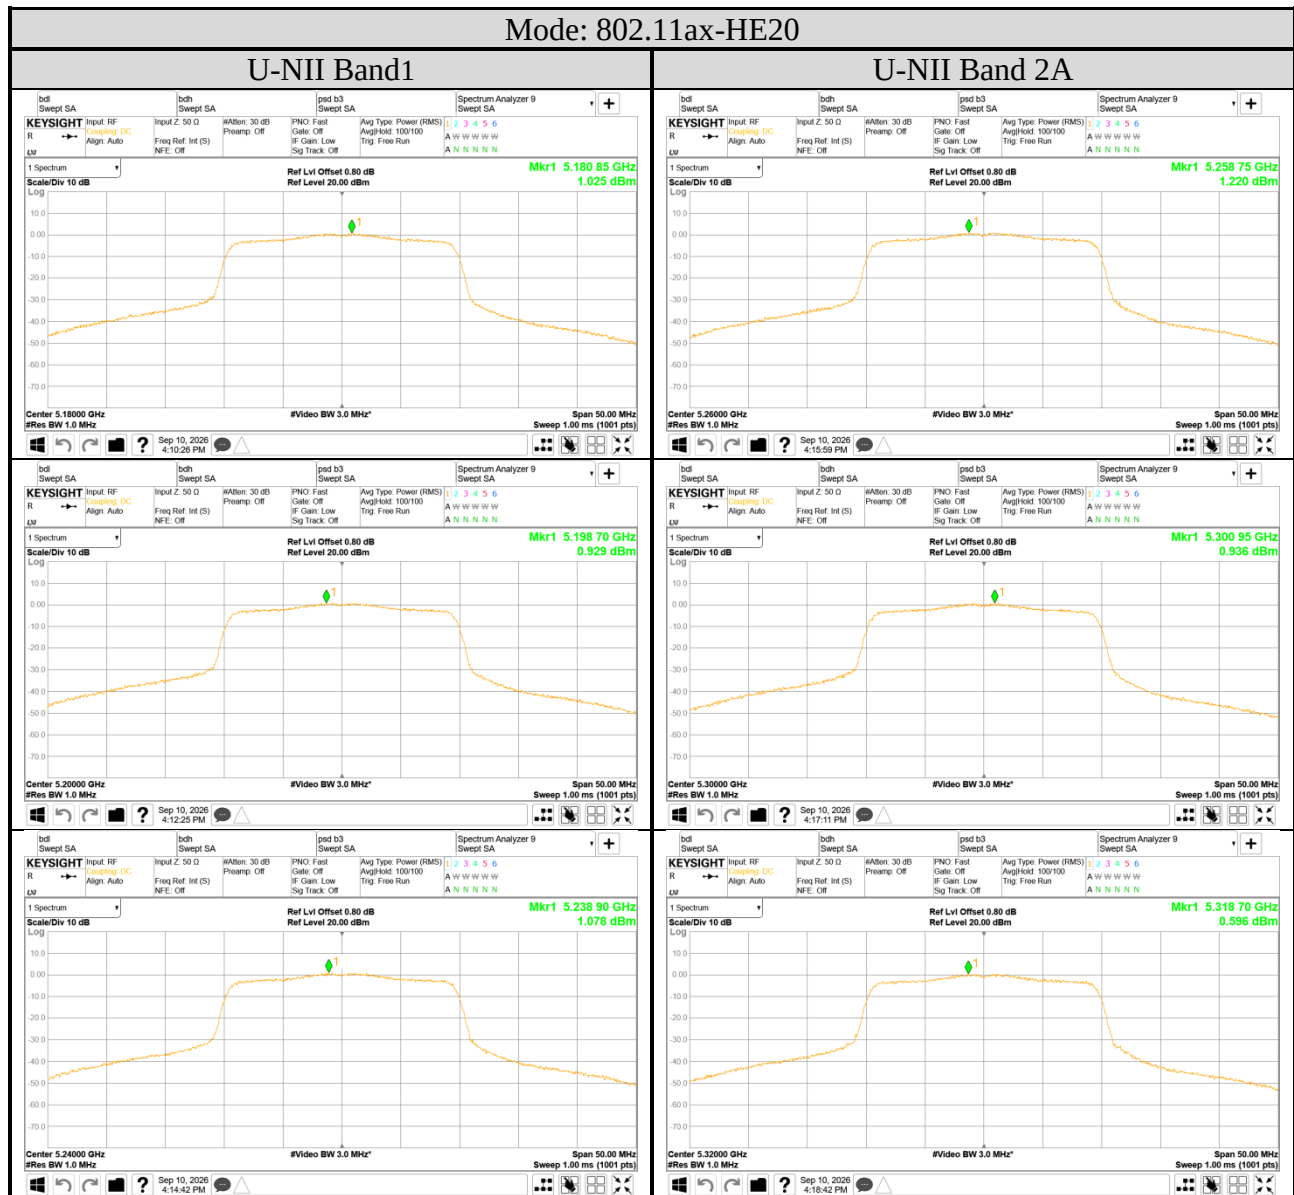


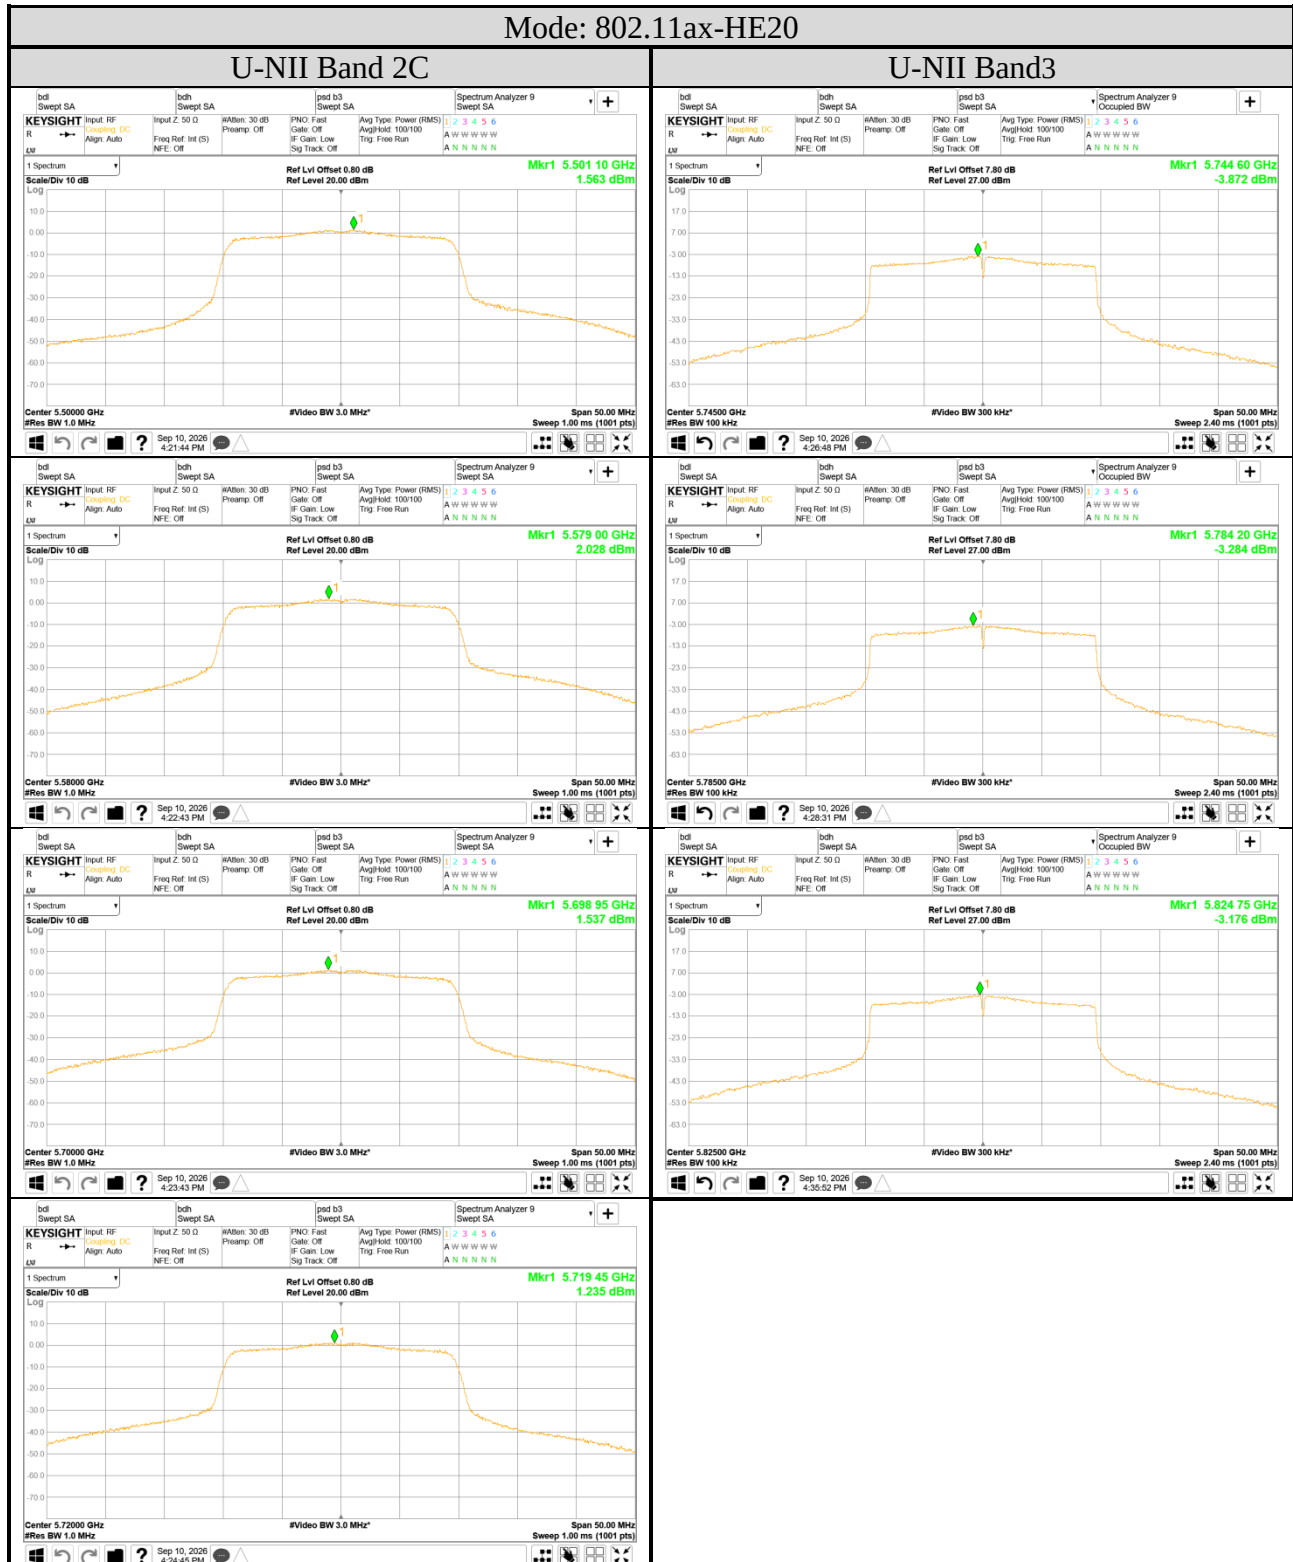

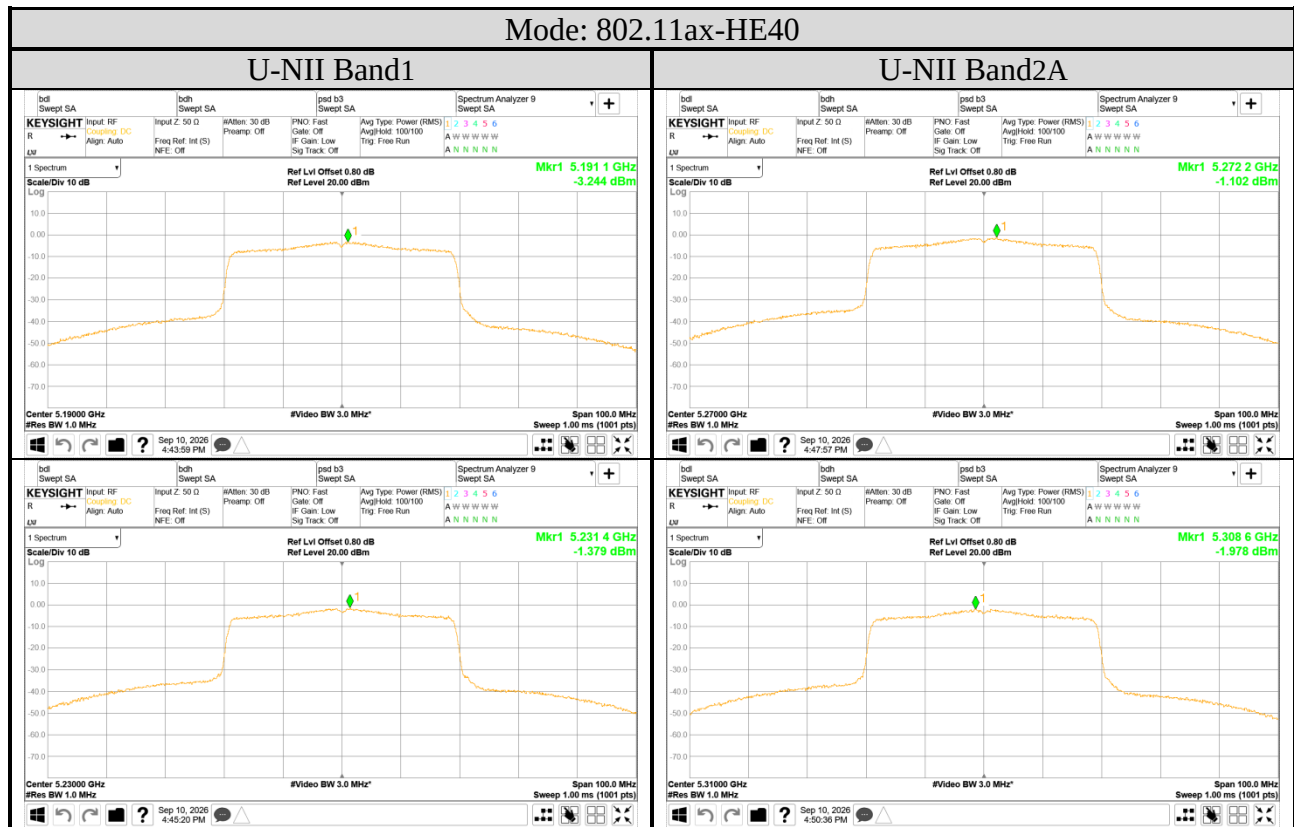

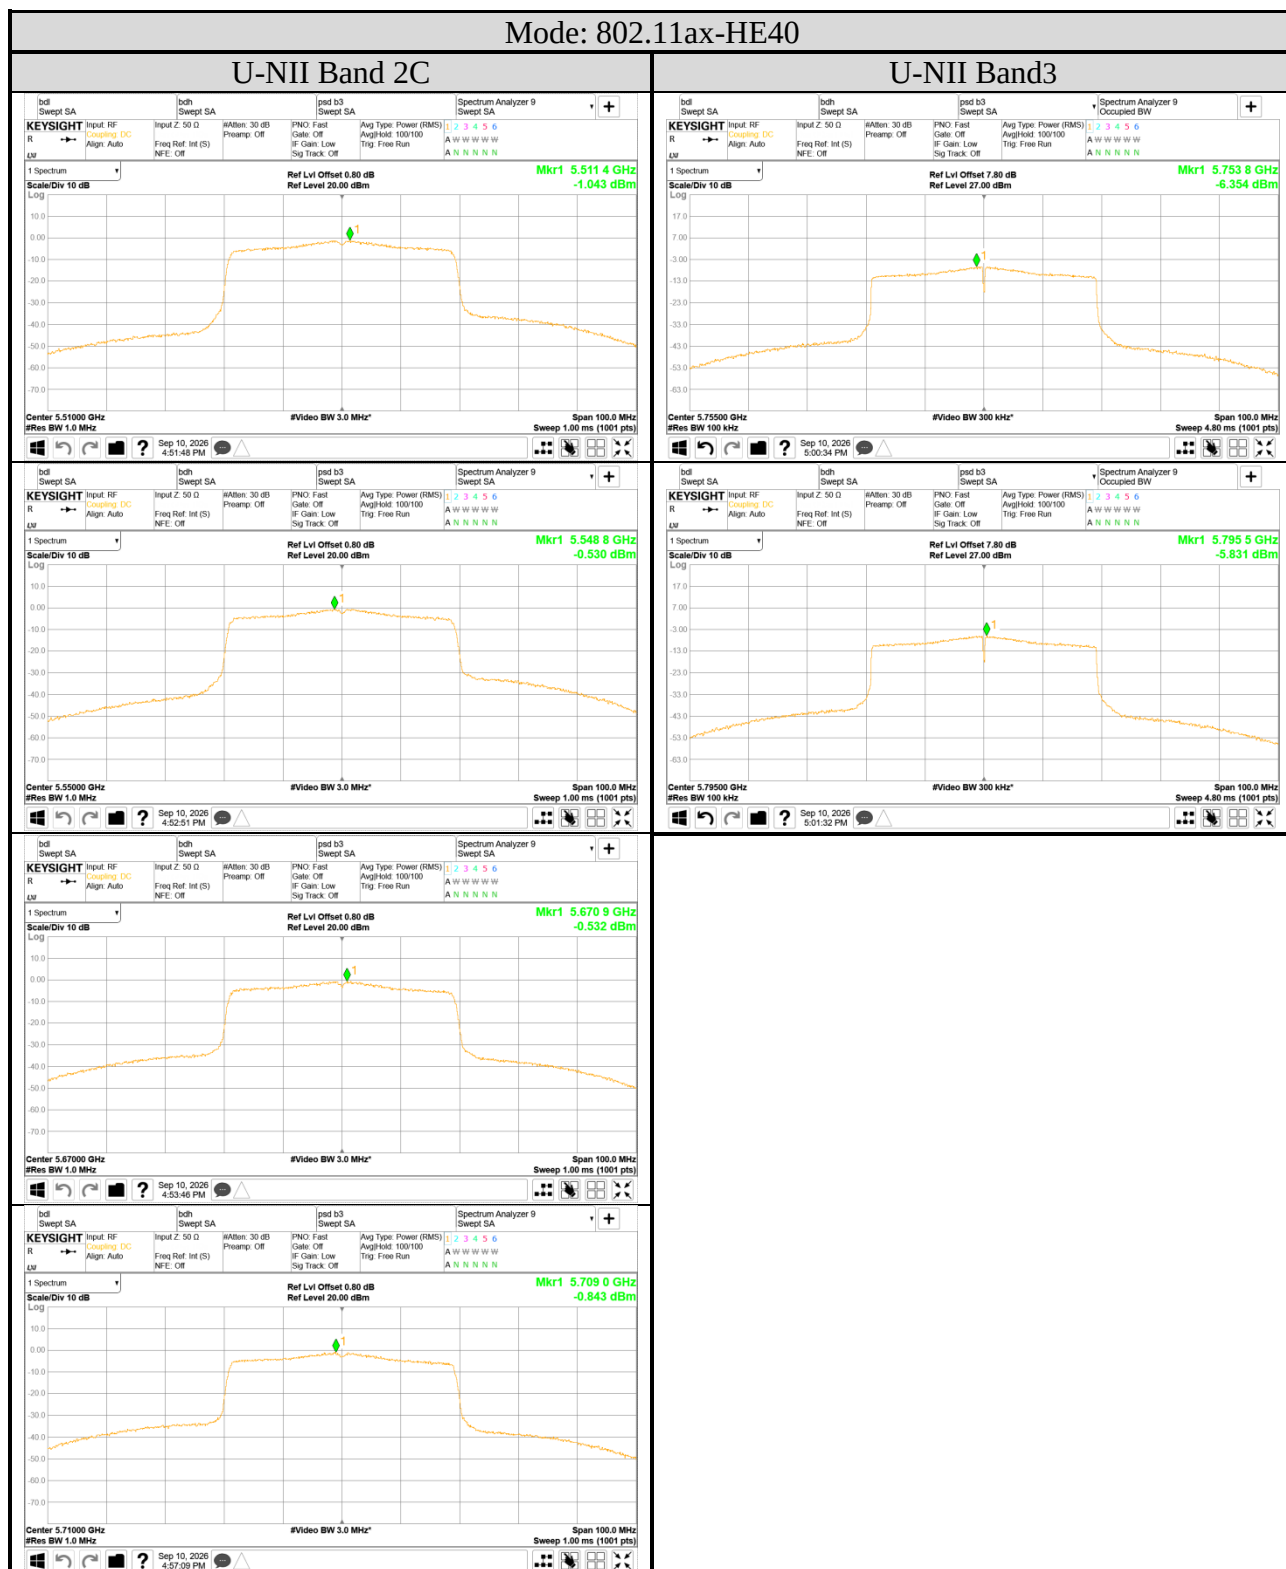


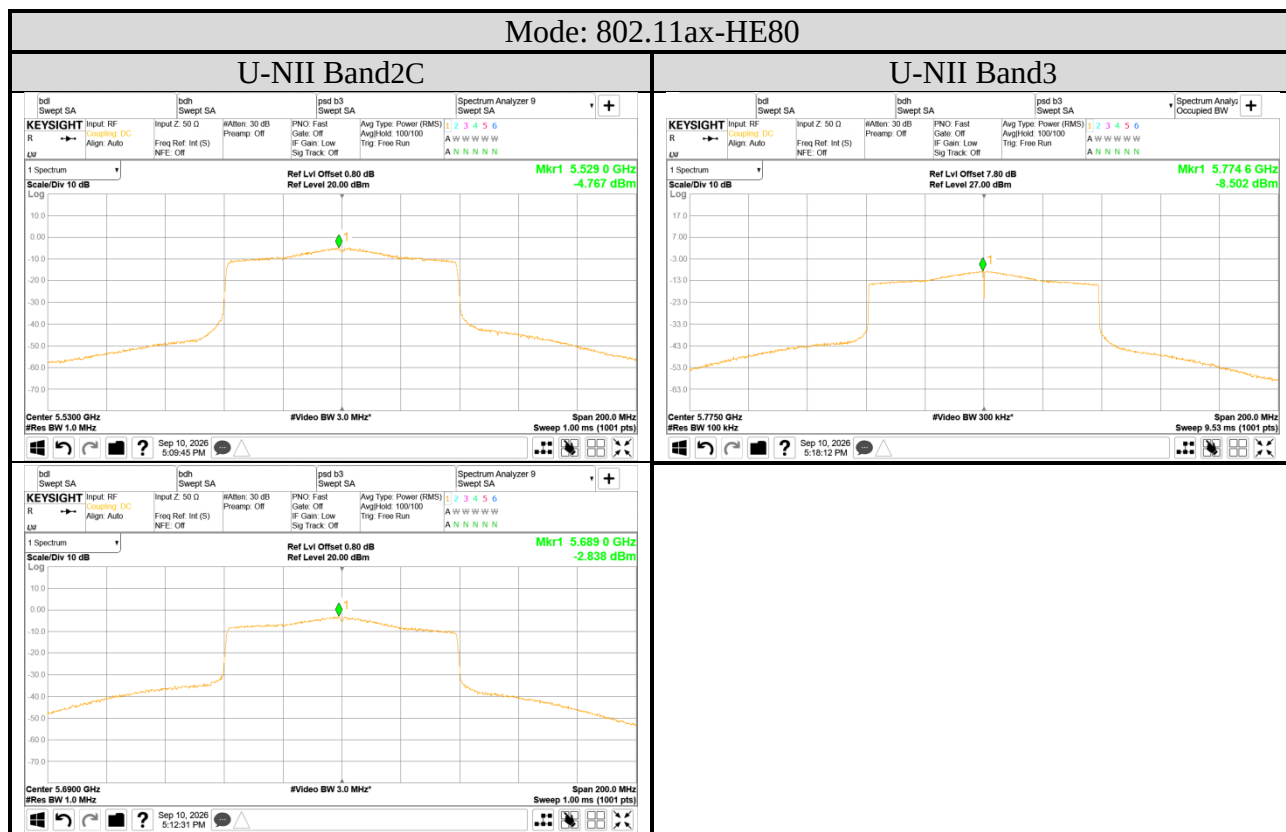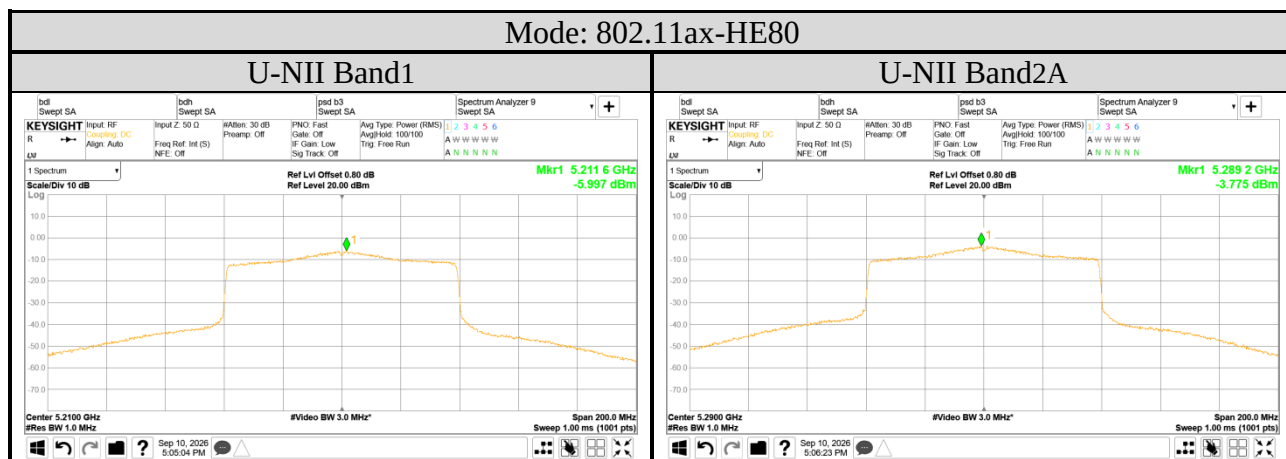

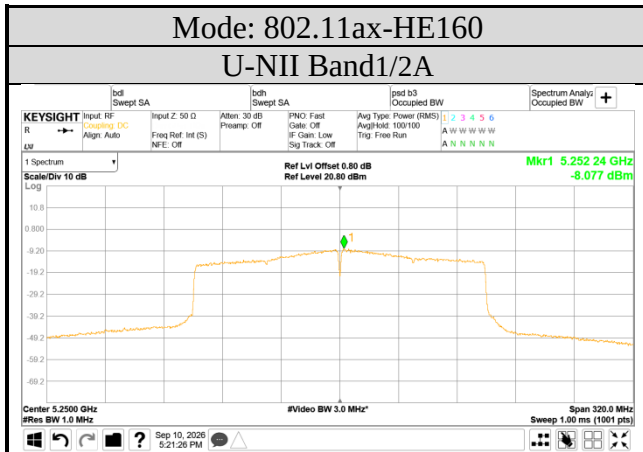


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

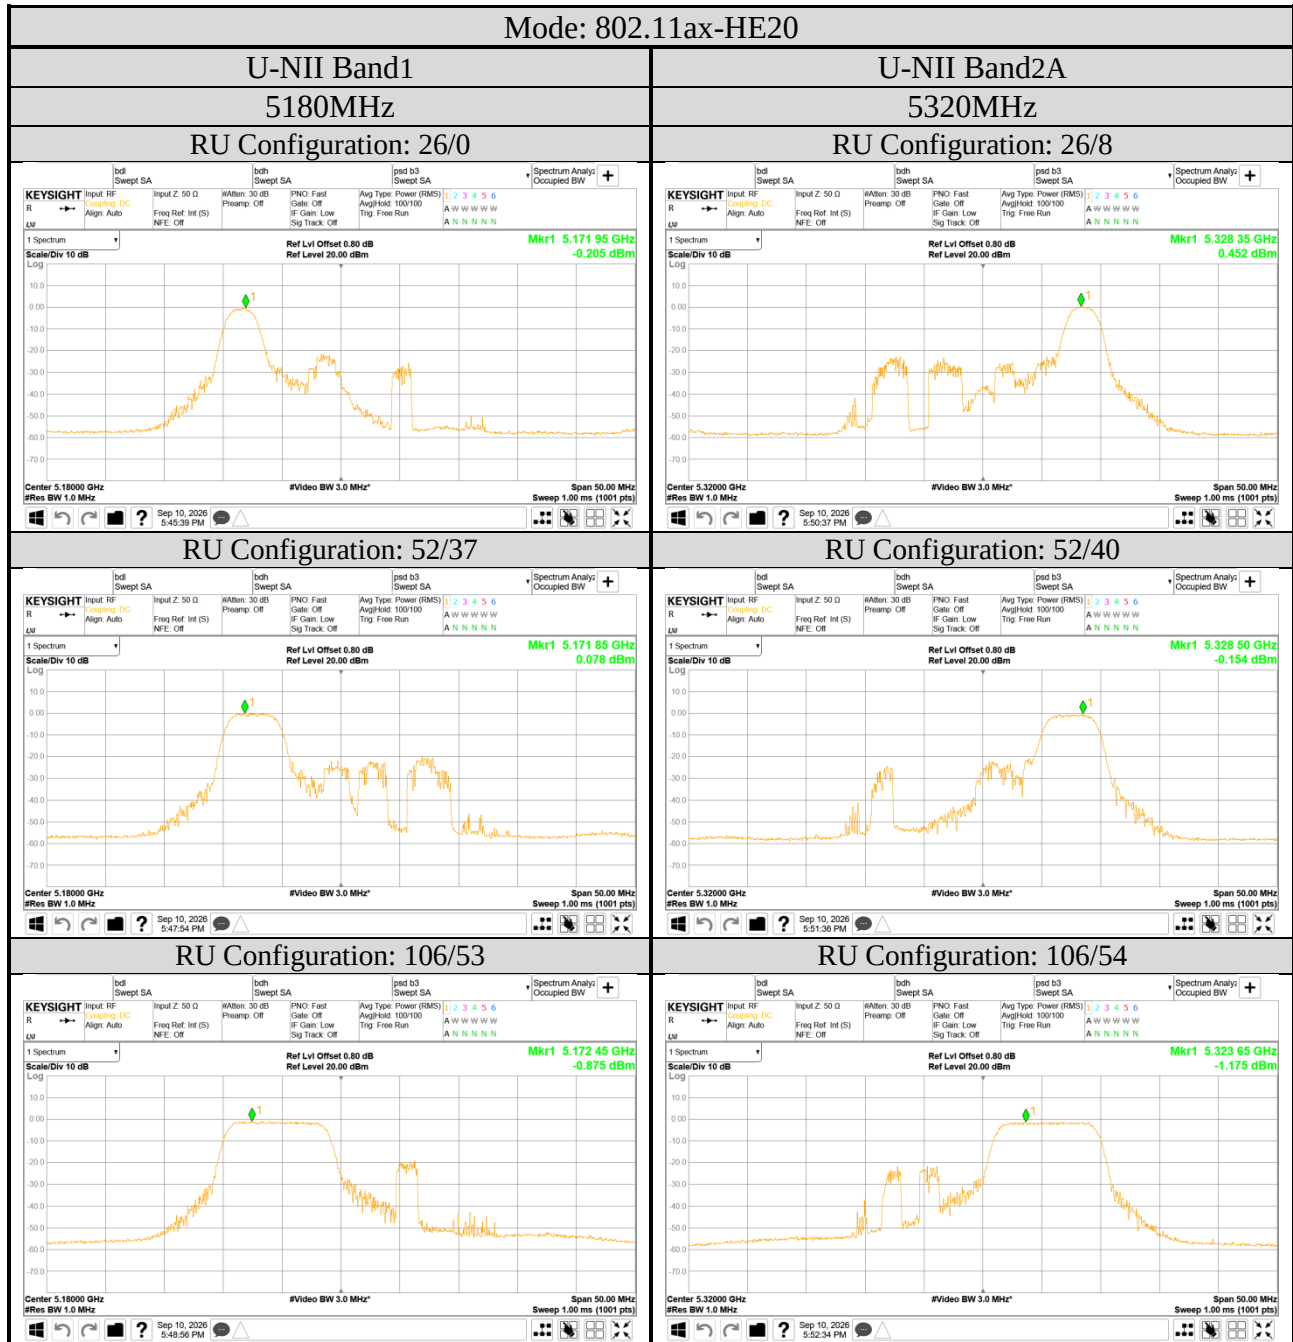


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

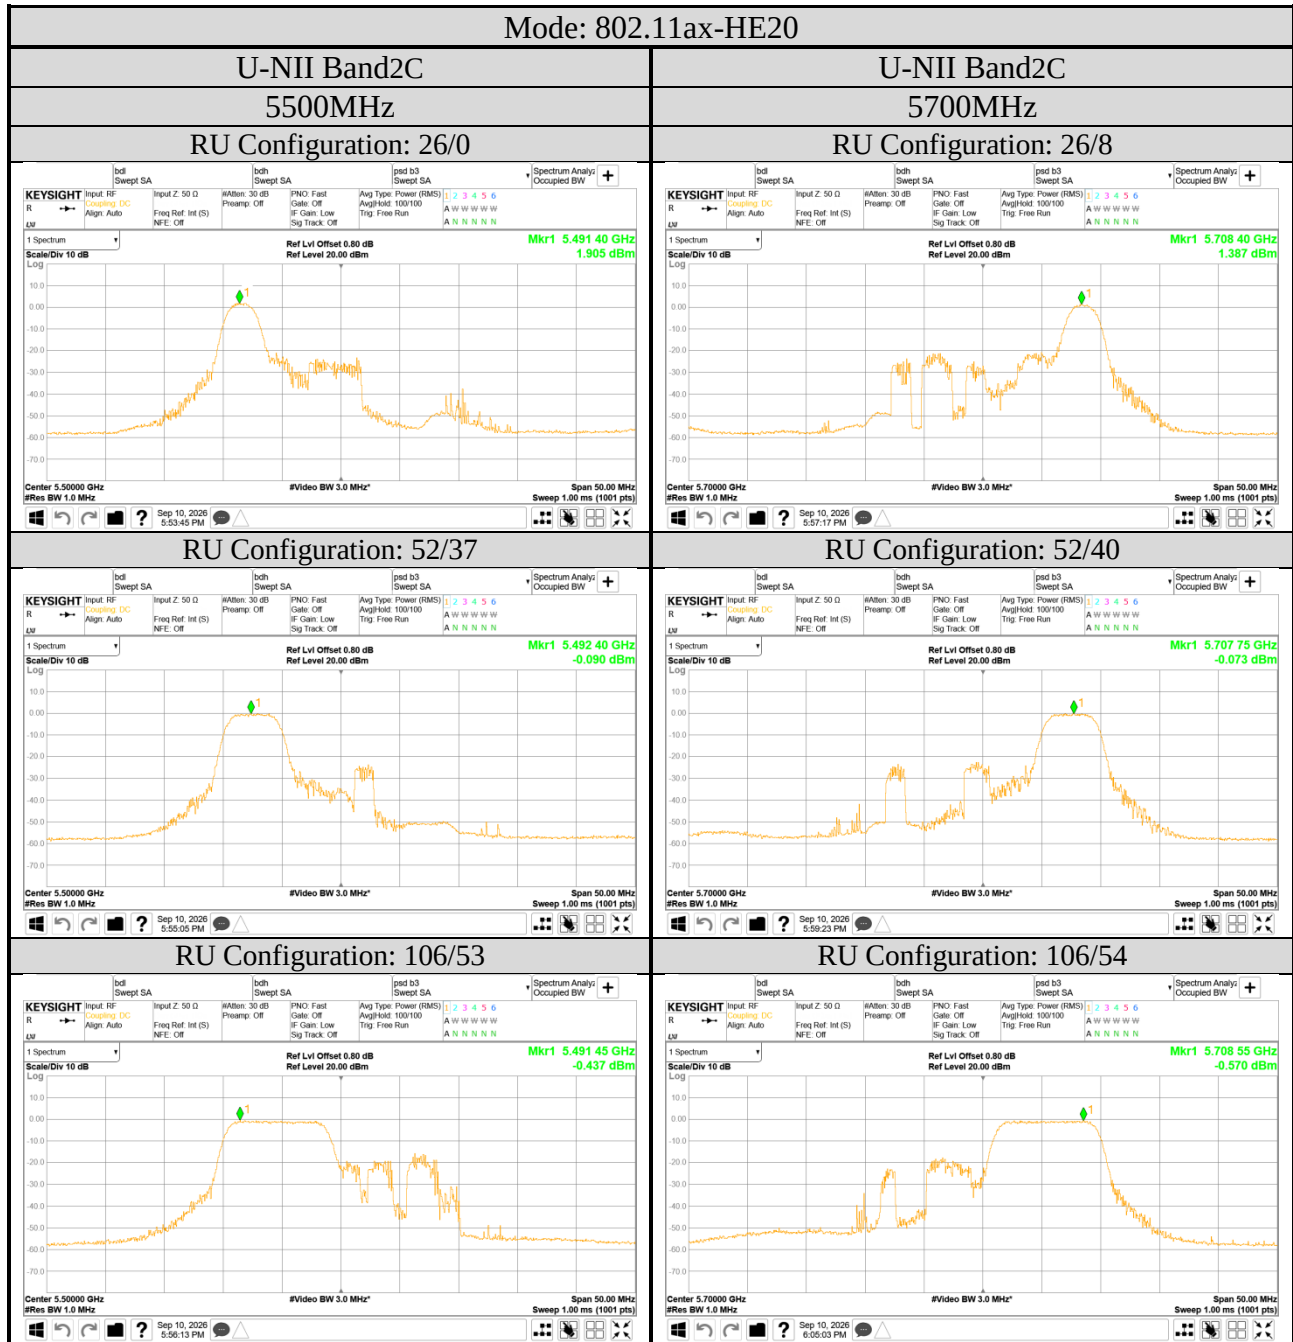

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

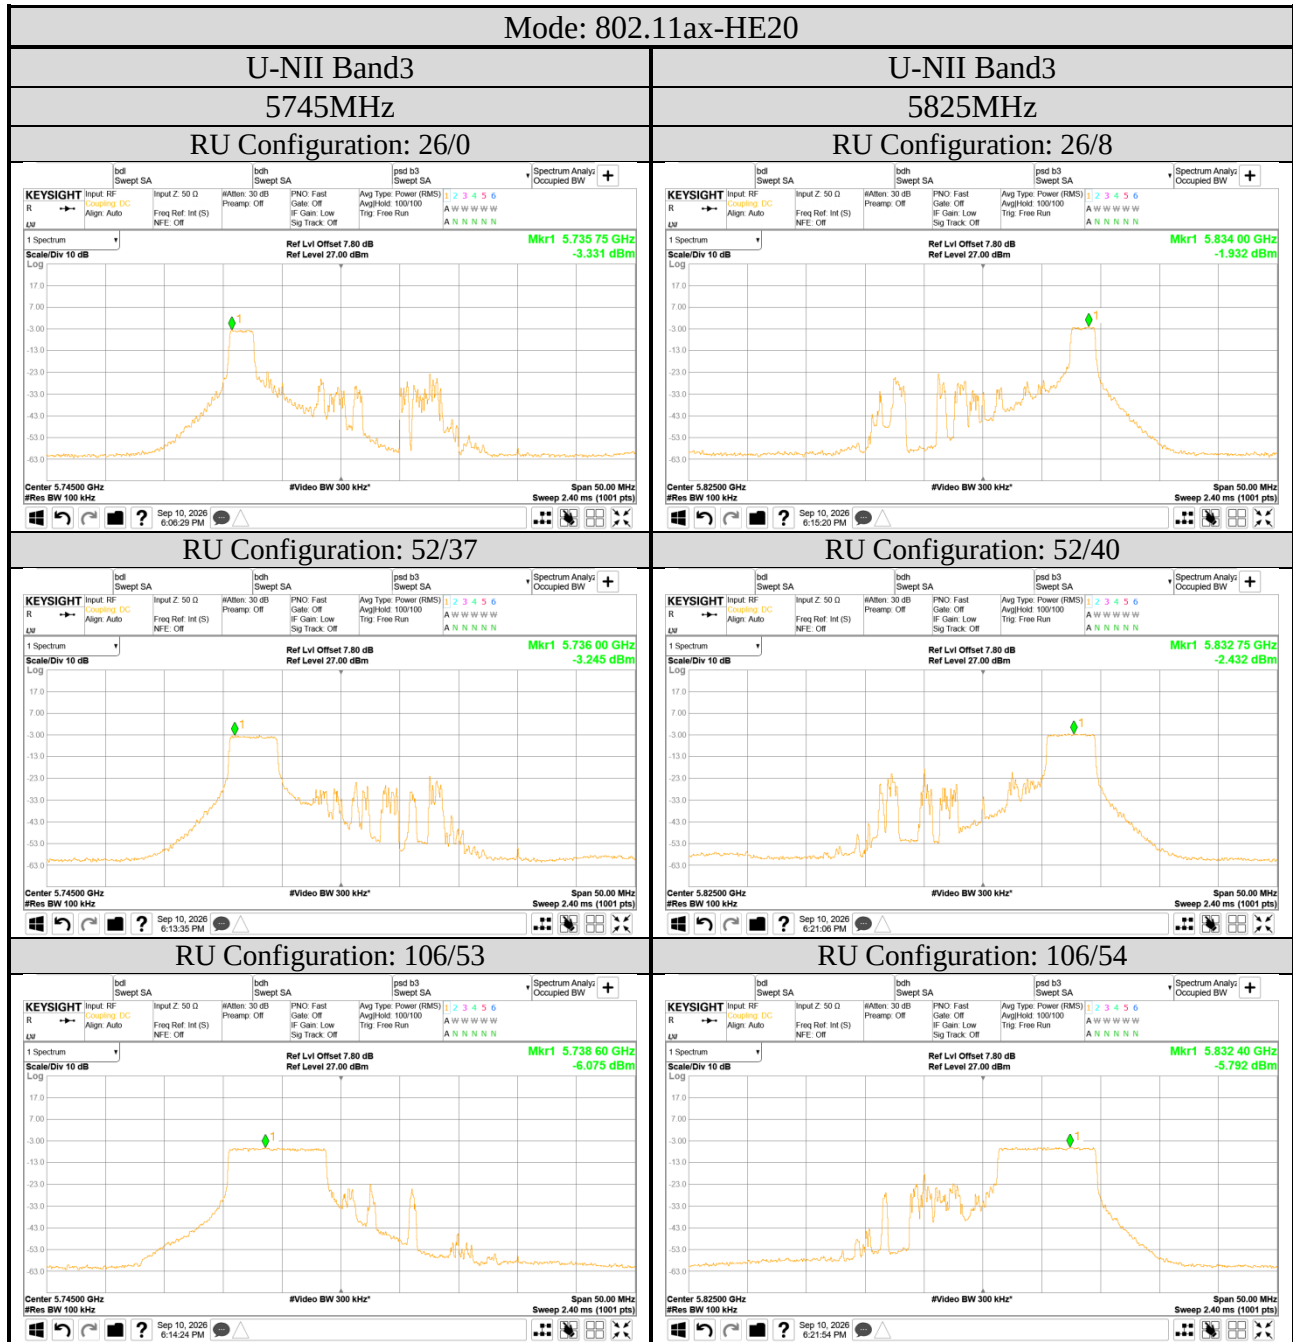

A.5 FREQUENCY STABILITY

Test Date	2026/09/09	Temp./Hum.	22°C/55%
Test Voltage	120Vac/102Vac/138Vac	Tested By	Kevin Yao

A.5.1 Frequency stability Result



Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.017	3.282
-30	102	5180	5179.991	-1.737
	138	5180	5179.985	-2.896
-20	102	5180	5180.001	0.193
	138	5180	5180.026	5.019
-10	102	5180	5179.983	-3.282
	138	5180	5179.979	-4.054
0	102	5180	5180.019	3.668
	138	5180	5179.997	-0.579
10	102	5180	5180.029	5.598
	138	5180	5179.993	-1.351
20	102	5180	5179.975	-4.826
	138	5180	5180.018	3.475
30	102	5180	5180.02	3.861
	138	5180	5180	0.000
40	102	5180	5180.020	3.861
	138	5180	5180.024	4.633
50	102	5180	5179.99	-1.931
	138	5180	5179.99	-1.931

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


A.6 BAND EDGE

Test Date	2026/06/26~07/02	Temp./Hum.	23 ~ 25°C /60%
Cable Loss	0.80dB	Tested By	Ming Shih
Test Voltage	DC 3.8V (Via Battery)		

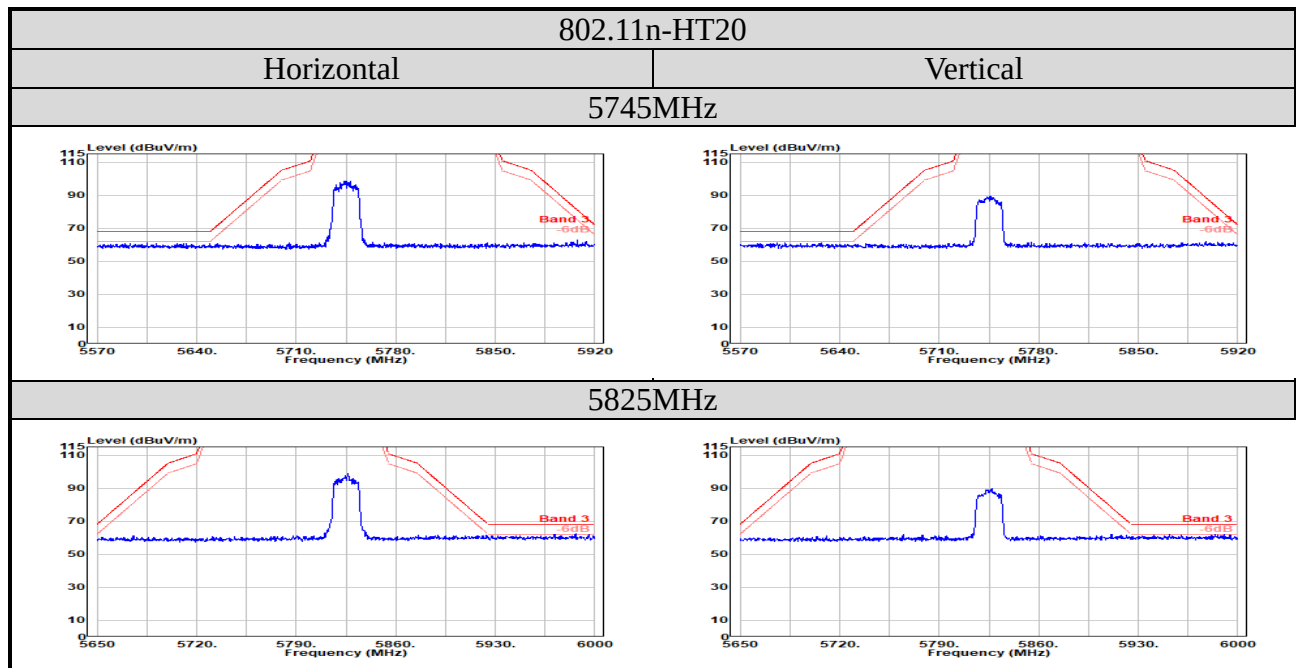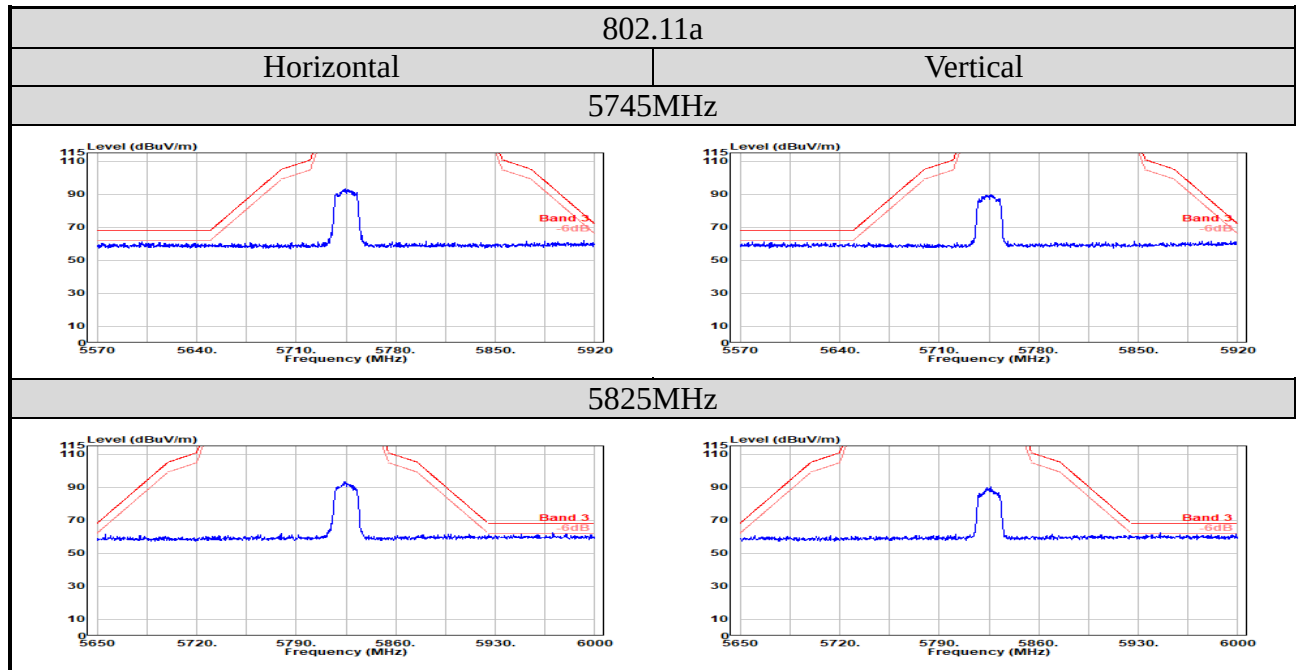


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

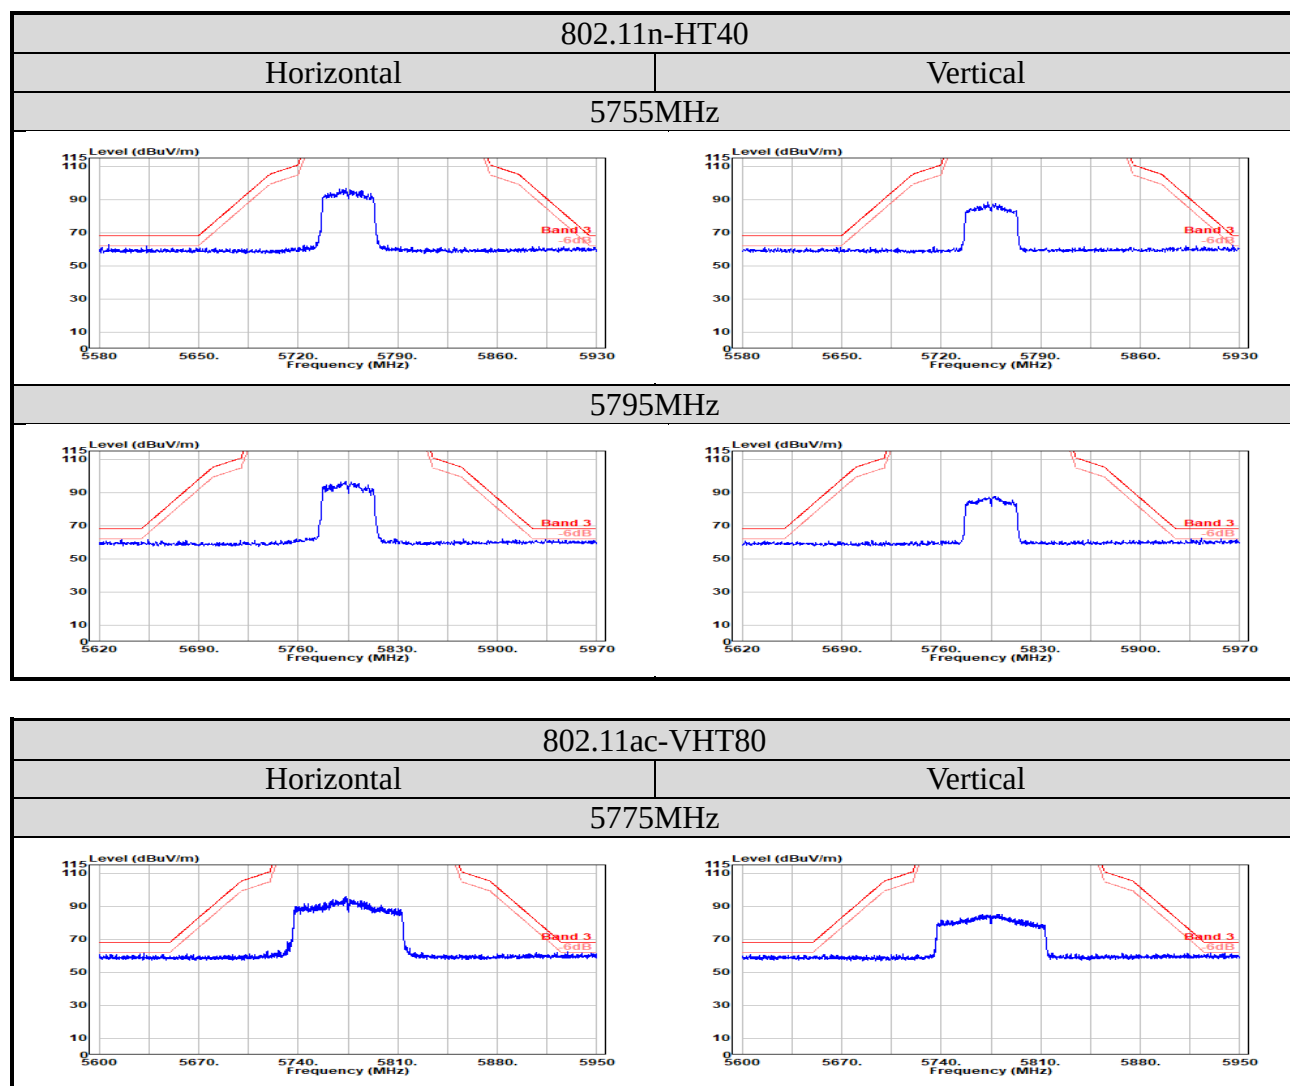

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

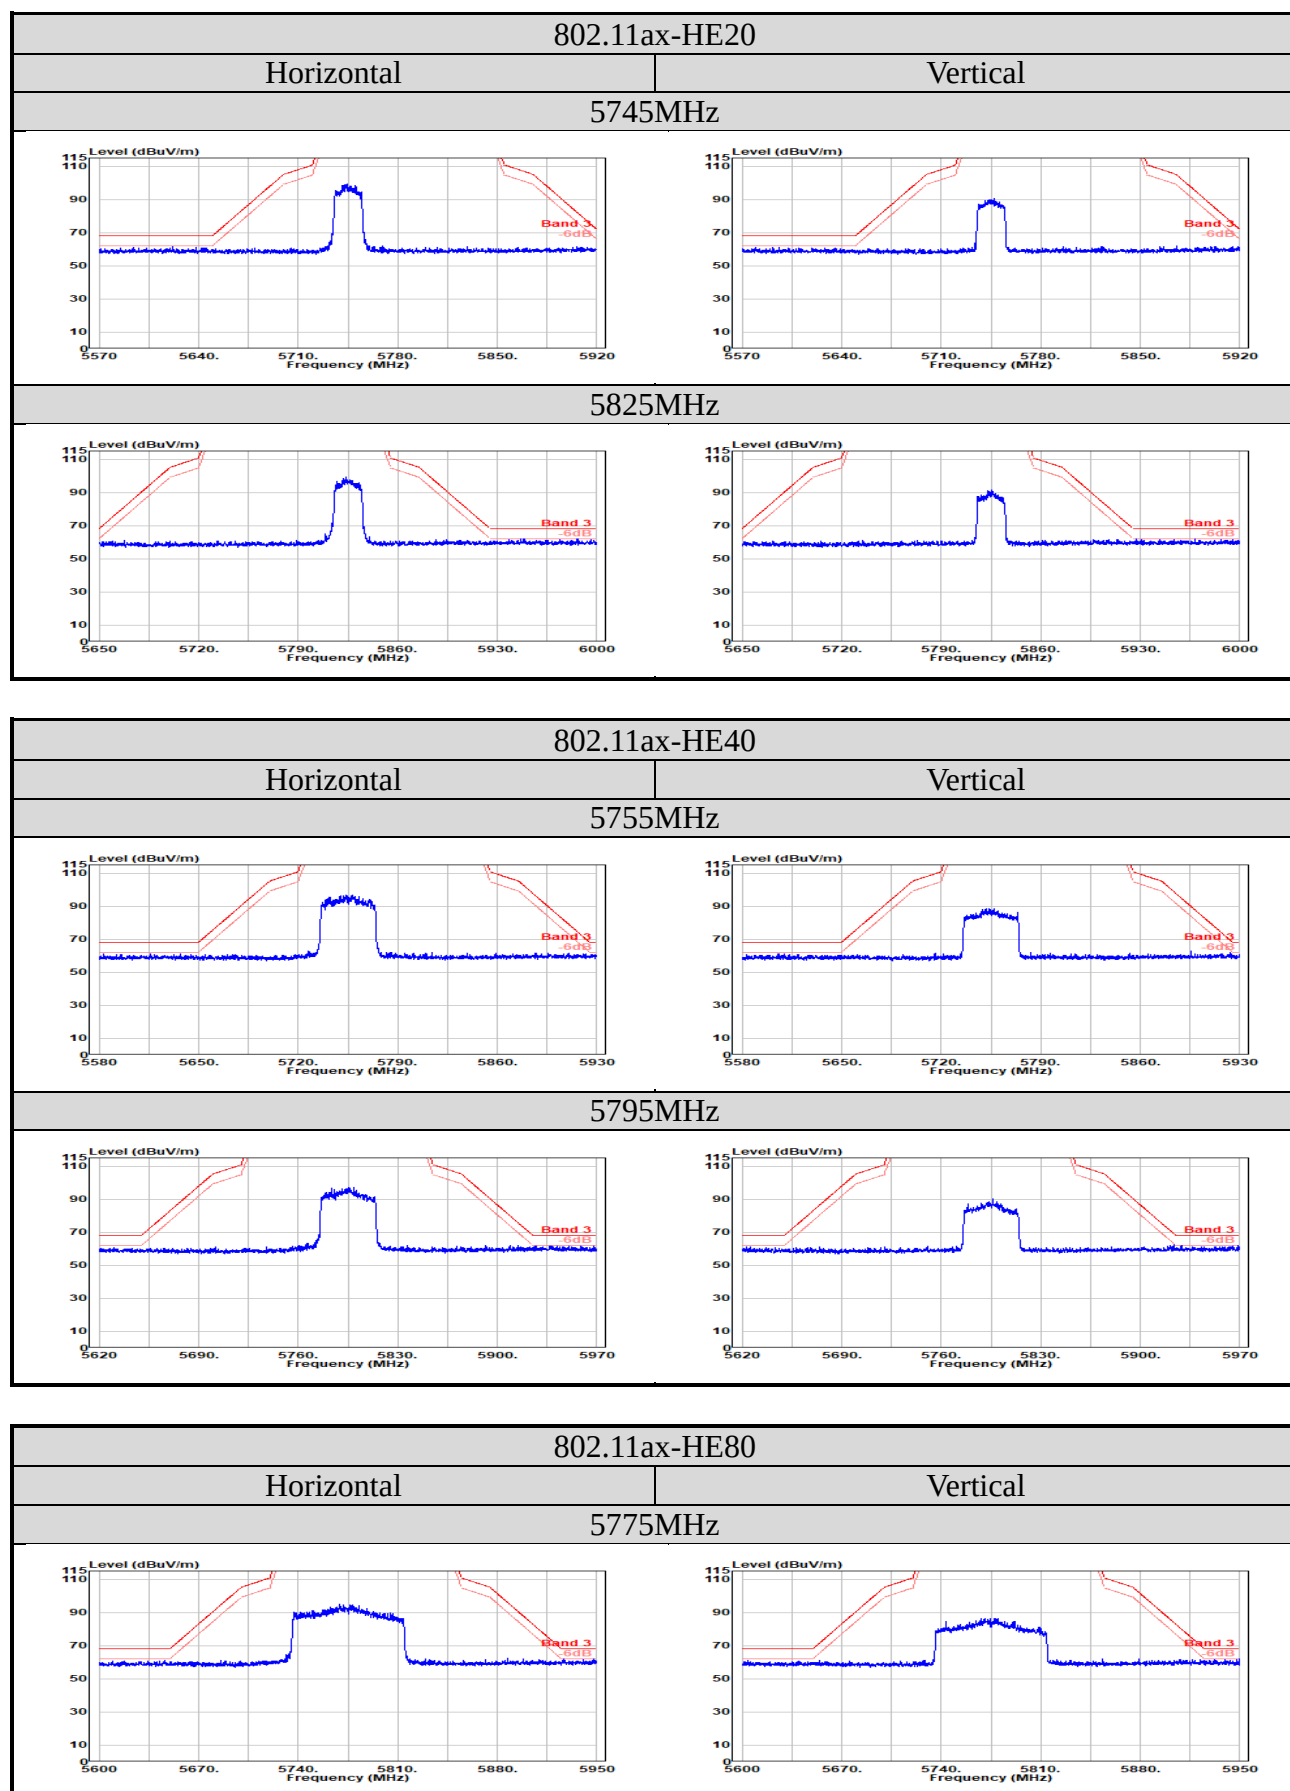

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303



802.11ax-HE20

5745MHz



Horizontal

Vertical



RU Configuration: 26/0

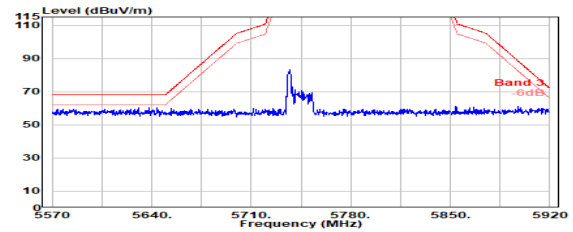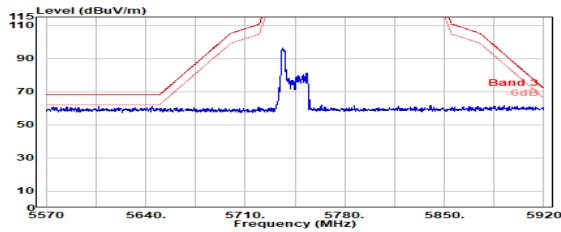

RU Configuration: 52/37

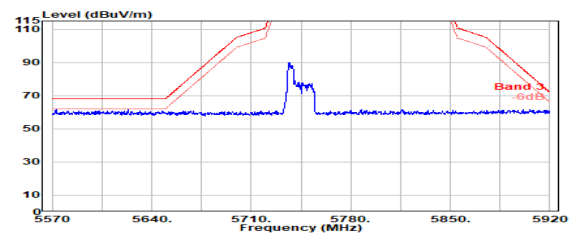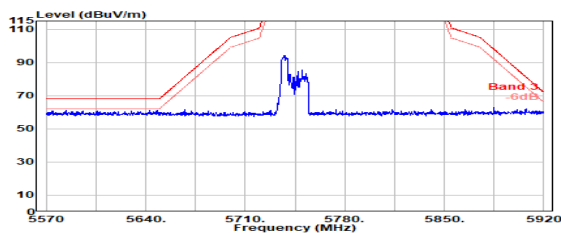

RU Configuration: 106/53

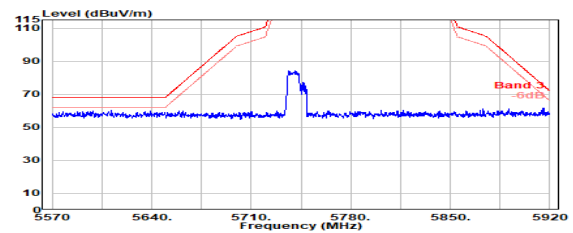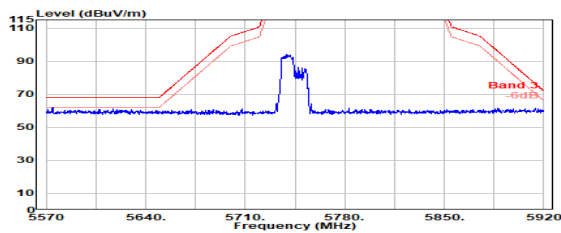

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303



802.11ax-HE20

5825MHz



Horizontal

Vertical



RU Configuration: 26/8

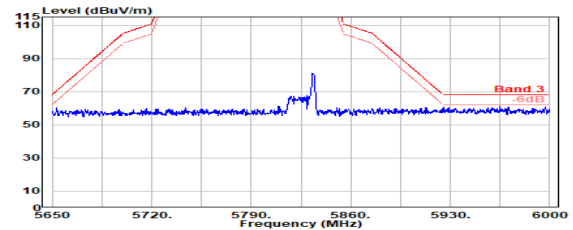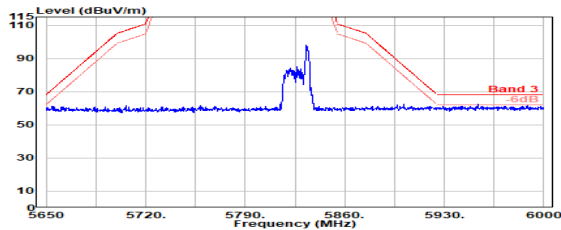

RU Configuration: 52/40

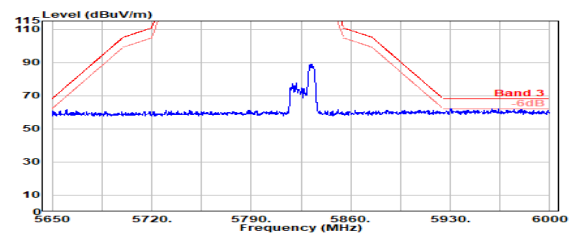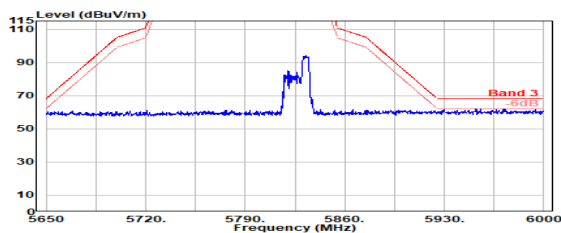

RU Configuration: 106/54

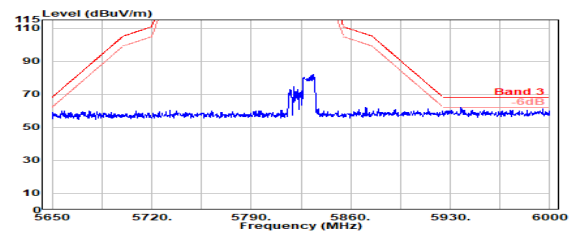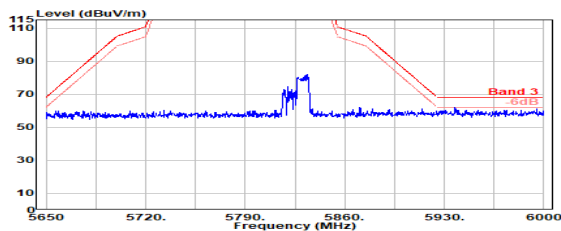



Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City 244, Taiwan

APPENDIX B

Tel: +886 2 26099301
Fax: +886 2 26099303

APPENDIX B

TEST PHOTOGRAPHS

(Model: YY1305B)