

6.4. Radiated Spurious Emissions -- Pursuant 47 CFR 2.1053, 2.1057, 90.210(g)(3), 90.691(a)(2)

FCC Limits

-Per 90.210(g)(3) and 90.691(a)(2), radiated spurious emissions shall be attenuated below the maximum level of emission of the carrier frequency in accordance with the following formula:

Spurious attenuation in dB = $43 + 10 \log_{10} (P)$
(Thus the effective limit is -13 dBm for any transmitter power level).

NOTE 1: Spurious emissions are dependent on the linearity of the Power Amplifier and are independent of modulation type or TDM interleaving. Thus emissions were tested with the radio set to Quad-16QAM at both maximum and minimum radio output power settings.

NOTE 2: An asterisk () in the data indicates the spurious emission was less than -33 dBm or could not be detected due to noise limitations or ambients.*


NOTE 3: Spurious emission levels were measured with the non-detachable antenna mounted on the radio product, as in intended use. Measurement setup is described in Exhibit 7.3.

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**806.0625 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1612.1250	-13	*	*
3XFund	2418.1875	-13	*	*
4XFund	3224.2500	-13	*	*
5XFund	4030.3125	-13	*	*
6XFund	4836.3750	-13	*	*
7XFund	5642.4375	-13	*	*
8XFund	6448.5000	-13	*	*
9XFund	7254.5625	-13	*	*
10XFund	8060.6250	-13	*	*

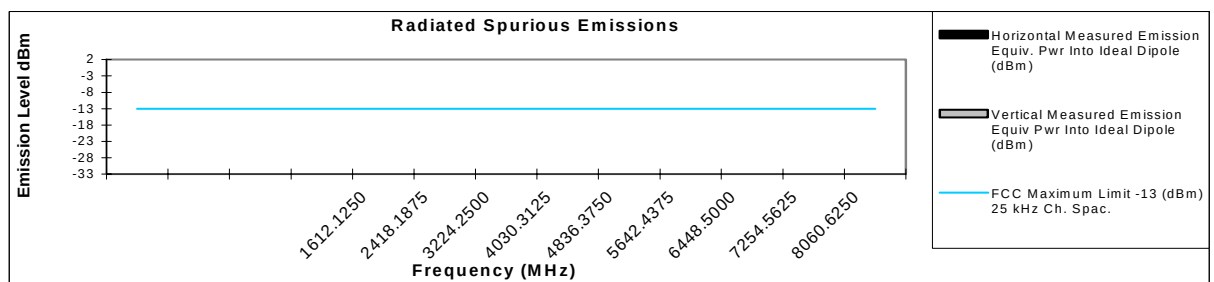

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**813.5625 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1627.1250	-13	*	*
3XFund	2440.6875	-13	*	*
4XFund	3254.2500	-13	*	*
5XFund	4067.8125	-13	*	*
6XFund	4881.3750	-13	*	*
7XFund	5694.9375	-13	*	*
8XFund	6508.5000	-13	*	*
9XFund	7322.0625	-13	*	*
10XFund	8135.6250	-13	*	*

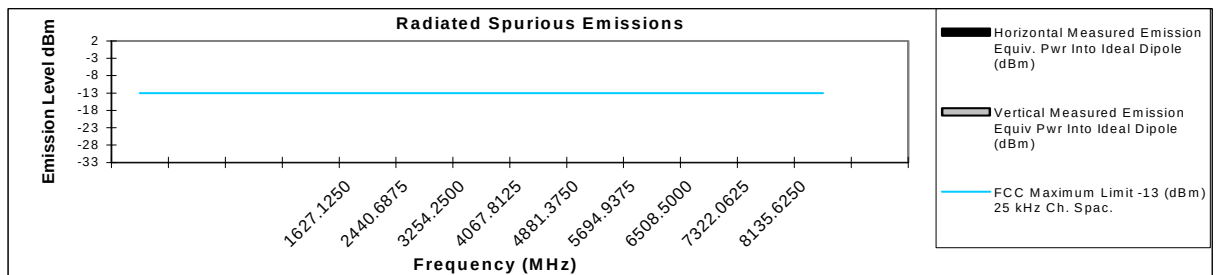

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679


Figure 6-23a: Maximum Power Setting Transmitter Spurious Emissions

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**820.9875 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1641.9750	-13	*	*
3XFund	2462.9625	-13	*	*
4XFund	3283.9500	-13	*	*
5XFund	4104.9375	-13	*	*
6XFund	4925.9250	-13	*	*
7XFund	5746.9125	-13	*	*
8XFund	6567.9000	-13	*	*
9XFund	7388.8875	-13	*	*
10XFund	8209.8750	-13	*	*

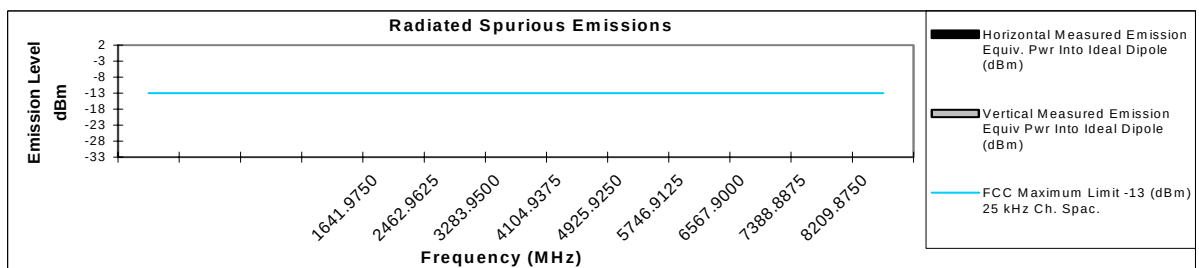

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**824.9875 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1649.9750	-13	*	*
3XFund	2474.9625	-13	*	*
4XFund	3299.9500	-13	*	*
5XFund	4124.9375	-13	*	*
6XFund	4949.9250	-13	*	*
7XFund	5774.9125	-13	*	*
8XFund	6599.9000	-13	*	*
9XFund	7424.8875	-13	*	*
10XFund	8249.8750	-13	*	*

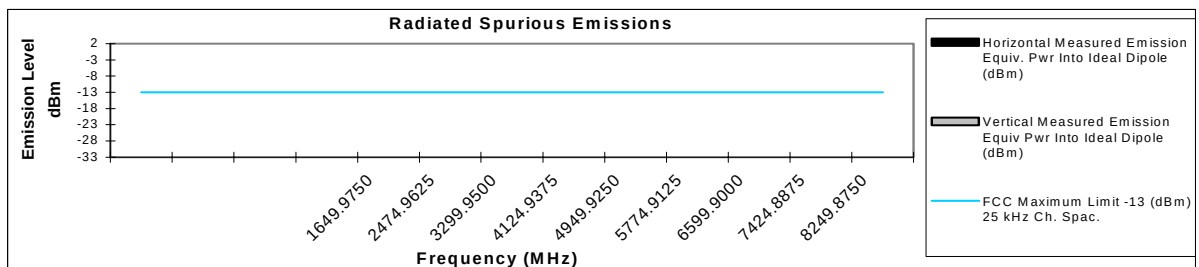

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679


Figure 6-23b: Maximum Power Setting Transmitter Spurious Emissions

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**896.01875 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1792.0375	-13	*	*
3XFund	2688.0563	-13	-39.53	*
4XFund	3584.0750	-13	*	*
5XFund	4480.0938	-13	*	*
6XFund	5376.1125	-13	*	*
7XFund	6272.1313	-13	*	*
8XFund	7168.1500	-13	*	*
9XFund	8064.1688	-13	*	*
10XFund	8960.1875	-13	*	*

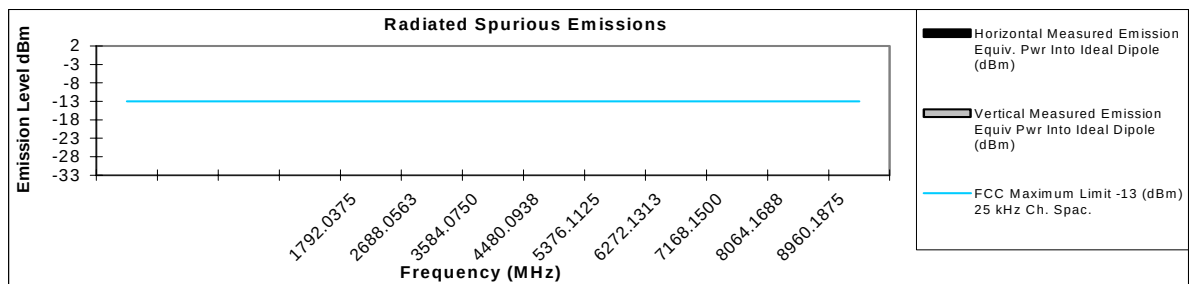

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**900.98125 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1801.9625	-13	*	*
3XFund	2702.9438	-13	-35.71	-28.89
4XFund	3603.9250	-13	*	*
5XFund	4504.9063	-13	*	*
6XFund	5405.8875	-13	*	*
7XFund	6306.8688	-13	*	*
8XFund	7207.8500	-13	*	*
9XFund	8108.8313	-13	*	*
10XFund	9009.8125	-13	*	*

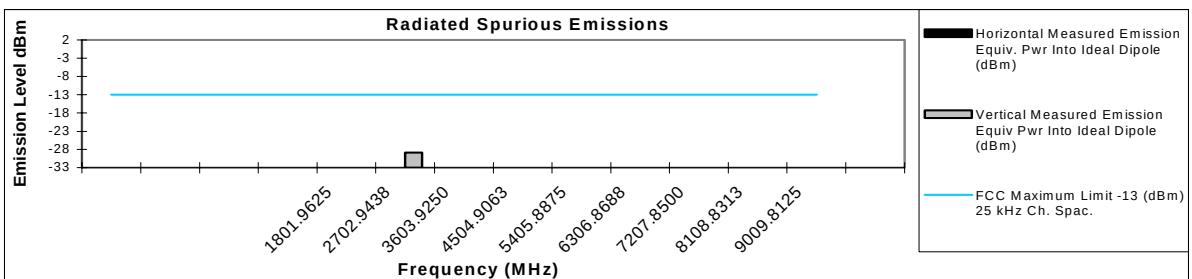

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679


Figure 6-24: Maximum Power Setting Transmitter Spurious Emissions

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**806.0625 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1612.1250	-13	*	*
3XFund	2418.1875	-13	*	*
4XFund	3224.2500	-13	*	*
5XFund	4030.3125	-13	*	*
6XFund	4836.3750	-13	*	*
7XFund	5642.4375	-13	*	*
8XFund	6448.5000	-13	*	*
9XFund	7254.5625	-13	*	*
10XFund	8060.6250	-13	*	*

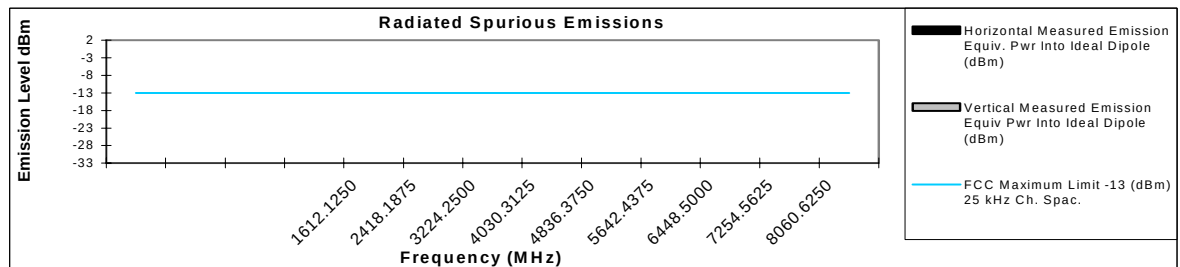

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**813.5625 MHz****Channel Spacing 25KHZ S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1627.1250	-13	*	*
3XFund	2440.6875	-13	*	*
4XFund	3254.2500	-13	*	*
5XFund	4067.8125	-13	*	*
6XFund	4881.3750	-13	*	*
7XFund	5694.9375	-13	*	*
8XFund	6508.5000	-13	*	*
9XFund	7322.0625	-13	*	*
10XFund	8135.6250	-13	*	*

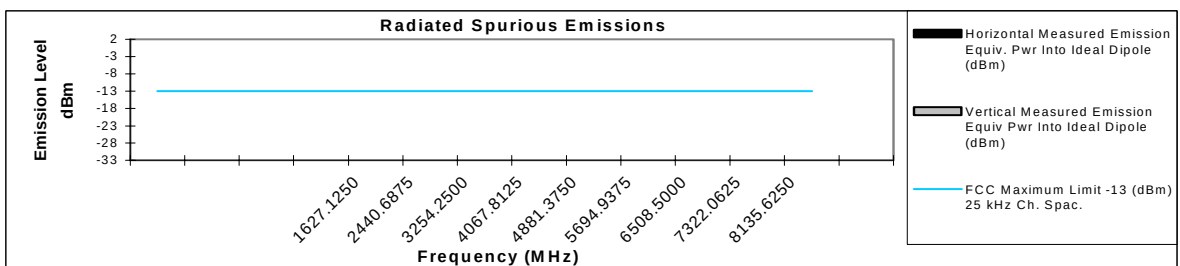

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679


Figure 6-25a: Minimum Power Setting Transmitter Spurious Emissions

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**820.9875 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1641.9750	-13	*	*
3XFund	2462.9625	-13	*	*
4XFund	3283.9500	-13	*	*
5XFund	4104.9375	-13	*	*
6XFund	4925.9250	-13	*	*
7XFund	5746.9125	-13	*	*
8XFund	6567.9000	-13	*	*
9XFund	7388.8875	-13	*	*
10XFund	8209.8750	-13	*	*

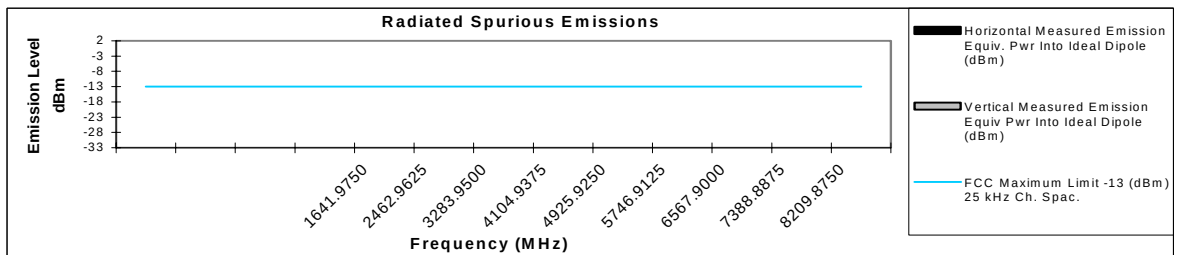

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**824.9875 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1649.9750	-13	*	*
3XFund	2474.9625	-13	*	*
4XFund	3299.9500	-13	*	*
5XFund	4124.9375	-13	*	*
6XFund	4949.9250	-13	*	*
7XFund	5774.9125	-13	*	*
8XFund	6599.9000	-13	*	*
9XFund	7424.8875	-13	*	*
10XFund	8249.8750	-13	*	*

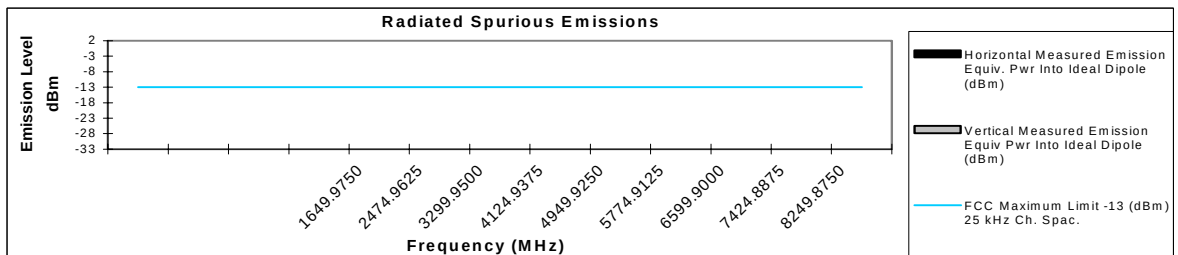

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679


Figure 6-25b: Minimum Power Setting Transmitter Spurious Emissions

Motorola Inc.

FCC ID:AZ489FT5833

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**896.01875 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**


Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1792.0375	-13	*	*
3XFund	2688.0563	-13	*	*
4XFund	3584.0750	-13	*	*
5XFund	4480.0938	-13	*	*
6XFund	5376.1125	-13	*	*
7XFund	6272.1313	-13	*	*
8XFund	7168.1500	-13	*	*
9XFund	8064.1688	-13	*	*
10XFund	8960.1875	-13	*	*

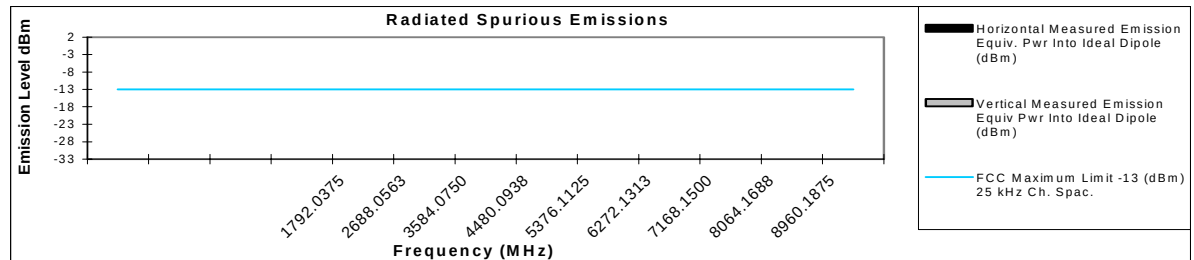

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

Transmitter Radiated Spurious Emissions: H73XAN6RR4AN**900.98125 MHz****Channel Spacing 25KHZ****S/N 364AEEQLMM**

Spur	Frequency (MHz)	FCC Maximum Limit -13 (dBm) 25 kHz Ch. Spac.	Horizontal Measured Emission Equiv. Pwr Into Ideal Dipole (dBm)	Vertical Measured Emission Equiv Pwr Into Ideal Dipole (dBm)
		-13		
		-13		
		-13		
		-13		
2XFund	1801.9625	-13	*	*
3XFund	2702.9438	-13	*	*
4XFund	3603.9250	-13	*	*
5XFund	4504.9063	-13	*	*
6XFund	5405.8875	-13	*	*
7XFund	6306.8688	-13	*	*
8XFund	7207.8500	-13	*	*
9XFund	8108.8313	-13	*	*
10XFund	9009.8125	-13	*	*

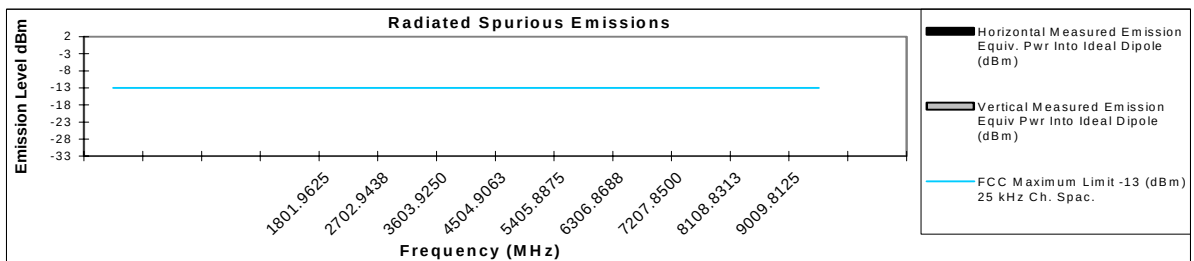

* Indicates the spurious emission could not be detected due to noise limitations or ambients.

The data presented here was taken using the substitution method as found in the TIA/EIA-603 document.

Motorola Plantation EMC Lab – Test Performed by: Constantin Belean

April 6, 2004

FCC Registration: 91932 / Industry Canada: IC3679

Figure 6-26: Minimum Power Setting Transmitter Spurious Emissions