



Shenzhen Yimingyuan Technology Co., Ltd

One stop communication RF antenna solution manufacturer

Antenna test report

Shenzhen Yimingyuan Technology Co., Ltd

Address: 2nd Floor, Building 5, Yifenghua Innovation
Industrial Park, Dalang Street, Longhua District, Shenzhen


Operator: king mouse

tester: Huang He

TEL: 134 2435 5302

Report edition: 2026.05.22


Project Development Environment

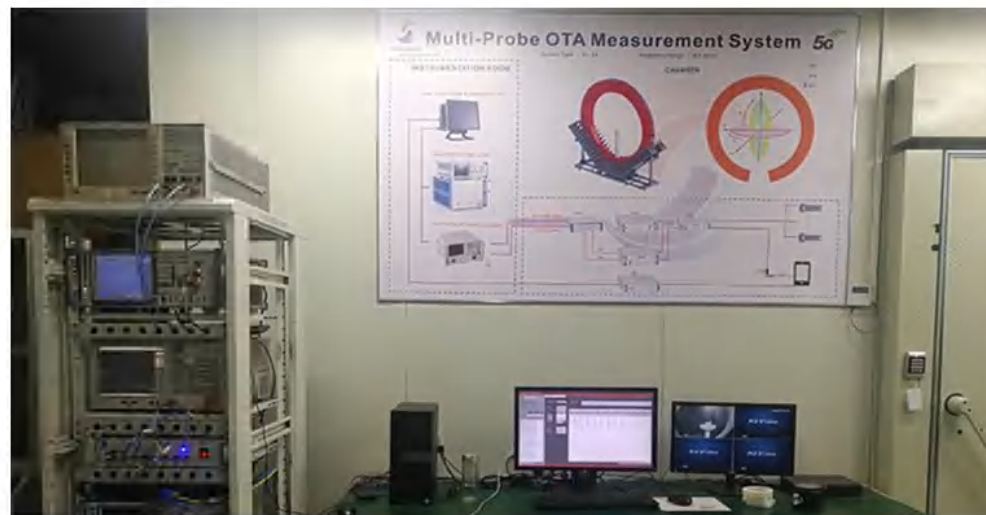

亿铭远一直都是您值得信赖且优秀的合作伙伴，我们为您提供全方位一站式的产品以及技术服务！






“质量第一，服务至上”是亿铭远一直以来的发展宗旨

Testing instruments and software

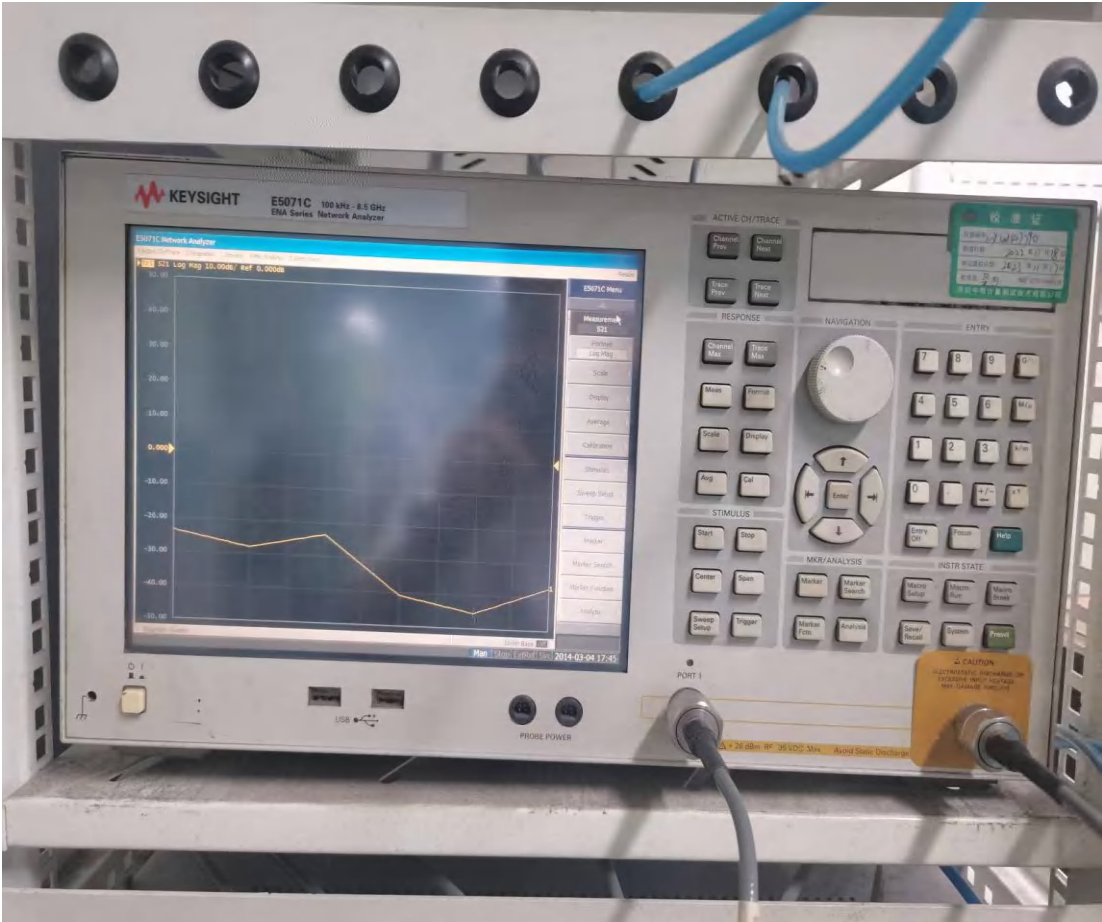

name	network analyzer
brand	Agilent Technologies
model	E5071C
serial number	MY46104453
calibration time	2025/8/25
Next calibration time	2026/8/24

Test steps and data export

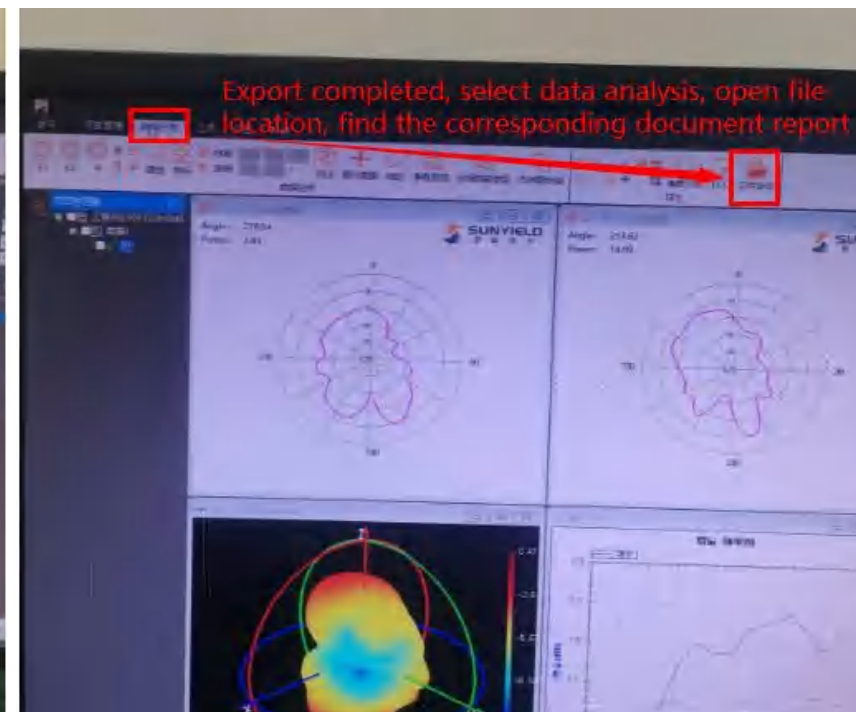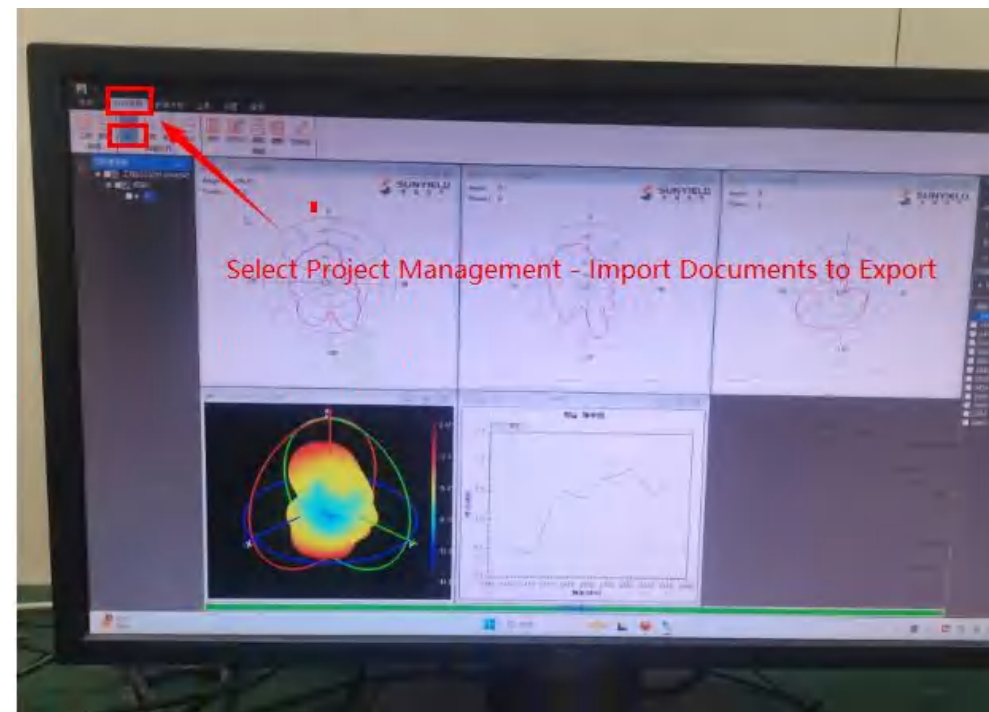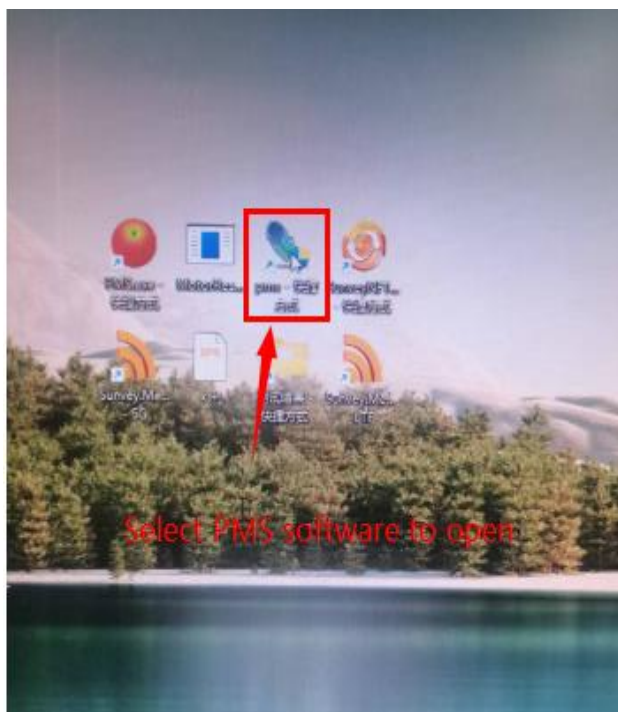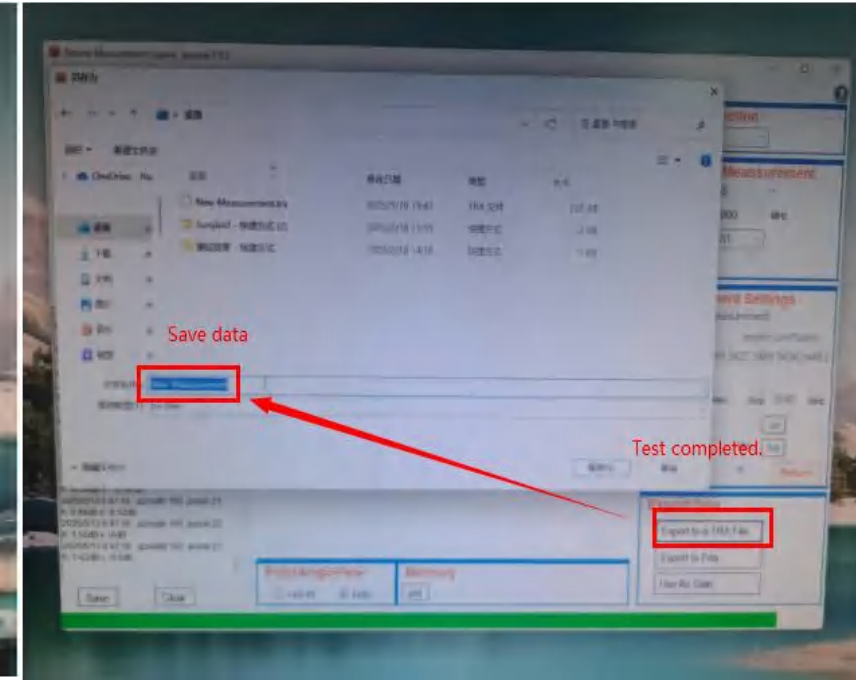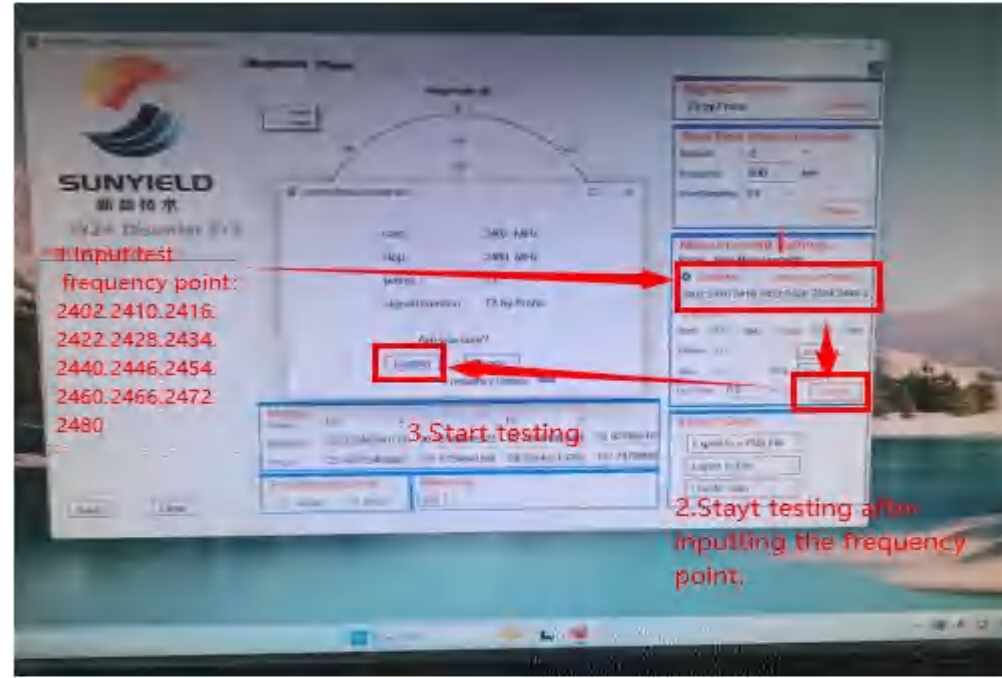

Information of Antenna

Customer Information:

Customer: Dongguan Thermal Electronic Technology Co., Ltd

Customer Address: No. 28 Jinyuling Road, Dongcheng Street,
Dongguan City, Guangdong Province, China

Project Name: king Mouse

Antenna manufacturing information:

Antenna manufacturing: Advanced Ceramic X Corp

Antenna model: king Mouse

Antenna type: chip antenna

Antenna gain: 3.21dBi

Antenna manufacturing address: 16 Tzu Chiang Road, Hsinchu
Industrial District Hsinchu Hsien 303, Taiwan


Antenna smith circle chart and S11 parameters





Antenna efficiency

深圳市亿铭远科技有限公司													
测试数据报告		地址：深圳市龙华区大浪街道颐丰华创新产业园5栋2楼											
软件版本：SNF V2.4.3 导出时间：2026/5/21 15:03:13													
Frequency ID	1	2	3	4	5	6	7	8	9	10	11	12	13
Frequency (MHz)	2402	2410	2416	2422	2428	2434	2440	2446	2454	2460	2466	2472	2480
Gain (dBi)	2.32	2.34	2.47	2.57	2.52	2.48	2.44	2.76	3.21	3.15	2.76	2.79	3.16
Efficiency (dB)	-3.06	-2.75	-2.94	-3.10	-3.06	-2.88	-2.80	-2.61	-2.30	-2.36	-2.60	-2.39	-2.06
Efficiency (%)	49.41	53.06	50.76	49.02	49.44	51.51	52.48	54.77	58.95	58.05	54.96	57.70	62.19
Plane: Phi=0	2402	2410	2416	2422	2428	2434	2440	2446	2454	2460	2466	2472	2480
Plane: Phi=90	2402	2410	2416	2422	2428	2434	2440	2446	2454	2460	2466	2472	2480
Plane: Theta=90	2402	2410	2416	2422	2428	2434	2440	2446	2454	2460	2466	2472	2480








Z、X、Y Physical drawing

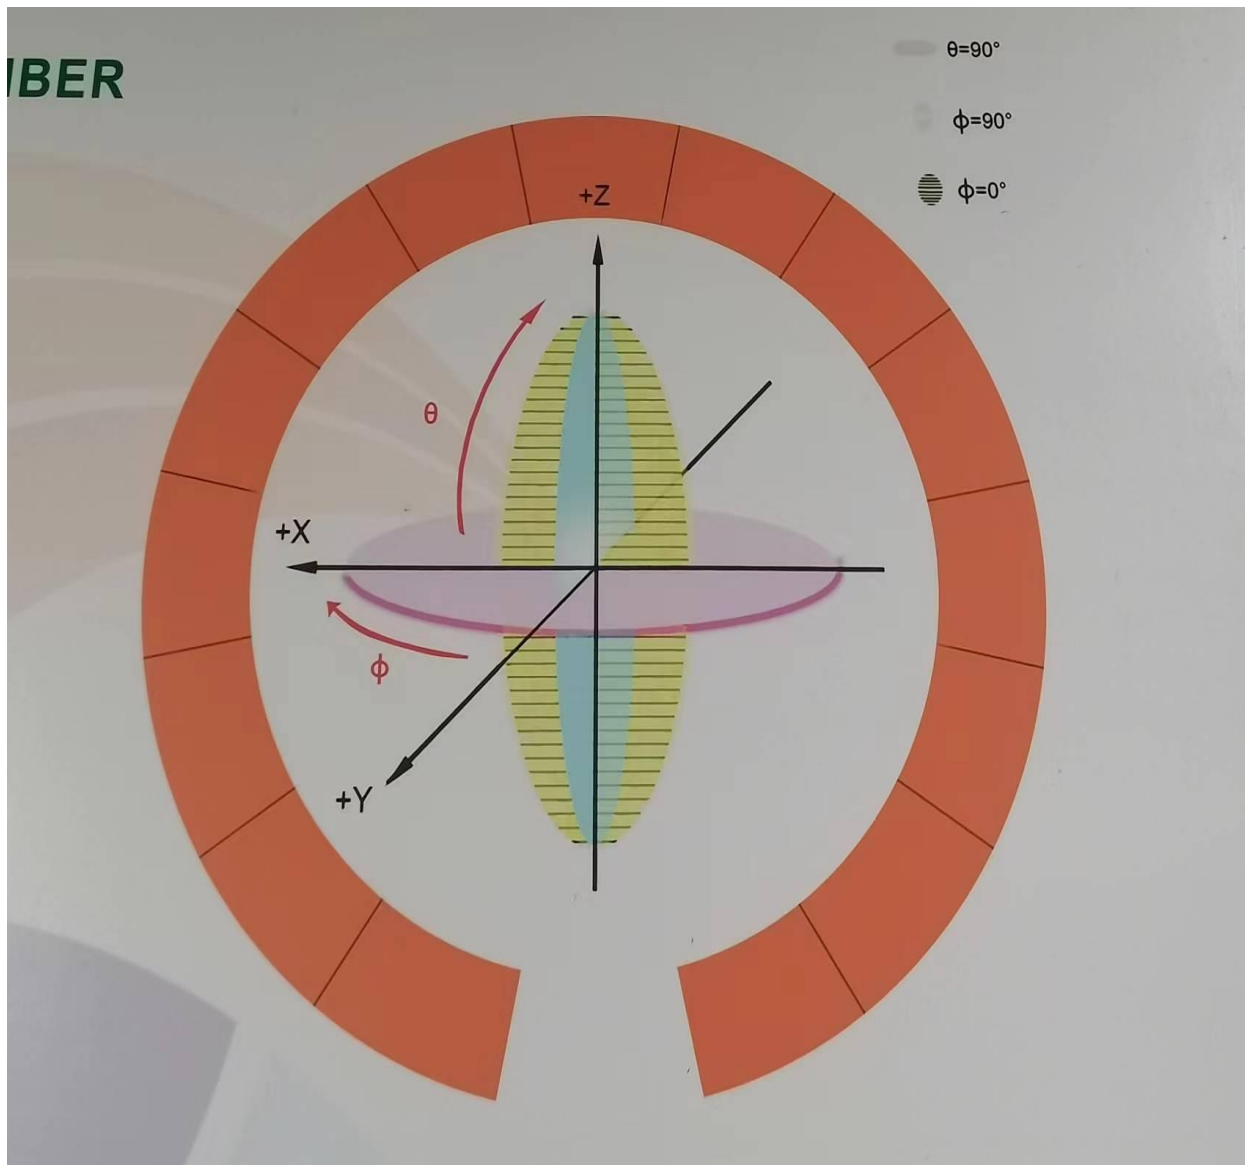








Antenna apple diagram and pattern

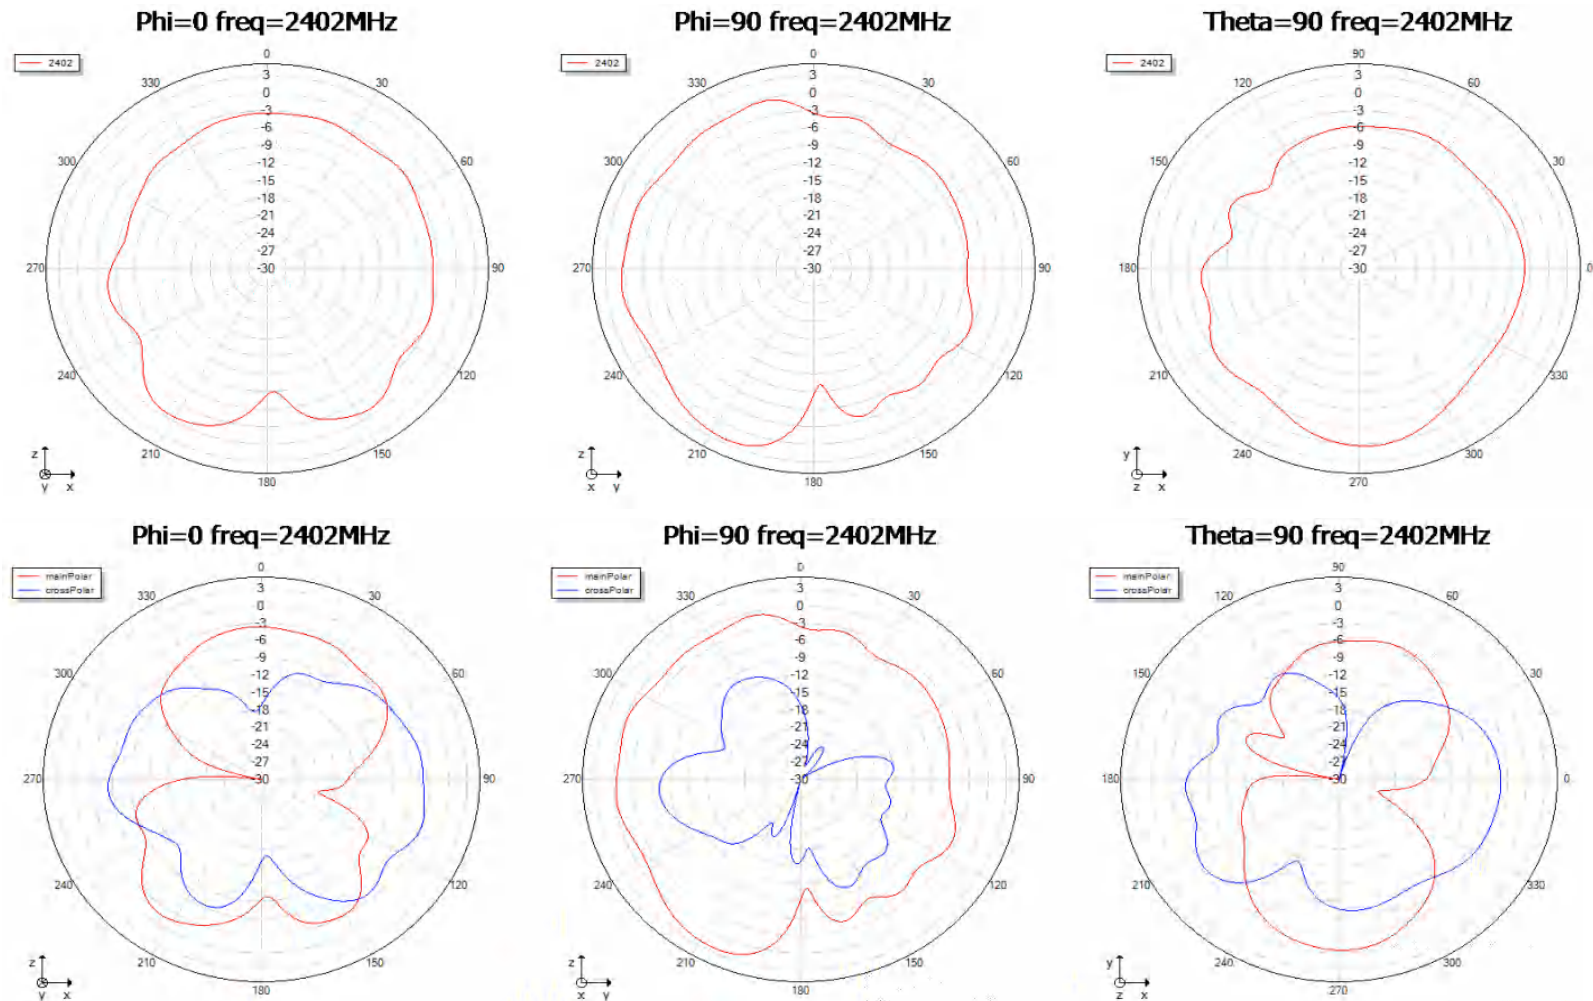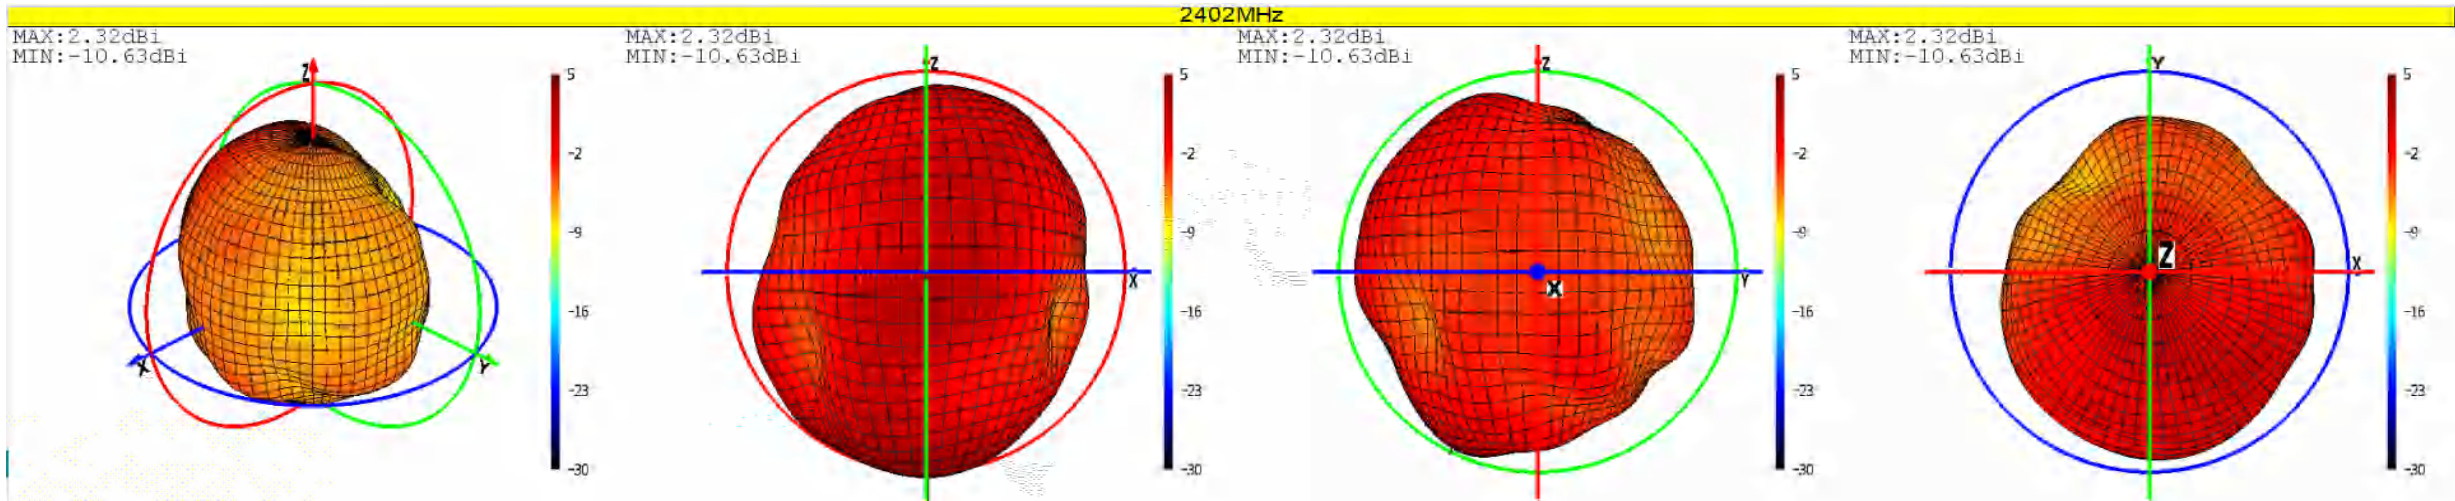


Antenna apple diagram and pattern

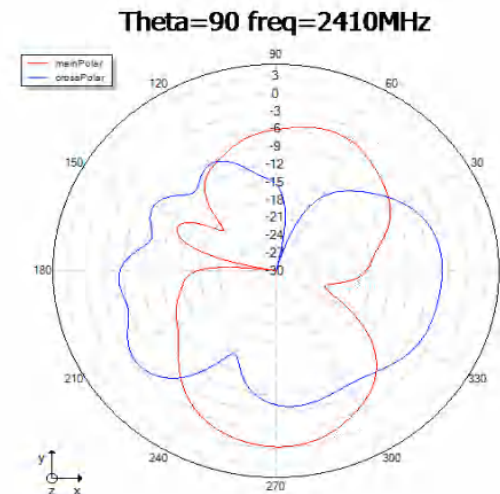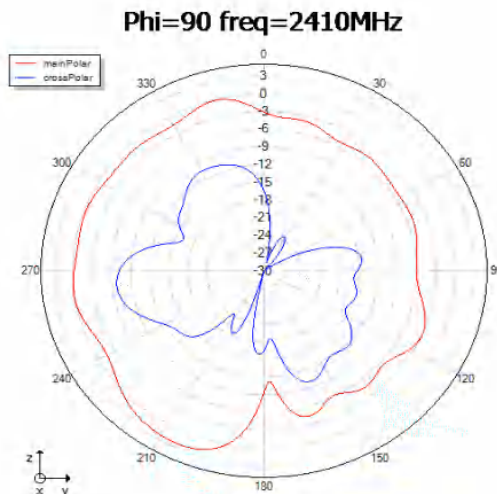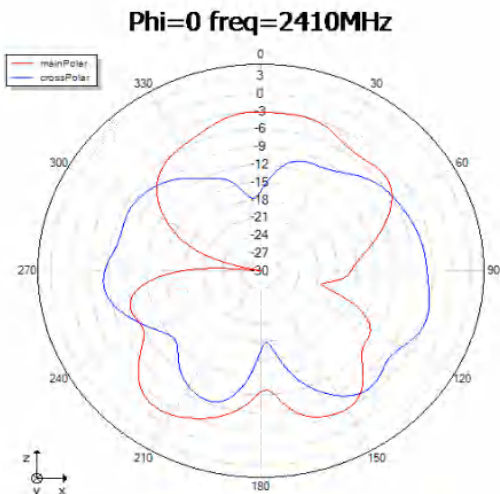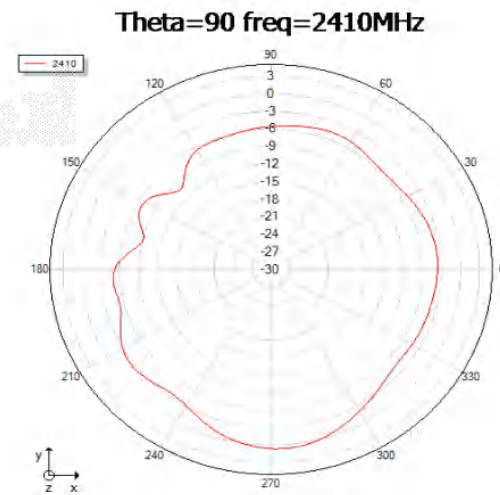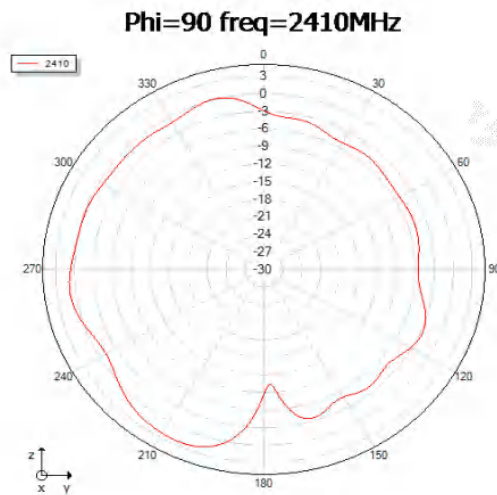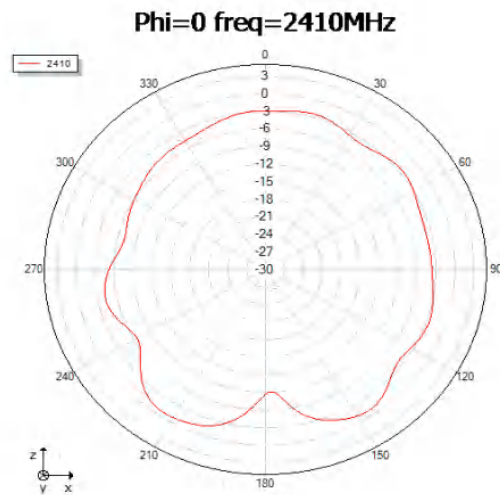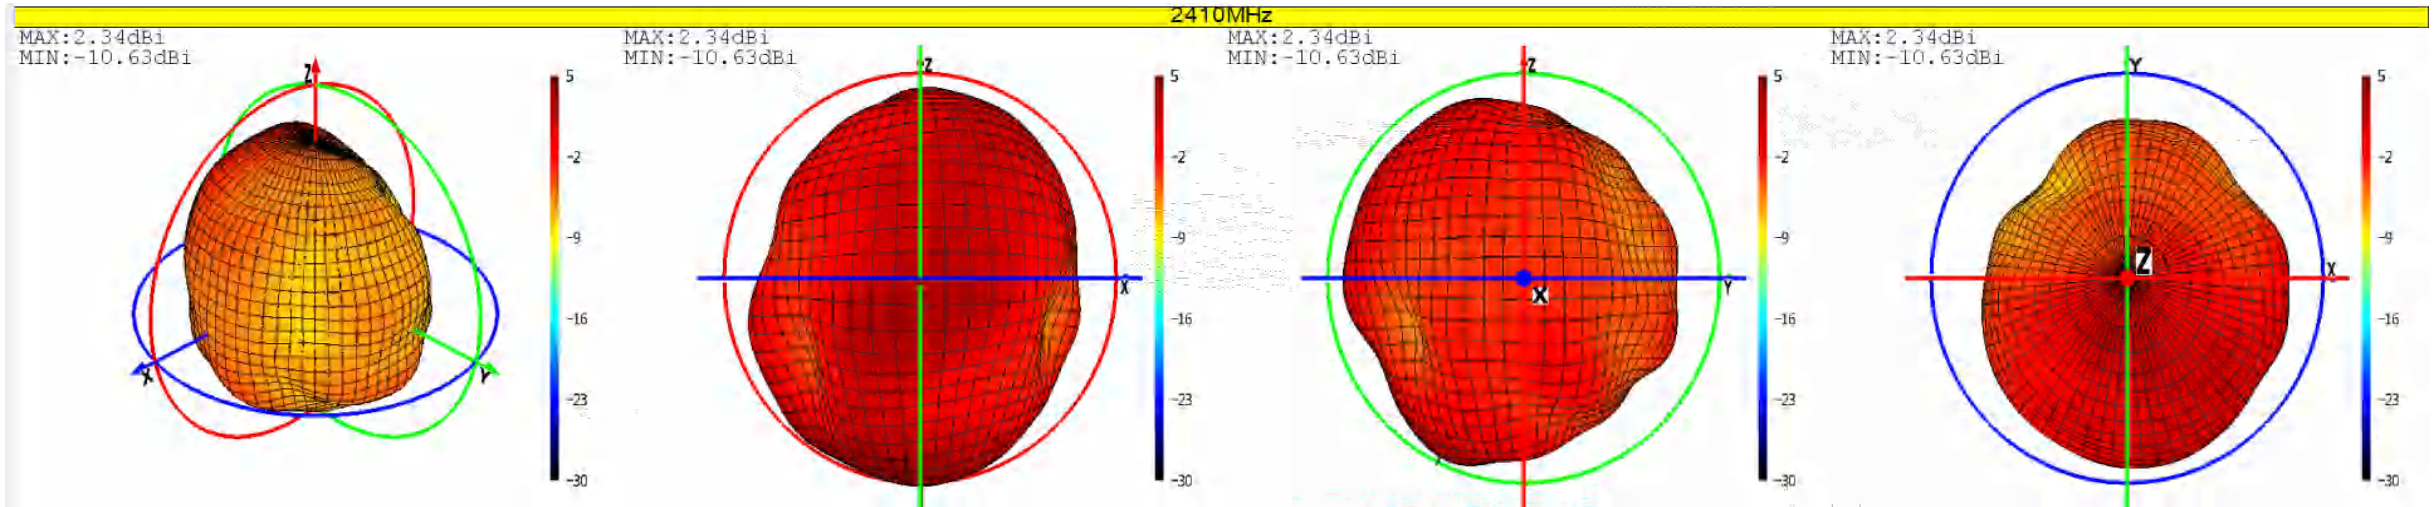


Antenna apple diagram and pattern

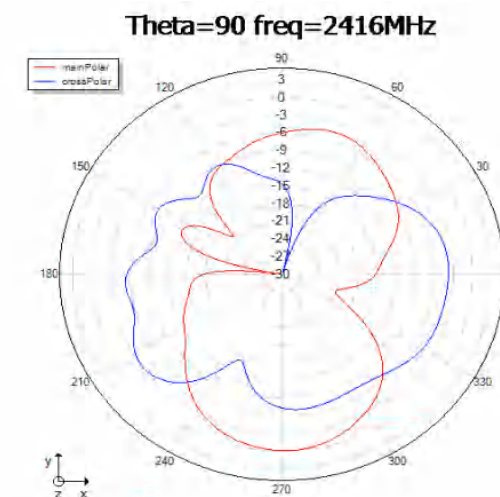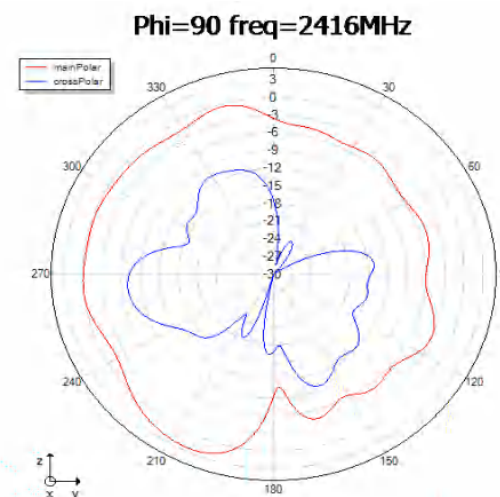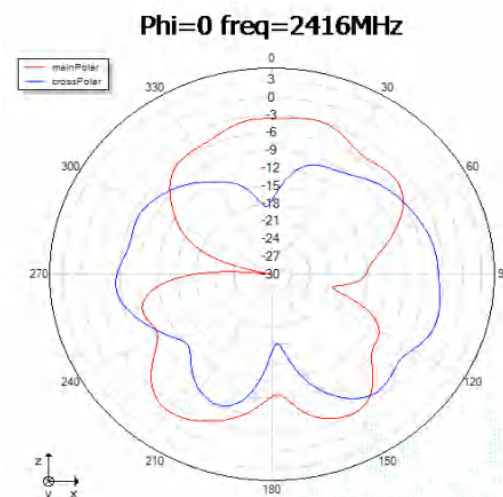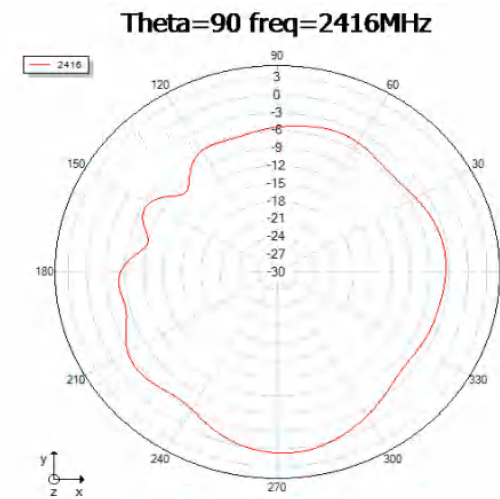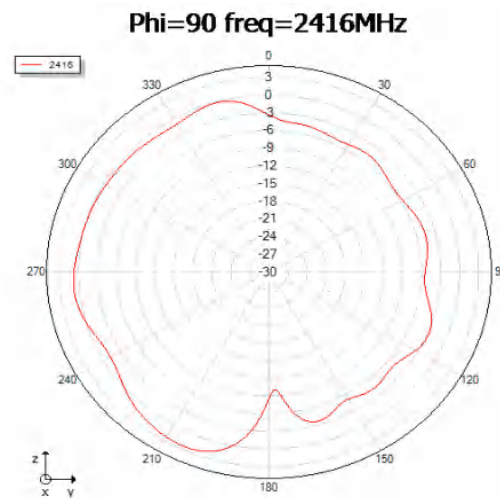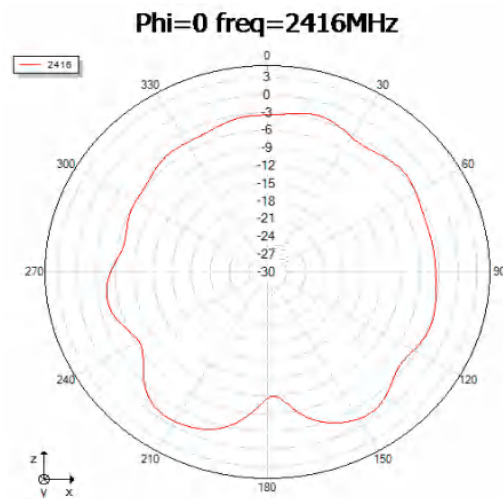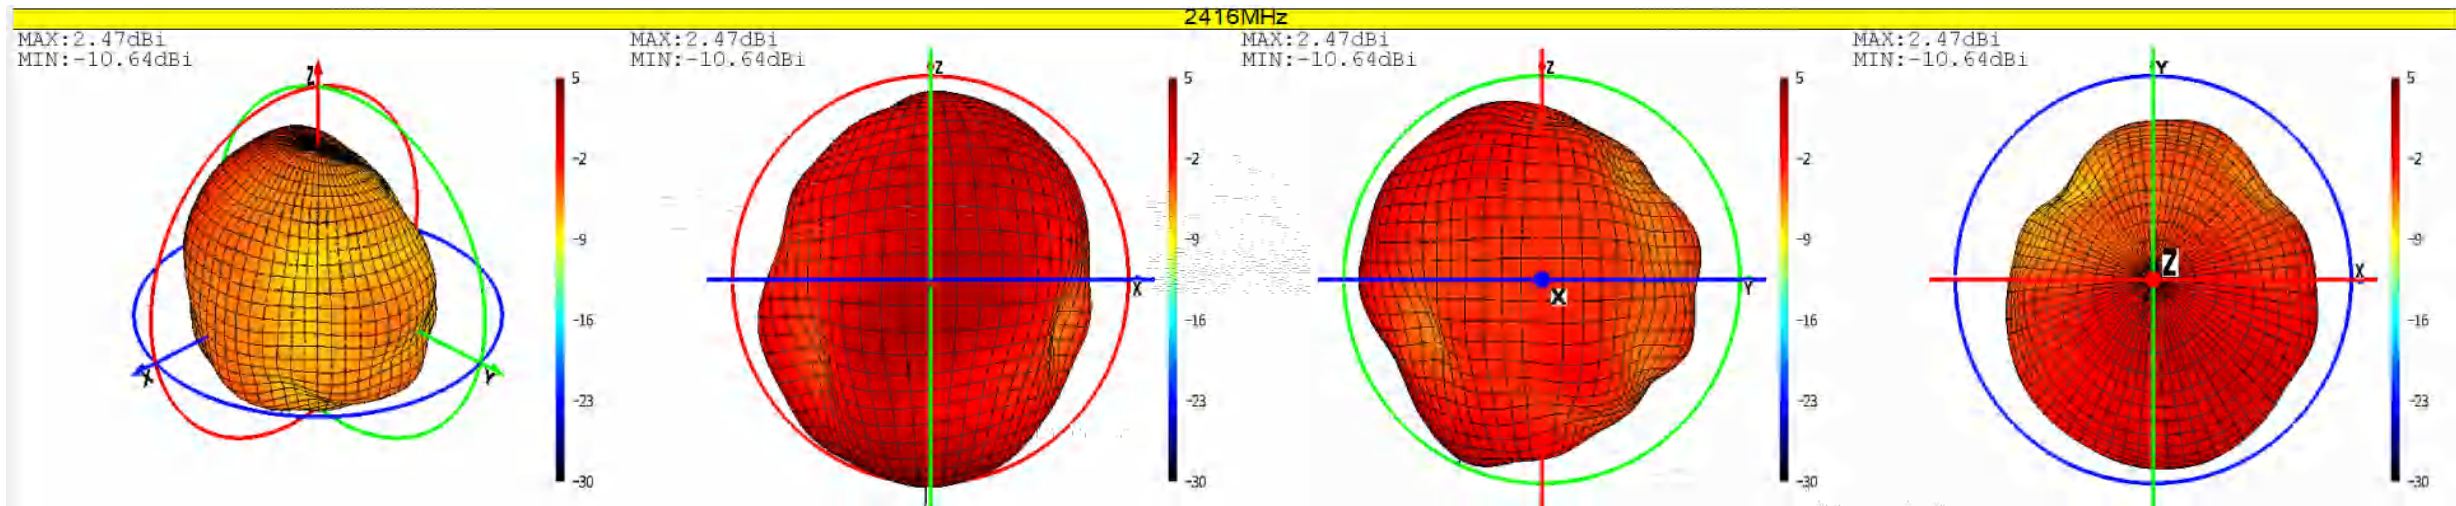


Antenna apple diagram and pattern

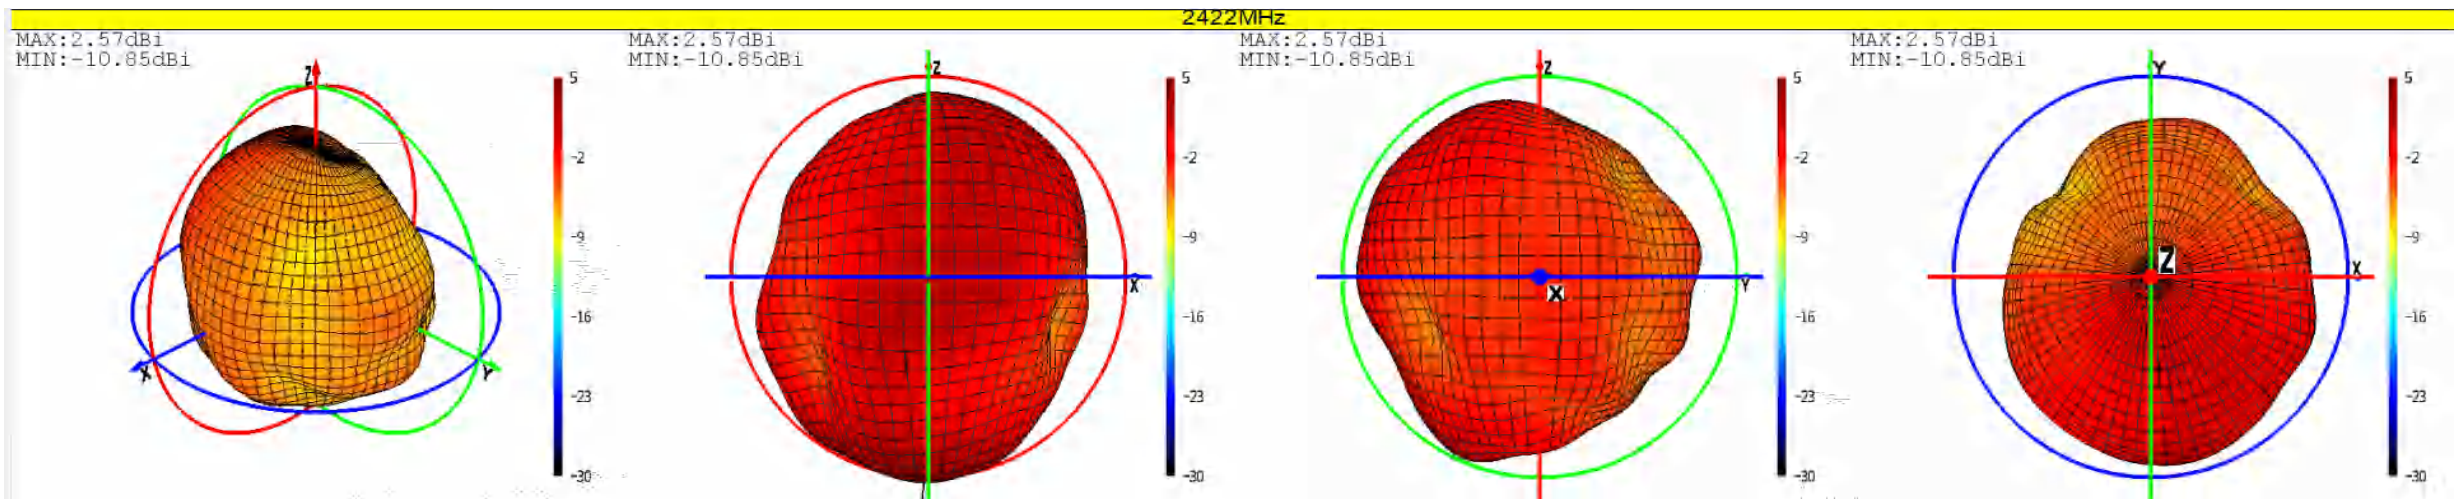


Phi=0 freq=2422MHz

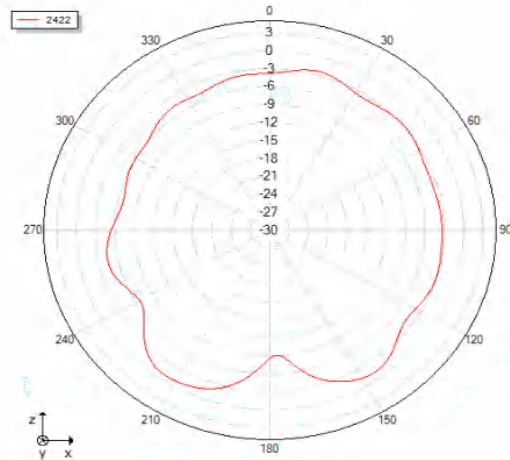


Phi=90 freq=2422MHz

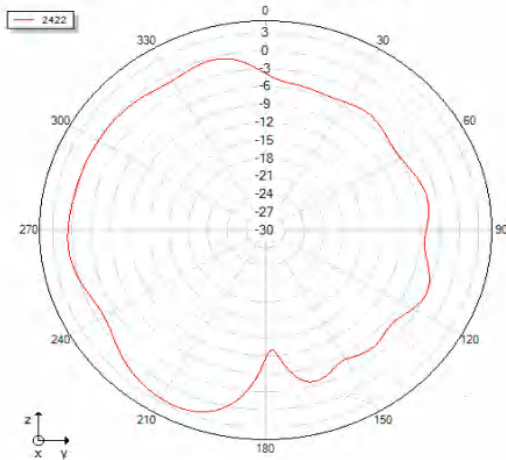


Theta=90 freq=2422MHz

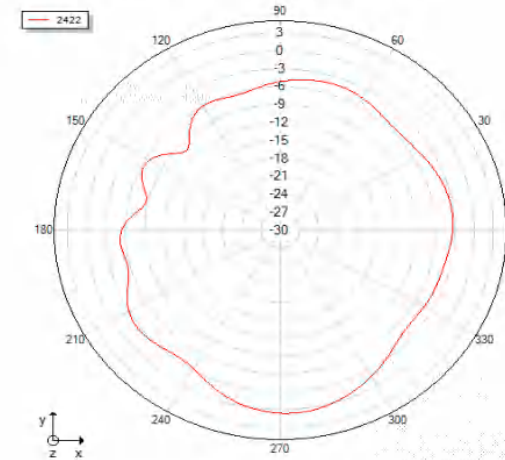


Phi=0 freq=2422MHz

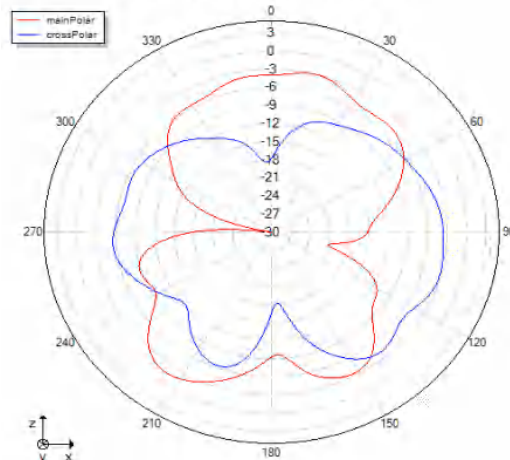

Phi=90 freq=2422MHz

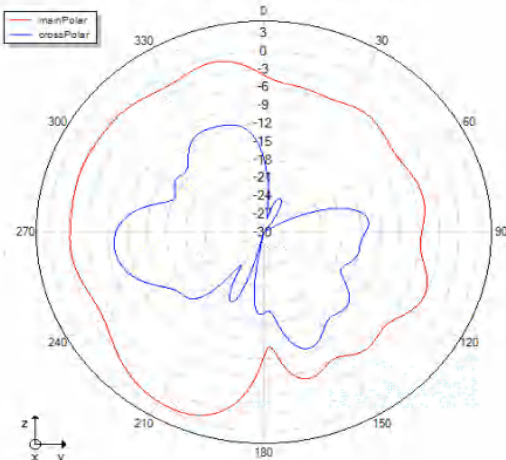


Theta=90 freq=2422MHz

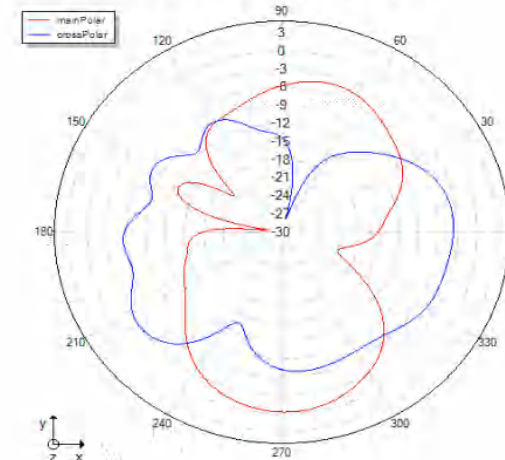


Antenna apple diagram and pattern


MAX: 2.52dBi
MIN: -10.67dBi

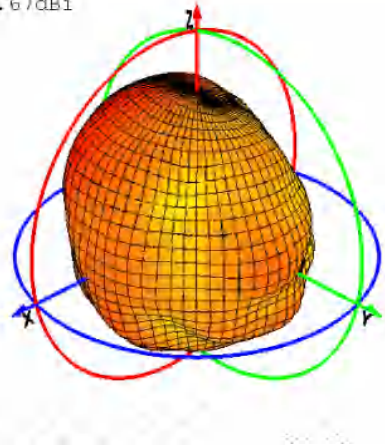


MAX: 2.52dBi
MIN: -10.67dBi

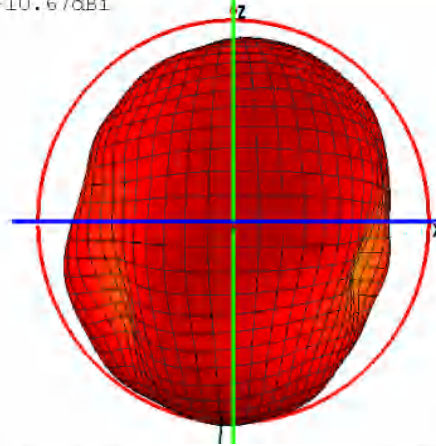


MAX: 2.52dBi
MIN: -10.67dBi

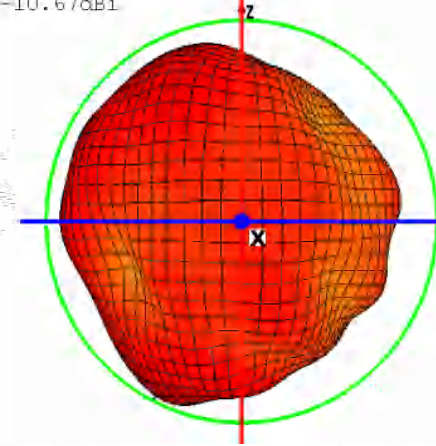


MAX: 2.52dBi
MIN: -10.67dBi

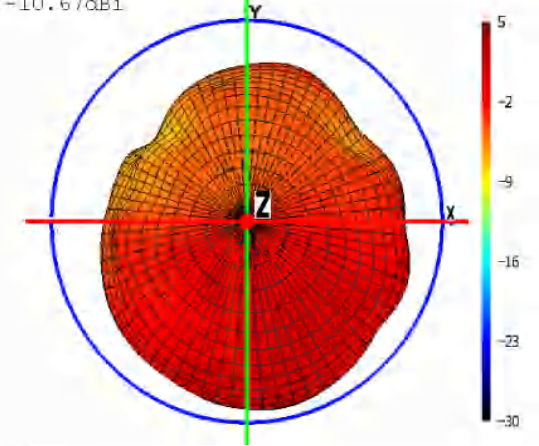


Phi=0 freq=2428MHz

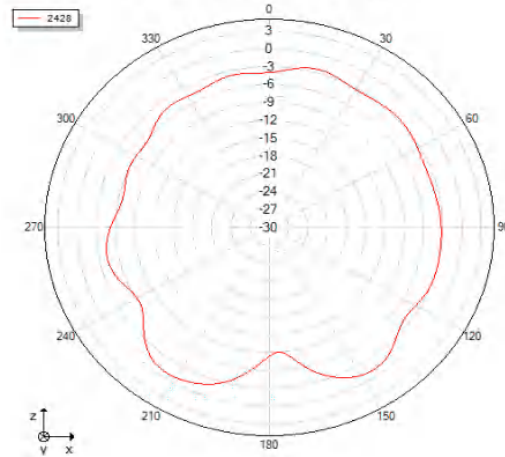


Phi=90 freq=2428MHz

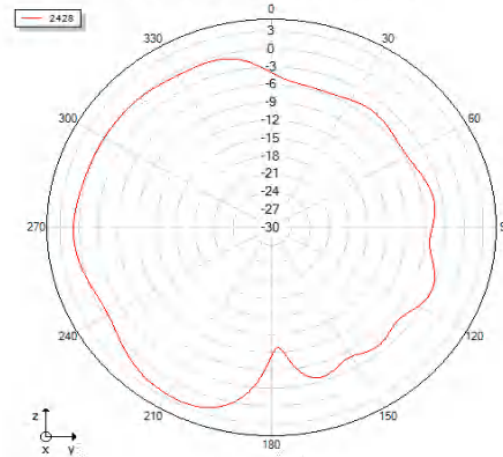


Theta=90 freq=2428MHz

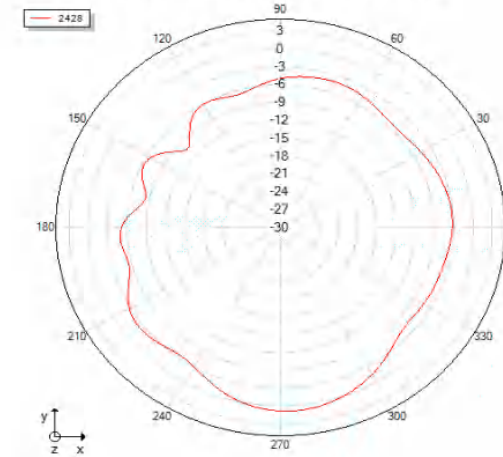


Phi=0 freq=2428MHz

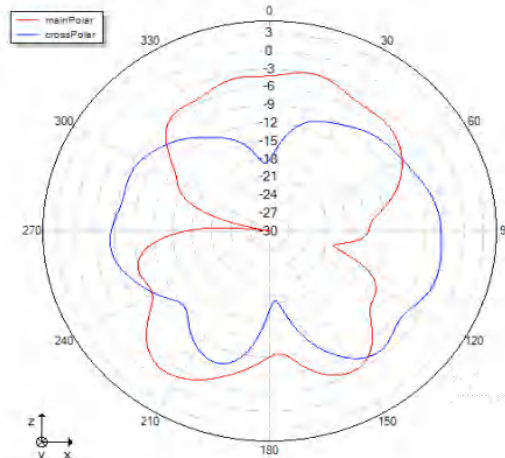








Phi=90 freq=2428MHz

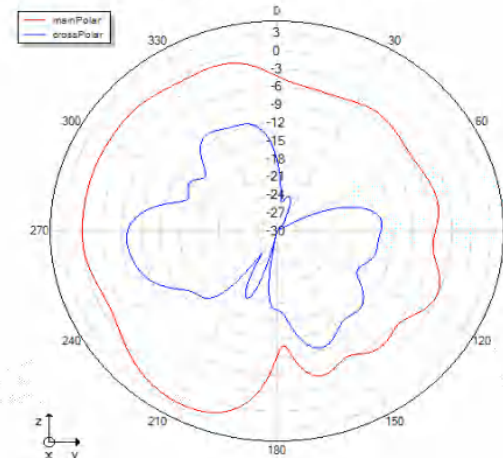


Theta=90 freq=2428MHz

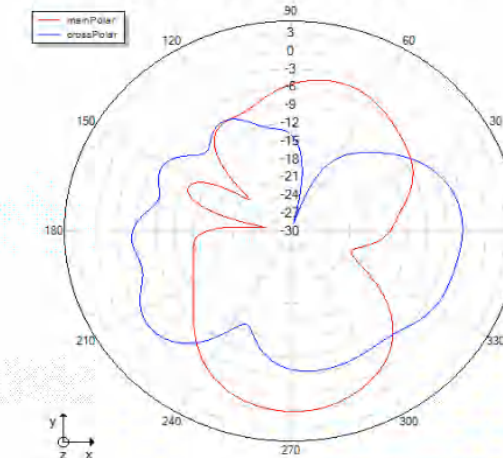


Antenna apple diagram and pattern

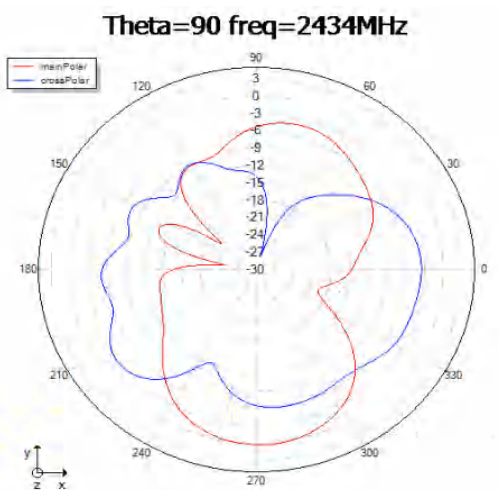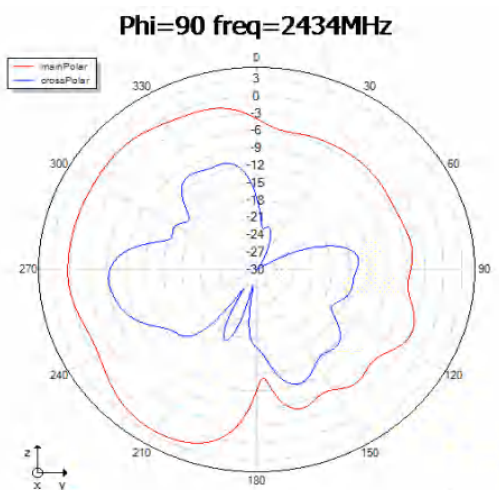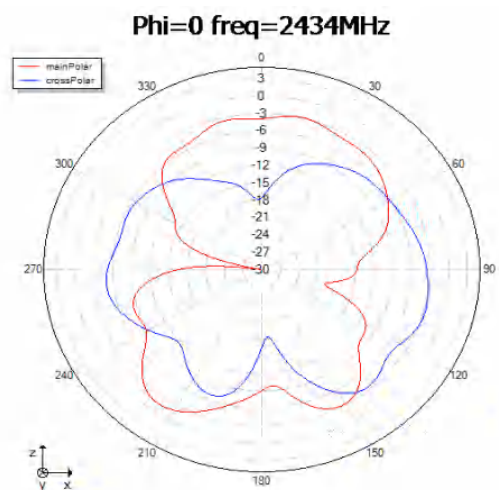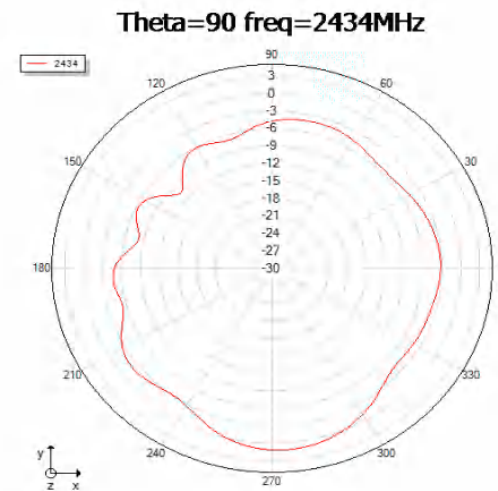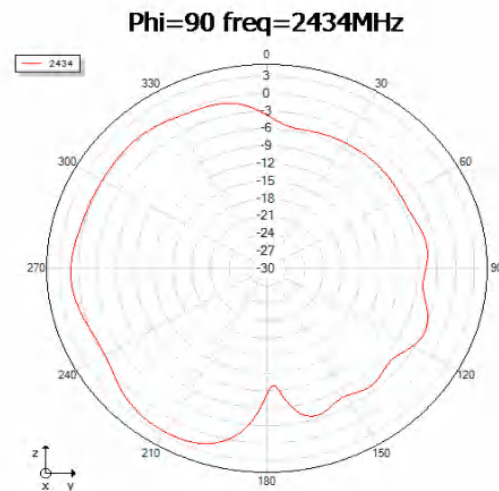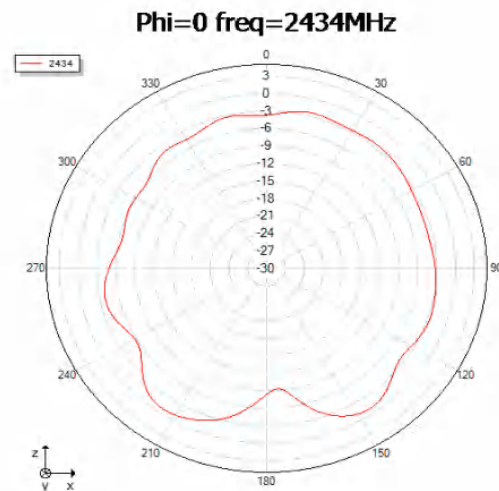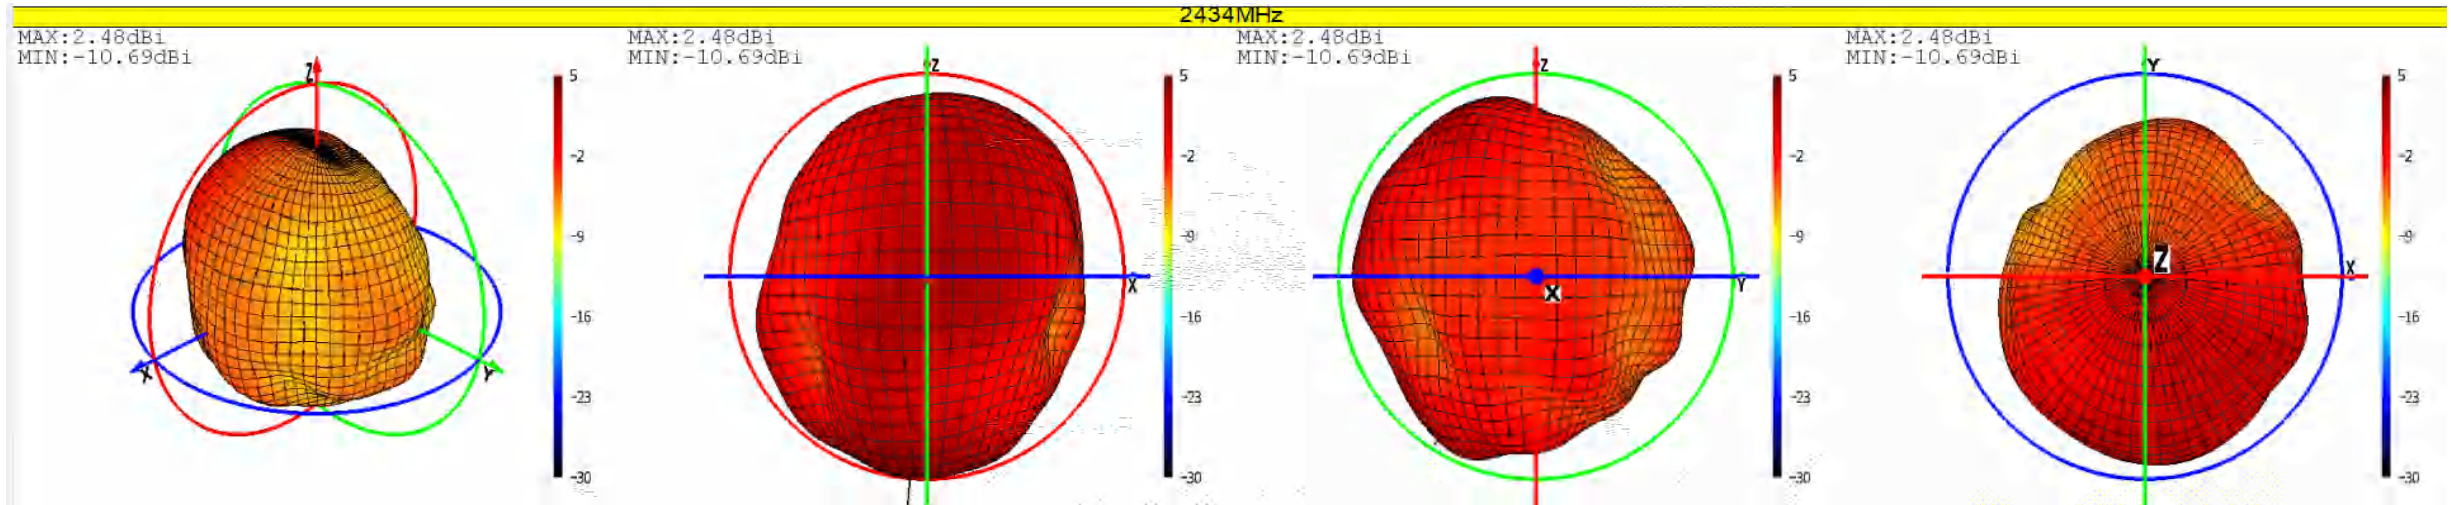


Antenna apple diagram and pattern

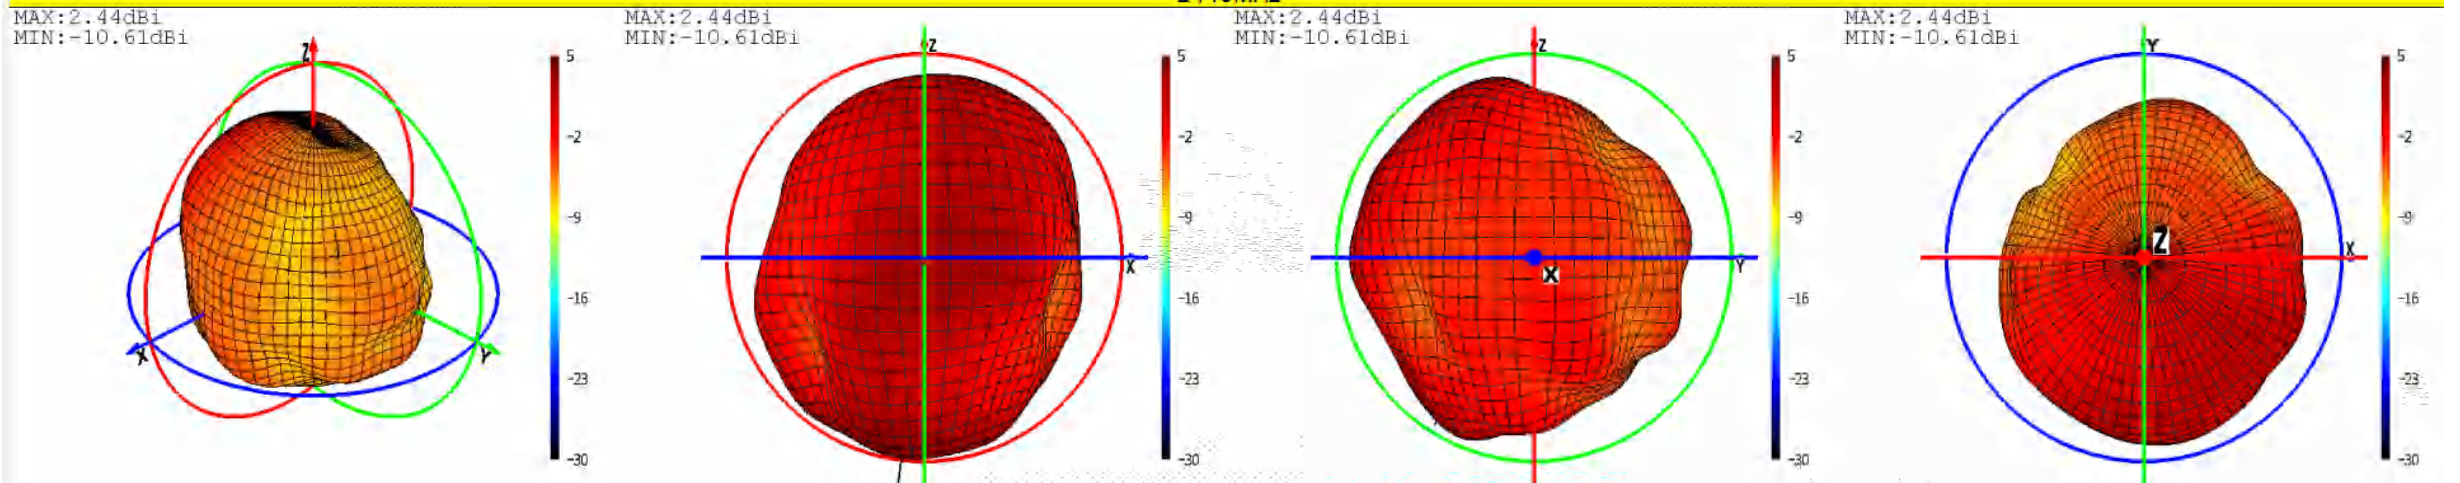


Phi=0 freq=2440MHz

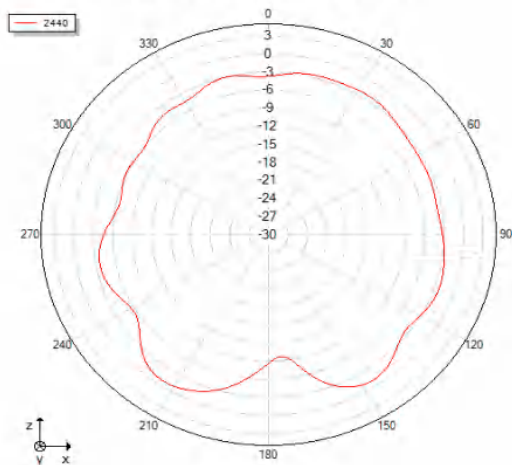


Phi=90 freq=2440MHz

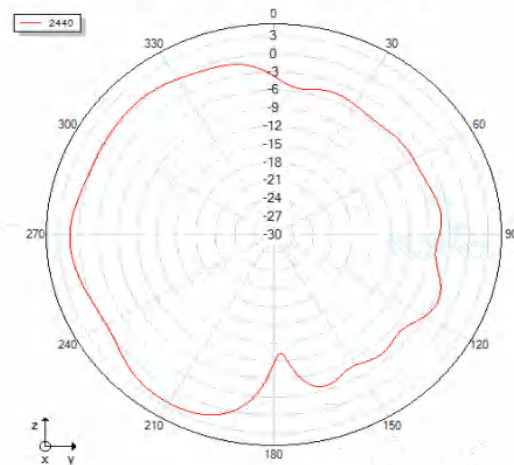


Theta=90 freq=2440MHz

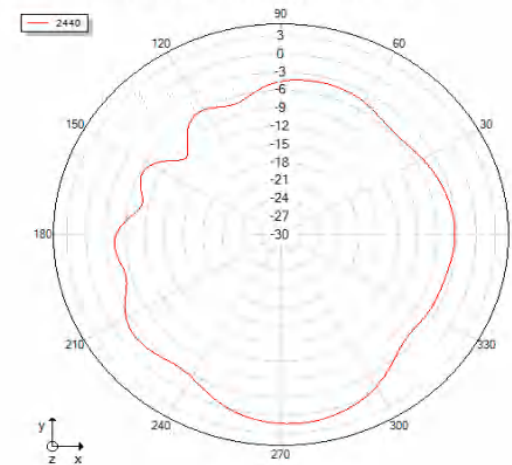


Phi=0 freq=2440MHz

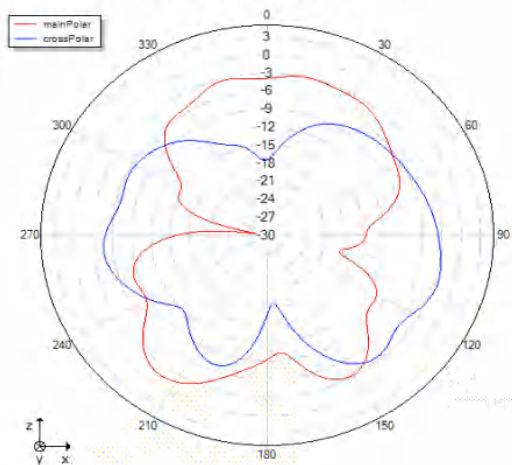

Phi=90 freq=2440MHz

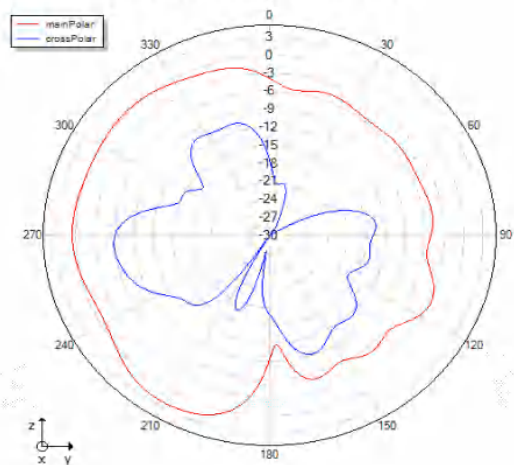


Theta=90 freq=2440MHz

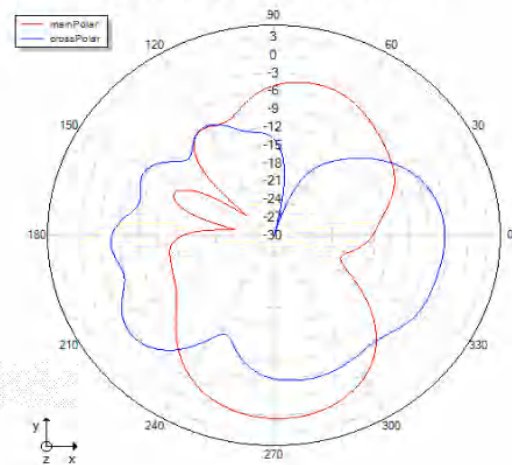


Antenna apple diagram and pattern


MAX: 2.76dBi
MIN: -10.86dBi

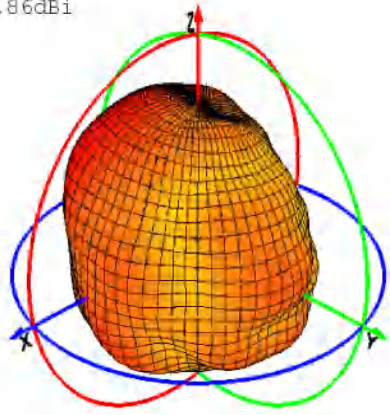


MAX: 2.76dBi
MIN: -10.86dBi

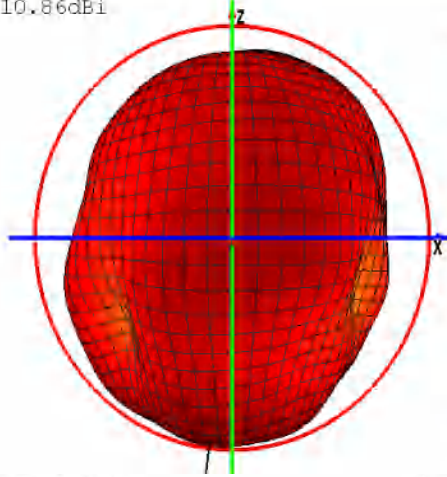


MAX: 2.76dBi
MIN: -10.86dBi

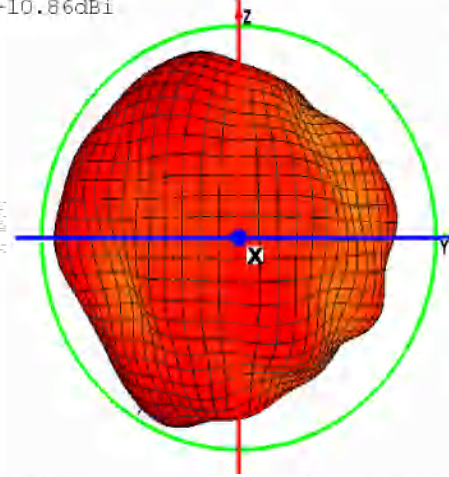


MAX: 2.76dBi
MIN: -10.86dBi

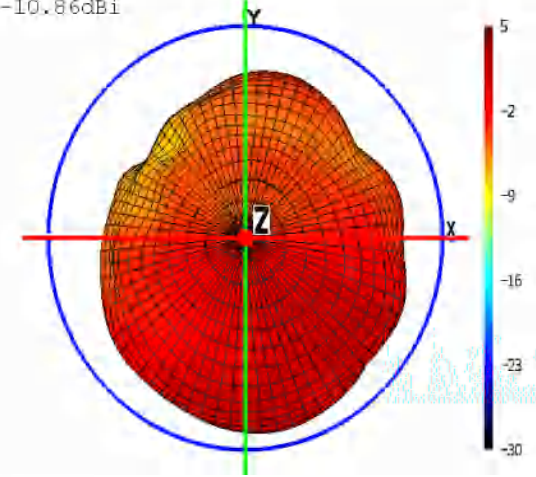


Phi=0 freq=2446MHz

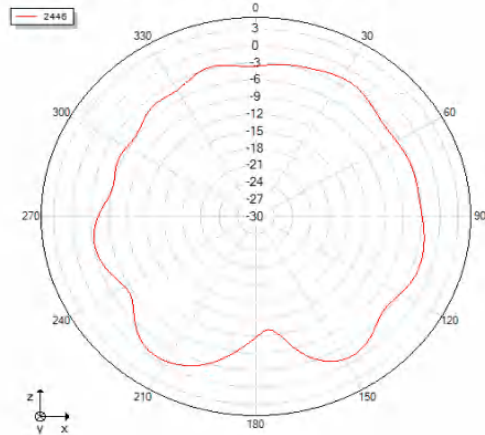


Phi=90 freq=2446MHz

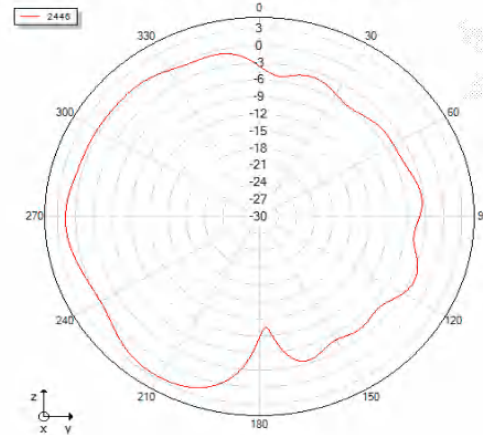


Theta=90 freq=2446MHz

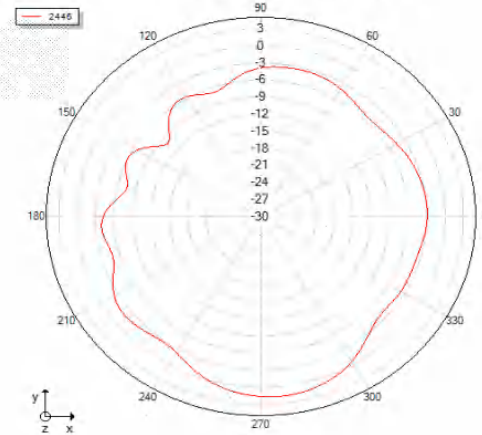


Phi=0 freq=2446MHz

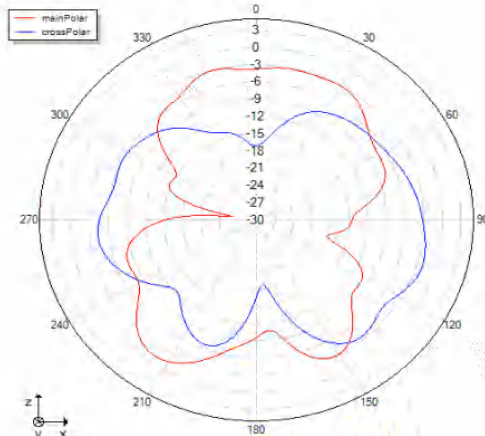








Phi=90 freq=2446MHz

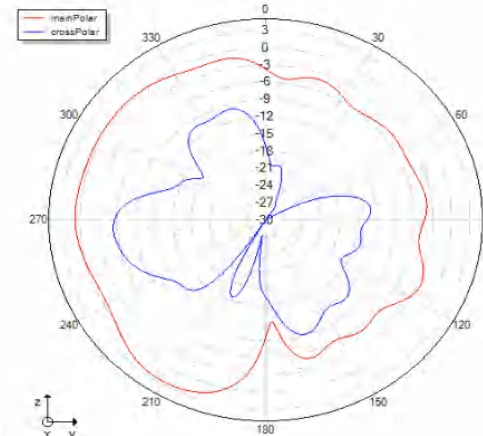

Theta=90 freq=2446MHz

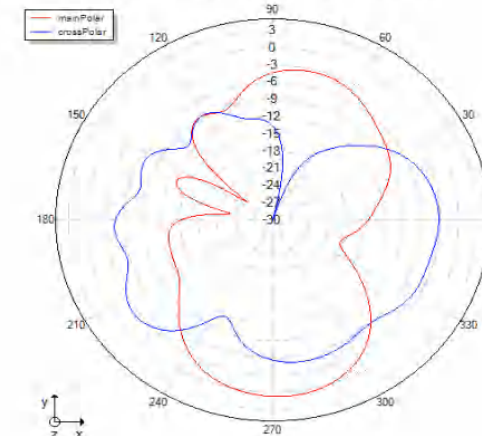


Antenna apple diagram and pattern

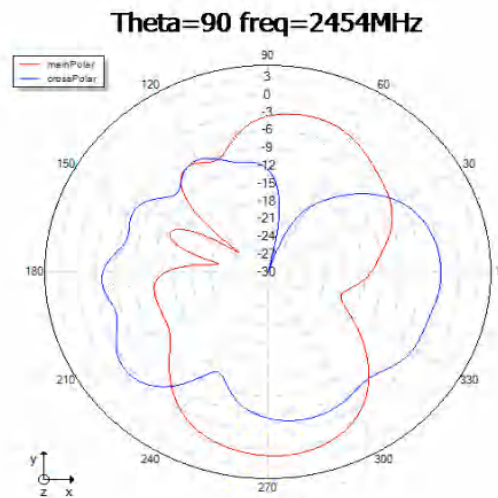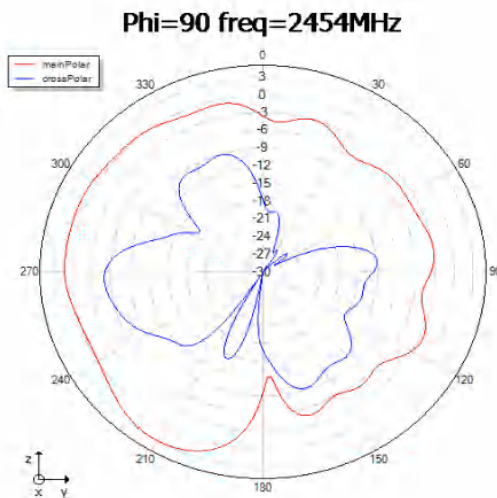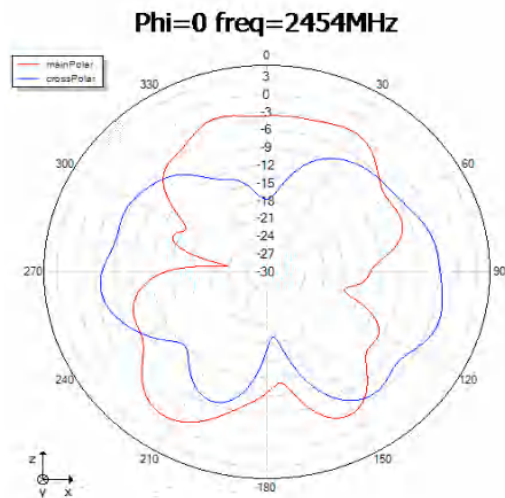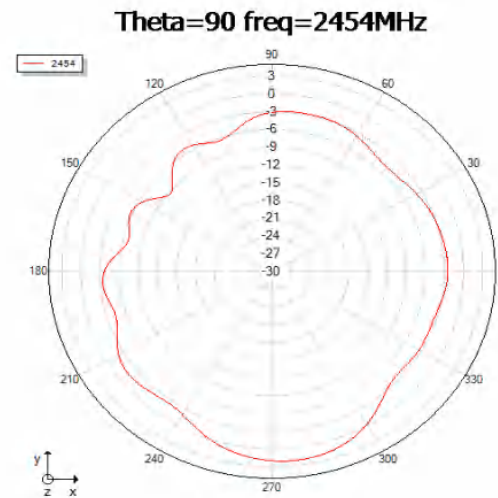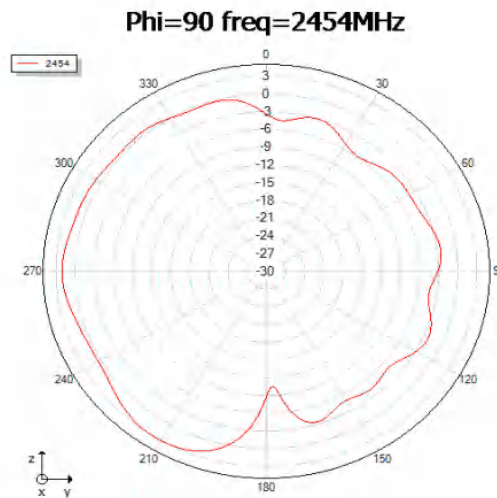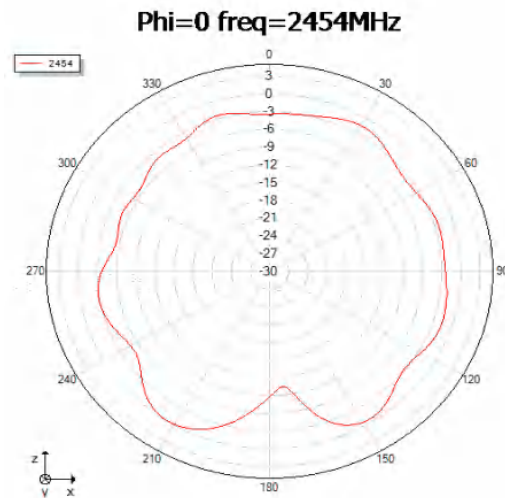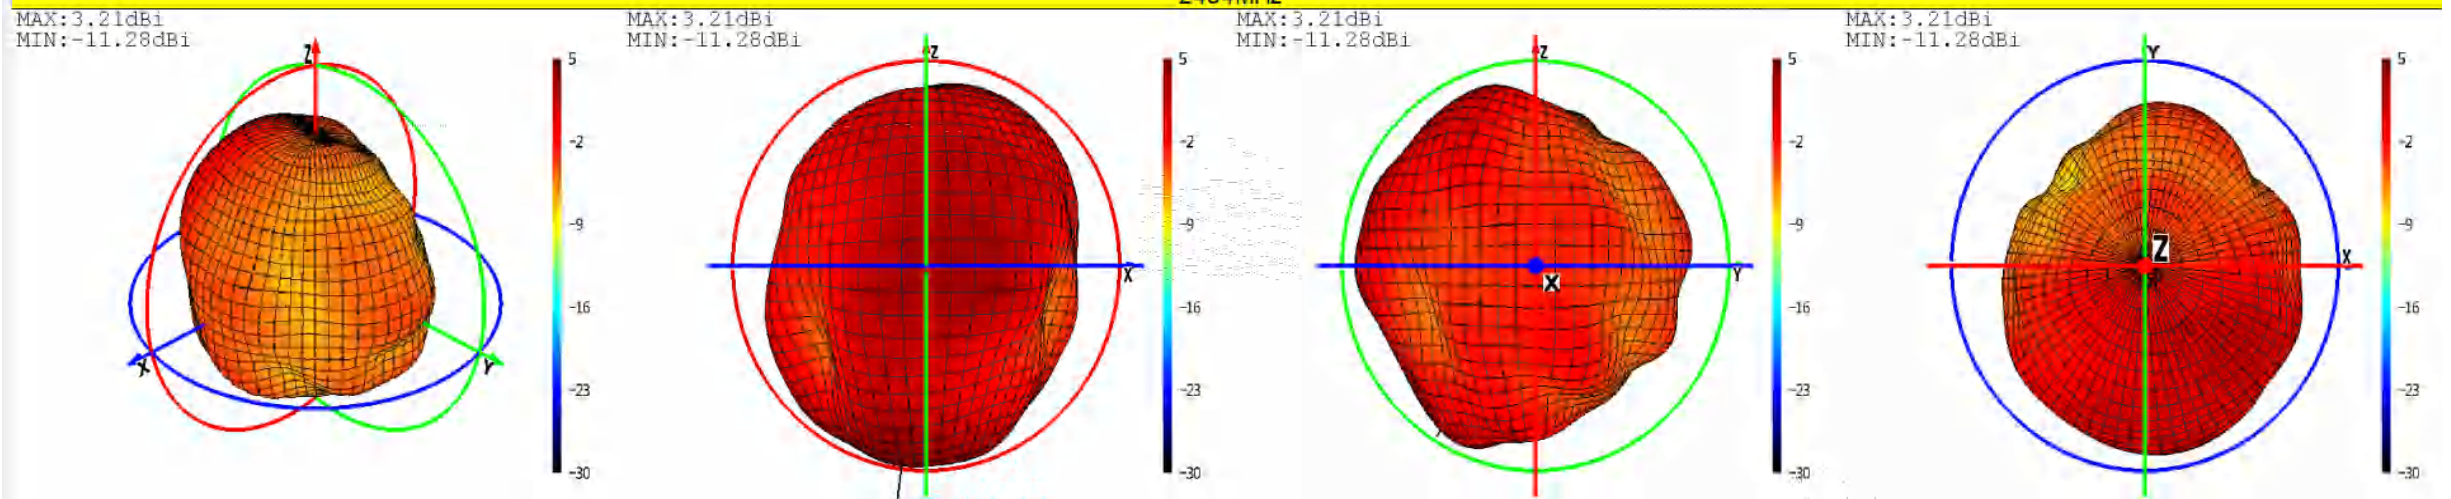


Antenna apple diagram and pattern


2460MHz

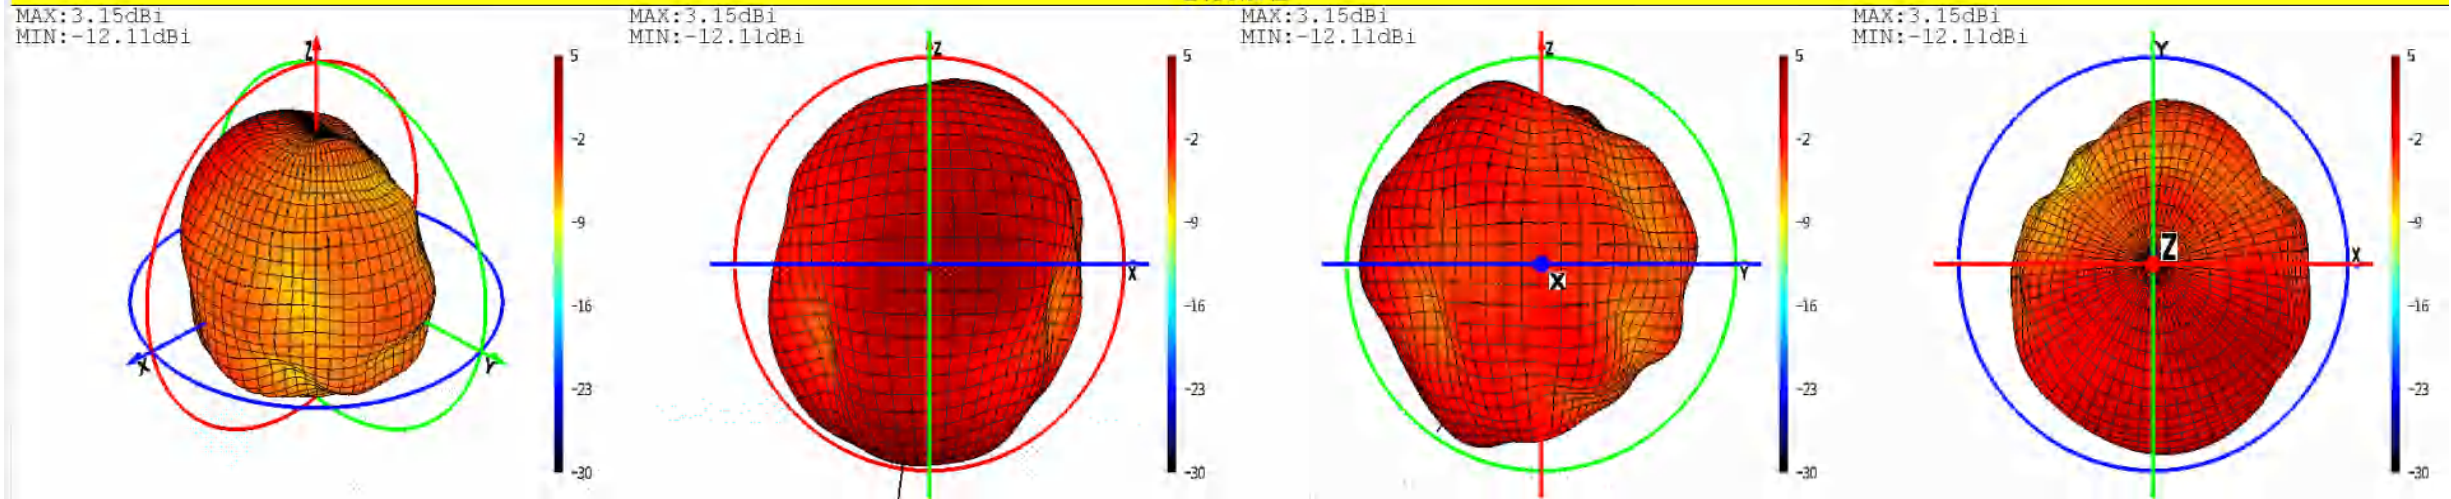


Phi=0 freq=2460MHz

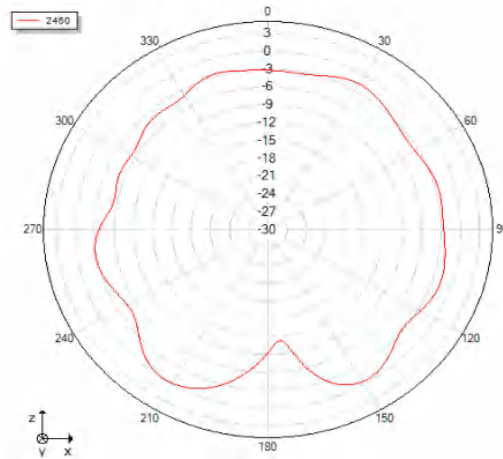


Phi=90 freq=2460MHz

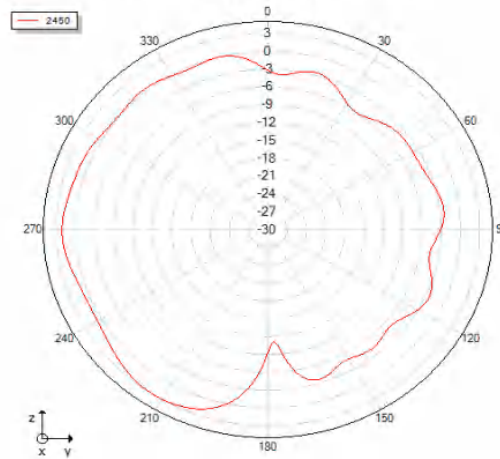


Theta=90 freq=2460MHz

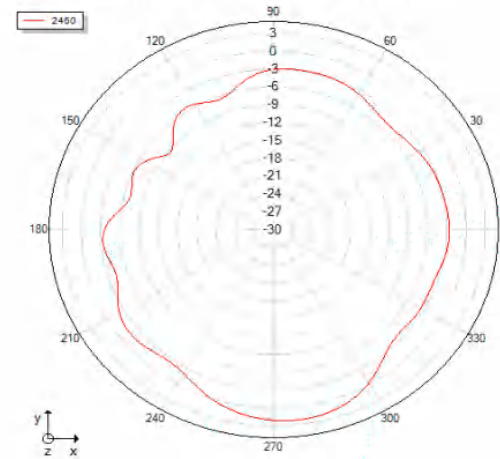


Phi=0 freq=2460MHz

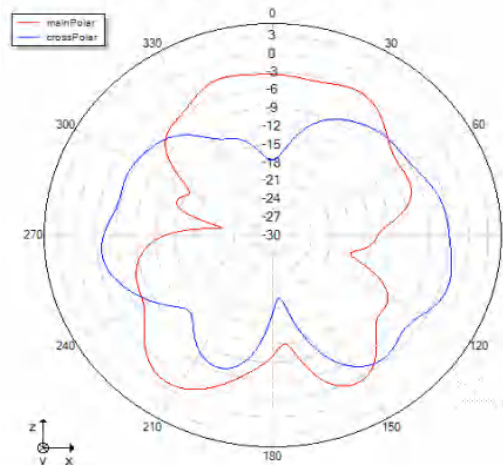








Phi=90 freq=2460MHz

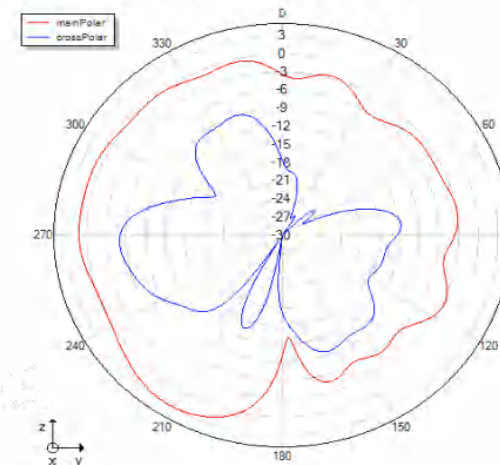




Theta=90 freq=2460MHz

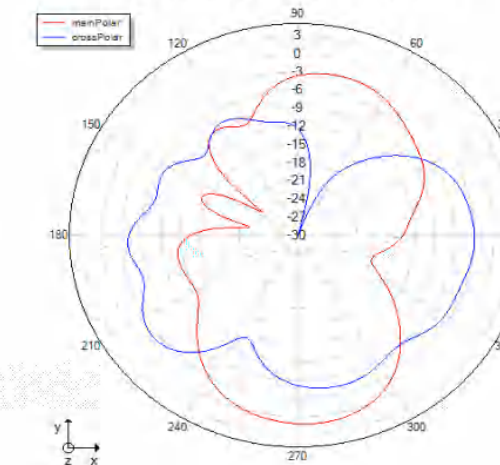


Antenna apple diagram and pattern

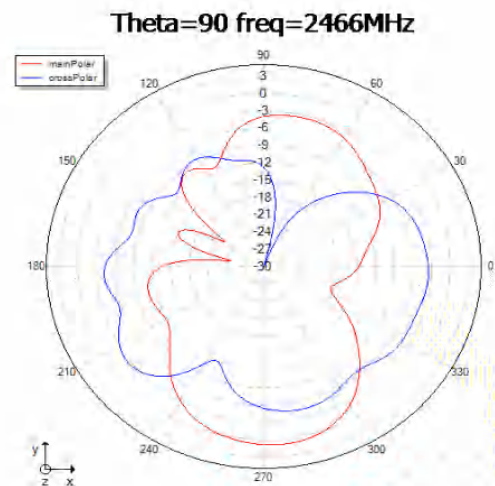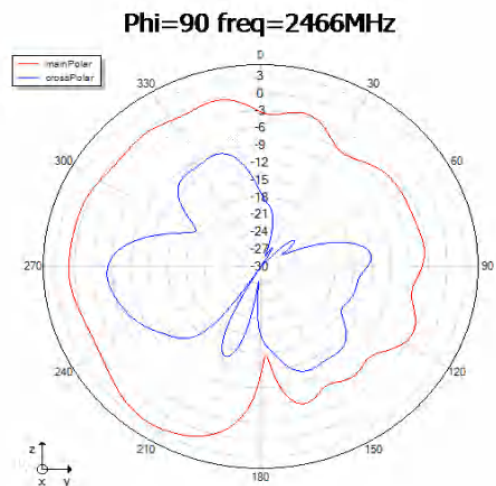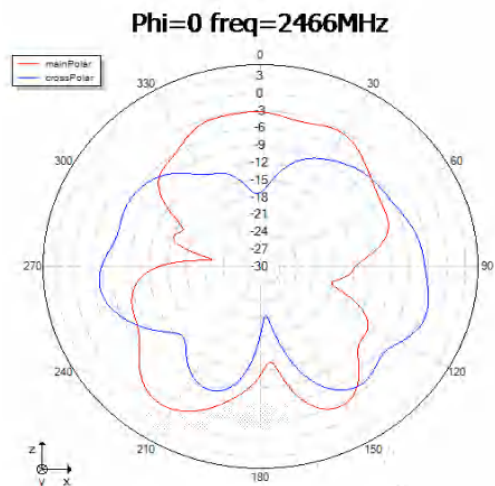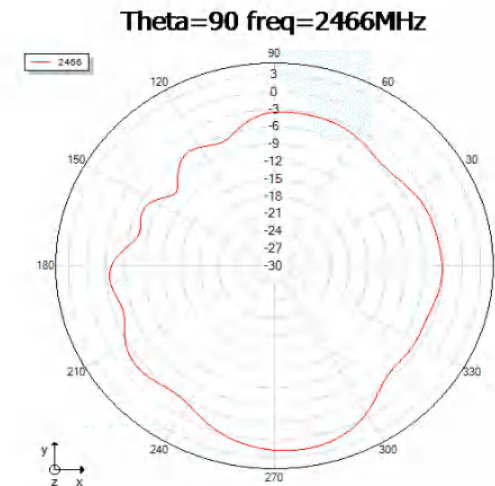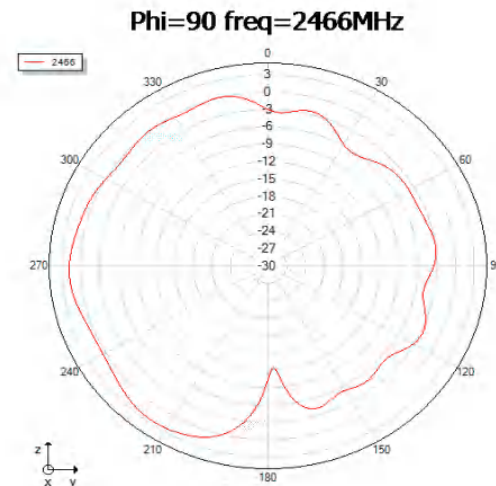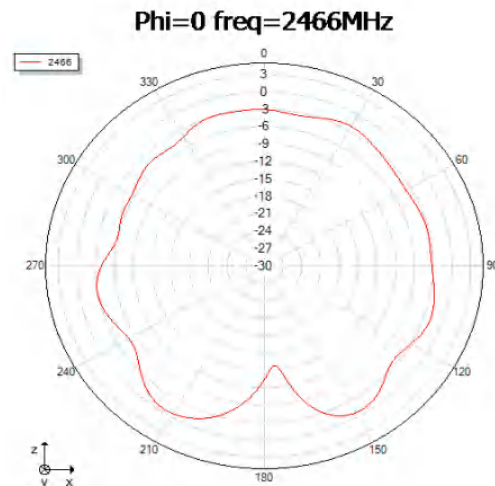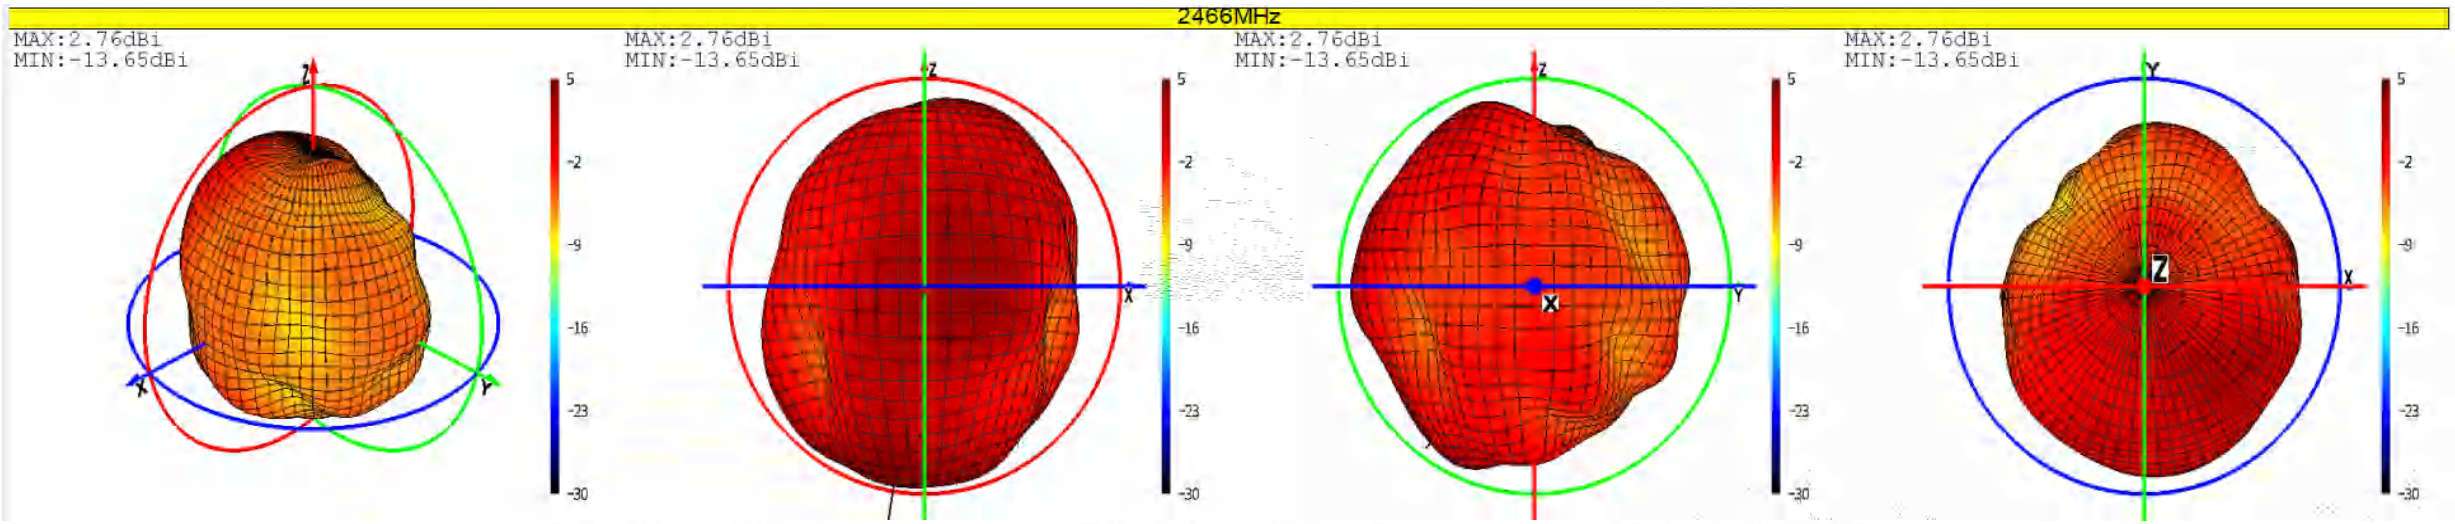


Antenna apple diagram and pattern

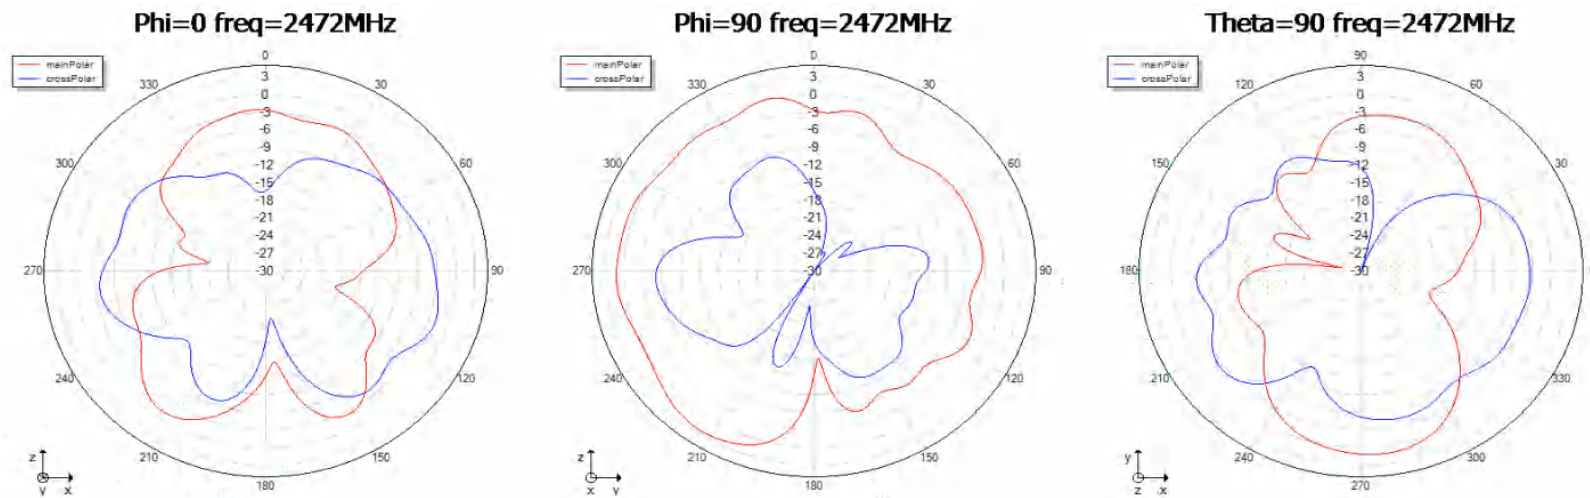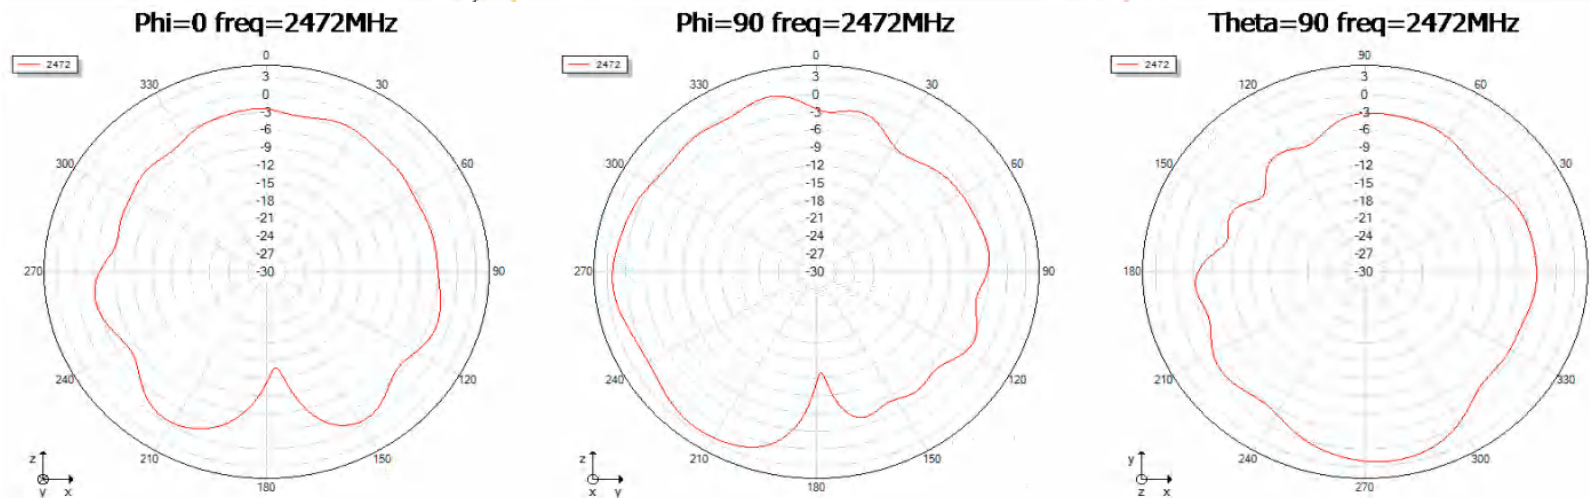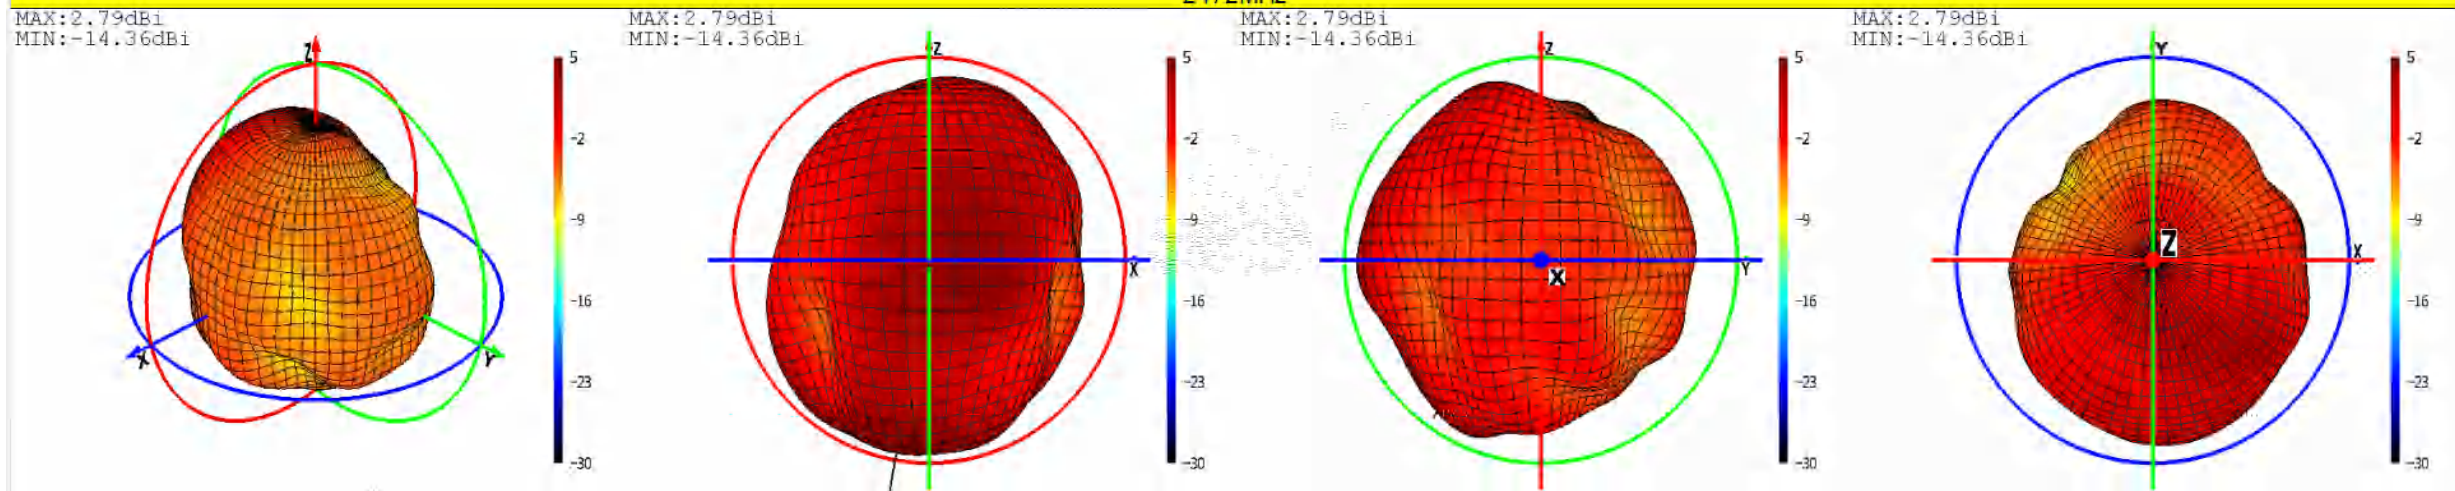


Antenna apple diagram and pattern

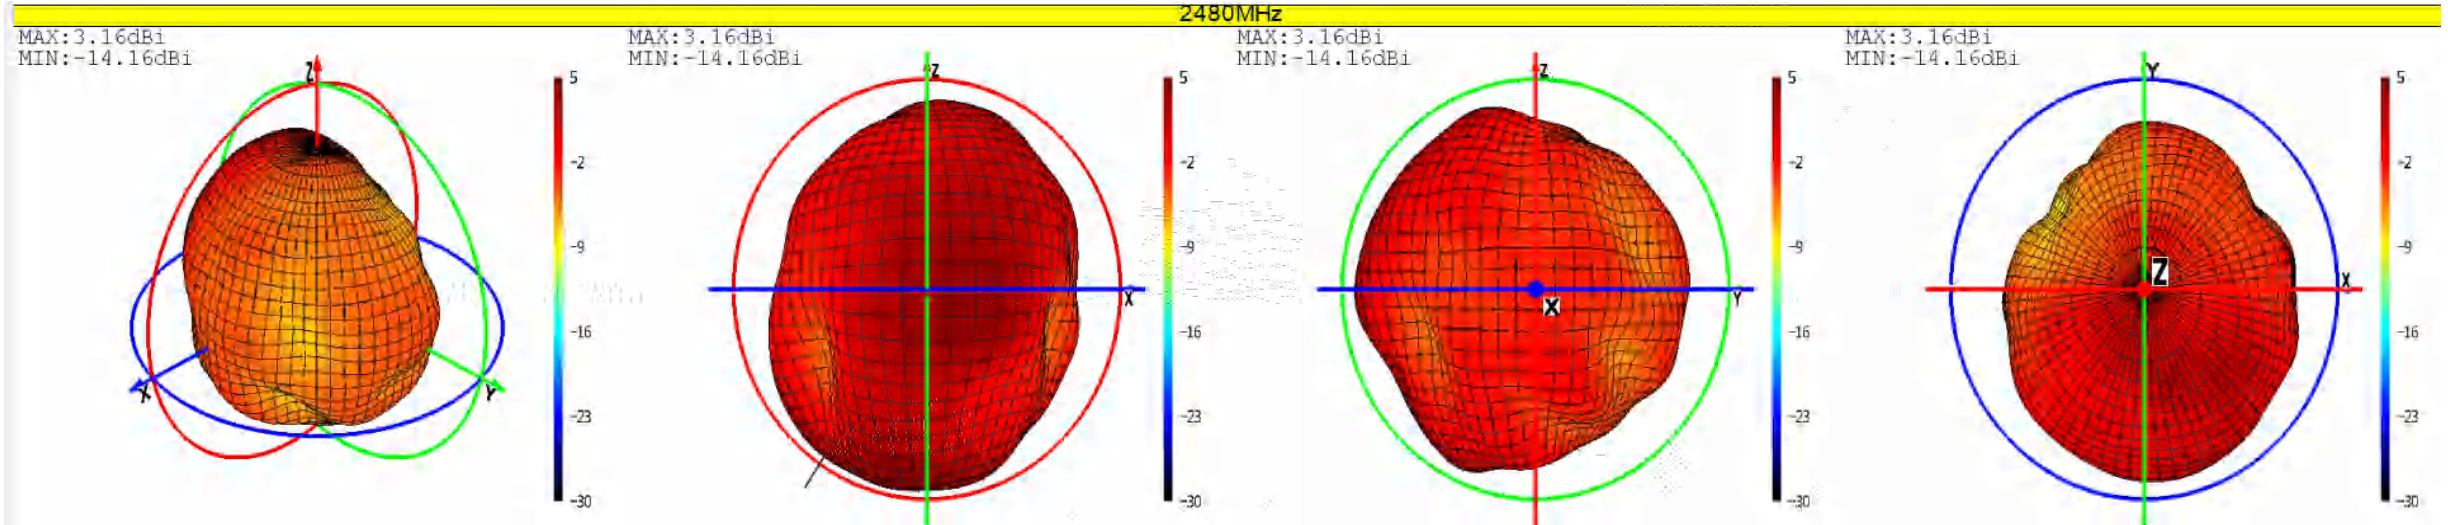


Phi=0 freq=2480MHz

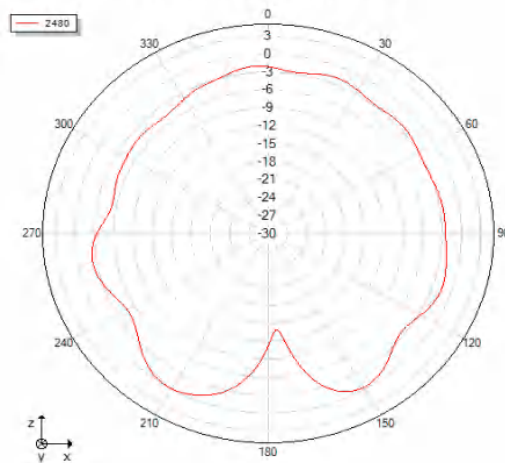


Phi=90 freq=2480MHz

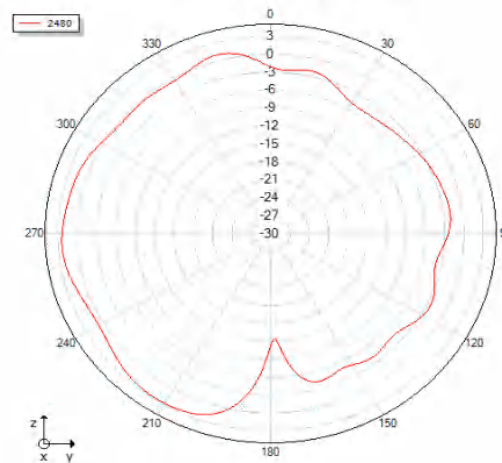


Theta=90 freq=2480MHz

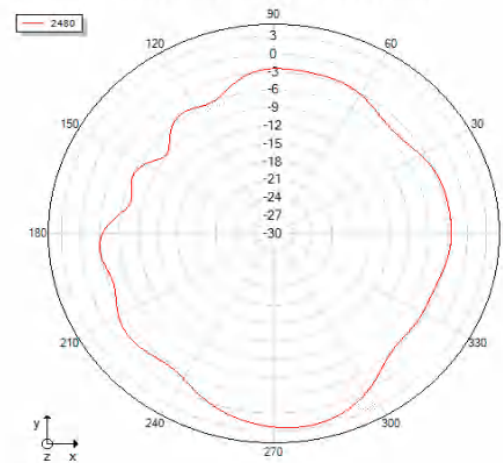


Phi=0 freq=2480MHz

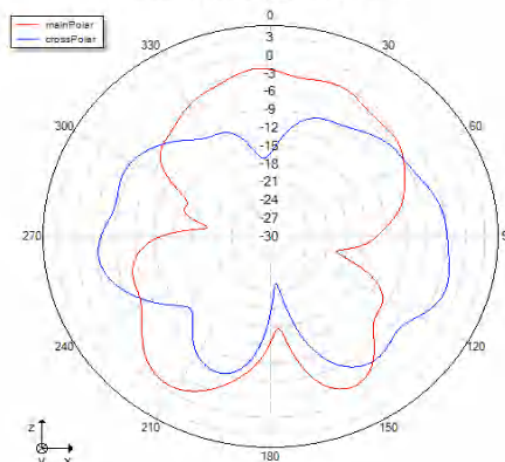

Phi=90 freq=2480MHz


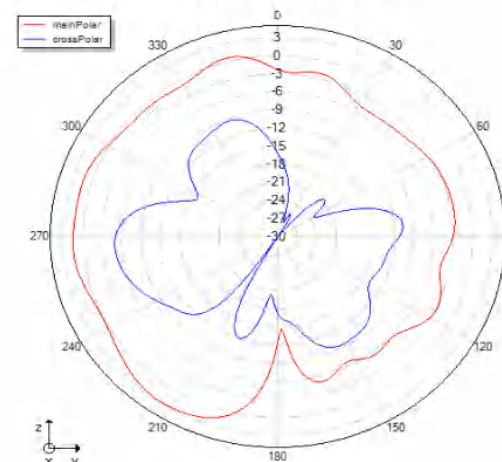


Theta=90 freq=2480MHz

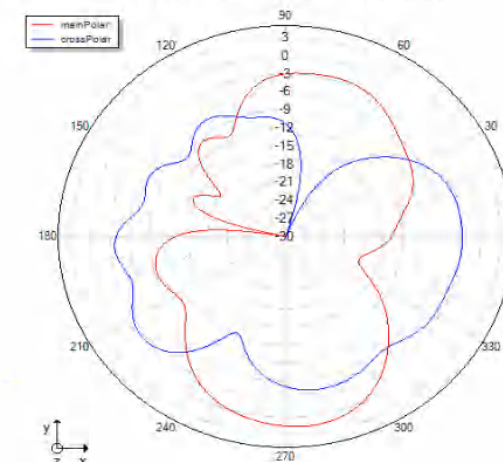

Antenna sticking position and positioning

antenna size

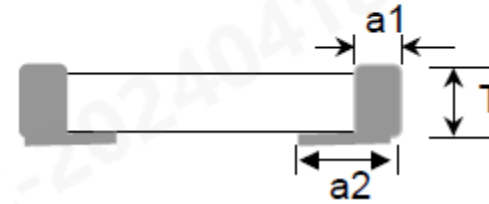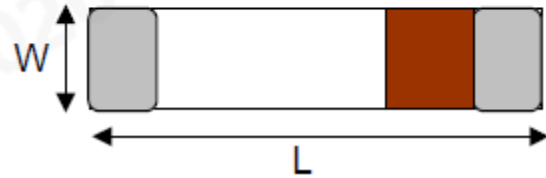

Unit : mm

Mark	L	W	T	a1	a2
Dimensions	8.0 ± 0.2	1.0 ± 0.2	1.0 ± 0.2	0.5 ± 0.2	1.0 ± 0.2

Additional notes

- 📶 Please double-check whether the matching circuitry mentioned in the report has been modified and whether environmental treatment has been introduced, which will directly affect the antenna performance.
- 📶 The parameters provided in this report are only the parameters given by the customer to our company's commissioning prototype, and do not represent the final mass production status of your company's final project.
- 📶 If your company has the latest trial production, or updated status (replacement of materials, update software, change of environmental treatment, etc.) of the prototype, please submit it to our company for verification as soon as possible to confirm whether the antenna performance is affected.
- 📶 If your company needs to send it to a third party for re-testing or to the customer for testing, please be sure to hand over the machine to our company for testing and confirmation, because the consistency of the motherboard, the consistency of the assembly, and the difference in antenna assembly and other factors may lead to the deviation of antenna parameters.