**2TX Antenna 6 + Antenna 5 OFDMA MODE – 242-Tones, RU Index 61**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5180 | 18.968 | 18.918 |
| Mid | 5200 | 18.986 | 18.978 |
| High | 5240 | 18.982 | 19.004 |

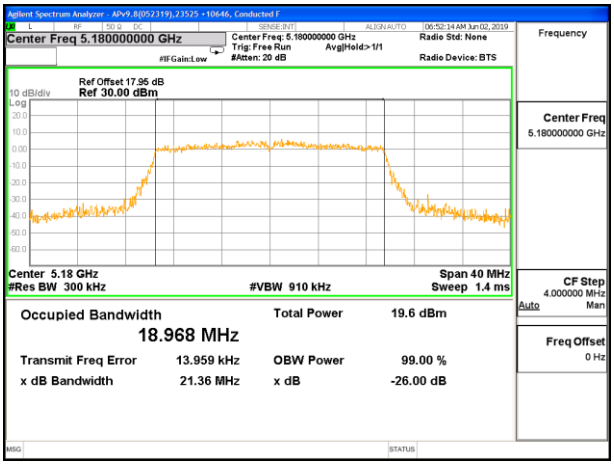


**LOW CHANNEL ANT 6**

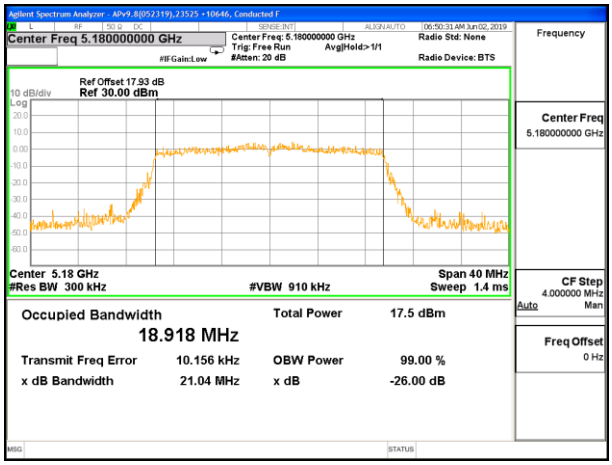


**LOW CHANNEL ANT 5**

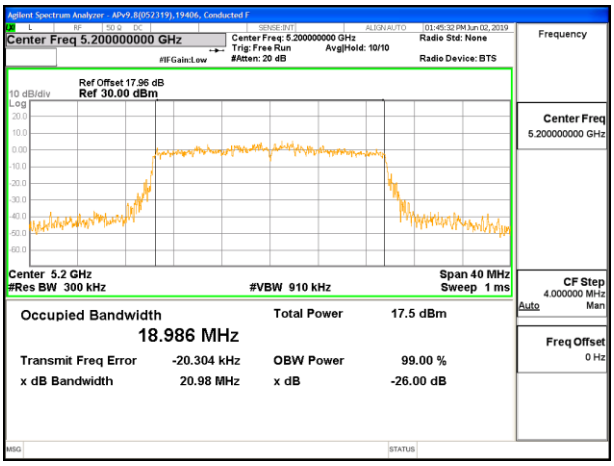


**MID CHANNEL ANT 6**

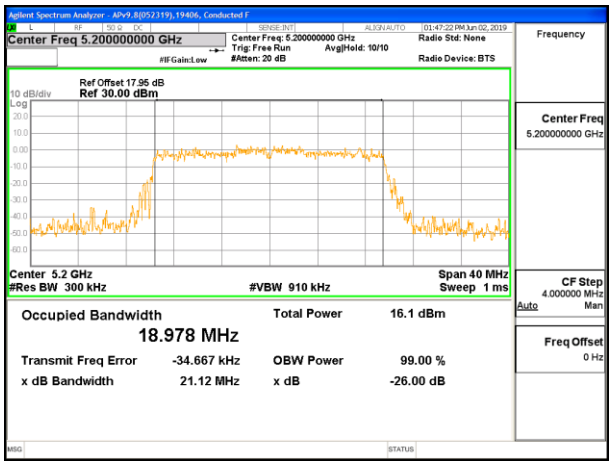


**MID CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

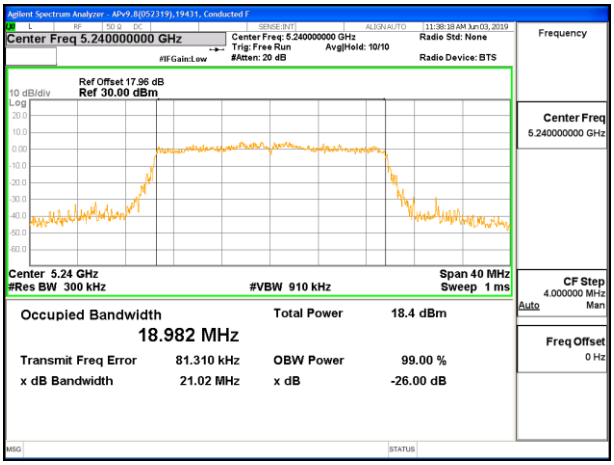


**HIGH CHANNEL ANT 6**

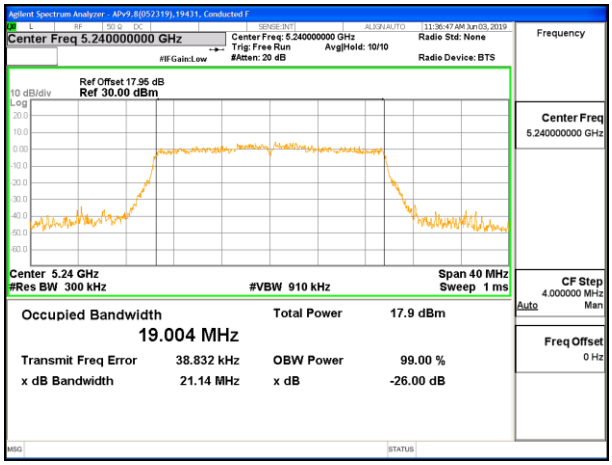


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5180 | 18.572 | 18.435 |
| Mid | 5200 | 18.457 | 18.453 |
| High | 5240 | 18.484 | 18.401 |

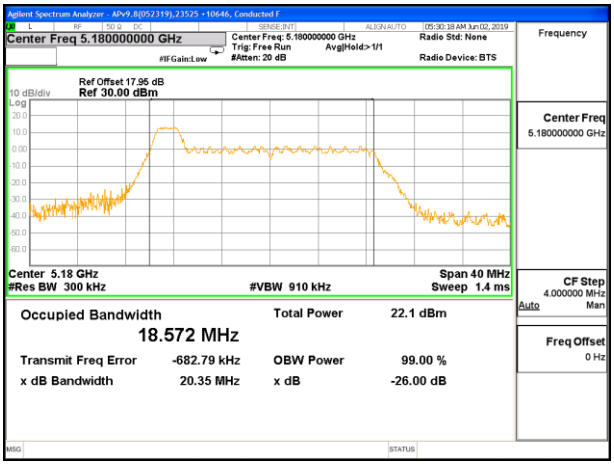


**LOW CHANNEL ANT 6**

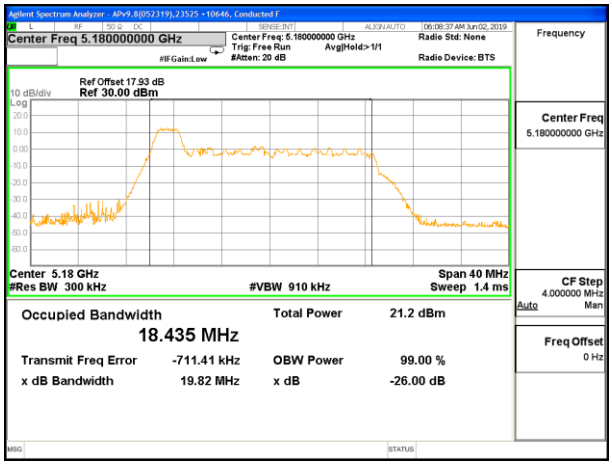


**LOW CHANNEL ANT 5**

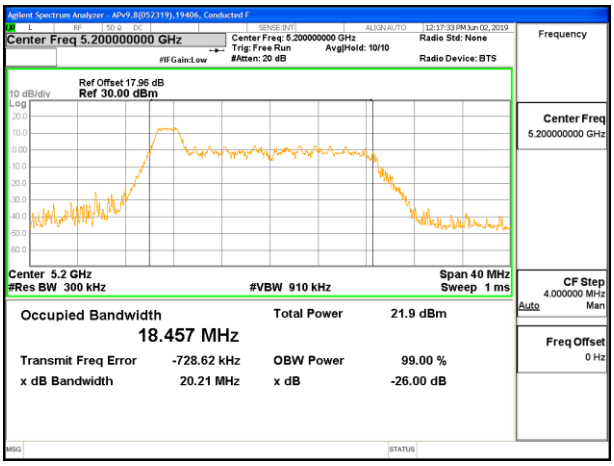


**MID CHANNEL ANT 6**

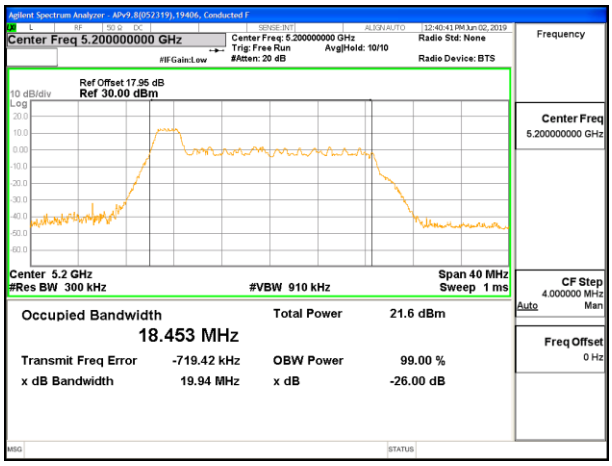


**MID CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

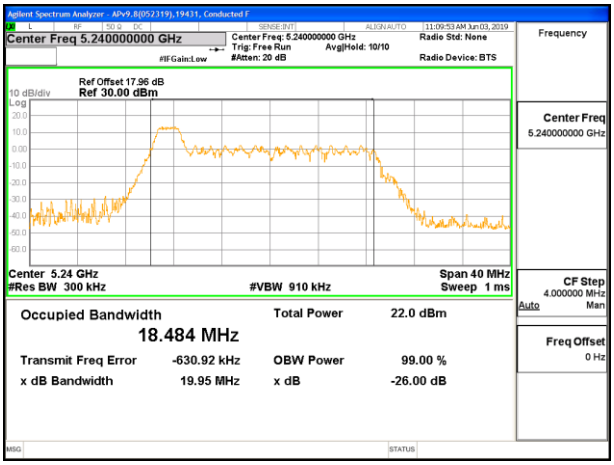


**HIGH CHANNEL ANT 6**

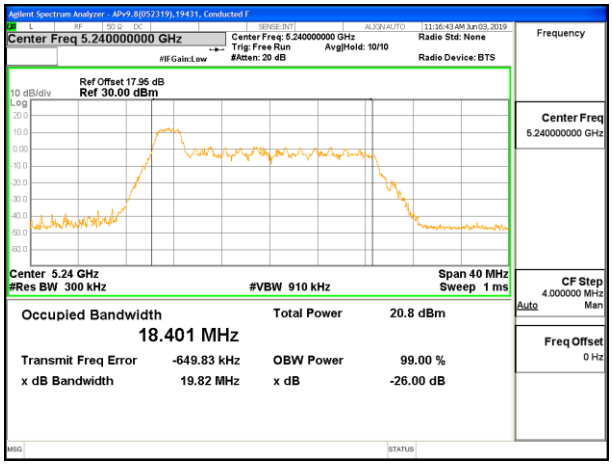


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 4**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5180 | 17.233 | 17.034 |
| Mid | 5200 | 17.423 | 17.011 |
| High | 5240 | 17.251 | 16.852 |

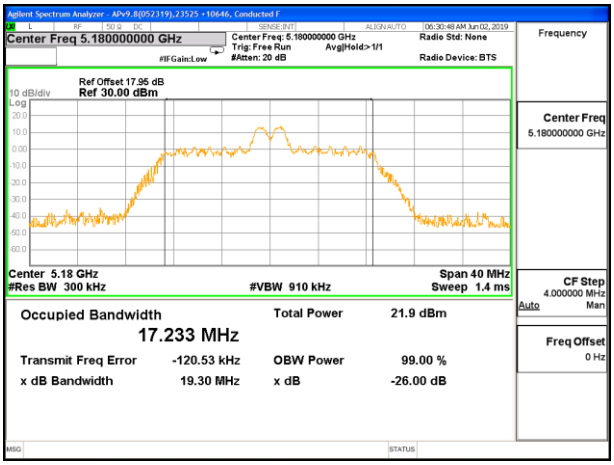


**LOW CHANNEL ANT 6**

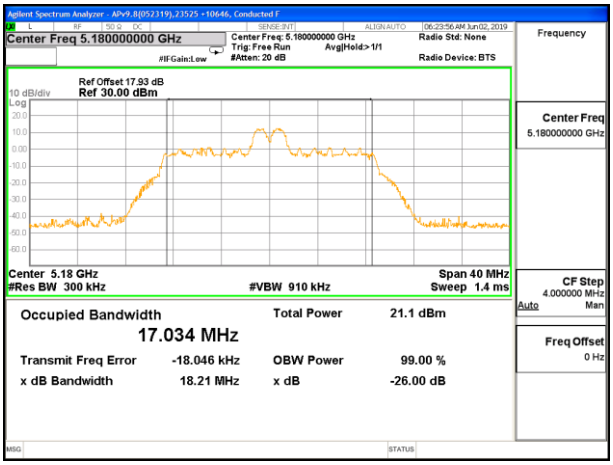


**LOW CHANNEL ANT 5**

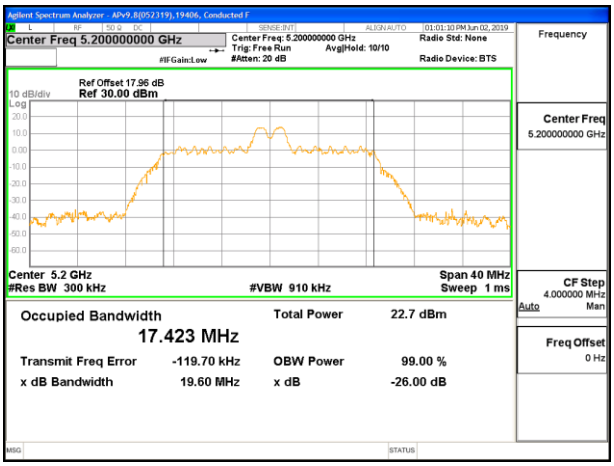


**MID CHANNEL ANT 6**

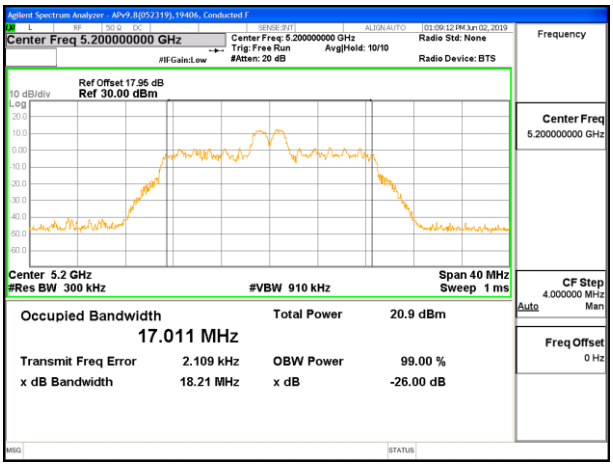


**MID CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

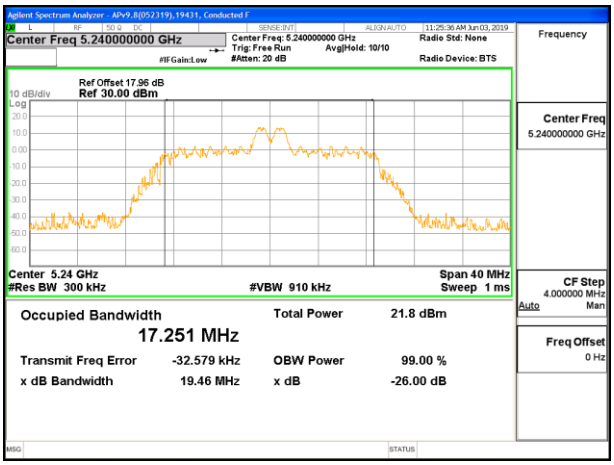


**HIGH CHANNEL ANT 6**

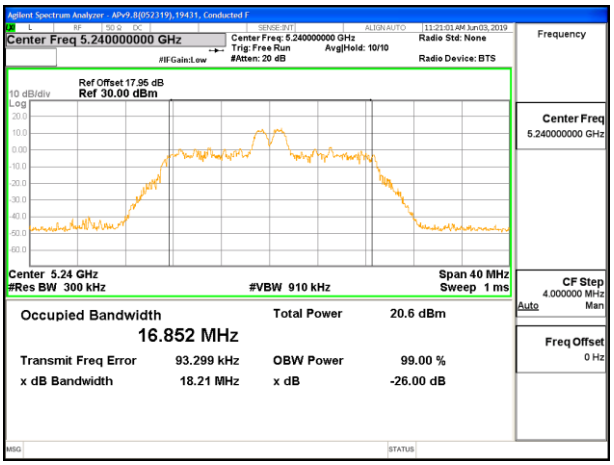


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 8**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5180 | 18.794 | 18.342 |
| Mid | 5200 | 18.844 | 18.464 |
| High | 5240 | 18.540 | 18.184 |

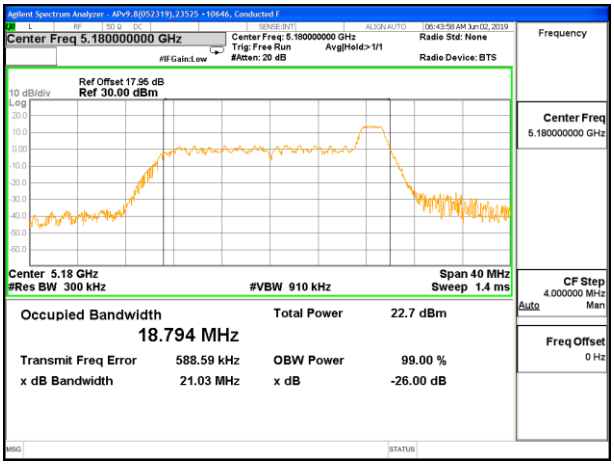


**LOW CHANNEL ANT 6**

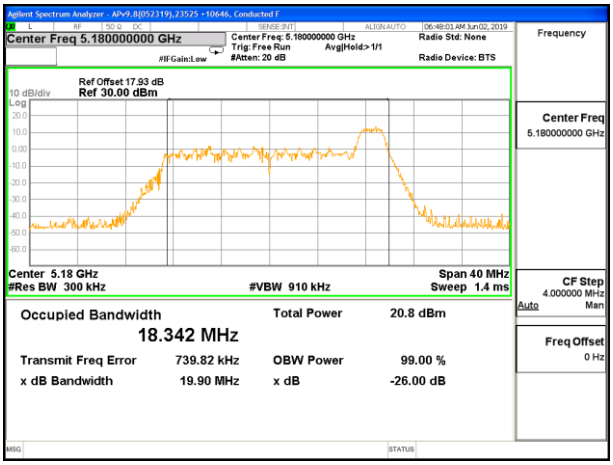


**LOW CHANNEL ANT 5**

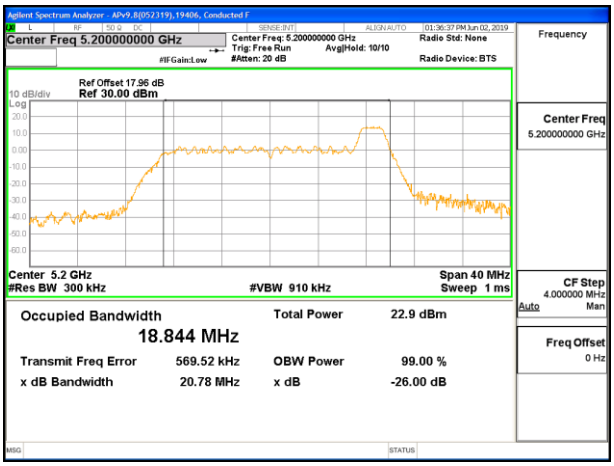


**MID CHANNEL ANT 6**

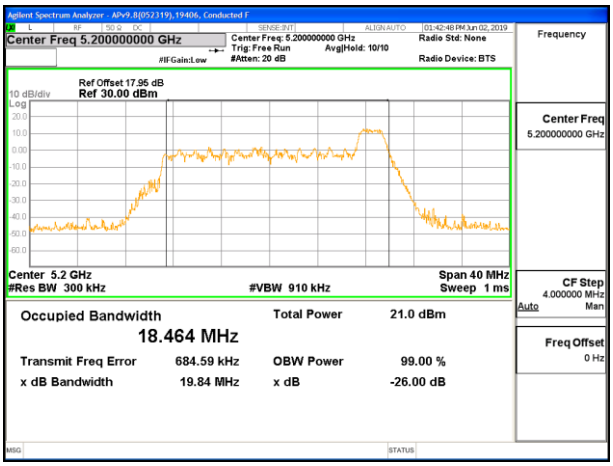


**MID CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

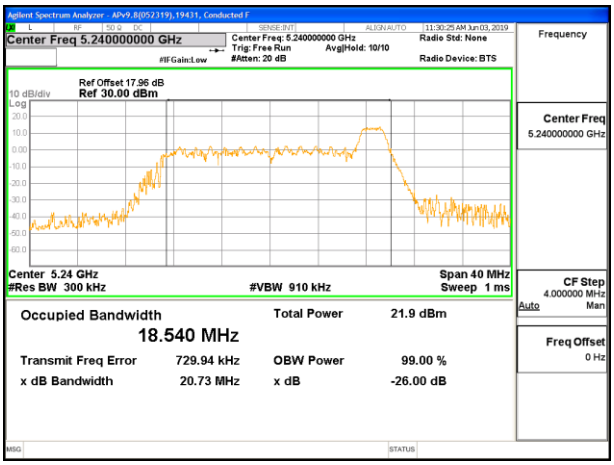


**HIGH CHANNEL ANT 6**

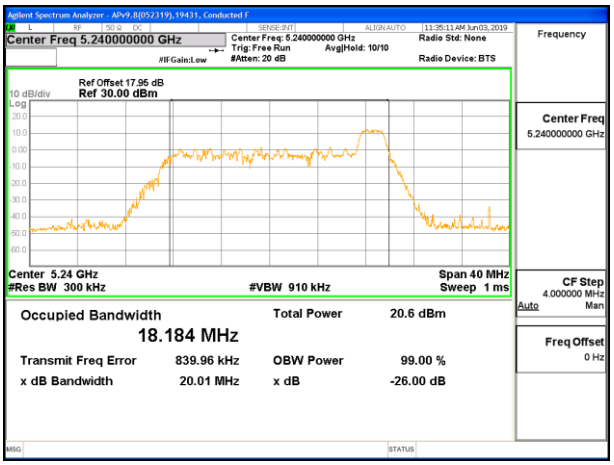


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

## 8.3.5. 802.11ax HE40 MODE IN THE 5.2 GHz BAND

**1TX Antenna 6 MODE – 484-Tones, RU Index 65**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 37.729 |
| High | 5230 | 37.769 |

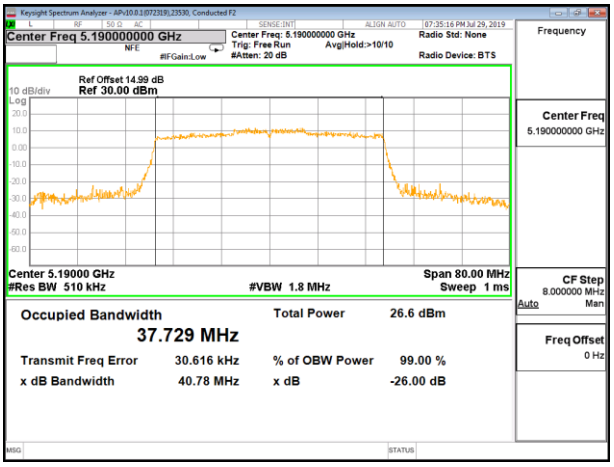


**LOW CHANNEL**

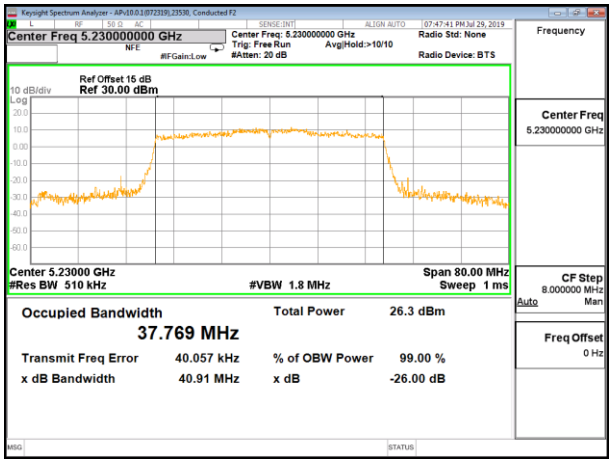


**HIGH CHANNEL**

**1TX Antenna 6 MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 18.425 |
| High | 5230 | 18.829 |

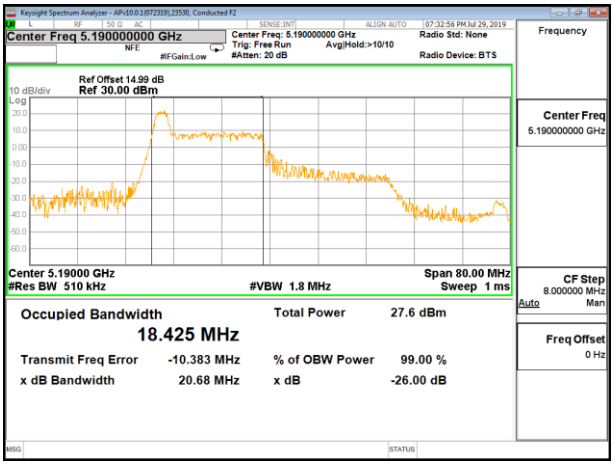


**LOW CHANNEL**

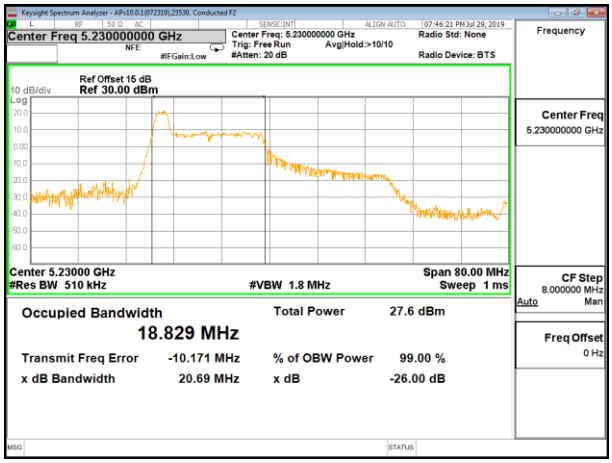


**HIGH CHANNEL**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 6 MODE – 26-Tones, RU Index 8**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 21.545 |
| High | 5230 | 21.590 |

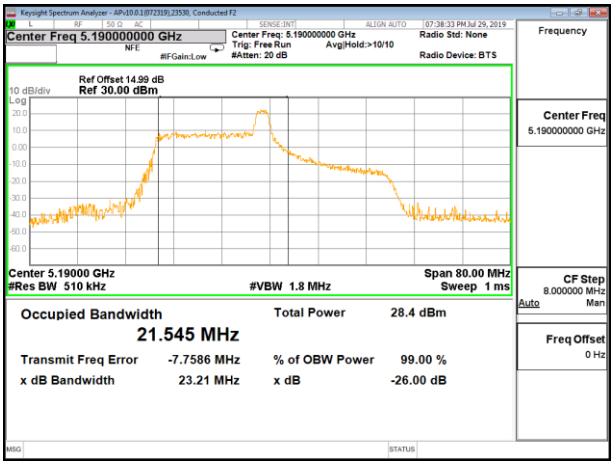


**LOW CHANNEL**

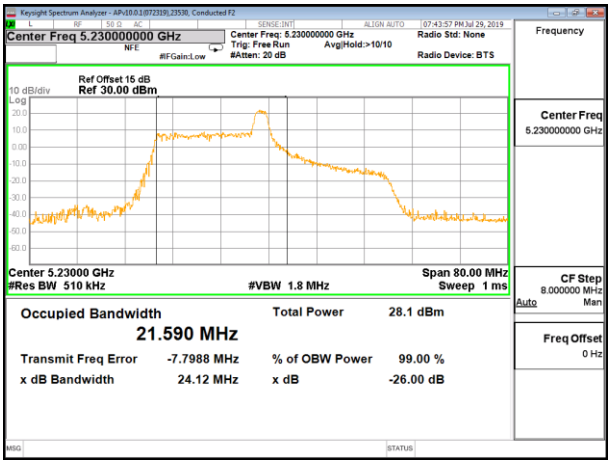


**HIGH CHANNEL**

**1TX Antenna 6 MODE – 26-Tones, RU Index 17**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 18.606 |
| High | 5230 | 18.670 |

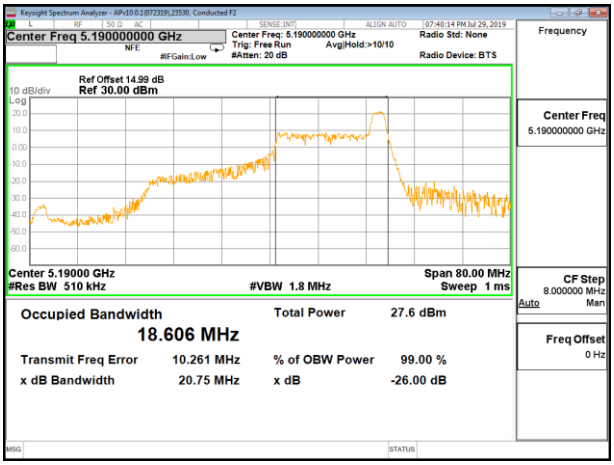


**LOW CHANNEL**

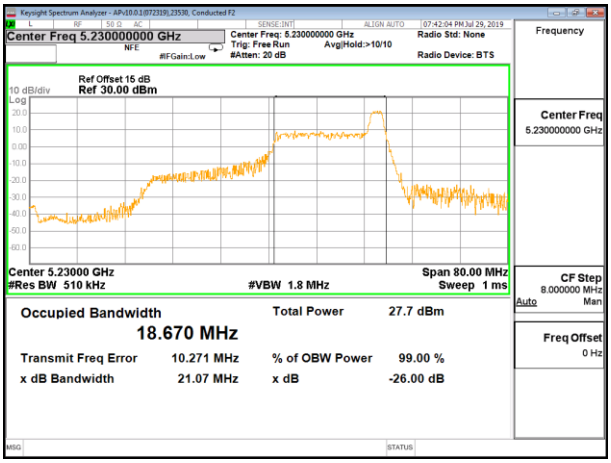


**HIGH CHANNEL**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 5 MODE – 484-Tones, RU Index 65**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 37.737 |
| High | 5230 | 37.731 |

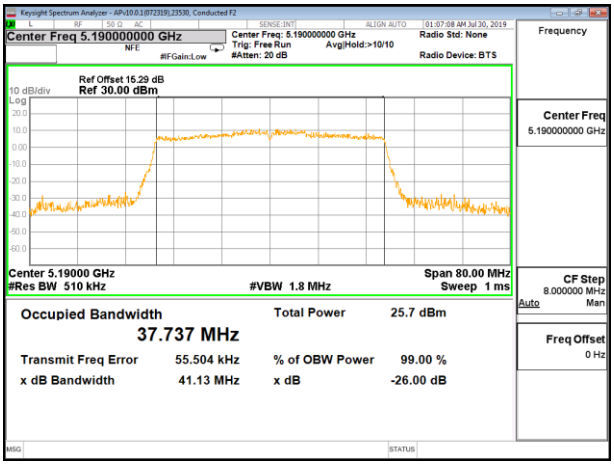


**LOW CHANNEL**

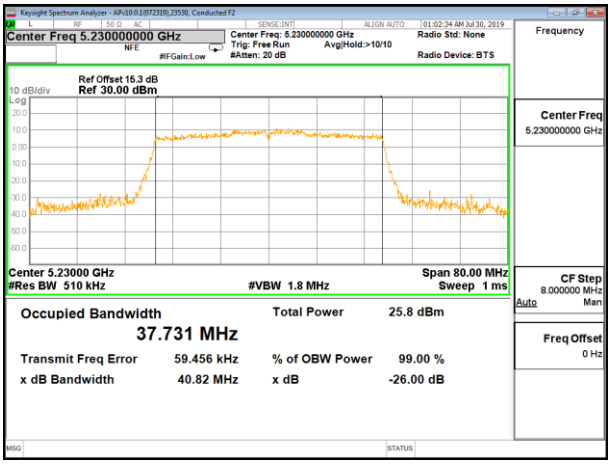


**HIGH CHANNEL**

**1TX Antenna 5 MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 18.528 |
| High | 5230 | 18.444 |

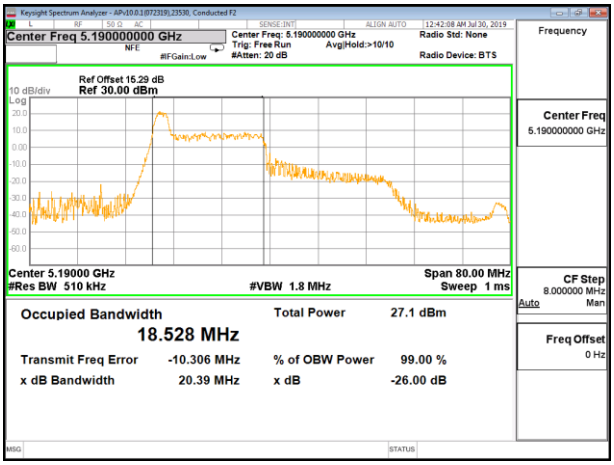


**LOW CHANNEL**

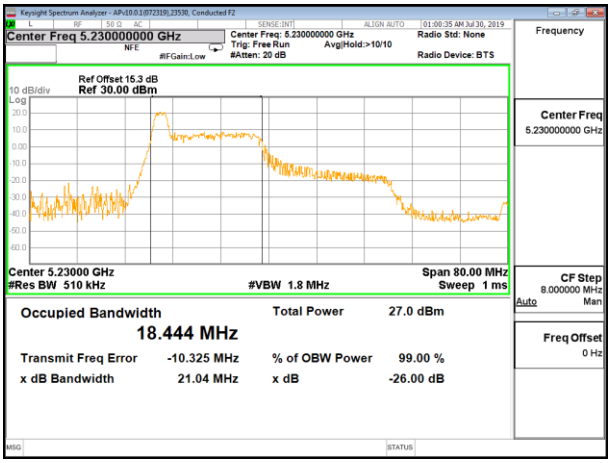


**HIGH CHANNEL**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 5 MODE – 26-Tones, RU Index 8**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 21.647 |
| High | 5230 | 21.970 |

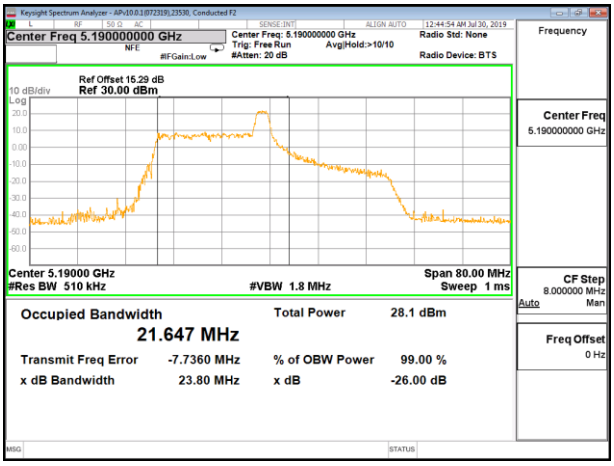


**LOW CHANNEL**

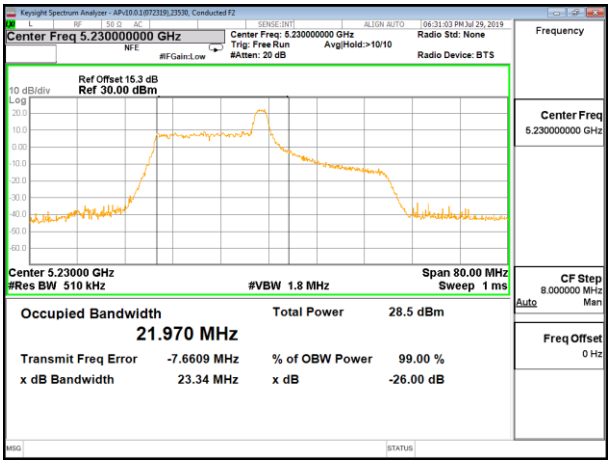


**HIGH CHANNEL**

**1TX Antenna 5 MODE – 26-Tones, RU Index 17**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Low | 5190 | 18.611 |
| High | 5230 | 18.706 |

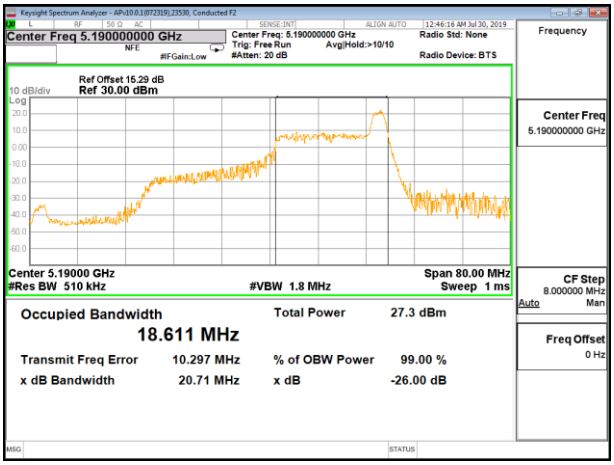


**LOW CHANNEL**

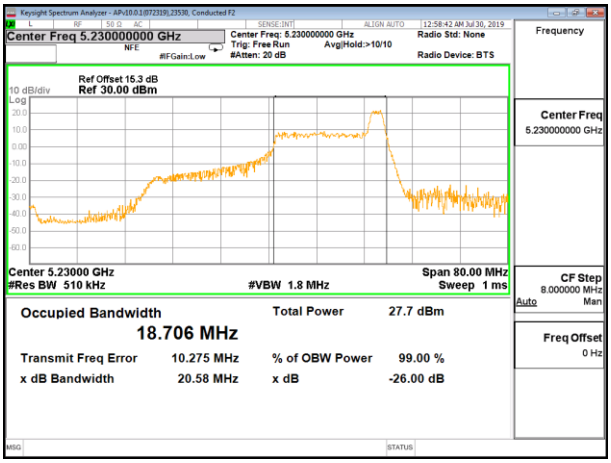


**HIGH CHANNEL**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 484-Tones, RU Index 65**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5190 | 37.742 | 37.713 |
| High | 5230 | 37.735 | 37.737 |

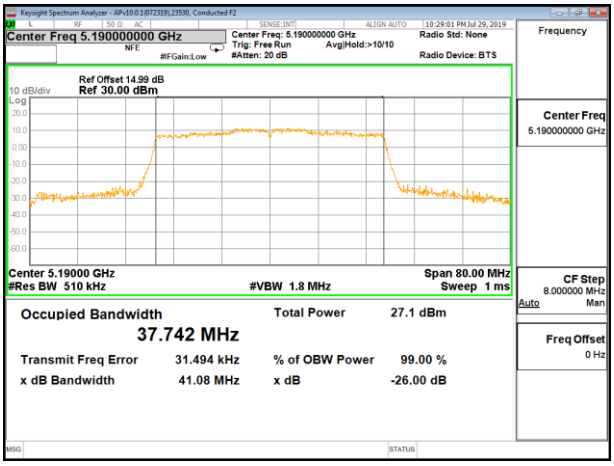


**LOW CHANNEL ANT 6**

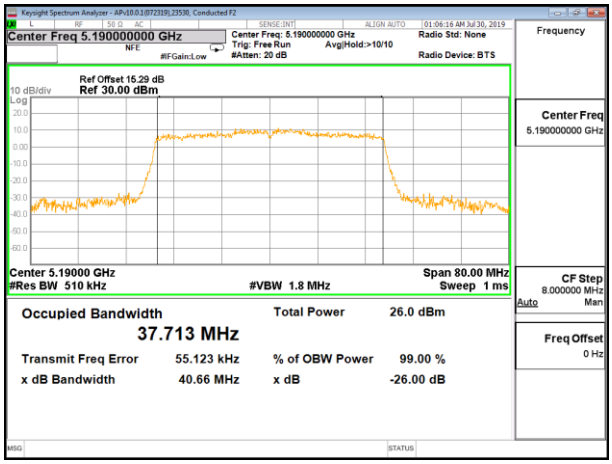


**LOW CHANNEL ANT 5**

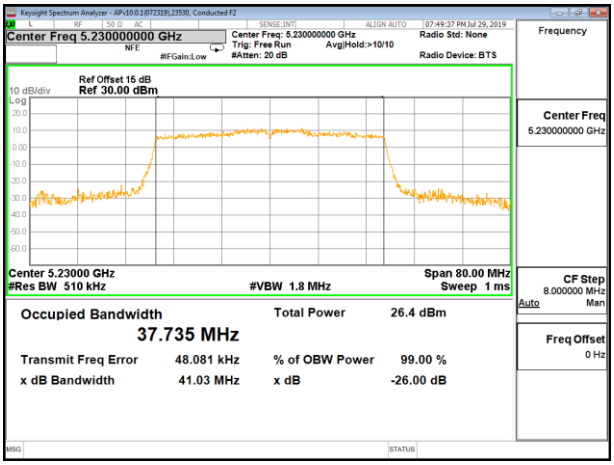


**HIGH CHANNEL ANT 6**

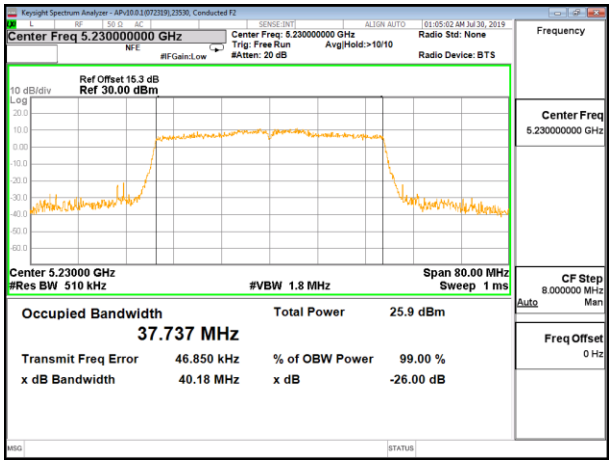


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5190 | 18.528 | 18.324 |
| High | 5230 | 18.687 | 18.391 |

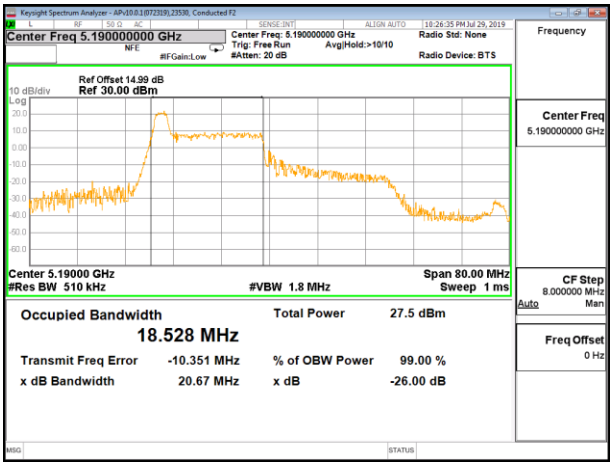


**LOW CHANNEL ANT 6**

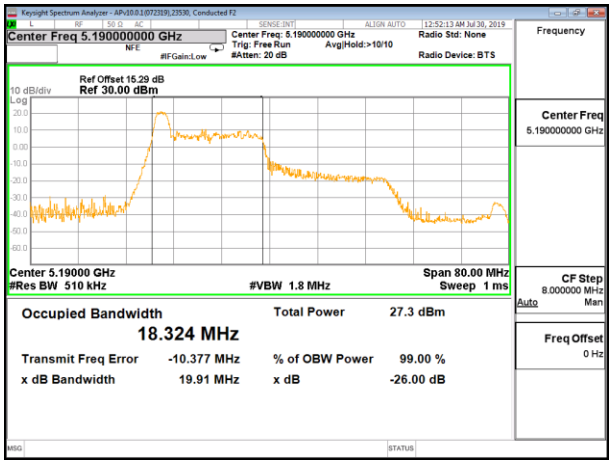


**LOW CHANNEL ANT 5**

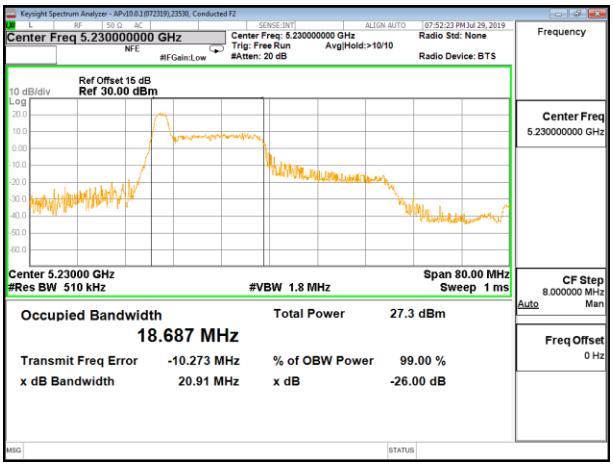


**HIGH CHANNEL ANT 6**

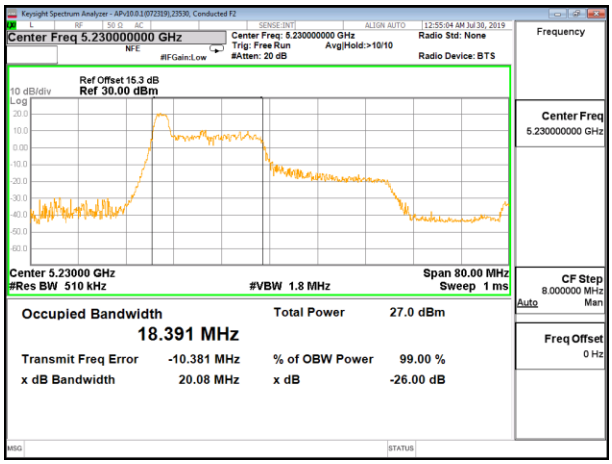


**HIGH CHANNEL ANT 5**


UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 8**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5190 | 21.741 | 21.229 |
| High | 5230 | 21.338 | 21.573 |

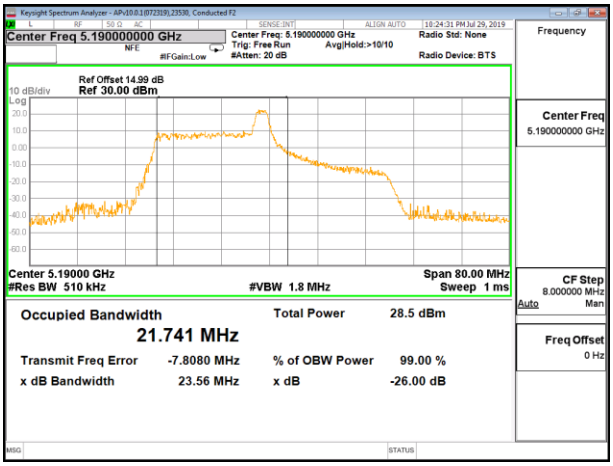


**LOW CHANNEL ANT 6**

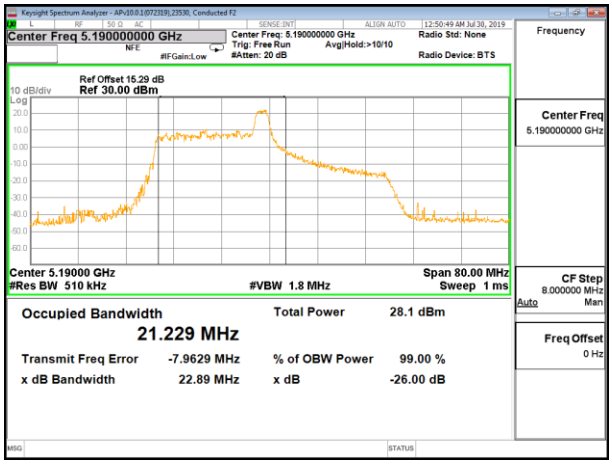


**LOW CHANNEL ANT 5**

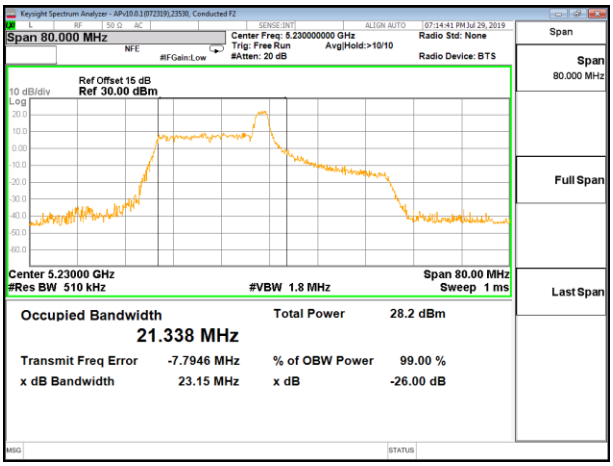


**HIGH CHANNEL ANT 6**

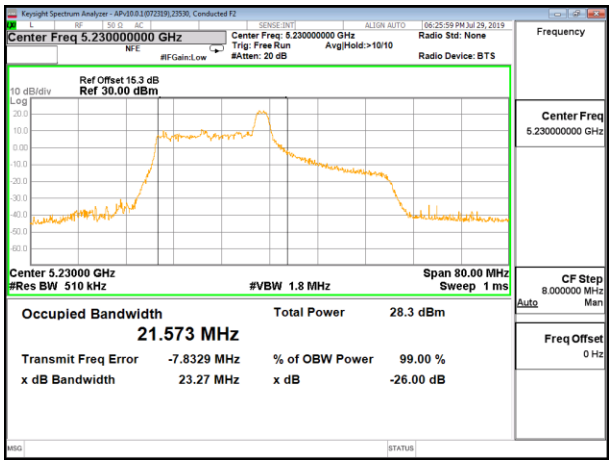


**HIGH CHANNEL ANT 5**


UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**2TX Antenna 6 + Antenna 5 OFDMA MODE – 26-Tones, RU Index 17**

| Channel | Frequency (MHz) | 99% Bandwidth Antenna 6 (MHz) | 99% Bandwidth Antenna 5 (MHz) |
|---|---|---|---|
| Low | 5190 | 18.642 | 18.371 |
| High | 5230 | 18.434 | 18.309 |

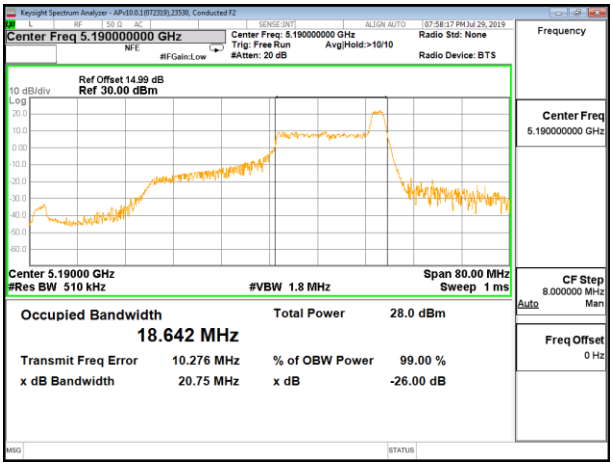


**LOW CHANNEL ANT 6**

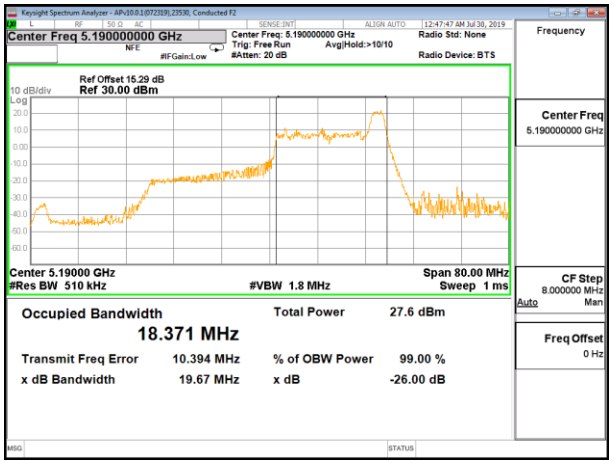


**LOW CHANNEL ANT 5**

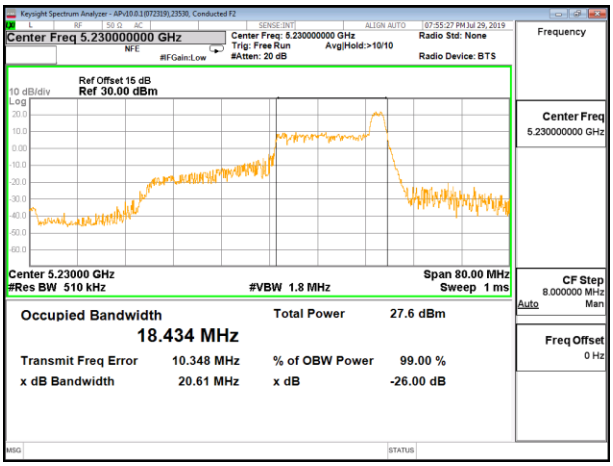


**HIGH CHANNEL ANT 6**

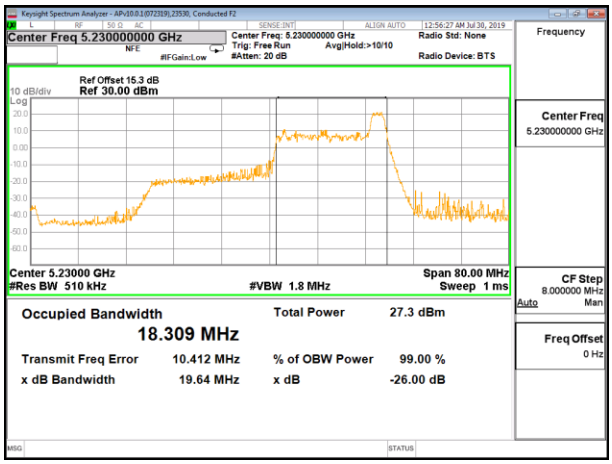


**HIGH CHANNEL ANT 5**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

## 8.3.6. 802.11ax HE80 MODE IN THE 5.2 GHz BAND

**1TX Antenna 6 MODE – 996-Tones, RU Index 67**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 77.219 |

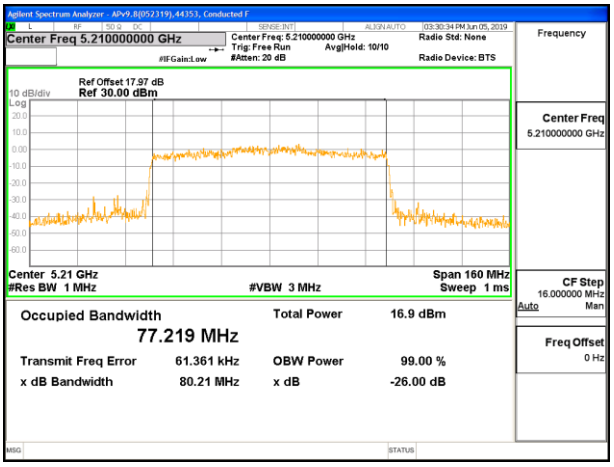


**MID CHANNEL**

**1TX Antenna 6 MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 18.299 |

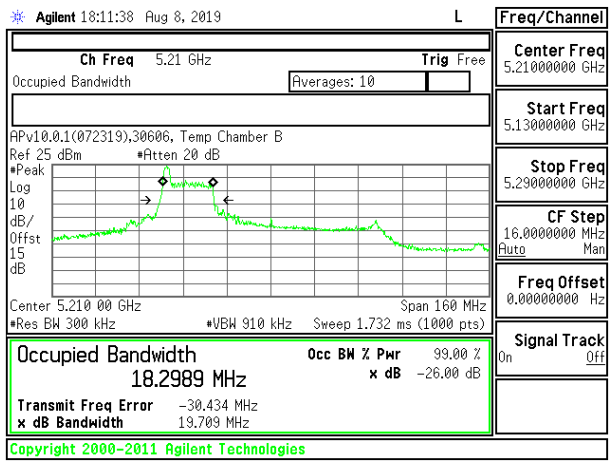


**MID CHANNEL**



UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 6 MODE – 26-Tones, RU Index 18**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 36.907 |

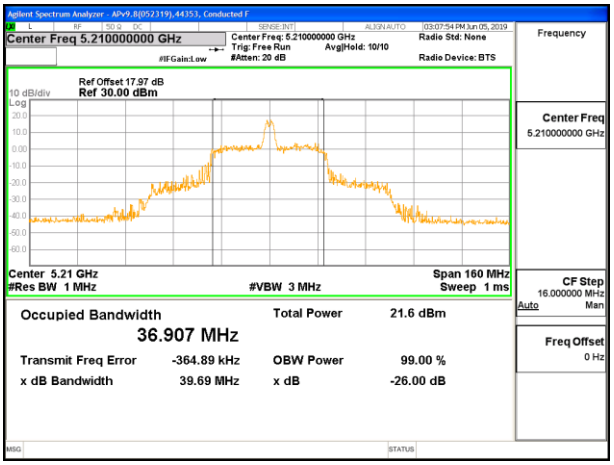


**MID CHANNEL**

**1TX Antenna 6 MODE – 26-Tones, RU Index 36**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 18.279 |

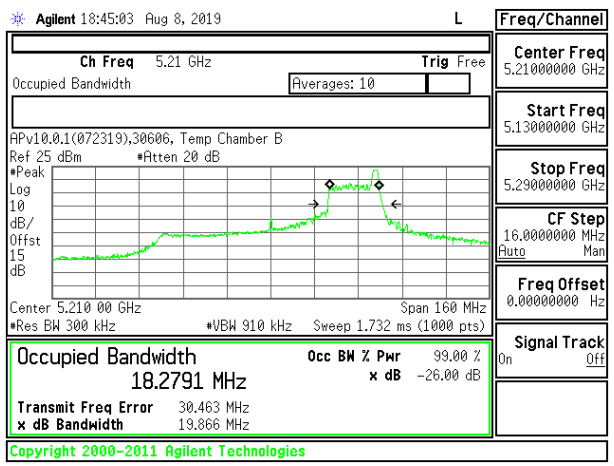


**MID CHANNEL**


UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 5 MODE – 996-Tones, RU Index 67**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 77.097 |

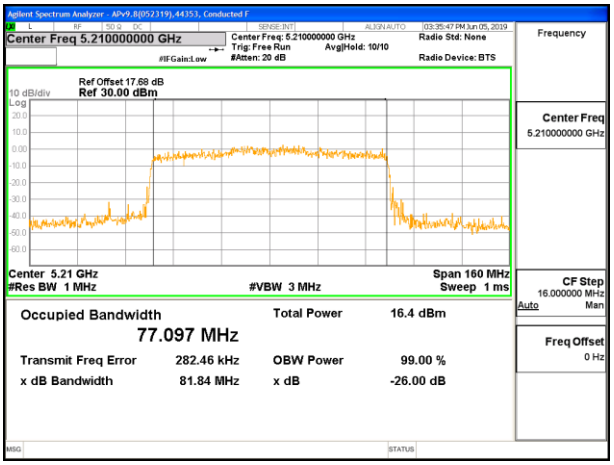


**MID CHANNEL**

**1TX Antenna 5 MODE – 26-Tones, RU Index 0**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 18.233 |

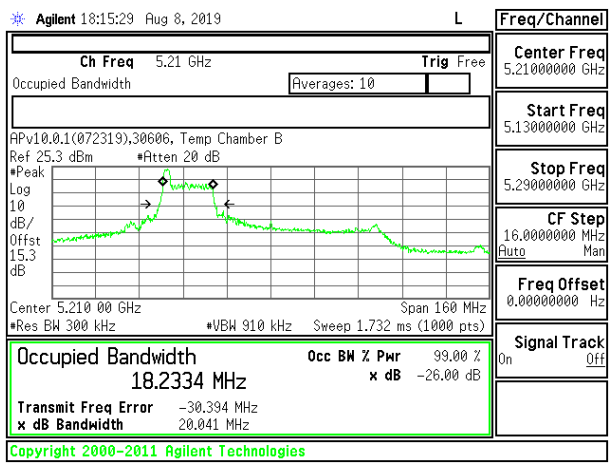


**MID CHANNEL**


UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*

**1TX Antenna 5 MODE – 26-Tones, RU Index 18**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 36.783 |

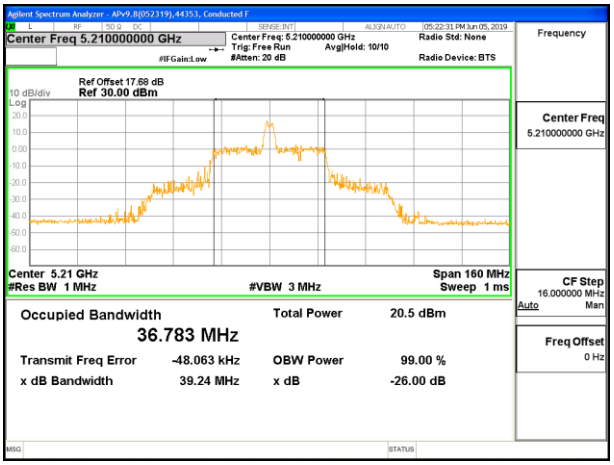


**MID CHANNEL**

**1TX Antenna 5 MODE – 26-Tones, RU Index 36**

| Channel | Frequency (MHz) | 99% Bandwidth (MHz) |
|---|---|---|
| Mid | 5210 | 18.203 |

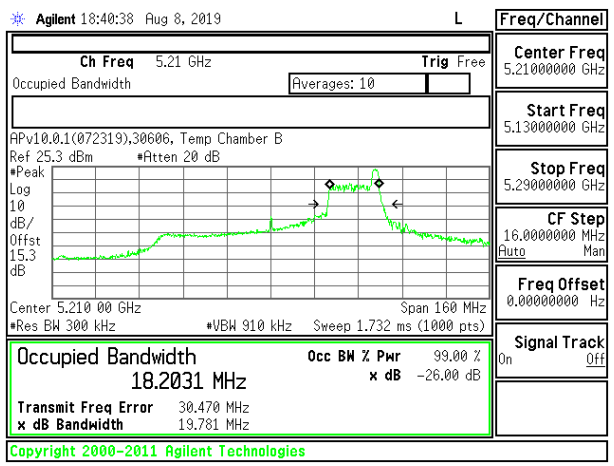


**MID CHANNEL**


UL VERIFICATION SERVICES INC.
47173 Benicia Street, Fremont, CA 94538; USA TEL:(510) 319-4000 FAX:(510) 661-0888
*This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.*