9.2.1. LTE BAND 7

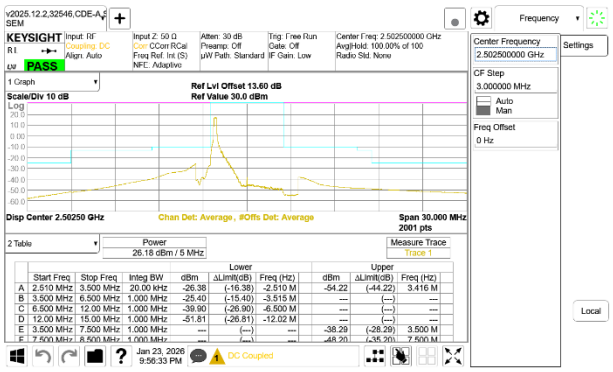

LTE B7 5MHz QPSK Low Channel RB1-0

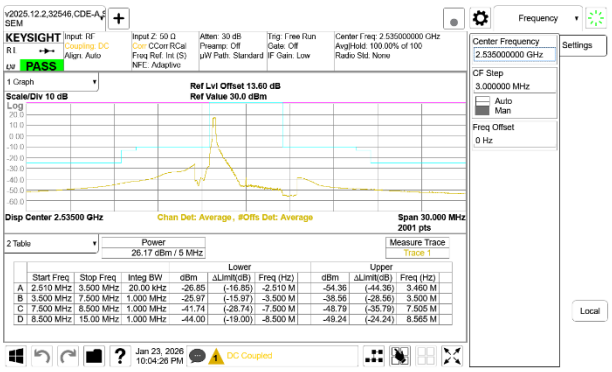

LTE B7 5MHz QPSK Middle Channel RB1-0

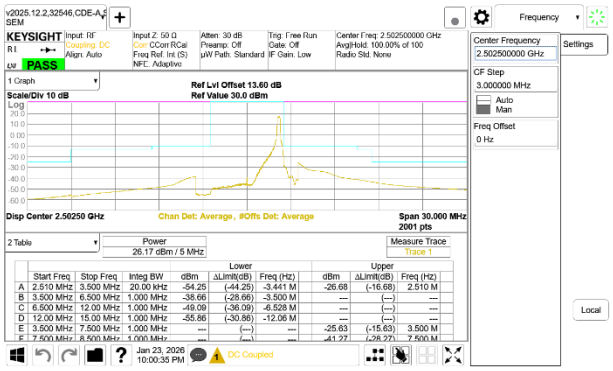

LTE B7 5MHz QPSK Low Channel RB1-24

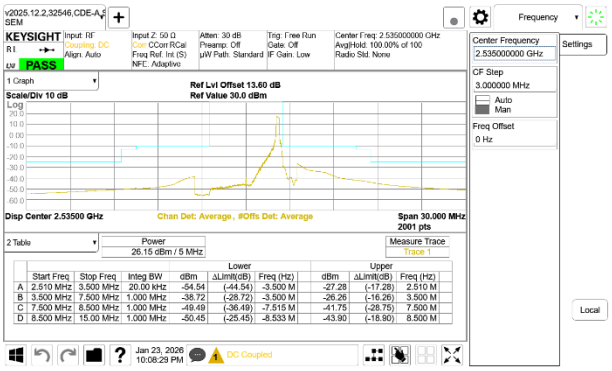

LTE B7 5MHz QPSK Middle Channel RB1-24

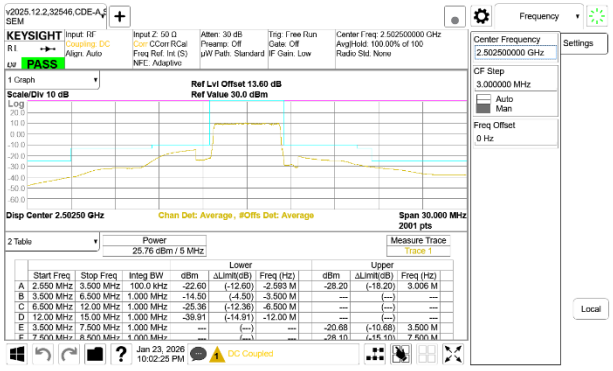

LTE B7 5MHz QPSK Low Channel RB25-0

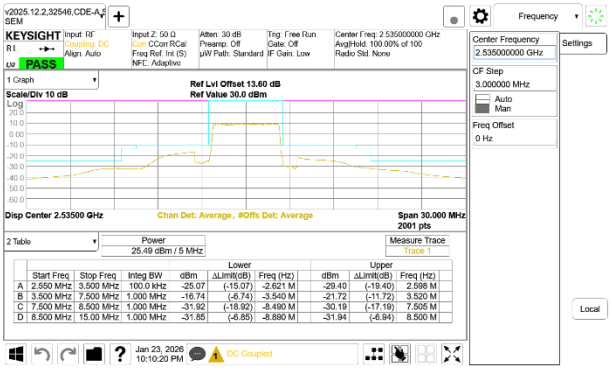

LTE B7 5MHz QPSK Middle Channel RB25-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

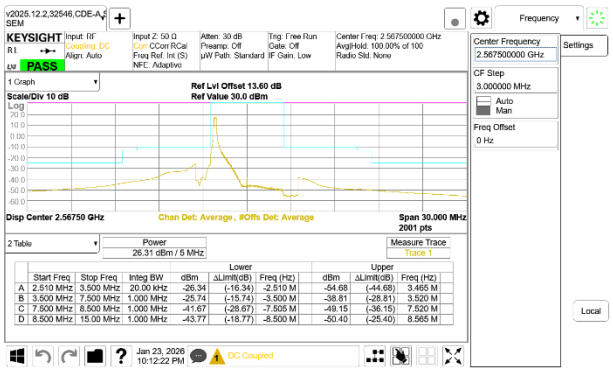

LTE B7 5MHz QPSK High Channel RB1-0

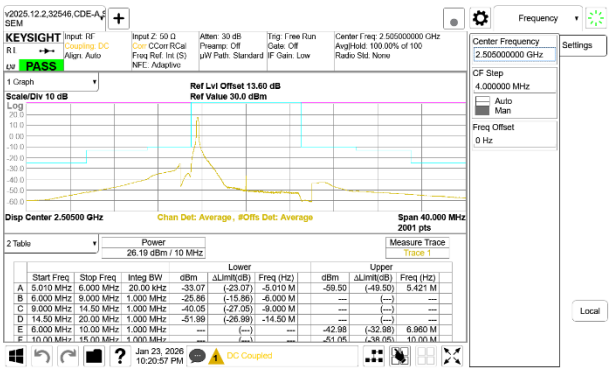

LTE B7 10MHz QPSK Low Channel RB1-0

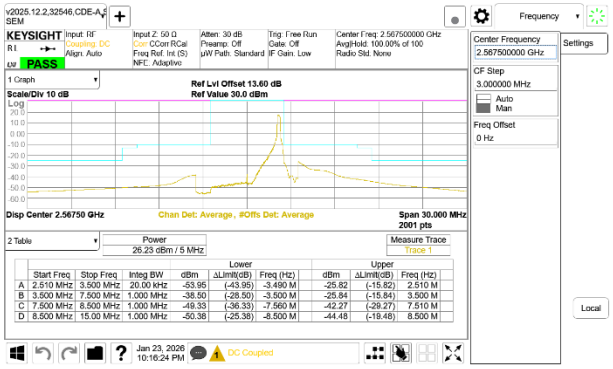

LTE B7 5MHz QPSK High Channel RB1-24

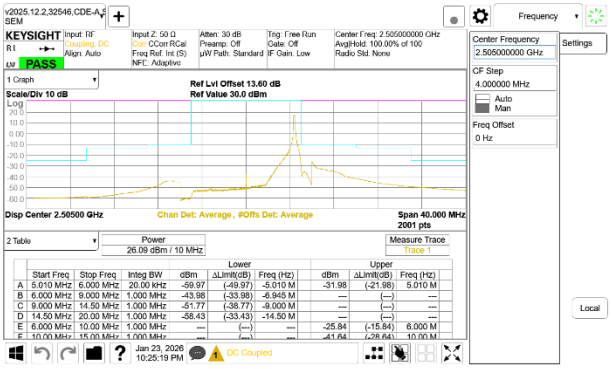

LTE B7 10MHz QPSK Low Channel RB1-49

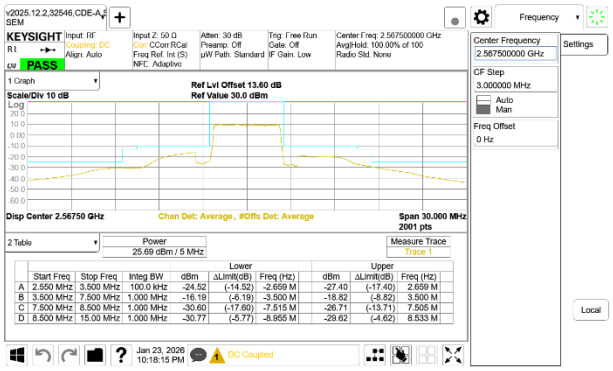

LTE B7 5MHz QPSK High Channel RB25-0

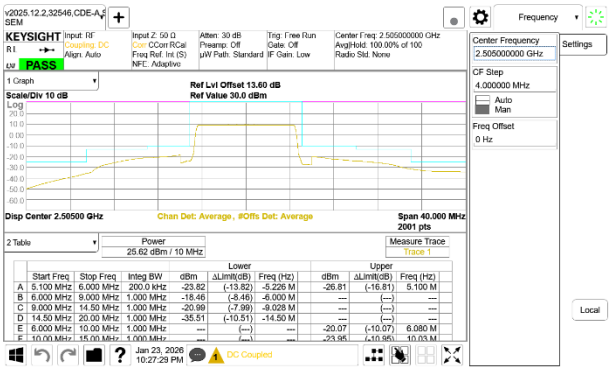

LTE B7 10MHz QPSK Low Channel RB50-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

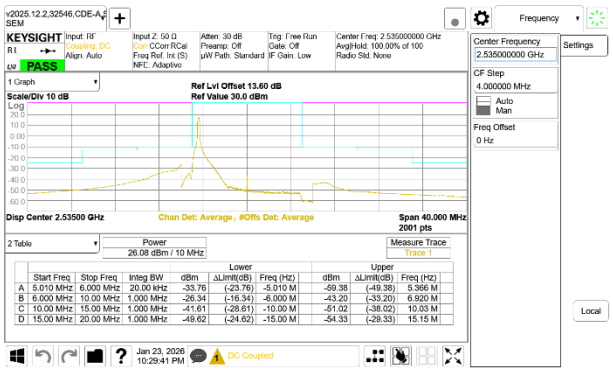

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.010 MHz	6.000 MHz	20.00 kHz	-33.76	(-23.76)	-5.010 M	-59.38	(-49.38)	5.366 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-26.34	(-16.34)	-6.000 M	-43.20	(-33.20)	6.920 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-41.61	(-28.61)	-10.00 M	-51.02	(-38.02)	10.03 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-49.62	(-24.62)	-15.00 M	-54.33	(-29.33)	15.15 M

LTE B7 10MHz QPSK Middle Channel RB1-0

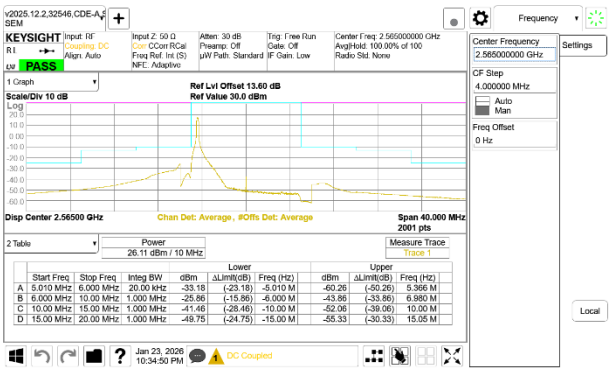

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.010 MHz	6.000 MHz	20.00 kHz	-33.18	(-23.18)	-5.010 M	-60.26	(-50.26)	5.366 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-25.86	(-15.86)	-6.000 M	-43.86	(-33.86)	6.980 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-41.46	(-28.46)	-10.00 M	-52.06	(-39.06)	10.00 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-49.75	(-24.75)	-15.00 M	-55.33	(-30.33)	15.05 M

LTE B7 10MHz QPSK High Channel RB1-0

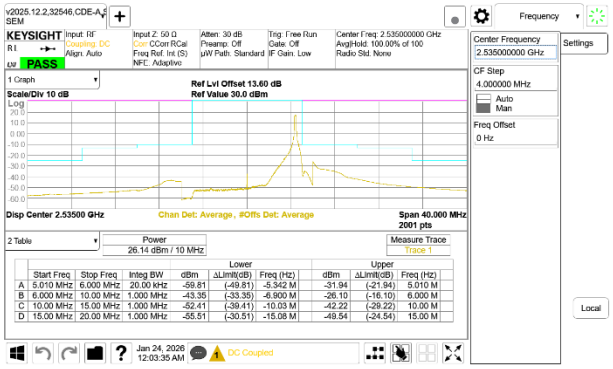

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.010 MHz	6.000 MHz	20.00 kHz	-59.81	(-49.81)	-5.342 M	-31.94	(-21.94)	5.010 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-43.35	(-33.35)	-6.900 M	-26.10	(-16.10)	6.000 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-52.41	(-39.41)	-10.03 M	-42.22	(-29.22)	10.00 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-55.51	(-30.51)	-15.08 M	-49.54	(-24.54)	15.00 M

LTE B7 10MHz QPSK Middle Channel RB1-49

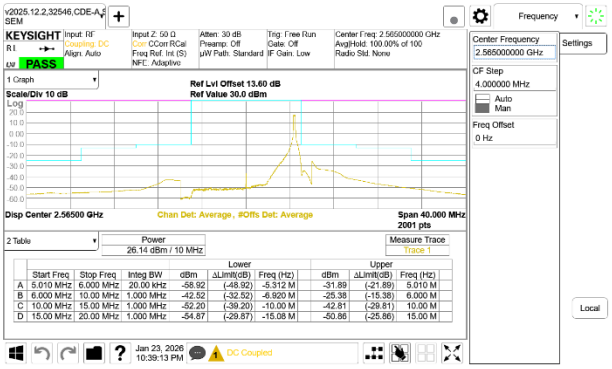

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.010 MHz	6.000 MHz	20.00 kHz	-58.92	(-48.92)	-5.312 M	-31.89	(-21.89)	5.010 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-42.52	(-32.52)	-6.920 M	-25.38	(-15.38)	6.000 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-52.20	(-39.20)	-10.00 M	-42.81	(-29.81)	10.00 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-54.87	(-29.87)	-15.08 M	-50.86	(-25.86)	15.00 M

LTE B7 10MHz QPSK High Channel RB1-49

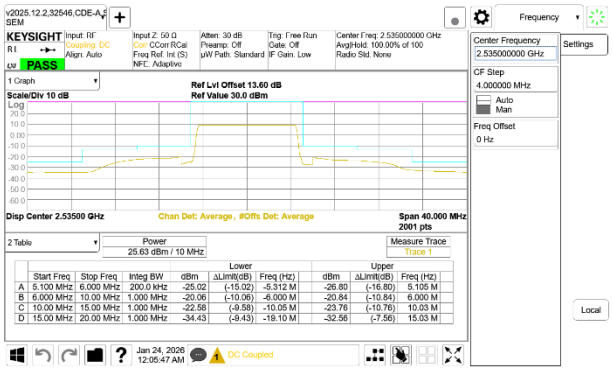

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.100 MHz	6.000 MHz	200.0 kHz	-25.02	(-15.02)	-5.312 M	-26.80	(-16.80)	5.105 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-20.06	(-10.06)	-6.000 M	-20.84	(-10.84)	6.000 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-22.58	(-9.58)	-10.05 M	-23.76	(-10.76)	10.03 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-34.43	(-9.43)	-19.10 M	-32.56	(-7.56)	15.03 M

LTE B7 10MHz QPSK Middle Channel RB50-0

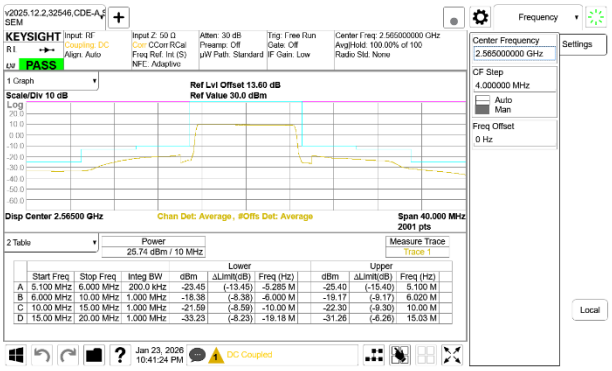

	Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
	Lower						Upper		
A	5.100 MHz	6.000 MHz	200.0 kHz	-23.45	(-13.45)	-5.285 M	-25.40	(-15.40)	5.100 M
B	6.000 MHz	10.00 MHz	1.000 MHz	-18.38	(-8.38)	-6.000 M	-19.17	(-9.17)	6.020 M
C	10.00 MHz	15.00 MHz	1.000 MHz	-21.59	(-8.59)	-10.00 M	-22.30	(-9.30)	10.00 M
D	15.00 MHz	20.00 MHz	1.000 MHz	-33.23	(-8.23)	-19.18 M	-31.26	(-8.26)	15.03 M

LTE B7 10MHz QPSK High Channel RB50-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

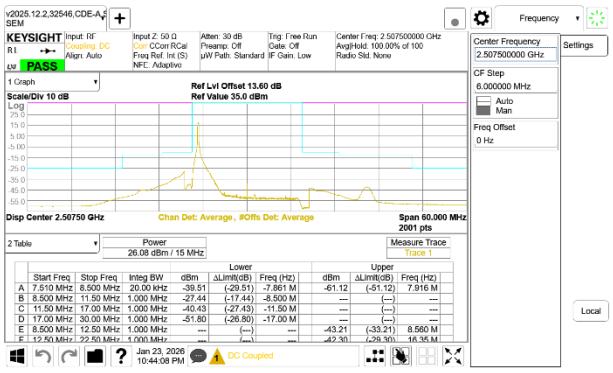

LTE B7 15MHz QPSK Low Channel RB1-0

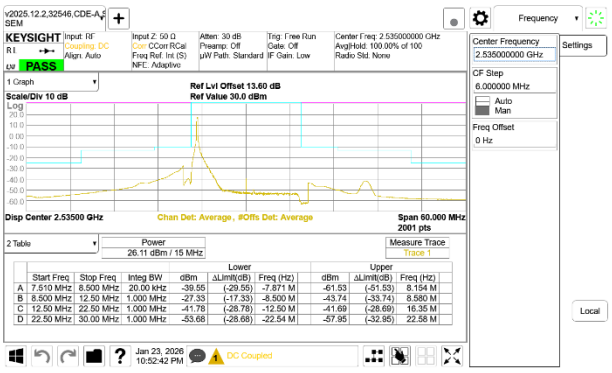

LTE B7 15MHz QPSK Middle Channel RB1-0

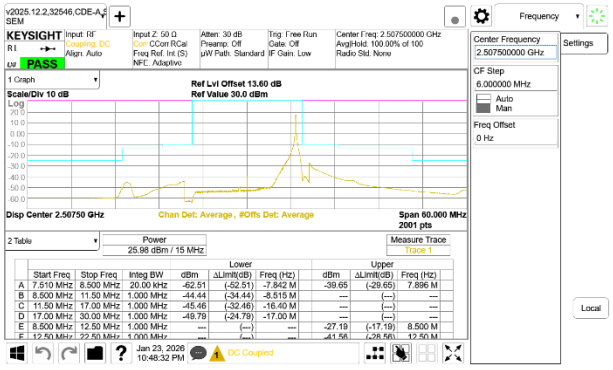

LTE B7 15MHz QPSK Low Channel RB1-74

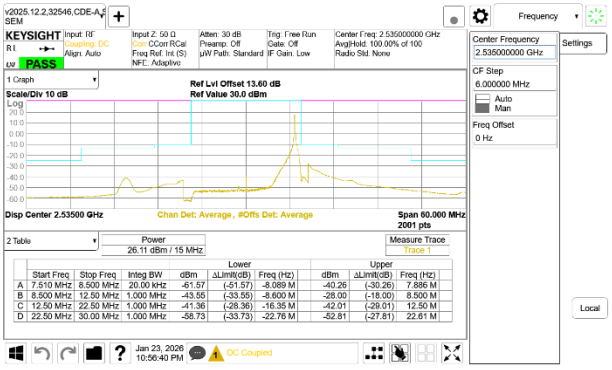

LTE B7 15MHz QPSK Middle Channel RB1-74

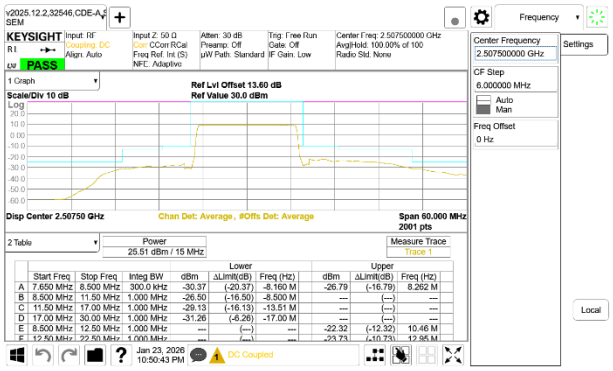

LTE B7 15MHz QPSK Low Channel RB75-0

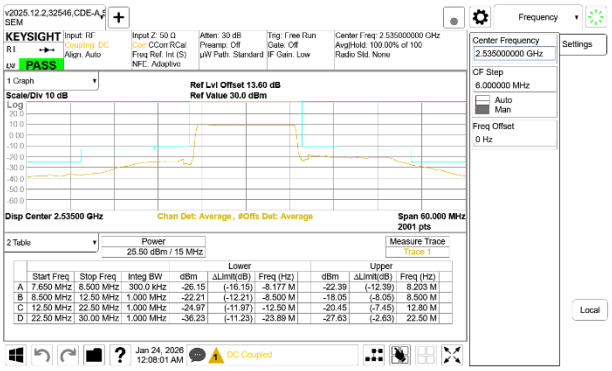

LTE B7 15MHz QPSK Middle Channel RB75-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

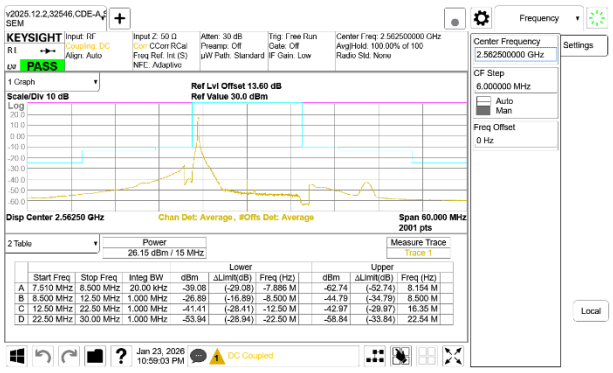

LTE B7 15MHz QPSK High Channel RB1-0

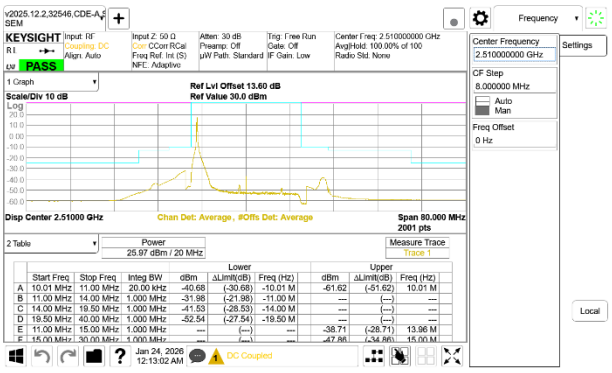

LTE B7 20MHz QPSK Low Channel RB1-0

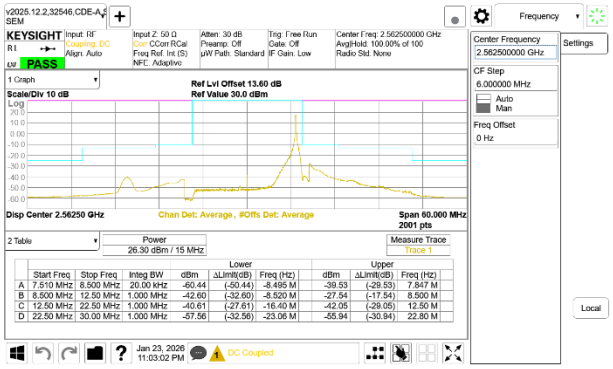

LTE B7 15MHz QPSK High Channel RB1-74

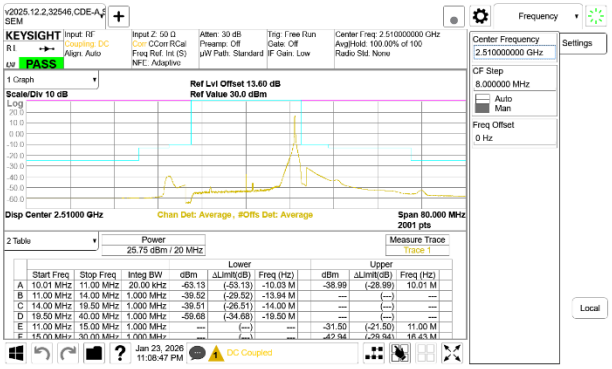

LTE B7 20MHz QPSK Low Channel RB1-99

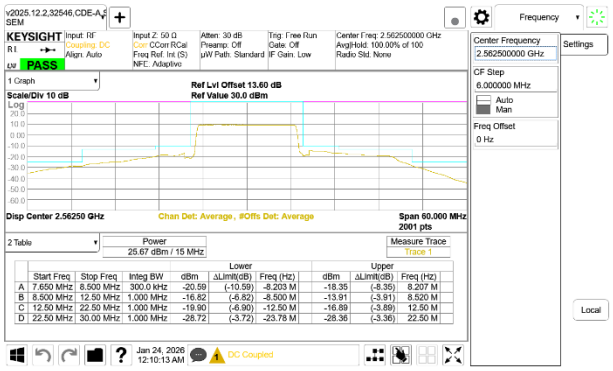

LTE B7 15MHz QPSK High Channel RB75-0

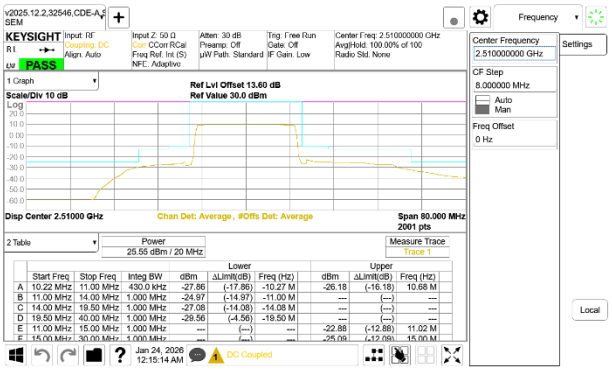

LTE B7 20MHz QPSK Low Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

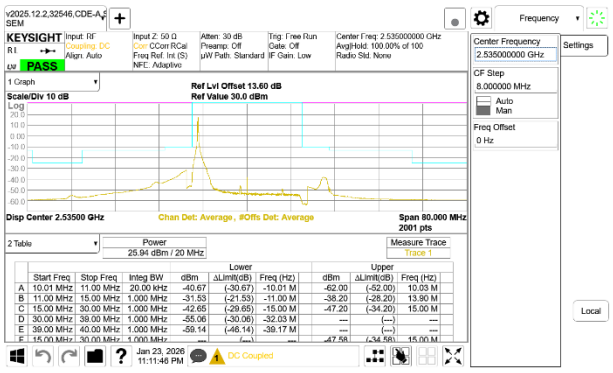

LTE B7 20MHz QPSK Middle Channel RB1-0

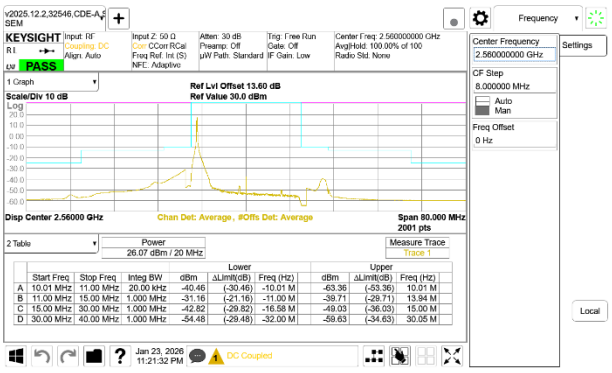

LTE B7 20MHz QPSK High Channel RB1-0

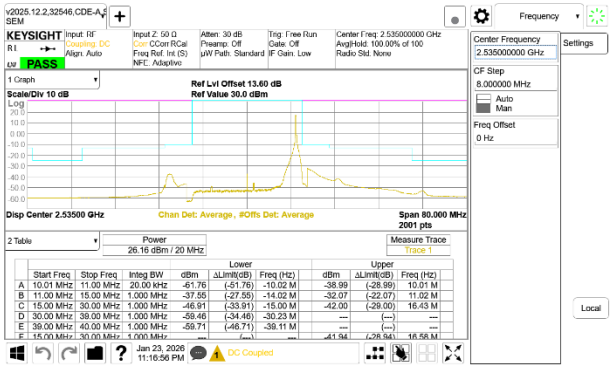

LTE B7 20MHz QPSK Middle Channel RB1-99

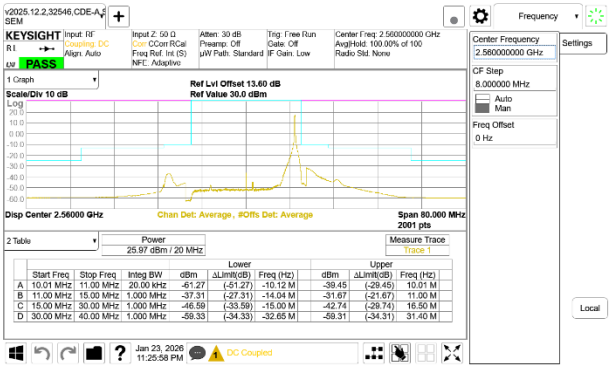

LTE B7 20MHz QPSK High Channel RB1-99

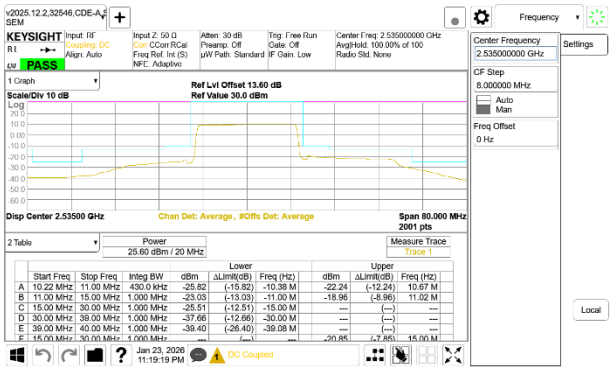

LTE B7 20MHz QPSK Middle Channel RB100-0

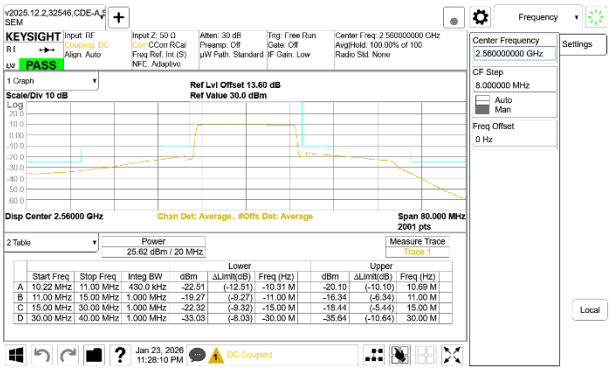

LTE B7 20MHz QPSK High Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

9.2.2. 5G NR n7

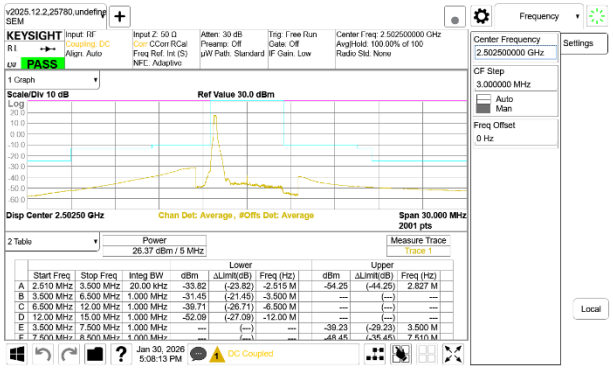

5G NR n7 5MHz BPSK Low Channel RB1-0

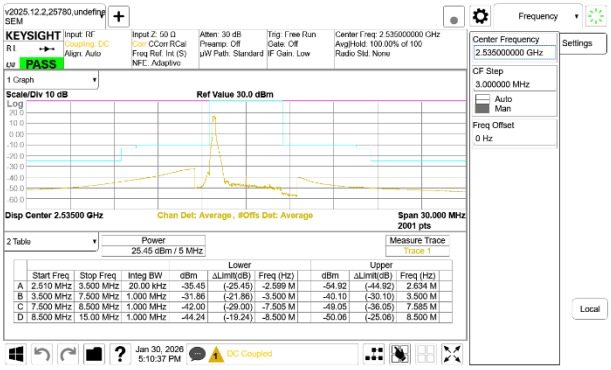

5G NR n7 5MHz BPSK Middle Channel RB1-0

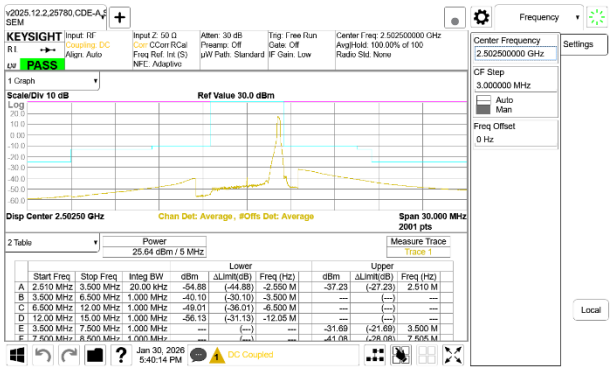

5G NR n7 5MHz BPSK Low Channel RB1-24

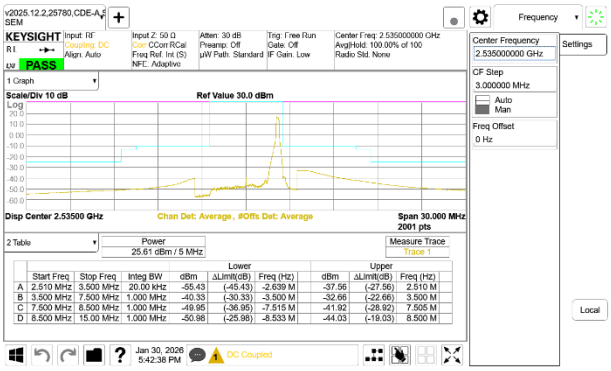

5G NR n7 5MHz BPSK Middle Channel RB1-24

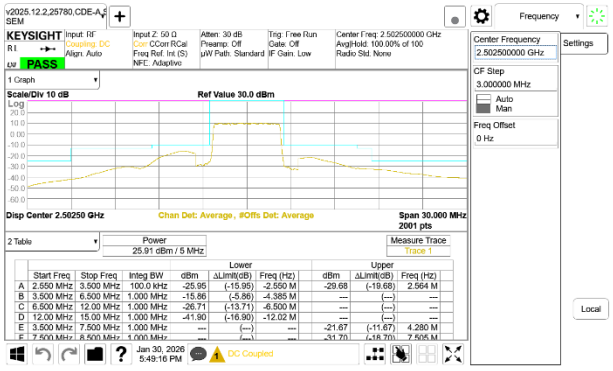

5G NR n7 5MHz BPSK Low Channel RB25-0

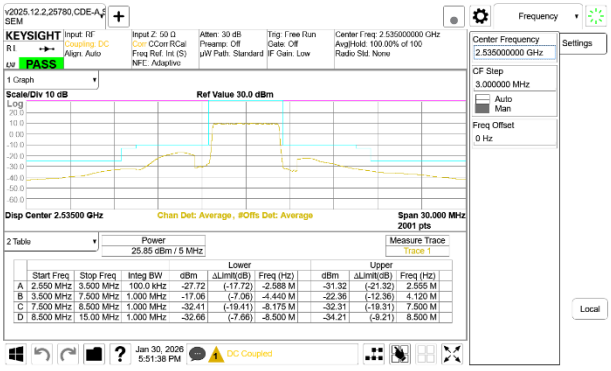

5G NR n7 5MHz BPSK Middle Channel RB25-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

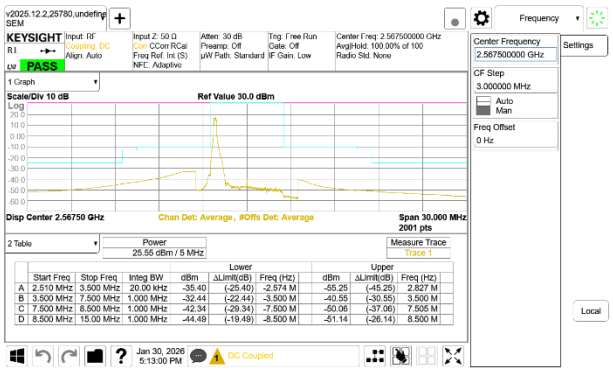

5G NR n7 5MHz BPSK High Channel RB1-0

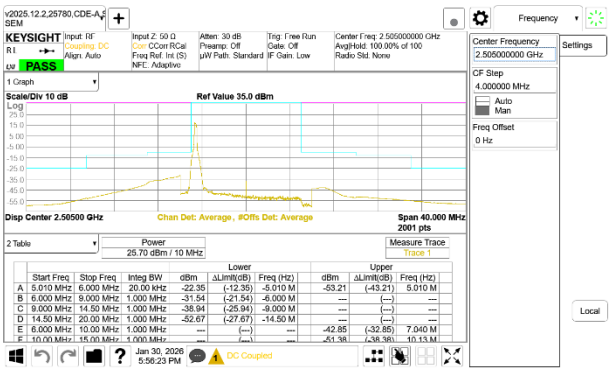

5G NR n7 10MHz BPSK Low Channel RB1-0

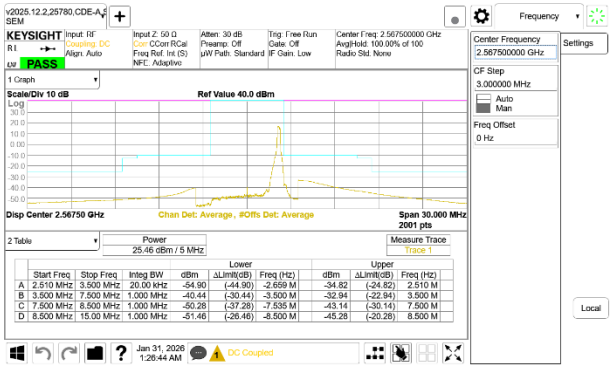

5G NR n7 5MHz BPSK High Channel RB1-24

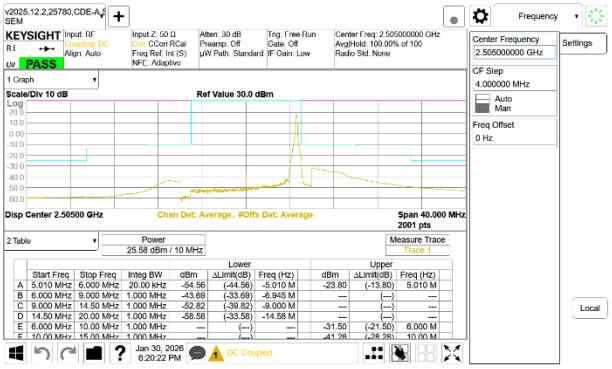

5G NR n7 10MHz BPSK Low Channel RB1-51

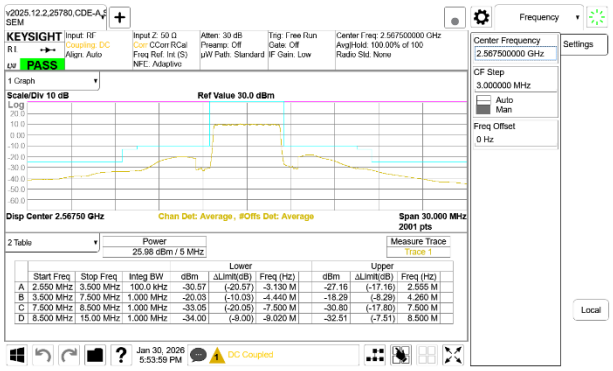

5G NR n7 5MHz BPSK High Channel RB25-0

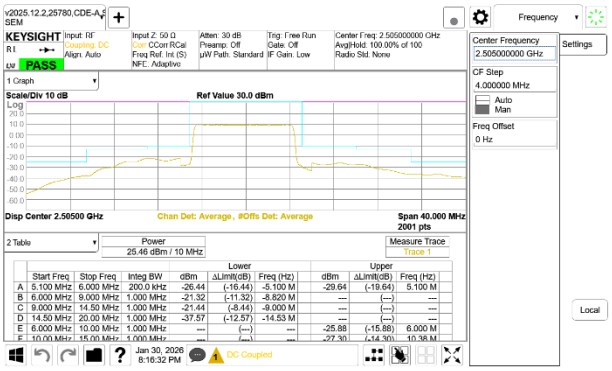

5G NR n7 10MHz BPSK Low Channel RB50-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

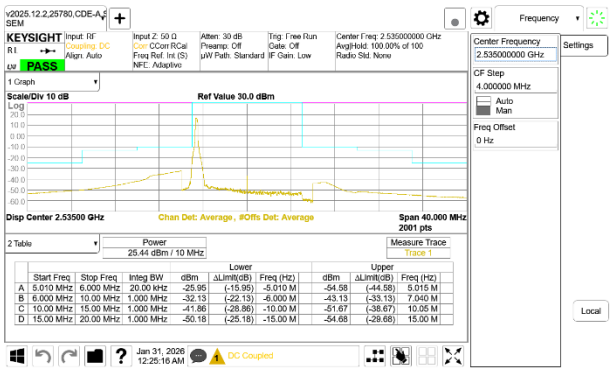

5G NR n7 10MHz BPSK Middle Channel RB1-0

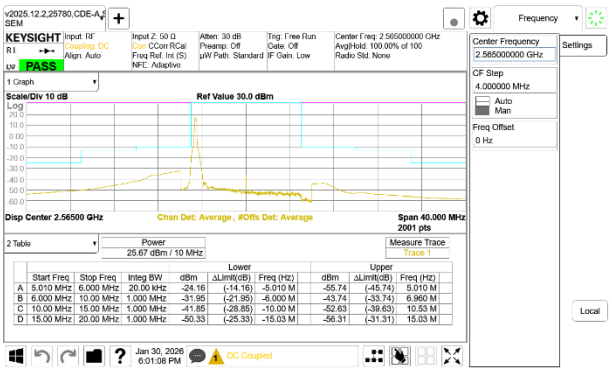

5G NR n7 10MHz BPSK High Channel RB1-0

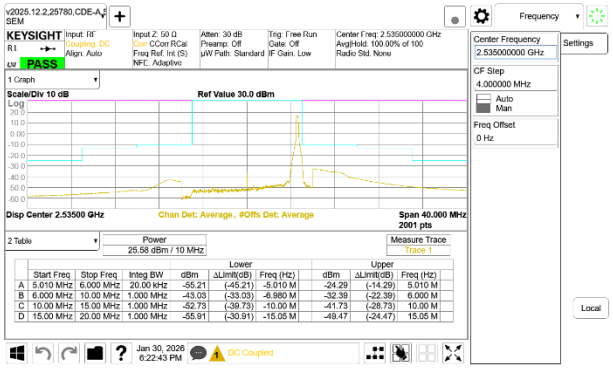

5G NR n7 10MHz BPSK Middle Channel RB1-51

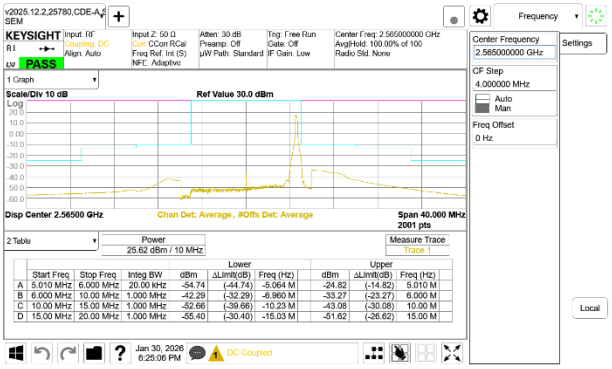

5G NR n7 10MHz BPSK High Channel RB1-51

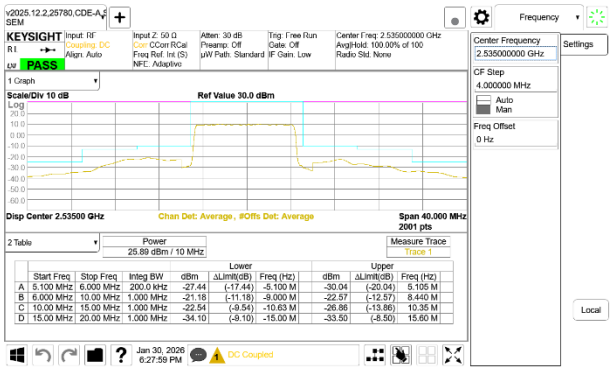

5G NR n7 10MHz BPSK Middle Channel RB50-0

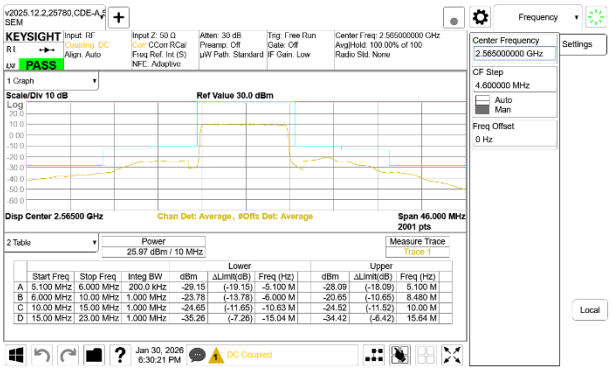

5G NR n7 10MHz BPSK High Channel RB50-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

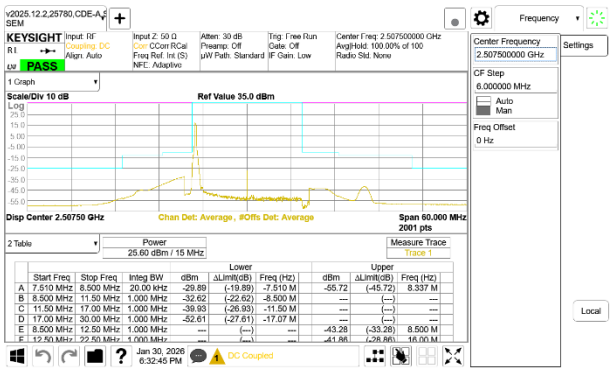

5G NR n7 15MHz BPSK Low Channel RB1-0

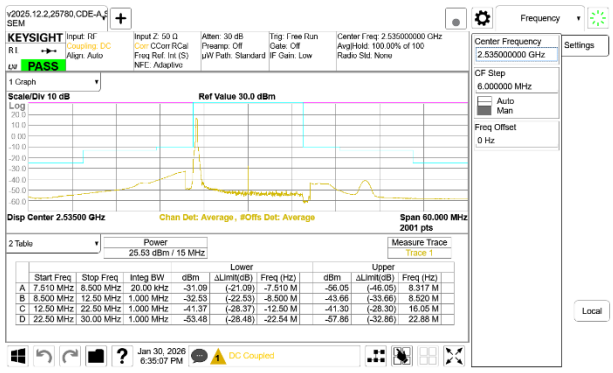

5G NR n7 15MHz BPSK Middle Channel RB1-0

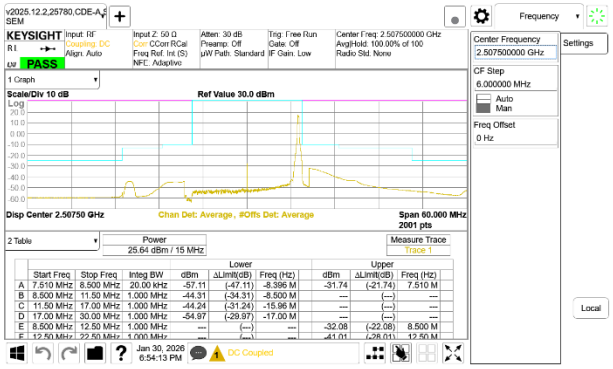

5G NR n7 15MHz BPSK Low Channel RB1-78

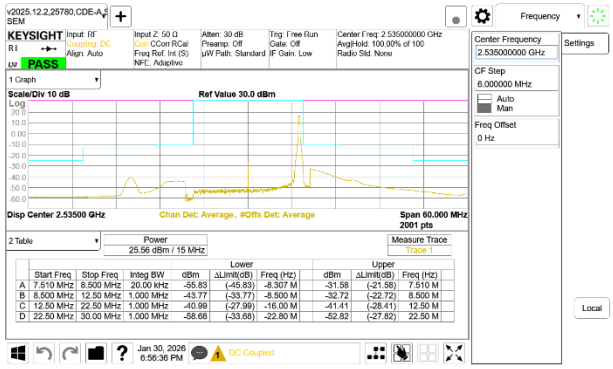

5G NR n7 15MHz BPSK Middle Channel RB1-78

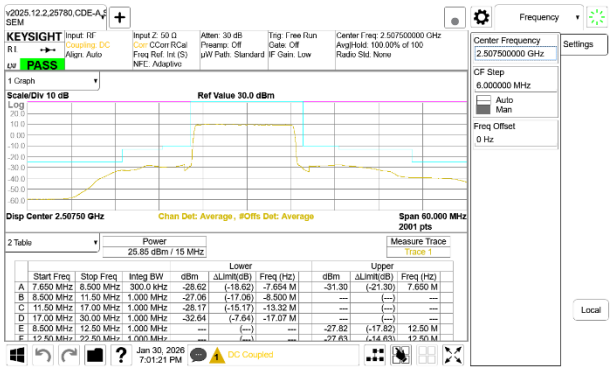

5G NR n7 15MHz BPSK Low Channel RB75-0

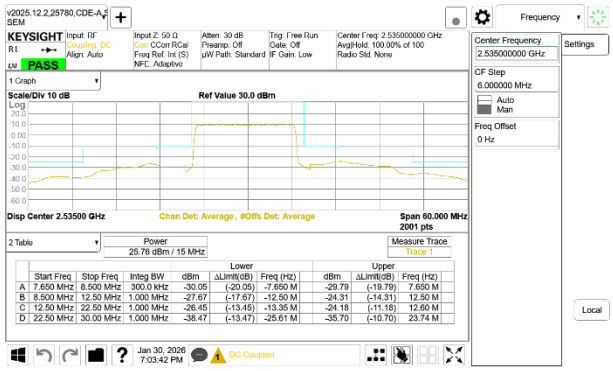

5G NR n7 15MHz BPSK Middle Channel RB75-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

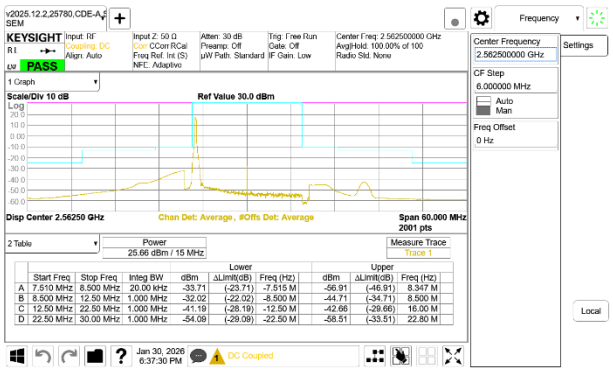

5G NR n7 15MHz BPSK High Channel RB1-0

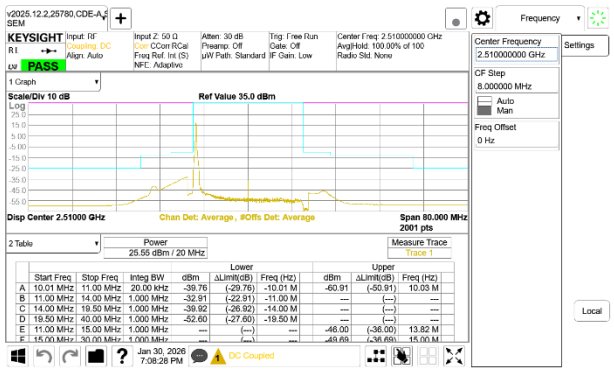

5G NR n7 20MHz BPSK Low Channel RB1-0

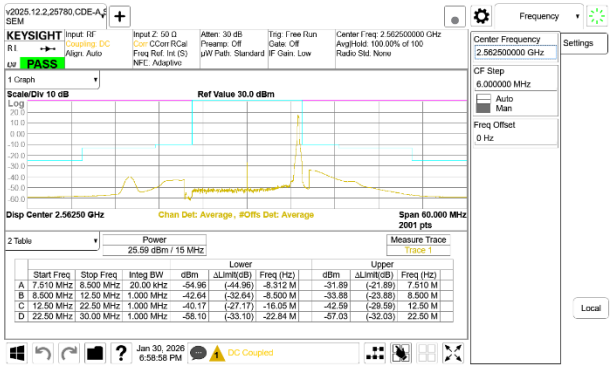

5G NR n7 15MHz BPSK High Channel RB1-78

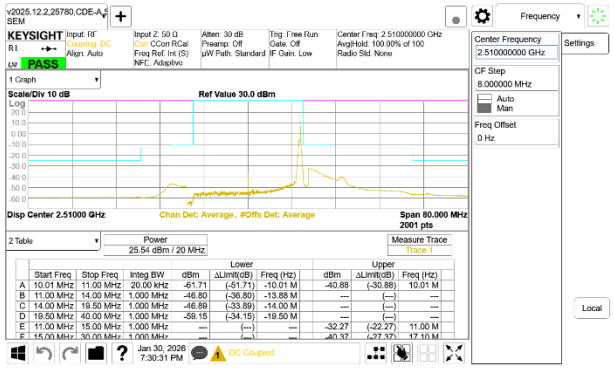

5G NR n7 20MHz BPSK Low Channel RB1-105

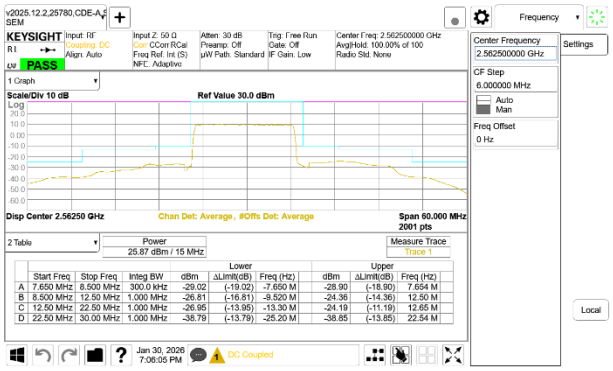

5G NR n7 15MHz BPSK High Channel RB75-0

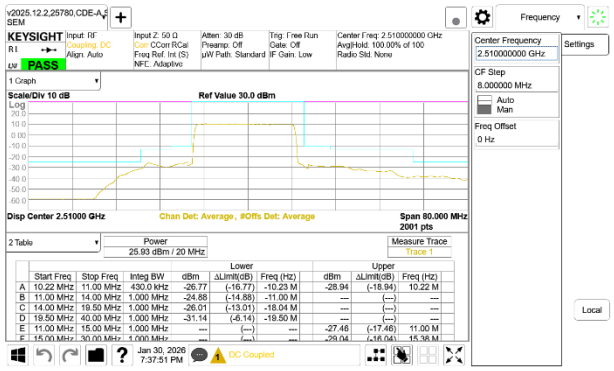

5G NR n7 20MHz BPSK Low Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

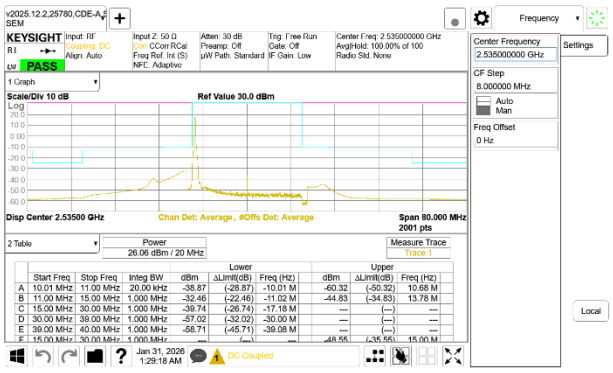

5G NR n7 20MHz BPSK Middle Channel RB1-0

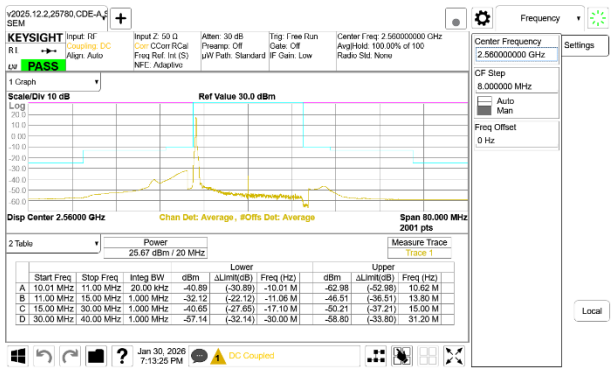

5G NR n7 20MHz BPSK High Channel RB1-0

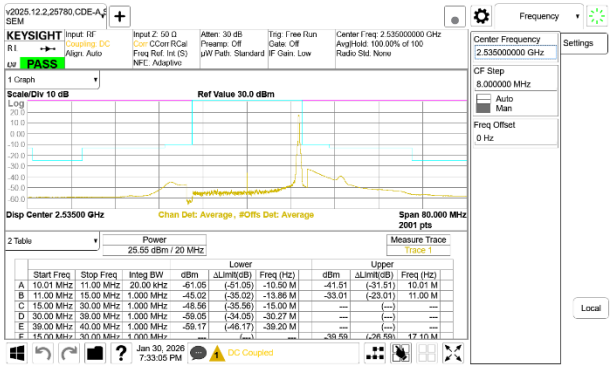

5G NR n7 20MHz BPSK Middle Channel RB1-105

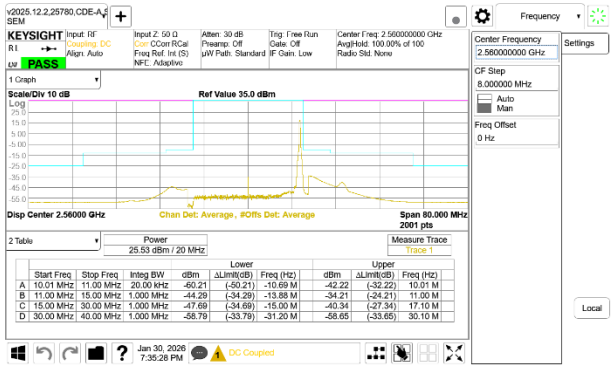

5G NR n7 20MHz BPSK High Channel RB1-105

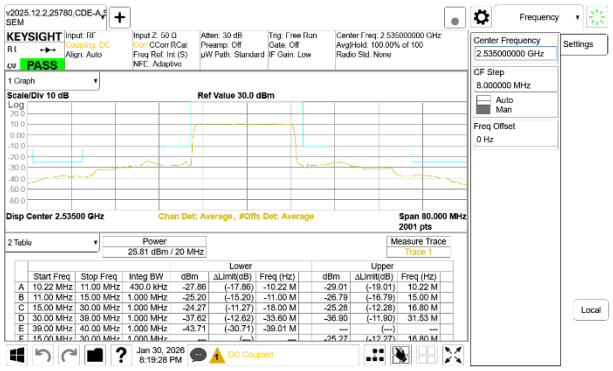

5G NR n7 20MHz BPSK Middle Channel RB100-0

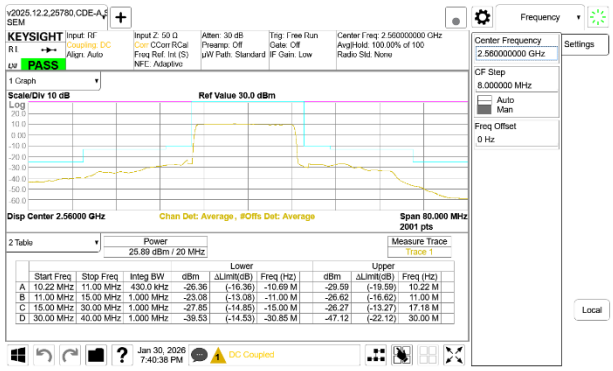

5G NR n7 20MHz BPSK High Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

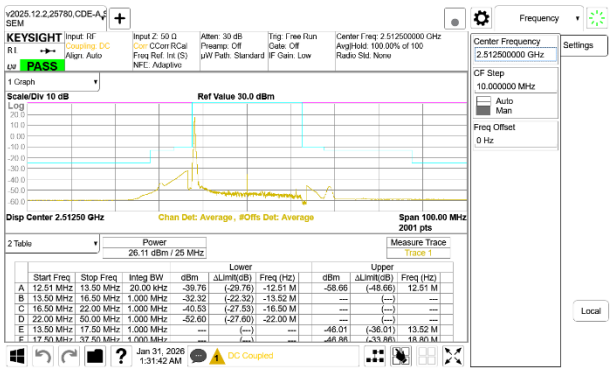

5G NR n7 25MHz BPSK Low Channel RB1-0

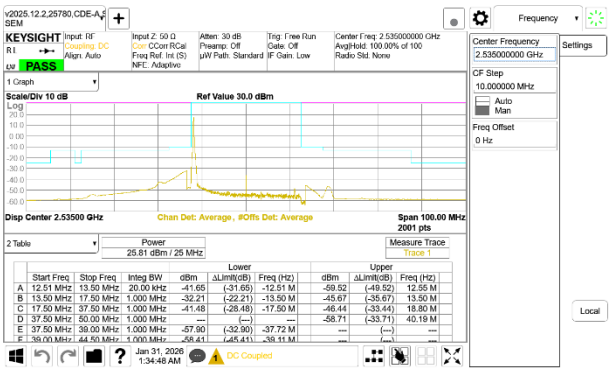

5G NR n7 25MHz BPSK Middle Channel RB1-0

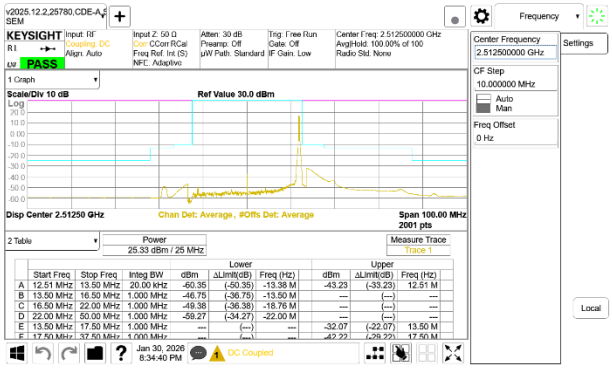

5G NR n7 25MHz BPSK Low Channel RB1-132

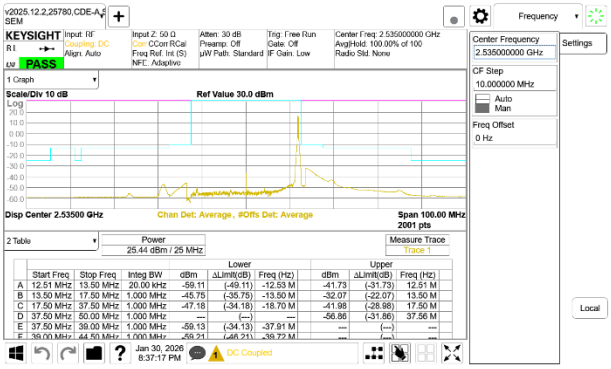

5G NR n7 25MHz BPSK Middle Channel RB1-132

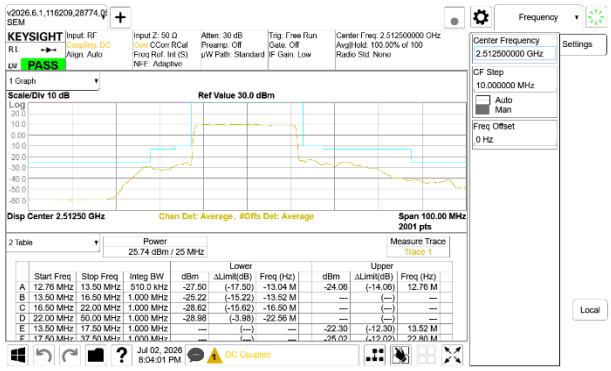

5G NR n7 25MHz BPSK Low Channel RB128-0

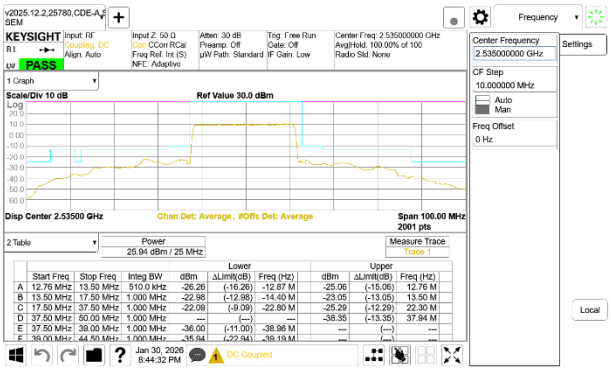

5G NR n7 25MHz BPSK Middle Channel RB128-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

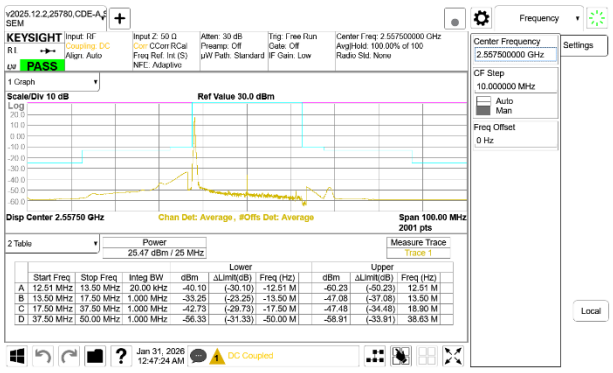

5G NR n7 25MHz BPSK High Channel RB1-0

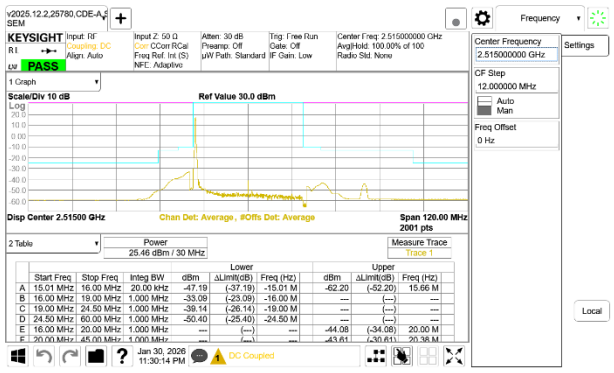

5G NR n7 30MHz BPSK Low Channel RB1-0

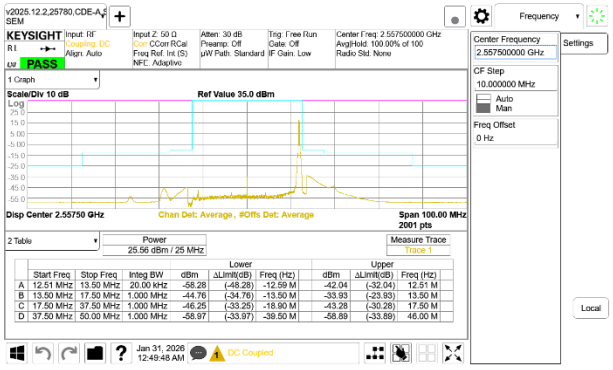

5G NR n7 25MHz BPSK High Channel RB1-132

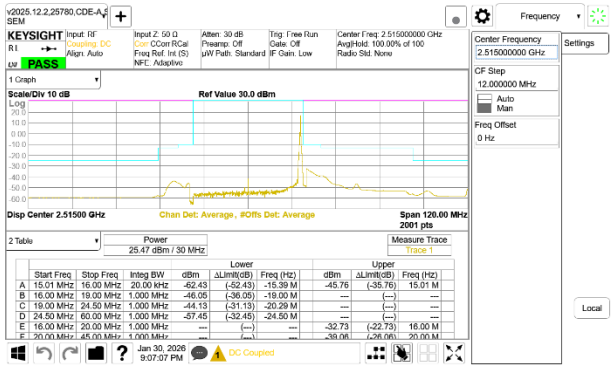

5G NR n7 30MHz BPSK Low Channel RB1-159

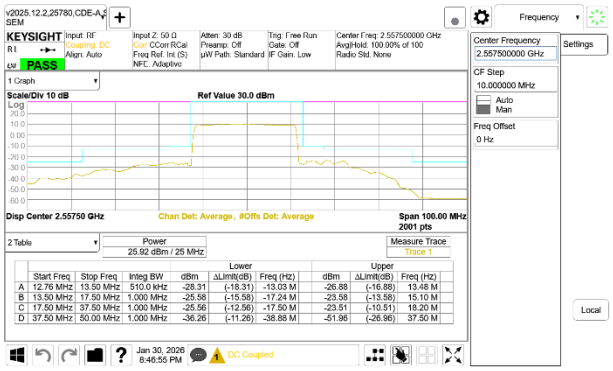

5G NR n7 25MHz BPSK High Channel RB128-0

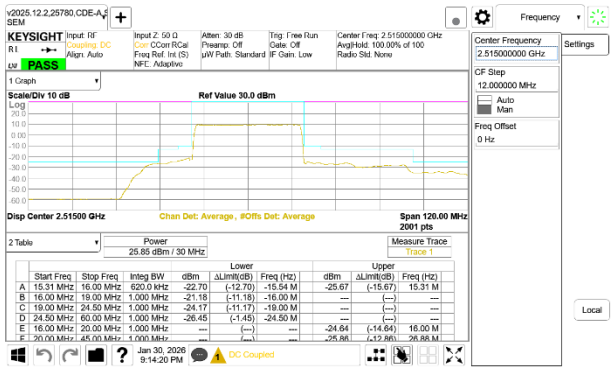

5G NR n7 30MHz BPSK Low Channel RB160-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.