Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE80

UNII Band II-2C

Chain 0	Chain 1
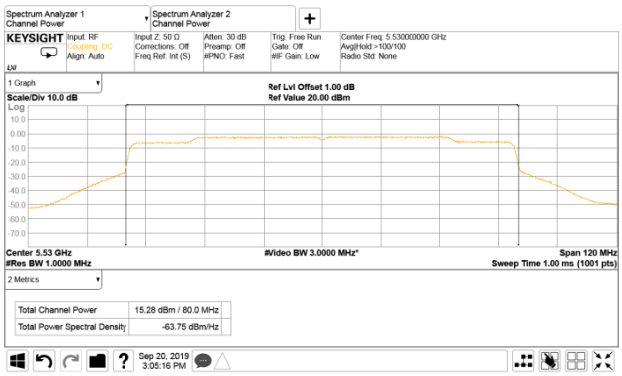	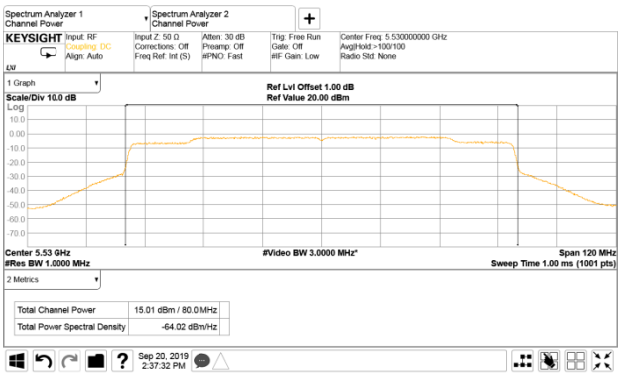
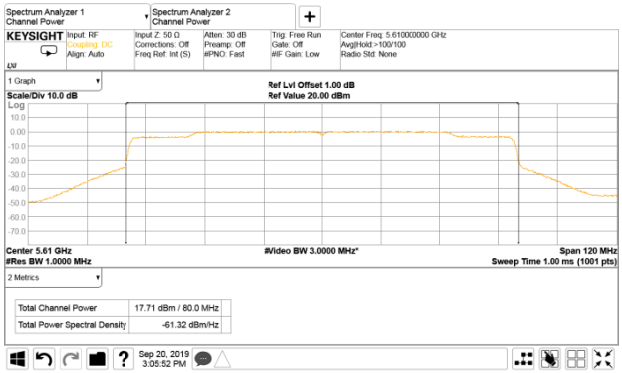	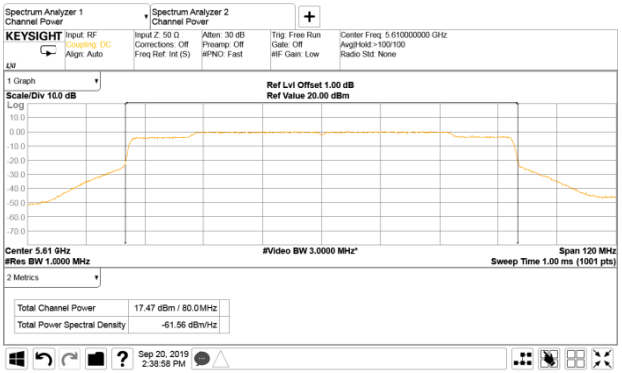
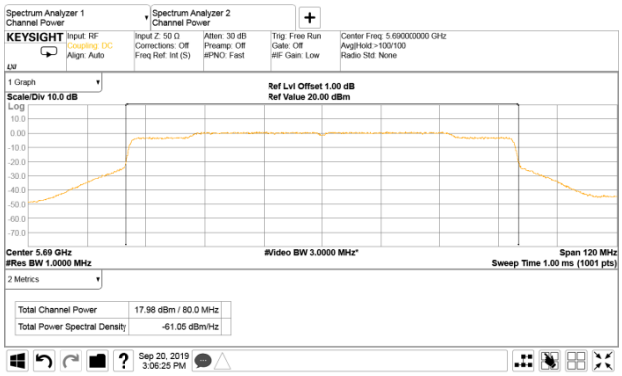	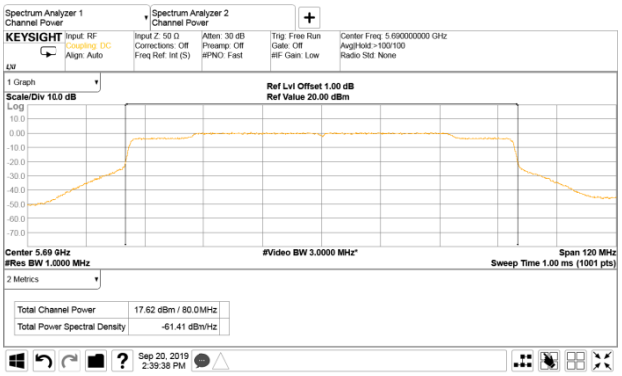

UNII Band III

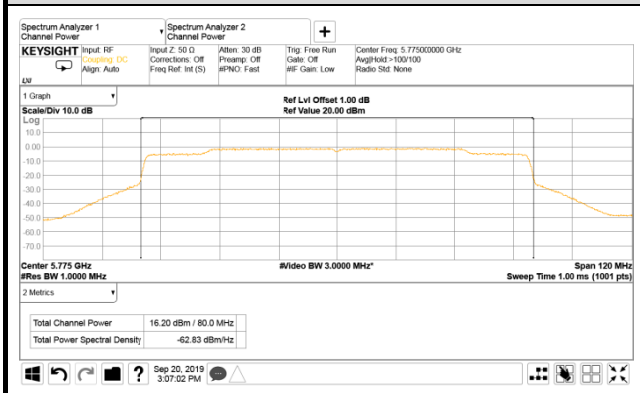	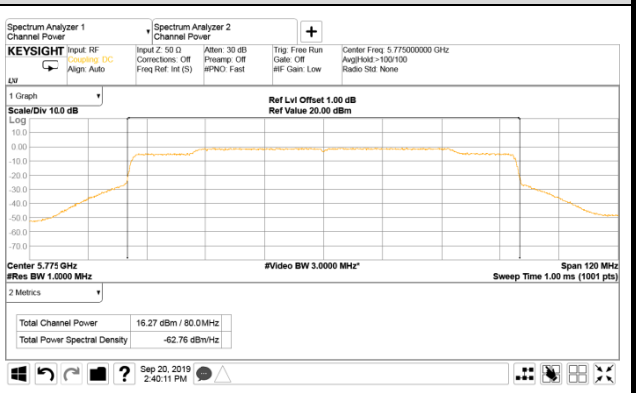

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE160	
UNII Band I/II-2A	
Chain 0	Chain 1
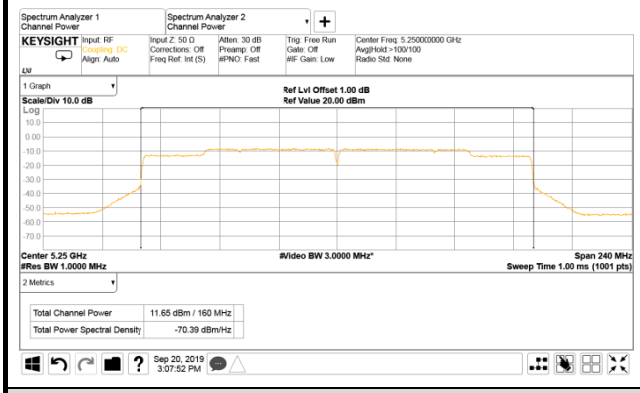	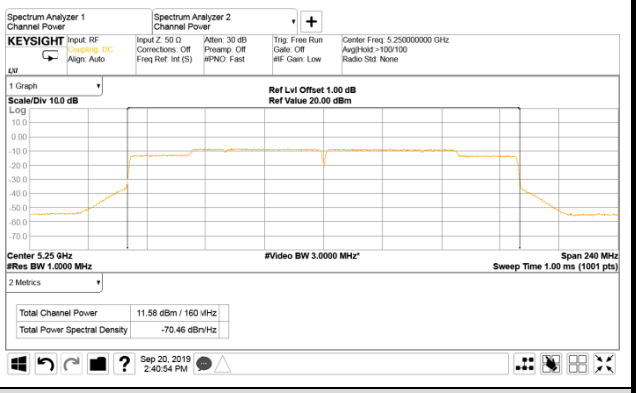
UNII Band II-2C	
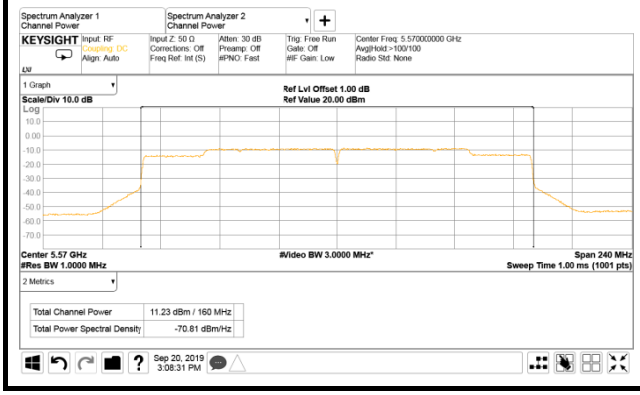	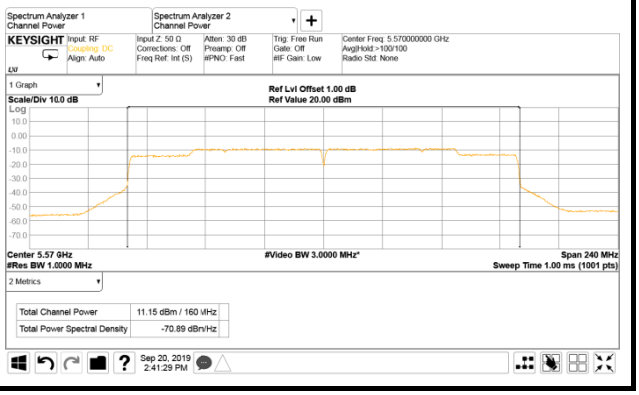

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE80	
UNII Band I	
Chain 0	Chain 1
5210MHz	
RU Configuration: 484/65	
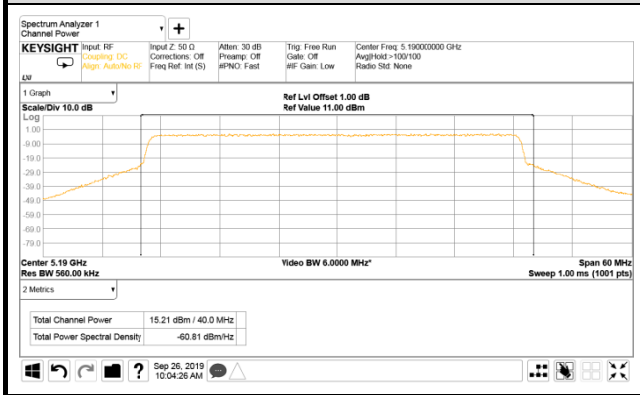	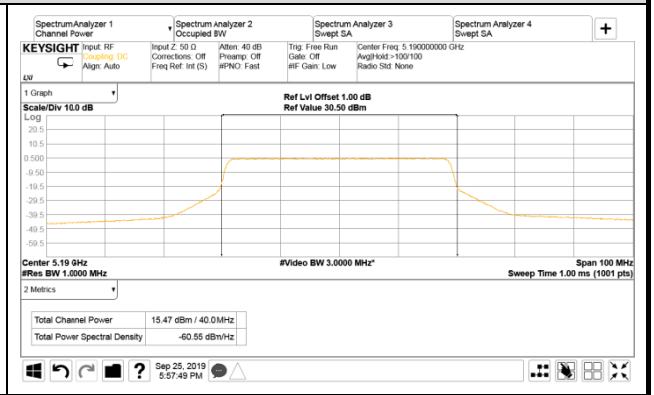
UNII Band II-2A	
Chain 0	Chain 1
5290MHz	
RU Configuration: 484/66	
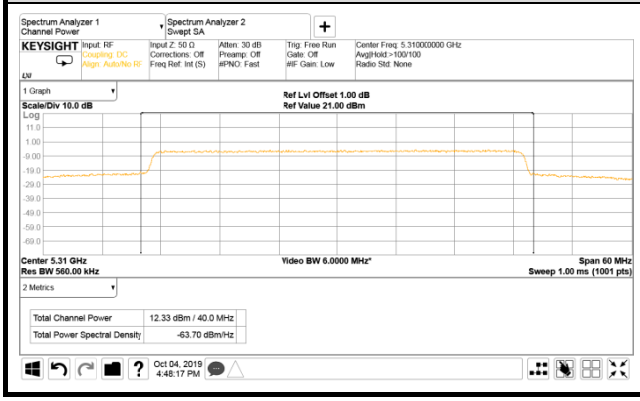	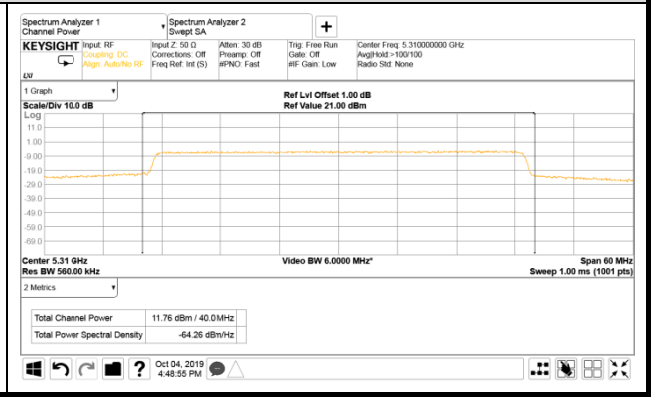

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE80	
UNII Band II-2C	
Chain 0	Chain 1
5530MHz	
RU Configuration: 484/65	
	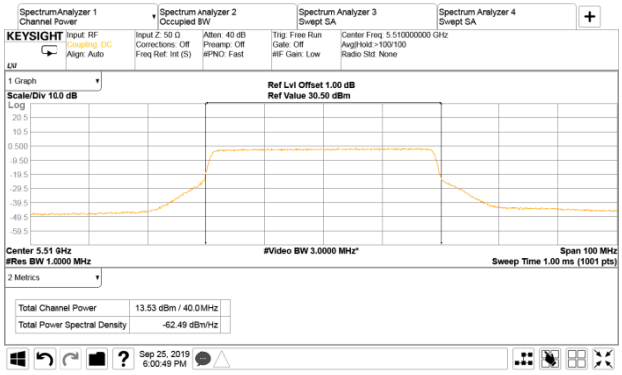
Chain 0	Chain 1
5610MHz	
RU Configuration: 484/66	

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE80	
UNII Band III	
Chain 0	Chain 1
5775MHz	
RU Configuration: 484/65	
	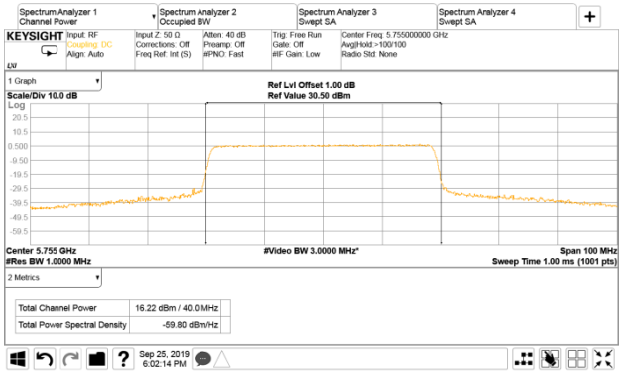
RU Configuration: 484/66	
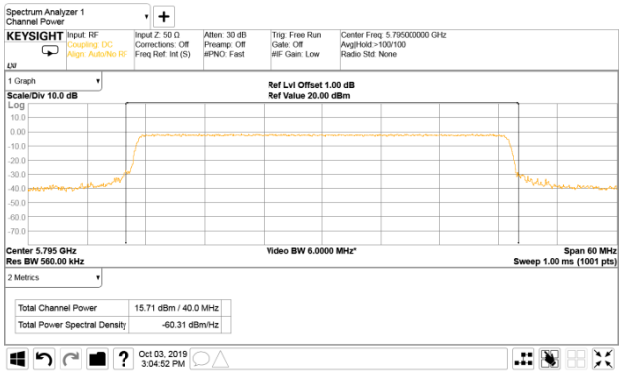	

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE160	
UNII Band I/II-2A	
Chain 0	Chain 1
5250MHz	
RU Configuration: 996/67	
	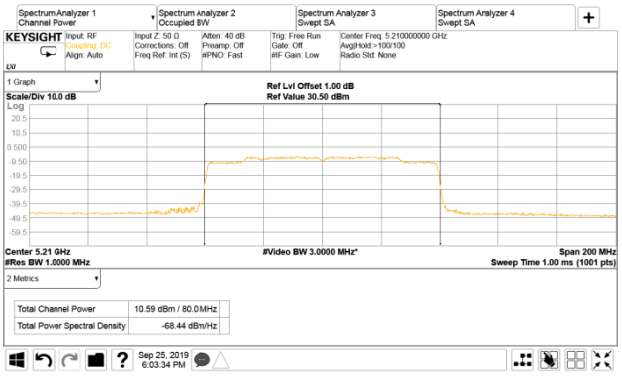
RU Configuration: 996/S67	
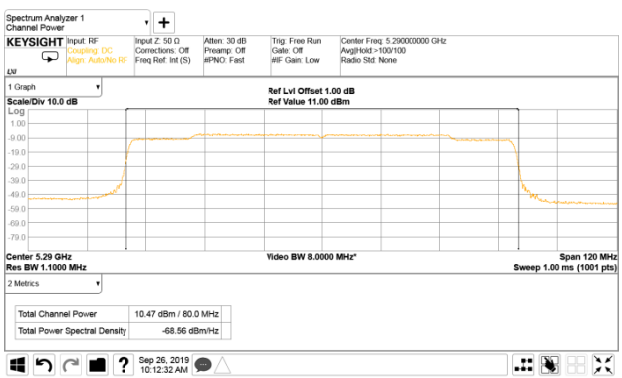	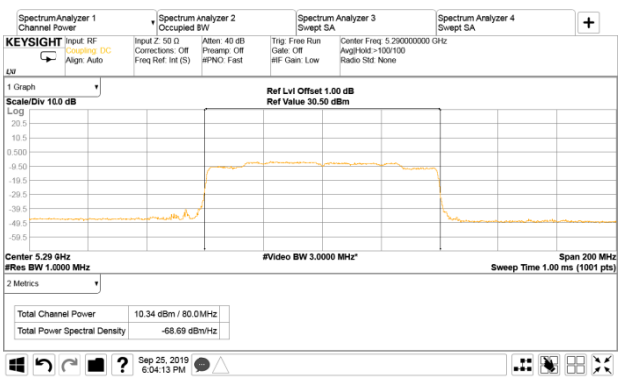

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

802.11ax-HE160	
UNII Band III	
Chain 0	Chain 1
5570MHz	
RU Configuration: 996/67	
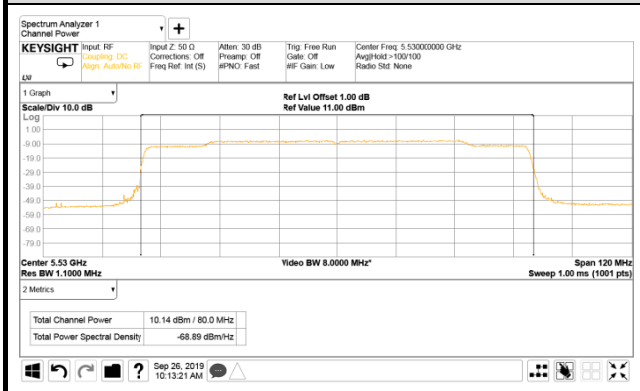	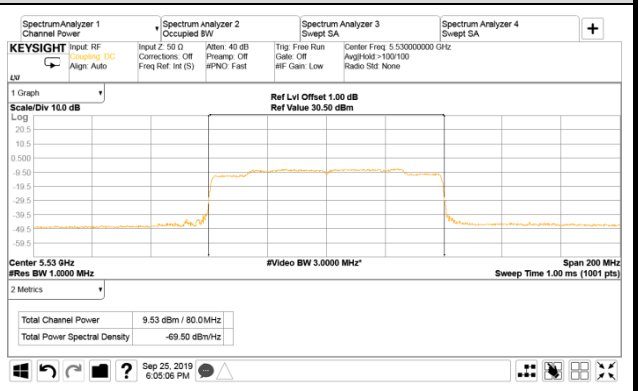
RU Configuration: 996/S67	
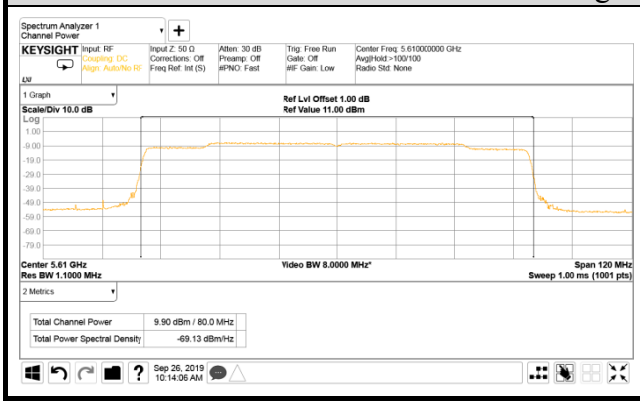	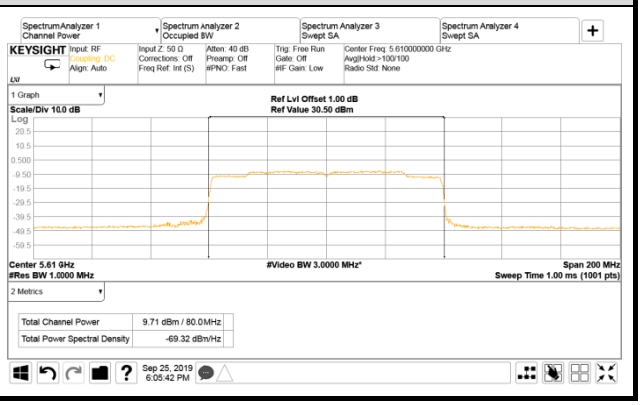

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

A.5 CONDUCTED BAND EDGES

Test Date	2019/01/07	Temp./Hum.	23℃/60%
Cable Loss	1.80	Tested By	Kuper Hsu
Test Voltage	AC 120V 60Hz (Via AC Adapter)	Test Model	14Z995
Simultaneous Factor 10 log(n) (Note: “n” is antenna number)		802.11a: 0 802.11n-HT20/40: 3 802.11ac-VHT80/160: 3 802.11ax-HE80/160: 3	

Mode: 802.11a	
UNII Band III	
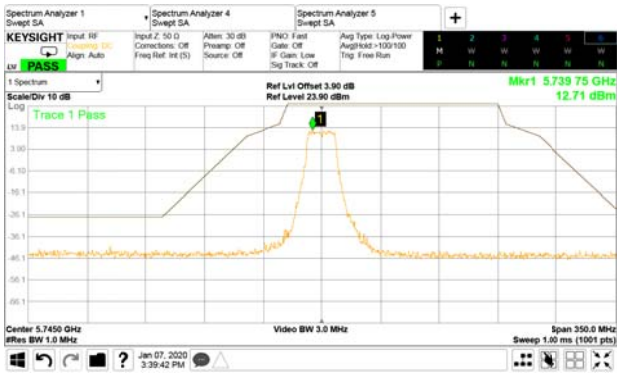	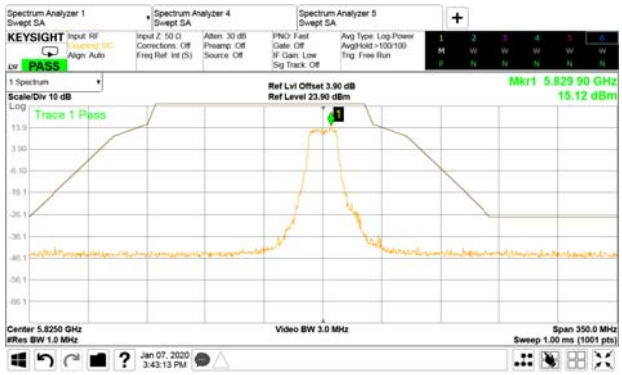

Mode: 802.11n-HT20	
UNII Band III	
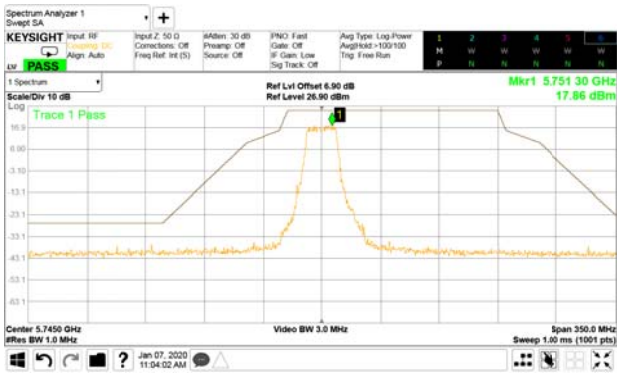	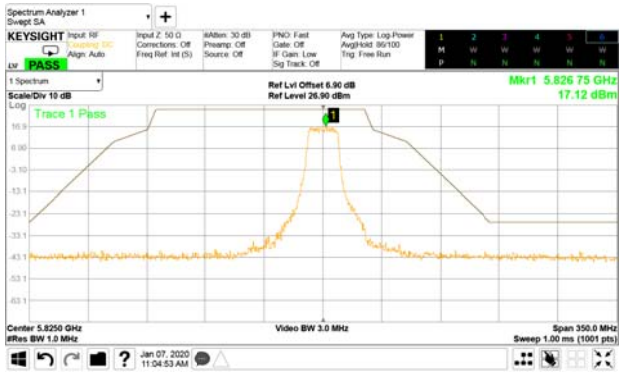

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11n-HT40	
UNII Band III	
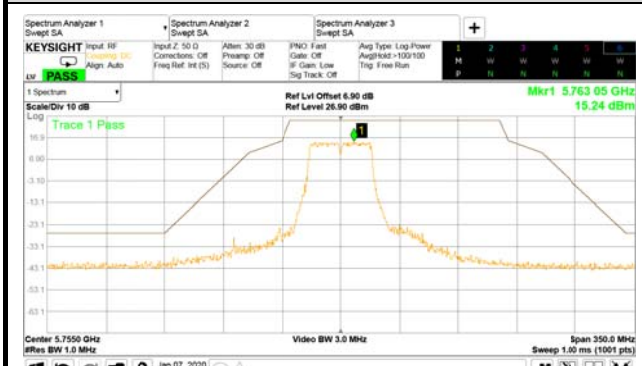	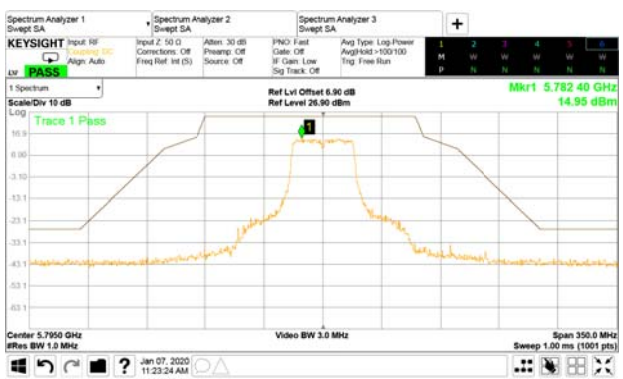

Mode: 802.11ac-VHT80
UNII Band III
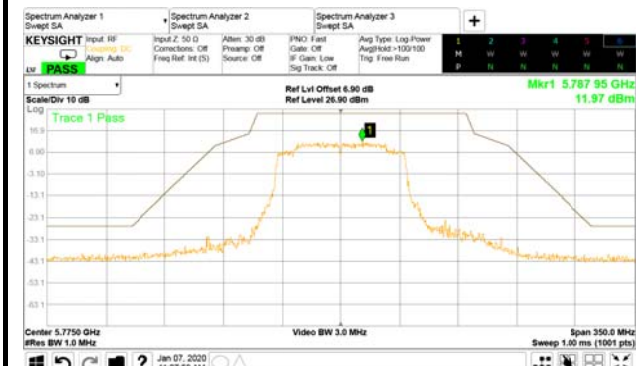

Mode: 802.11ax-HE20	
UNII Band III	
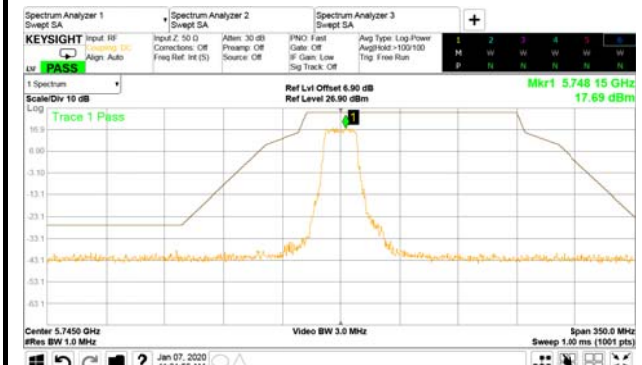	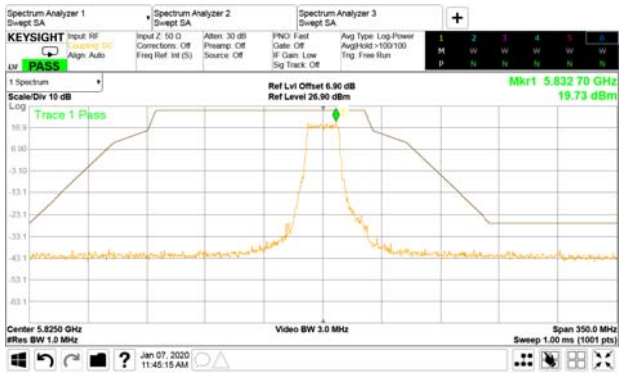

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11ax-HE40	
UNII Band III	
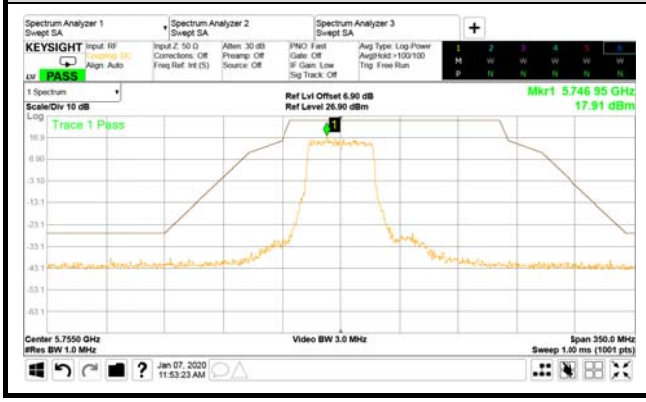	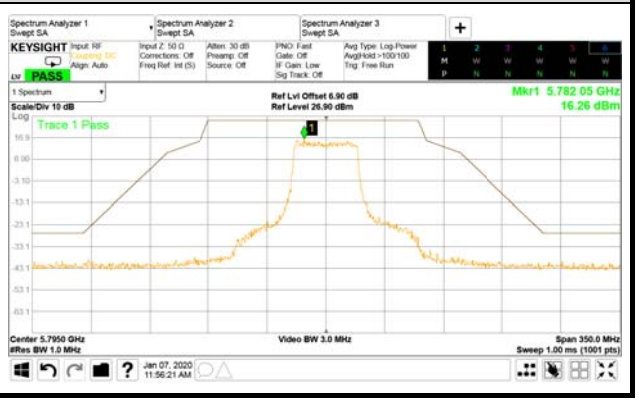

Mode: 802.11ax-HE80
UNII Band III
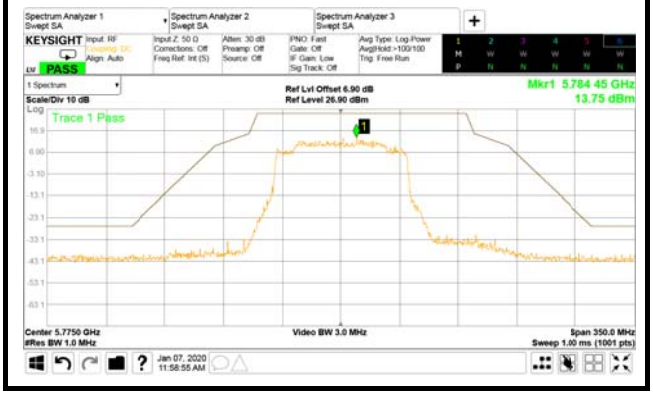

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11ax-HE20	
UNII Band III	
5745MHz	5825MHz
RU Configuration: 26/10	RU Configuration: 26/8
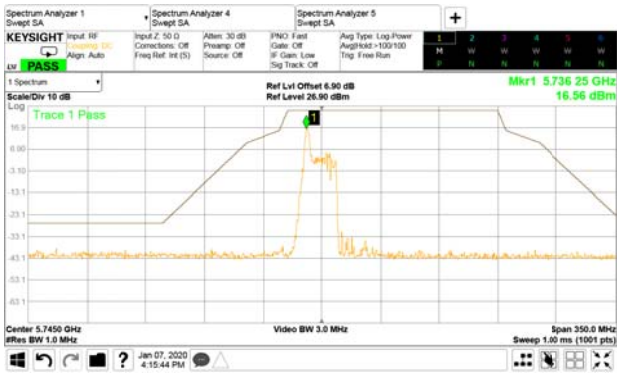	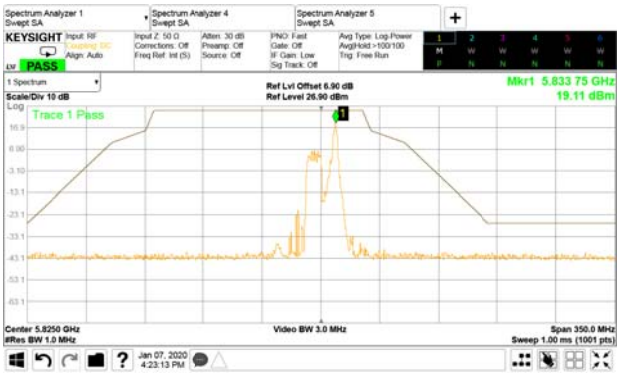
RU Configuration: 52/37	RU Configuration: 52/40
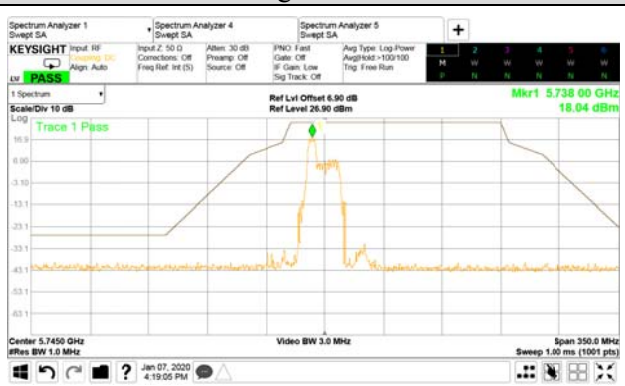	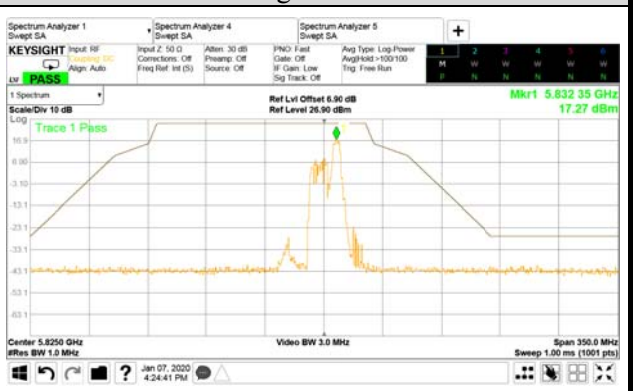
RU Configuration: 106/53	RU Configuration: 106/54
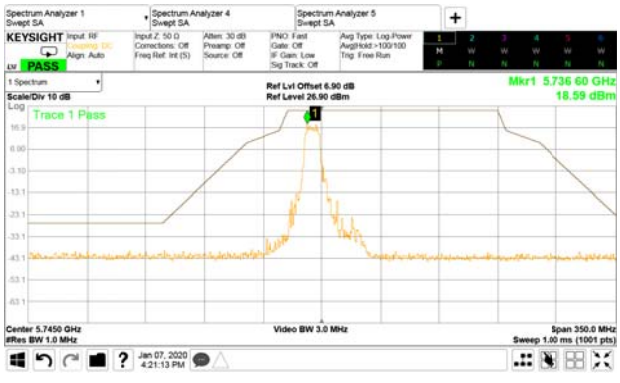	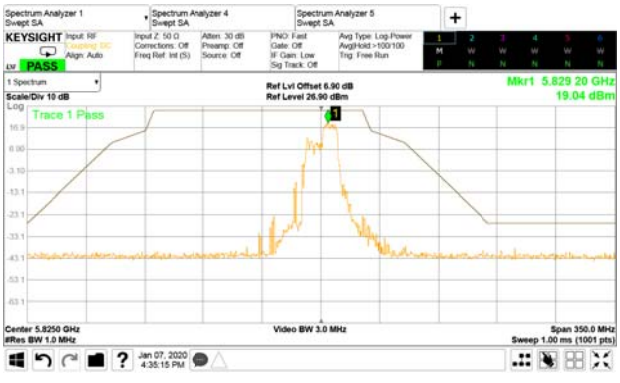

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11ax-HE40	
UNII Band III	
5755MHz	5795MHz
RU Configuration: 242/61	RU Configuration: 242/62
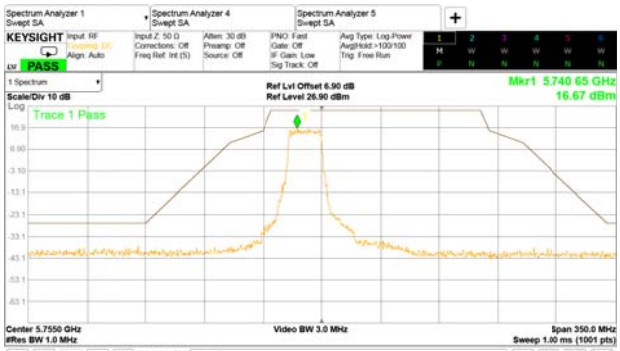	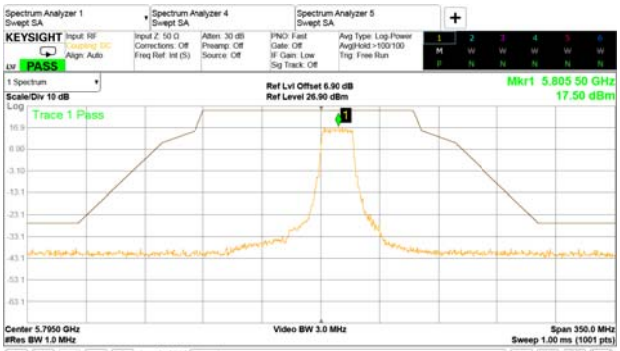

Mode: 802.11ax-HE80	
UNII Band III	
5775MHz	
RU Configuration: 484/65	RU Configuration: 484/66
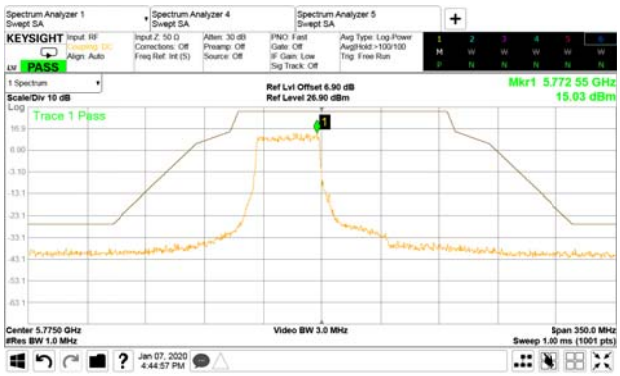	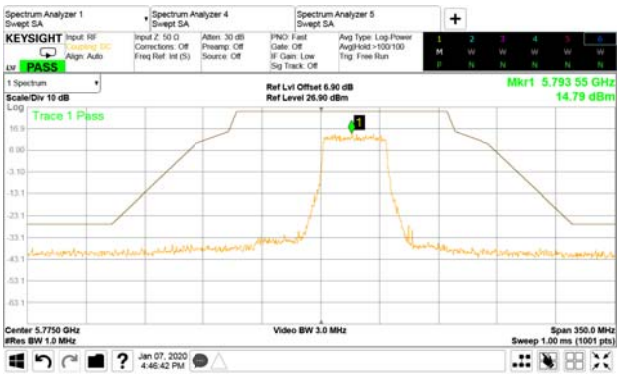

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan
Tel: +886 2 26099301
Fax: +886 2 26099303

A.6 POWER SPECTRAL DENSITY

Test Date	2019/09/23~10/3	Temp./Hum.	24℃/47~53%
Cable Loss	1	Tested By	Martin Chen
Test Voltage	AC 120V 60Hz (Via AC Adapter)	Test Model	14Z995
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)		802.11a: 0 802.11n-HT20/40: 3 802.11ac-VHT80/160: 3 802.11ax-HE80/160: 3	

A.6.1 Power Spectral Density Result

Mode	UNII Band	Centre Frequency (MHz)	Power Spectral Density (dBm)	Limit
802.11a	I	5180	7.304	11 dBm/MHz
		5200	8.070	
		5240	8.864	
	II-2A	5260	8.770	
		5300	7.407	
		5320	6.531	
	II-2C	5500	6.744	
		5580	8.860	
		5700	6.507	
		5720	8.838	
	III[Note2]	5745	6.604	30dBm/500 kHz
		5785	6.672	
		5825	6.616	

Note 1: All results have been included cable loss and Simultaneous Factor and correct duty factor.
Note 2: BWCF 6.99dB (100kHz converted to 500kHz) has been included in the test result.

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan
Tel: +886 2 26099301
Fax: +886 2 26099303

Mode	UNII Band	Centre Frequency (MHz)	Power Spectral Density (dBm)	Limit
802.11n-HT20	I	5180	7.207	11 dBm/MHz
		5200	7.751	
		5240	8.948	
	II-2A	5260	9.014	
		5300	7.552	
		5320	6.079	
	II-2C	5500	6.477	
		5580	8.936	
		5700	6.287	
		5720	8.803	
	III[Note2]	5745	6.562	30dBm/500 kHz
		5785	7.103	
		5825	6.825	
802.11n-HT40	I	5190	4.124	11 dBm/MHz
		5230	5.601	
	II-2A	5270	4.613	
		5310	2.175	
	II-2C	5510	2.677	
		5550	3.714	
		5670	5.746	
		5710	6.437	
	III[Note2]	5755	3.771	30dBm/500 kHz
		5795	3.783	
802.11ac-VHT80	I	5210	1.109	11 dBm/MHz
	II-2A	5290	-0.078	
	II-2C	5530	1.630	
		5610	3.978	
		5690	1.682	
	III [Note2]	5775	-0.372	30dBm/500 kHz
802.11ac-VHT160	I/II-2A	5250	-5.753	11 dBm/MHz
	II-2C	5570	-5.638	

Note 1: All results have been included cable loss and Simultaneous Factor.
Note 2: BWCF 6.99dB (100kHz converted to 500kHz) has been included in the test result.

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan
Tel: +886 2 26099301
Fax: +886 2 26099303

Mode	UNII Band	Centre Frequency (MHz)	Power Spectral Density (dBm)	Limit
802.11ax-HE20	I	5180	6.955	11 dBm/MHz
		5200	7.579	
		5240	8.661	
	II-2A	5260	9.004	
		5300	6.932	
		5320	6.014	
	II-2C	5500	6.177	
		5580	8.680	
		5700	6.106	
		5720	8.779	
	III[Note2]	5745	5.230	30dBm/500 kHz
		5785	5.201	
		5825	5.344	
802.11ax-HE40	I	5190	3.664	11 dBm/MHz
		5230	5.246	
	II-2A	5270	4.226	
		5310	1.608	
	II-2C	5510	2.252	
		5550	3.309	
		5670	5.314	
		5710	5.871	
	III[Note2]	5755	2.431	30dBm/500 kHz
		5795	2.550	
802.11ax-HE80	I	5210	0.831	11 dBm/MHz
	II-2A	5290	-0.441	
	II-2C	5530	1.185	
		5610	3.570	
		5690	3.682	
	III [Note2]	5775	-1.398	30dBm/500 kHz
802.11ax-HE160	I/II-2A	5250	-6.145	11 dBm/MHz
	II-2C	5570	-6.191	

Note 1: All results have been included cable loss and Simultaneous Factor.
Note 2: BWCF 6.99dB (100kHz converted to 500kHz) has been included in the test result.

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan
Tel: +886 2 26099301
Fax: +886 2 26099303

Mode	UNII Band	Centre Frequency (MHz)	RU Configuration	Power Spectral Density (dBm)	Limit
802.11ax-HE20	I	5180	26/10	10.204	11 dBm/MHz
			52/37	10.844	
			106/53	9.840	
	II-2A	5320	26/8	10.090	
			52/40	7.383	
			106/54	8.675	
	II-2C	5500	26/10	10.522	
			52/37	10.852	
			106/53	9.587	
		5700	26/8	9.841	
			52/40	8.772	
			106/54	8.214	
	III[Note2]	5745	26/10	7.675	30dBm/500 kHz
			52/37	7.773	
			106/53	7.986	
		5825	26/8	13.528	
			52/40	10.901	
			106/54	8.154	
802.11ax-HE40	I	5190	242/61	6.586	11 dBm/MHz
	II-2A	5310	242/62	4.462	
	II-2C	5510	242/61	5.450	
		5670	242/62	6.834	
	III[Note2]	5755	242/61	4.064	30dBm/500 kHz
		5795	242/62	4.563	
802.11ax-HE80	I	5210	484/65	3.093	11 dBm/MHz
	II-2A	5290	484/66	1.752	
	II-2C	5530	484/65	2.010	
		5610	484/66	4.301	
	III [Note2]	5775	484/65	0.411	30dBm/500 kHz
			484/66	0.620	
802.11ax-HE160	I/II-2A	5250	996/67	-3.198	11 dBm/MHz
			996/S67	-3.453	
	II-2C	5570	996/67	-4.063	
			996/S67	-3.809	

Note 1: All results have been included cable loss and Simultaneous Factor.
Note 2: BWCF 6.99dB (100kHz converted to 500kHz) has been included in the test result.

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

A.6.2 Measurement Plots

Mode: 802.11a	
UNII Band I	UNII Band II-2A
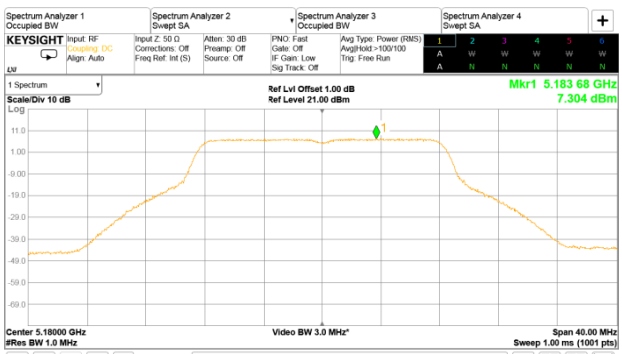	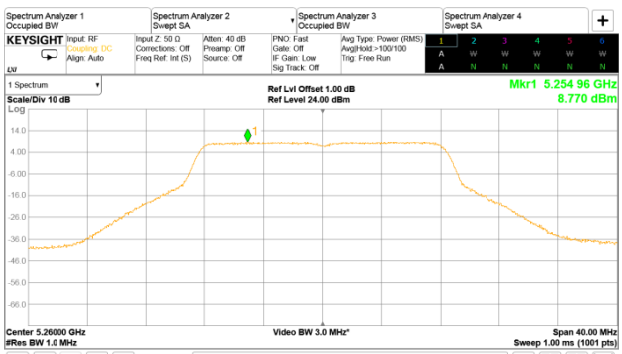
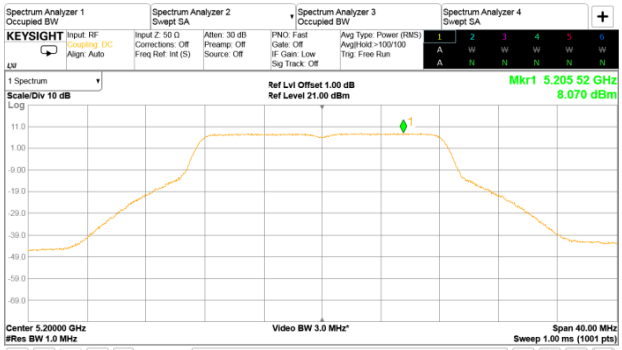	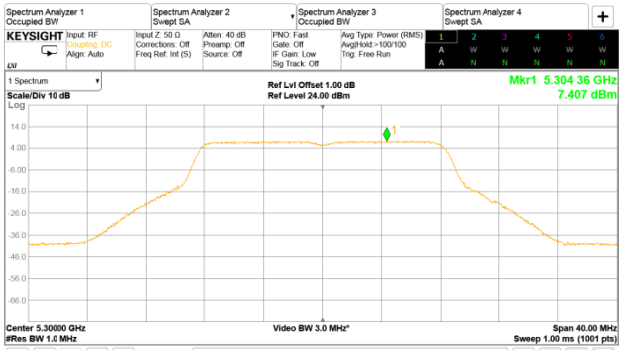
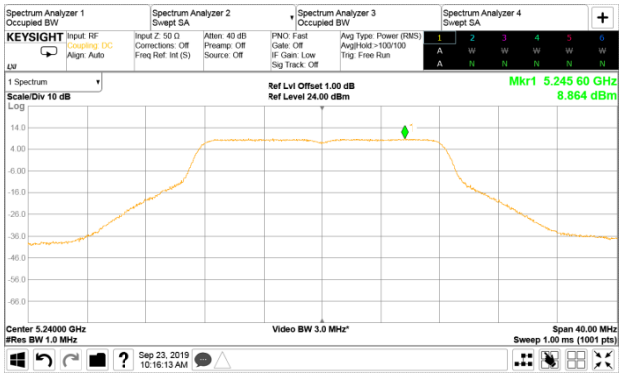	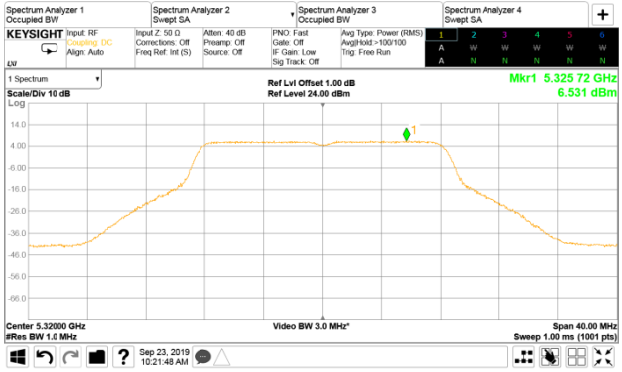

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11a	
UNII Band II-2C	UNII Band III

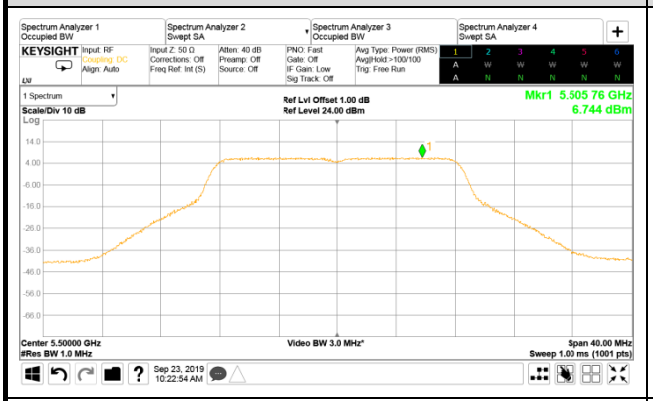

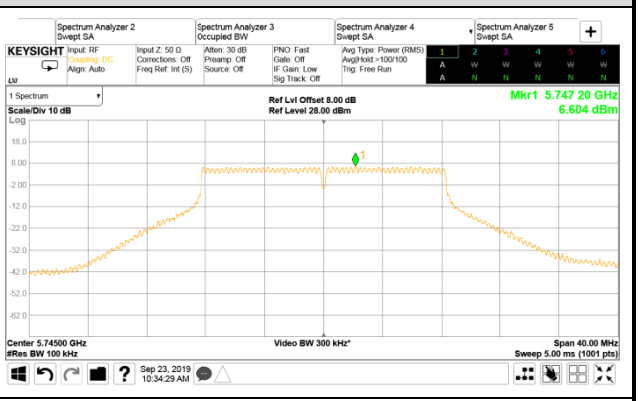

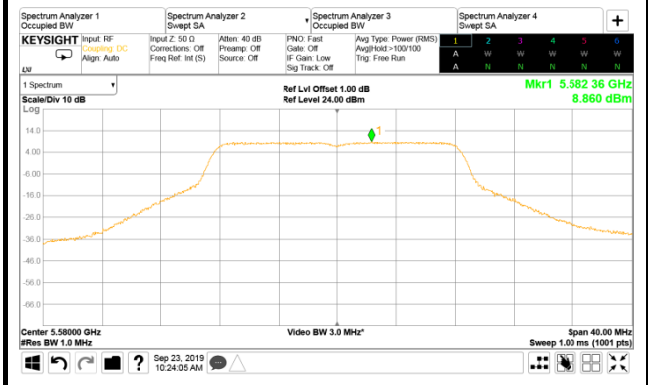

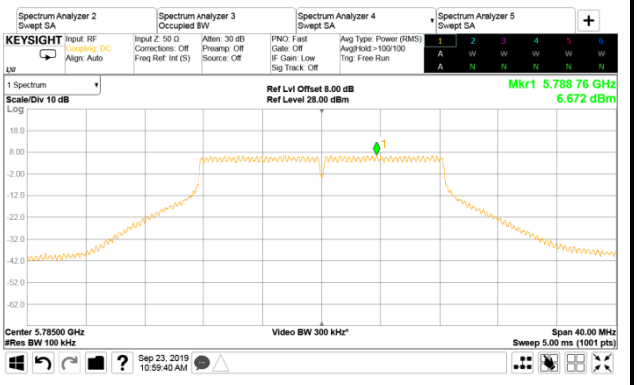

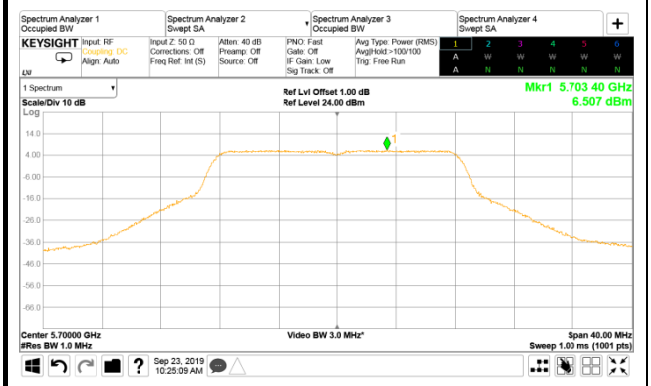

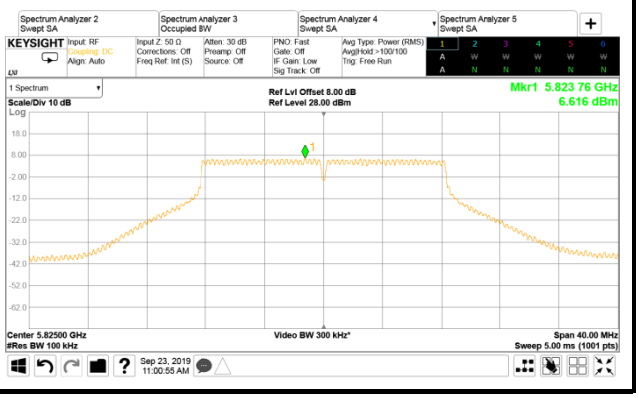

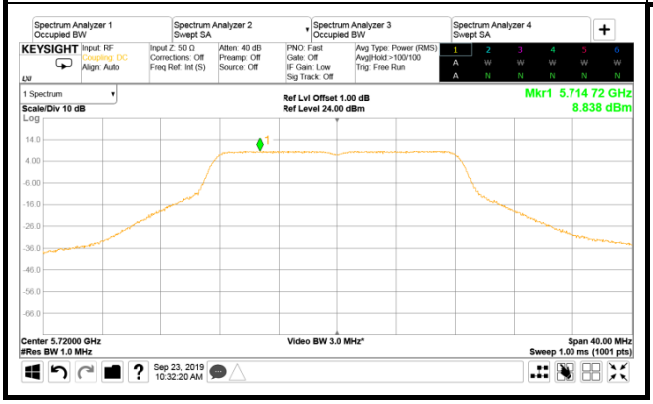

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11n-HT20	
UNII Band I	UNII Band II-2A
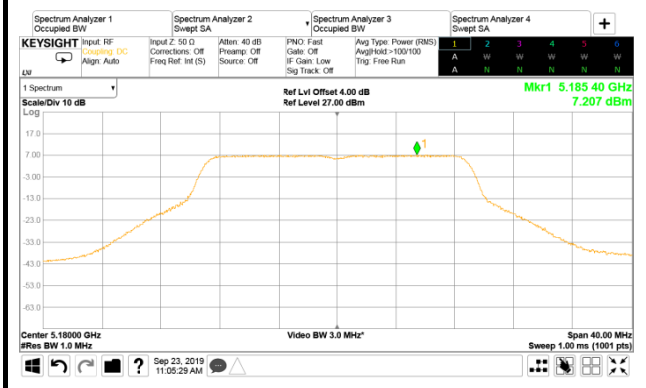	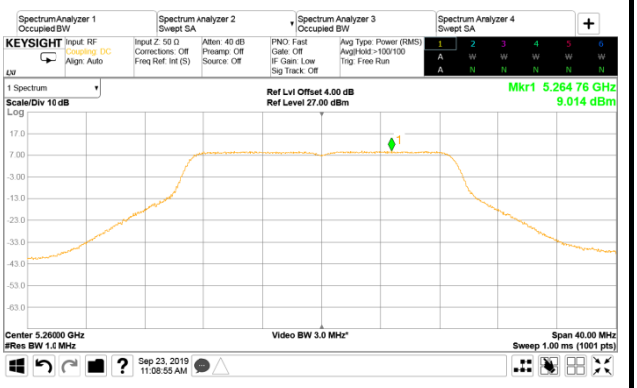
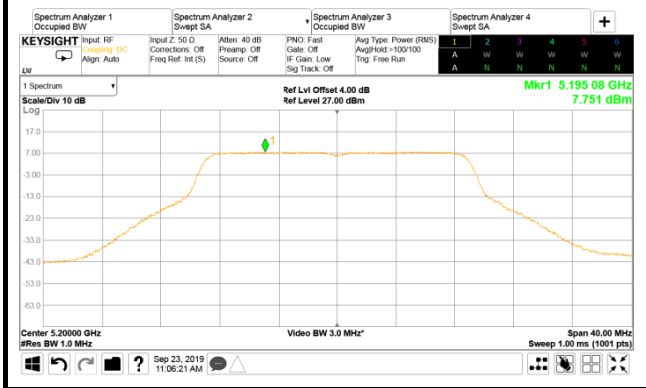	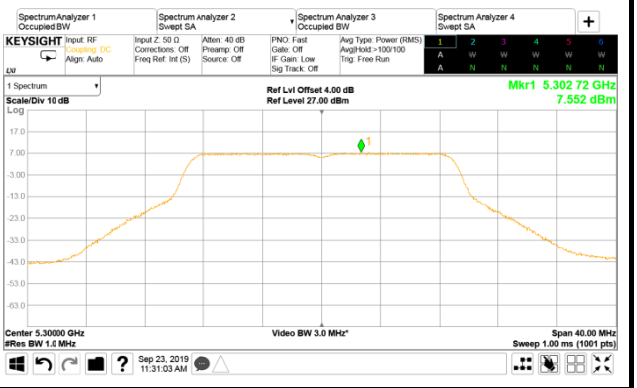
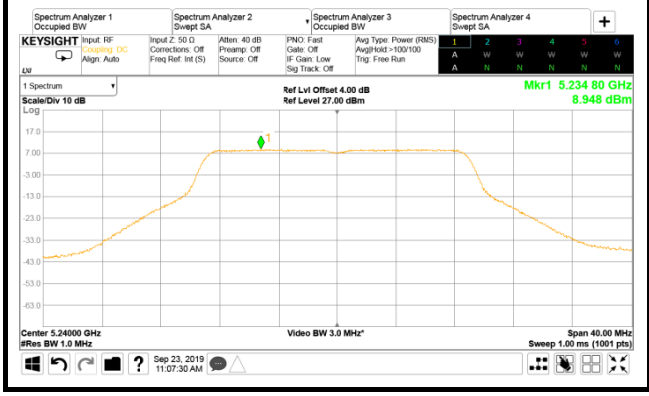	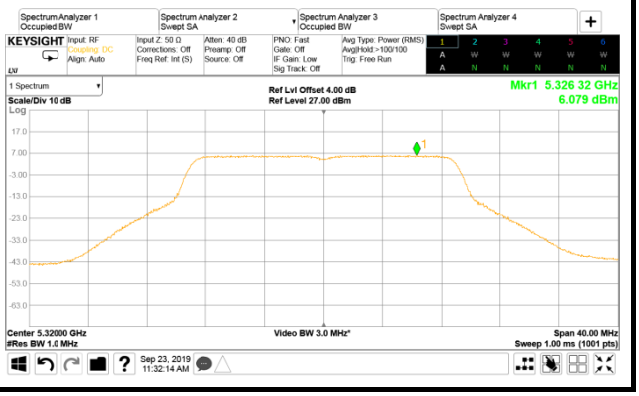

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11n-HT20	
UNII Band II-2C	UNII Band III

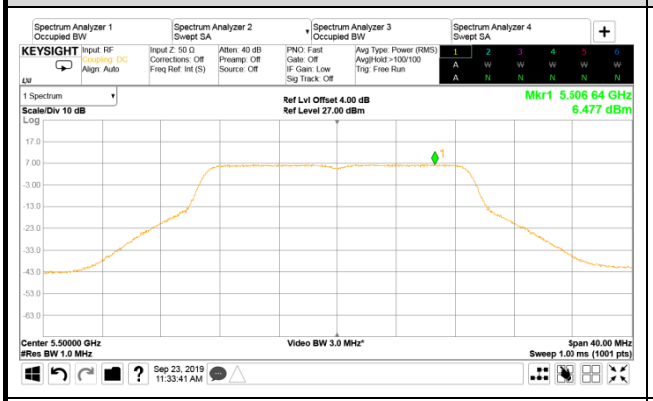

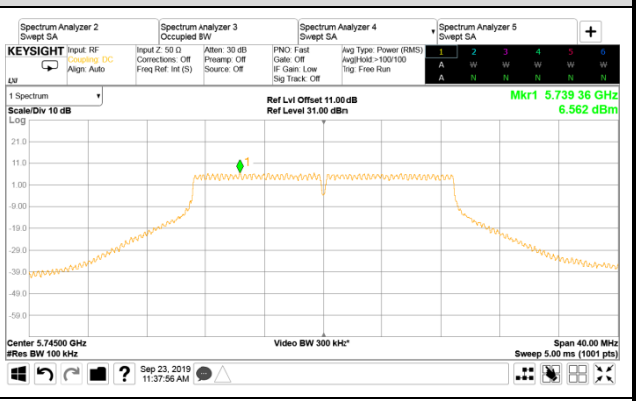

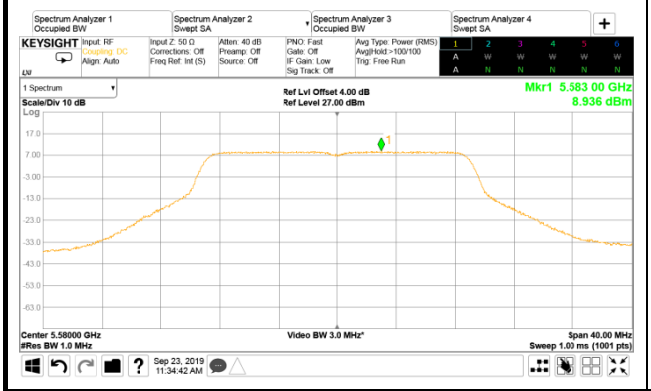

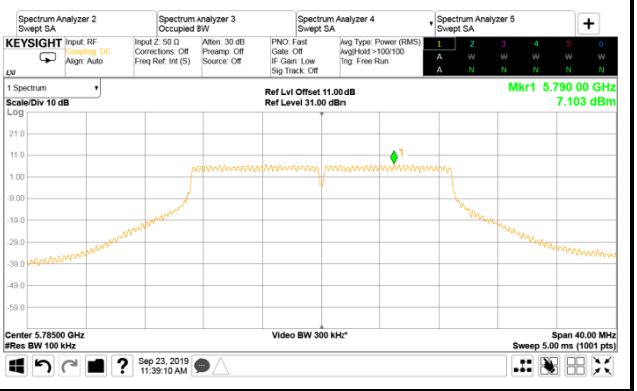

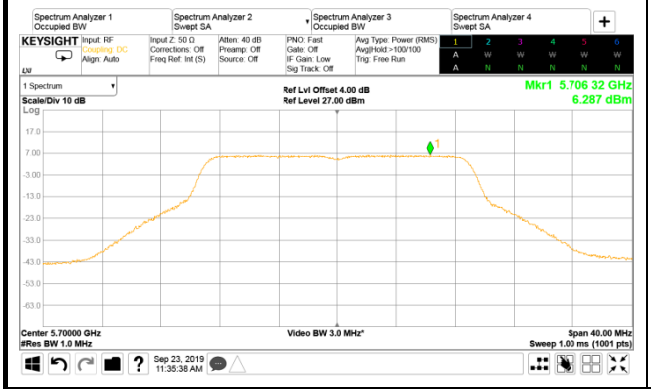

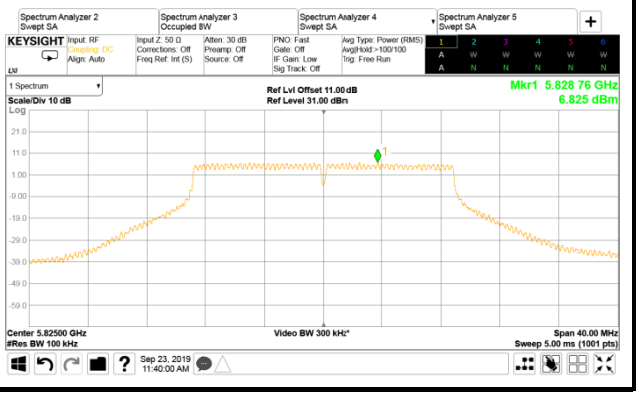

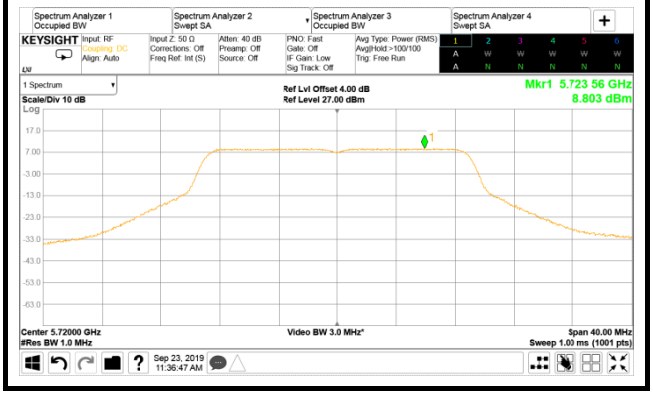

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11n-HT40	
UNII Band I	UNII Band II-2A
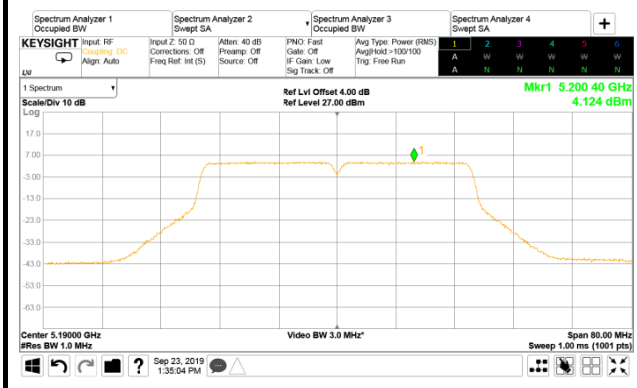	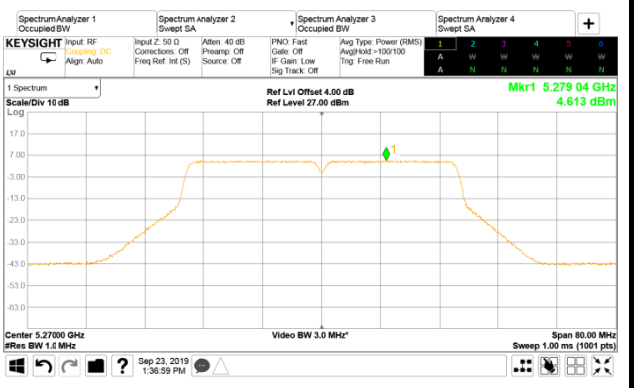
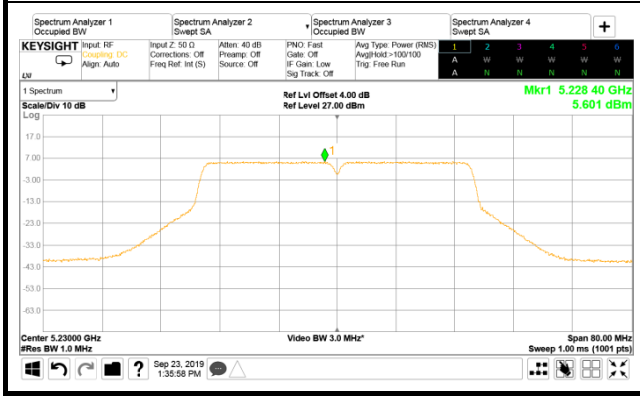	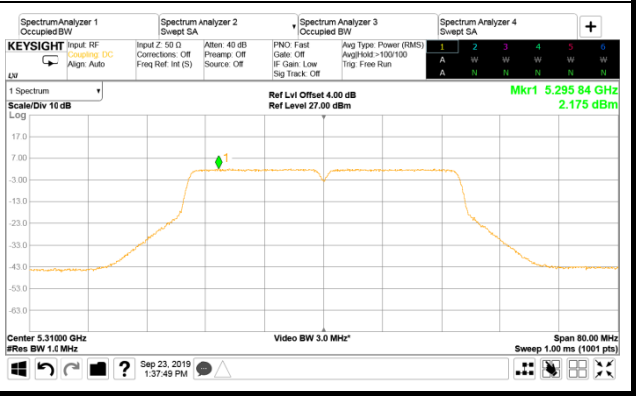

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Mode: 802.11n-HT40

UNII Band II-2C

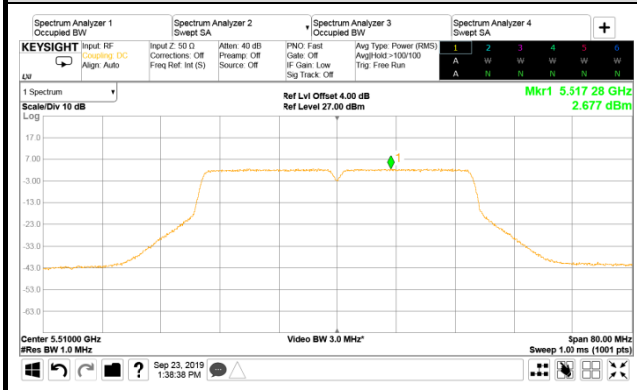

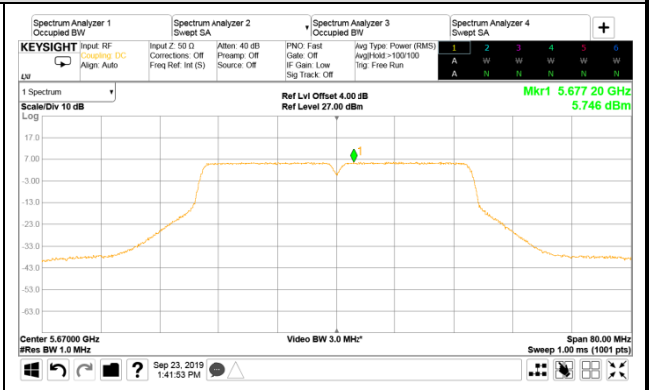

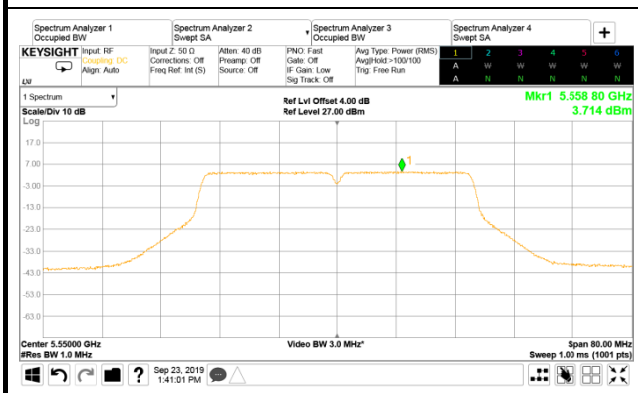

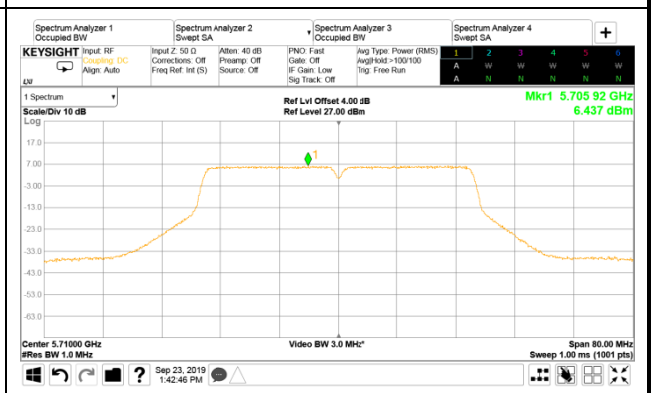

UNII Band III

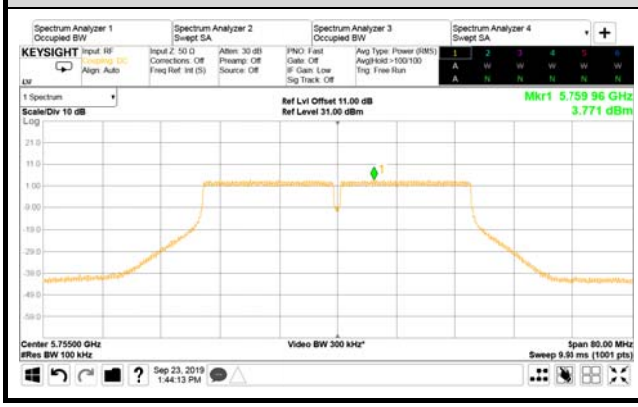

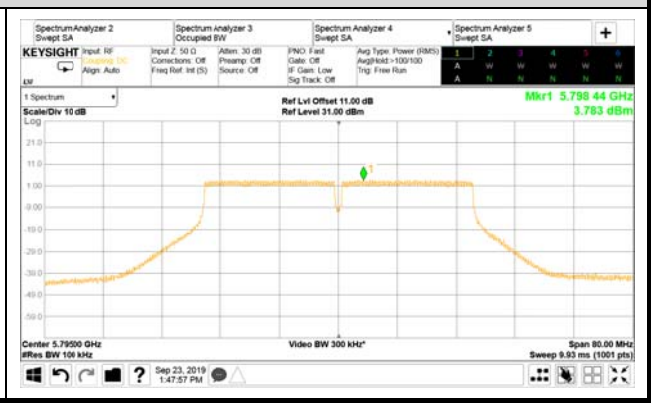

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.