






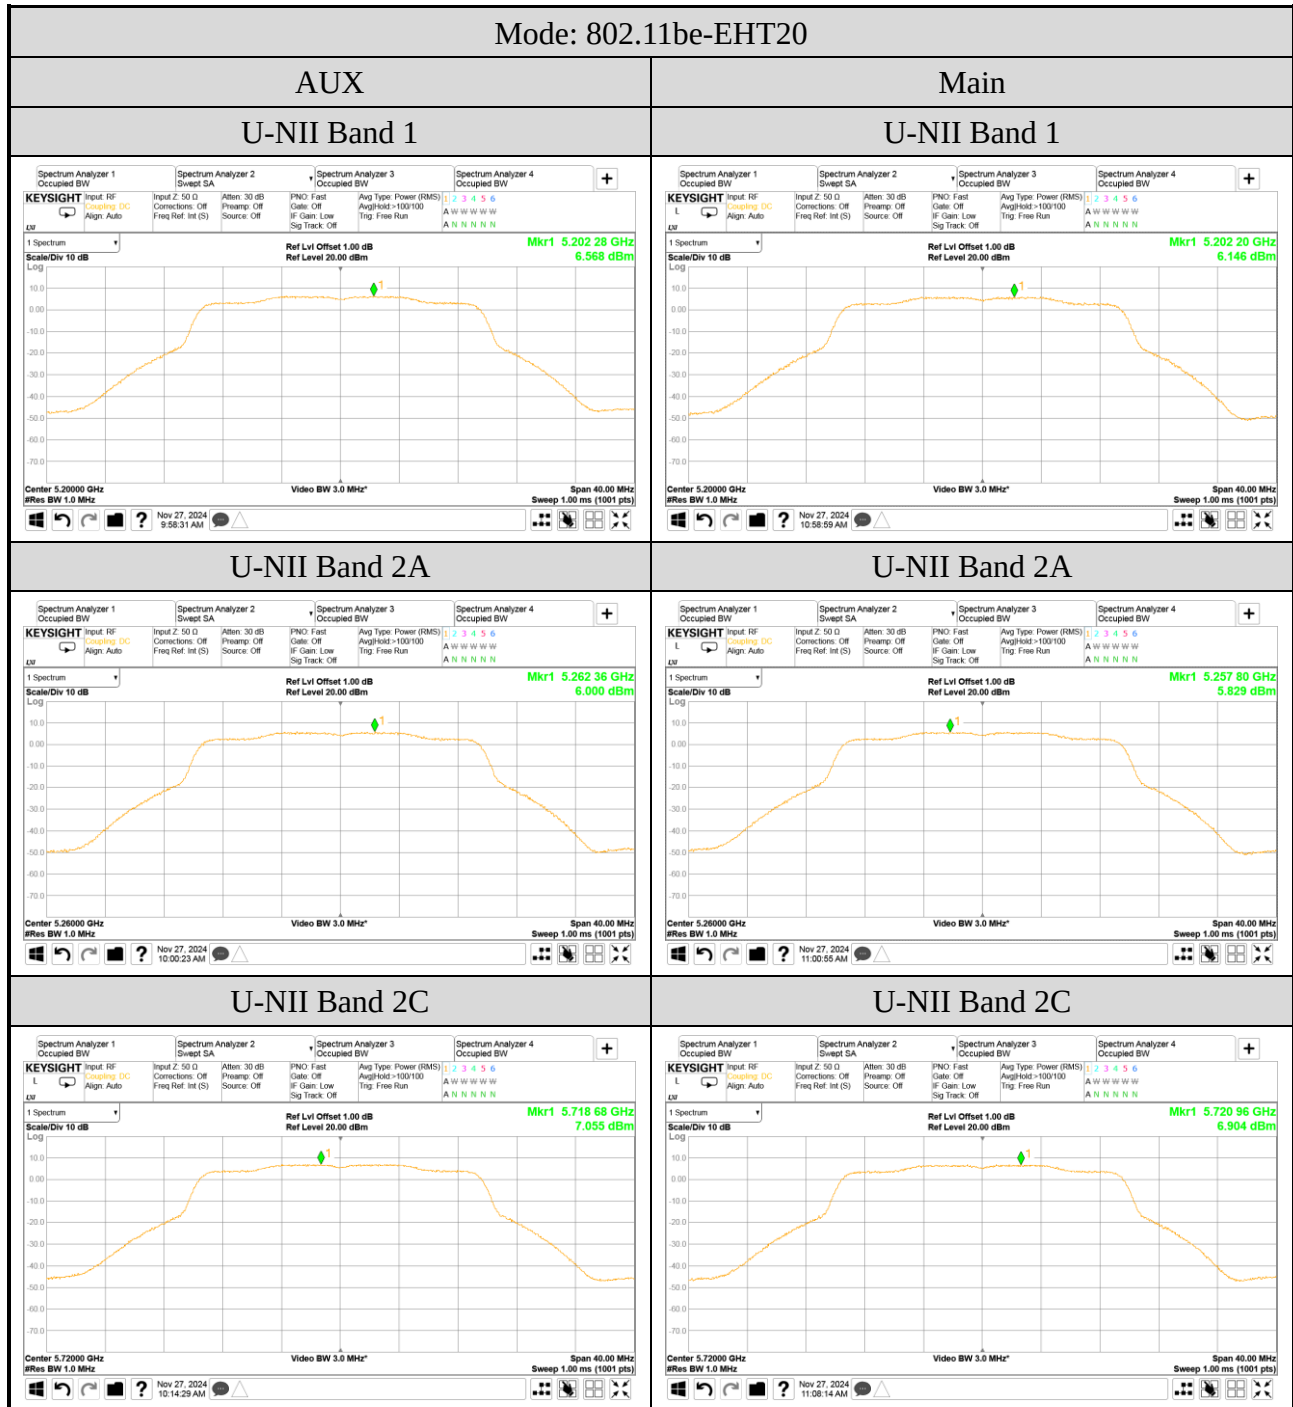


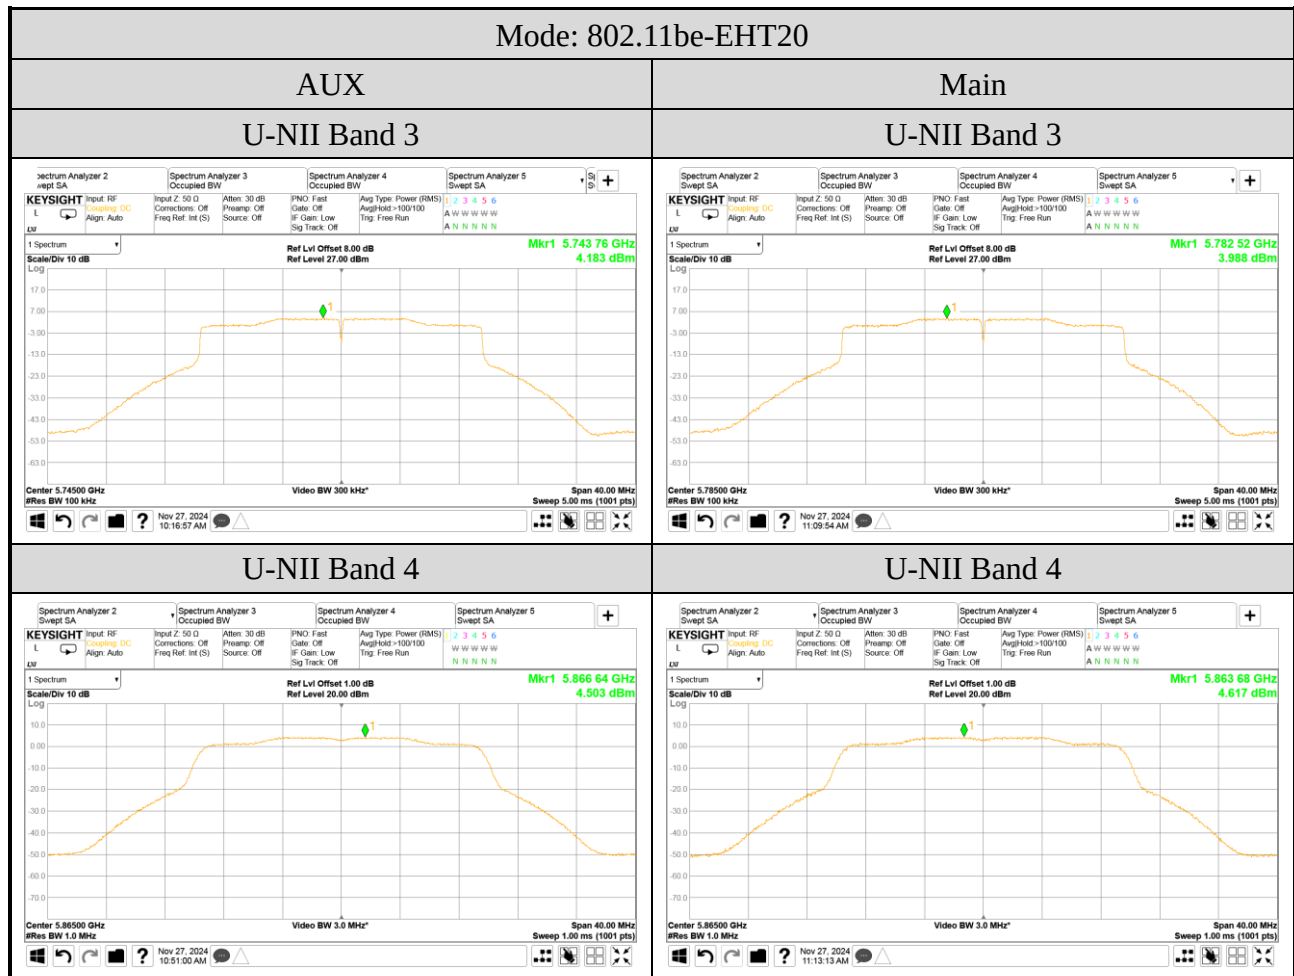


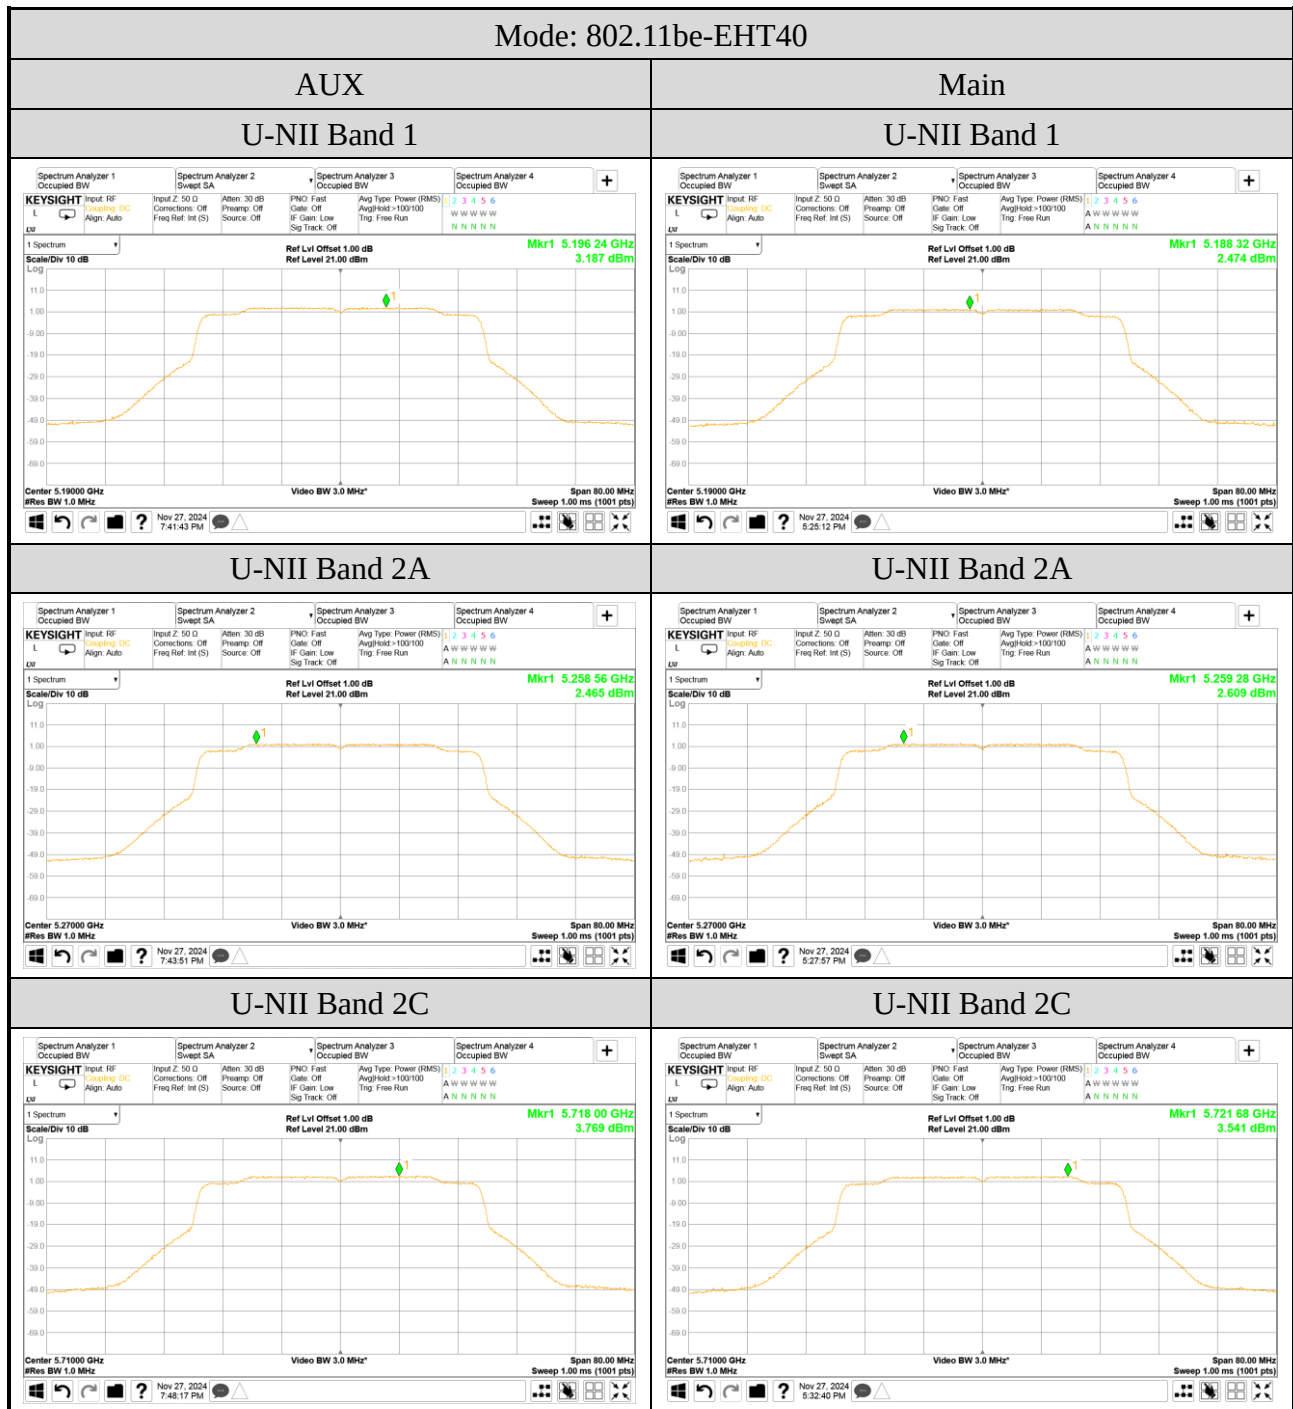

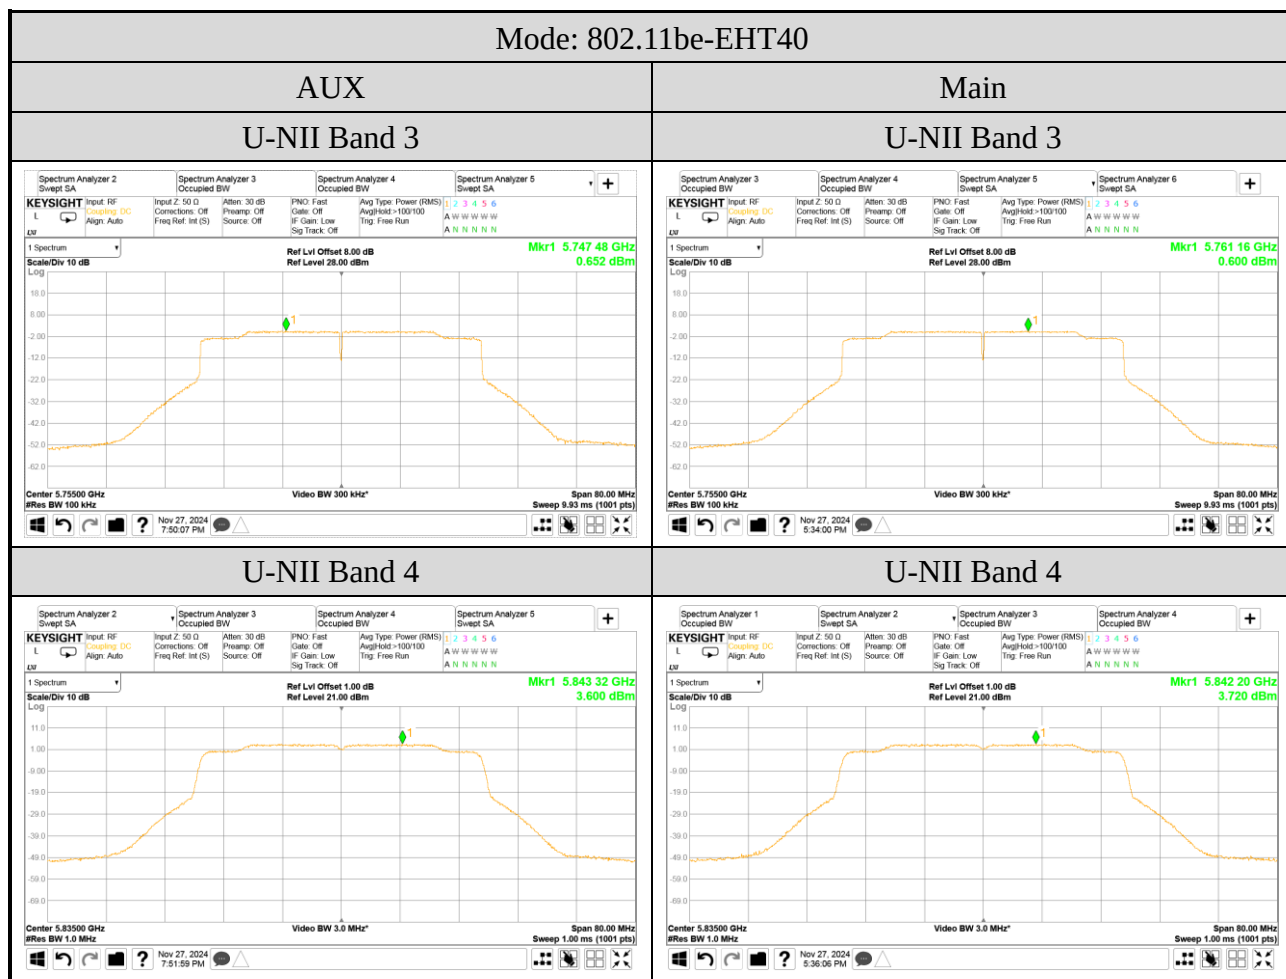


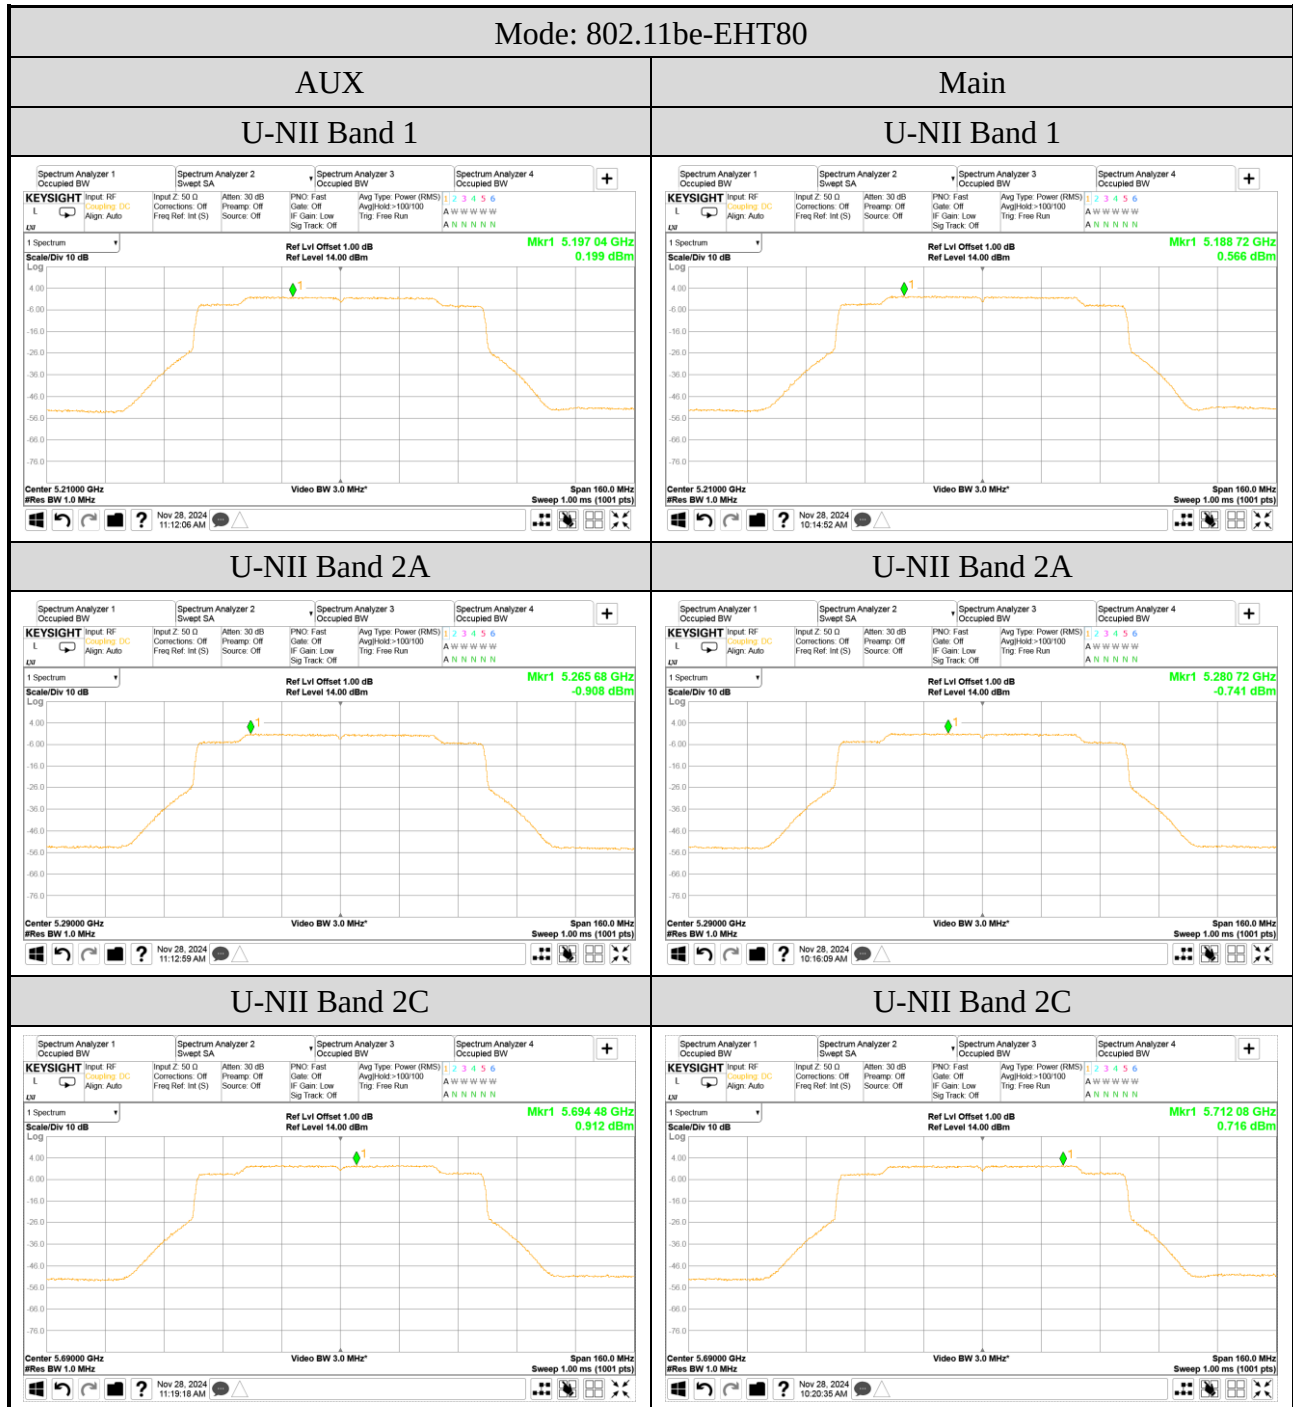



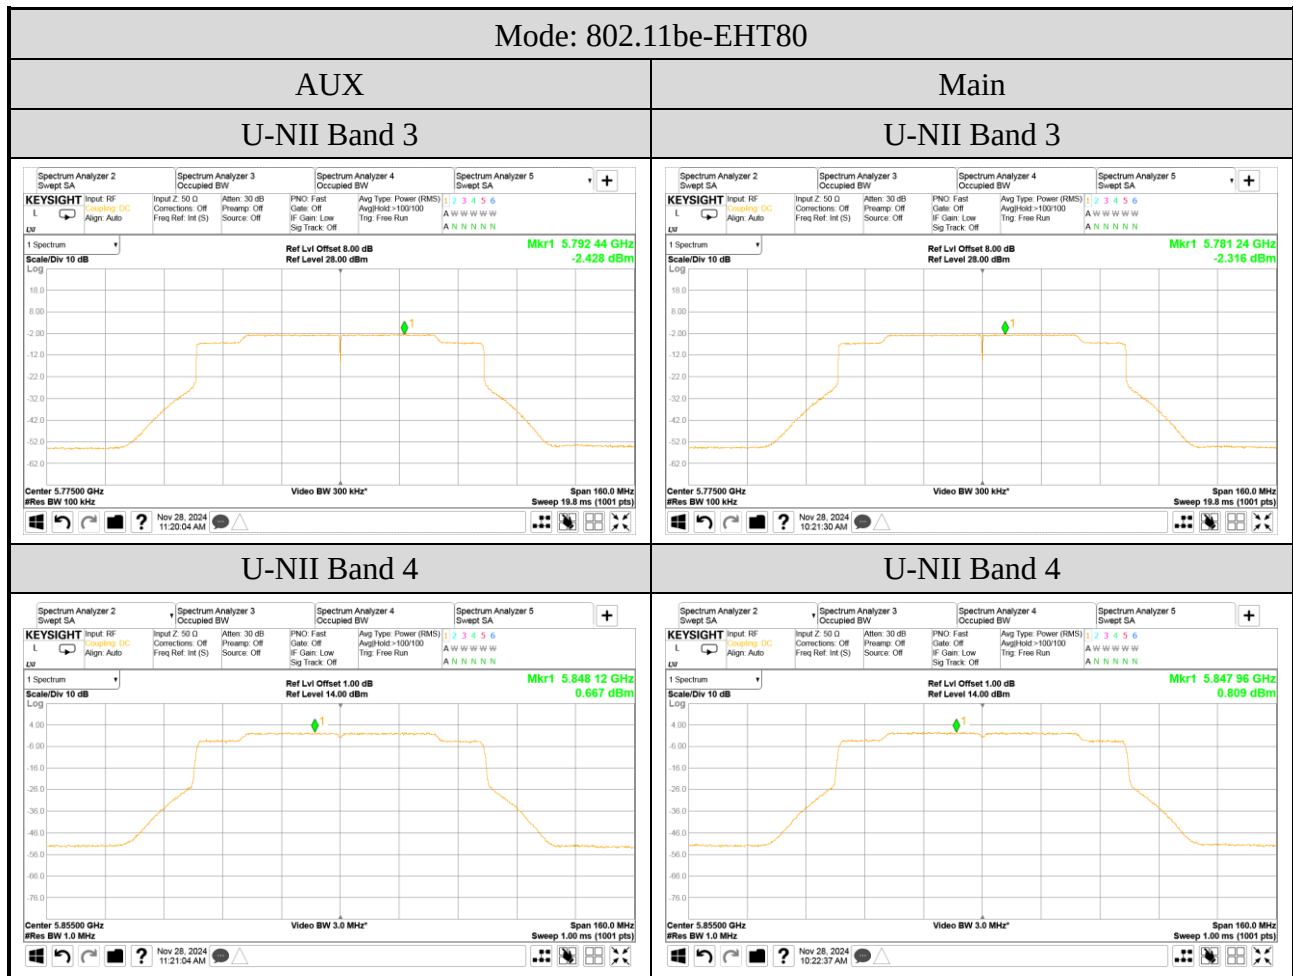


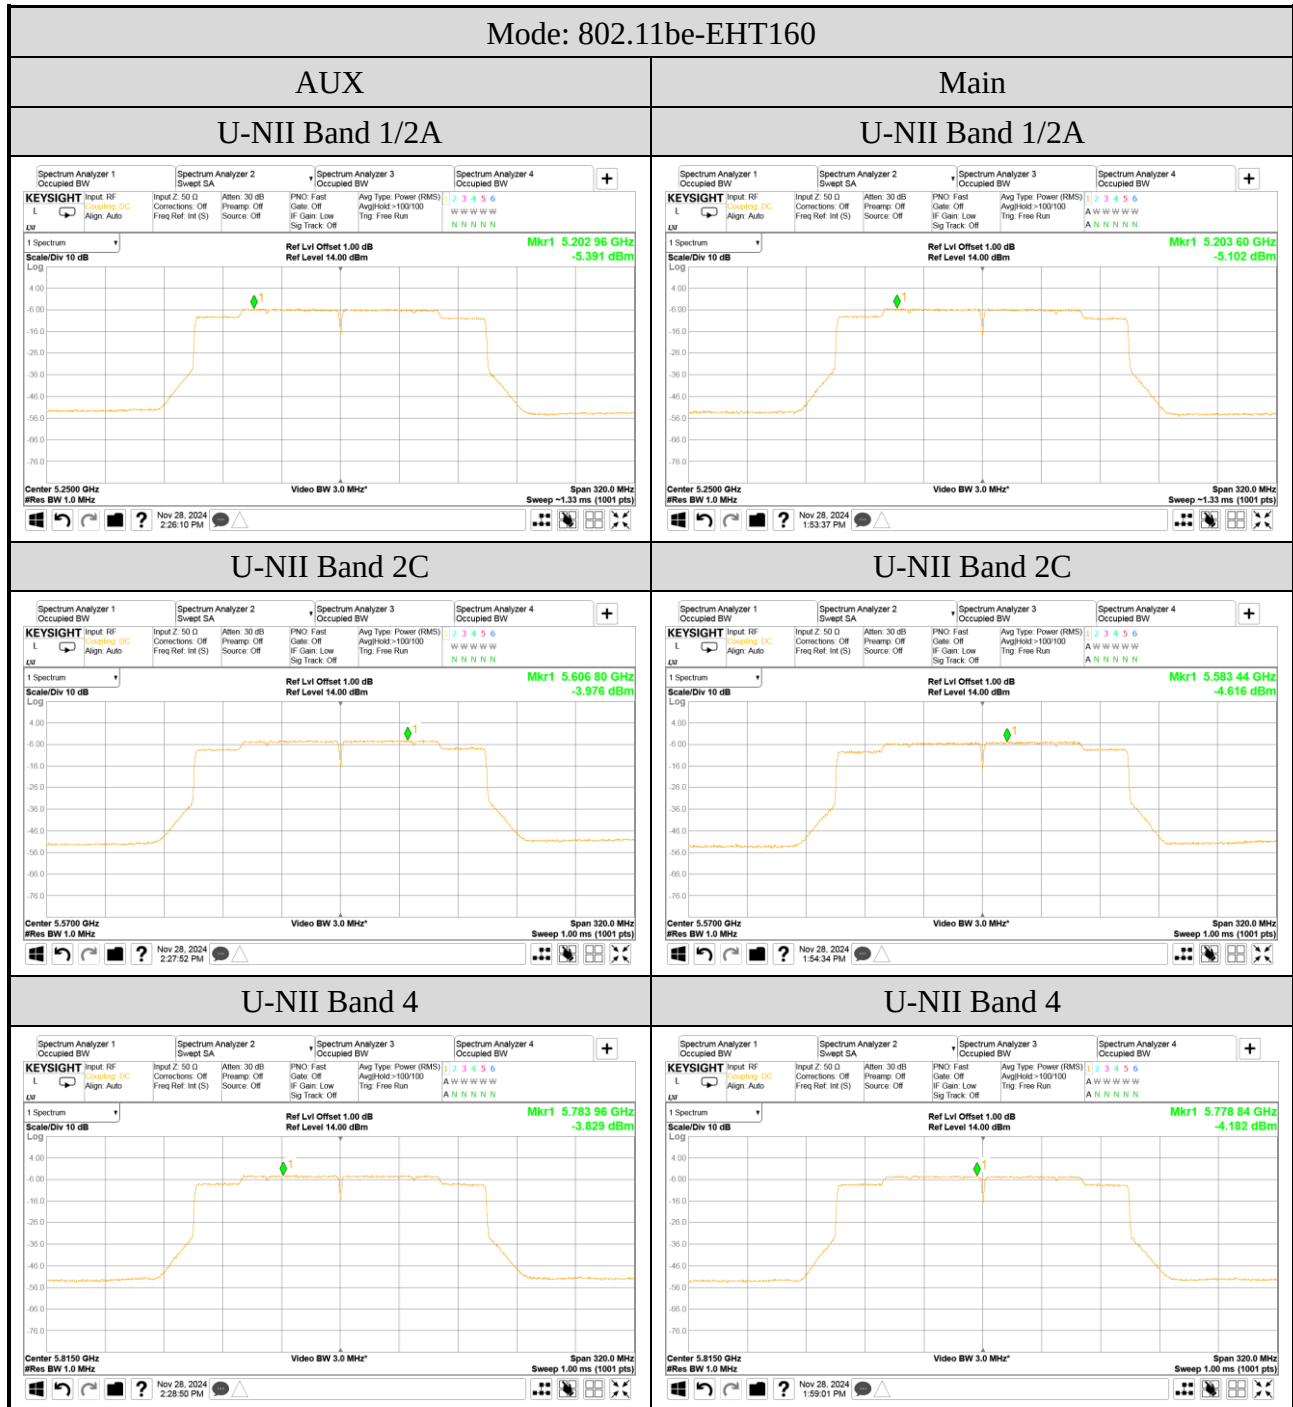

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

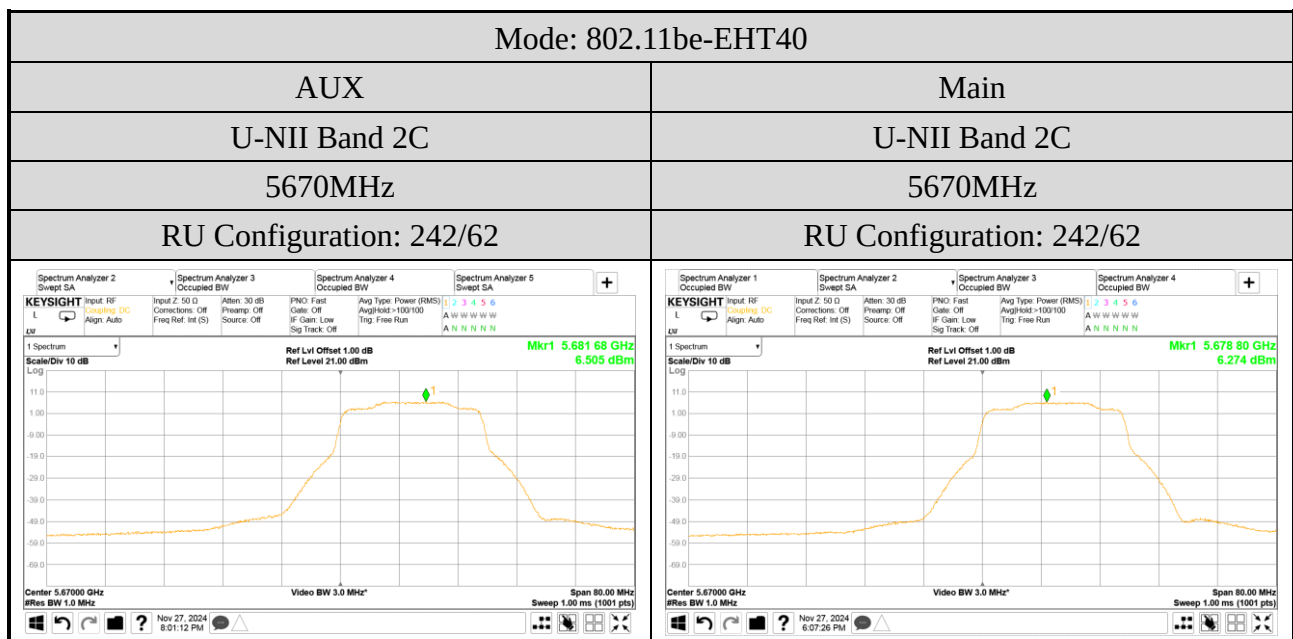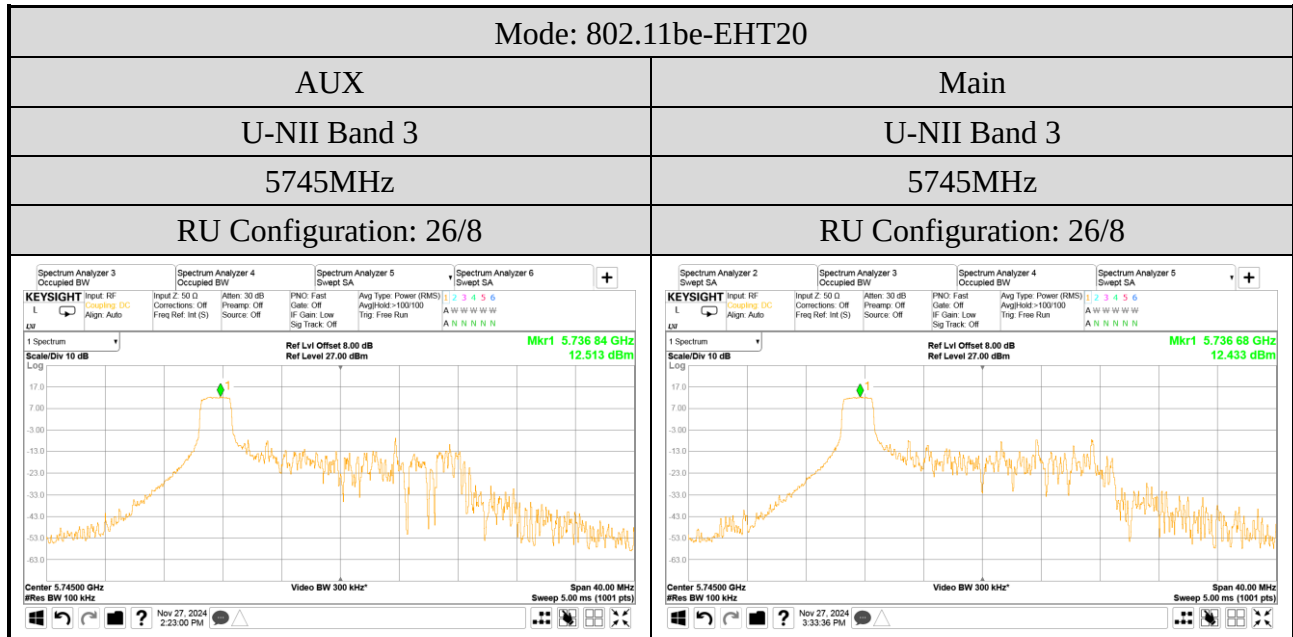

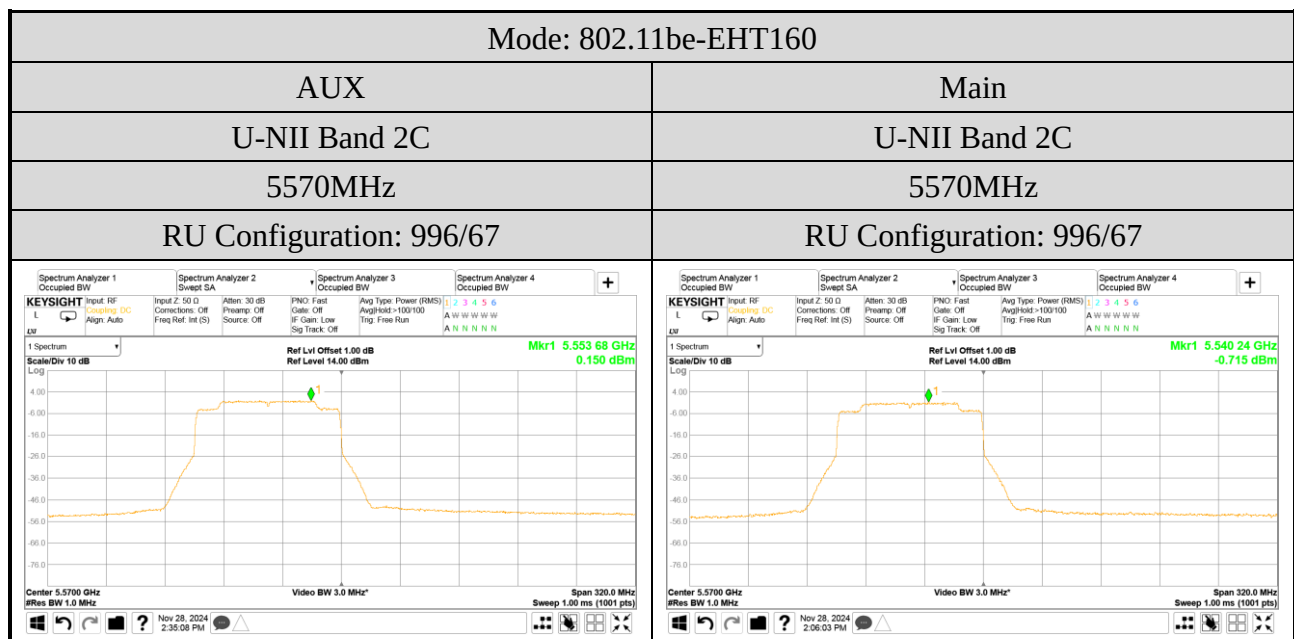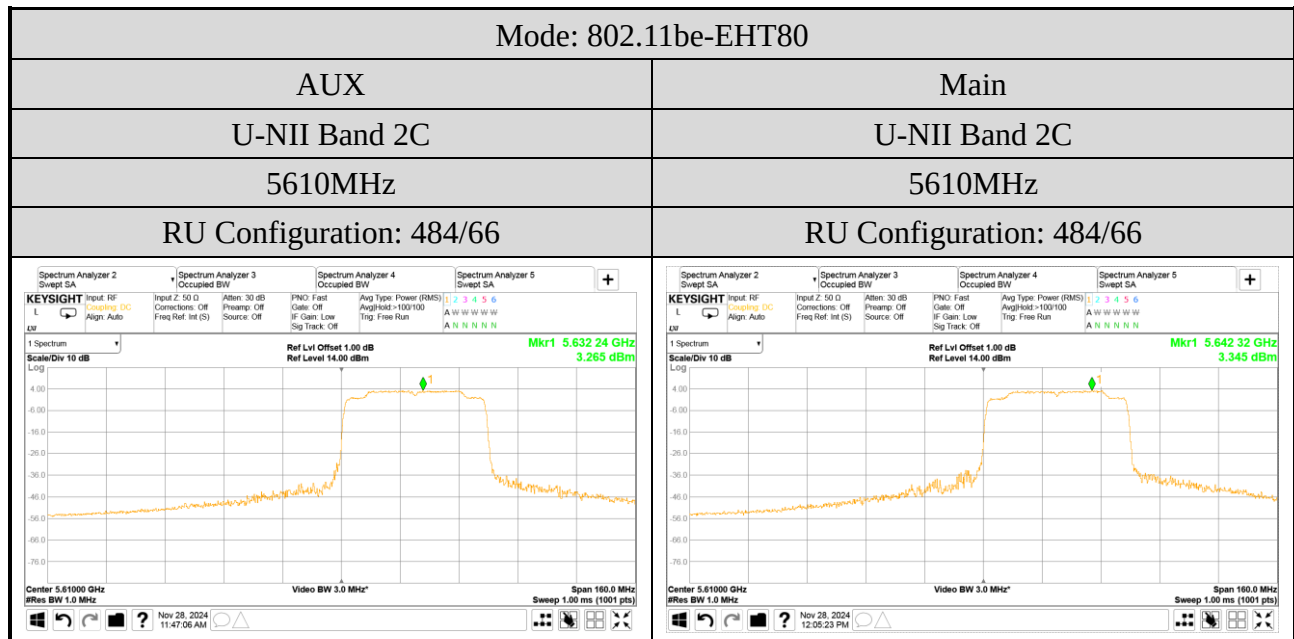

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

## A.5 FREQUENCY STABILITY

|              |                               |            |             |
|--------------|-------------------------------|------------|-------------|
| Test Date    | 2024/12/12                    | Temp./Hum. | 20°C/60%    |
| Cable Loss   | ---                           | Tested By  | Harry Huang |
| Test Voltage | AC 120V 60Hz (Via AC Adapter) |            |             |

### A.5.1 Frequency stability Result

| Temperature (°C) | Voltage (Vac) | Centre Frequency (MHz) | Measurement Value (MHz) | Frequency Stability (ppm) |
|------------------|---------------|------------------------|-------------------------|---------------------------|
| 25               | 120           | 5180                   | 5180.004                | 0.772                     |
| -30              | 102           |                        | 5179.996                | -0.772                    |
|                  | 138           |                        | 5180.009                | 1.737                     |
| -20              | 102           |                        | 5179.991                | -1.737                    |
|                  | 138           |                        | 5180.005                | 0.965                     |
| -10              | 102           |                        | 5180.003                | 0.579                     |
|                  | 138           |                        | 5180.010                | 1.931                     |
| 0                | 102           |                        | 5179.985                | -2.896                    |
|                  | 138           |                        | 5180.002                | 0.386                     |
| 10               | 102           |                        | 5179.996                | -0.772                    |
|                  | 138           |                        | 5180.001                | 0.193                     |
| 20               | 102           |                        | 5180.013                | 2.510                     |
|                  | 138           |                        | 5179.988                | -2.317                    |
| 30               | 102           |                        | 5179.996                | -0.772                    |
|                  | 138           |                        | 5179.983                | -3.282                    |
| 40               | 102           |                        | 5179.986                | -2.703                    |
|                  | 138           |                        | 5179.984                | -3.089                    |
| 50               | 102           |                        | 5179.999                | -0.193                    |
|                  | 138           |                        | 5180.010                | 1.931                     |


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan



**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303

## A.6 BAND EDGE

|              |                               |            |                       |
|--------------|-------------------------------|------------|-----------------------|
| Test Date    | 2024/11/25 ~ 12/8             | Temp./Hum. | 22 ~ 24°C/50 ~ 56%    |
| Test Voltage | AC 120V 60Hz (Via AC Adapter) | Tested By  | Kuper Hsu/Harry Huang |



**Antenna: INPAQ**


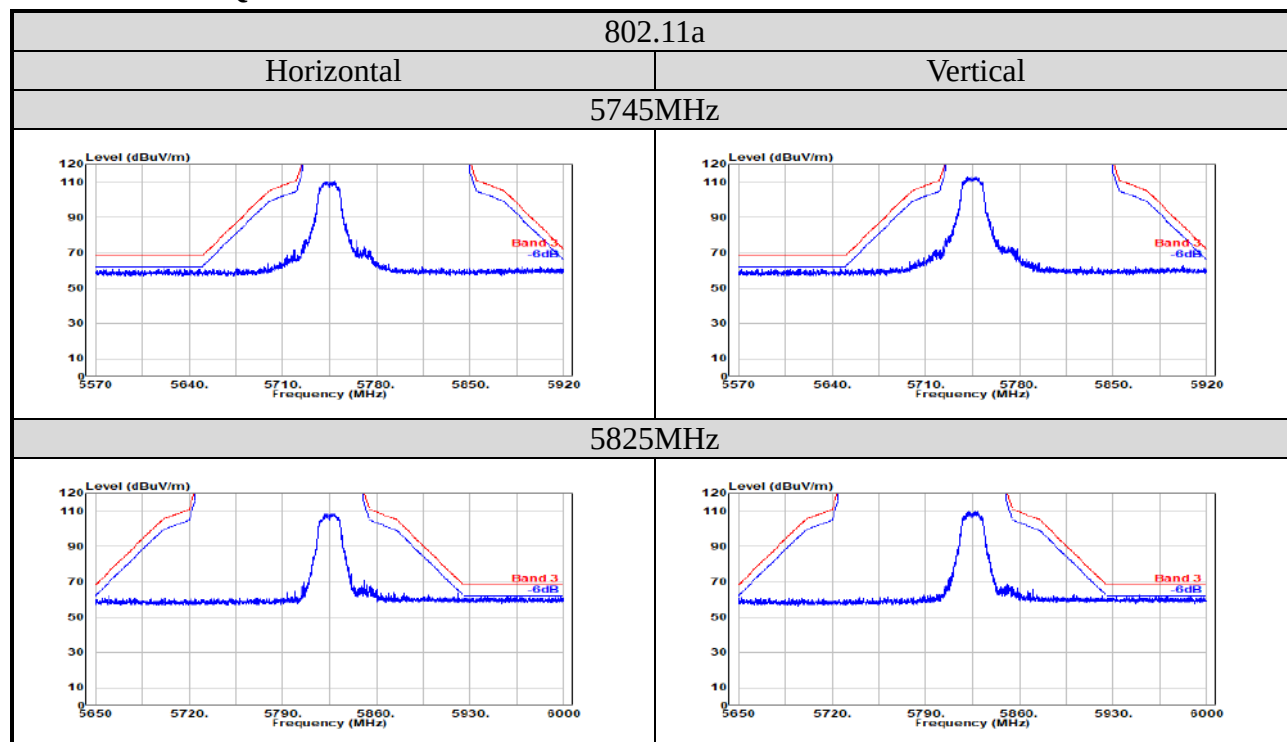


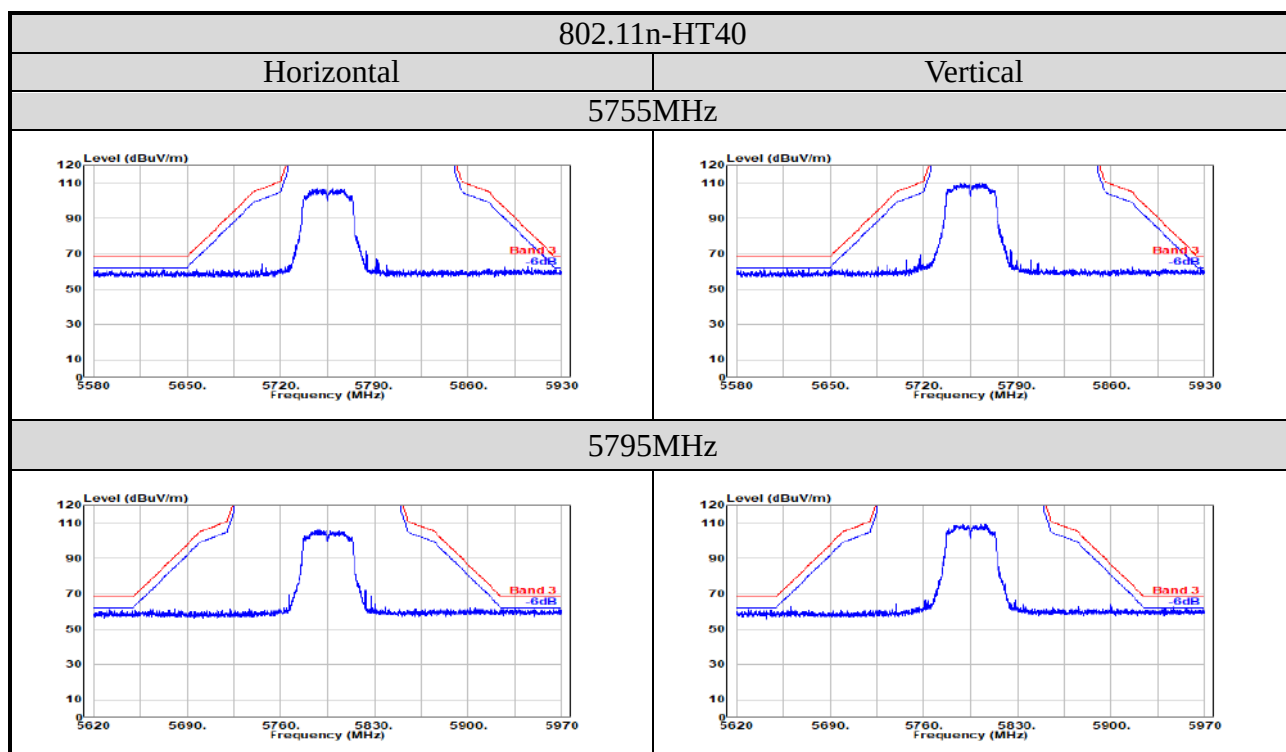
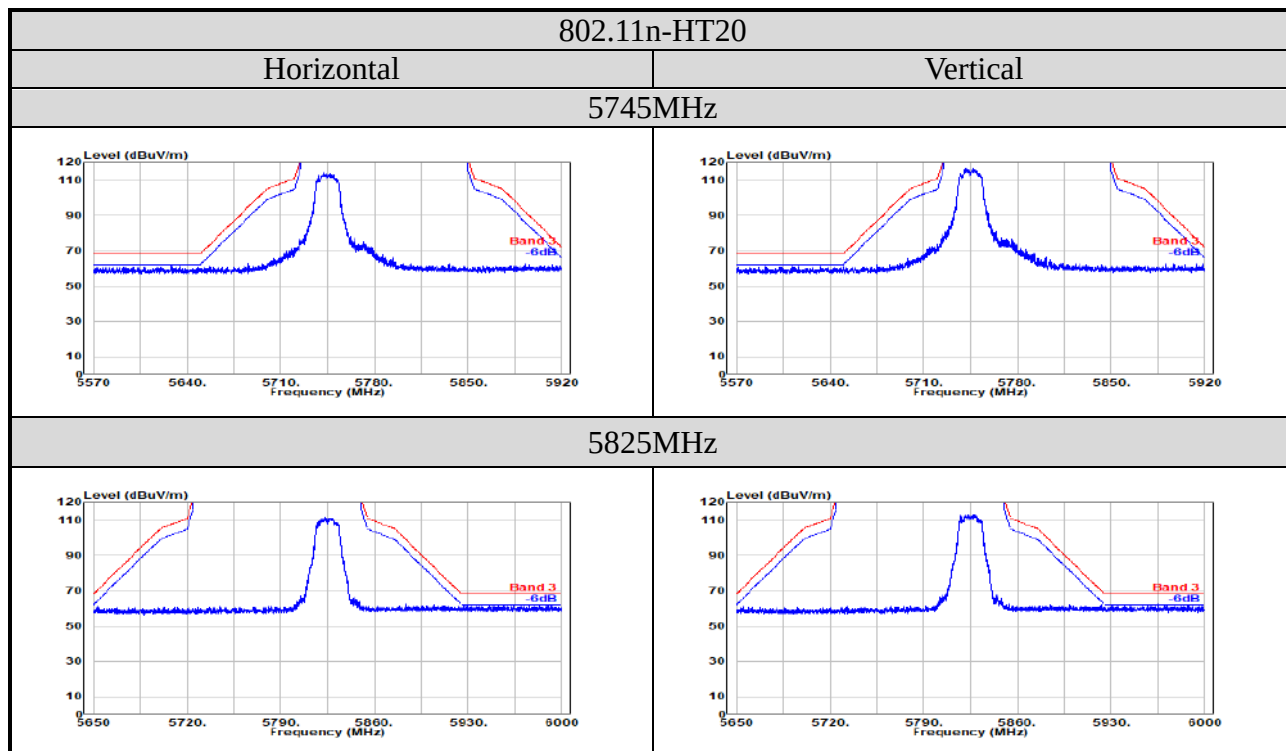




**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

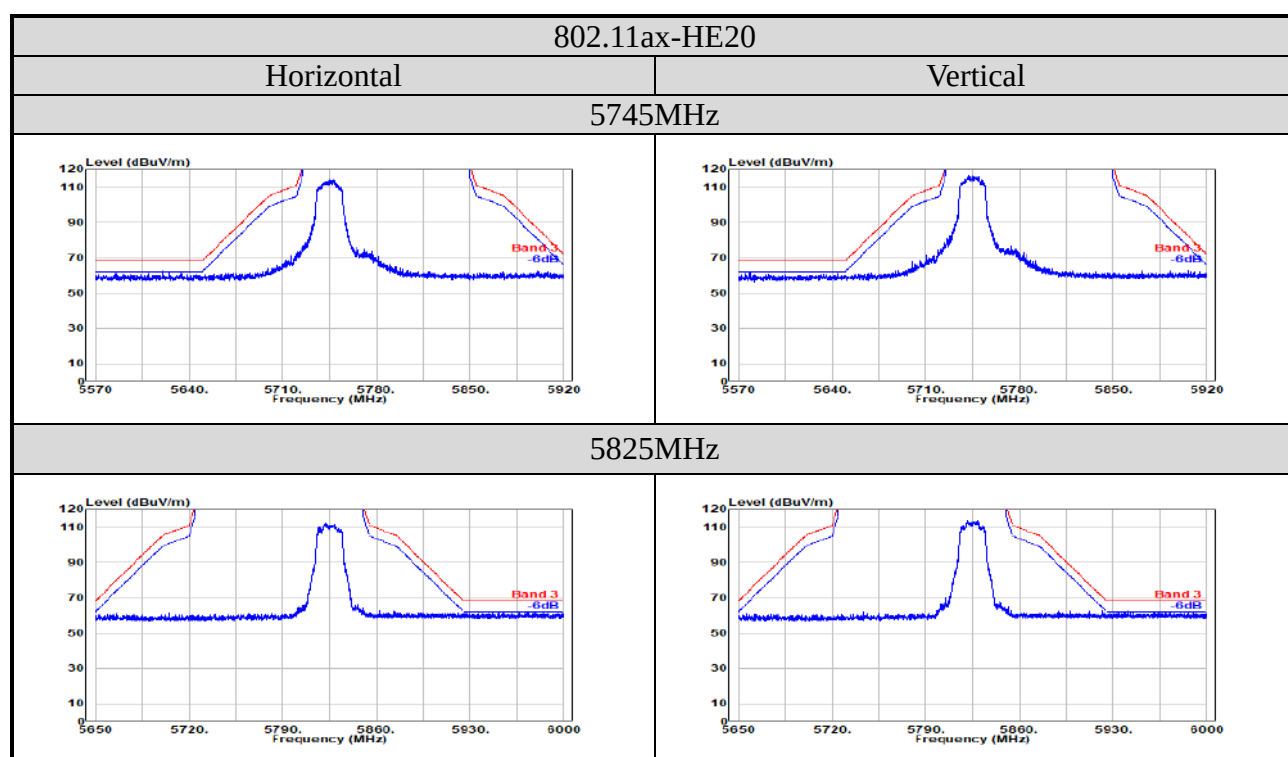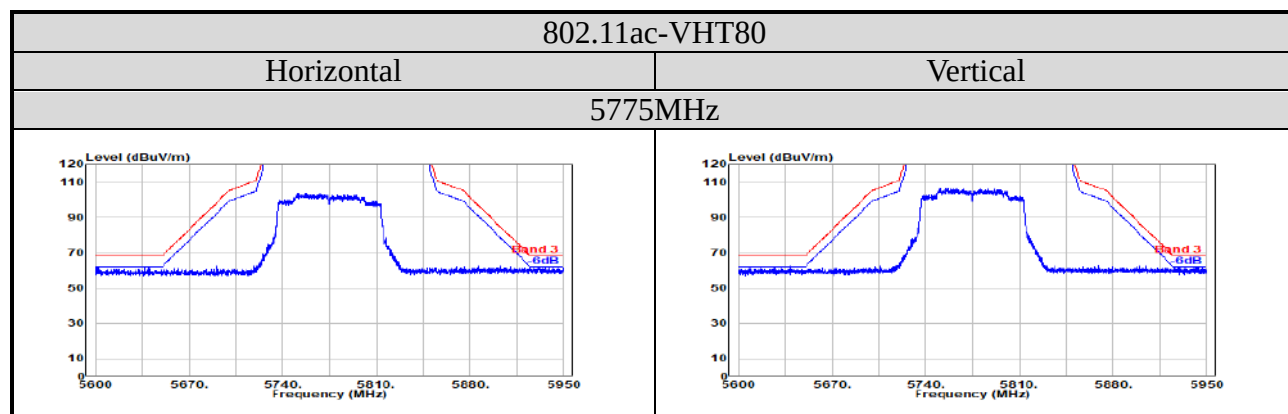

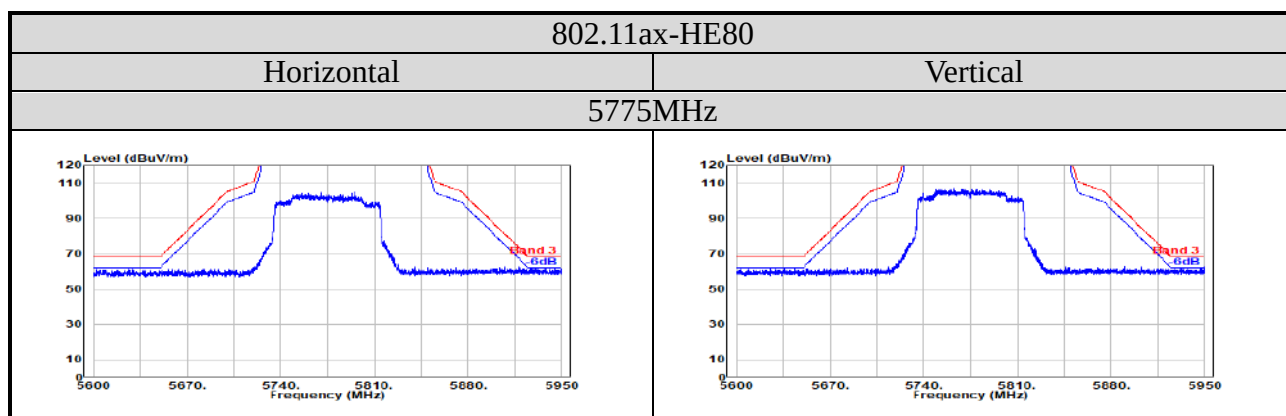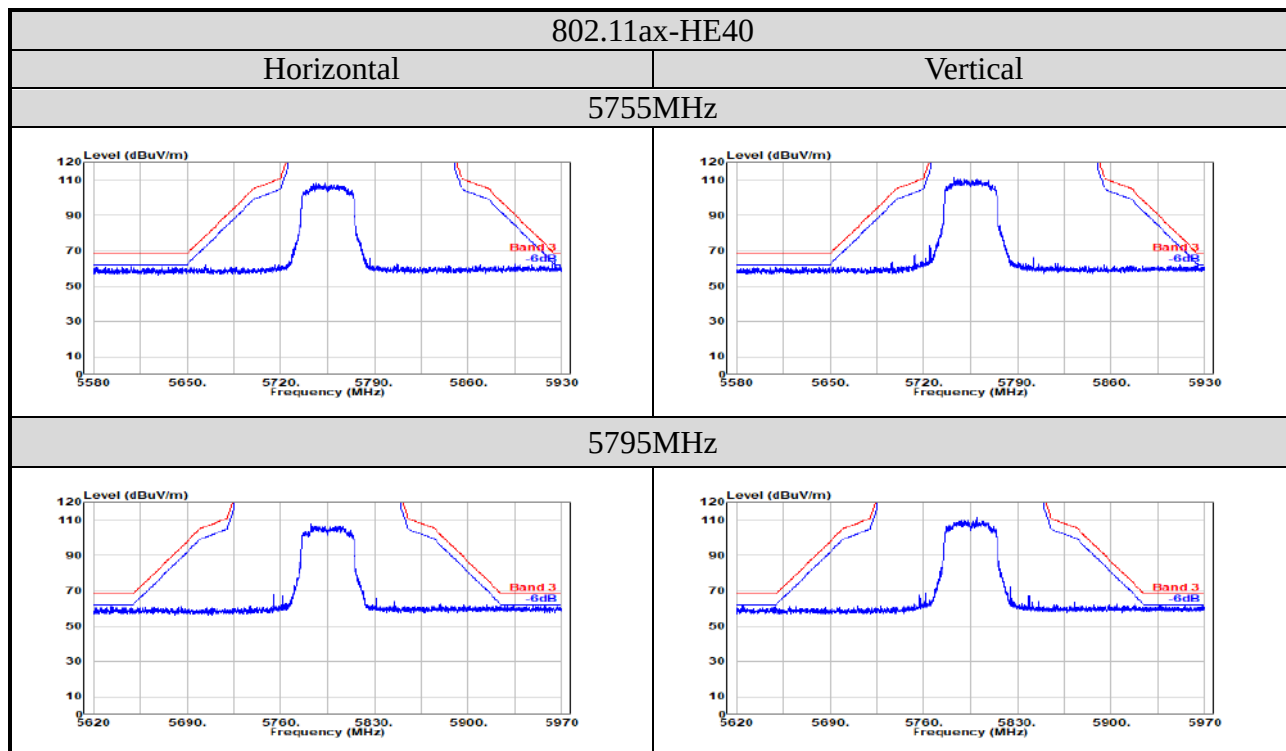


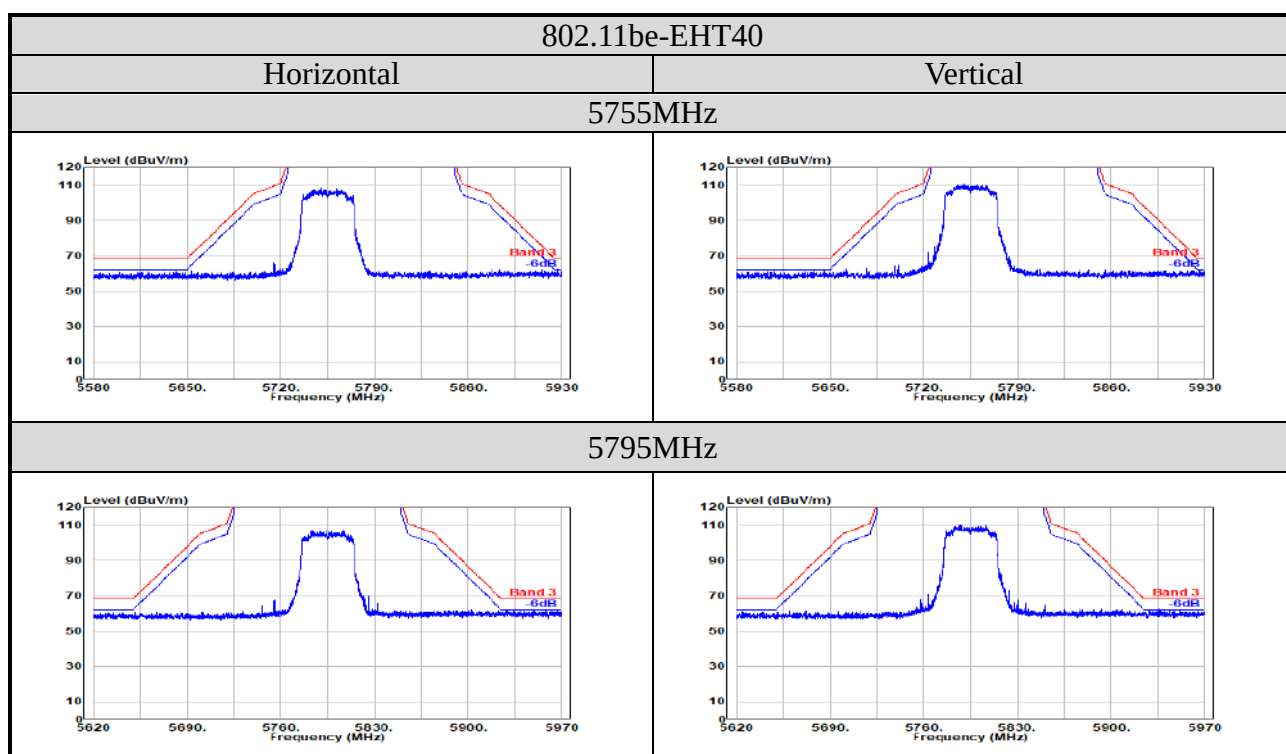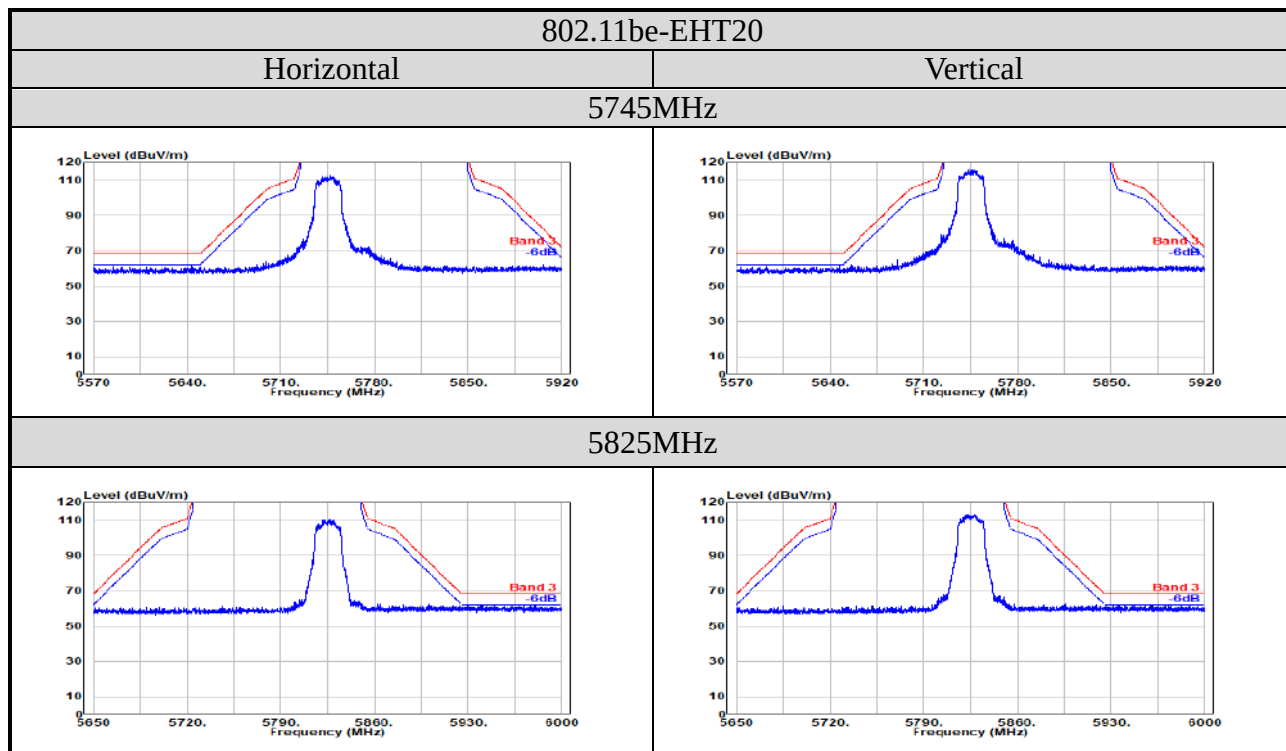


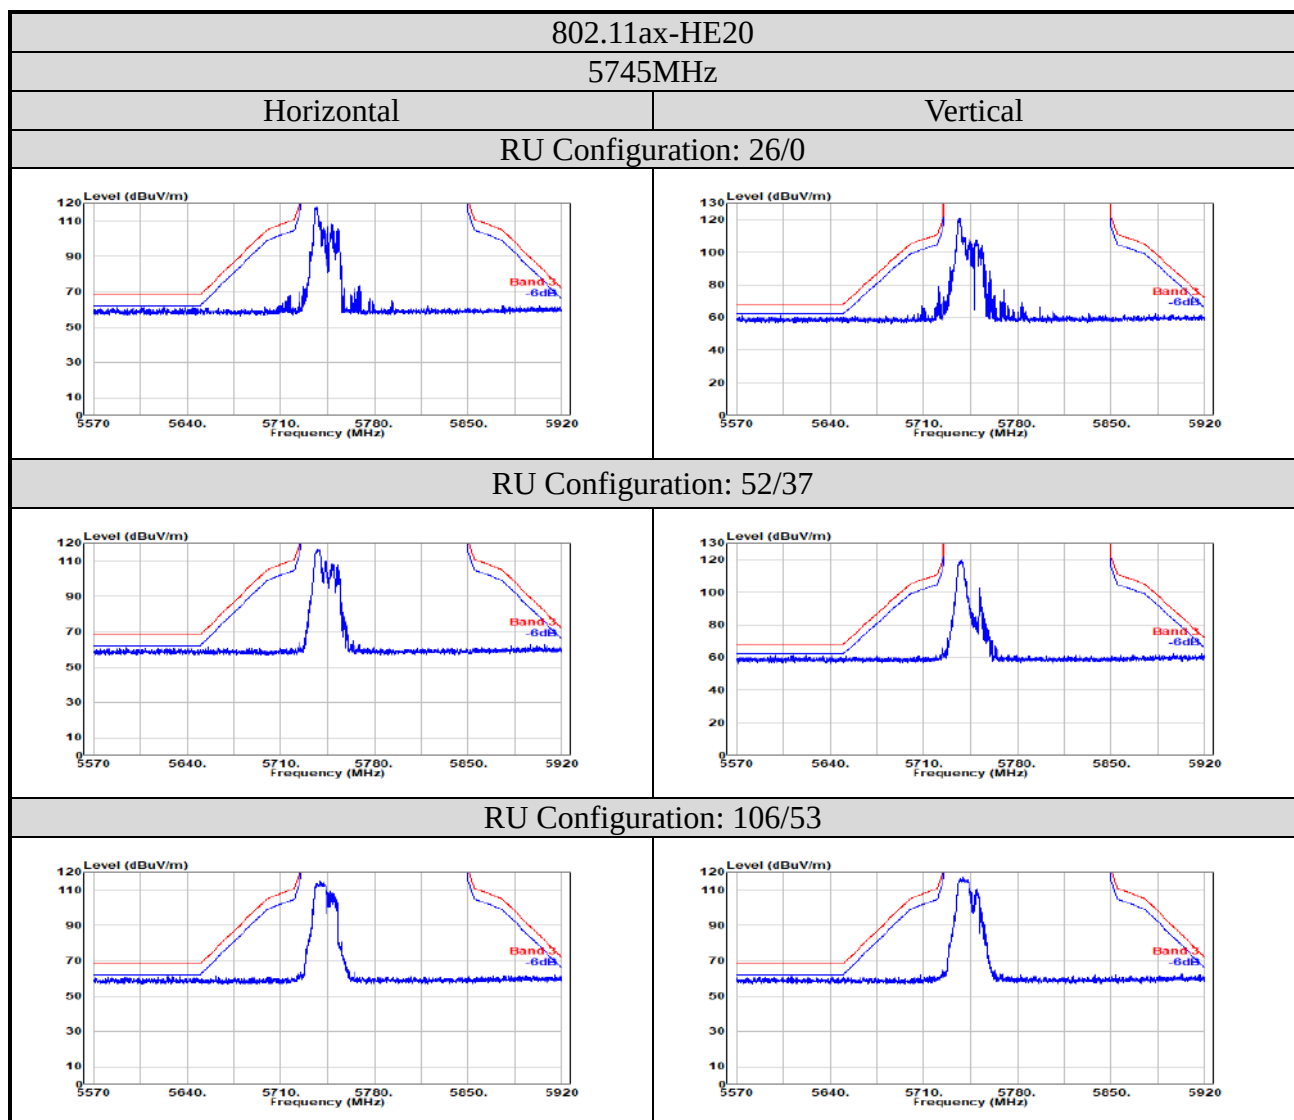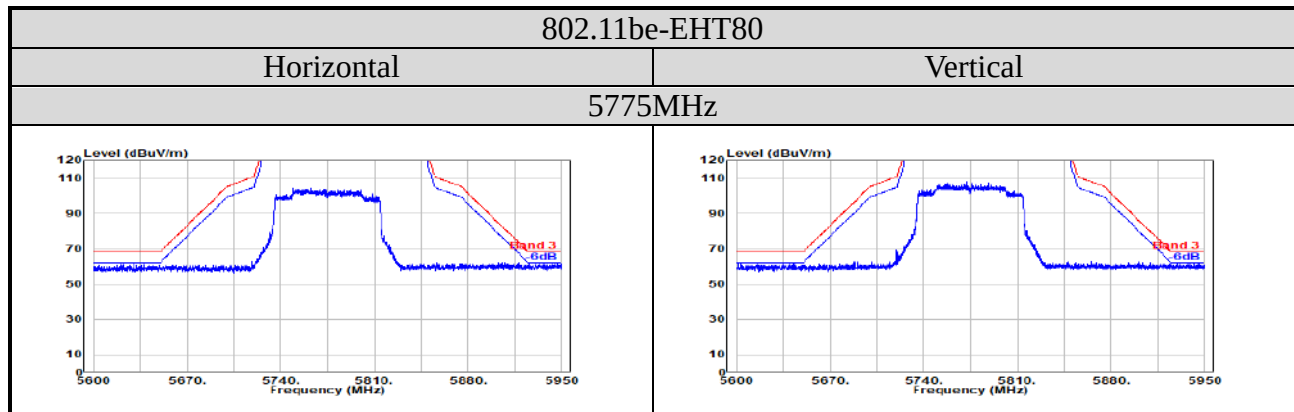

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan


**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

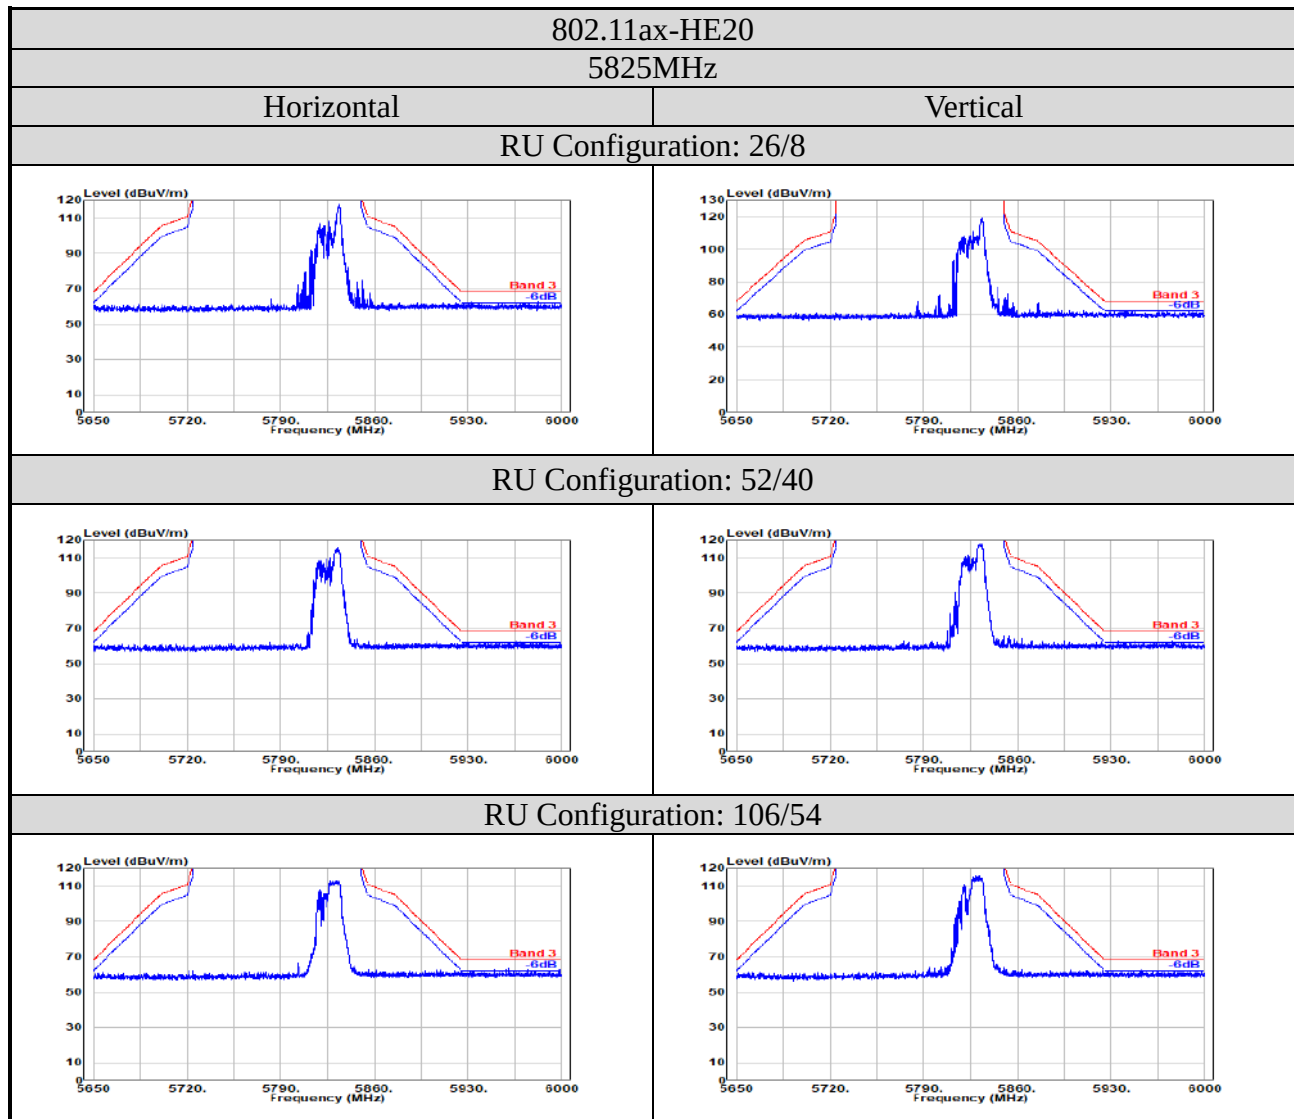

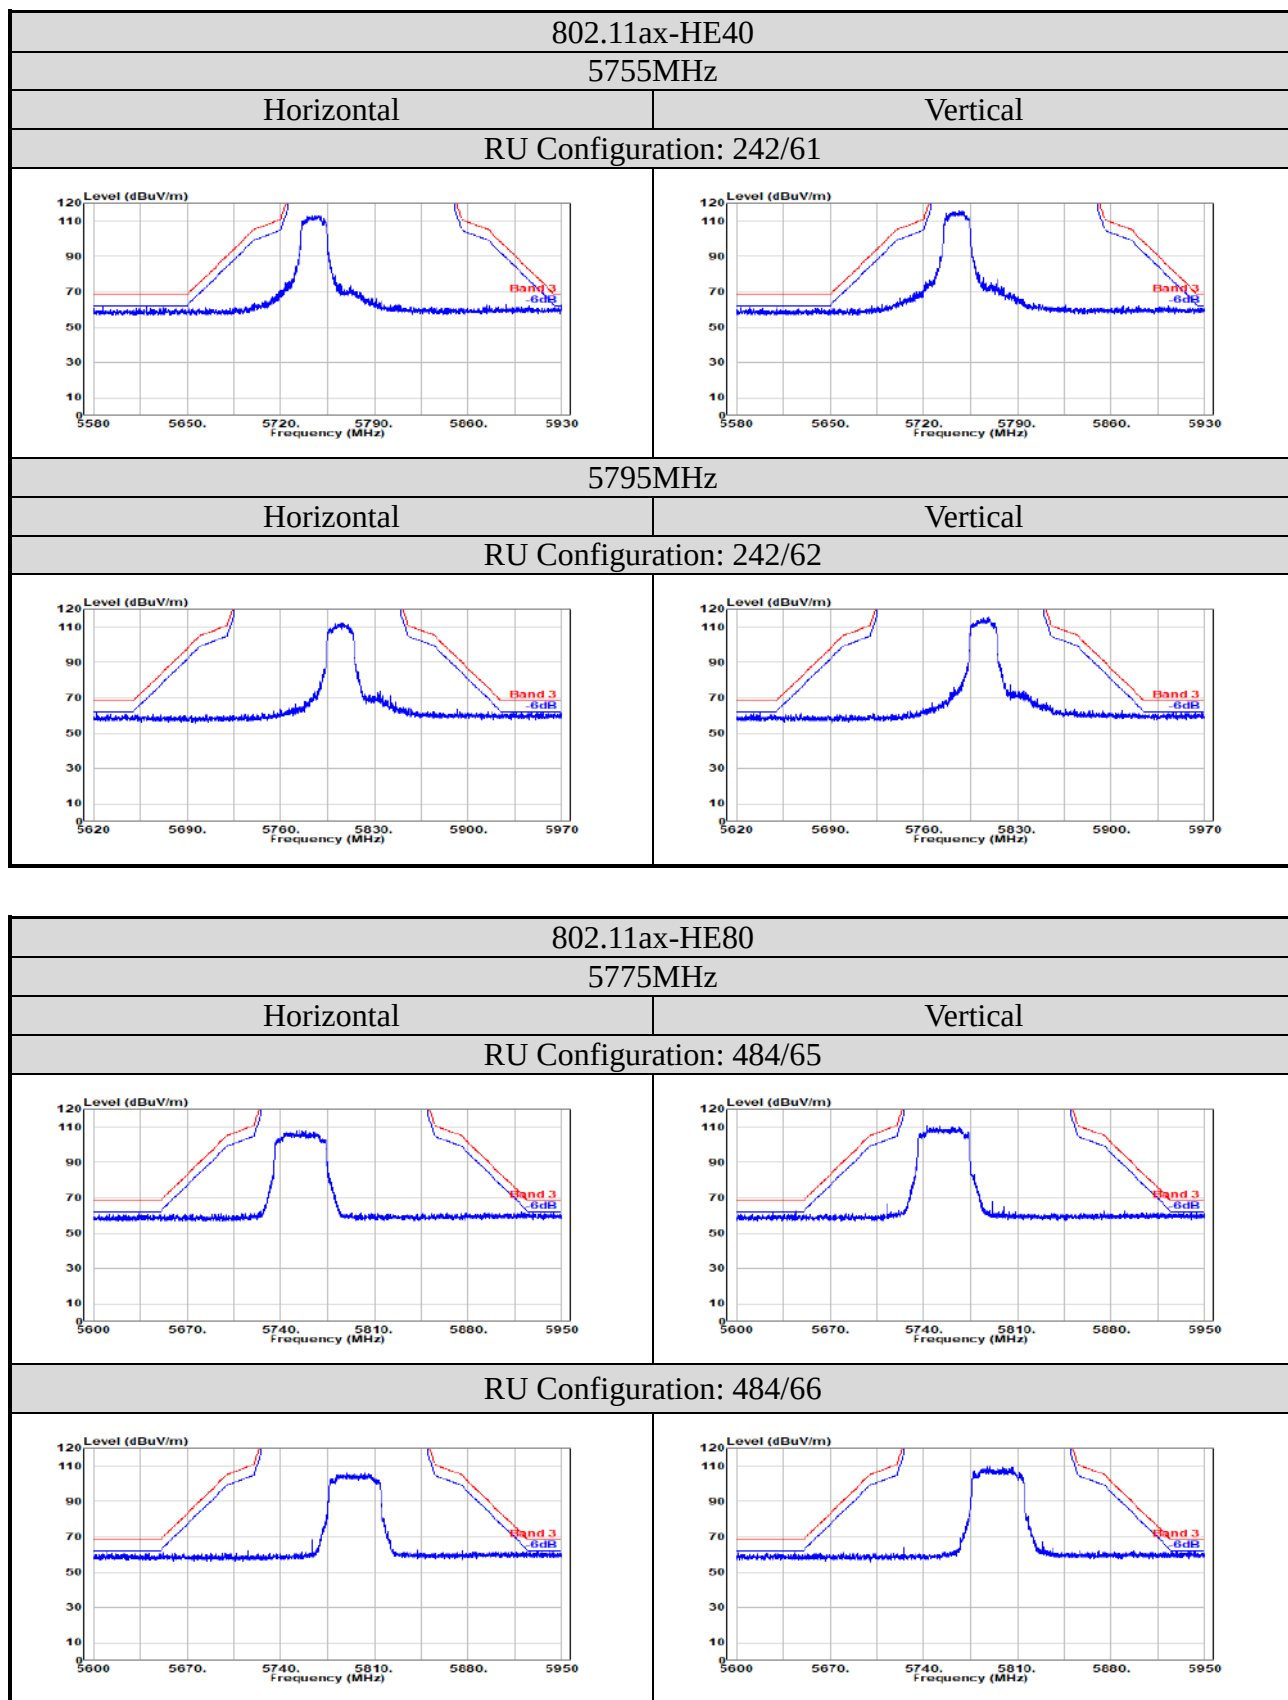


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan


**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

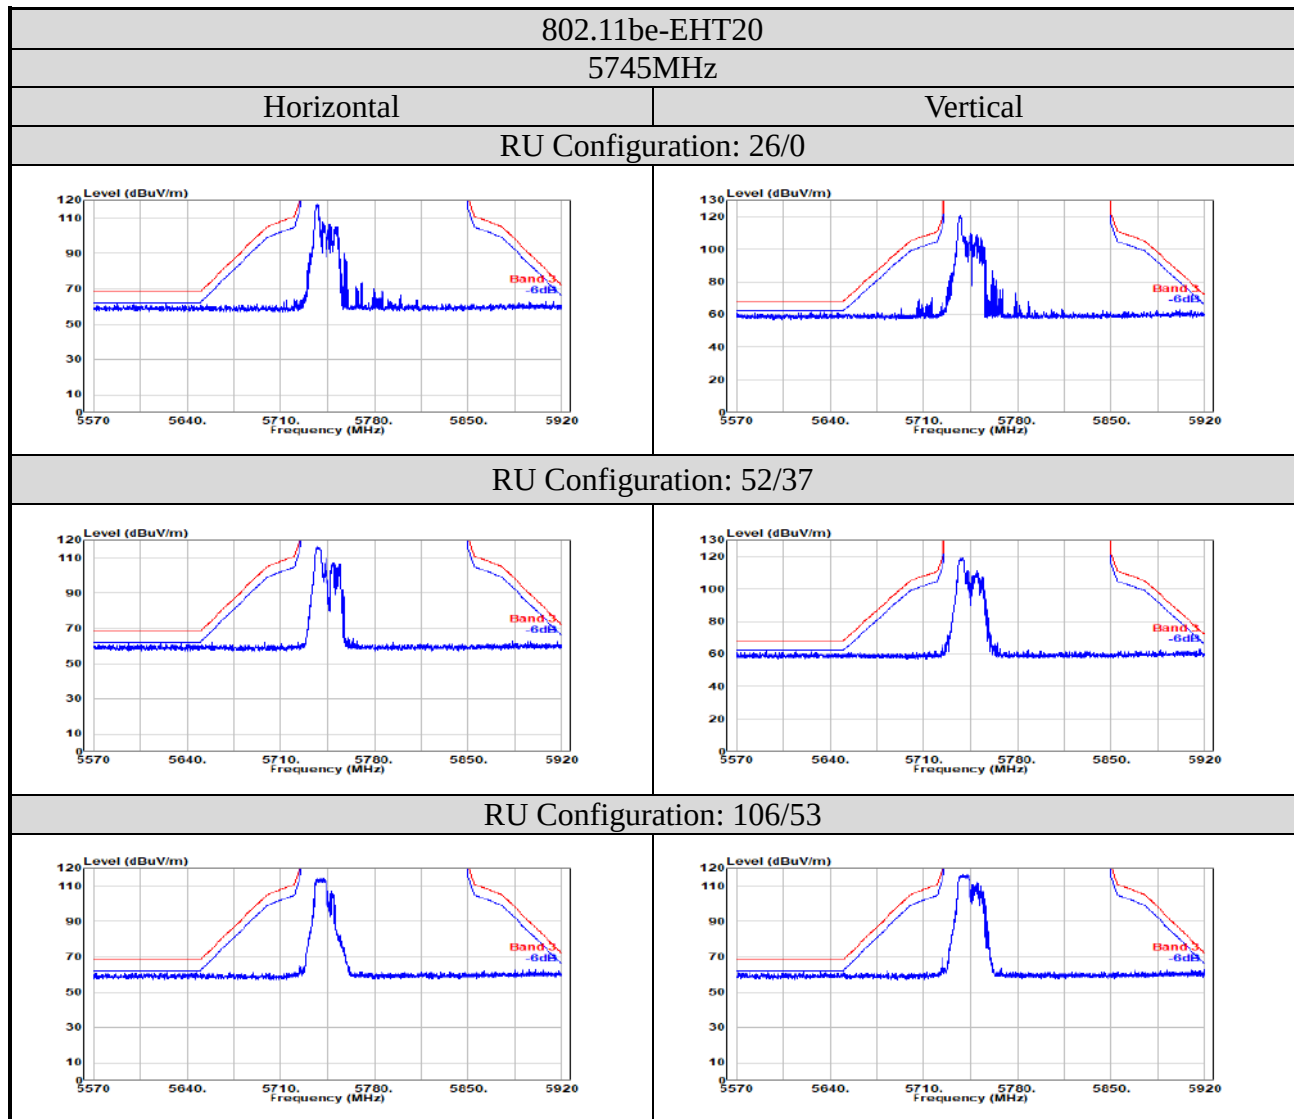

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303


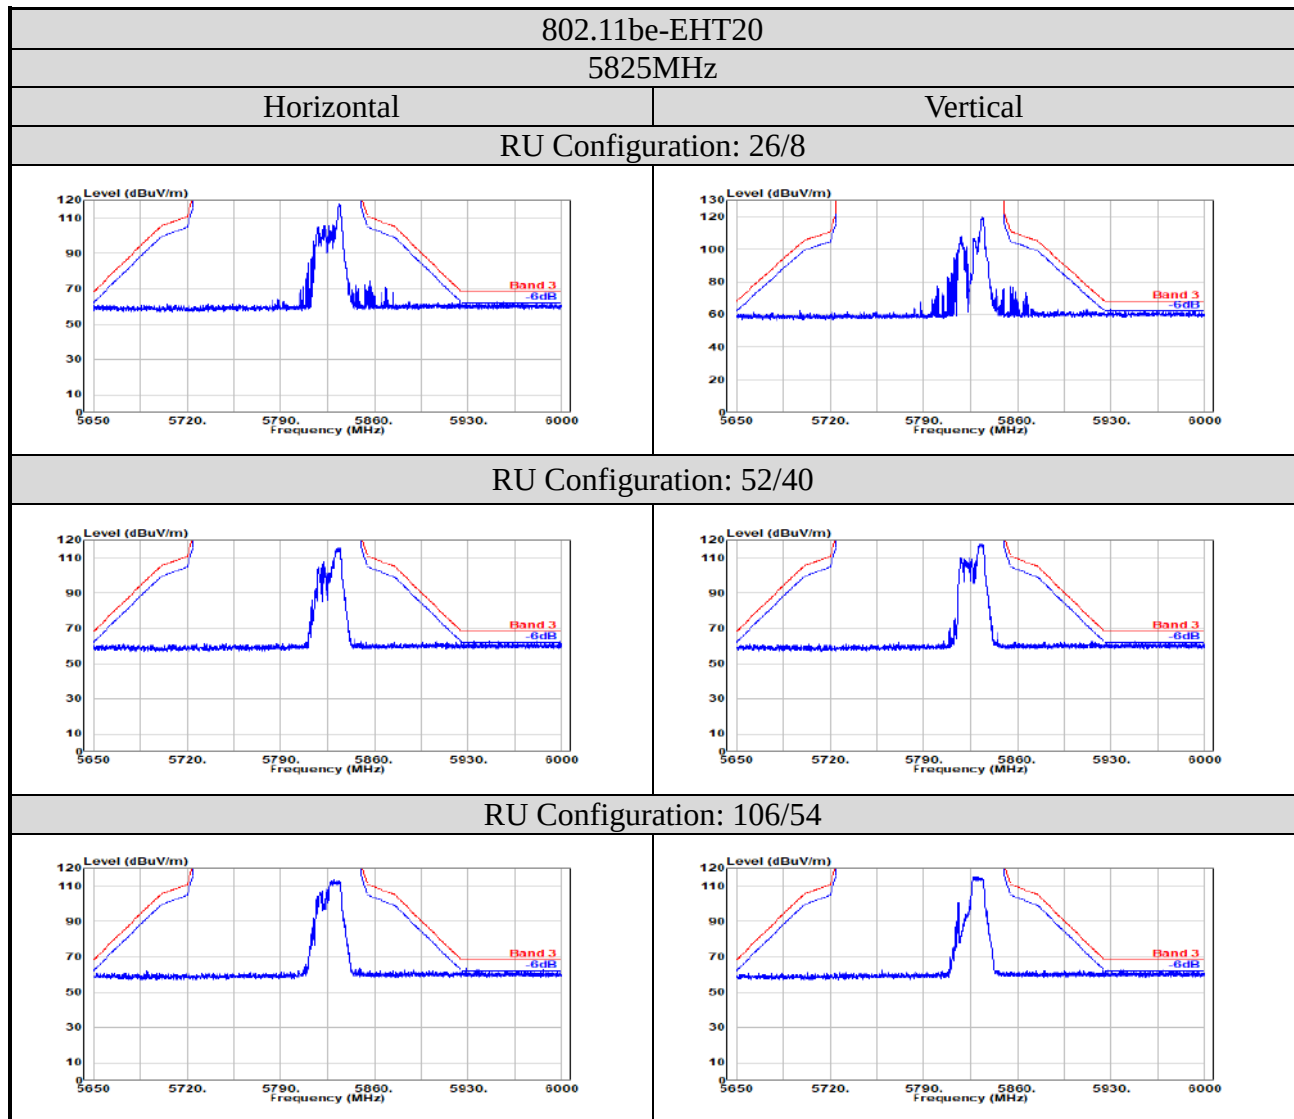


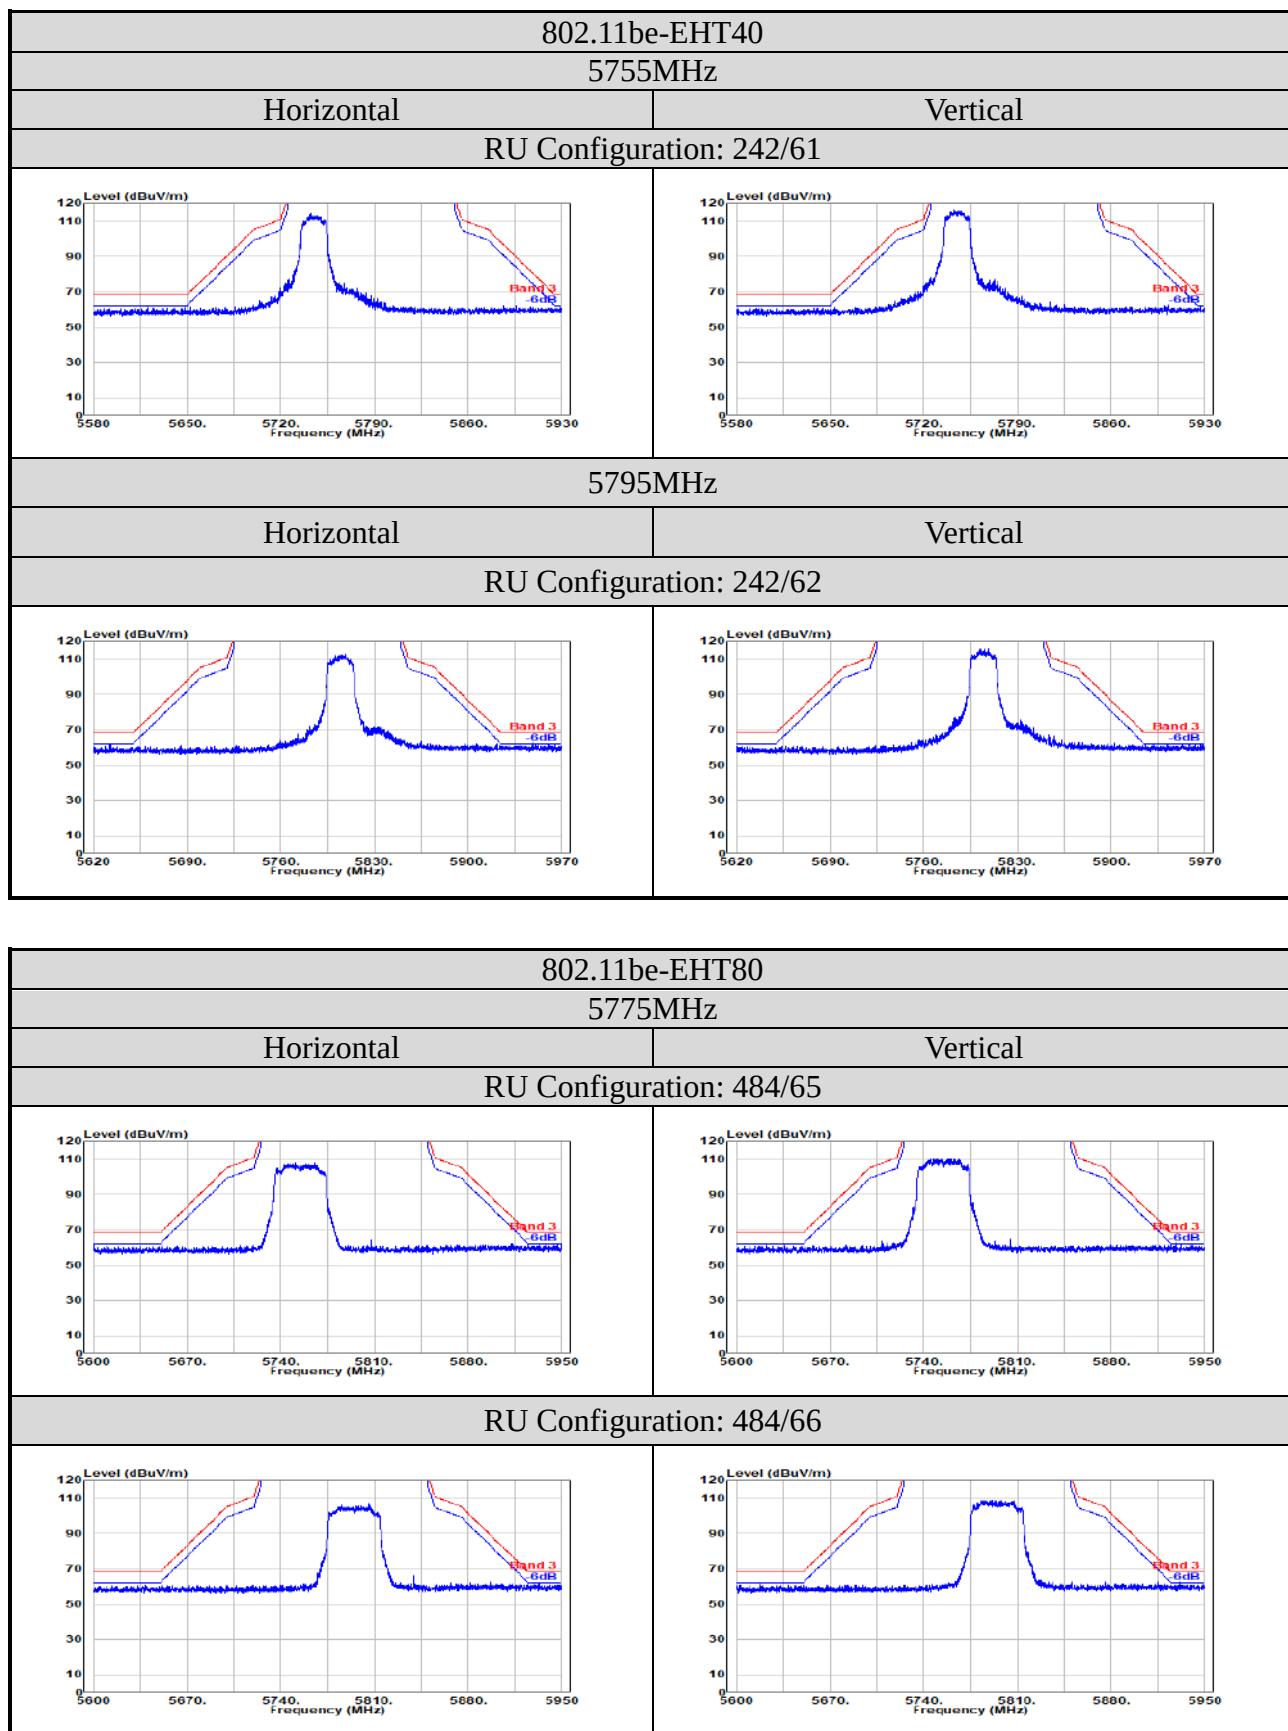

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan



**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

# Antenna: LUXSHARE-ICT

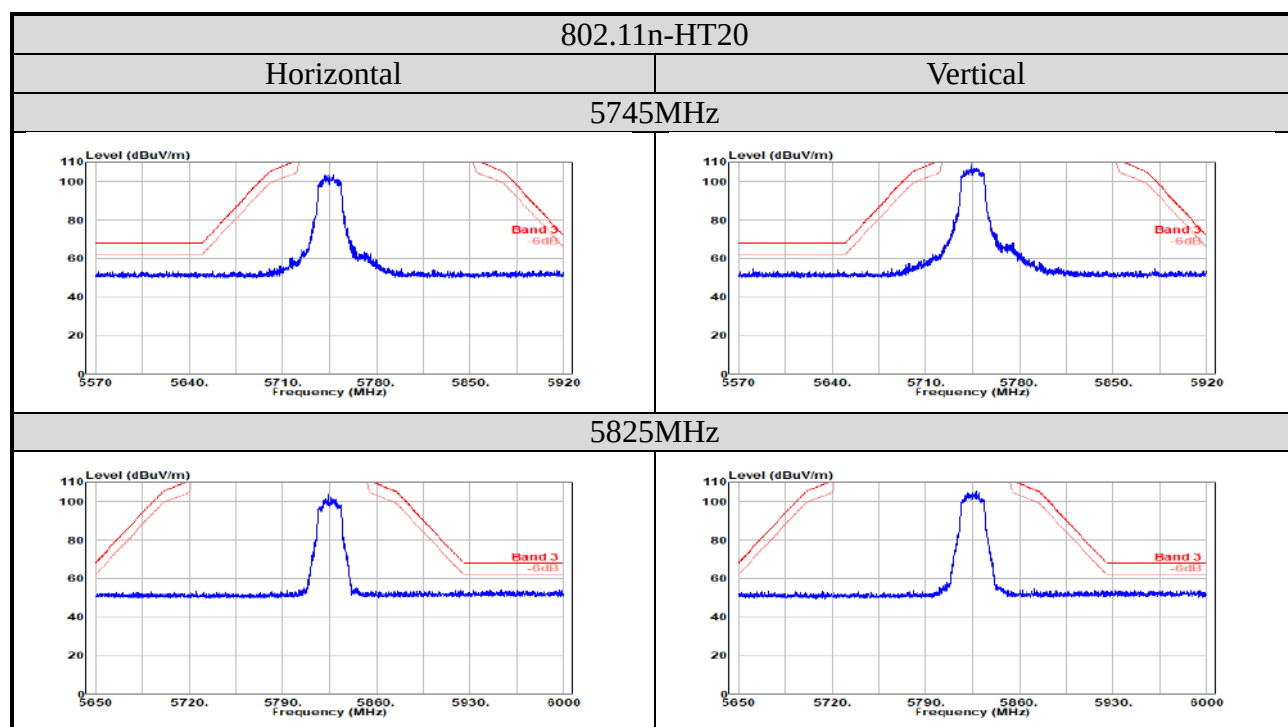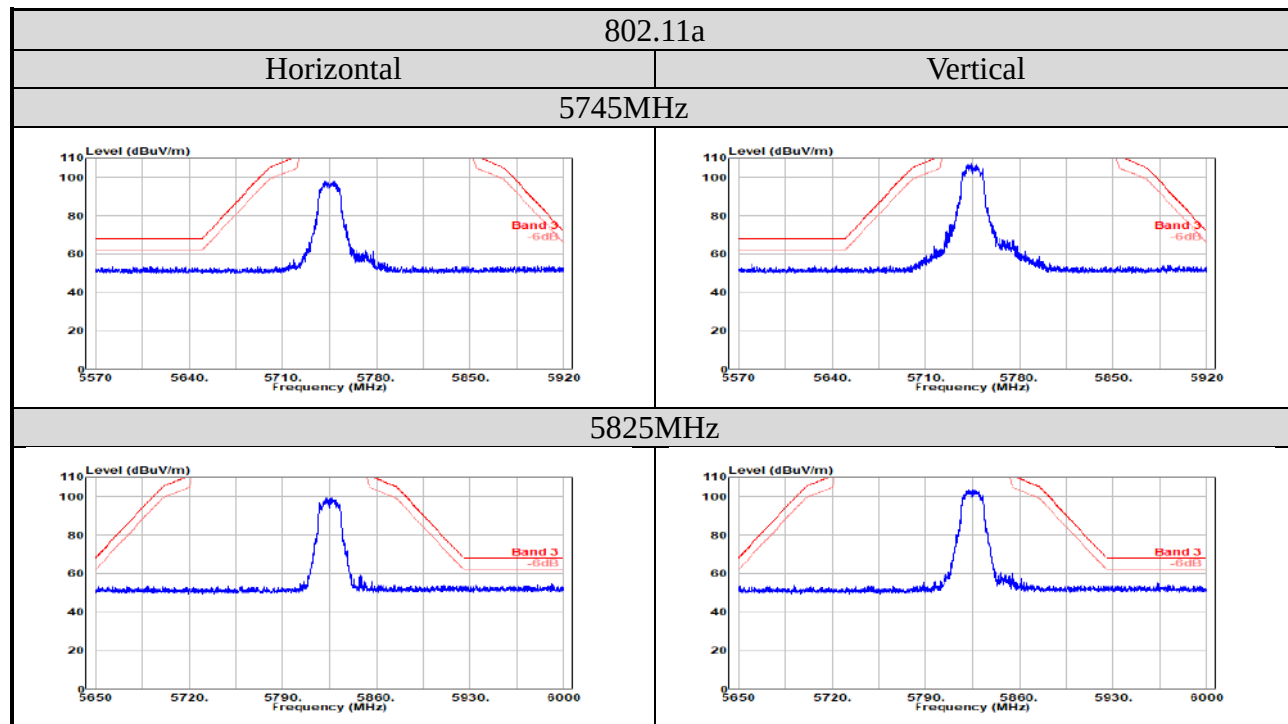



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

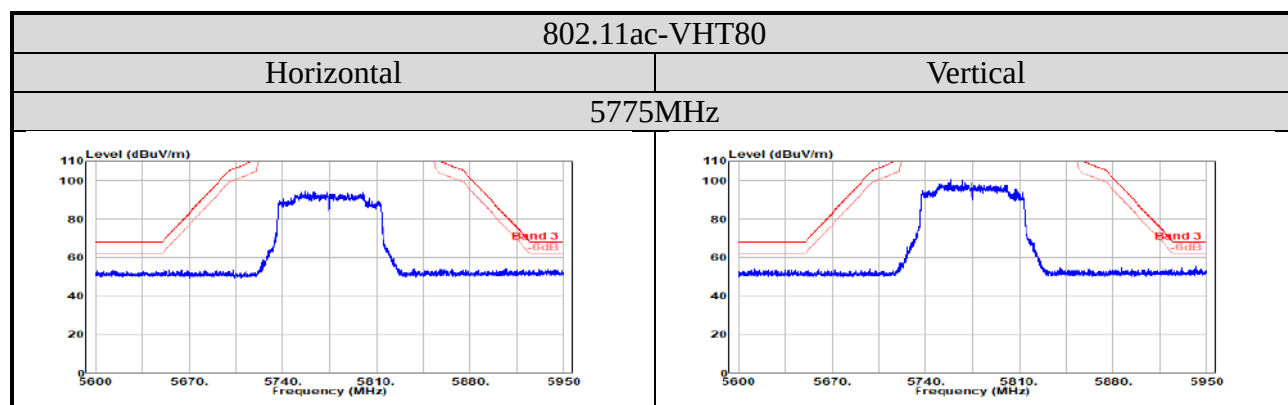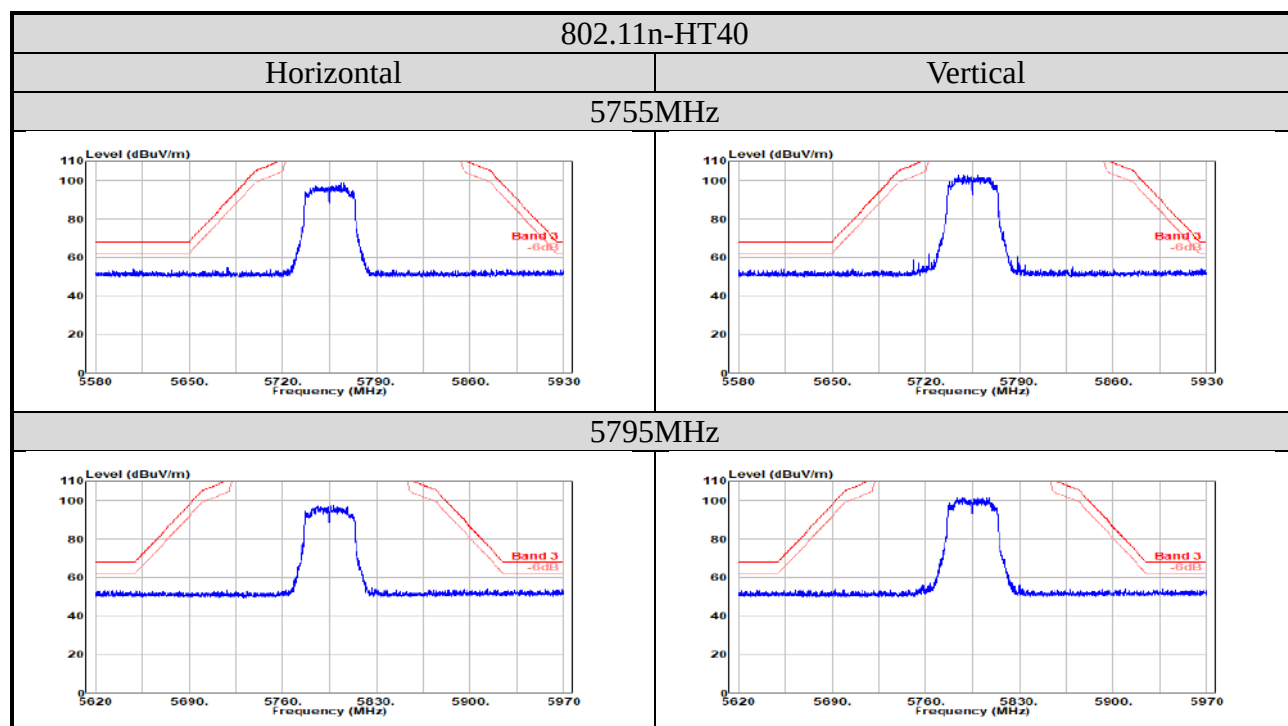



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

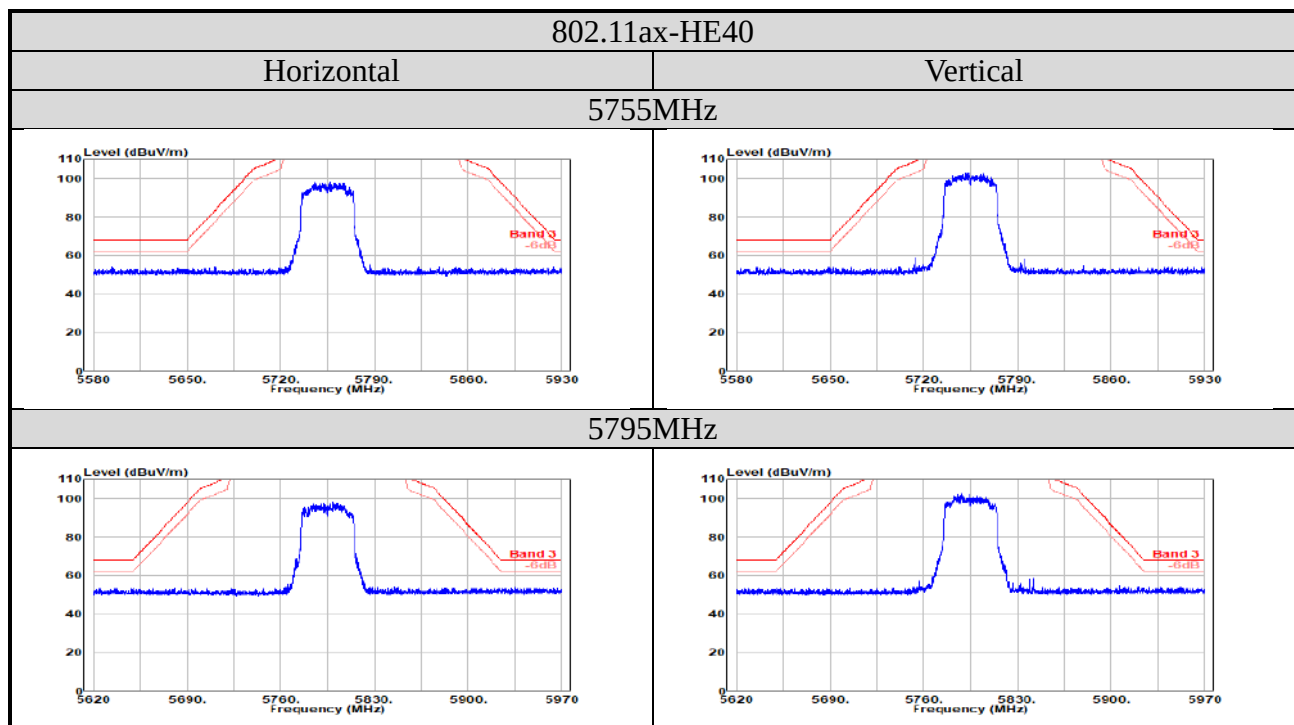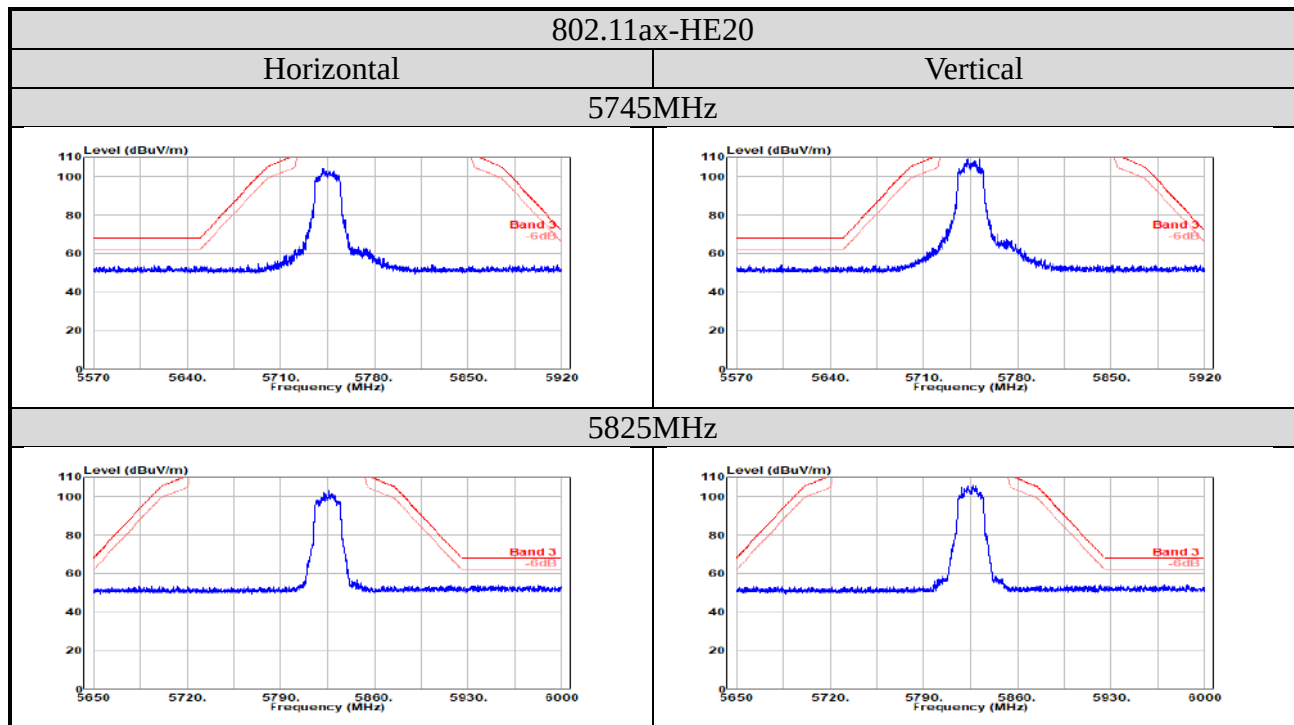



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

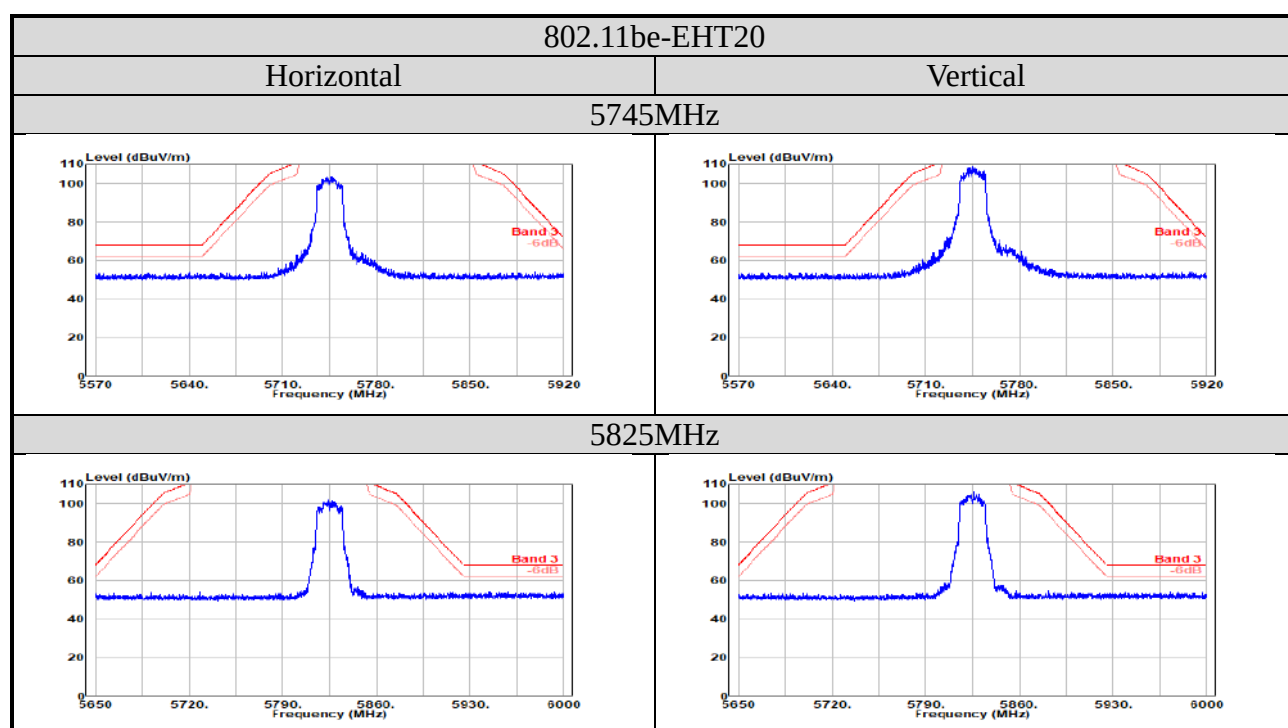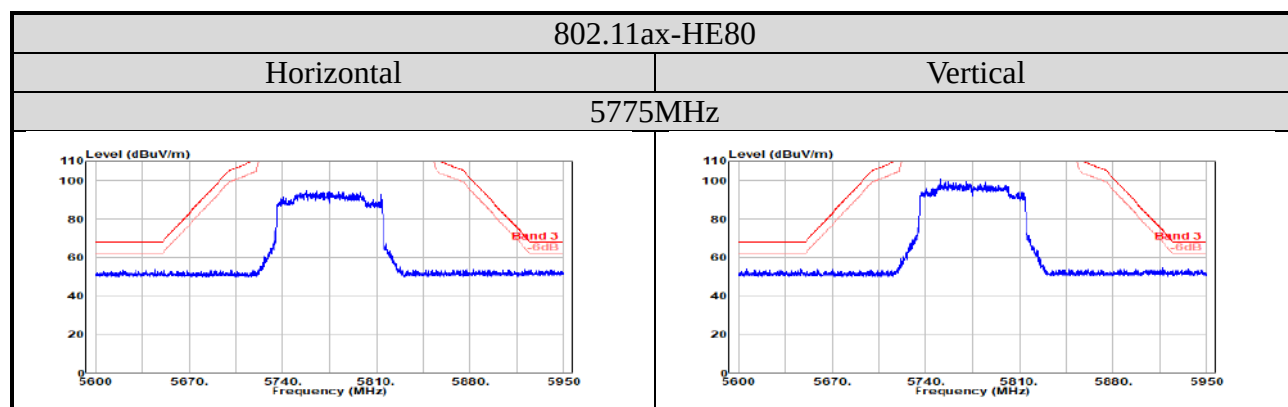


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303

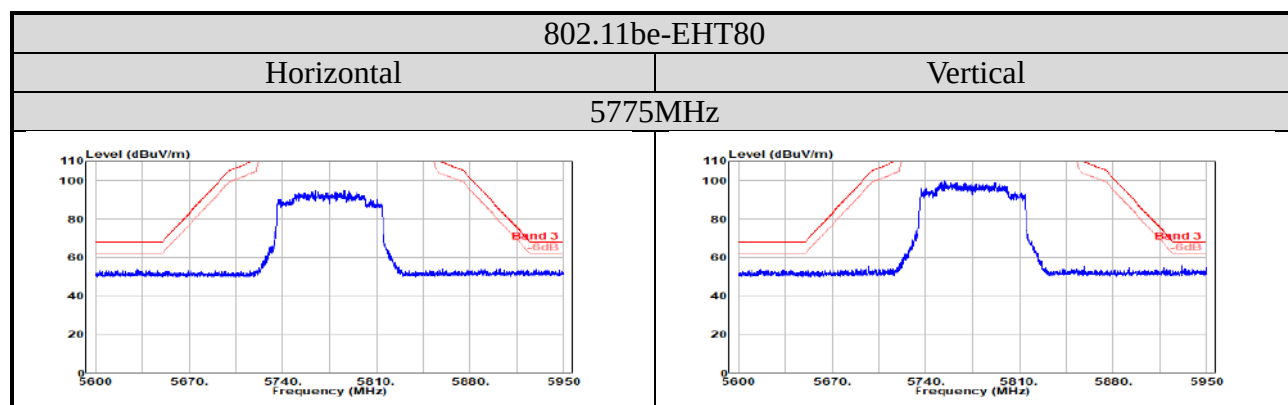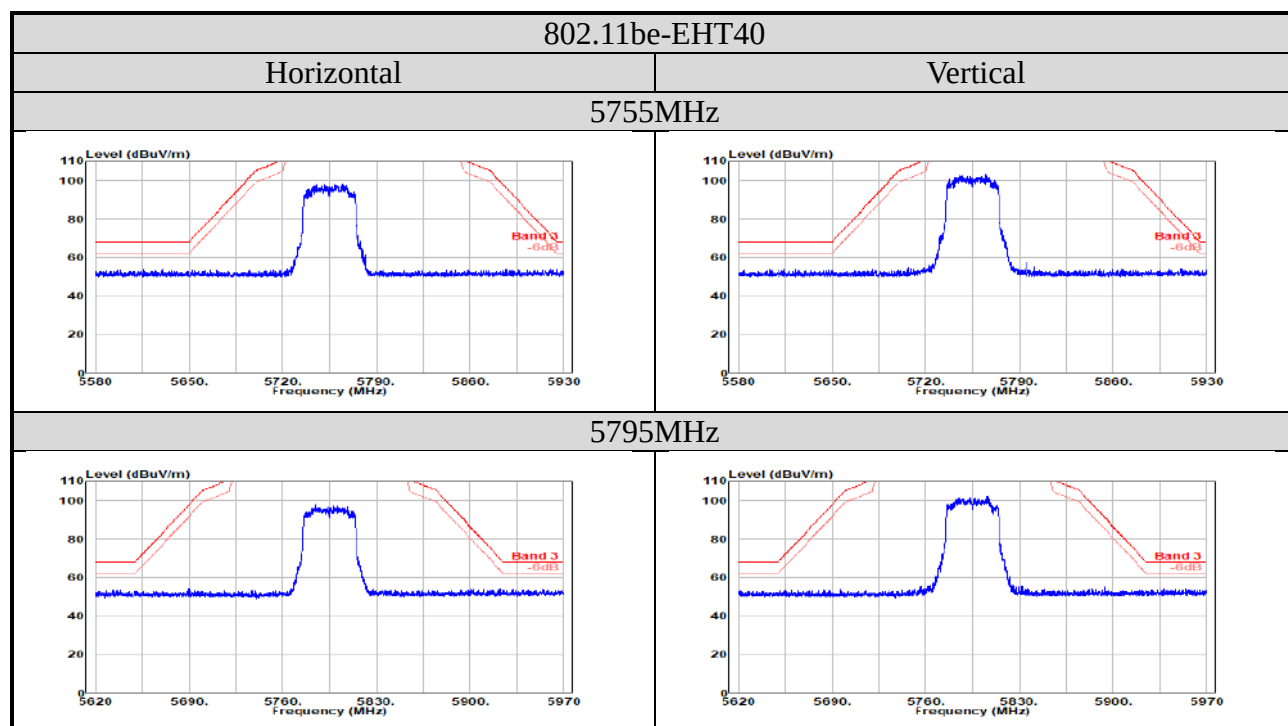


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

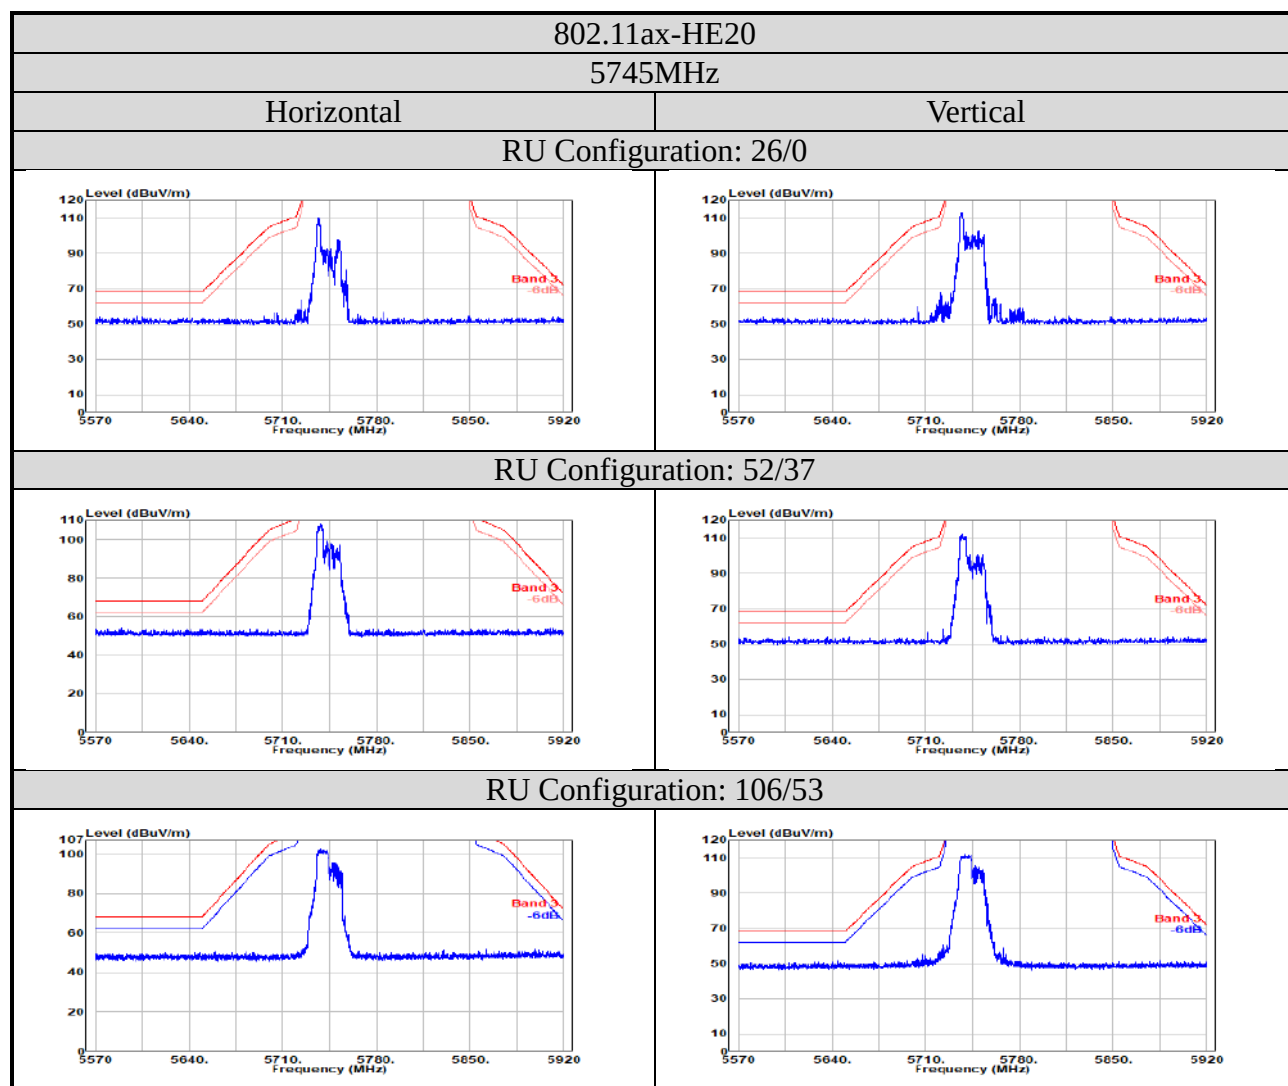



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

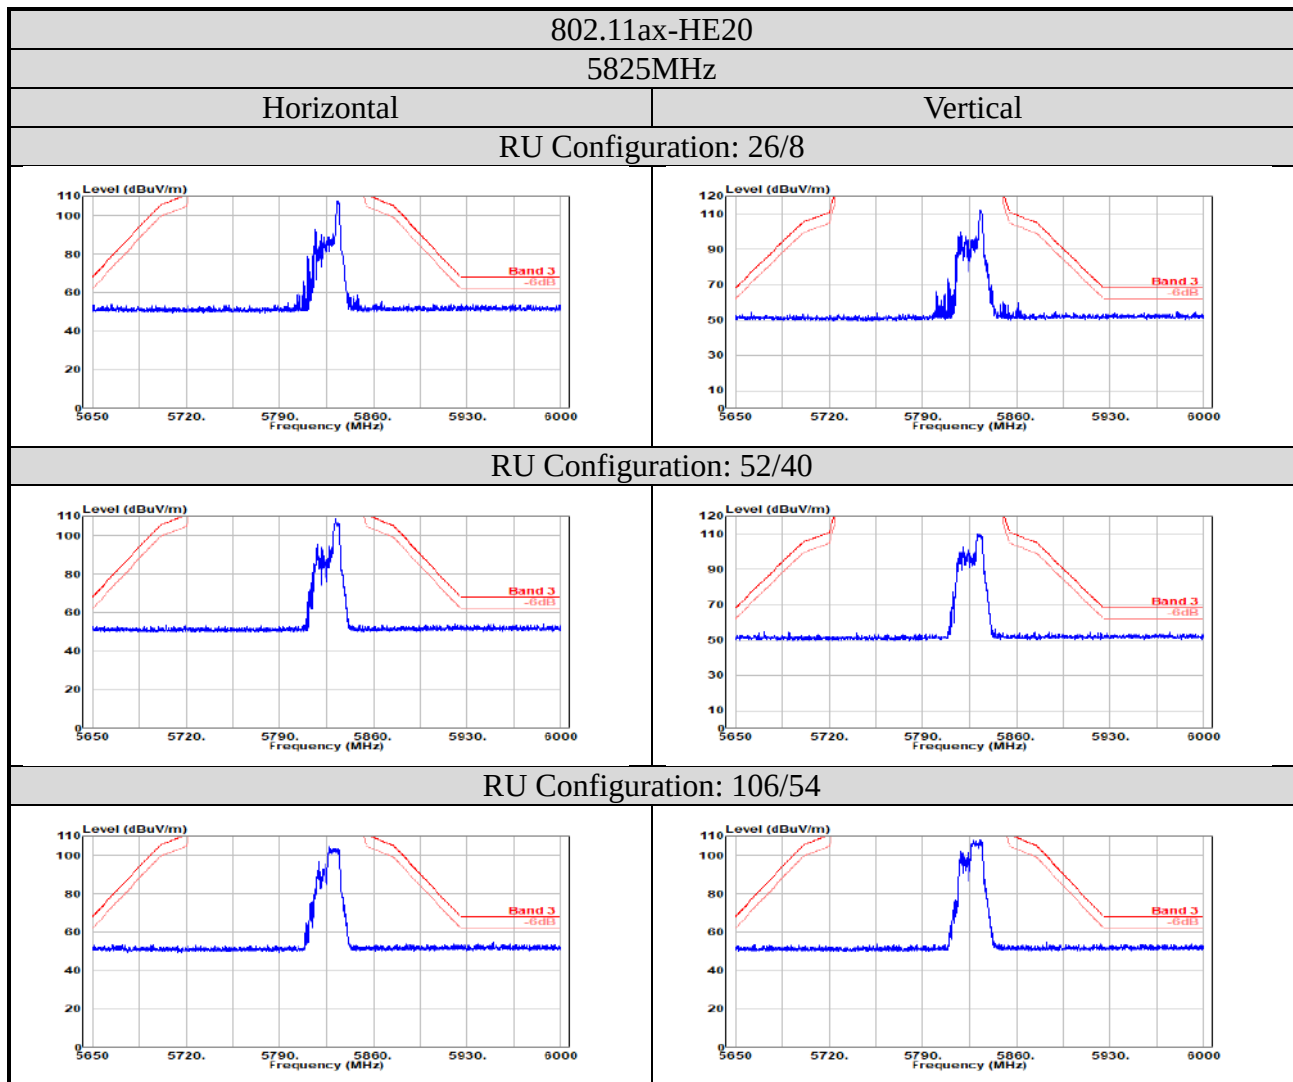


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

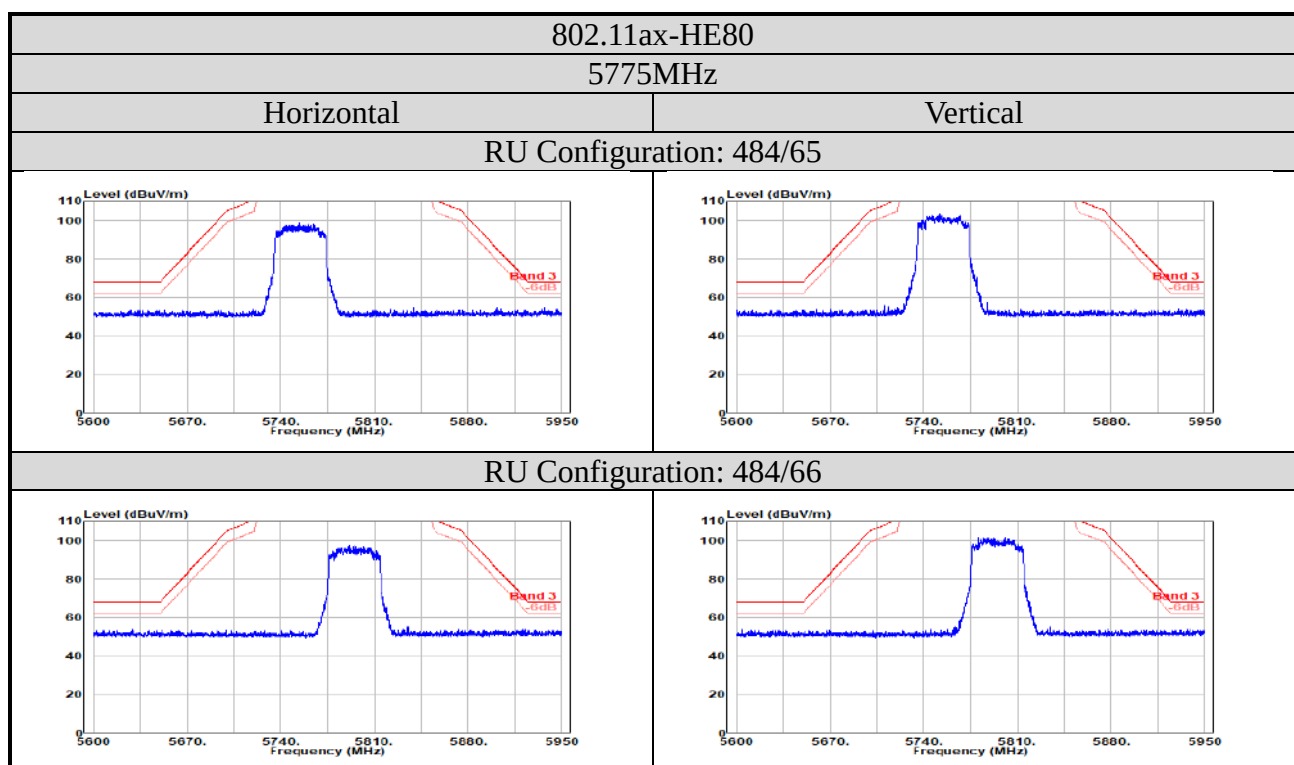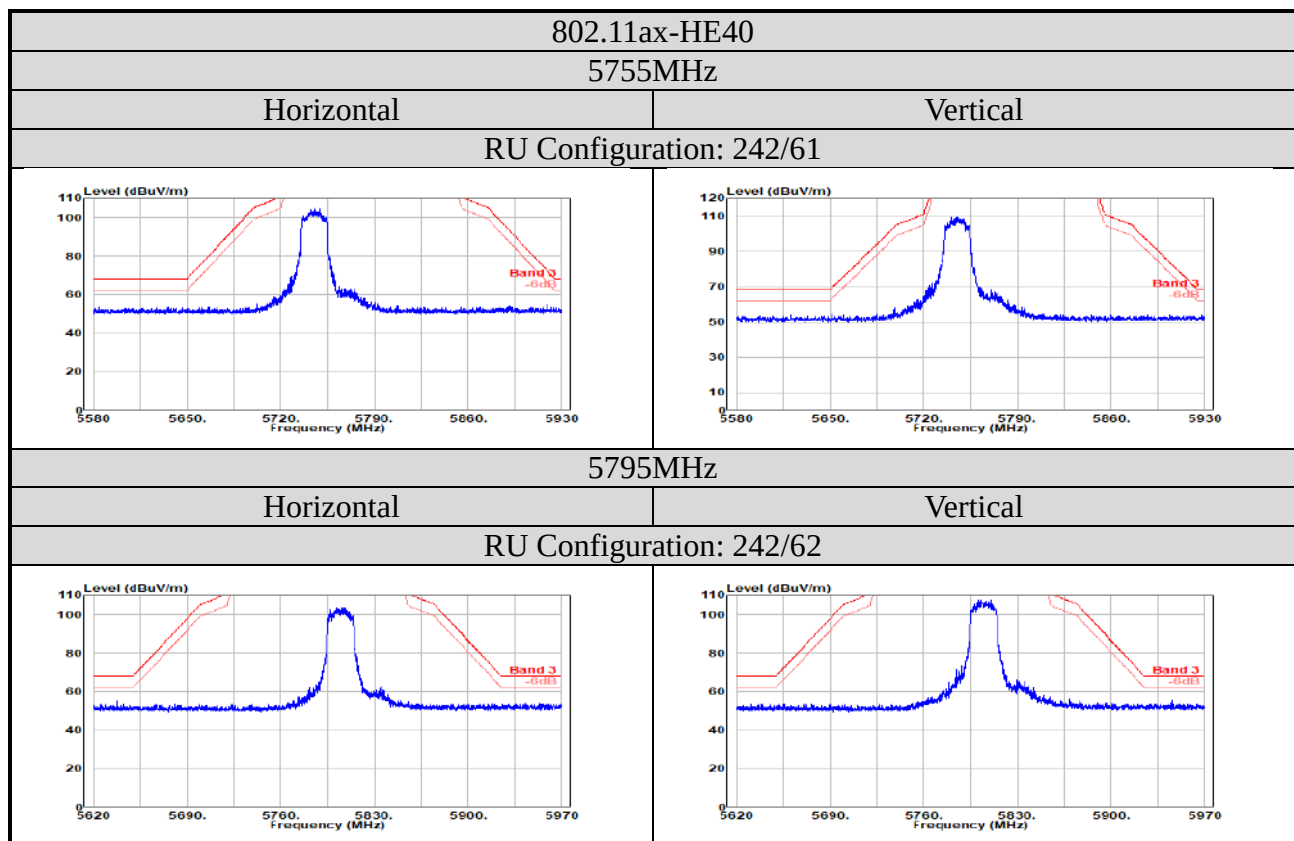

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

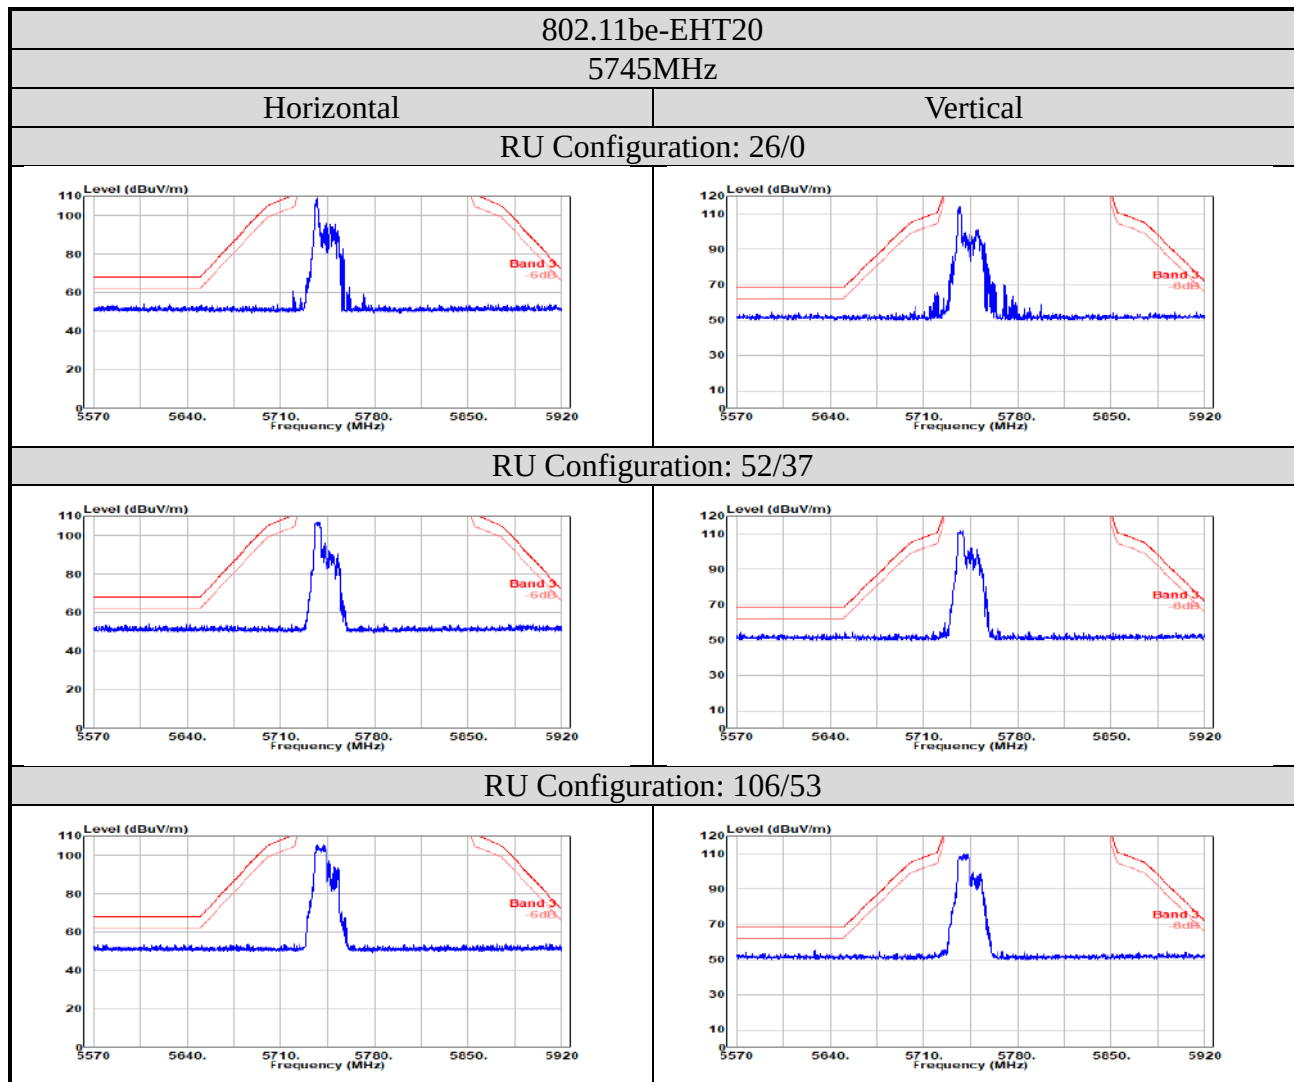

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

