




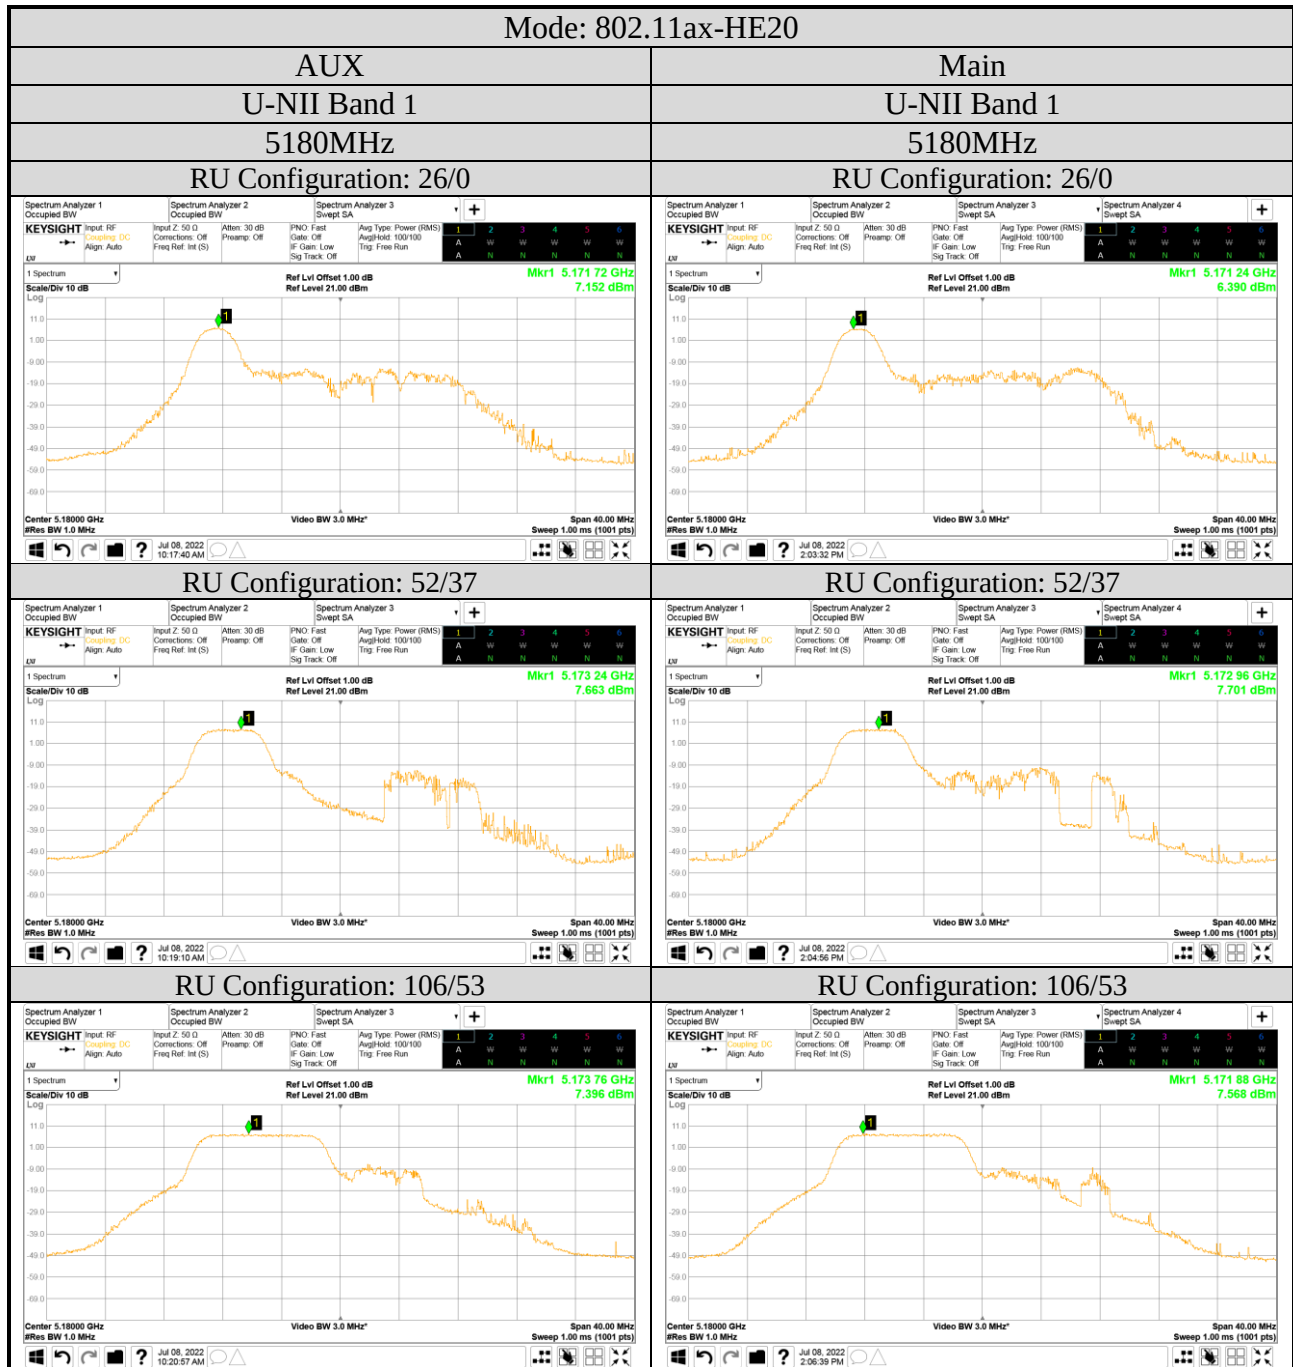

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

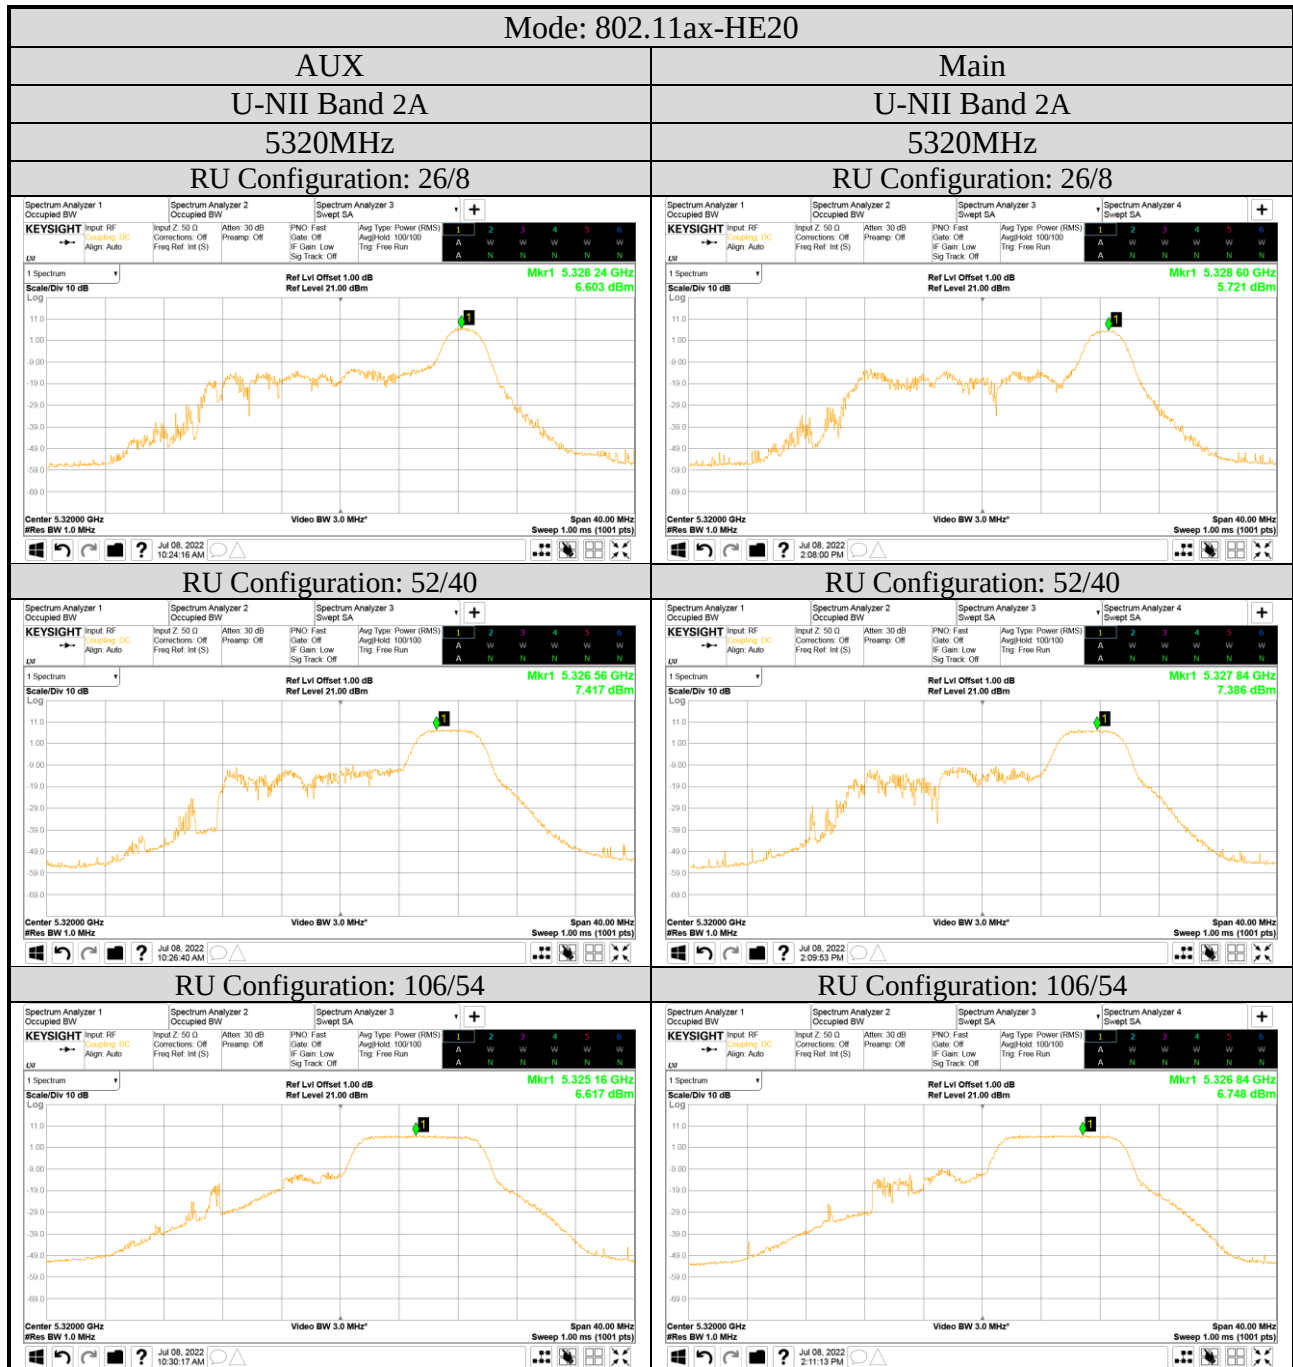


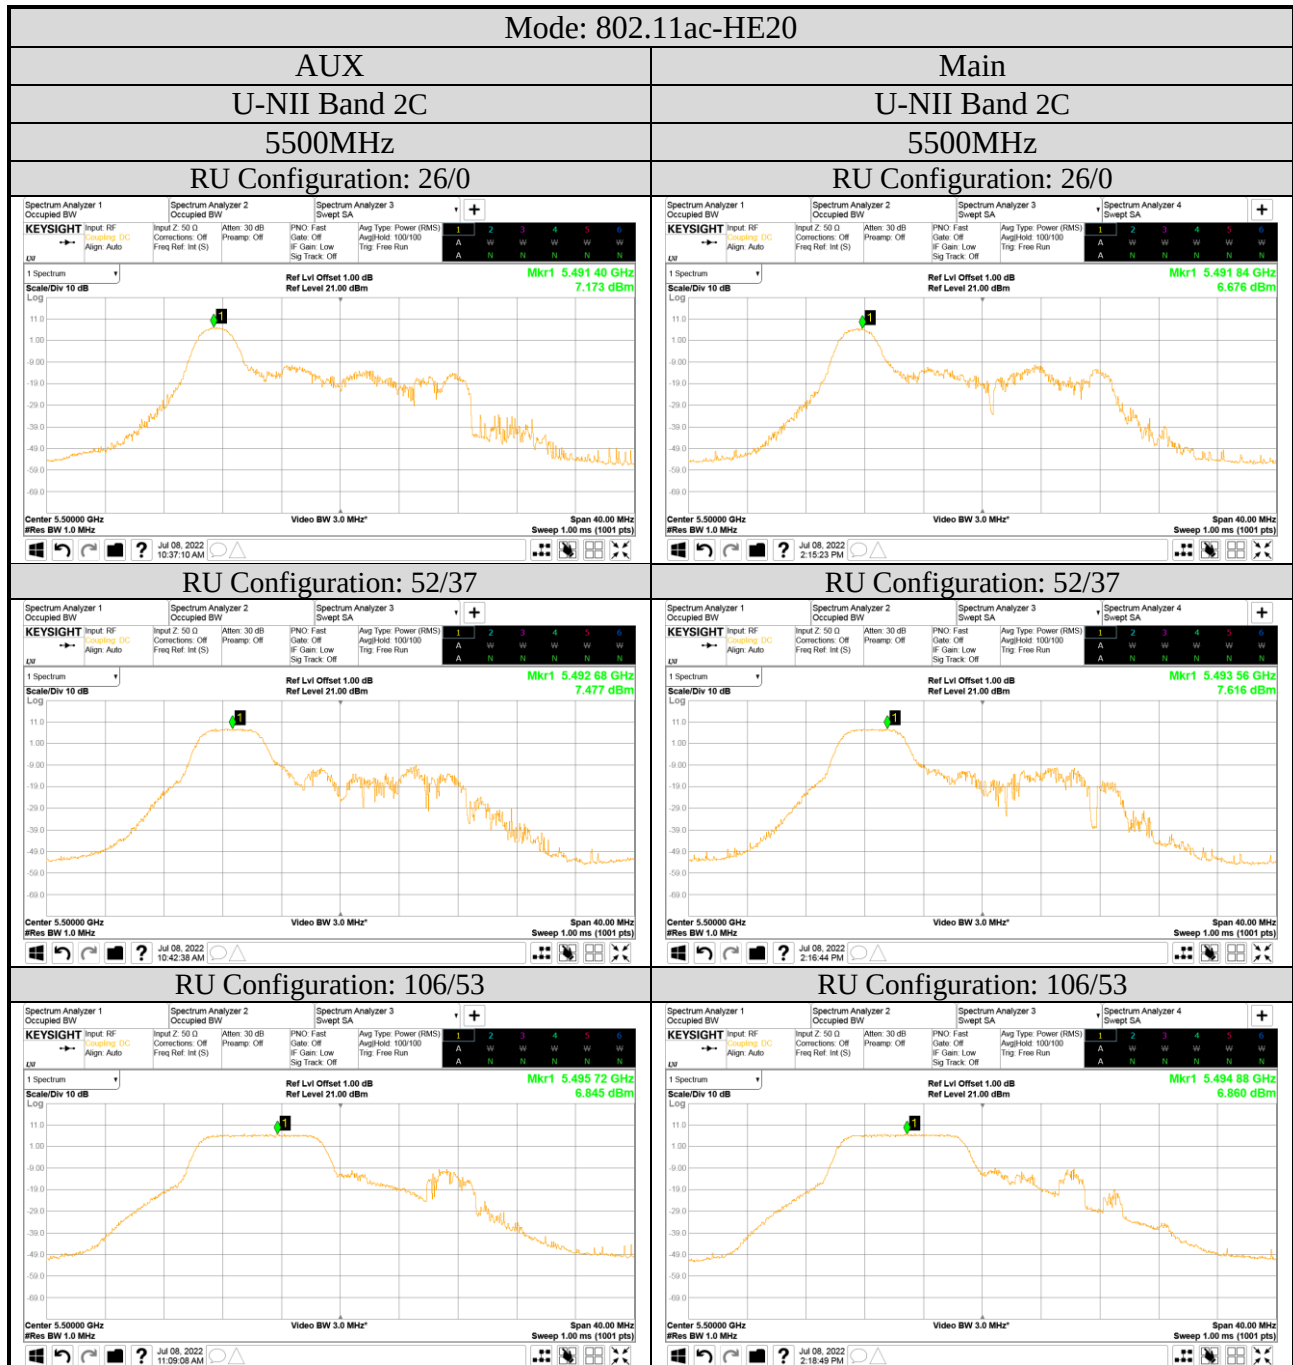

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

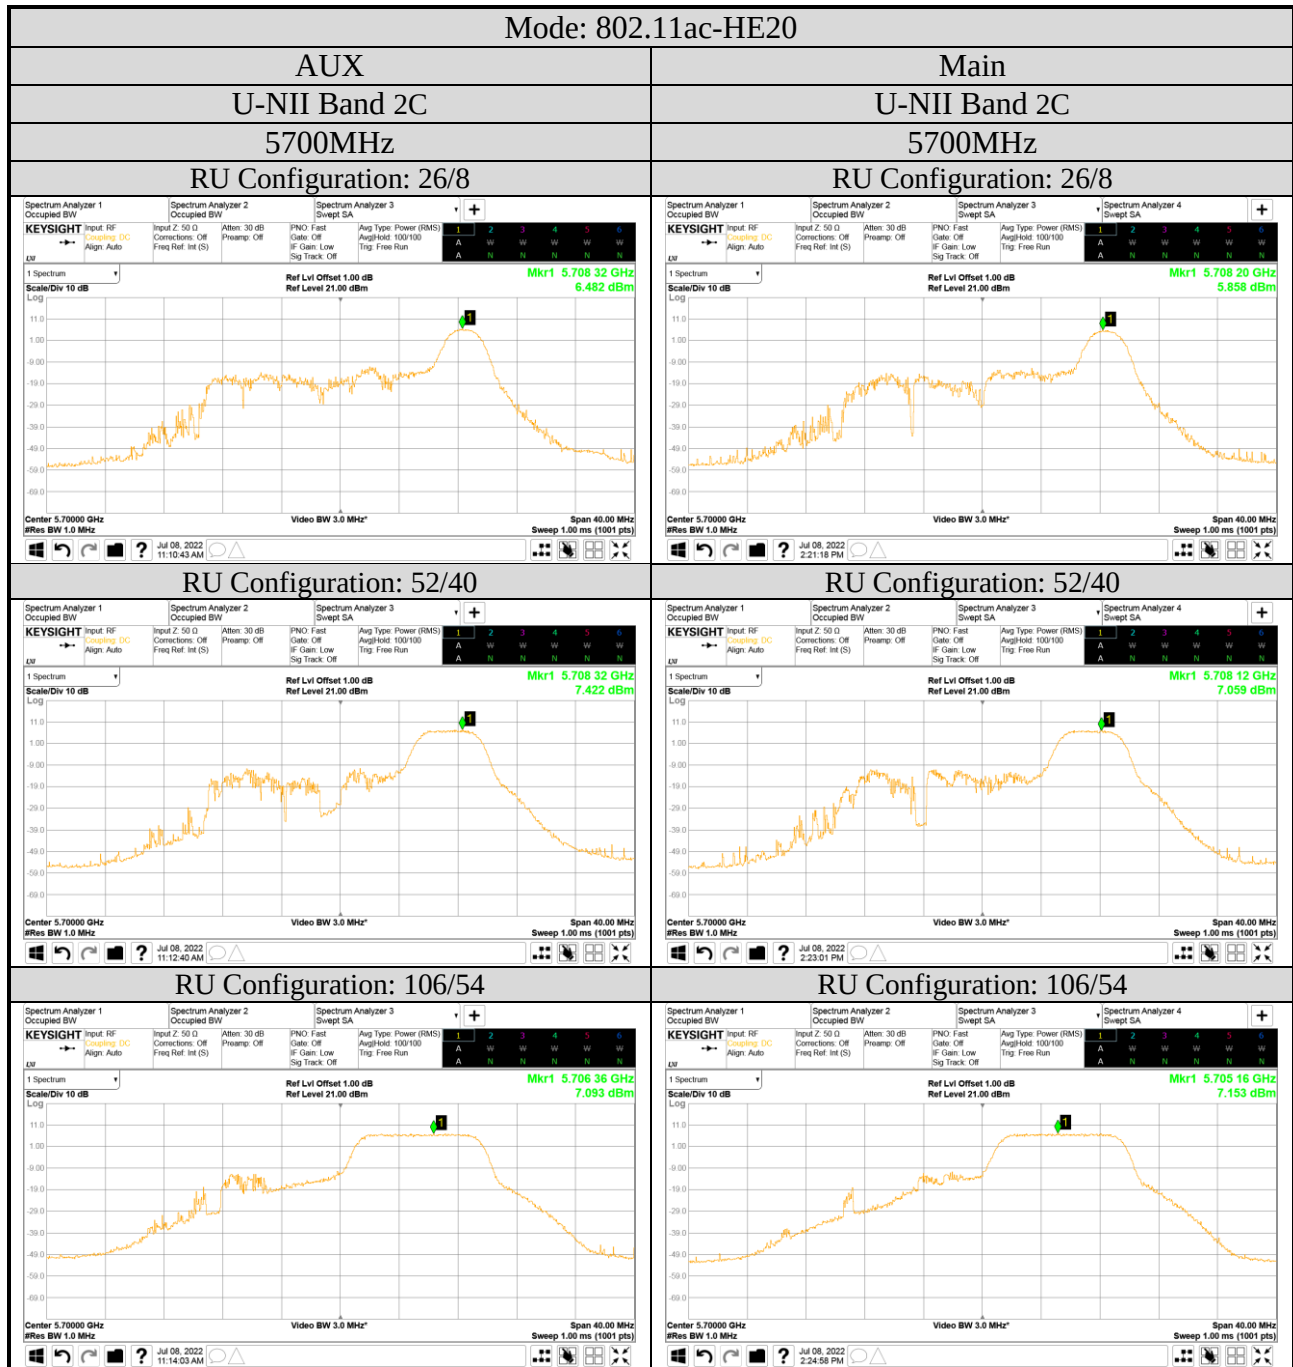


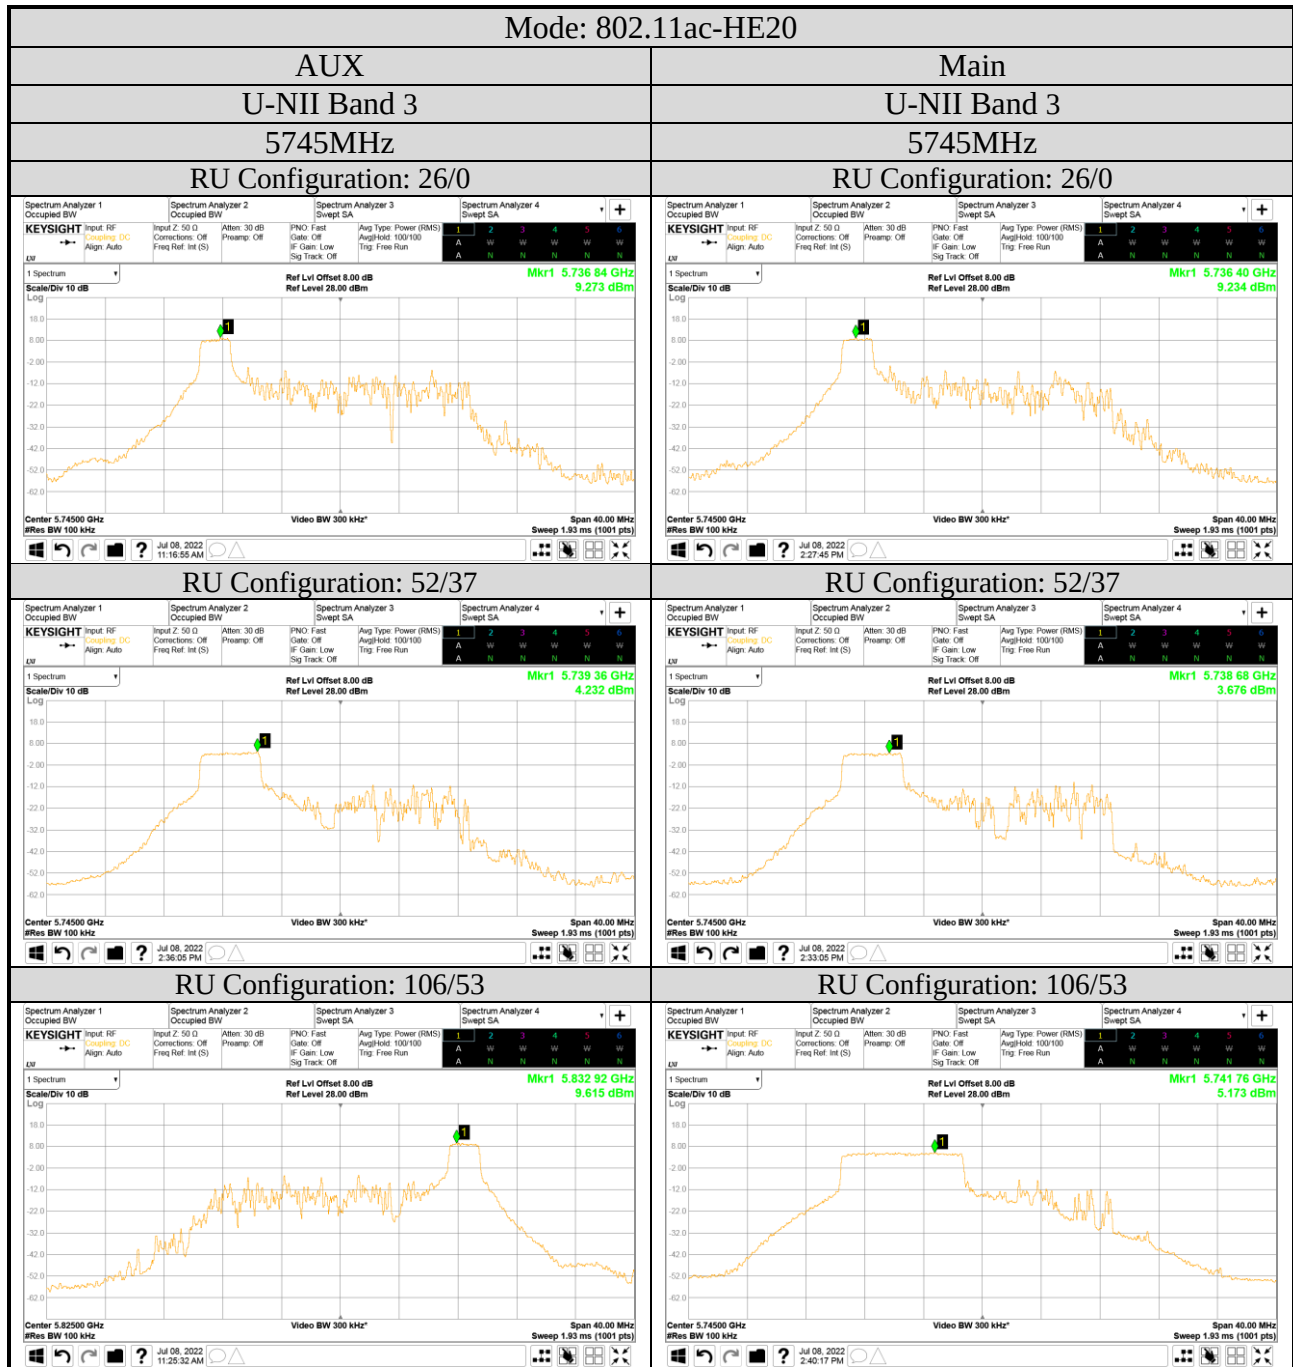

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

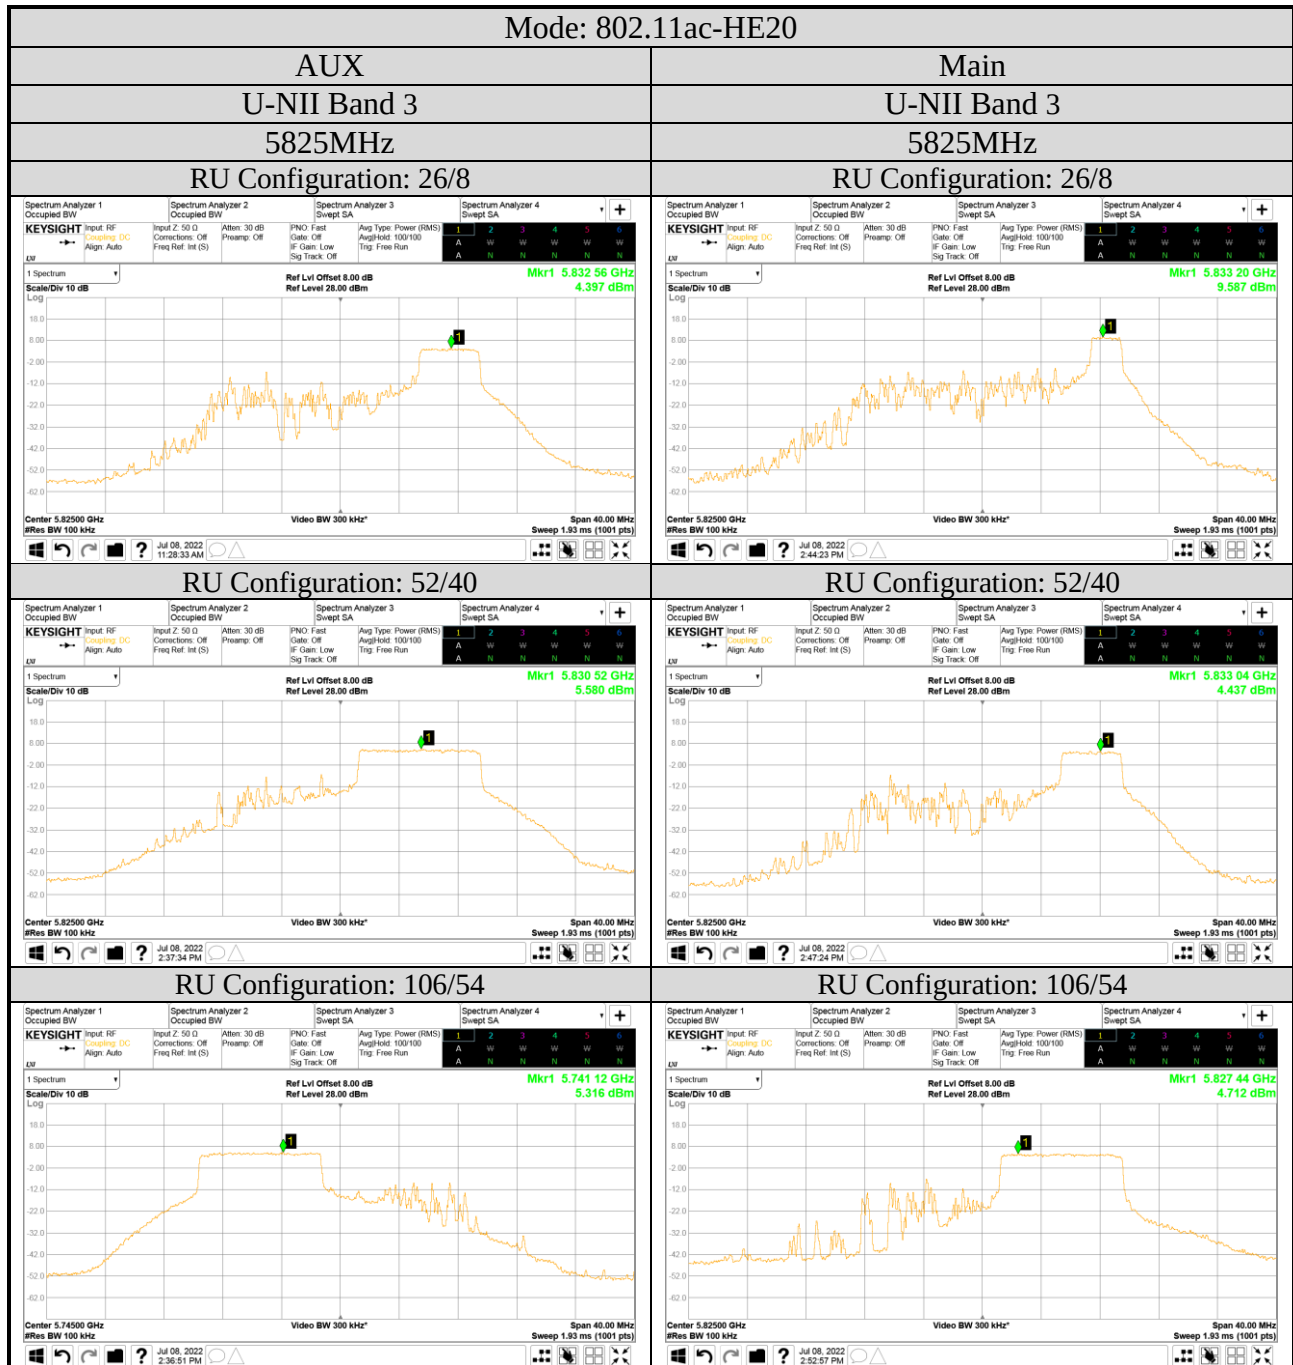

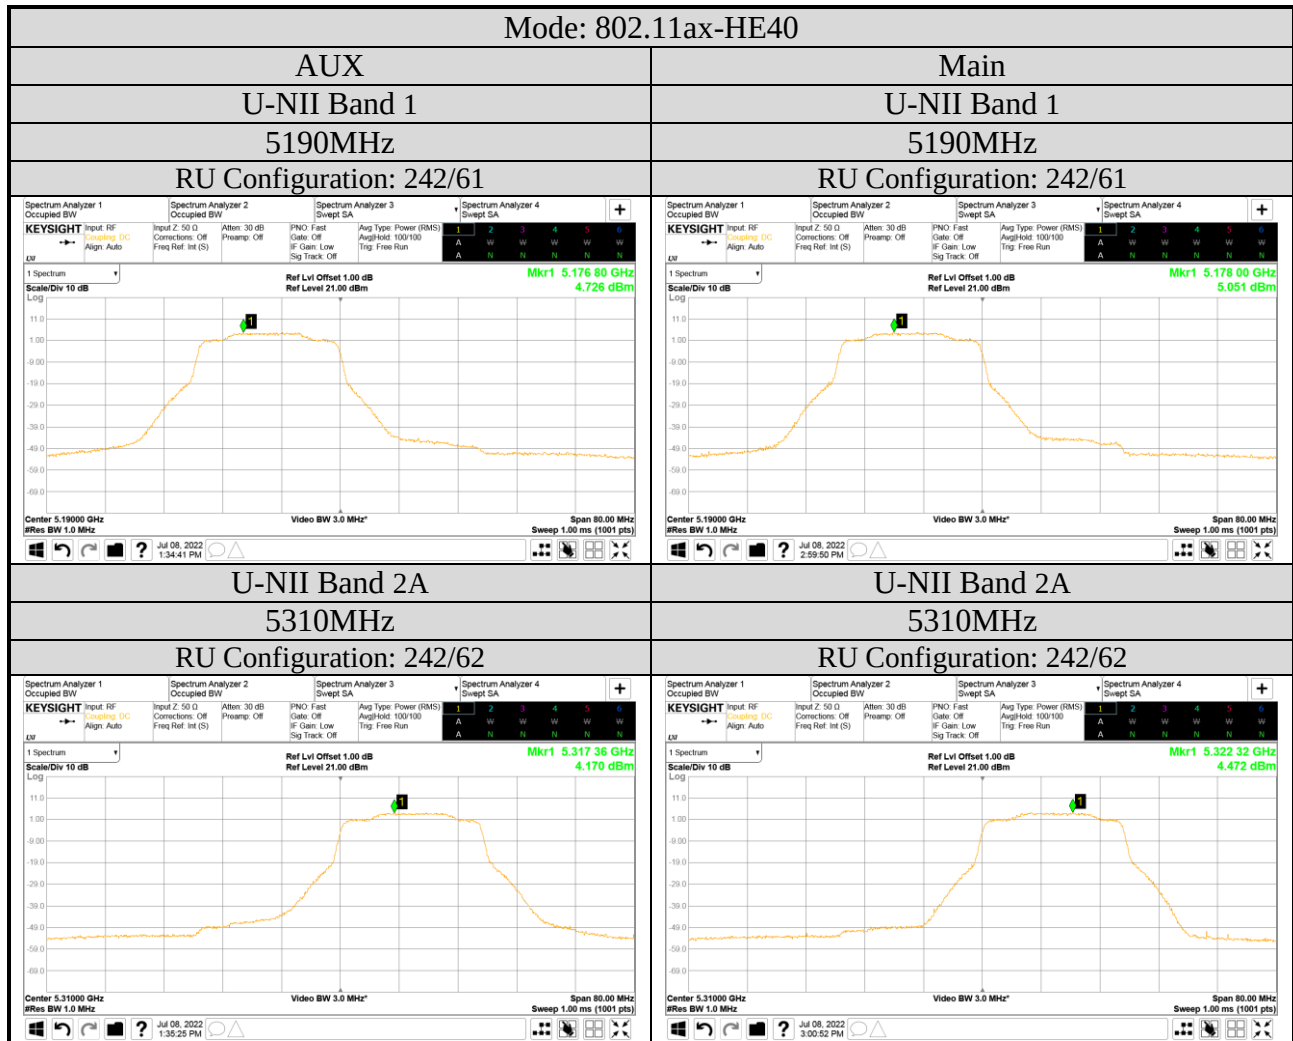


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

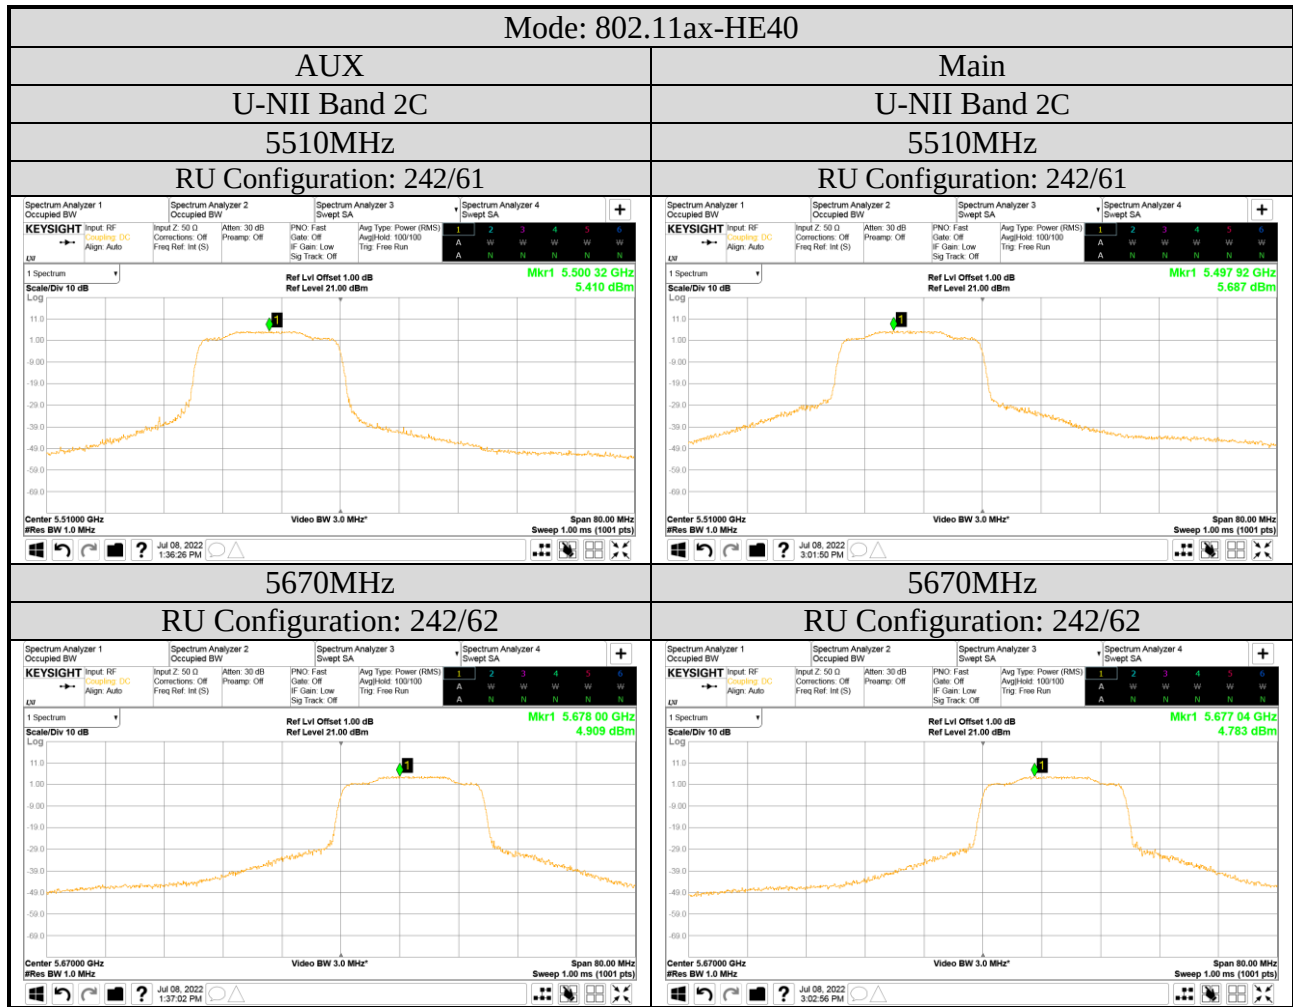



Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

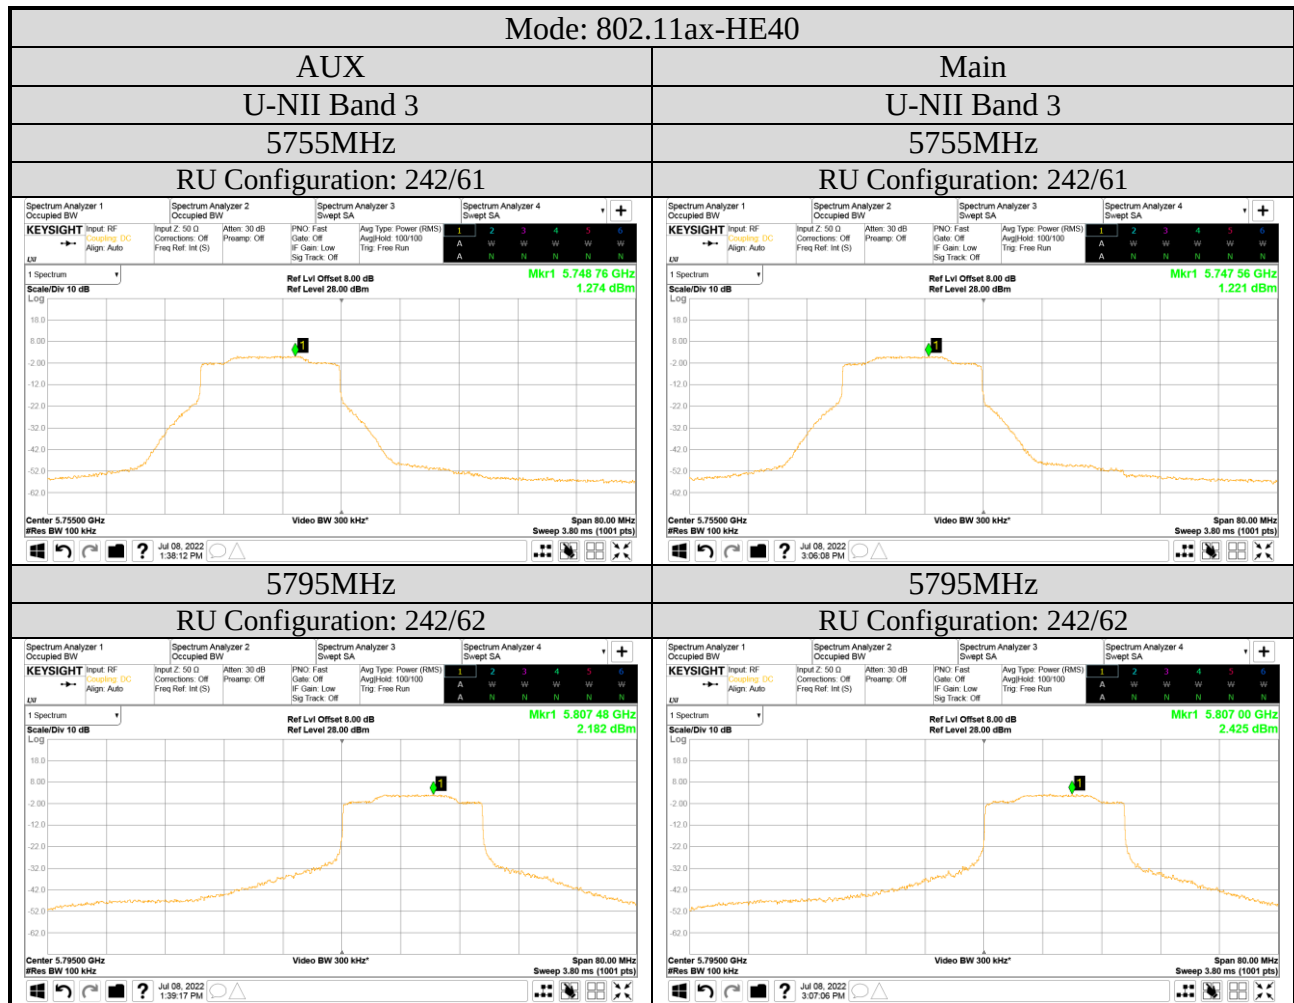

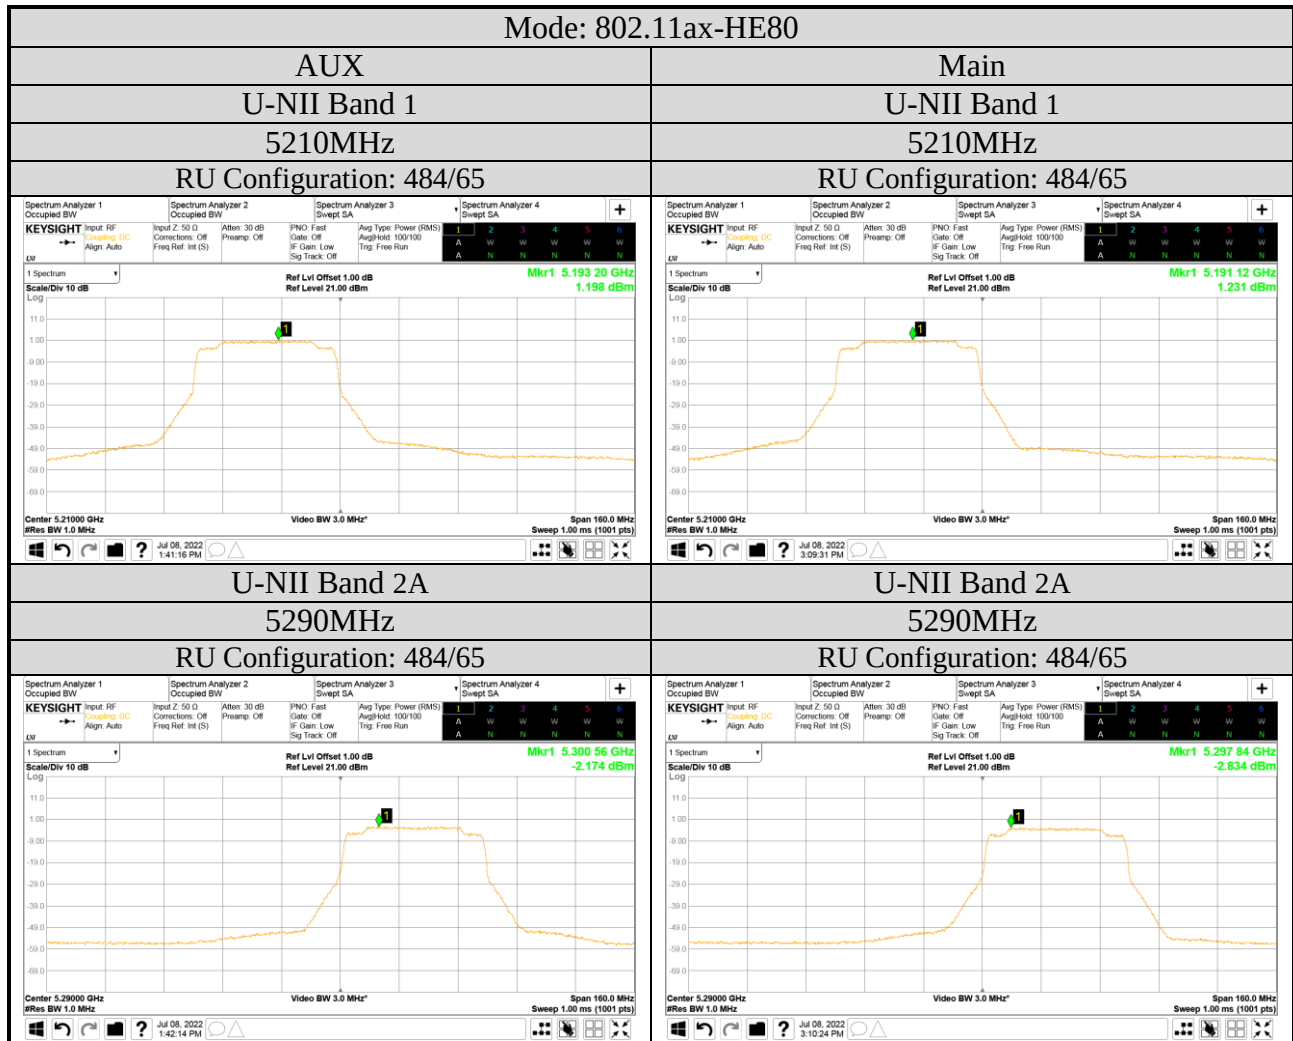


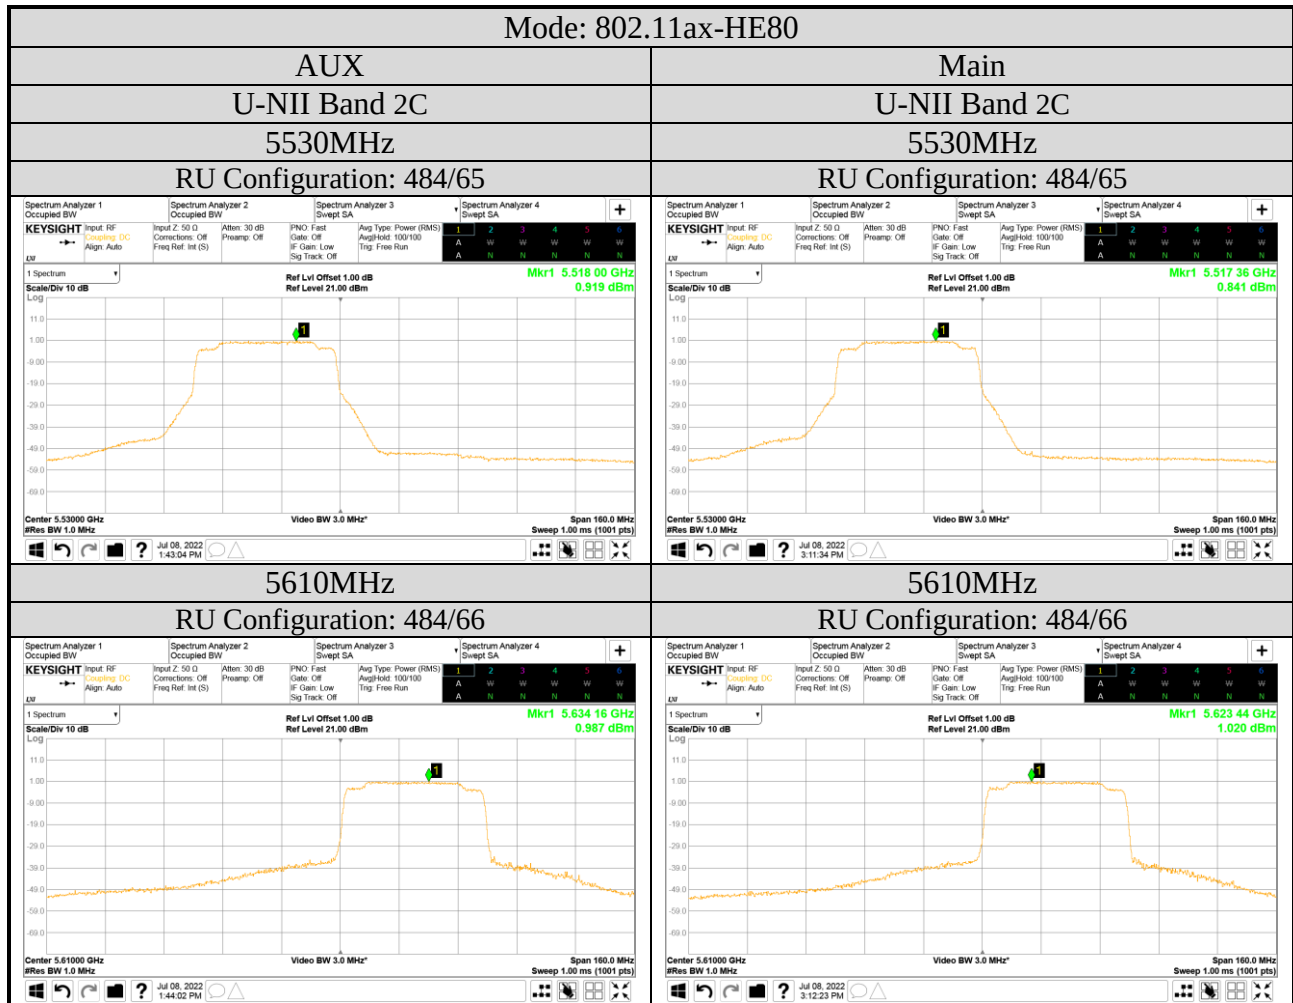


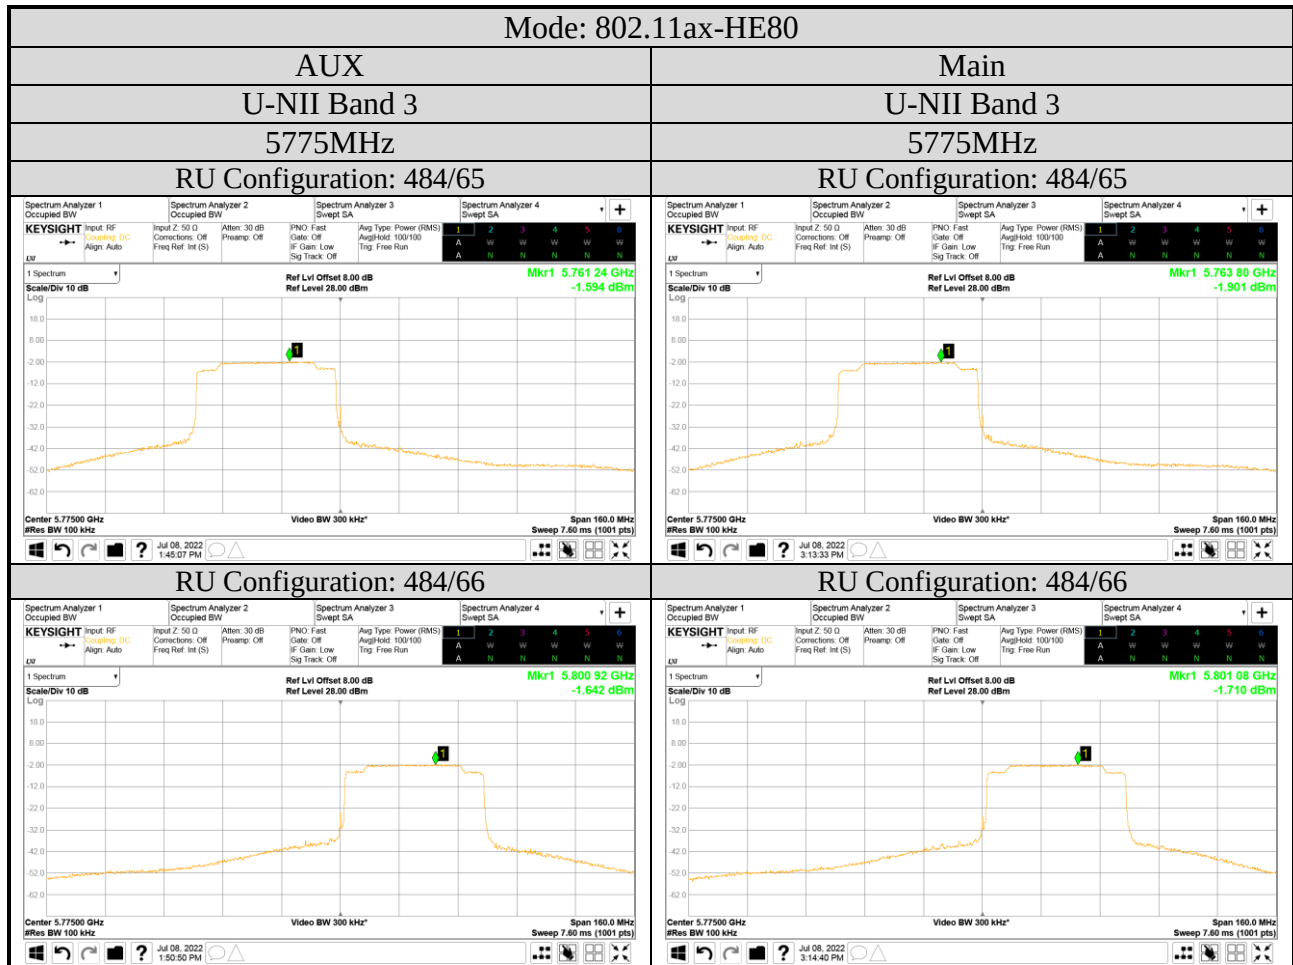

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

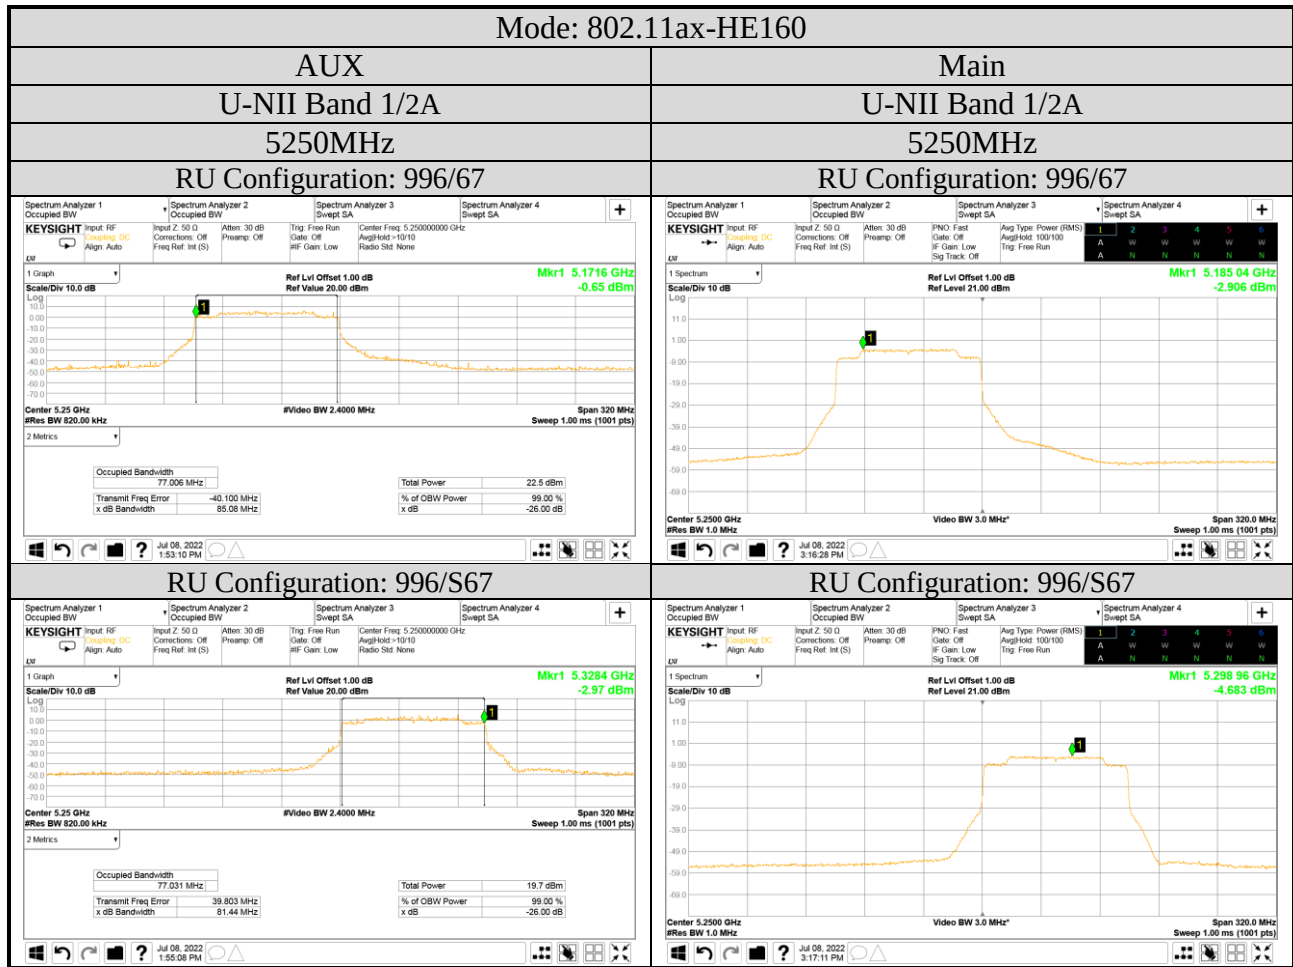

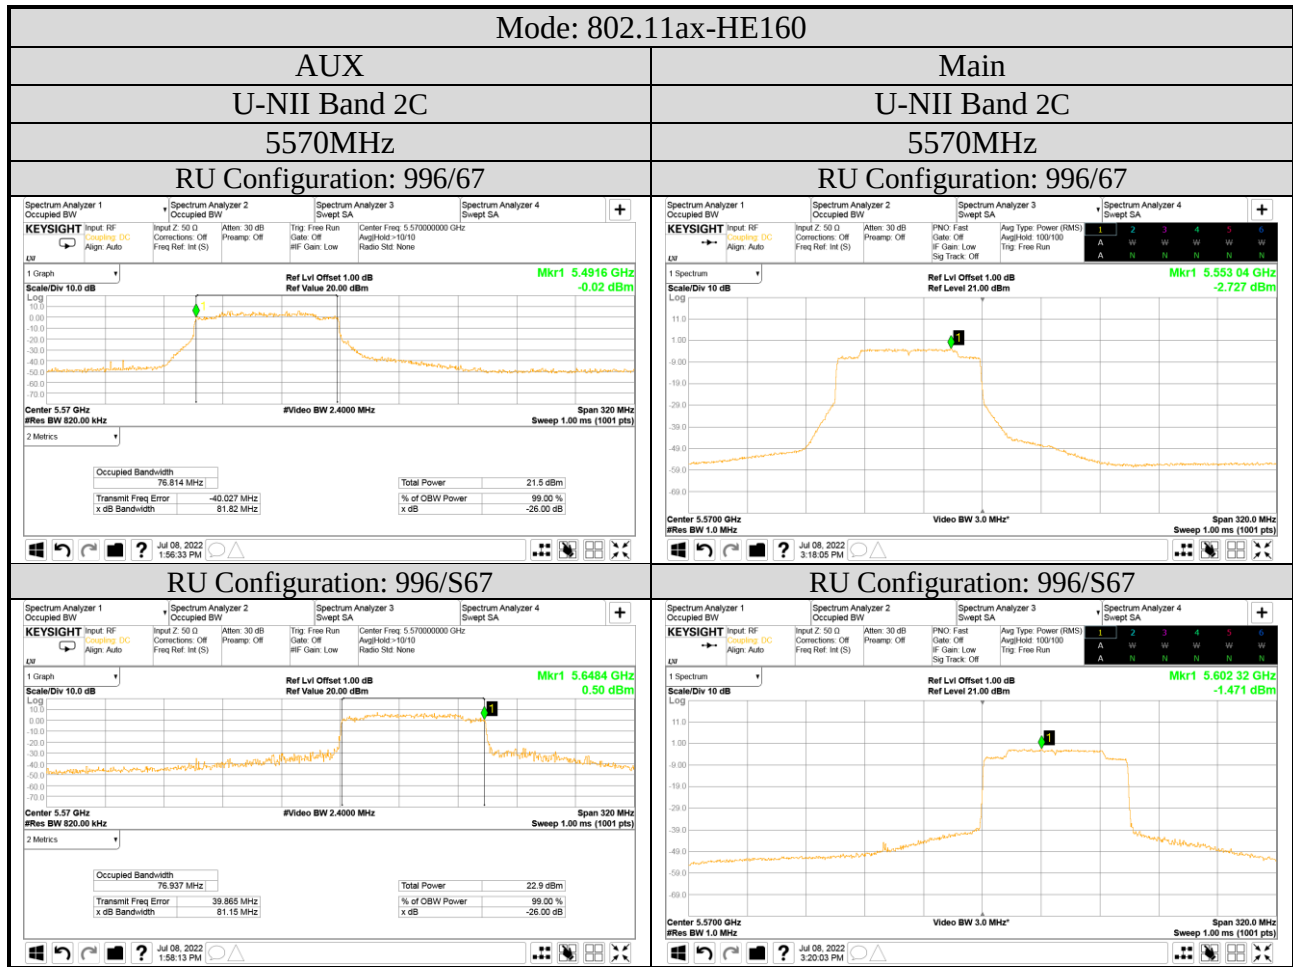

A.5 FREQUENCY STABILITY

Test Date	2022/07/20	Temp./Hum.	26°C/52~57%
Test Voltage	AC 120V 60Hz (Via AC Adapter)	Tested By	Kuper Hsu

A.5.1 Frequency stability Result

Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.023	4.440
-30	102		5180.029	5.598
	138		5180.024	4.633
-20	102		5180.007	1.351
	138		5180.014	2.703
-10	102		5180.027	5.212
	138		5179.989	-2.124
0	102		5179.97	-5.792
	138		5179.978	-4.247
10	102		5179.976	-4.633
	138		5180.018	3.475
20	102		5179.979	-4.054
	138		5179.986	-2.703
30	102		5180.008	1.544
	138		5180.011	2.124
40	102		5179.998	-0.386
	138		5179.994	-1.158
50	102		5179.995	-0.965
	138		5180.016	3.089