


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City 244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

A.5.2 Measurement Plots







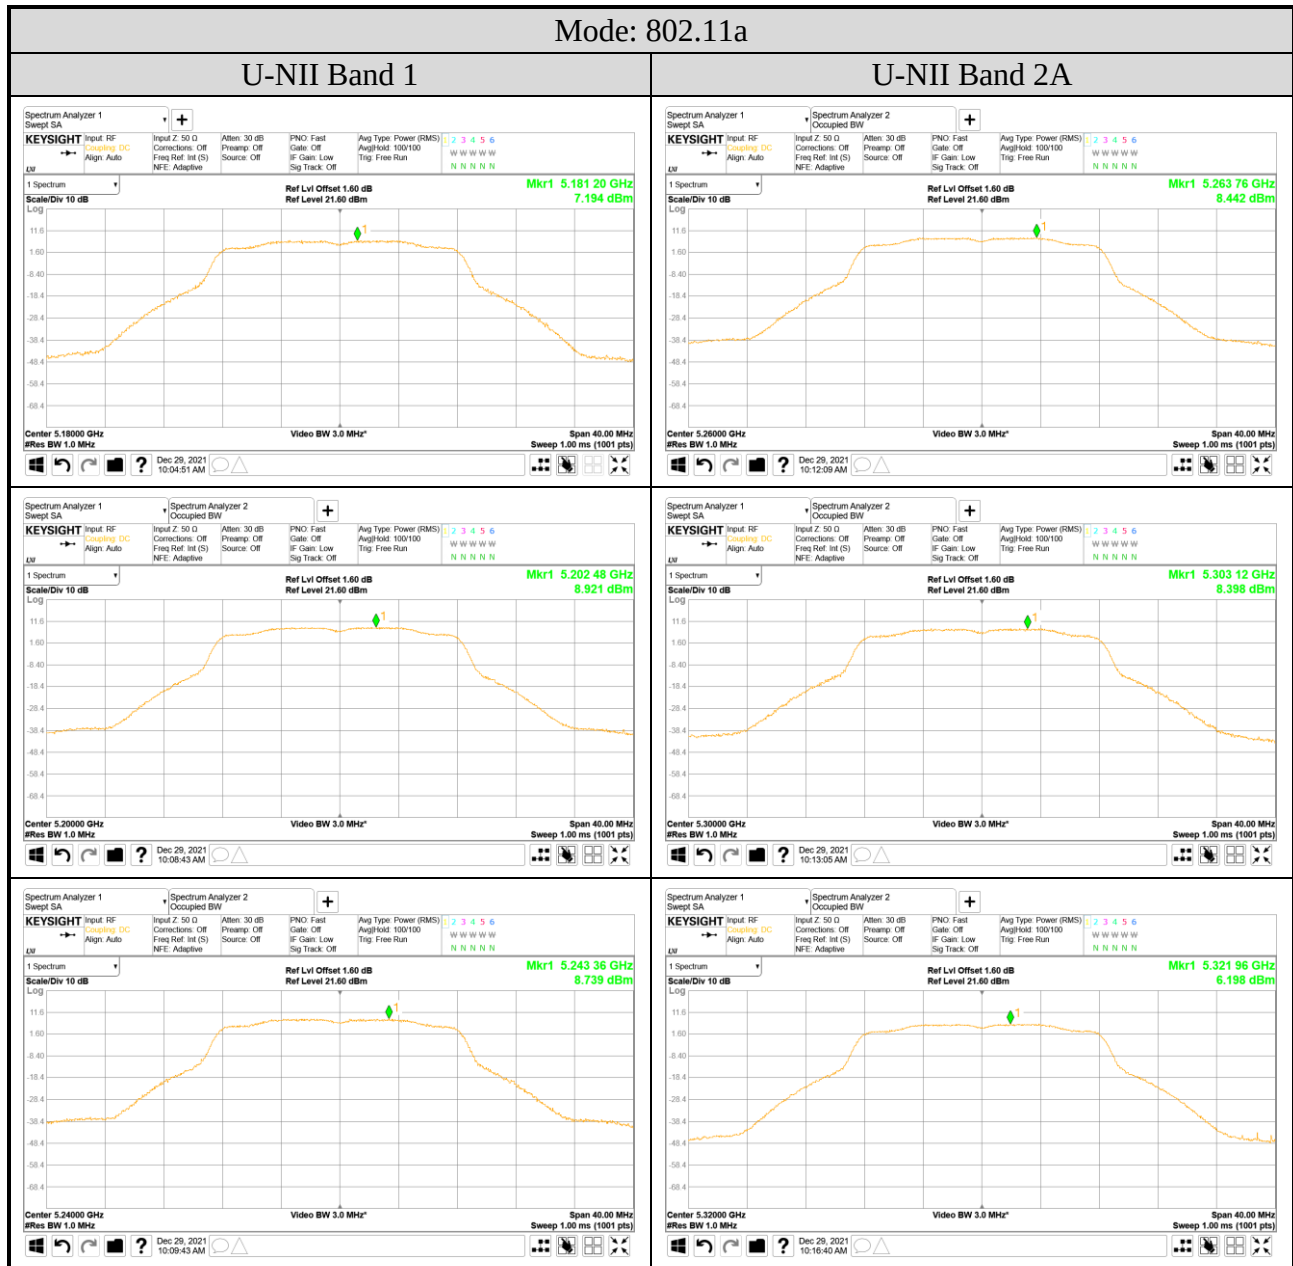


Mode: 802.11a

U-NII Band 2C

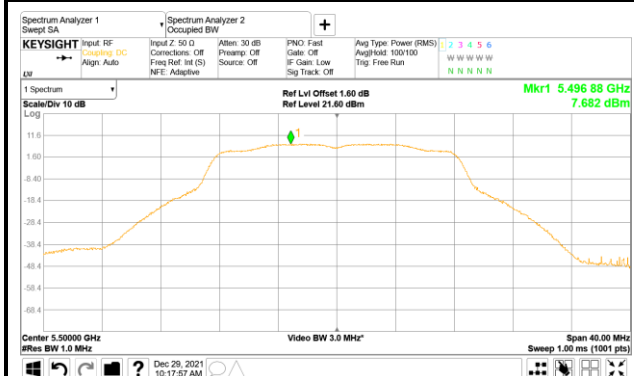


U-NII Band 3

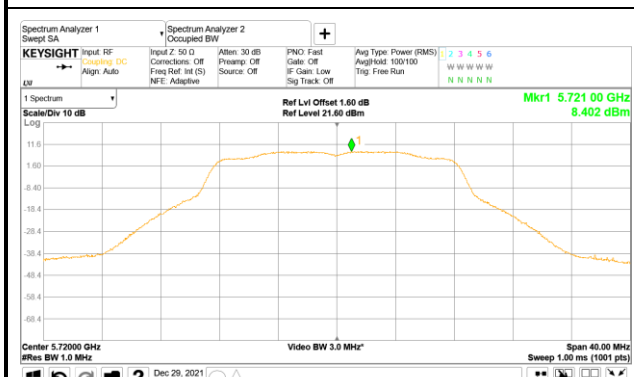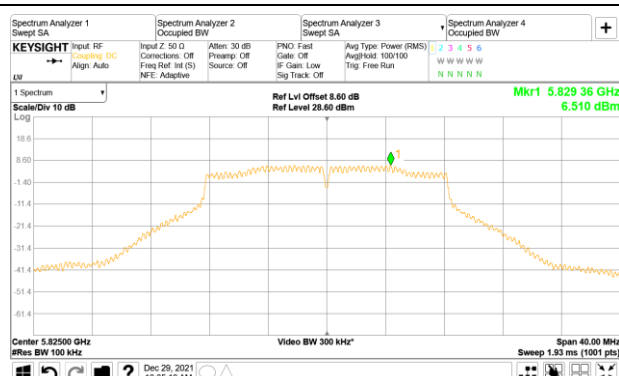
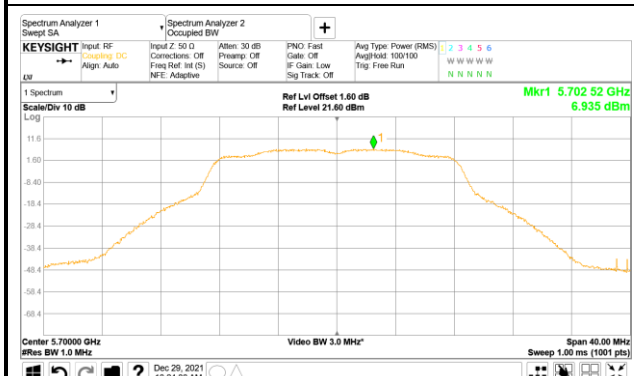
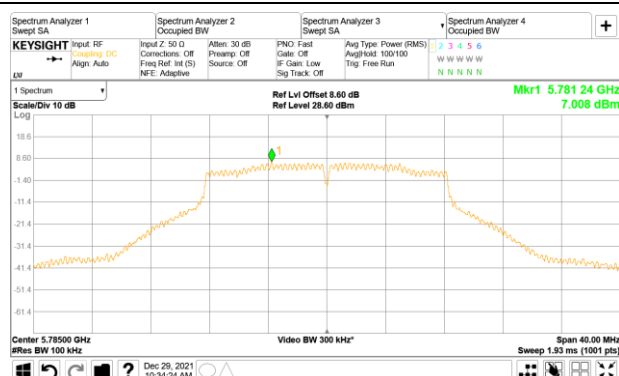
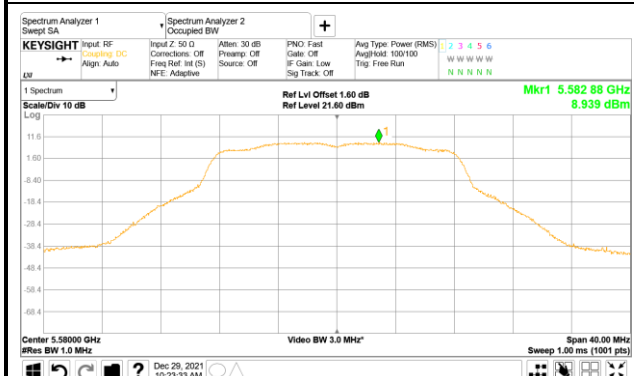
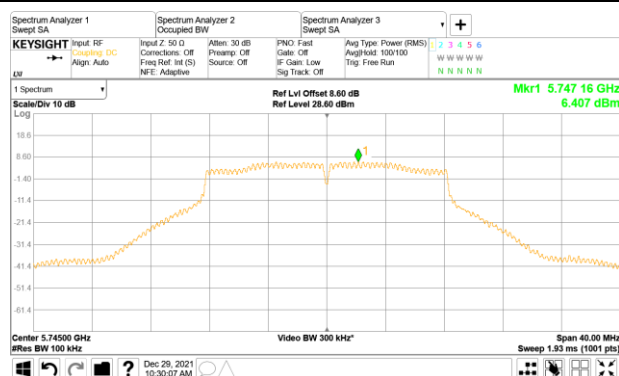


Mode: 802.11n-HT20

U-NII Band 1

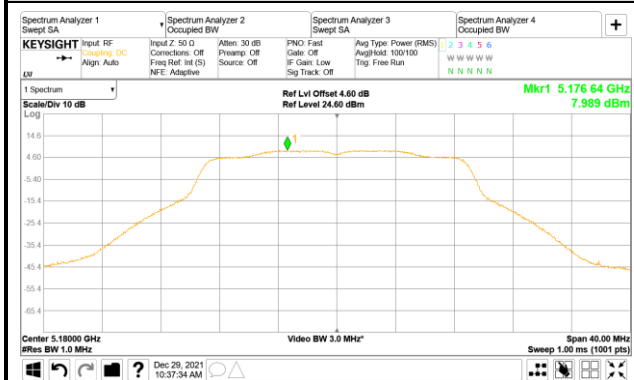


U-NII Band 2A


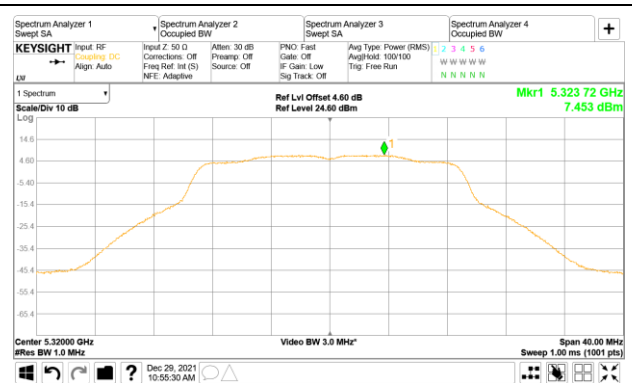
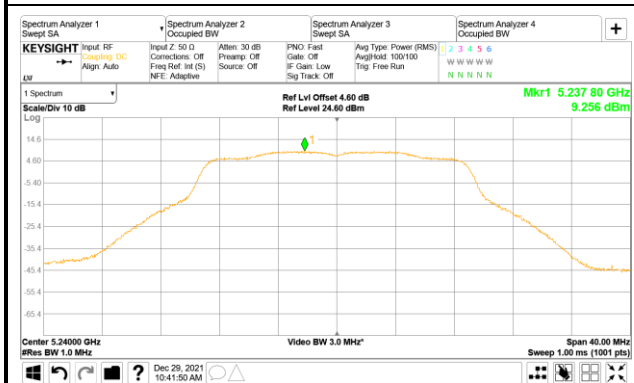
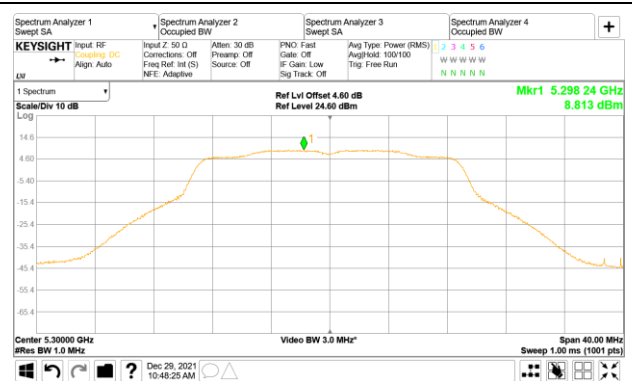
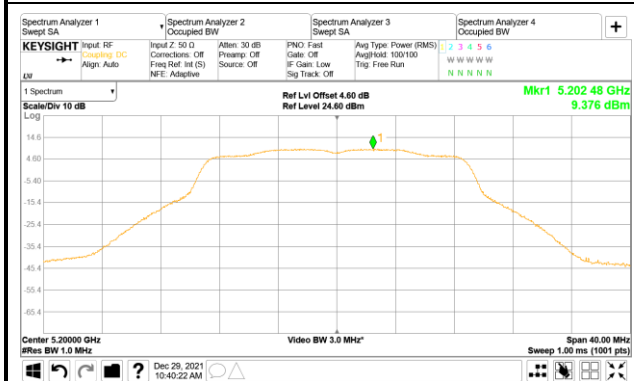
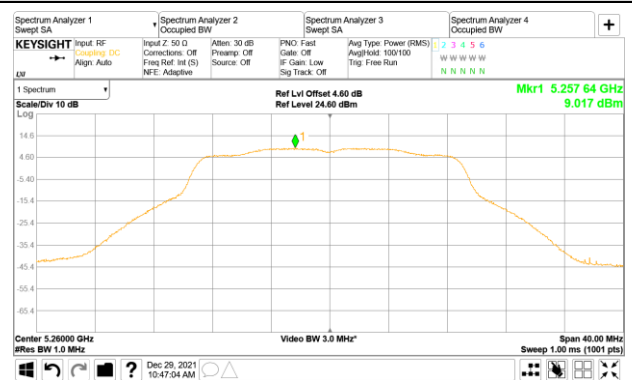


Mode: 802.11n-HT20

U-NII Band 2C

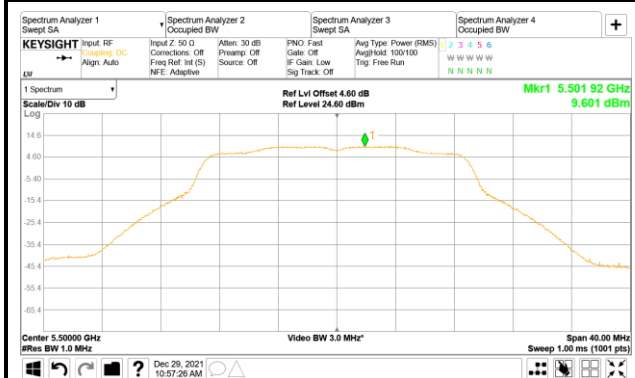


U-NII Band 3

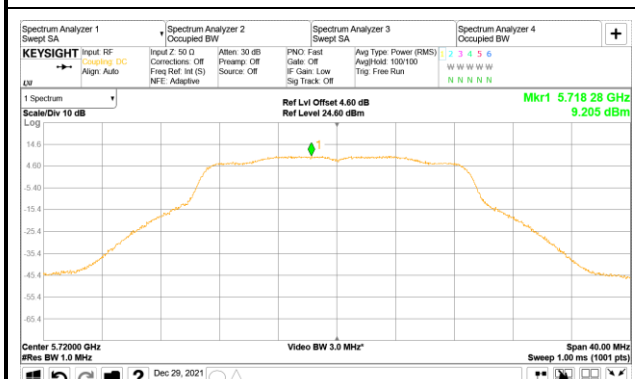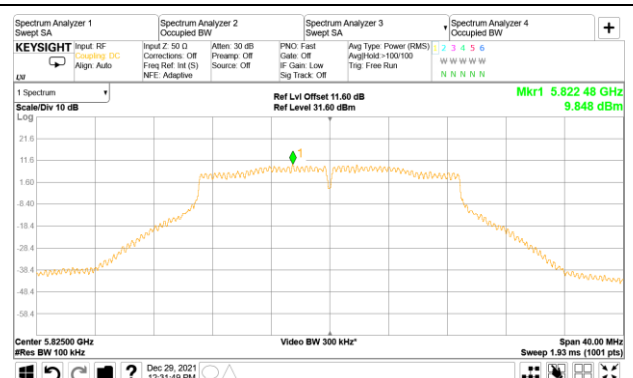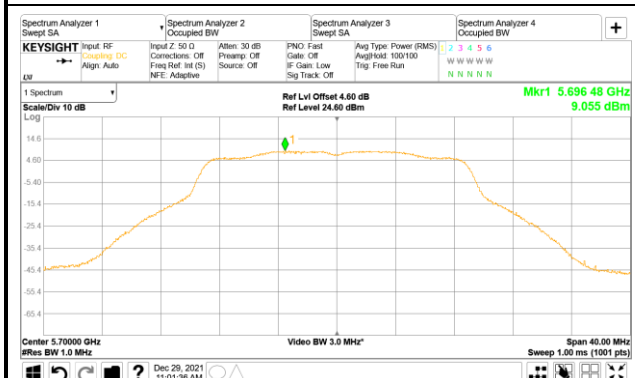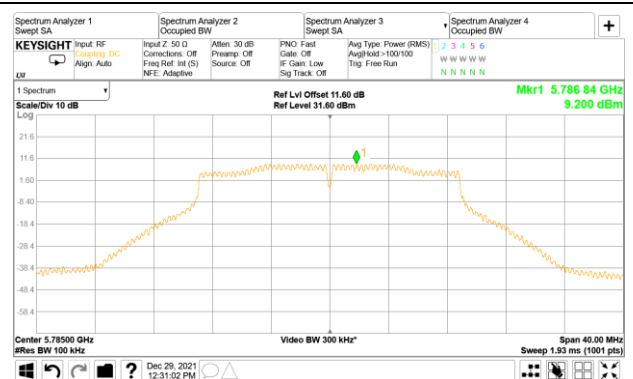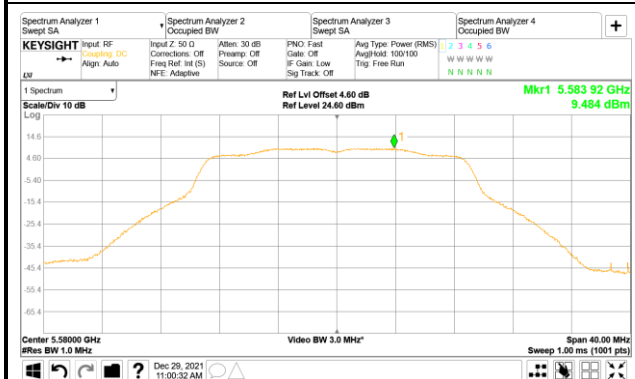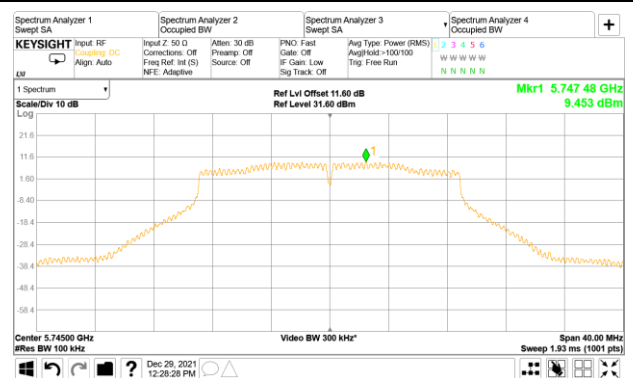

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

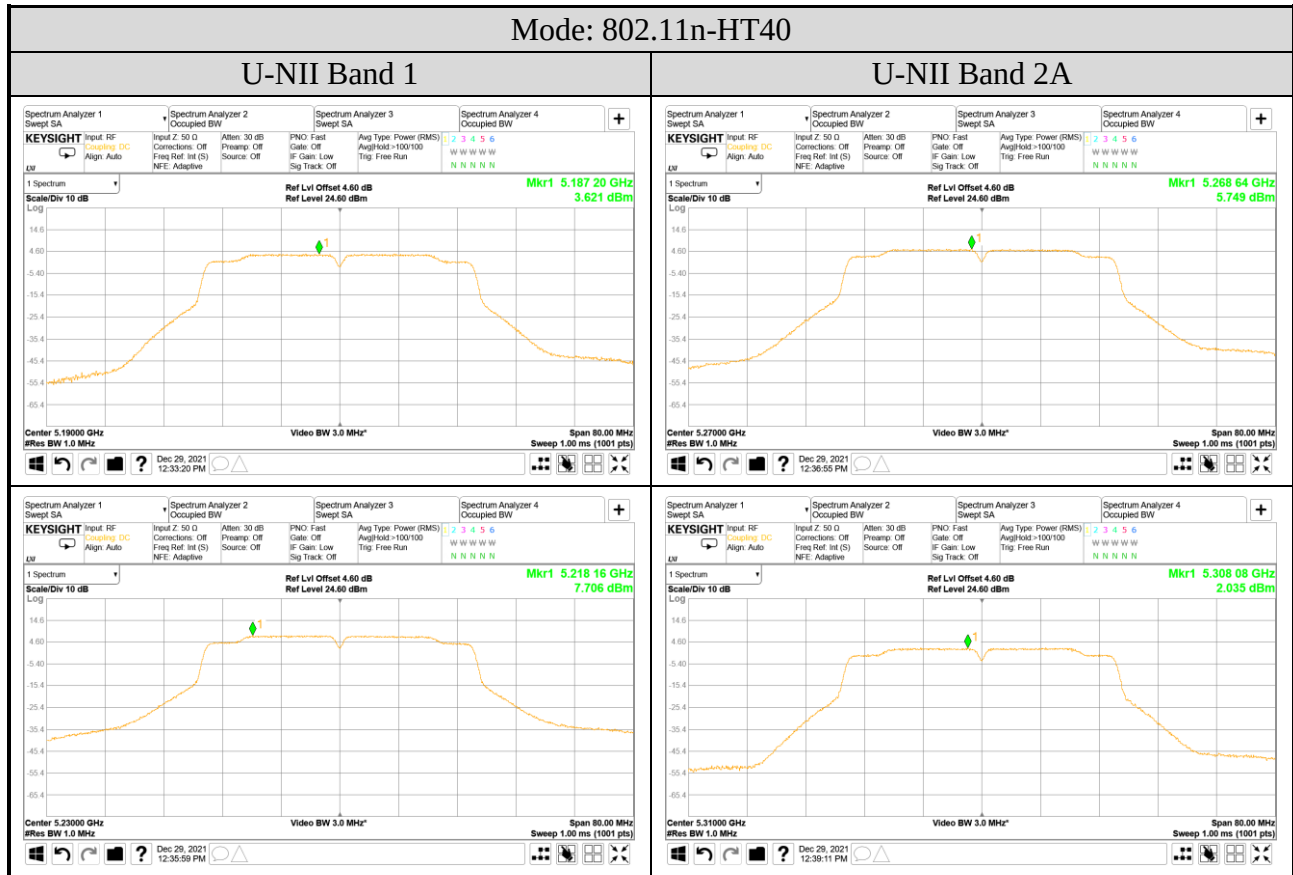

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303



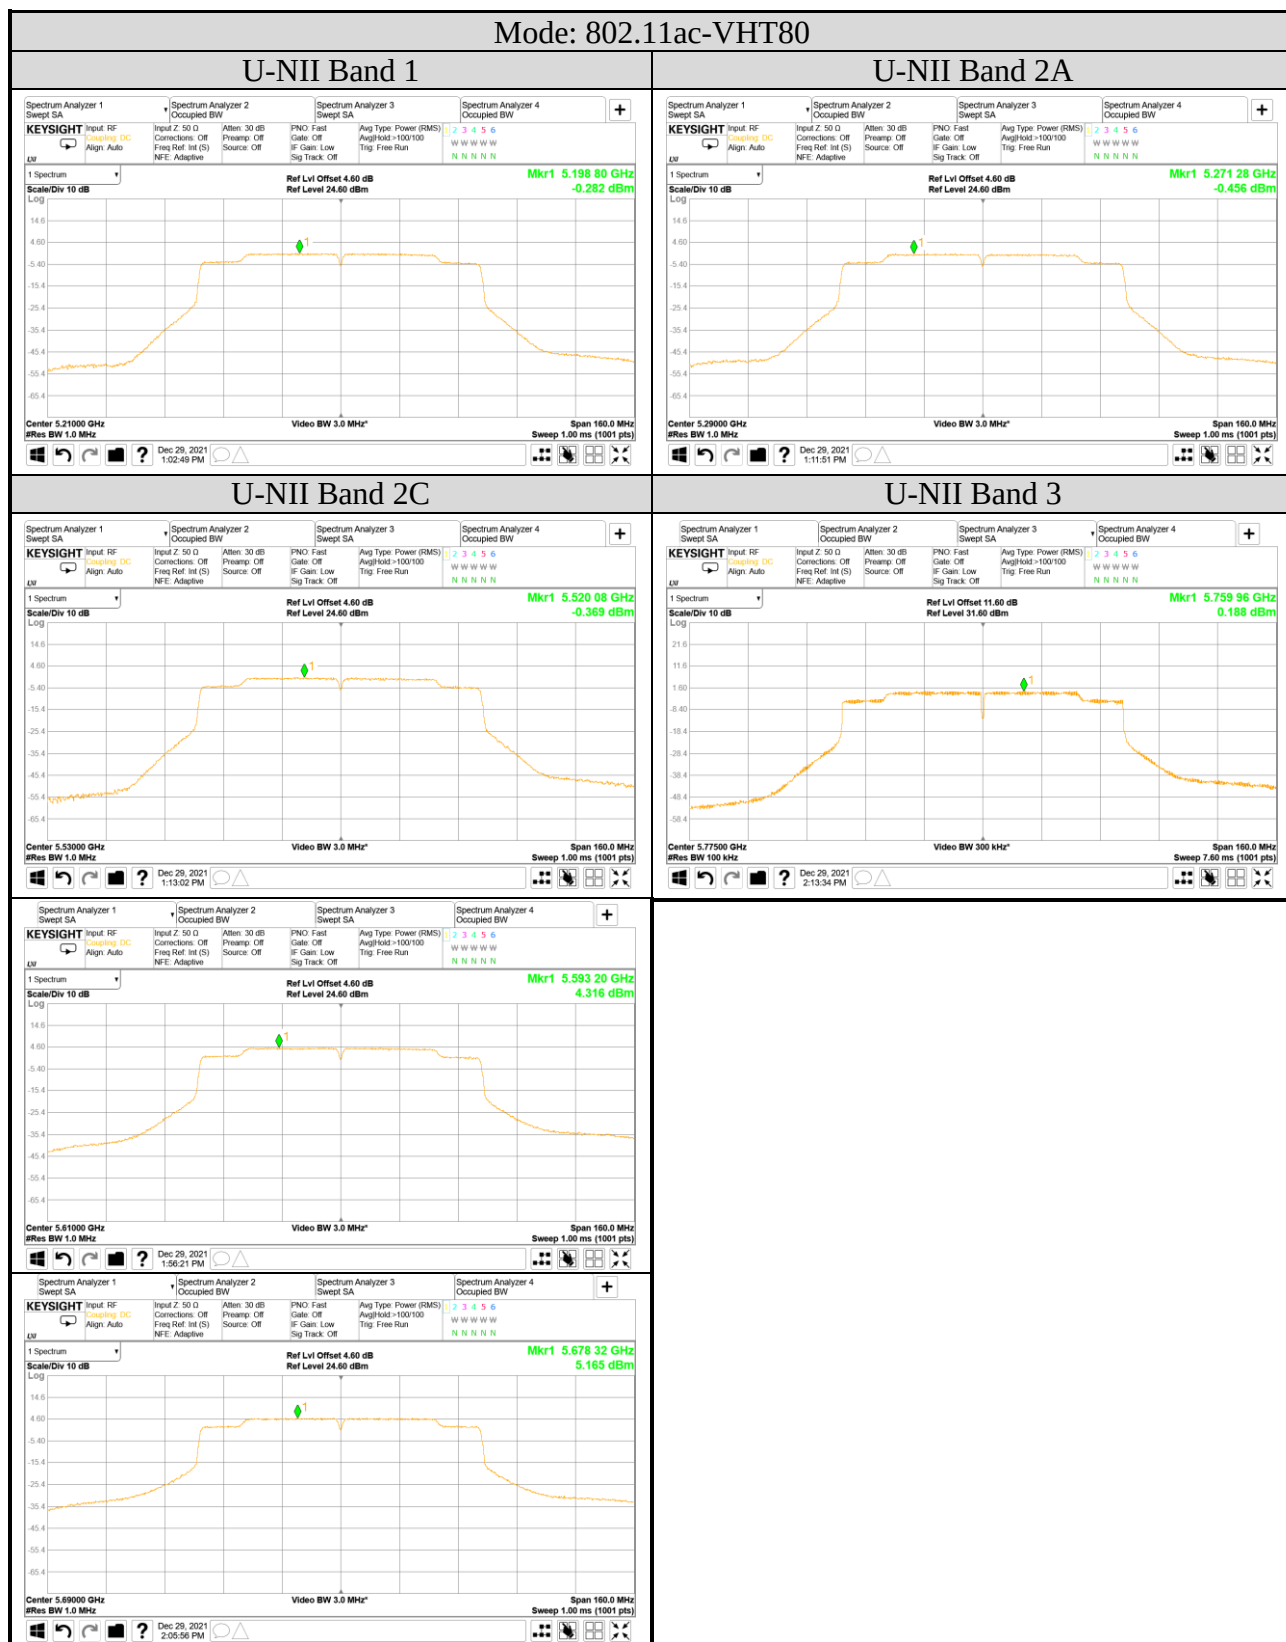


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

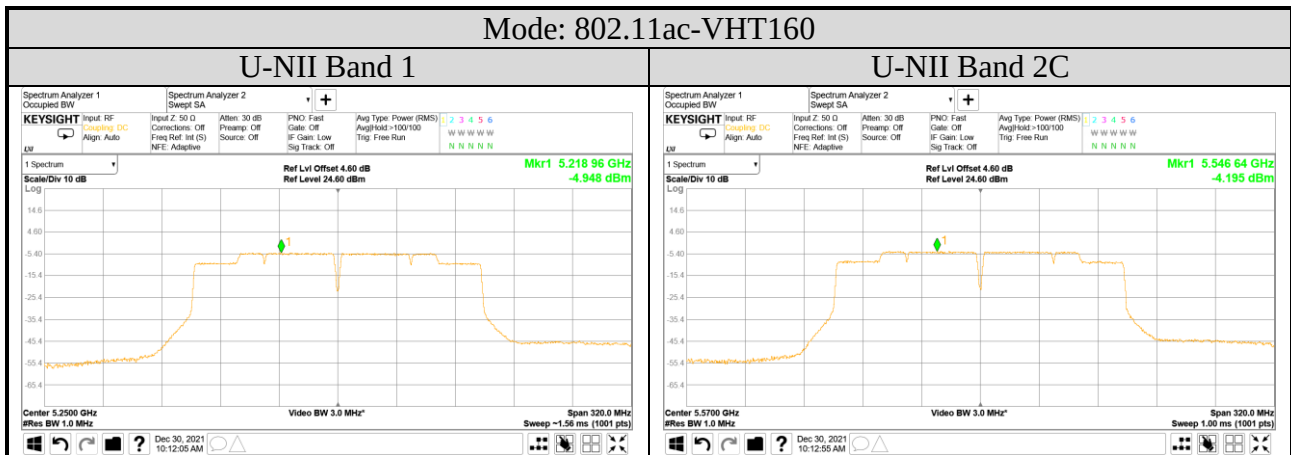


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

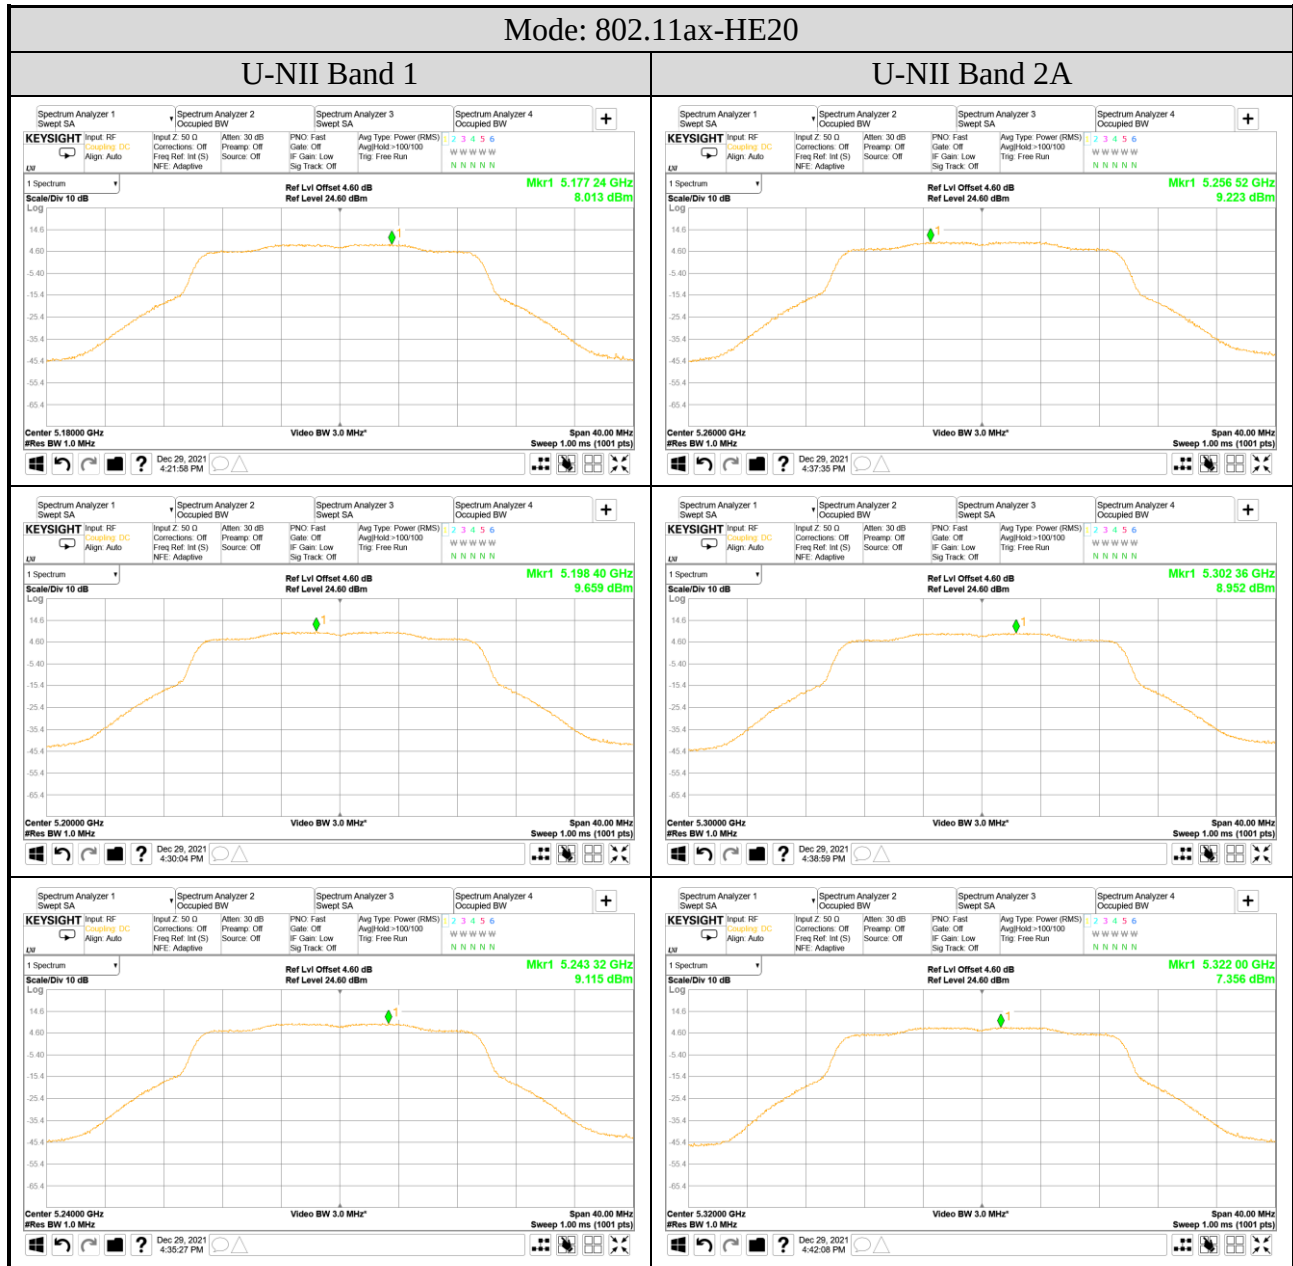

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan


Tel: +886 2 26099301
Fax: +886 2 26099303

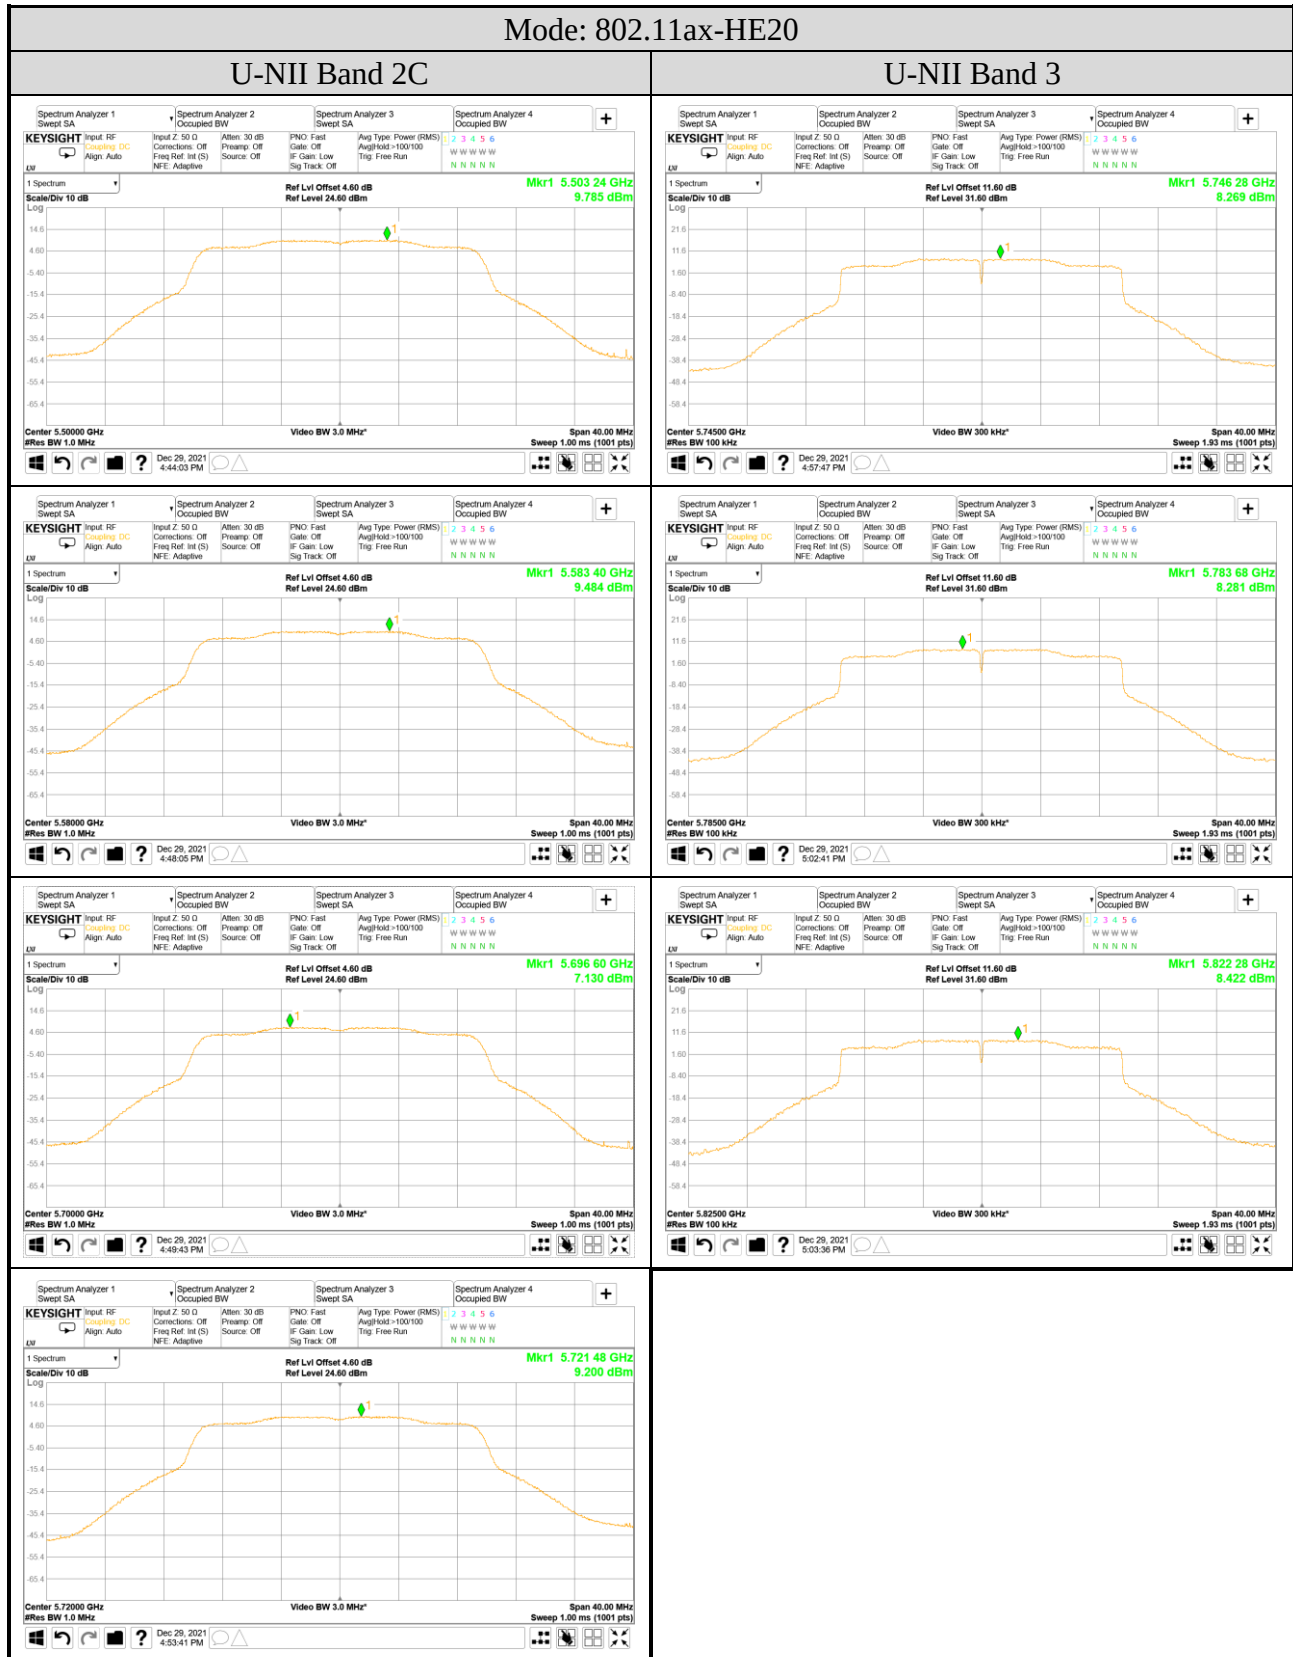


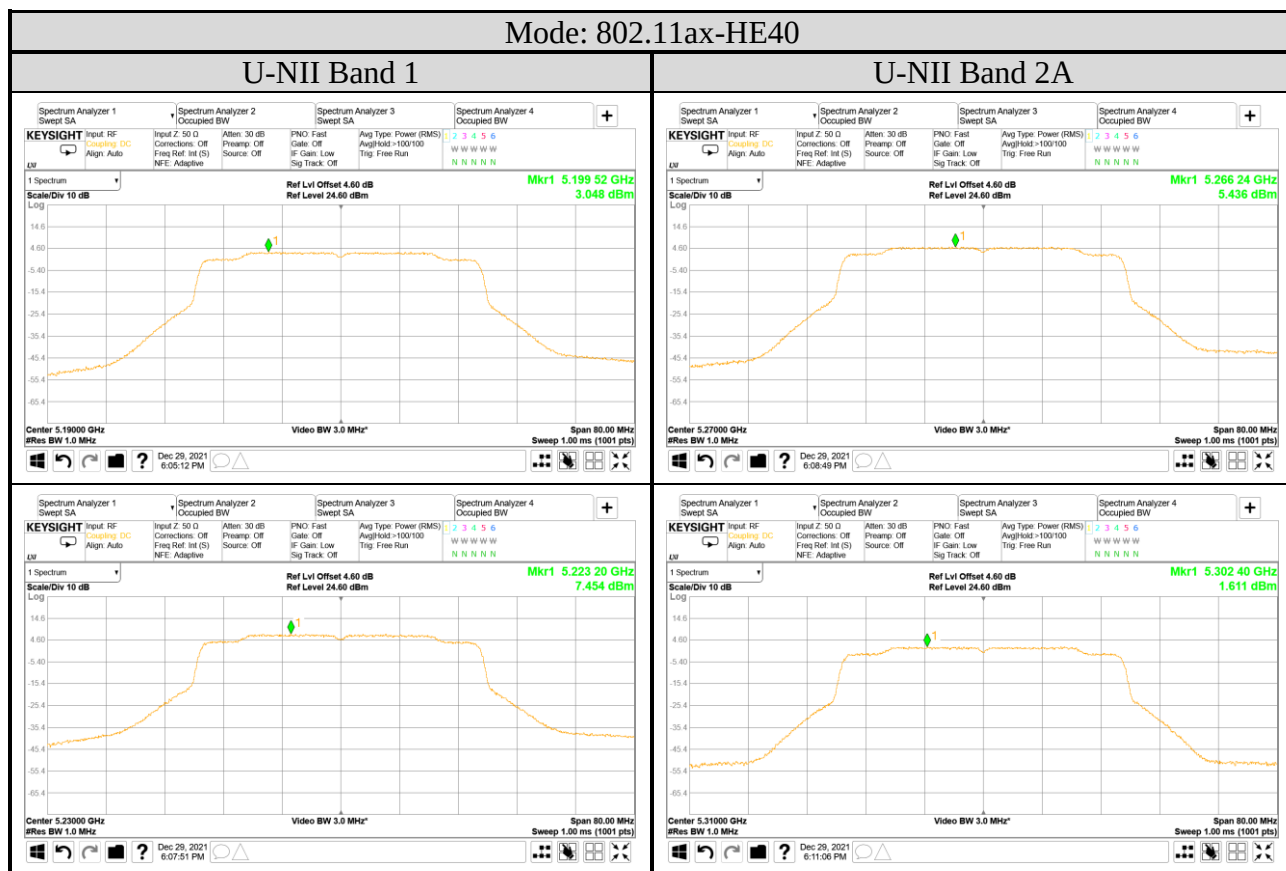



Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

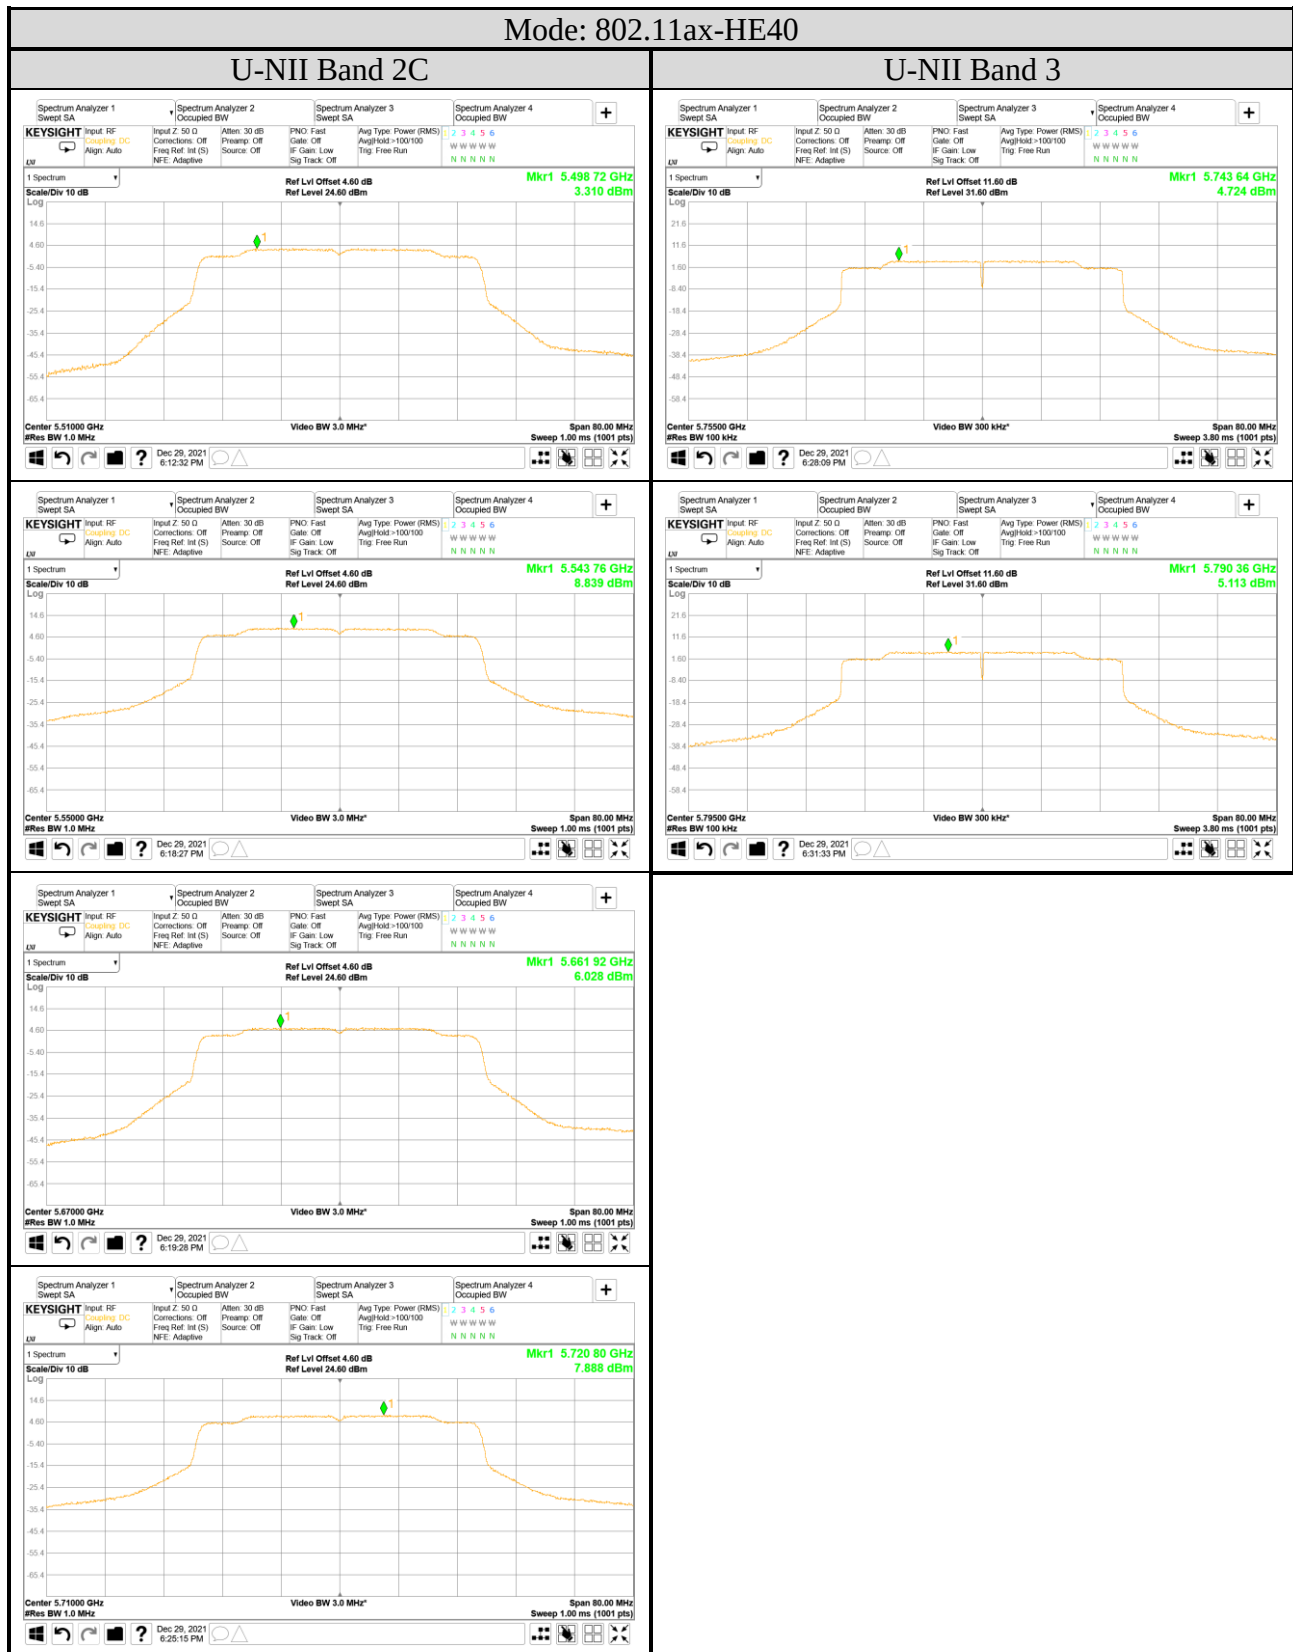

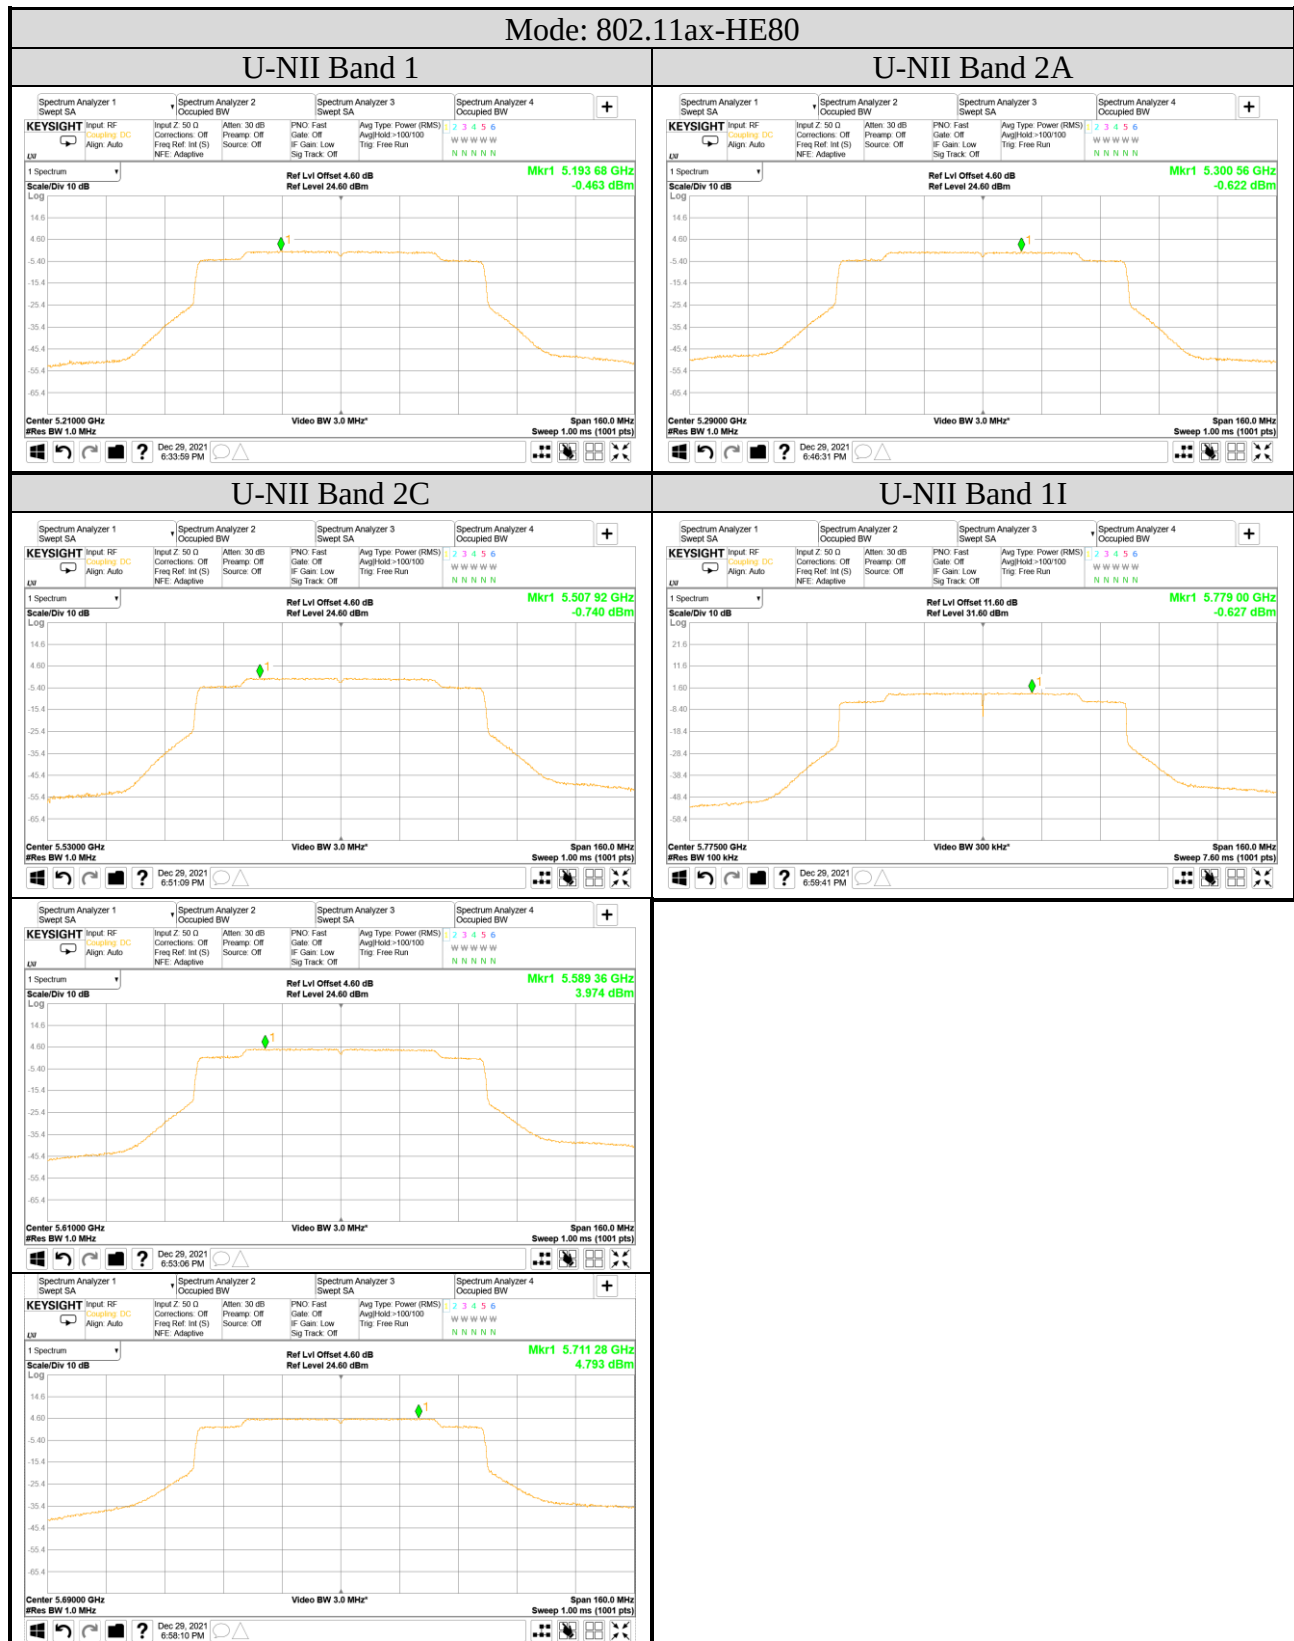


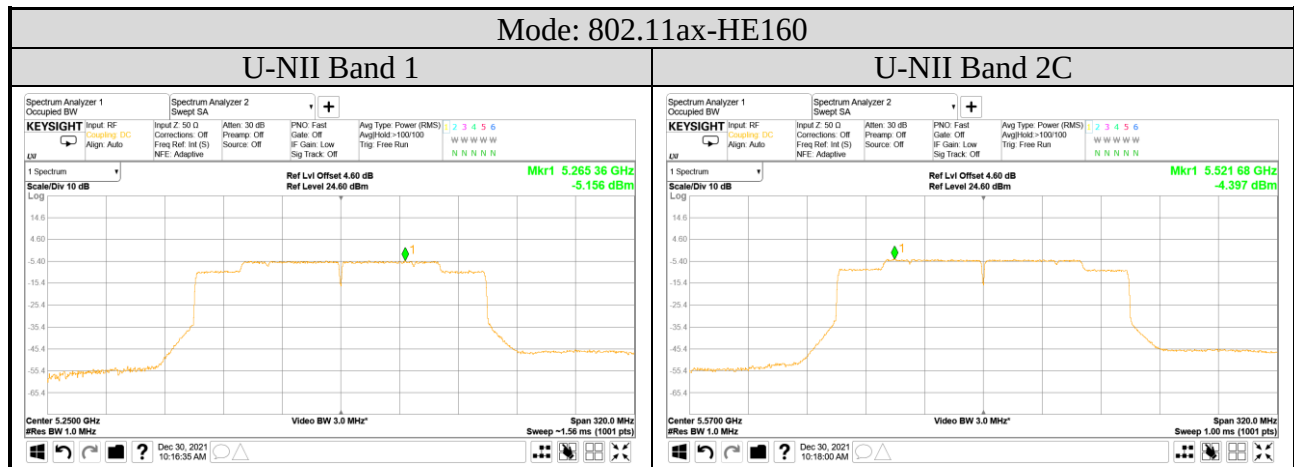


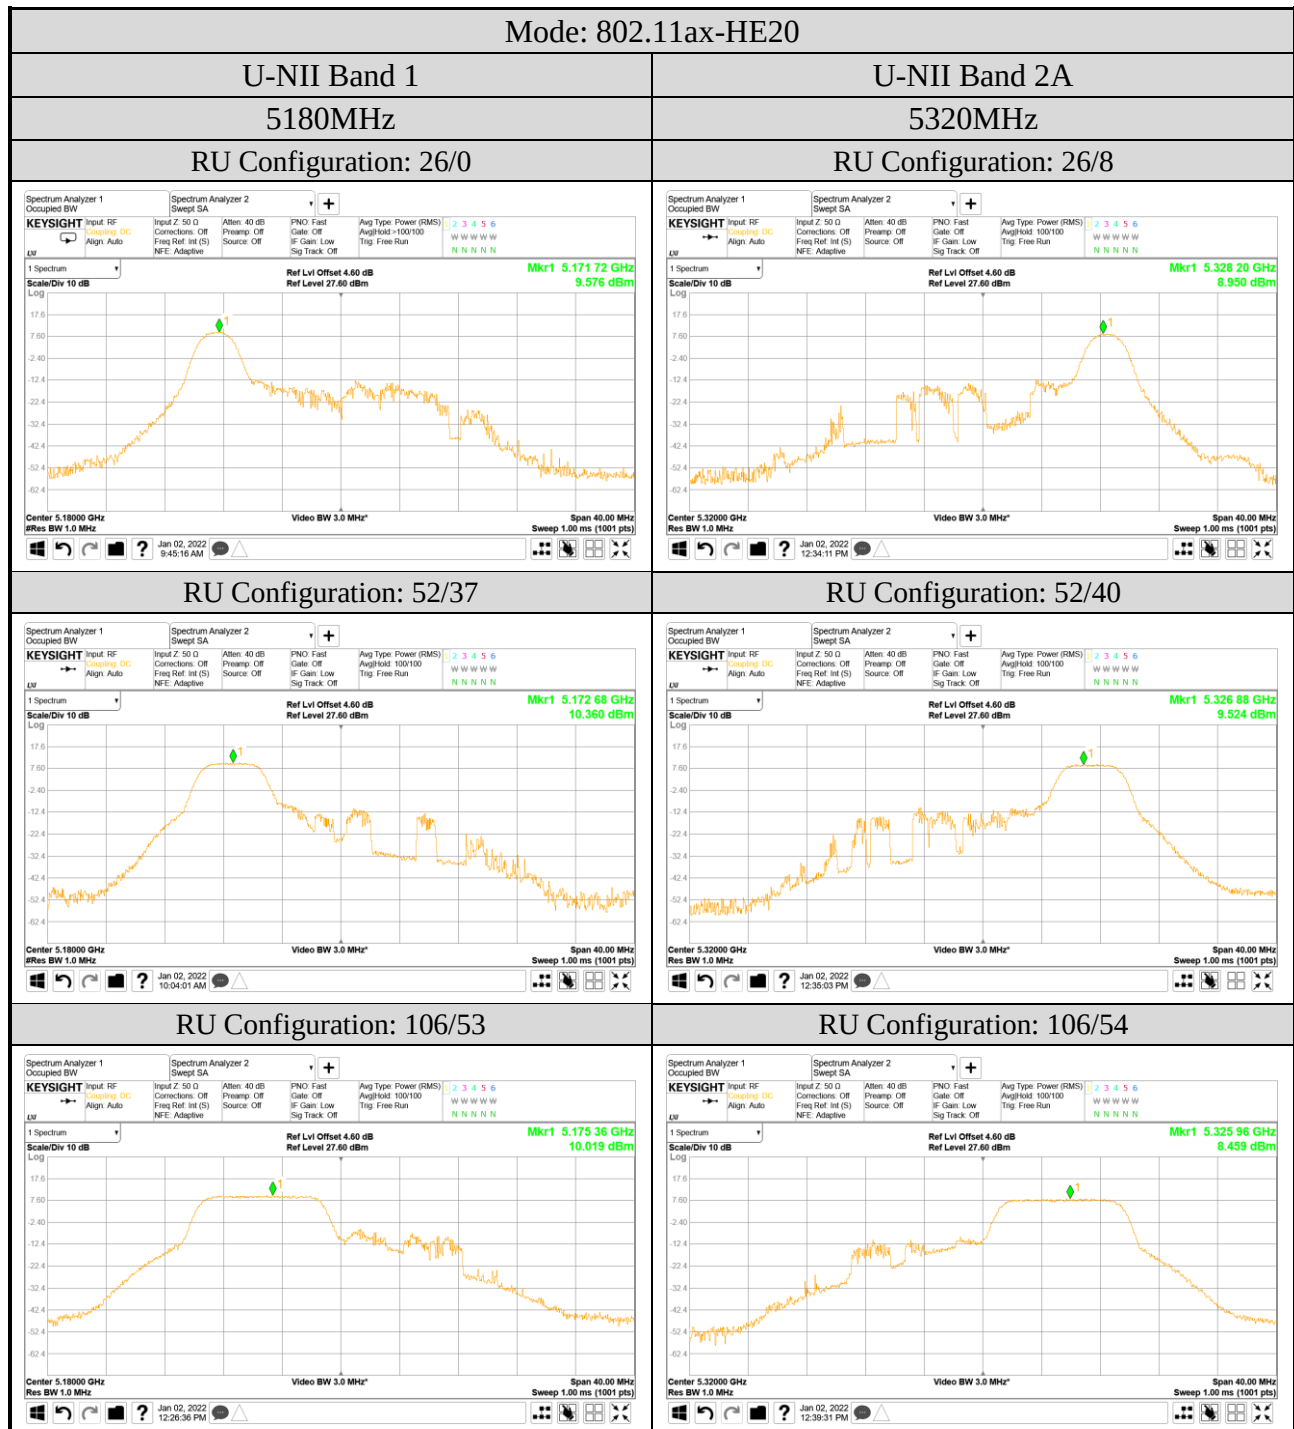



Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

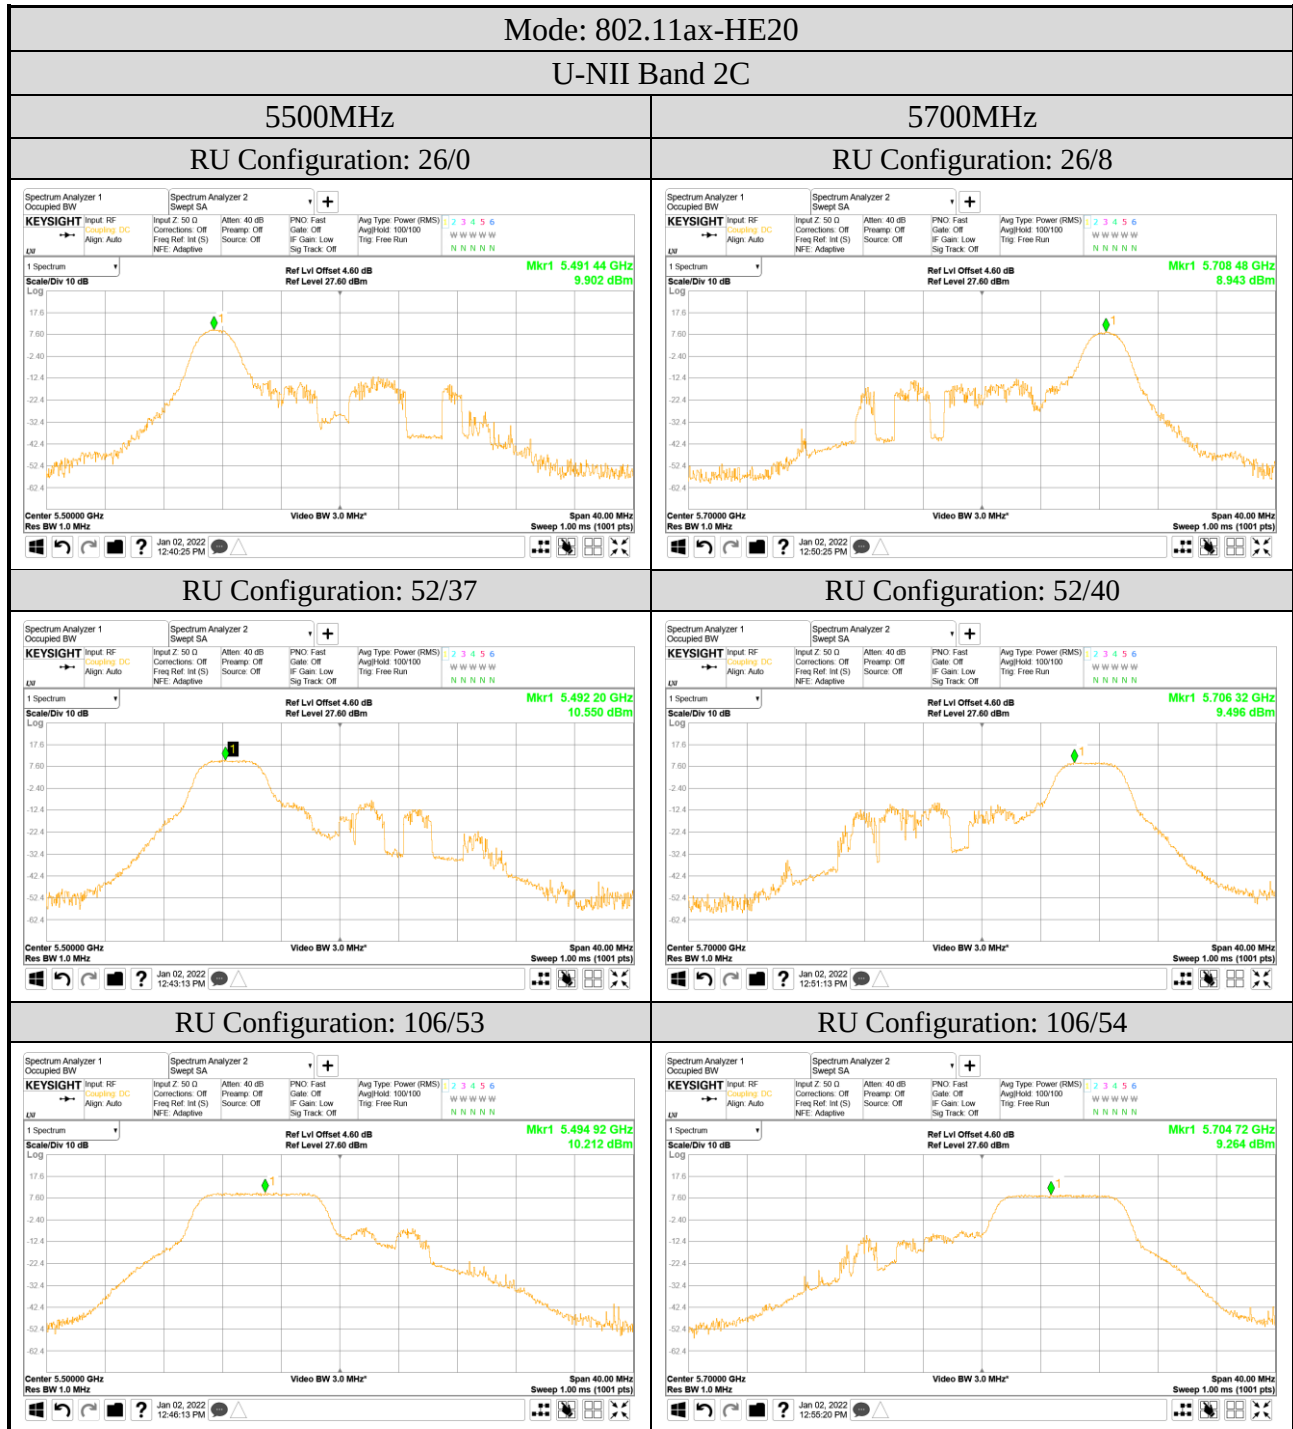

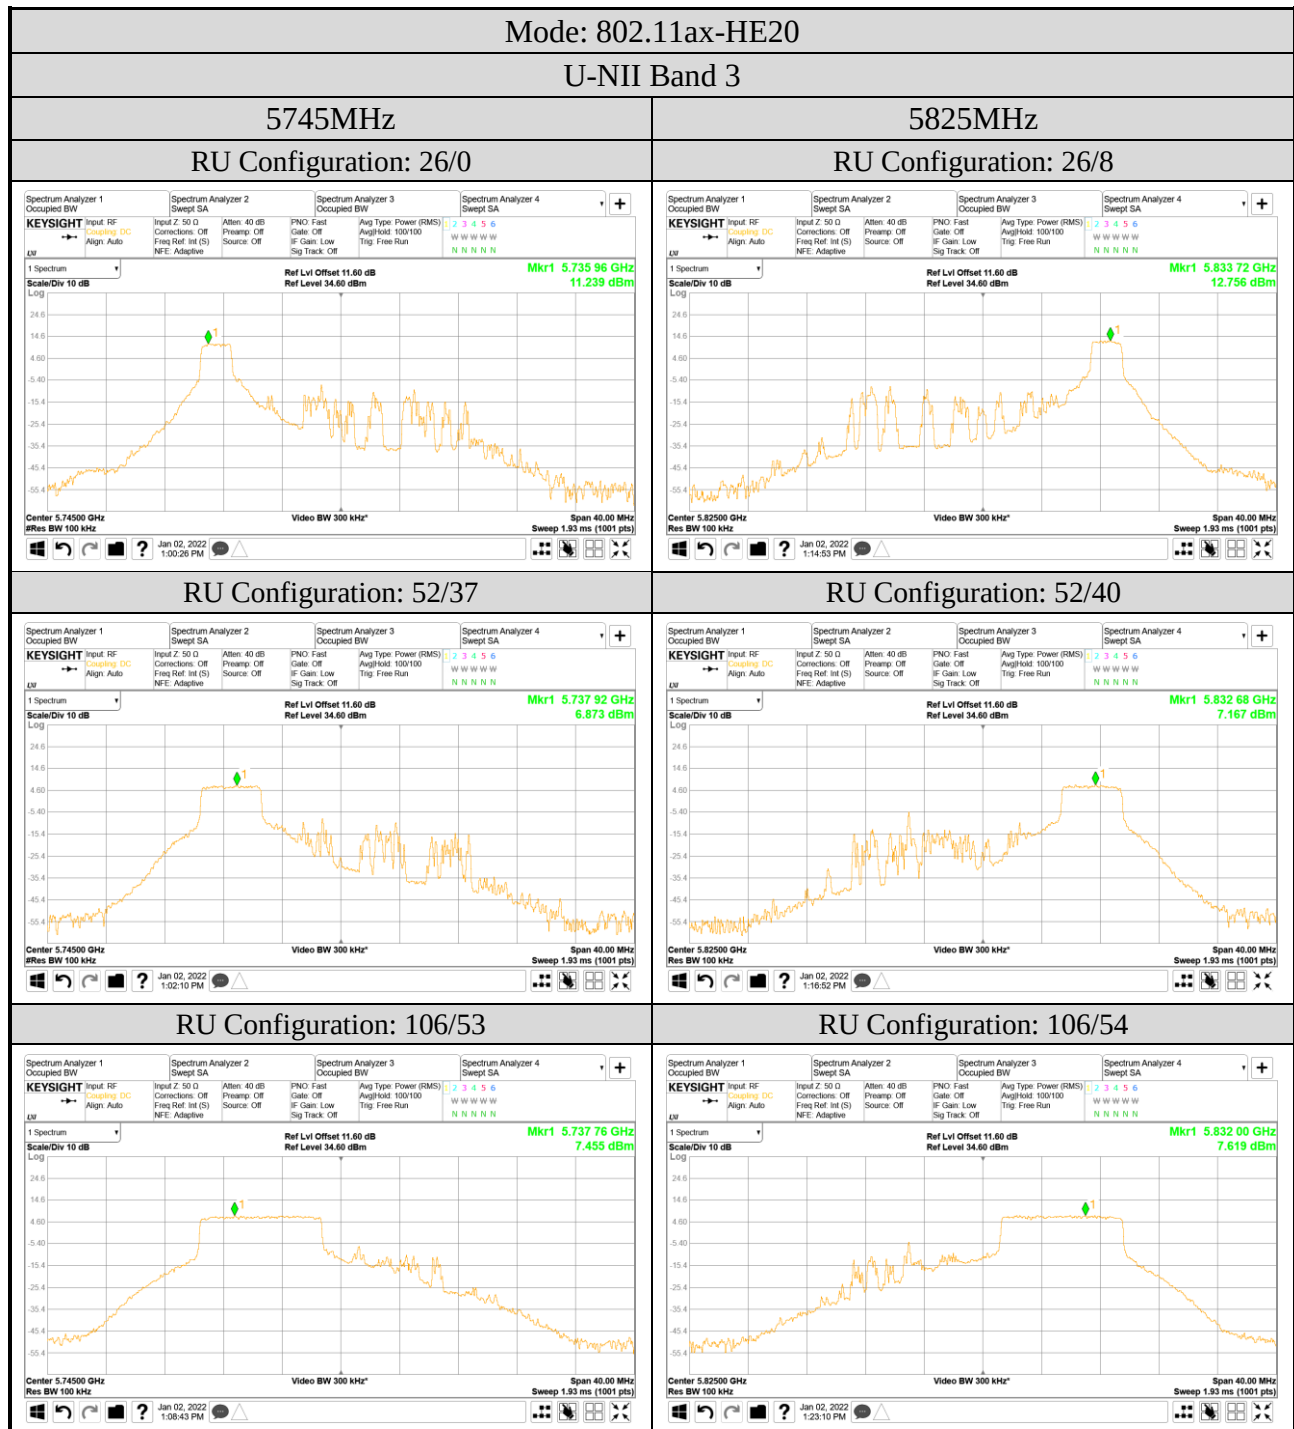


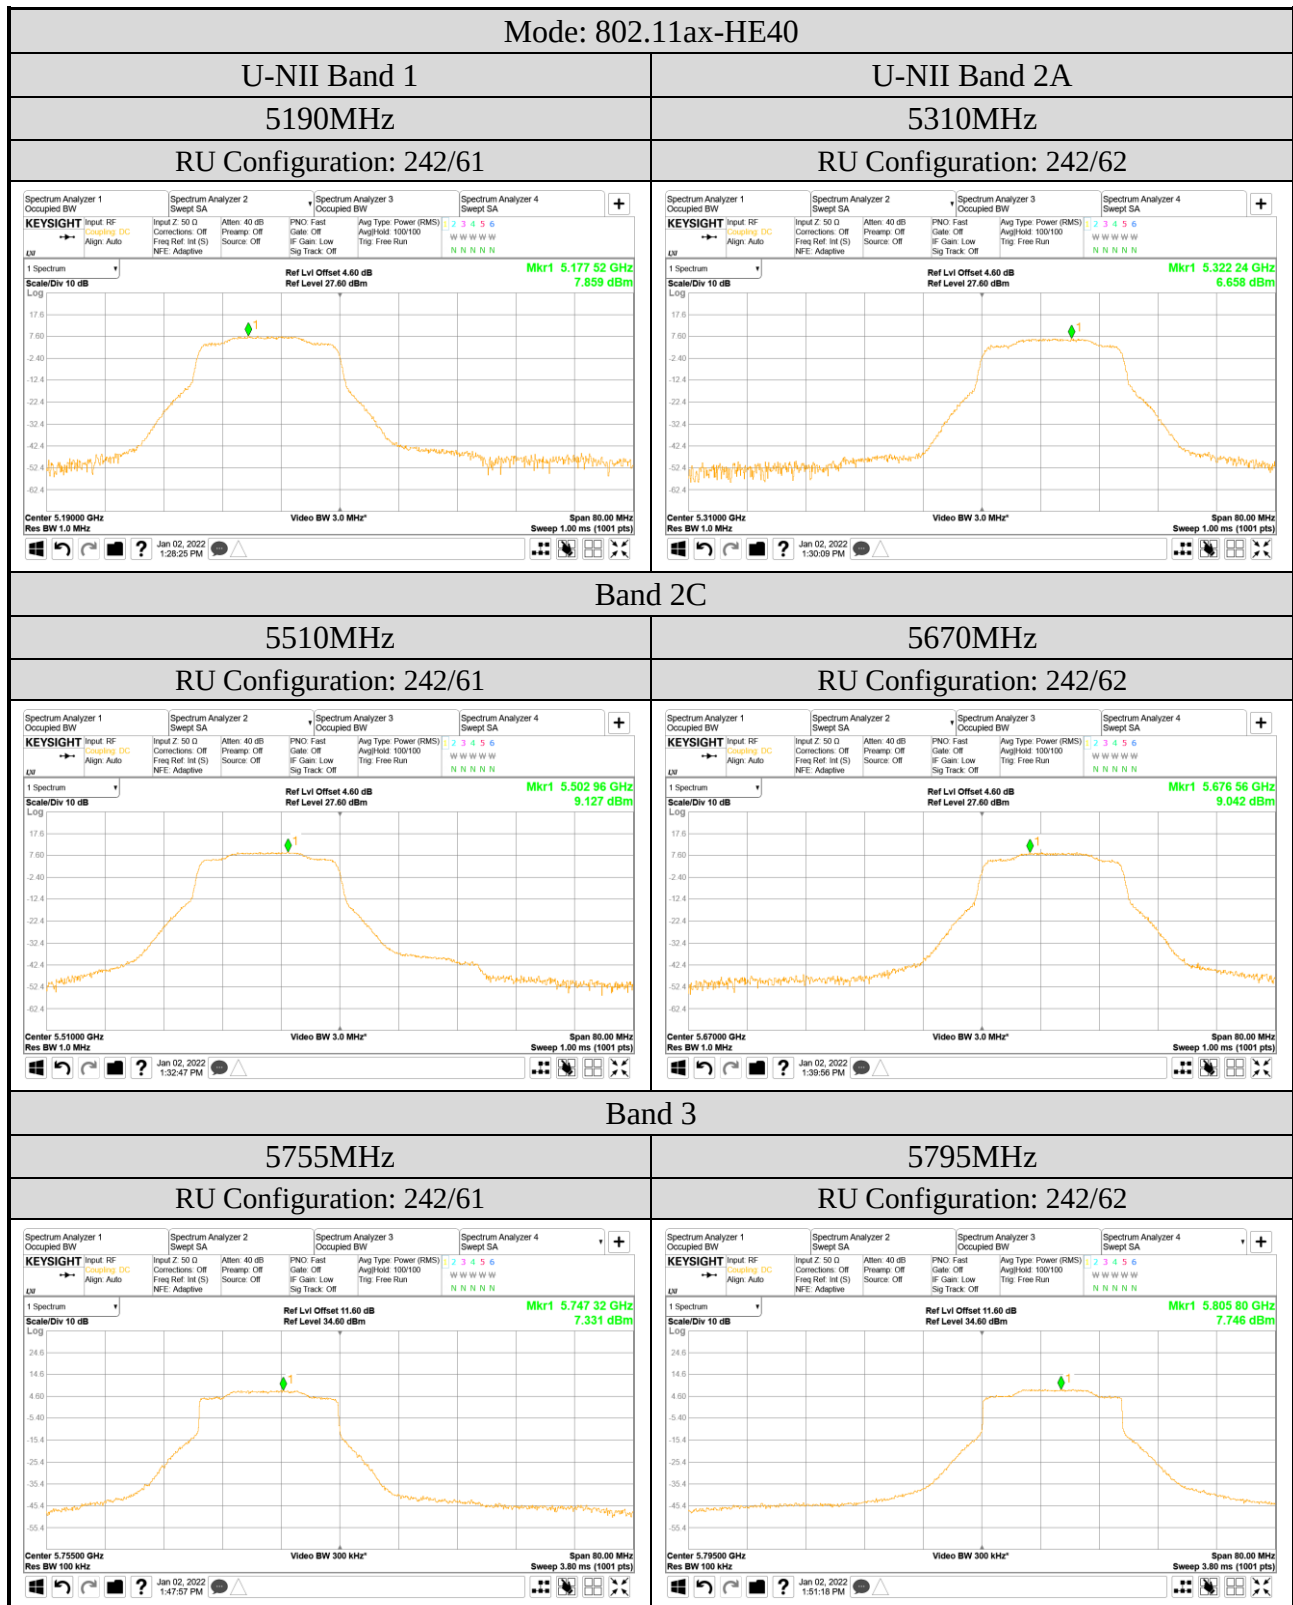

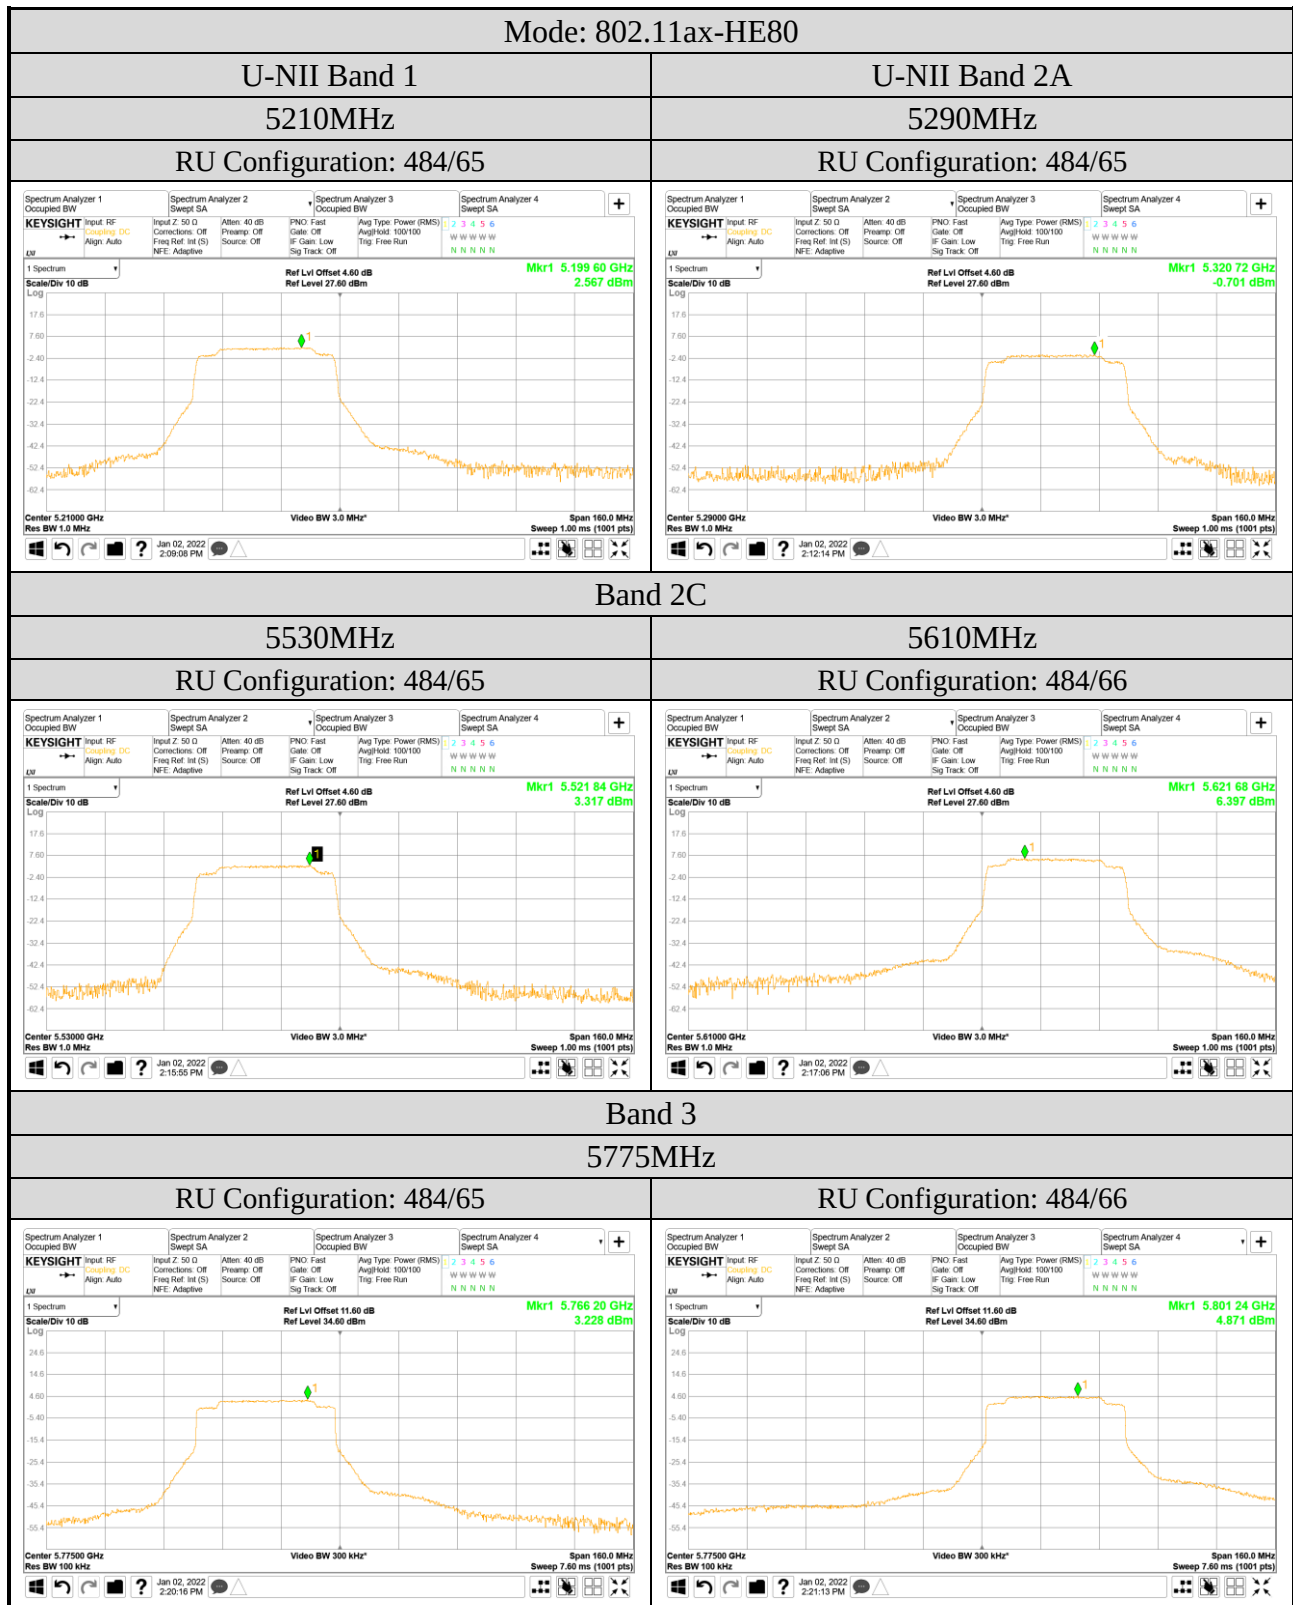

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

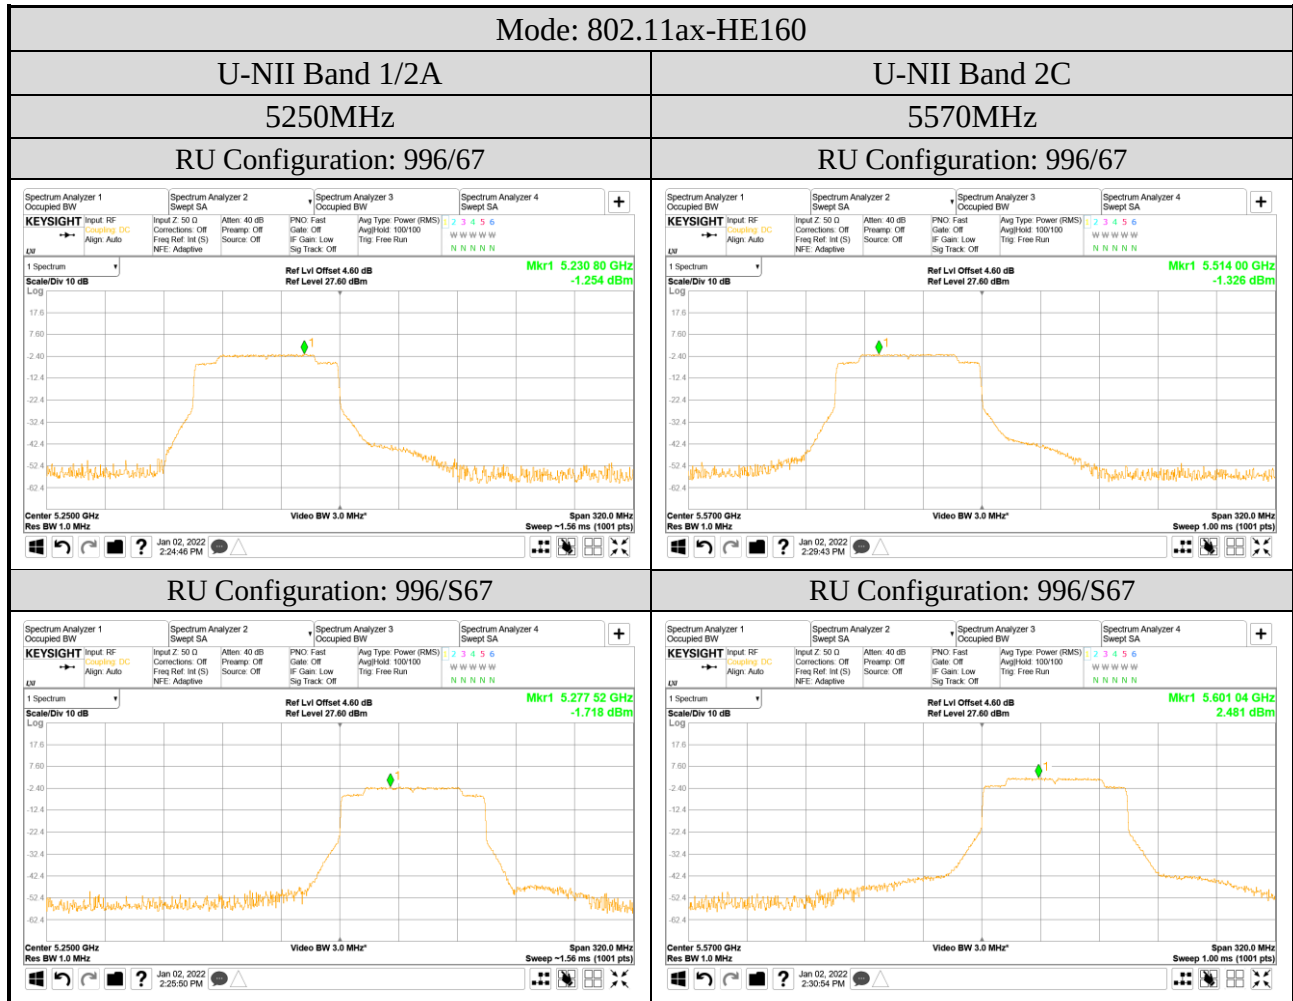

A.6 FREQUENCY STABILITY

Test Date	2022/01/10	Temp./Hum.	14°C/68%
Cable Loss	---	Tested By	Brian Hsieh
Test Voltage	AC 120V 60Hz (Via AC Adapter)		

A.6.1 Frequency stability Result

Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.015	2.896
-30	102		5179.977	-4.440
	138		5180.007	1.351
-20	102		5179.99	-1.931
	138		5179.995	-0.965
-10	102		5179.994	-1.158
	138		5180.025	4.826
0	102		5180.017	3.282
	138		5180.001	0.193
10	102		5179.977	-4.440
	138		5180.014	2.703
20	102		5179.982	-3.475
	138		5179.998	-0.386
30	102		5180.014	2.703
	138		5179.984	-3.089
40	102		5179.972	-5.405
	138		5180.01	1.931
50	102		5180.028	5.405
	138		5180.008	1.544