




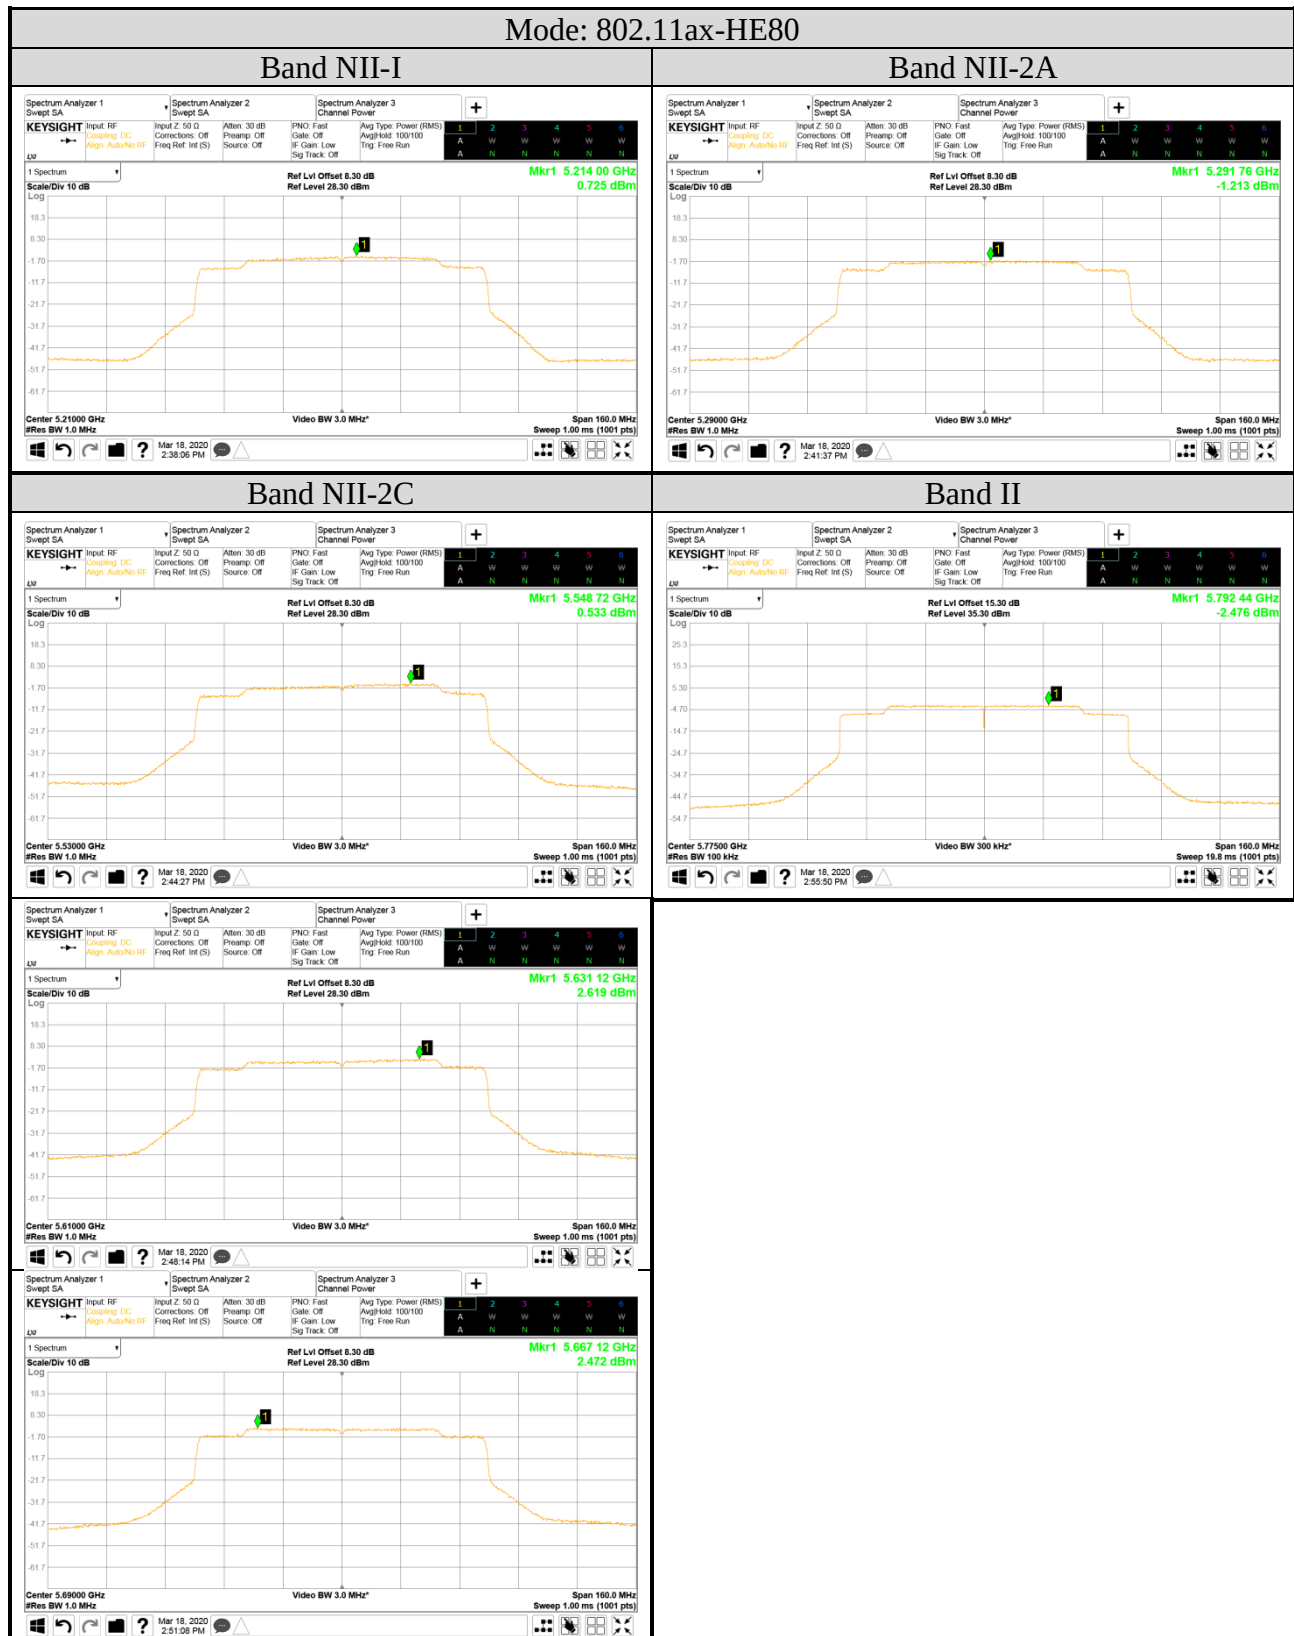



Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

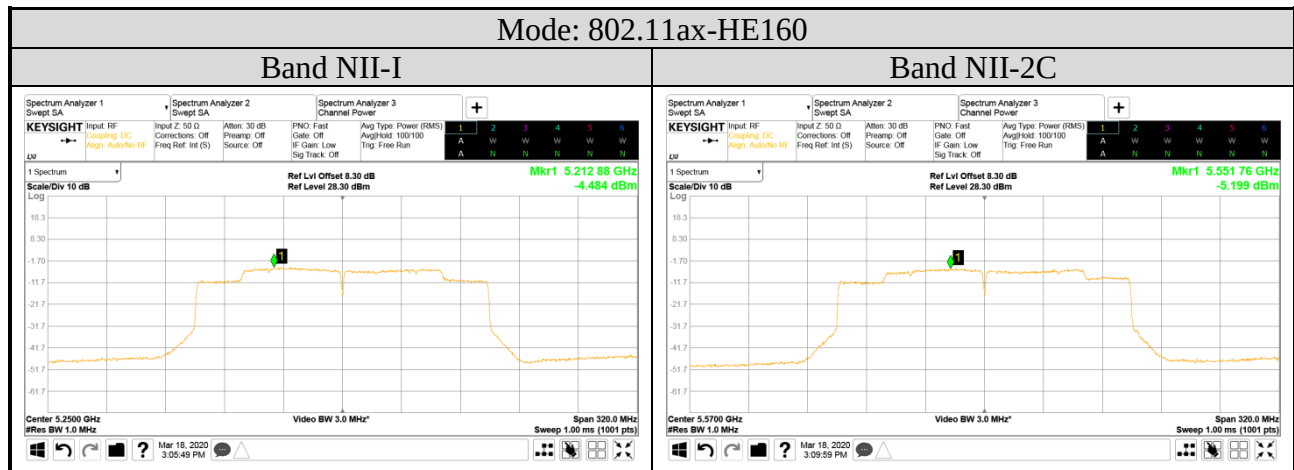

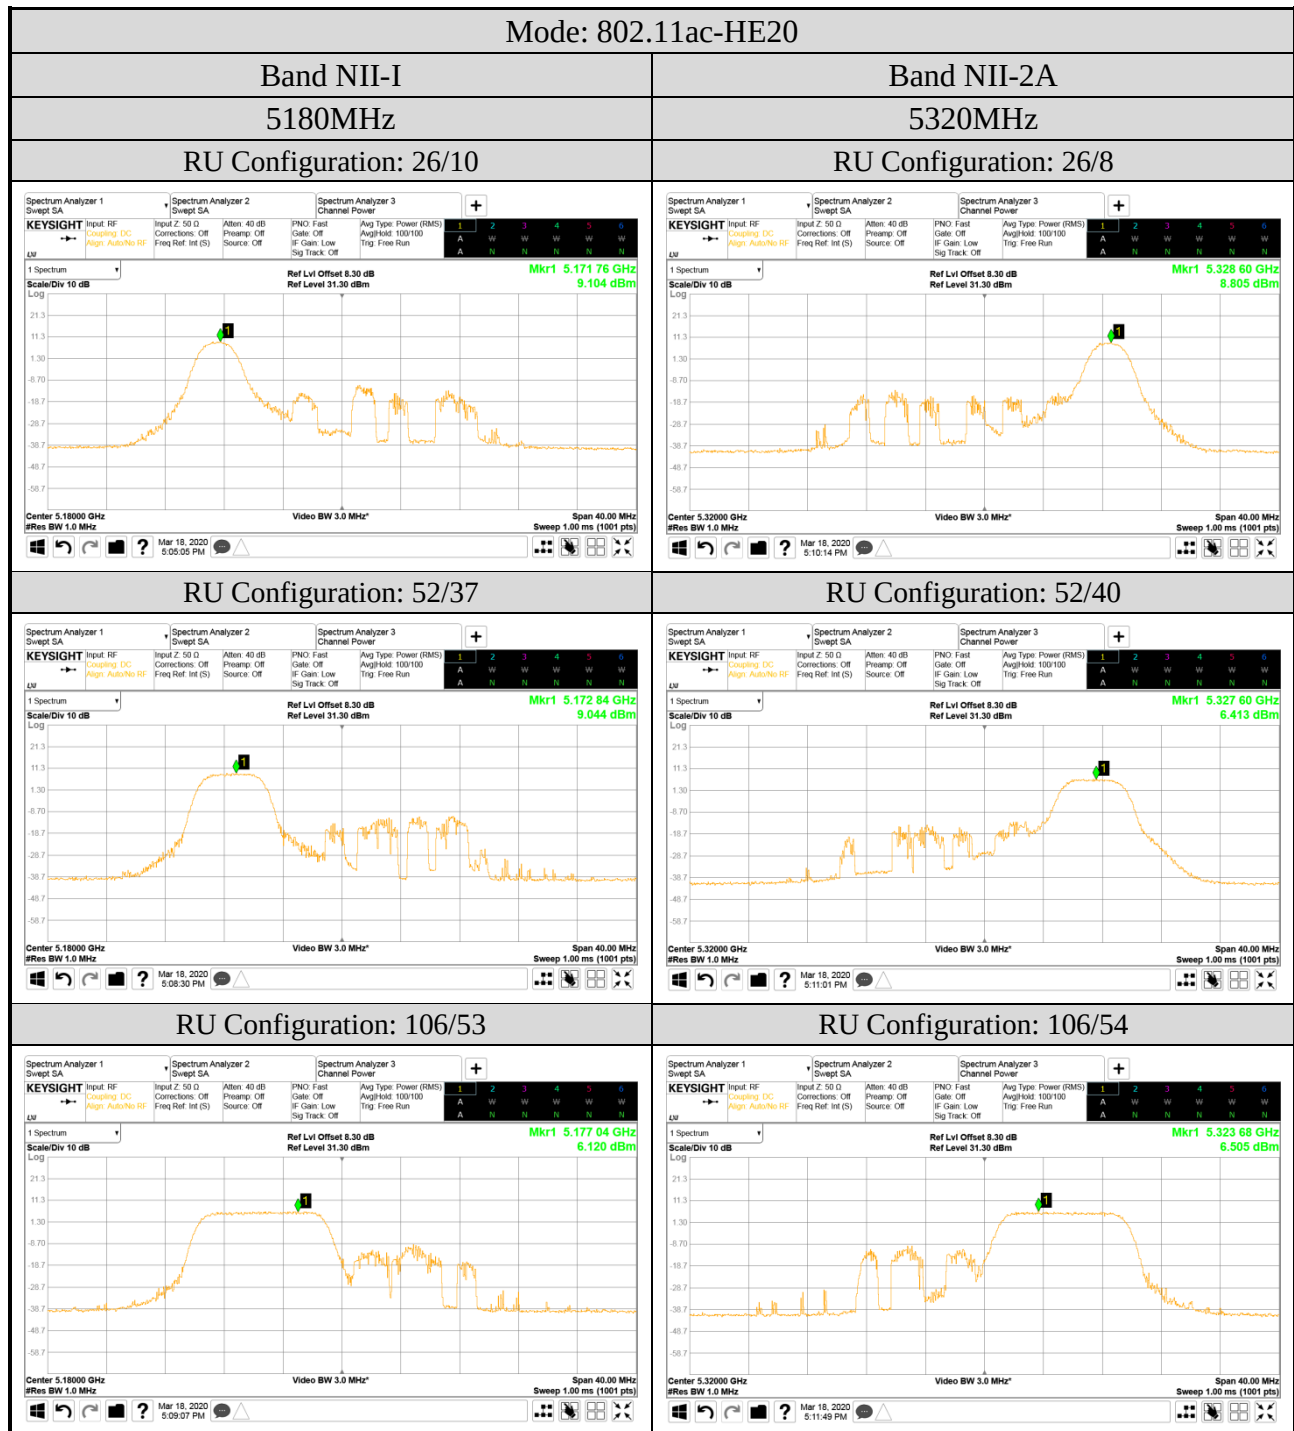


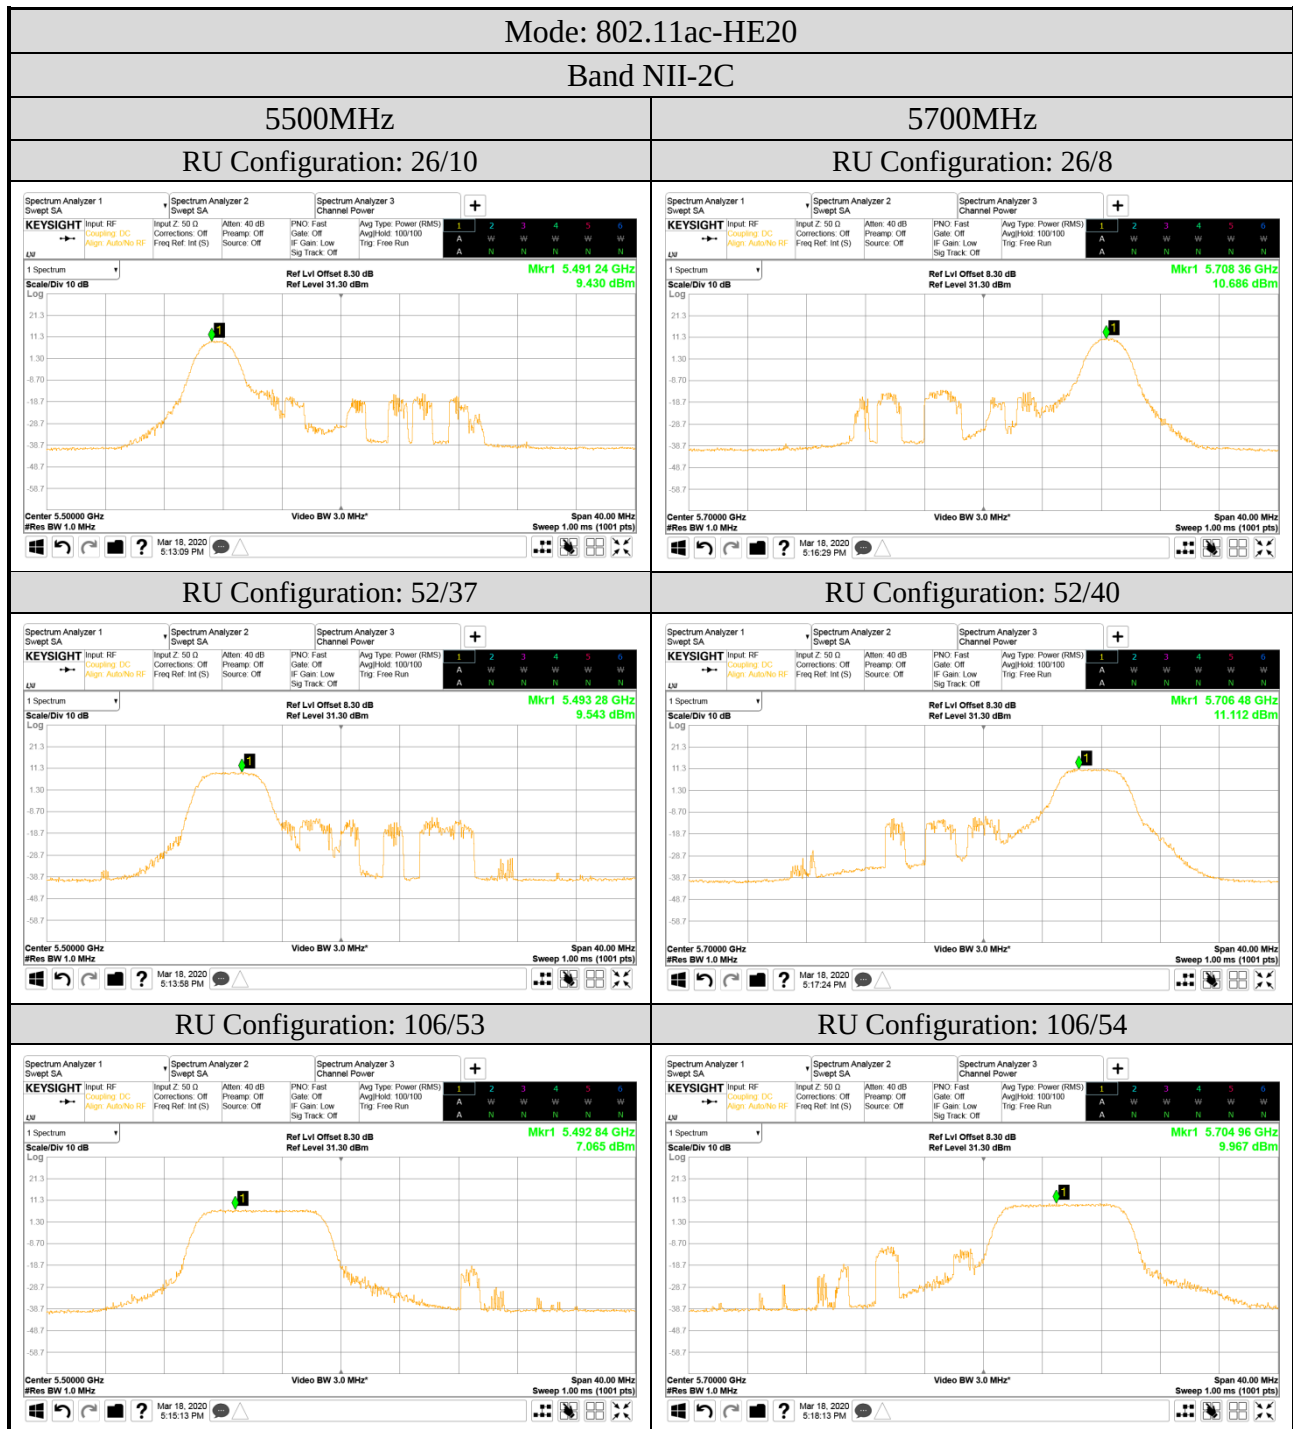

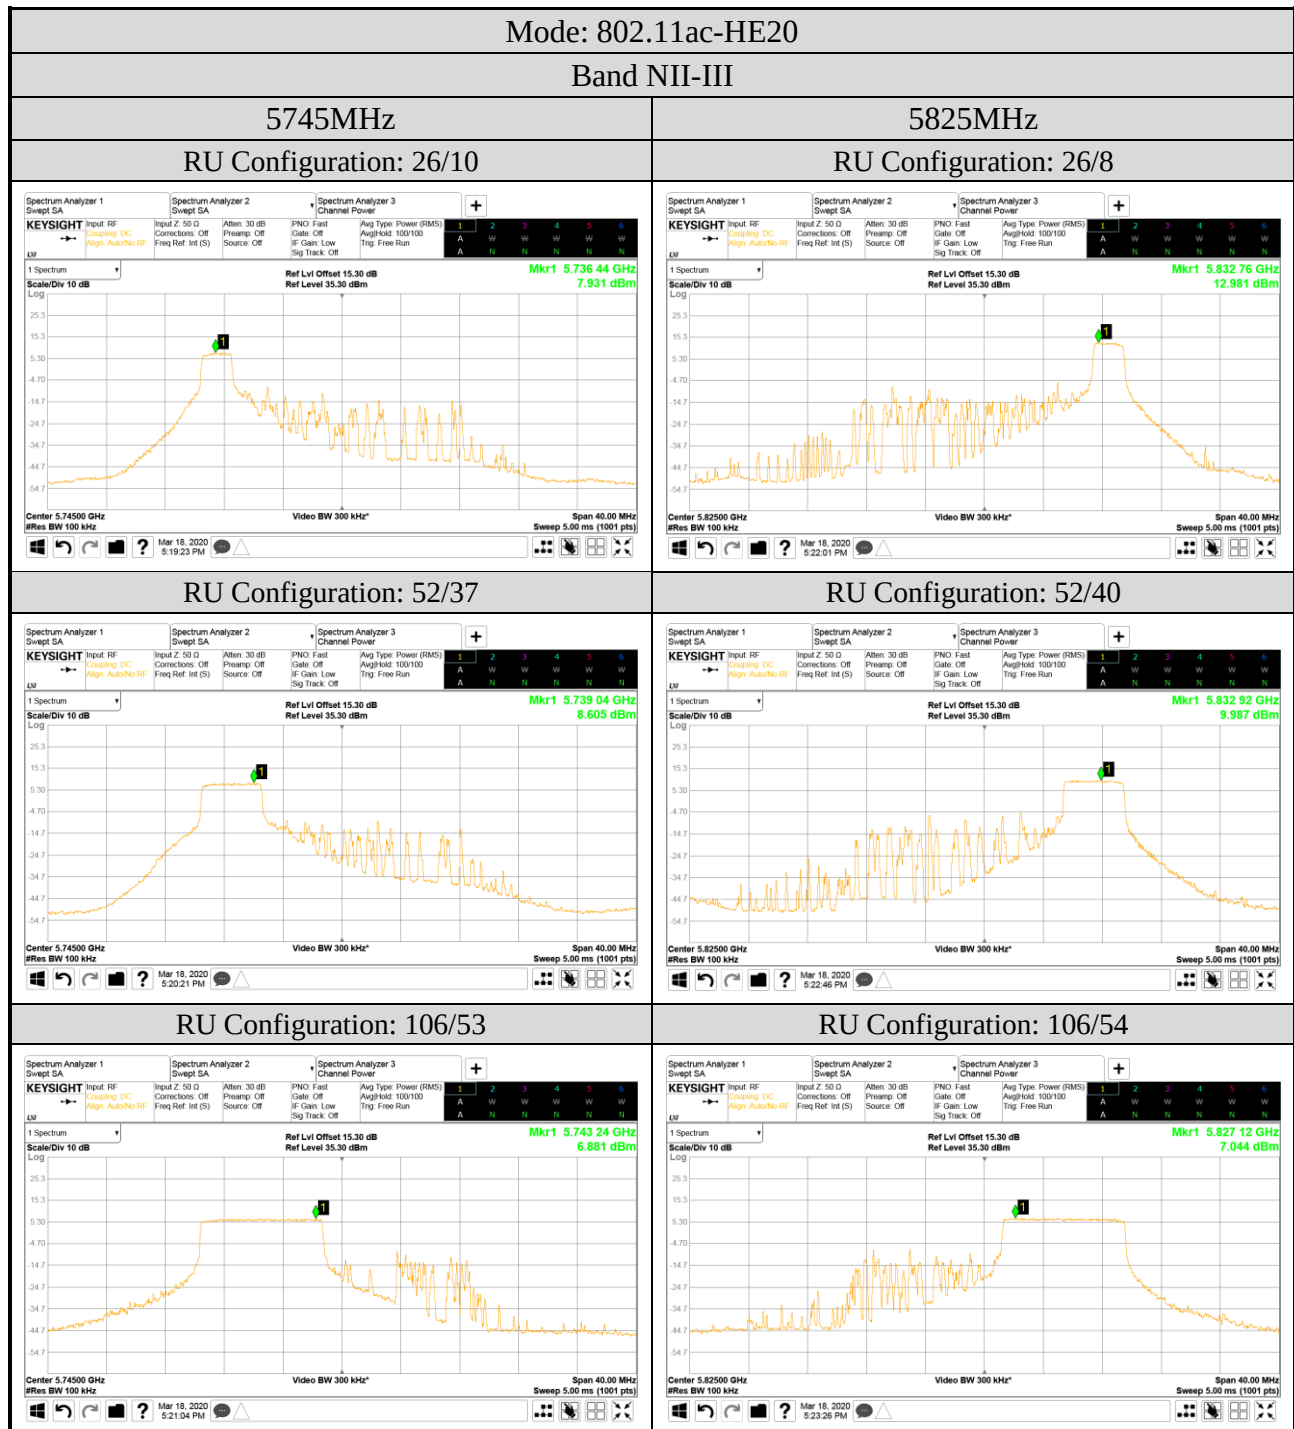


Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

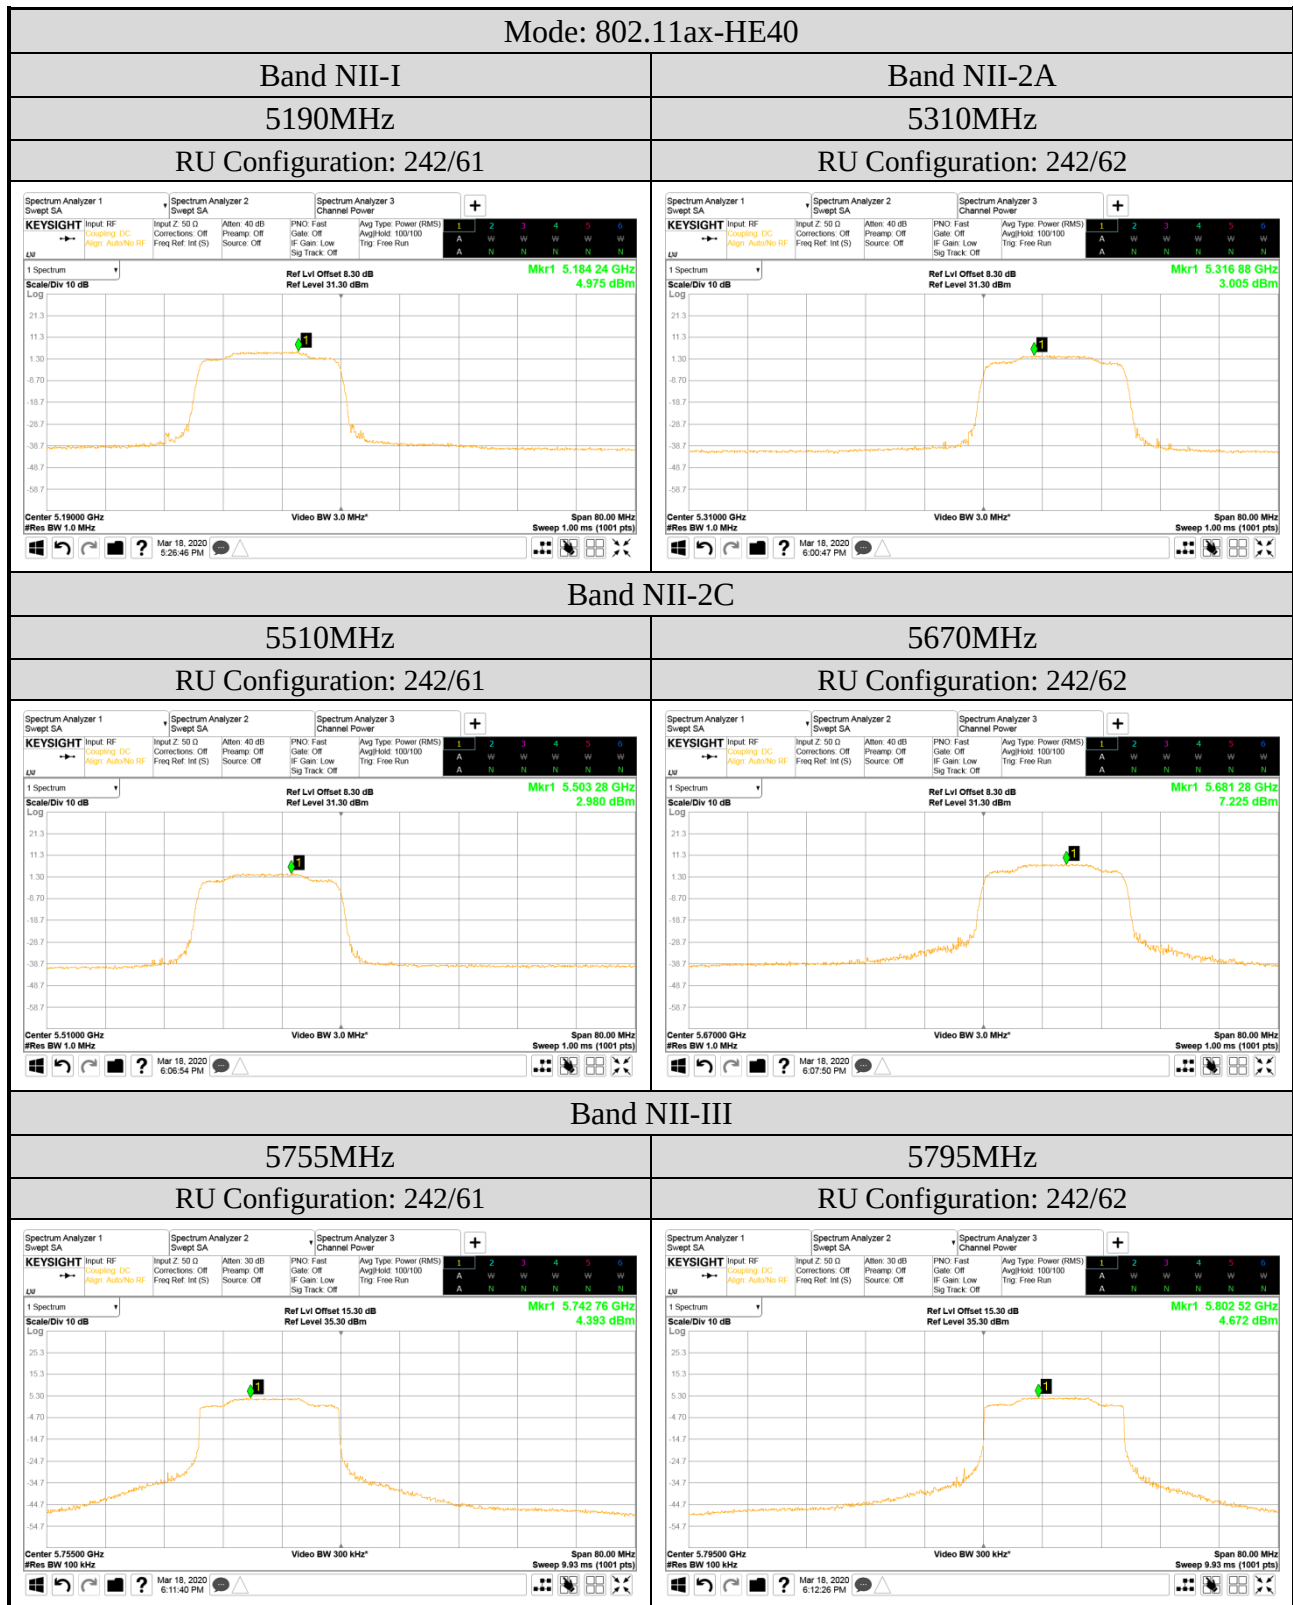


Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

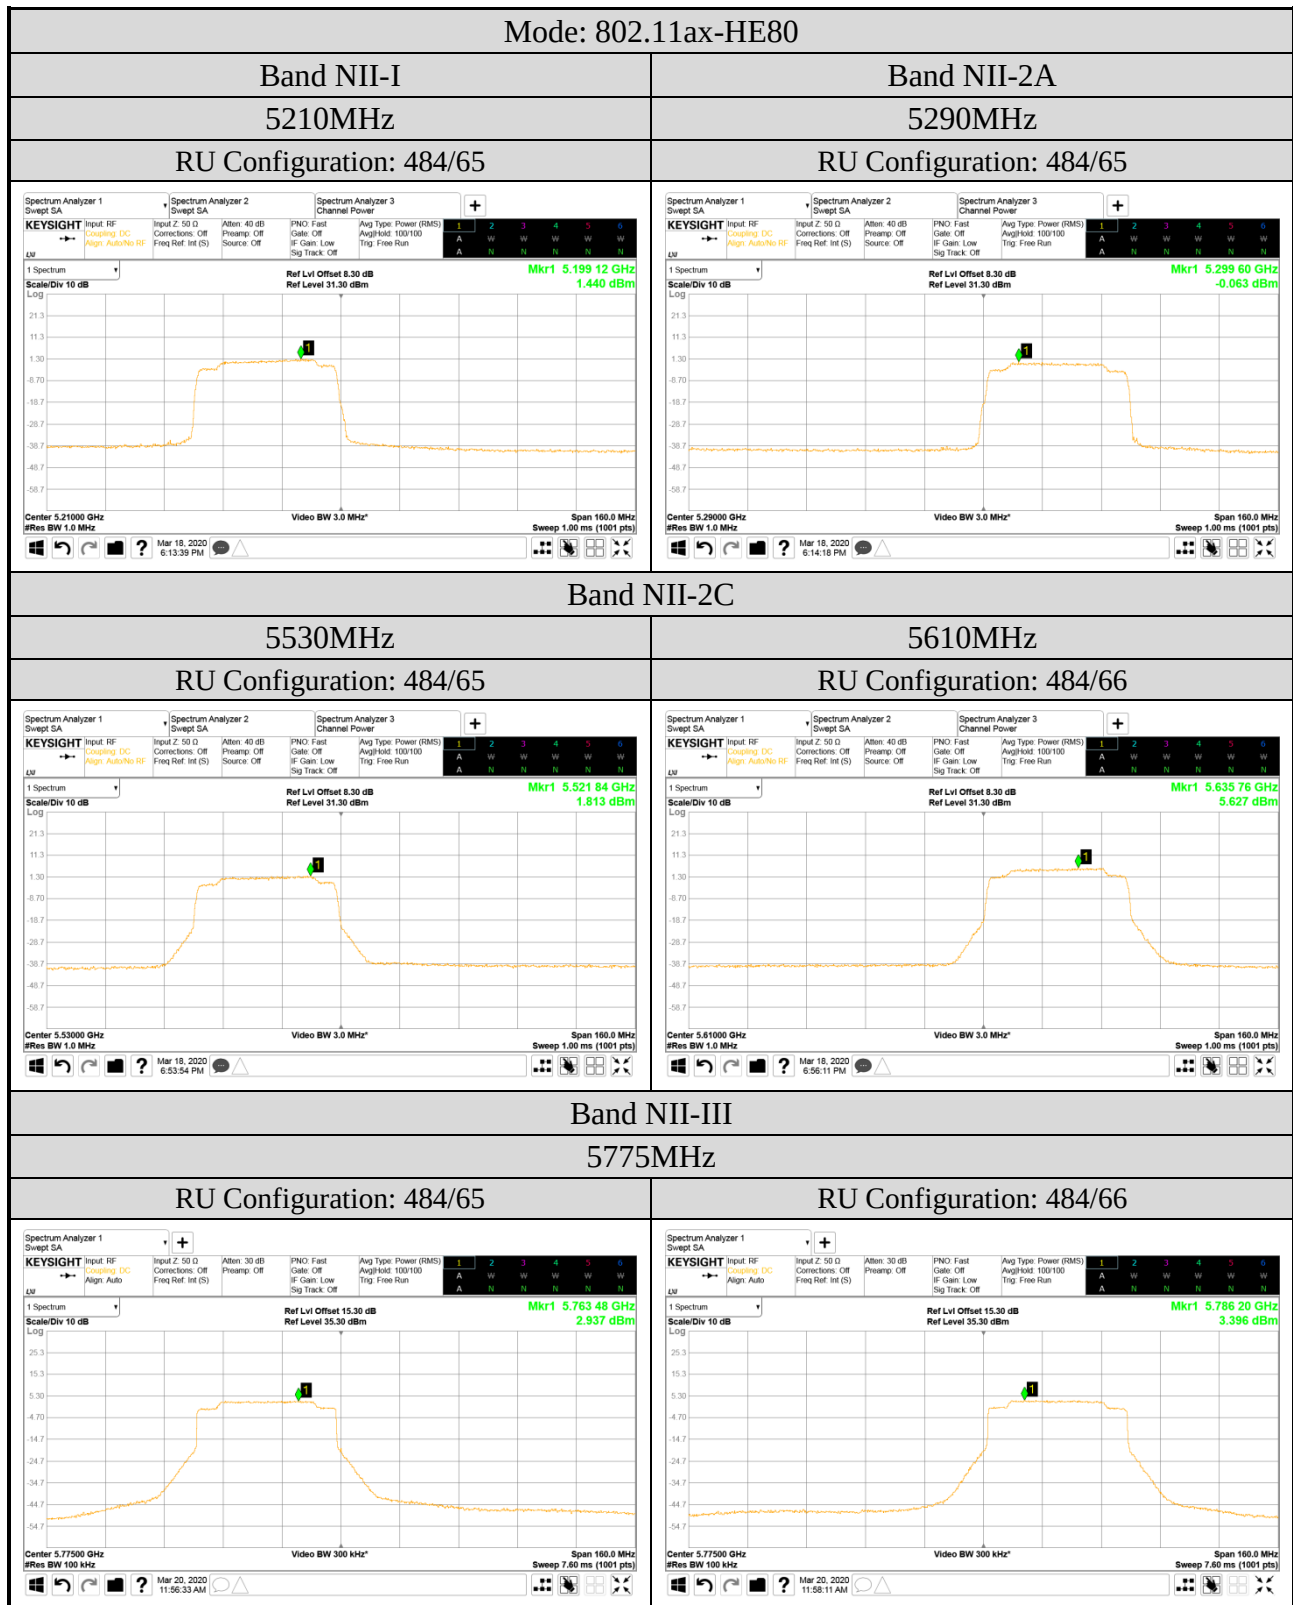

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

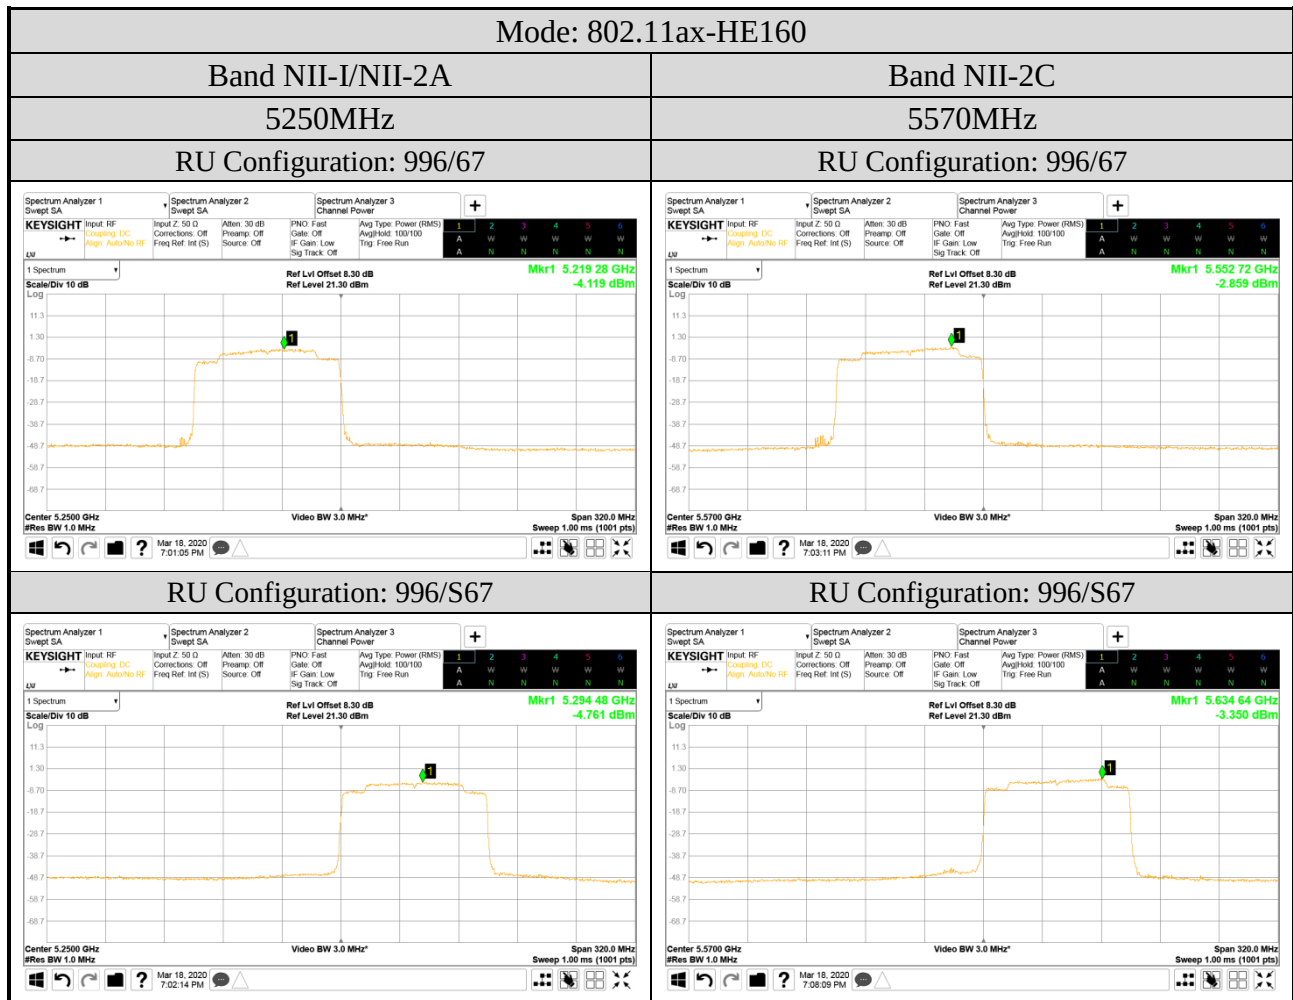

A.6 FREQUENCY STABILITY

Test Date	2020/03/18	Temp./Hum.	21°C/55%
Cable Loss	2.3dB	Tested By	Kuper Hsu
Test Voltage	AC 120V 60Hz (Via AC Adapter)	Test SKU	SKU #1

A.6.1 Frequency stability Result

Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.032	6.178
-30	102		5179.932	-13.127
	138		5179.969	-5.985
-20	102		5179.997	-0.579
	138		5179.955	-8.687
-10	102		5179.984	-3.089
	138		5180.011	2.124
0	102		5179.96	-7.722
	138		5179.995	-0.965
10	102		5180.019	3.668
	138		5179.976	-4.633
20	102		5180.014	2.703
	138		5180.037	7.143
30	102		5179.991	-1.737
	138		5180.028	5.405
40	102		5180.046	8.880
	138		5180.004	0.772
50	102		5180.035	6.757
	138		5180.062	11.969



Audix Technology Corp.

No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301

Fax: +886 2 26099303

APPDNDIX B

TEST PHOTOGRAPHS

(Model: 17U70N)