




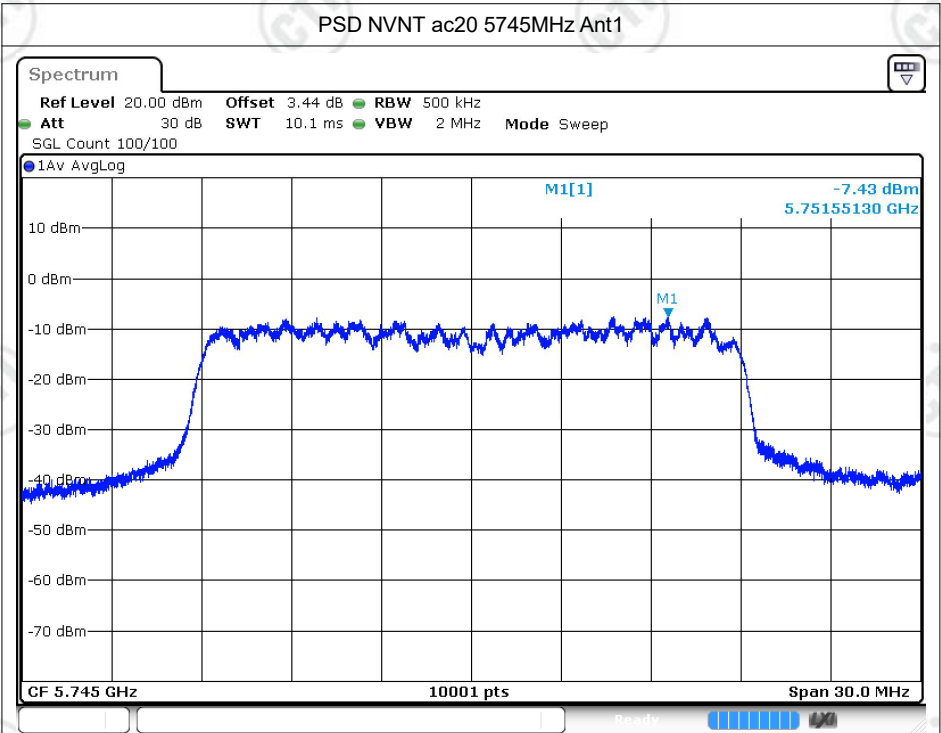


Date: 14.APR.2026 13:31:47

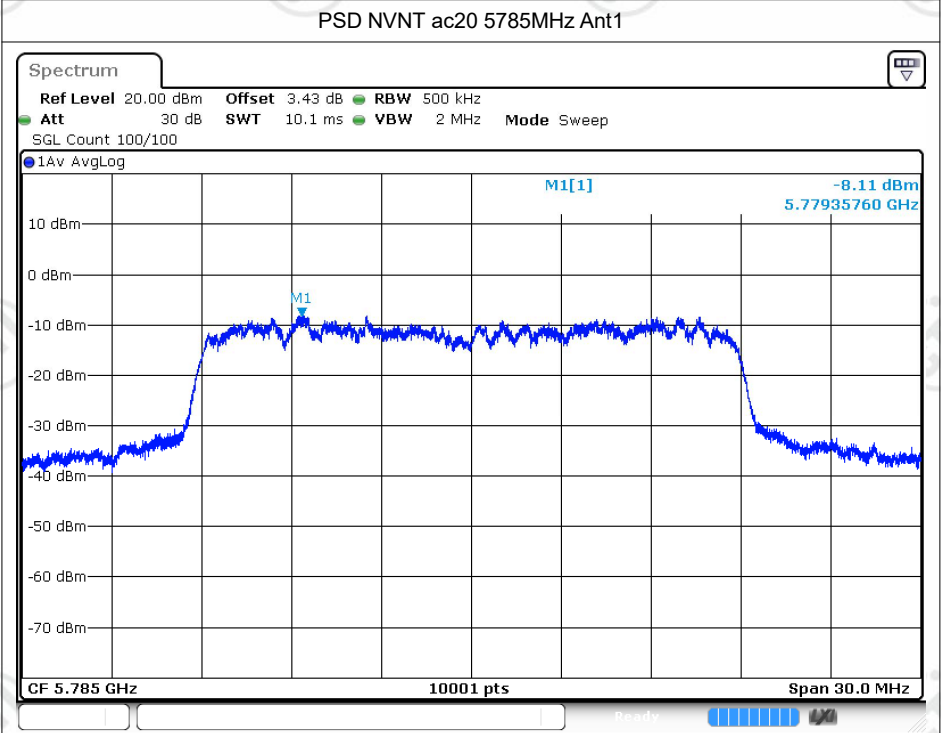


Date: 14.APR.2026 13:34:26

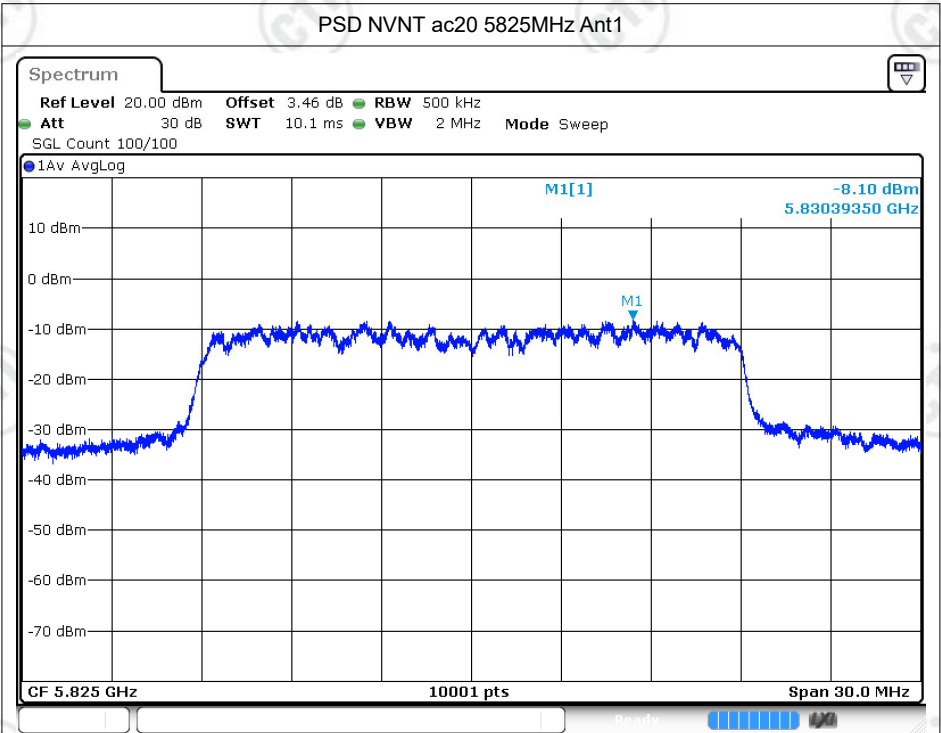

Date: 14.APR.2026 13:36:22

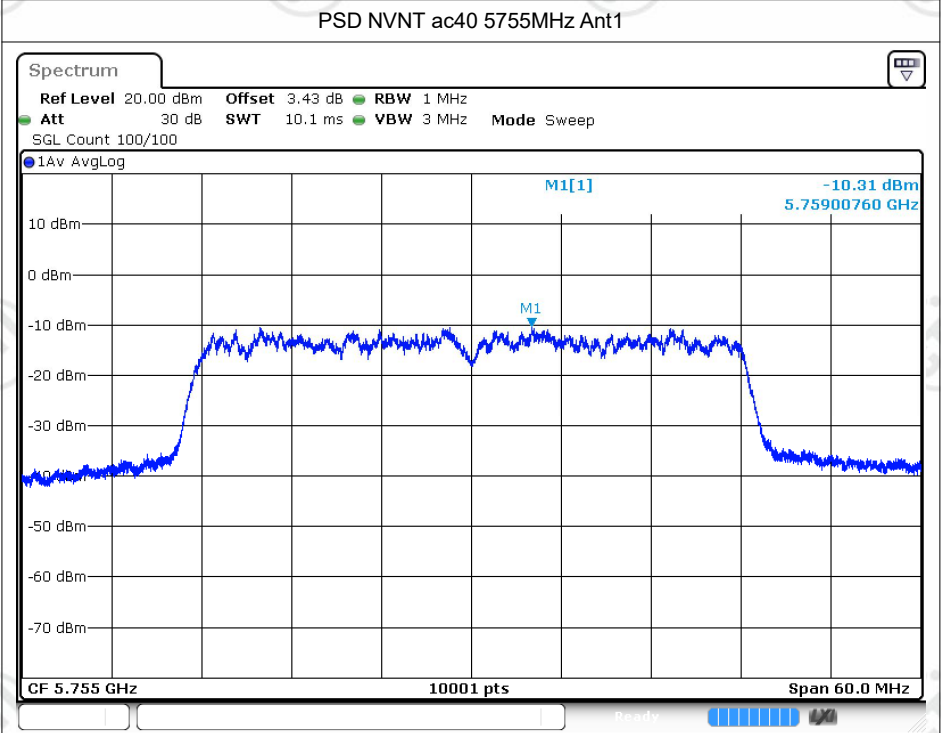

Date: 14.APR.2026 13:44:33

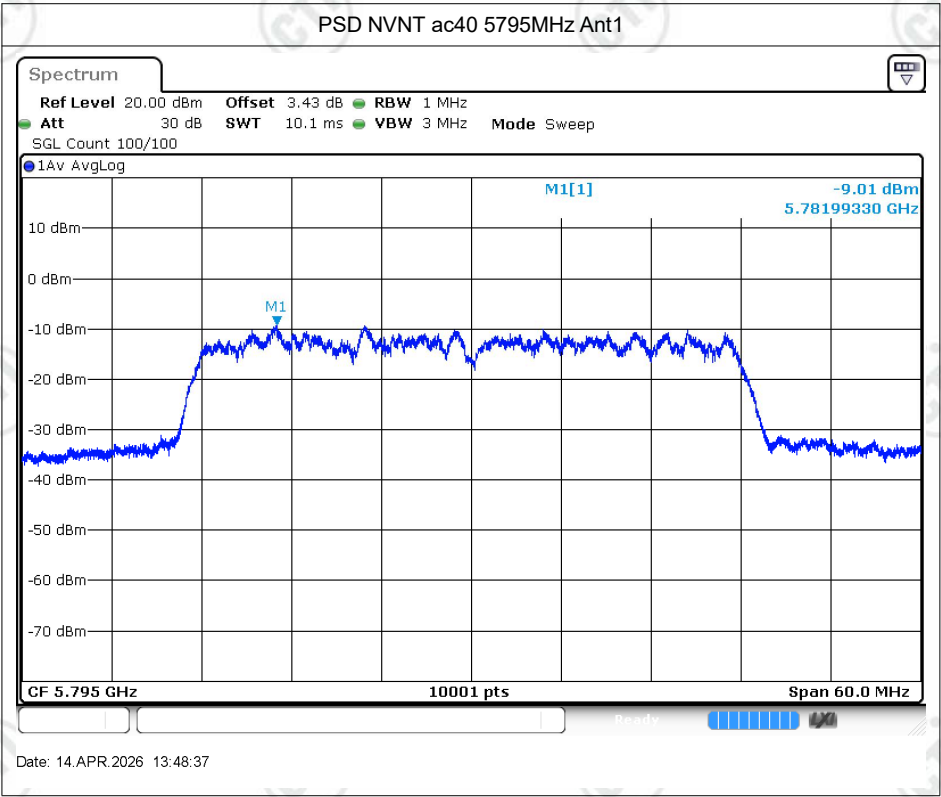


Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5745	Ant1	5745	0	0	25	Pass
20C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 138V	a	5745	Ant1	5745	0	0	25	Pass
-20C 120V	a	5745	Ant1	5745	0	0	25	Pass
-10C 120V	a	5745	Ant1	5745	0	0	25	Pass
0C 120V	a	5745	Ant1	5745	0	0	25	Pass
10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	a	5745	Ant1	5745	0	0	25	Pass
50C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 102V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	a	5785	Ant1	5785	0	0	25	Pass
10C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	a	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	5825	Ant1	5825	0	0	25	Pass
20C 138V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	a	5825	Ant1	5825	0	0	25	Pass
-10C 120V	a	5825	Ant1	5825	0	0	25	Pass
0C 120V	a	5825	Ant1	5825	0	0	25	Pass
10C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 120V	a	5825	Ant1	5825	0	0	25	Pass
40C 120V	a	5825	Ant1	5825	0	0	25	Pass
50C 120V	a	5825	Ant1	5825	0	0	25	Pass
20C 102V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass

10C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	n20	5745	Ant1	5745	0	0	25	Pass
40C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 102V	n20	5785	Ant1	5785	0	0	25	Pass
20C 120V	n20	5785	Ant1	5785	0	0	25	Pass
20C 138V	n20	5785	Ant1	5785	0	0	25	Pass
-20C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	n20	5785	Ant1	5785	0	0	25	Pass
0C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	5785	Ant1	5785	0	0	25	Pass
30C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	n20	5785	Ant1	5785	0	0	25	Pass
50C 120V	n20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 102V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	n20	5825	Ant1	5825	0	0	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
30C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 138V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
0C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass


30C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 102V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	ac20	5785	Ant1	5785	0	0	25	Pass
20C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	ac20	5785	Ant1	5785	0	0	25	Pass
0C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass

40C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass

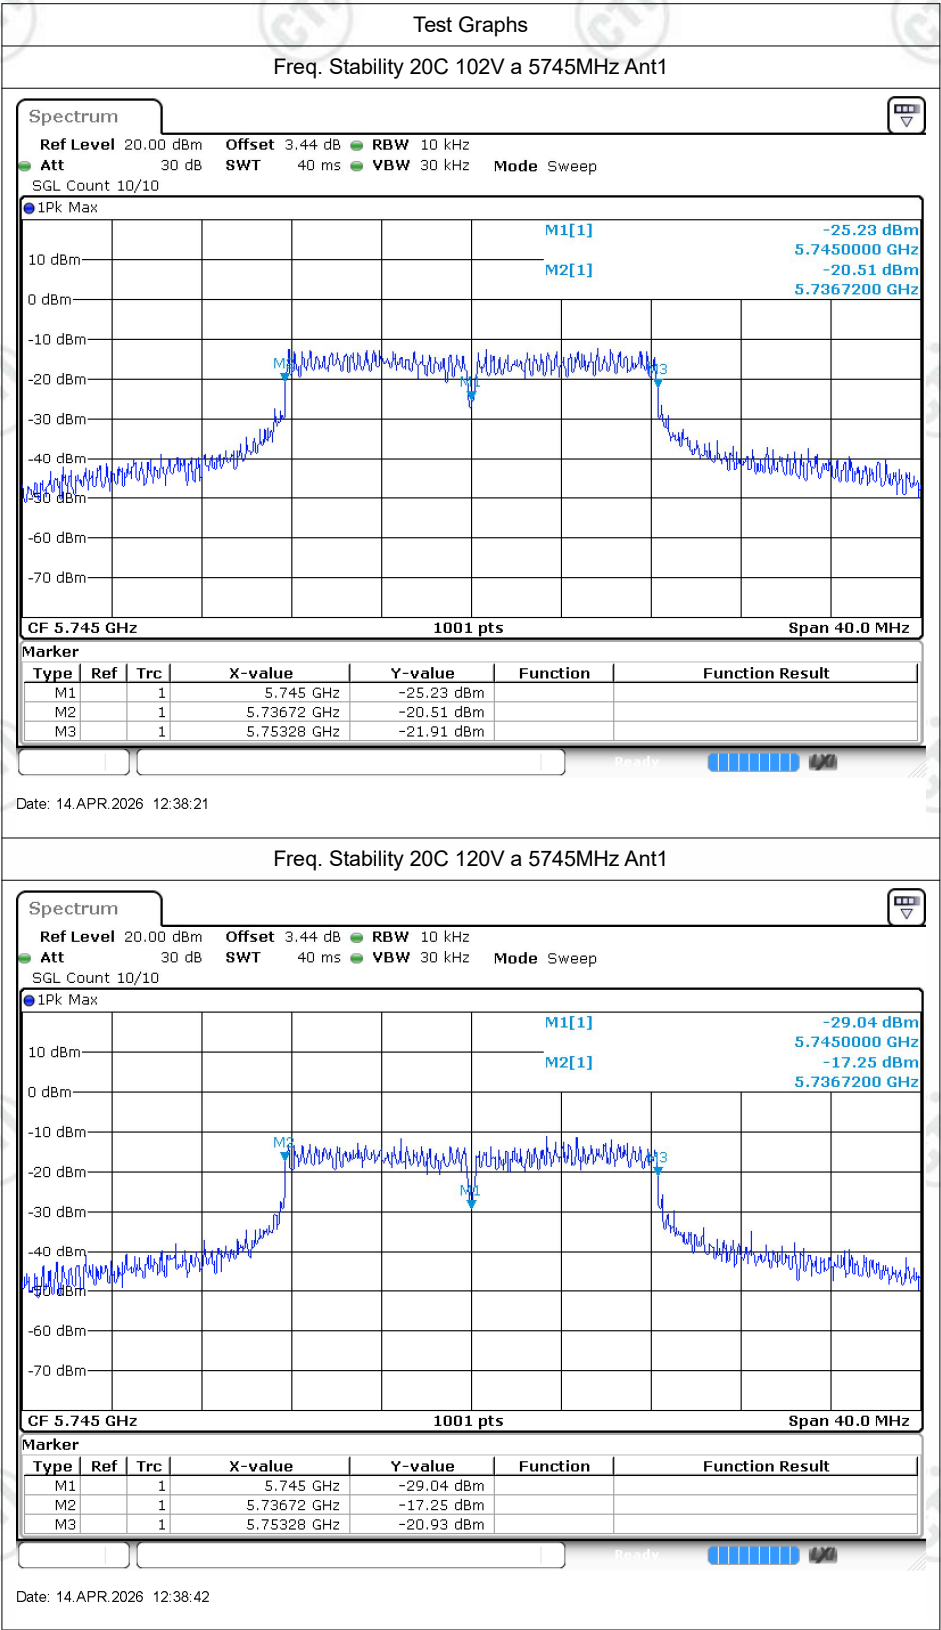


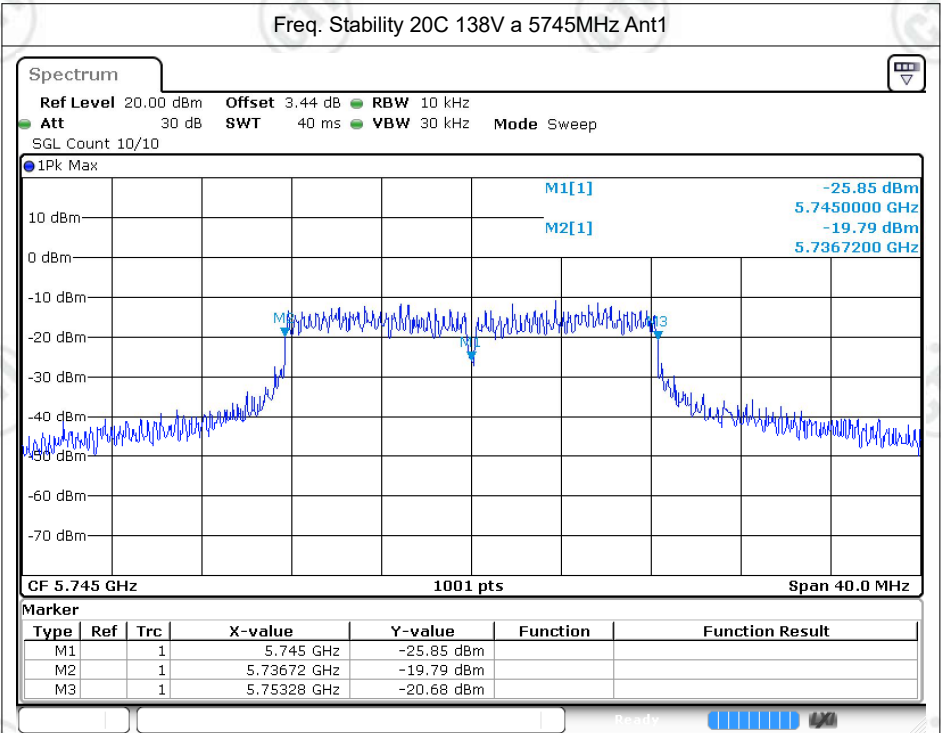


Date: 14.APR.2026 12:38:27

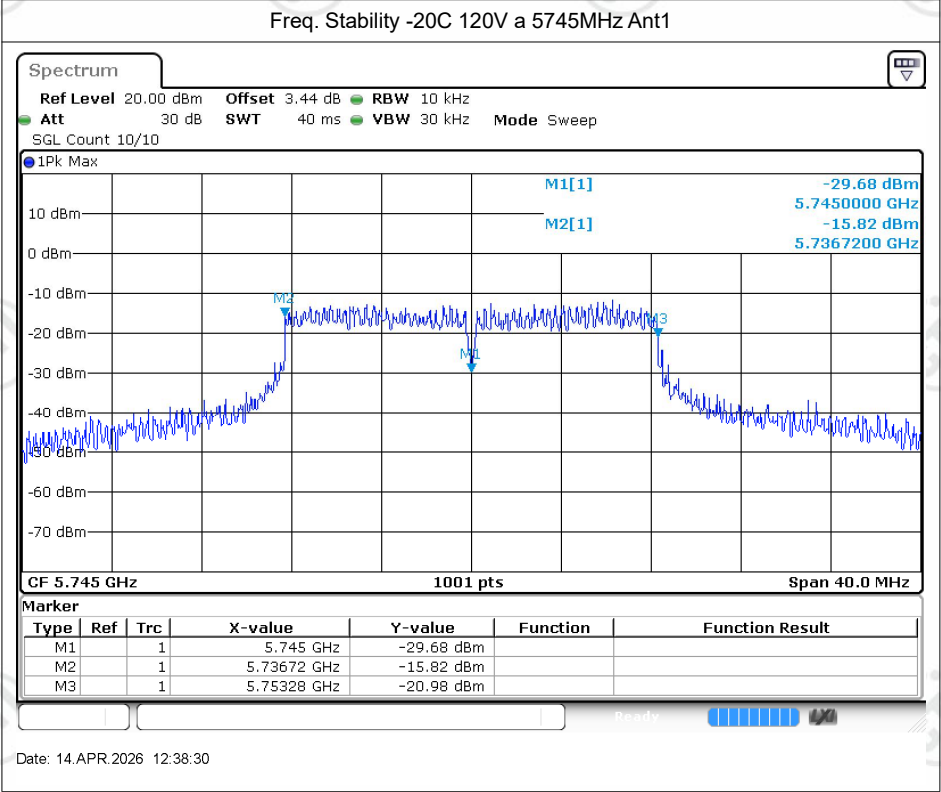


Date: 14.APR.2026 12:38:30

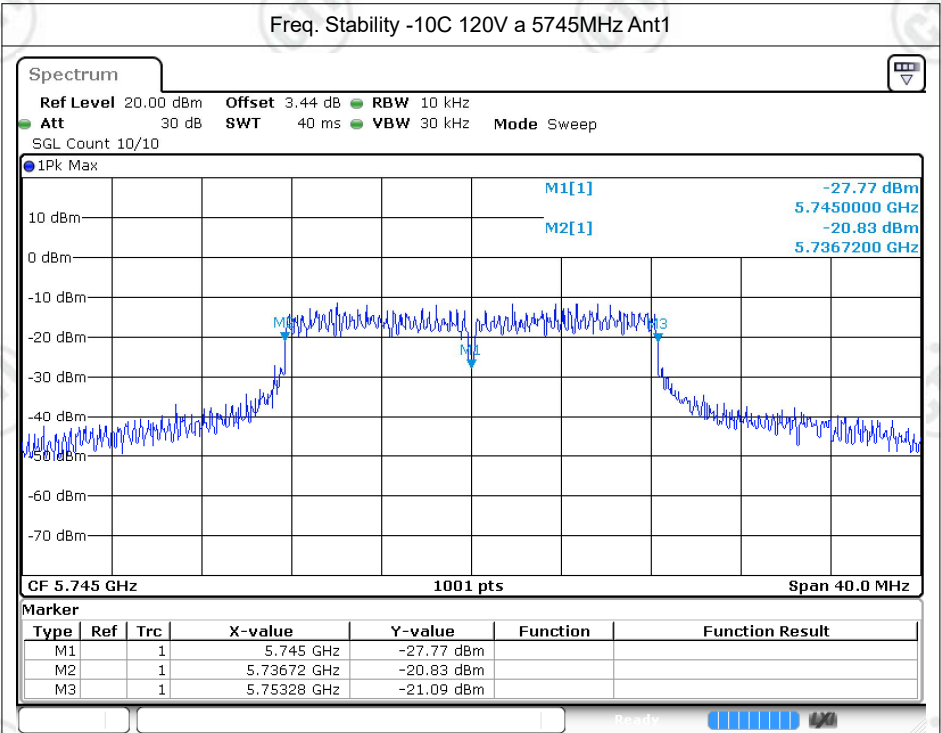


Date: 14.APR.2026 12:38:33

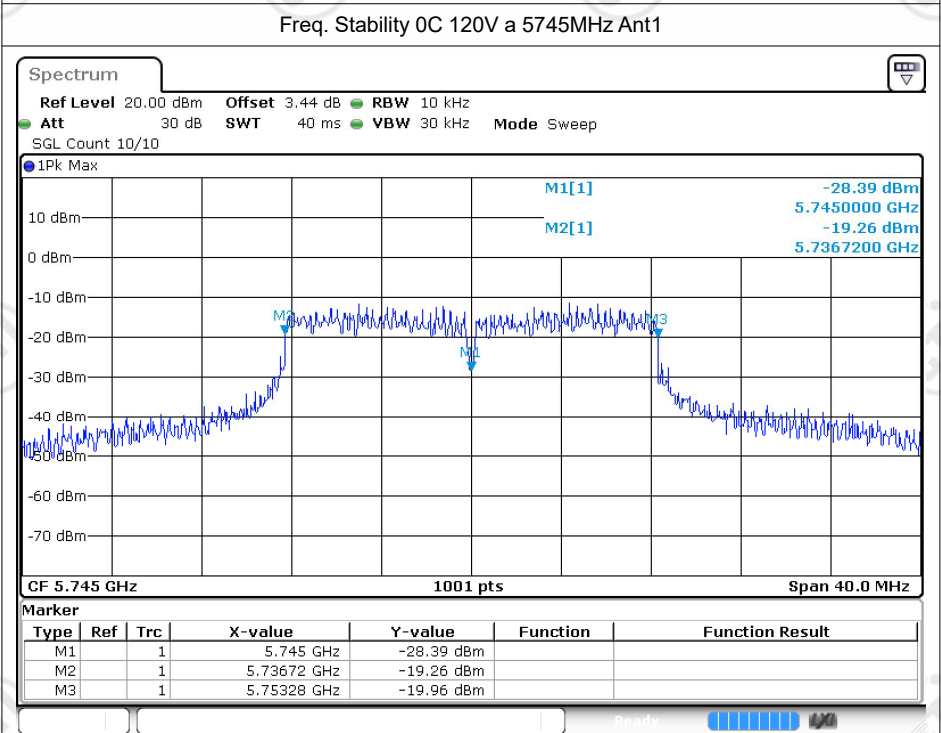


Date: 14.APR.2026 12:38:36

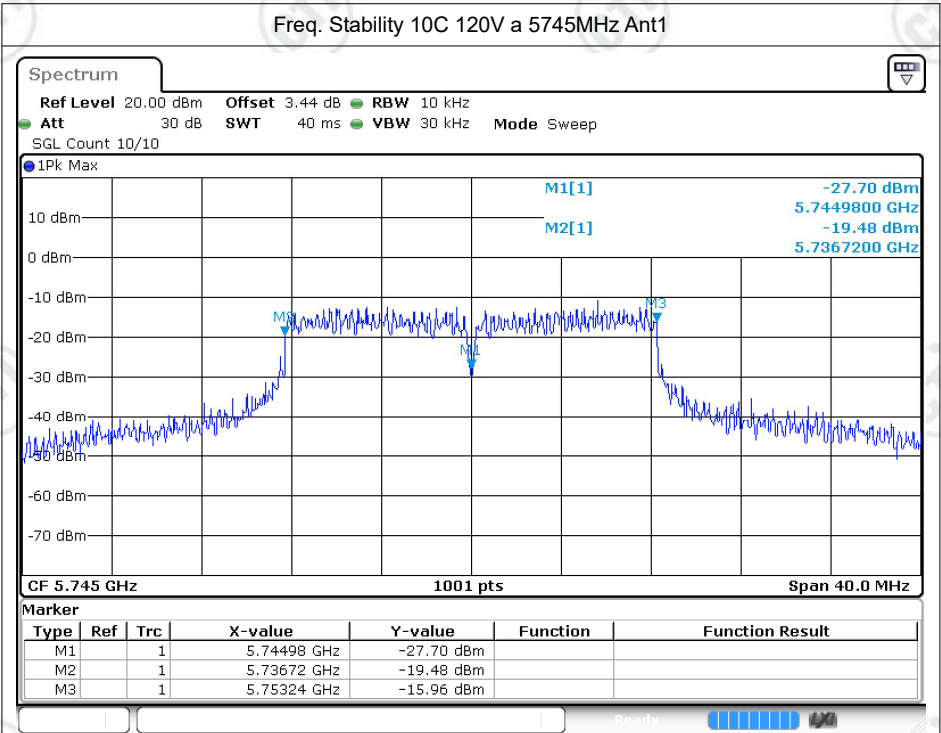


Date: 14.APR.2026 12:38:39

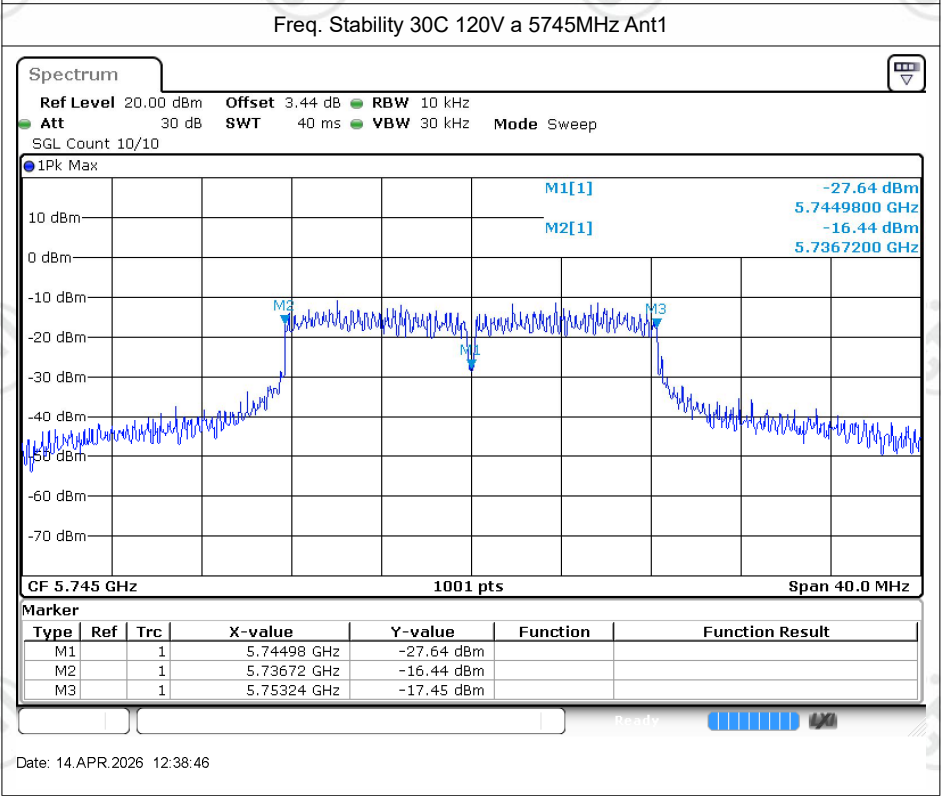


Date: 14.APR.2026 12:38:46

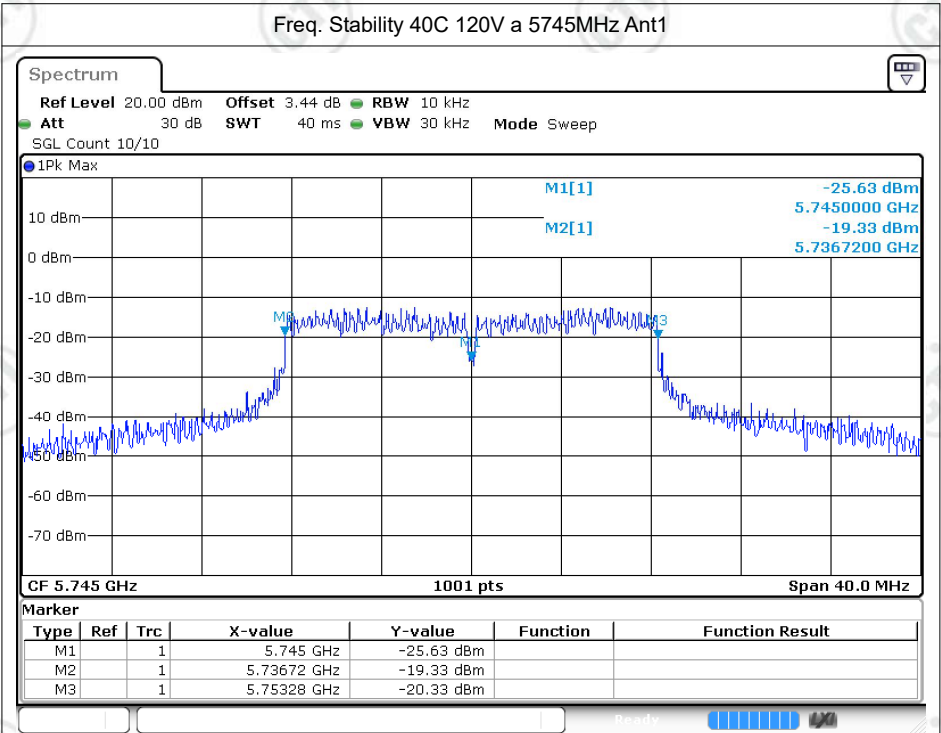


Date: 14.APR.2026 12:38:49

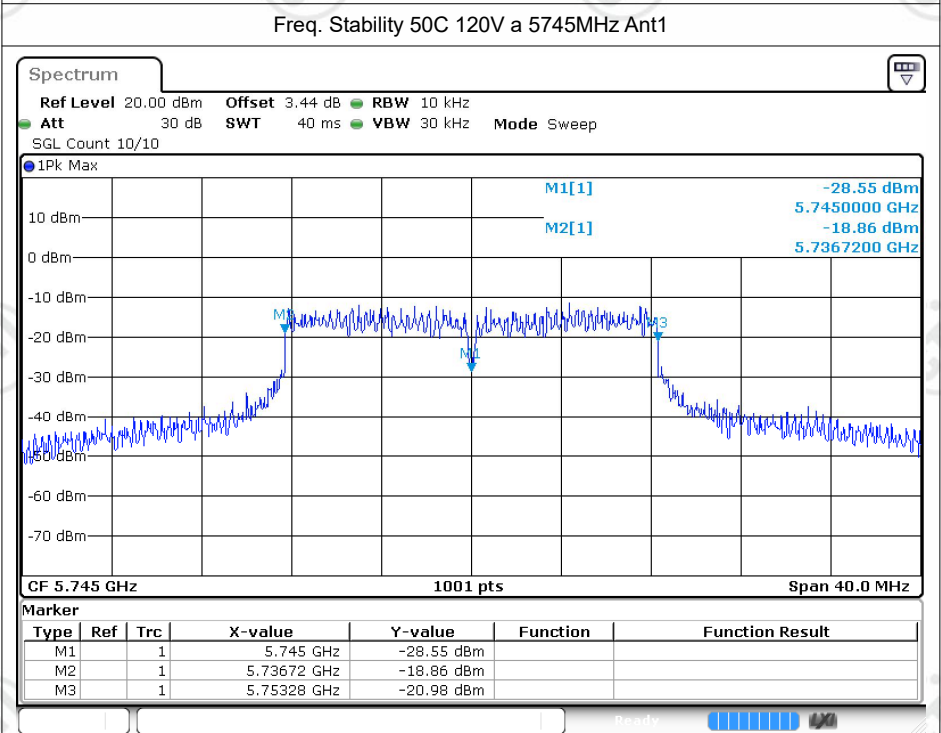


Date: 14.APR.2026 12:38:52

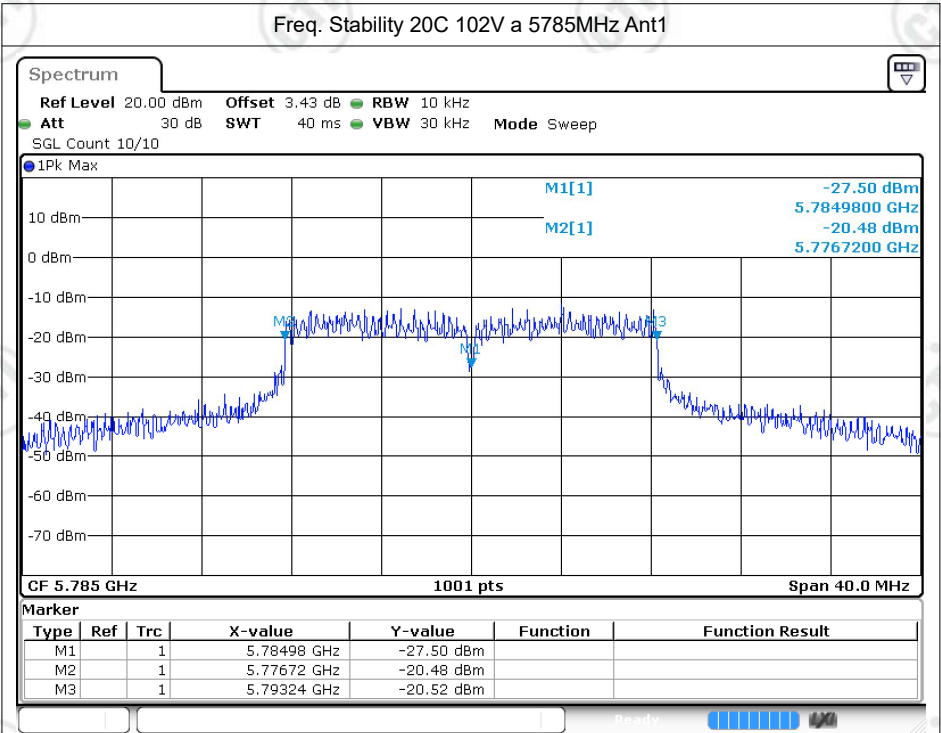


Date: 14.APR.2026 12:42:52

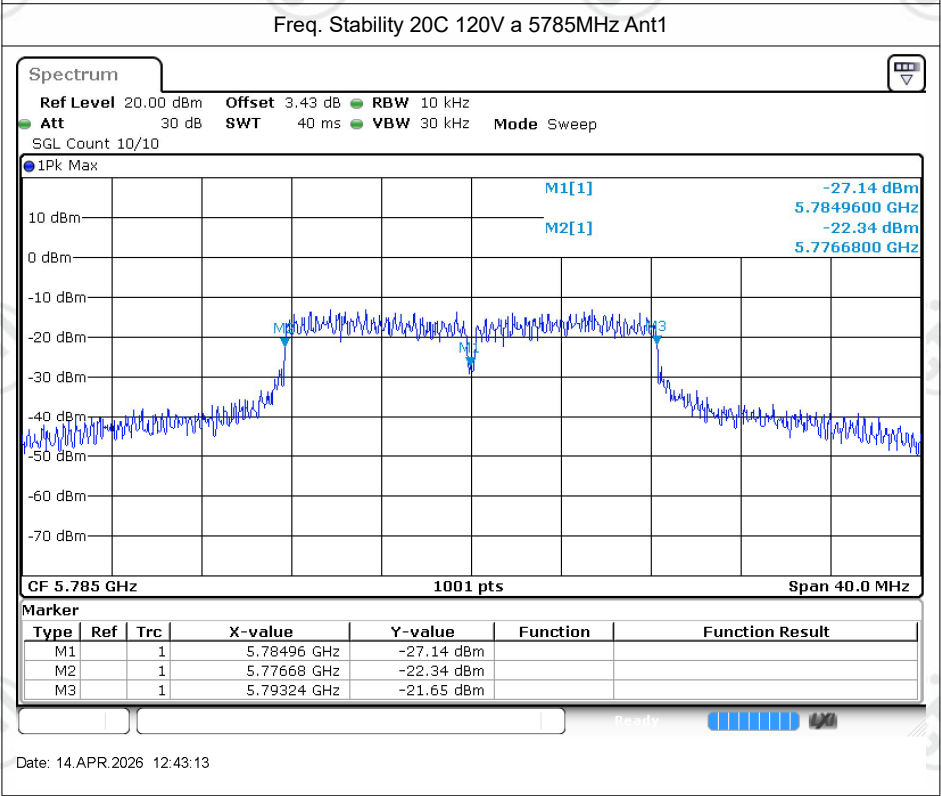


Date: 14.APR.2026 12:43:13

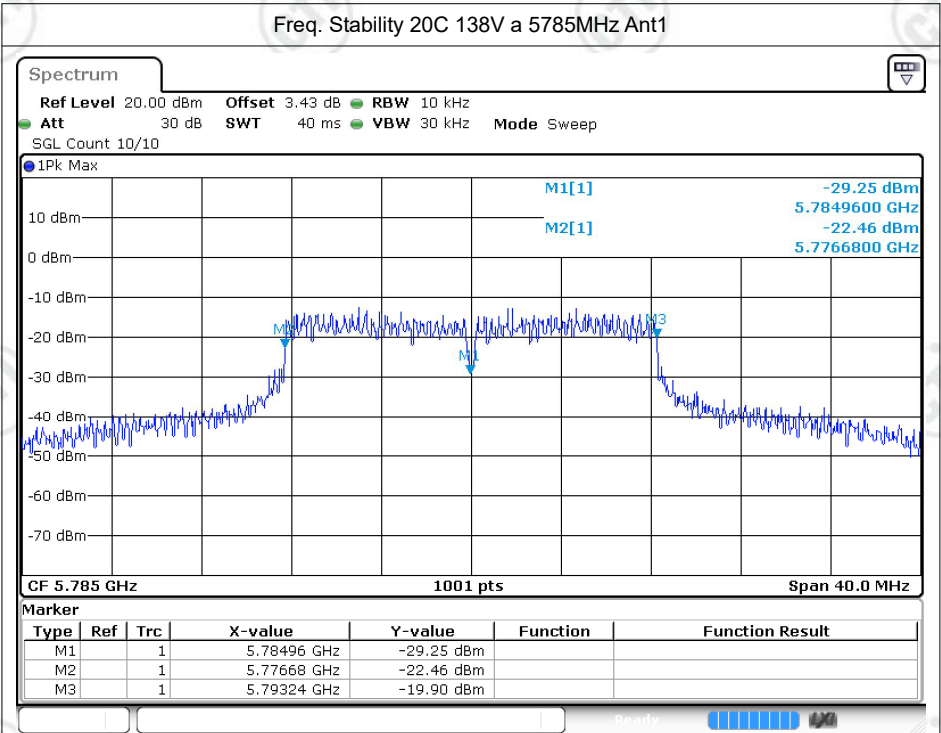


Date: 14.APR.2026 12:42:58

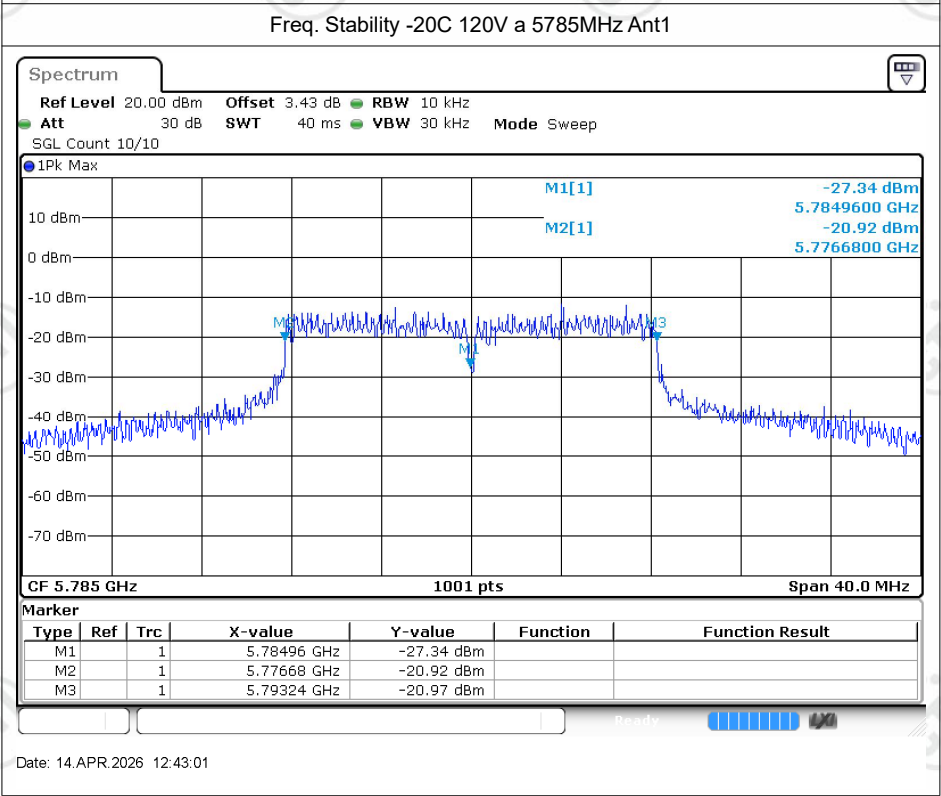


Date: 14.APR.2026 12:43:01

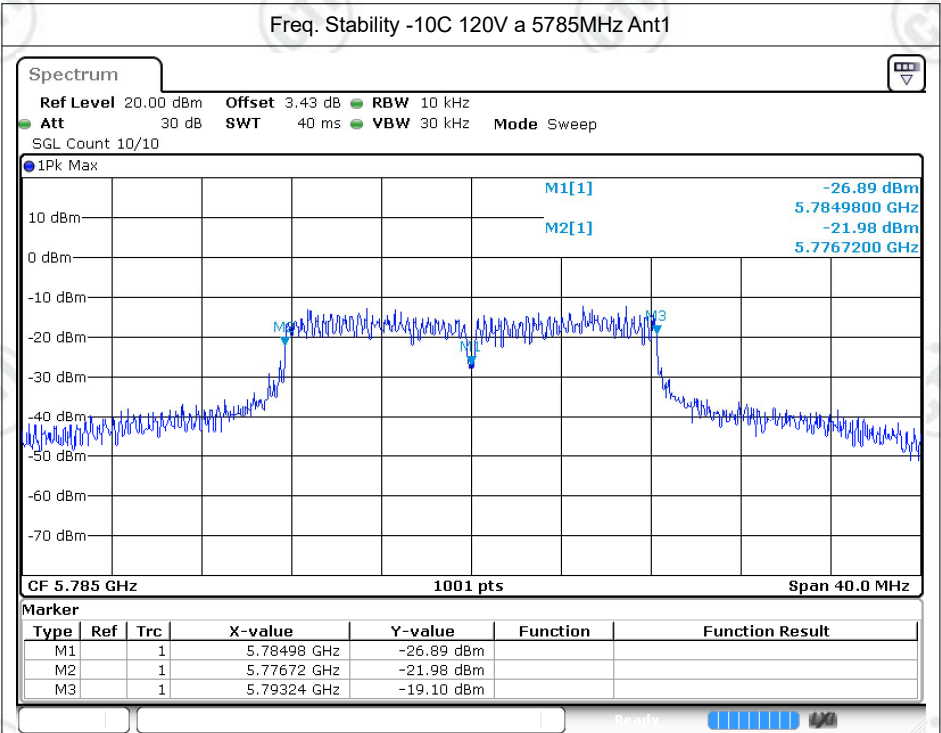


Date: 14.APR.2026 12:43:04

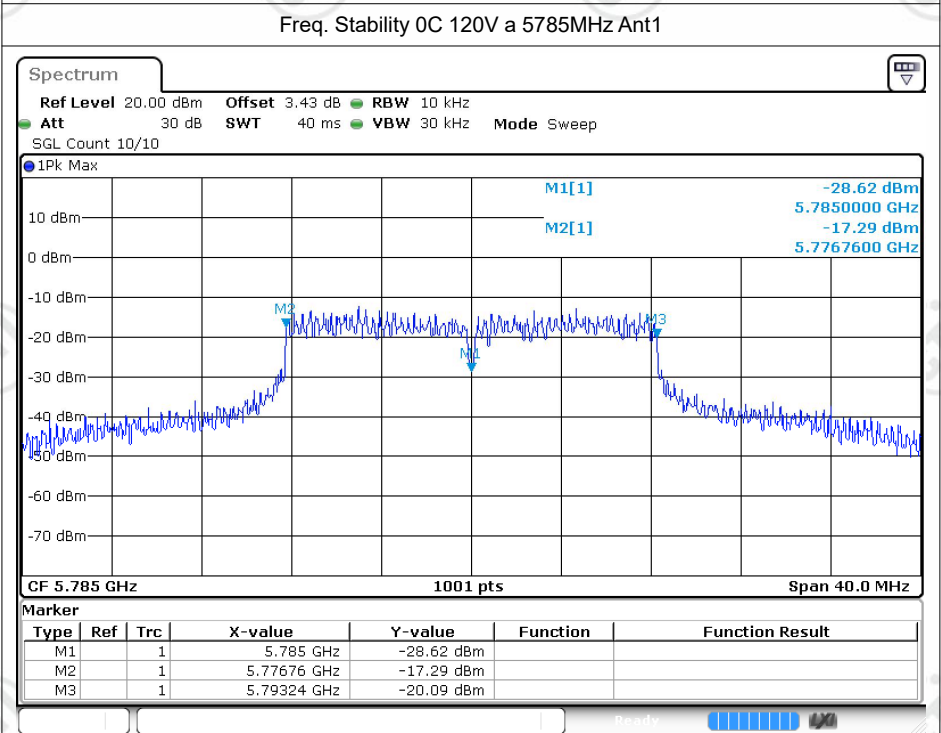


Date: 14.APR.2026 12:43:07

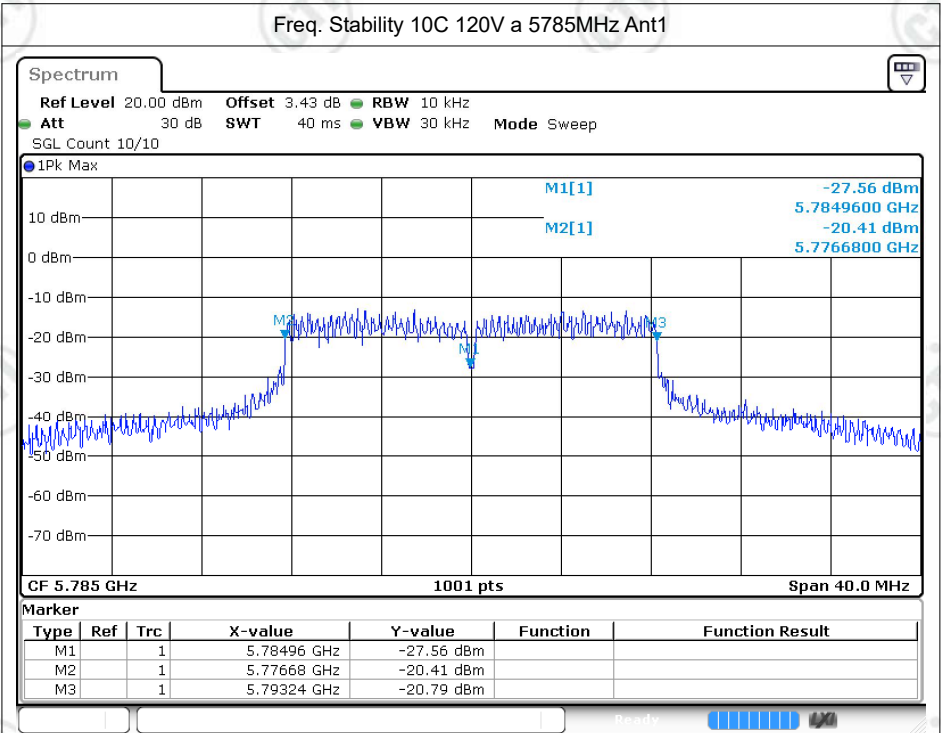


Date: 14.APR.2026 12:43:10

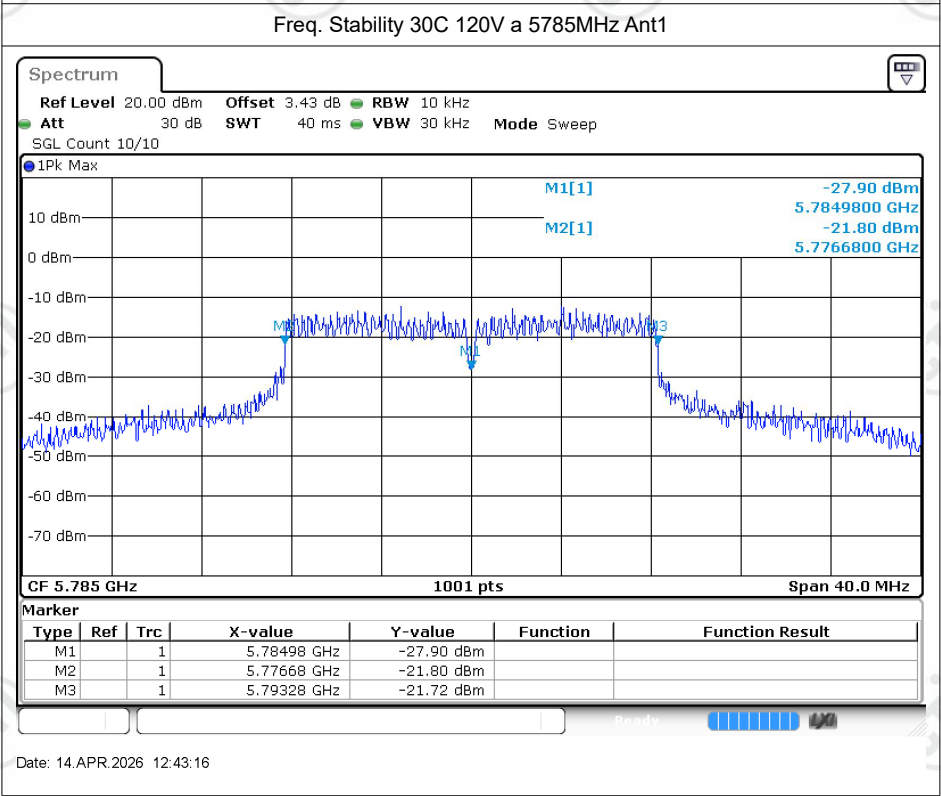


Date: 14.APR.2026 12:43:16

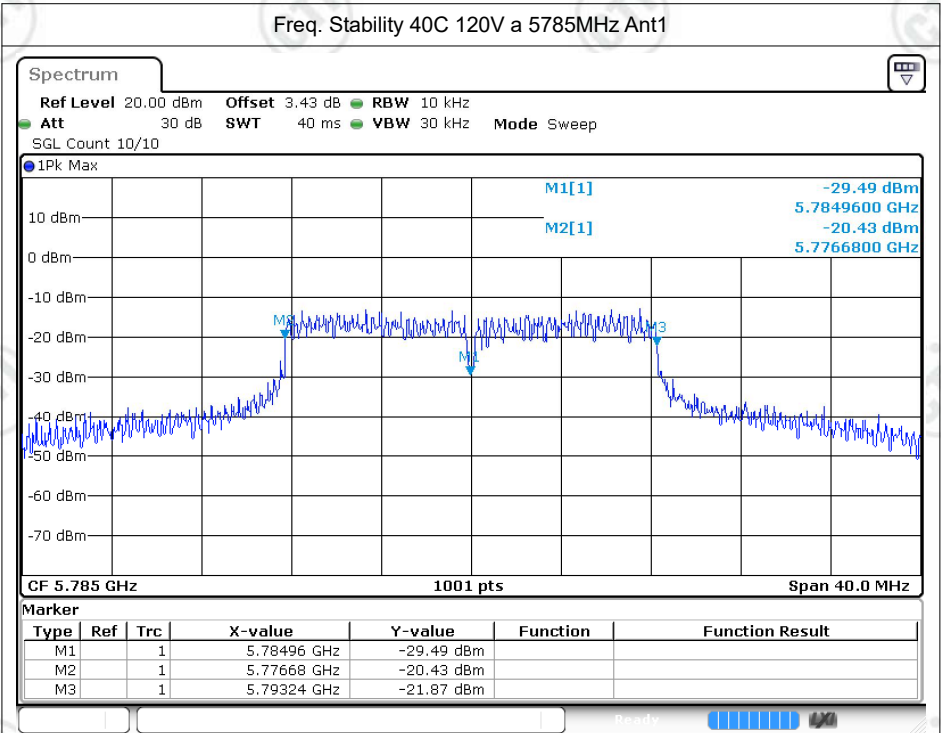


Date: 14.APR.2026 12:43:19

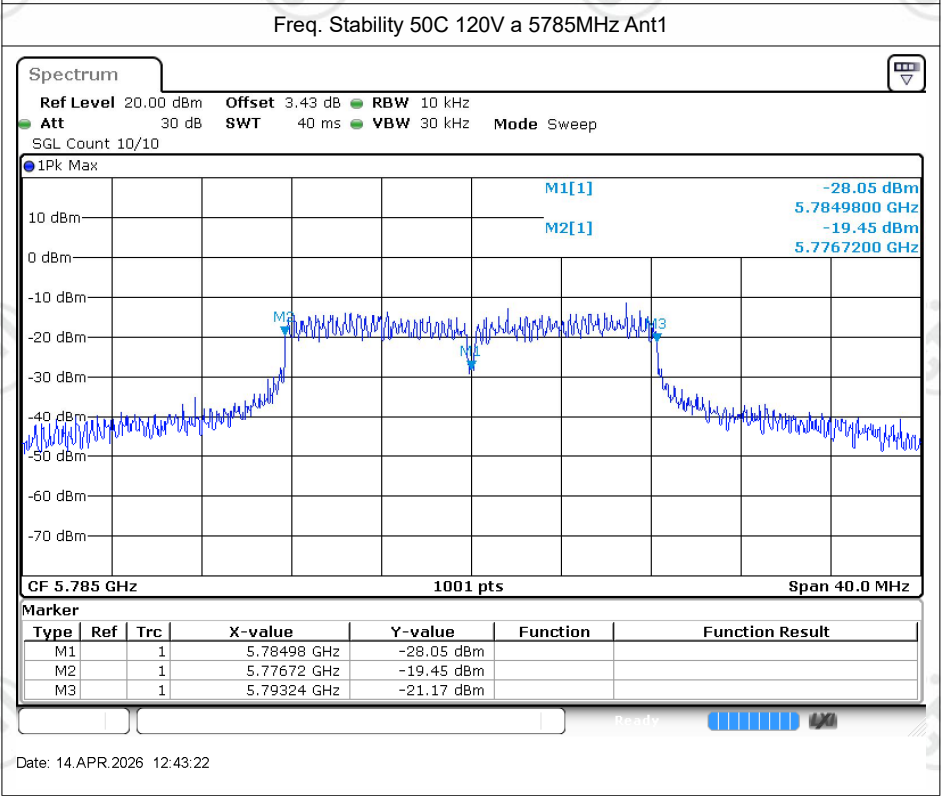


Date: 14.APR.2026 12:43:22

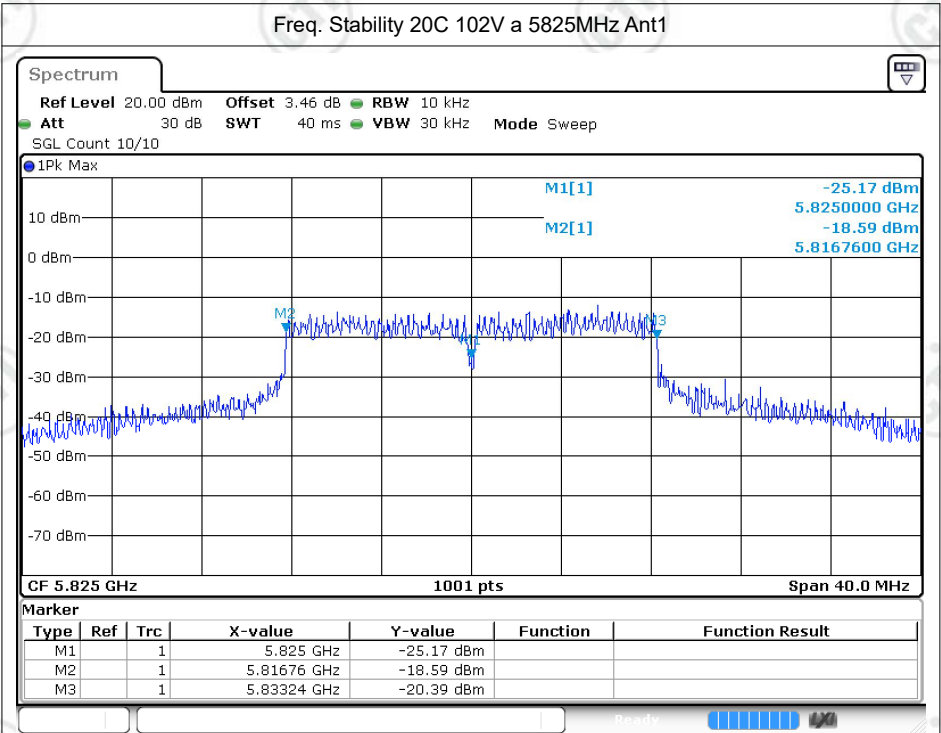


Date: 14.APR.2026 12:46:14

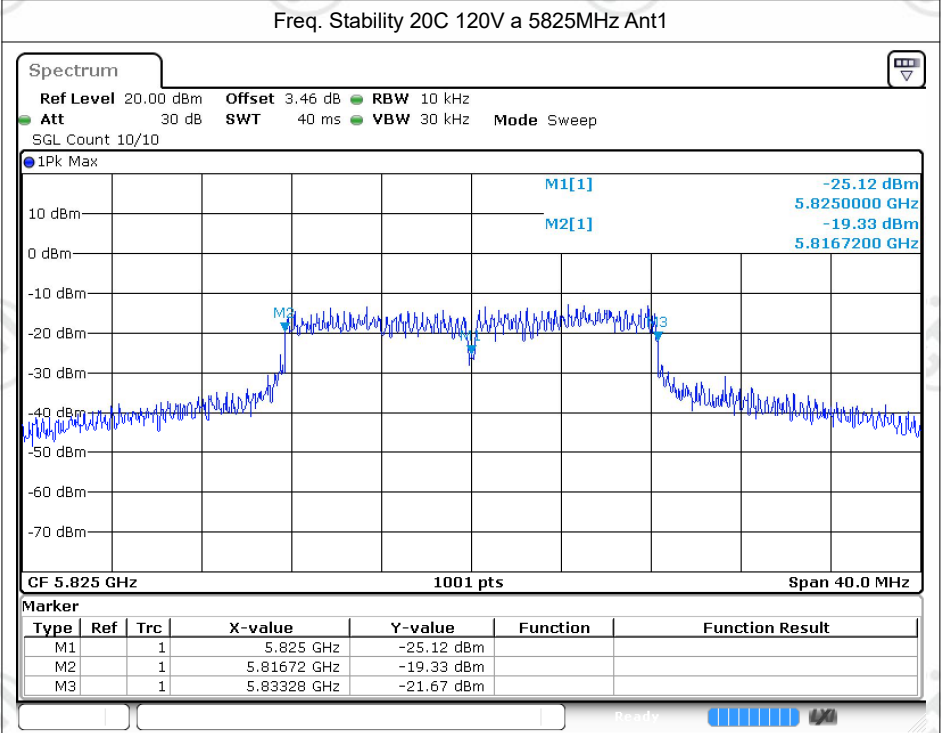


Date: 14.APR.2026 12:46:35

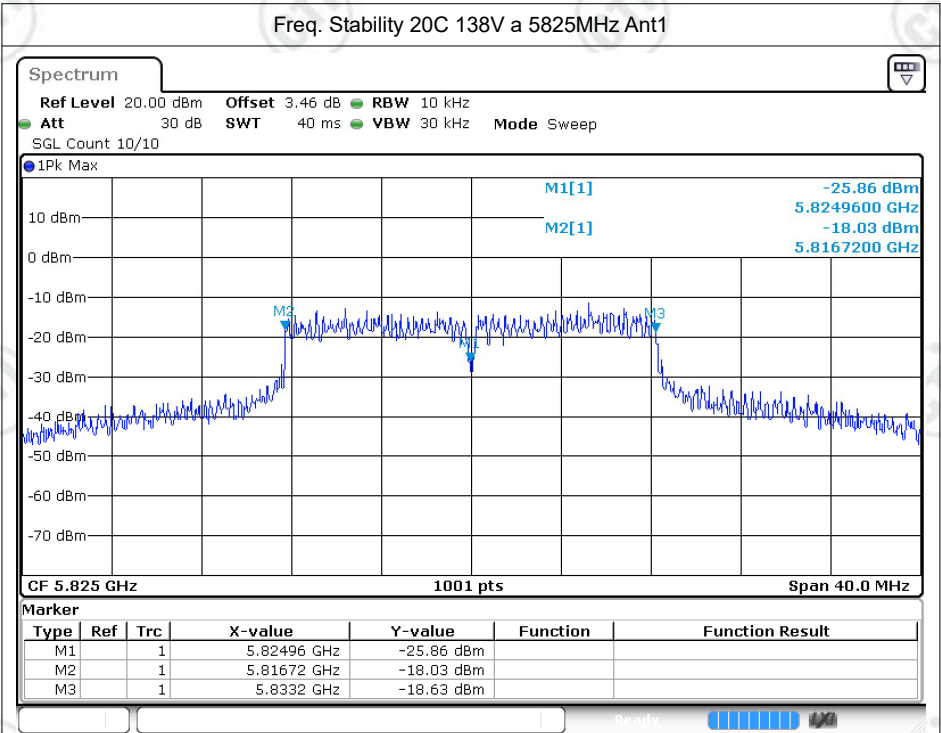


Date: 14.APR.2026 12:46:20

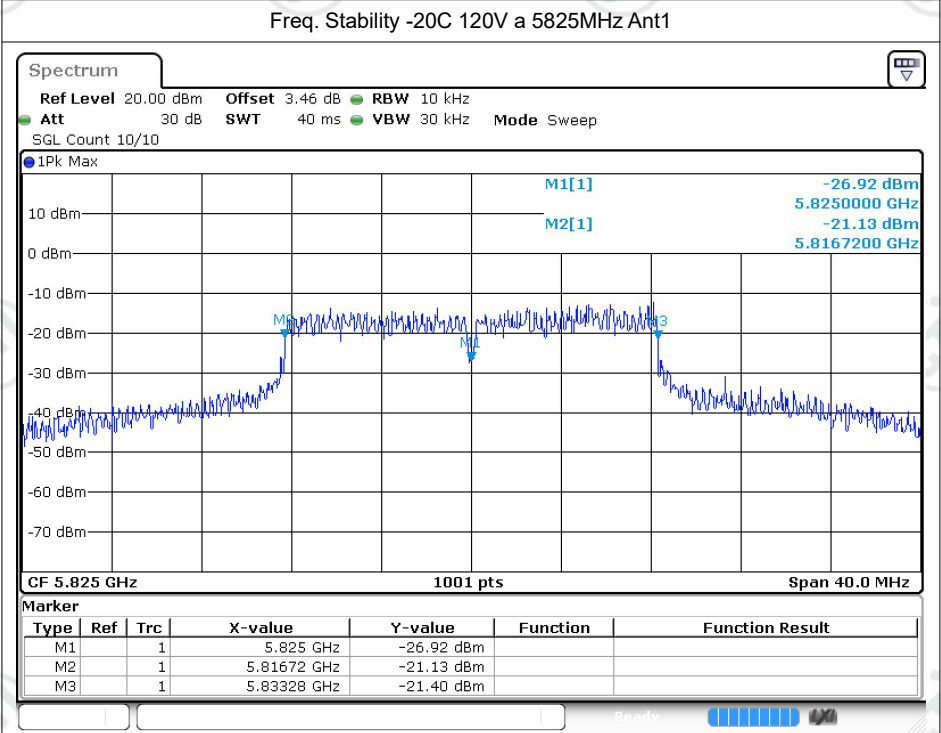


Date: 14.APR.2026 12:46:23

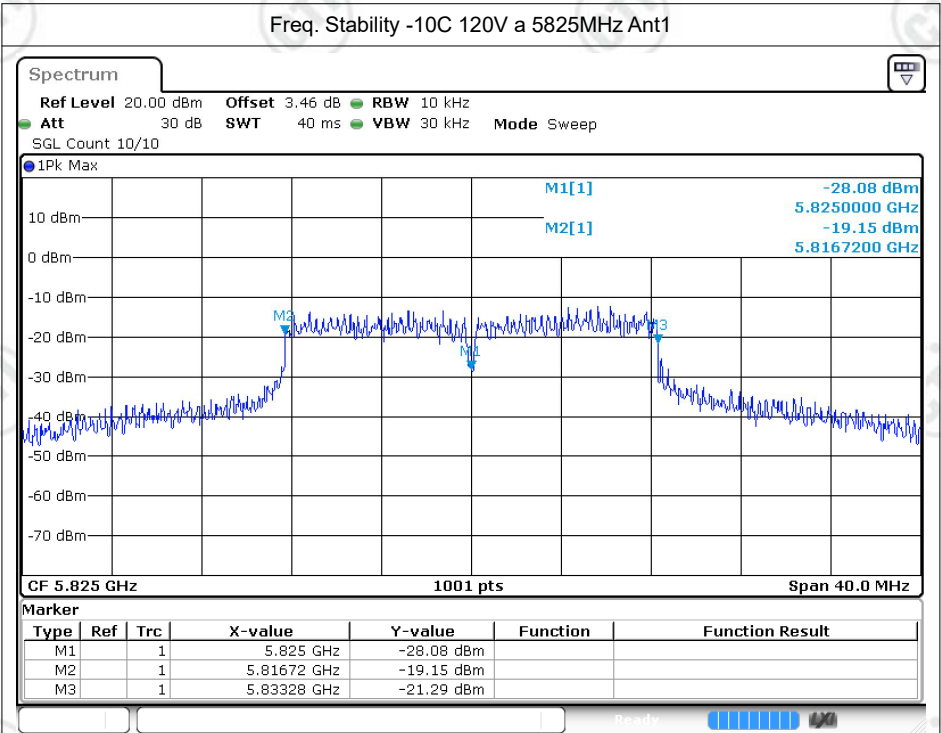


Date: 14.APR.2026 12:46:26

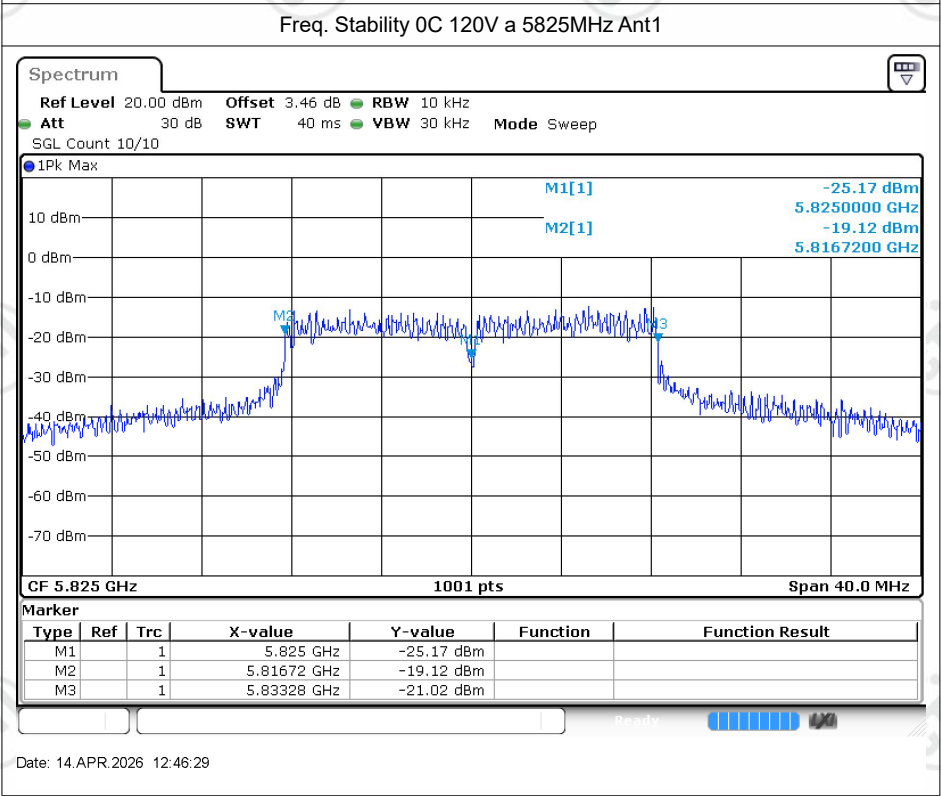


Date: 14.APR.2026 12:46:29

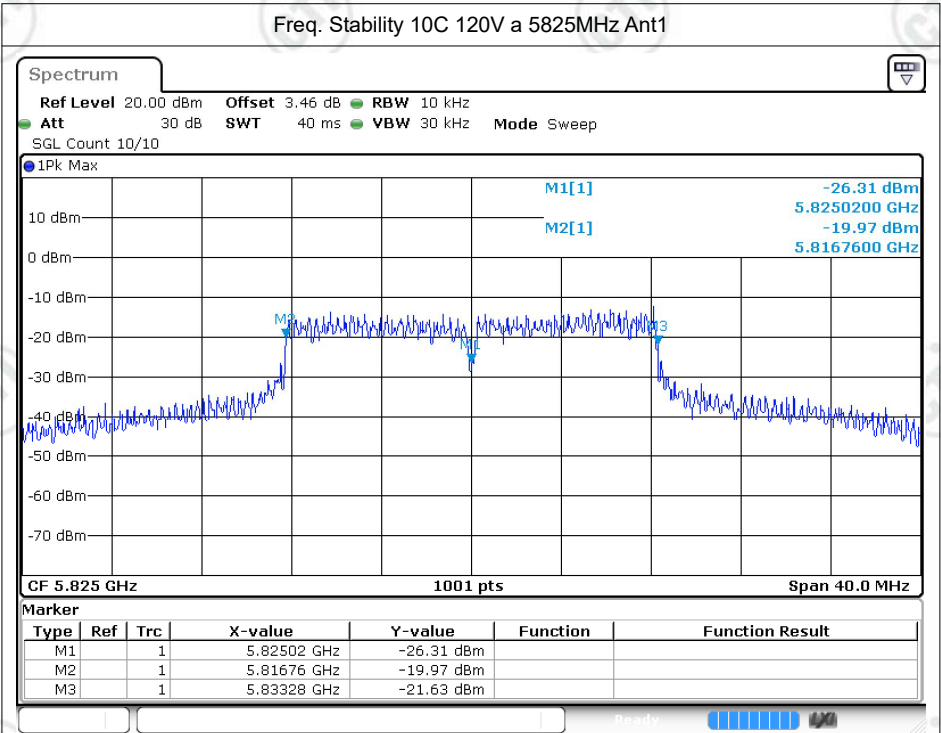


Date: 14.APR.2026 12:46:32

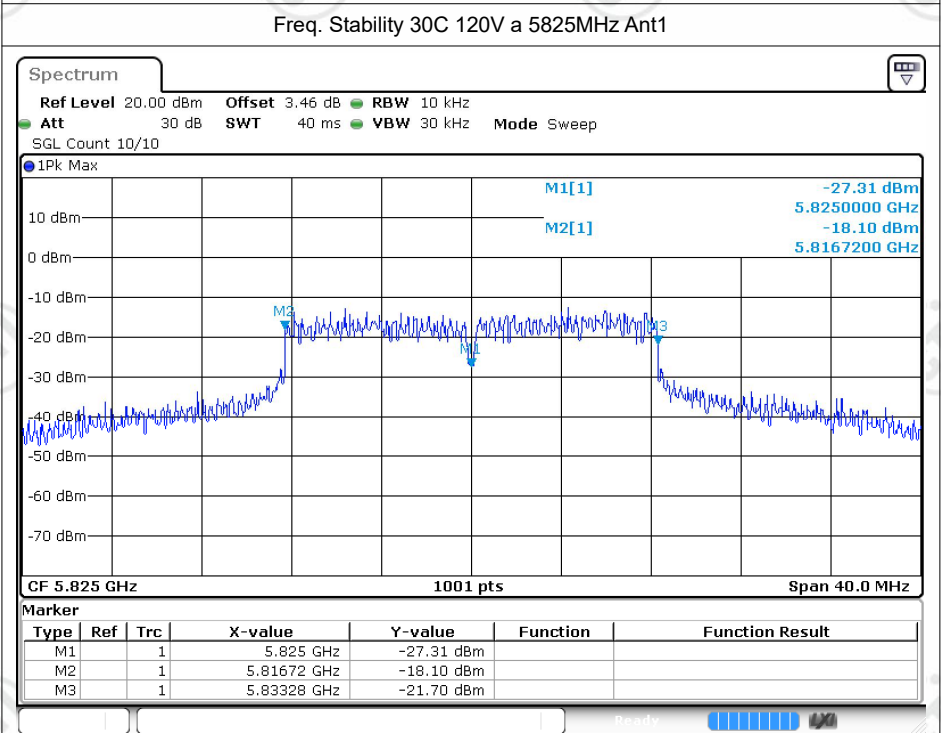


Date: 14.APR.2026 12:46:38

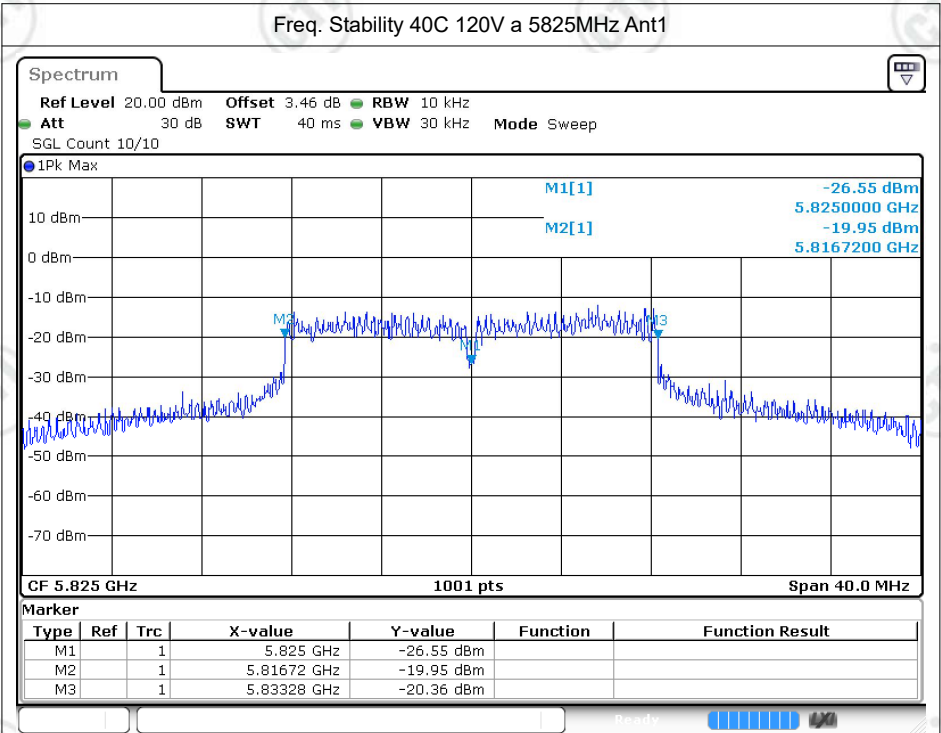


Date: 14.APR.2026 12:46:41

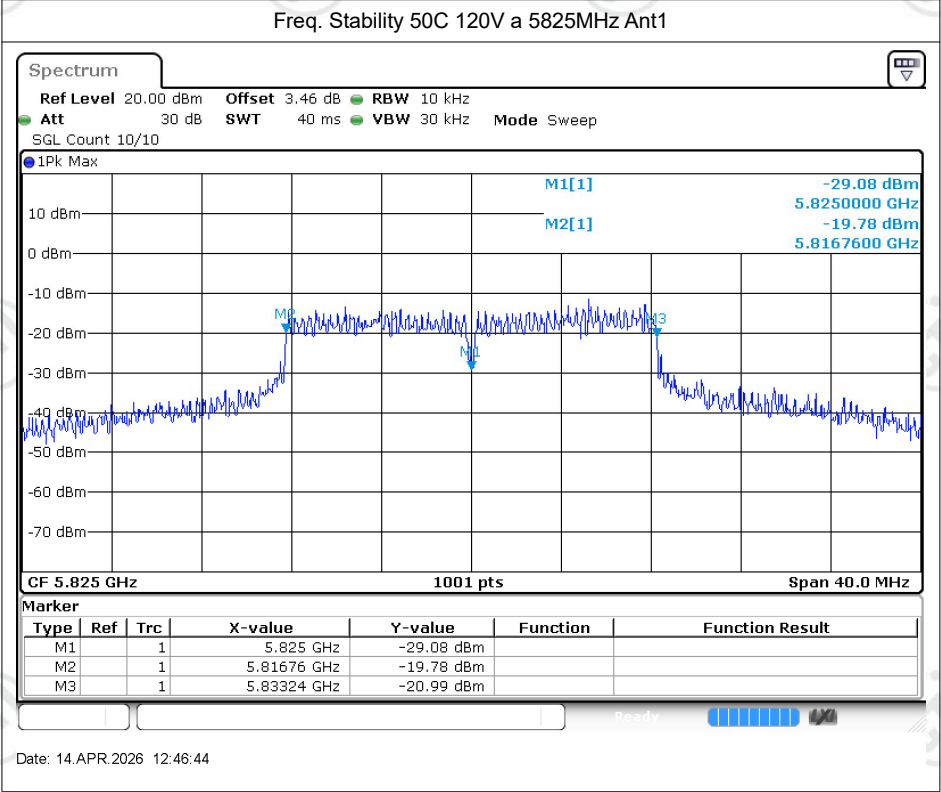


Date: 14.APR.2026 12:46:44

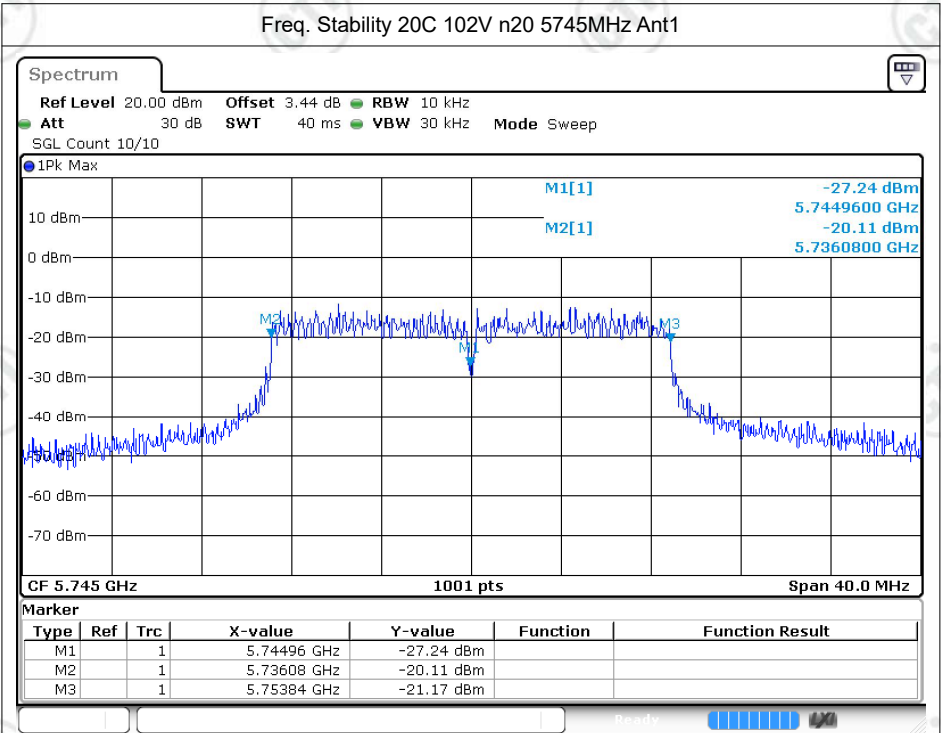


Date: 14.APR.2026 12:50:35

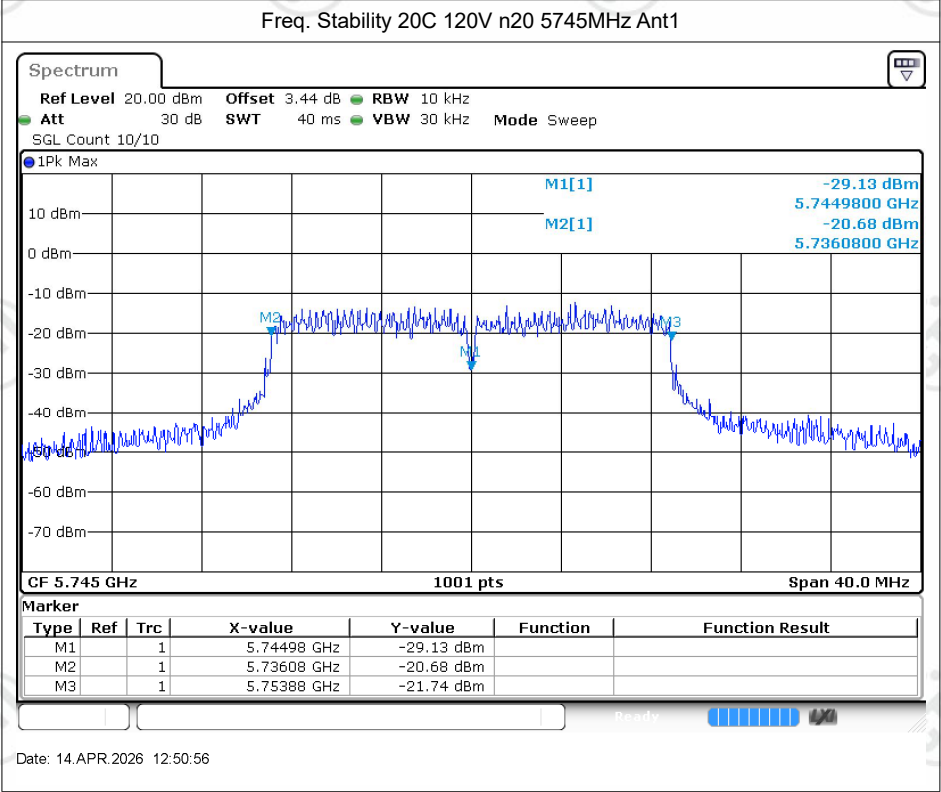


Date: 14.APR.2026 12:50:56

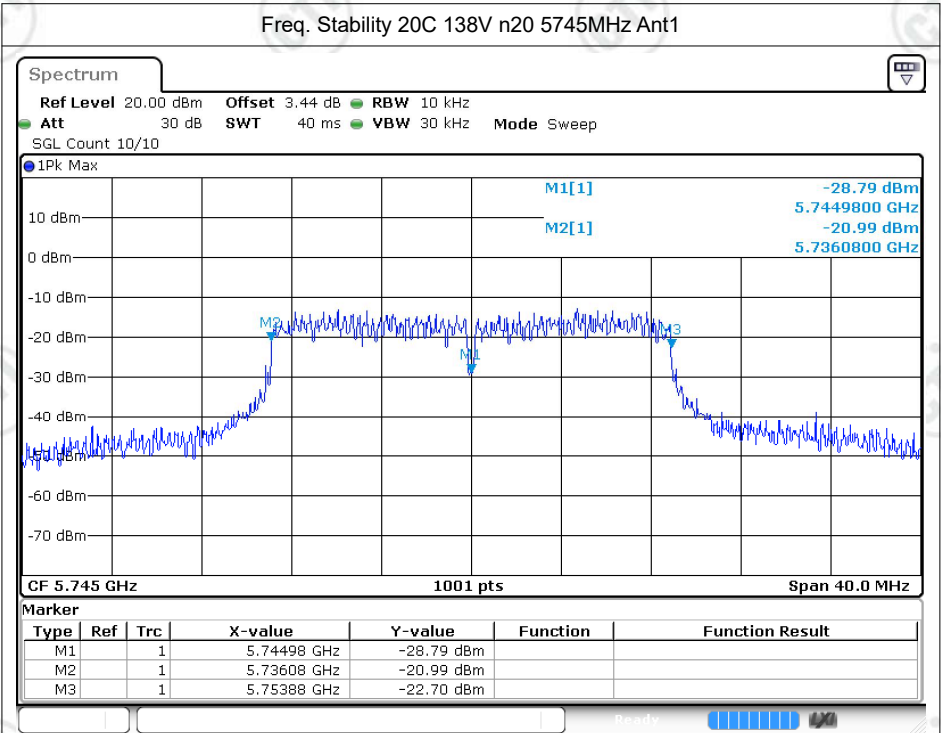


Date: 14.APR.2026 12:50:41

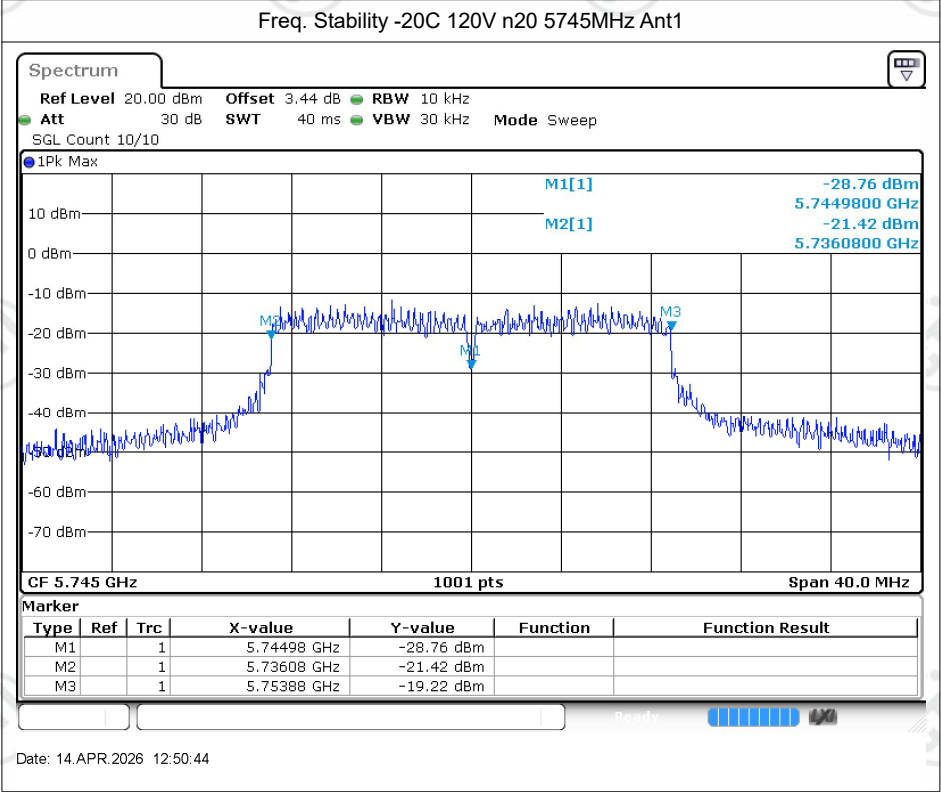


Date: 14.APR.2026 12:50:44

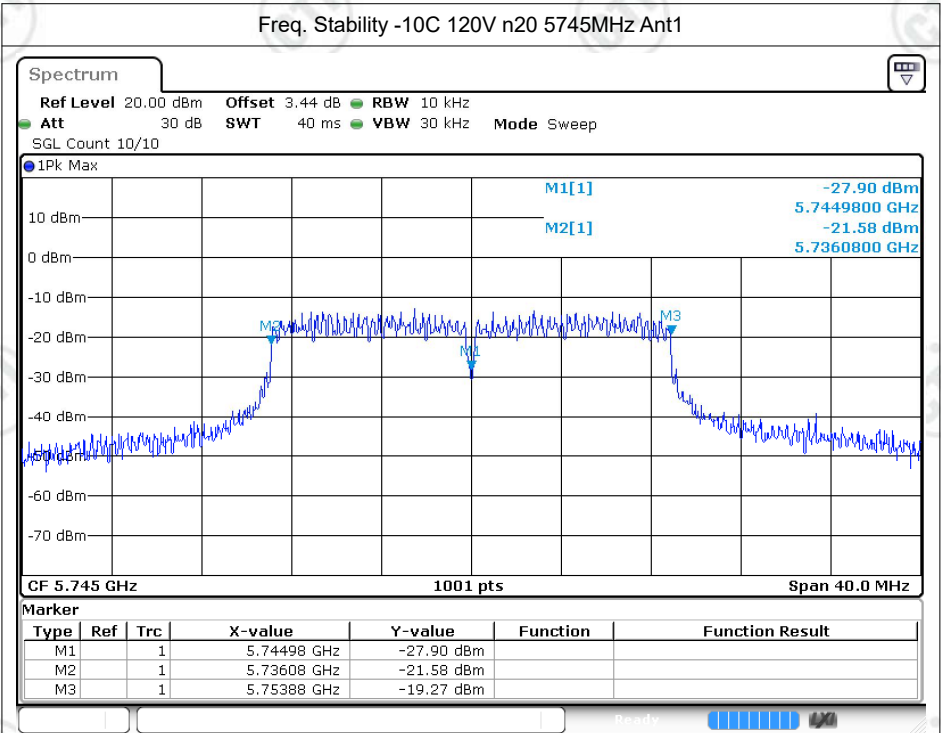


Date: 14.APR.2026 12:50:47

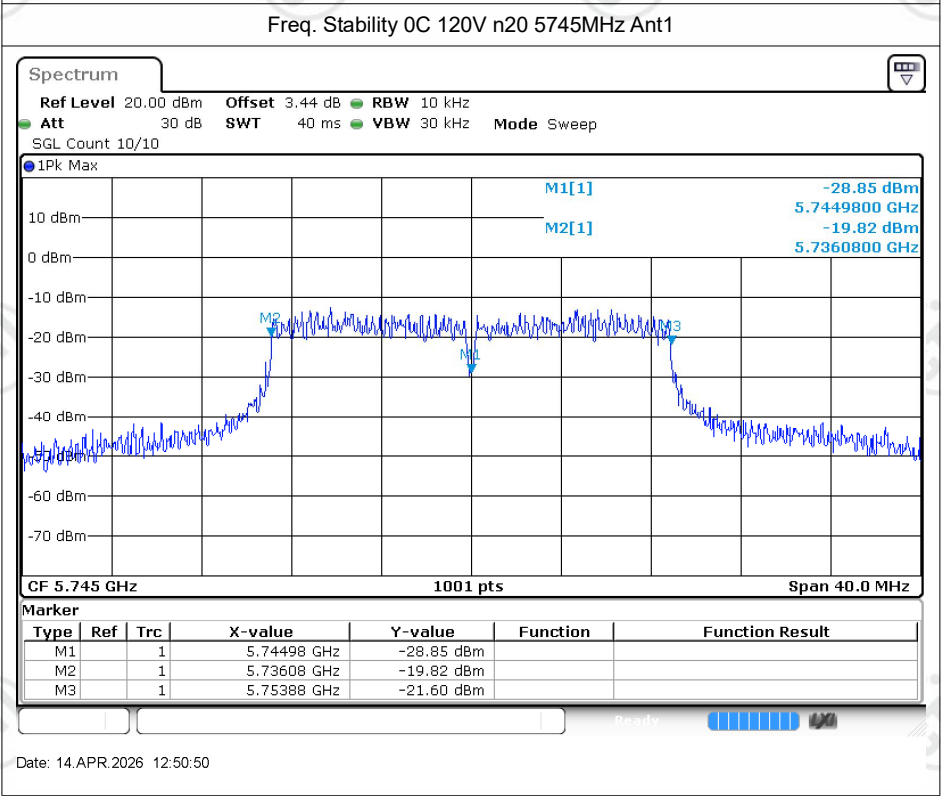


Date: 14.APR.2026 12:50:50

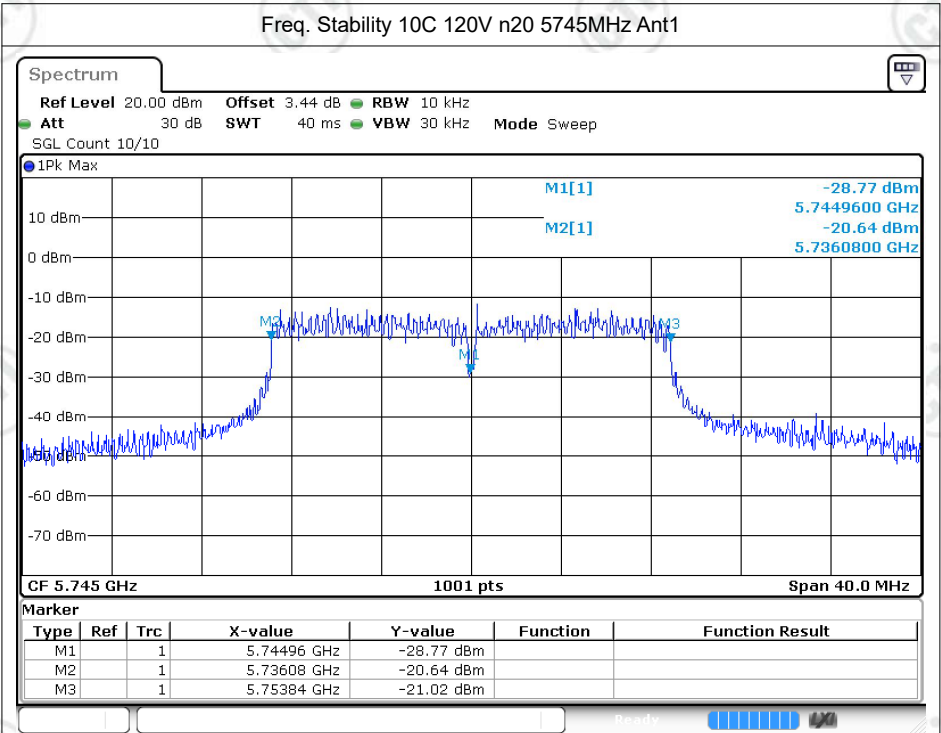


Date: 14.APR.2026 12:50:53

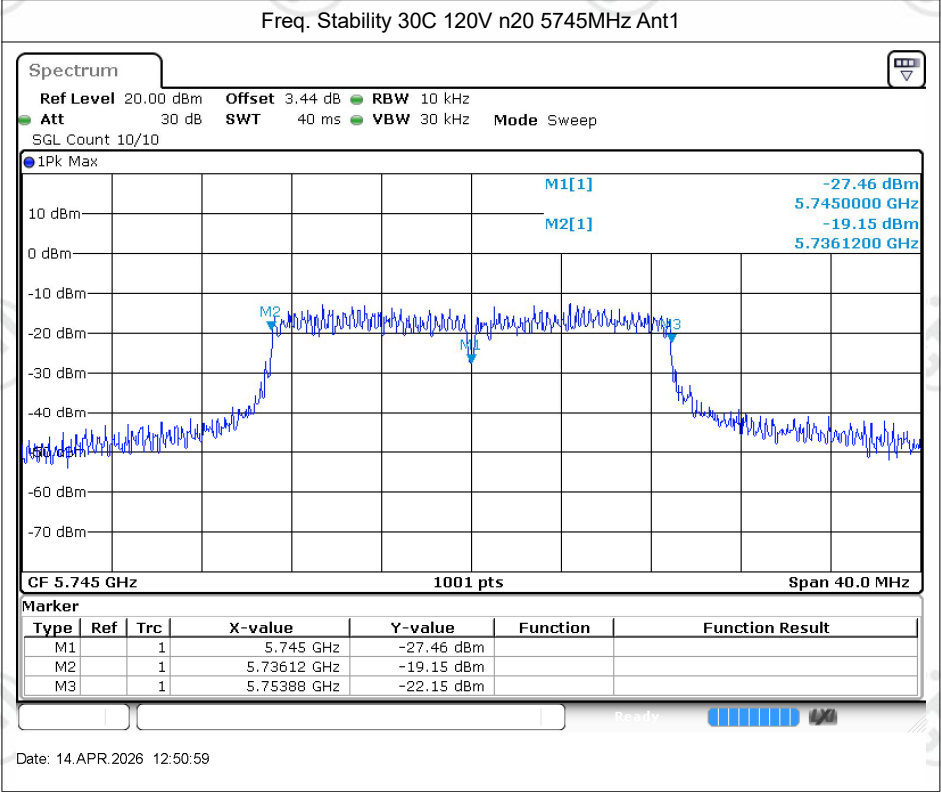


Date: 14.APR.2026 12:50:59

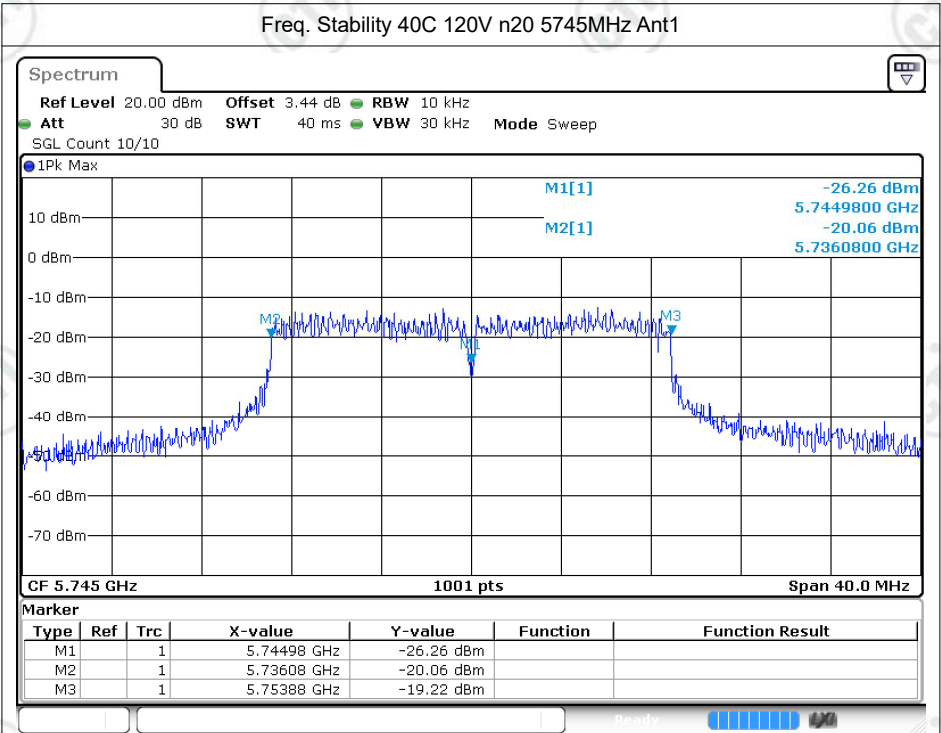


Date: 14.APR.2026 12:51:02

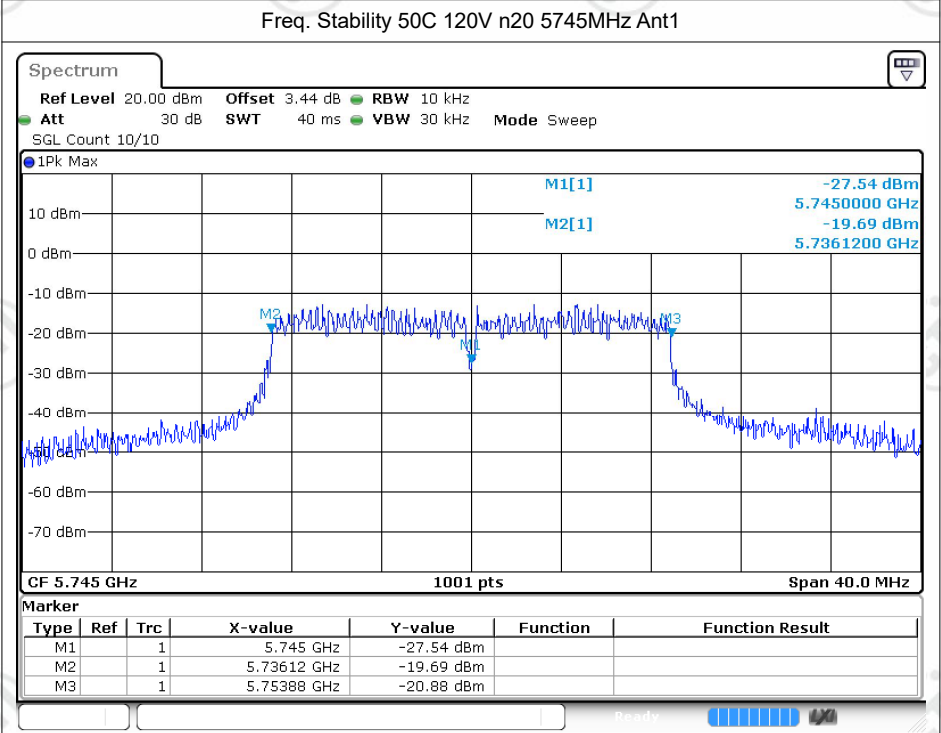


Date: 14.APR.2026 12:51:05

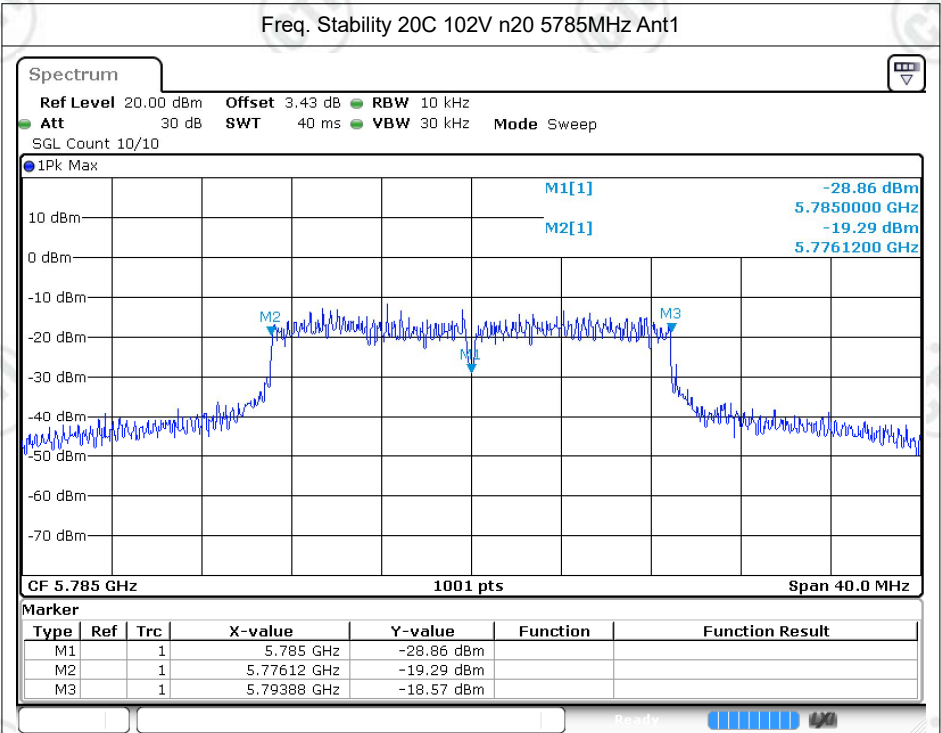


Date: 14.APR.2026 12:54:31

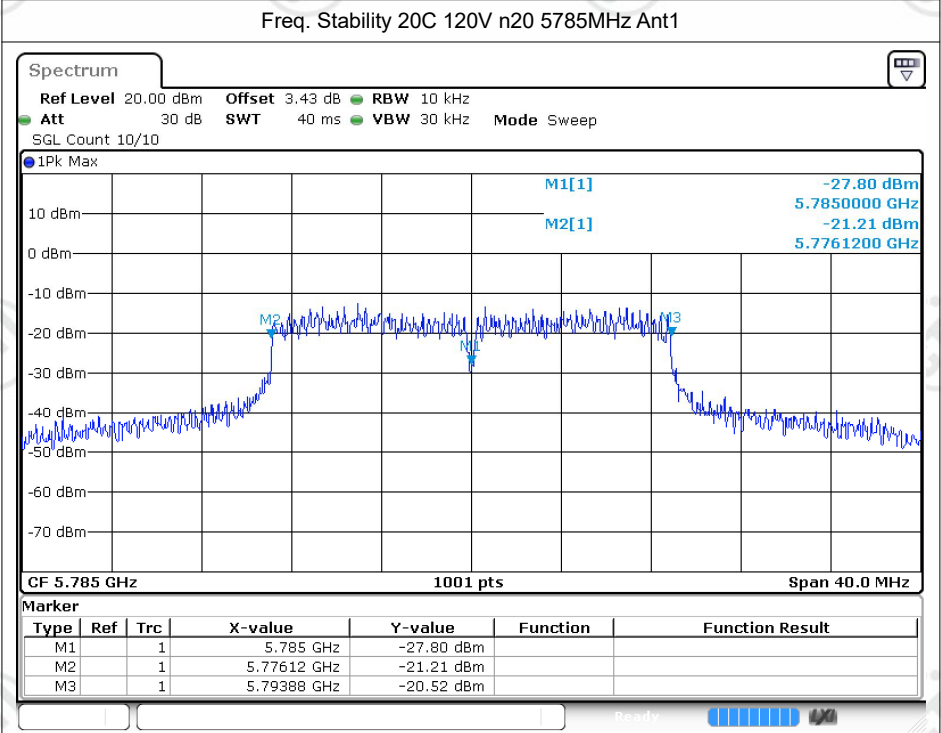

Date: 14.APR.2026 12:54:52

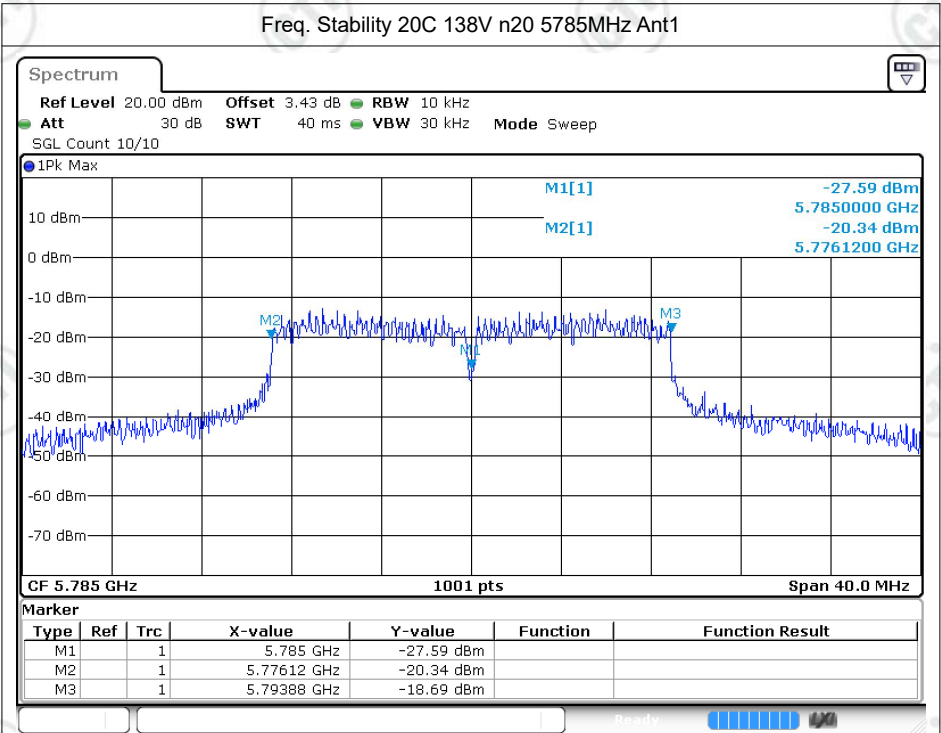

Date: 14.APR.2026 12:54:37

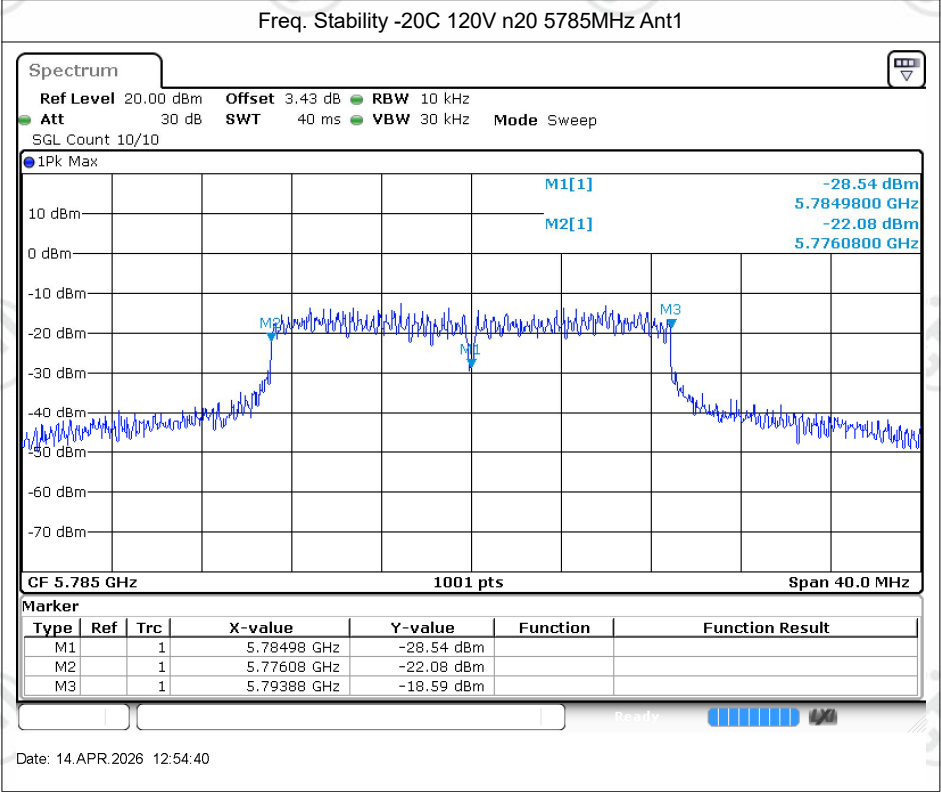

Date: 14.APR.2026 12:54:40