


Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	---	13.57	100.00	0.00	13.57	≤23.98	PASS
11A	Ant1	5200	---	13.64	100.00	0.00	13.64	≤23.98	PASS
11A	Ant1	5240	---	13.50	100.00	0.00	13.50	≤23.98	PASS
11A	Ant1	5260	---	14.03	100.00	0.00	14.03	≤23.52	PASS
11A	Ant1	5280	---	13.57	100.00	0.00	13.57	≤23.46	PASS
11A	Ant1	5320	---	13.34	100.00	0.00	13.34	≤23.48	PASS
11A	Ant1	5500	---	12.87	100.00	0.00	12.87	≤23.47	PASS
11A	Ant1	5580	---	14.26	100.00	0.00	14.26	≤23.51	PASS
11A	Ant1	5700	---	14.04	100.00	0.00	14.04	≤23.48	PASS
11A	Ant1	5745	---	14.09	100.00	0.00	14.09	≤30.00	PASS
11A	Ant1	5785	---	13.91	100.00	0.00	13.91	≤30.00	PASS
11A	Ant1	5825	---	13.29	100.00	0.00	13.29	≤30.00	PASS
11N20SISO	Ant1	5180	---	13.70	100.00	0.00	13.70	≤23.98	PASS
11N20SISO	Ant1	5200	---	13.65	100.00	0.00	13.65	≤23.98	PASS
11N20SISO	Ant1	5240	---	13.35	100.00	0.00	13.35	≤23.98	PASS
11N20SISO	Ant1	5260	---	14.03	100.00	0.00	14.03	≤23.65	PASS
11N20SISO	Ant1	5280	---	13.70	100.00	0.00	13.70	≤23.66	PASS
11N20SISO	Ant1	5320	---	13.51	100.00	0.00	13.51	≤23.67	PASS
11N20SISO	Ant1	5500	---	13.23	100.00	0.00	13.23	≤23.67	PASS
11N20SISO	Ant1	5580	---	14.60	100.00	0.00	14.60	≤23.66	PASS
11N20SISO	Ant1	5700	---	14.40	100.00	0.00	14.40	≤23.66	PASS
11N20SISO	Ant1	5745	---	13.48	100.00	0.00	13.48	≤30.00	PASS
11N20SISO	Ant1	5785	---	13.31	100.00	0.00	13.31	≤30.00	PASS
11N20SISO	Ant1	5825	---	12.85	100.00	0.00	12.85	≤30.00	PASS
11N40SISO	Ant1	5190	---	13.33	100.00	0.00	13.33	≤23.98	PASS
11N40SISO	Ant1	5230	---	13.12	100.00	0.00	13.12	≤23.98	PASS
11N40SISO	Ant1	5270	---	13.40	100.00	0.00	13.40	≤23.98	PASS
11N40SISO	Ant1	5310	---	13.06	100.00	0.00	13.06	≤23.98	PASS
11N40SISO	Ant1	5510	---	12.91	100.00	0.00	12.91	≤23.98	PASS
11N40SISO	Ant1	5550	---	13.56	100.00	0.00	13.56	≤23.98	PASS
11N40SISO	Ant1	5670	---	13.95	100.00	0.00	13.95	≤23.98	PASS
11N40SISO	Ant1	5755	---	13.04	100.00	0.00	13.04	≤30.00	PASS
11N40SISO	Ant1	5795	---	12.84	100.00	0.00	12.84	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Graphs Channel Power

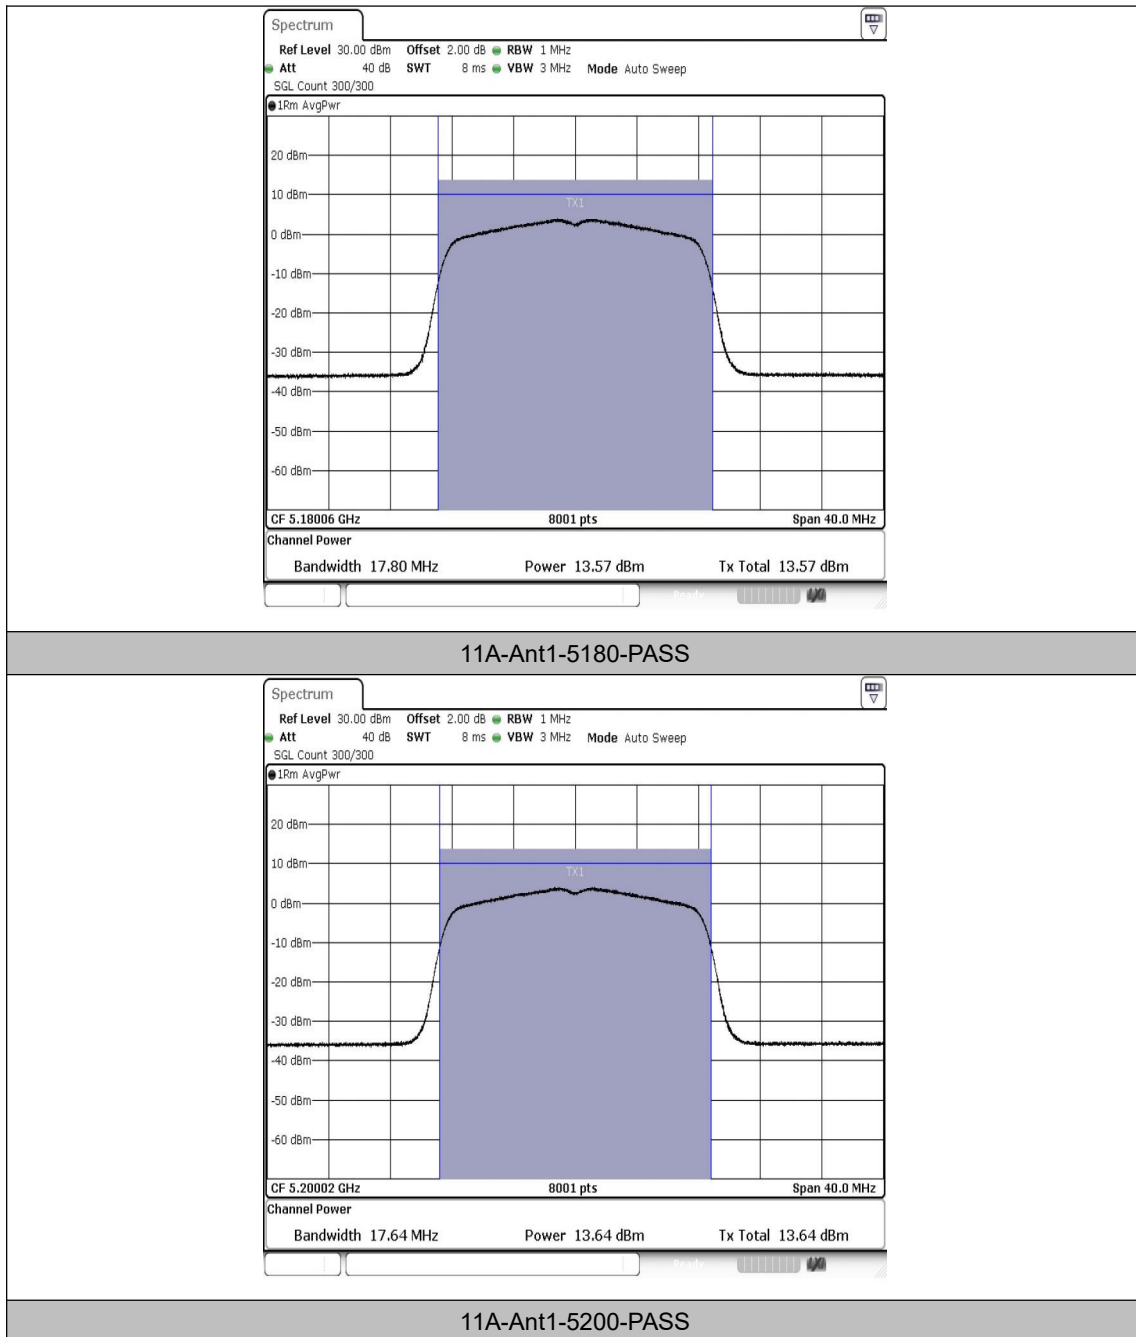


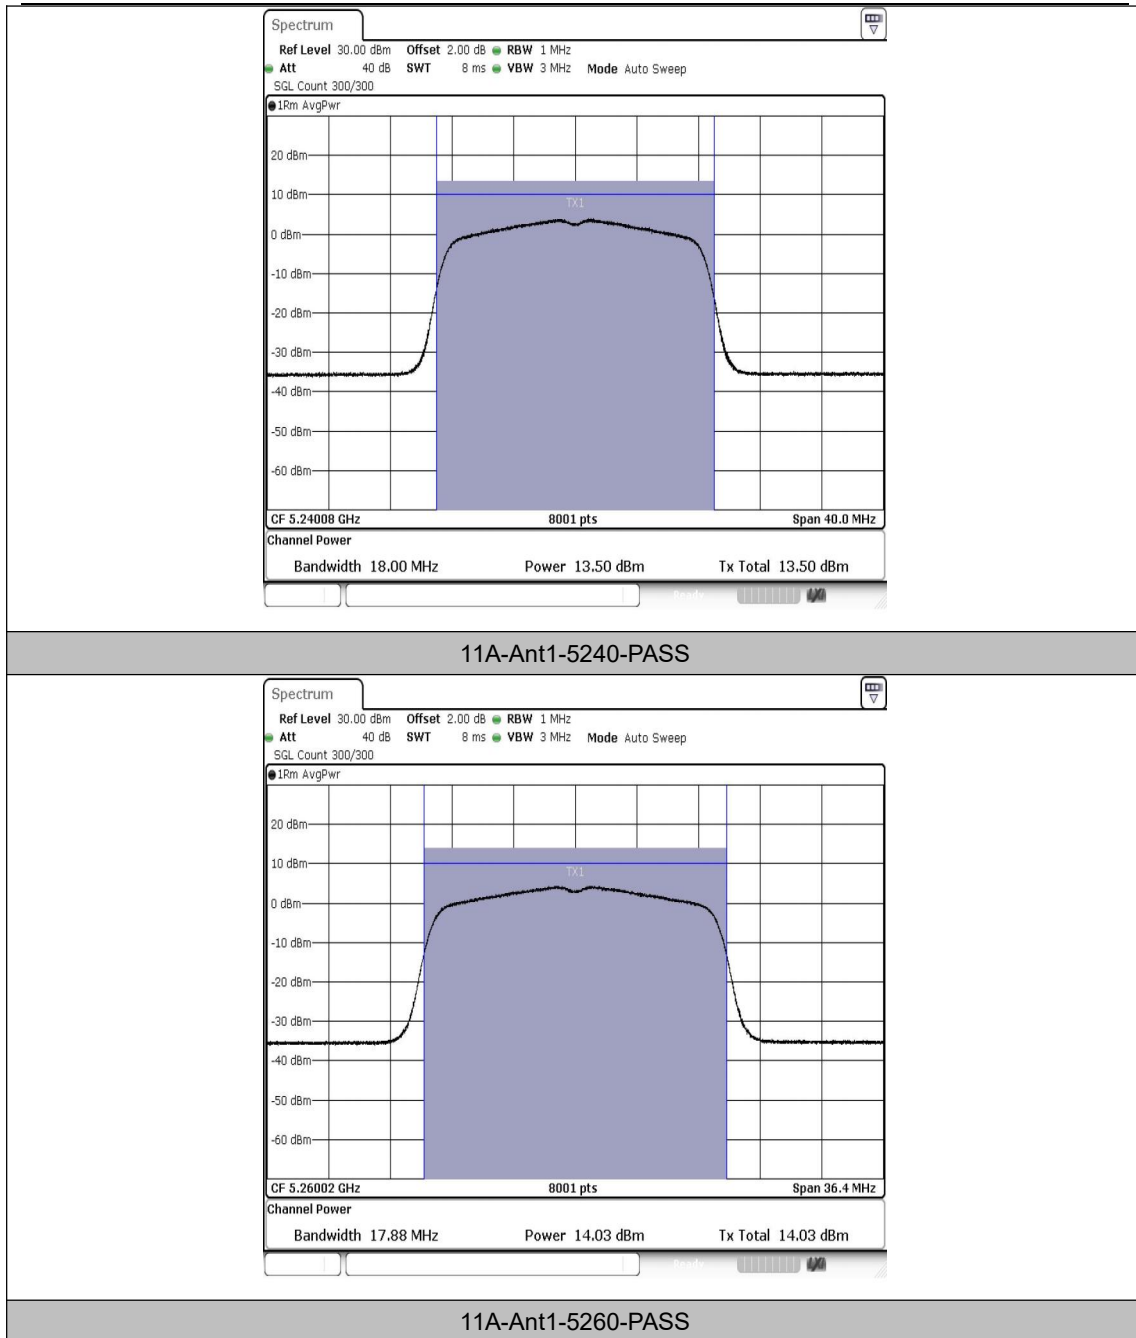

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

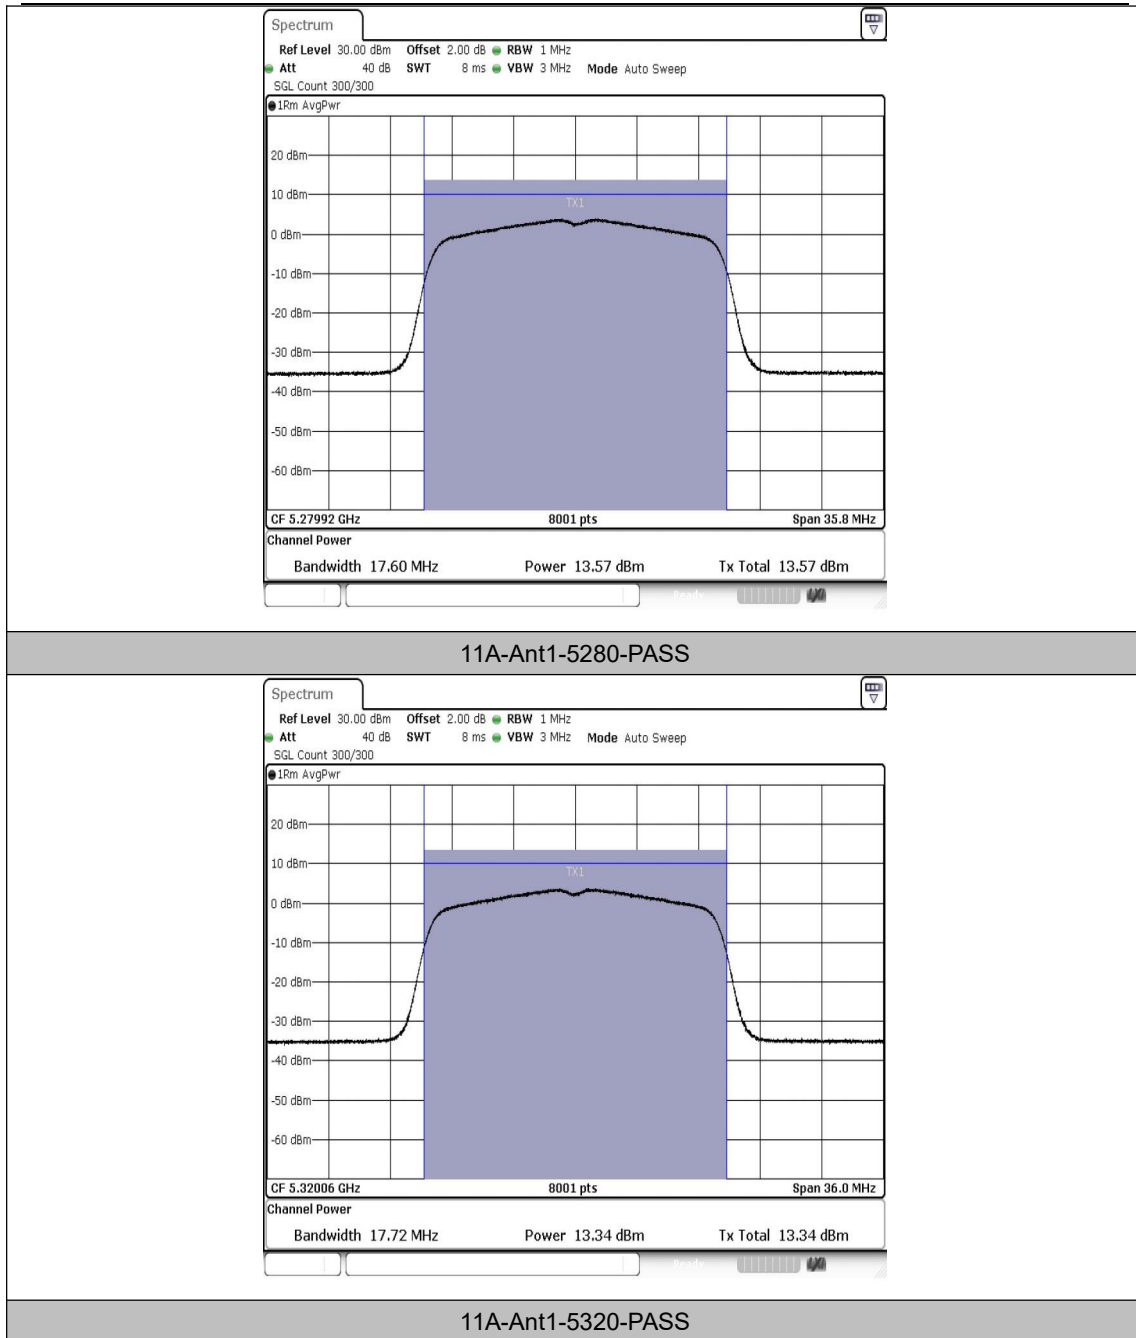

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

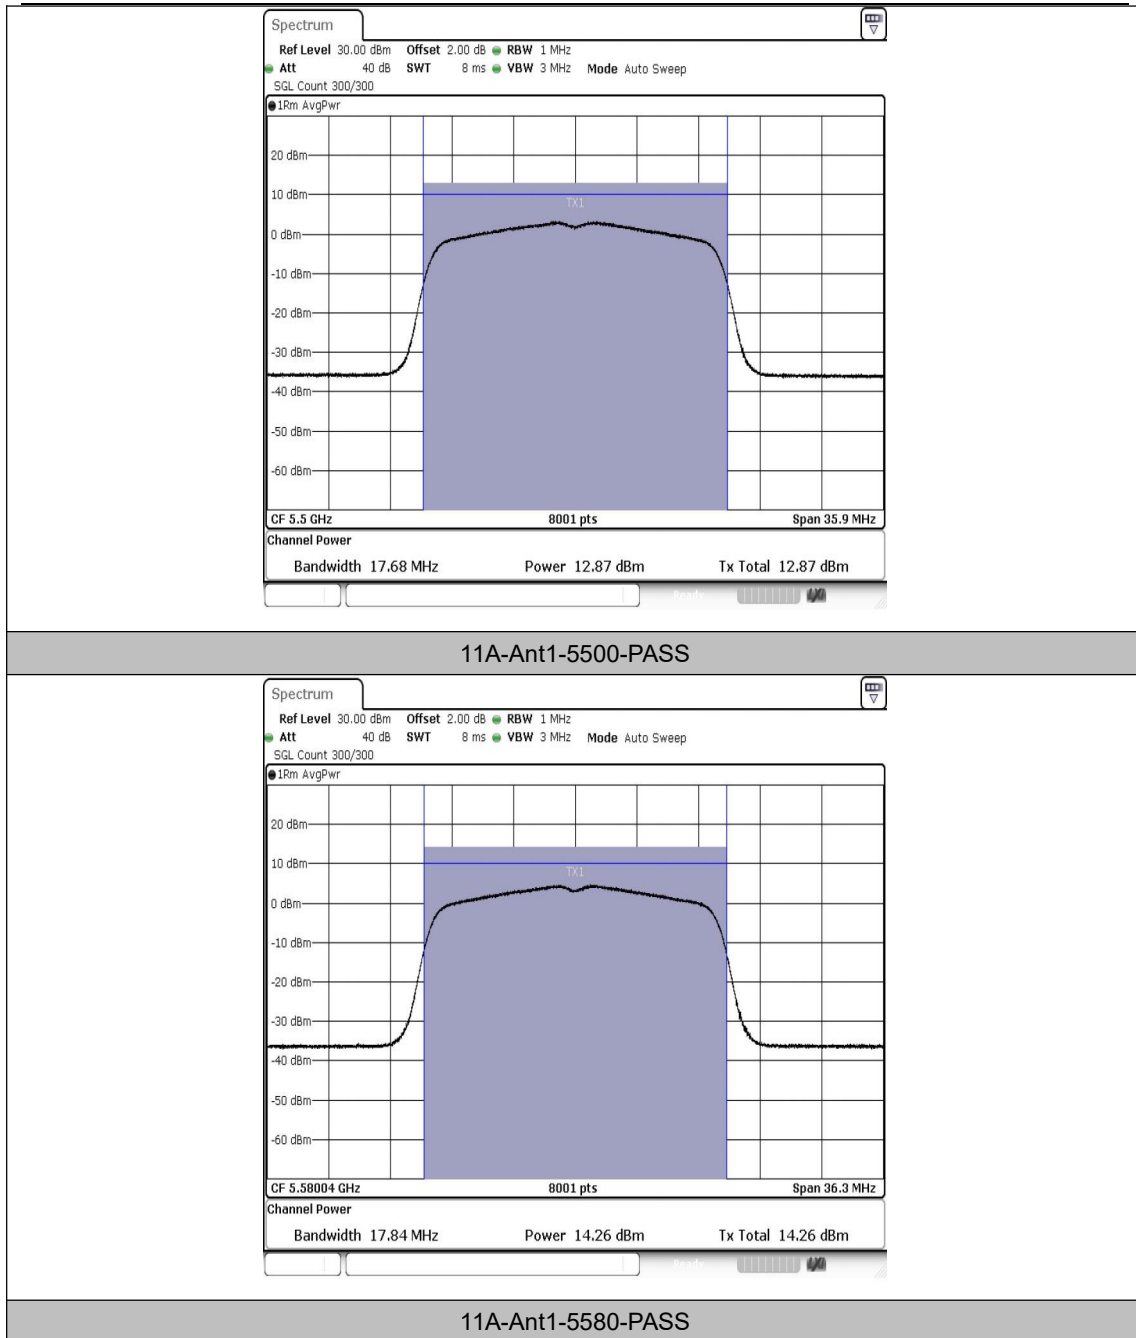

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

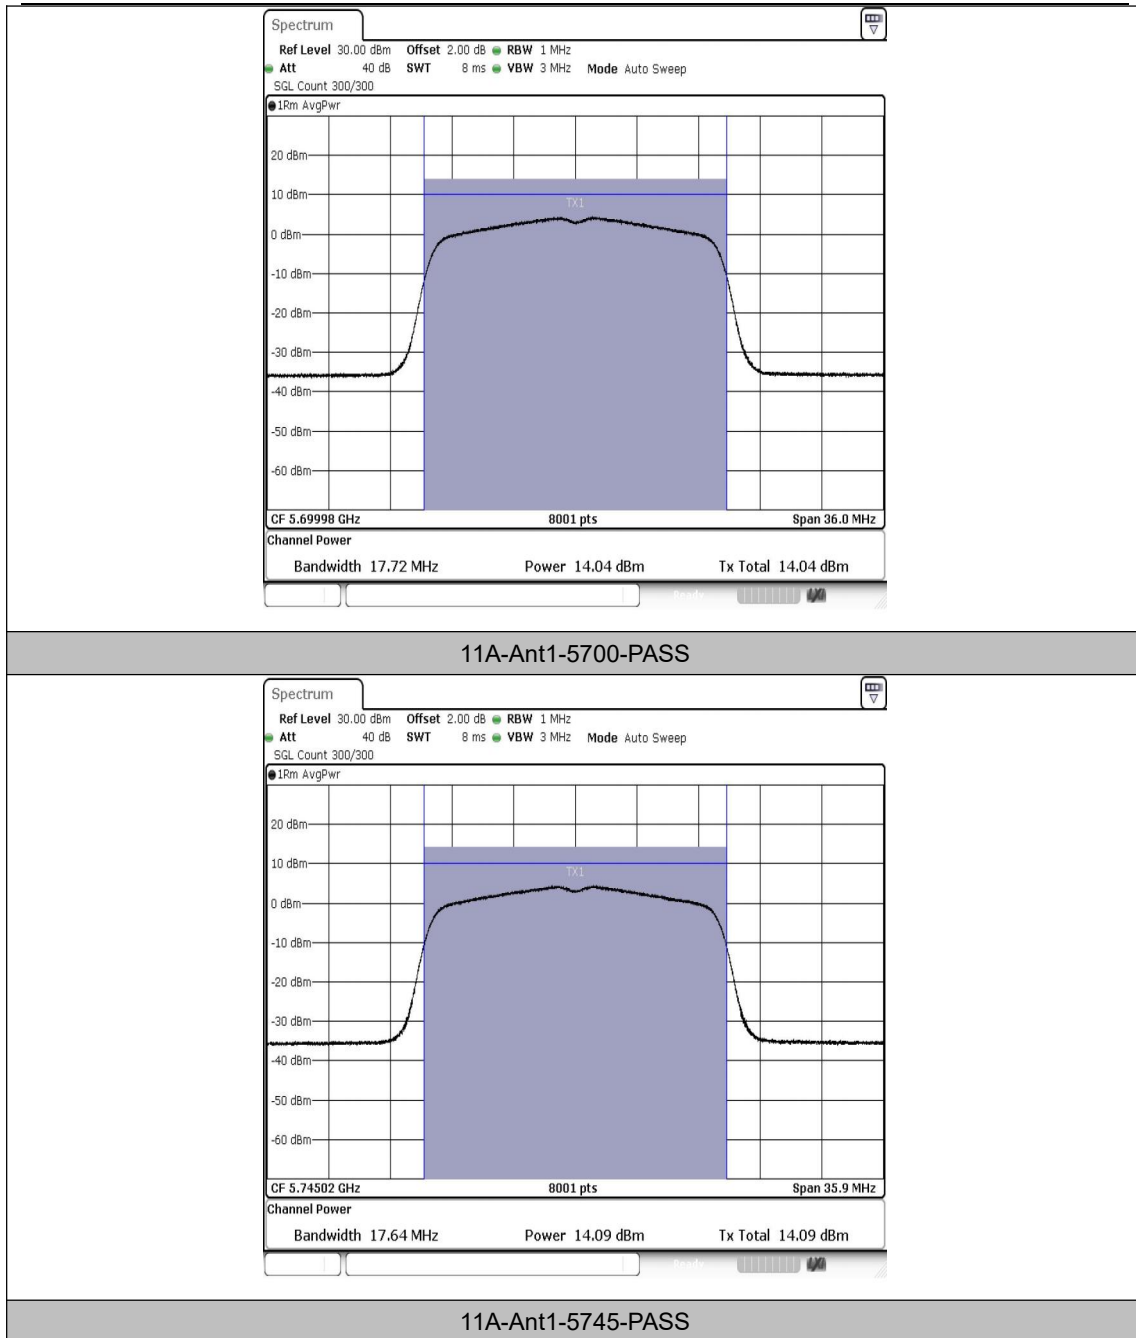

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

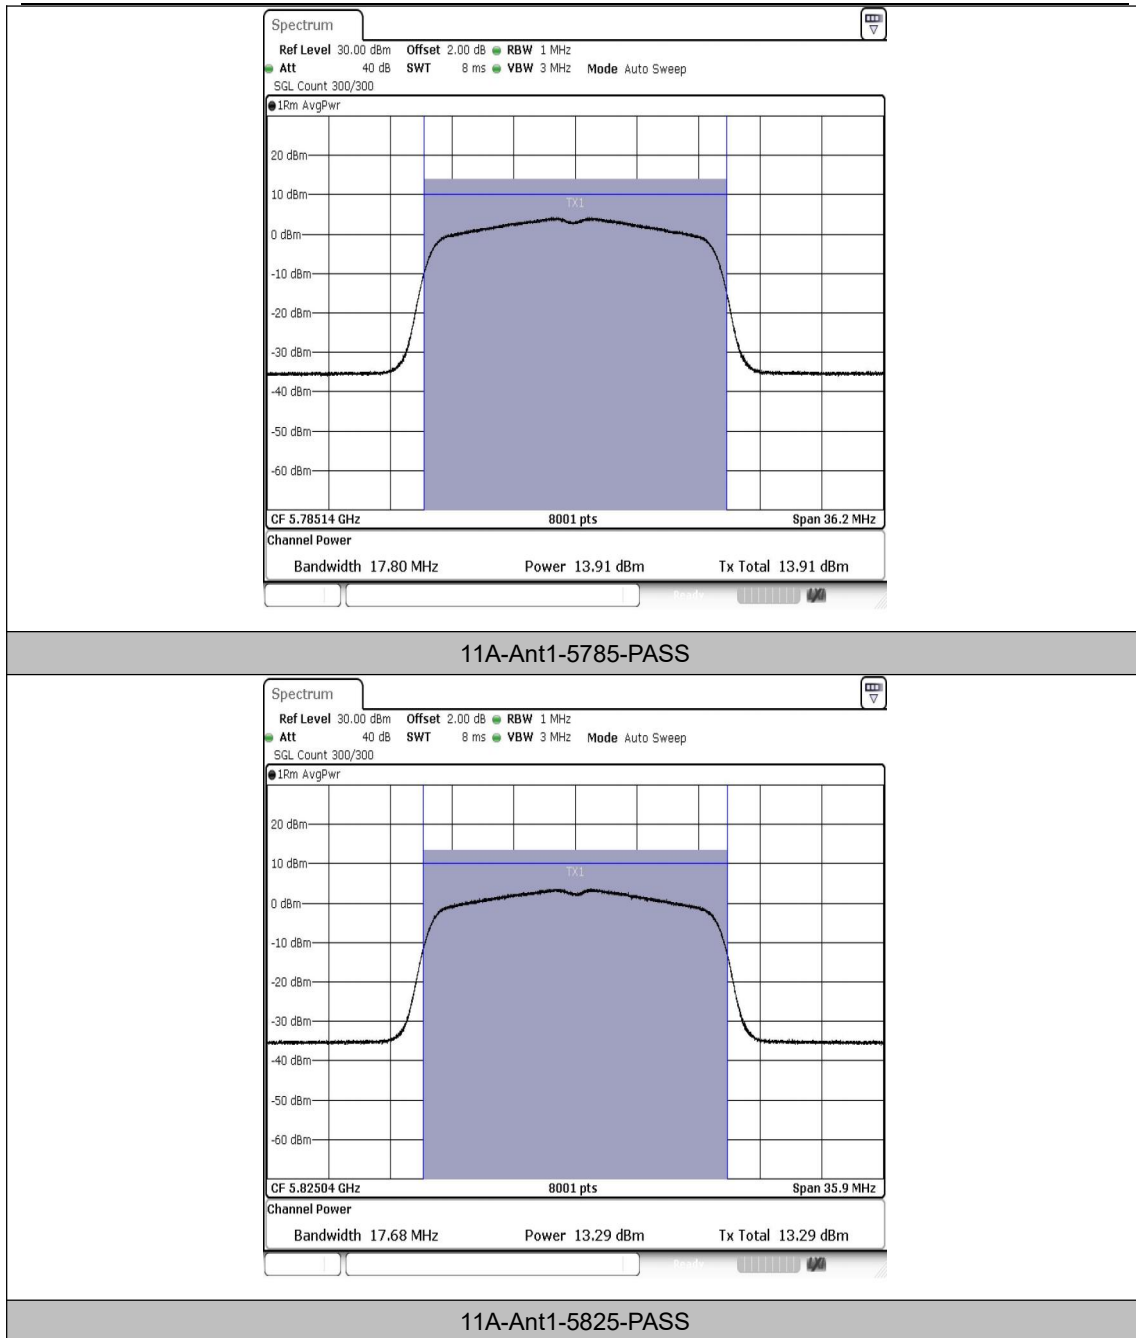

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

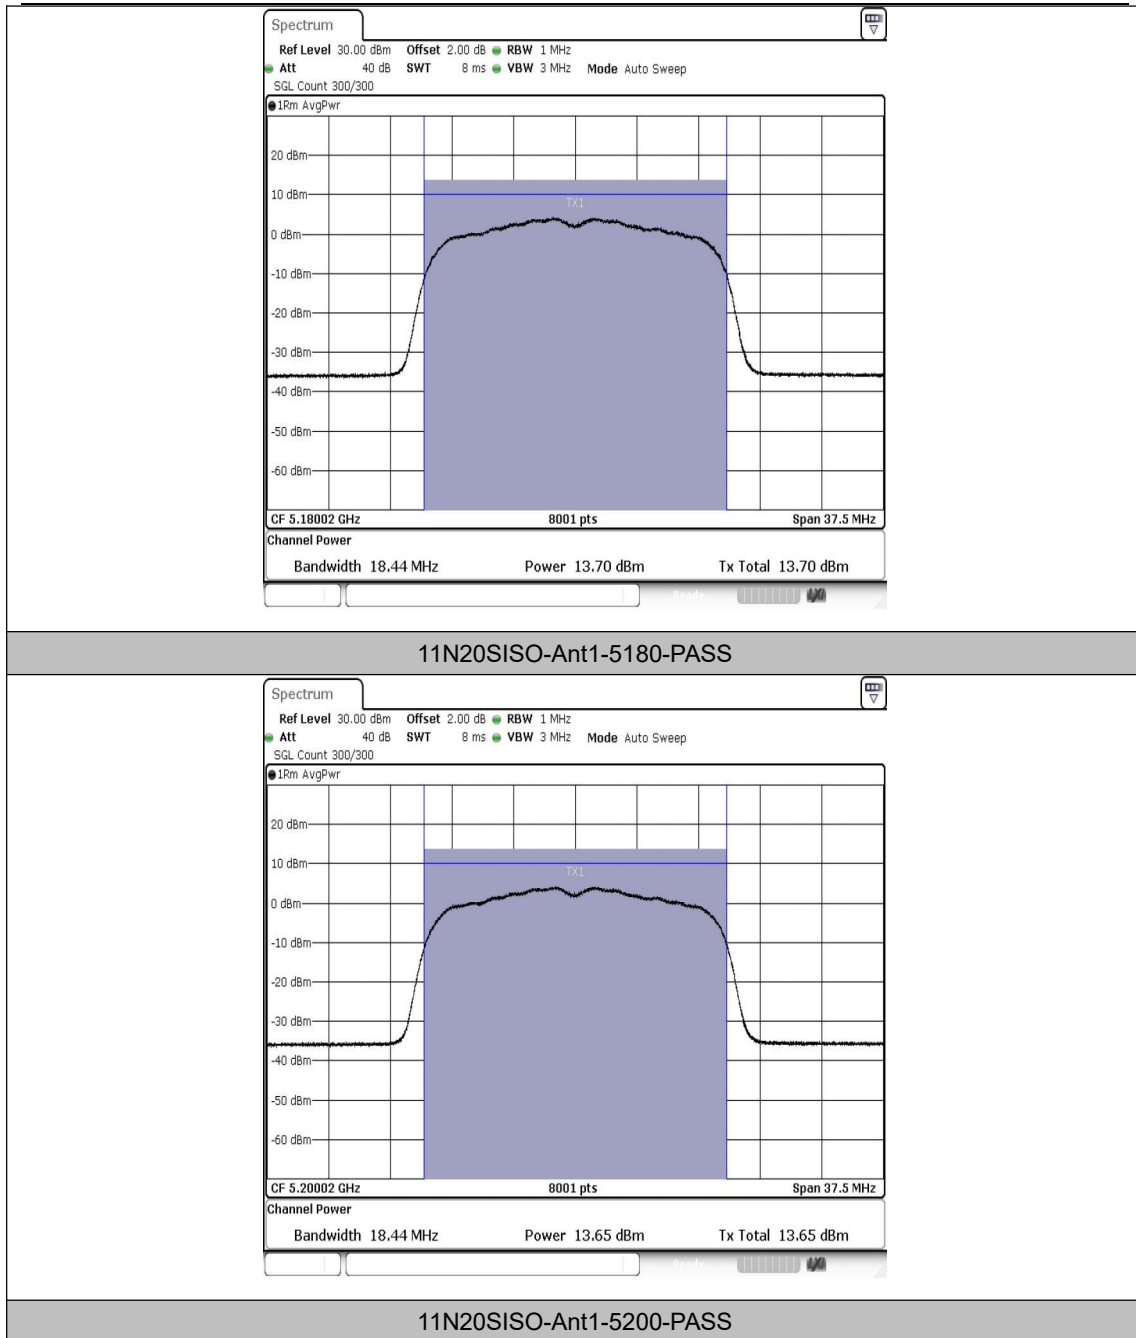



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

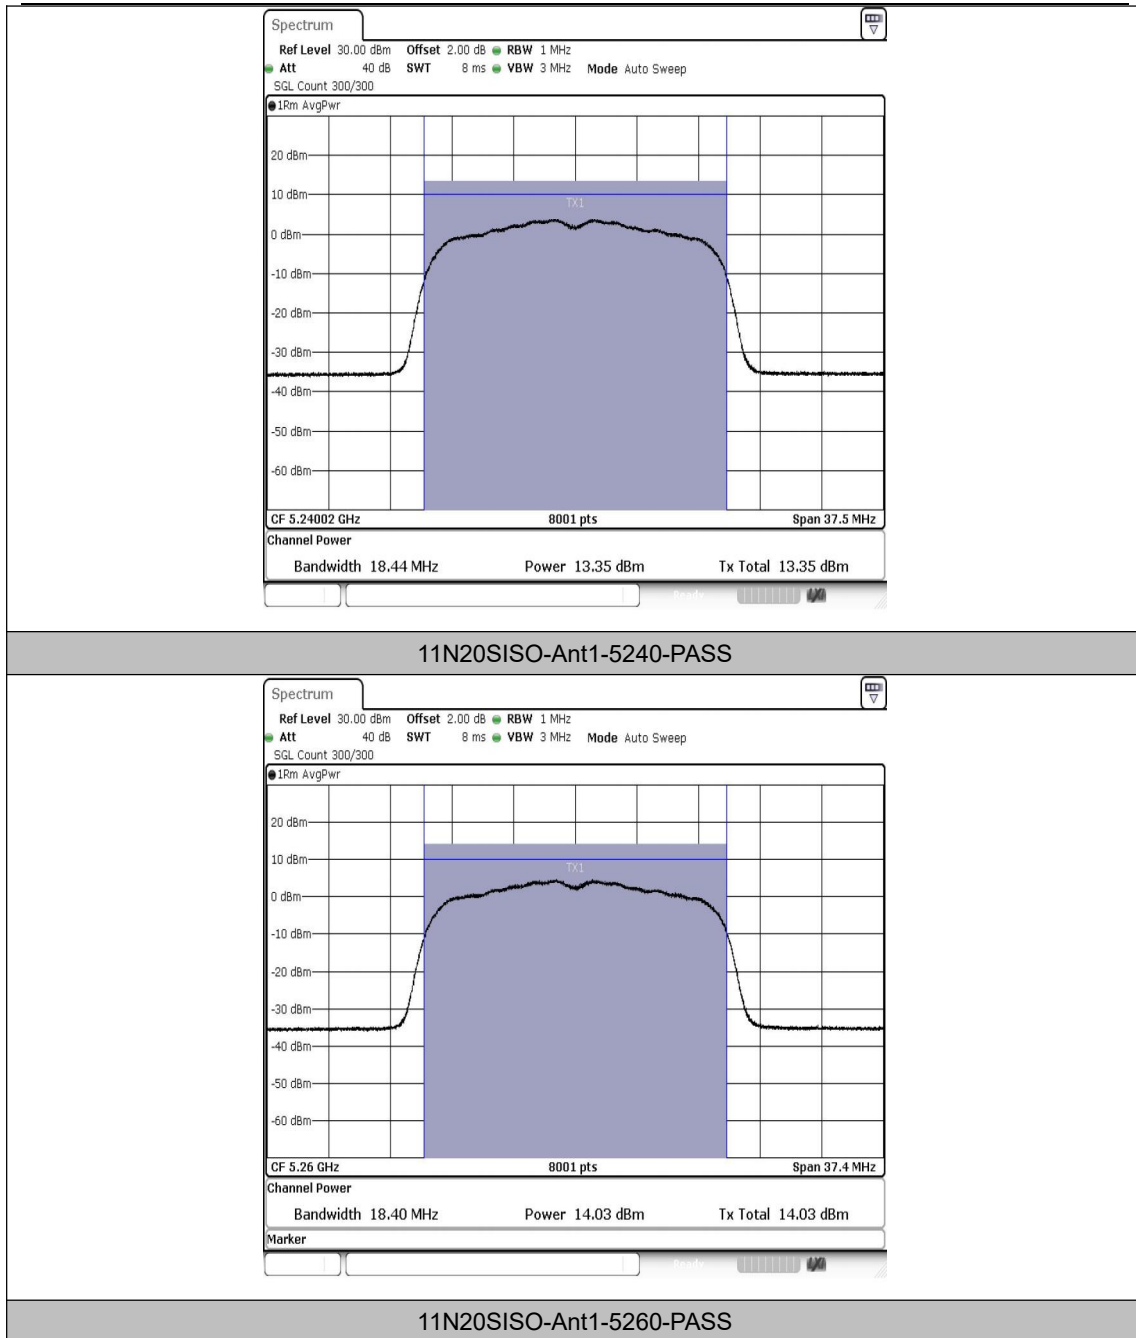

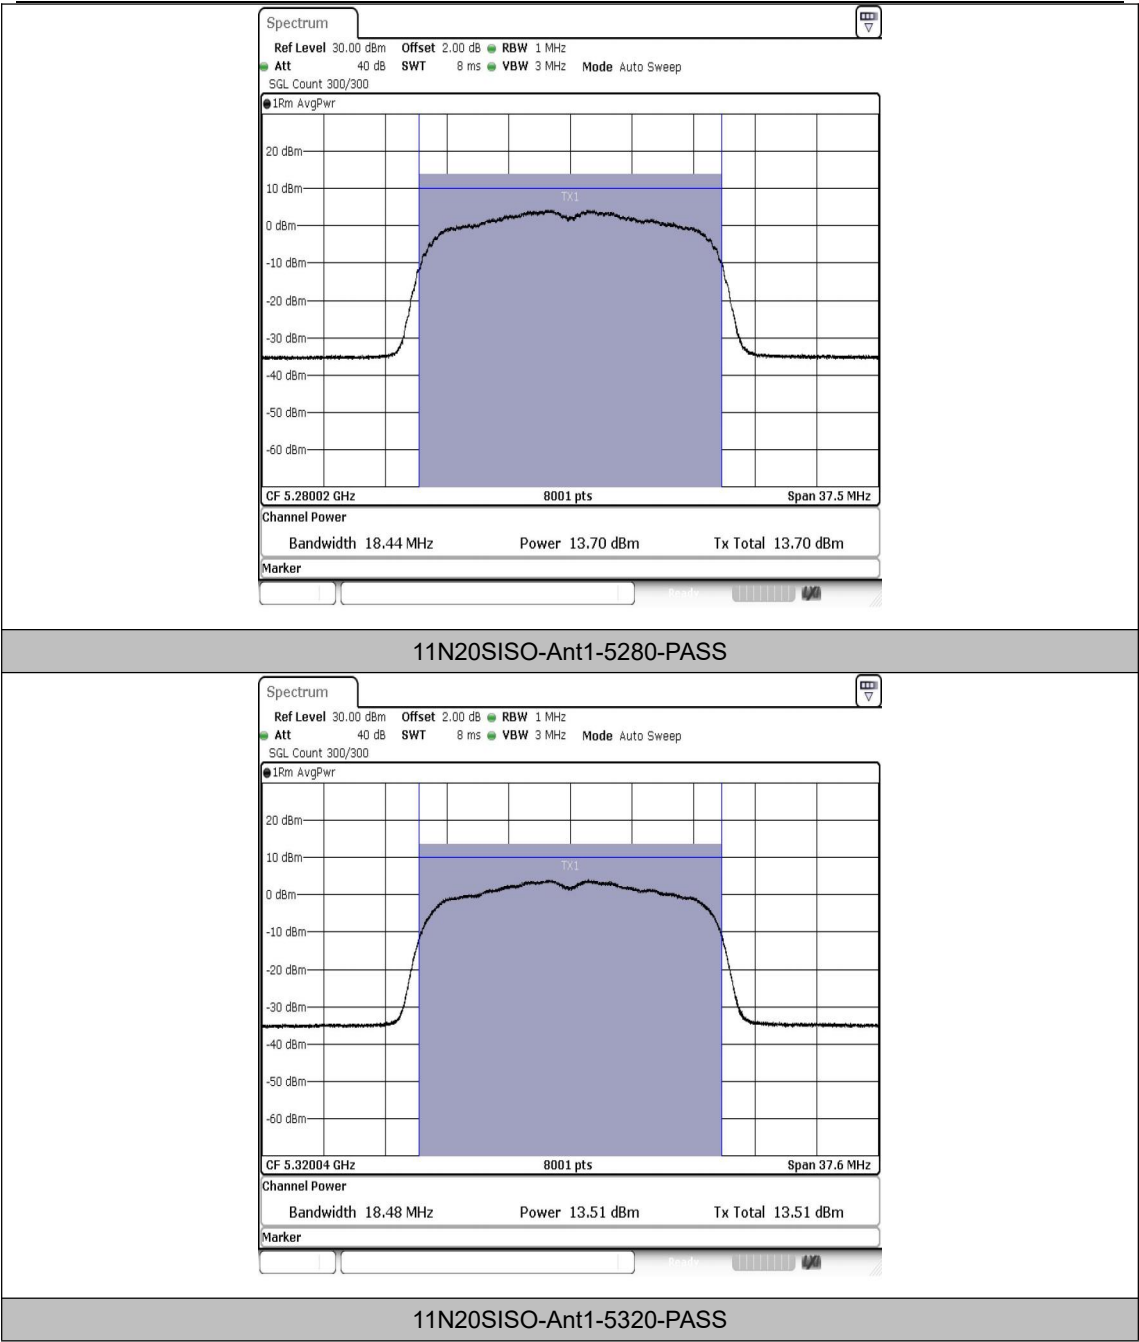


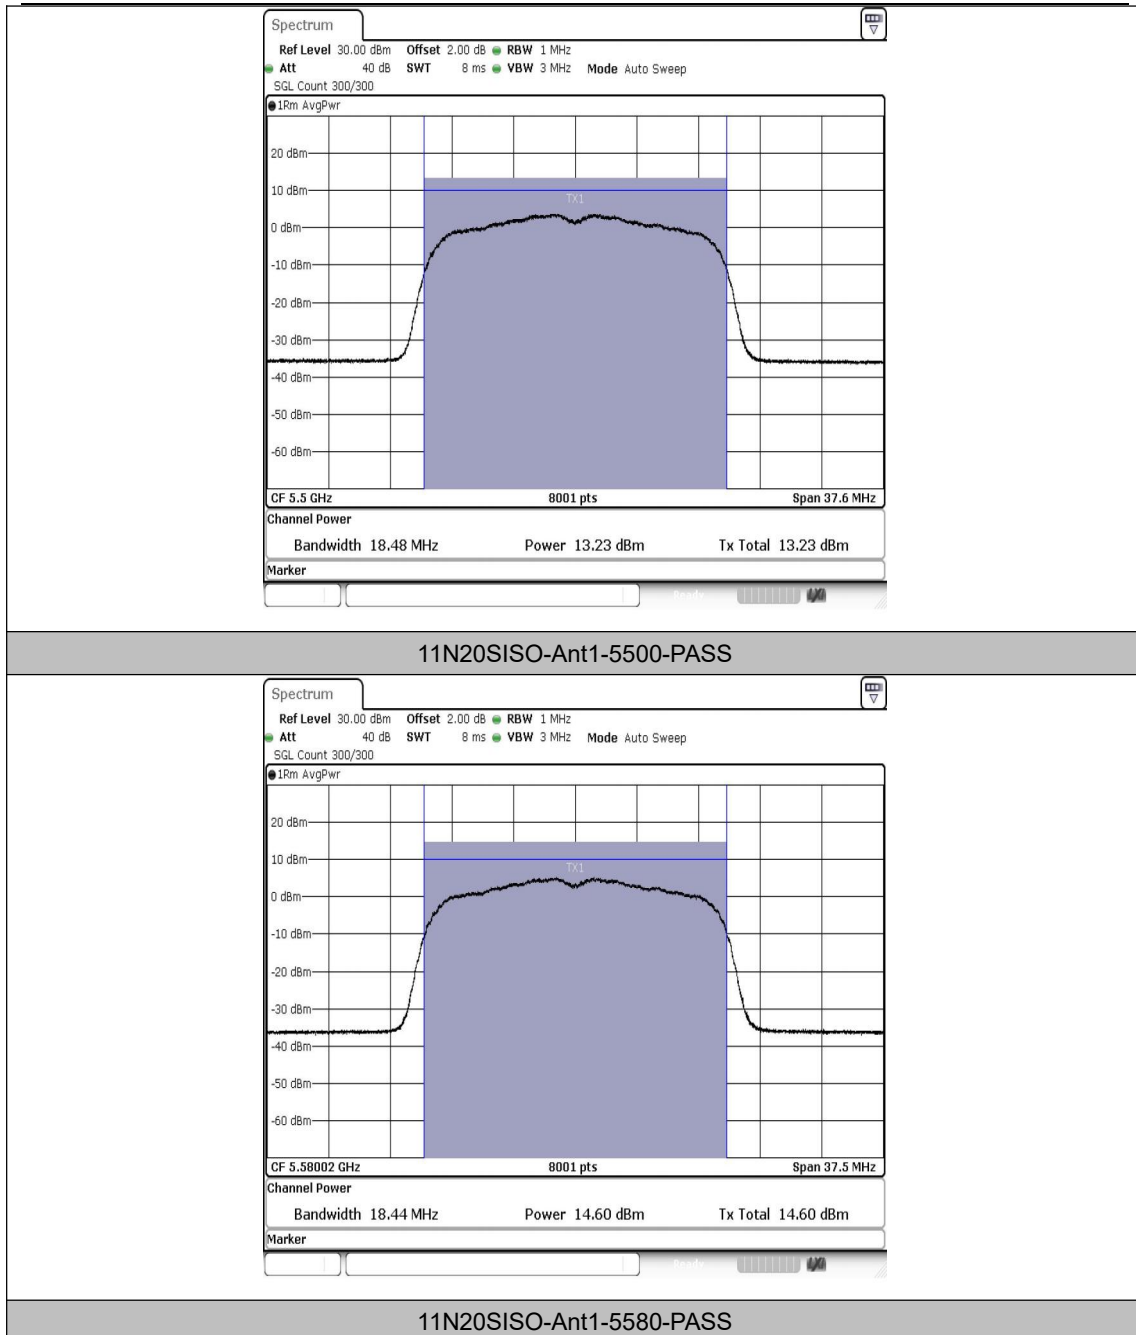

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

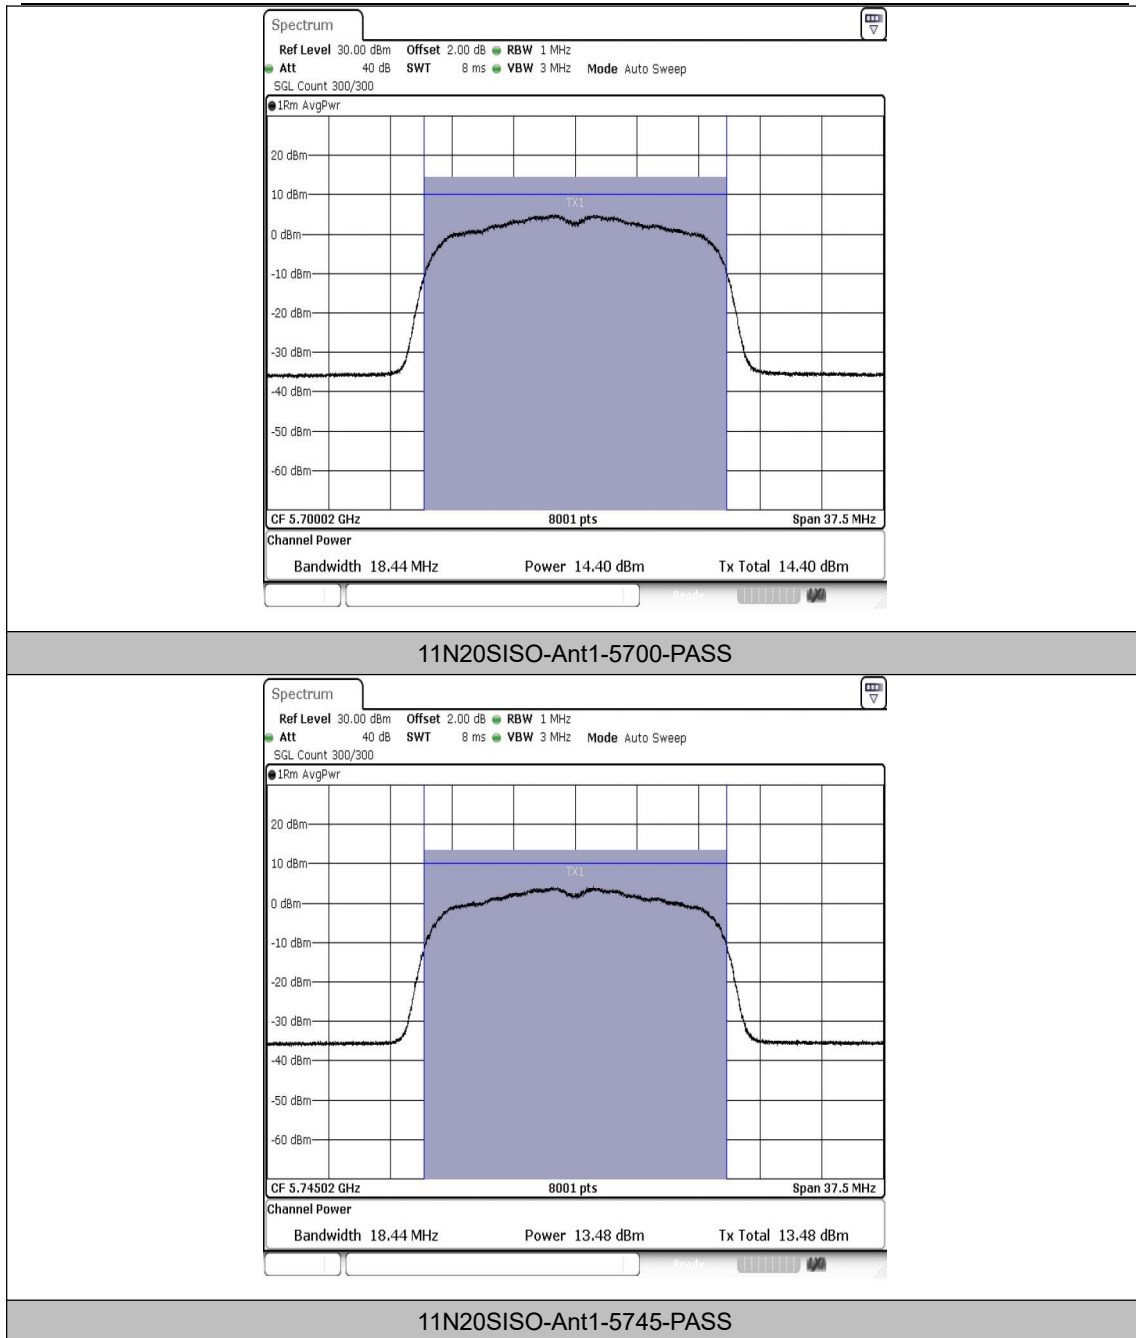

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

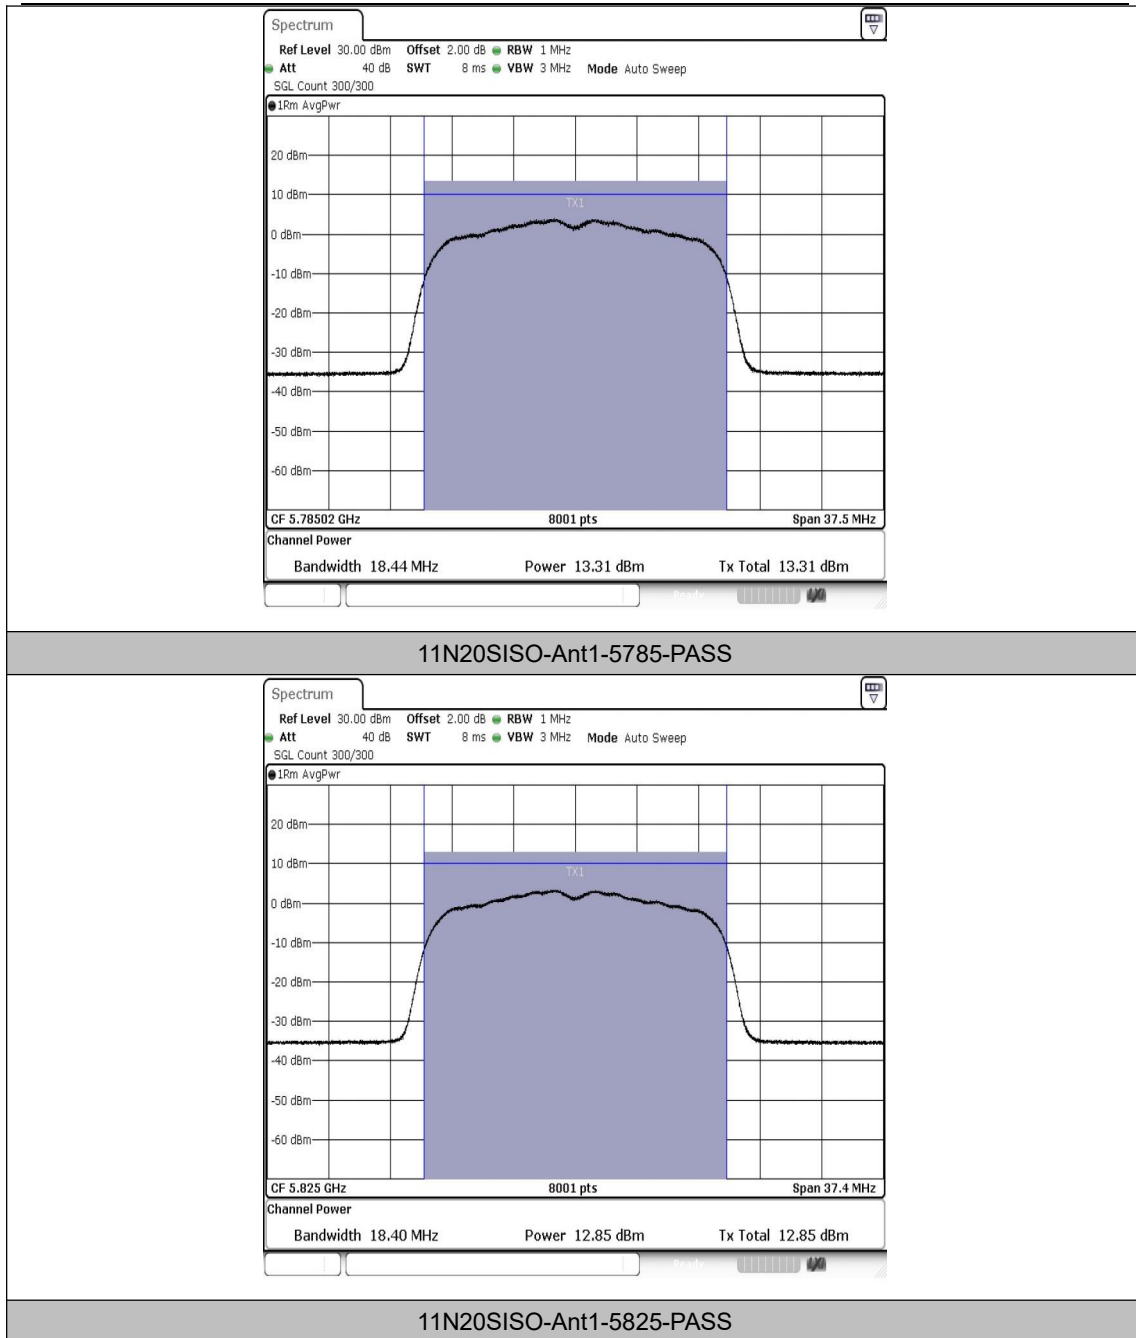

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

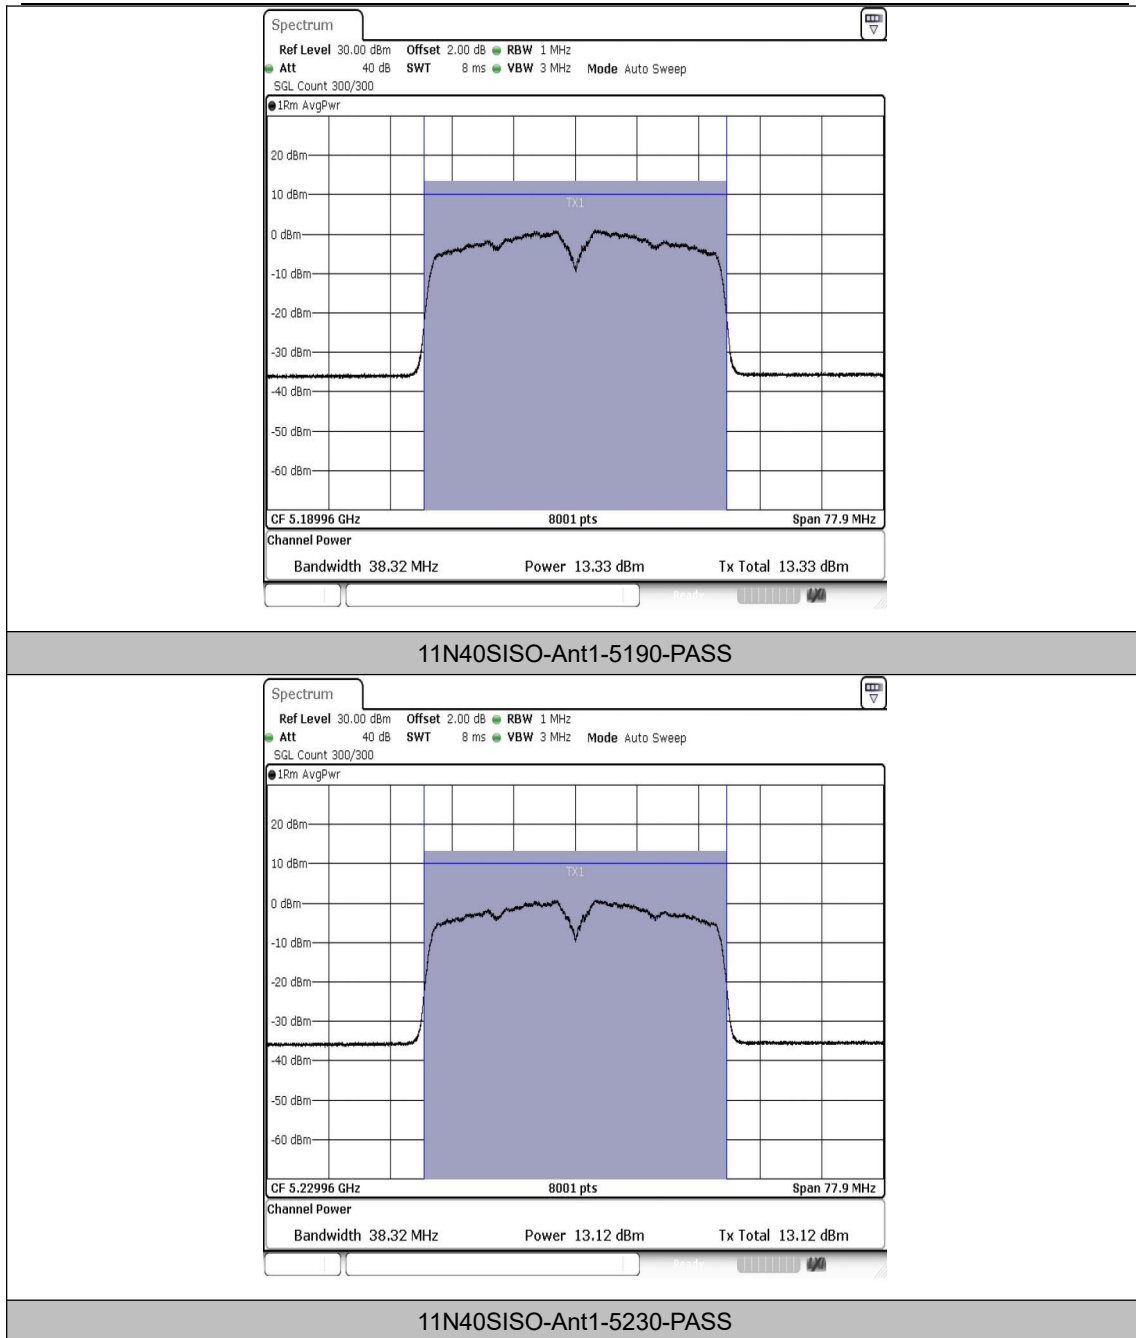

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

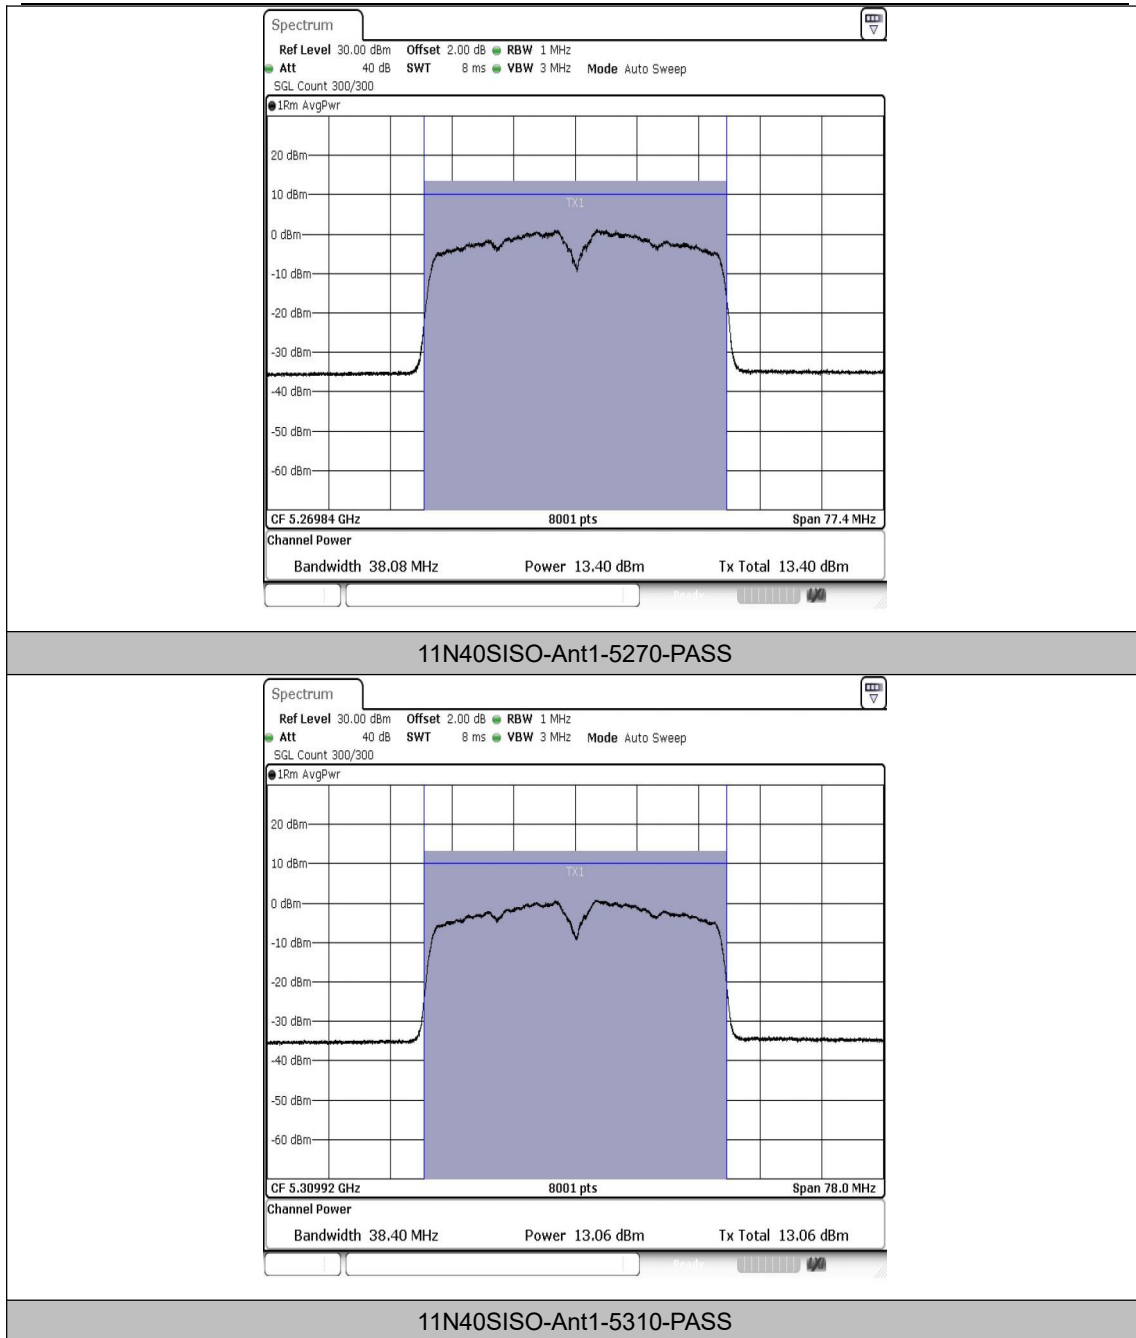

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

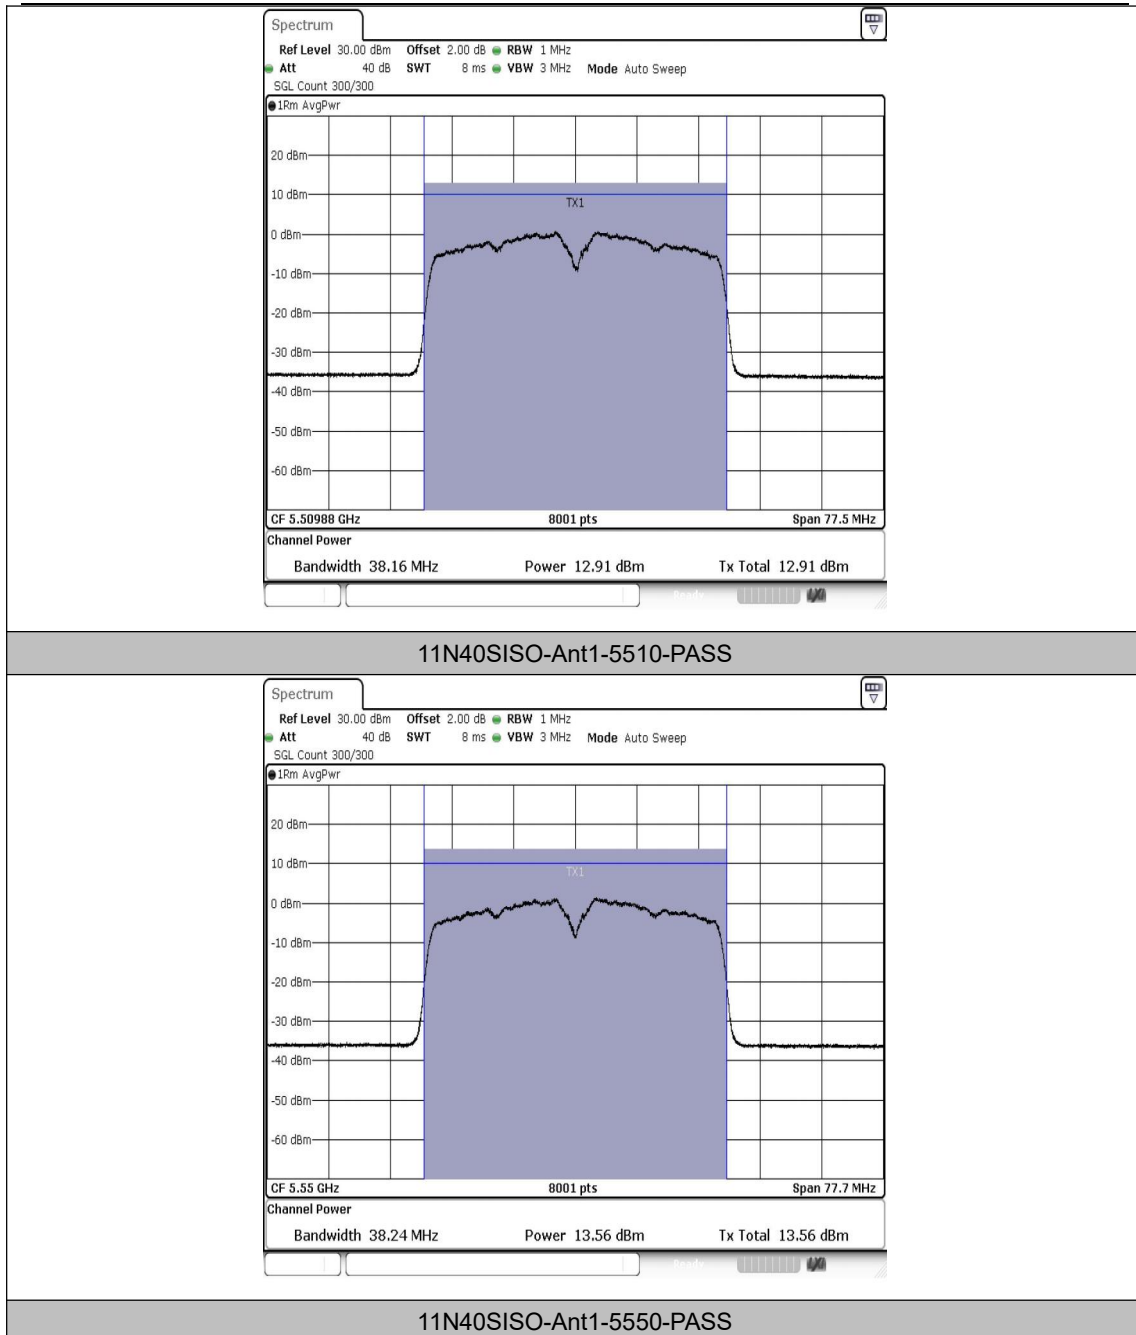

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

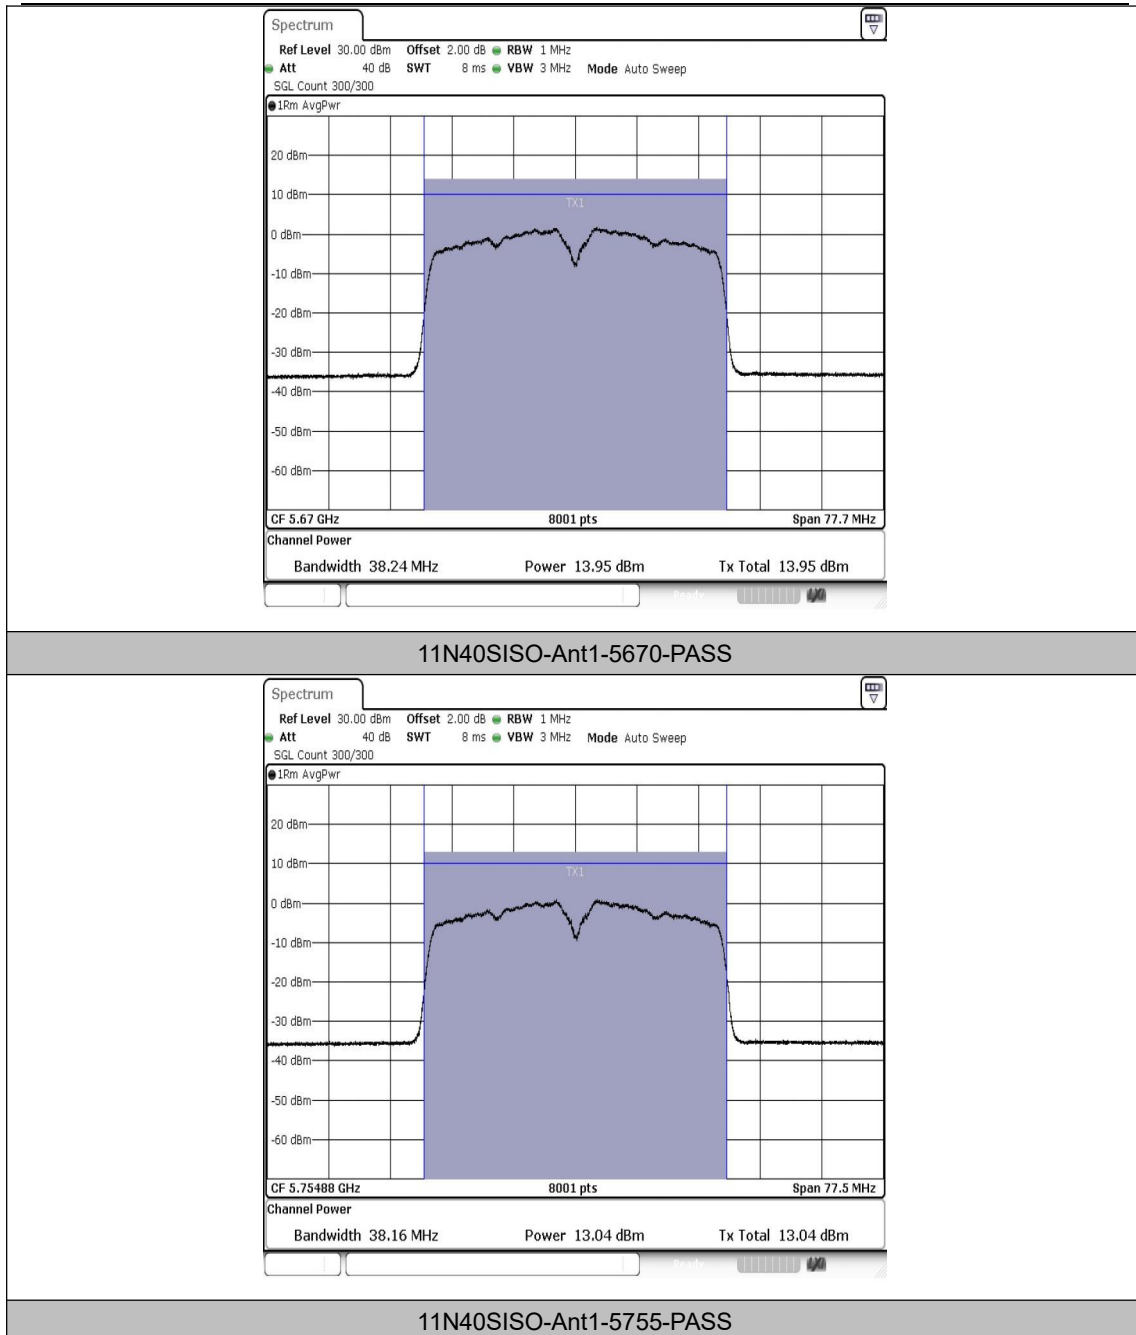

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

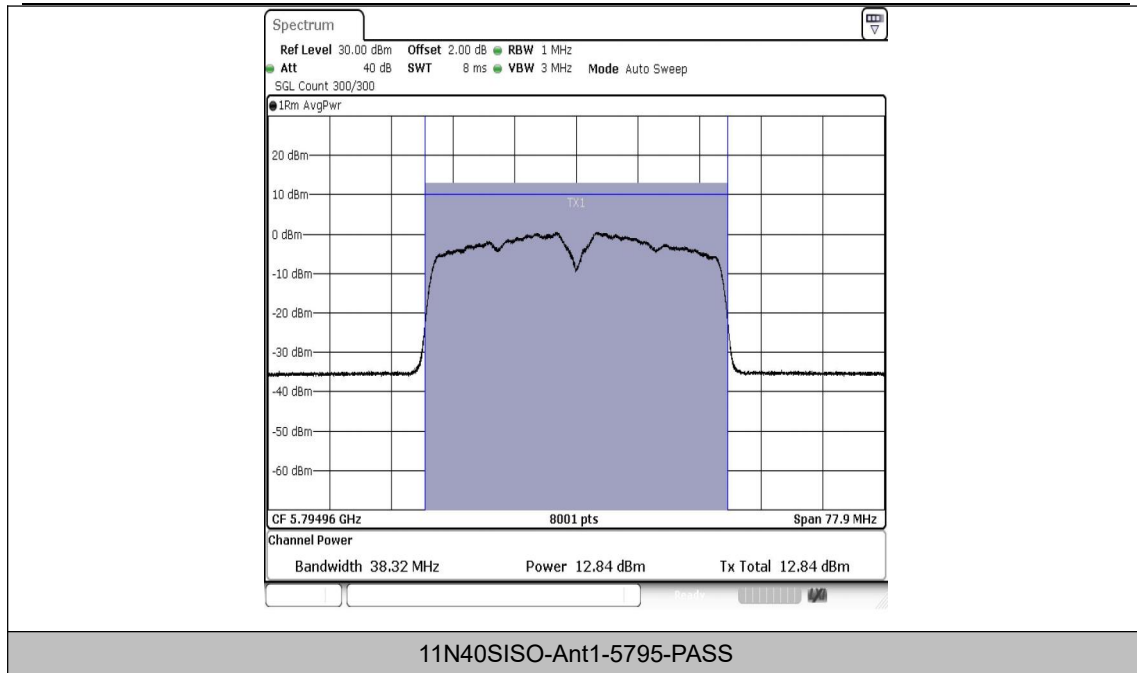

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11A	Ant1	5180	3.87	0.00	3.87	≤11.00	PASS
11A	Ant1	5200	4.28	0.00	4.28	≤11.00	PASS
11A	Ant1	5240	3.83	0.00	3.83	≤11.00	PASS
11A	Ant1	5260	4.02	0.00	4.02	≤11.00	PASS
11A	Ant1	5280	3.48	0.00	3.48	≤11.00	PASS
11A	Ant1	5320	3.82	0.00	3.82	≤11.00	PASS
11A	Ant1	5500	3.11	0.00	3.11	≤11.00	PASS
11A	Ant1	5580	4.51	0.00	4.51	≤11.00	PASS
11A	Ant1	5700	4.68	0.00	4.68	≤11.00	PASS
11N20SISO	Ant1	5180	3.87	0.00	3.87	≤11.00	PASS
11N20SISO	Ant1	5200	3.56	0.00	3.56	≤11.00	PASS
11N20SISO	Ant1	5240	3.76	0.00	3.76	≤11.00	PASS
11N20SISO	Ant1	5260	4.37	0.00	4.37	≤11.00	PASS
11N20SISO	Ant1	5280	4.43	0.00	4.43	≤11.00	PASS
11N20SISO	Ant1	5320	3.63	0.00	3.63	≤11.00	PASS
11N20SISO	Ant1	5500	3.81	0.00	3.81	≤11.00	PASS
11N20SISO	Ant1	5580	4.5	0.00	4.50	≤11.00	PASS
11N20SISO	Ant1	5700	4.68	0.00	4.68	≤11.00	PASS
11N40SISO	Ant1	5190	0.98	0.00	0.98	≤11.00	PASS
11N40SISO	Ant1	5230	1.19	0.00	1.19	≤11.00	PASS
11N40SISO	Ant1	5270	1.07	0.00	1.07	≤11.00	PASS
11N40SISO	Ant1	5310	0.86	0.00	0.86	≤11.00	PASS
11N40SISO	Ant1	5510	0.19	0.00	0.19	≤11.00	PASS
11N40SISO	Ant1	5550	1.4	0.00	1.40	≤11.00	PASS
11N40SISO	Ant1	5670	2.13	0.00	2.13	≤11.00	PASS


Note: 1.The cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/500KHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11A	Ant1	5745	1.2	0.00	1.20	≤30.00	PASS
11A	Ant1	5785	1.12	0.00	1.12	≤30.00	PASS
11A	Ant1	5825	0.74	0.00	0.74	≤30.00	PASS
11N20SISO	Ant1	5745	1.74	0.00	1.74	≤30.00	PASS
11N20SISO	Ant1	5785	1.47	0.00	1.47	≤30.00	PASS
11N20SISO	Ant1	5825	0.55	0.00	0.55	≤30.00	PASS
11N40SISO	Ant1	5755	-1.35	0.00	-1.35	≤30.00	PASS
11N40SISO	Ant1	5795	-1.35	0.00	-1.35	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs B1/2/3

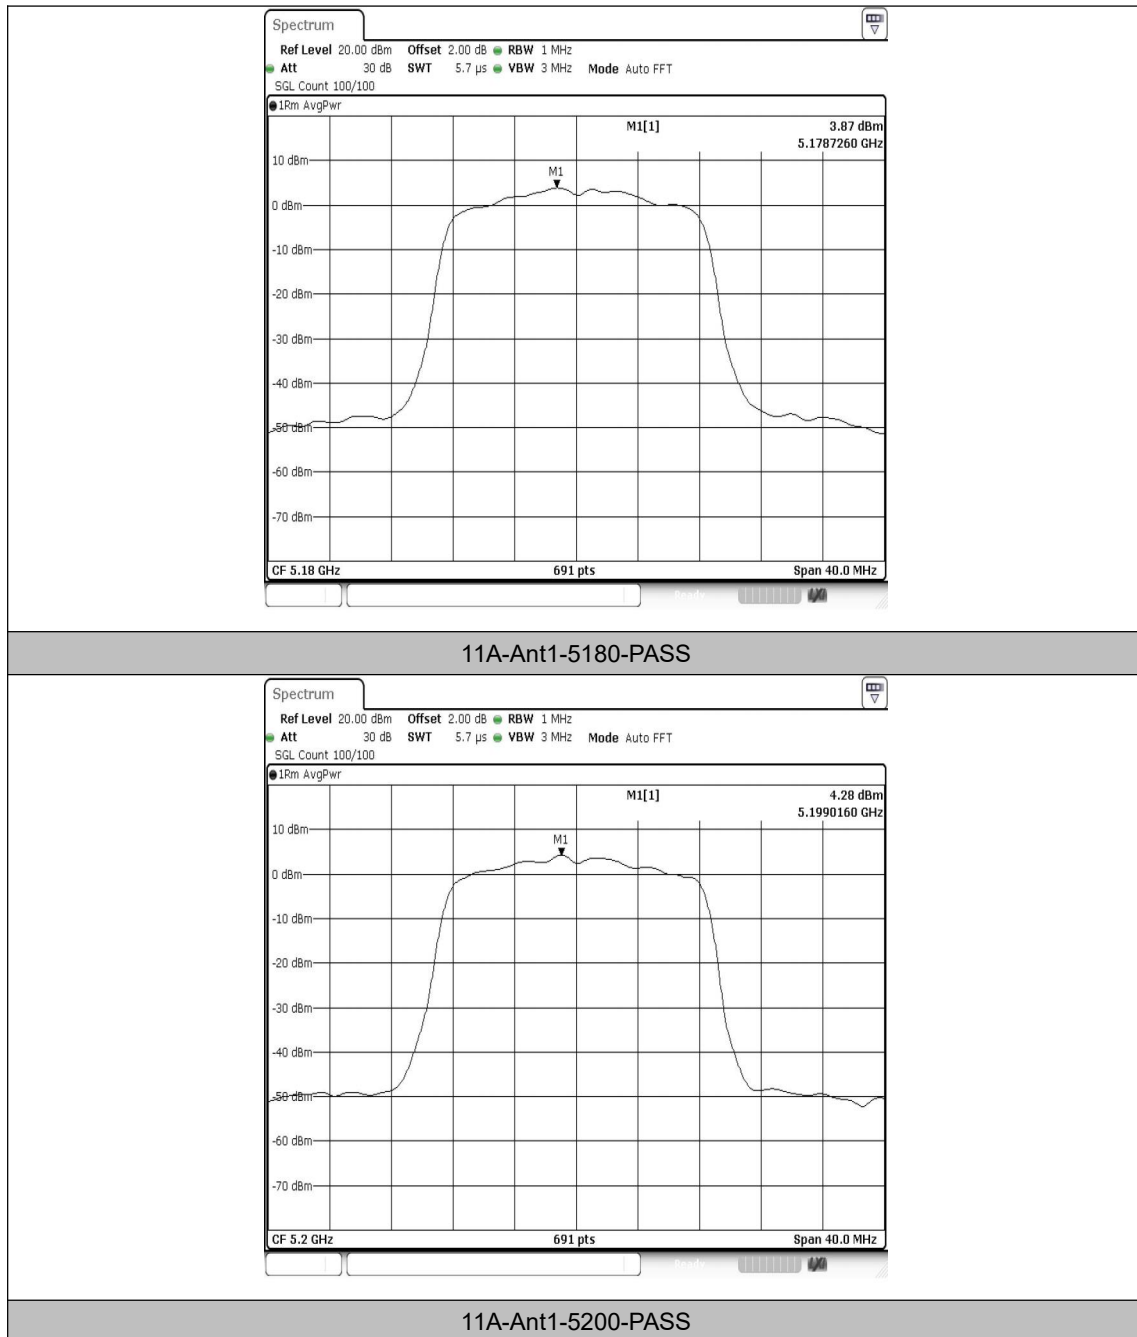

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

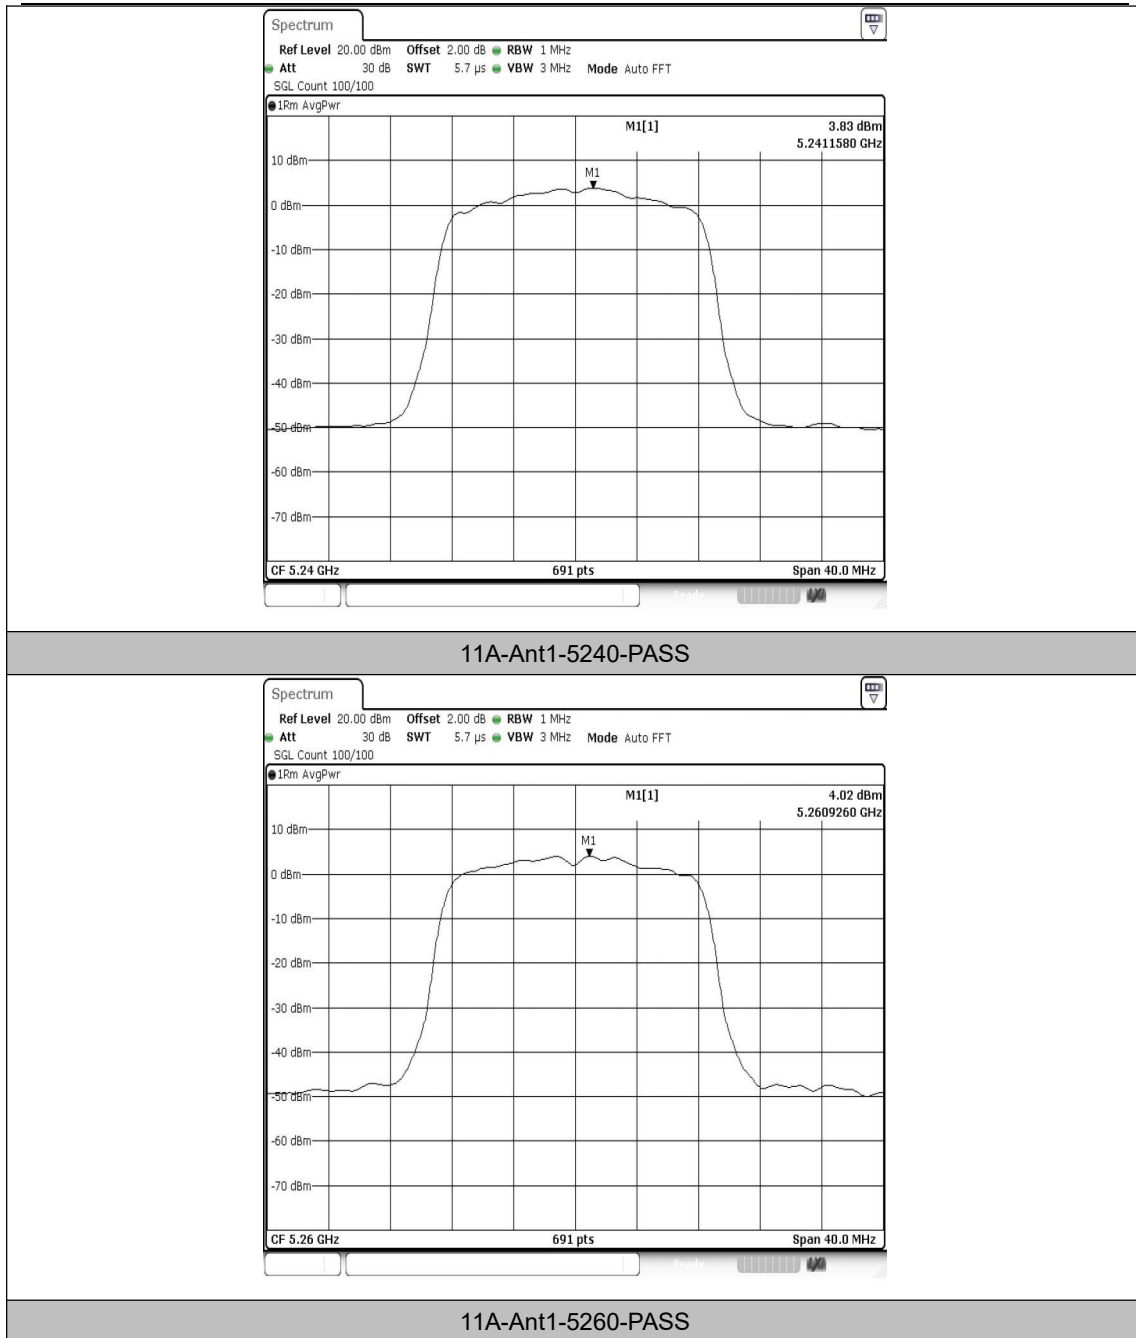

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

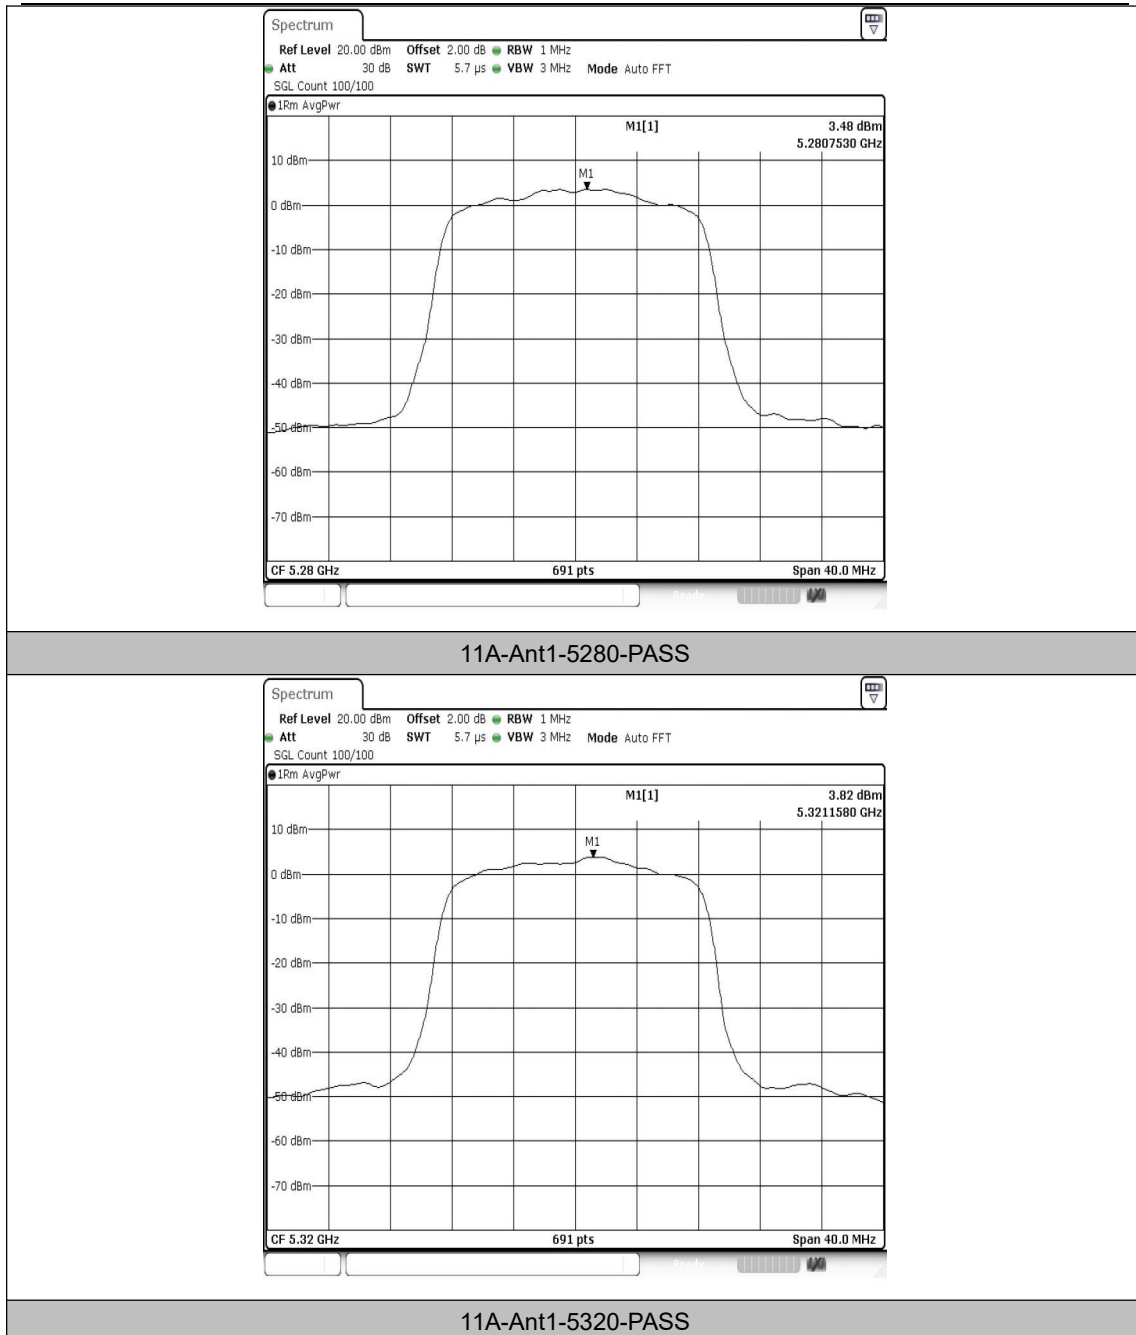

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

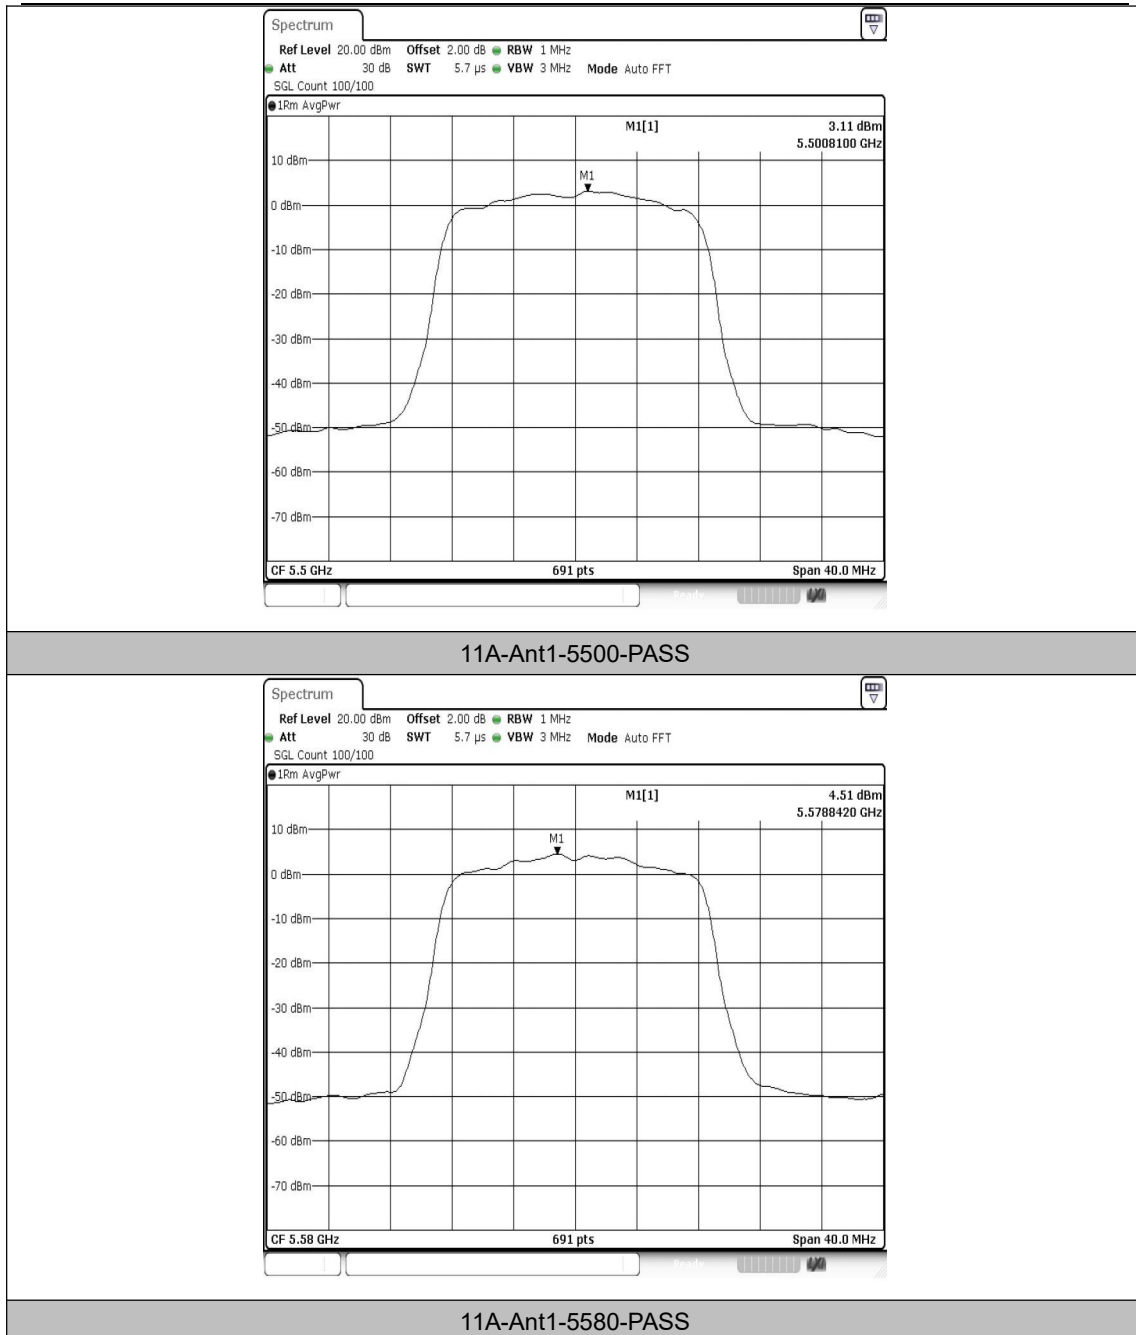

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

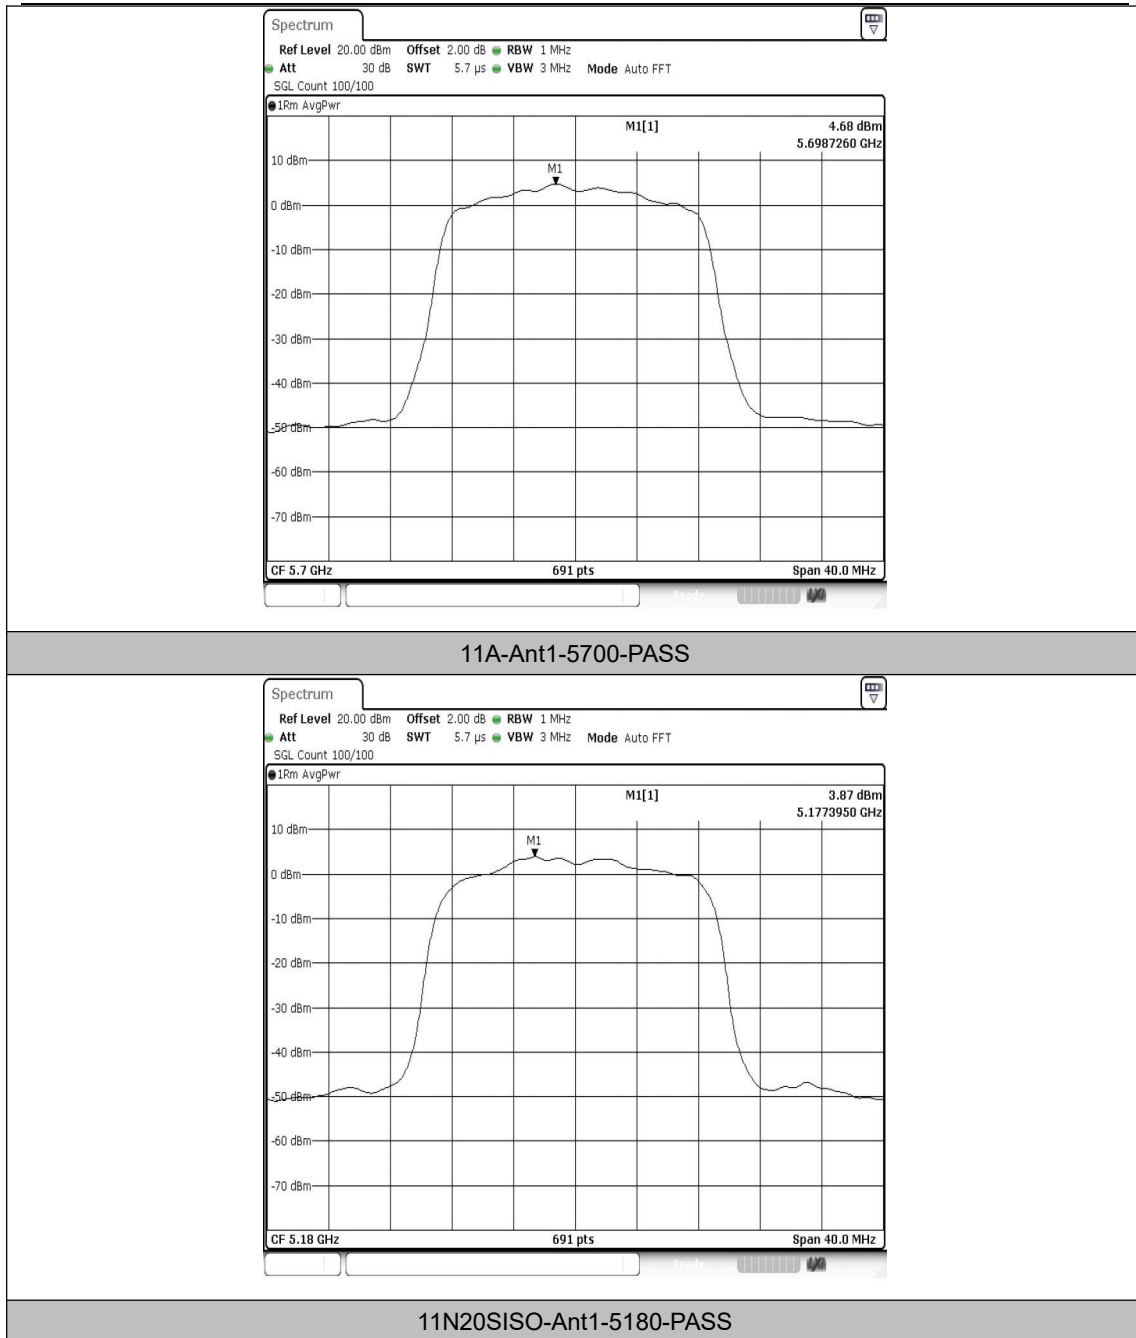

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

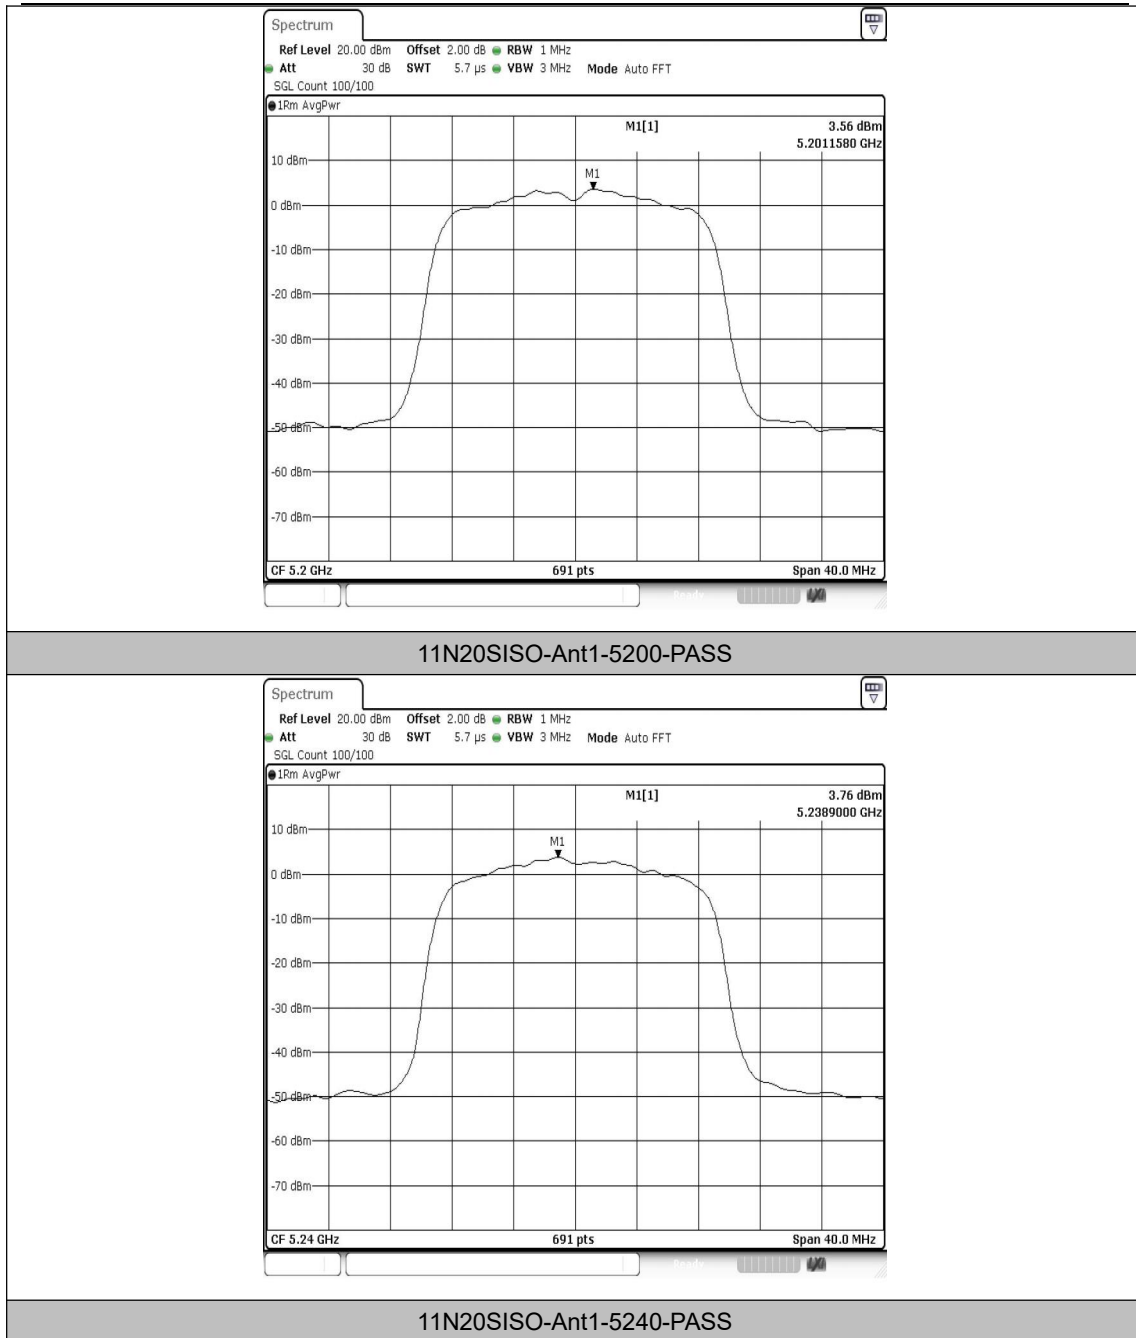

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

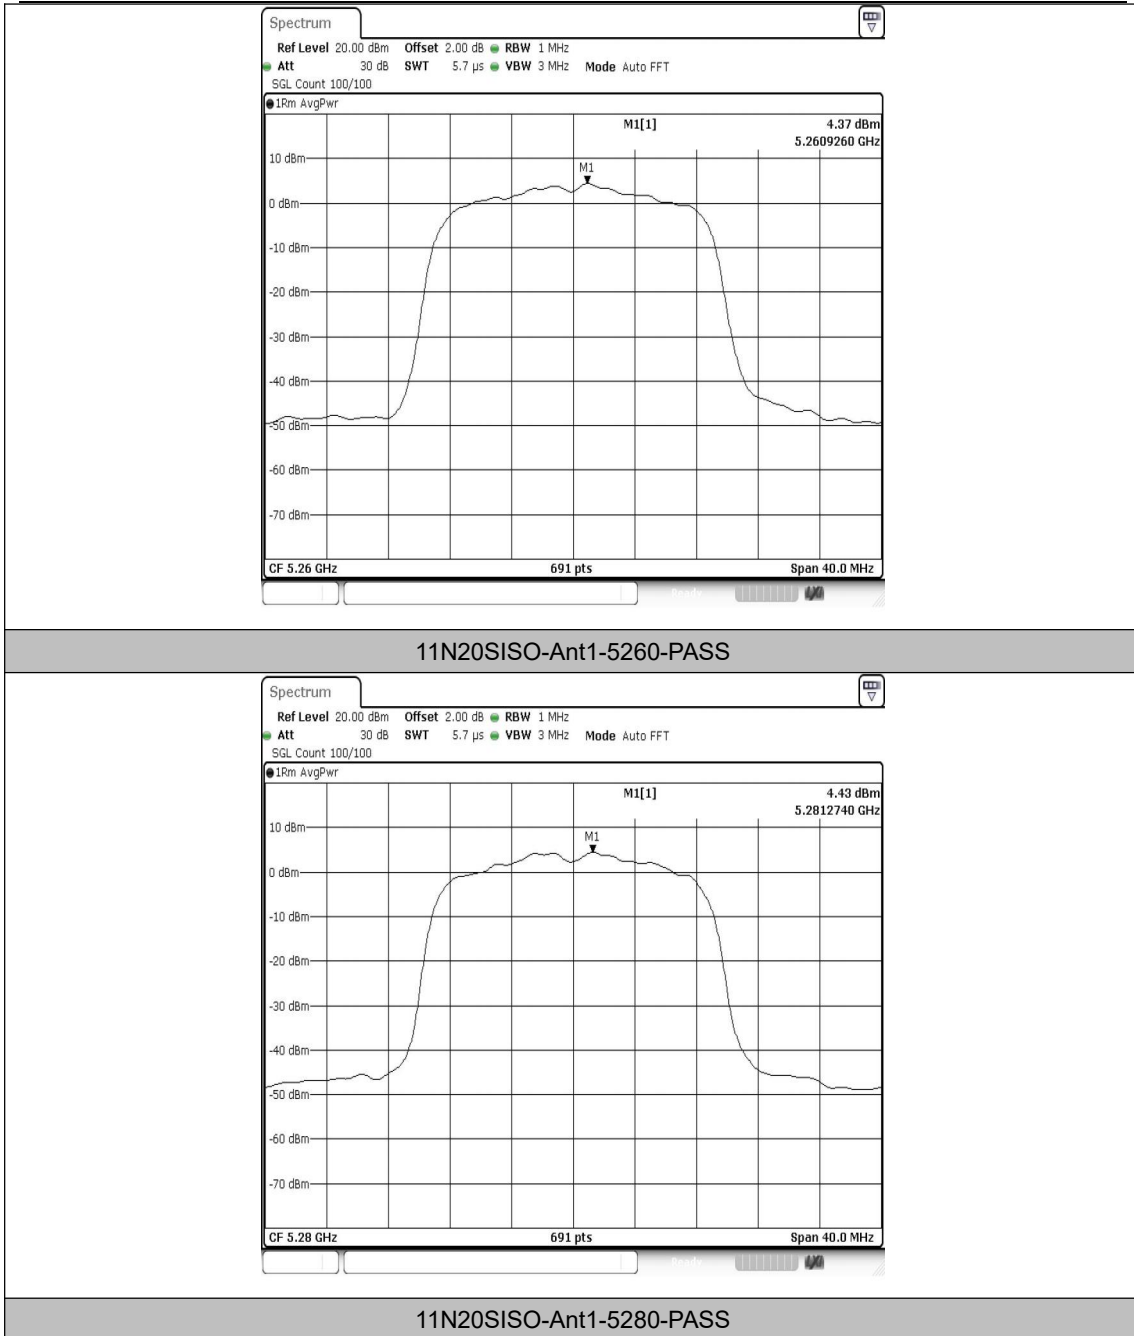

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

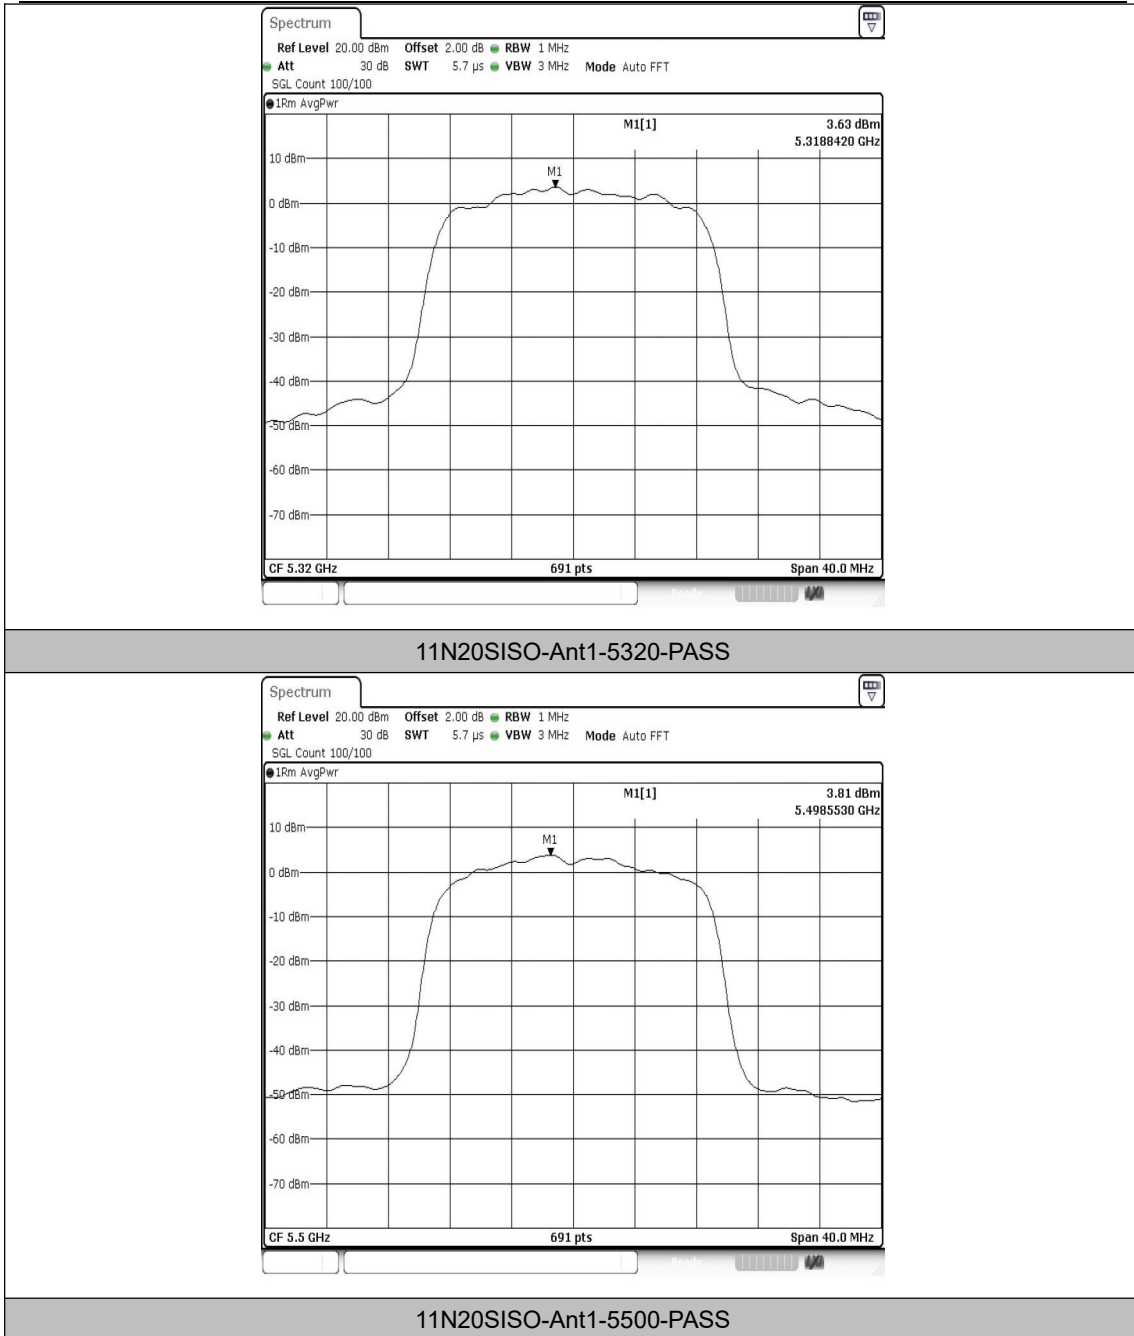

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

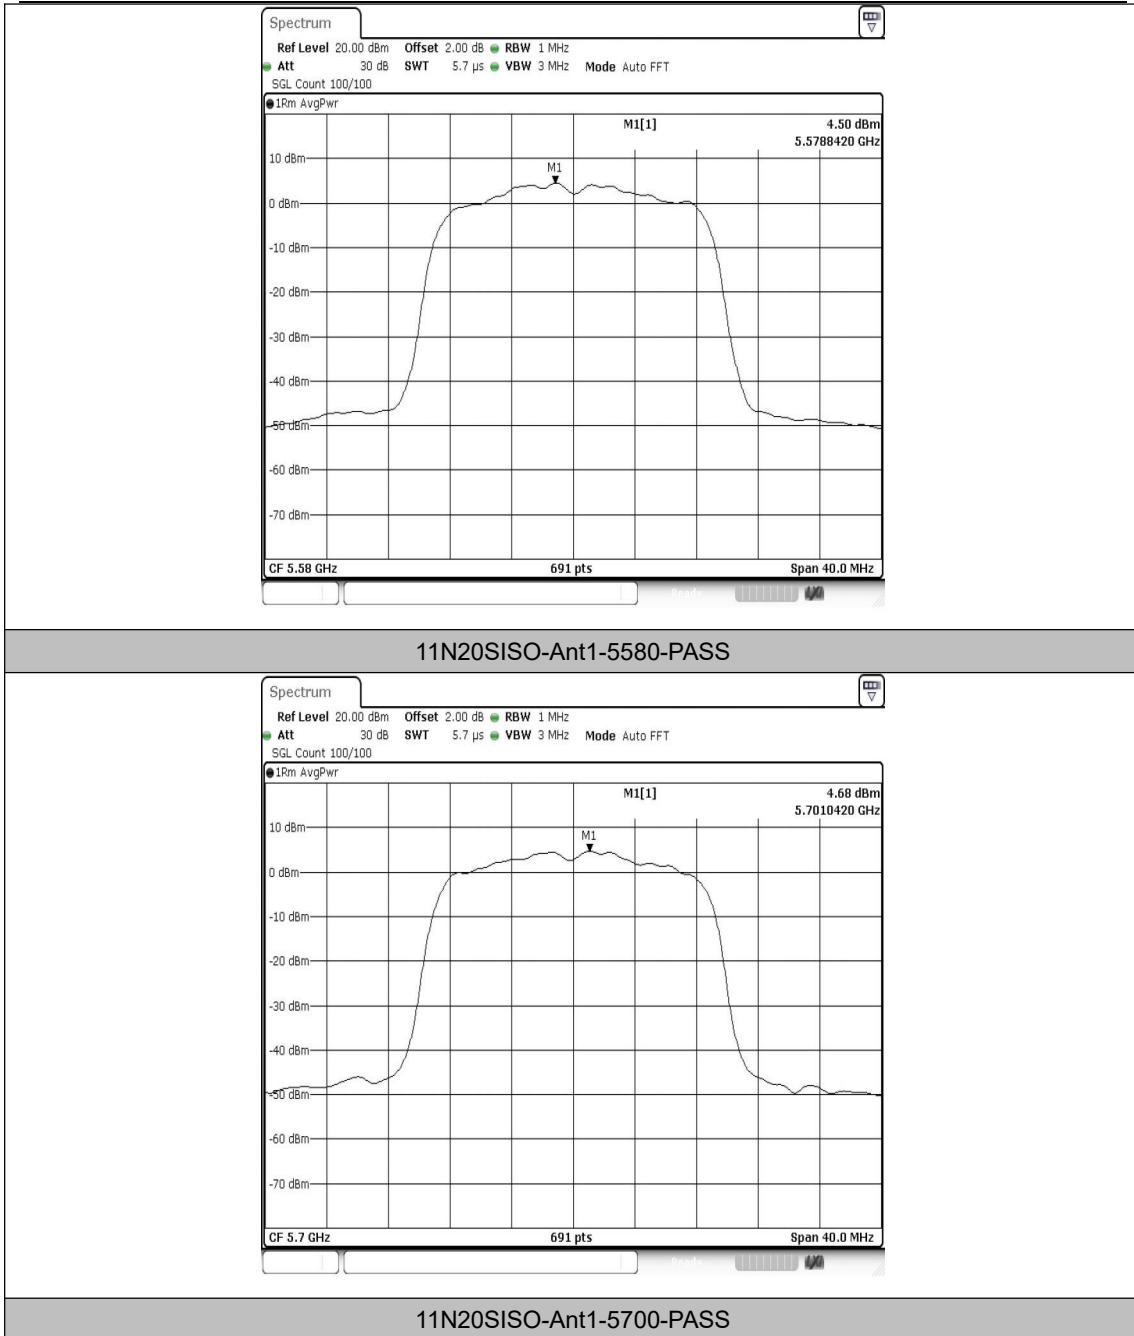

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

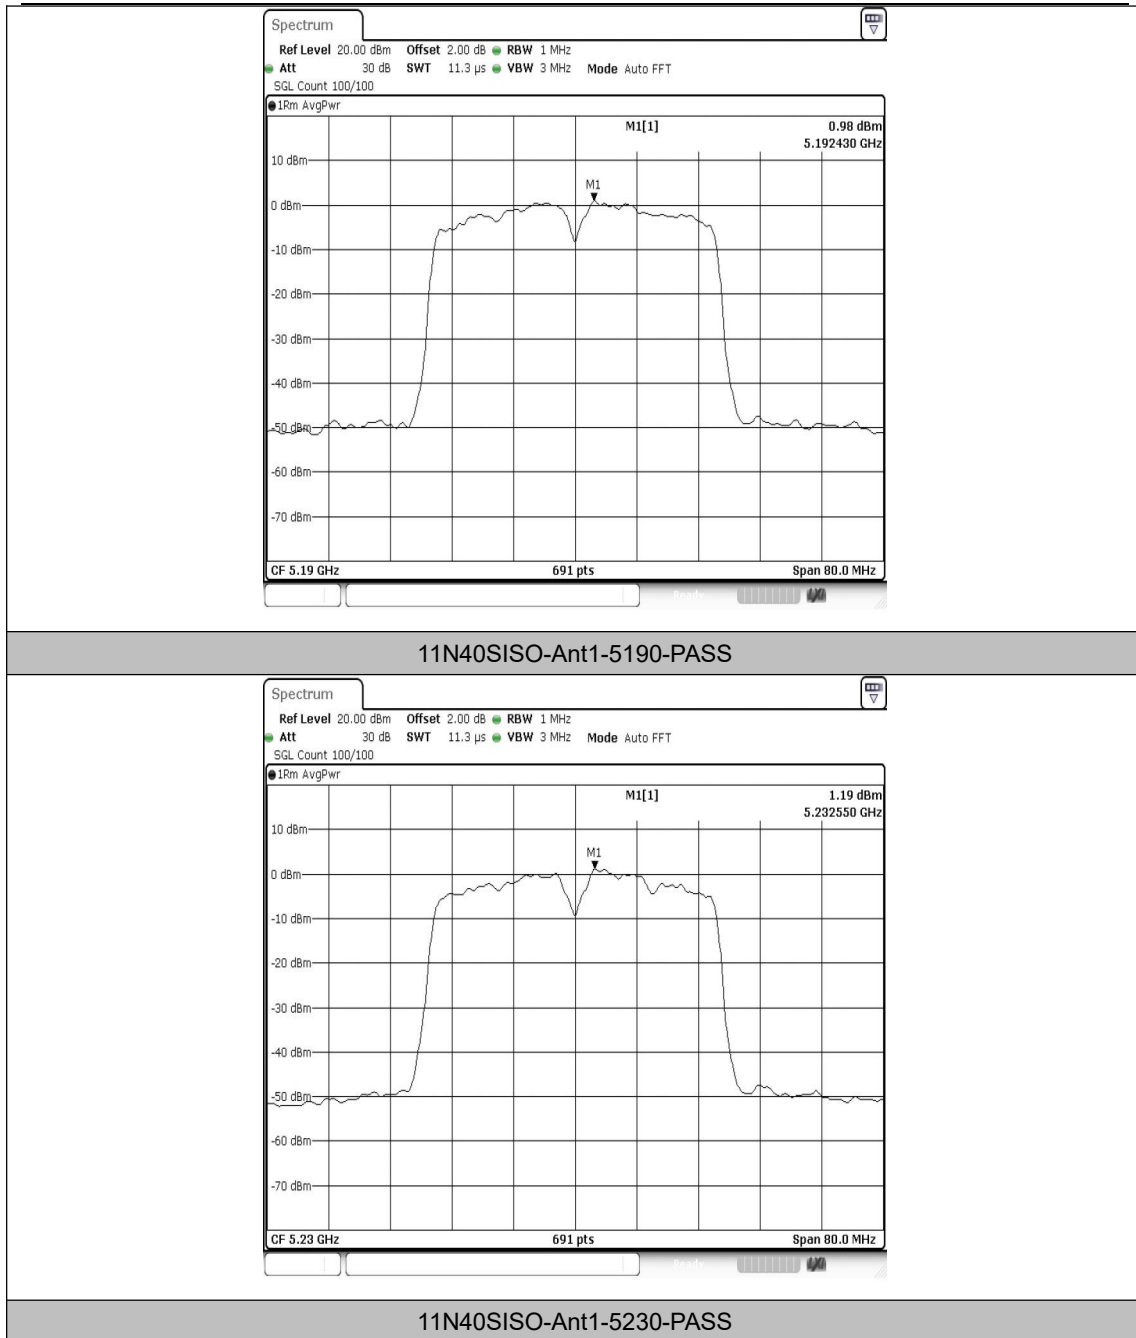

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

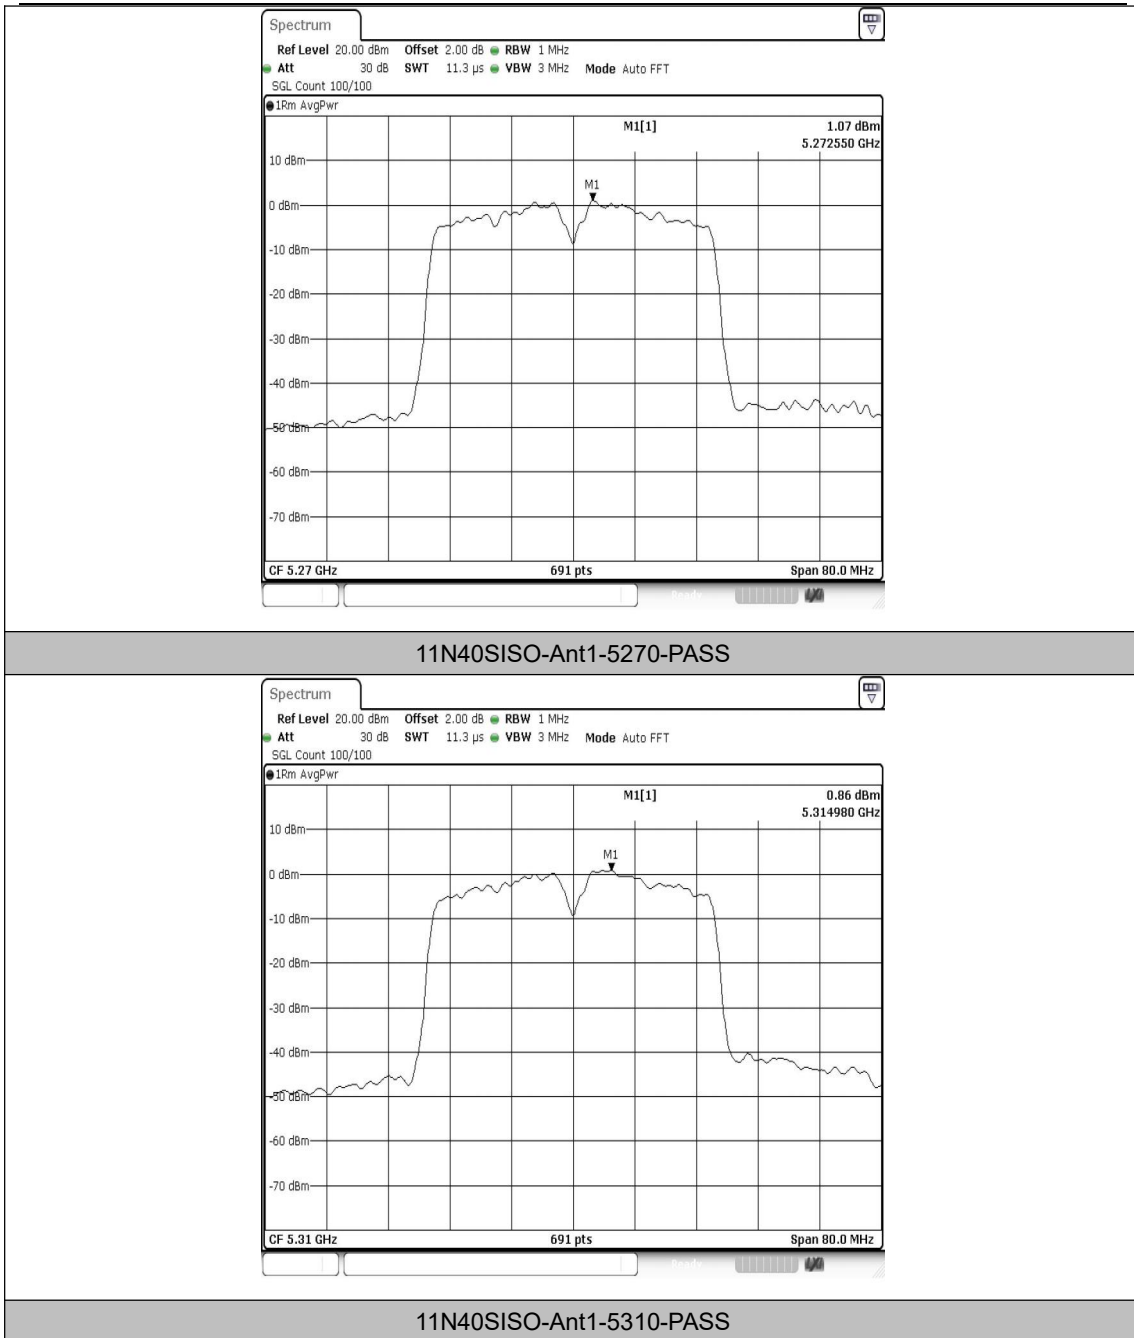


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

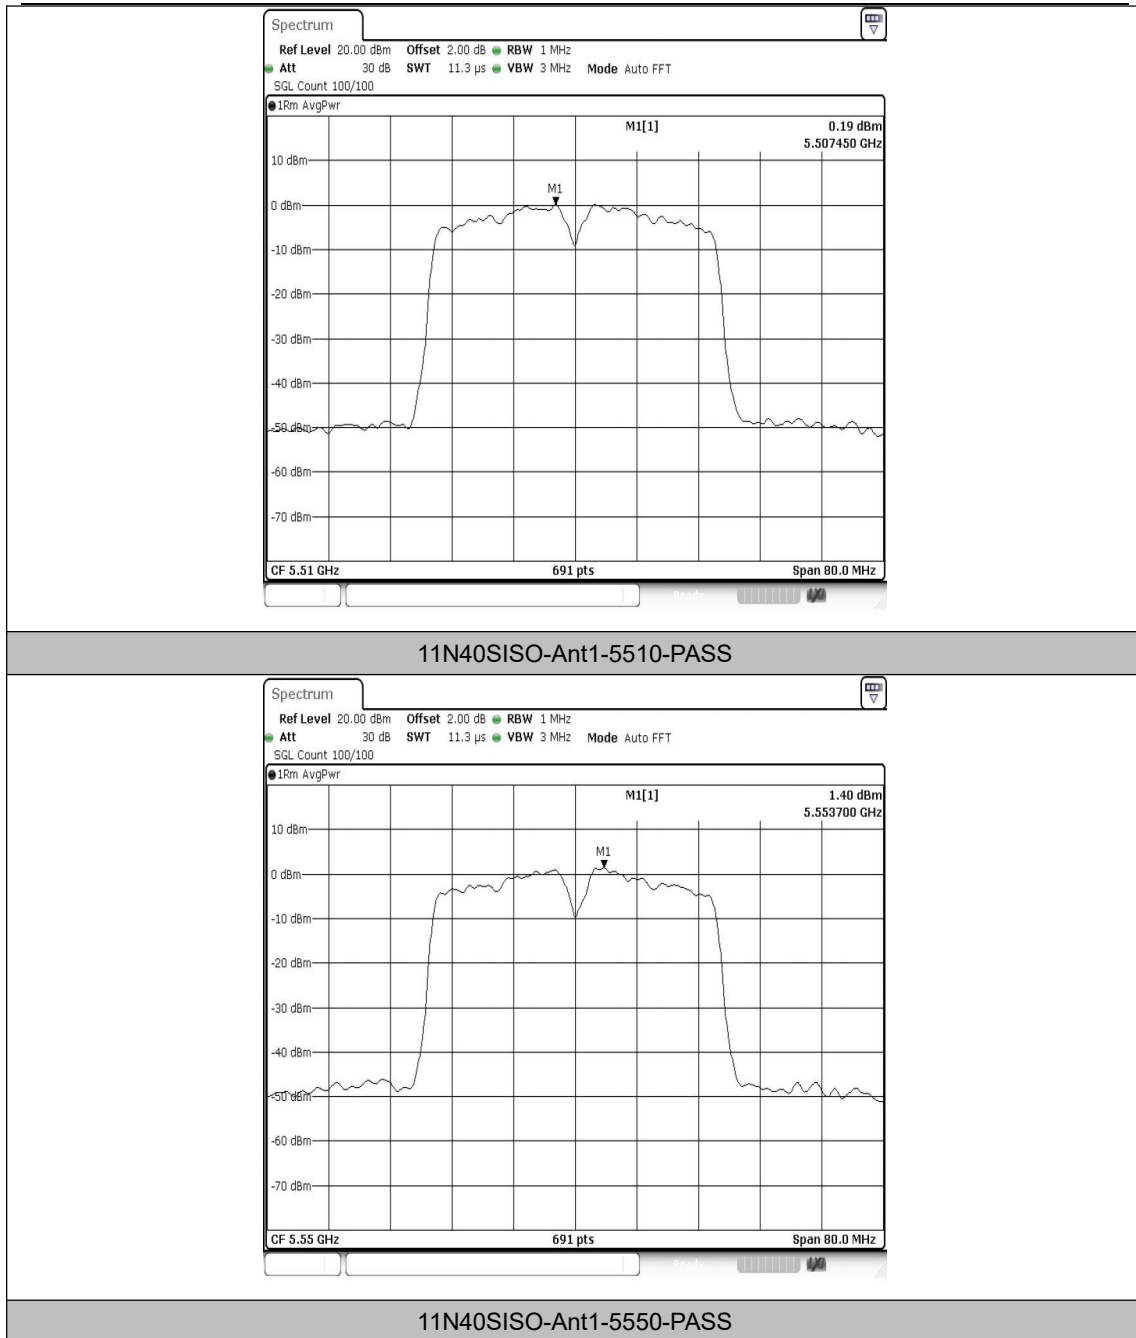

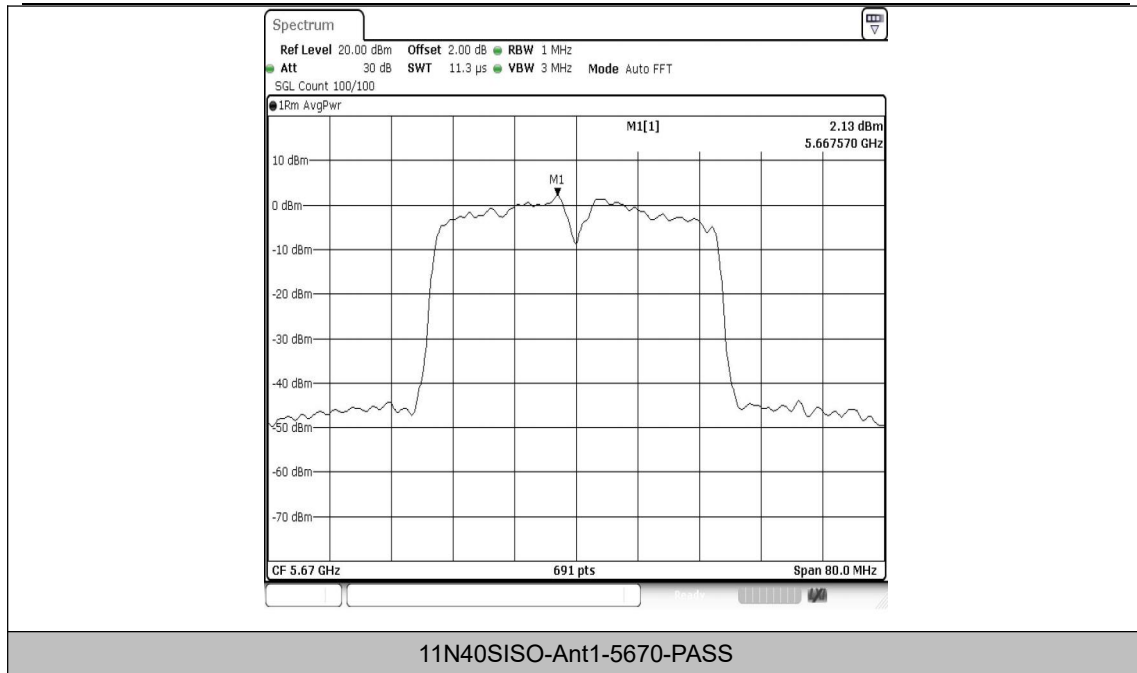



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs B4

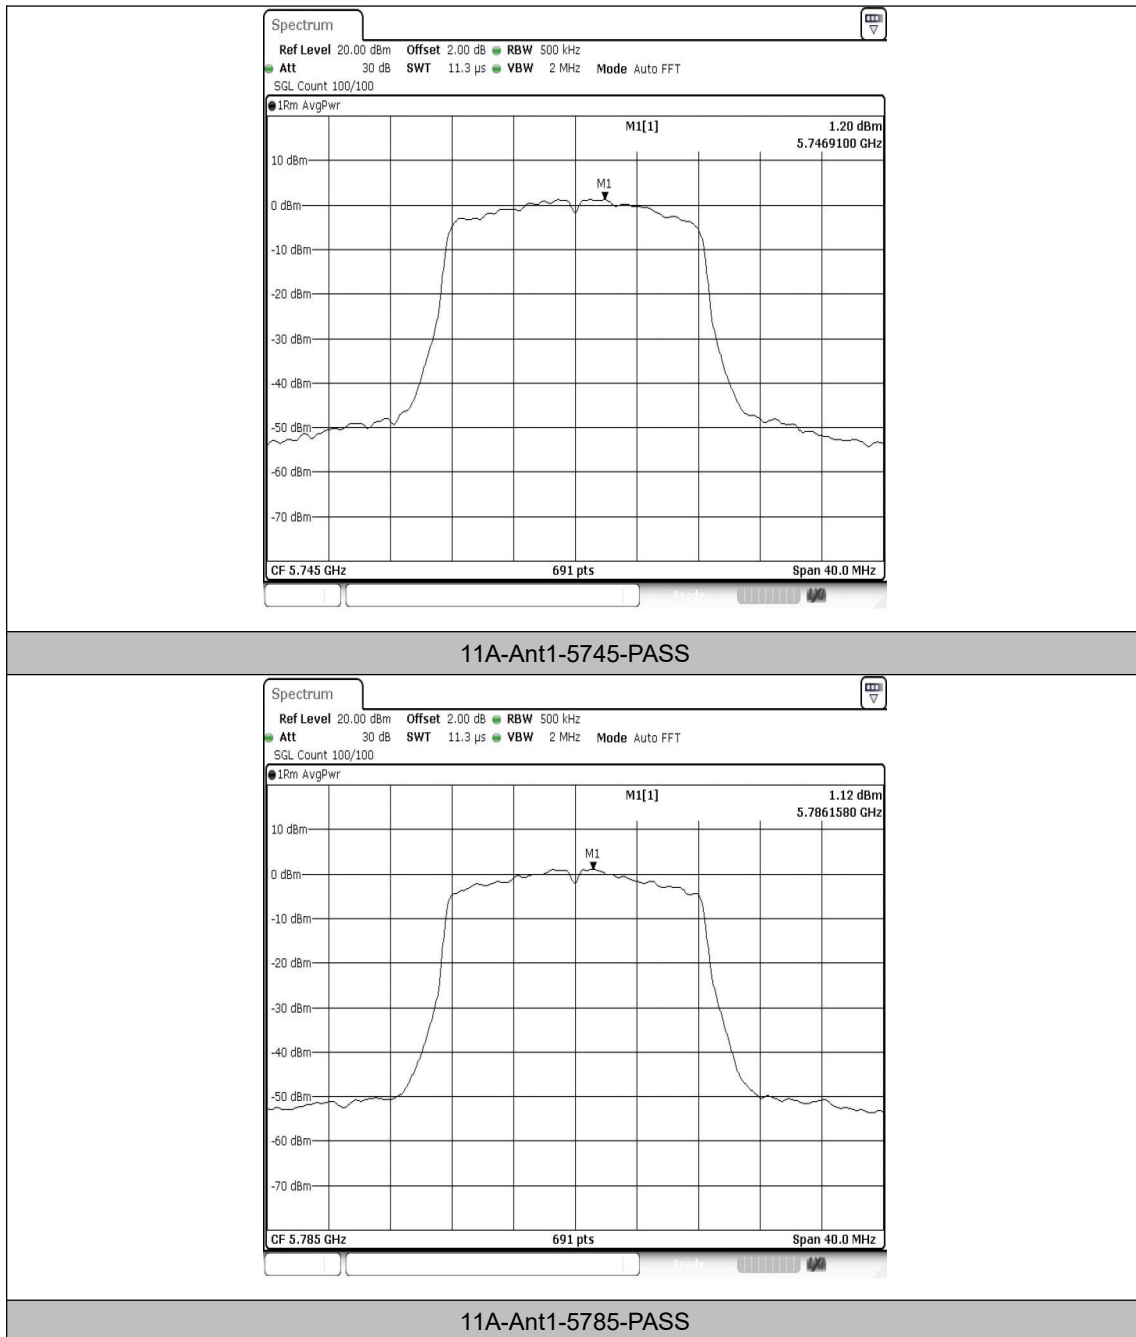


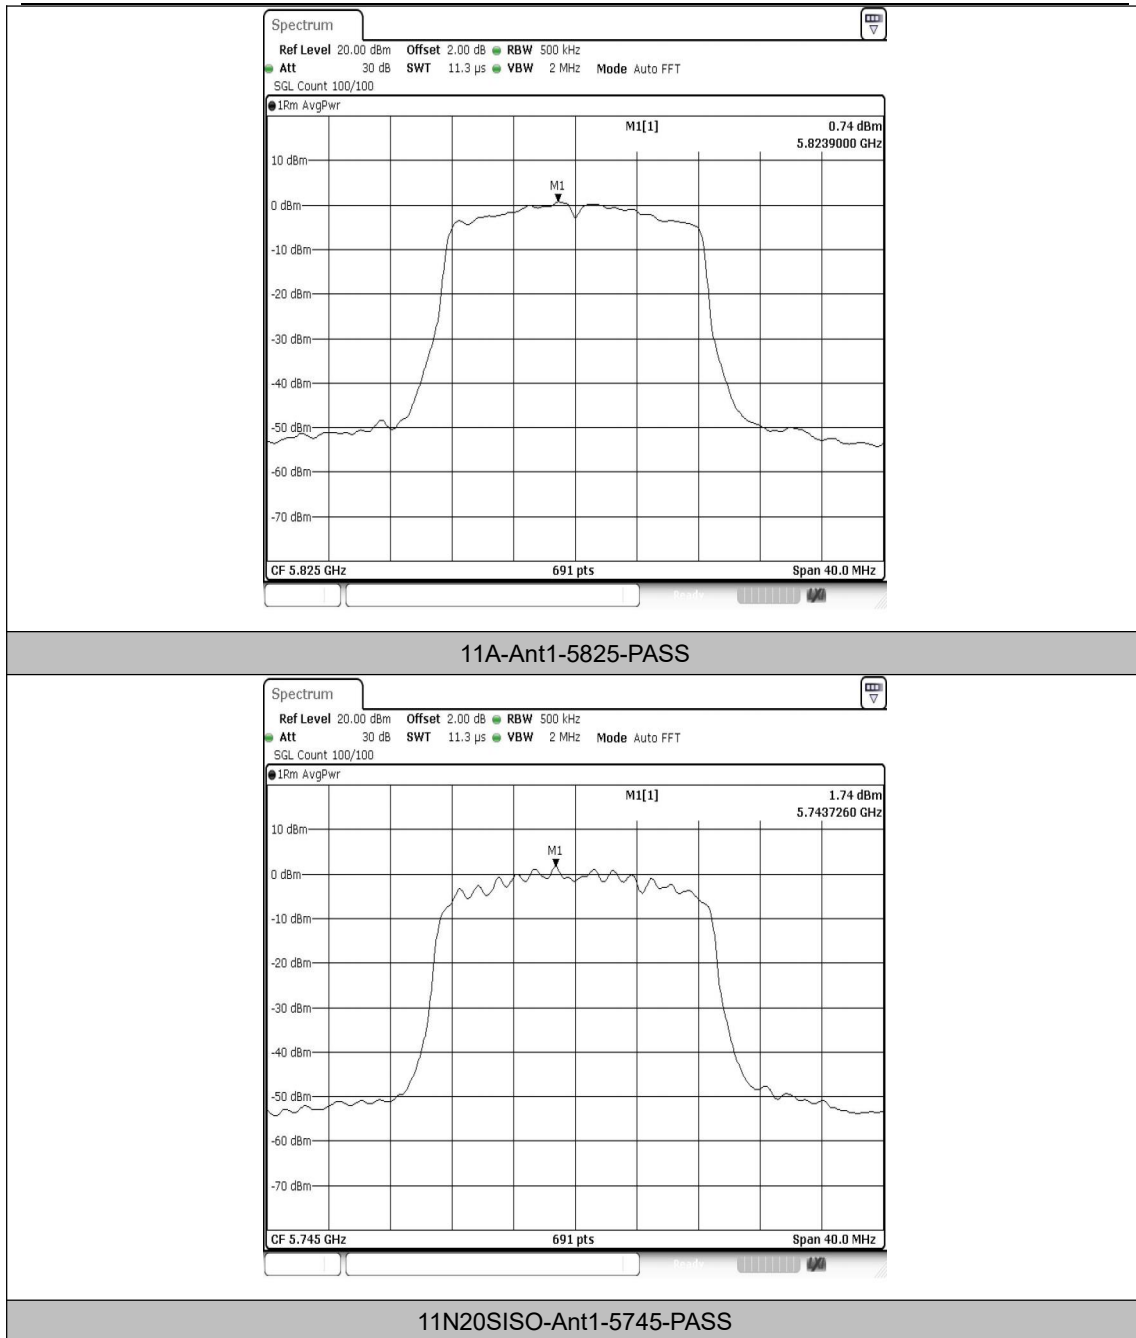

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

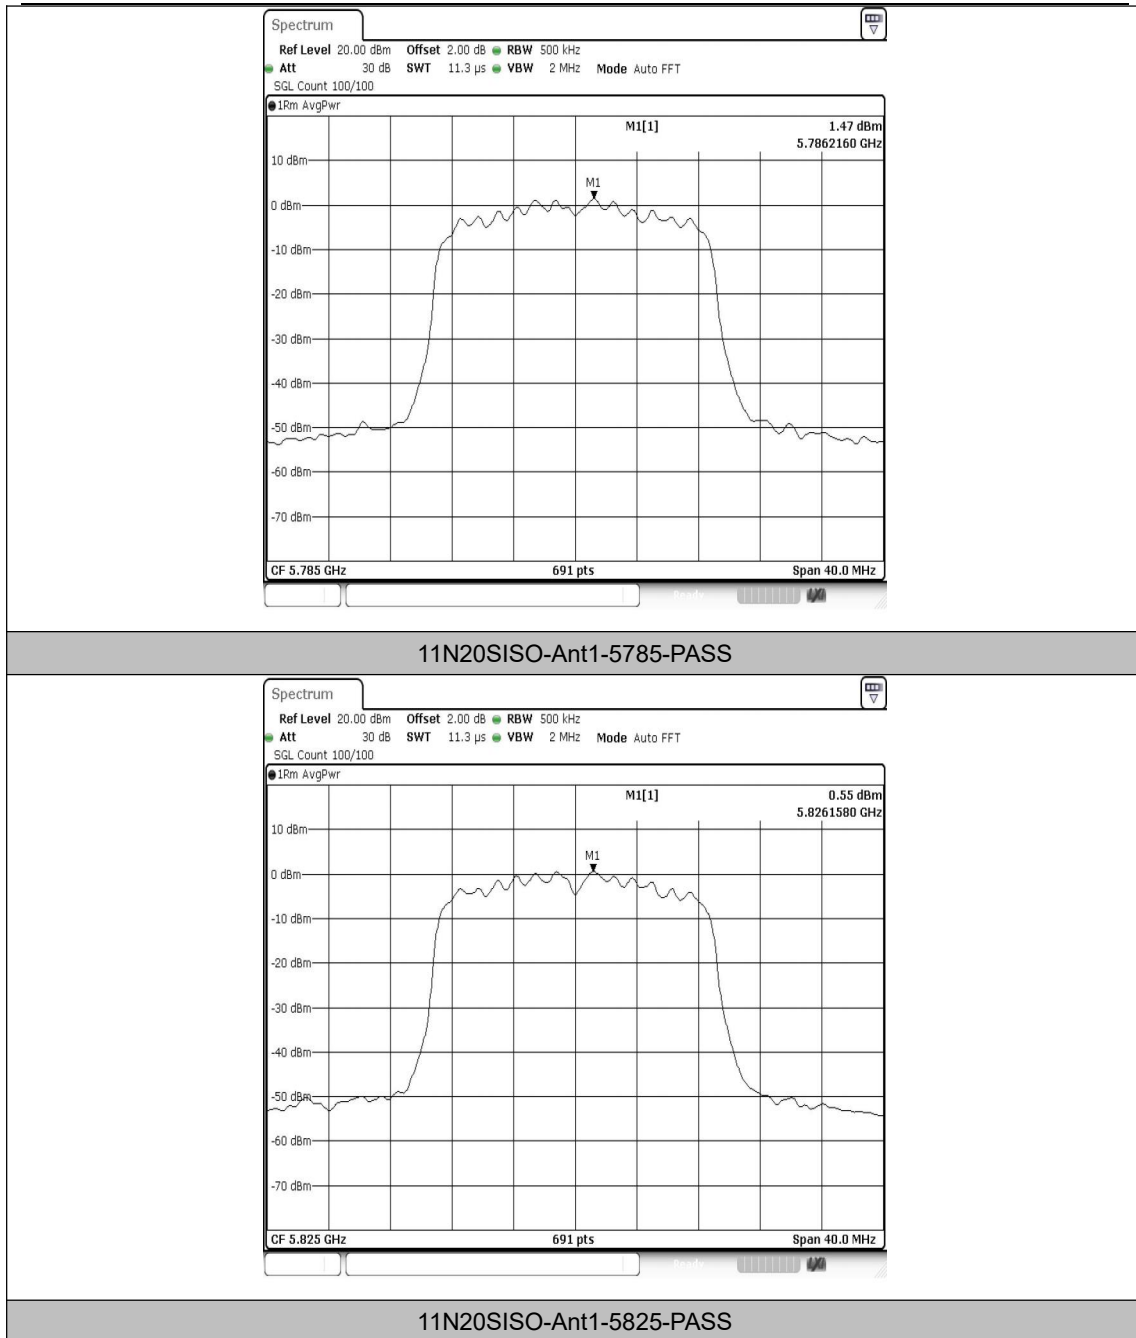

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

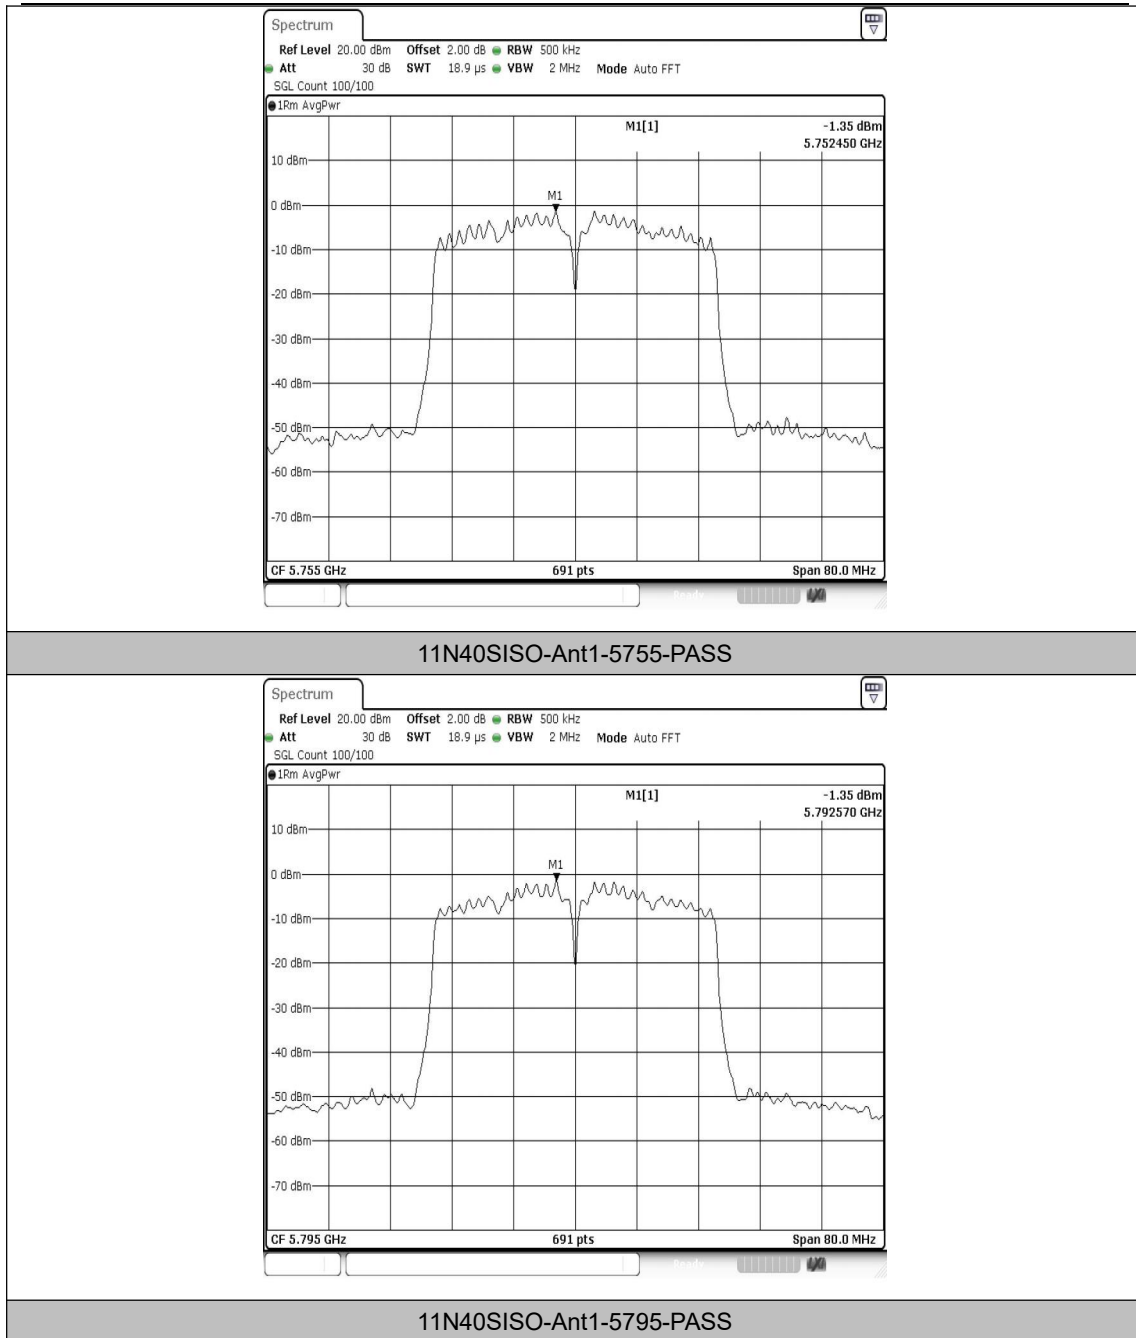

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-38.14	≤-27	PASS
11A	Ant1	High	5240	-46.72	≤-27	PASS
11A	Ant1	High	5320	-42.05	≤-27	PASS
11A	Ant1	Low	5500	-42.16	≤-27	PASS
11A	Ant1	High	5700	-42.31	≤-27	PASS
11N20SISO	Ant1	Low	5180	-36.63	≤-27	PASS
11N20SISO	Ant1	High	5240	-46.05	≤-27	PASS
11N20SISO	Ant1	High	5320	-43.05	≤-27	PASS
11N20SISO	Ant1	Low	5500	-41	≤-27	PASS
11N20SISO	Ant1	High	5700	-41.16	≤-27	PASS
11N40SISO	Ant1	Low	5190	-37.71	≤-27	PASS
11N40SISO	Ant1	High	5230	-46.28	≤-27	PASS
11N40SISO	Ant1	High	5310	-32.83	≤-27	PASS
11N40SISO	Ant1	Low	5510	-40.36	≤-27	PASS
11N40SISO	Ant1	High	5670	-42.74	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-42.52	≤15.98	PASS
11A	Ant1	Low	5745	5700~5720	-46.12	≤10.89	PASS
11A	Ant1	Low	5745	5650~5700	-50.65	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-49.63	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-45.1	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-46.68	≤10.95	PASS
11A	Ant1	High	5825	5875~5925	-47.24	≤-26.58	PASS
11A	Ant1	High	5825	5925~5935	-48.21	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-37.67	≤20.54	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-45.9	≤10.23	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-50.18	≤-26.88	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-49.46	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-45.79	≤16.54	PASS
11N20SISO	Ant1	High	5825	5855~5875	-47.17	≤10.02	PASS
11N20SISO	Ant1	High	5825	5875~5925	-49.36	≤-26.73	PASS
11N20SISO	Ant1	High	5825	5925~5935	-48.41	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-39.49	≤15.90	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-38.66	≤14.76	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-49.42	≤-26.79	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-49.41	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-46.59	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-46.95	≤10.14	PASS
11N40SISO	Ant1	High	5795	5875~5925	-48.19	≤-26.44	PASS
11N40SISO	Ant1	High	5795	5925~5935	-46.6	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

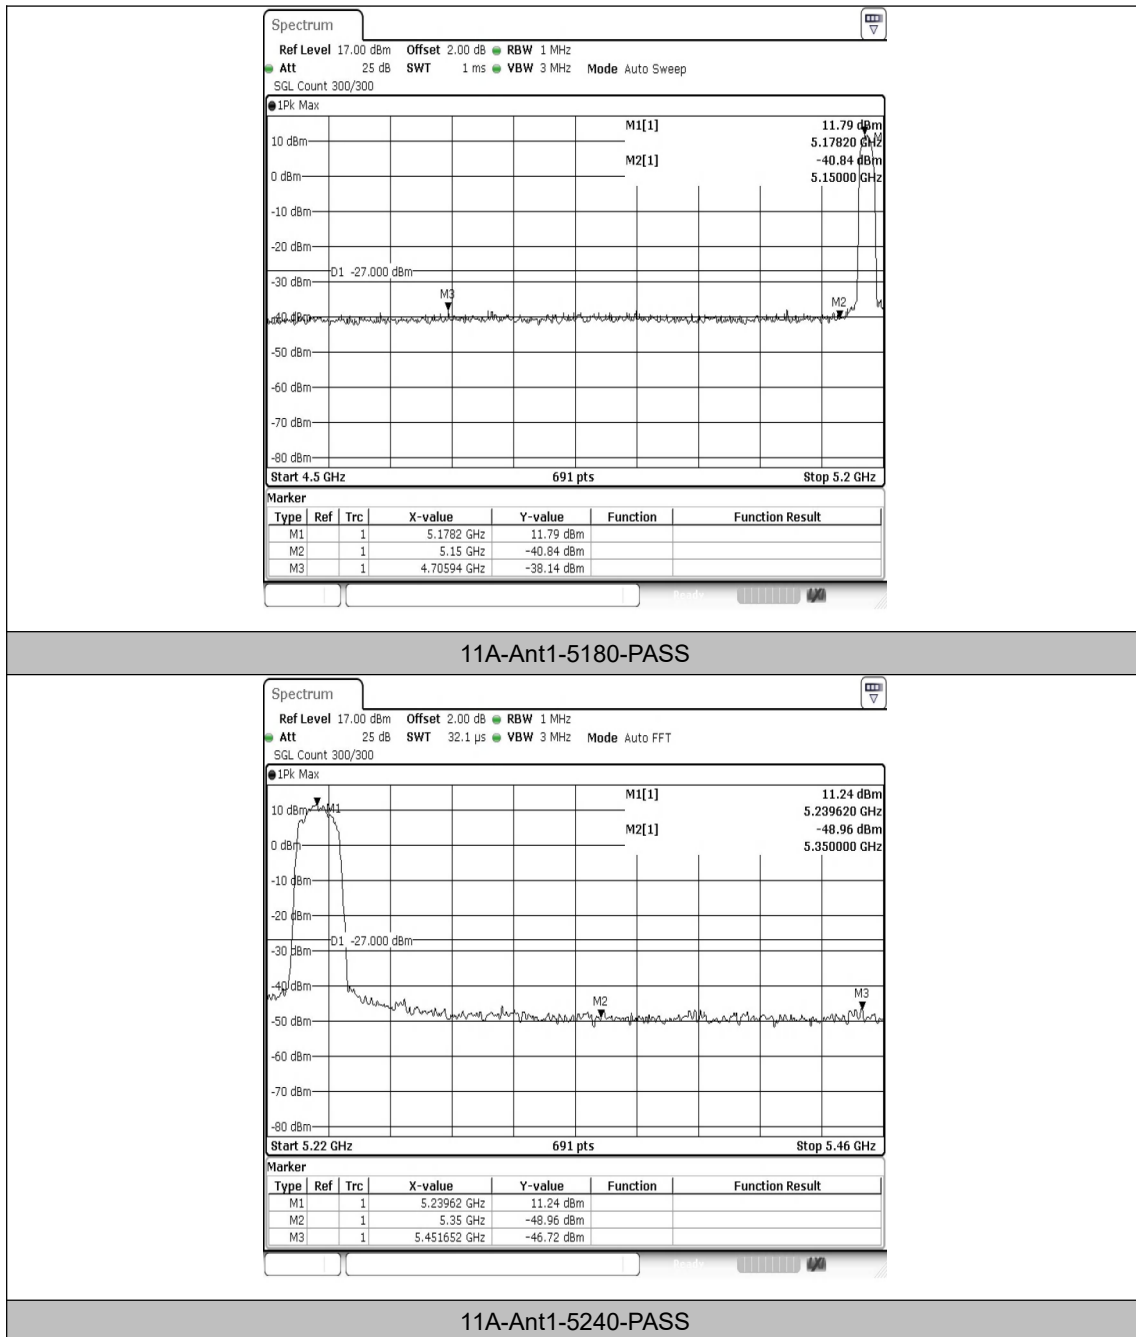

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

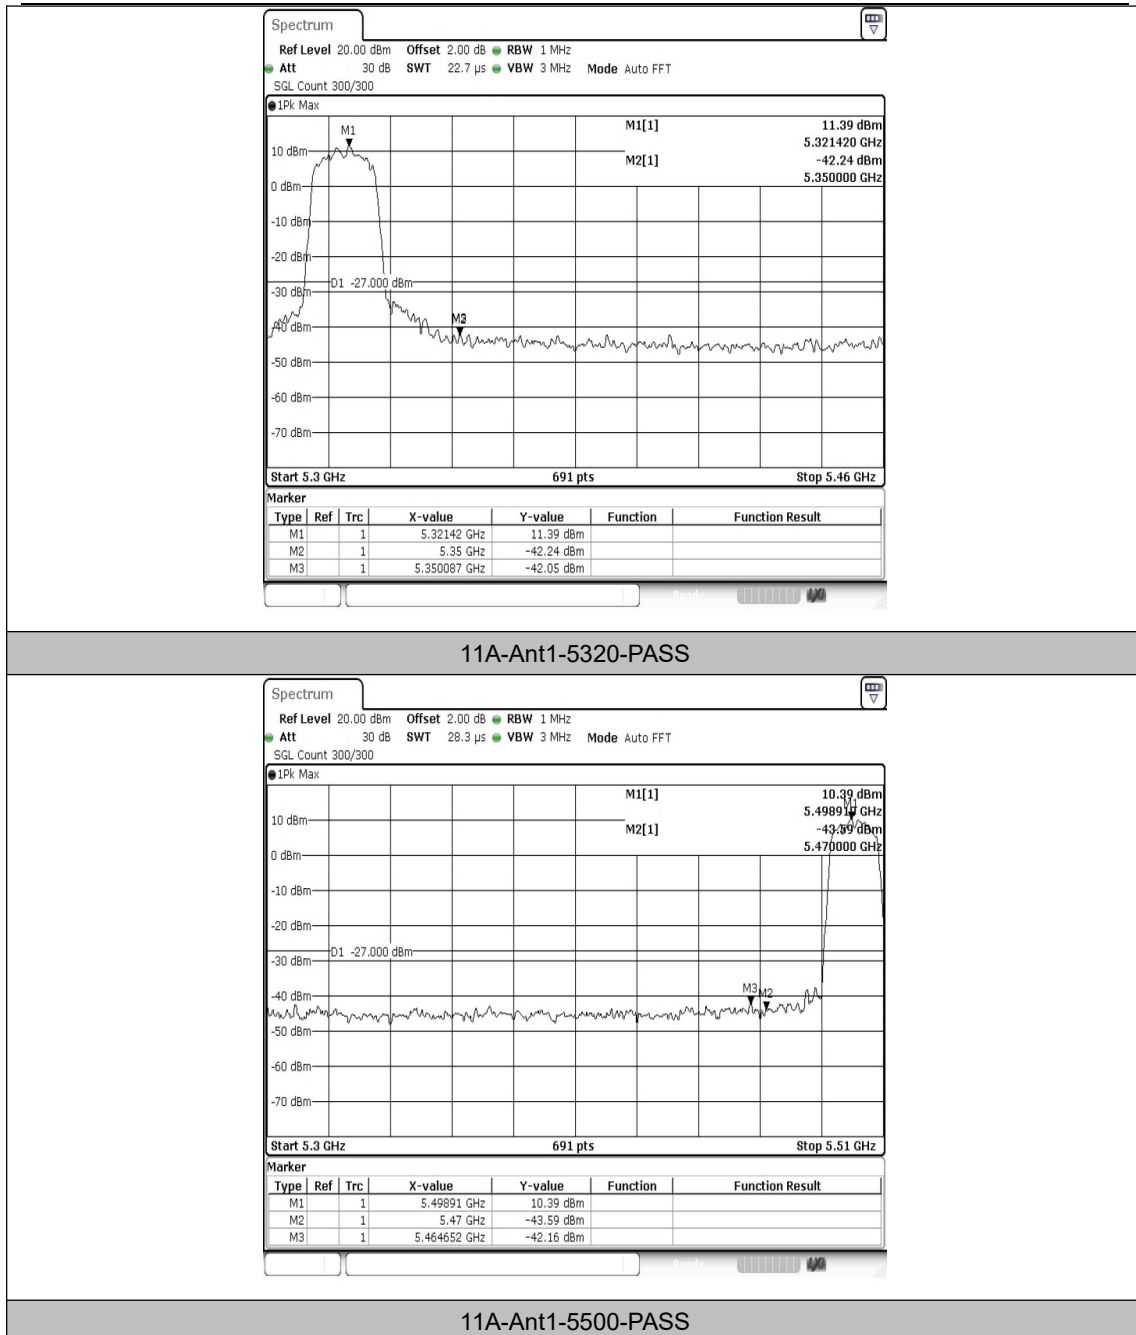

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

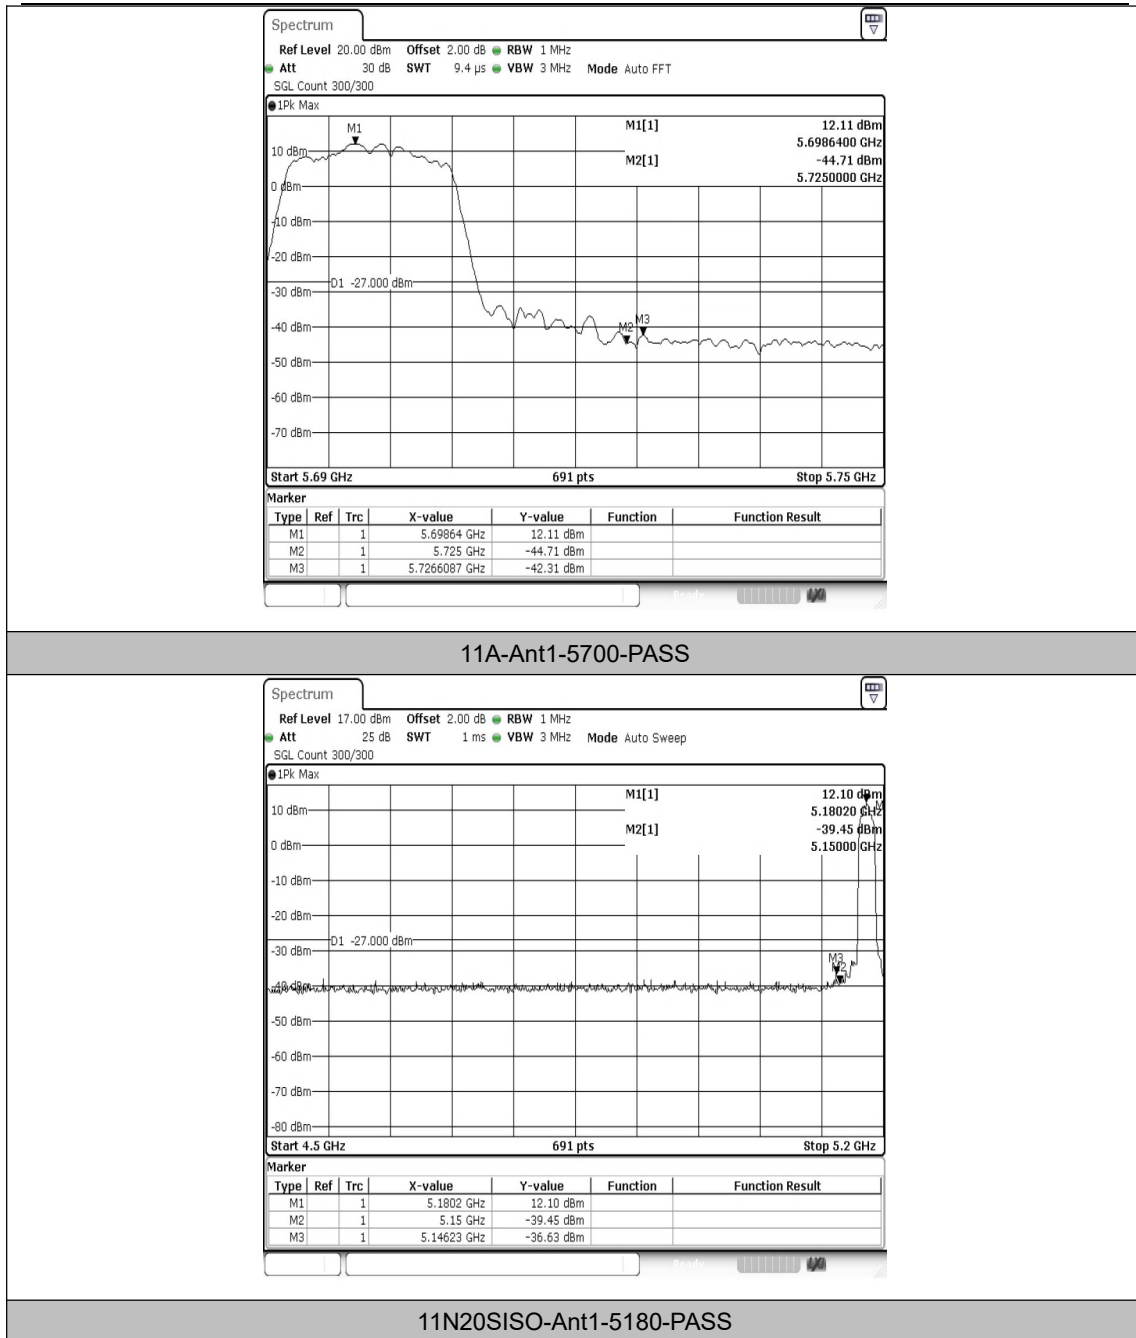

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

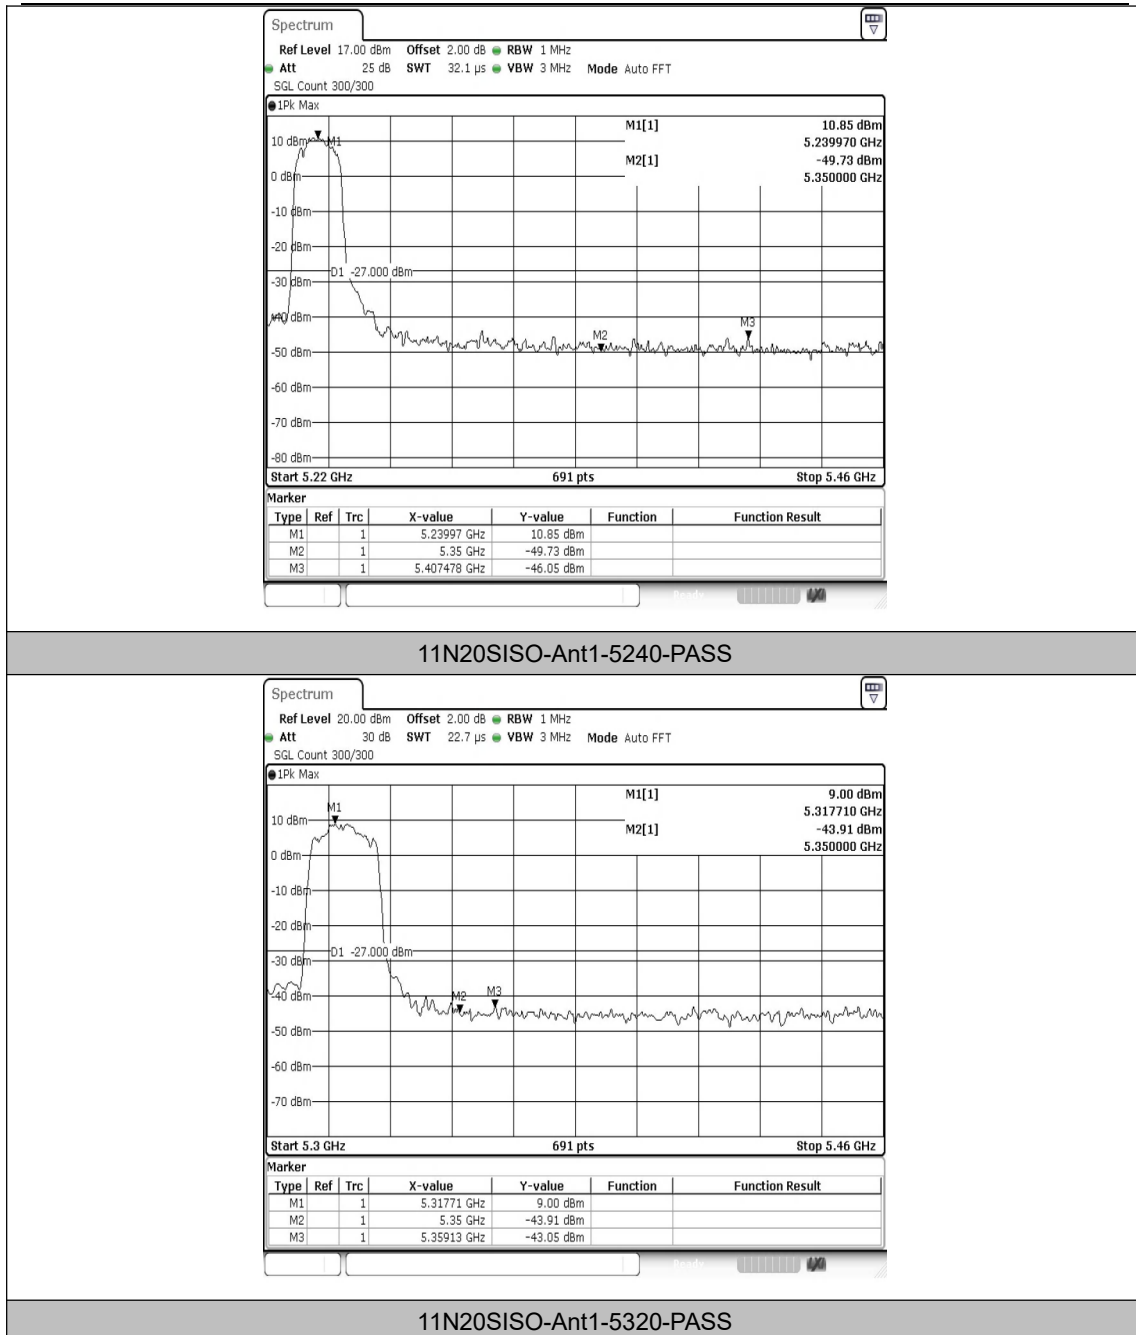


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

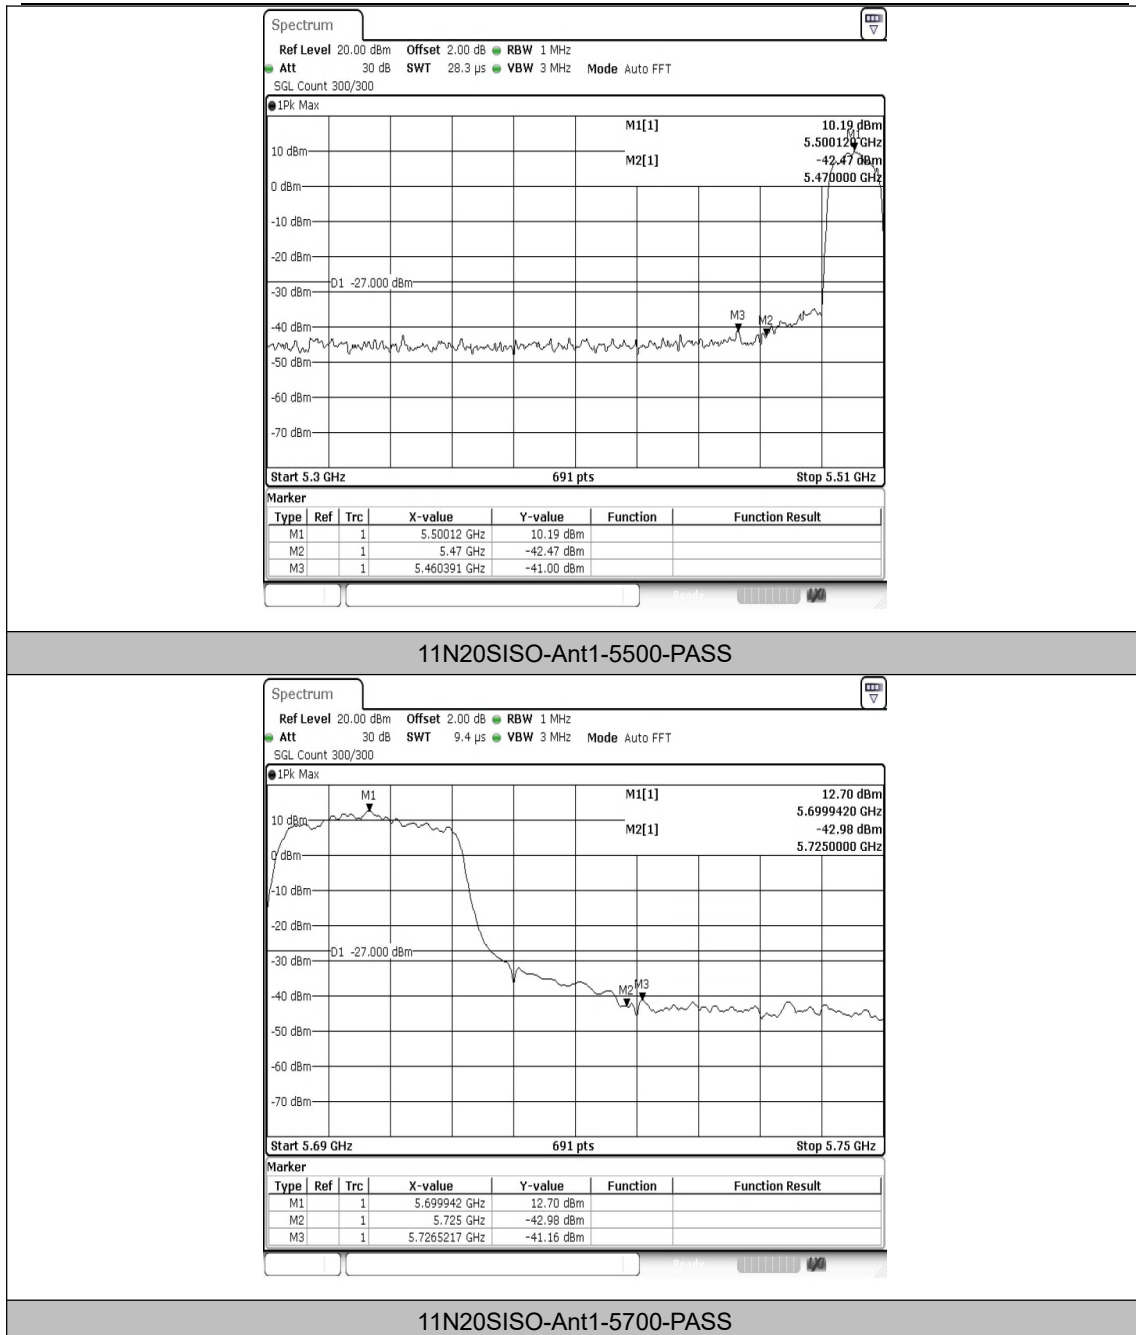


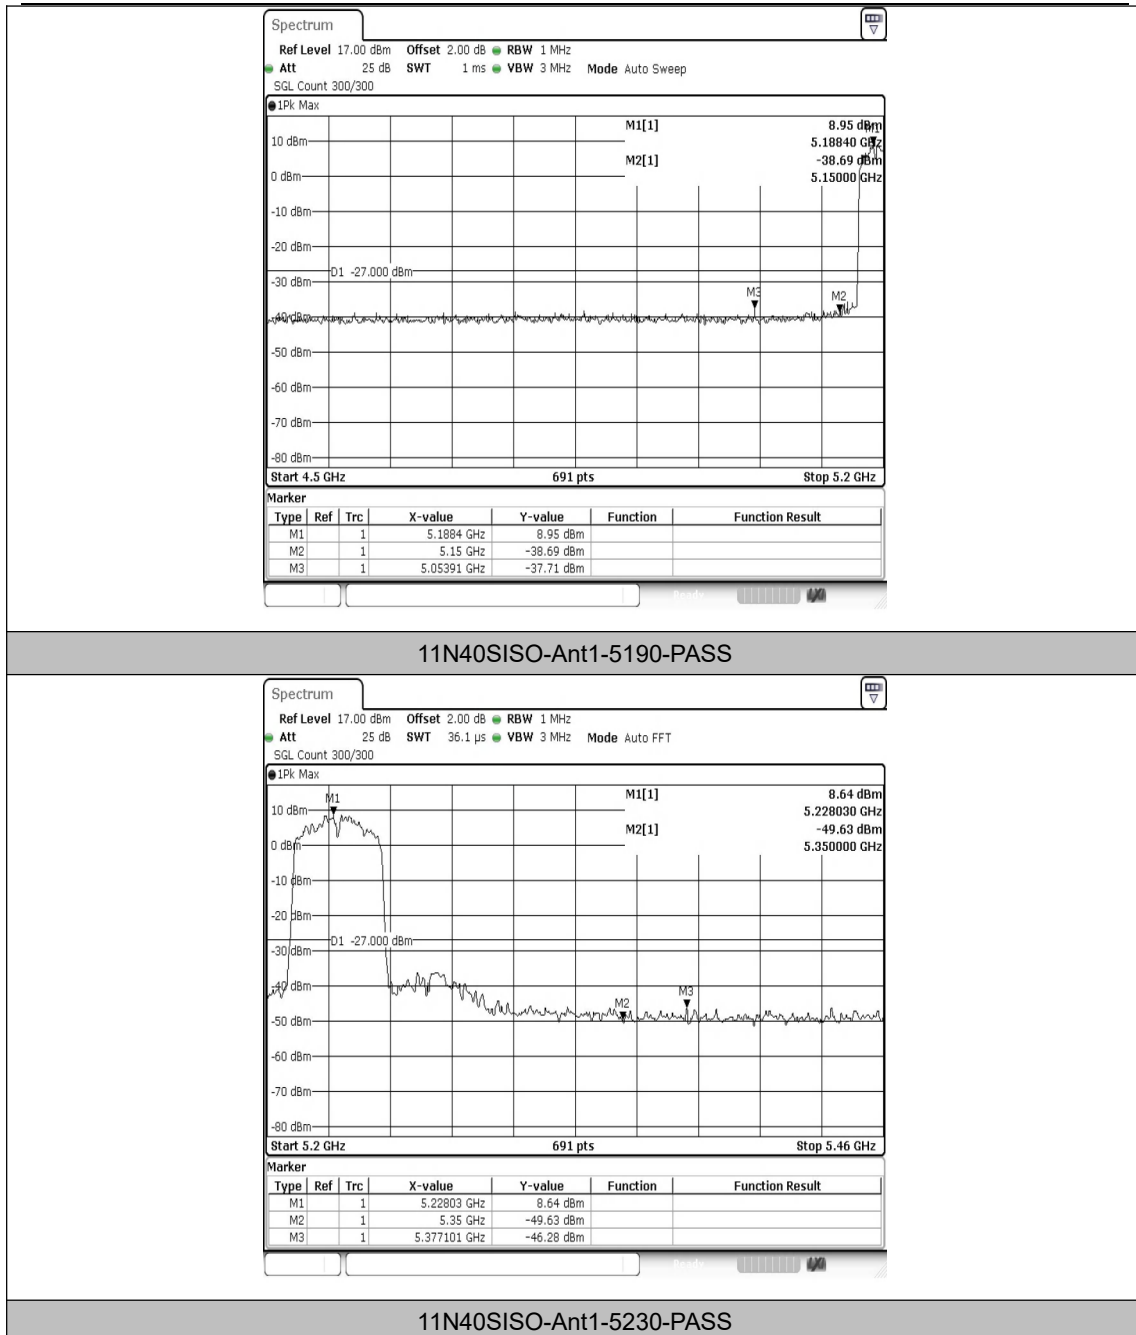


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

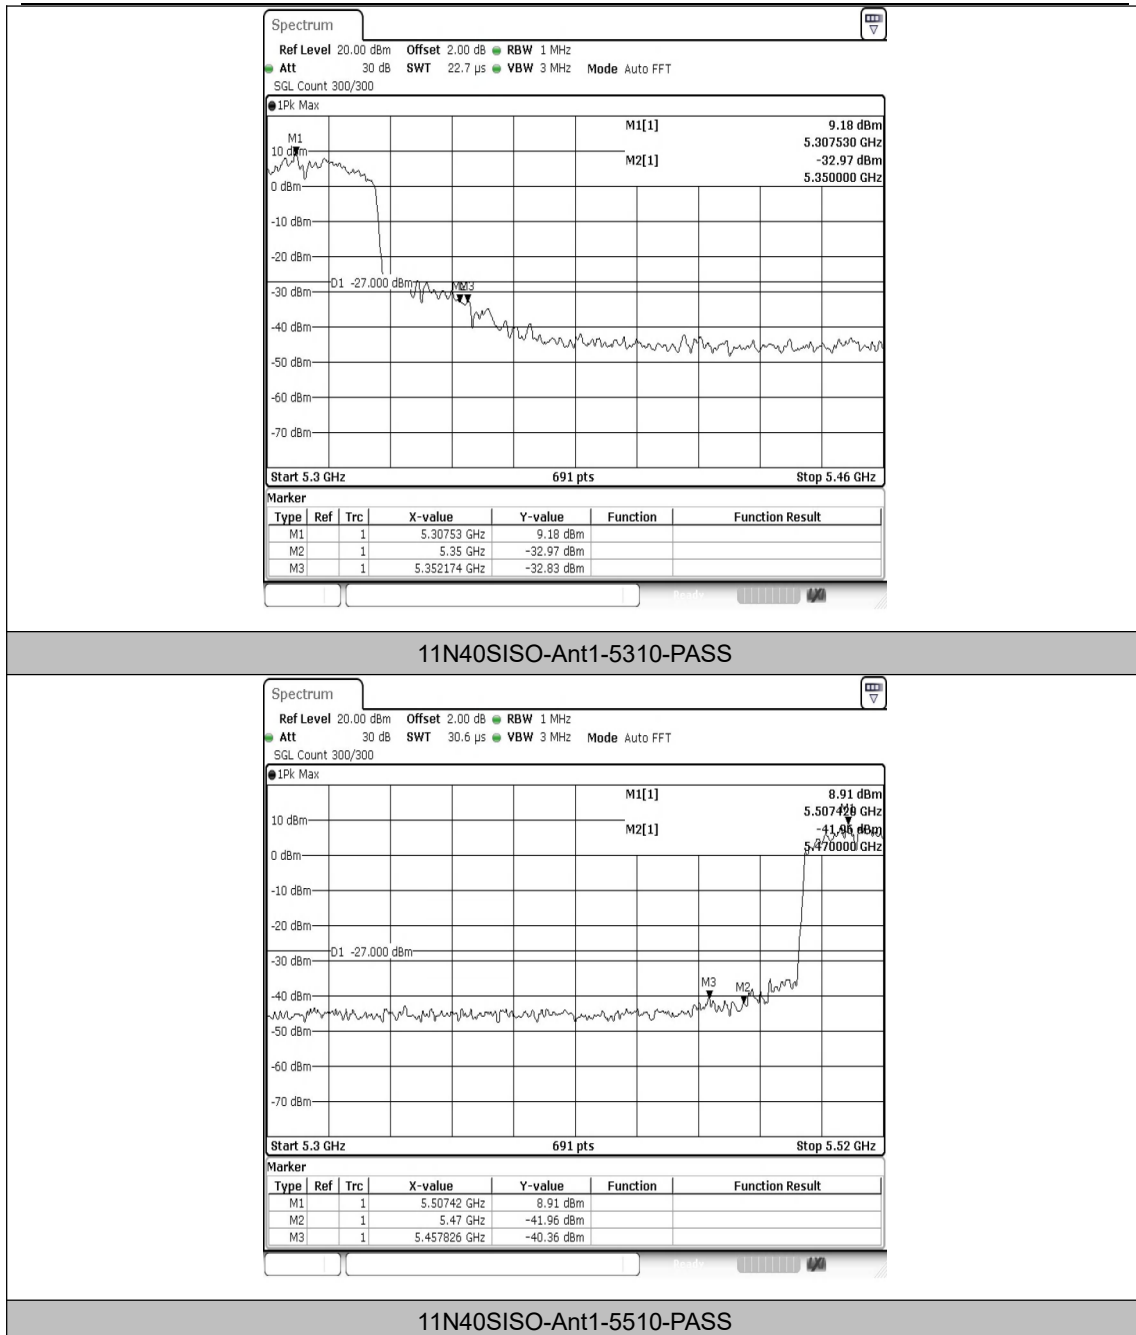

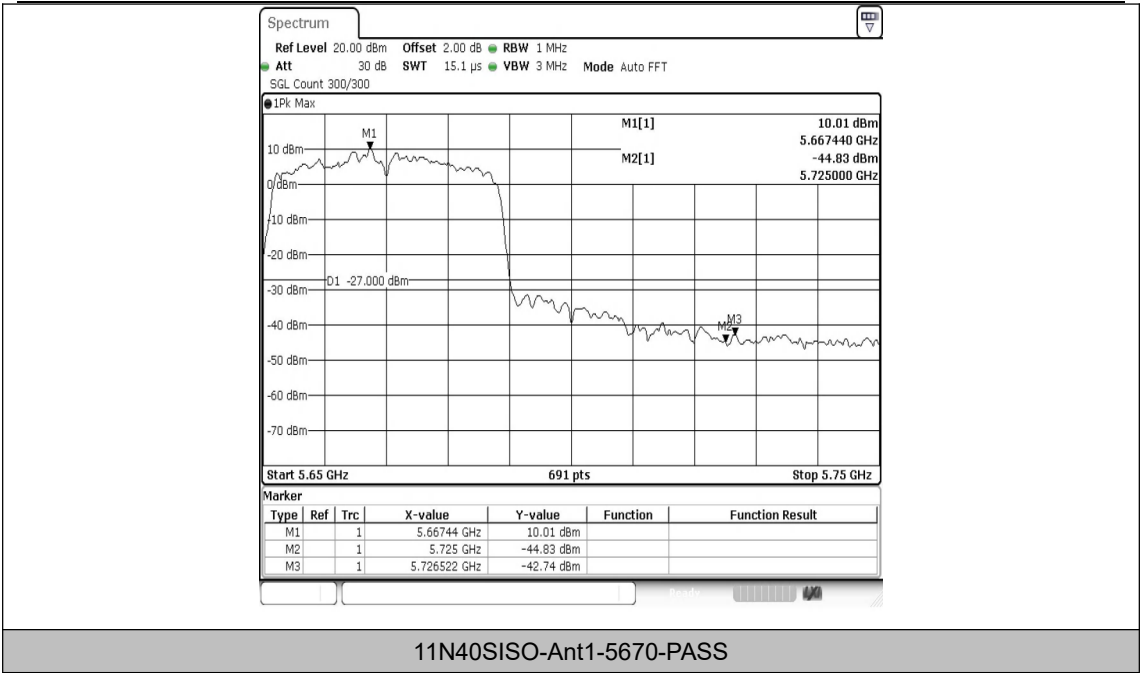


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs B4

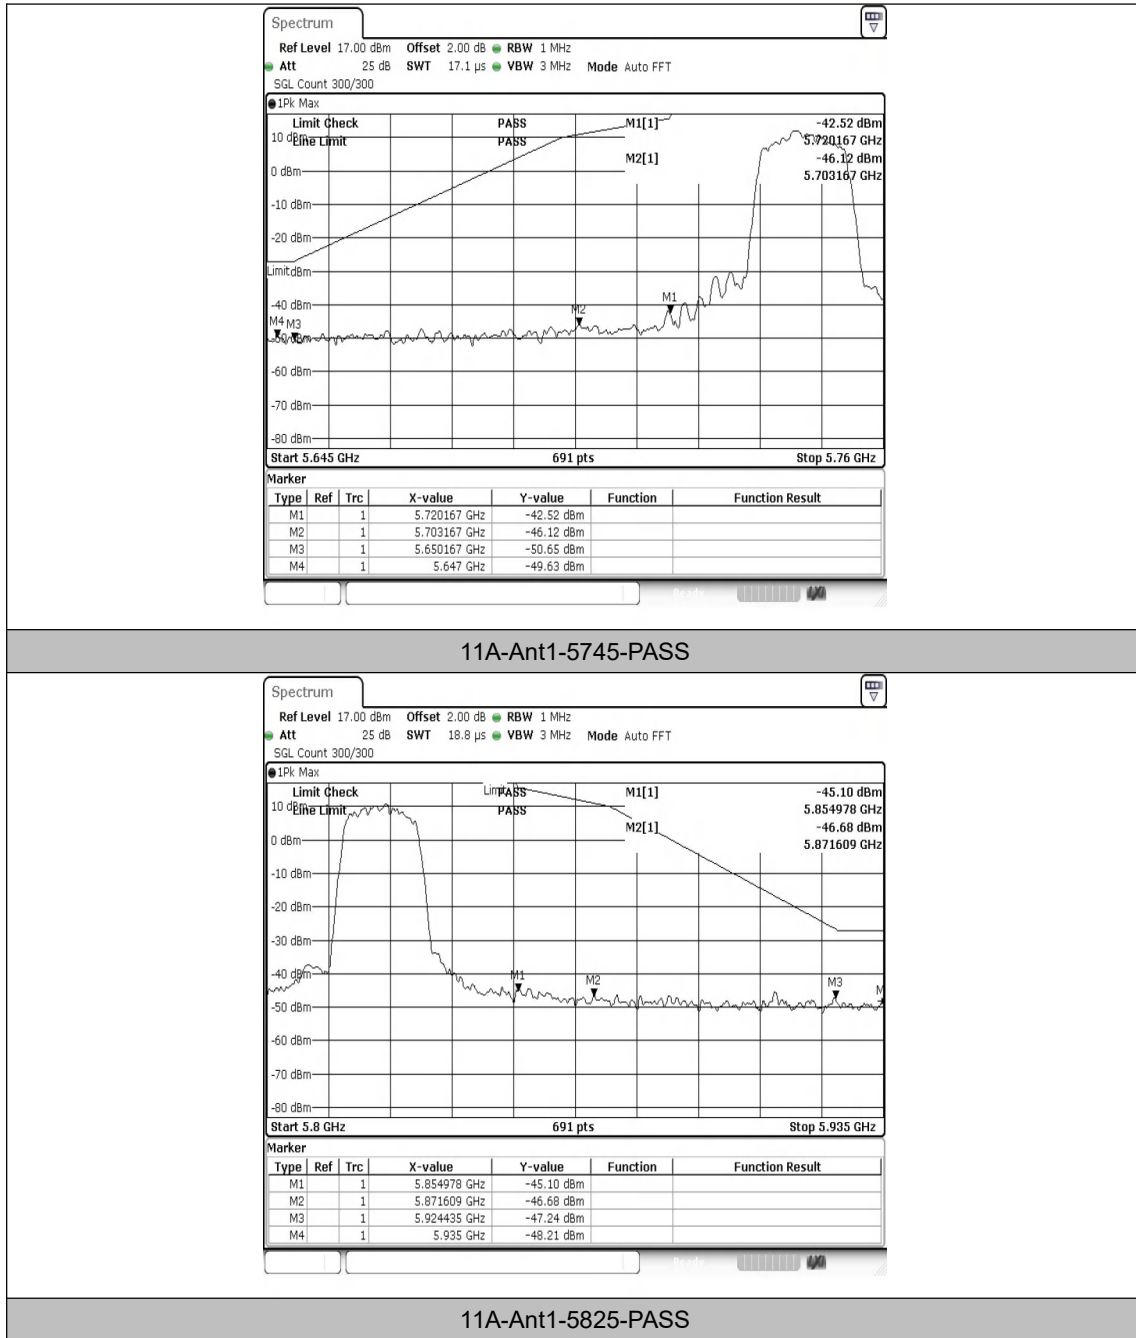

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

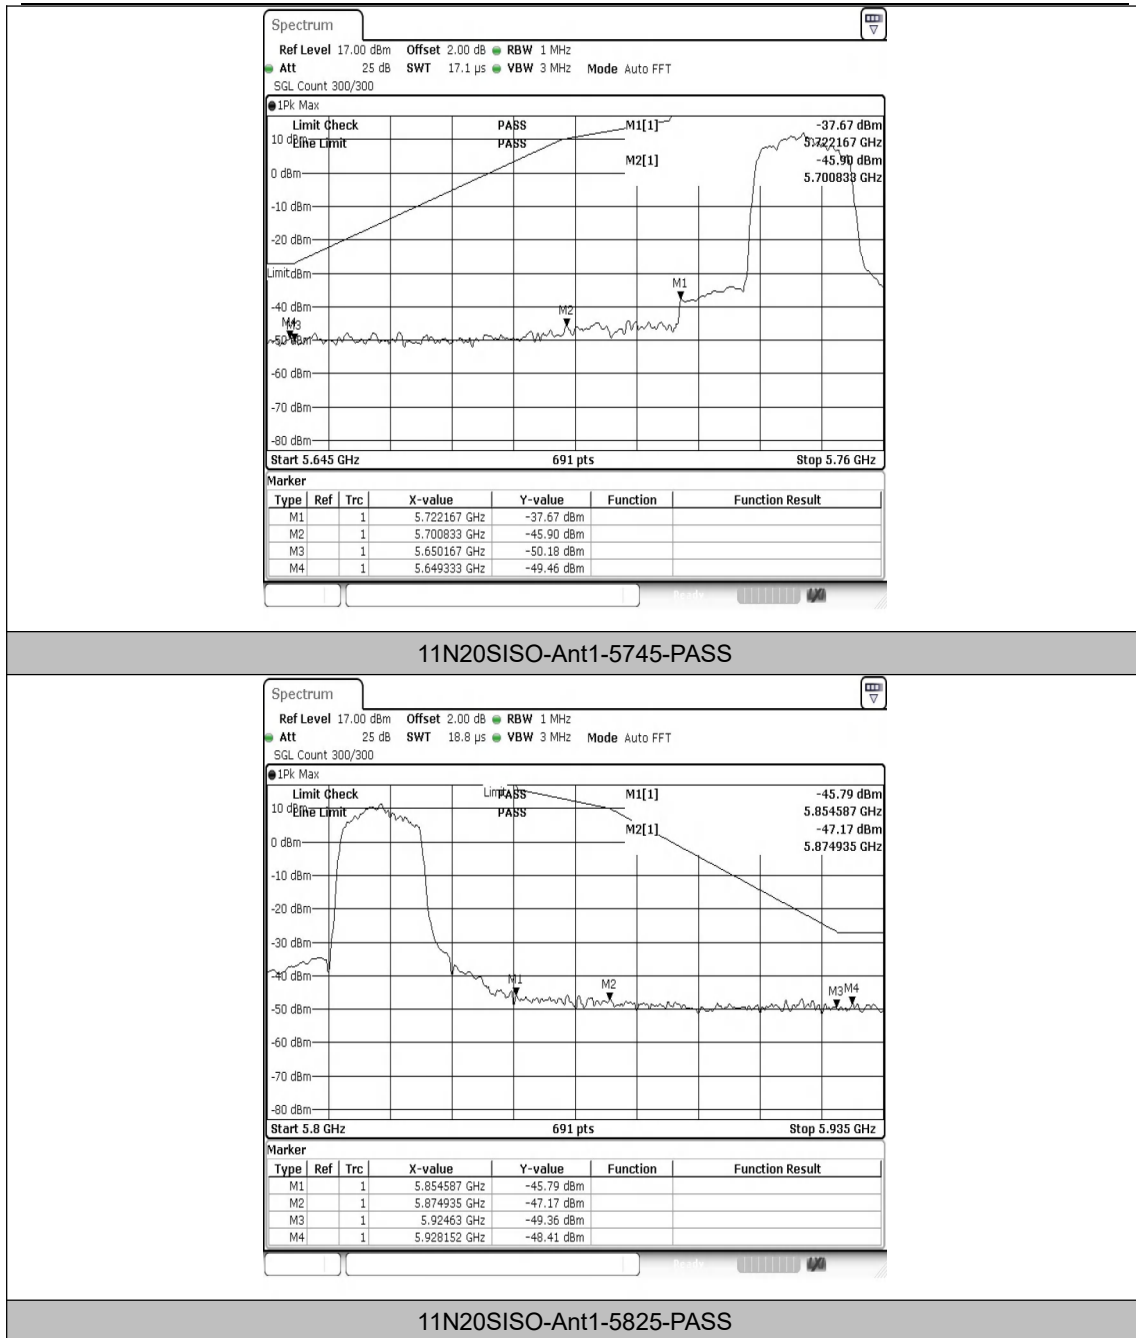

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

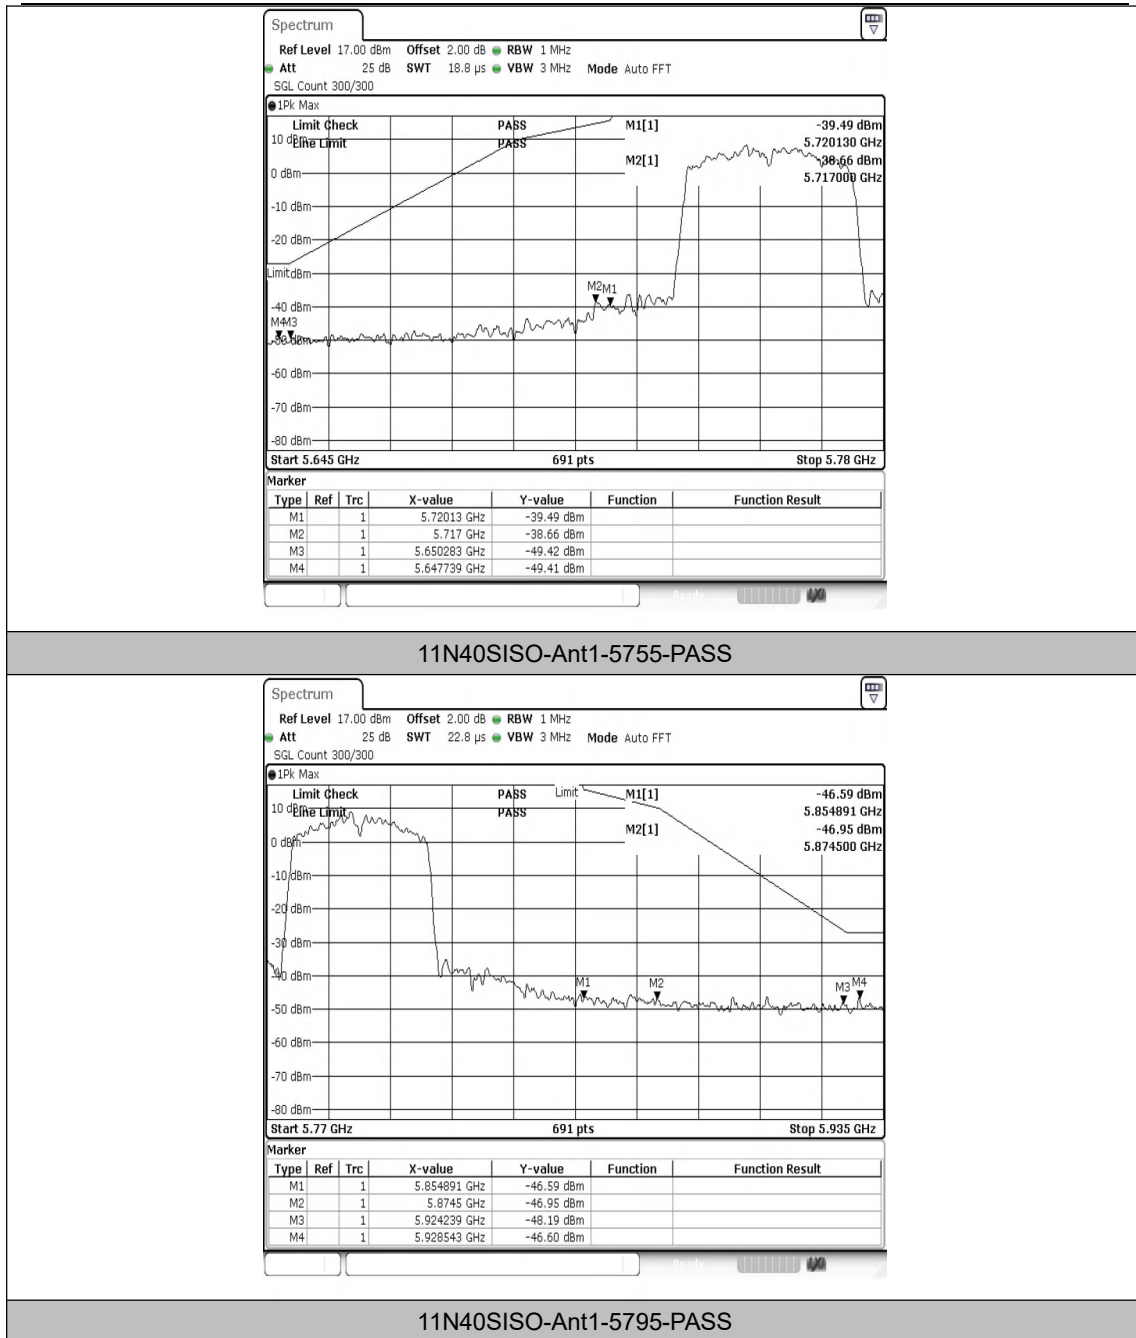


Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[dbm]	Radar Type	Result	Limit[dbm]	Verdict
11N40SISO	5270	Type0	-62.22	-62.00	PASS
11N40SISO	5510	Type0	-62.01	-62.00	PASS

Note: During the test, pre-scan all the modes, only the worst case is recorded in the report.

Test Graphs

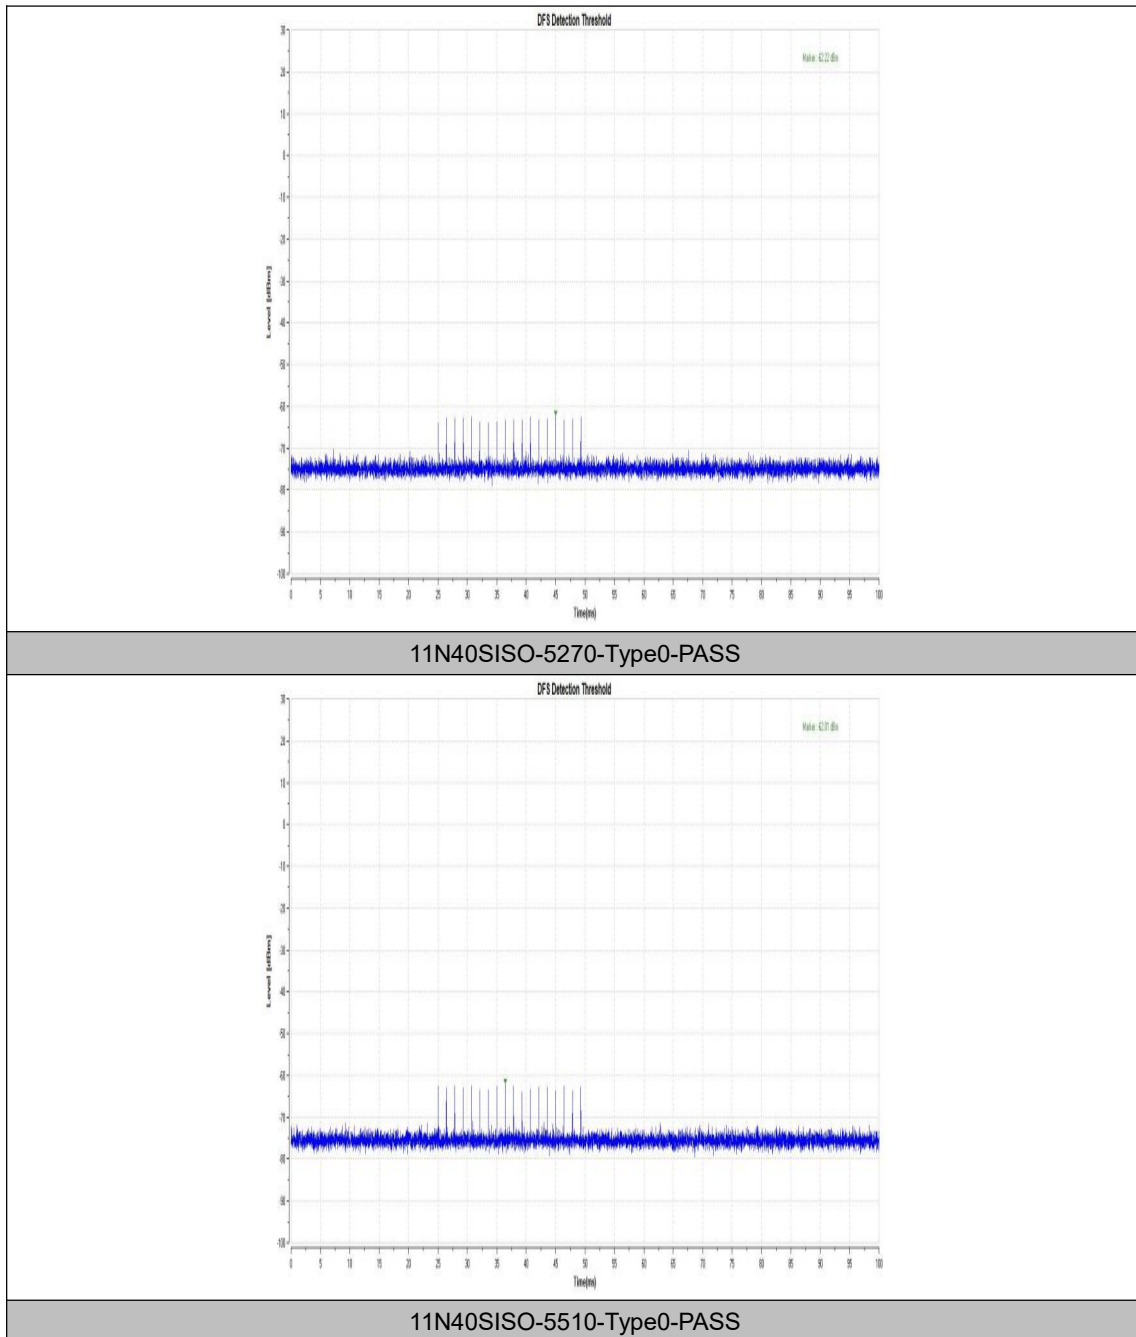

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Channel Move Time and Channel Closing


Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11N40SISO	5270	200+6.48	200+60	247.7	10000	PASS
11N40SISO	5510	200+1.62	200+60	129.1	10000	PASS

Note: During the test, pre-scan all the modes, only the worst case is recorded in the report.

Test Graphs

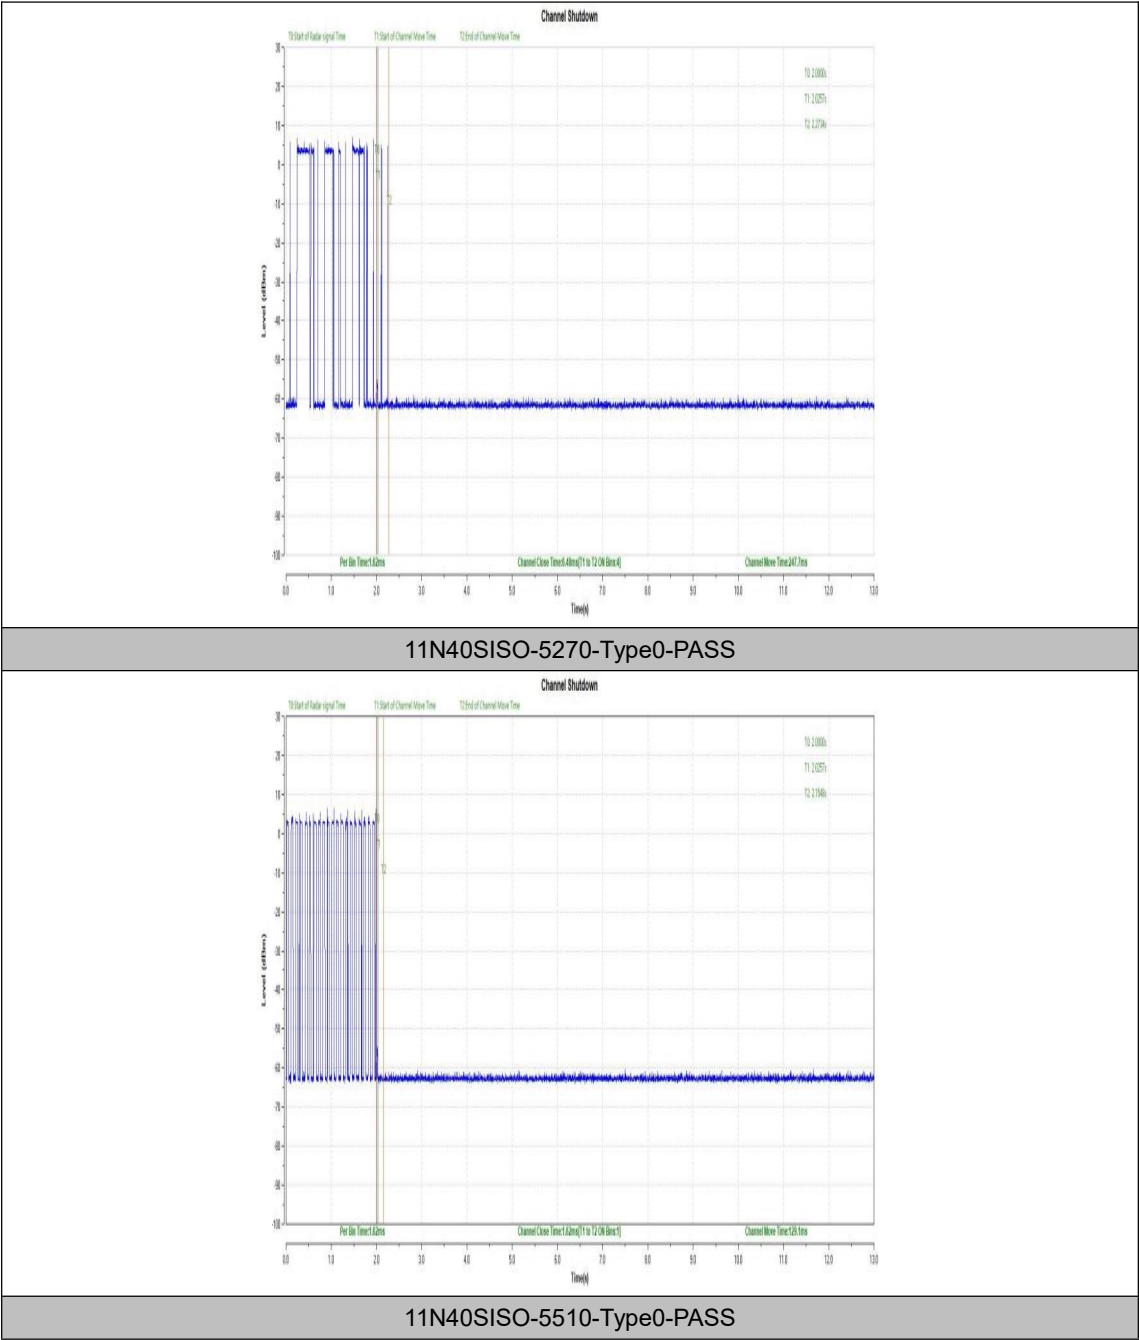

---End---