


Appendix Test Data

Report No.:	1812C50353712501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-7-21	Finish Test Date:	2025-8-19
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	26.3°C	Relative Humidity:	55%
Pressure:	101kPa		

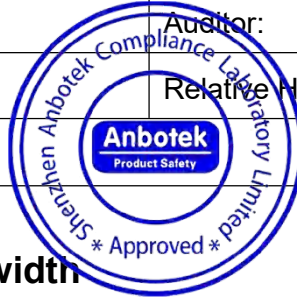


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	1.10	2401.47	2402.58	---	---
DH5	Ant1	2441	0.97	2440.50	2441.47	---	---
DH5	Ant1	2480	1.01	2479.45	2480.46	---	---
2DH5	Ant1	2402	1.36	2401.29	2402.65	---	---
2DH5	Ant1	2441	1.32	2440.31	2441.63	---	---
2DH5	Ant1	2480	1.26	2479.34	2480.60	---	---
3DH5	Ant1	2402	1.27	2401.32	2402.59	---	---
3DH5	Ant1	2441	1.30	2440.32	2441.62	---	---
3DH5	Ant1	2480	1.31	2479.32	2480.63	---	---


Test Graphs

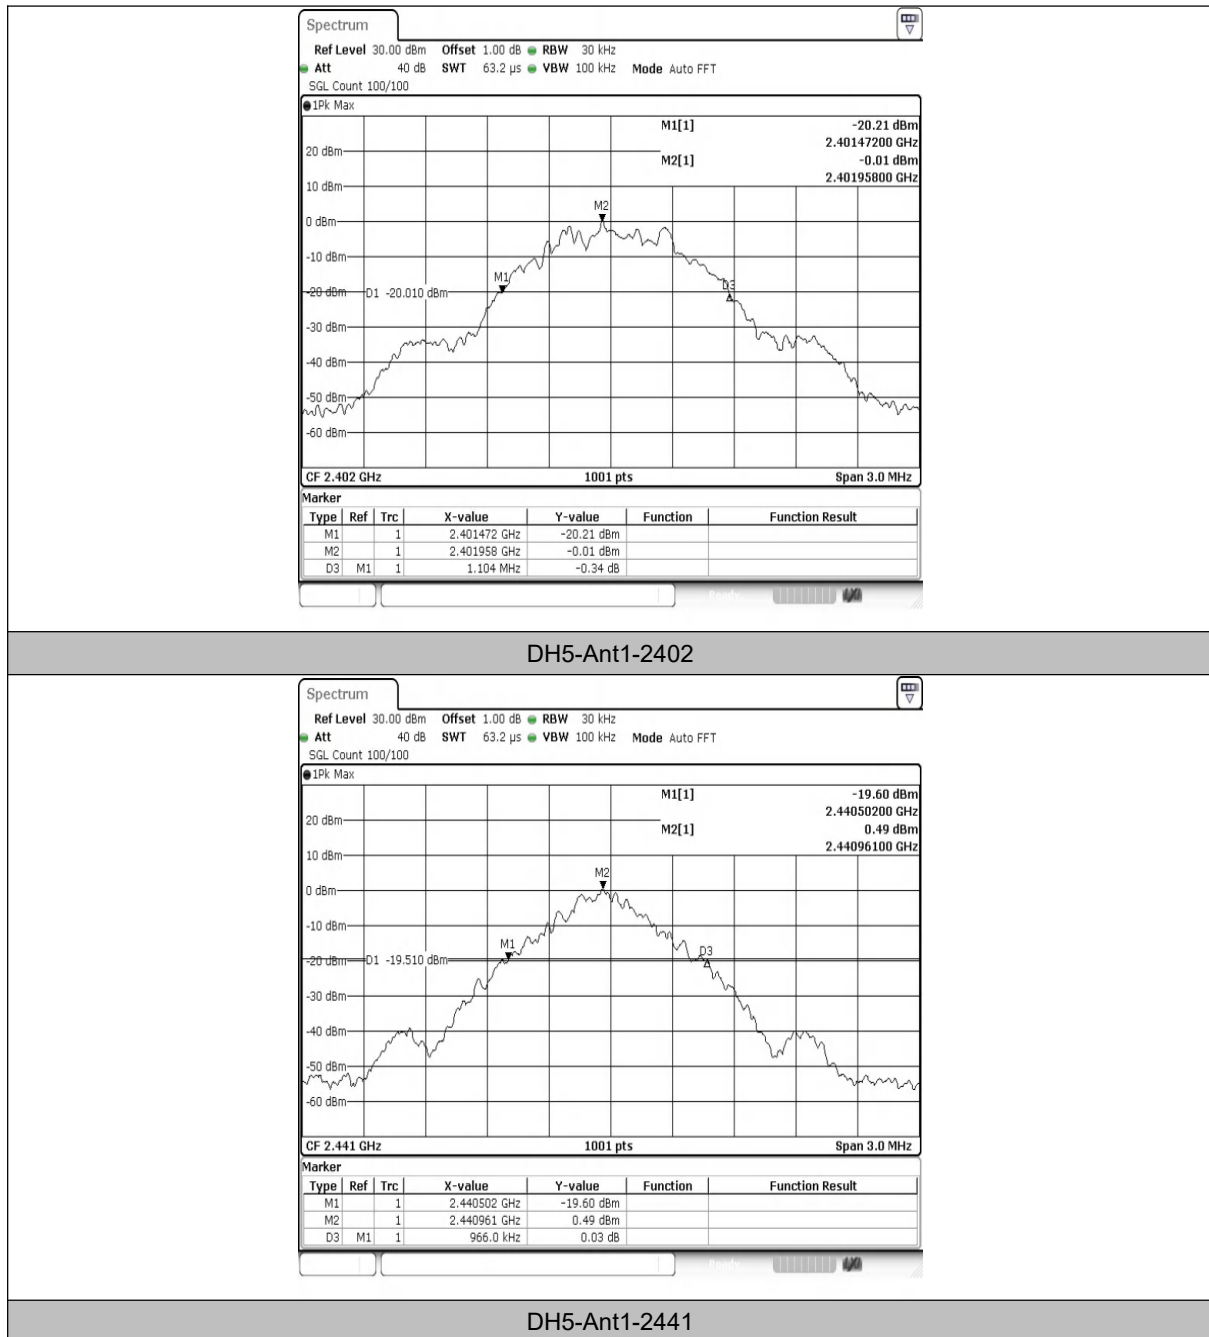

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

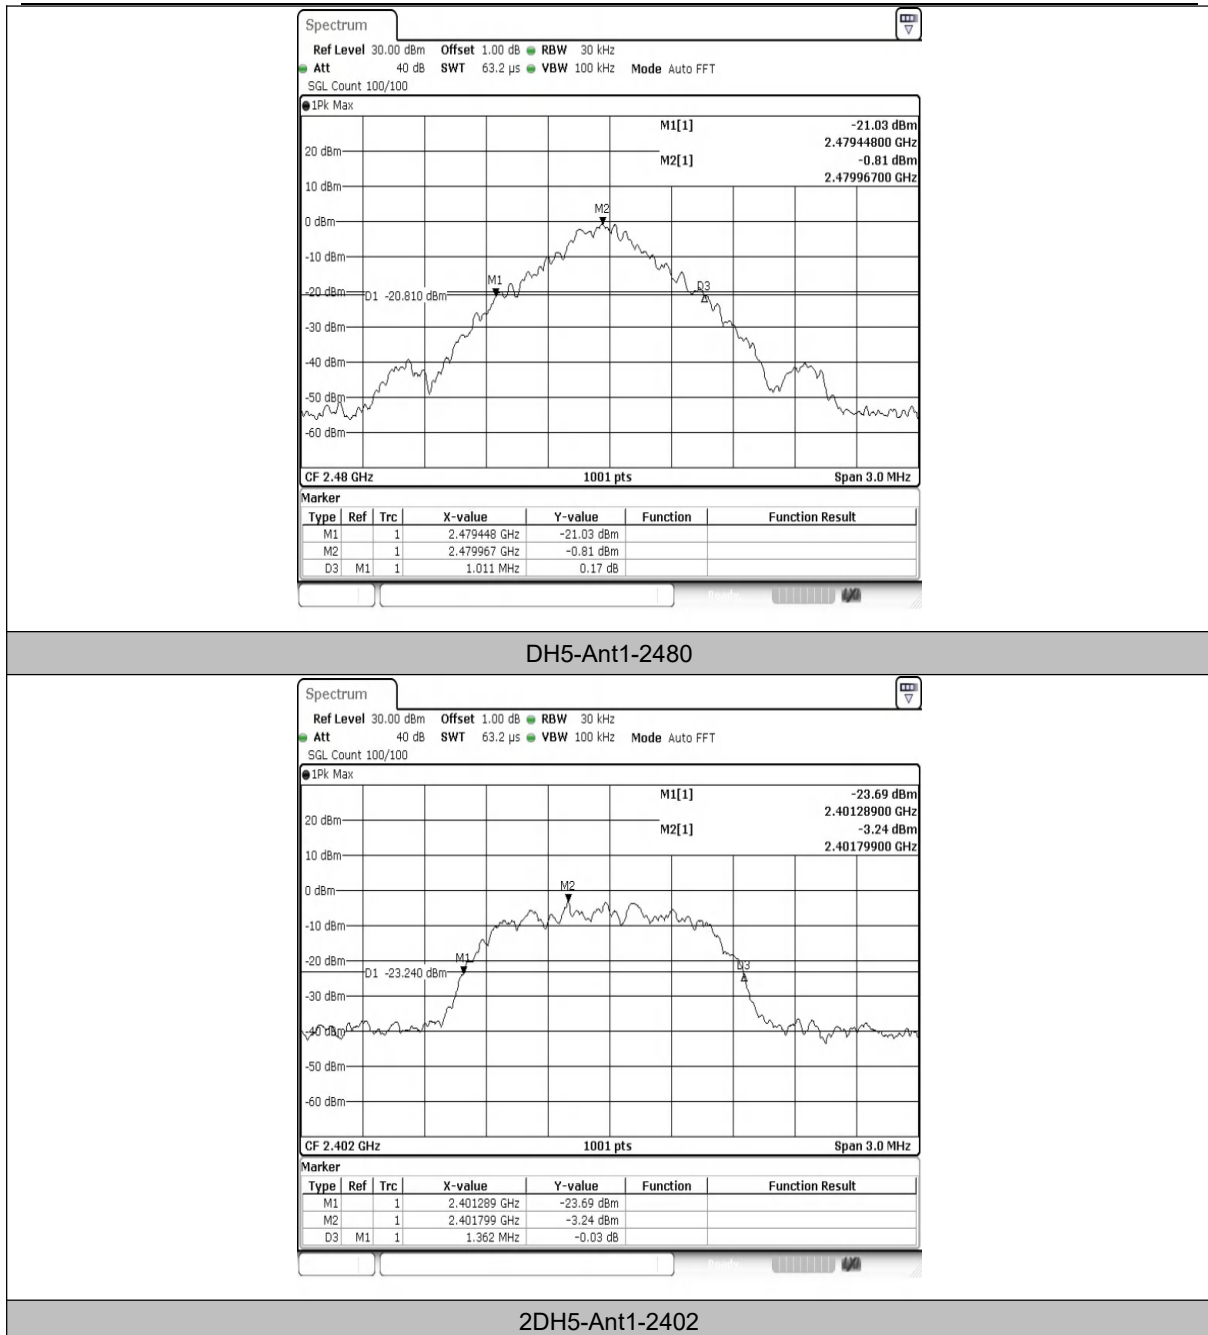

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

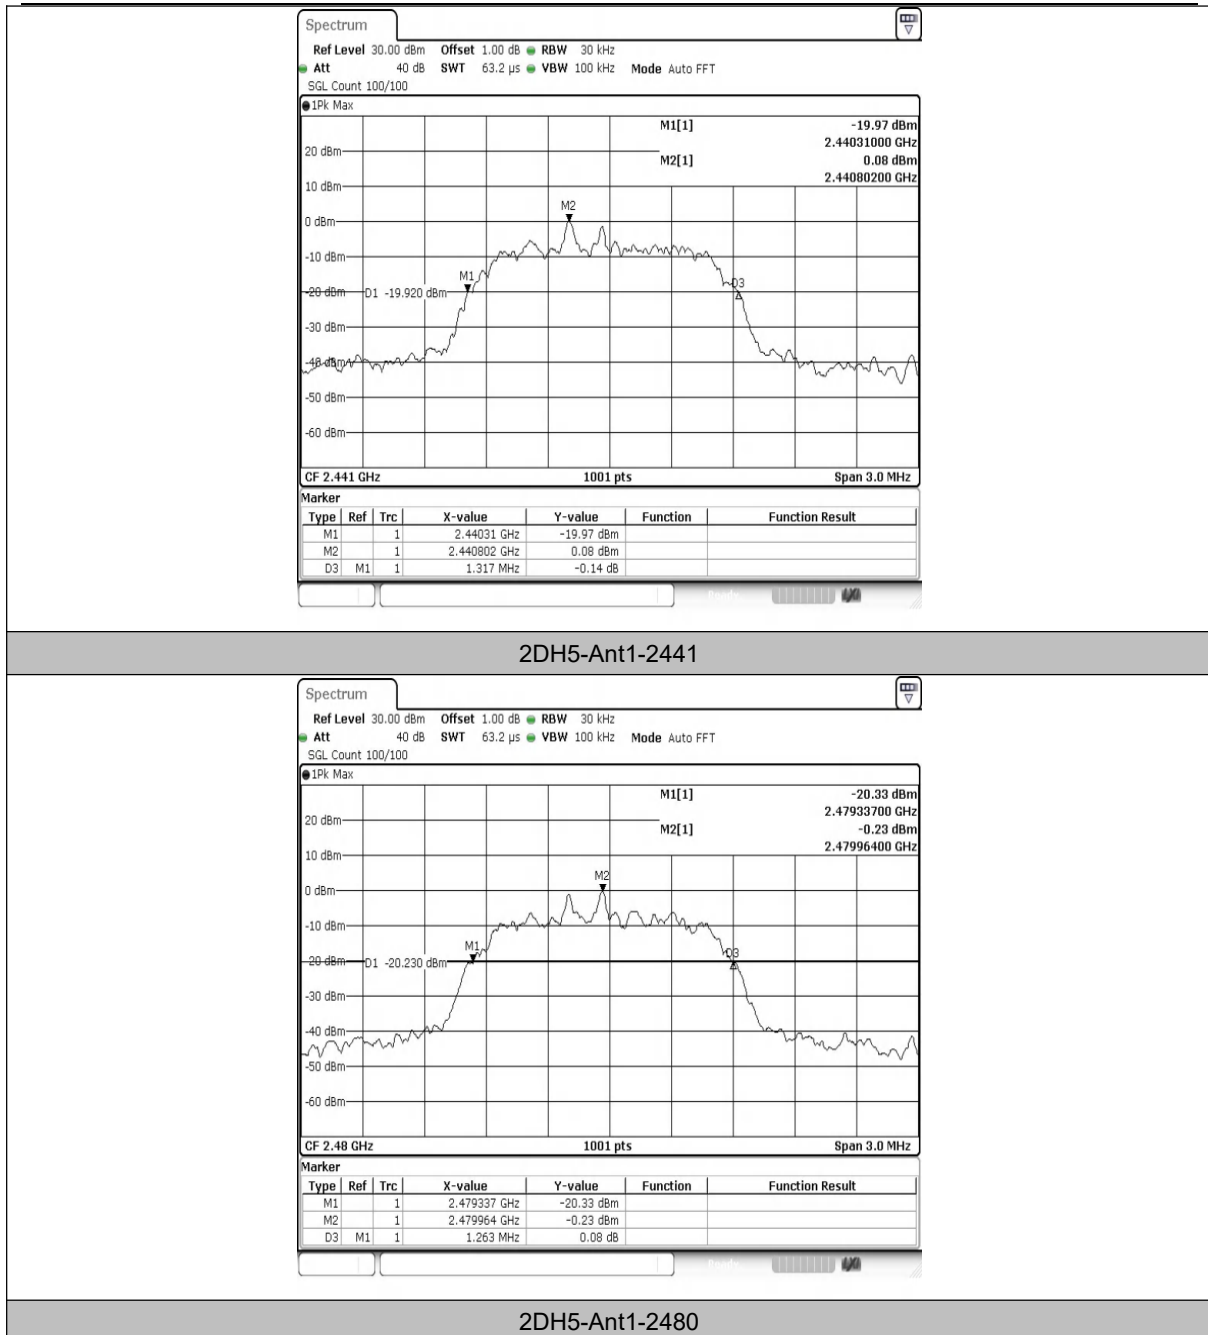


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

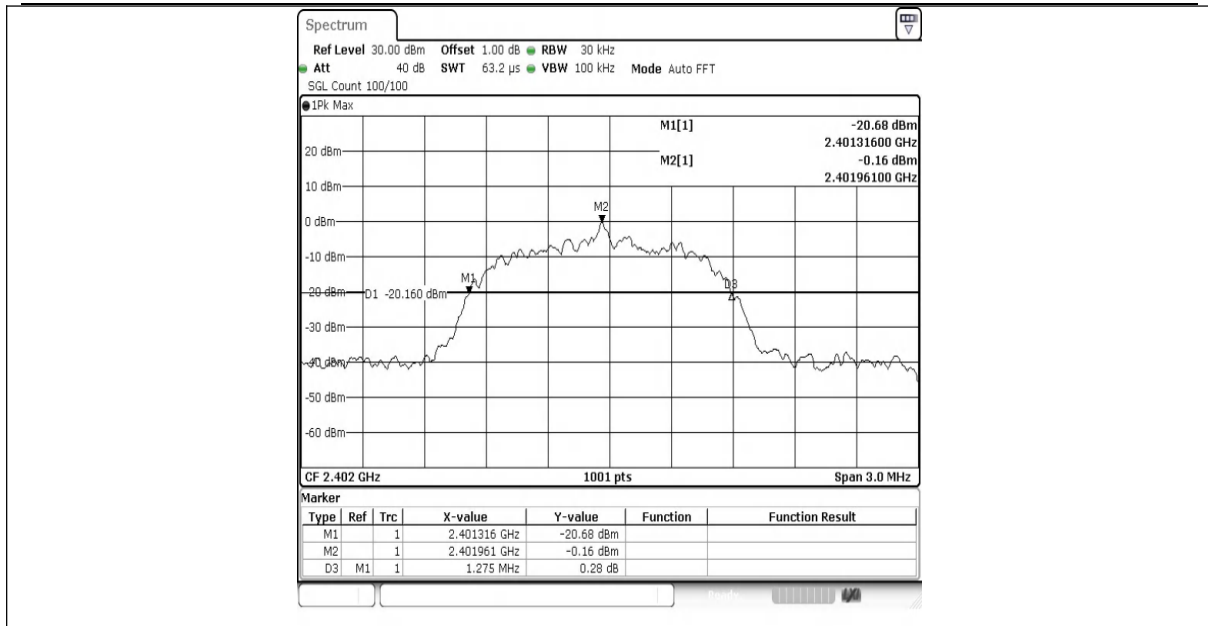

3DH5-Ant1-2402

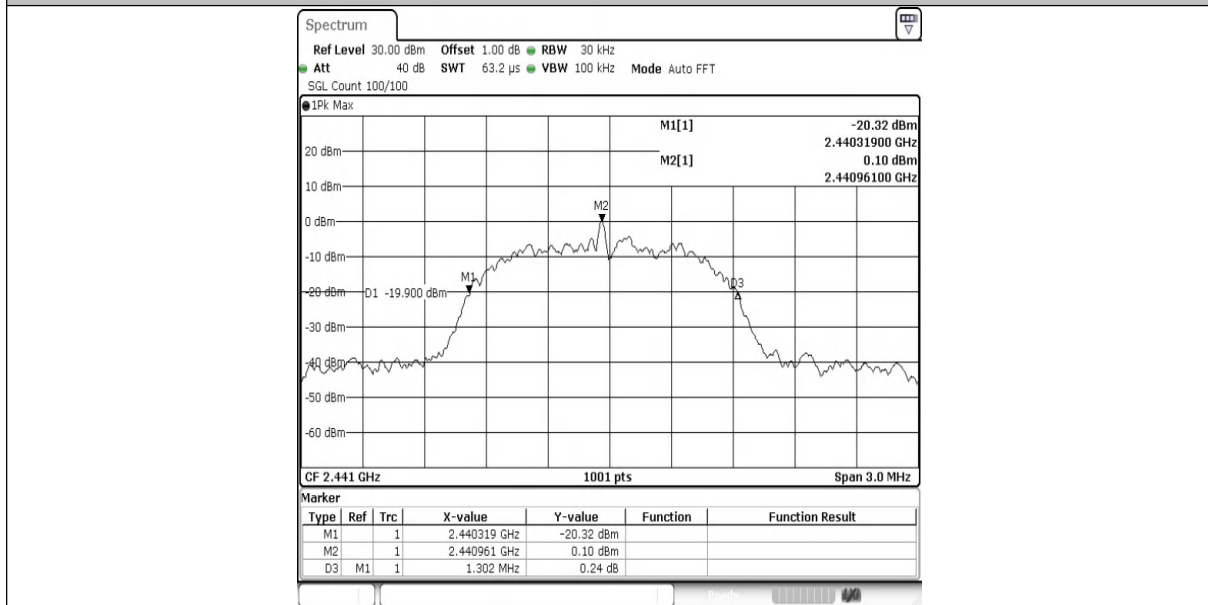


3DH5-Ant1-2441

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

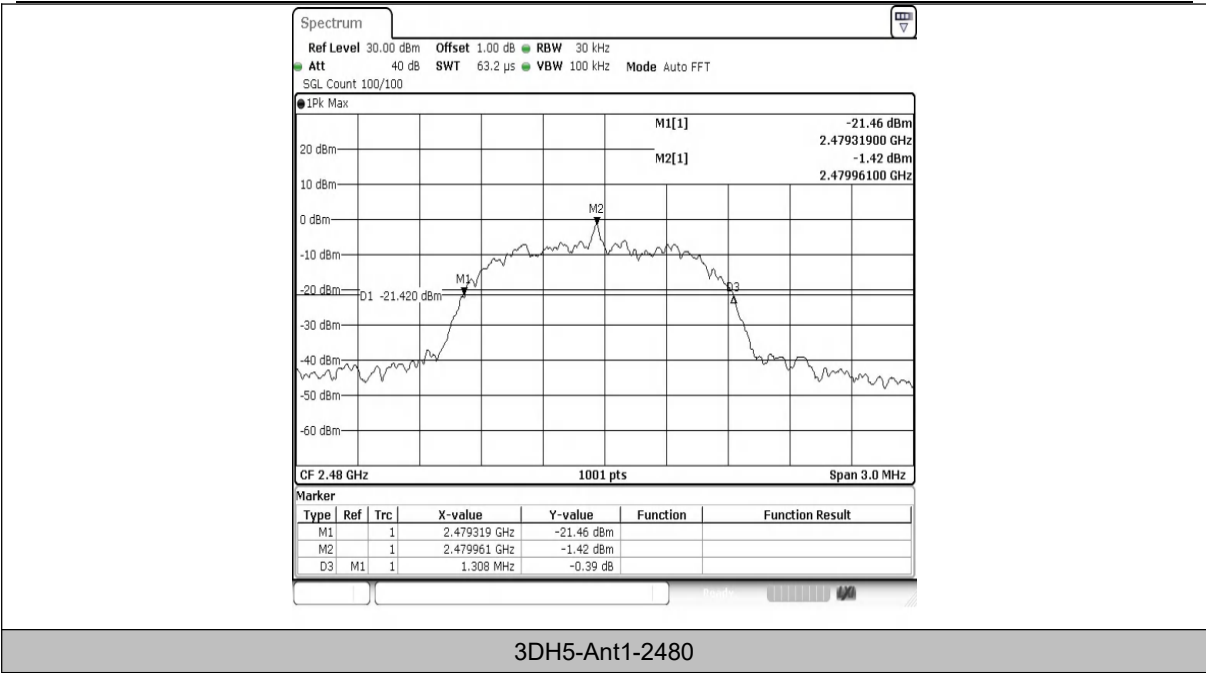

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	1.0160	2401.5145	2402.5305	---	---
DH5	Ant1	2441	0.90509	2440.5145	2441.4196	---	---
DH5	Ant1	2480	0.88711	2479.5235	2480.4106	---	---
2DH5	Ant1	2402	1.2138	2401.3646	2402.5784	---	---
2DH5	Ant1	2441	1.1928	2440.3646	2441.5574	---	---
2DH5	Ant1	2480	1.2198	2479.3616	2480.5814	---	---
3DH5	Ant1	2402	1.2018	2401.3556	2402.5574	---	---
3DH5	Ant1	2441	1.1868	2440.3766	2441.5634	---	---
3DH5	Ant1	2480	1.2048	2479.3586	2480.5634	---	---


Test Graphs

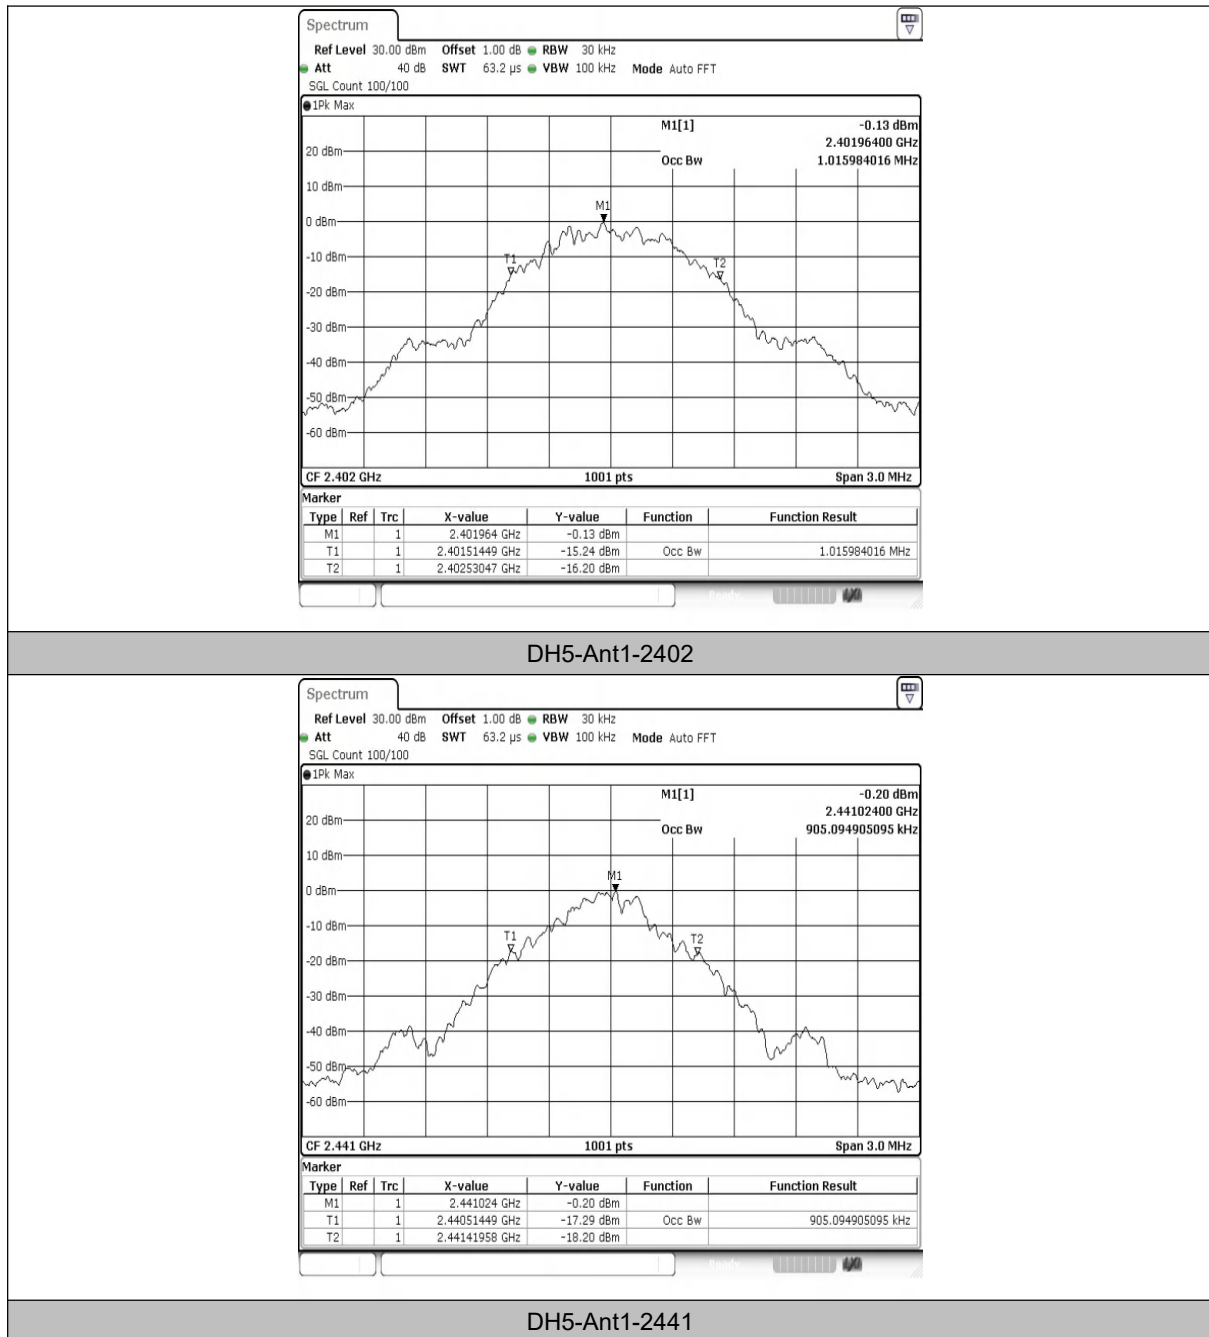

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

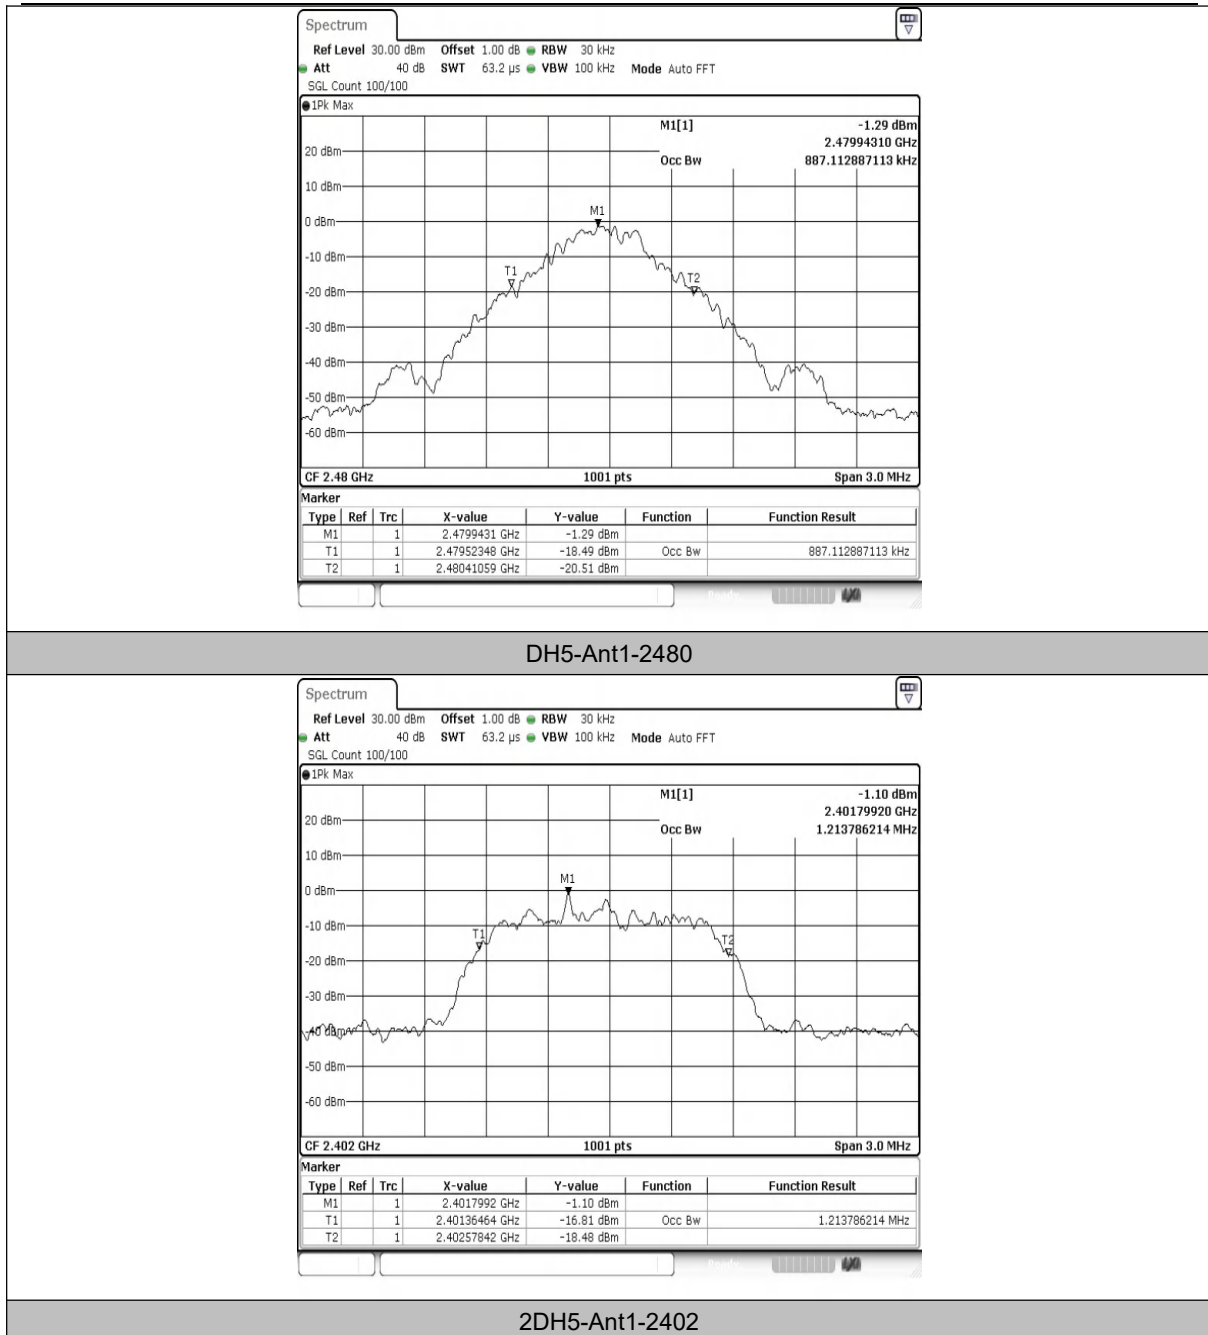

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

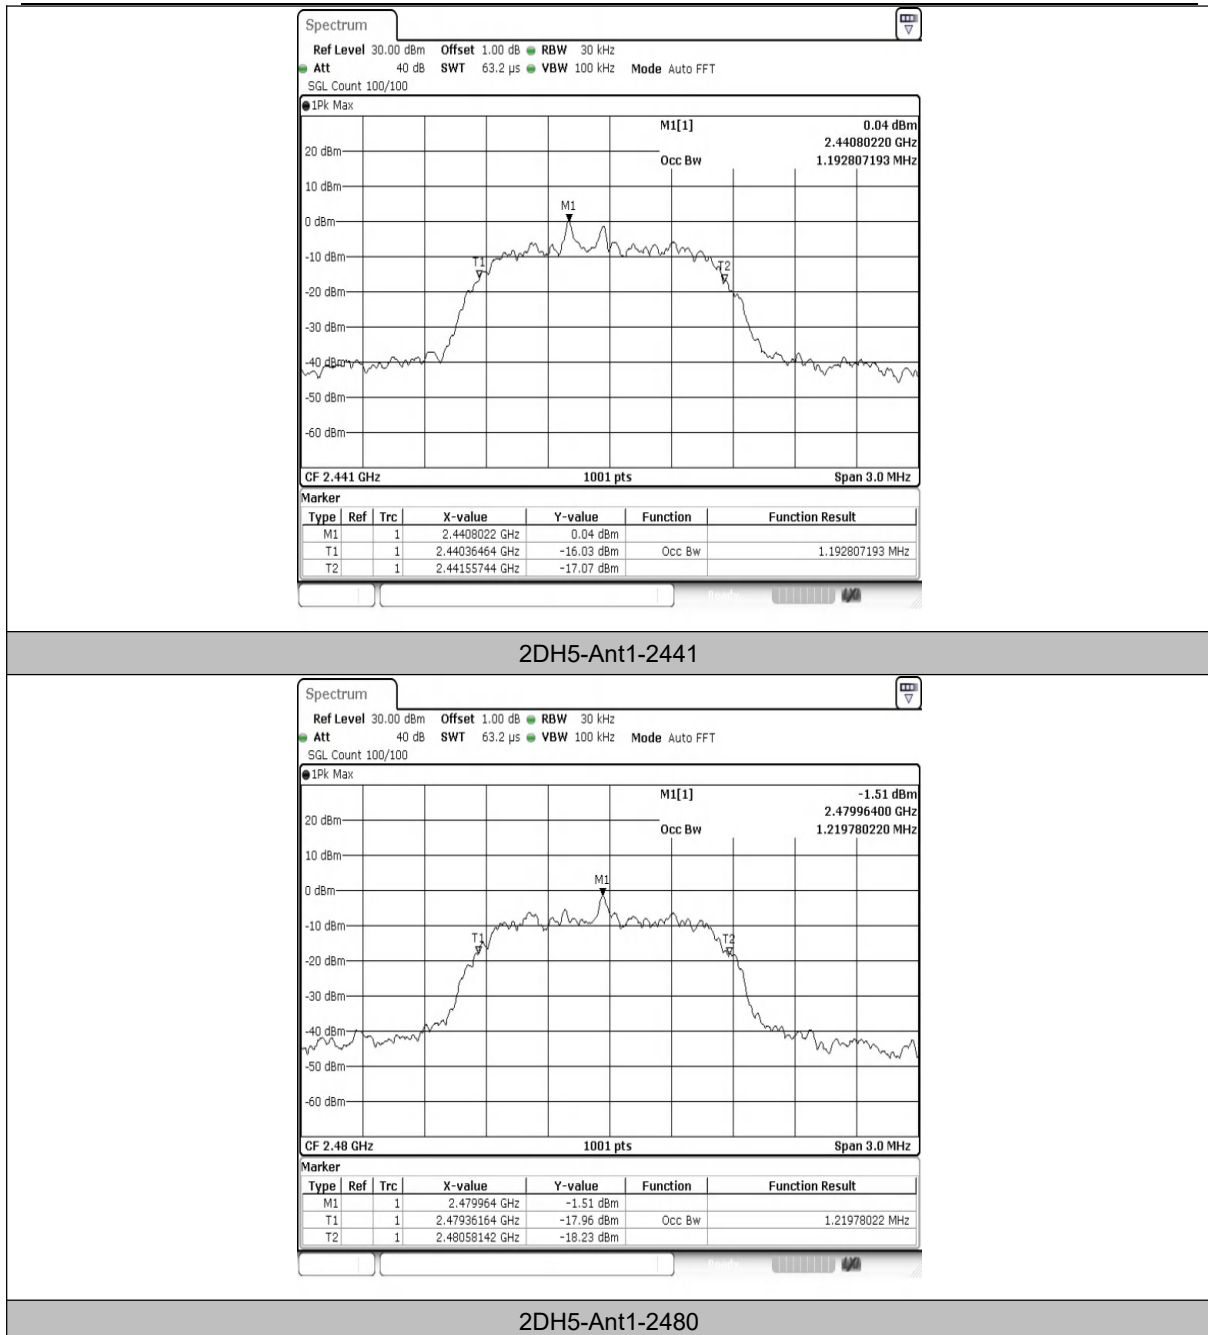

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

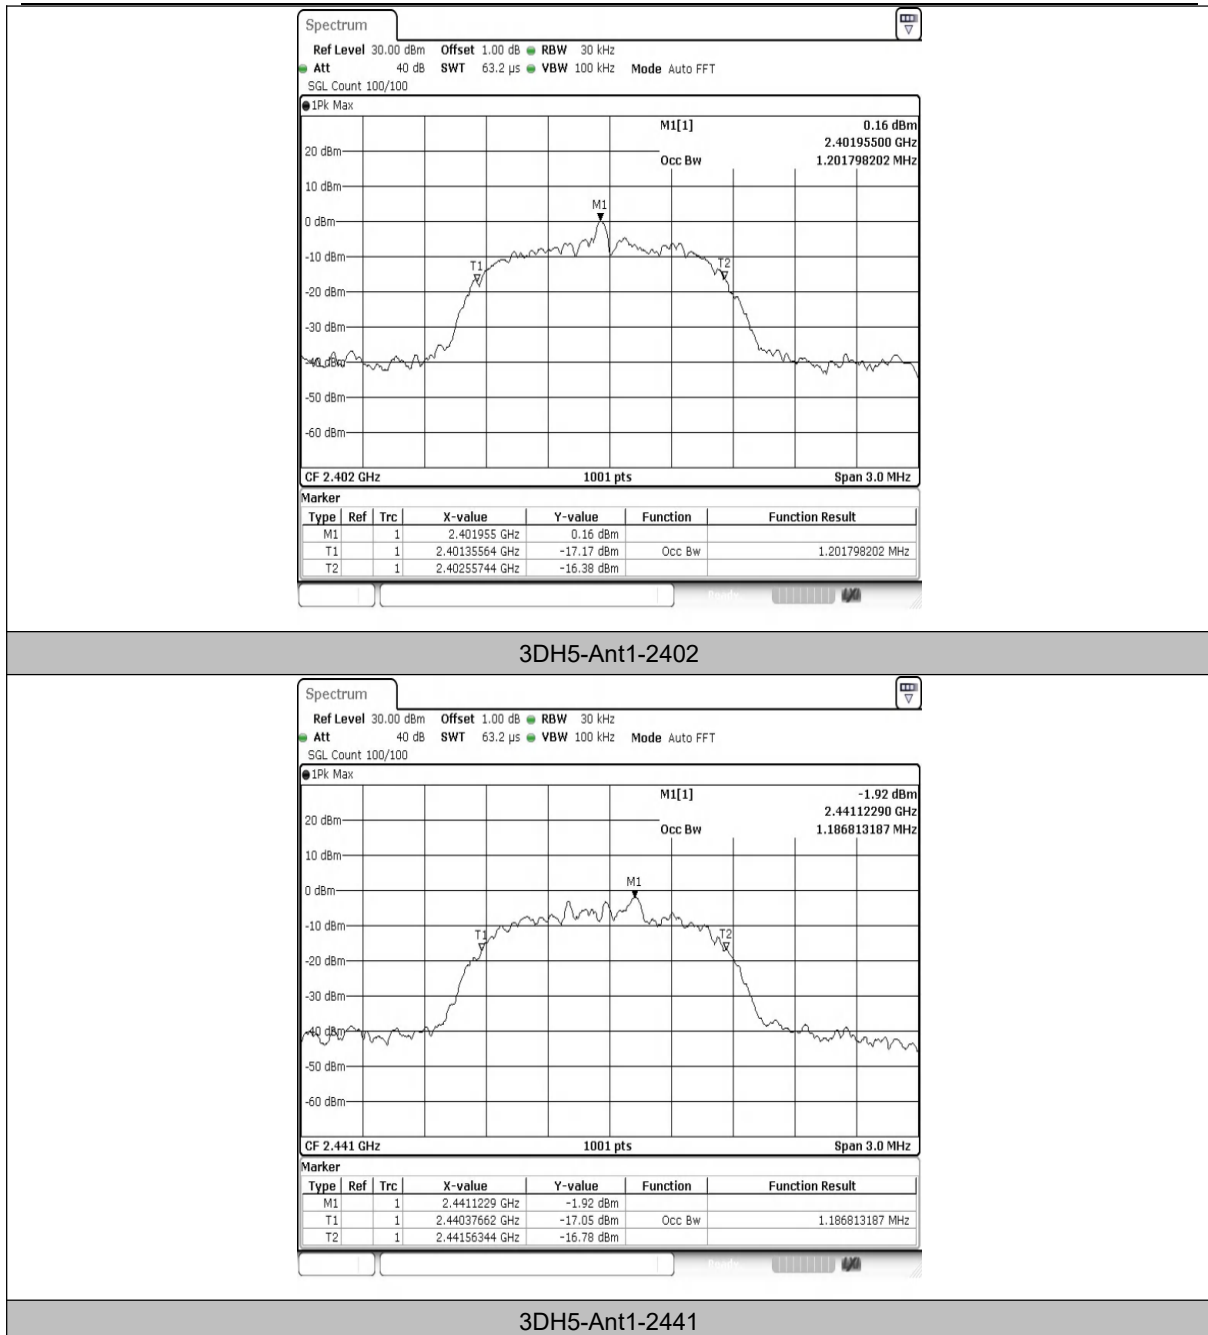

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

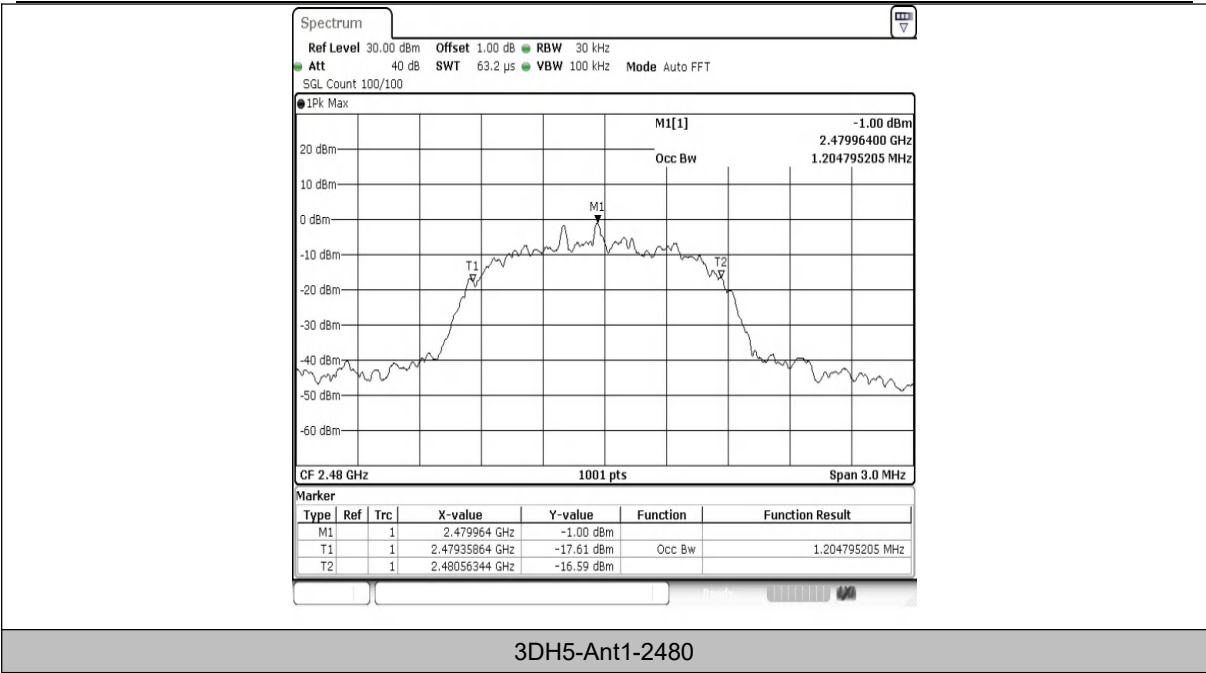

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	2.74	≤20.97	PASS
DH5	Ant1	2441	2.70	≤20.97	PASS
DH5	Ant1	2480	2.10	≤20.97	PASS
2DH5	Ant1	2402	3.18	≤20.97	PASS
2DH5	Ant1	2441	2.98	≤20.97	PASS
2DH5	Ant1	2480	2.33	≤20.97	PASS
3DH5	Ant1	2402	3.50	≤20.97	PASS
3DH5	Ant1	2441	3.34	≤20.97	PASS
3DH5	Ant1	2480	2.64	≤20.97	PASS

Test Graphs

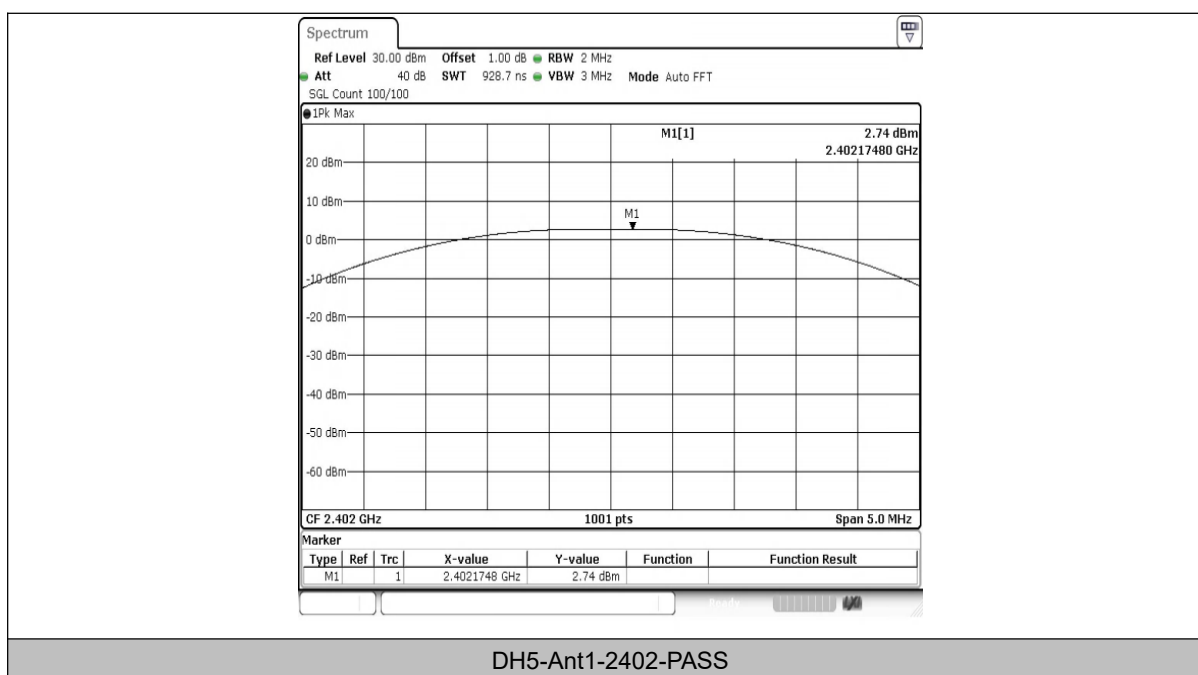


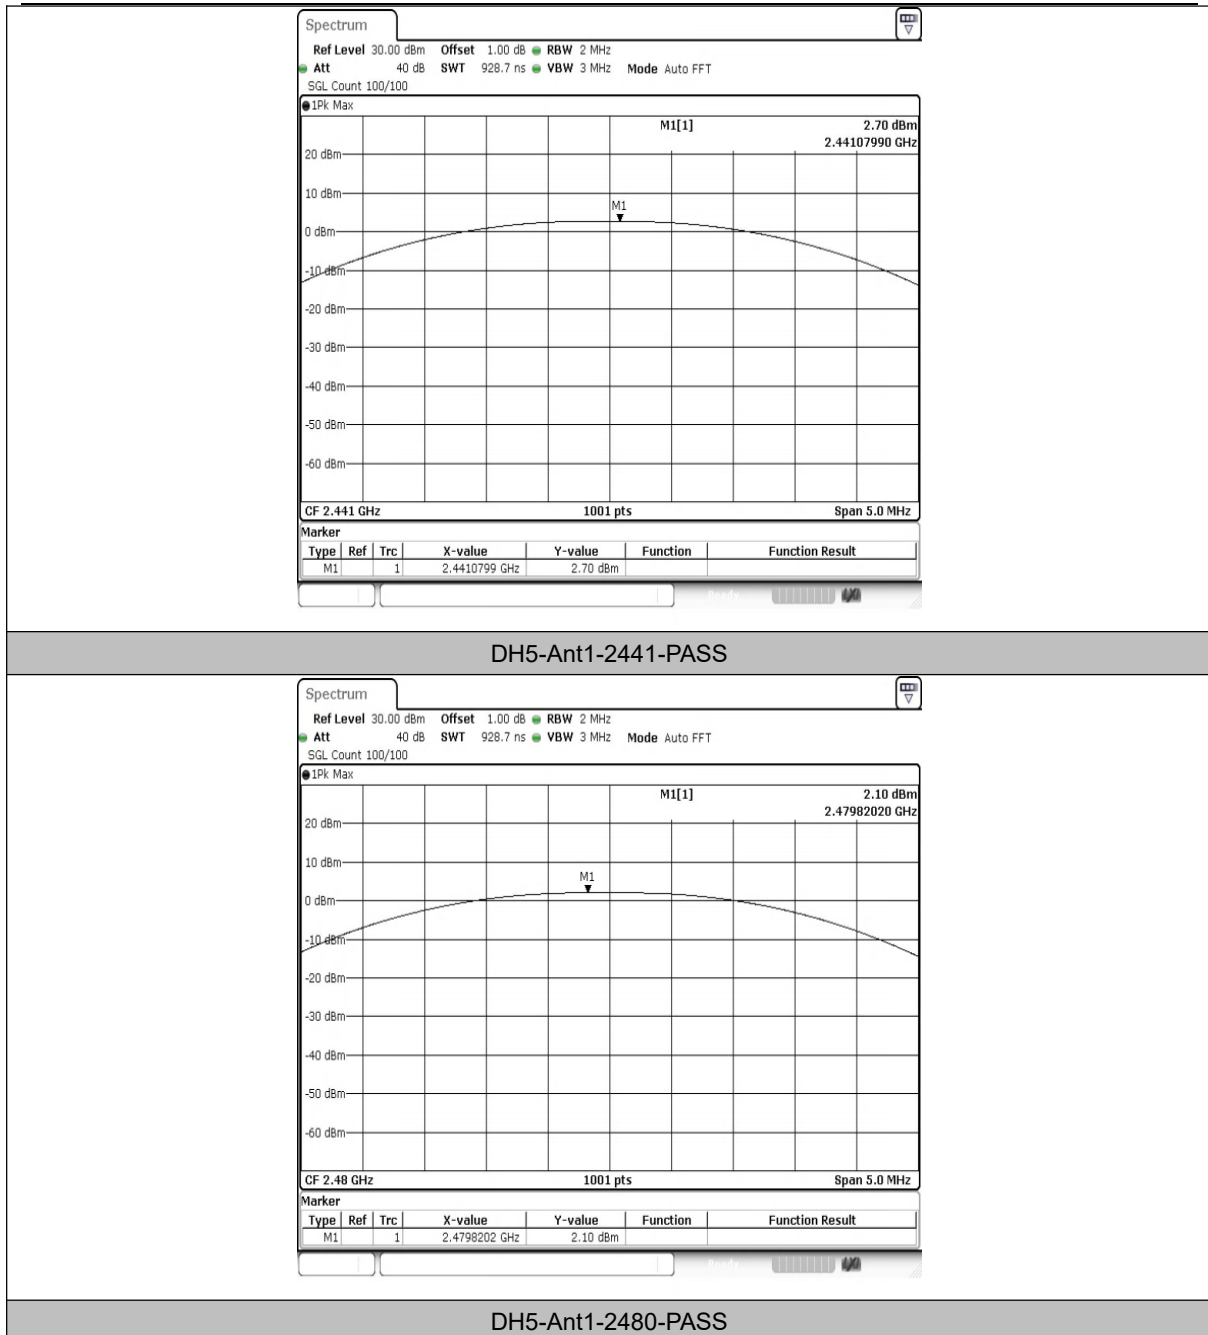


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

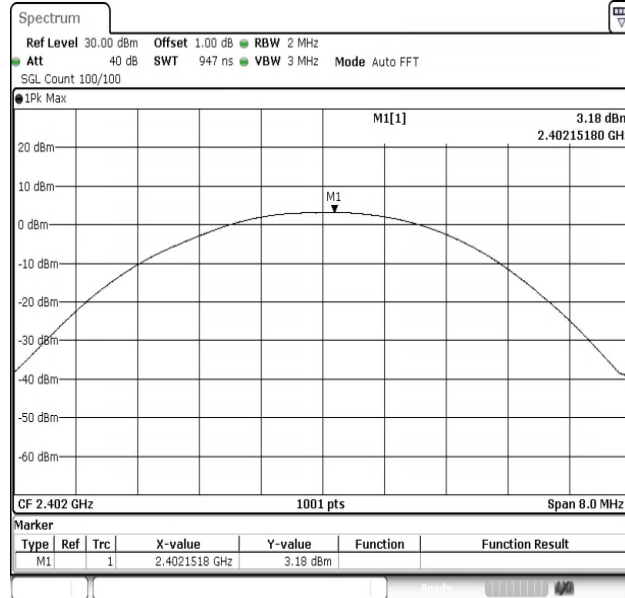

2DH5-Ant1-2402-PASS

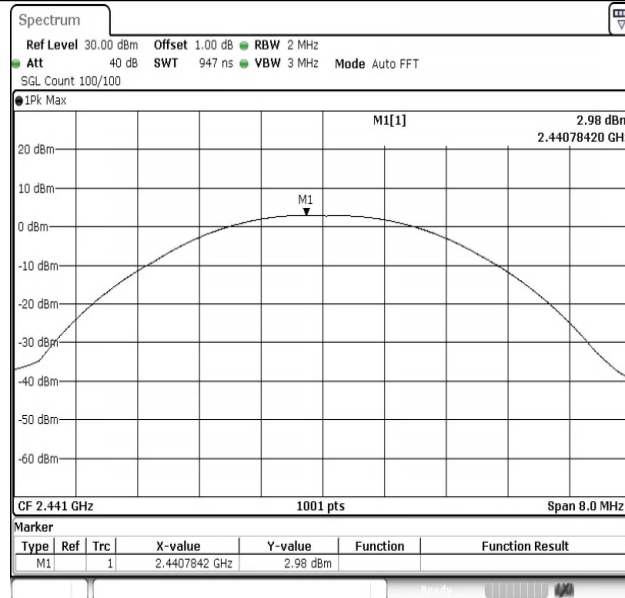



2DH5-Ant1-2441-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

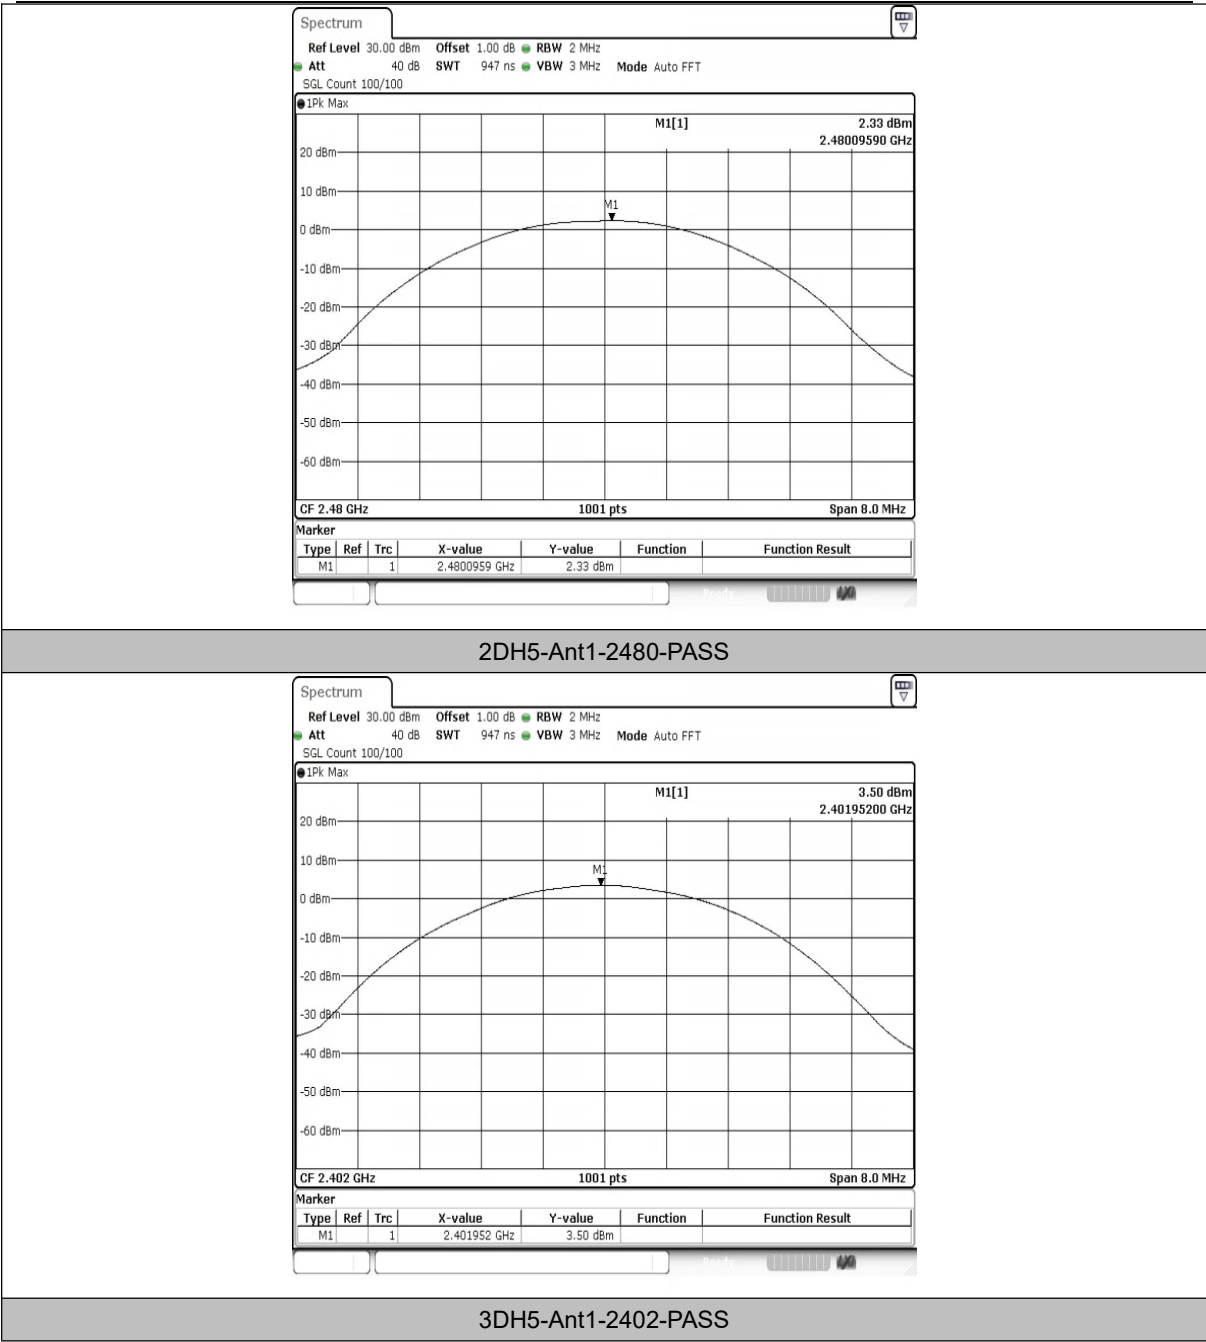

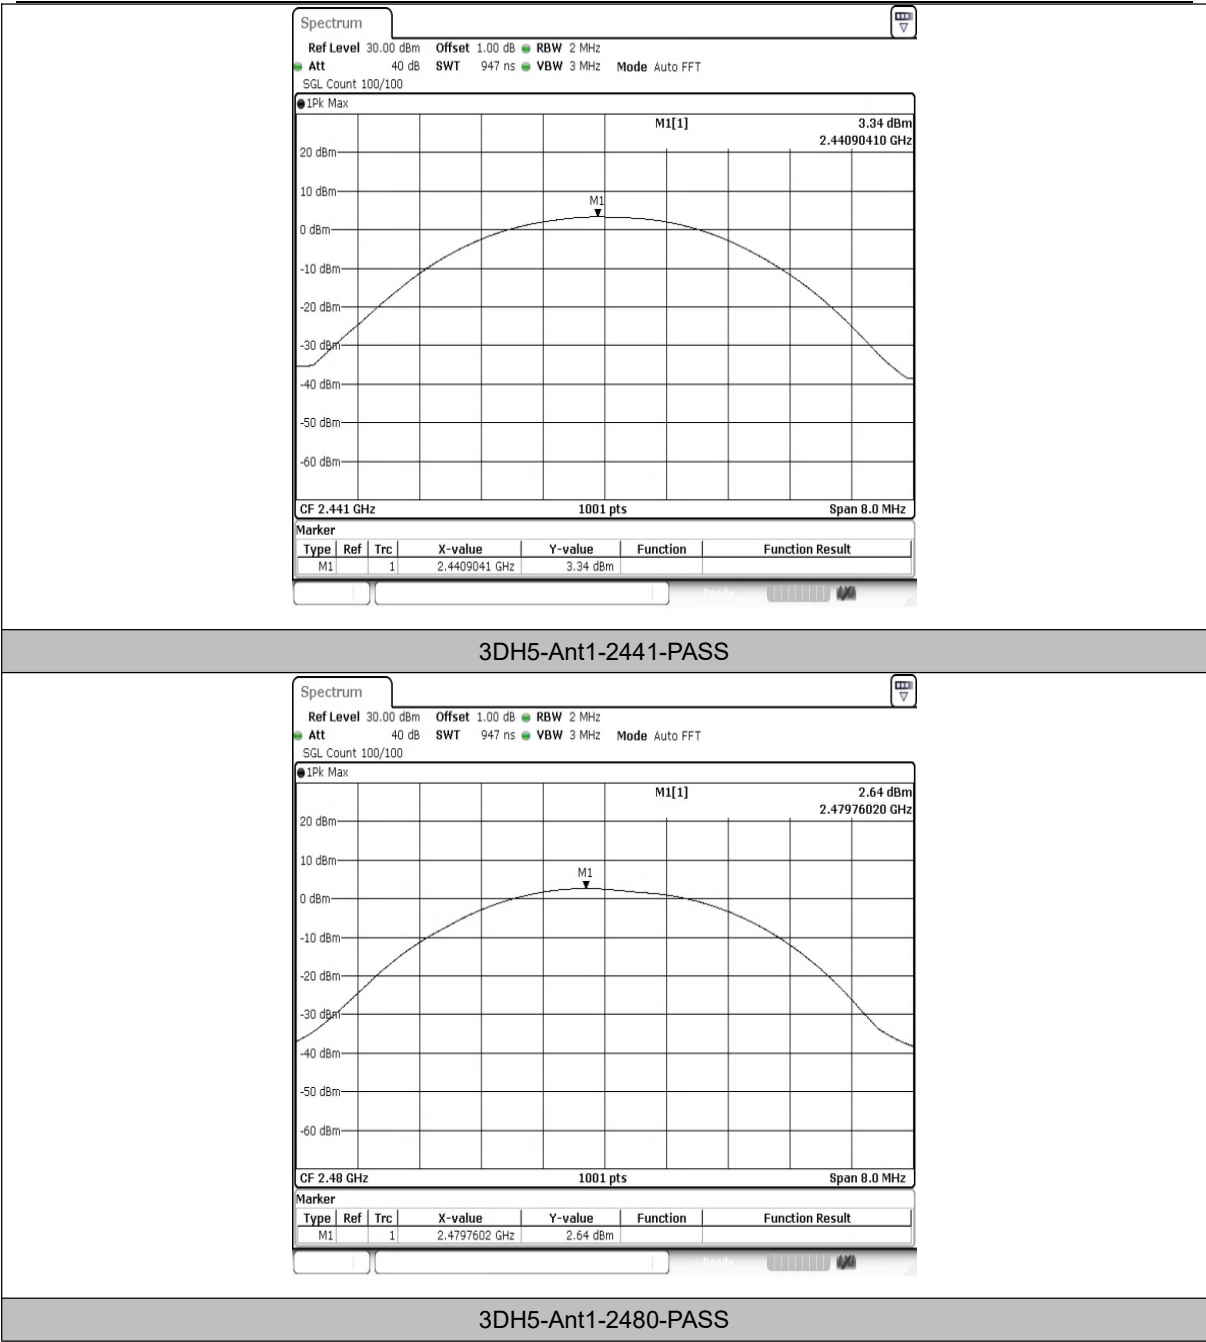


Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.000	≥0.733	PASS
2DH5	Ant1	Hop	1.000	≥0.907	PASS
3DH5	Ant1	Hop	1.000	≥0.873	PASS


Test Graphs

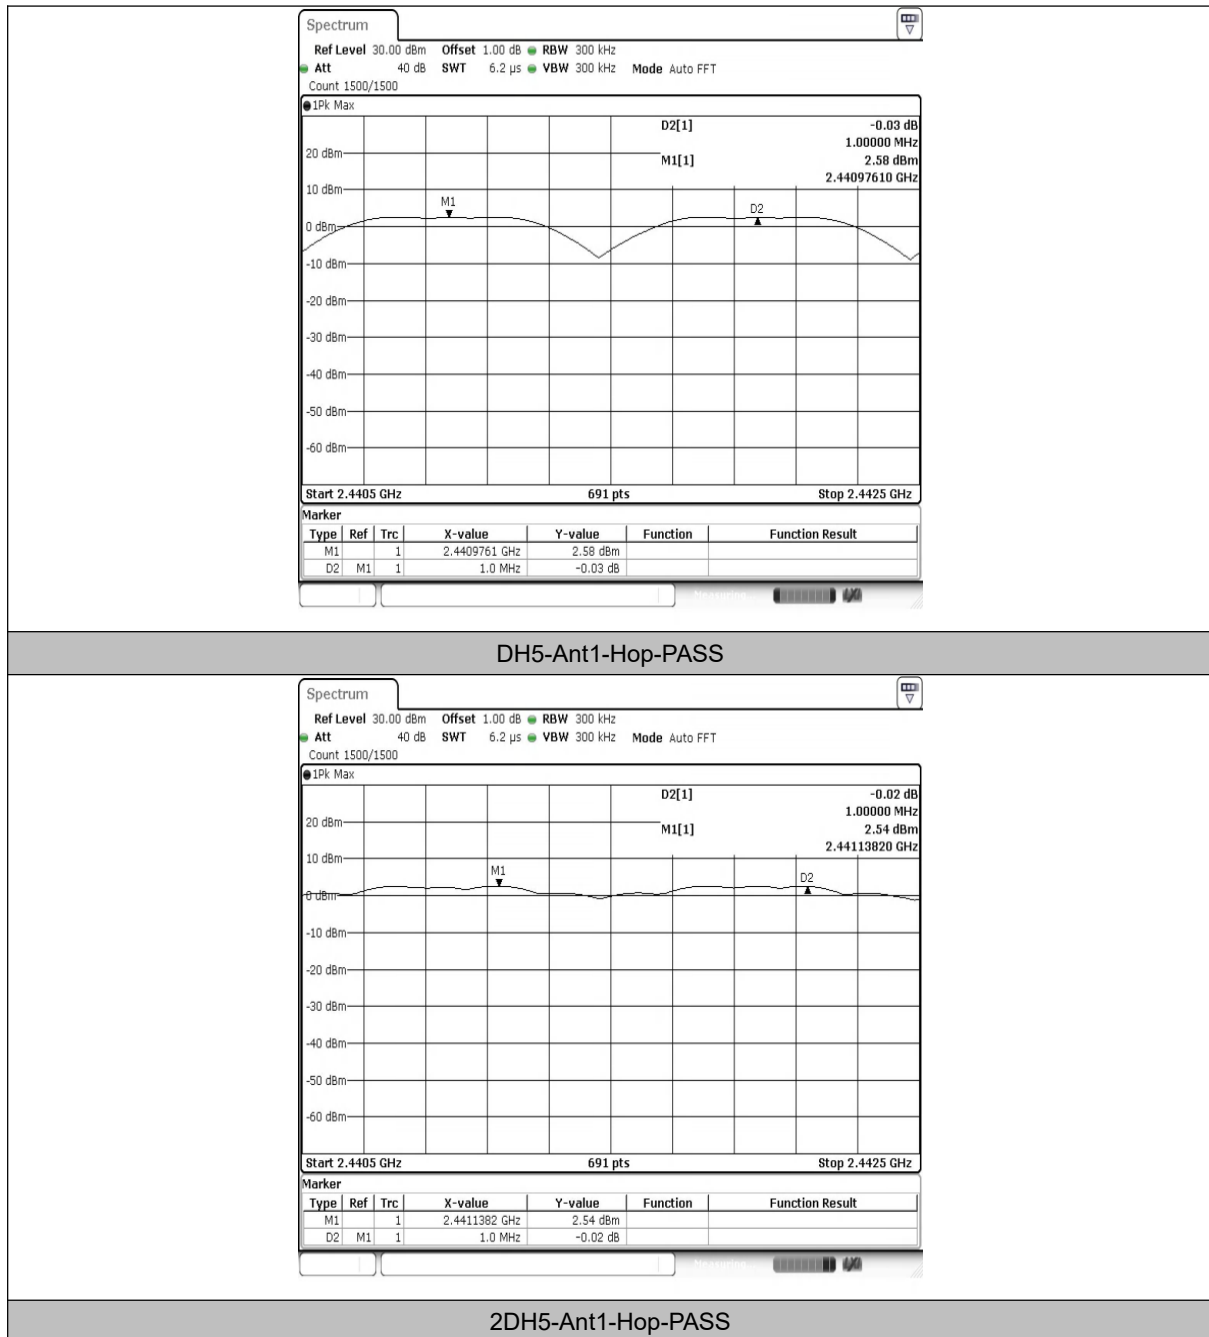

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

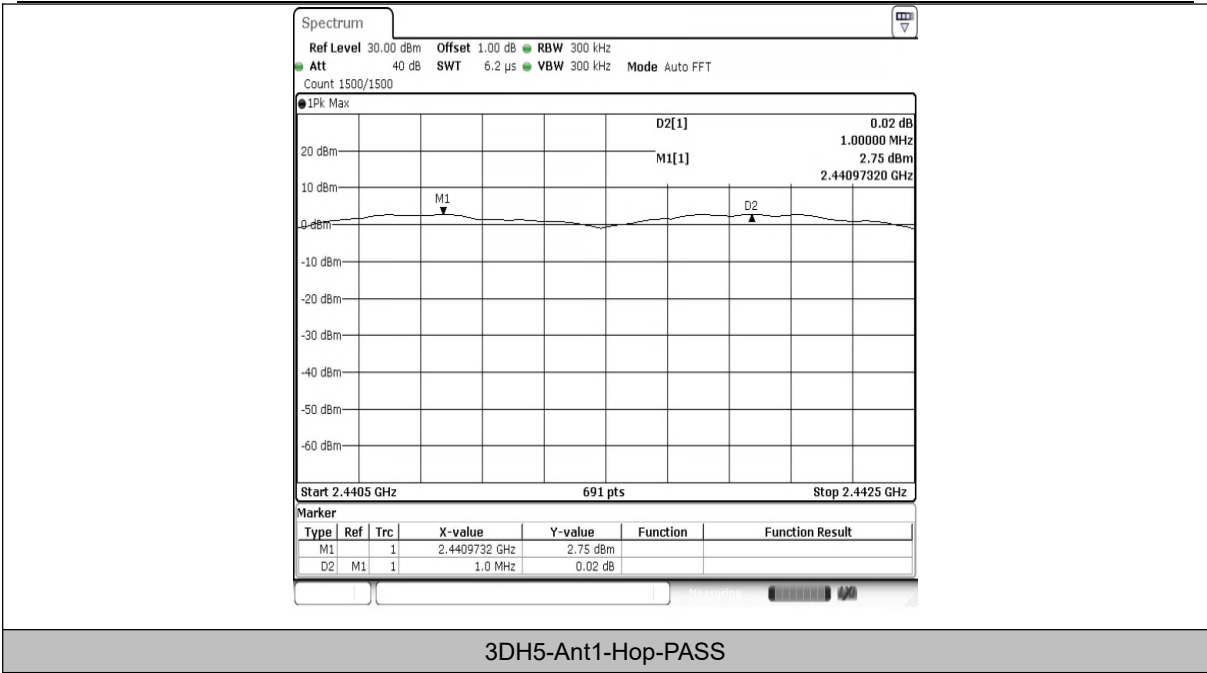

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.887	96	0.277	≤0.4	PASS
2DH5	Ant1	Hop	2.892	111	0.321	≤0.4	PASS
3DH5	Ant1	Hop	2.893	109	0.315	≤0.4	PASS


Test Graphs

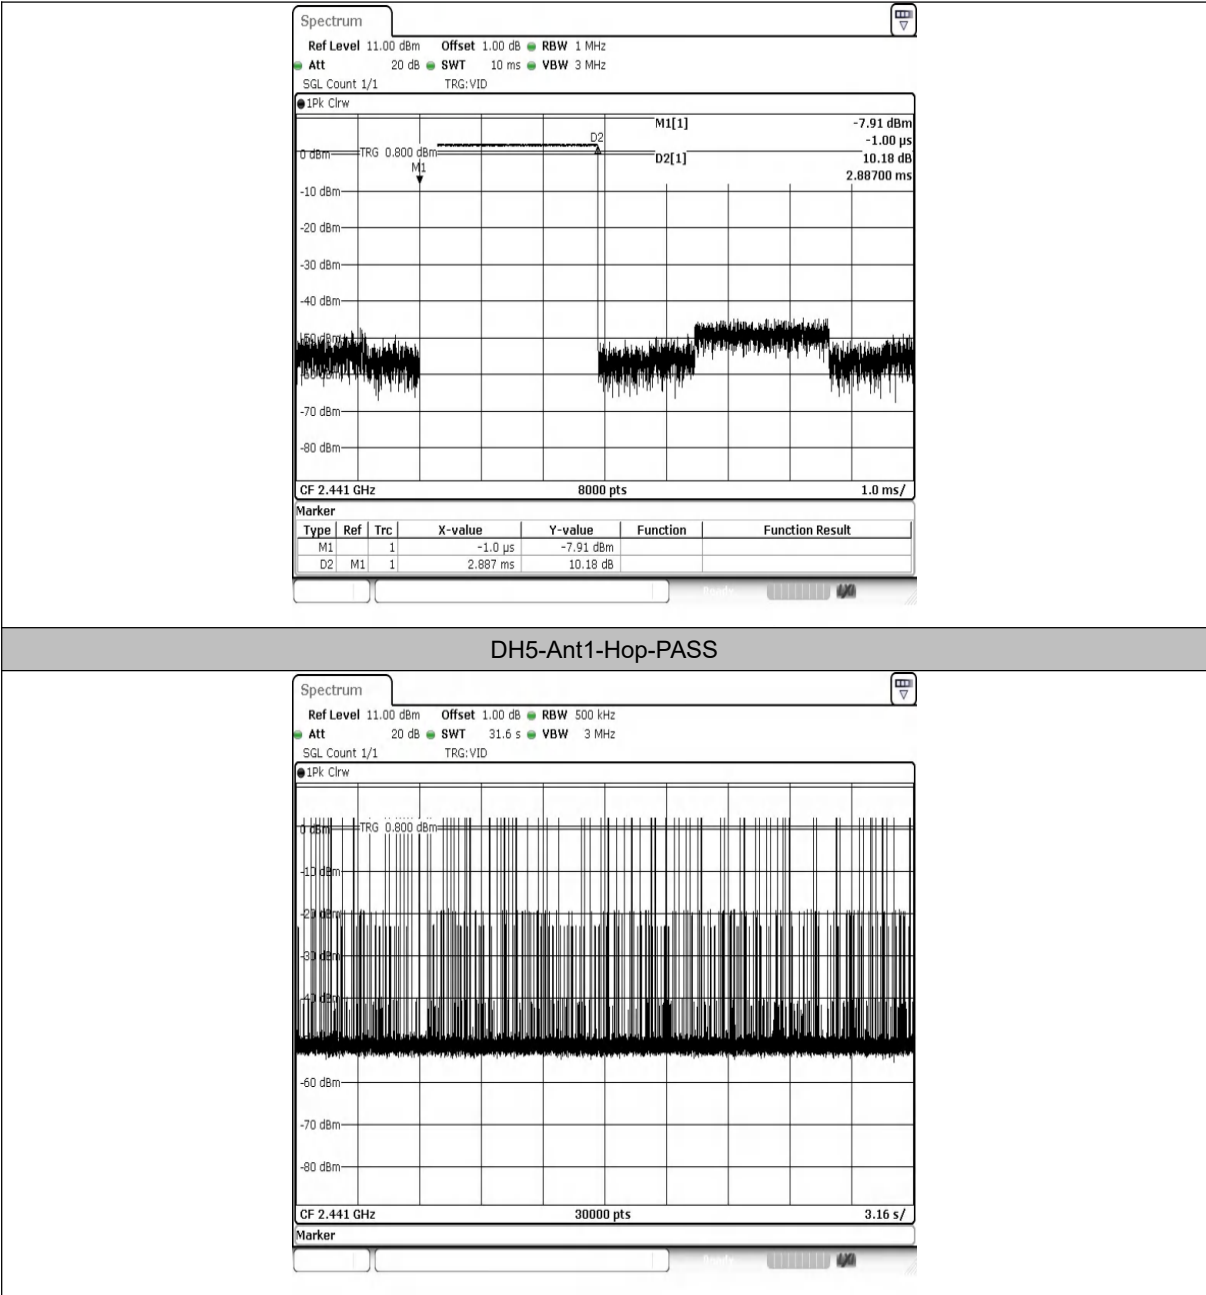

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

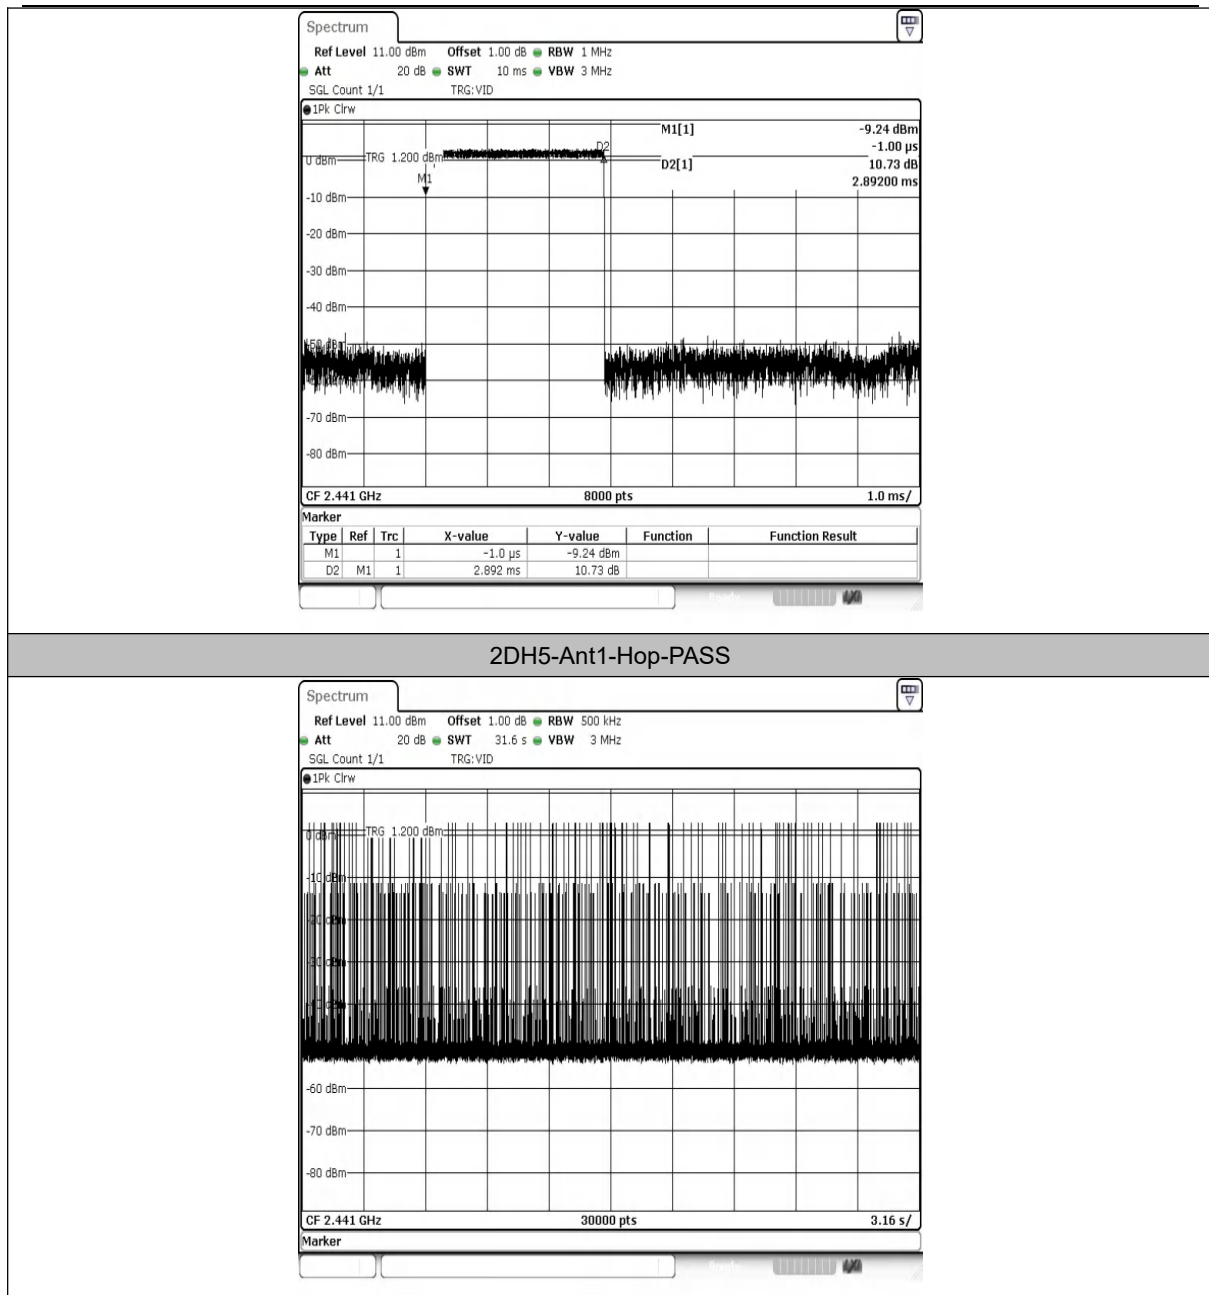

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

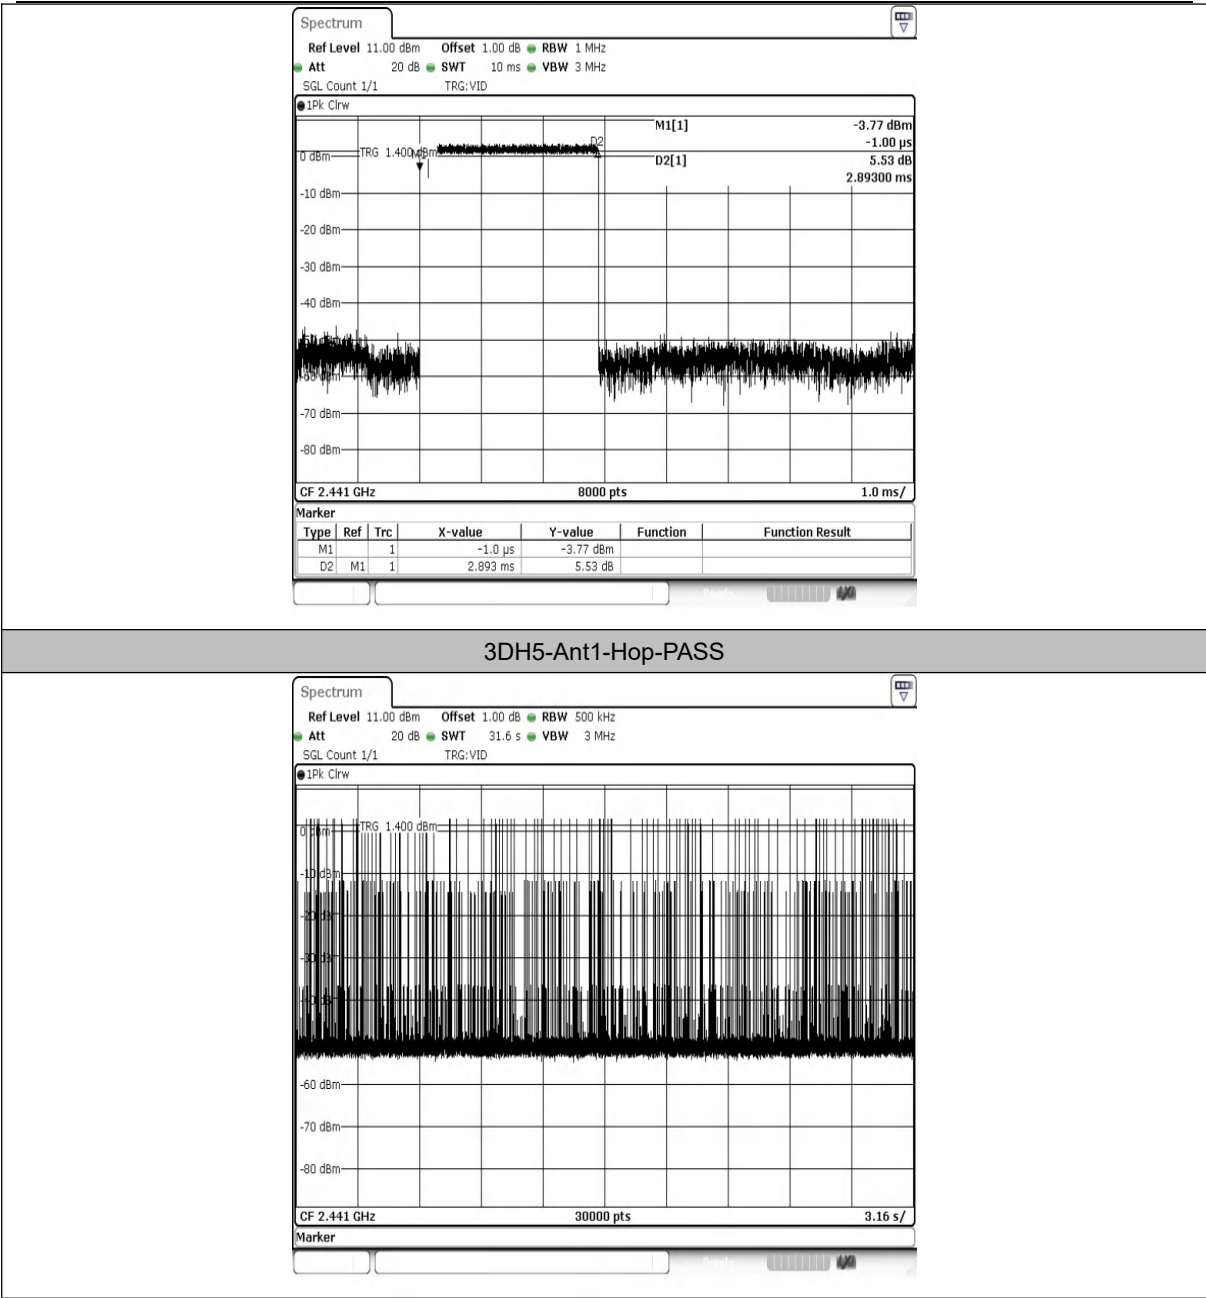

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS


Test Graphs

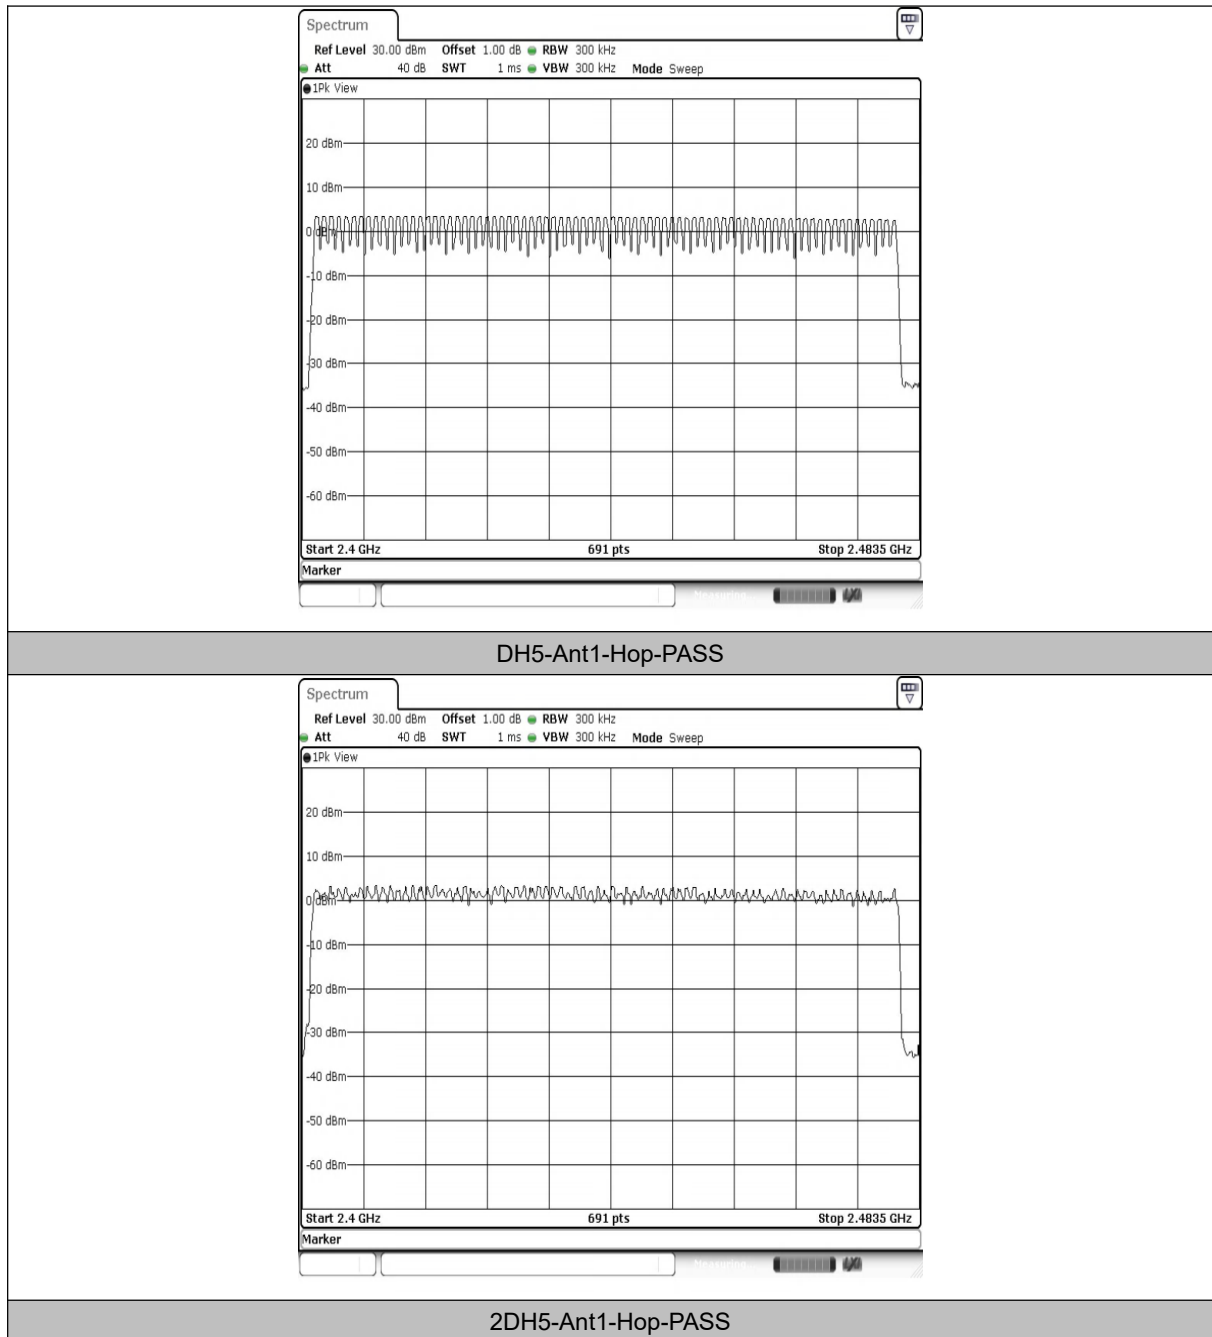

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

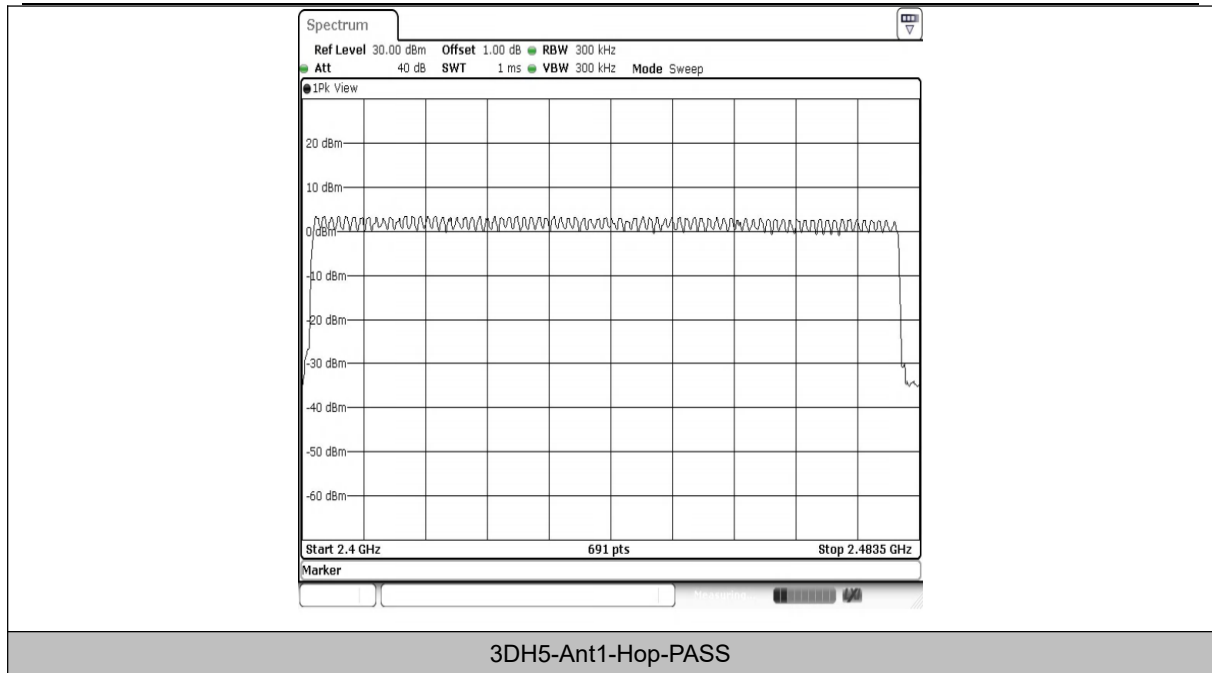

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge


Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	2.71	-47.8	≤-17.29	PASS
DH5	Ant1	High	2480	1.51	-53.92	≤-18.49	PASS
DH5	Ant1	Low	Hop_2402	2.01	-50.2	≤-17.99	PASS
DH5	Ant1	High	Hop_2480	1.71	-54.38	≤-18.29	PASS
2DH5	Ant1	Low	2402	1.61	-49.85	≤-18.39	PASS
2DH5	Ant1	High	2480	2.08	-55.2	≤-17.92	PASS
2DH5	Ant1	Low	Hop_2402	1.23	-53.6	≤-18.77	PASS
2DH5	Ant1	High	Hop_2480	-1.72	-54.97	≤-21.72	PASS
3DH5	Ant1	Low	2402	2.93	-52.09	≤-17.07	PASS
3DH5	Ant1	High	2480	1.96	-53.24	≤-18.04	PASS
3DH5	Ant1	Low	Hop_2402	0.60	-50.7	≤-19.4	PASS
3DH5	Ant1	High	Hop_2480	0.86	-55.78	≤-19.14	PASS

Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Test Graphs

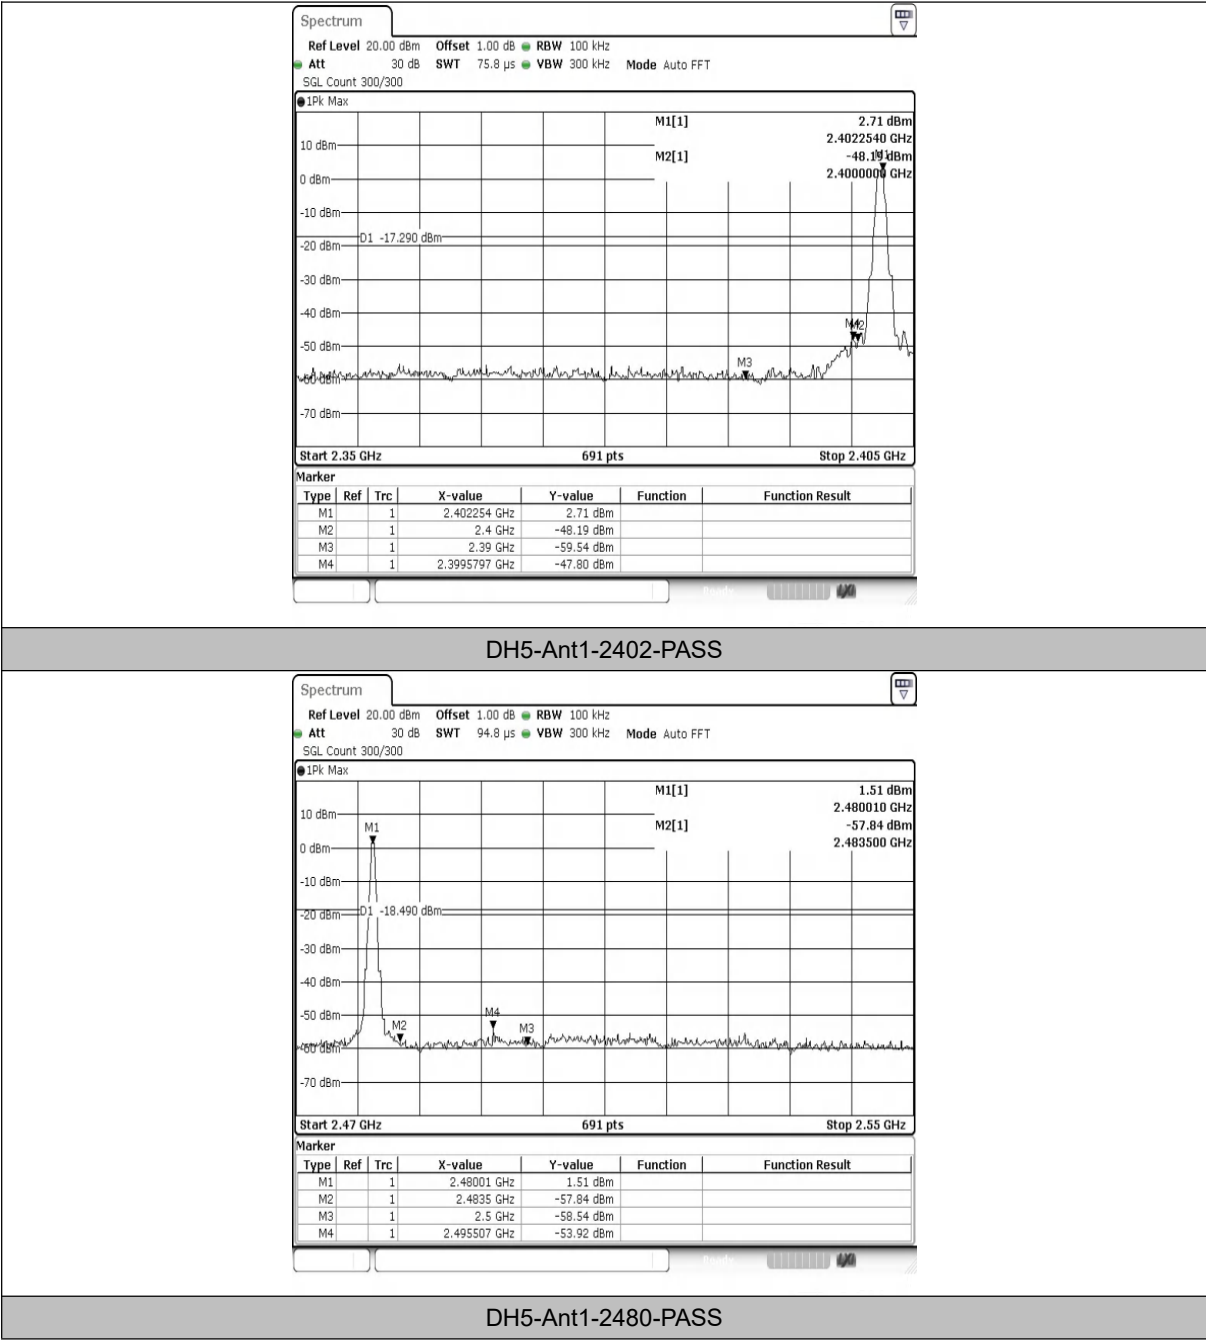


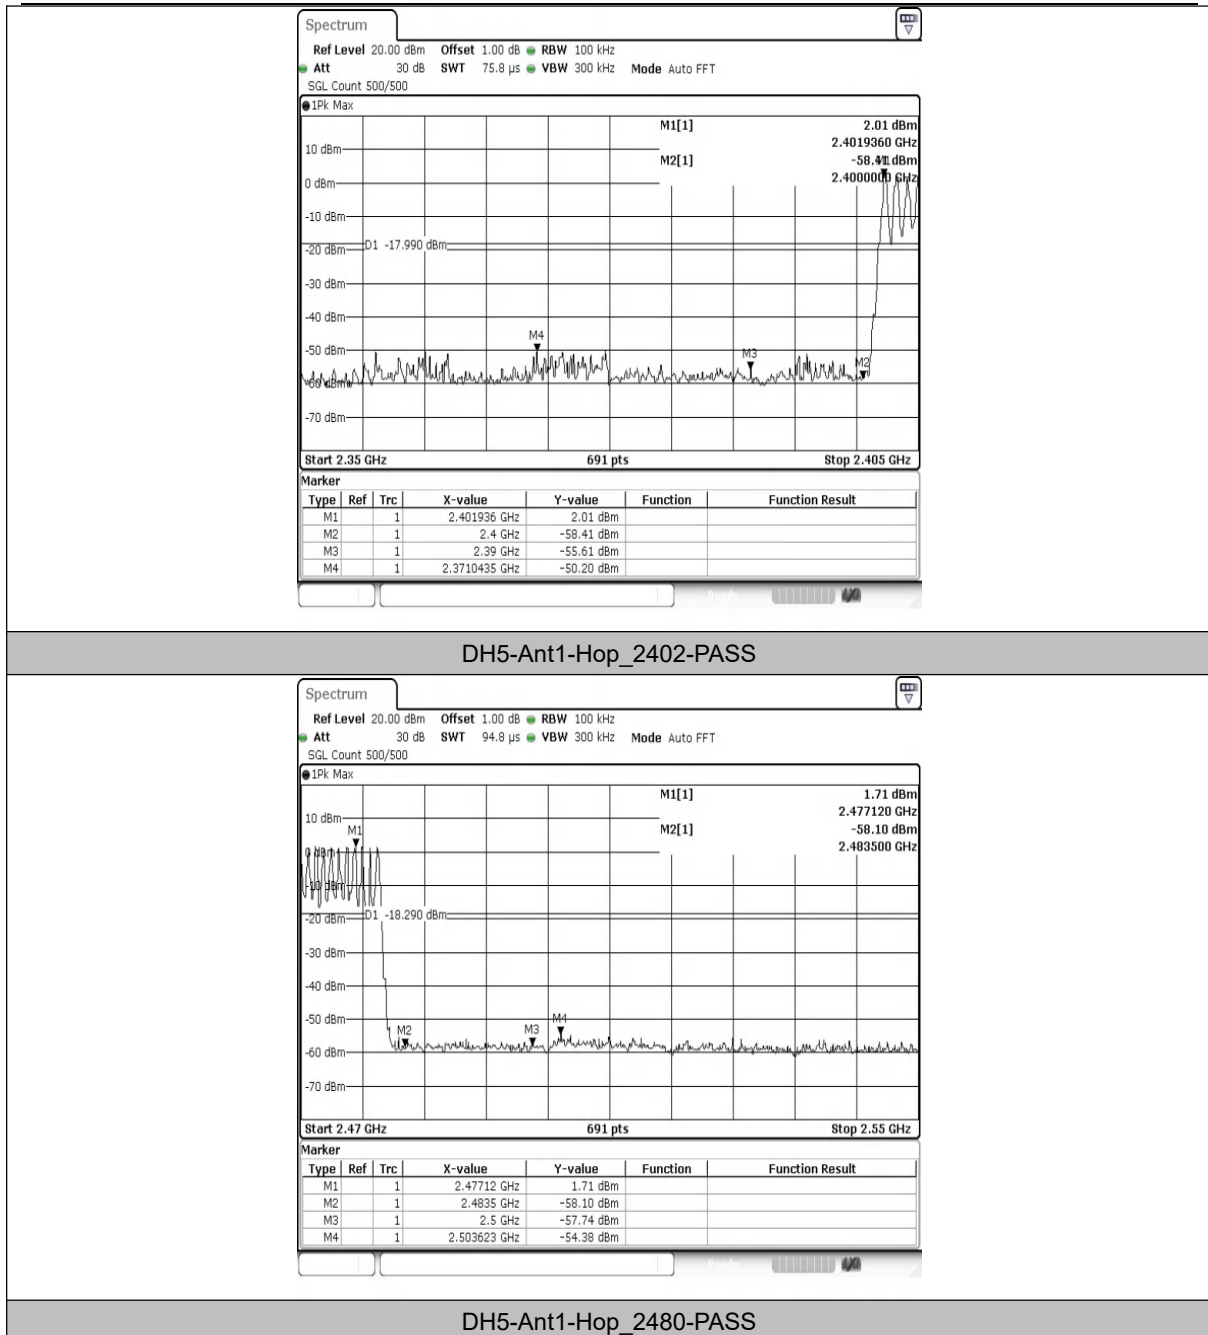

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

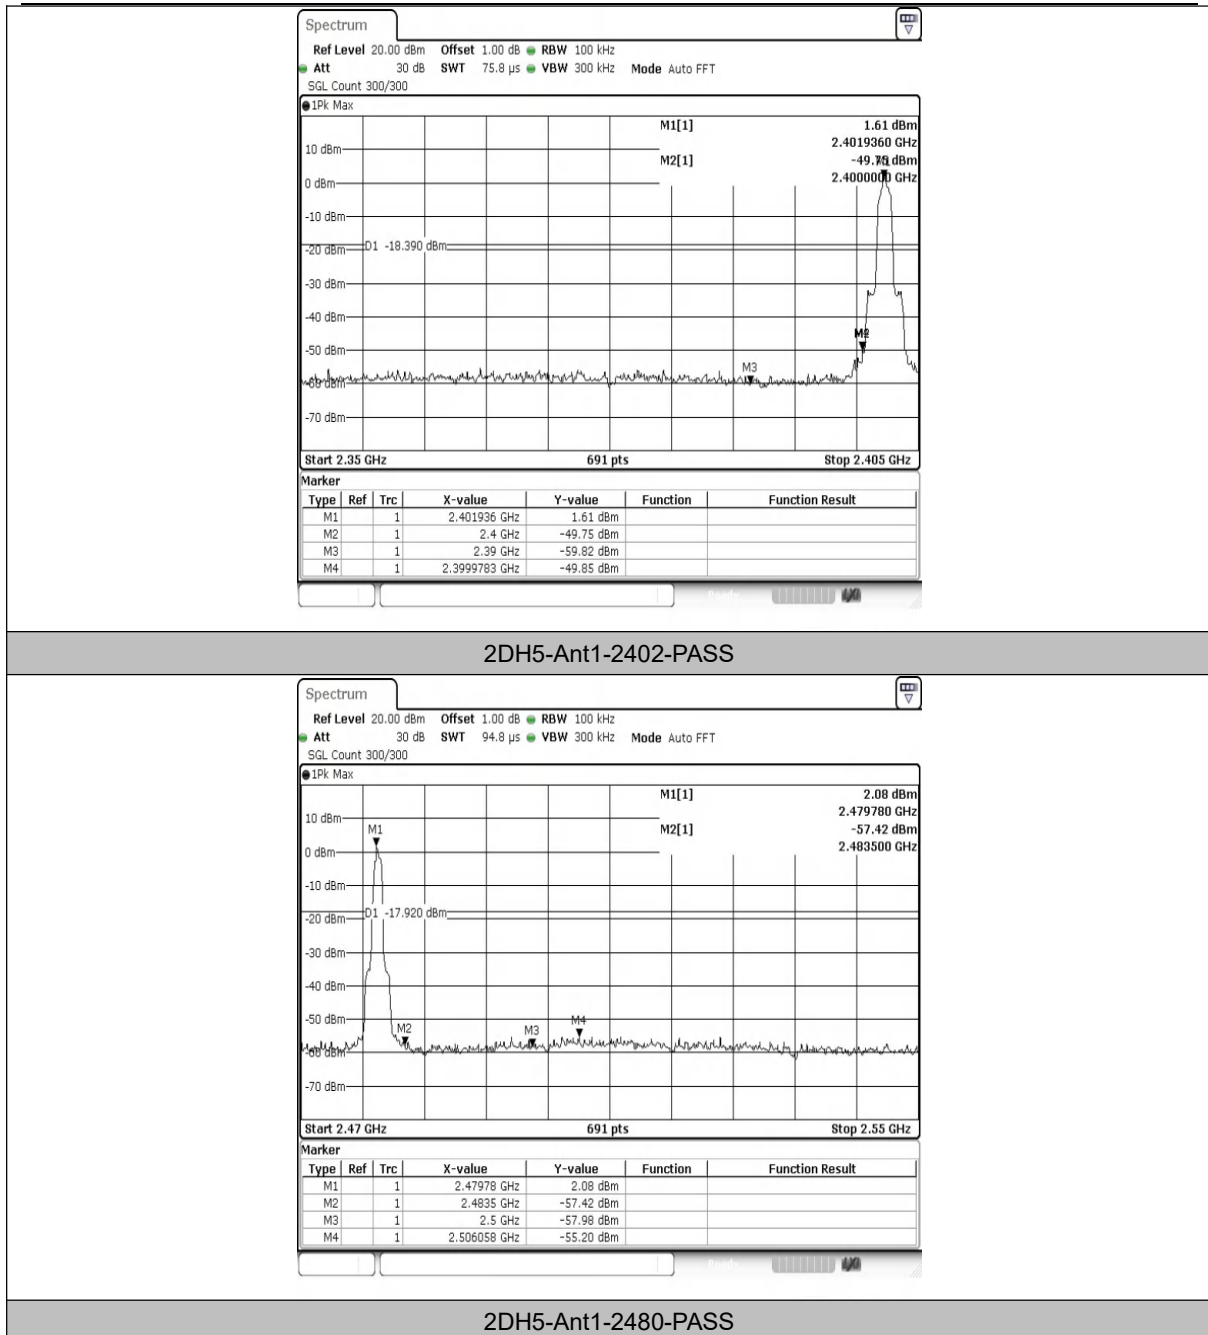

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

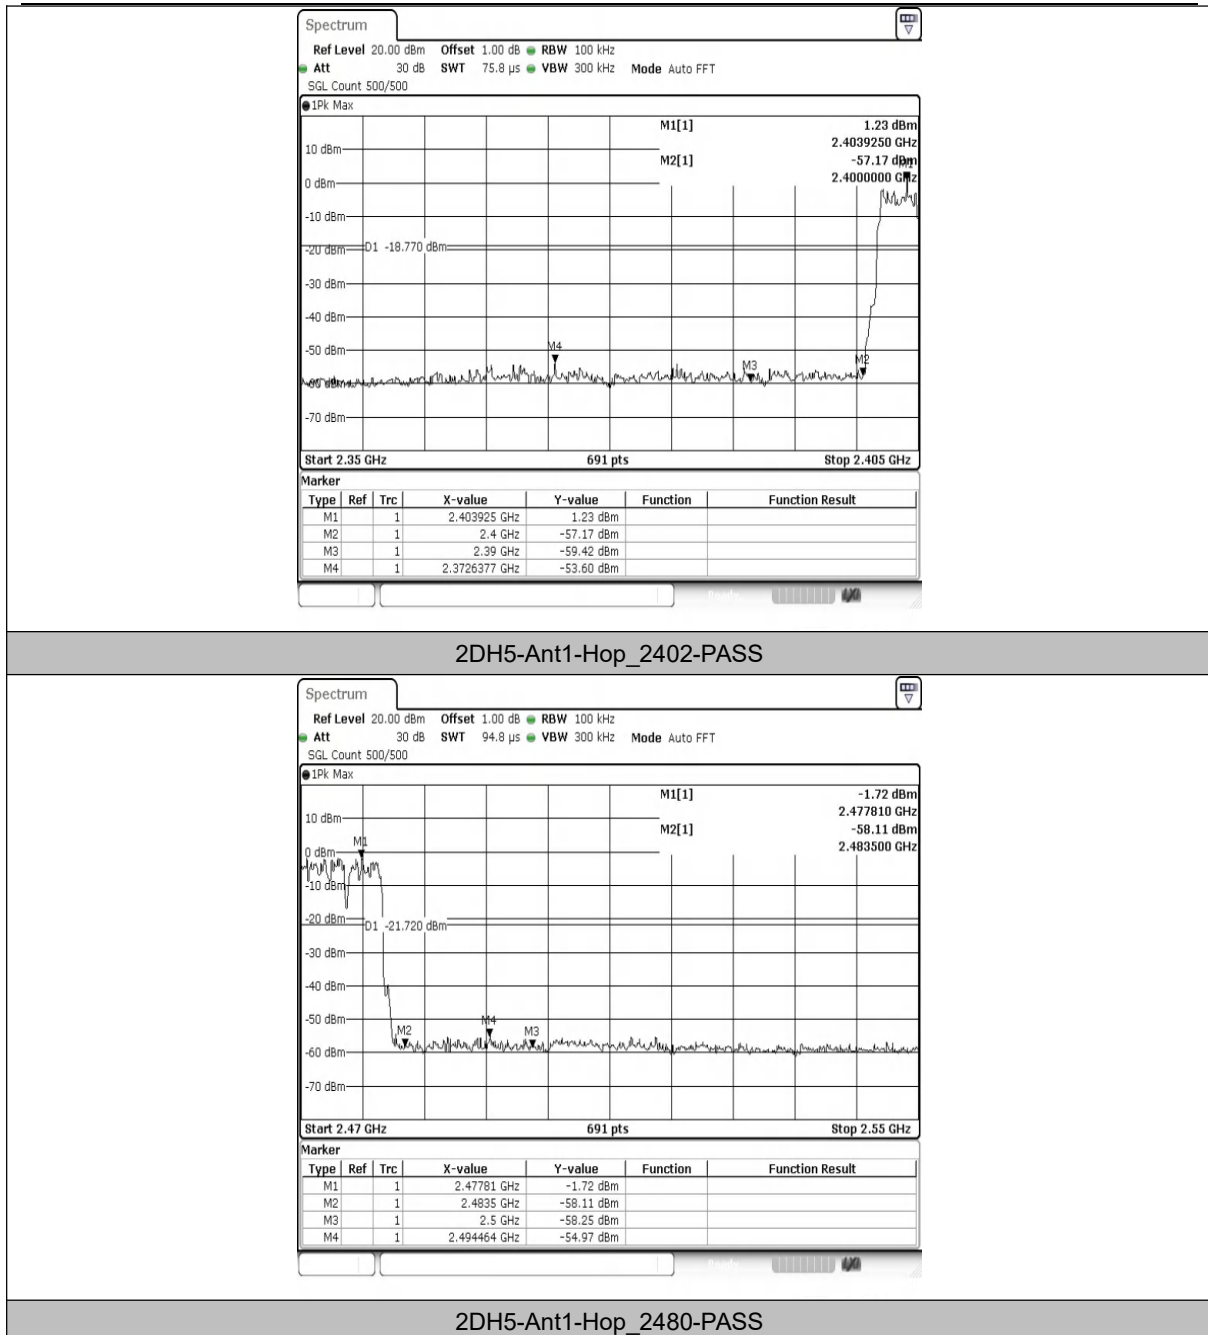


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

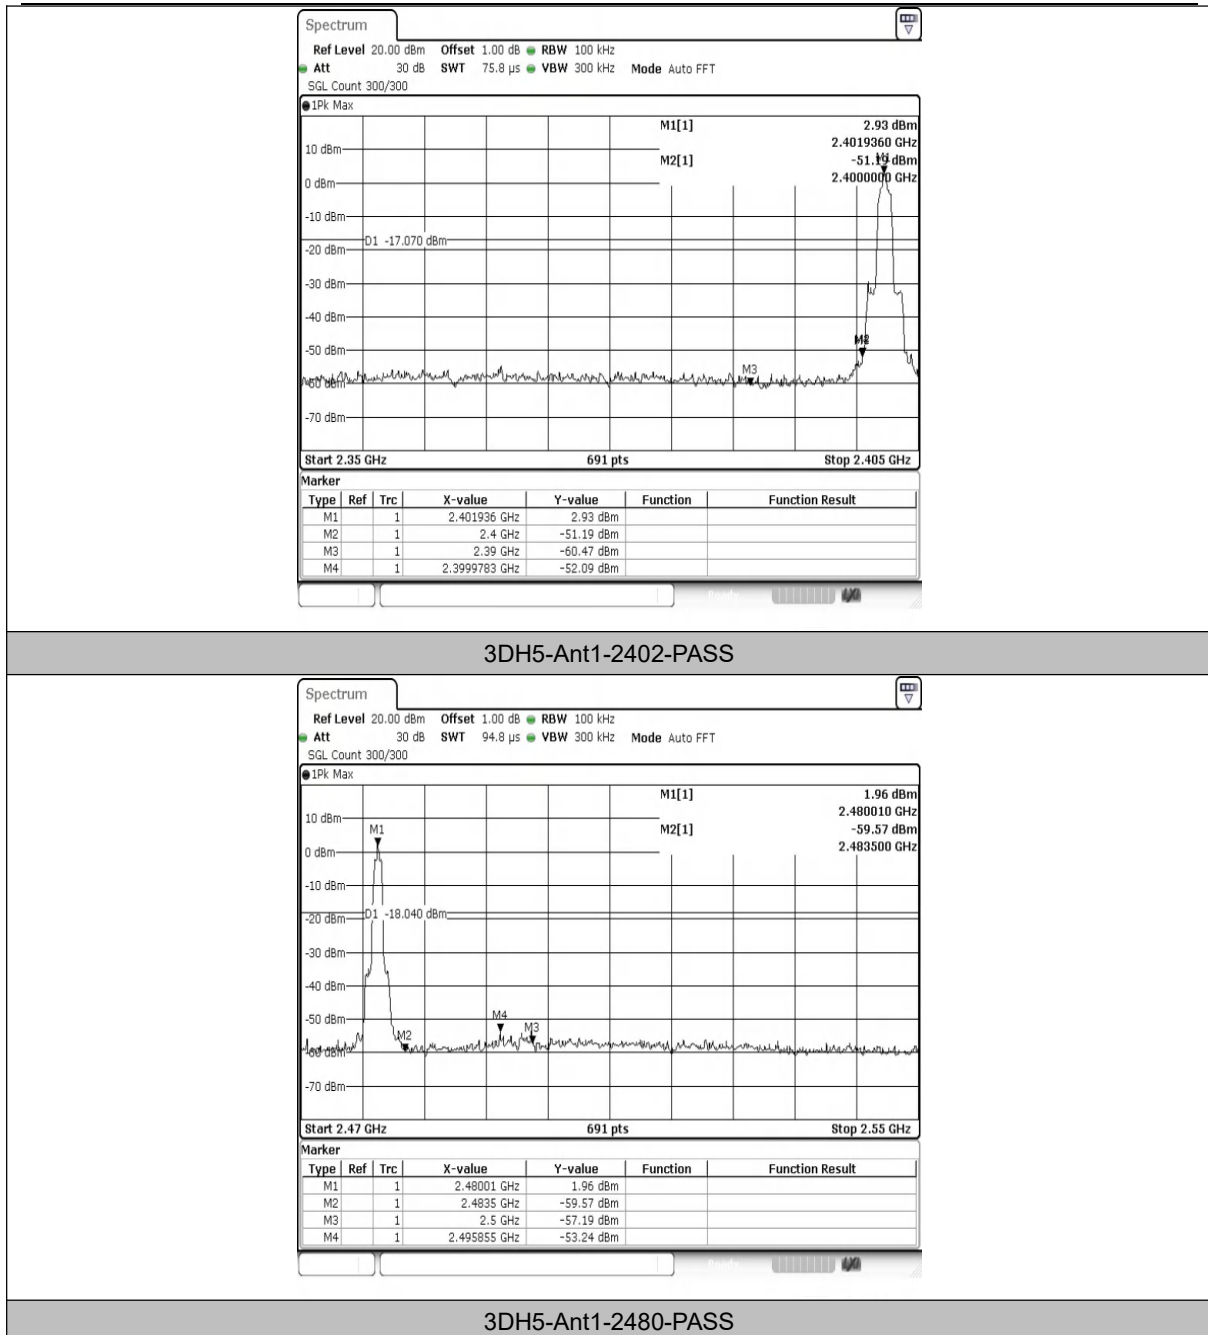

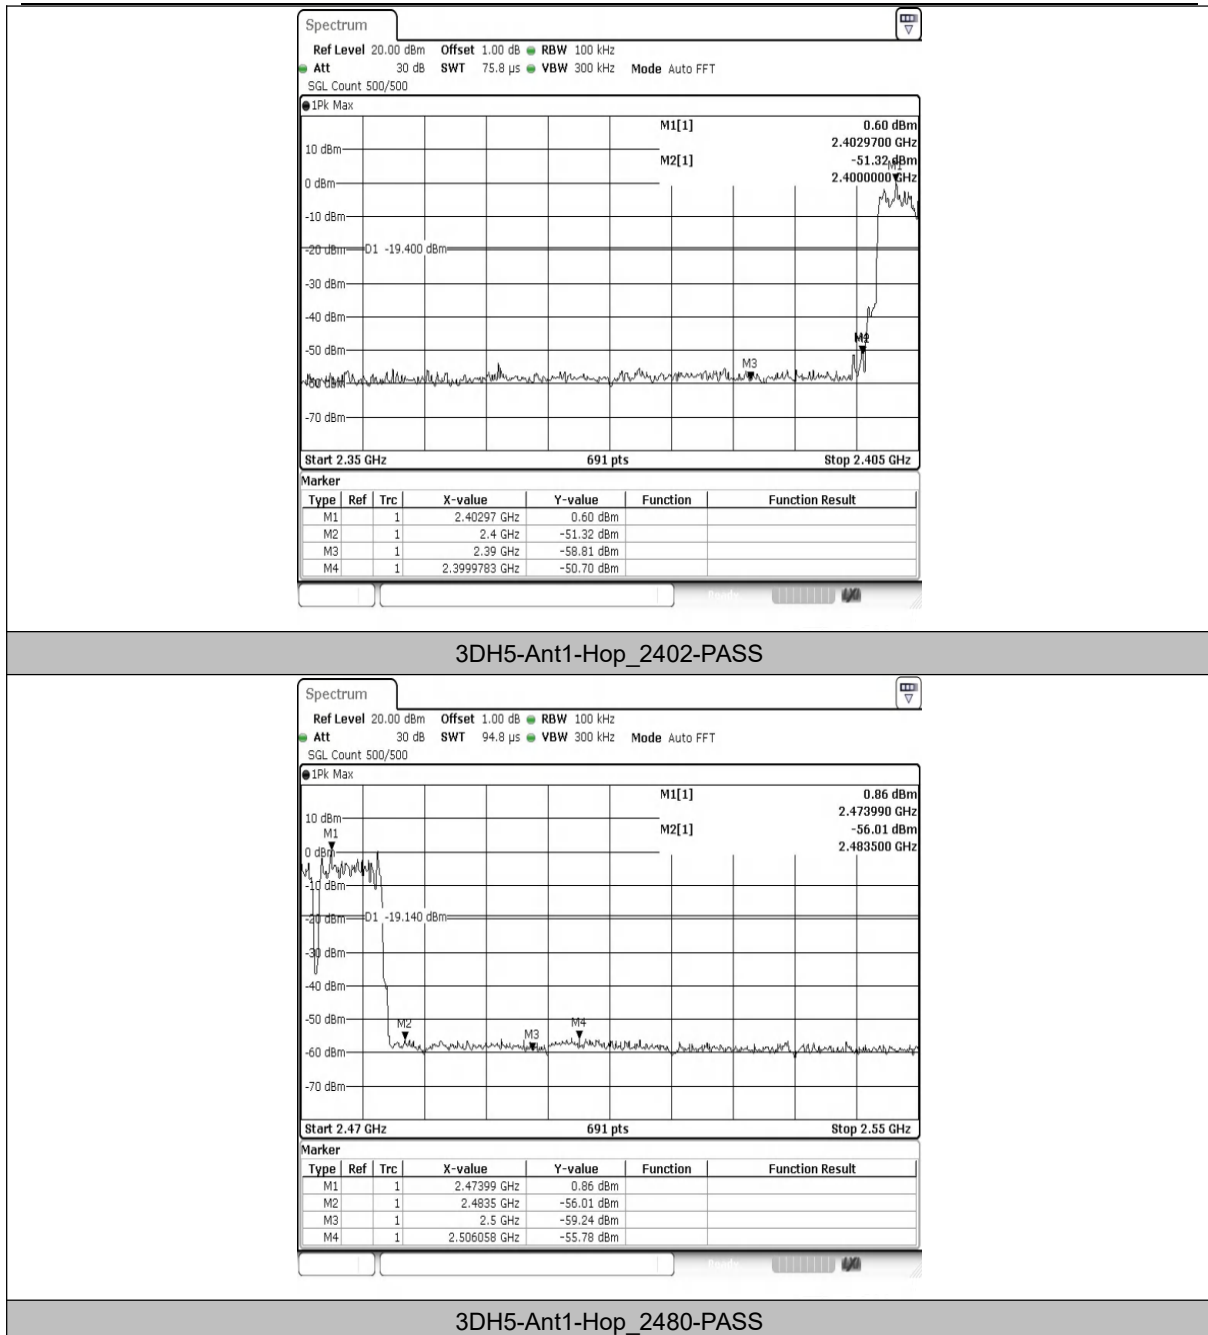

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	2.63	2.63	---	PASS
DH5	Ant1	2402	30~1000	2.63	-58.31	≤-17.37	PASS
DH5	Ant1	2402	1000~26500	2.63	-43.81	≤-17.37	PASS
DH5	Ant1	2441	0~Reference	2.04	2.04	---	PASS
DH5	Ant1	2441	30~1000	2.04	-57.82	≤-17.96	PASS
DH5	Ant1	2441	1000~26500	2.04	-44.35	≤-17.96	PASS
DH5	Ant1	2480	0~Reference	1.81	1.81	---	PASS
DH5	Ant1	2480	30~1000	1.81	-58.18	≤-18.19	PASS
DH5	Ant1	2480	1000~26500	1.81	-44.06	≤-18.19	PASS
2DH5	Ant1	2402	0~Reference	2.63	2.63	---	PASS
2DH5	Ant1	2402	30~1000	2.63	-58.42	≤-17.37	PASS
2DH5	Ant1	2402	1000~26500	2.63	-44.44	≤-17.37	PASS
2DH5	Ant1	2441	0~Reference	0.99	0.99	---	PASS
2DH5	Ant1	2441	30~1000	0.99	-58.01	≤-19.01	PASS
2DH5	Ant1	2441	1000~26500	0.99	-38.2	≤-19.01	PASS
2DH5	Ant1	2480	0~Reference	1.80	1.80	---	PASS
2DH5	Ant1	2480	30~1000	1.80	-58.41	≤-18.2	PASS
2DH5	Ant1	2480	1000~26500	1.80	-44.31	≤-18.2	PASS
3DH5	Ant1	2402	0~Reference	2.63	2.63	---	PASS
3DH5	Ant1	2402	30~1000	2.63	-58.12	≤-17.37	PASS
3DH5	Ant1	2402	1000~26500	2.63	-44.44	≤-17.37	PASS
3DH5	Ant1	2441	0~Reference	1.30	1.30	---	PASS
3DH5	Ant1	2441	30~1000	1.30	-57.85	≤-18.7	PASS
3DH5	Ant1	2441	1000~26500	1.30	-44.53	≤-18.7	PASS
3DH5	Ant1	2480	0~Reference	1.88	1.88	---	PASS
3DH5	Ant1	2480	30~1000	1.88	-57.16	≤-18.12	PASS
3DH5	Ant1	2480	1000~26500	1.88	-43.91	≤-18.12	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'TDF' of the Spectrum Analyzer during the test.


Test Graphs

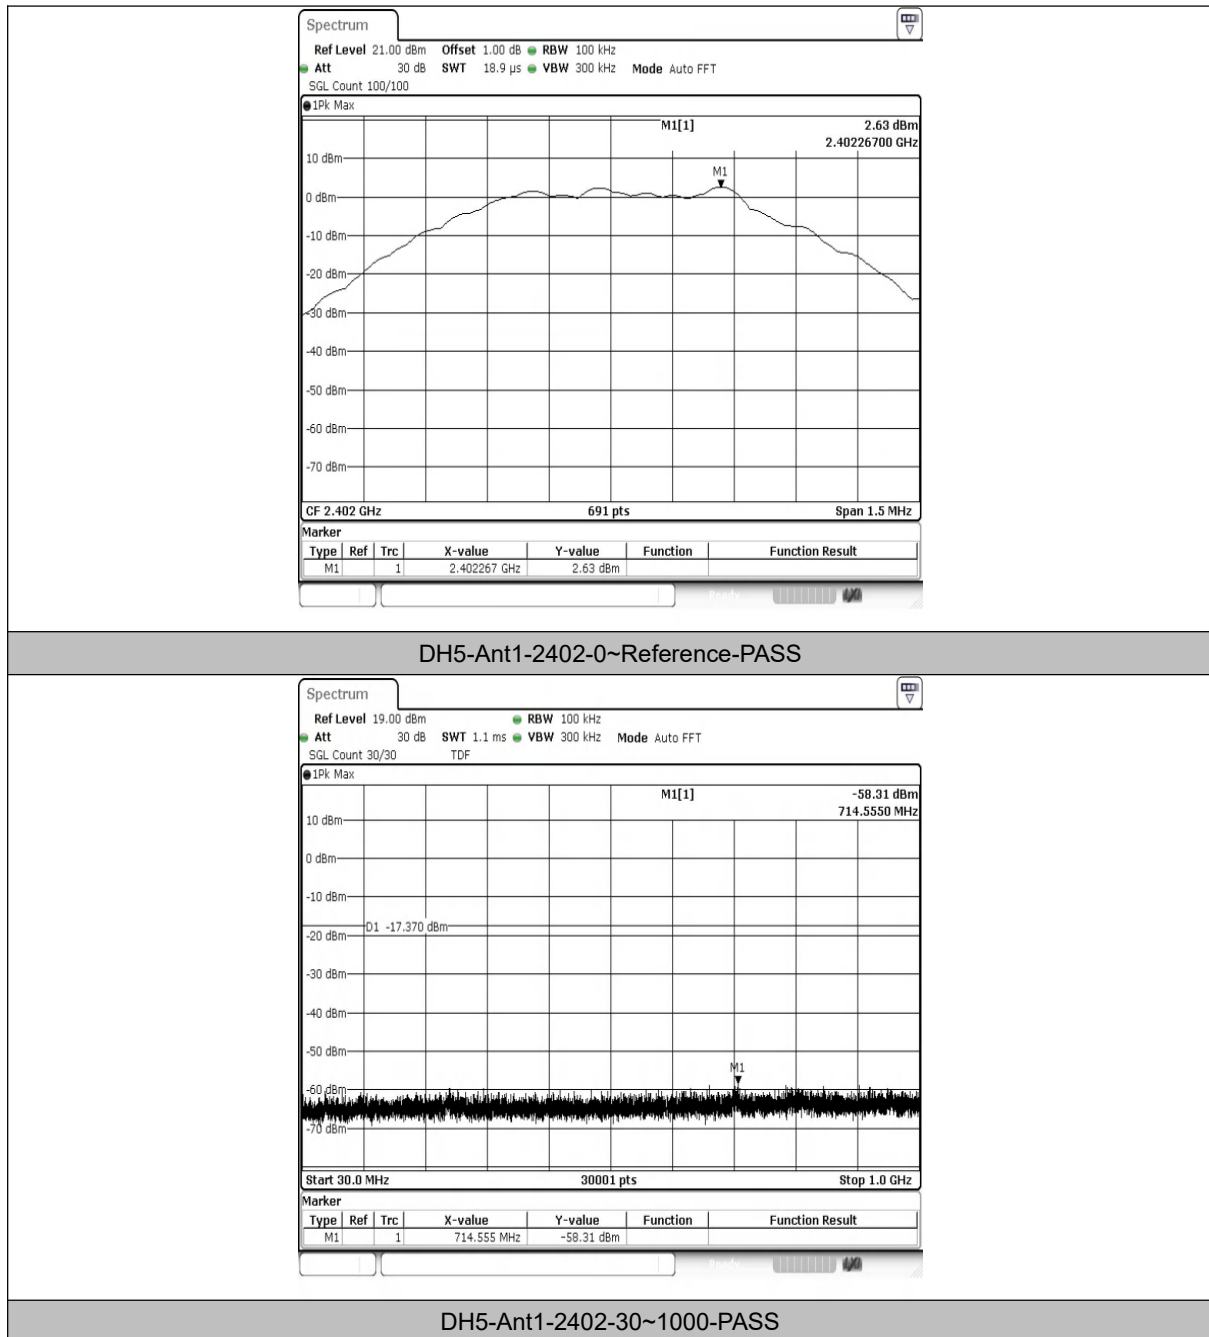


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

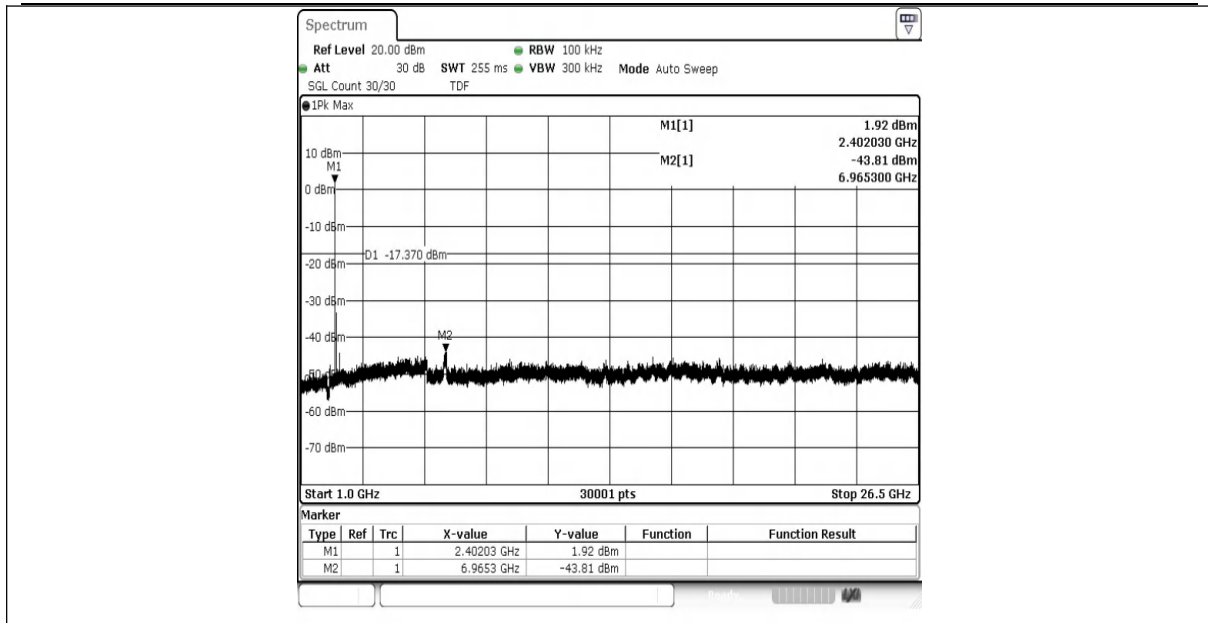

DH5-Ant1-2402-1000~26500-PASS

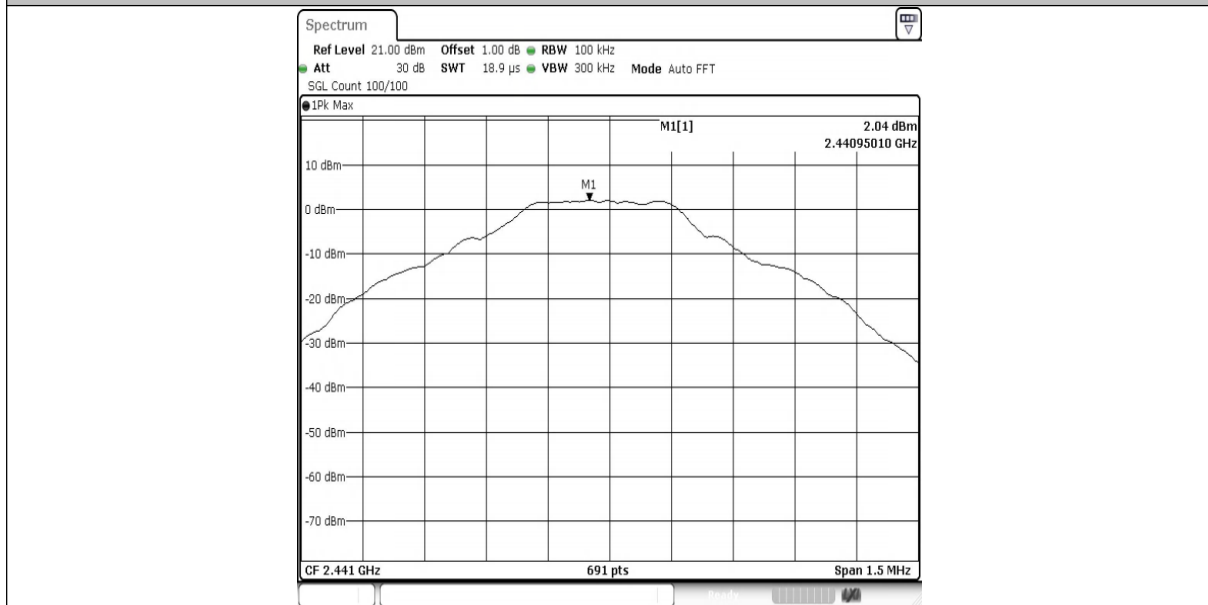


DH5-Ant1-2441-0~Reference-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

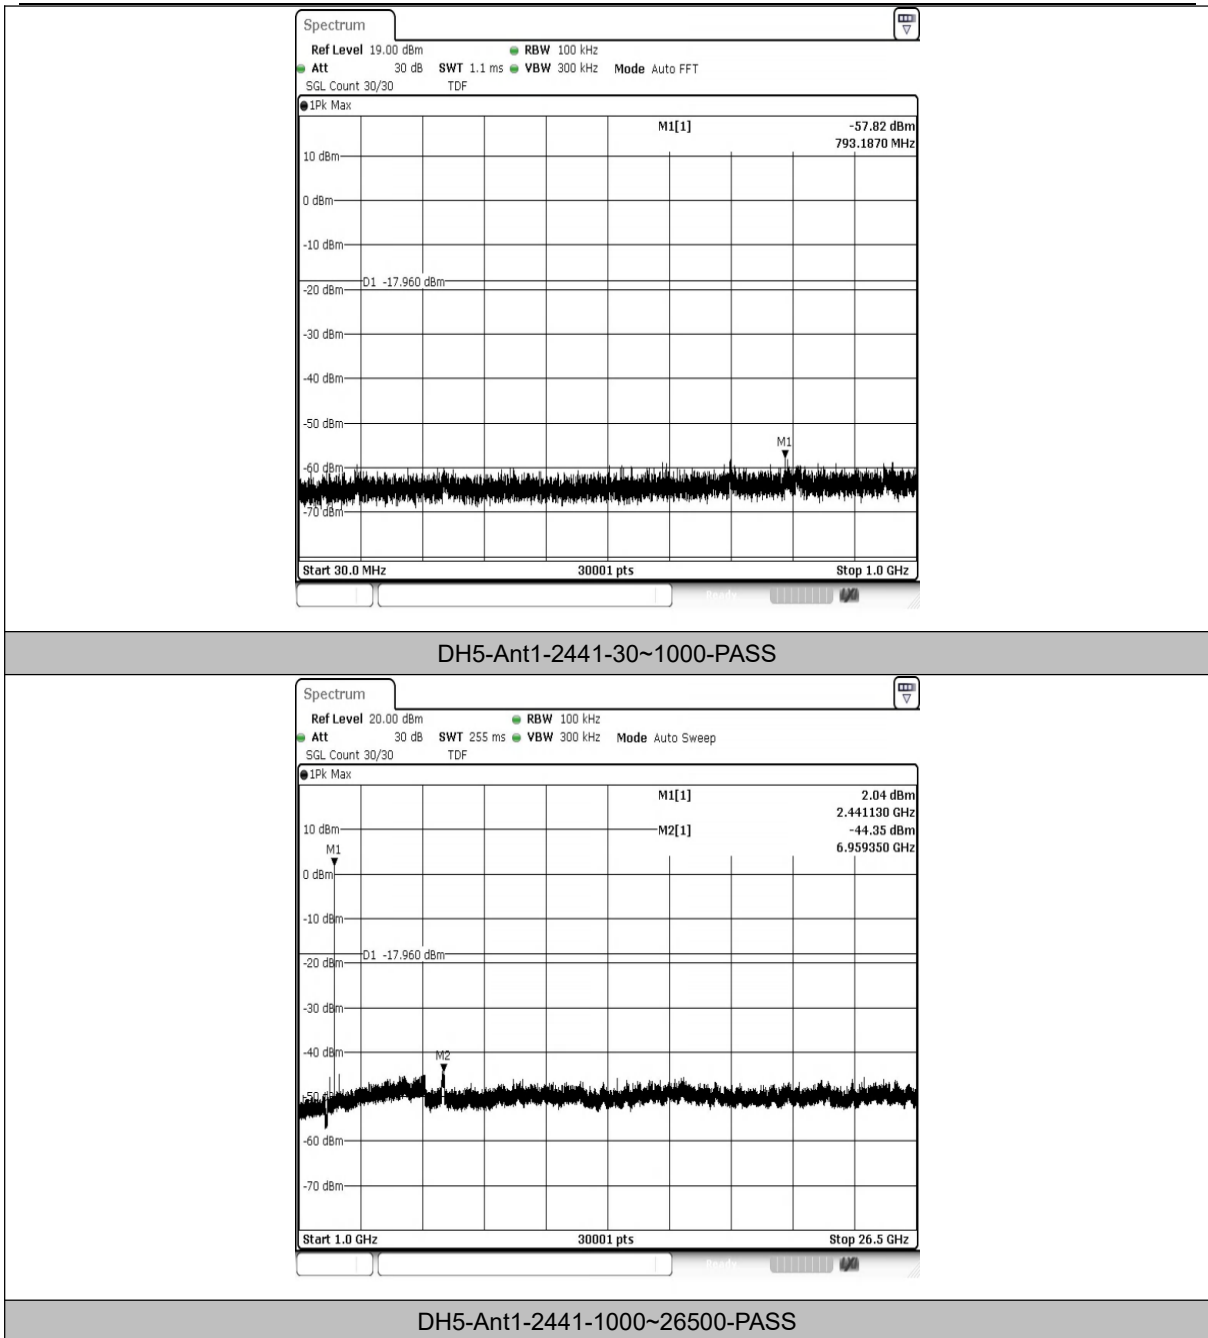

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

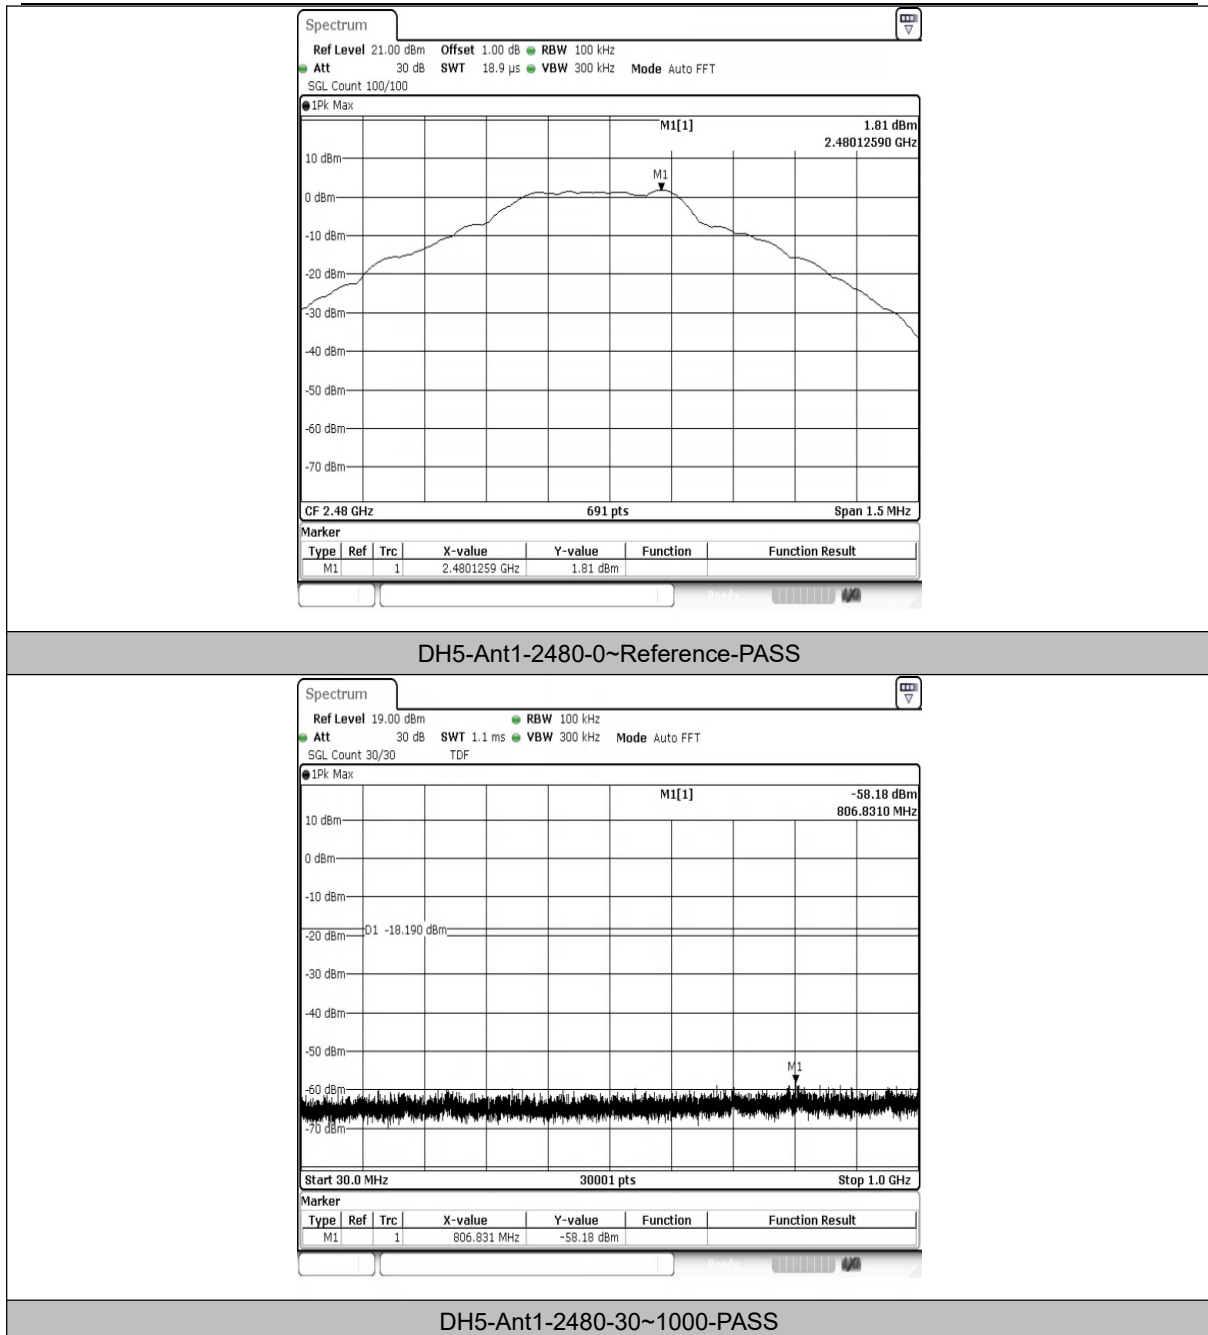


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

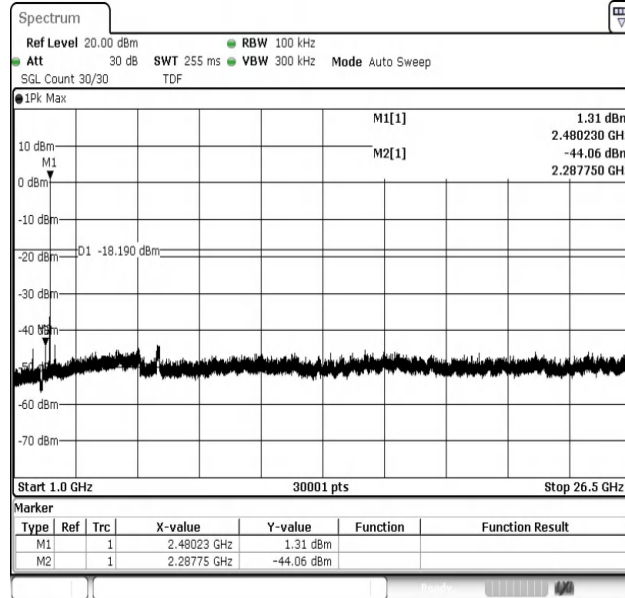

DH5-Ant1-2480-1000~26500-PASS

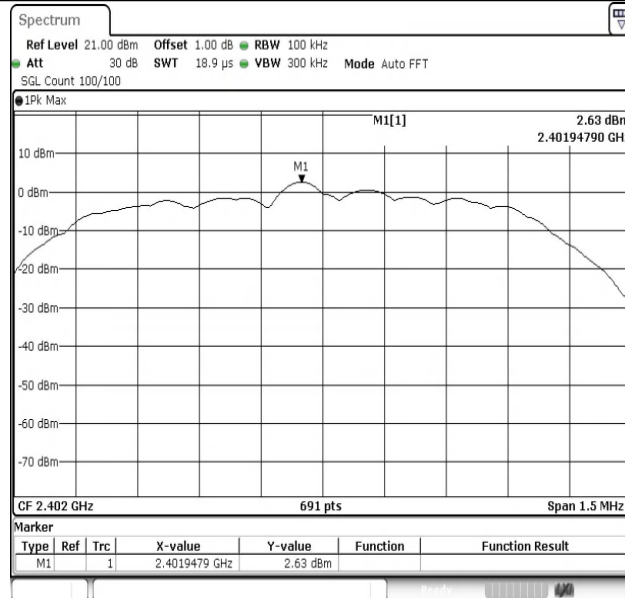


2DH5-Ant1-2402-0~Reference-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

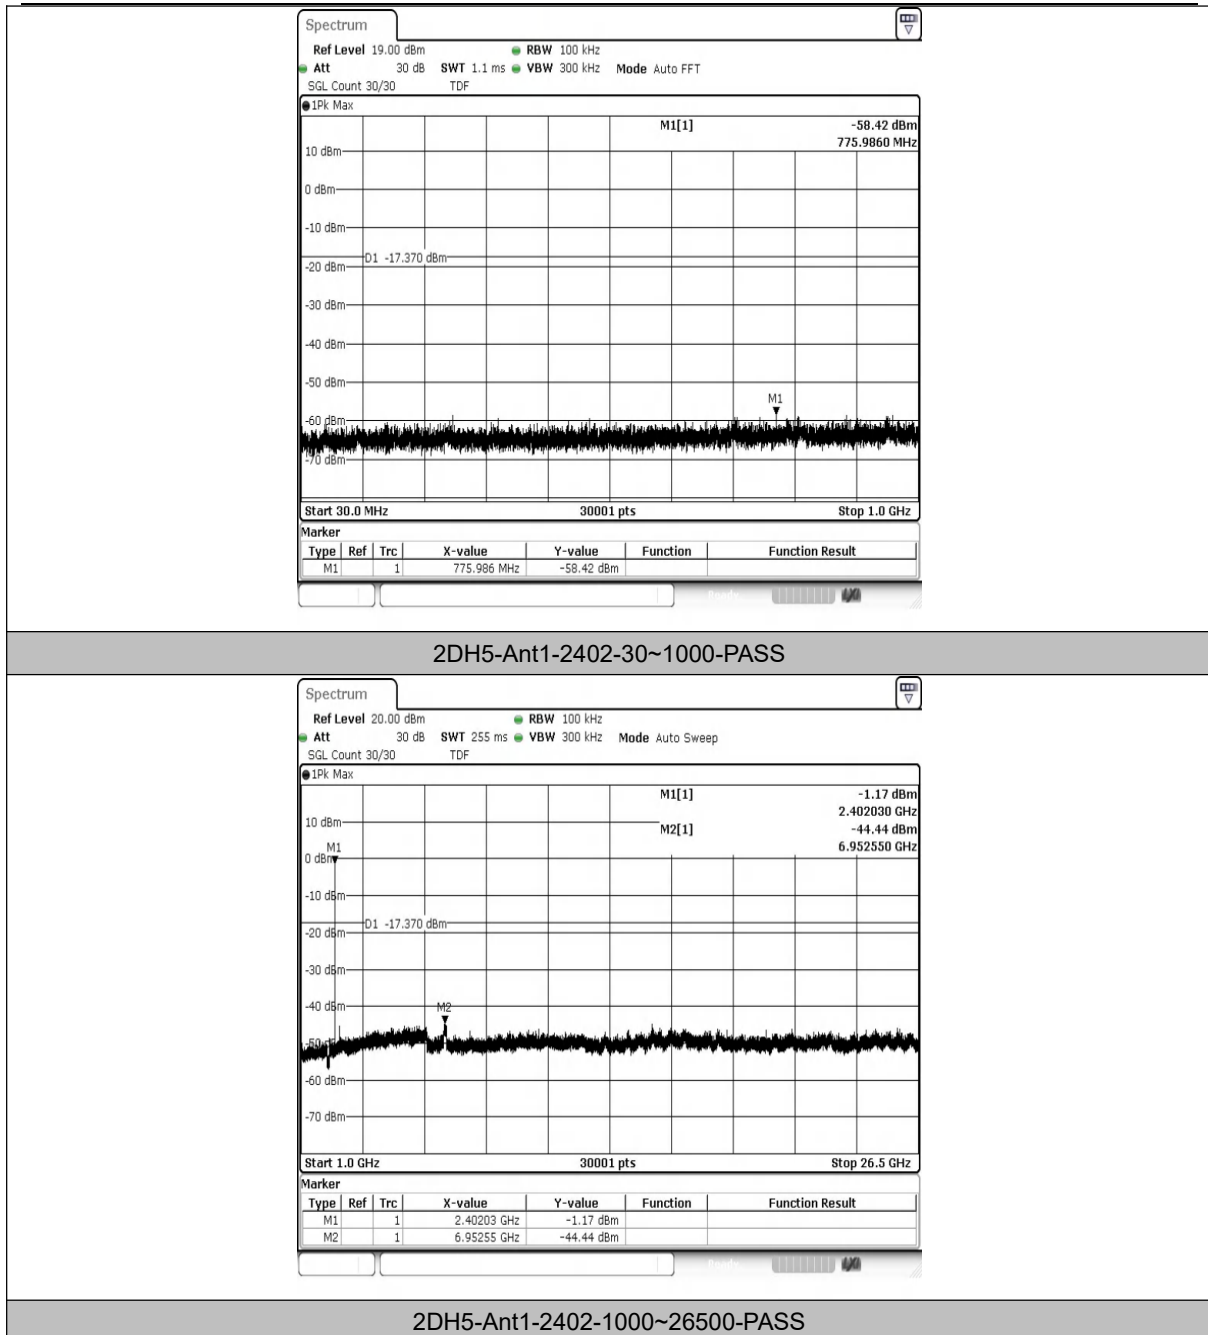


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

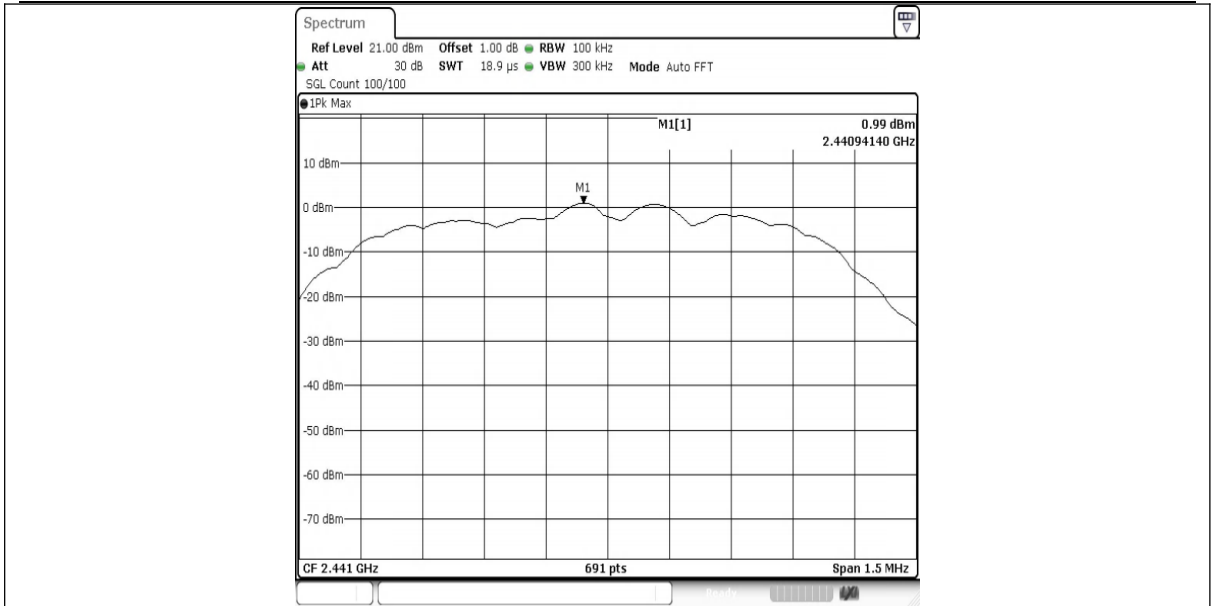

2DH5-Ant1-2441-0~Reference-PASS

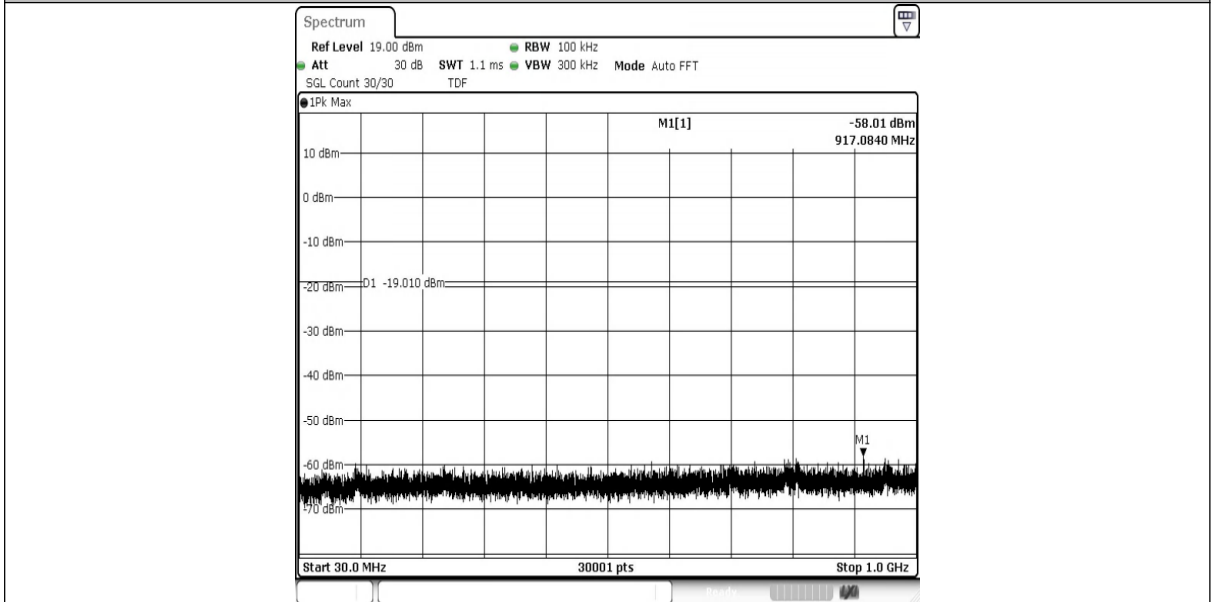


2DH5-Ant1-2441-30~1000-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

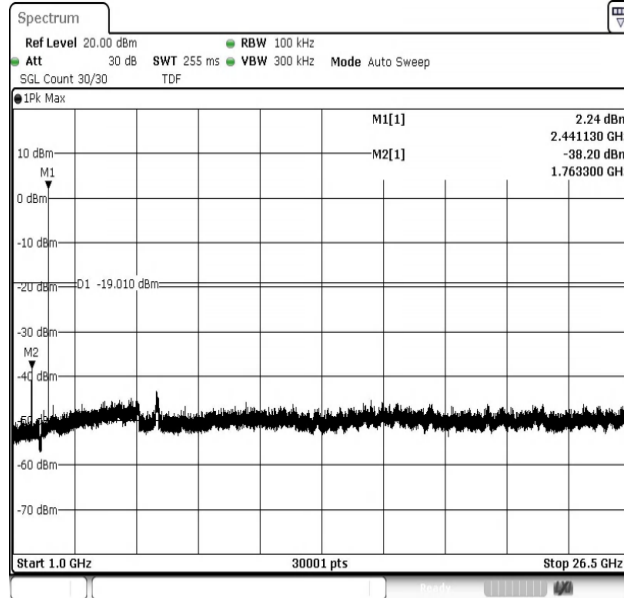

2DH5-Ant1-2441-1000~26500-PASS

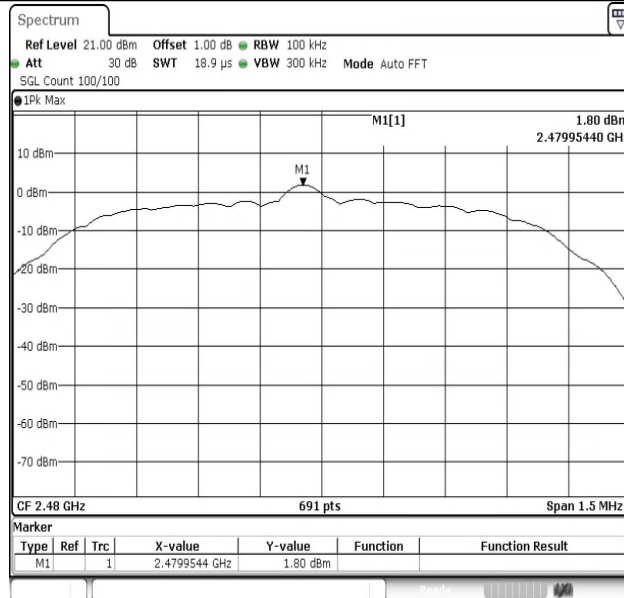


2DH5-Ant1-2480-0~Reference-PASS

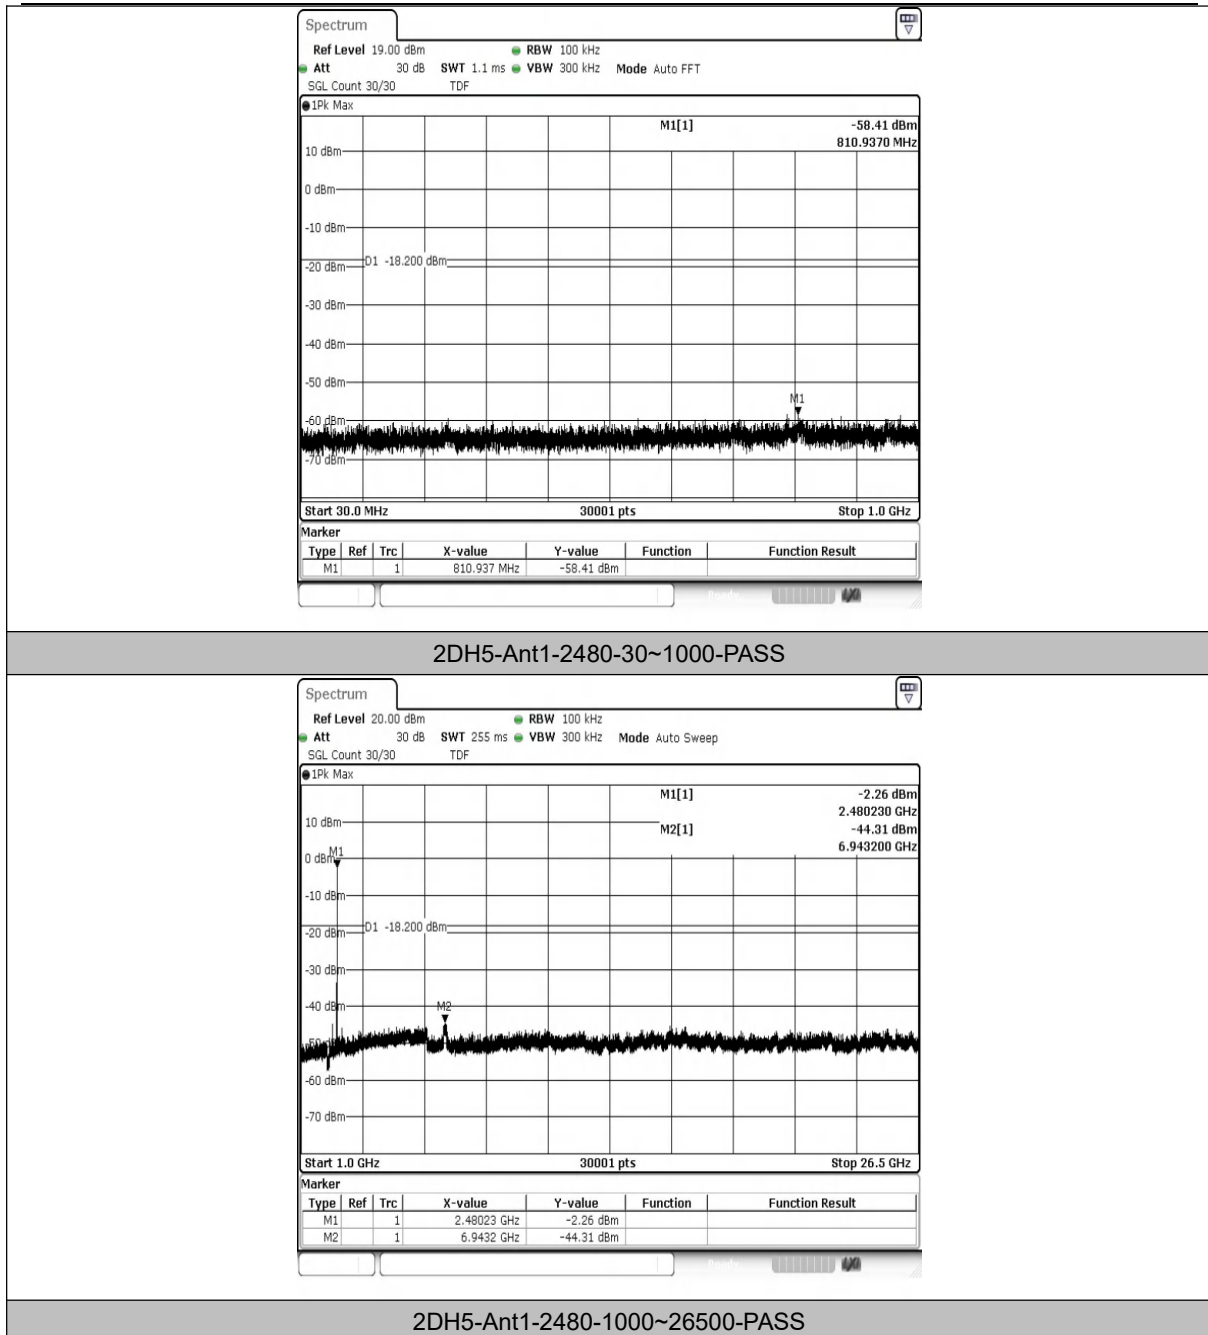

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

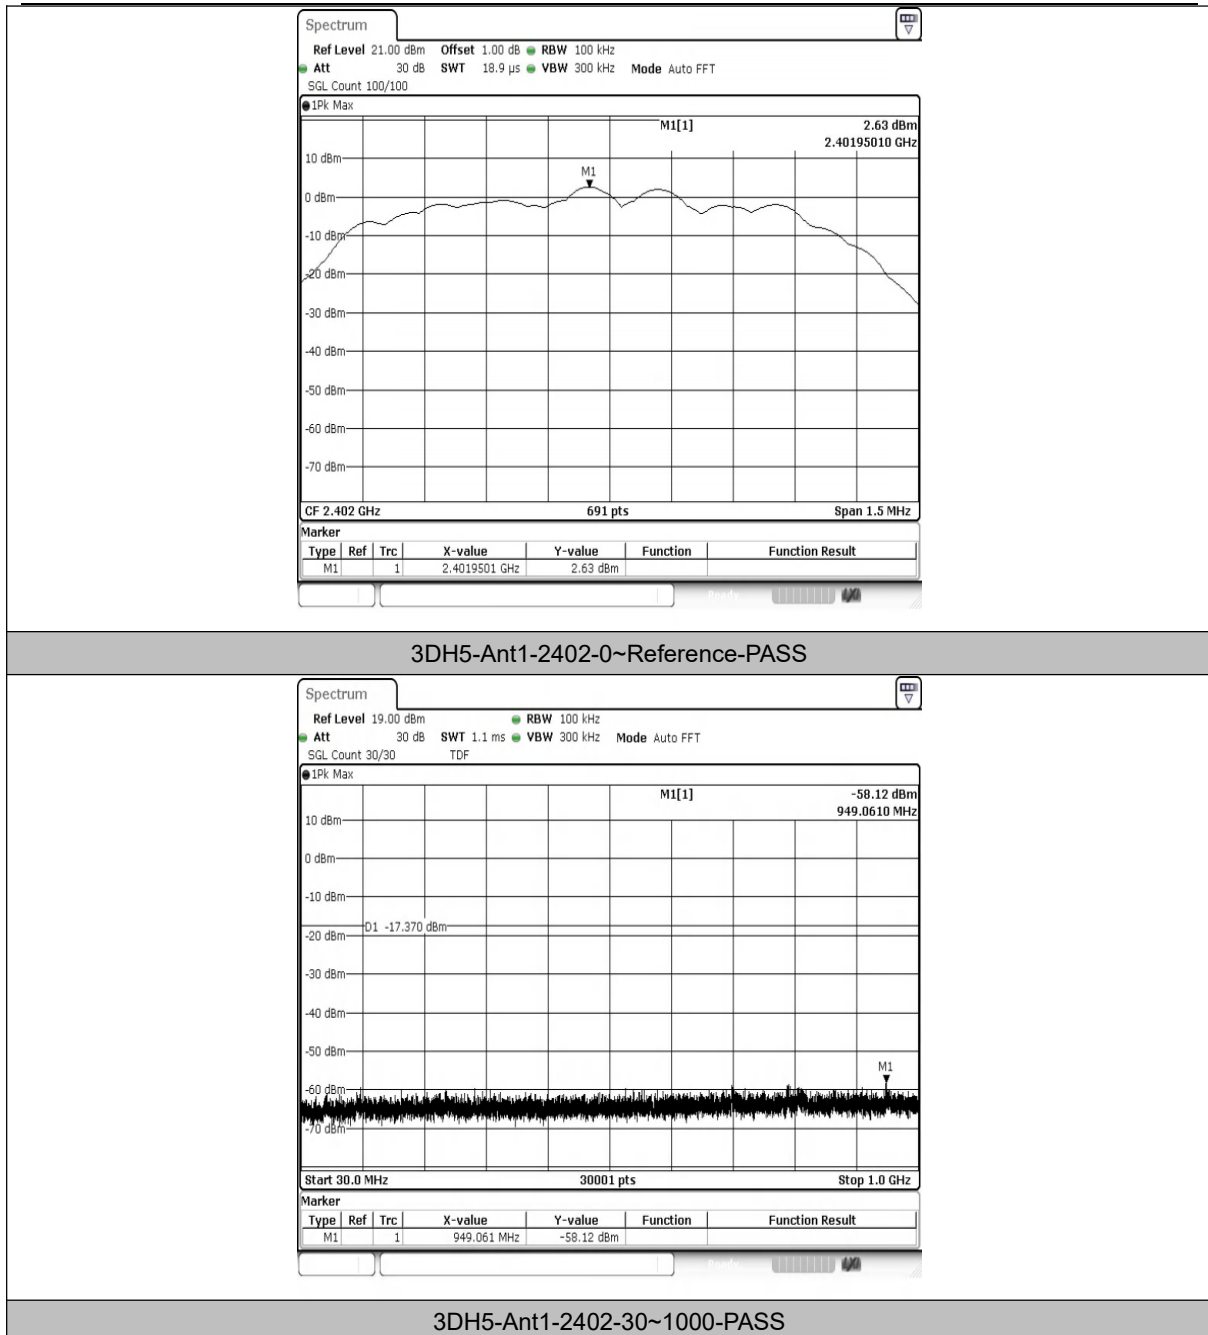


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

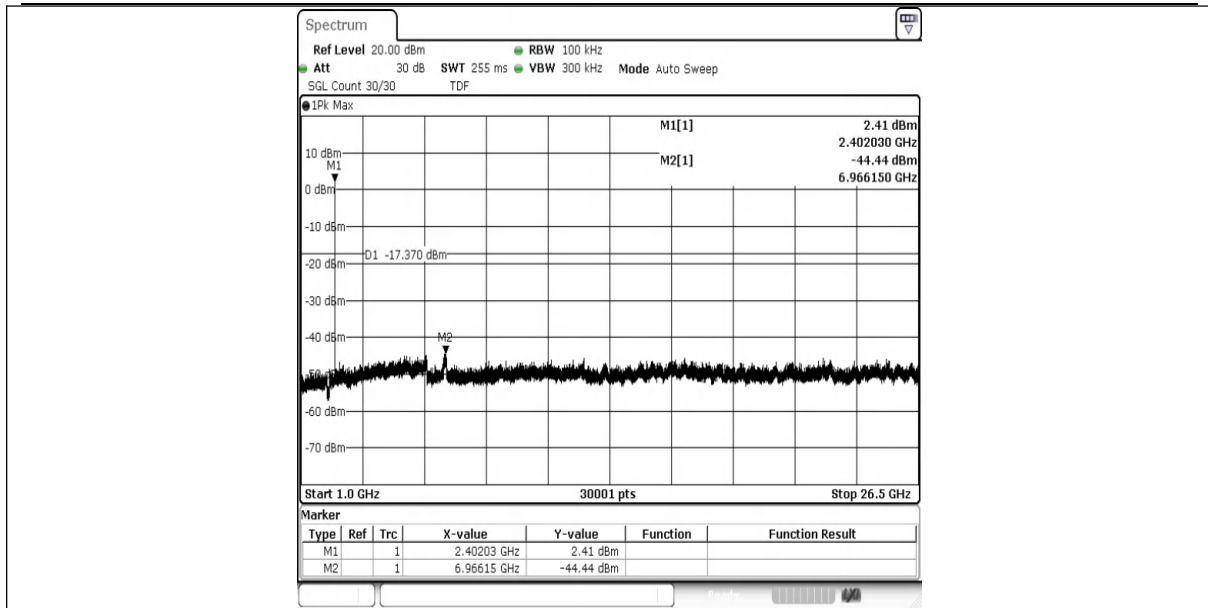

3DH5-Ant1-2402-1000~26500-PASS

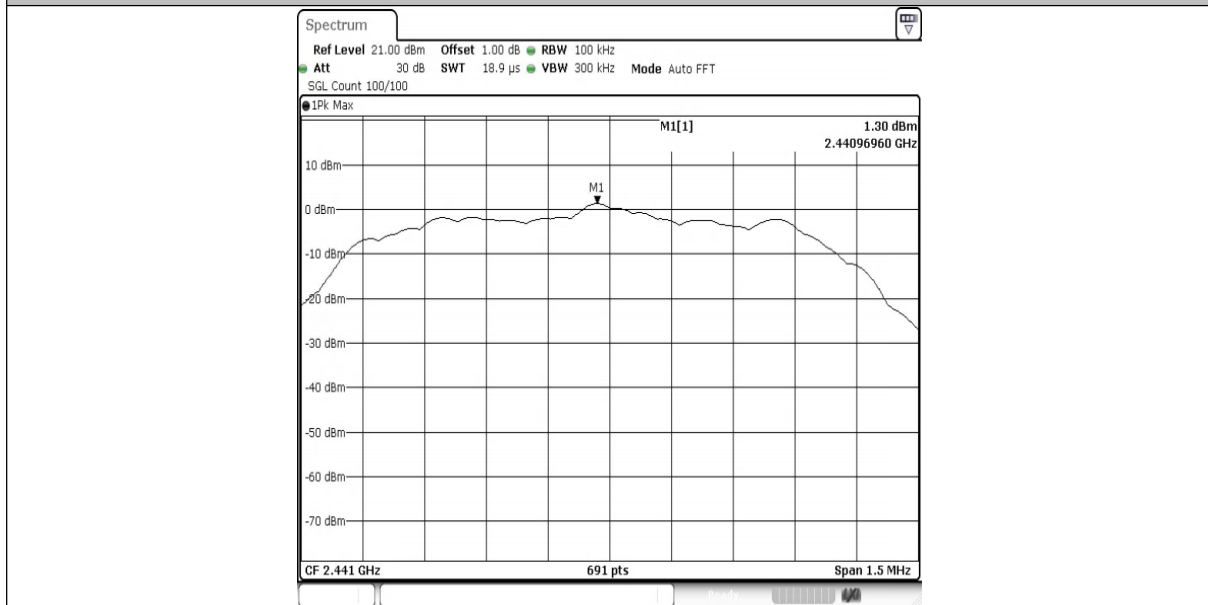


3DH5-Ant1-2441-0~Reference-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

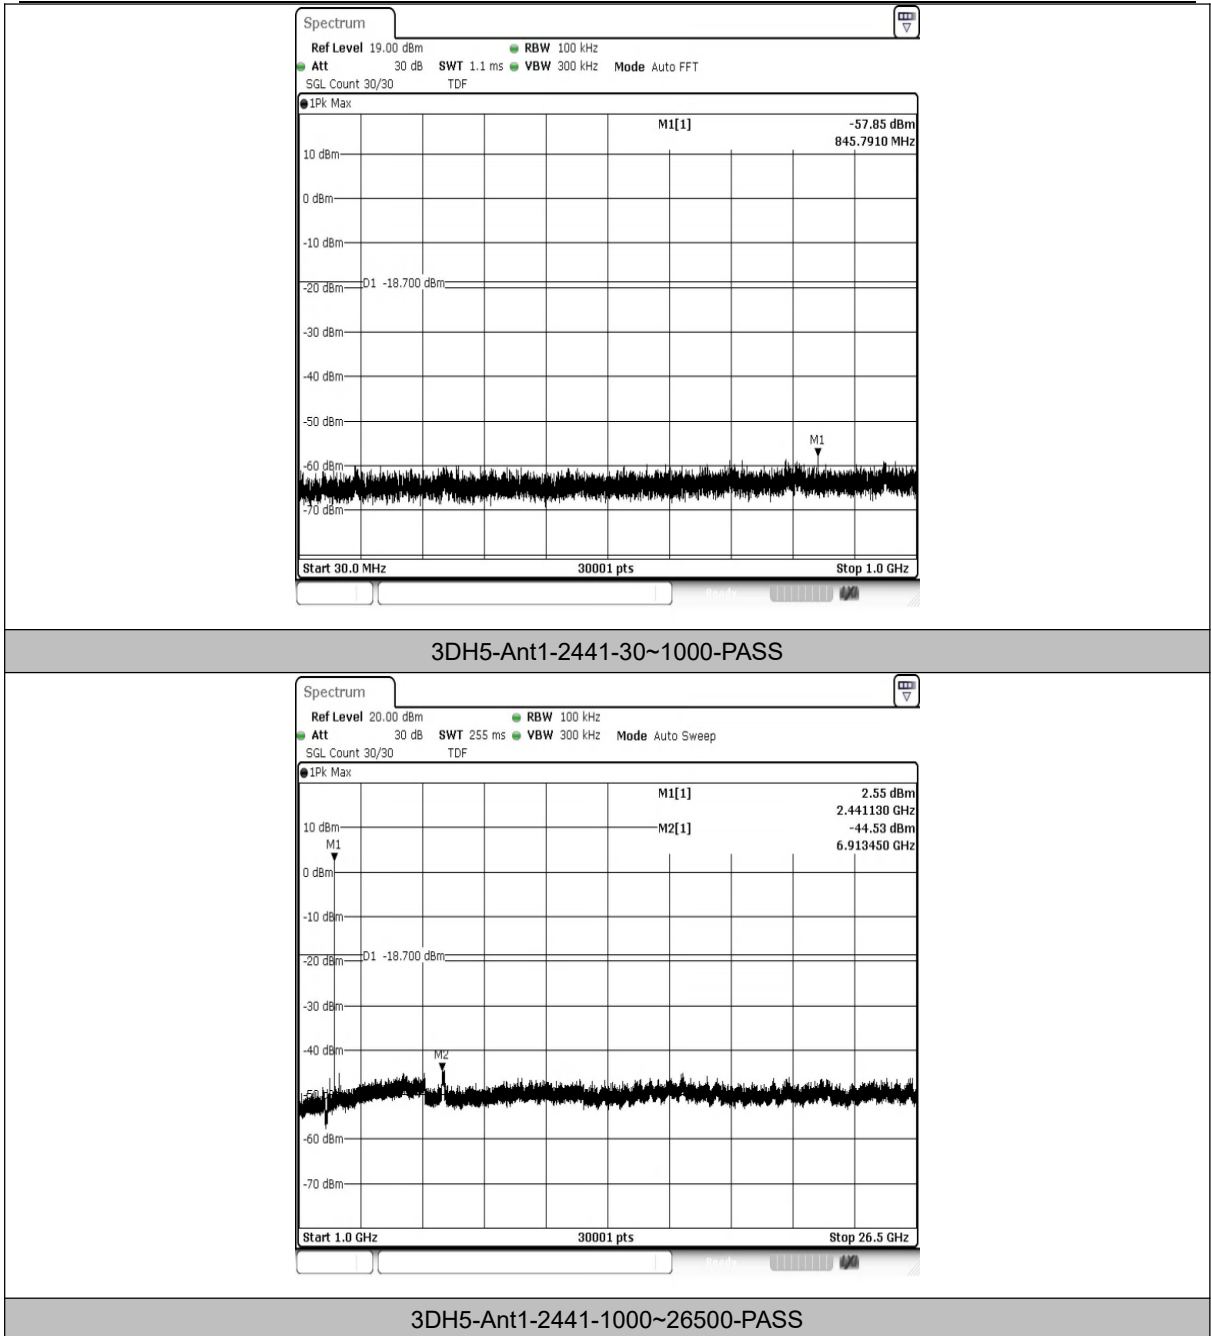


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

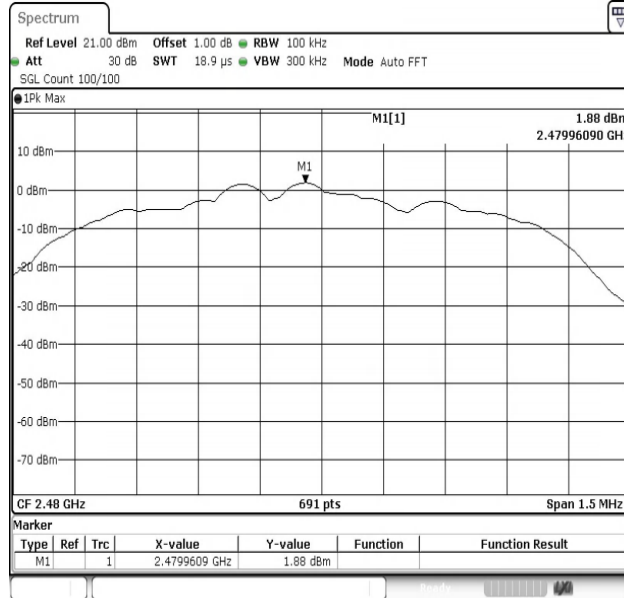

3DH5-Ant1-2480-0~Reference-PASS

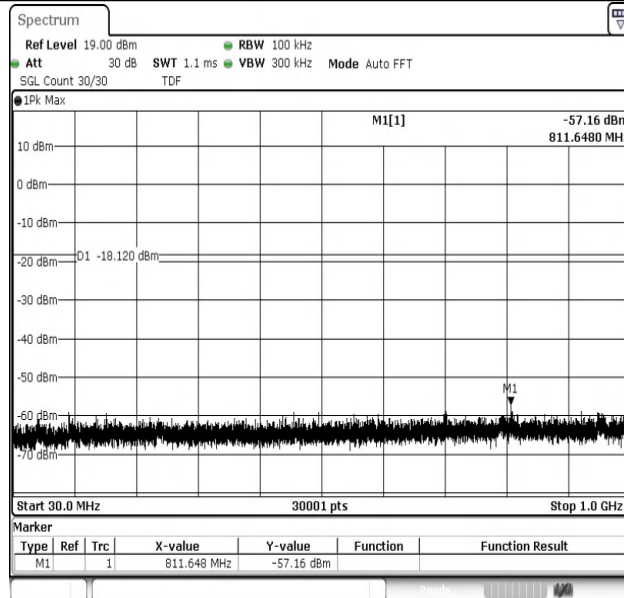


3DH5-Ant1-2480-30~1000-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

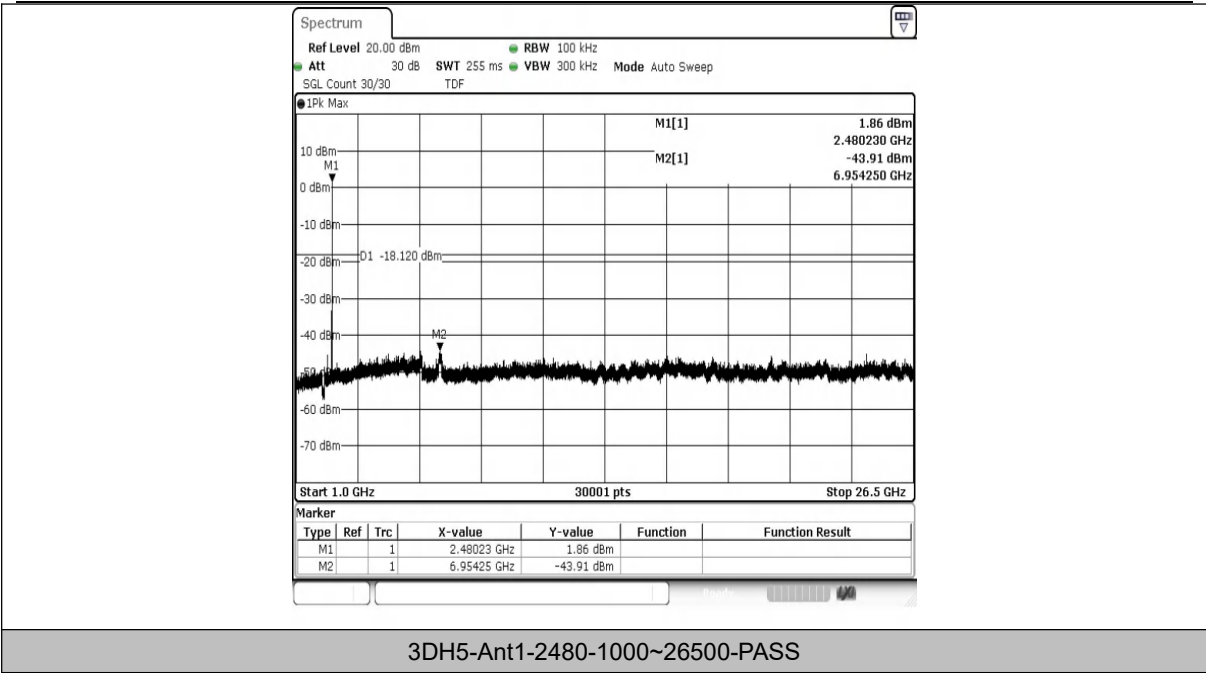

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix I: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.89	3.76	76.86	1.14
DH5	Ant1	2441	2.89	3.76	76.86	1.14
DH5	Ant1	2480	2.88	3.75	76.80	1.15
2DH5	Ant1	2402	2.90	3.75	77.33	1.12
2DH5	Ant1	2441	2.90	3.75	77.33	1.12
2DH5	Ant1	2480	2.90	3.75	77.33	1.12
3DH5	Ant1	2402	2.90	3.75	77.33	1.12
3DH5	Ant1	2441	2.89	3.75	77.07	1.13
3DH5	Ant1	2480	2.90	3.77	76.92	1.14


Test Graphs

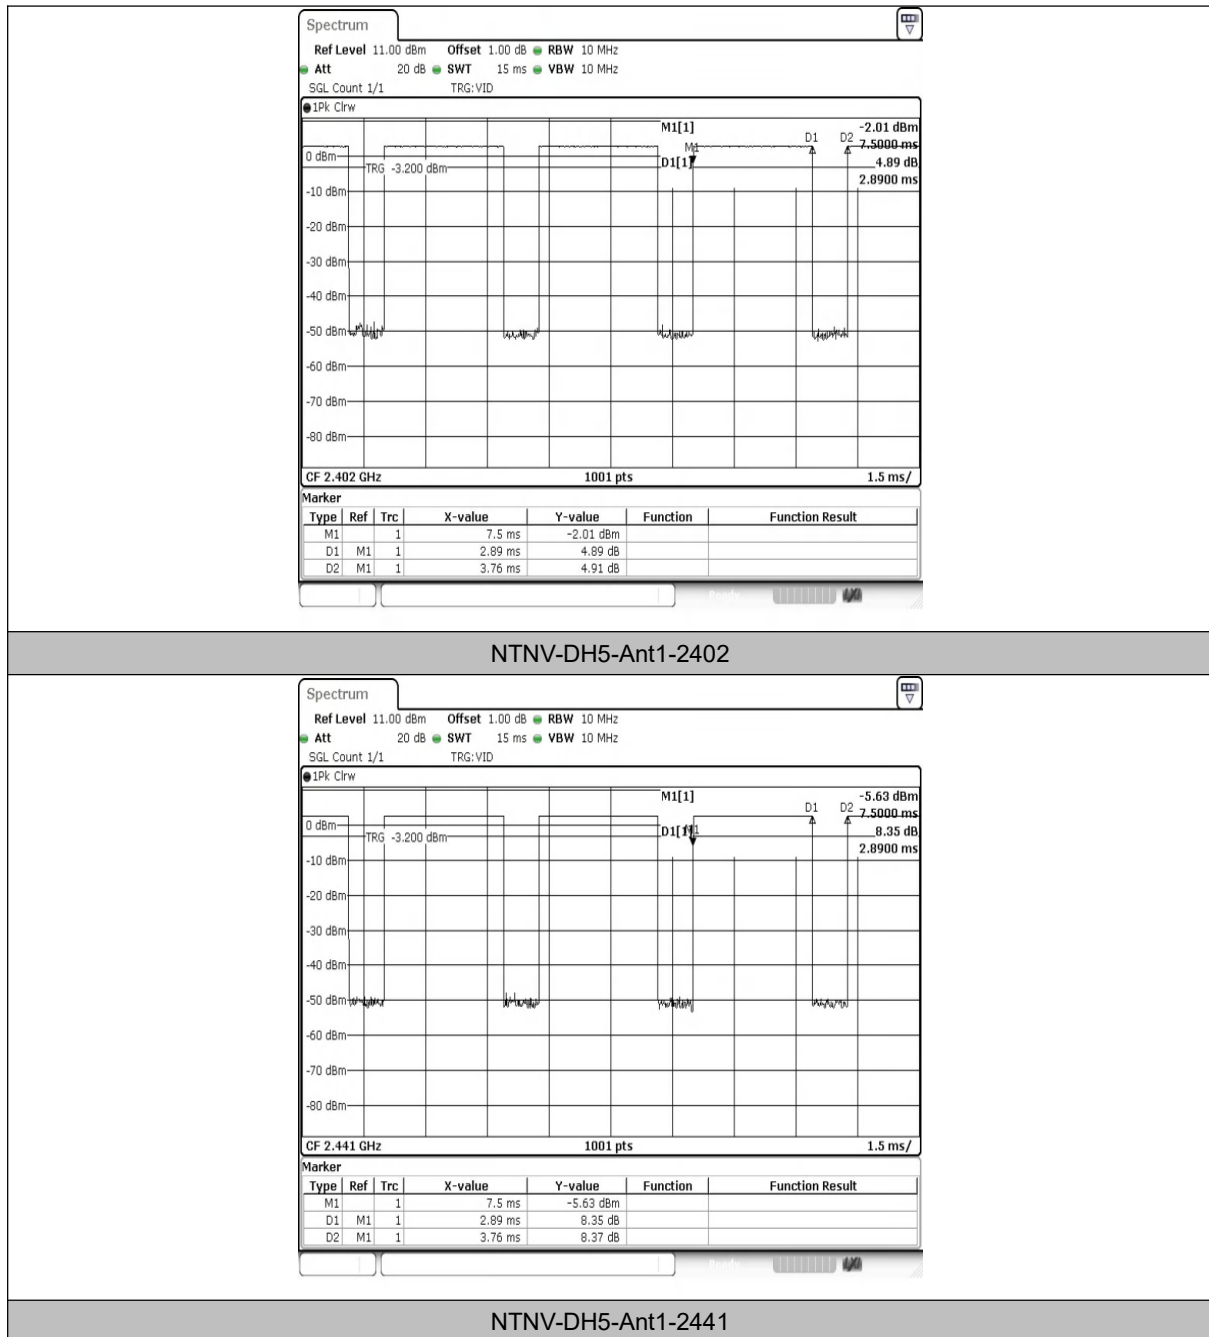

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

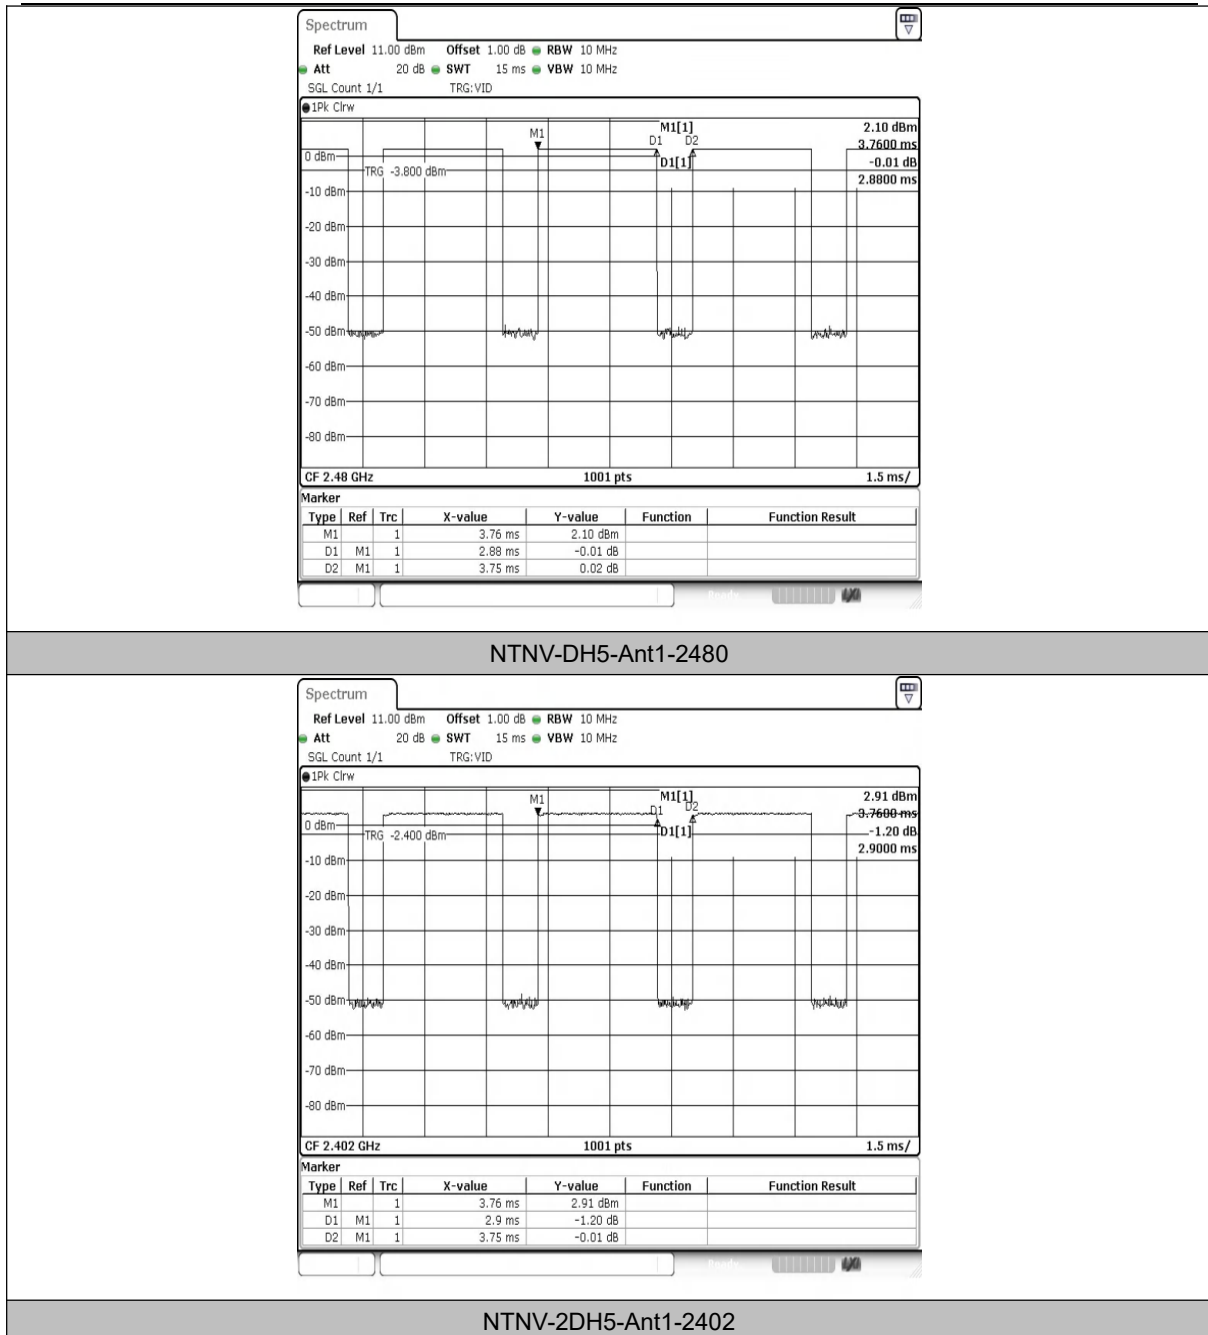

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

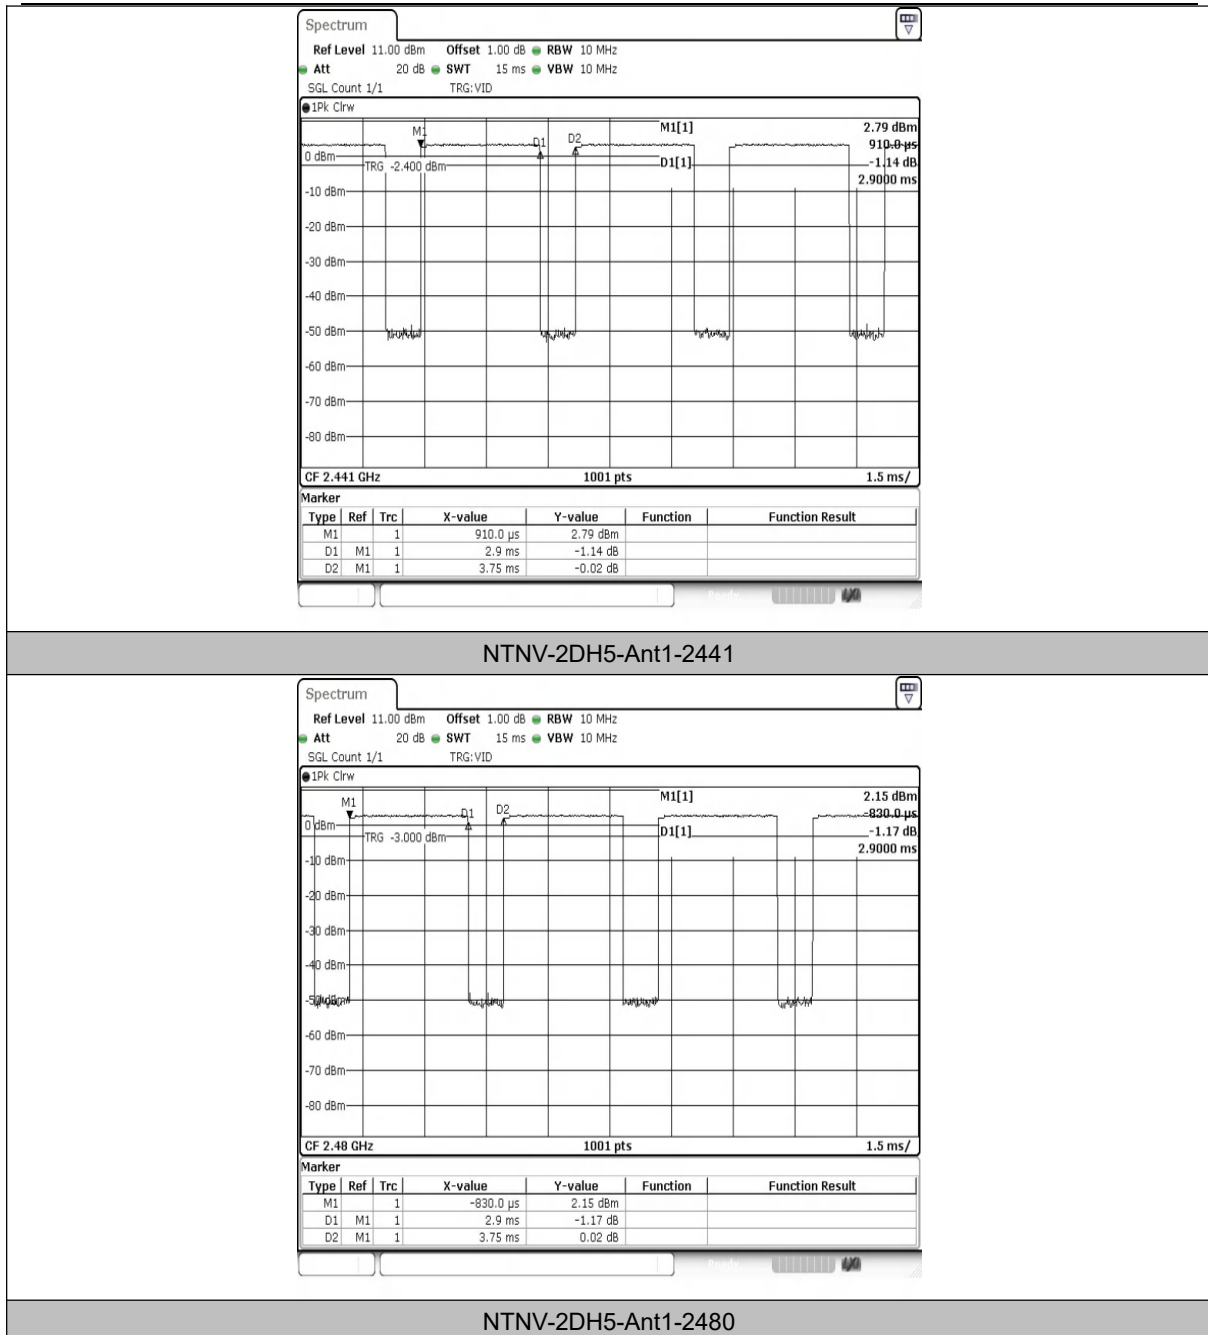

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

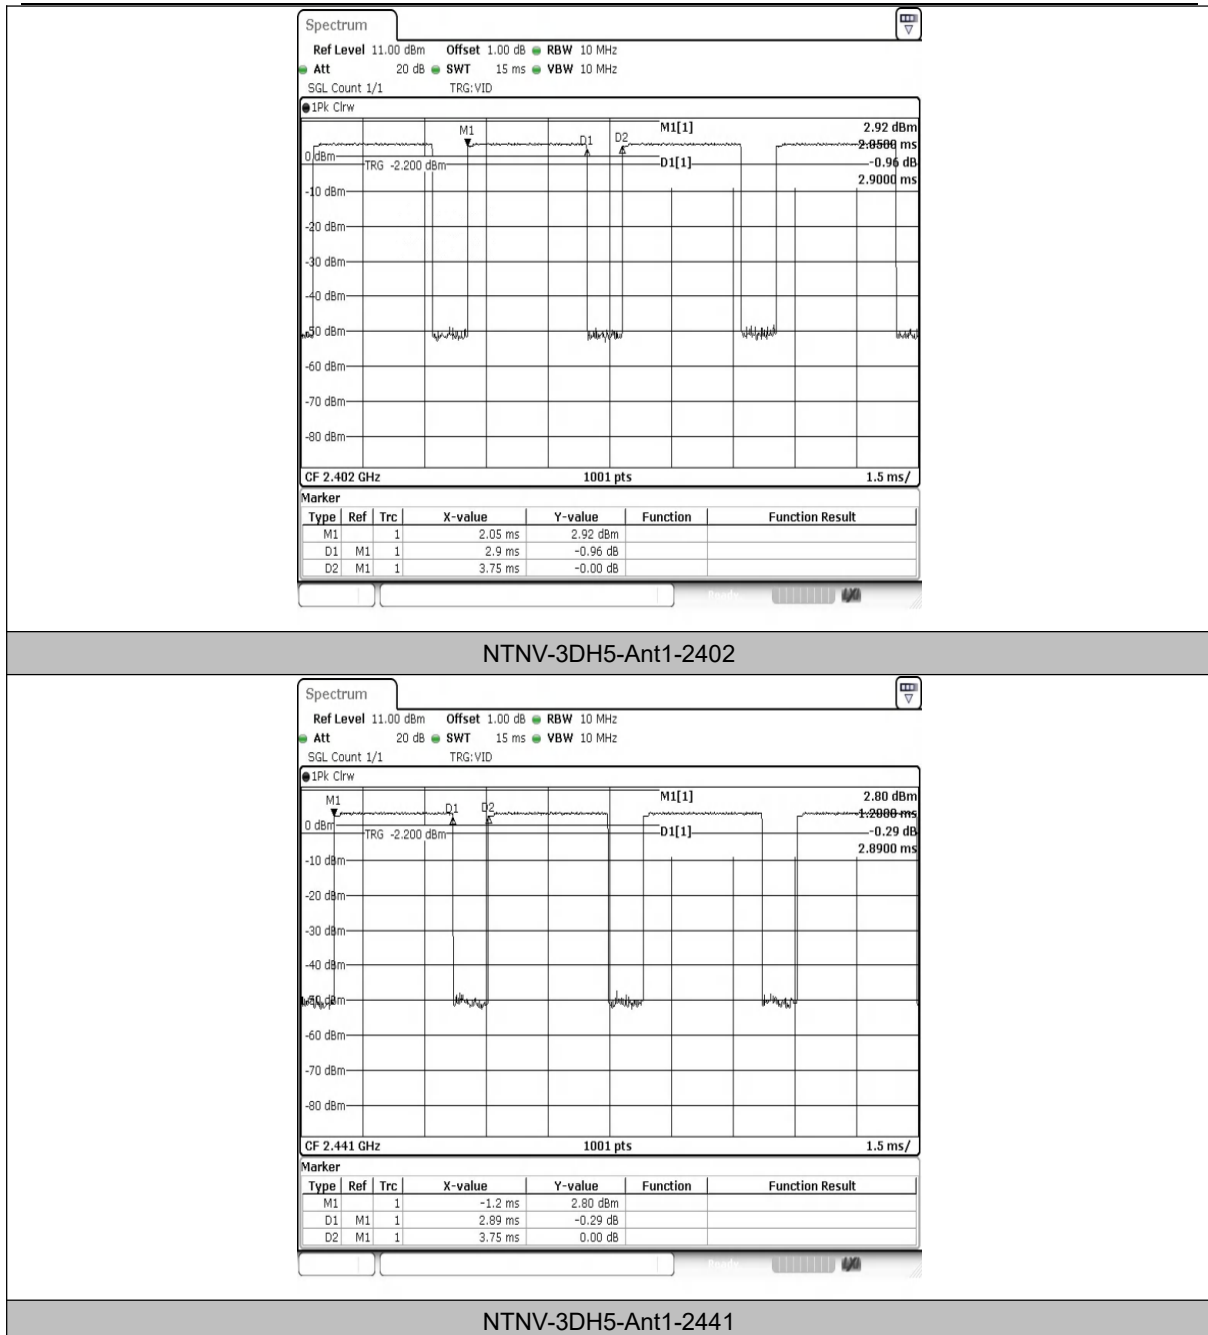

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

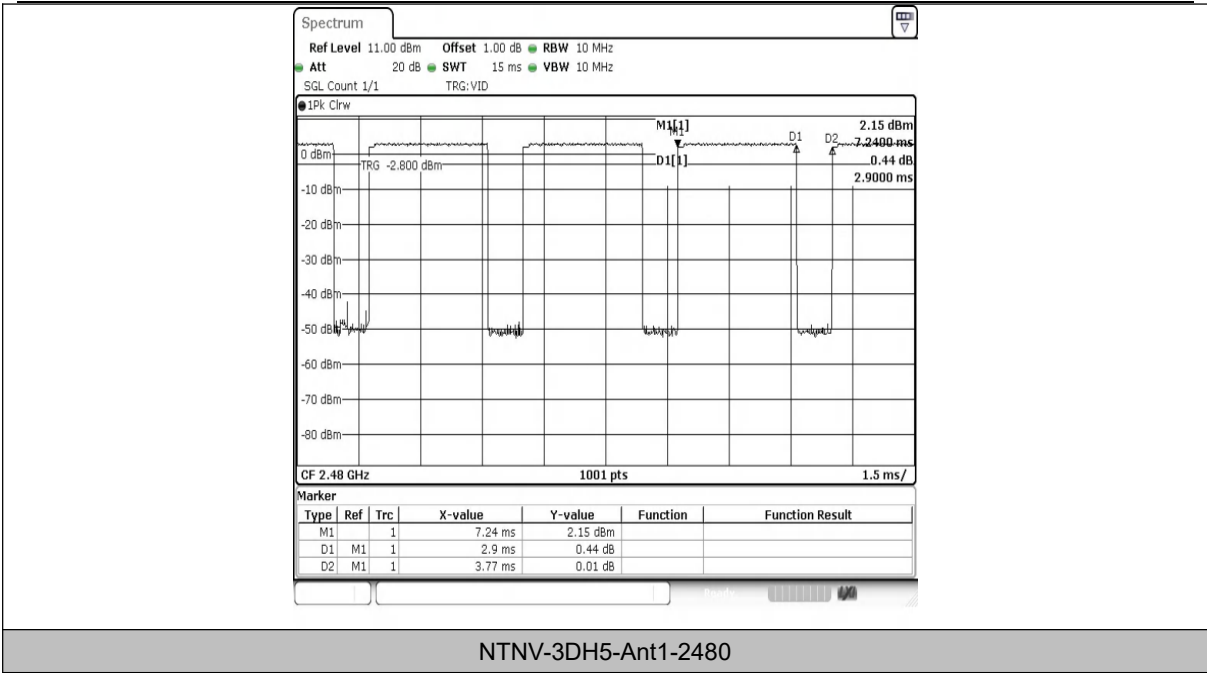

---End---