


## Appendix C: Maximum Conducted Output Power

### Test Result Channel Power

| Test Mode | Antenna | Frequency [MHz] | Set Power | Channel Power [dBm] | Duty Cycle [%] | DC Factor [dB] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|-----------------|-----------|---------------------|----------------|----------------|--------------|-------------|---------|
| 11A       | Ant1    | 5180            | ---       | 14.01               | 100.00         | 0.00           | 14.01        | ≤23.98      | PASS    |
| 11A       | Ant1    | 5200            | ---       | 14.06               | 100.00         | 0.00           | 14.06        | ≤23.98      | PASS    |
| 11A       | Ant1    | 5240            | ---       | 13.59               | 100.00         | 0.00           | 13.59        | ≤23.98      | PASS    |
| 11A       | Ant1    | 5260            | ---       | 13.41               | 100.00         | 0.00           | 13.41        | ≤23.46      | PASS    |
| 11A       | Ant1    | 5280            | ---       | 13.15               | 100.00         | 0.00           | 13.15        | ≤23.47      | PASS    |
| 11A       | Ant1    | 5320            | ---       | 12.95               | 100.00         | 0.00           | 12.95        | ≤23.48      | PASS    |
| 11A       | Ant1    | 5500            | ---       | 12.68               | 100.00         | 0.00           | 12.68        | ≤23.46      | PASS    |
| 11A       | Ant1    | 5580            | ---       | 14.08               | 100.00         | 0.00           | 14.08        | ≤23.50      | PASS    |
| 11A       | Ant1    | 5700            | ---       | 13.90               | 100.00         | 0.00           | 13.90        | ≤23.46      | PASS    |
| 11A       | Ant1    | 5745            | ---       | 13.84               | 100.00         | 0.00           | 13.84        | ≤30.00      | PASS    |
| 11A       | Ant1    | 5785            | ---       | 13.61               | 100.00         | 0.00           | 13.61        | ≤30.00      | PASS    |
| 11A       | Ant1    | 5825            | ---       | 13.13               | 100.00         | 0.00           | 13.13        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 5180            | ---       | 13.47               | 100.00         | 0.00           | 13.47        | ≤23.98      | PASS    |
| 11N20SISO | Ant1    | 5200            | ---       | 13.52               | 100.00         | 0.00           | 13.52        | ≤23.98      | PASS    |
| 11N20SISO | Ant1    | 5240            | ---       | 13.23               | 100.00         | 0.00           | 13.23        | ≤23.98      | PASS    |
| 11N20SISO | Ant1    | 5260            | ---       | 13.99               | 100.00         | 0.00           | 13.99        | ≤23.66      | PASS    |
| 11N20SISO | Ant1    | 5280            | ---       | 13.70               | 100.00         | 0.00           | 13.70        | ≤23.66      | PASS    |
| 11N20SISO | Ant1    | 5320            | ---       | 13.51               | 100.00         | 0.00           | 13.51        | ≤23.67      | PASS    |
| 11N20SISO | Ant1    | 5500            | ---       | 13.18               | 100.00         | 0.00           | 13.18        | ≤23.66      | PASS    |
| 11N20SISO | Ant1    | 5580            | ---       | 14.60               | 100.00         | 0.00           | 14.60        | ≤23.66      | PASS    |
| 11N20SISO | Ant1    | 5700            | ---       | 14.42               | 100.00         | 0.00           | 14.42        | ≤23.66      | PASS    |
| 11N20SISO | Ant1    | 5745            | ---       | 13.22               | 100.00         | 0.00           | 13.22        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 5785            | ---       | 13.06               | 100.00         | 0.00           | 13.06        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 5825            | ---       | 12.58               | 100.00         | 0.00           | 12.58        | ≤30.00      | PASS    |
| 11N40SISO | Ant1    | 5190            | ---       | 13.21               | 100.00         | 0.00           | 13.21        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5230            | ---       | 12.98               | 100.00         | 0.00           | 12.98        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5270            | ---       | 13.44               | 100.00         | 0.00           | 13.44        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5310            | ---       | 13.08               | 100.00         | 0.00           | 13.08        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5510            | ---       | 12.92               | 100.00         | 0.00           | 12.92        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5550            | ---       | 13.59               | 100.00         | 0.00           | 13.59        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5670            | ---       | 14.01               | 100.00         | 0.00           | 14.01        | ≤23.98      | PASS    |
| 11N40SISO | Ant1    | 5755            | ---       | 12.87               | 100.00         | 0.00           | 12.87        | ≤30.00      | PASS    |
| 11N40SISO | Ant1    | 5795            | ---       | 12.55               | 100.00         | 0.00           | 12.55        | ≤30.00      | PASS    |

Note: 1.The cable loss are compensated in the graph.


## Test Graphs Channel Power

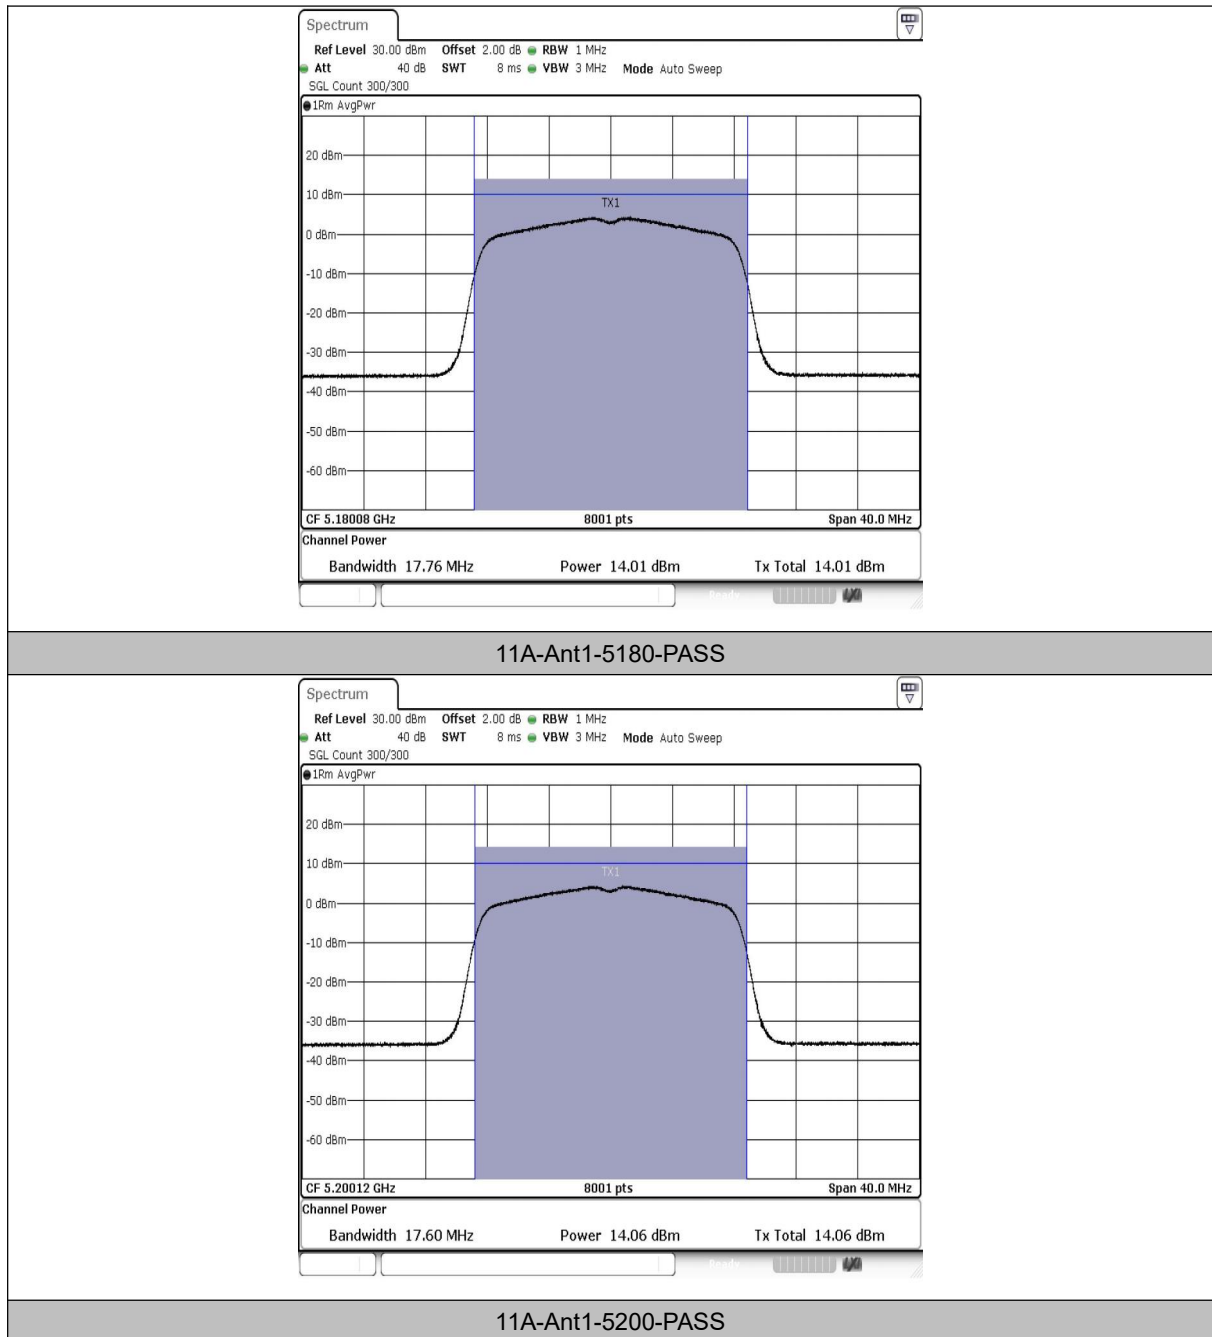

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

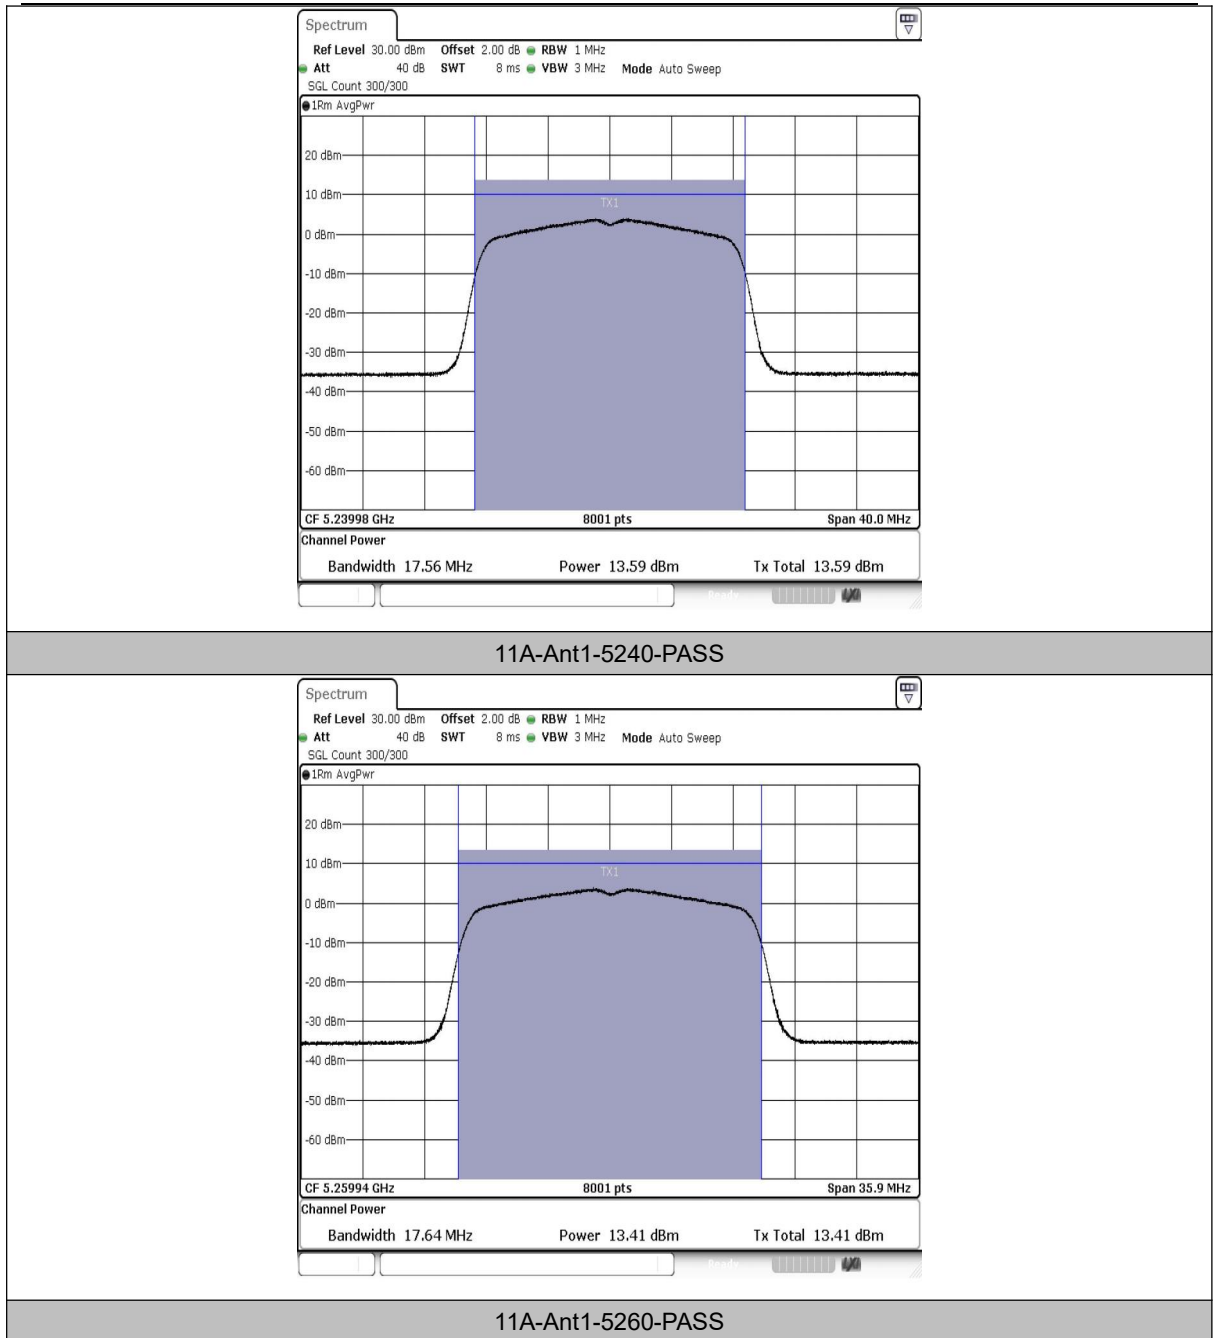

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

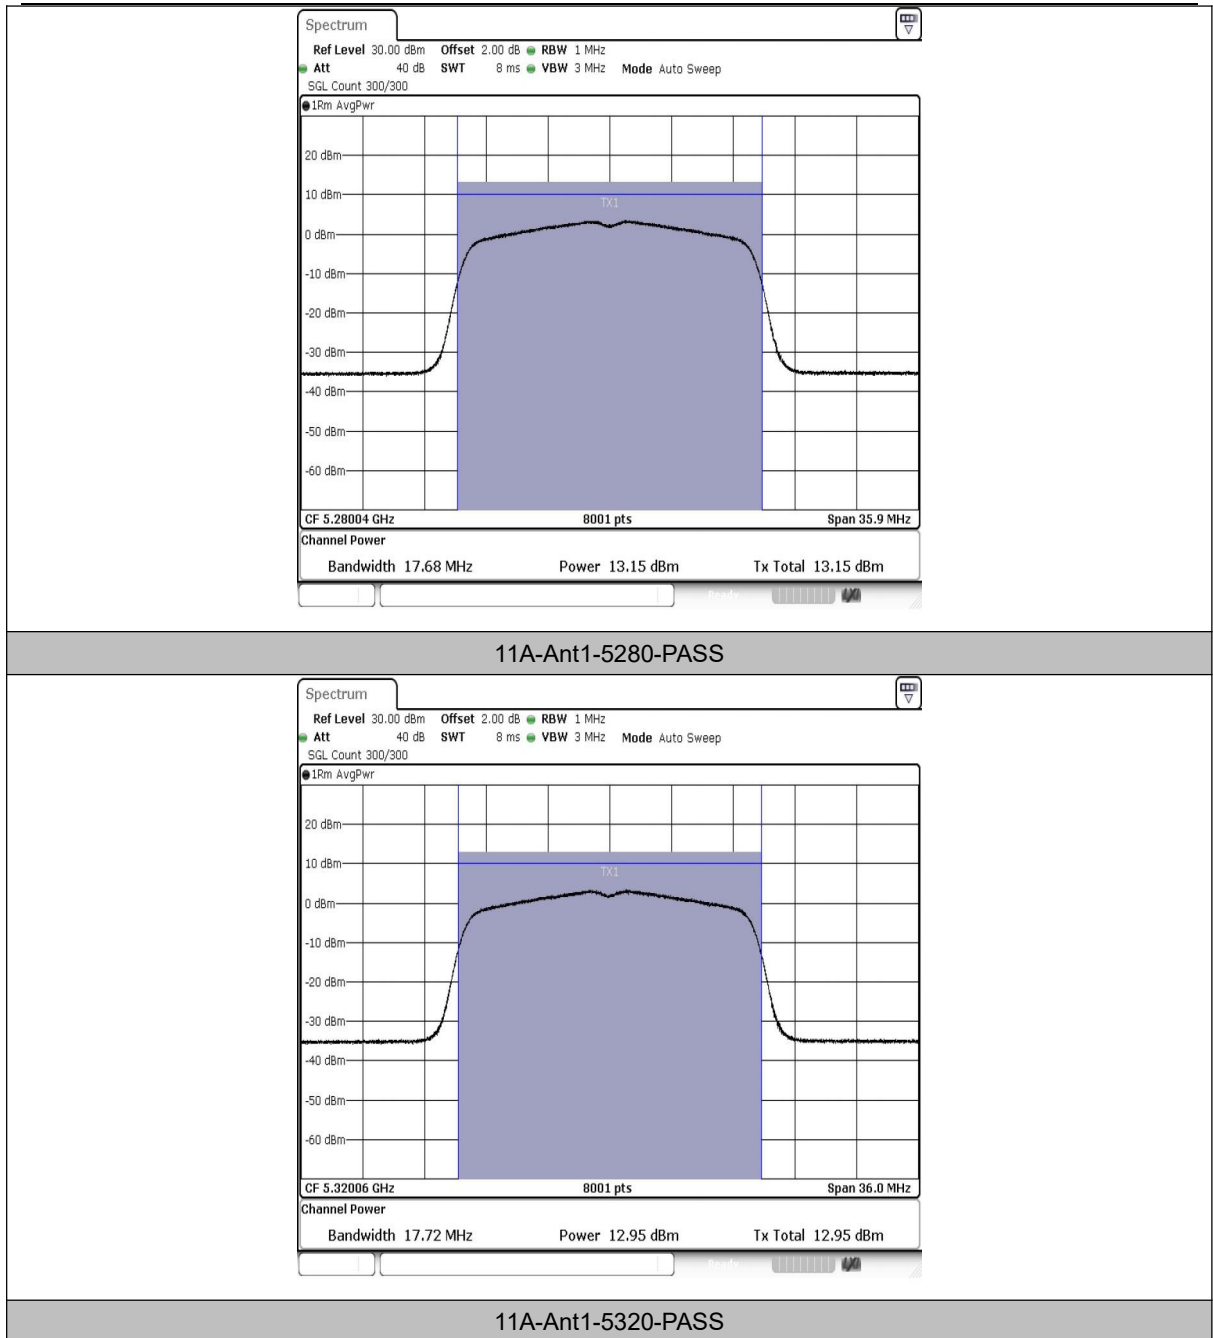

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

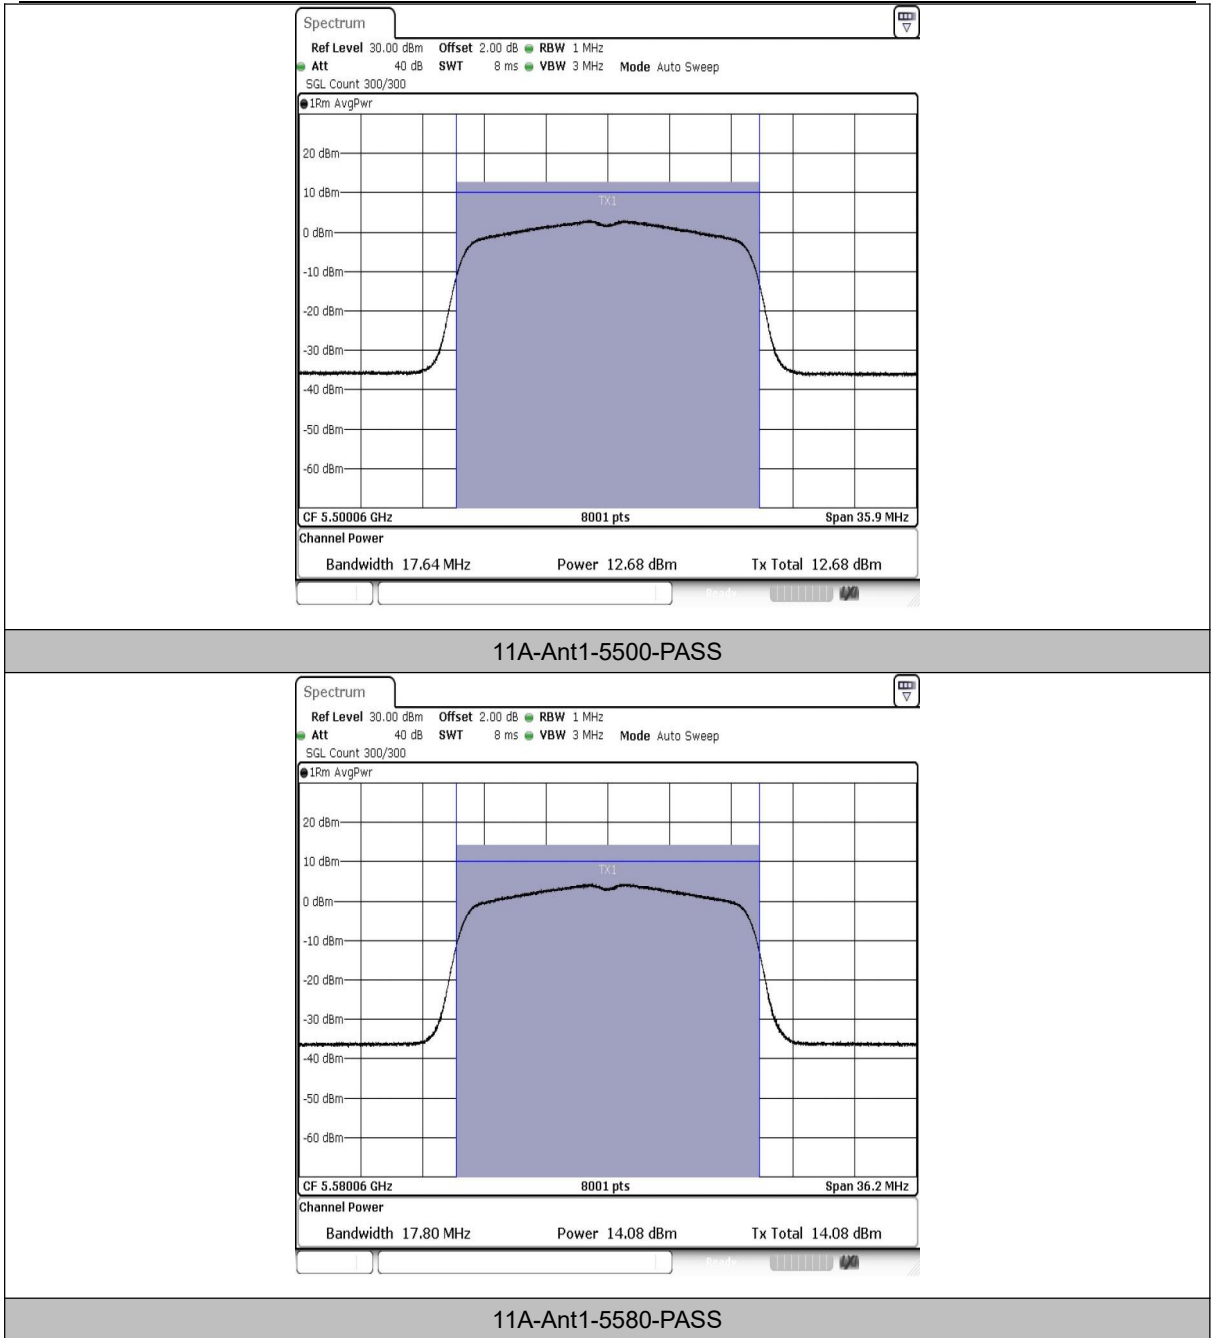

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

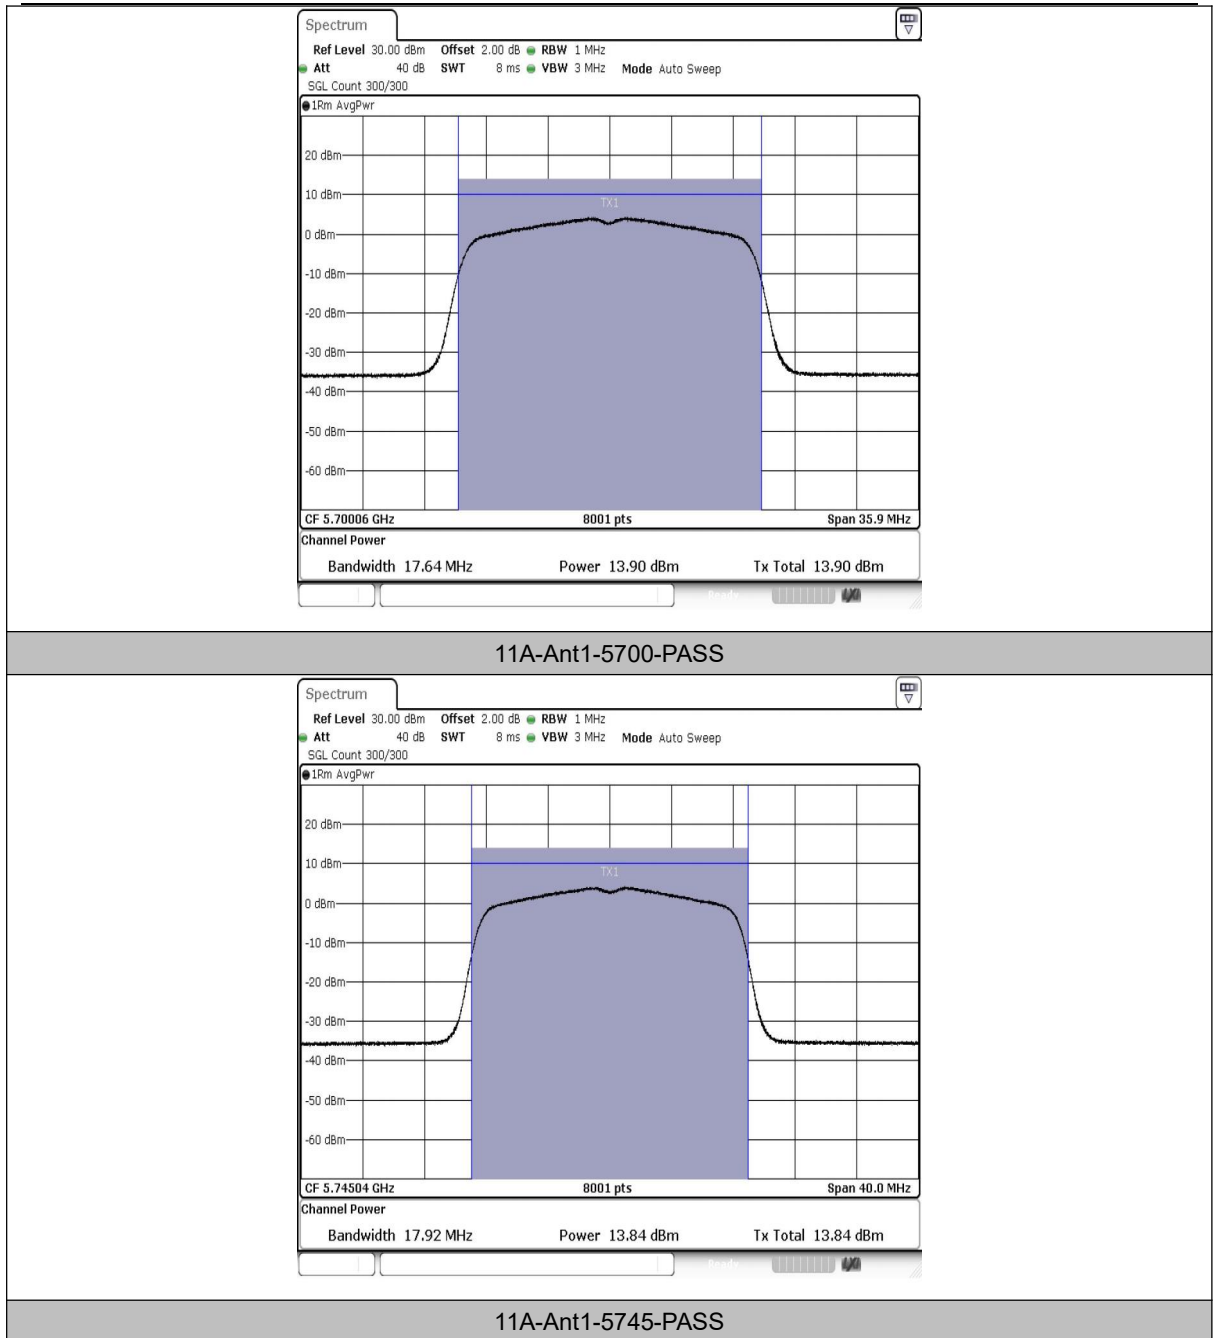

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

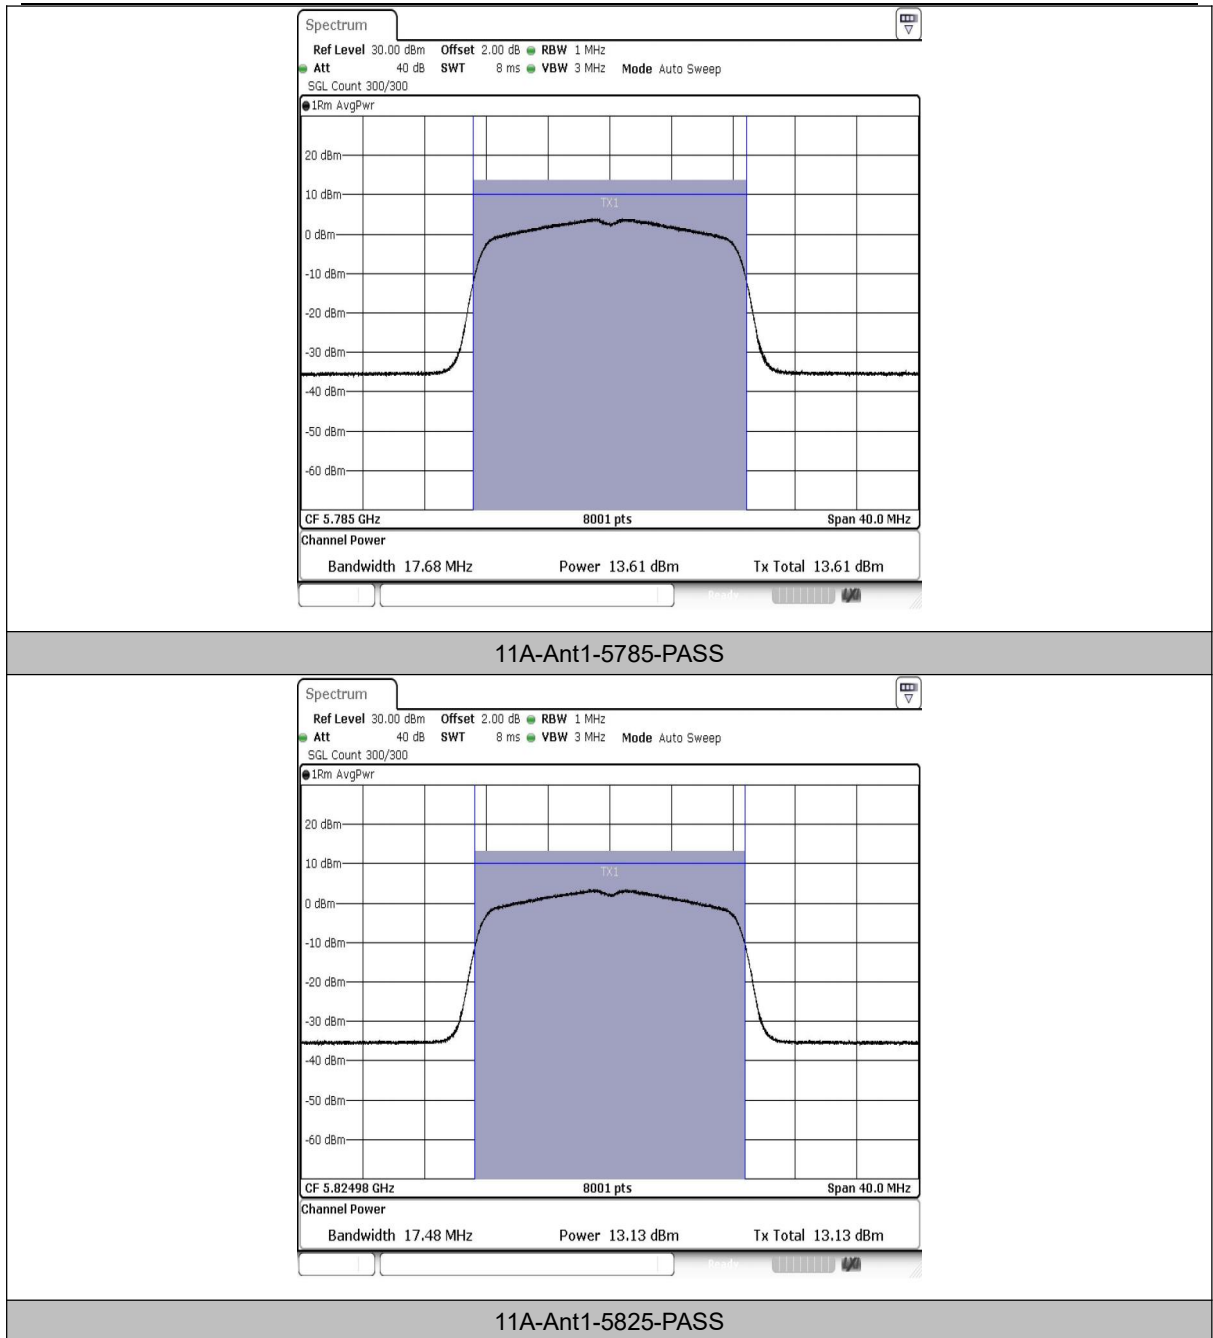

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

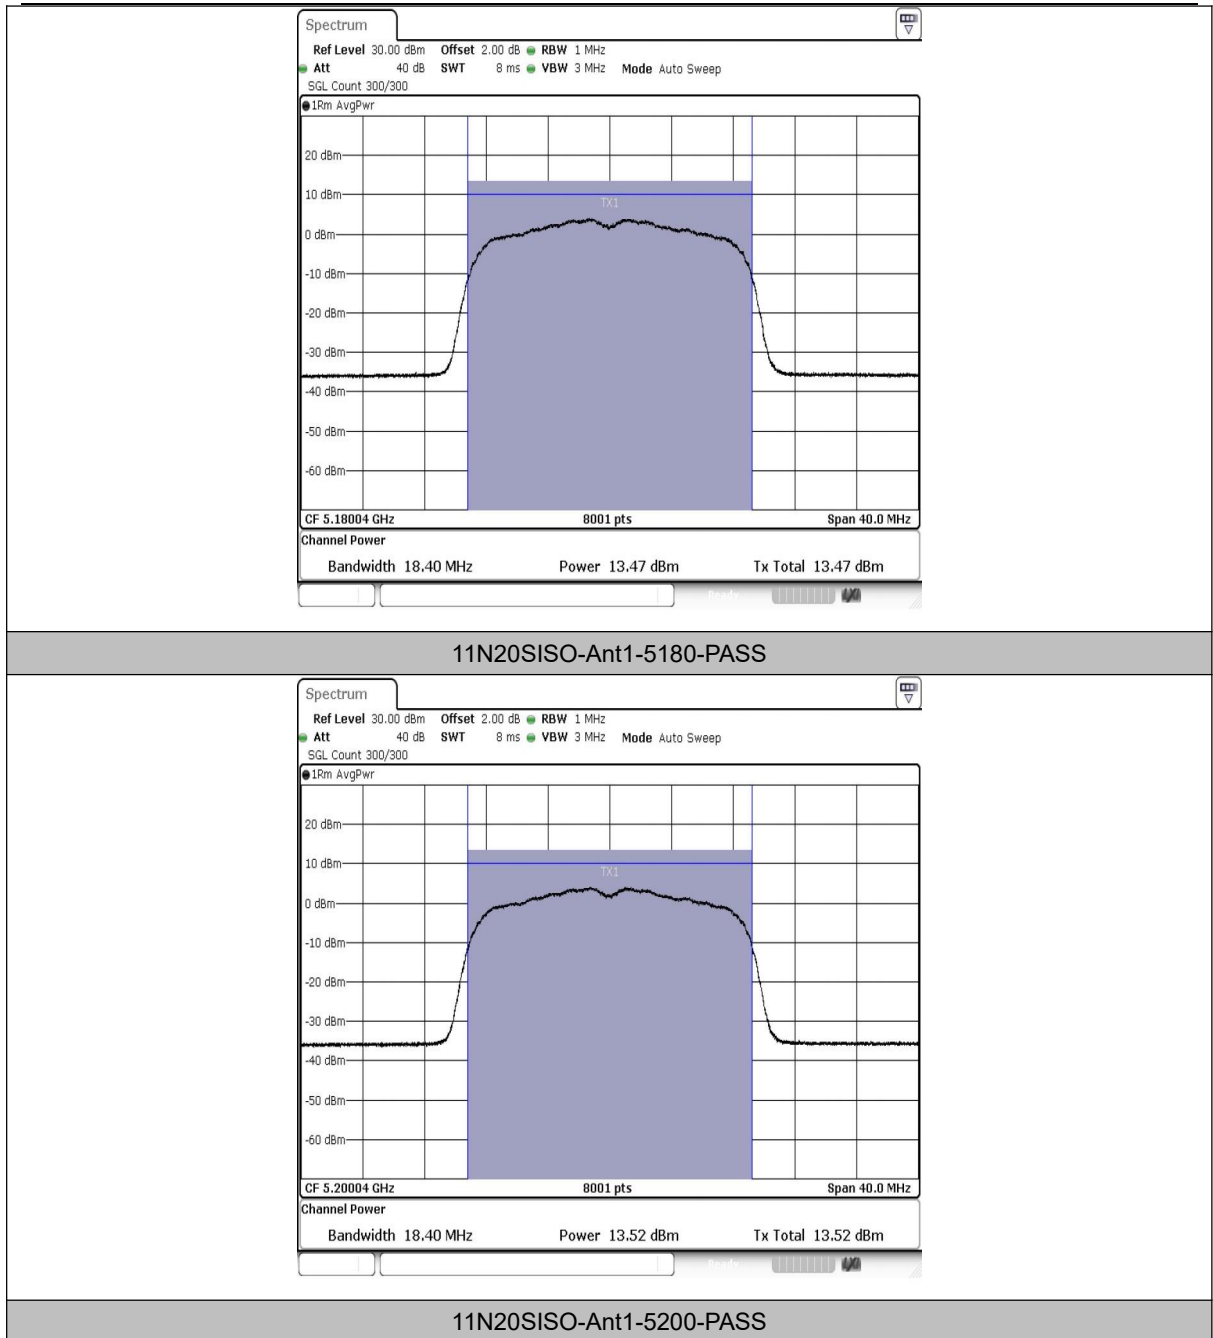

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

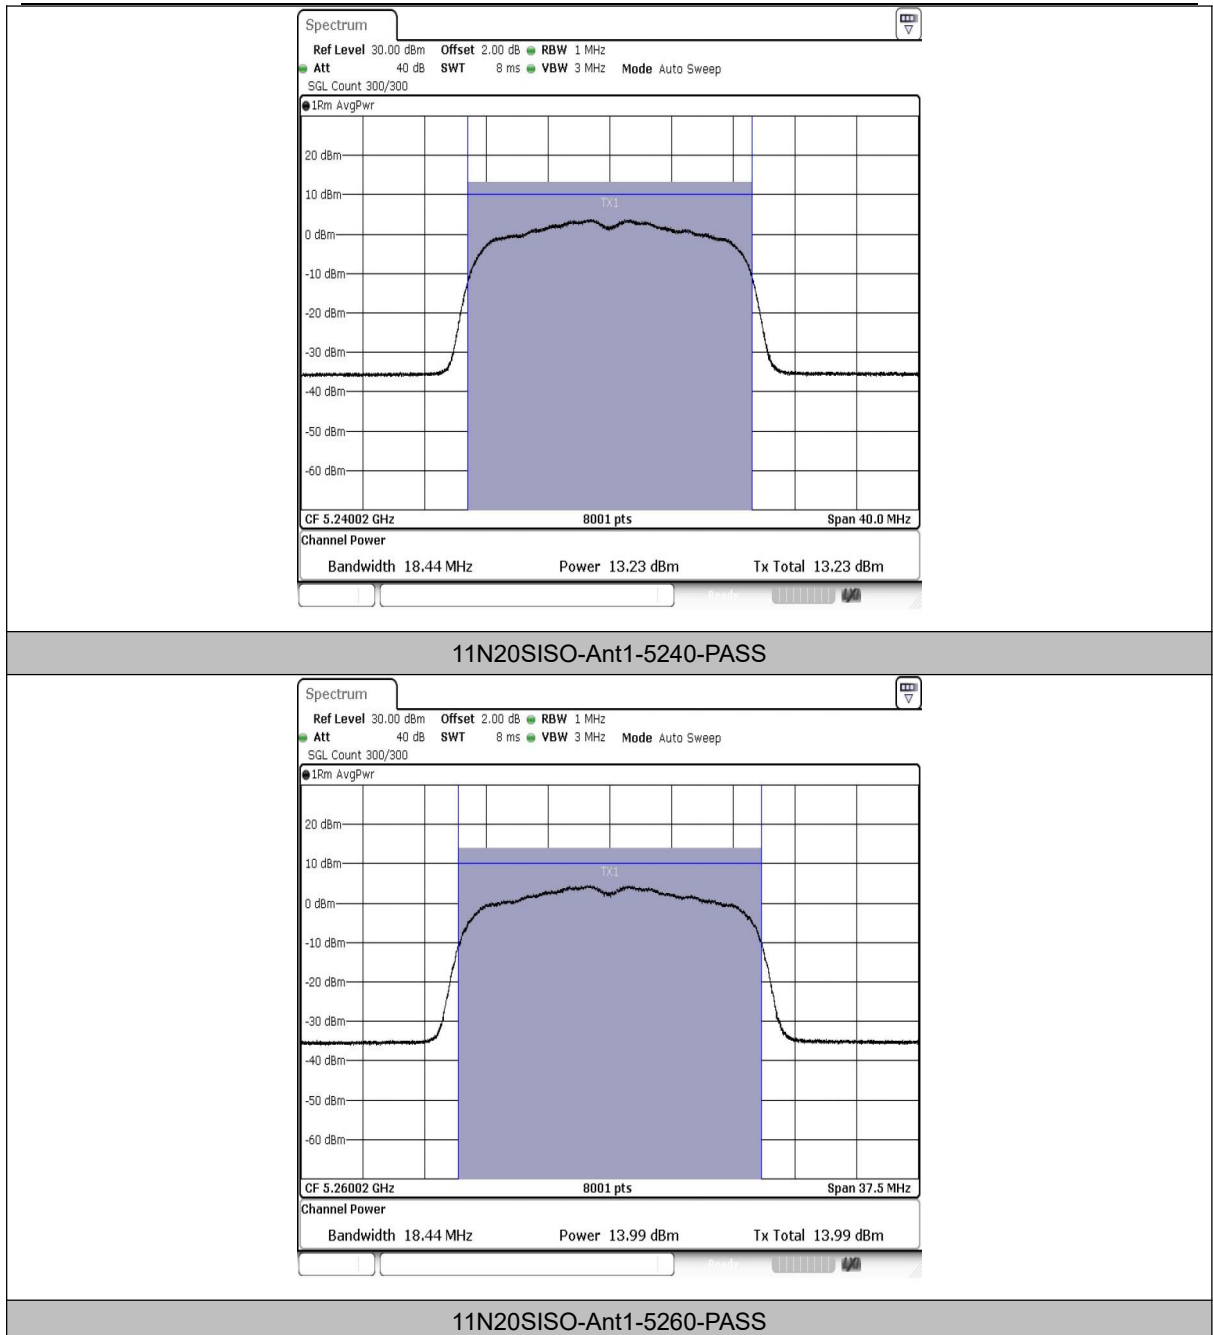

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

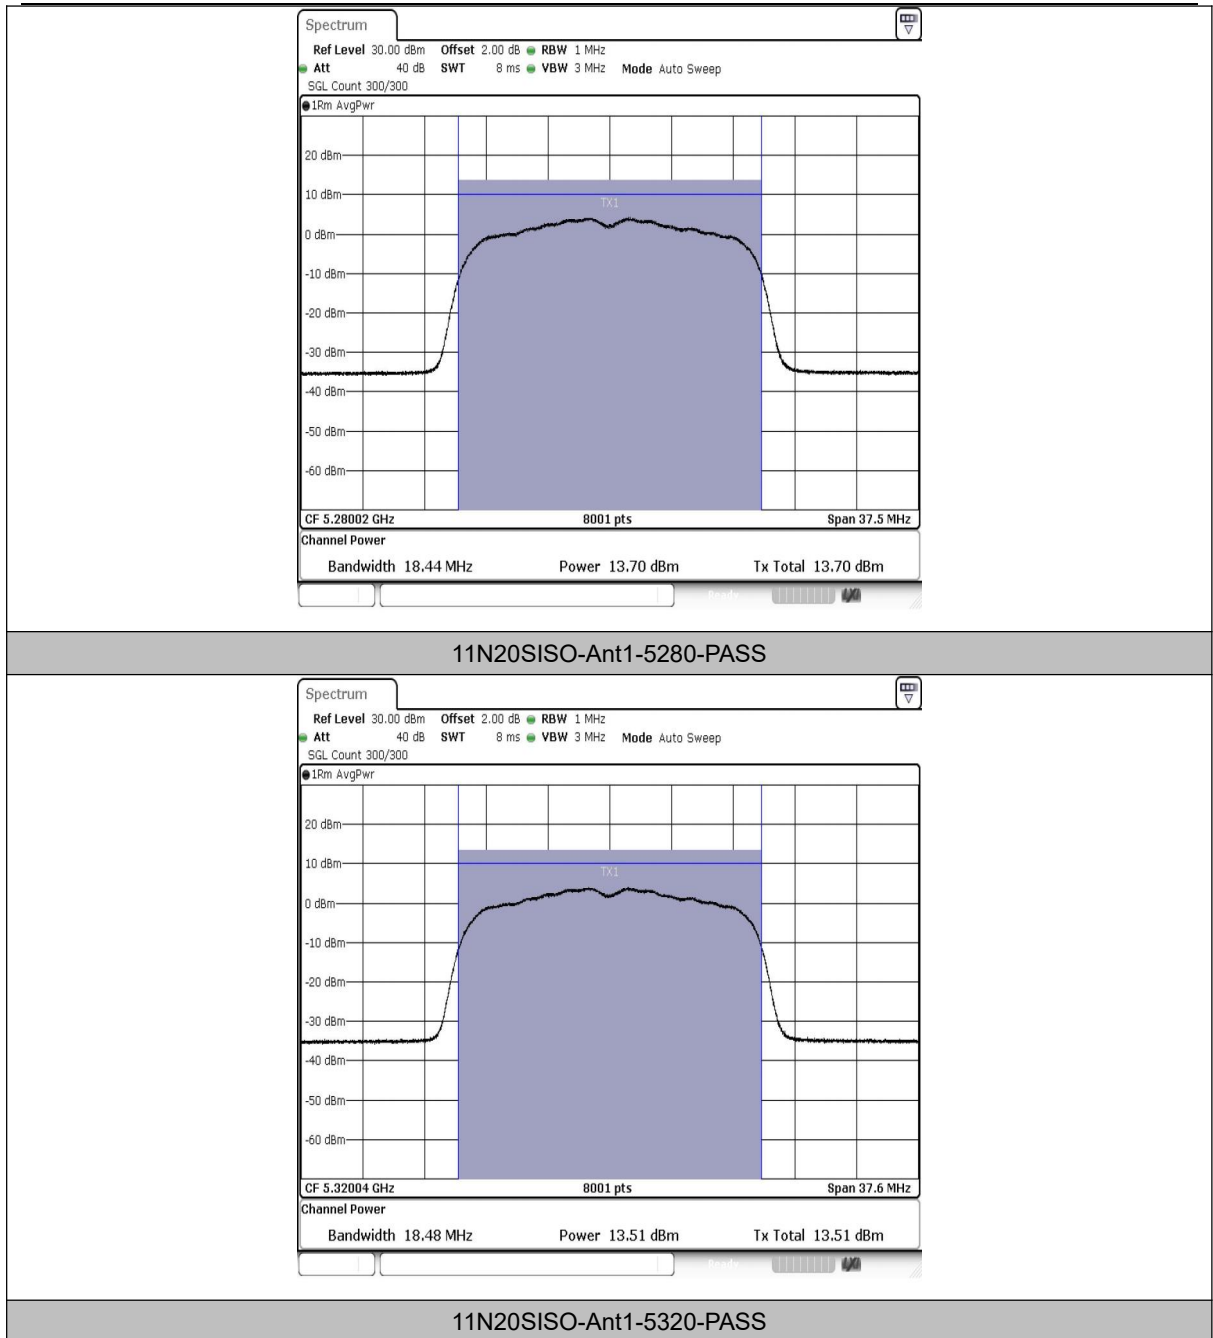

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

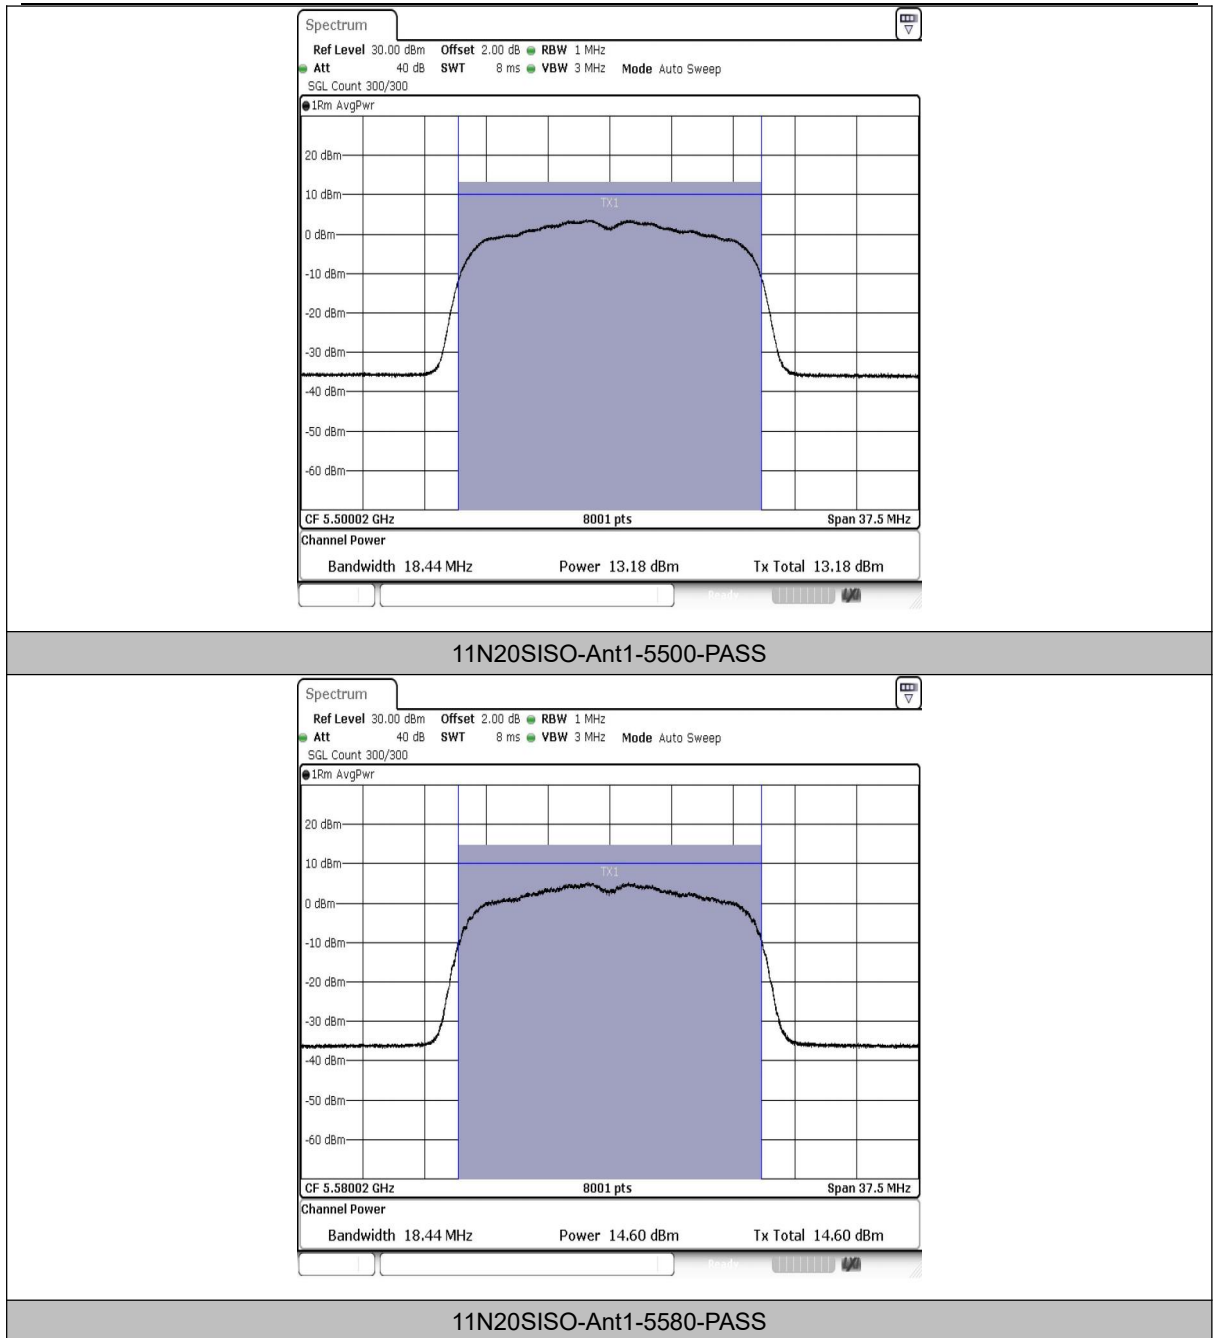

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

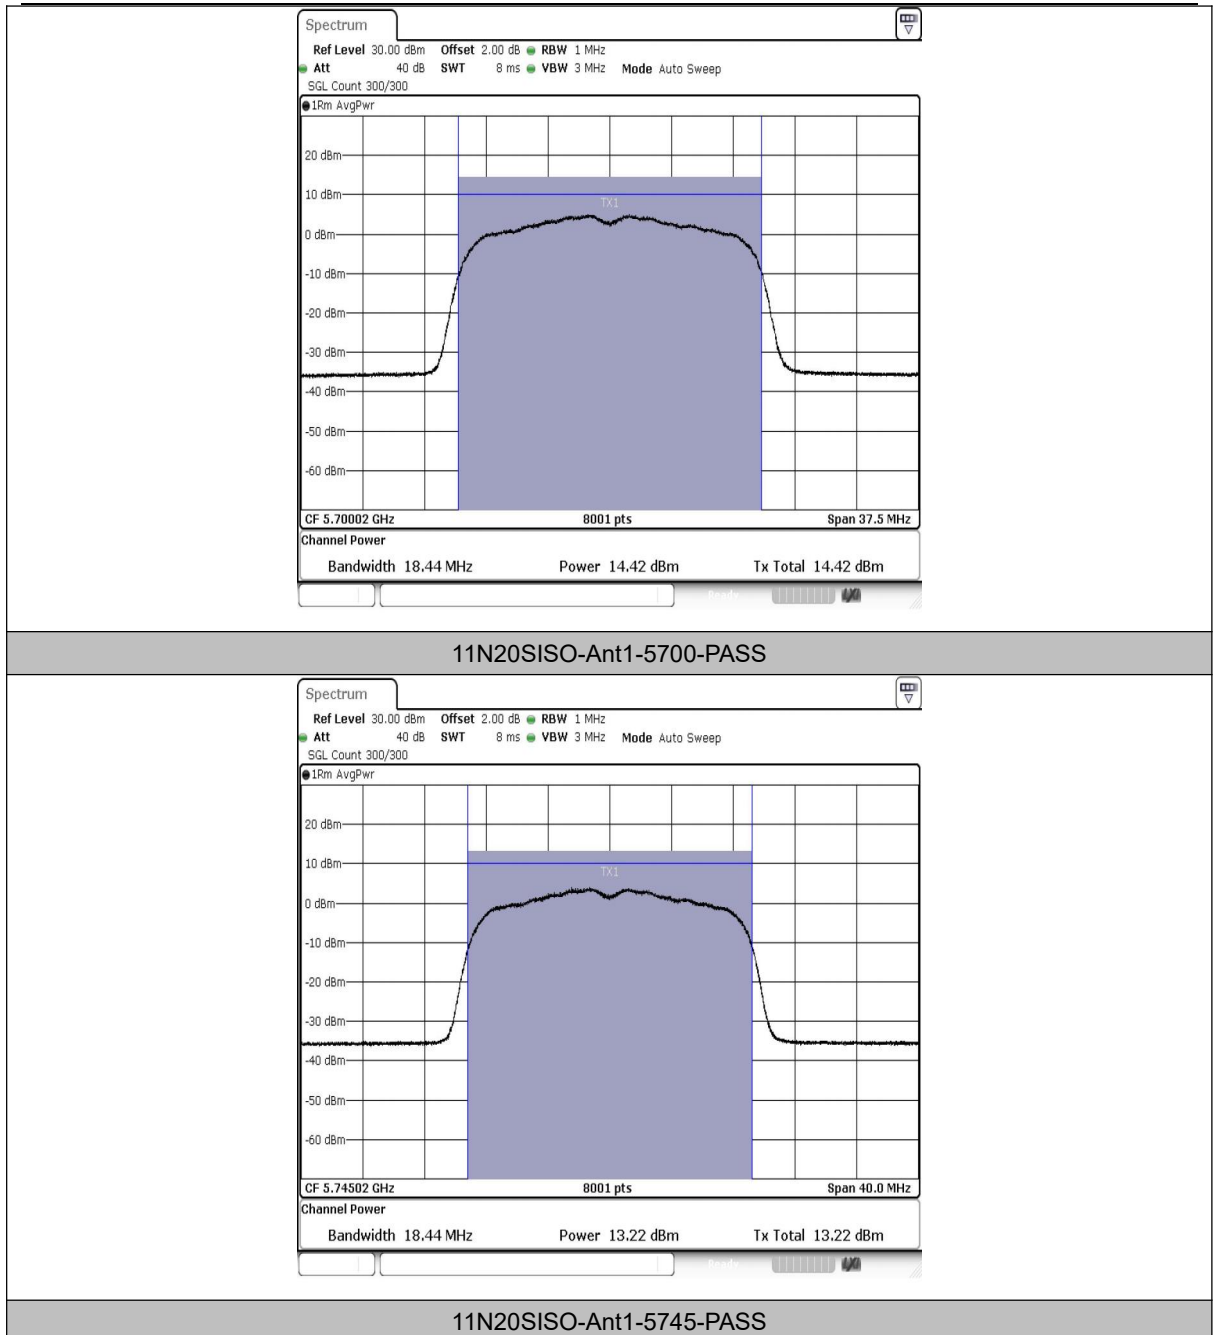

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

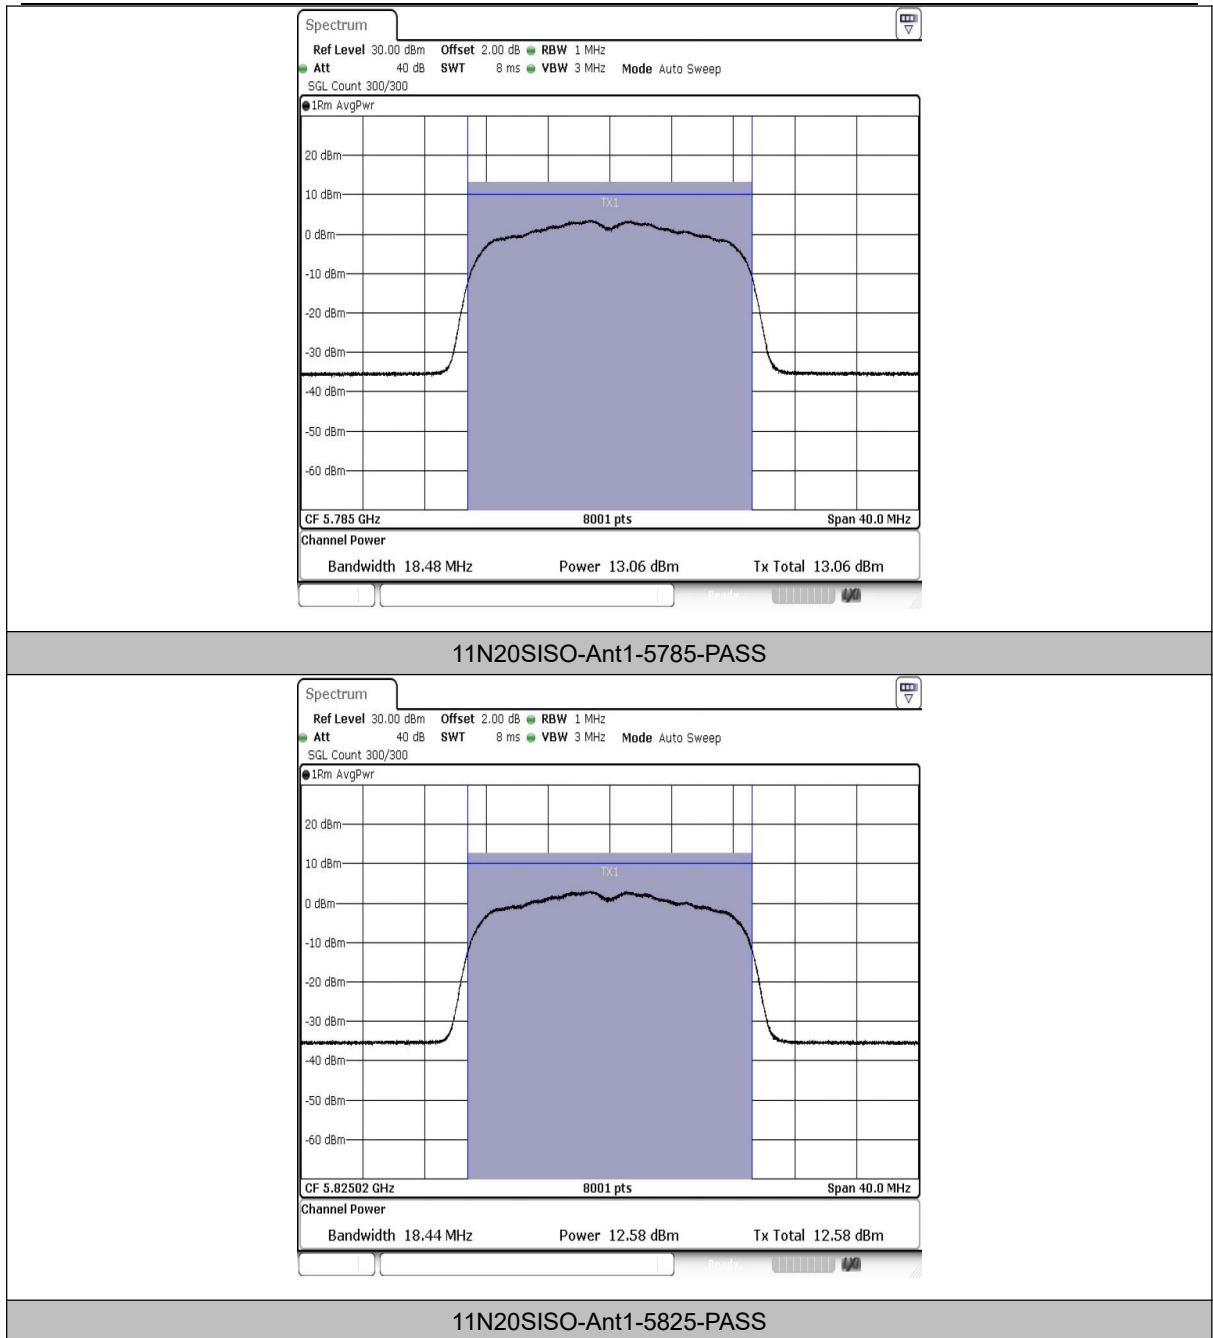

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

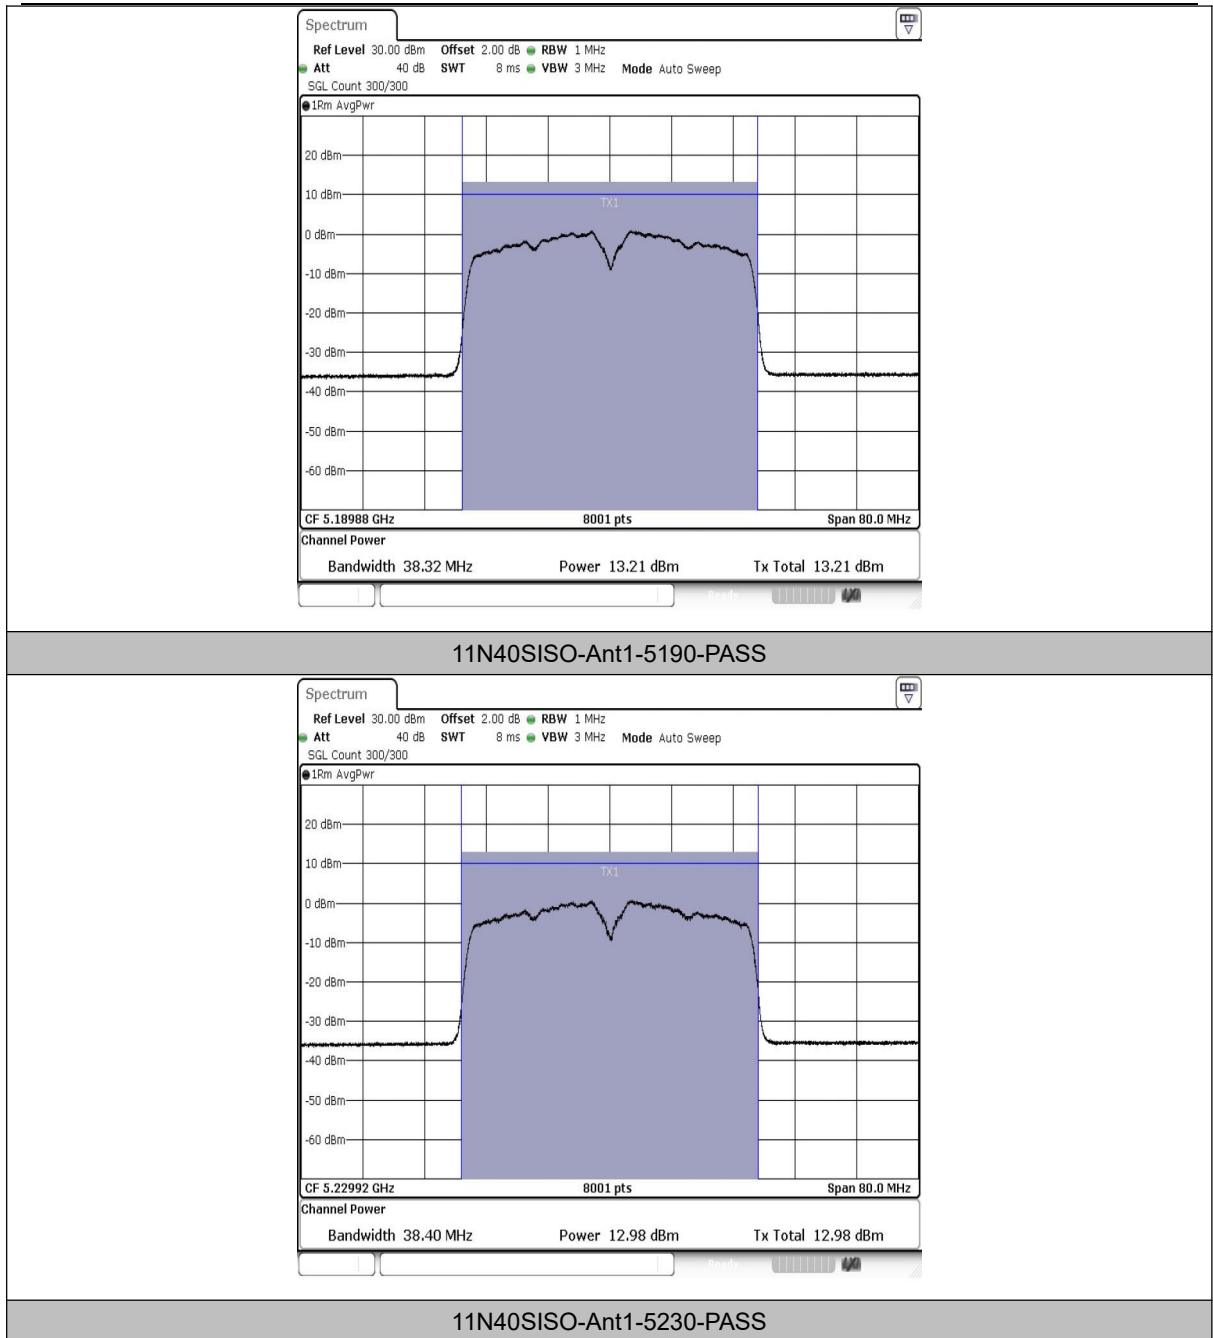

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

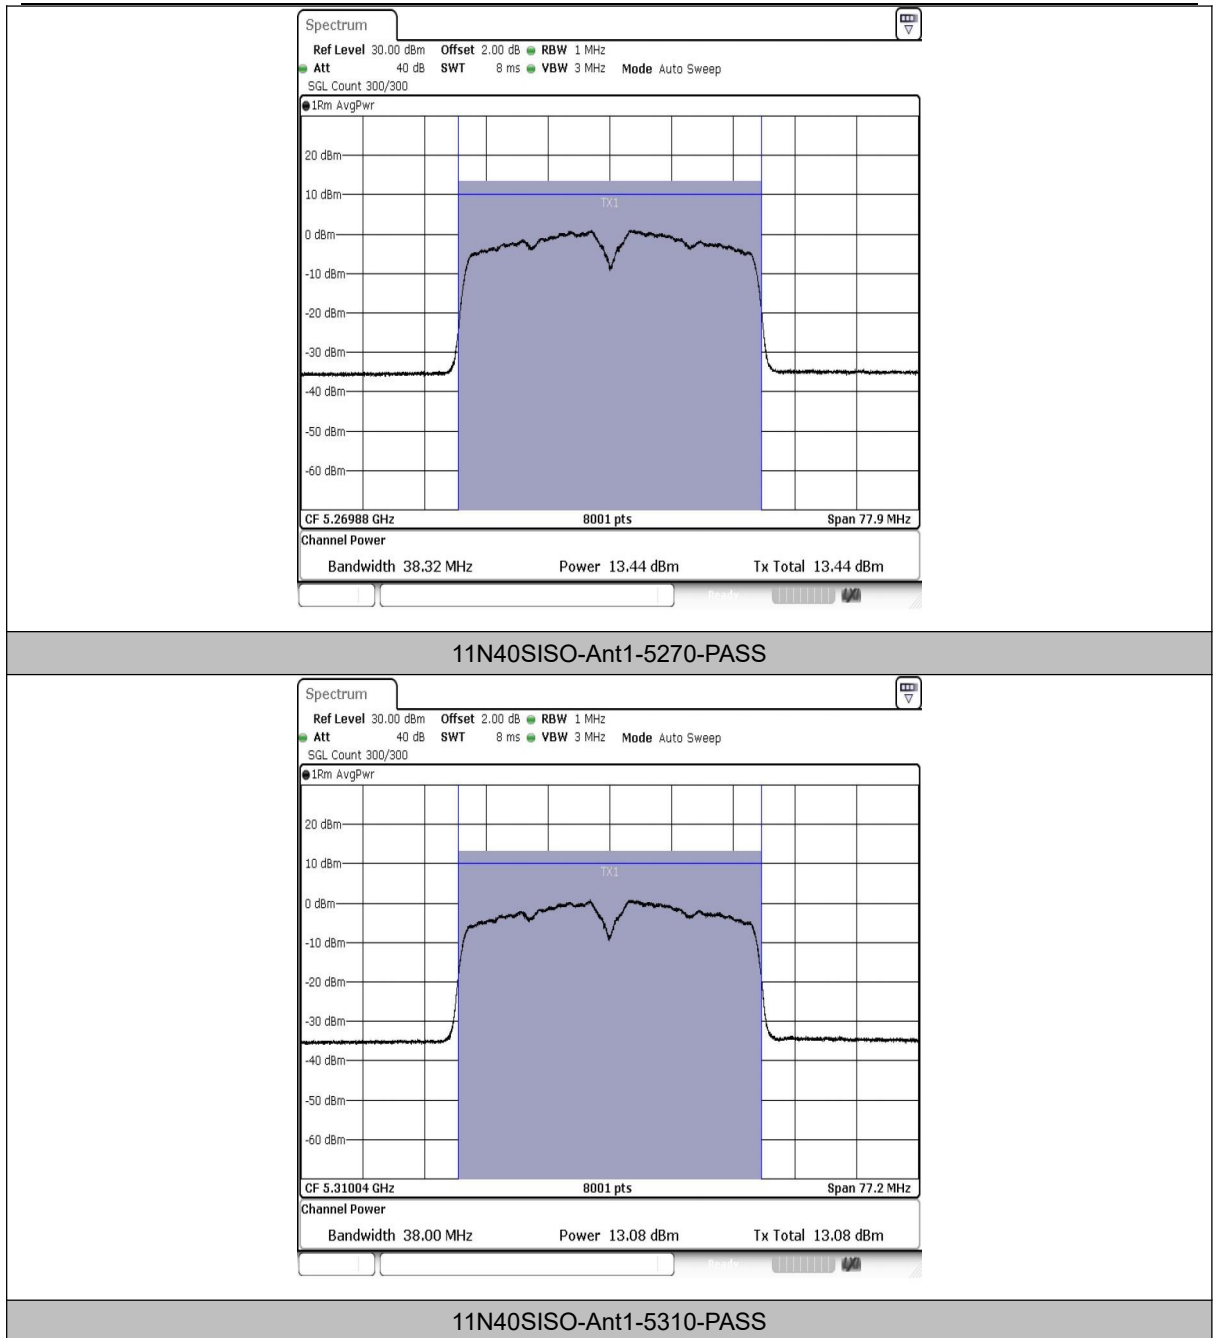

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

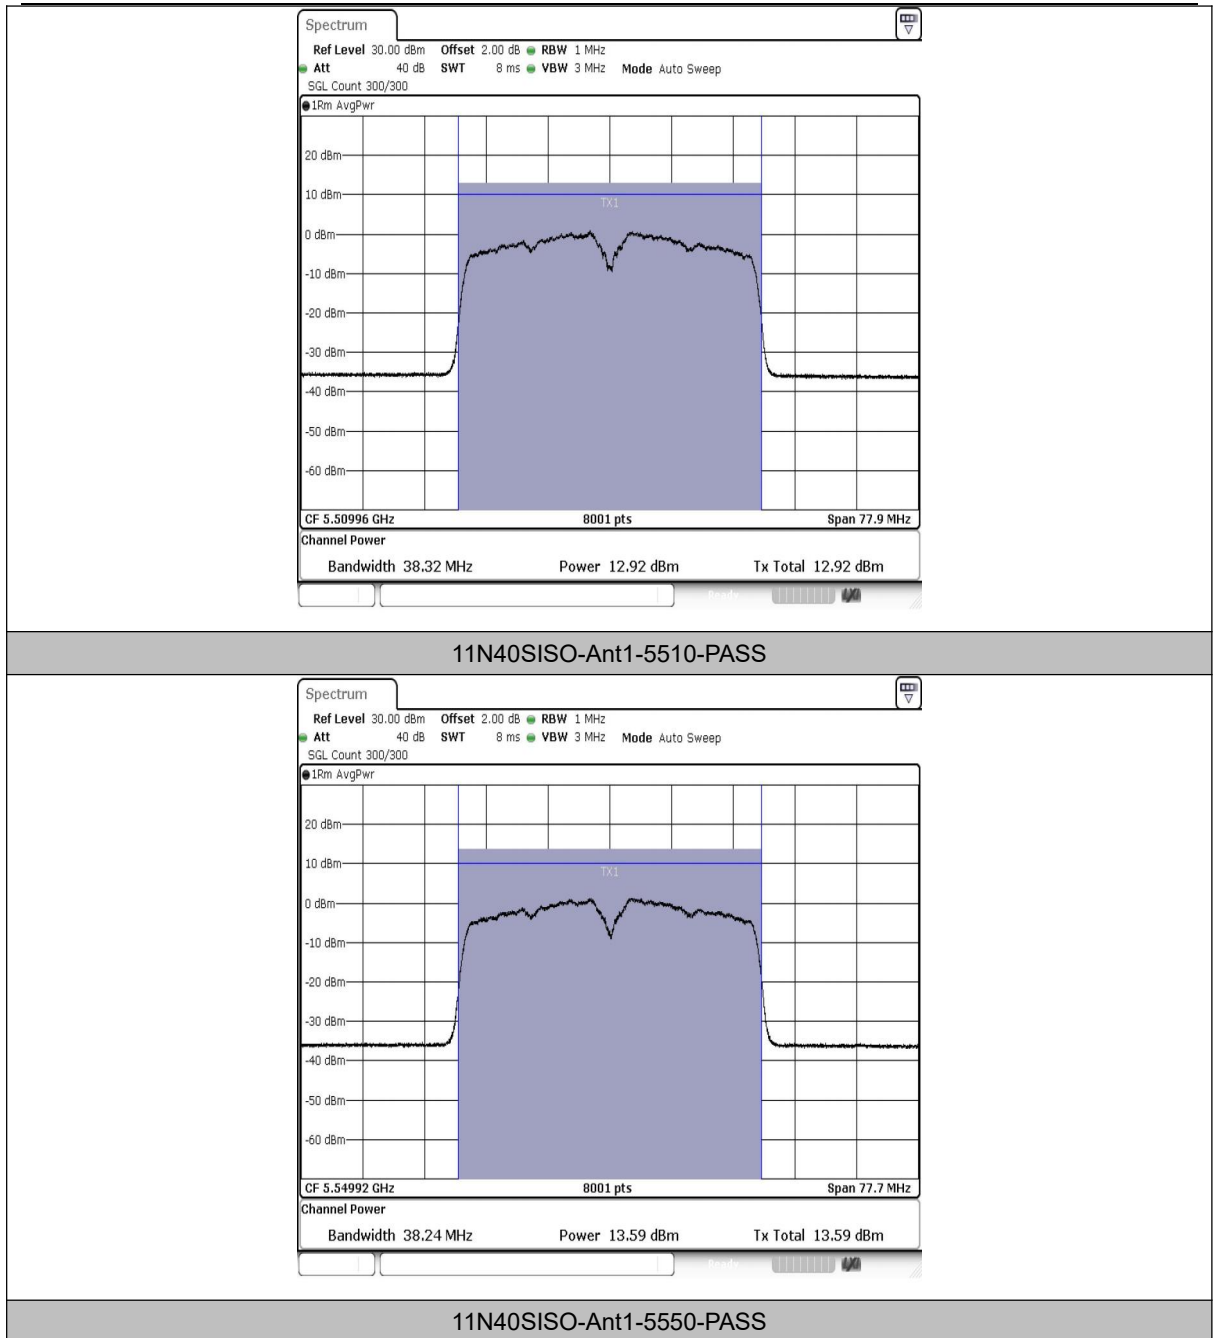

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

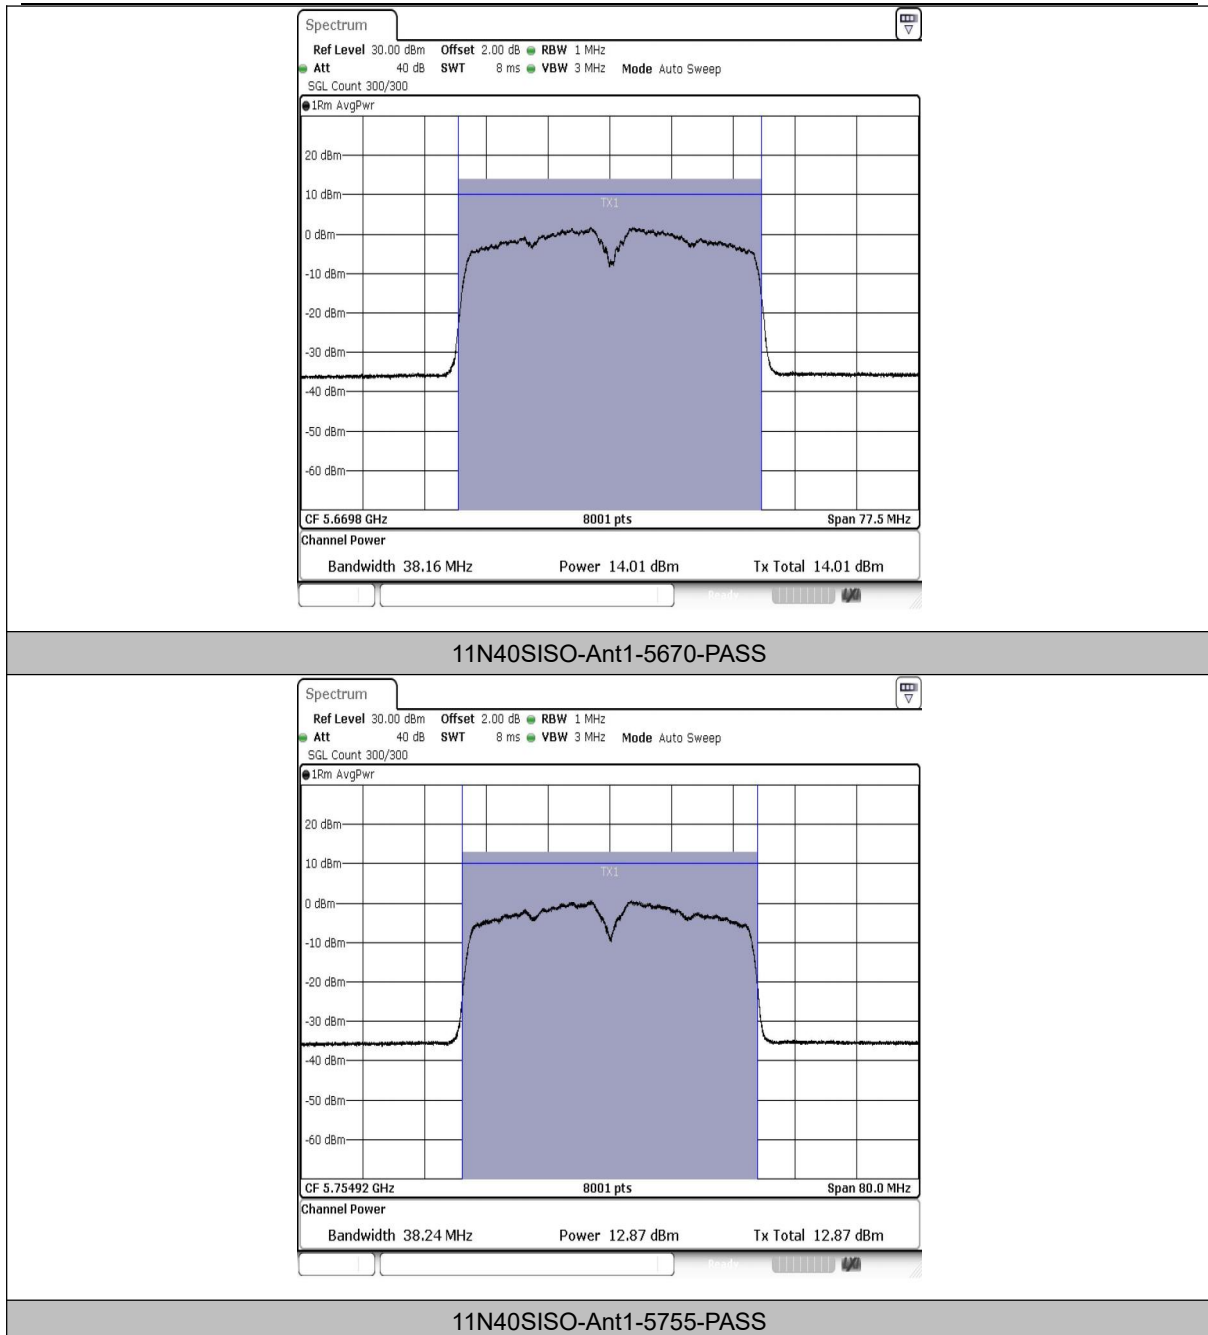

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

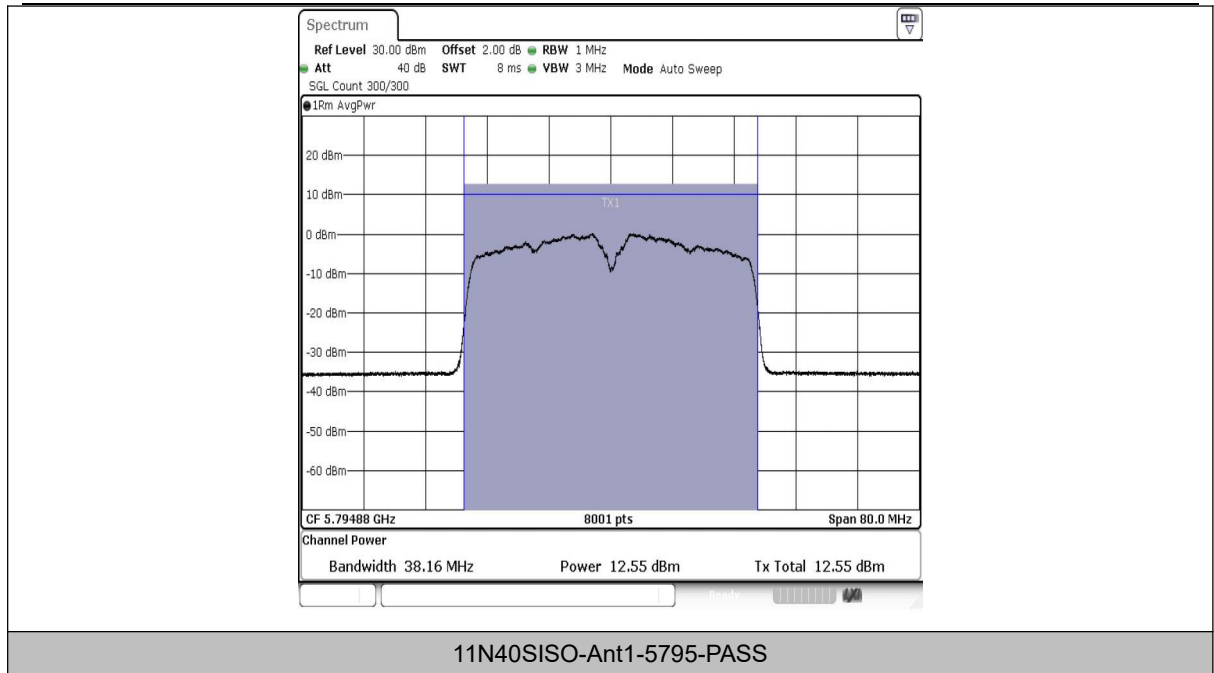

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix D: Maximum Power Spectral Density

### Test Result B1/2/3

| Test Mode | Antenna | Frequency[MHz] | Reading Result [dBm/MHz] | DC Factor [dB] | Result [dBm/MHz] | Limit [dBm/MHz] | Verdict |
|-----------|---------|----------------|--------------------------|----------------|------------------|-----------------|---------|
| 11A       | Ant1    | 5180           | 4.22                     | 0.00           | 4.22             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5200           | 3.48                     | 0.00           | 3.48             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5240           | 3.77                     | 0.00           | 3.77             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5260           | 3.23                     | 0.00           | 3.23             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5280           | 3.37                     | 0.00           | 3.37             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5320           | 2.83                     | 0.00           | 2.83             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5500           | 2.73                     | 0.00           | 2.73             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5580           | 4.21                     | 0.00           | 4.21             | ≤11.00          | PASS    |
| 11A       | Ant1    | 5700           | 4.27                     | 0.00           | 4.27             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5180           | 3.92                     | 0.00           | 3.92             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5200           | 3.66                     | 0.00           | 3.66             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5240           | 3.9                      | 0.00           | 3.90             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5260           | 4.47                     | 0.00           | 4.47             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5280           | 3.89                     | 0.00           | 3.89             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5320           | 3.92                     | 0.00           | 3.92             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5500           | 3.31                     | 0.00           | 3.31             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5580           | 4.71                     | 0.00           | 4.71             | ≤11.00          | PASS    |
| 11N20SISO | Ant1    | 5700           | 5.15                     | 0.00           | 5.15             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5190           | 0.66                     | 0.00           | 0.66             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5230           | 0.33                     | 0.00           | 0.33             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5270           | 1.22                     | 0.00           | 1.22             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5310           | 0.82                     | 0.00           | 0.82             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5510           | 0.45                     | 0.00           | 0.45             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5550           | 1.27                     | 0.00           | 1.27             | ≤11.00          | PASS    |
| 11N40SISO | Ant1    | 5670           | 1.79                     | 0.00           | 1.79             | ≤11.00          | PASS    |


Note: 1.The cable loss are compensated in the graph.

## Test Result B4

| Test Mode | Antenna | Frequency[MHz] | Reading Result[dBm/500KHz] | DC Factor [dB] | Result [dBm/500KHz] | Limit[dBm/500KHz] | Verdict |
|-----------|---------|----------------|----------------------------|----------------|---------------------|-------------------|---------|
| 11A       | Ant1    | 5745           | 1.33                       | 0.00           | 1.33                | ≤30.00            | PASS    |
| 11A       | Ant1    | 5785           | 1.27                       | 0.00           | 1.27                | ≤30.00            | PASS    |
| 11A       | Ant1    | 5825           | 0.69                       | 0.00           | 0.69                | ≤30.00            | PASS    |
| 11N20SISO | Ant1    | 5745           | 1.23                       | 0.00           | 1.23                | ≤30.00            | PASS    |
| 11N20SISO | Ant1    | 5785           | 1.38                       | 0.00           | 1.38                | ≤30.00            | PASS    |
| 11N20SISO | Ant1    | 5825           | 0.72                       | 0.00           | 0.72                | ≤30.00            | PASS    |
| 11N40SISO | Ant1    | 5755           | -1.79                      | 0.00           | -1.79               | ≤30.00            | PASS    |
| 11N40SISO | Ant1    | 5795           | -1.66                      | 0.00           | -1.66               | ≤30.00            | PASS    |

Note: 1.The cable loss are compensated in the graph.


## Test Graphs B1/2/3

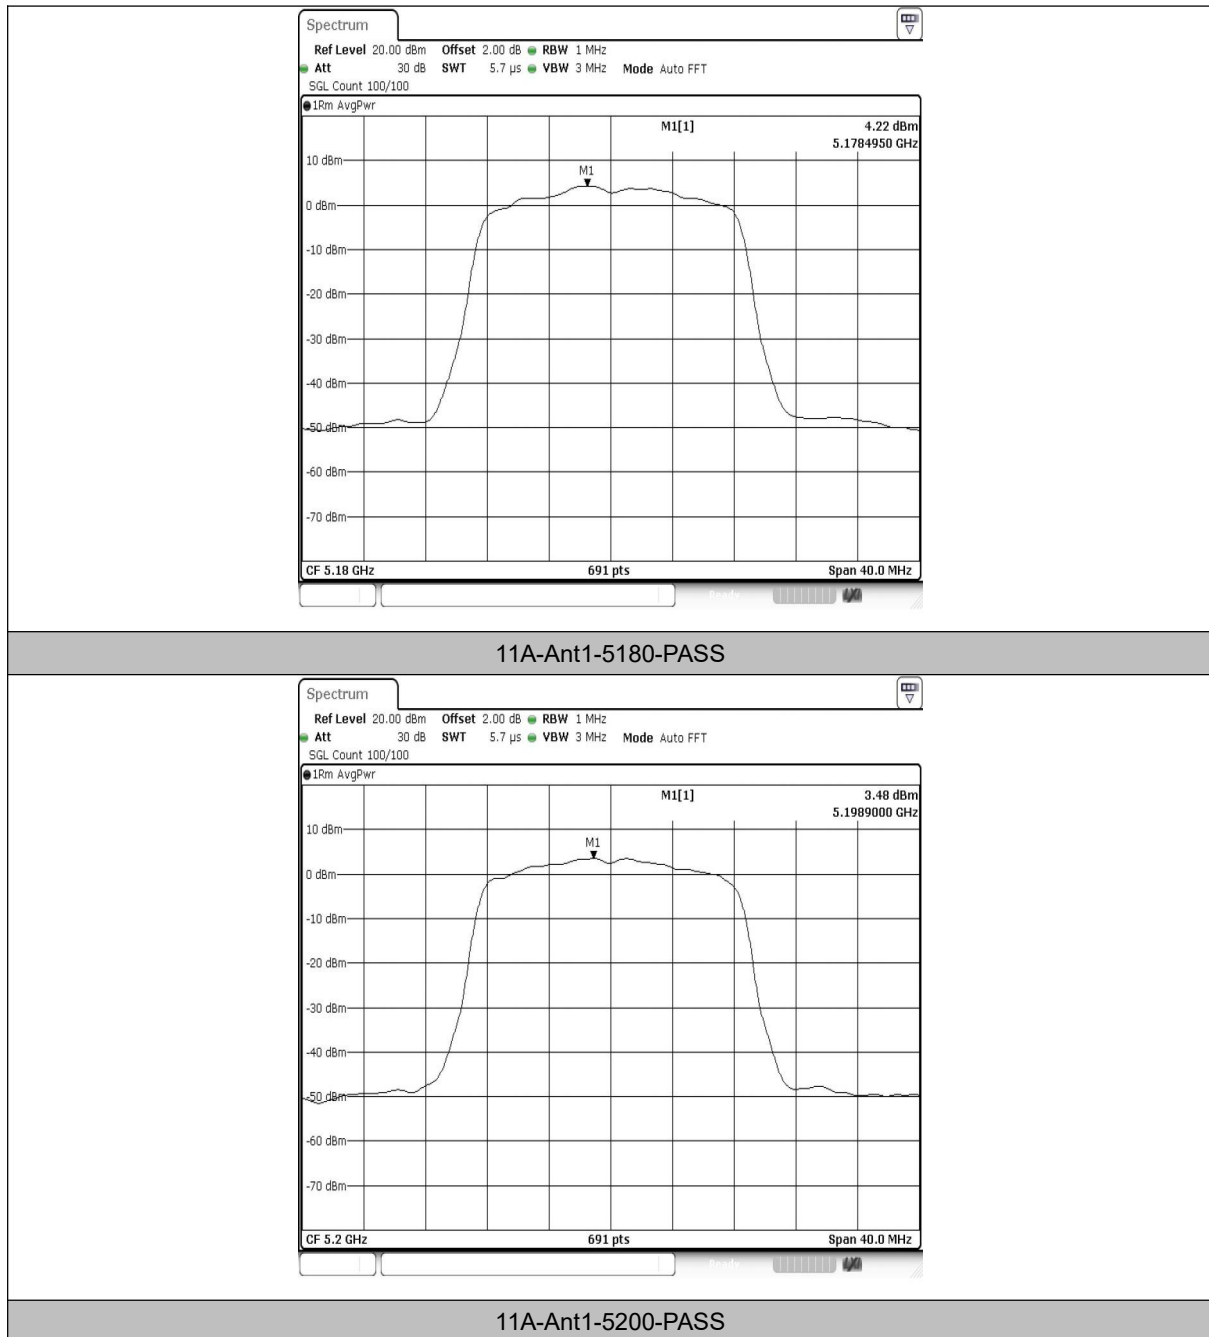


## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

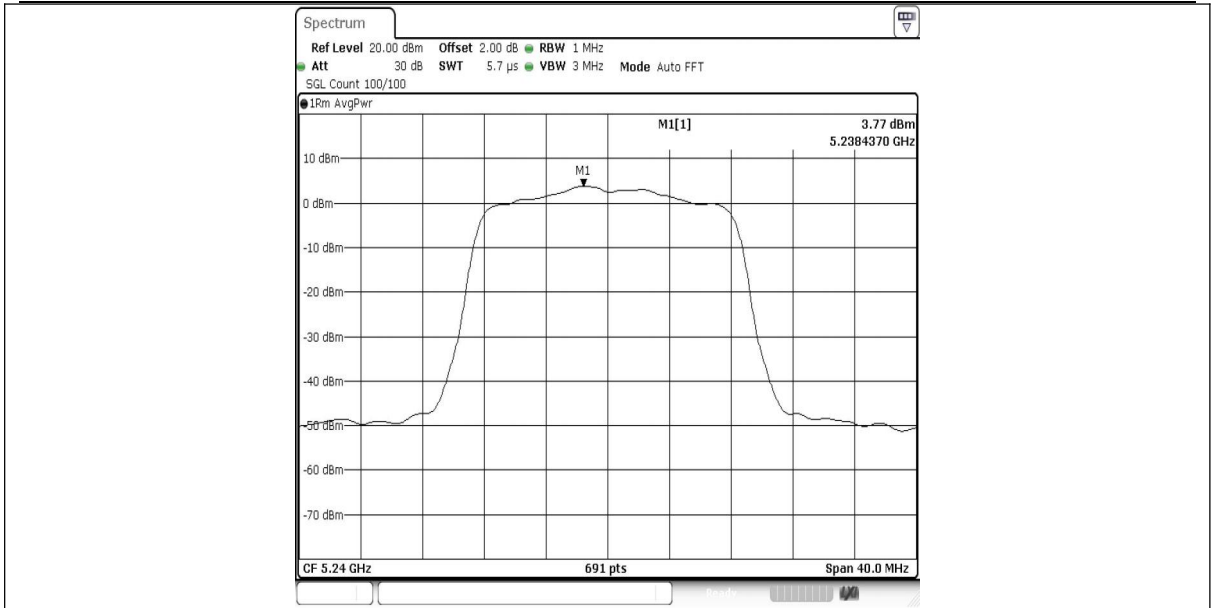

11A-Ant1-5240-PASS

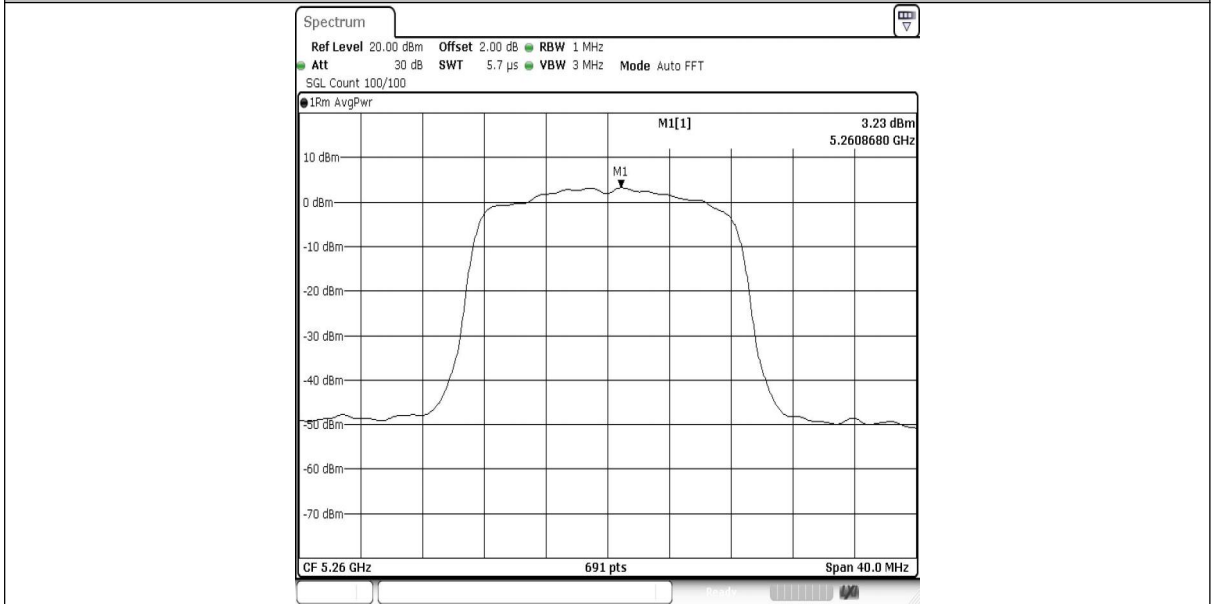


11A-Ant1-5260-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

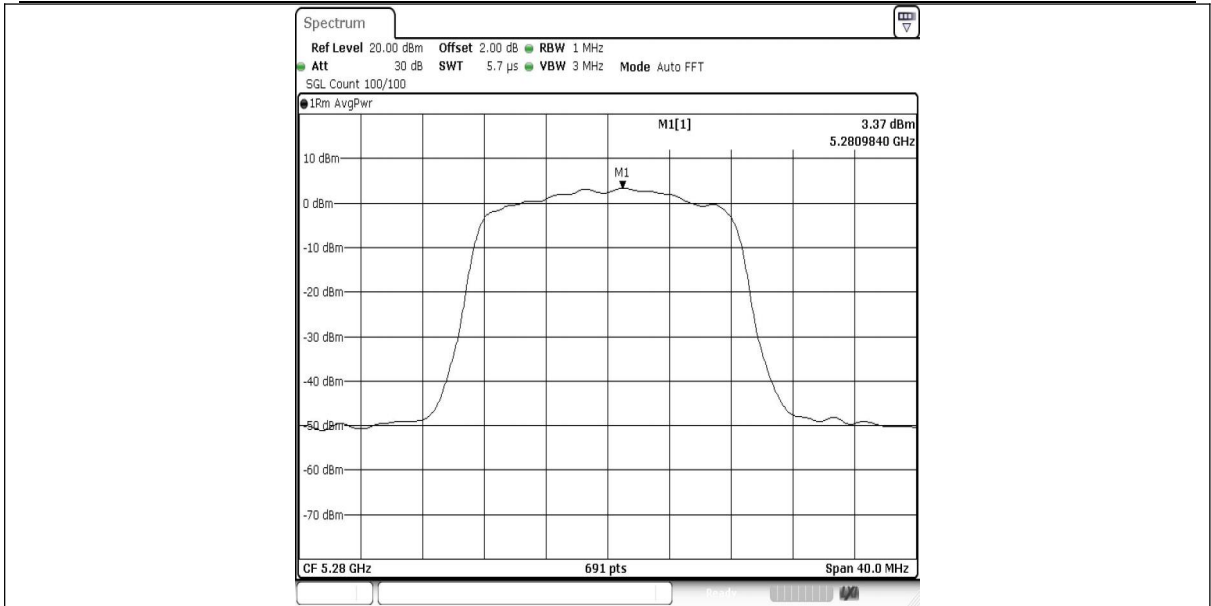

11A-Ant1-5280-PASS

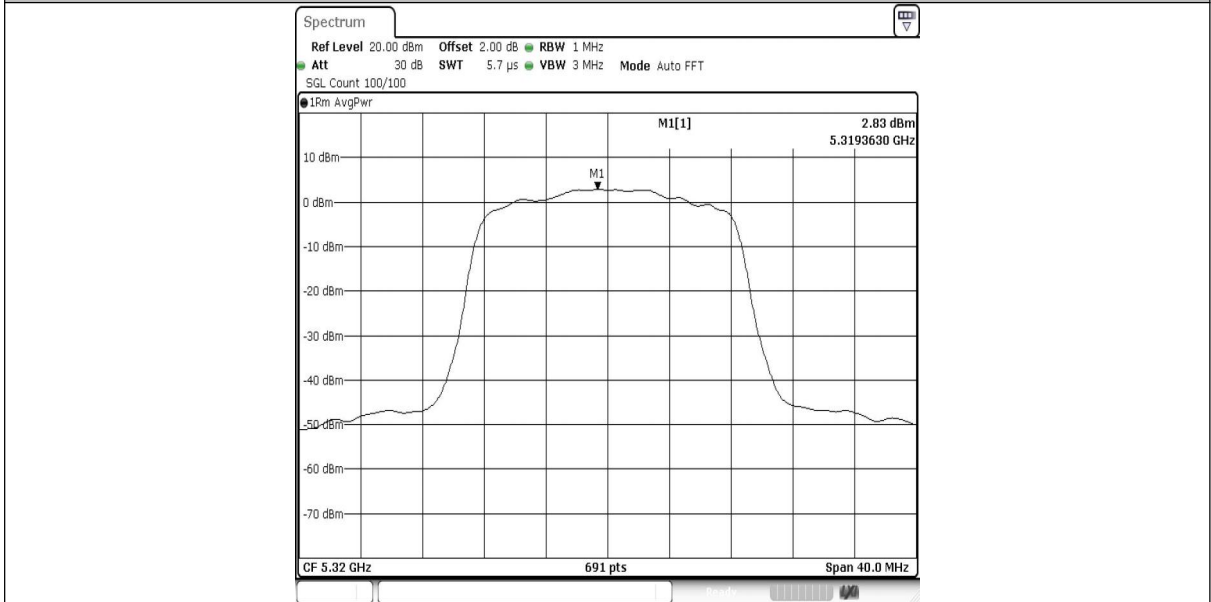


11A-Ant1-5320-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

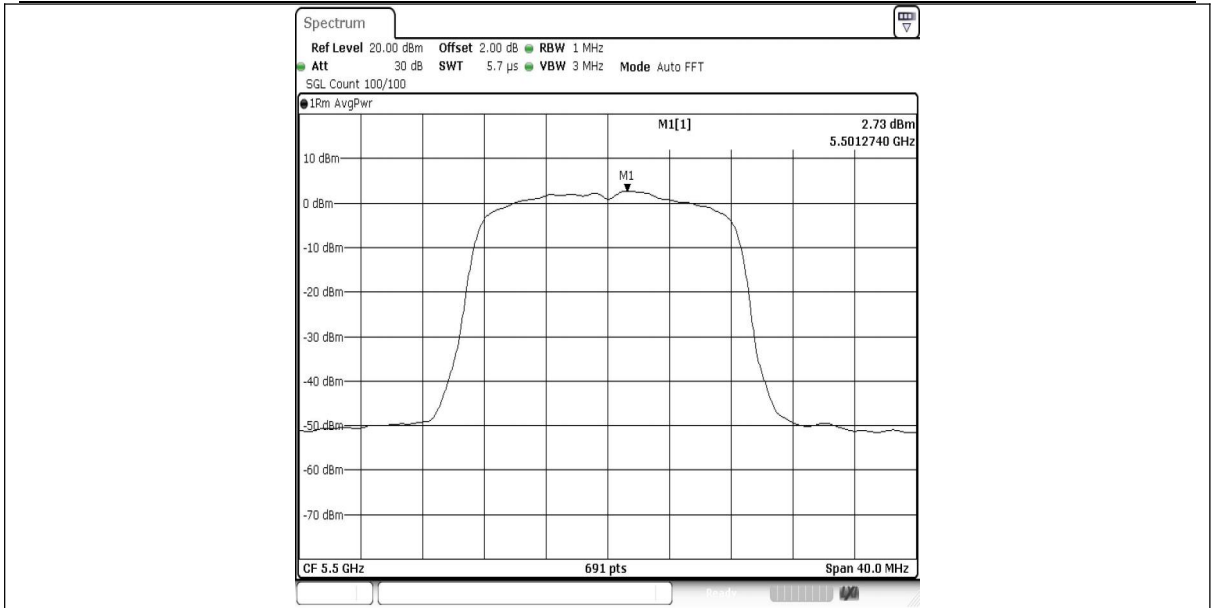

11A-Ant1-5500-PASS

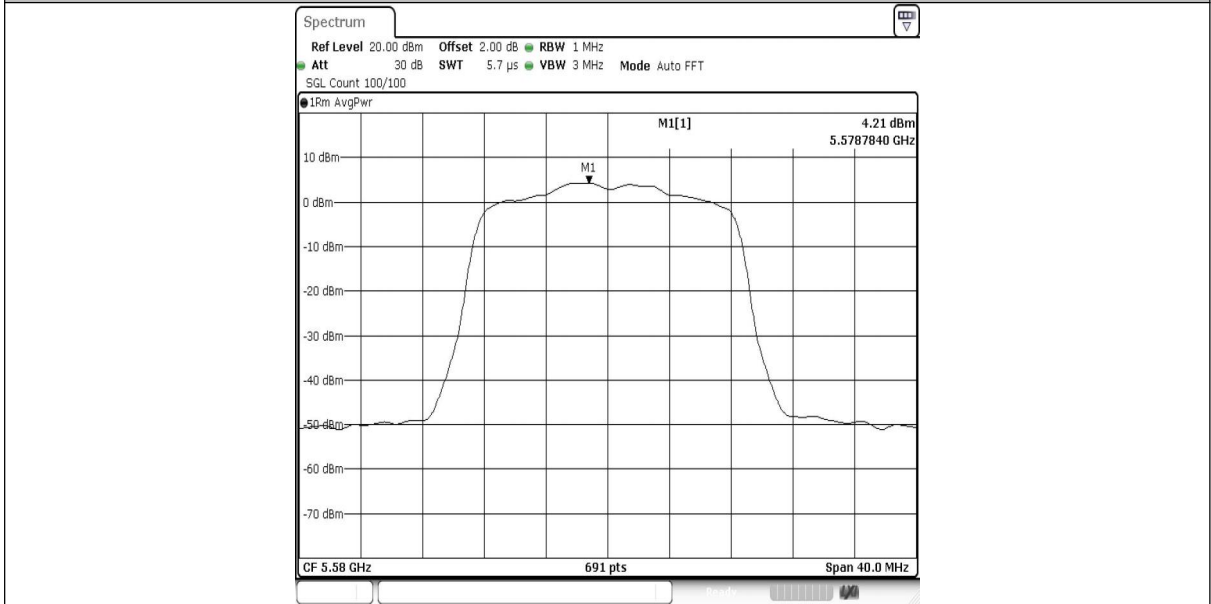


11A-Ant1-5580-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

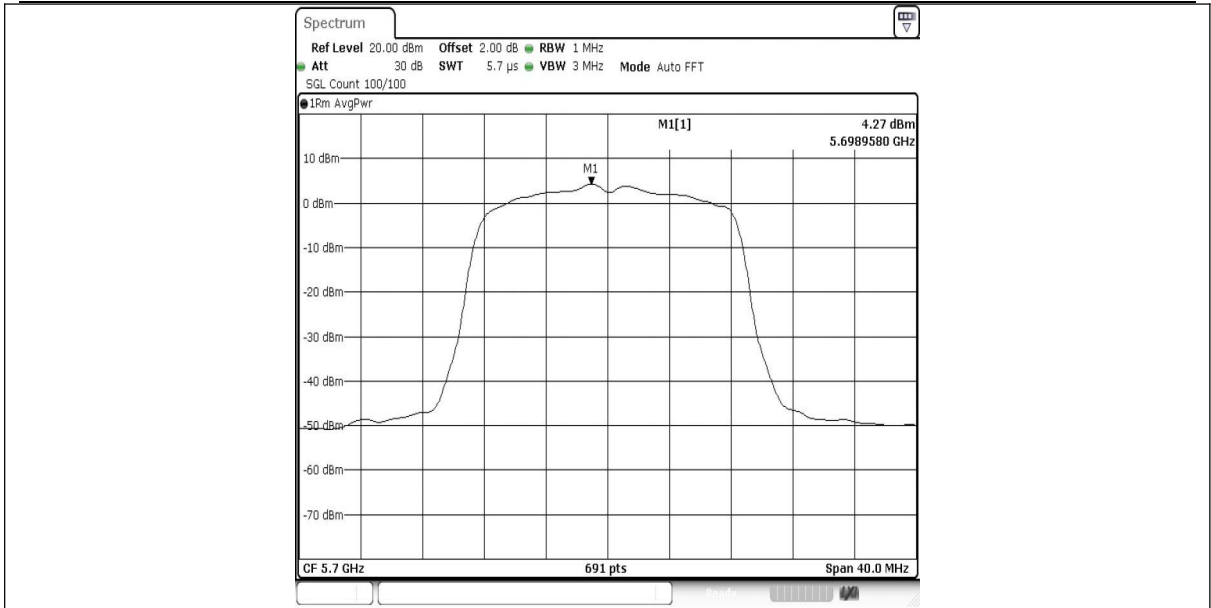

11A-Ant1-5700-PASS

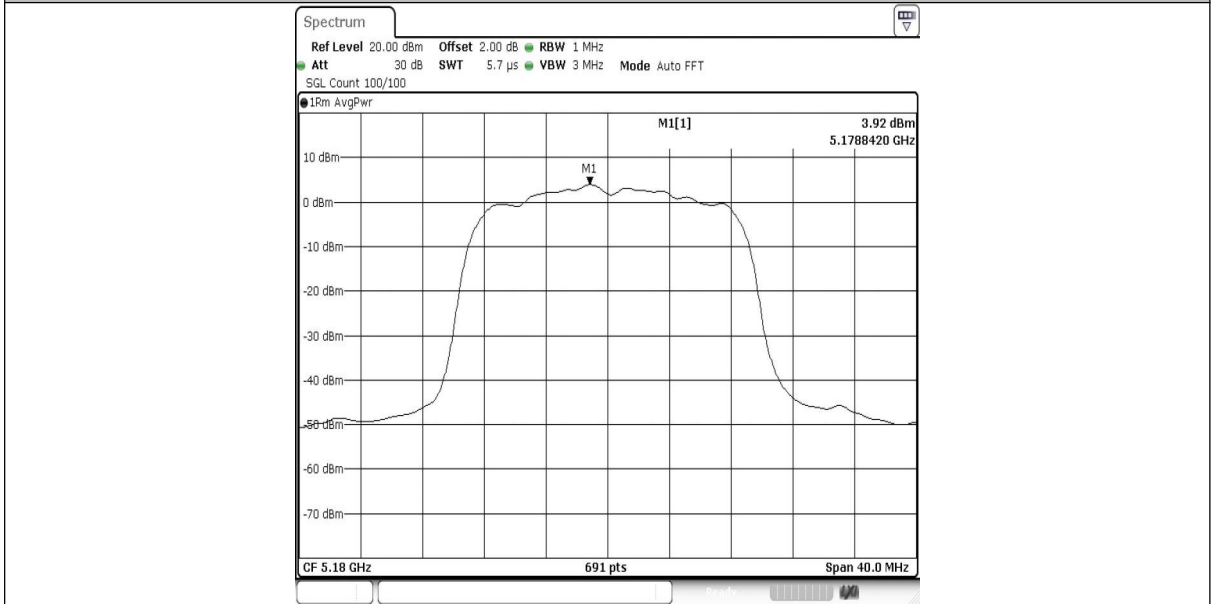


11N20SISO-Ant1-5180-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

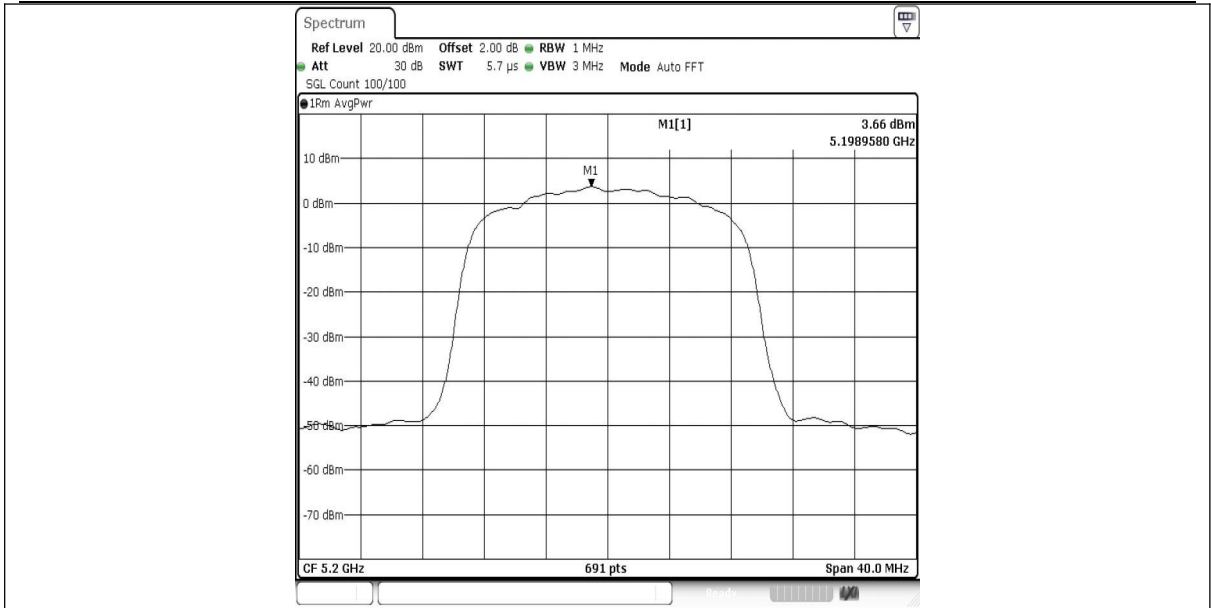

11N20SISO-Ant1-5200-PASS

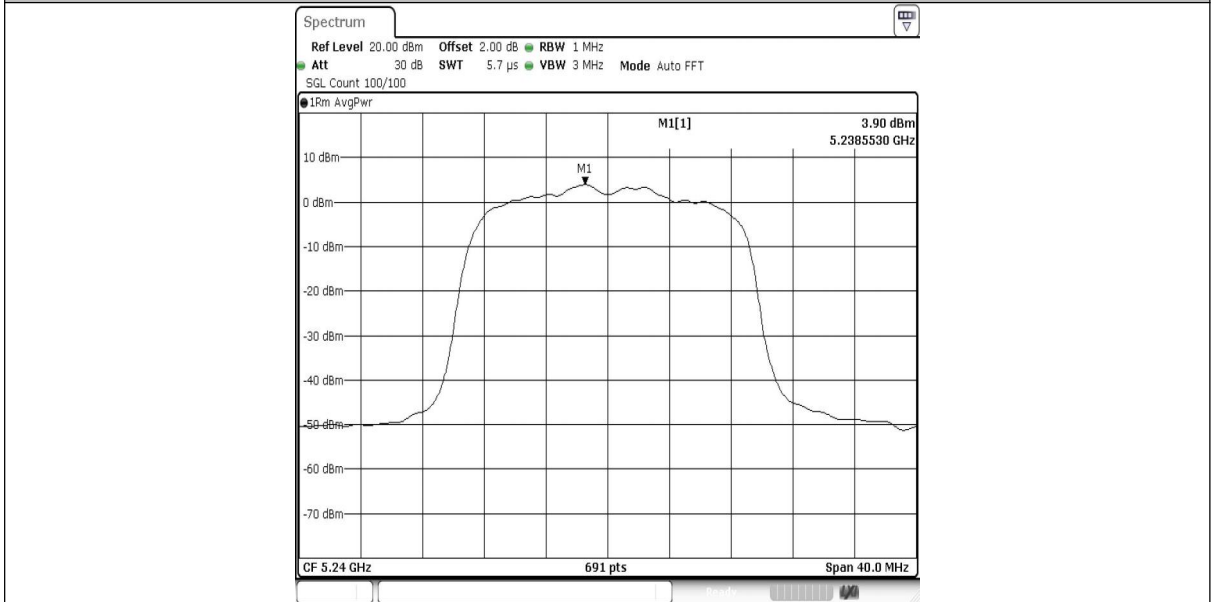


11N20SISO-Ant1-5240-PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

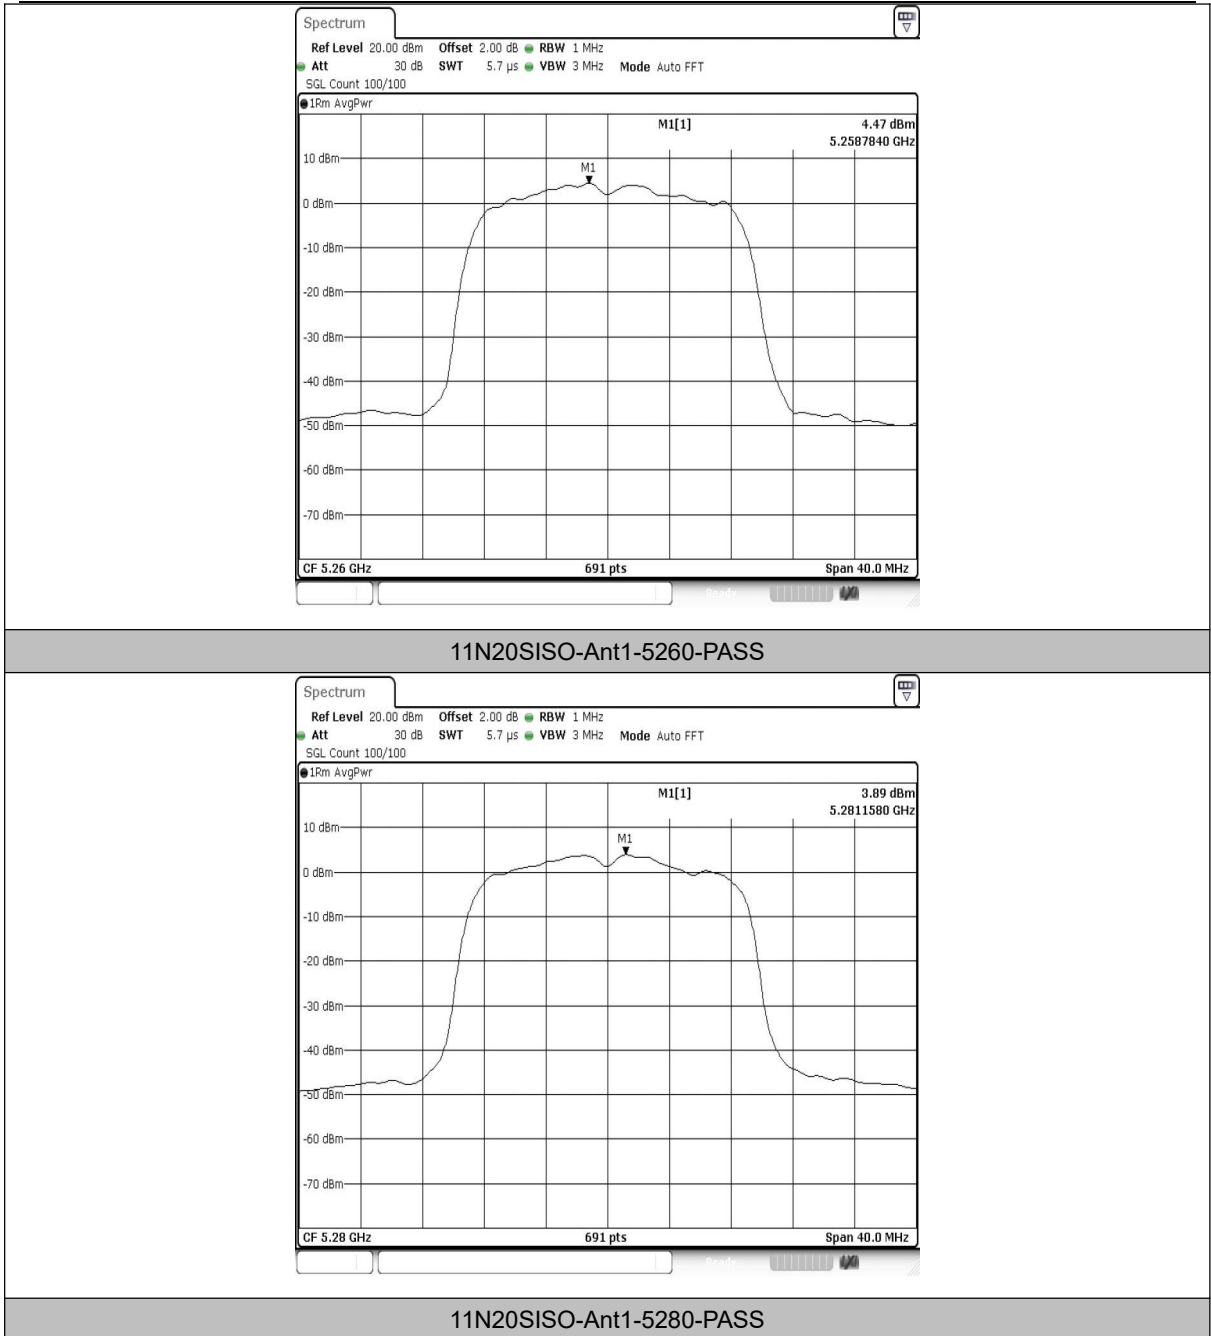


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

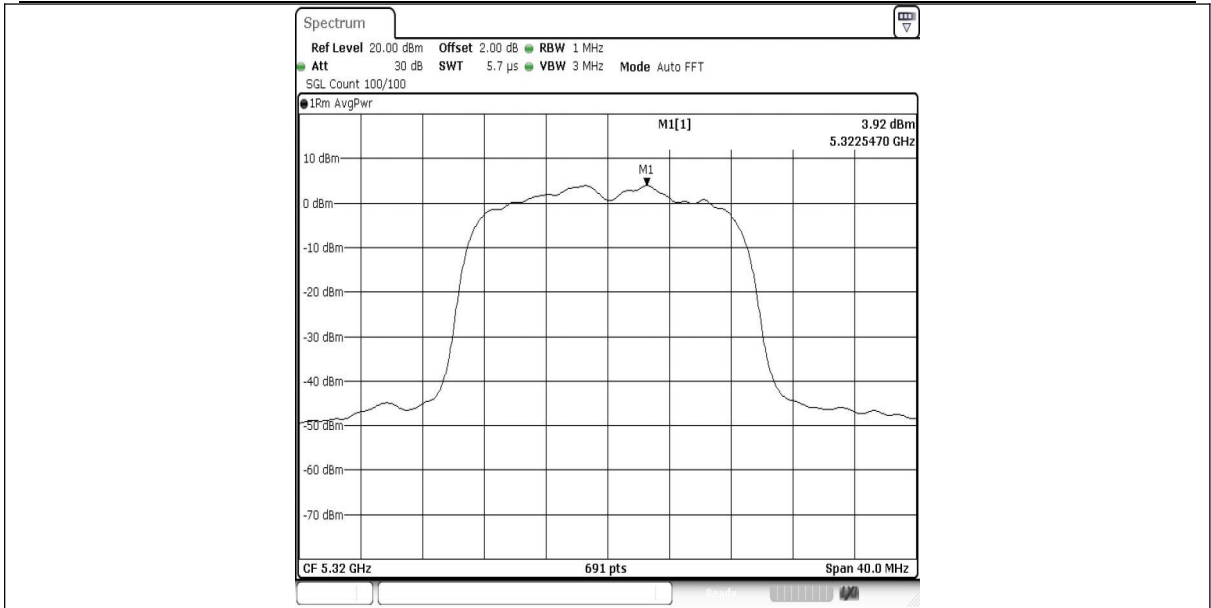

11N20SISO-Ant1-5320-PASS

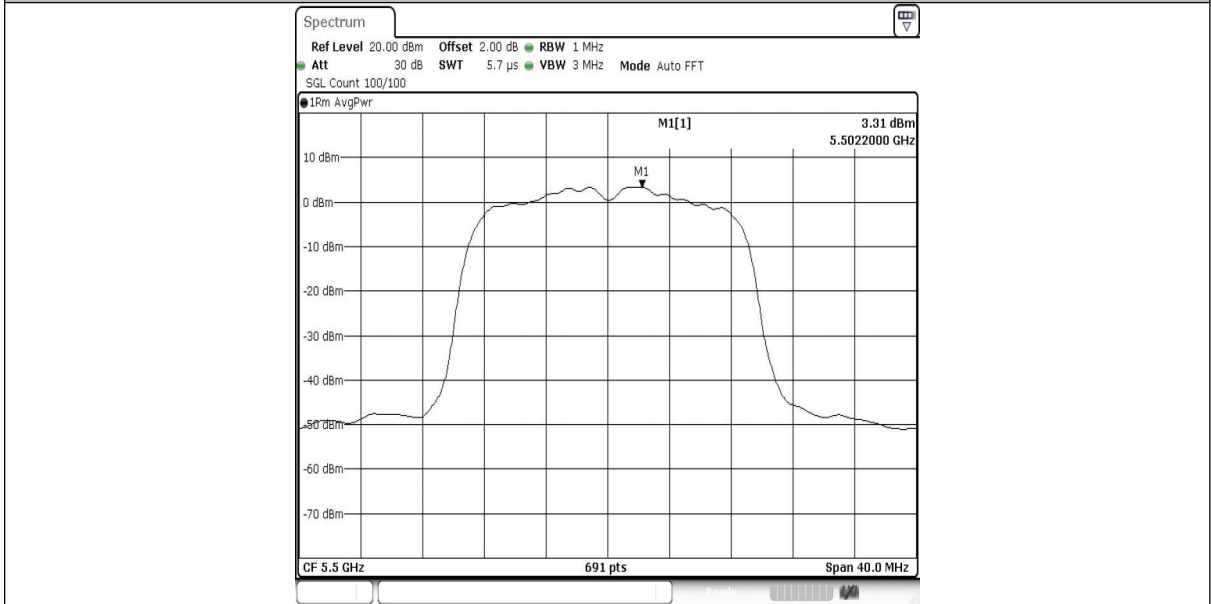


11N20SISO-Ant1-5500-PASS

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

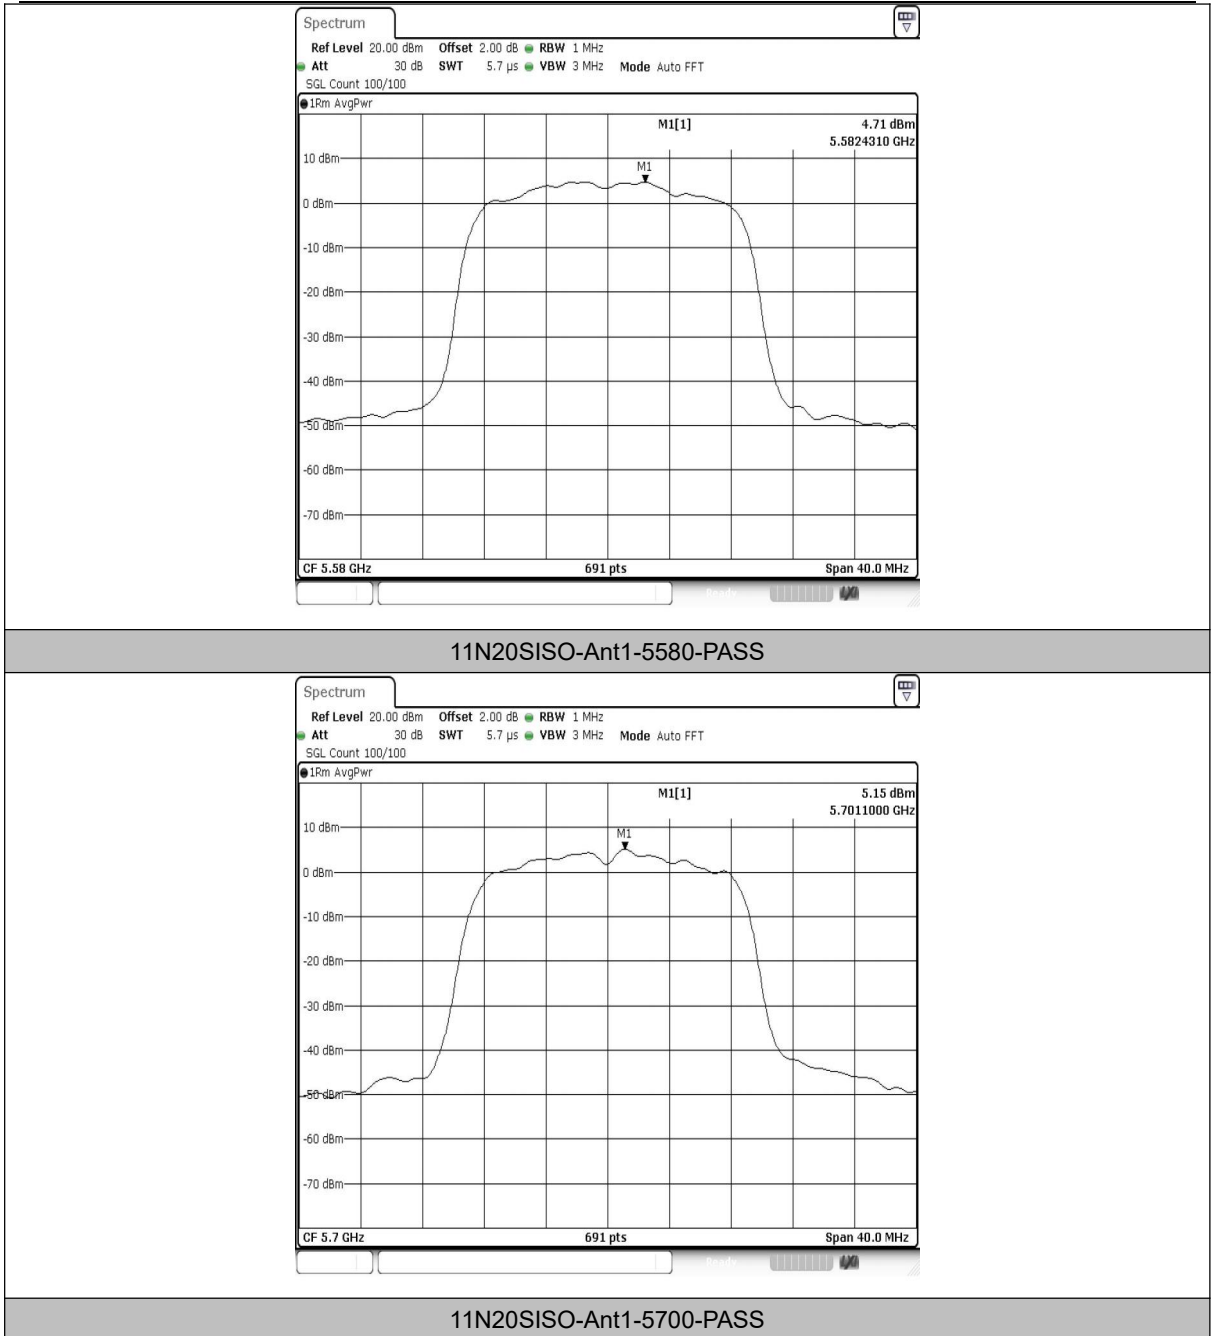


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

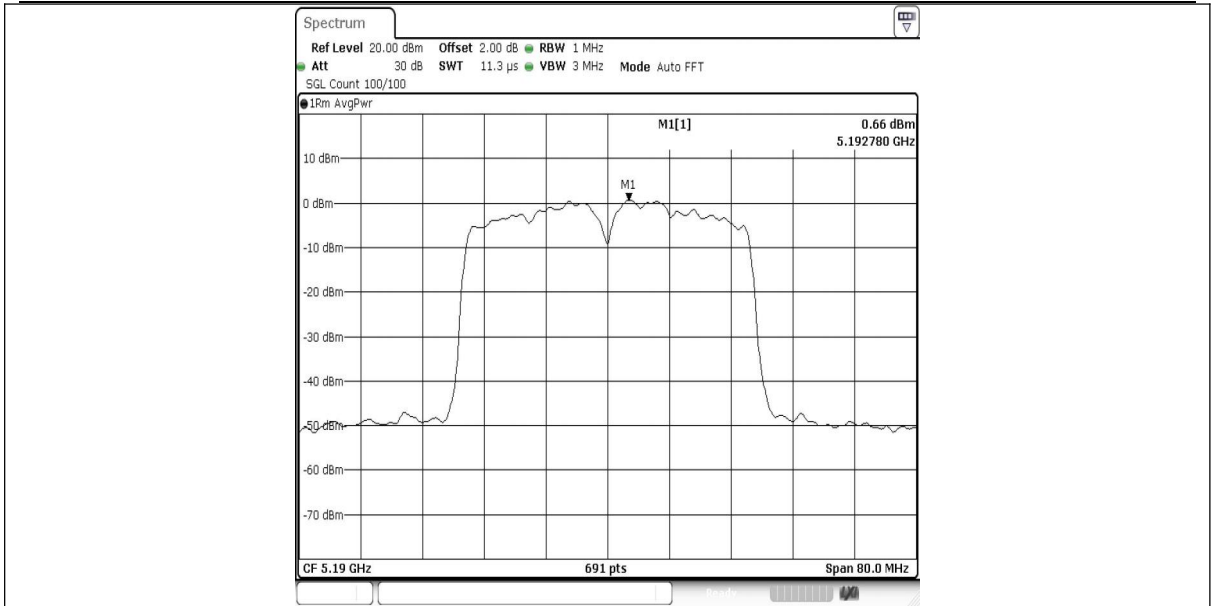

11N40SISO-Ant1-5190-PASS

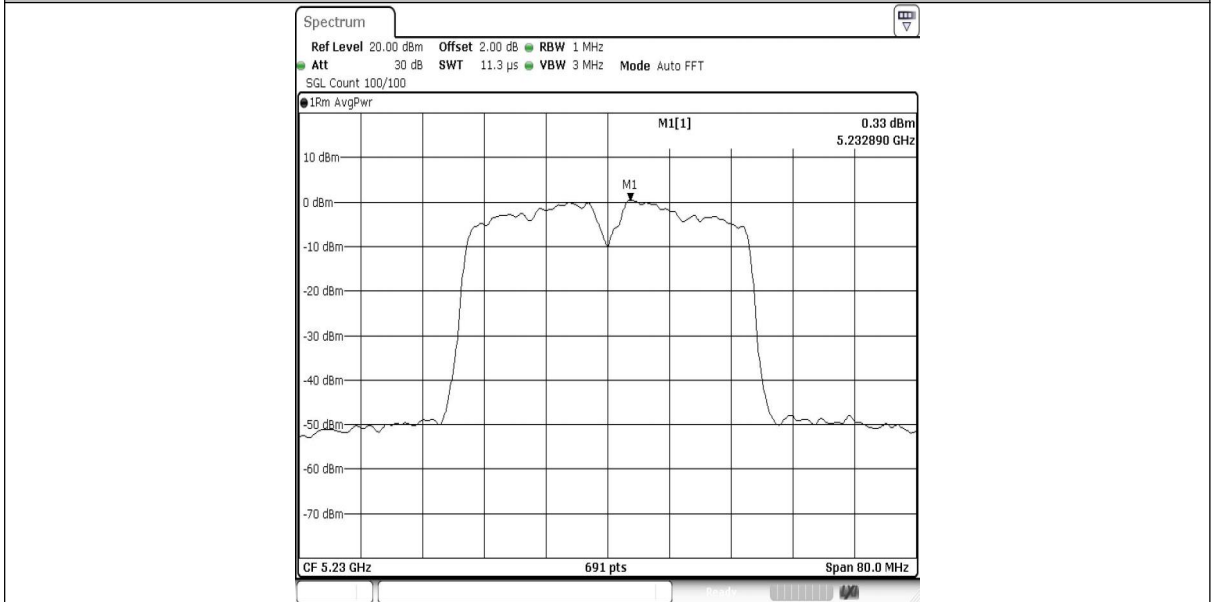


11N40SISO-Ant1-5230-PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

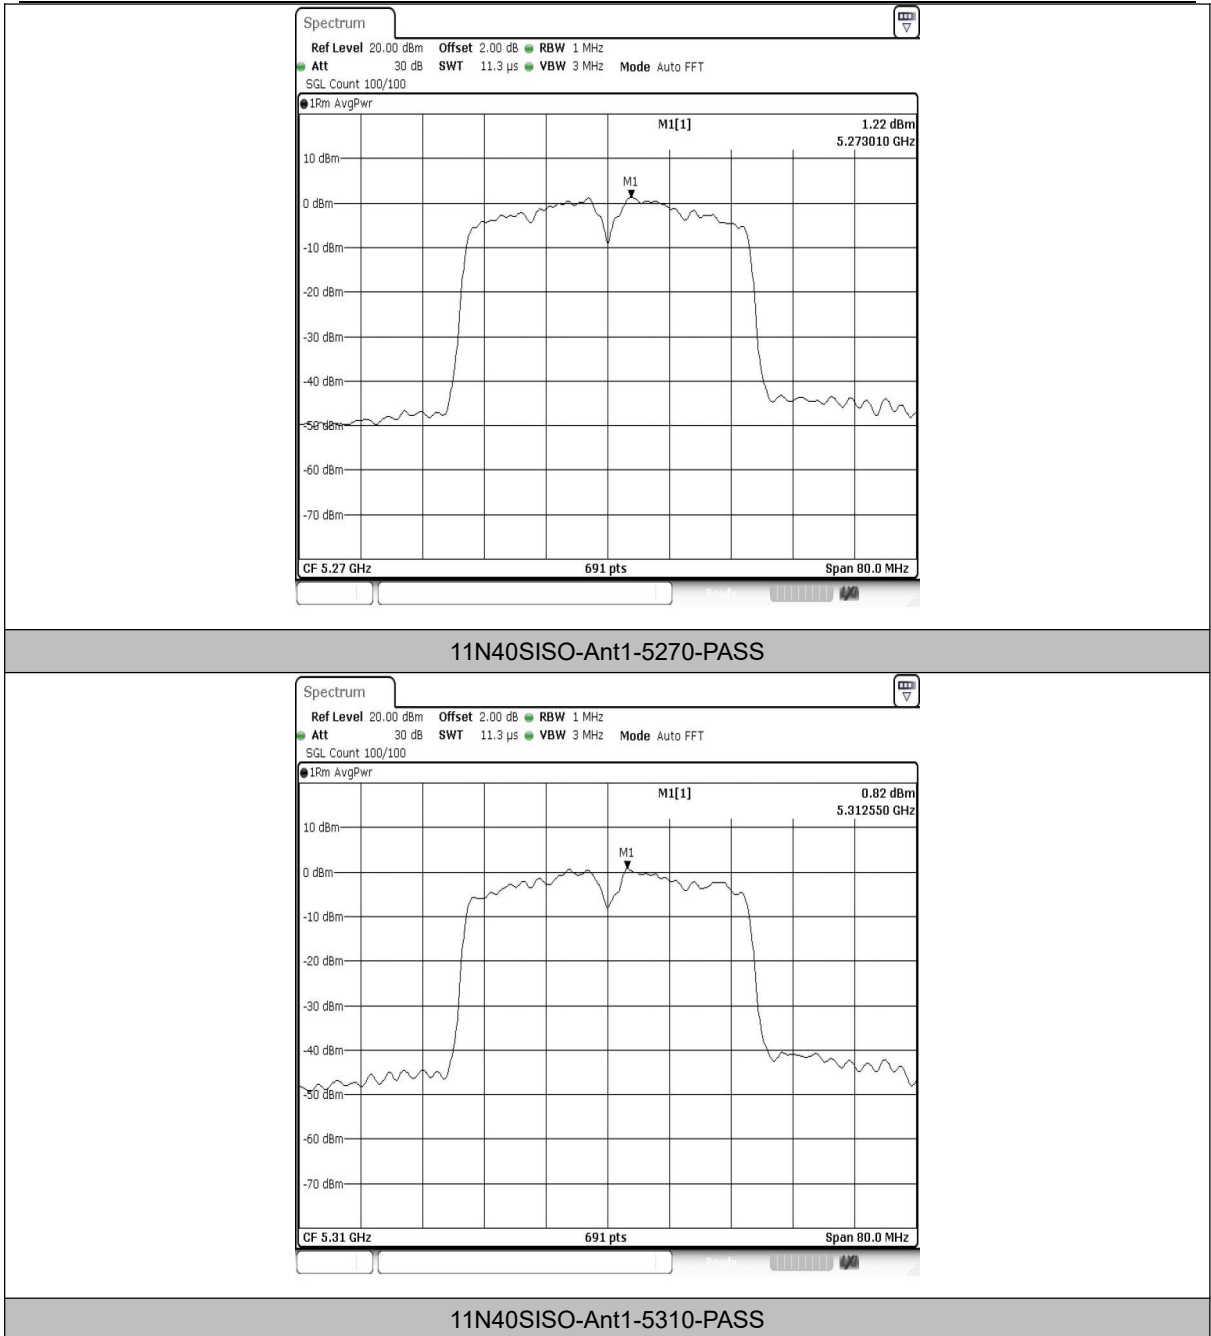

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

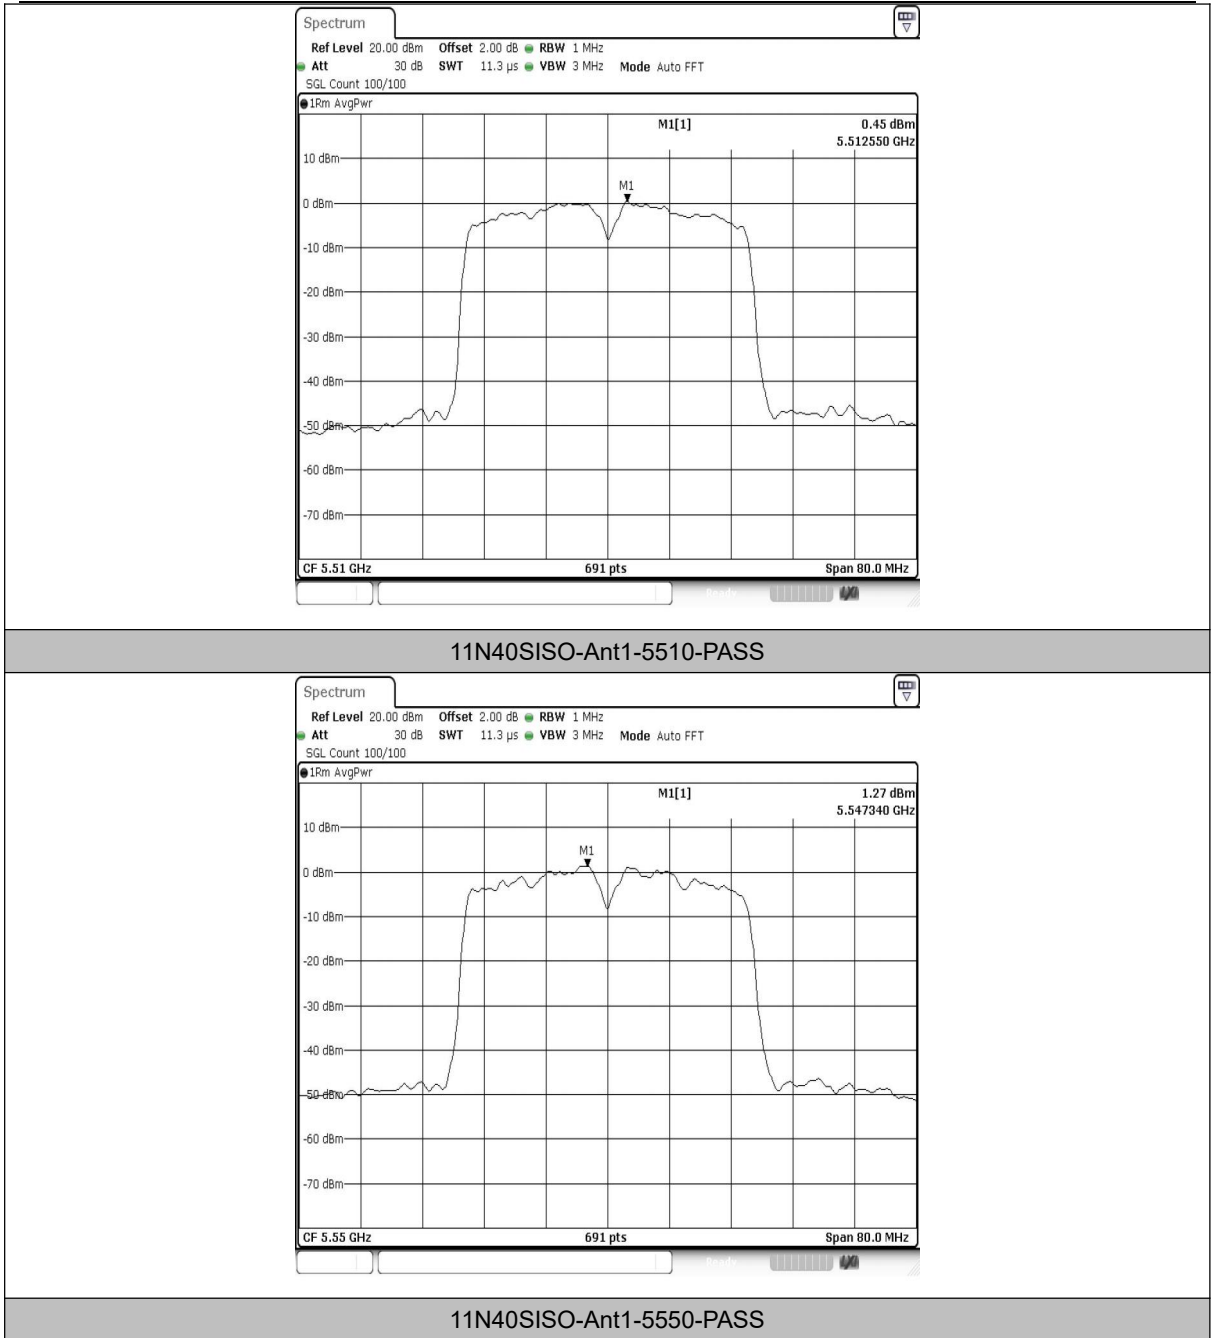

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

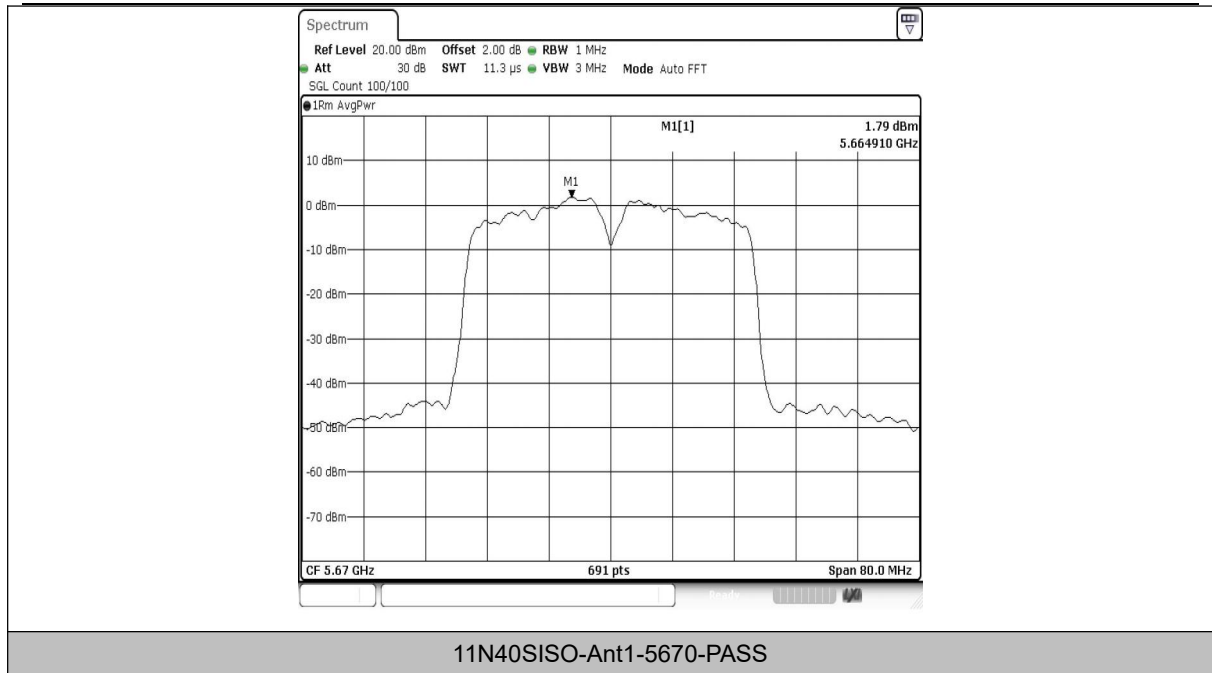


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs B4

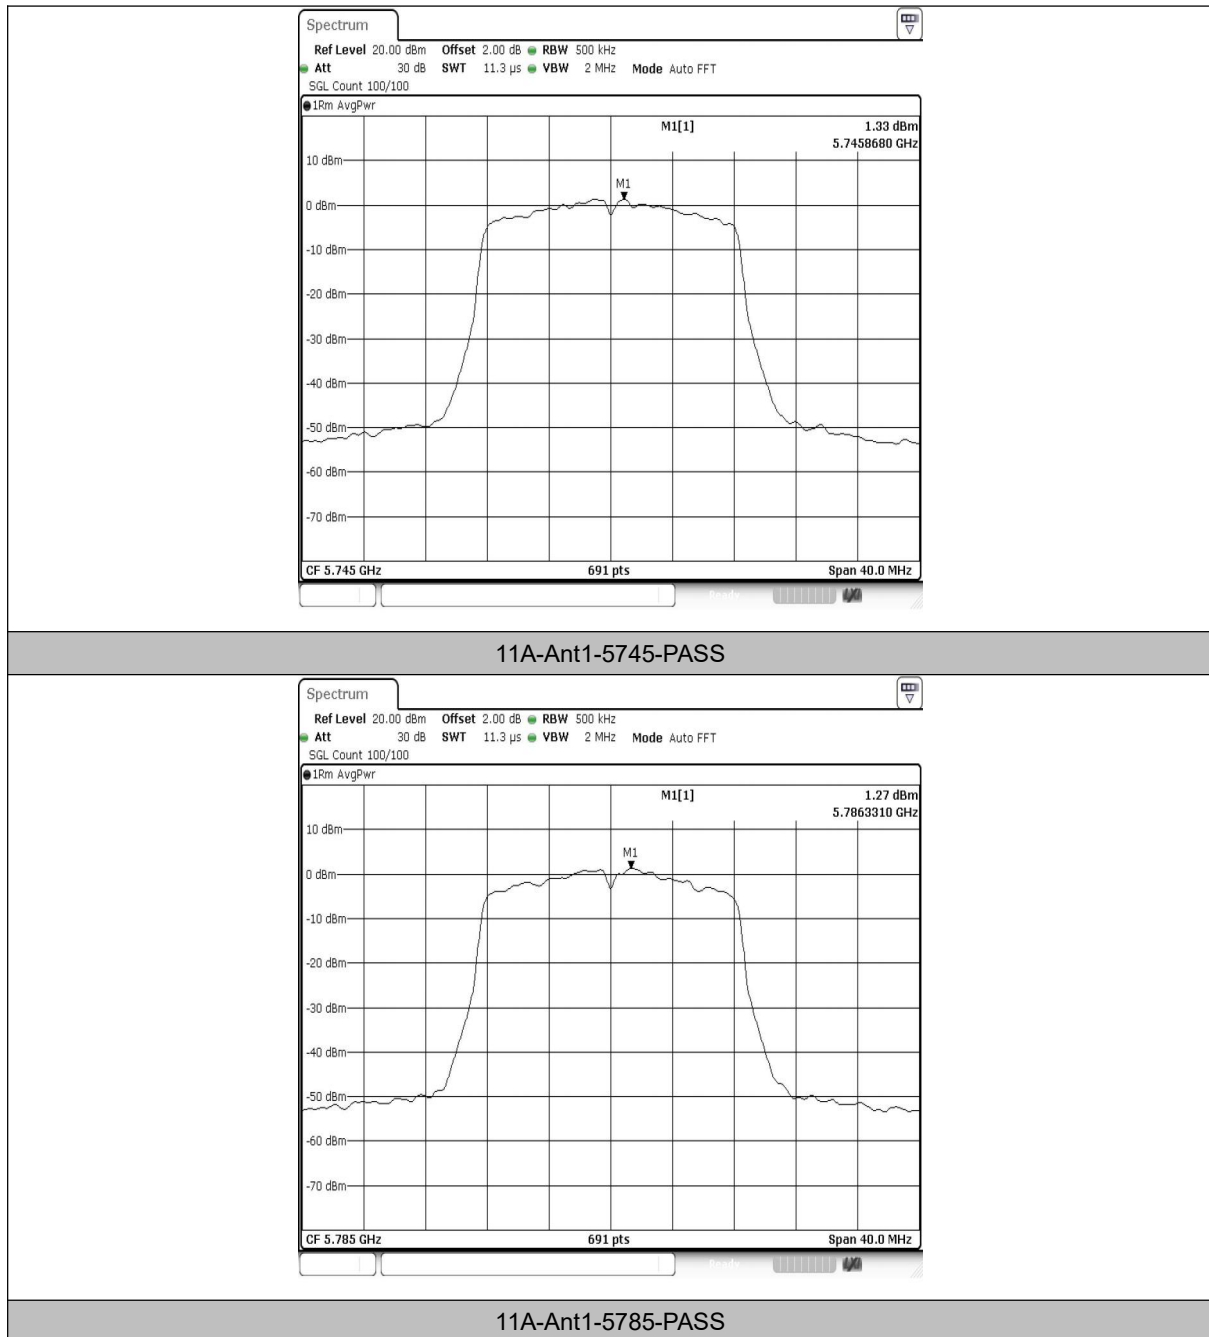


## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

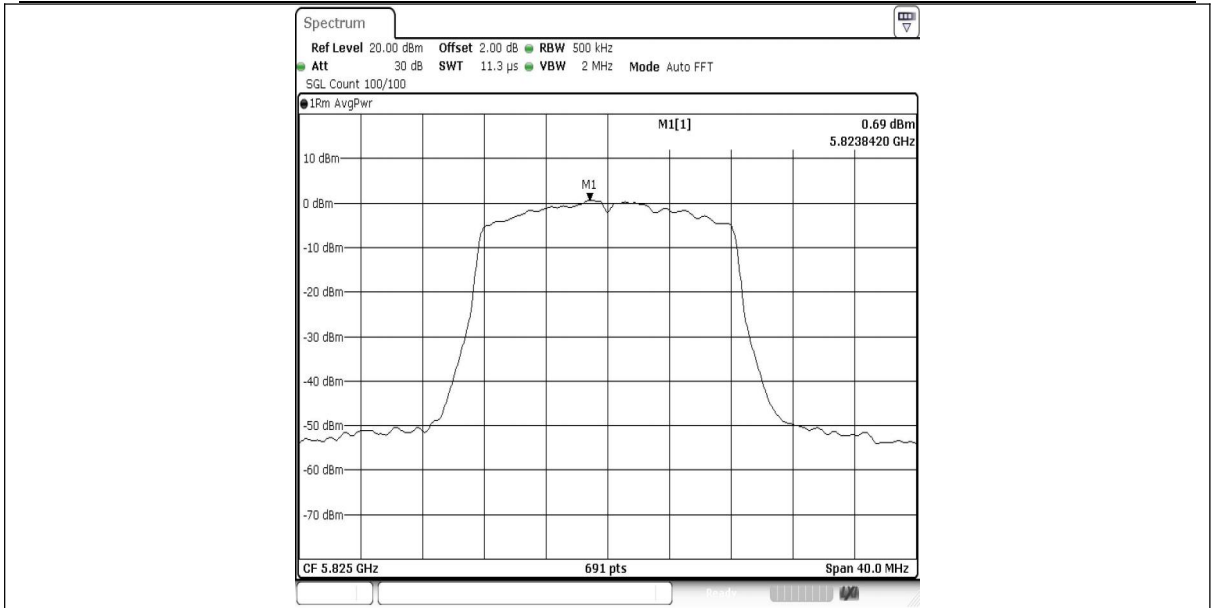

11A-Ant1-5825-PASS

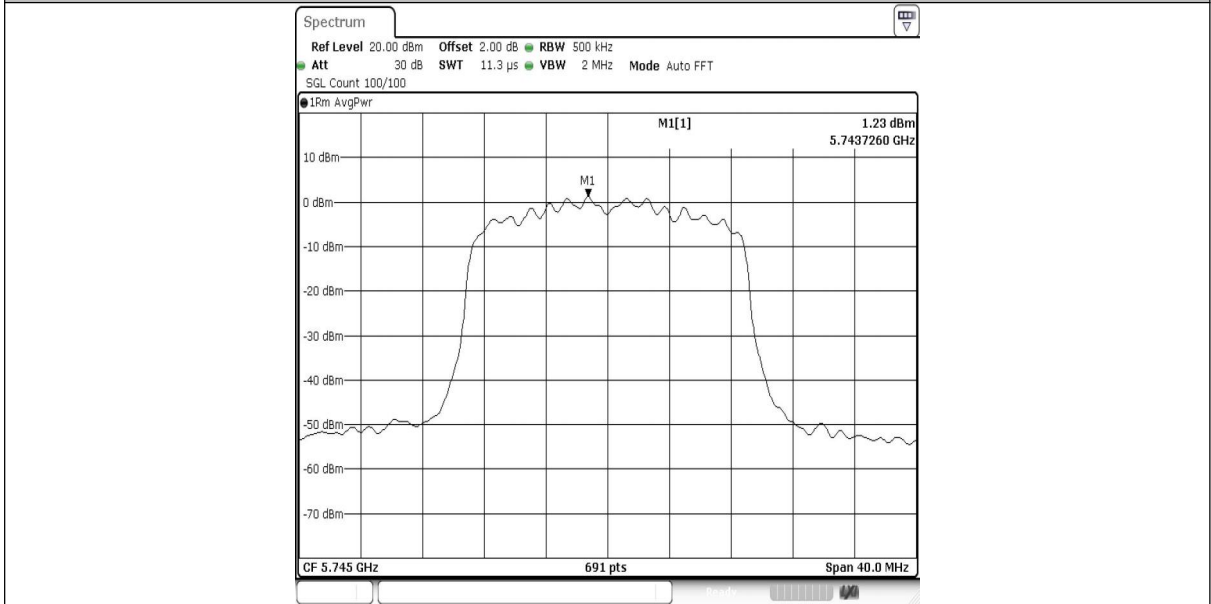


11N20SISO-Ant1-5745-PASS

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

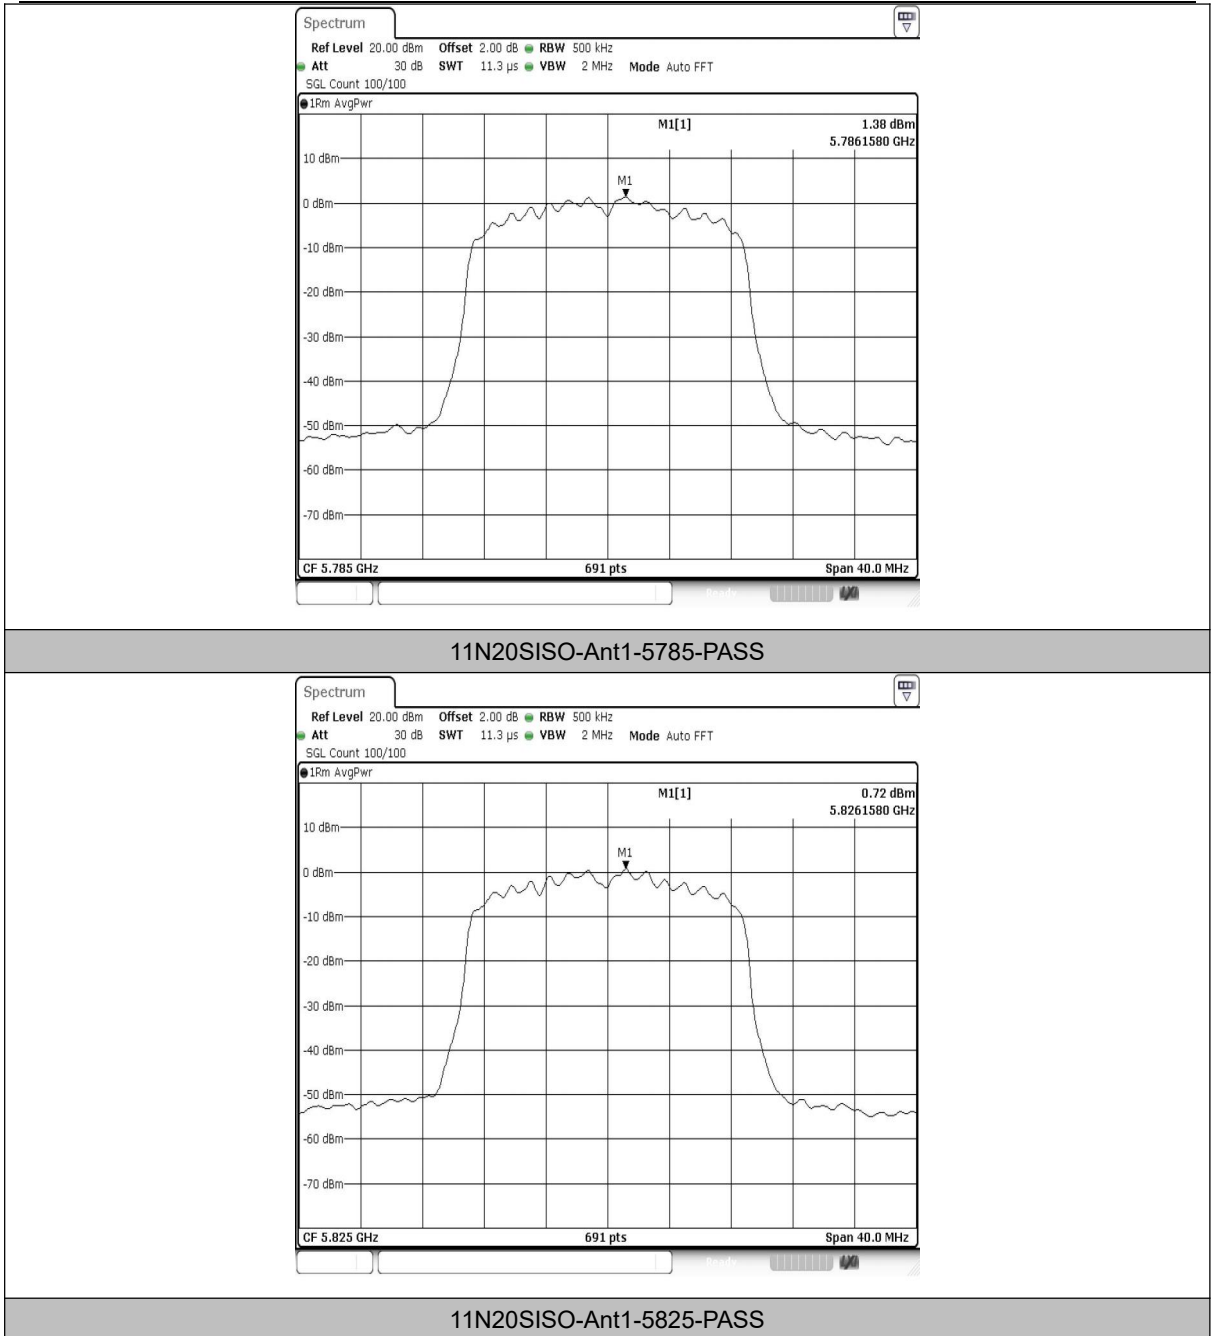


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

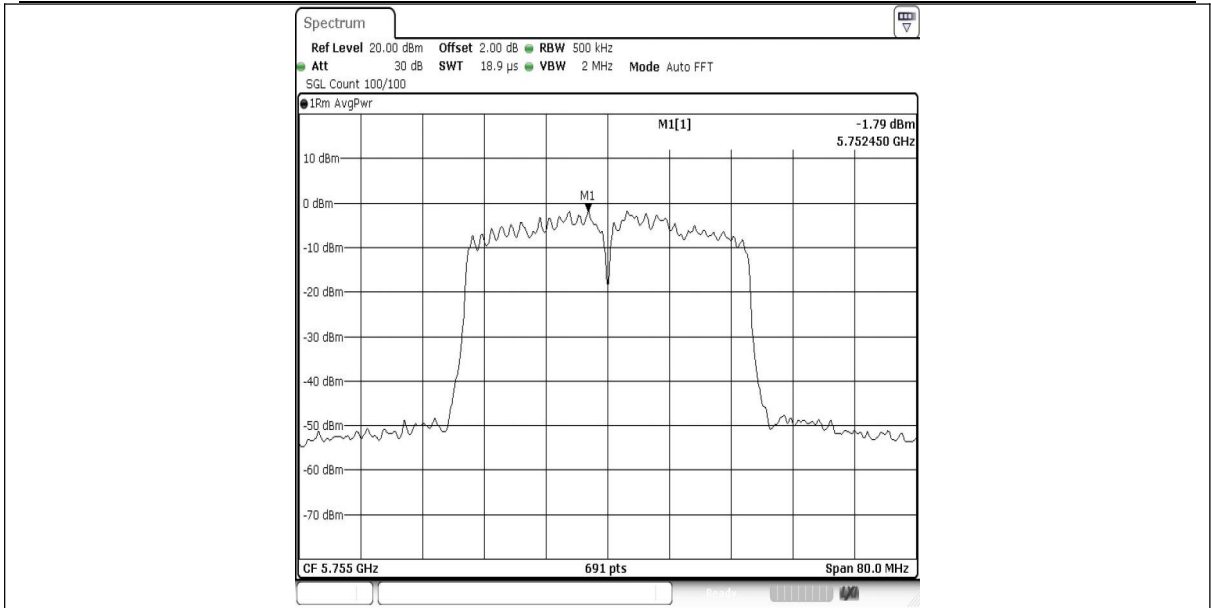

11N40SISO-Ant1-5755-PASS

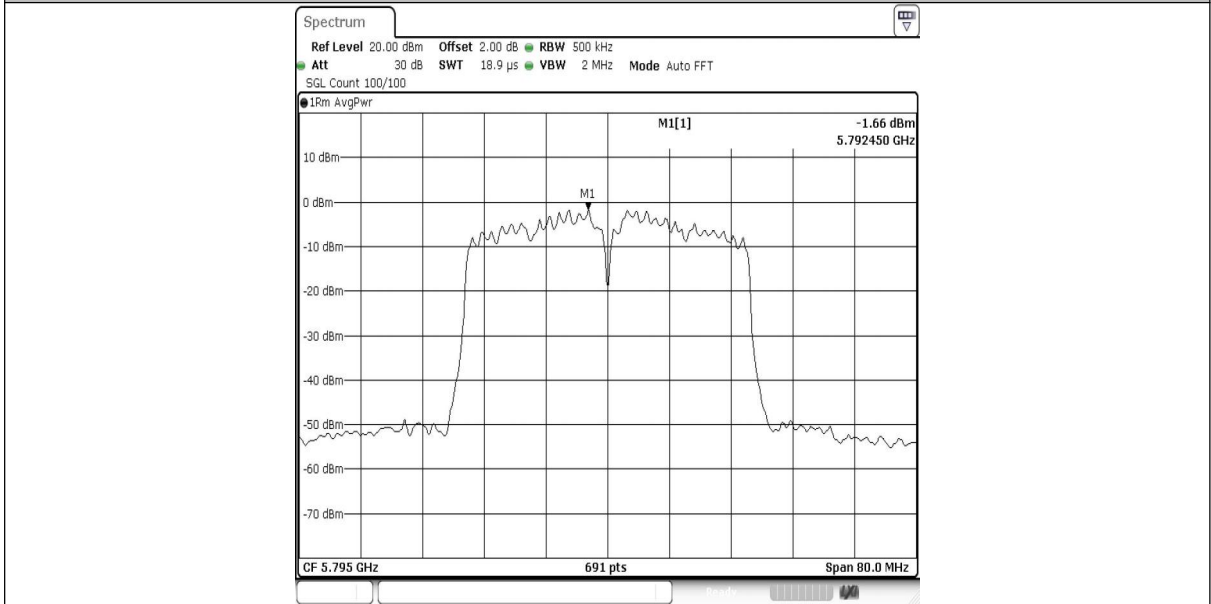

11N40SISO-Ant1-5795-PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix E: Band edge measurements

### Test Result B1/2/3

| Test Mode | Antenna | ChName | Frequency[MHz] | Result[dBm] | Limit[dBm] | Verdict |
|-----------|---------|--------|----------------|-------------|------------|---------|
| 11A       | Ant1    | Low    | 5180           | -38.1       | $\leq -27$ | PASS    |
| 11A       | Ant1    | High   | 5240           | -46.7       | $\leq -27$ | PASS    |
| 11A       | Ant1    | High   | 5320           | -42.59      | $\leq -27$ | PASS    |
| 11A       | Ant1    | Low    | 5500           | -41.87      | $\leq -27$ | PASS    |
| 11A       | Ant1    | High   | 5700           | -41.62      | $\leq -27$ | PASS    |
| 11N20SISO | Ant1    | Low    | 5180           | -37.95      | $\leq -27$ | PASS    |
| 11N20SISO | Ant1    | High   | 5240           | -46.66      | $\leq -27$ | PASS    |
| 11N20SISO | Ant1    | High   | 5320           | -41.93      | $\leq -27$ | PASS    |
| 11N20SISO | Ant1    | Low    | 5500           | -39.3       | $\leq -27$ | PASS    |
| 11N20SISO | Ant1    | High   | 5700           | -40.68      | $\leq -27$ | PASS    |
| 11N40SISO | Ant1    | Low    | 5190           | -37.52      | $\leq -27$ | PASS    |
| 11N40SISO | Ant1    | High   | 5230           | -46.15      | $\leq -27$ | PASS    |
| 11N40SISO | Ant1    | High   | 5310           | -32.42      | $\leq -27$ | PASS    |
| 11N40SISO | Ant1    | Low    | 5510           | -39.98      | $\leq -27$ | PASS    |
| 11N40SISO | Ant1    | High   | 5670           | -40.63      | $\leq -27$ | PASS    |


Note: The margin plus the antenna gain also meets the limit.


## Test Result B4

| Test Mode | Antenna | Ch. Name | Frequency[MHz] | FreqRange [MHz] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|----------|----------------|-----------------|--------------|-------------|---------|
| 11A       | Ant1    | Low      | 5745           | 5720~5725       | -46.48       | ≤15.98      | PASS    |
| 11A       | Ant1    | Low      | 5745           | 5700~5720       | -43.5        | ≤12.33      | PASS    |
| 11A       | Ant1    | Low      | 5745           | 5650~5700       | -48.6        | ≤-25.52     | PASS    |
| 11A       | Ant1    | Low      | 5745           | 5760~5650       | -48.79       | ≤-27        | PASS    |
| 11A       | Ant1    | High     | 5825           | 5850~5855       | -46.81       | ≤16.10      | PASS    |
| 11A       | Ant1    | High     | 5825           | 5855~5875       | -45.71       | ≤11.39      | PASS    |
| 11A       | Ant1    | High     | 5825           | 5875~5925       | -45.72       | ≤-26.73     | PASS    |
| 11A       | Ant1    | High     | 5825           | 5925~5935       | -46.88       | ≤-27        | PASS    |
| 11N20SISO | Ant1    | Low      | 5745           | 5720~5725       | -41.13       | ≤15.98      | PASS    |
| 11N20SISO | Ant1    | Low      | 5745           | 5700~5720       | -41.18       | ≤12.85      | PASS    |
| 11N20SISO | Ant1    | Low      | 5745           | 5650~5700       | -50.27       | ≤-26.63     | PASS    |
| 11N20SISO | Ant1    | Low      | 5745           | 5760~5650       | -48.44       | ≤-27        | PASS    |
| 11N20SISO | Ant1    | High     | 5825           | 5850~5855       | -46.51       | ≤15.65      | PASS    |
| 11N20SISO | Ant1    | High     | 5825           | 5855~5875       | -47.48       | ≤10.79      | PASS    |
| 11N20SISO | Ant1    | High     | 5825           | 5875~5925       | -48.62       | ≤-26.87     | PASS    |
| 11N20SISO | Ant1    | High     | 5825           | 5925~5935       | -48.09       | ≤-27        | PASS    |
| 11N40SISO | Ant1    | Low      | 5755           | 5720~5725       | -39.01       | ≤15.90      | PASS    |
| 11N40SISO | Ant1    | Low      | 5755           | 5700~5720       | -38.18       | ≤14.92      | PASS    |
| 11N40SISO | Ant1    | Low      | 5755           | 5650~5700       | -48.39       | ≤-26.94     | PASS    |
| 11N40SISO | Ant1    | Low      | 5755           | 5780~5650       | -45.64       | ≤-27        | PASS    |
| 11N40SISO | Ant1    | High     | 5795           | 5850~5855       | -47.94       | ≤16.39      | PASS    |
| 11N40SISO | Ant1    | High     | 5795           | 5855~5875       | -46.55       | ≤10.94      | PASS    |
| 11N40SISO | Ant1    | High     | 5795           | 5875~5925       | -47          | ≤-26.44     | PASS    |
| 11N40SISO | Ant1    | High     | 5795           | 5925~5935       | -48.21       | ≤-27        | PASS    |

Note: The margin plus the antenna gain also meets the limit.

## Test Graphs B1/2/3

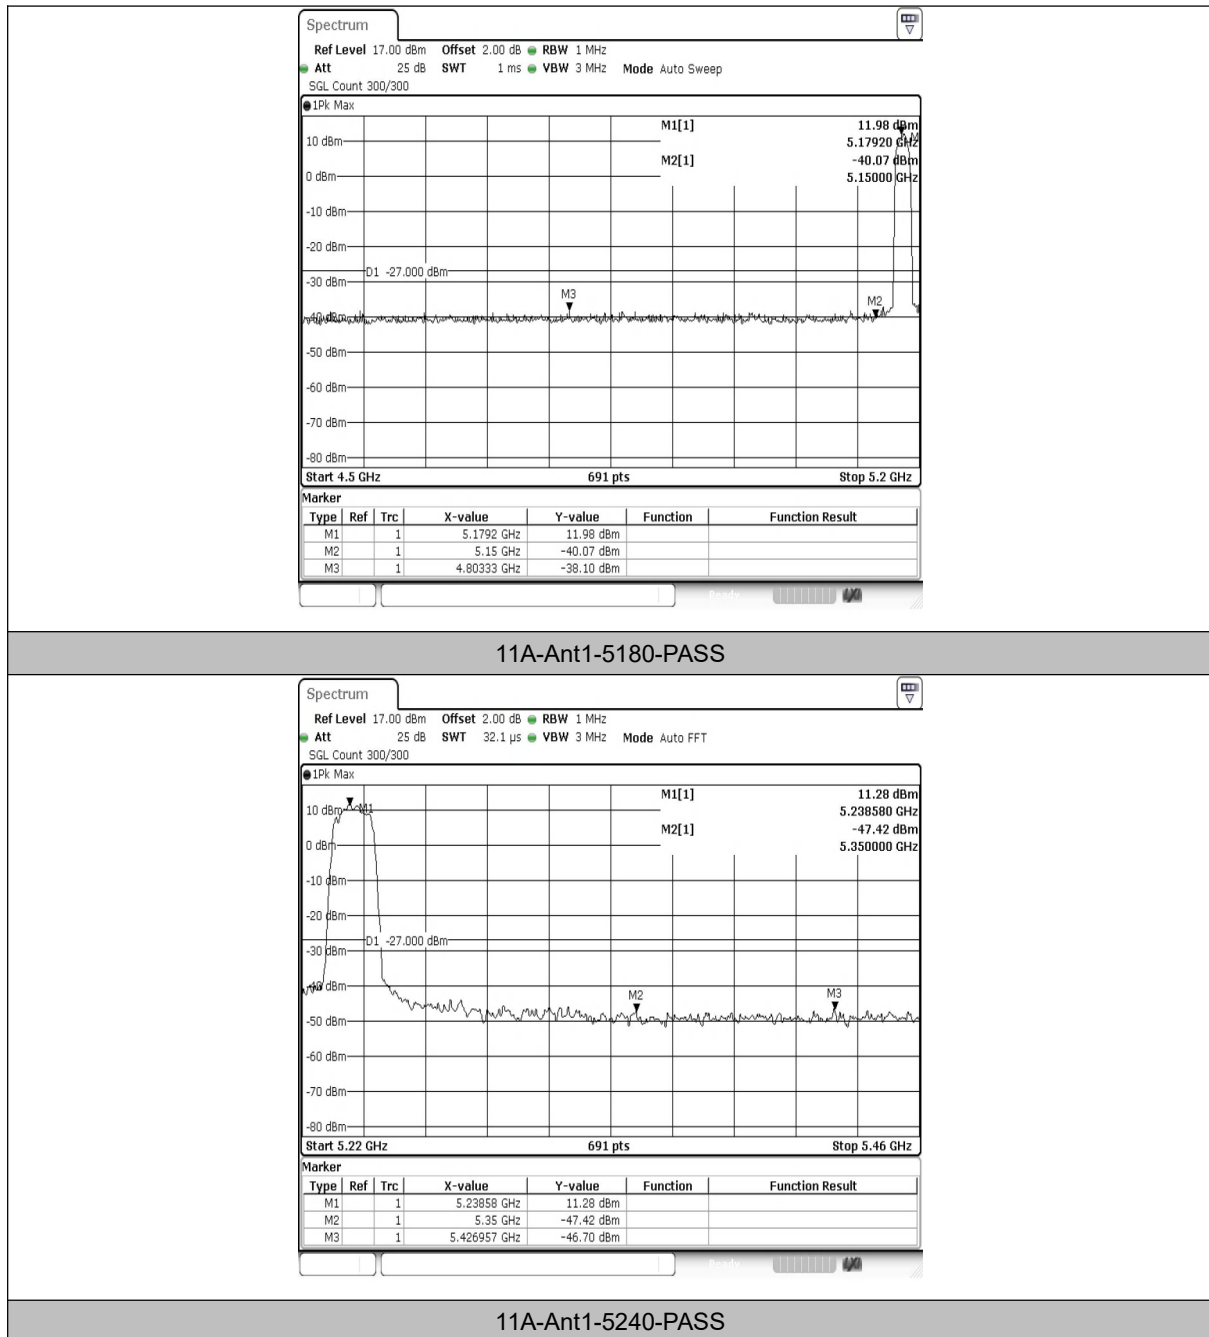


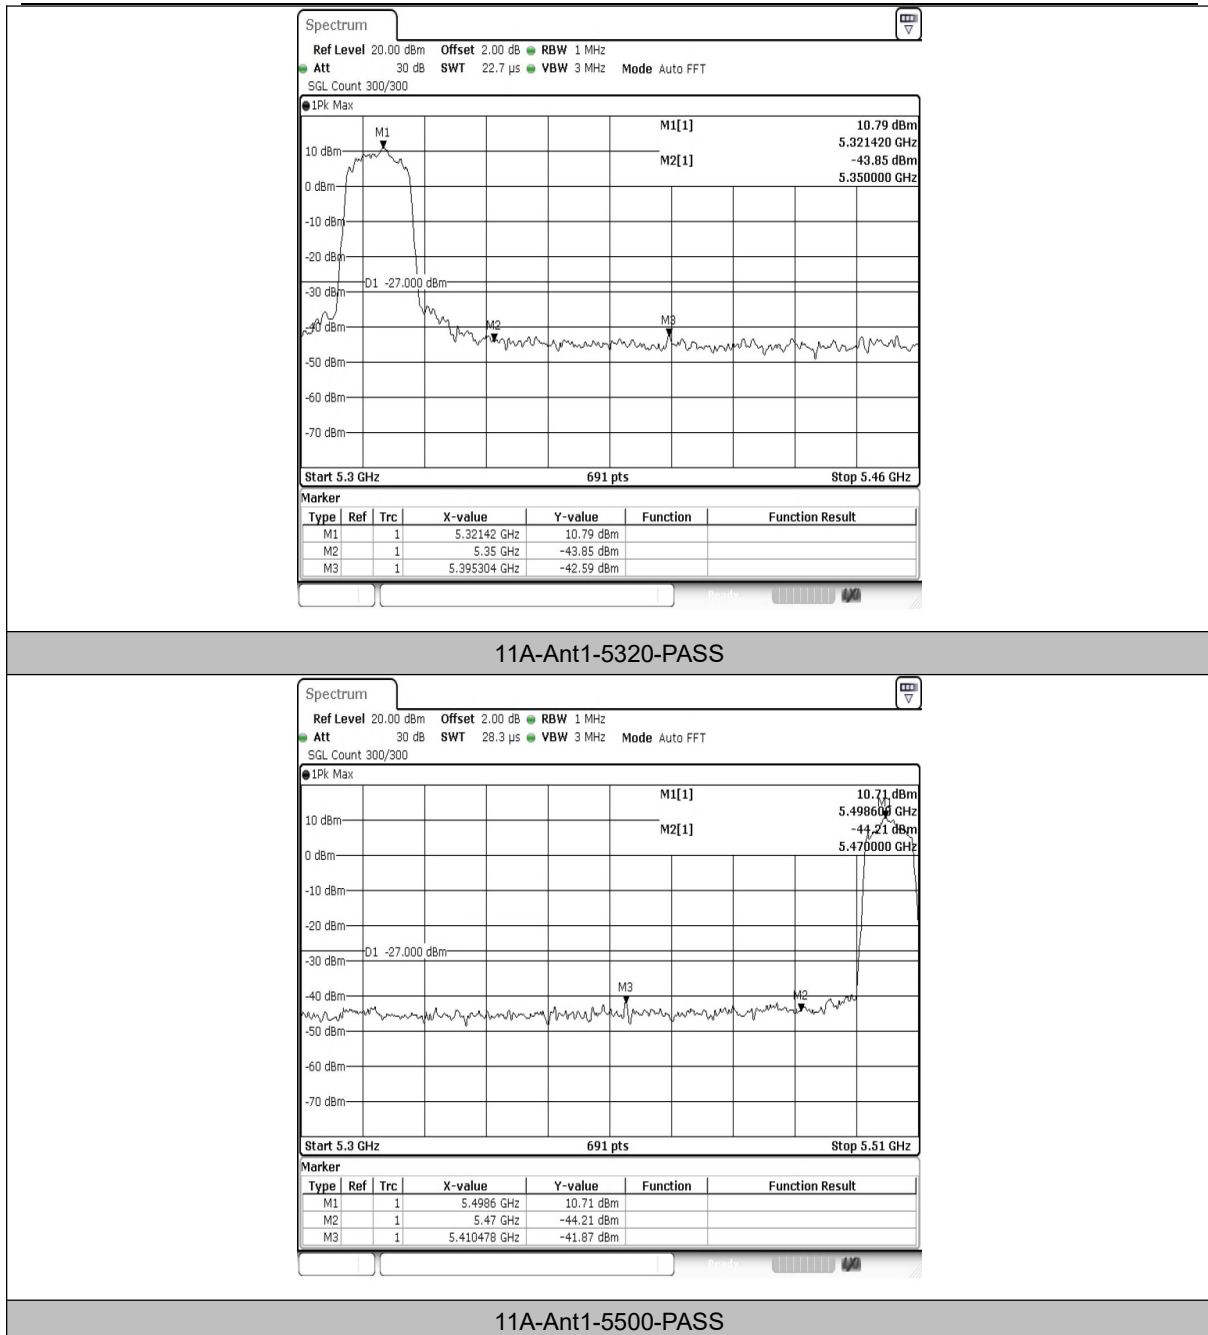

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

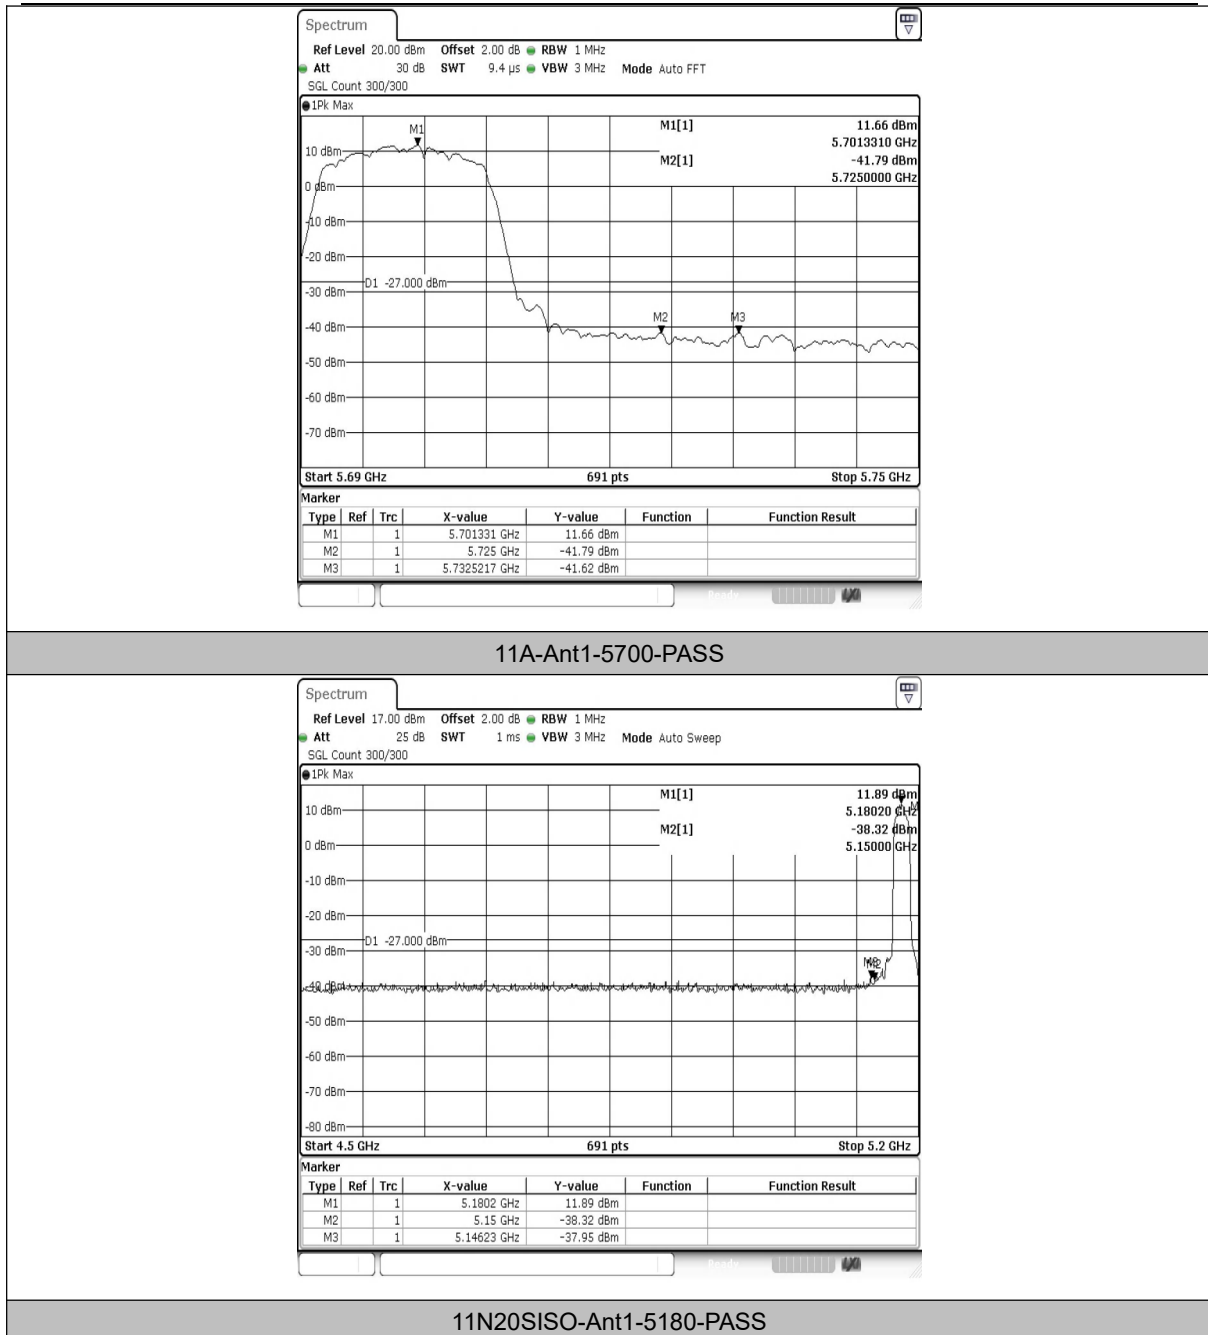

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

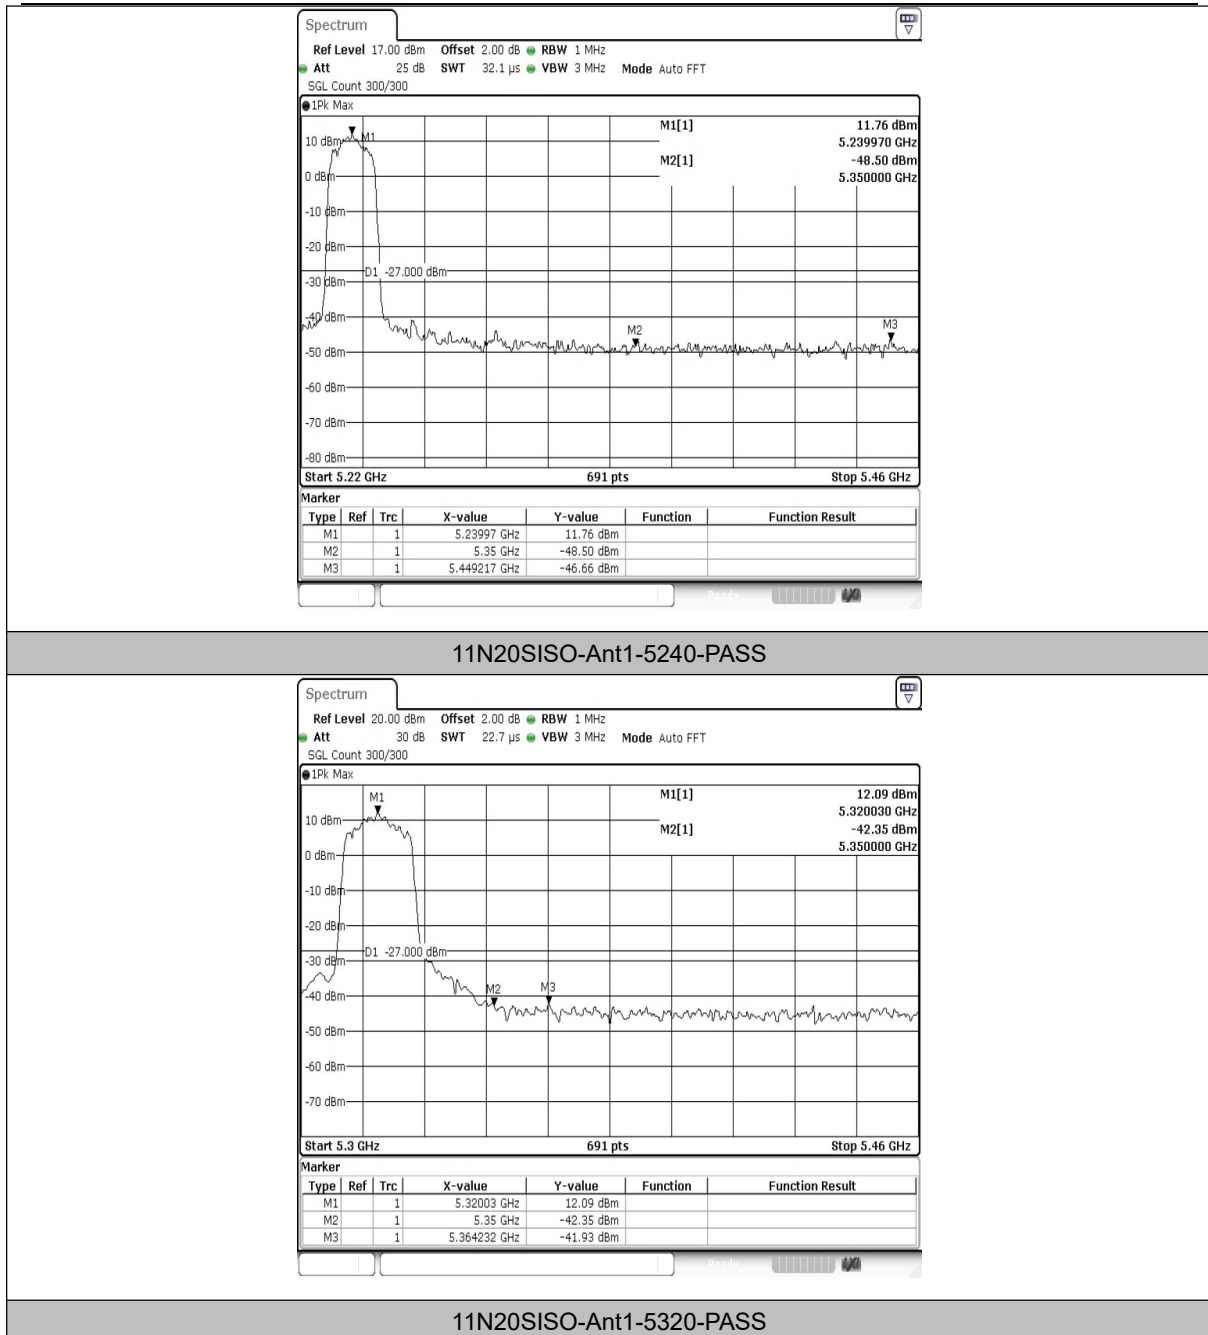


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

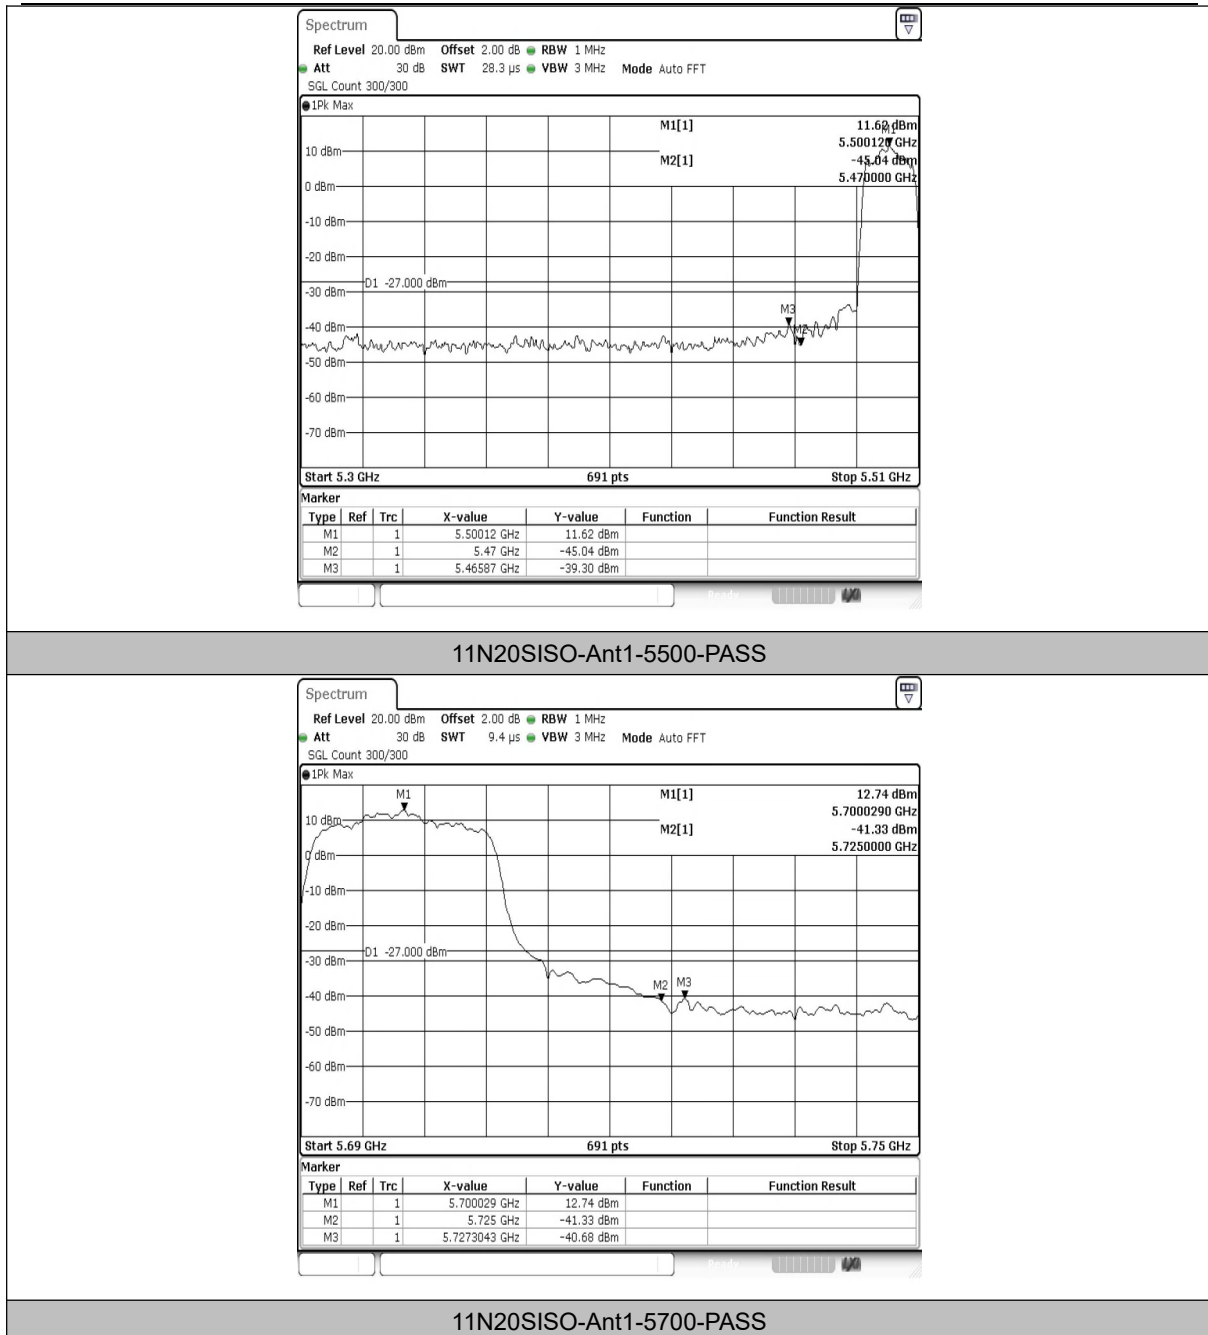


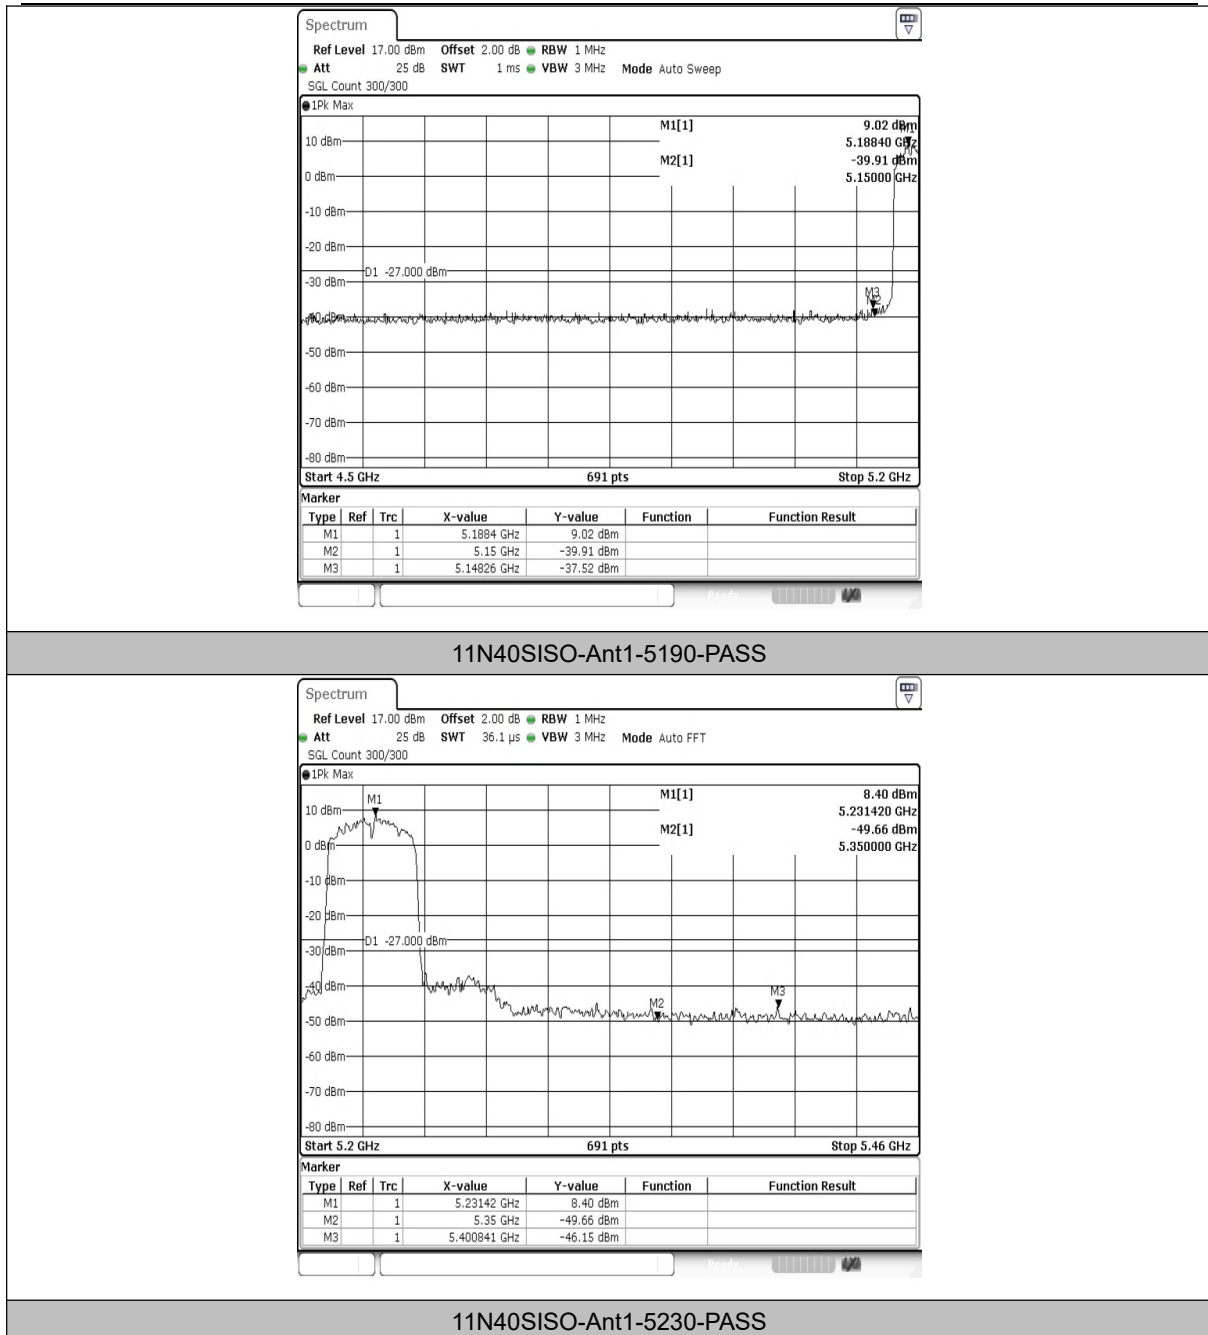

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

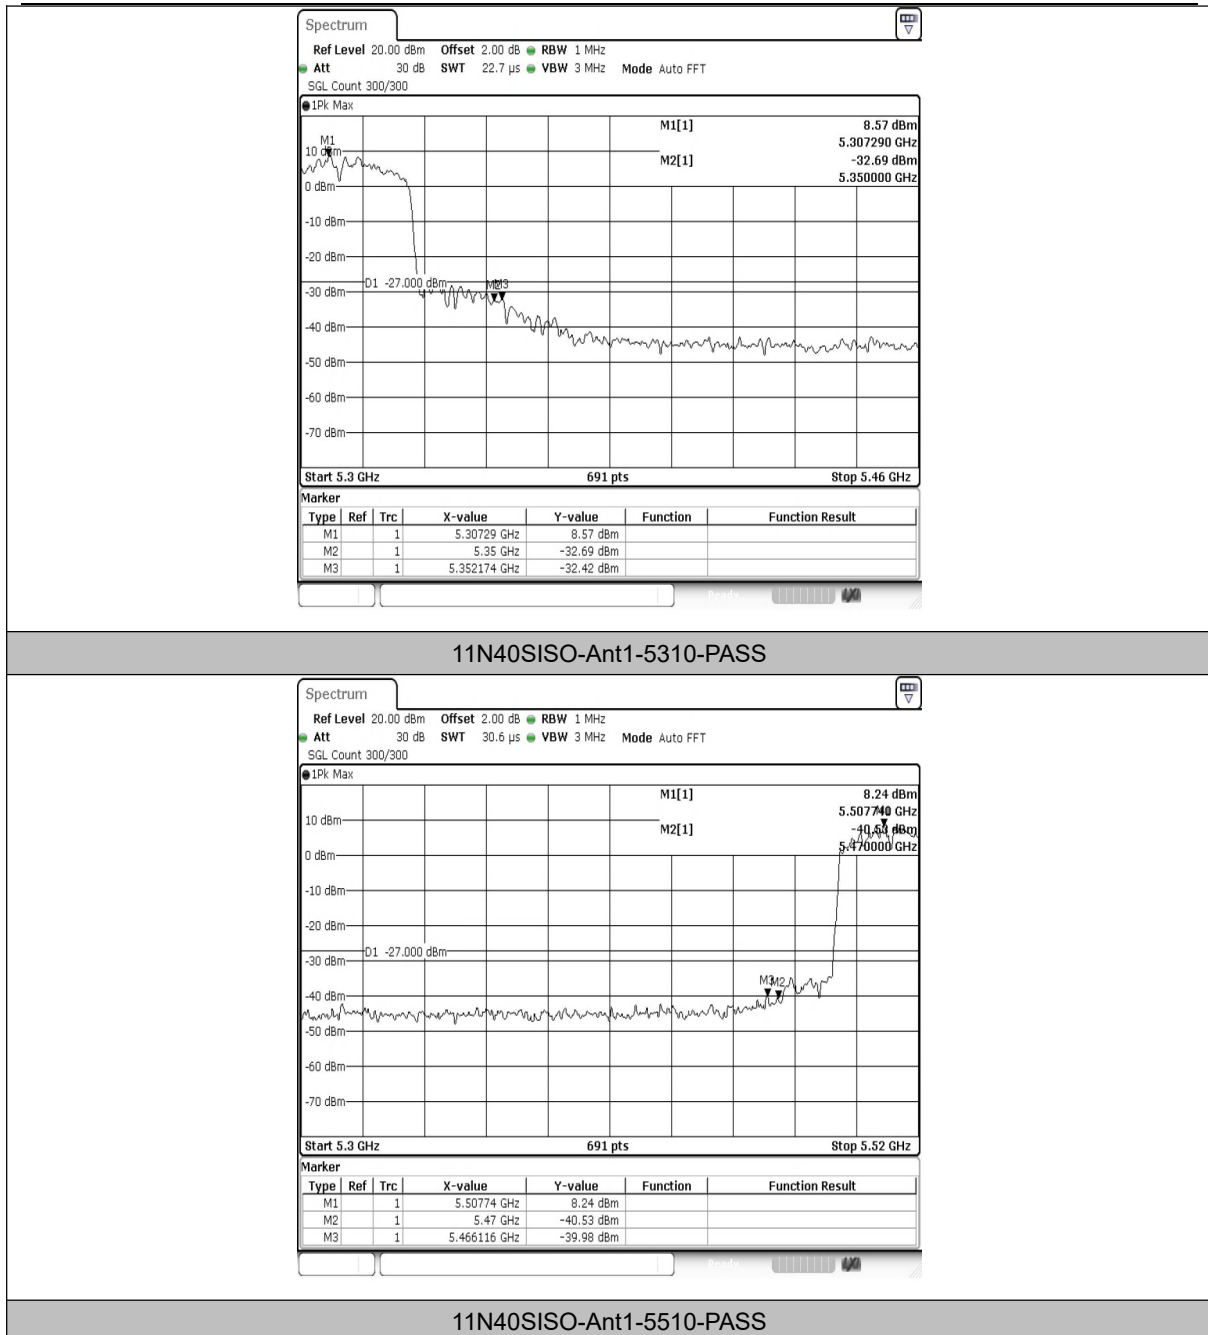

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

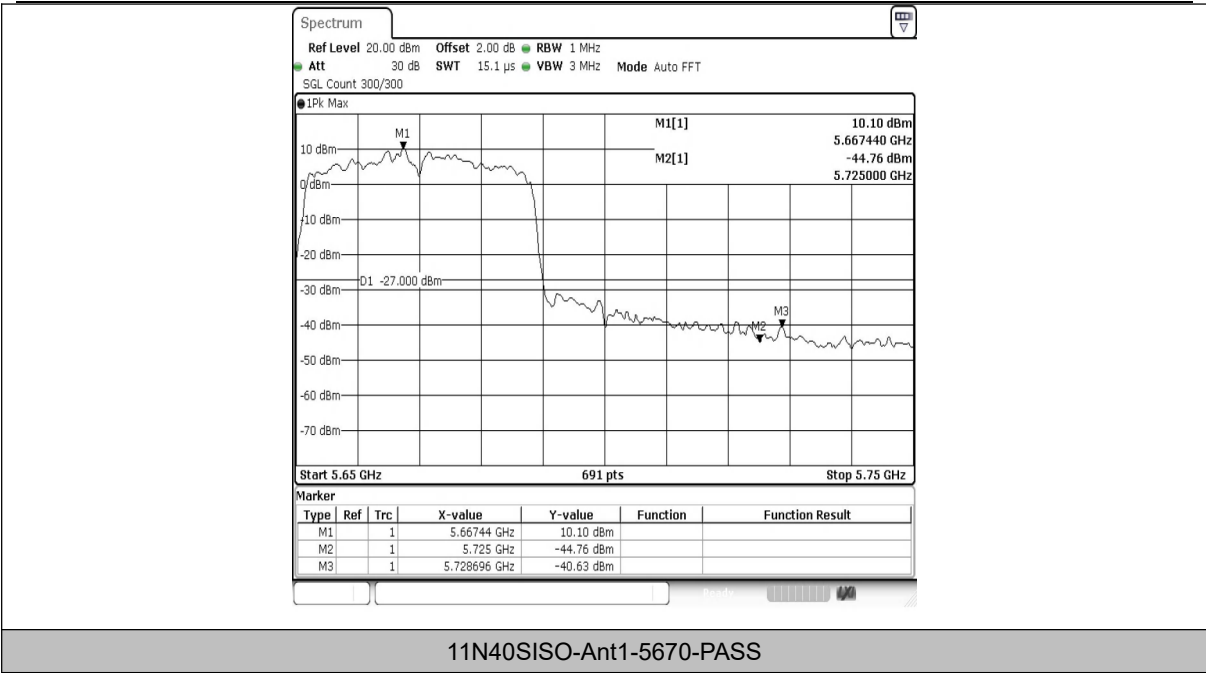


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs B4

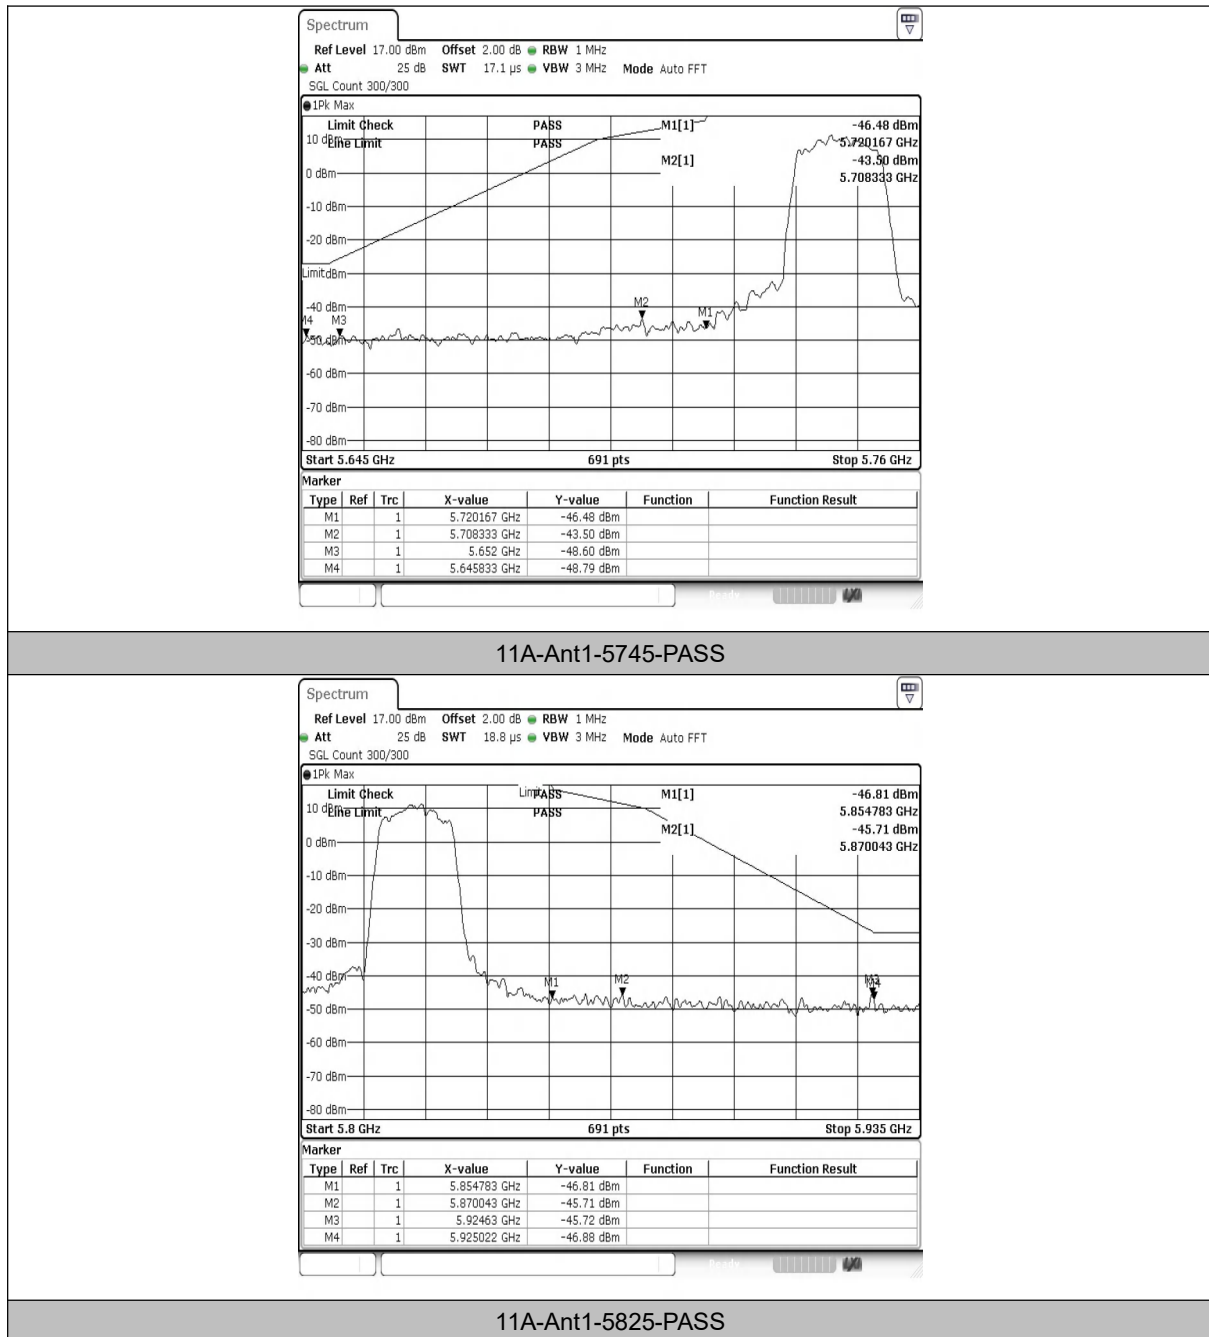


### Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

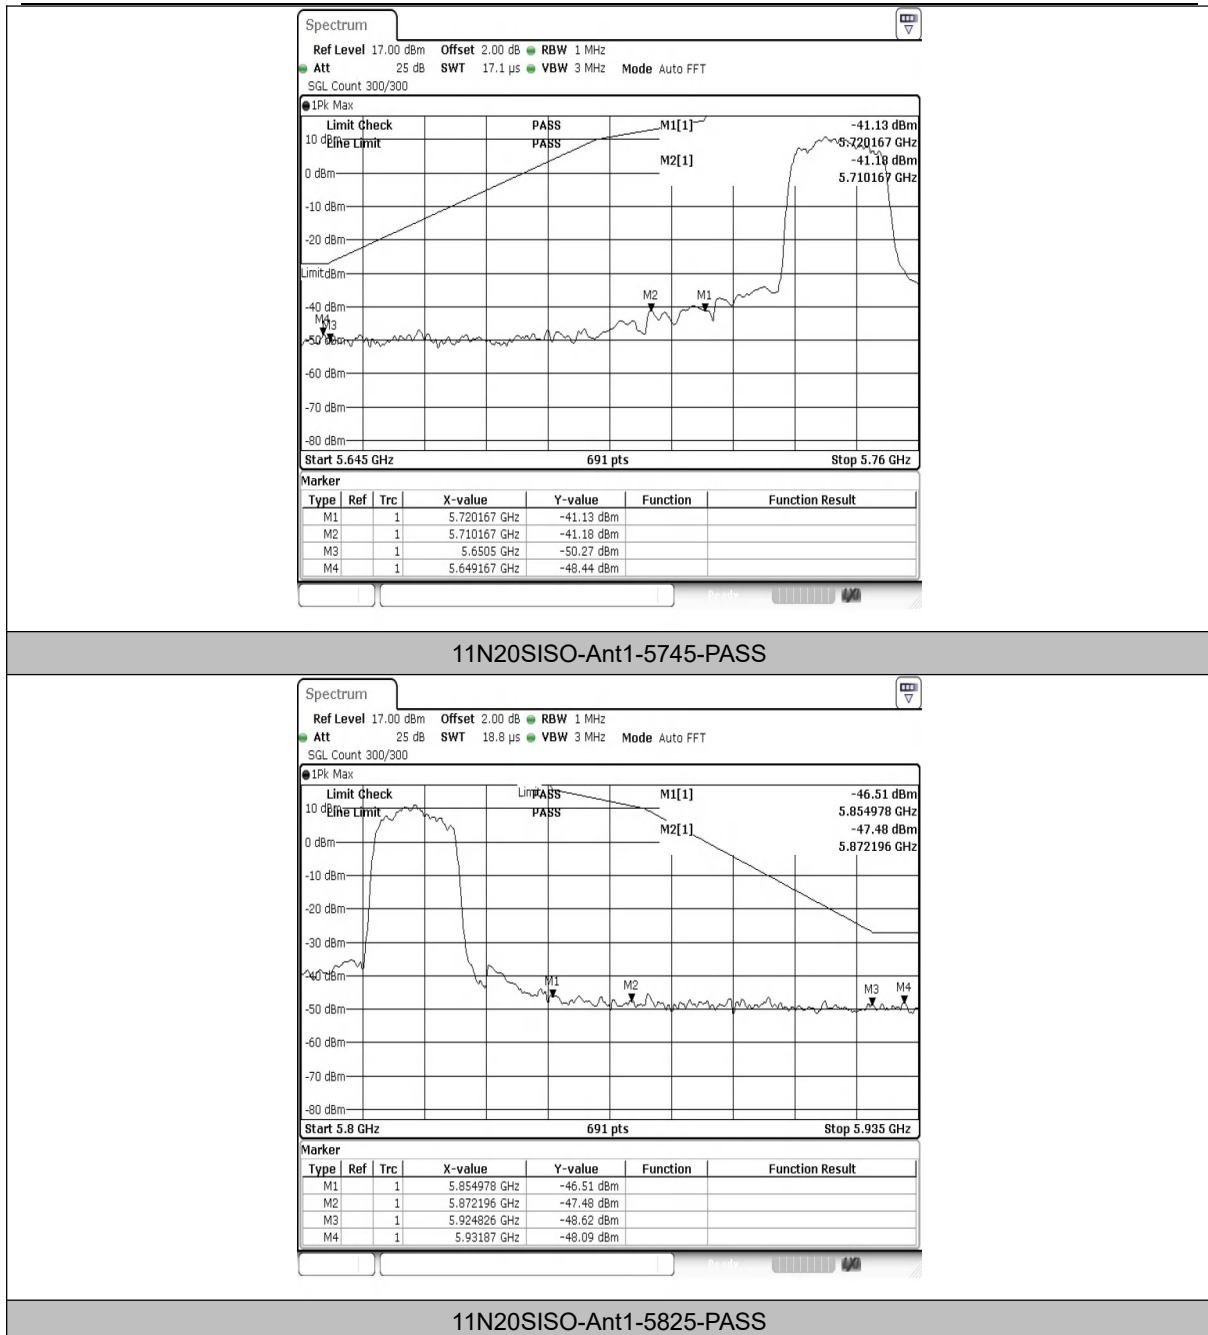

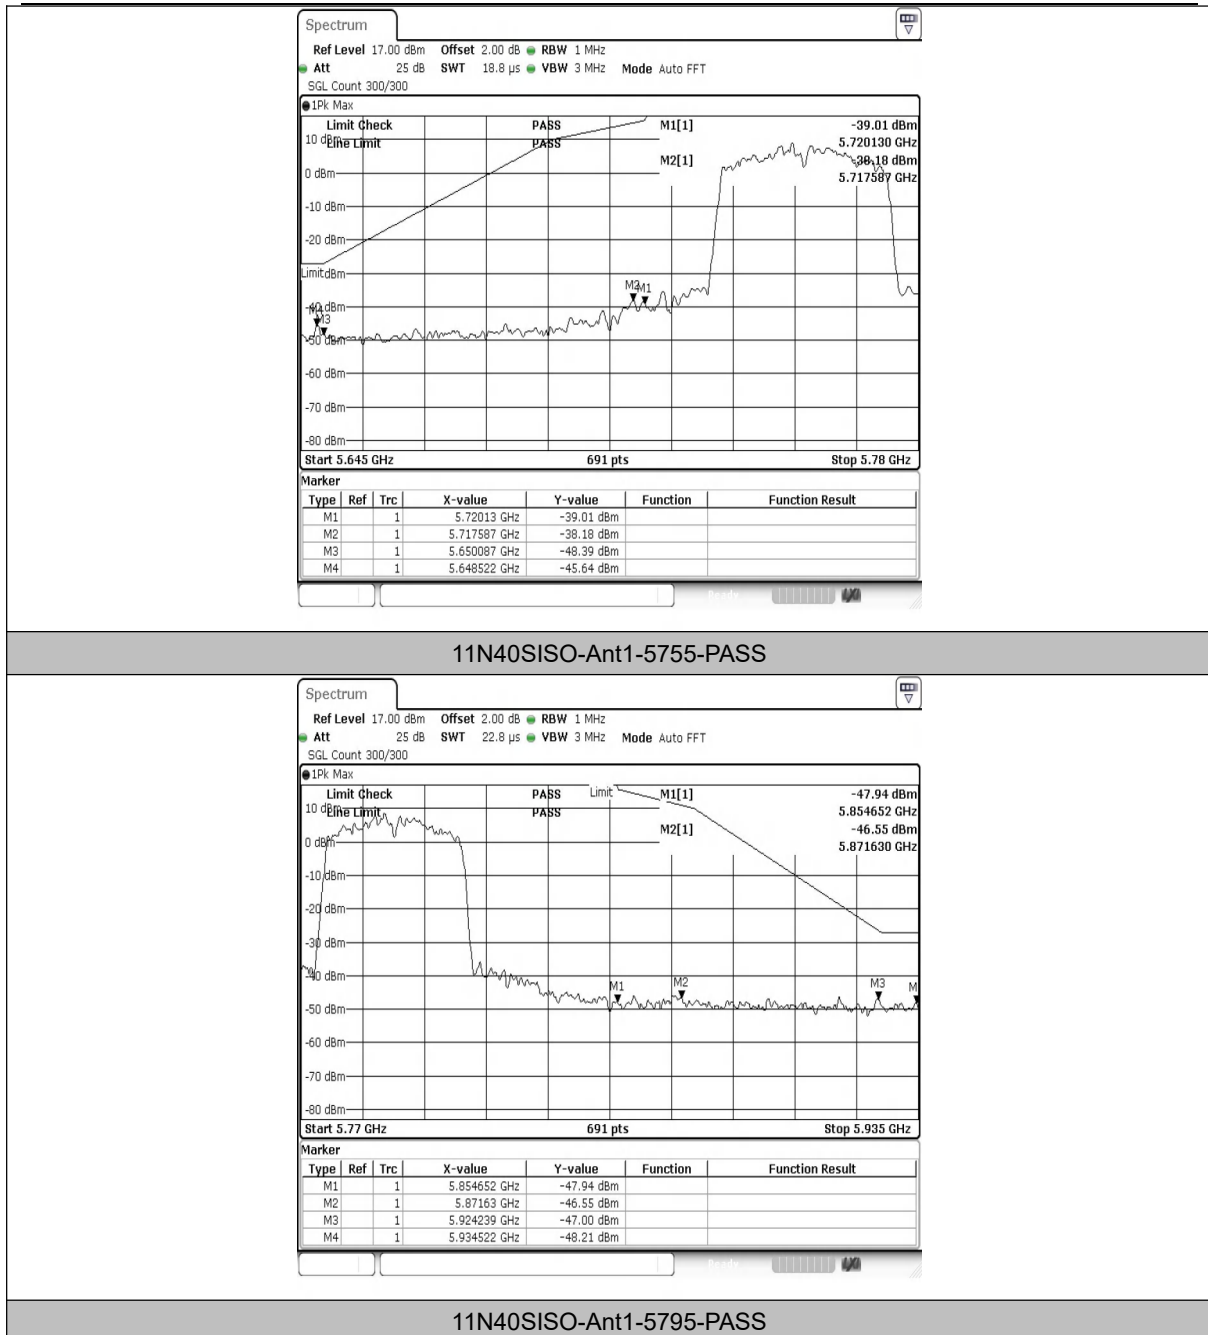

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

---


## Appendix F: DFS Detection Thresholds

### Test Result

| TestMode  | Frequency[dbm] | Radar Type | Result | Limit[dbm] | Verdict |
|-----------|----------------|------------|--------|------------|---------|
| 11N40SISO | 5270           | Type0      | -62.36 | -62.00     | PASS    |
|           | 5510           | Type0      | -62.38 | -62.00     | PASS    |

Note: During the test, pre-scan all the modes, only the worst case is recorded in the report.

## Test Graphs

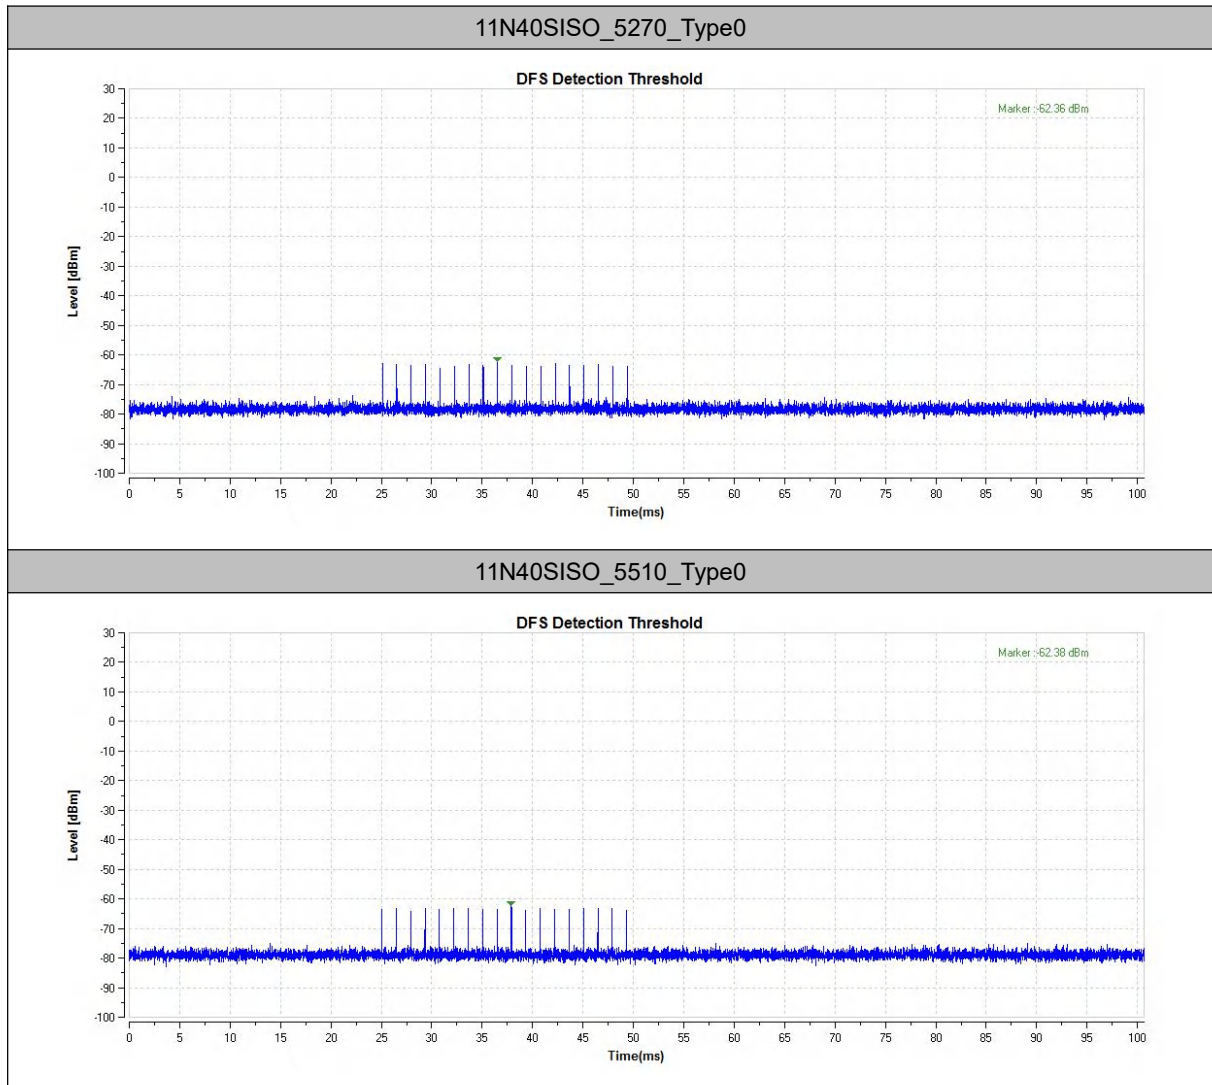

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

---

## Appendix G: Channel Move Time and Channel Closing


### Transmission Time

#### Test Result

| TestMode  | Frequency[MHz] | CCT[ms] | Limit[ms] | CMT[ms] | Limit[ms] | Verdict |
|-----------|----------------|---------|-----------|---------|-----------|---------|
| 11N40SISO | 5270           | 200+5.2 | 200+60    | 396.2   | 10000     | PASS    |
| 11N40SISO | 5510           | 200+7.8 | 200+60    | 1294.5  | 10000     | PASS    |

Note: During the test, pre-scan all the modes, only the worst case is recorded in the report.

## Test Graphs

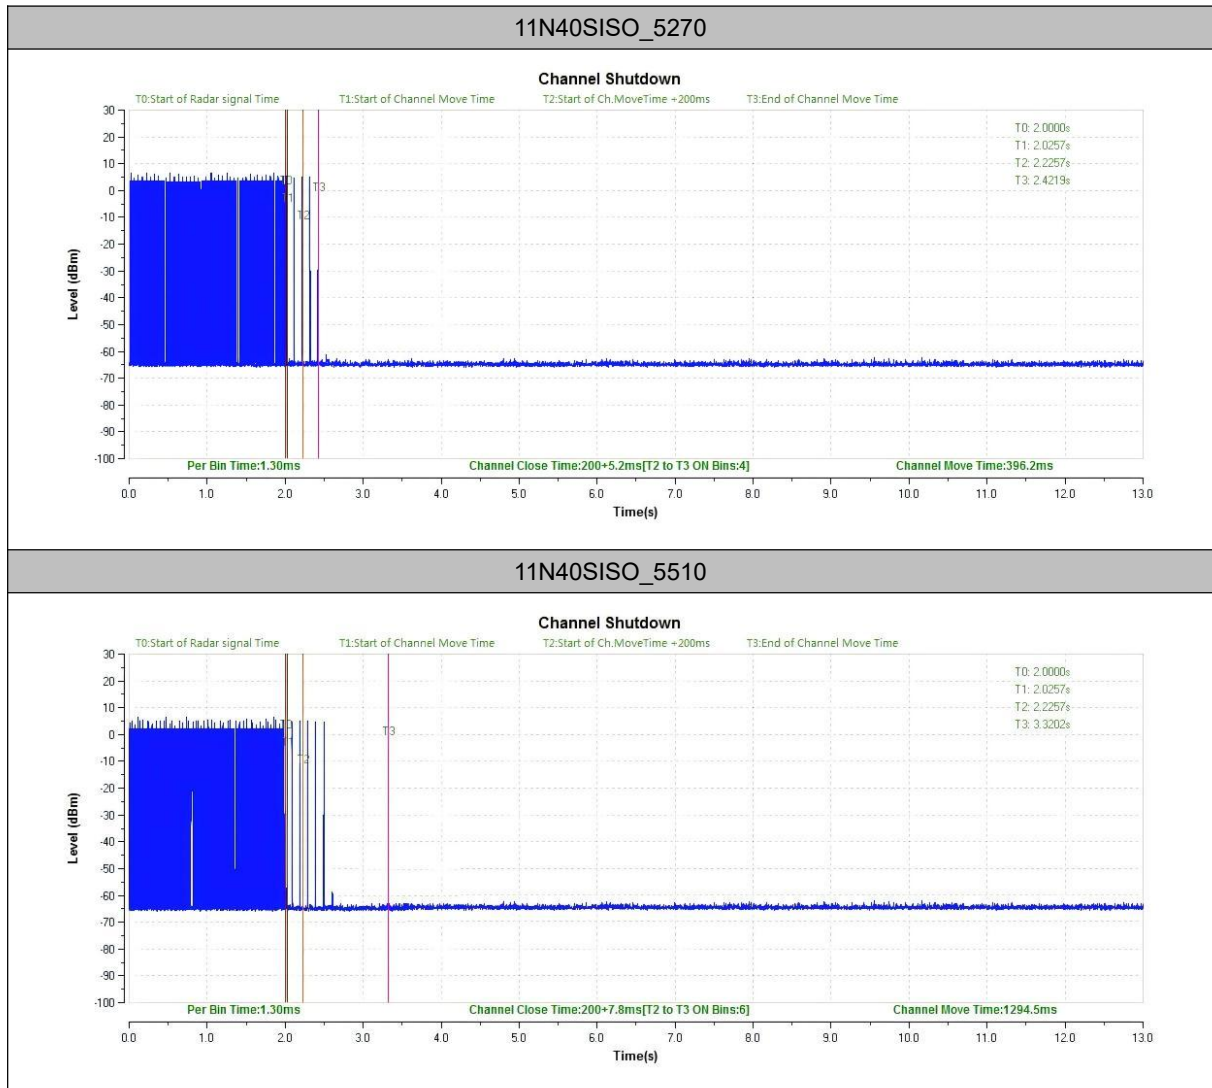

---End---