



TELEPHONE: (352) 472-5500
(888) 472-2424
FAX: (352) 472-2030
E-MAIL: info@timcoengr.com
WEBSITE: www.timcoengr.com

3/17/99

FCC
7435 Oakland Mills Road
Columbia, Md. 21045

SUBJECT: MONICOR ELECTRONIC CORP. FCCID: GES4BAM2000T

REFERENCE: EA93343

TO WHOM IT MAY CONCERN,

Attached you will find antenna conducted emissions that were omitted from the original application.

Also we have attached occupied bandwidth plots that indicate that this unit meets the requirements for paragraphs 90.217(b), (c) and we want to modify our application so that this unit will be licensable for 12.5KHz and 6.25KHz bandwidths.

If you have any questions please call toll free at 888.472.2424.

BEST REGARDS,



S.S. Sanders

Mon34u9.tr

APPLICANT: MONICOR ELECTRONIC CORPORATION
FCCID: GES4BAM2000T
NAME OF TEST: SPURIOUS EMISSIONS AT ANTENNA TERMINALS
REQUIREMENTS: 30dB below the unmodulated carrier

EMISSION FREQUENCY MHz	dB BELOW CARRIER
457.54	00.0
915.08	-62.5
1372.64	-71.8
1830.16	-75.7
2287.72	-80.5
2745.72	-75.2
3202.75	-62.8
3660.31	-65.2
4117.83	-71.4
4575.40	-77.5

APPLICANT: MONICOR ELECTRONIC CORPORATION
FCC ID: GES4BAM2000T
REPORT #: F:\CUS\M\MON\MON34M9.RPT
PAGE #: _____
F:\CUS\M\MON\MON34M9.RPT

hp

REF -36.6 dBm ATTEN 10 dB +0 dB

MKR 457.53705 MHz
-37.10 dBm

10 dB/

OFFSET
-20.0
dB


SPAN
50.00 KHz

MONITOR ELECTRONIC CORP.
FCC ID: GES4BAM2000T
EXHIBIT #: 11

CENTER 457.53705 MHz
RES BW 300 Hz

VBW 100 KHz

SPAN 50.00 KHz
SWP 1.0 sec

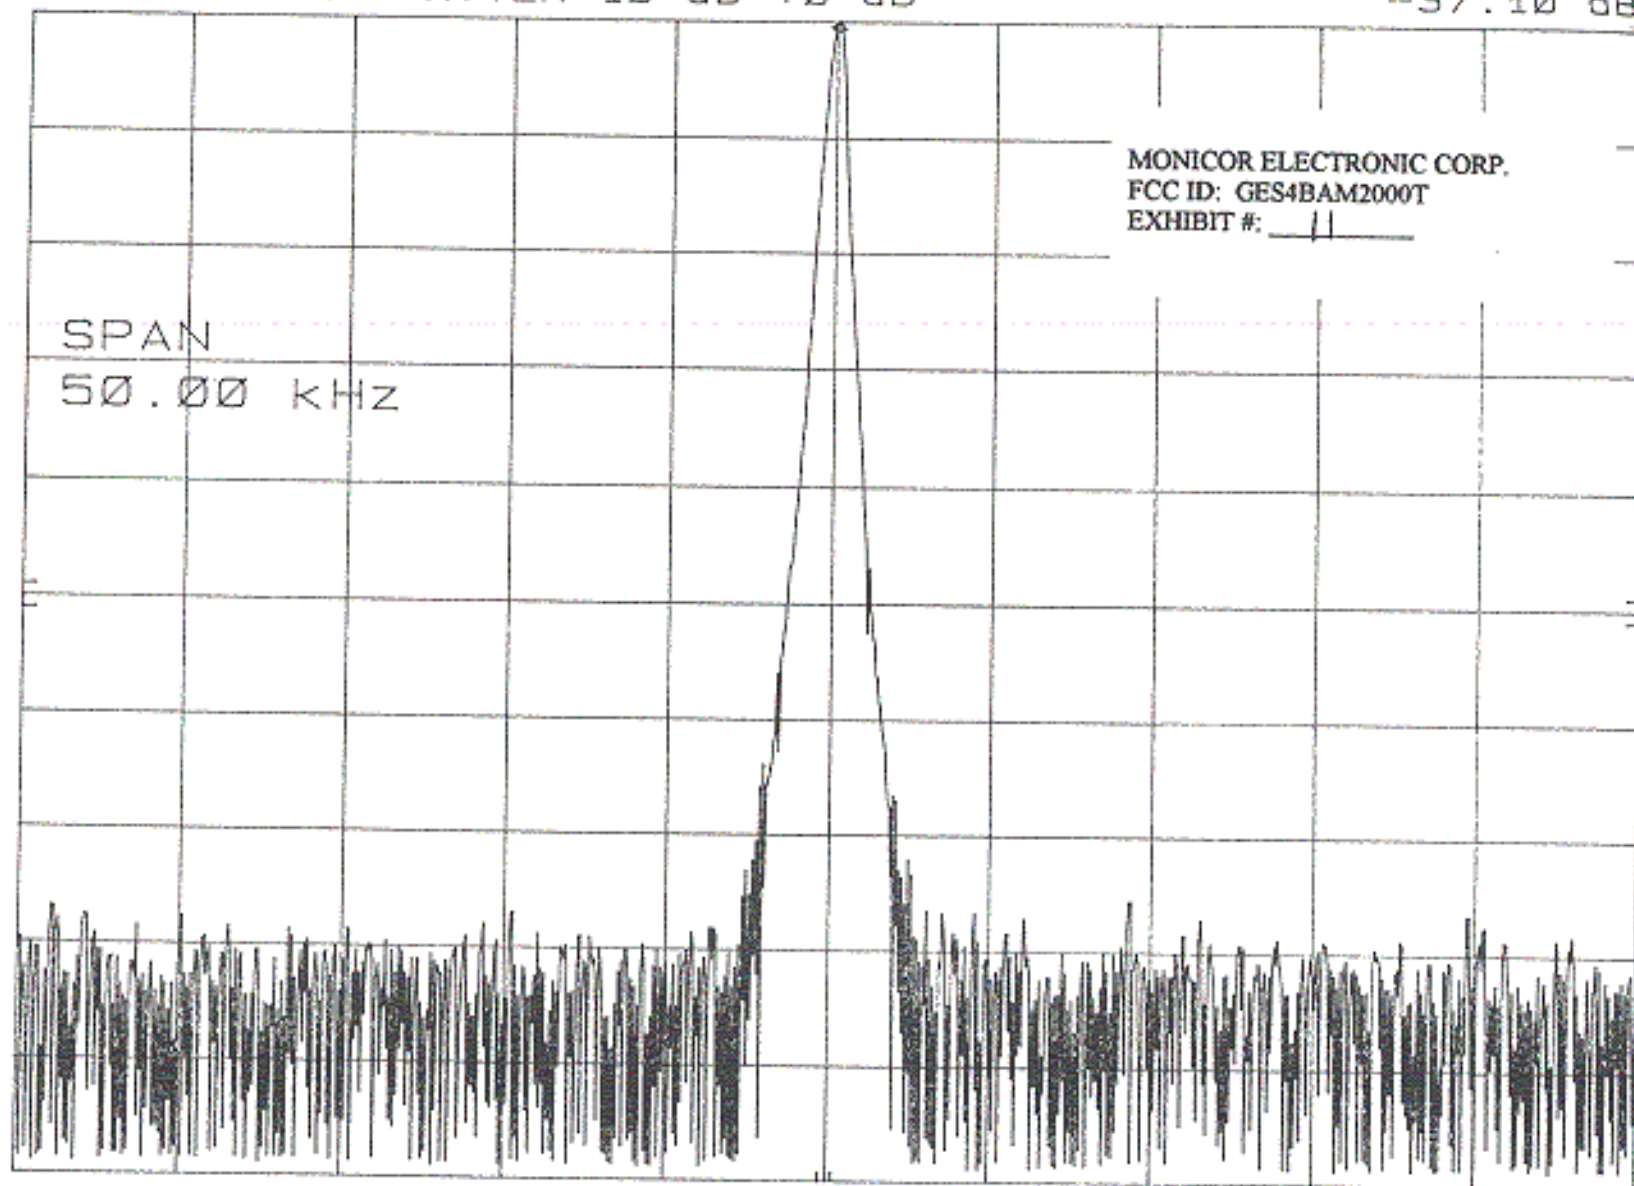

hp

REF -31.6 dBm ATTEN 10 dB +0 dB


MKR 457.53715 MHz
-33.10 dBm

10 dB/

OFFSET
-20.0
dB

MONICOR ELECTRONIC CORP.
FCC ID: GES4BAM2000T
EXHIBIT #: 12

MARKER
457.53715 MHz
-33.10 dBm

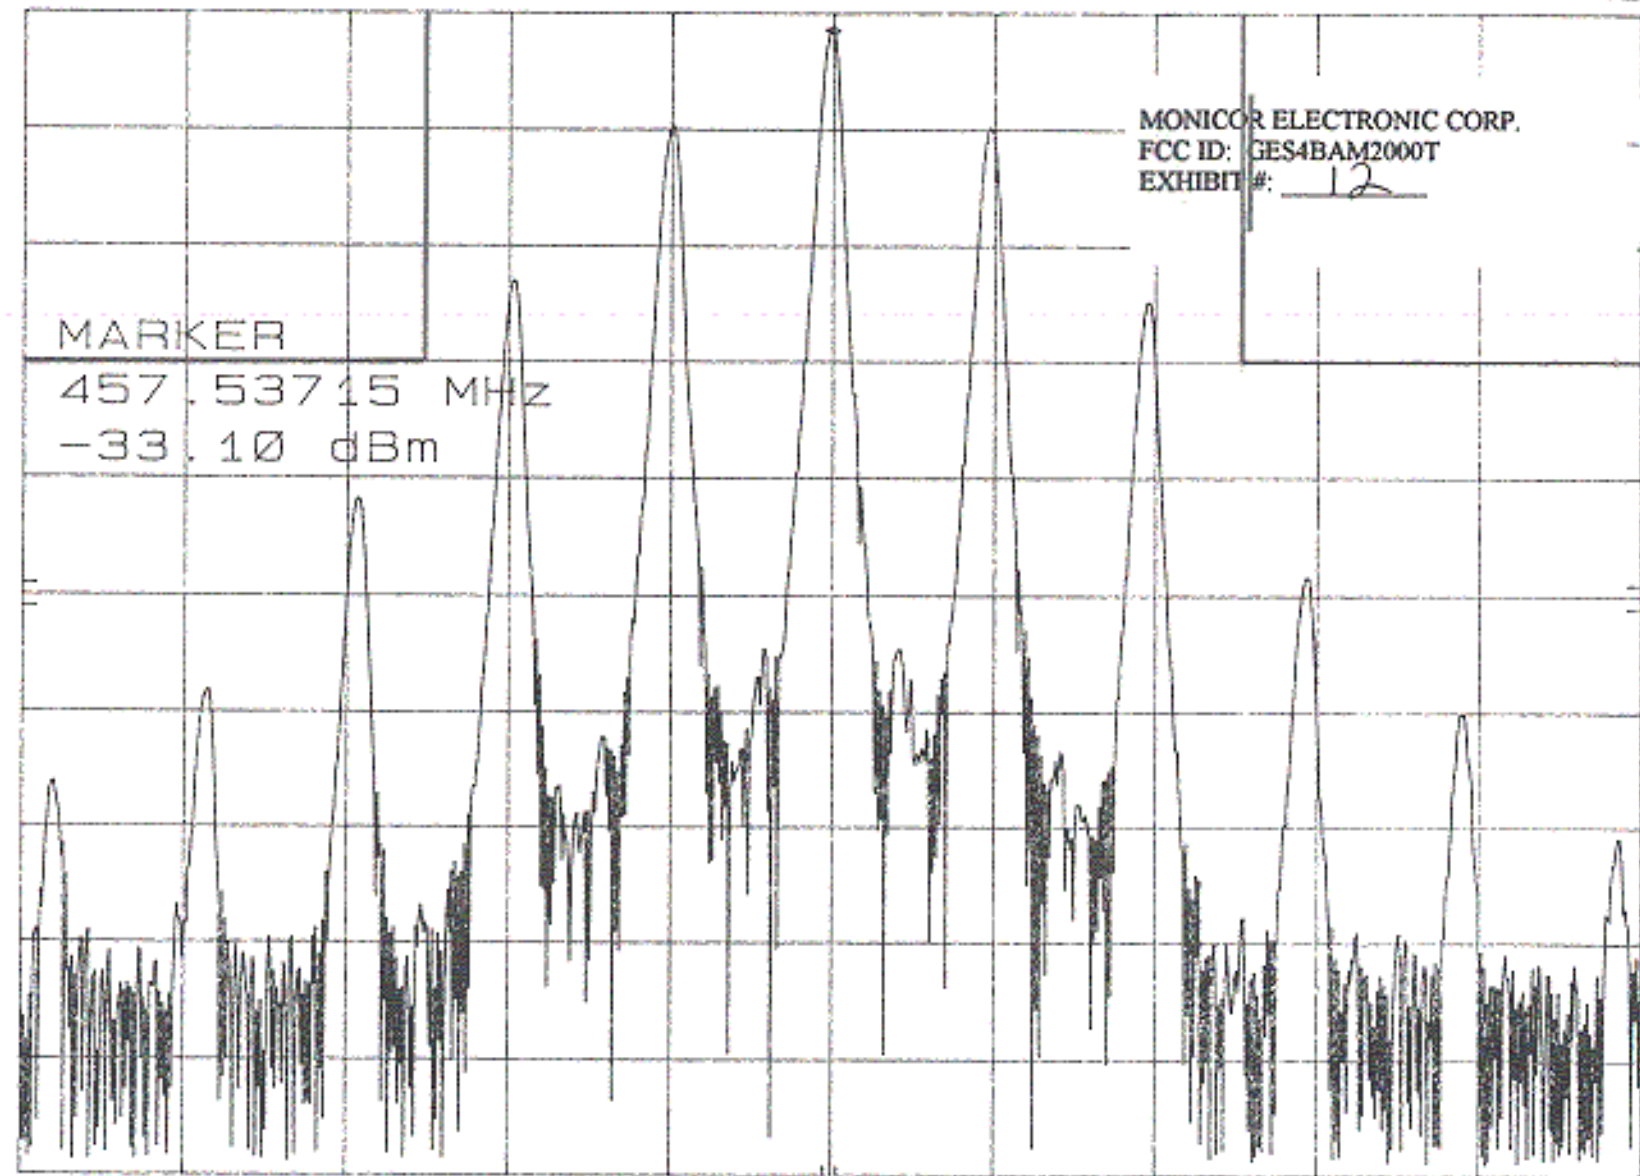

CENTER 457.53720 MHz
RES BW 300 Hz

VBW 100 kHz

SPAN 50.00 kHz
SWP 1.0 sec

hp

REF -31.6 dBm ATTEN 10 dB +0 dB

MKR 457.53705 MHz
-41.30 dBm

10 dB/

OFFSET
-20.0
dB

MONITOR ELECTRONIC CORP.
FCC ID: GES4BAM2000T
EXHIBIT #: 12

MARKER
457.53705 MHz
-41.30 dBm

CENTER 457.53720 MHz SPAN 50.00 kHz
RES BW 300 Hz VBW 100 kHz SWP 1.0 sec