





Restrict Band NVNT ac80 5530MHz Ant0 Peak

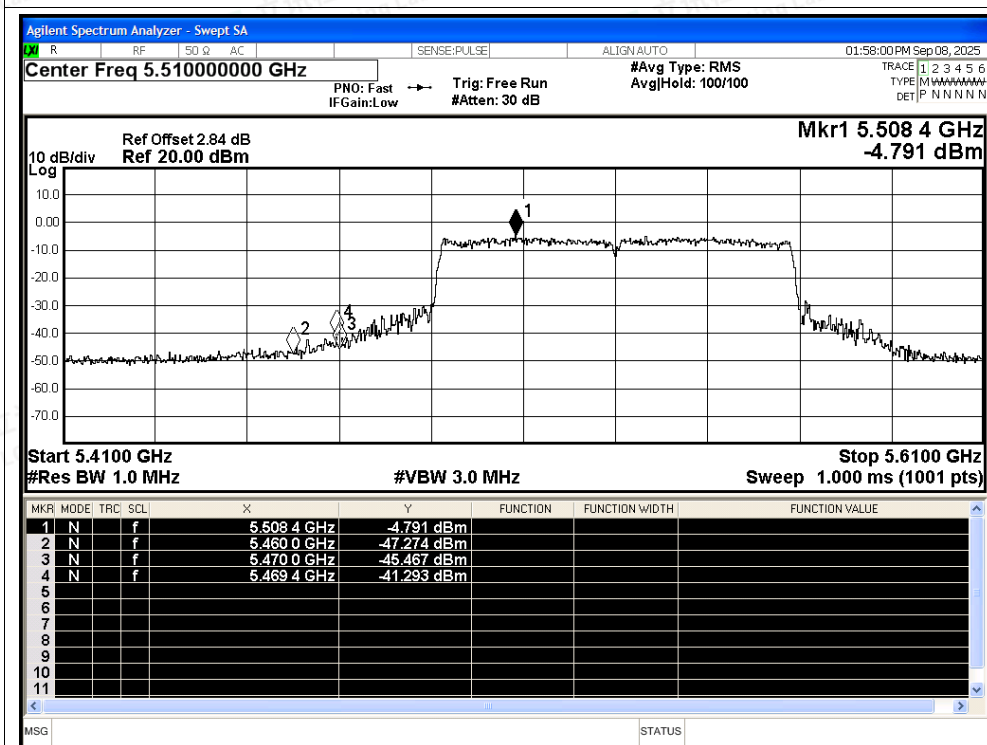

Restrict Band NVNT ac80 5530MHz Ant0 Average

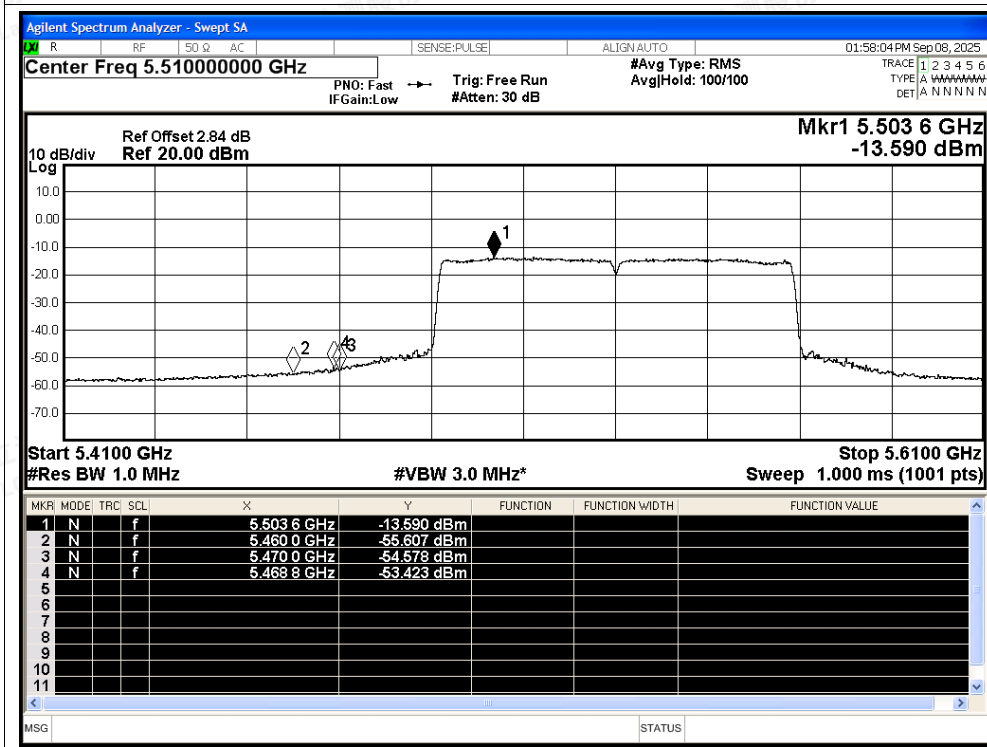

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant0 Peak

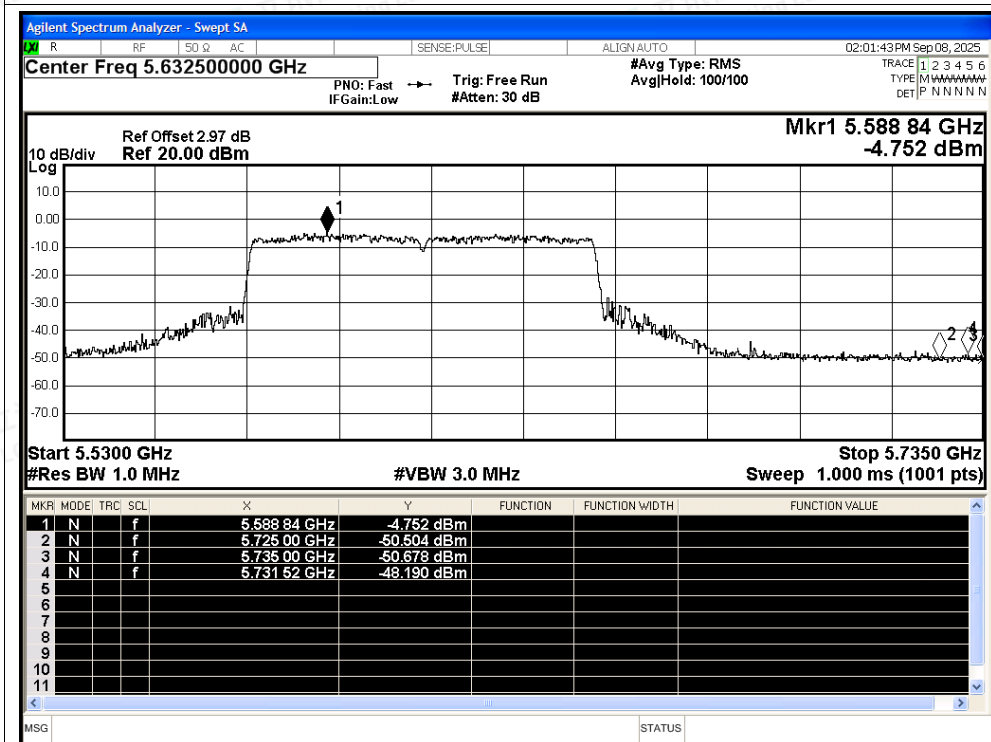

Restrict Band NVNT ac80 5610MHz Ant0 Average

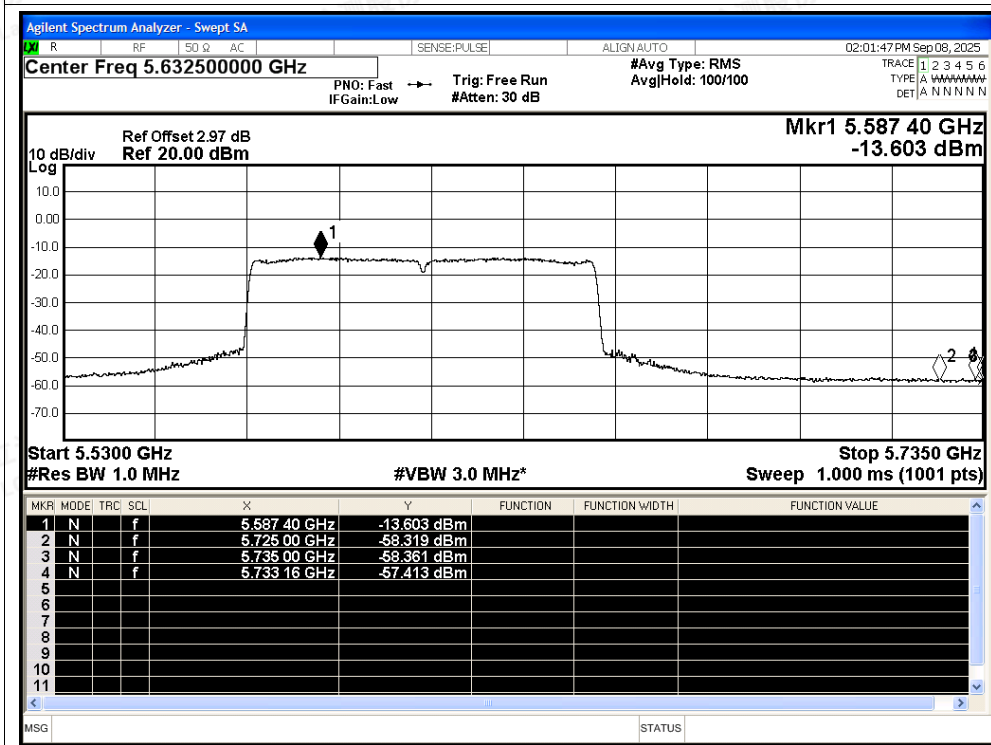

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-51.11	2.08	-	46.20	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.79	2.08	0.24	39.76	Average	54	Pass
NVNT	a	5500	Ant1	5470	-42.5	2.08	-	54.81	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469.6	-56.52	2.08	0.24	41.03	Average	54	Pass
NVNT	a	5500	Ant1	5470	-42.5	2.08	-	54.81	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-56.54	2.08	0.24	41.01	Average	54	Pass
NVNT	a	5700	Ant1	5725	-42.41	2.08	-	54.90	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-53.77	2.08	0.24	43.78	Average	54	Pass
NVNT	a	5700	Ant1	5725.2	-38.73	2.08	-	58.58	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.4	-53.46	2.08	0.24	44.09	Average	54	Pass
NVNT	a	5700	Ant1	5735	-50.62	2.08	-	46.69	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.93	2.08	0.24	39.62	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-48.87	2.08	-	48.44	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-58.06	2.08	0.28	39.53	Average	54	Pass
NVNT	n20	5500	Ant1	5469.8	-38.43	2.08	-	58.88	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469	-55.32	2.08	0.28	42.27	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-42.15	2.08	-	55.16	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-56.02	2.08	0.28	41.57	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-38.83	2.08	-	58.48	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.96	2.08	0.28	43.63	Average	54	Pass
NVNT	n20	5700	Ant1	5726.2	-36.93	2.08	-	60.38	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725.6	-53.38	2.08	0.28	44.21	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-50.44	2.08	-	46.87	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-57.05	2.08	0.28	40.54	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-49.66	2.08	-	47.65	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-56.99	2.08	0.24	40.56	Average	54	Pass
NVNT	n40	5510	Ant1	5469	-37.17	2.08	-	60.14	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.6	-54	2.08	0.24	43.55	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-38.38	2.08	-	58.93	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-54.23	2.08	0.24	43.32	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-50.22	2.08	-	47.09	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-57.6	2.08	0.24	39.95	Average	54	Pass
NVNT	n40	5670	Ant1	5728.6	-48.35	2.08	-	48.96	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5726.2	-57	2.08	0.24	40.55	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-49.13	2.08	-	48.18	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-57.74	2.08	0.24	39.81	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-48.88	2.08	-	48.43	Peak	68.2	Pass





NVNT	ac20	5500	Ant1	5460	-57.39	2.08	0.28	40.20	Average	54	Pass
NVNT	ac20	5500	Ant1	5469.4	-39.68	2.08	-	57.63	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5467.8	-55.27	2.08	0.28	42.32	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-42.47	2.08	-	54.84	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-55.52	2.08	0.28	42.07	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-39.56	2.08	-	57.75	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-51.92	2.08	0.28	45.67	Average	54	Pass
NVNT	ac20	5700	Ant1	5727.8	-36.35	2.08	-	60.96	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725.2	-51.91	2.08	0.28	45.68	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-48.03	2.08	-	49.28	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.58	2.08	0.28	40.01	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-50.31	2.08	-	47.00	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.38	2.08	0.23	40.16	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.6	-40.72	2.08	-	56.59	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469.8	-53.42	2.08	0.23	44.12	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-42.46	2.08	-	54.85	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-54.19	2.08	0.23	43.35	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-50.87	2.08	-	46.44	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-57.72	2.08	0.24	39.83	Average	54	Pass
NVNT	ac40	5670	Ant1	5727.2	-48.09	2.08	-	49.22	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5733.2	-56.69	2.08	0.24	40.86	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-48.13	2.08	-	49.18	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-58.14	2.08	0.24	39.41	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-48.38	2.08	-	48.93	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-56.94	2.08	0.47	40.84	Average	54	Pass
NVNT	ac80	5530	Ant1	5467	-41.21	2.08	-	56.10	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5468	-53.35	2.08	0.47	44.43	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-44.14	2.08	-	53.17	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-54.05	2.08	0.47	43.73	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-50.22	2.08	-	47.09	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-57.68	2.08	0.47	40.10	Average	54	Pass
NVNT	ac80	5610	Ant1	5733.77	-47.97	2.08	-	49.34	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5734.18	-57.49	2.08	0.47	40.29	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.6	2.08	-	46.71	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-58.36	2.08	0.47	39.42	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

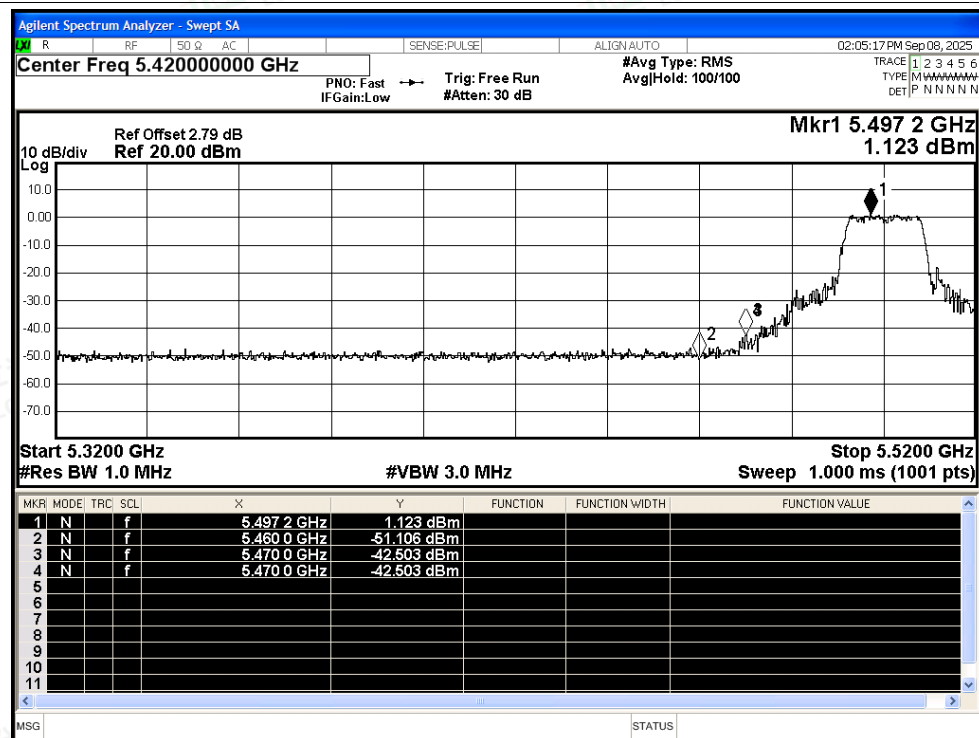

Restrict Band NVNT a 5500MHz Ant1 Average

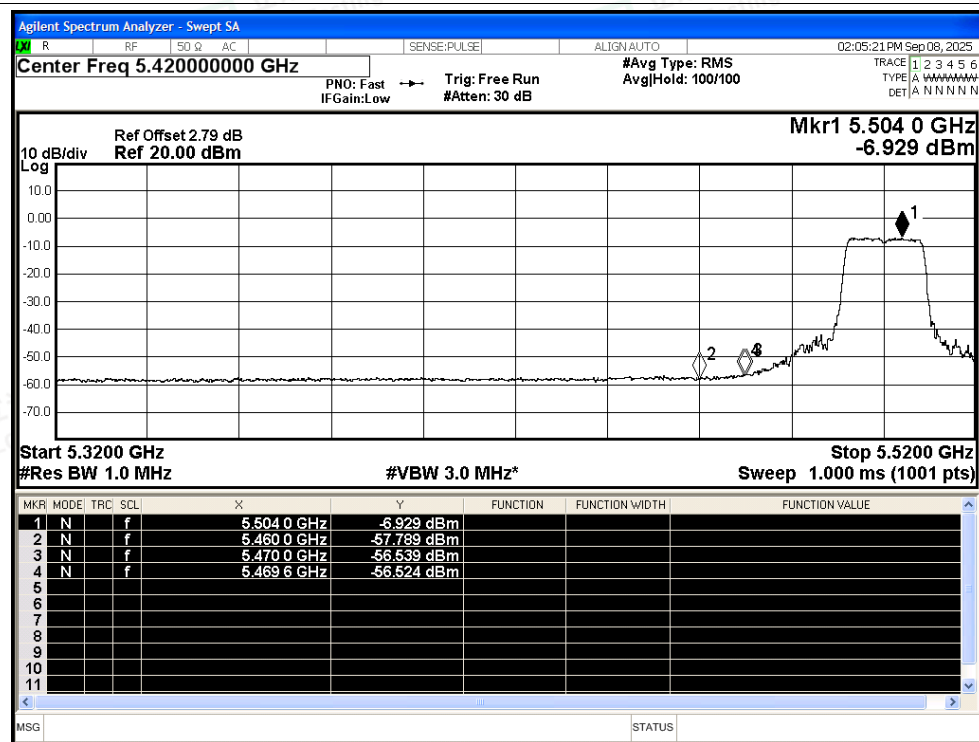

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

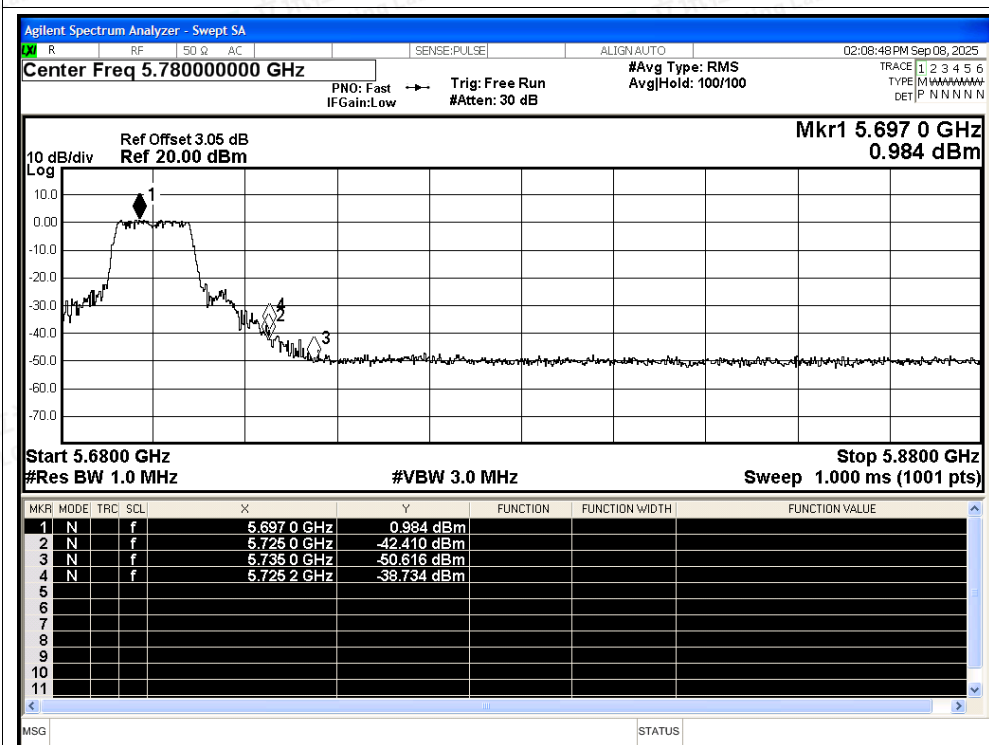

Restrict Band NVNT a 5700MHz Ant1 Average

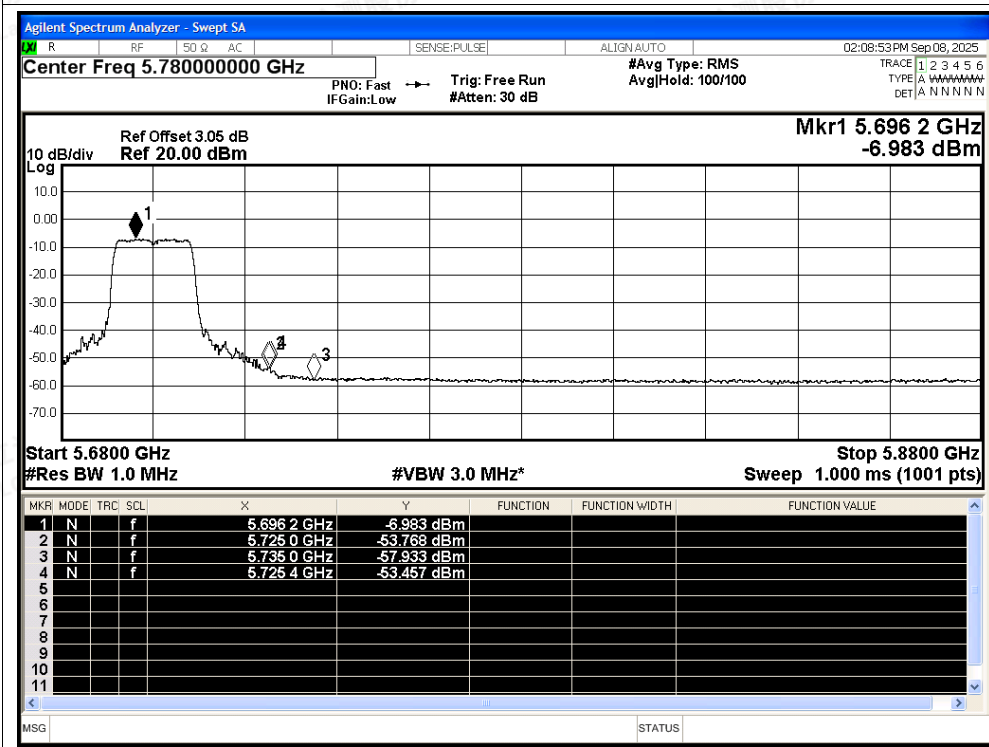

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak

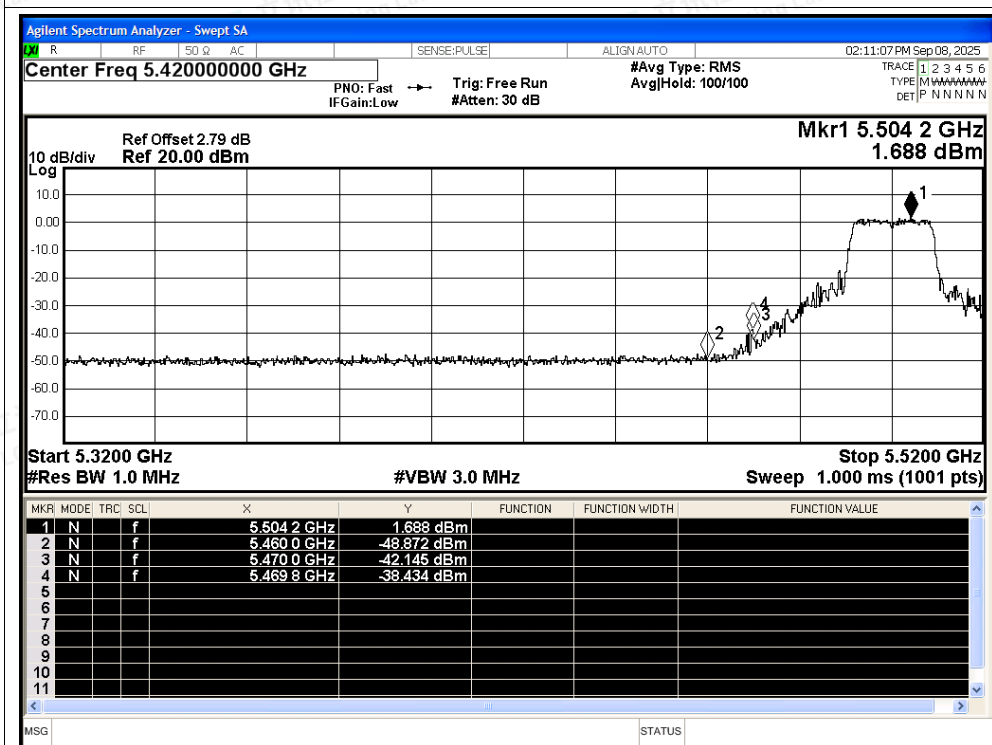

Restrict Band NVNT n20 5500MHz Ant1 Average

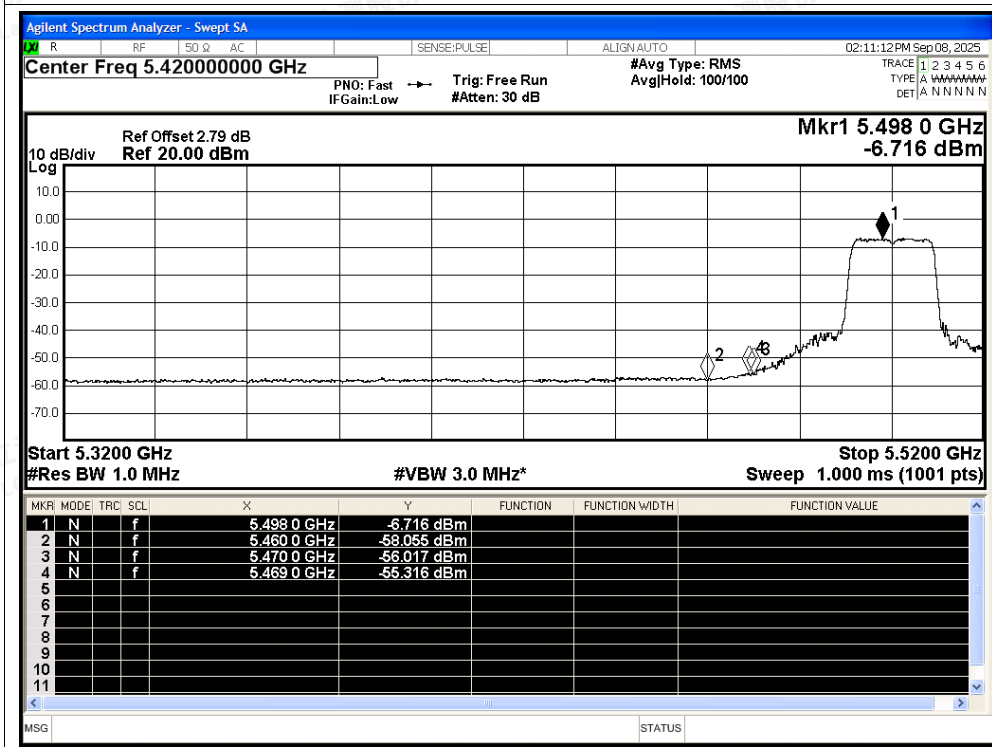

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

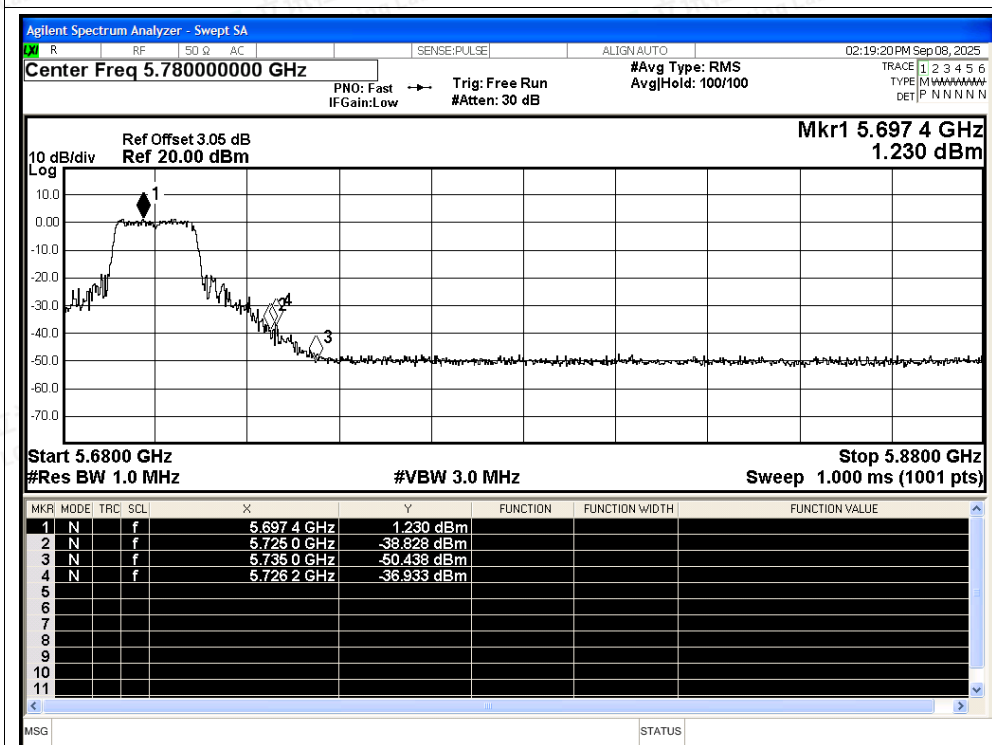

Restrict Band NVNT n20 5700MHz Ant1 Average

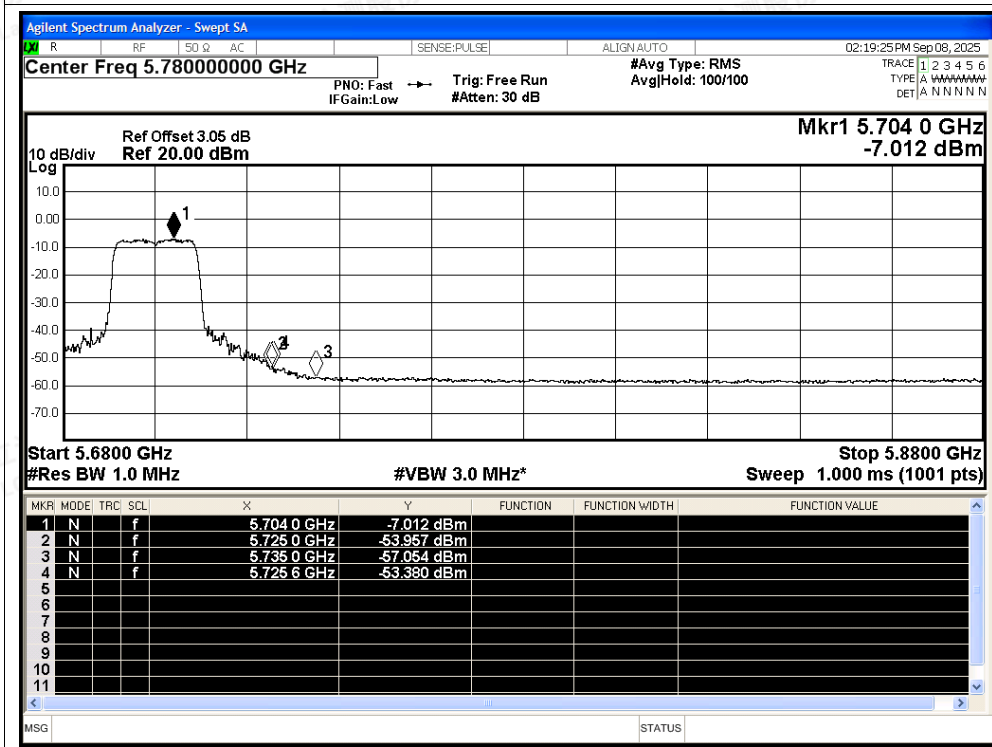

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

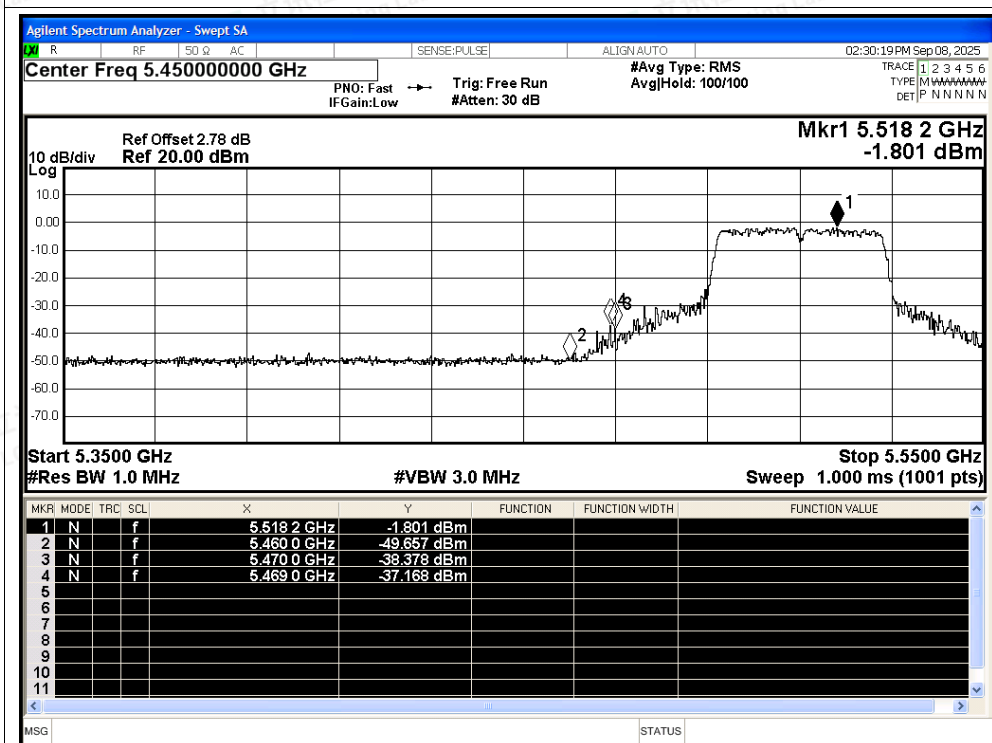

Restrict Band NVNT n40 5510MHz Ant1 Average

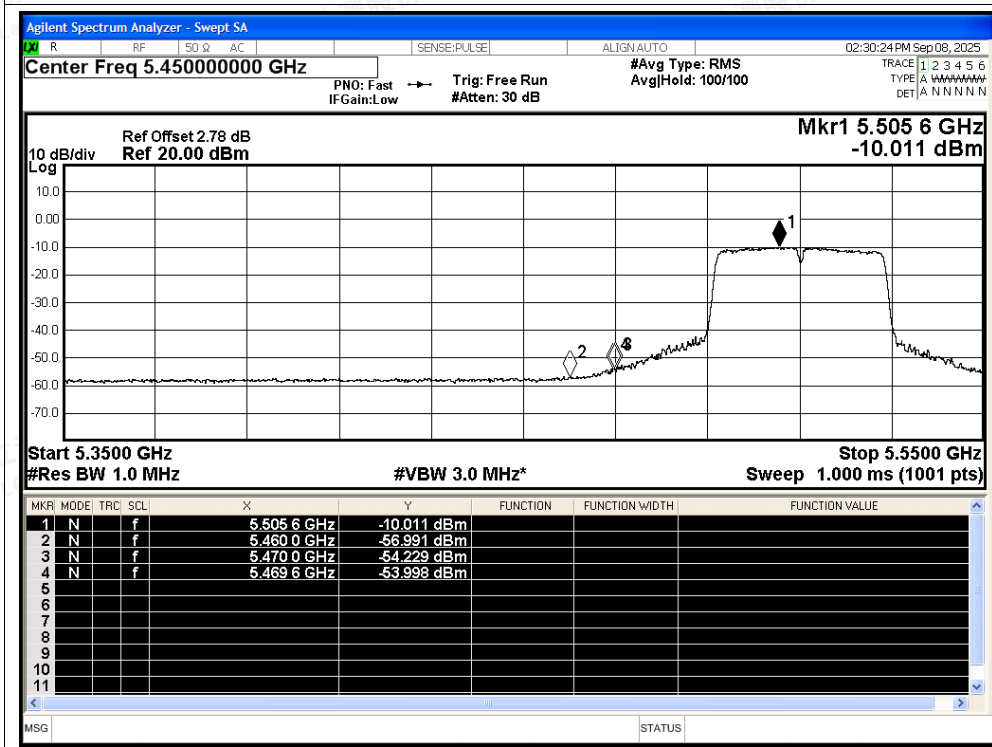

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

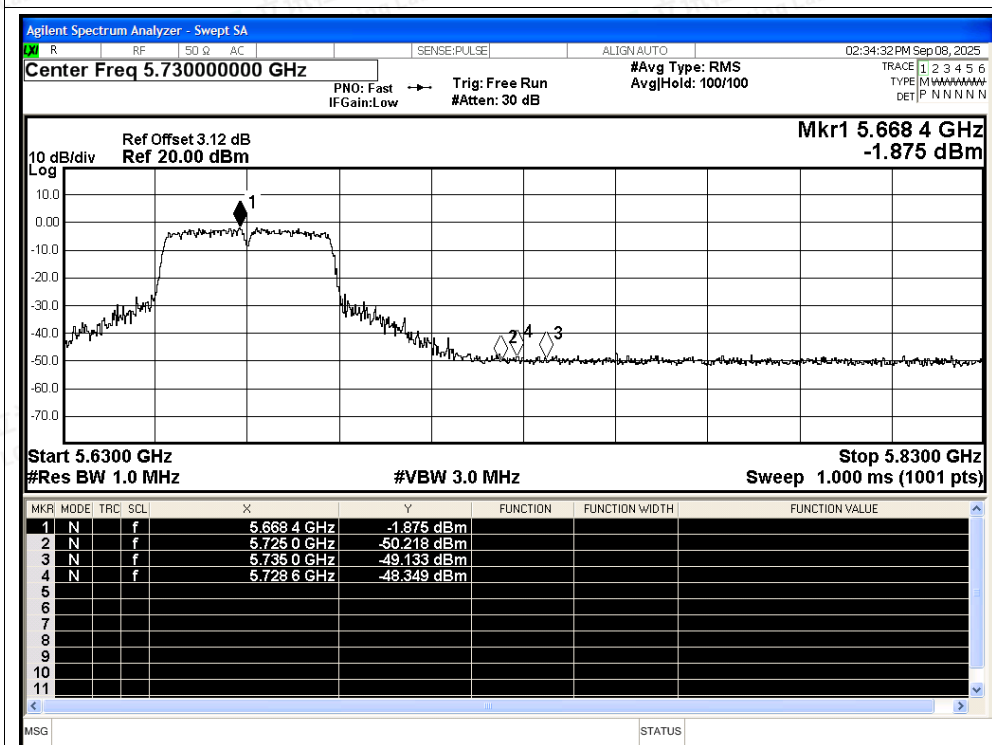

Restrict Band NVNT n40 5670MHz Ant1 Average

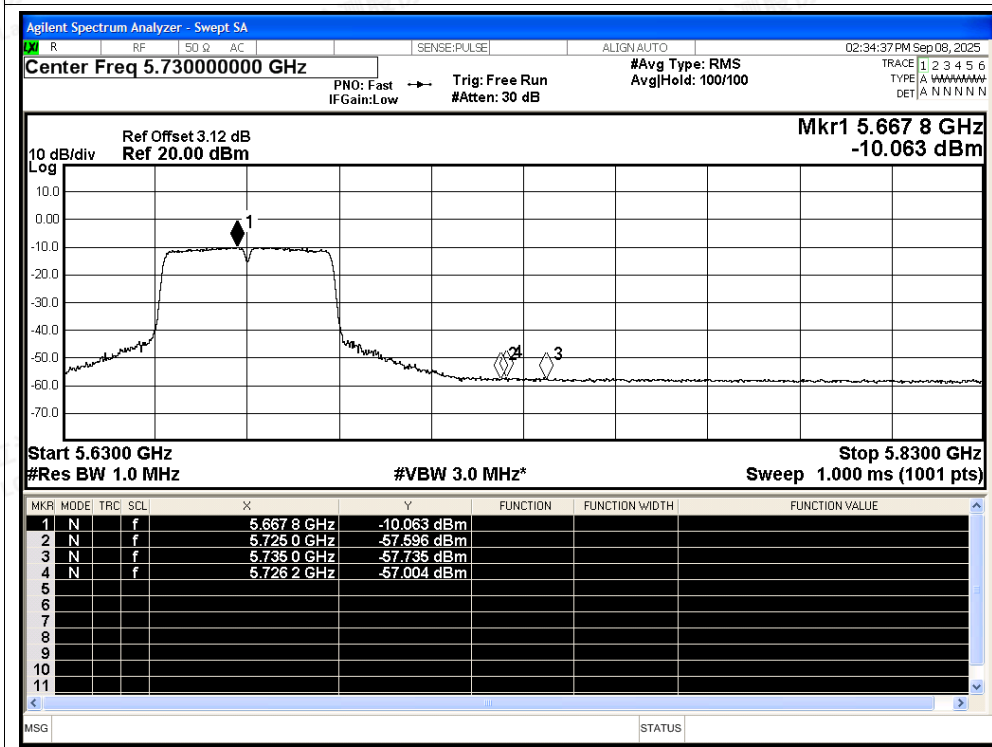

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

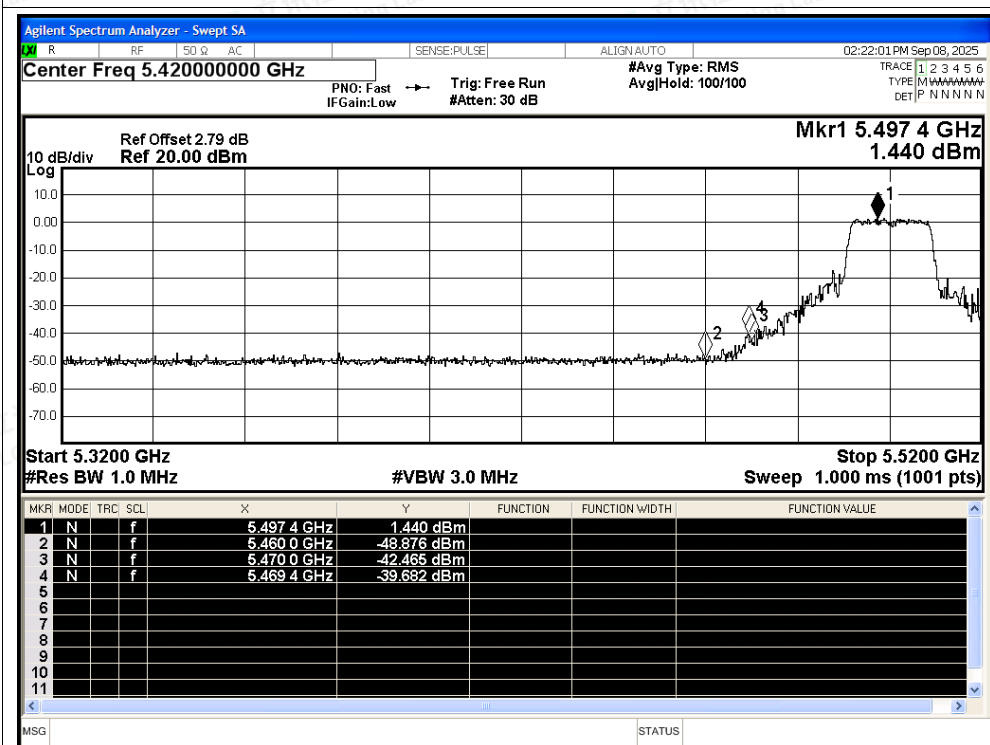

Restrict Band NVNT ac20 5500MHz Ant1 Average

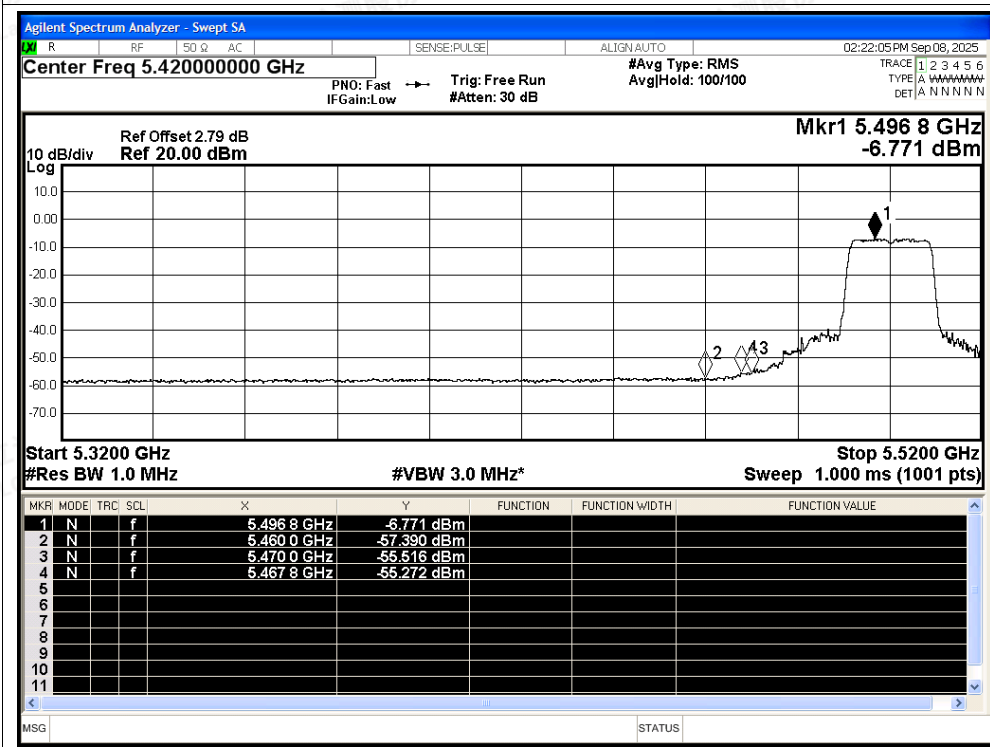

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

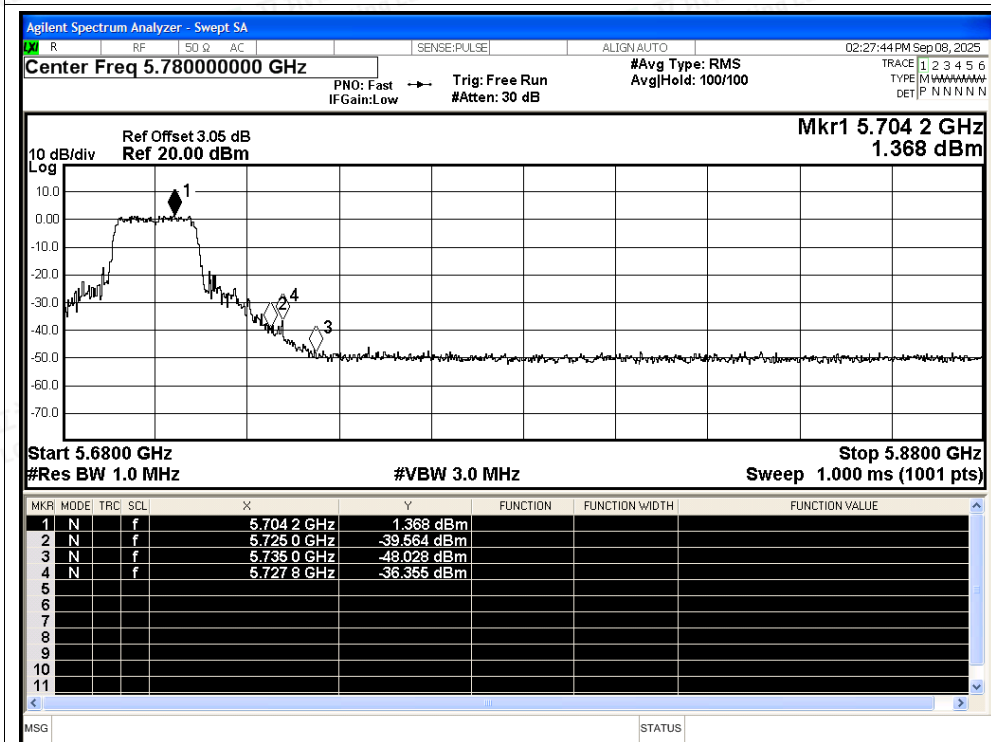

Restrict Band NVNT ac20 5700MHz Ant1 Average

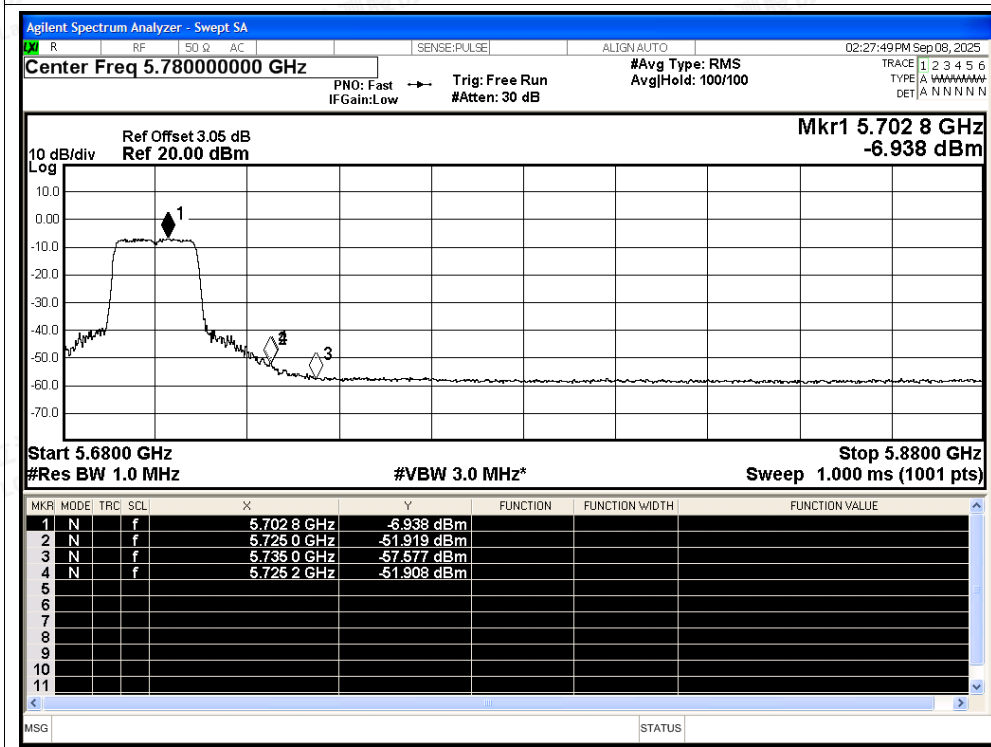

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

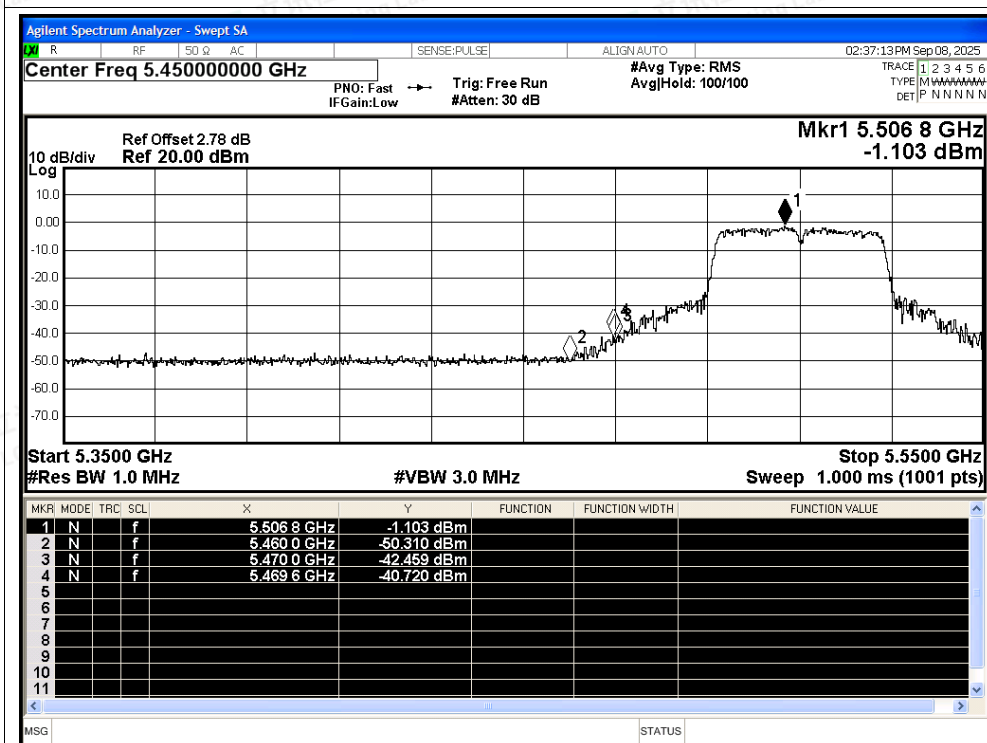

Restrict Band NVNT ac40 5510MHz Ant1 Average

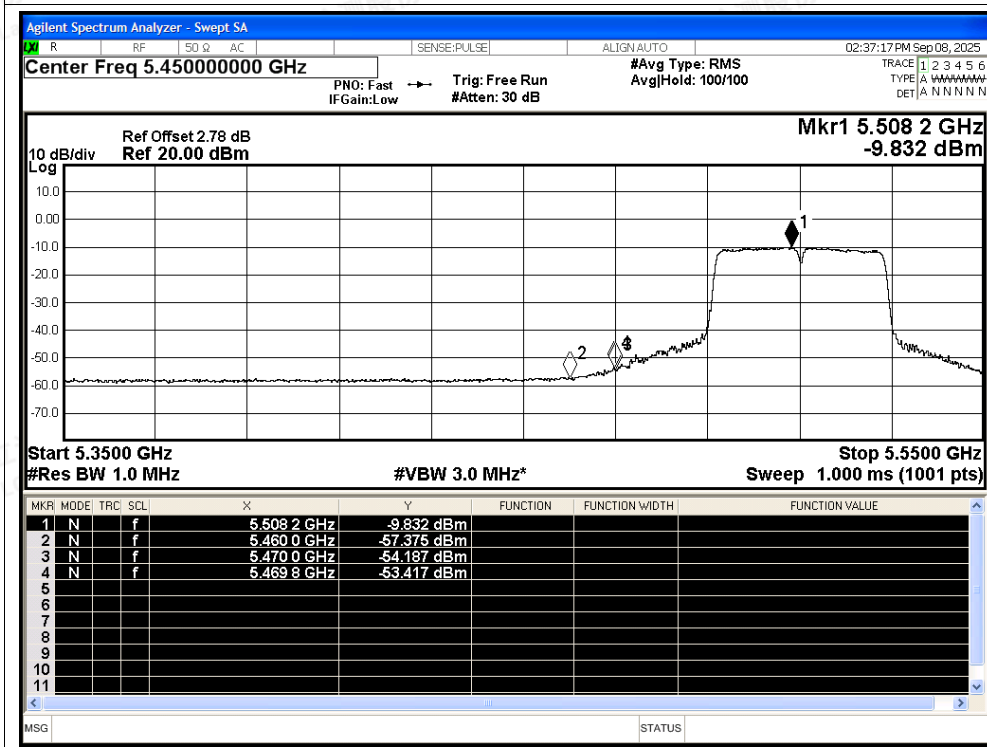

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant1 Peak

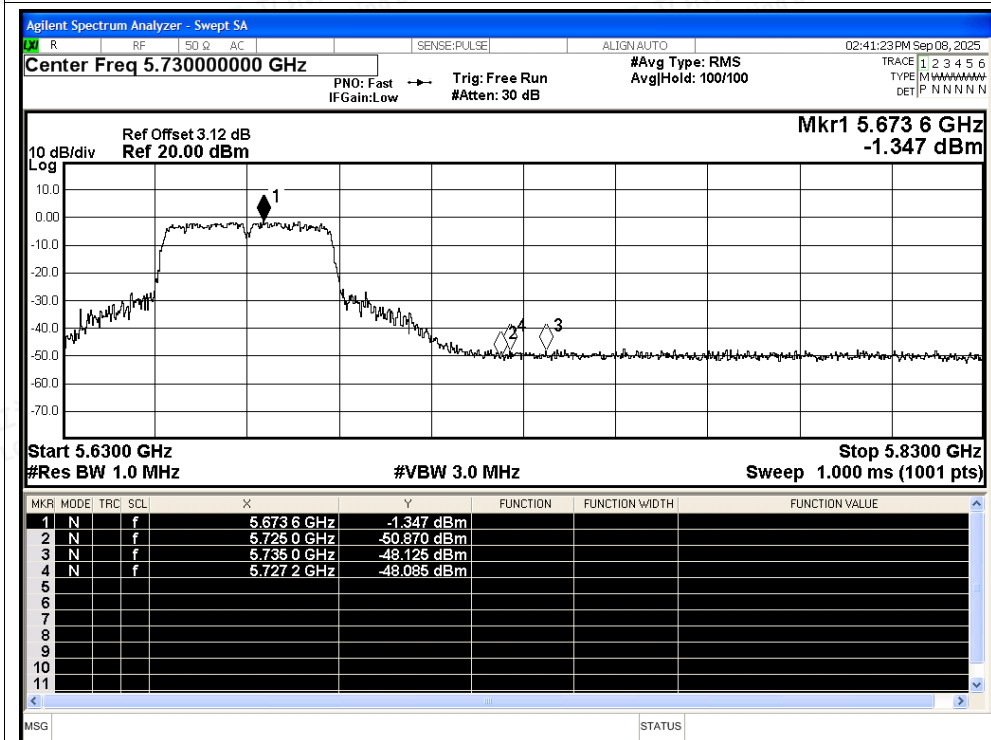

Restrict Band NVNT ac40 5670MHz Ant1 Average

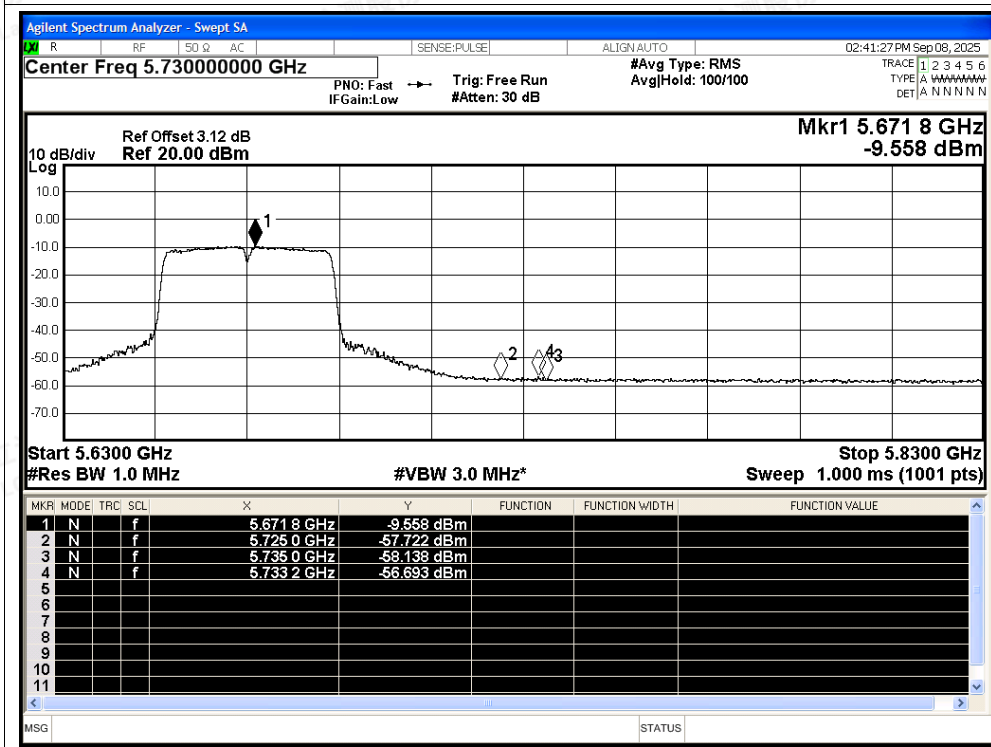

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant1 Peak

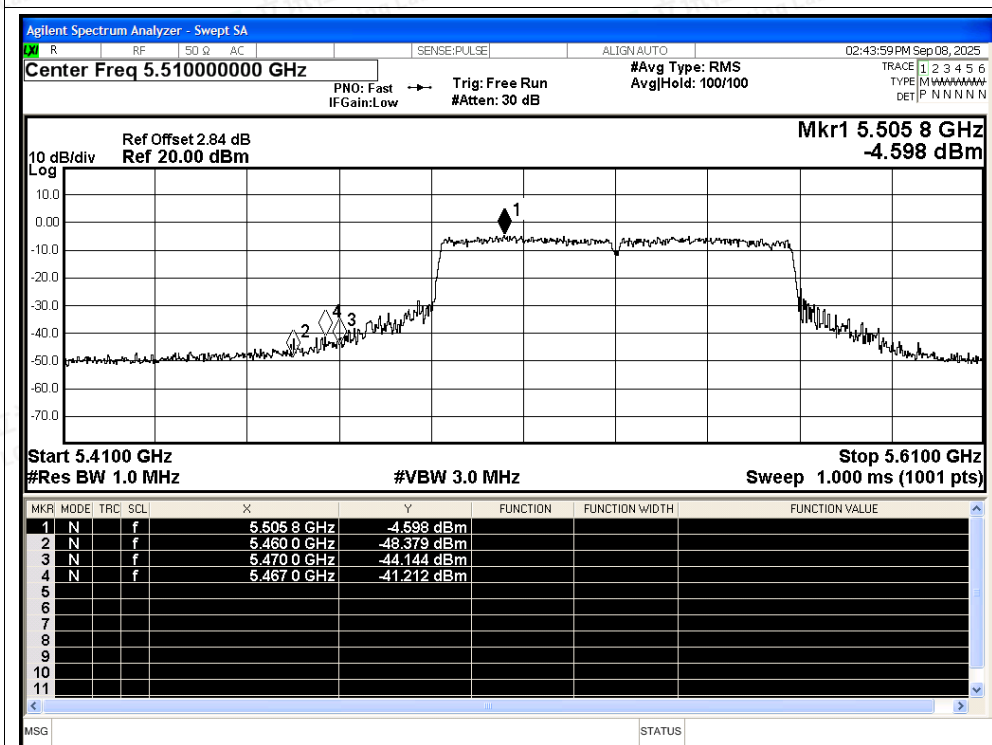

Restrict Band NVNT ac80 5530MHz Ant1 Average

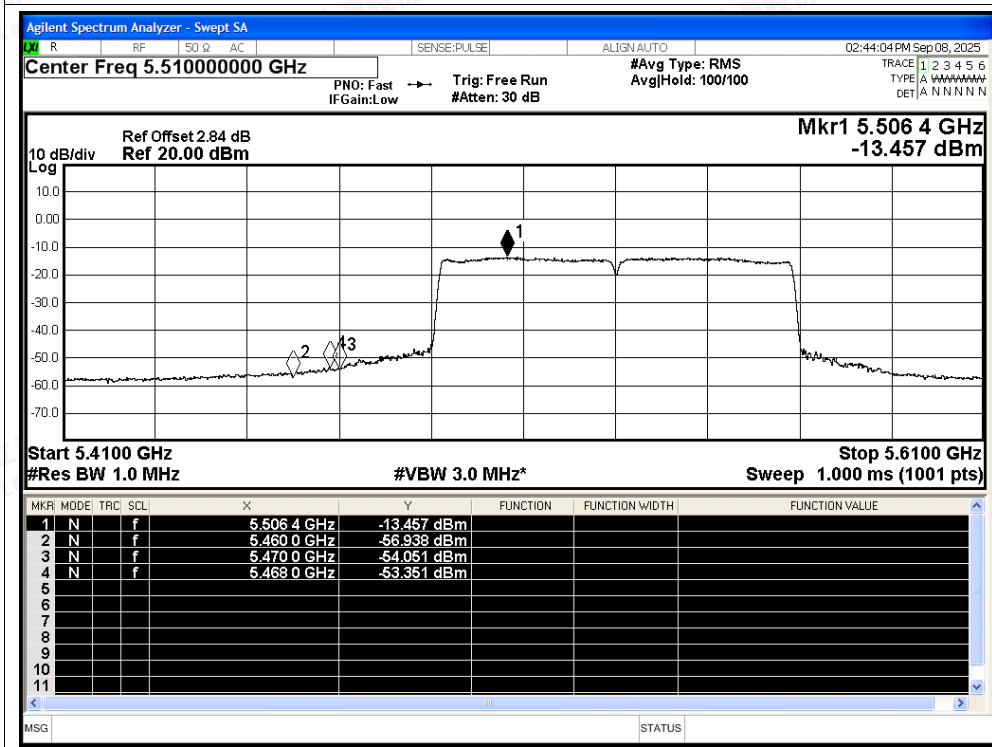

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant1 Peak

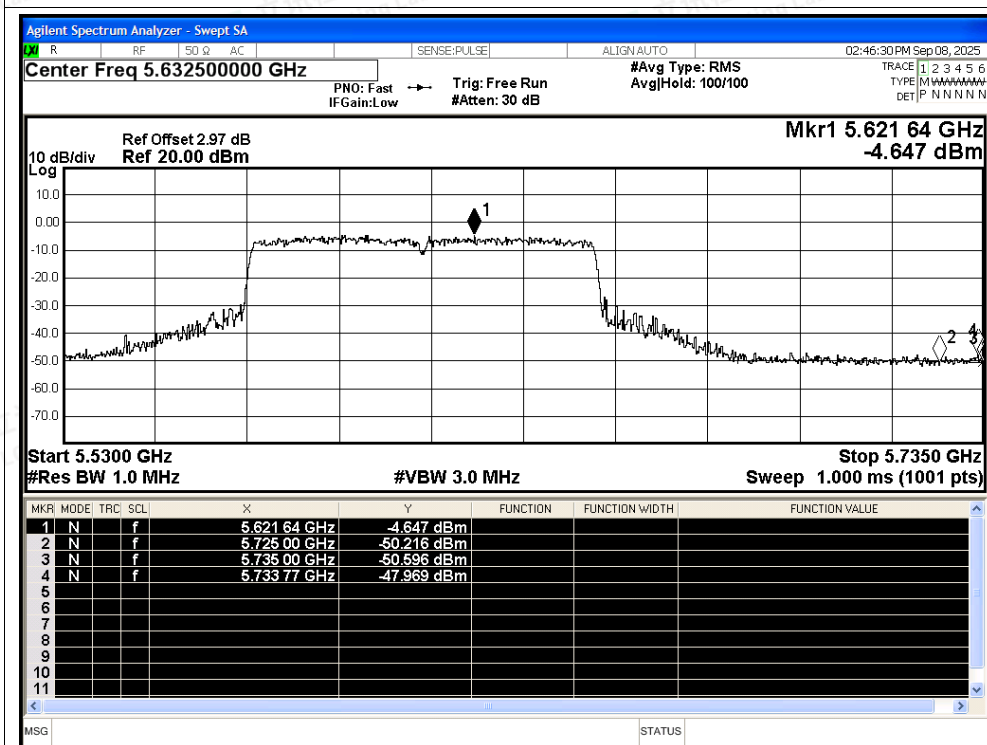

Restrict Band NVNT ac80 5610MHz Ant1 Average

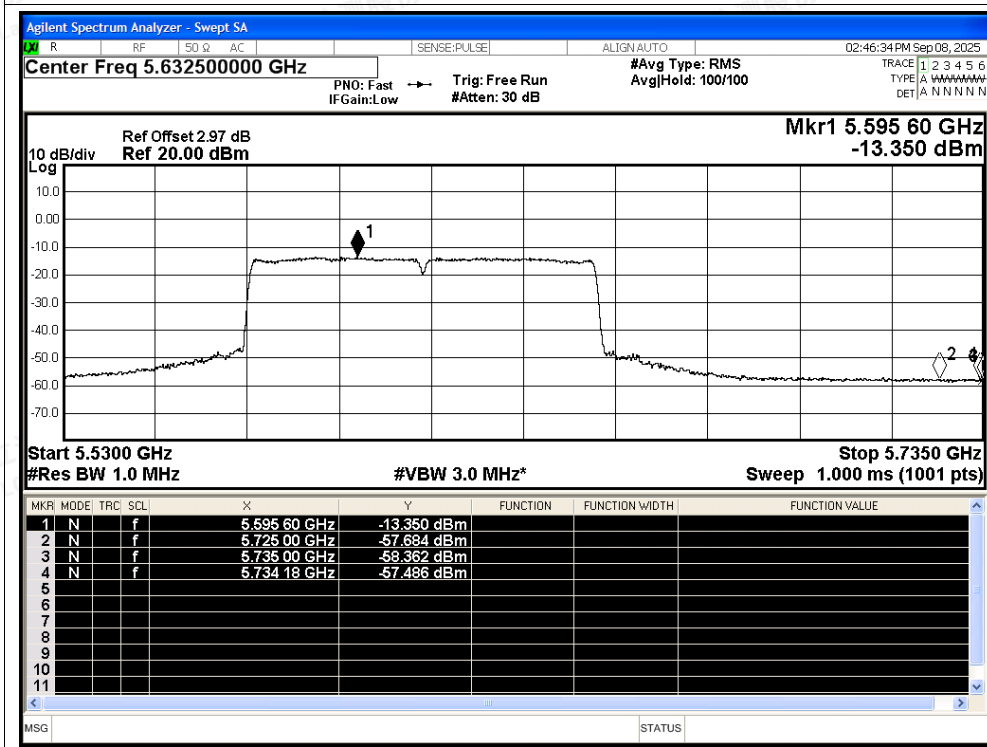

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant0	Ant1	Ant Ant1			
NVNT	n20	5500	47.13	48.44	53.83	Peak	68.2	Pass
NVNT	n20	5500	39.92	39.53	45.75	Average	54	Pass
NVNT	n20	5500	56.02	58.88	63.59	Peak	68.2	Pass
NVNT	n20	5500	42.07	42.27	48.19	Average	54	Pass
NVNT	n20	5500	52.71	55.16	60.04	Peak	68.2	Pass
NVNT	n20	5500	41.55	41.57	47.58	Average	54	Pass
NVNT	n20	5700	57.12	58.48	63.85	Peak	68.2	Pass
NVNT	n20	5700	44.60	43.63	50.15	Average	54	Pass
NVNT	n20	5700	60.84	60.38	66.63	Peak	68.2	Pass
NVNT	n20	5700	45.10	44.21	50.69	Average	54	Pass
NVNT	n20	5700	48.49	46.87	53.74	Peak	68.2	Pass
NVNT	n20	5700	39.77	40.54	46.18	Average	54	Pass
NVNT	n40	5510	47.49	47.65	53.59	Peak	68.2	Pass
NVNT	n40	5510	39.48	40.56	46.06	Average	54	Pass
NVNT	n40	5510	58.45	60.14	65.36	Peak	68.2	Pass
NVNT	n40	5510	43.19	43.55	49.39	Average	54	Pass
NVNT	n40	5510	51.78	58.93	62.09	Peak	68.2	Pass
NVNT	n40	5510	42.21	43.32	48.80	Average	54	Pass
NVNT	n40	5670	47.67	47.09	53.41	Peak	68.2	Pass
NVNT	n40	5670	39.23	39.95	45.62	Average	54	Pass
NVNT	n40	5670	50.57	48.96	55.82	Peak	68.2	Pass
NVNT	n40	5670	40.46	40.55	46.53	Average	54	Pass
NVNT	n40	5670	47.34	48.18	53.79	Peak	68.2	Pass
NVNT	n40	5670	39.52	39.81	45.69	Average	54	Pass
NVNT	ac20	5500	47.59	48.43	54.04	Peak	68.2	Pass
NVNT	ac20	5500	39.70	40.20	45.97	Average	54	Pass
NVNT	ac20	5500	54.78	57.63	62.34	Peak	68.2	Pass
NVNT	ac20	5500	42.07	42.32	48.22	Average	54	Pass
NVNT	ac20	5500	50.26	54.84	58.87	Peak	68.2	Pass
NVNT	ac20	5500	41.38	42.07	47.75	Average	54	Pass
NVNT	ac20	5700	60.19	57.75	65.08	Peak	68.2	Pass
NVNT	ac20	5700	43.30	45.67	50.59	Average	54	Pass
NVNT	ac20	5700	60.19	60.96	66.60	Peak	68.2	Pass
NVNT	ac20	5700	43.90	45.68	50.86	Average	54	Pass
NVNT	ac20	5700	46.81	49.28	54.15	Peak	68.2	Pass
NVNT	ac20	5700	39.80	40.01	45.93	Average	54	Pass
NVNT	ac40	5510	48.32	47.00	53.71	Peak	68.2	Pass
NVNT	ac40	5510	39.64	40.16	45.92	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	58.81	56.59	63.79	Peak	68.2	Pass
NVNT	ac40	5510	43.03	44.12	49.61	Average	54	Pass
NVNT	ac40	5510	54.34	54.85	60.62	Peak	68.2	Pass
NVNT	ac40	5510	42.86	43.35	49.13	Average	54	Pass
NVNT	ac40	5670	47.99	46.44	53.27	Peak	68.2	Pass
NVNT	ac40	5670	39.41	39.83	45.64	Average	54	Pass
NVNT	ac40	5670	50.04	49.22	55.66	Peak	68.2	Pass
NVNT	ac40	5670	40.34	40.86	46.62	Average	54	Pass
NVNT	ac40	5670	46.51	49.18	53.97	Peak	68.2	Pass
NVNT	ac40	5670	39.32	39.41	45.39	Average	54	Pass
NVNT	ac80	5530	49.96	48.93	55.48	Peak	68.2	Pass
NVNT	ac80	5530	42.09	40.84	47.51	Average	54	Pass
NVNT	ac80	5530	55.94	56.10	62.04	Peak	68.2	Pass
NVNT	ac80	5530	44.28	44.43	50.38	Average	54	Pass
NVNT	ac80	5530	51.76	53.17	58.51	Peak	68.2	Pass
NVNT	ac80	5530	43.12	43.73	49.45	Average	54	Pass
NVNT	ac80	5610	46.73	47.09	52.93	Peak	68.2	Pass
NVNT	ac80	5610	39.38	40.10	45.77	Average	54	Pass
NVNT	ac80	5610	49.04	49.34	55.21	Peak	68.2	Pass
NVNT	ac80	5610	40.29	40.29	46.31	Average	54	Pass
NVNT	ac80	5610	46.55	46.71	52.65	Peak	68.2	Pass
NVNT	ac80	5610	39.34	39.42	45.40	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5500	Ant0	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant0	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant0	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant0	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant0	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant0	5669.96	-40000	-7.05	25	Pass
NVNT	ac80	5530	Ant0	5530	0	0	25	Pass
NVNT	ac80	5610	Ant0	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5500MHz Ant0

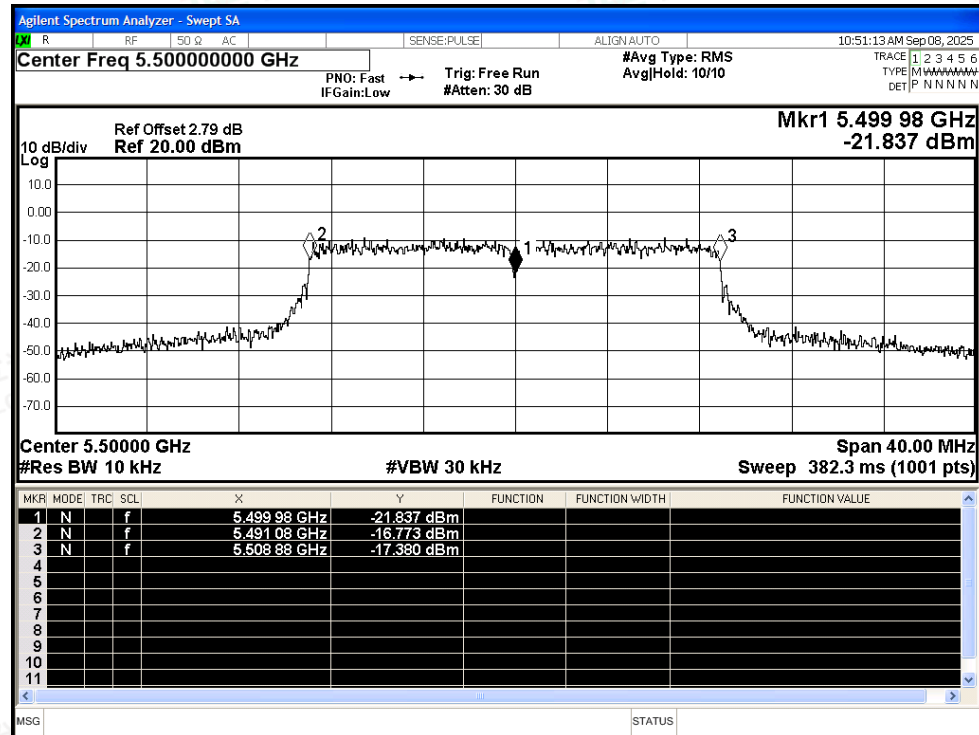

Freq. Stability NVNT ac20 5580MHz Ant0


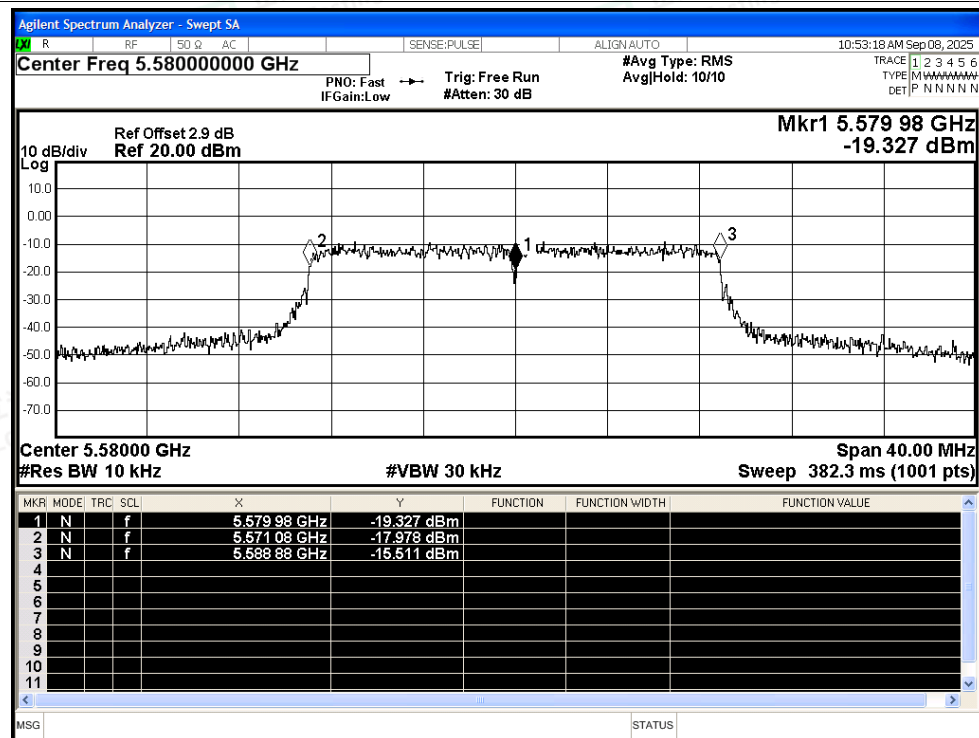


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

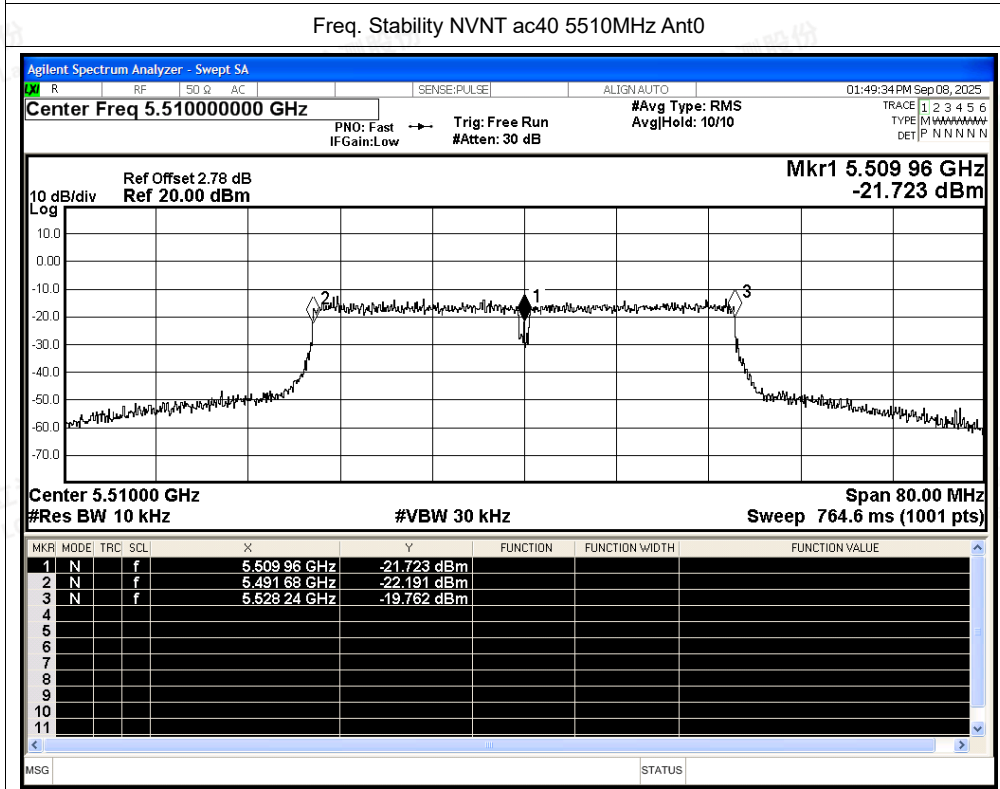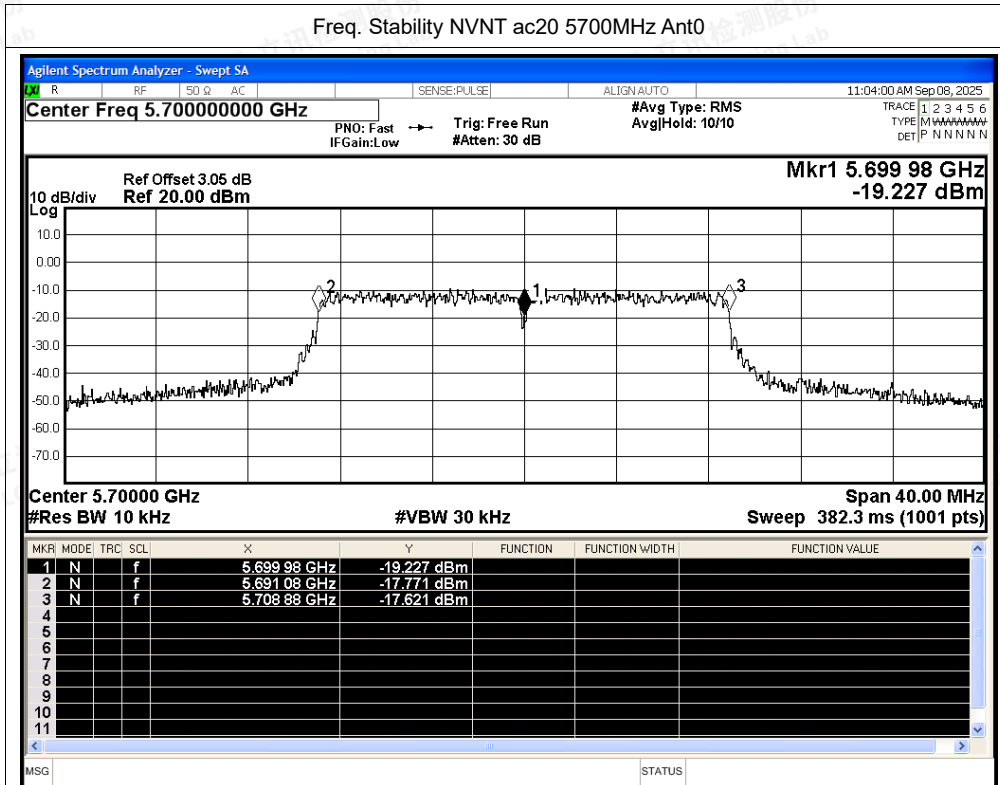




Freq. Stability NVNT ac40 5550MHz Ant0

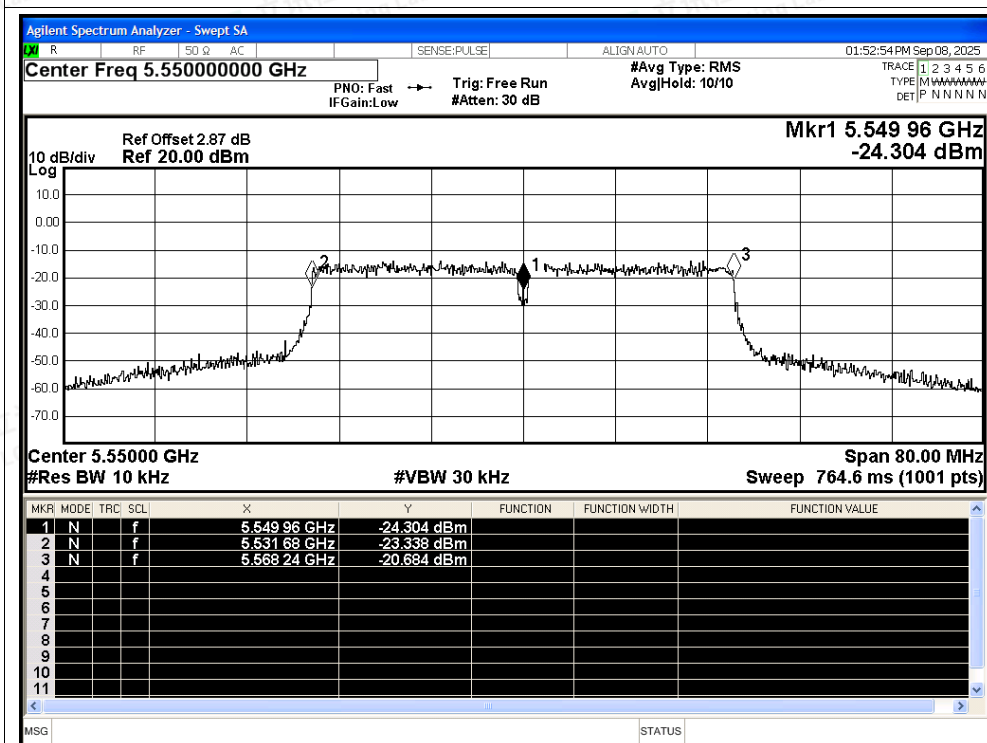

Freq. Stability NVNT ac40 5670MHz Ant0

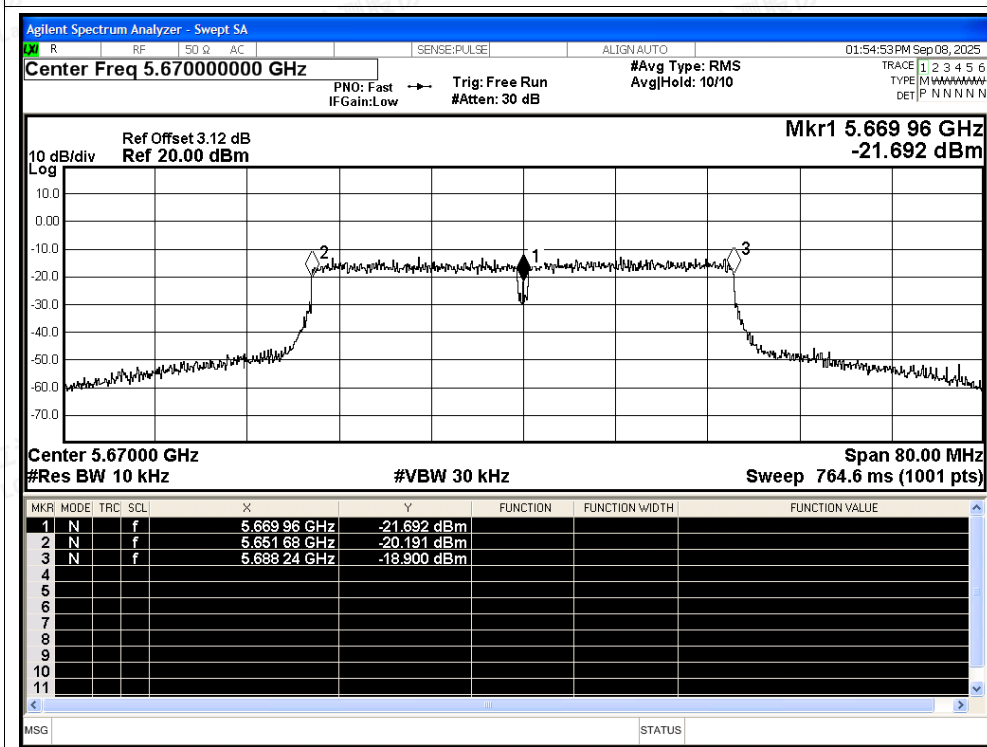

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5530MHz Ant0

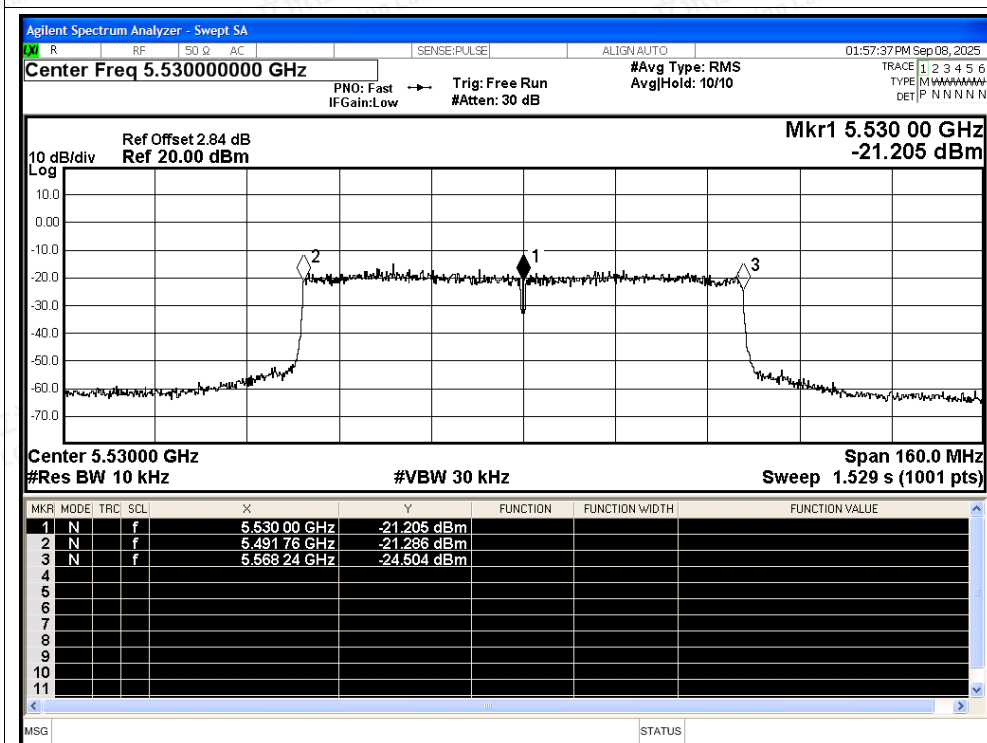

Freq. Stability NVNT ac80 5610MHz Ant0

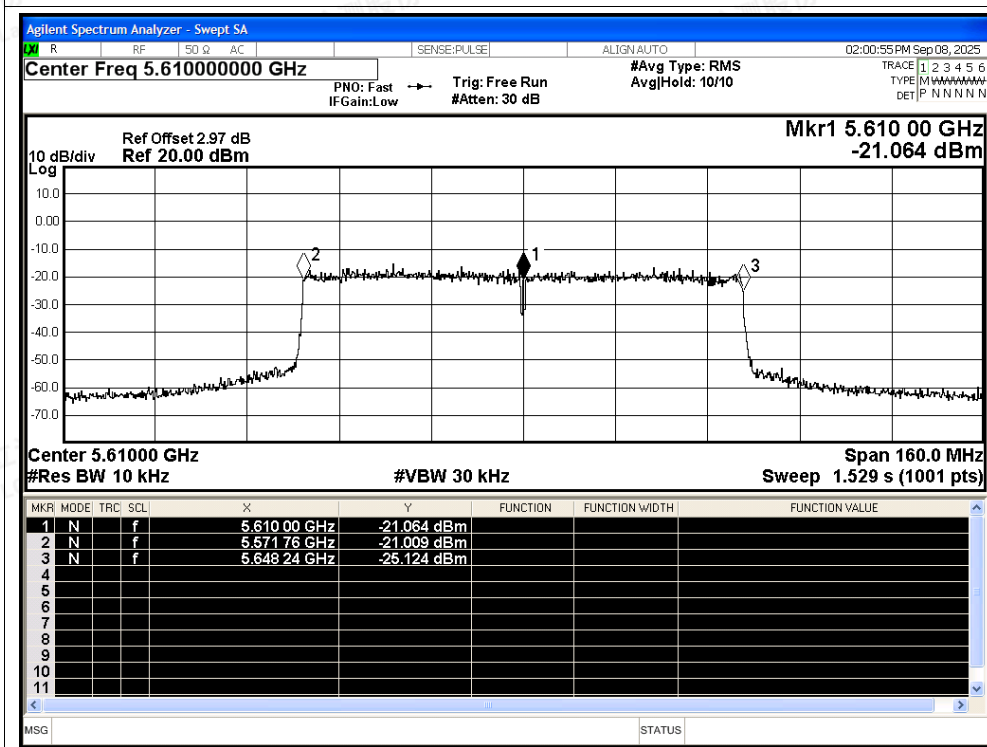

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5500	Ant1	5500	0	0	25	Pass
NVNT	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant1	5700	0	0	25	Pass
NVNT	ac40	5510	Ant1	5509.92	-80000	-14.52	25	Pass
NVNT	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5500MHz Ant1

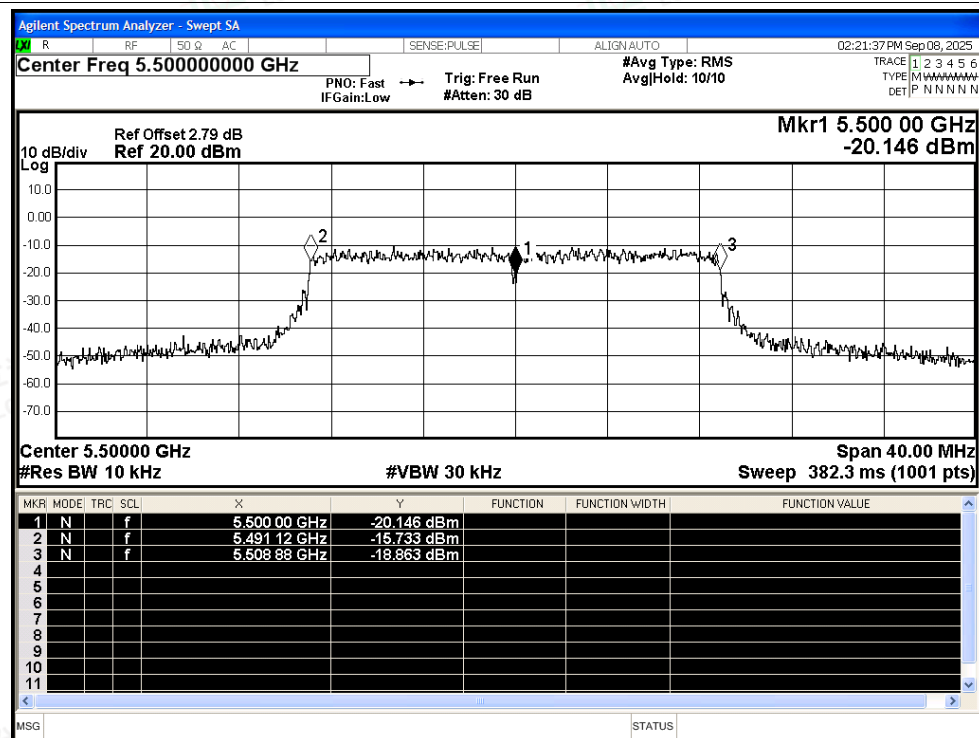

Freq. Stability NVNT ac20 5580MHz Ant1

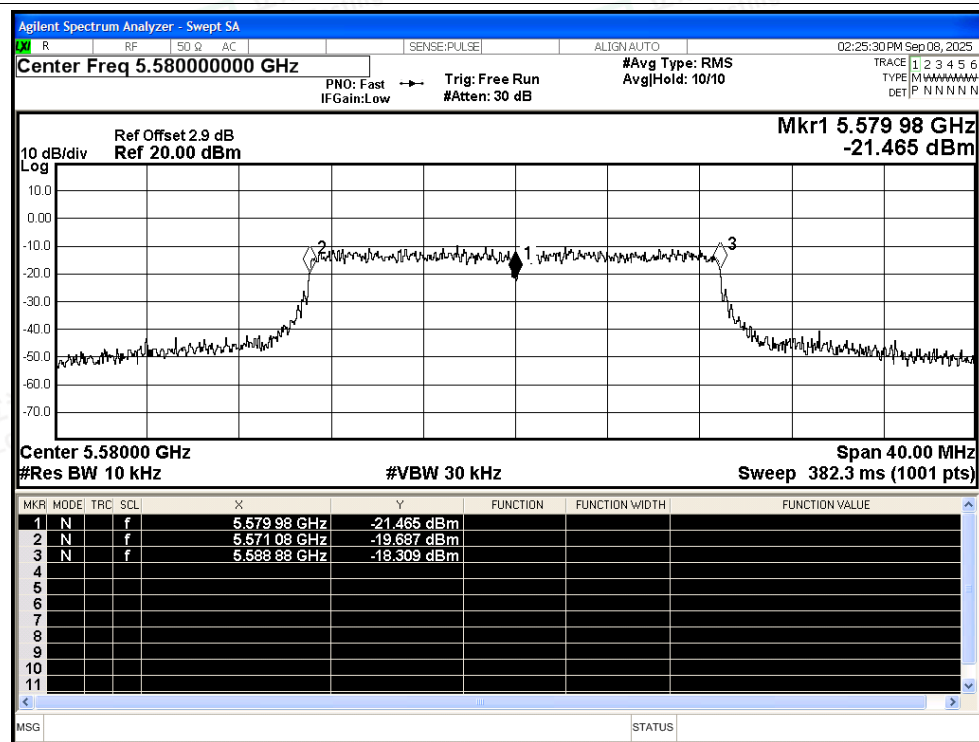

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5700MHz Ant1

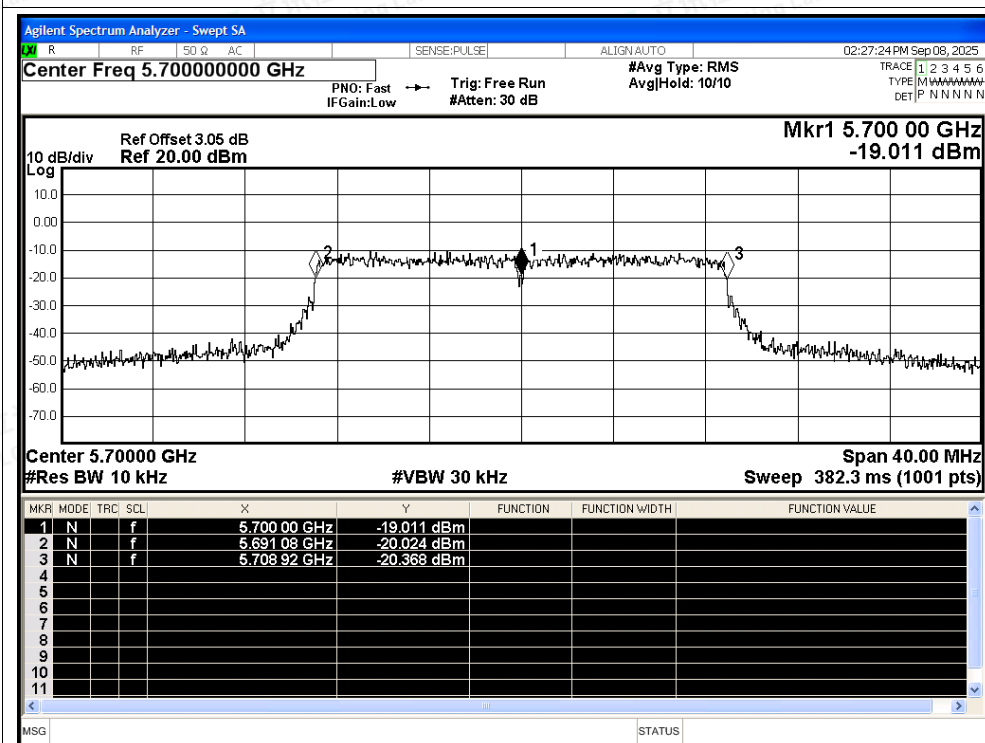

Freq. Stability NVNT ac40 5510MHz Ant1

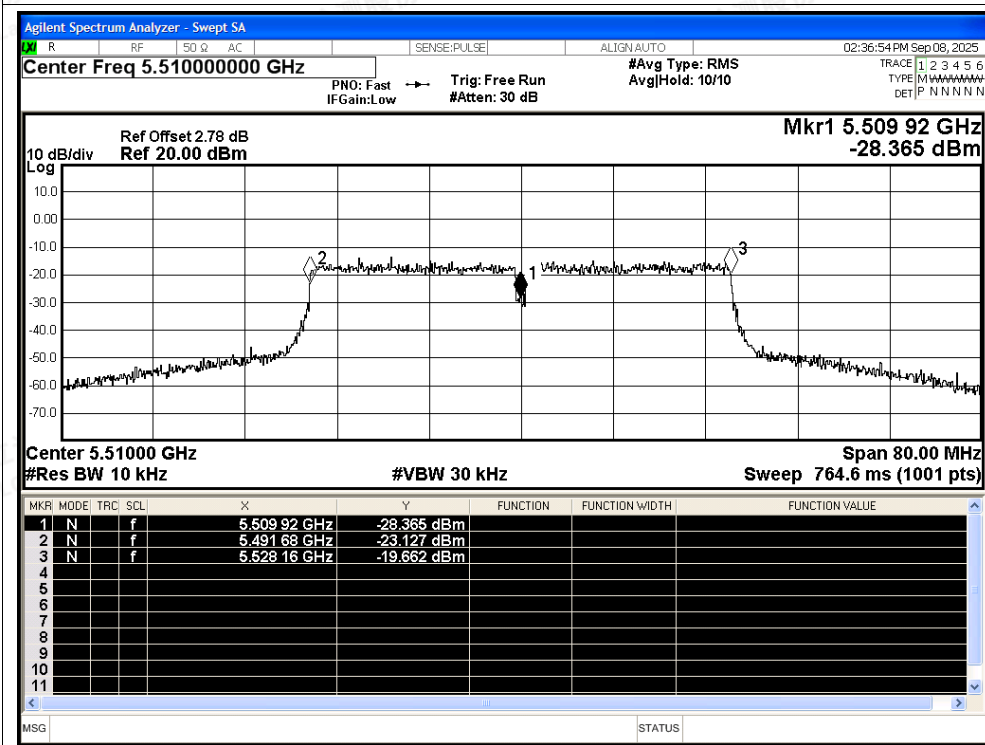

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5550MHz Ant1

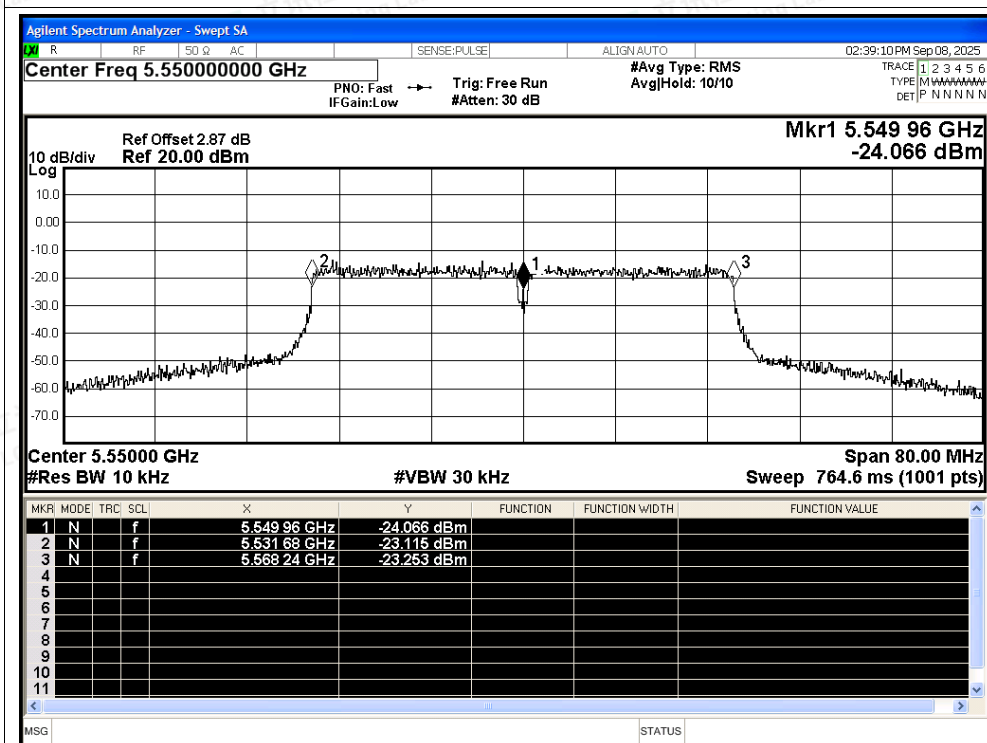

Freq. Stability NVNT ac40 5670MHz Ant1

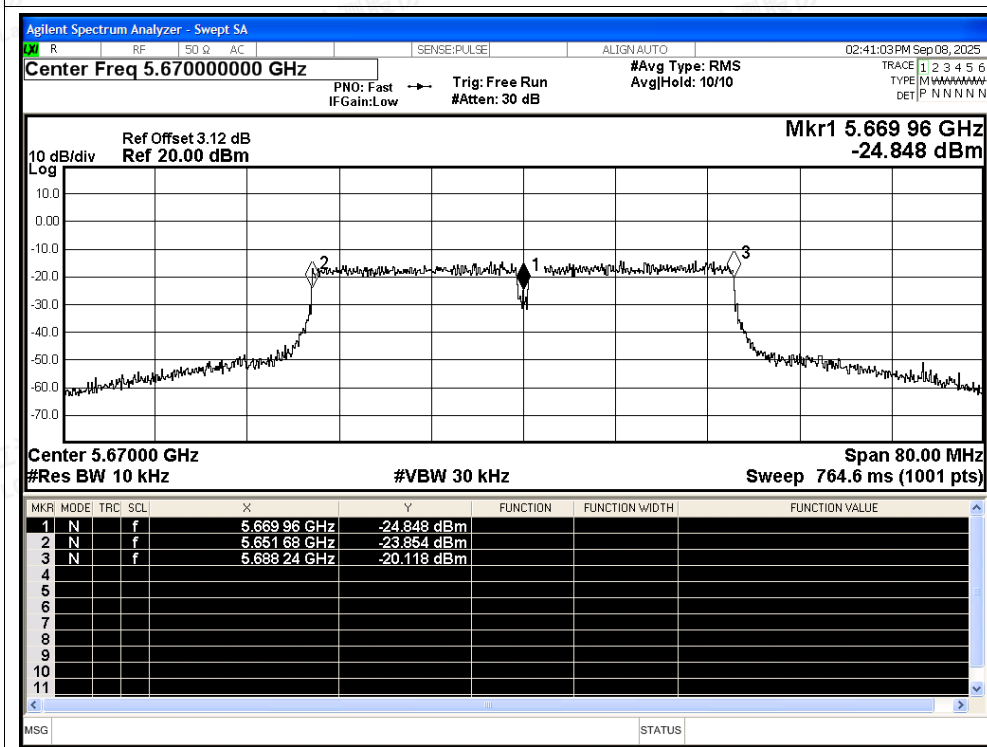

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5530MHz Ant1

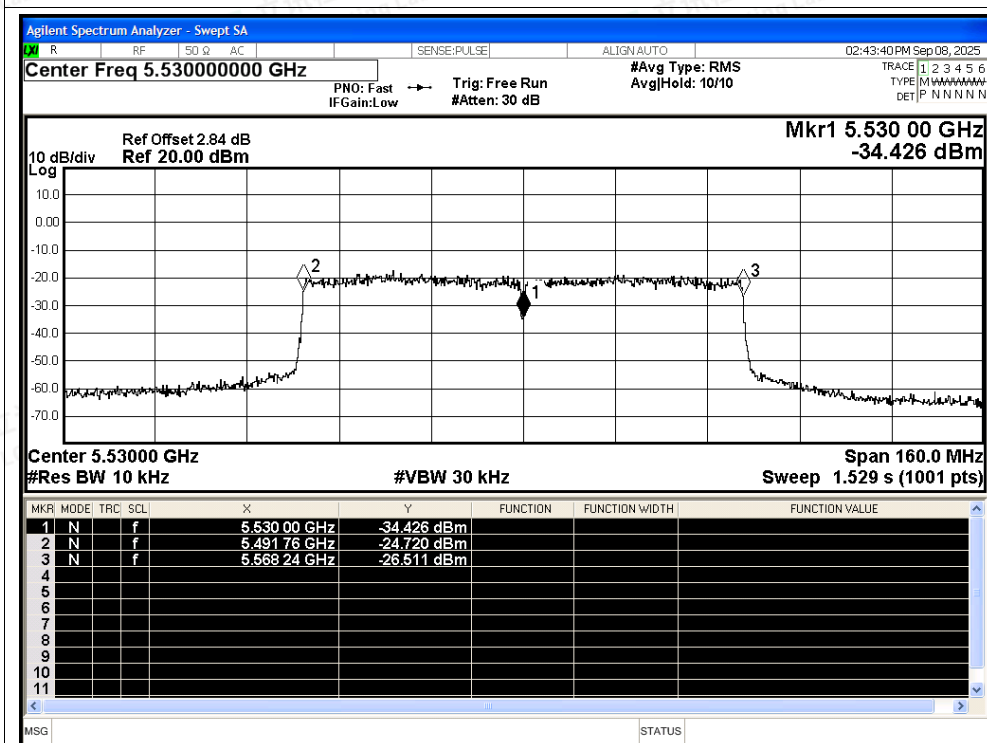

Freq. Stability NVNT ac80 5610MHz Ant1

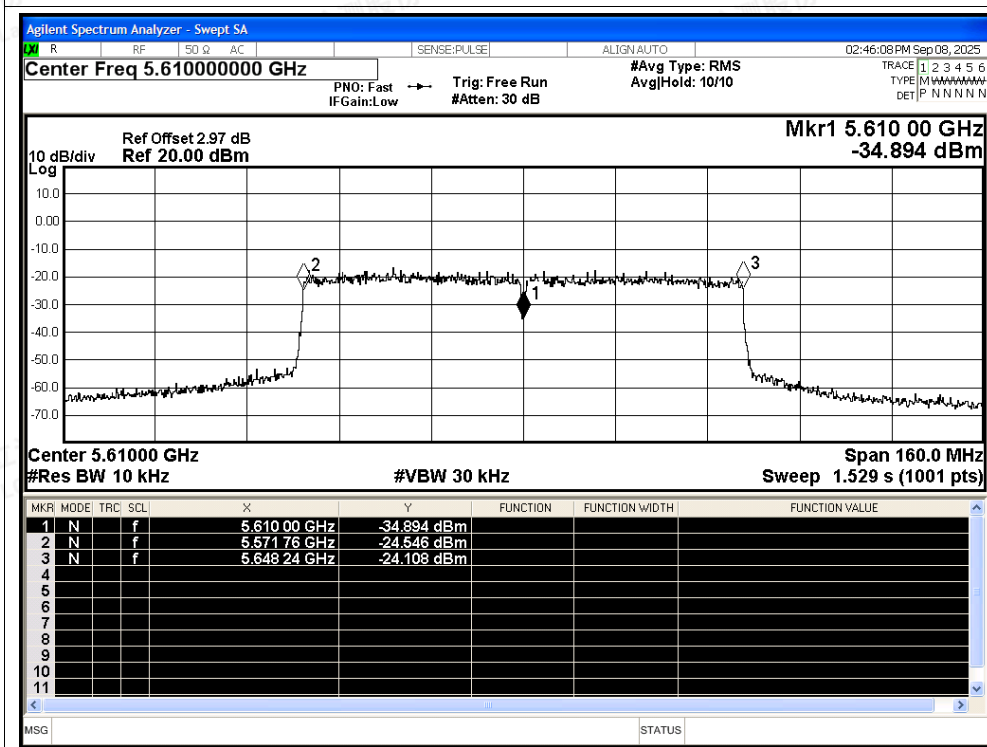

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant0	94.56	0.24	0.91
NVNT	a	5580	Ant0	94.56	0.24	0.91
NVNT	a	5700	Ant0	94.56	0.24	0.91
NVNT	n20	5500	Ant0	93.67	0.28	1.07
NVNT	n20	5580	Ant0	93.77	0.28	1.07
NVNT	n20	5700	Ant0	93.67	0.28	1.07
NVNT	n40	5510	Ant0	94.79	0.23	0.9
NVNT	n40	5550	Ant0	94.71	0.24	0.9
NVNT	n40	5670	Ant0	94.71	0.24	0.9
NVNT	ac20	5500	Ant0	93.72	0.28	1.06
NVNT	ac20	5580	Ant0	93.82	0.28	1.06
NVNT	ac20	5700	Ant0	93.72	0.28	1.06
NVNT	ac40	5510	Ant0	94.72	0.24	0.9
NVNT	ac40	5550	Ant0	94.72	0.24	0.9
NVNT	ac40	5670	Ant0	94.81	0.23	0.9
NVNT	ac80	5530	Ant0	89.65	0.47	1.86
NVNT	ac80	5610	Ant0	89.65	0.47	1.86




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5500MHz Ant0

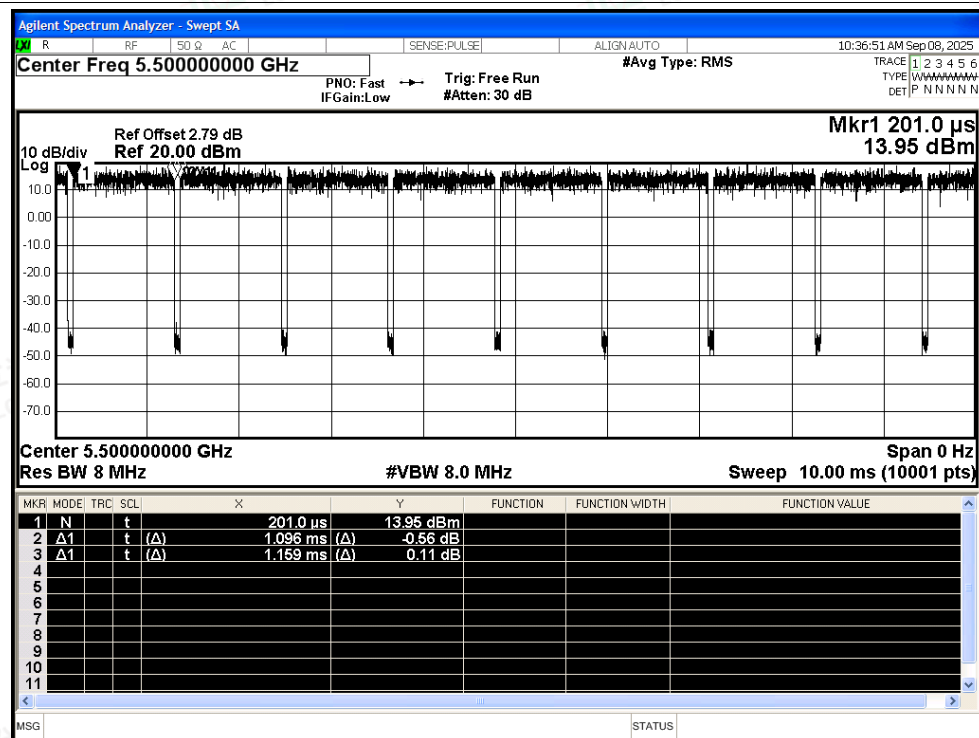

Duty Cycle NVNT a 5580MHz Ant0

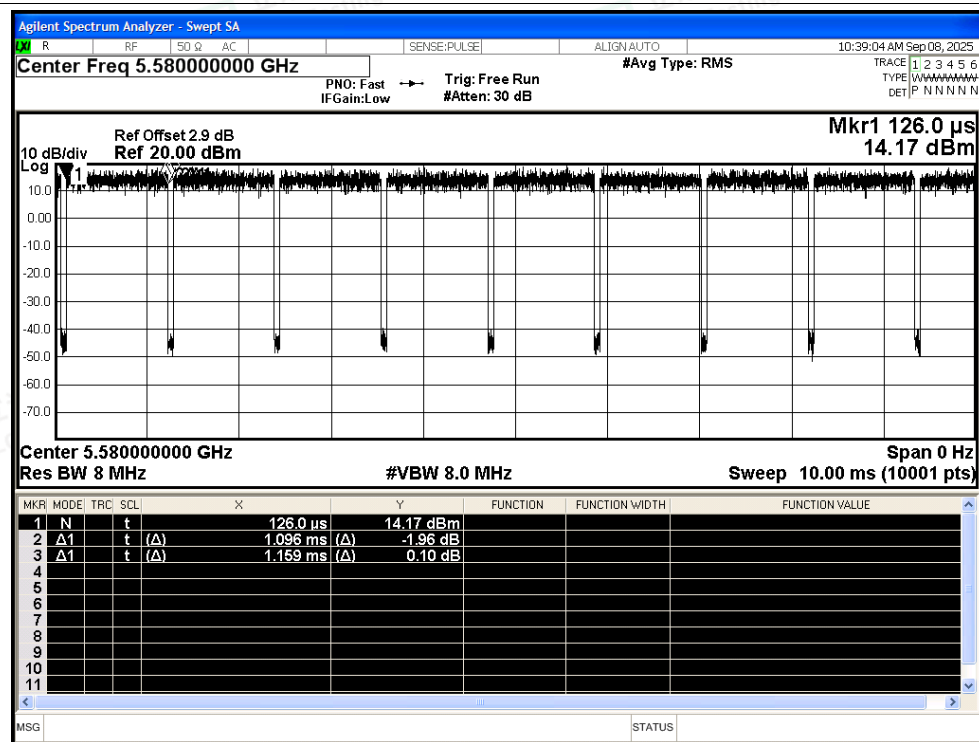

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant0

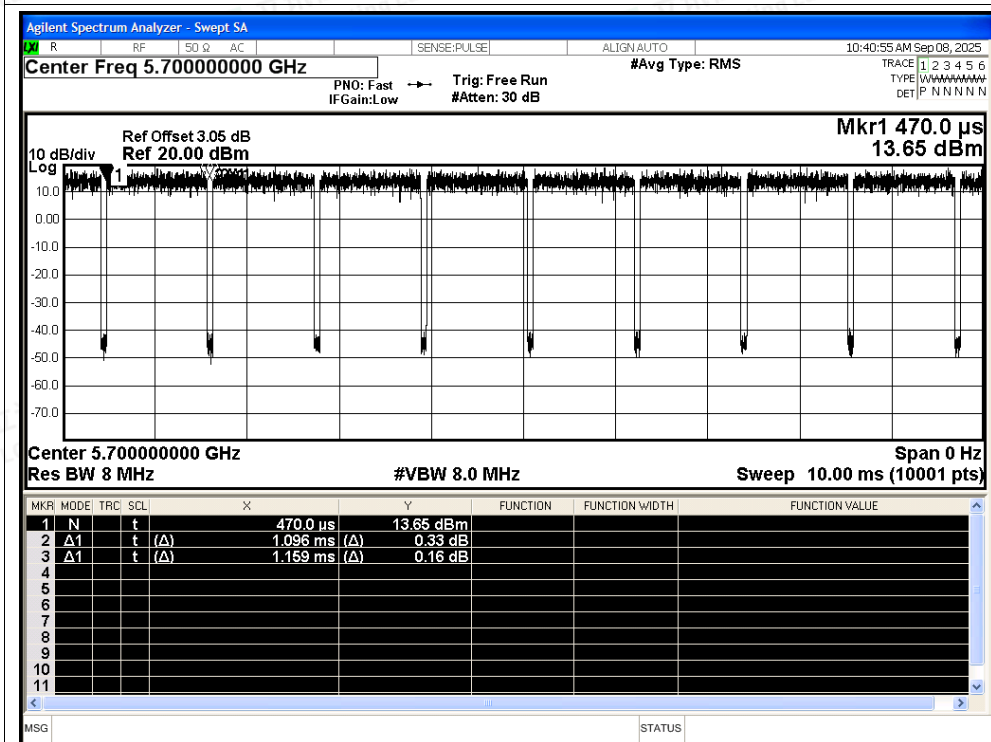


Duty Cycle NVNT n20 5500MHz Ant0

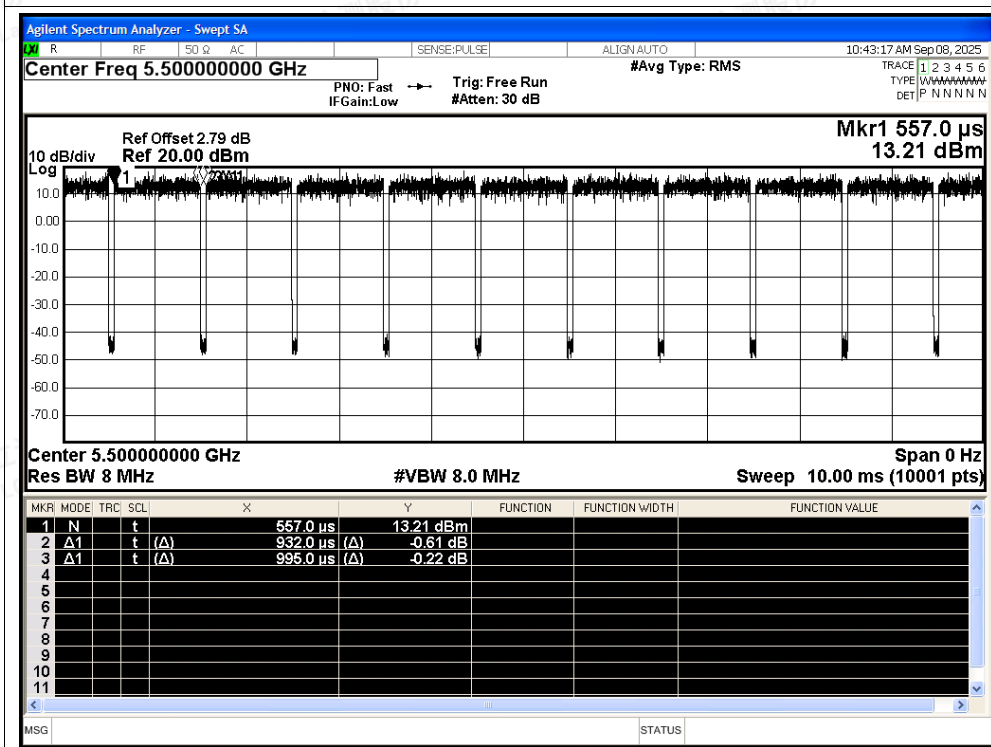




Duty Cycle NVNT n20 5580MHz Ant0

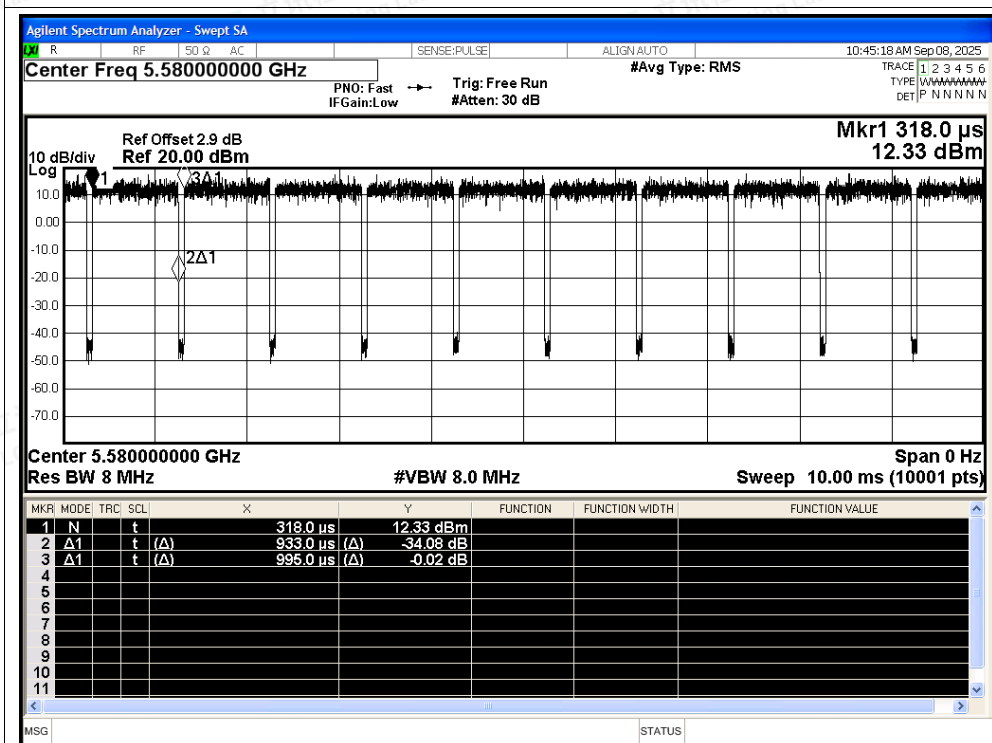

Duty Cycle NVNT n20 5700MHz Ant0

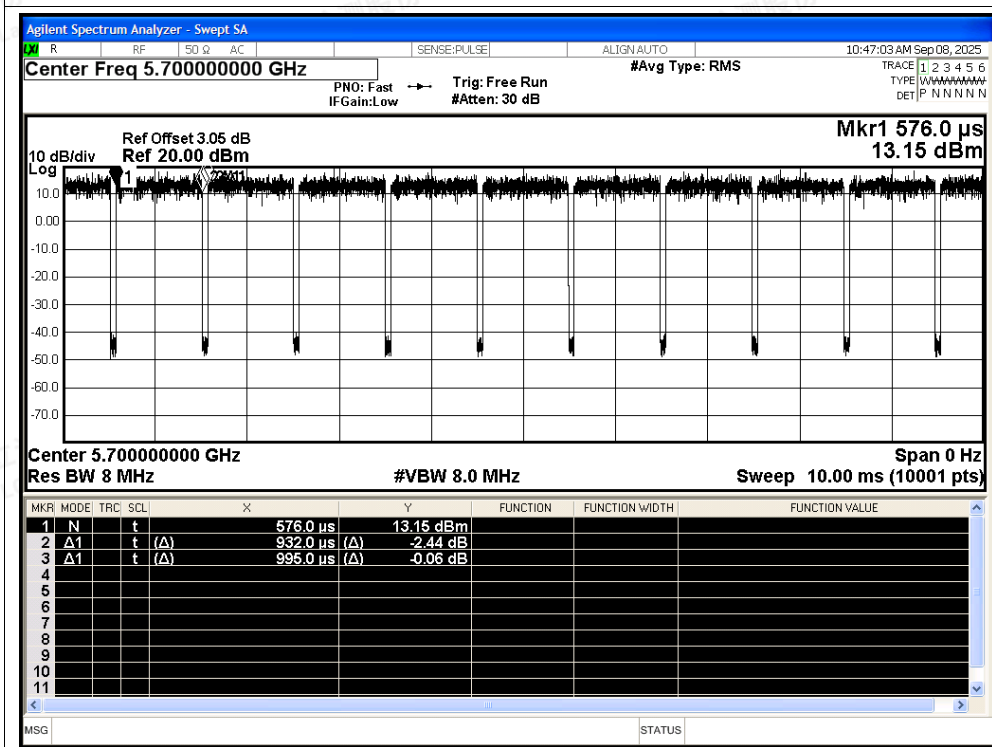

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant0

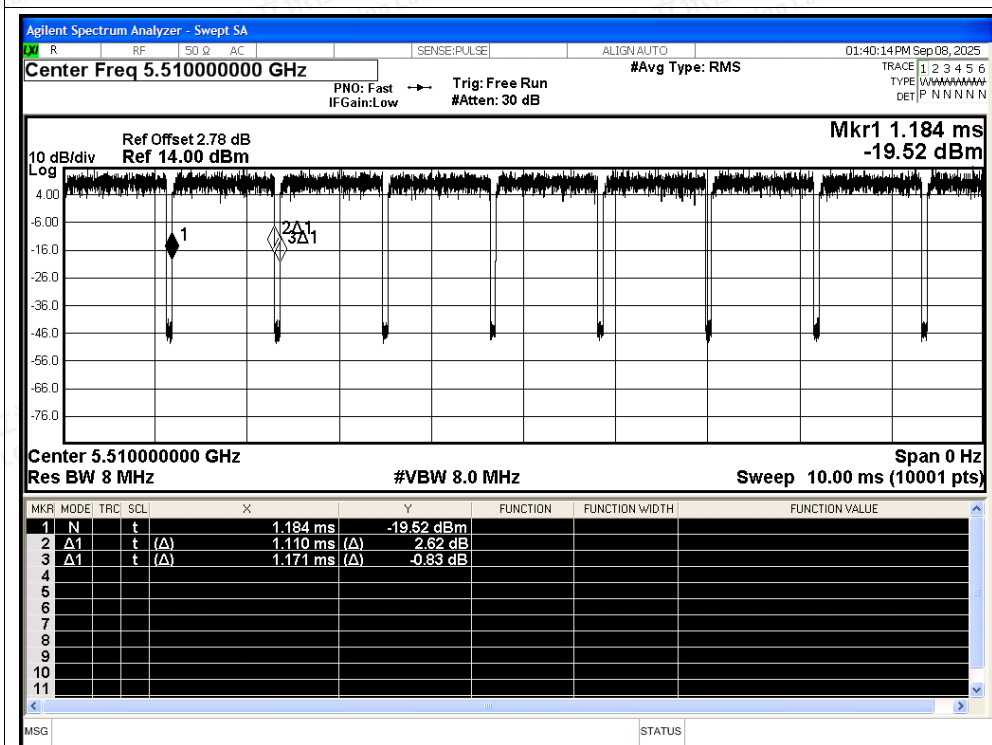

Duty Cycle NVNT n40 5550MHz Ant0

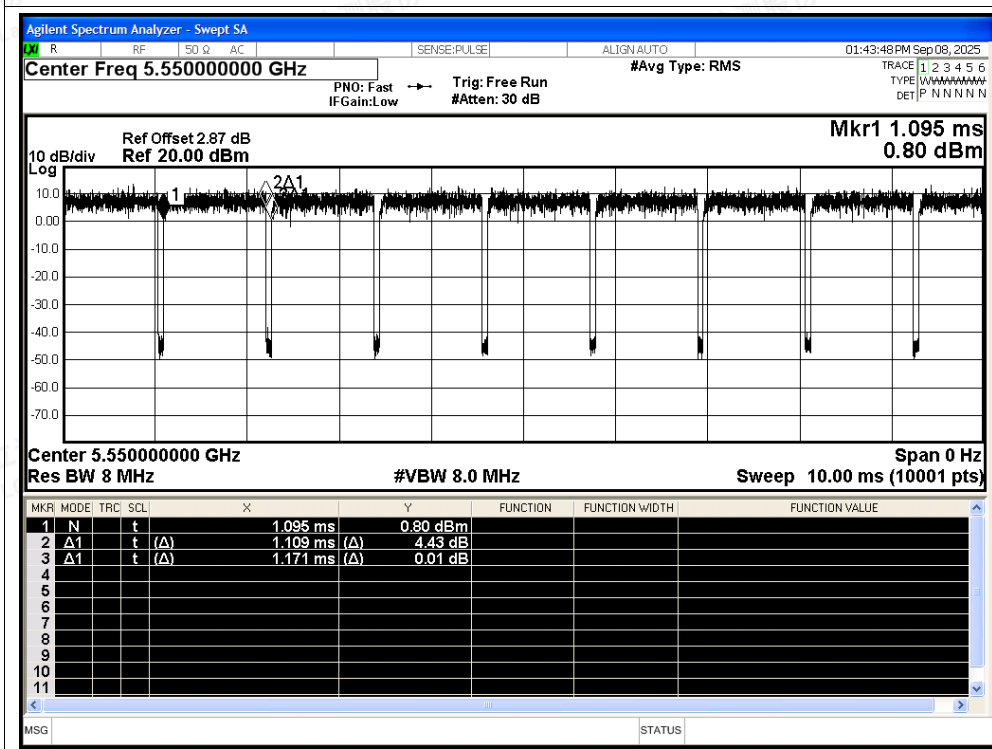

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant0

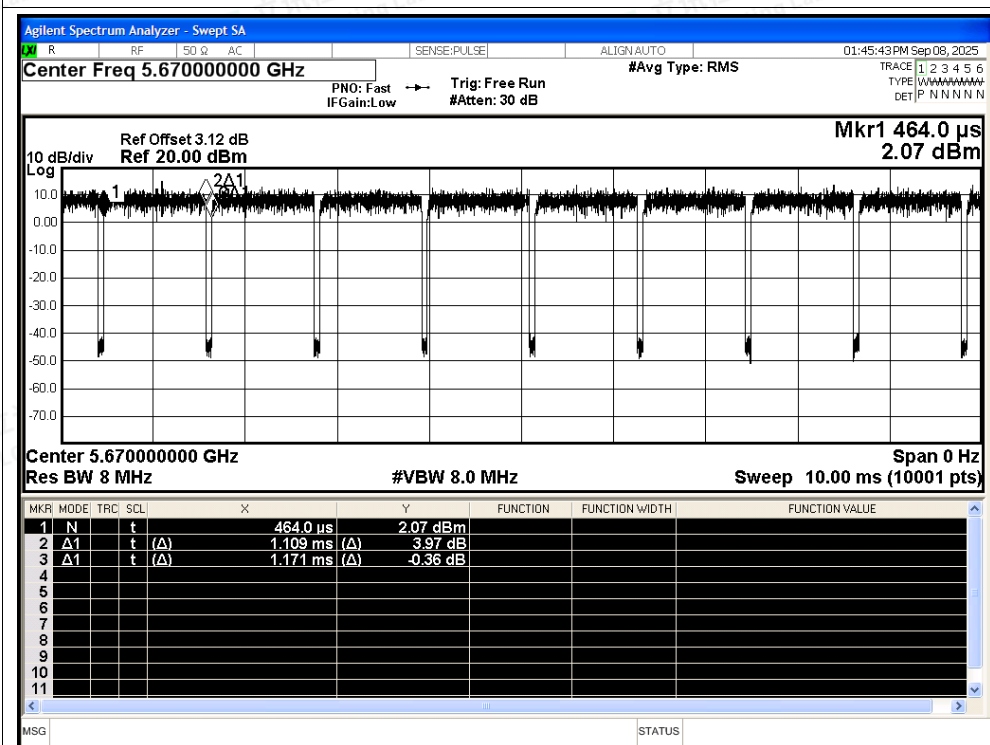

Duty Cycle NVNT ac20 5500MHz Ant0

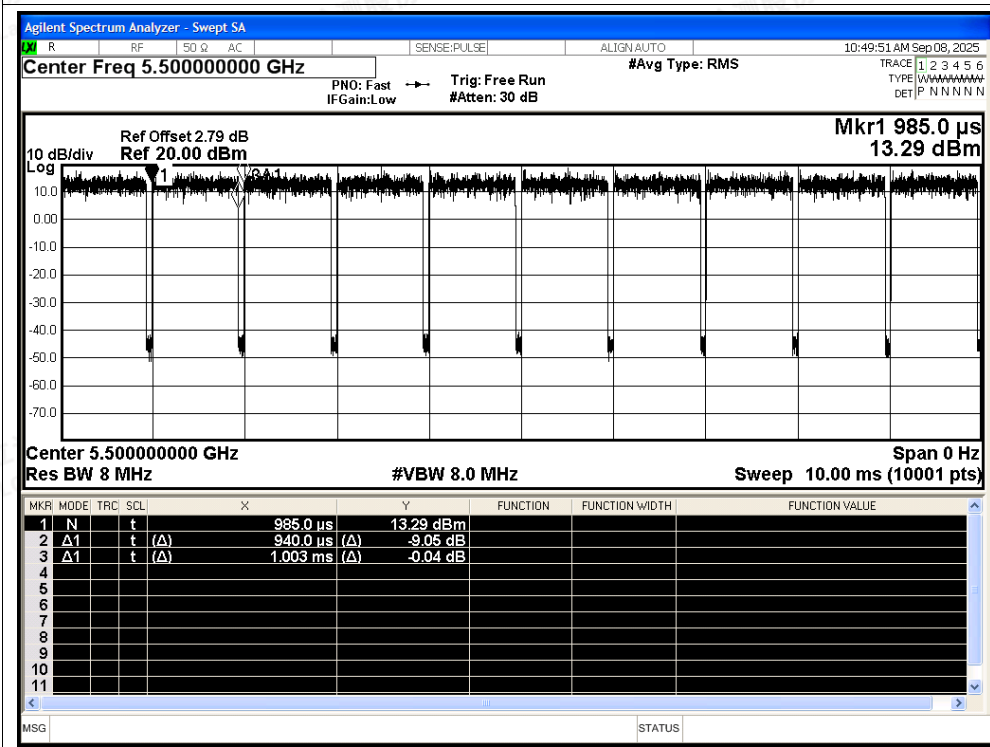

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant0

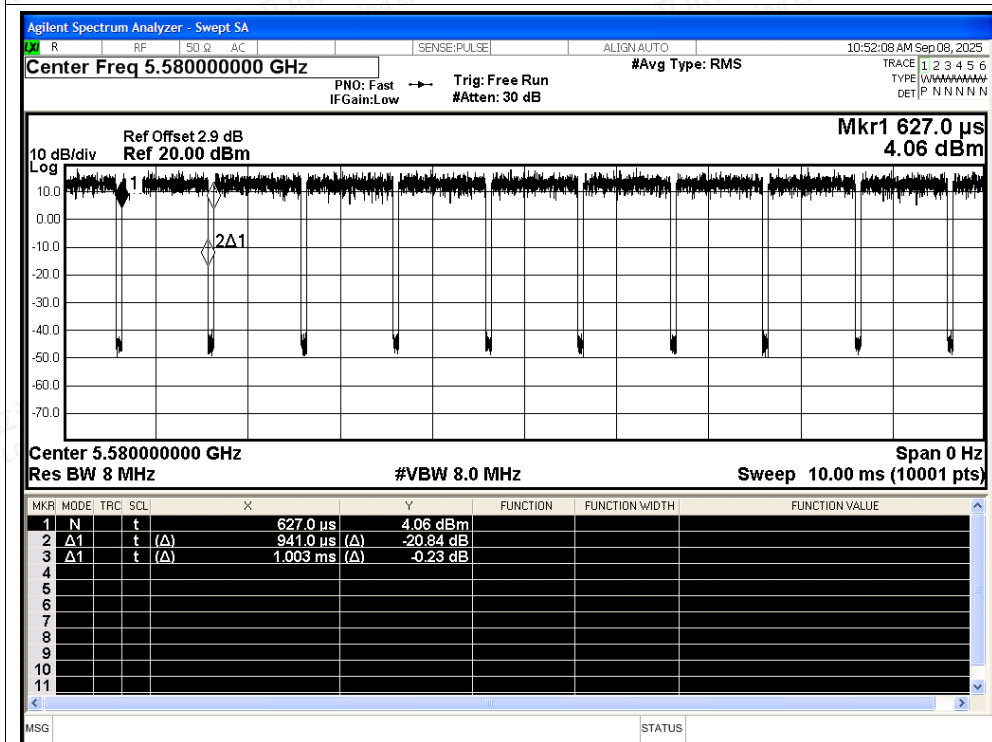


Duty Cycle NVNT ac20 5700MHz Ant0

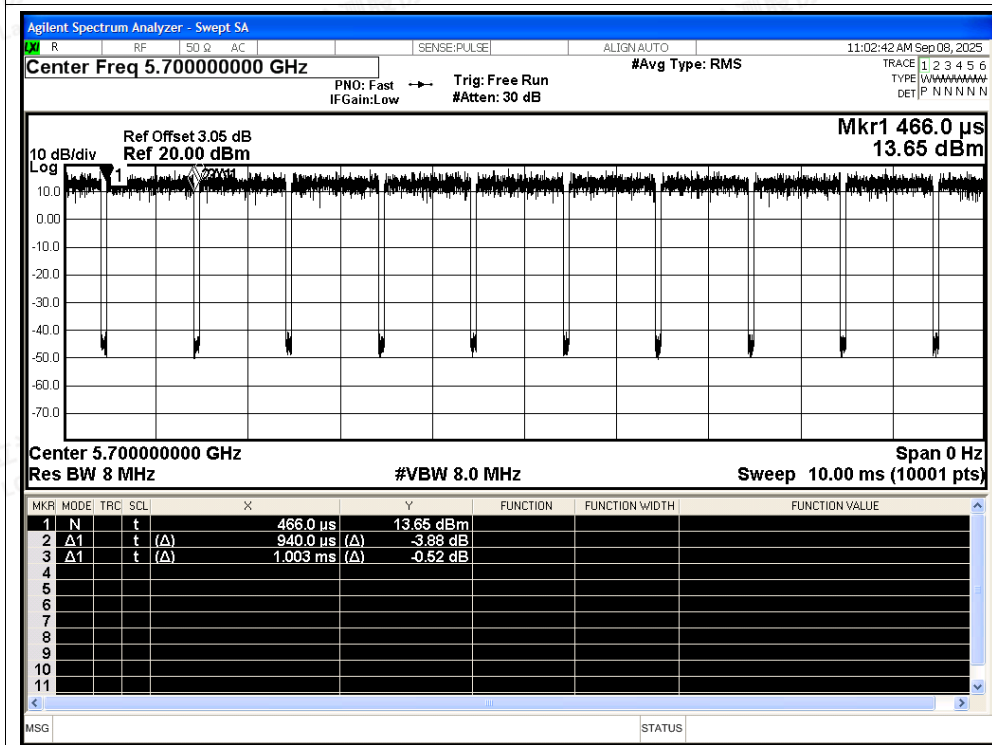




Duty Cycle NVNT ac40 5510MHz Ant0

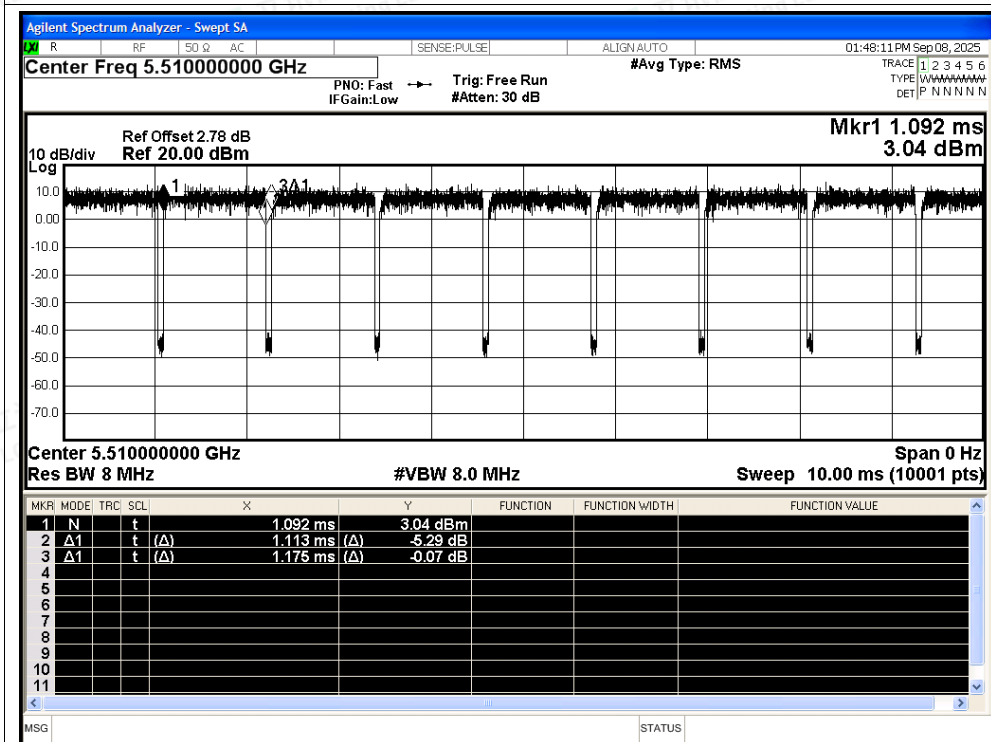

Duty Cycle NVNT ac40 5550MHz Ant0

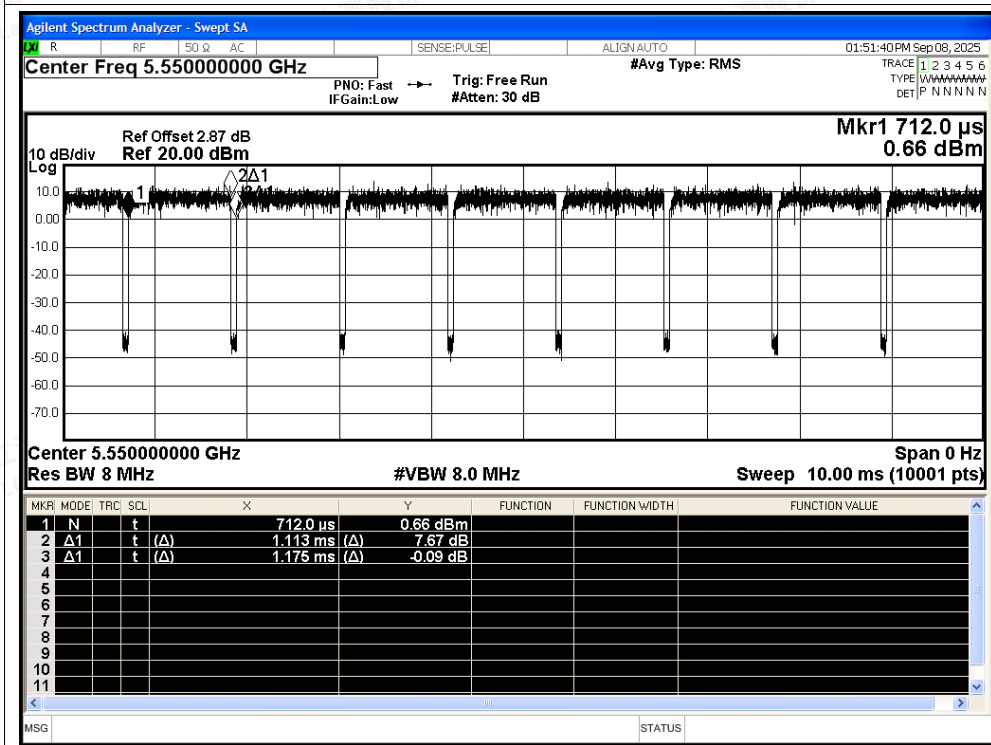

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant0

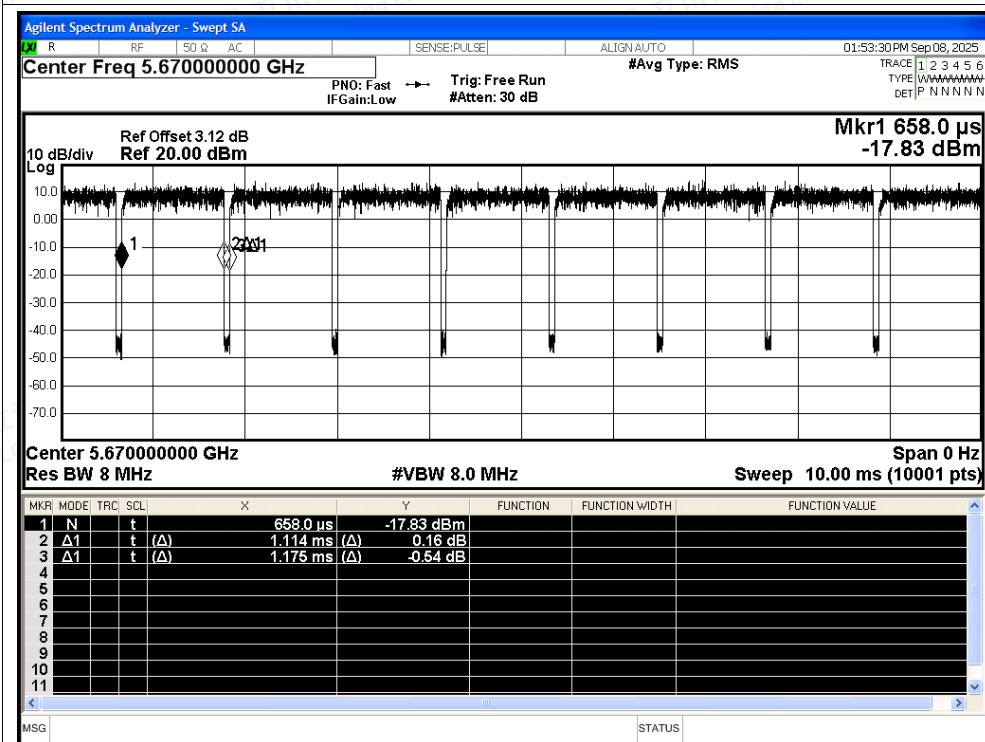

Duty Cycle NVNT ac80 5530MHz Ant0

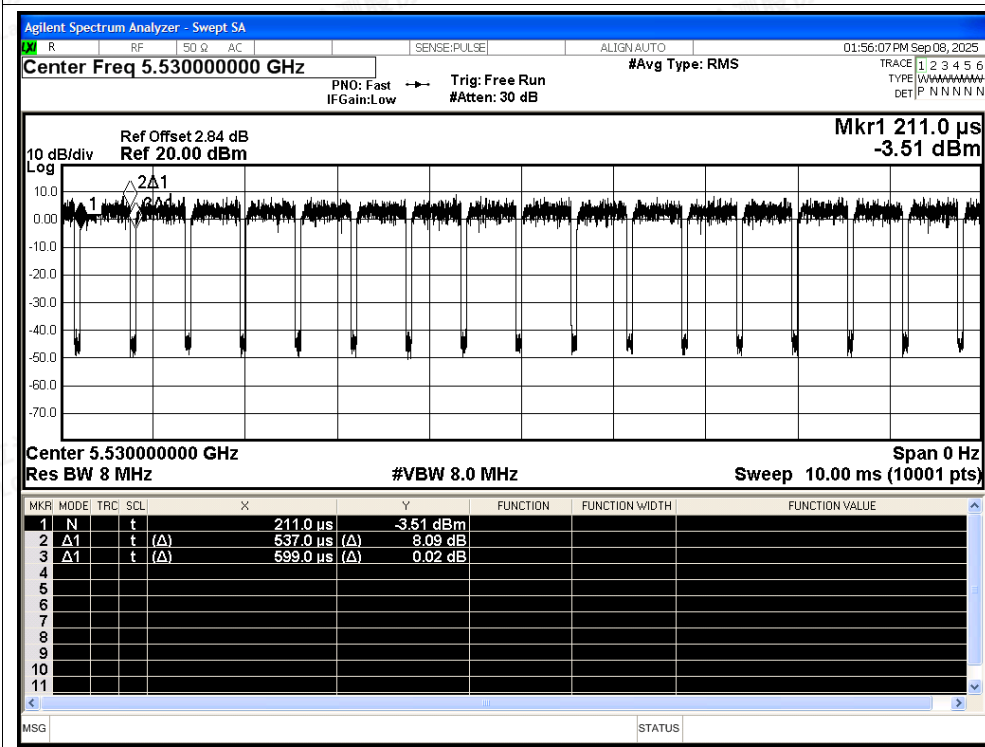


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

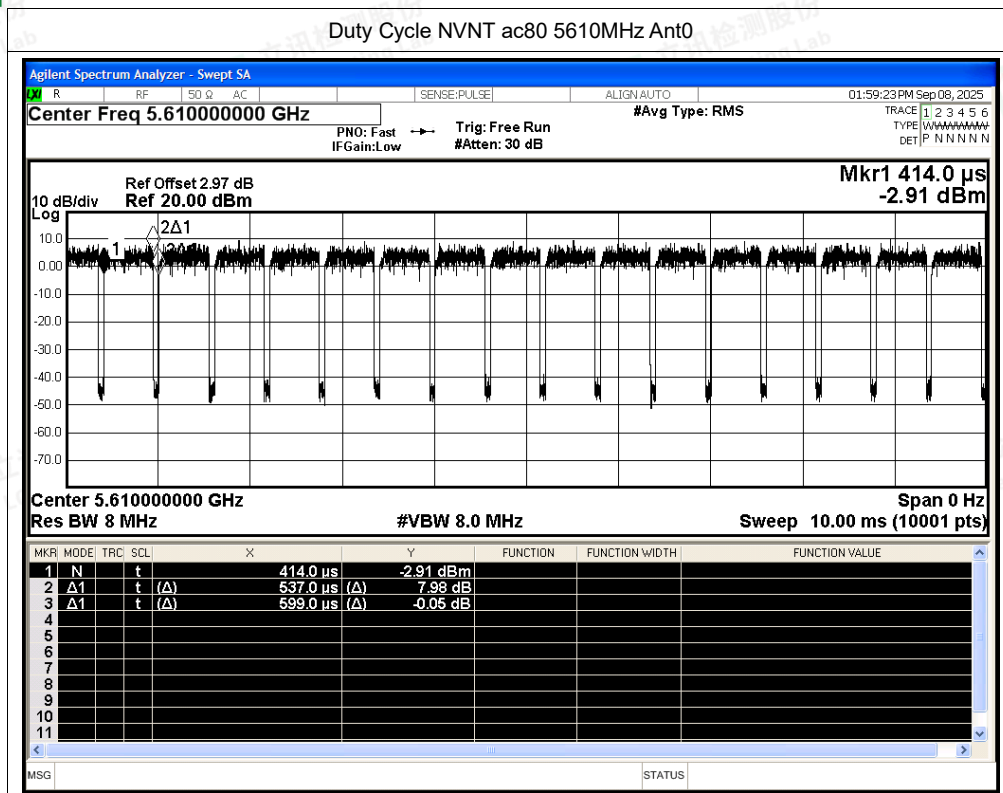

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	94.56	0.24	0.91
NVNT	a	5580	Ant1	94.65	0.24	0.91
NVNT	a	5700	Ant1	94.65	0.24	0.91
NVNT	n20	5500	Ant1	93.77	0.28	1.07
NVNT	n20	5580	Ant1	93.77	0.28	1.07
NVNT	n20	5700	Ant1	93.77	0.28	1.07
NVNT	n40	5510	Ant1	94.71	0.24	0.9
NVNT	n40	5550	Ant1	94.71	0.24	0.9
NVNT	n40	5670	Ant1	94.71	0.24	0.9
NVNT	ac20	5500	Ant1	93.72	0.28	1.06
NVNT	ac20	5580	Ant1	93.72	0.28	1.06
NVNT	ac20	5700	Ant1	93.72	0.28	1.06
NVNT	ac40	5510	Ant1	94.81	0.23	0.9
NVNT	ac40	5550	Ant1	94.72	0.24	0.9
NVNT	ac40	5670	Ant1	94.72	0.24	0.9
NVNT	ac80	5530	Ant1	89.65	0.47	1.86
NVNT	ac80	5610	Ant1	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5500MHz Ant1

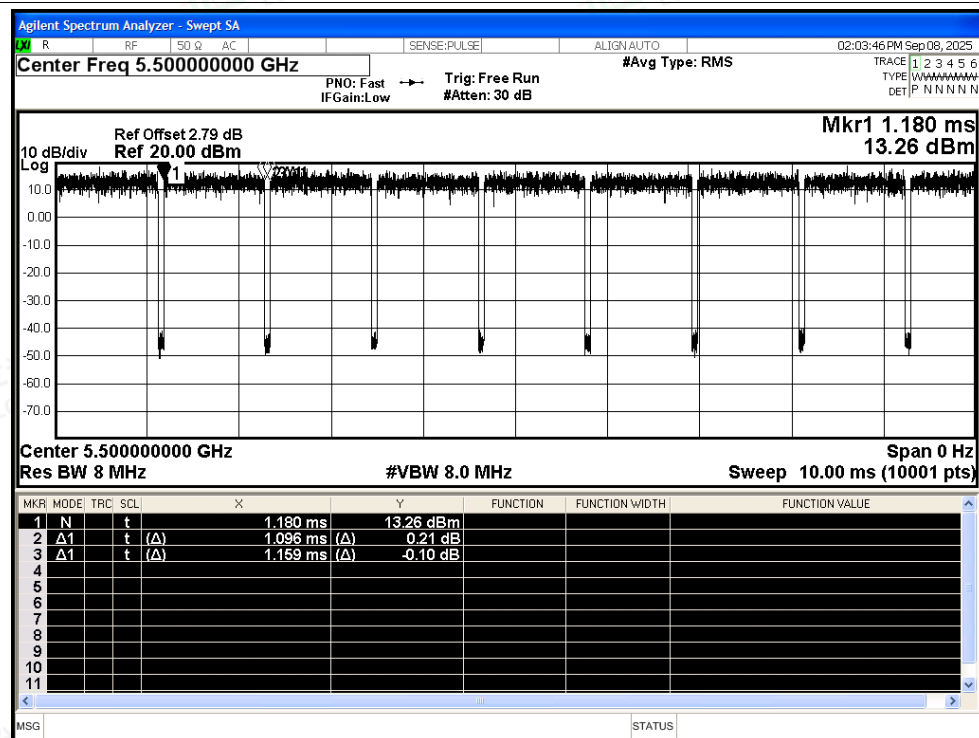

Duty Cycle NVNT a 5580MHz Ant1

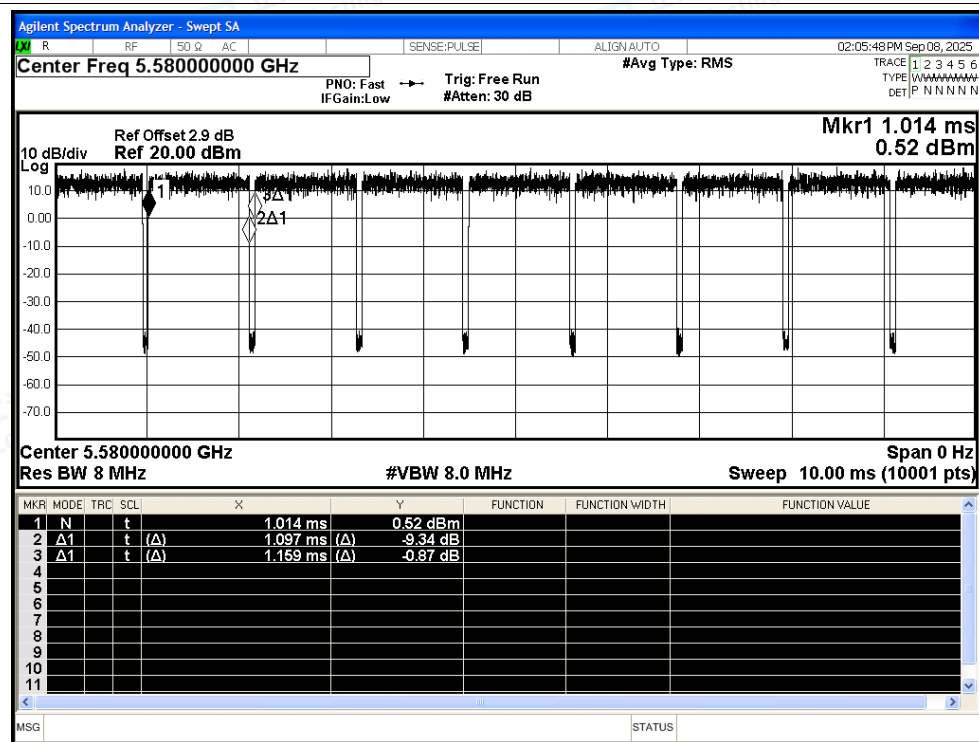

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant1

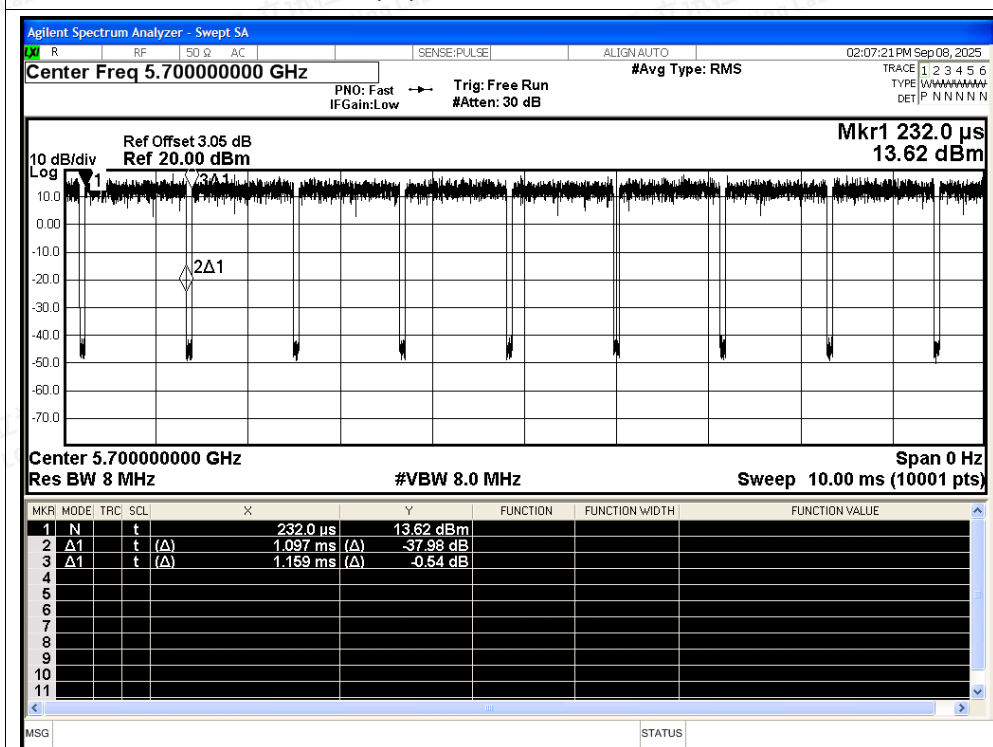

Duty Cycle NVNT n20 5500MHz Ant1

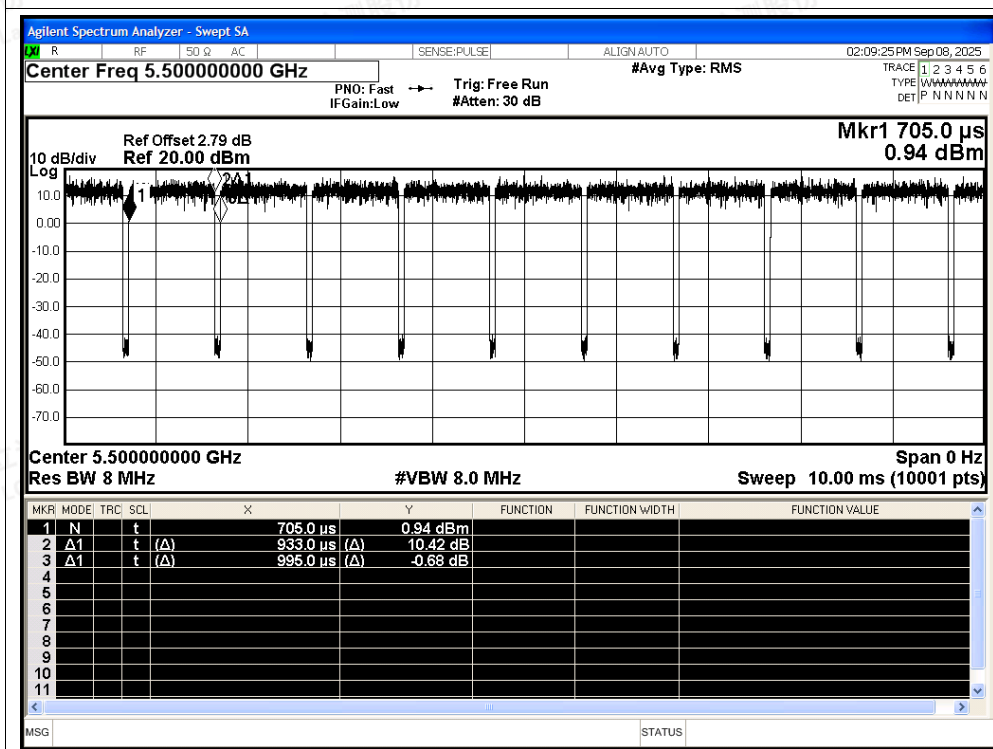

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant1

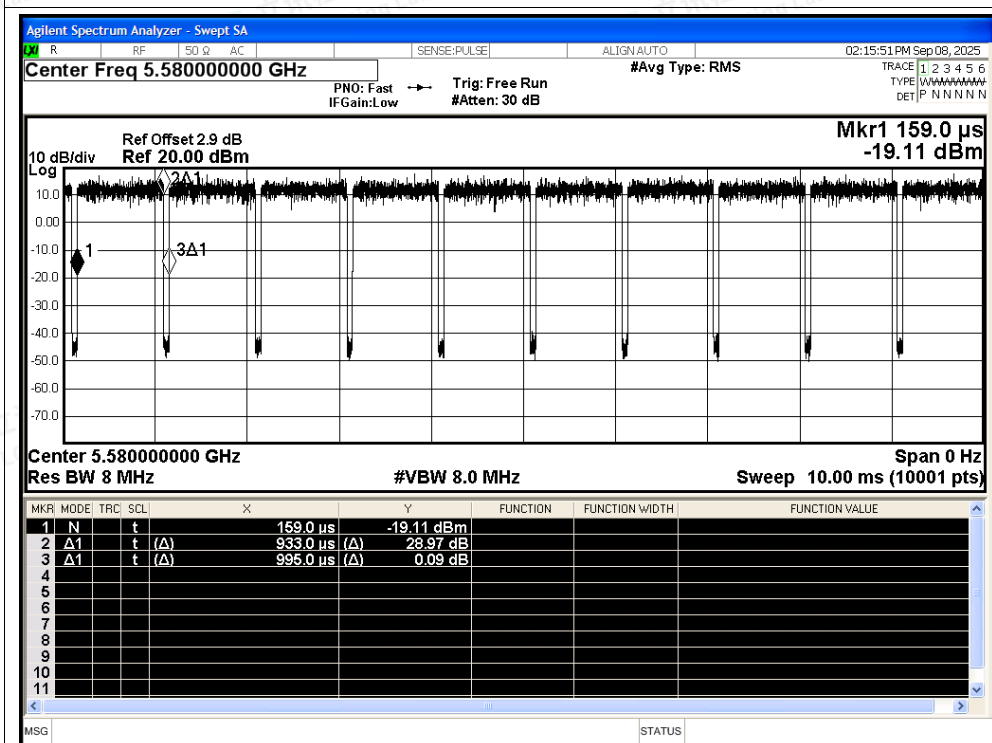

Duty Cycle NVNT n20 5700MHz Ant1

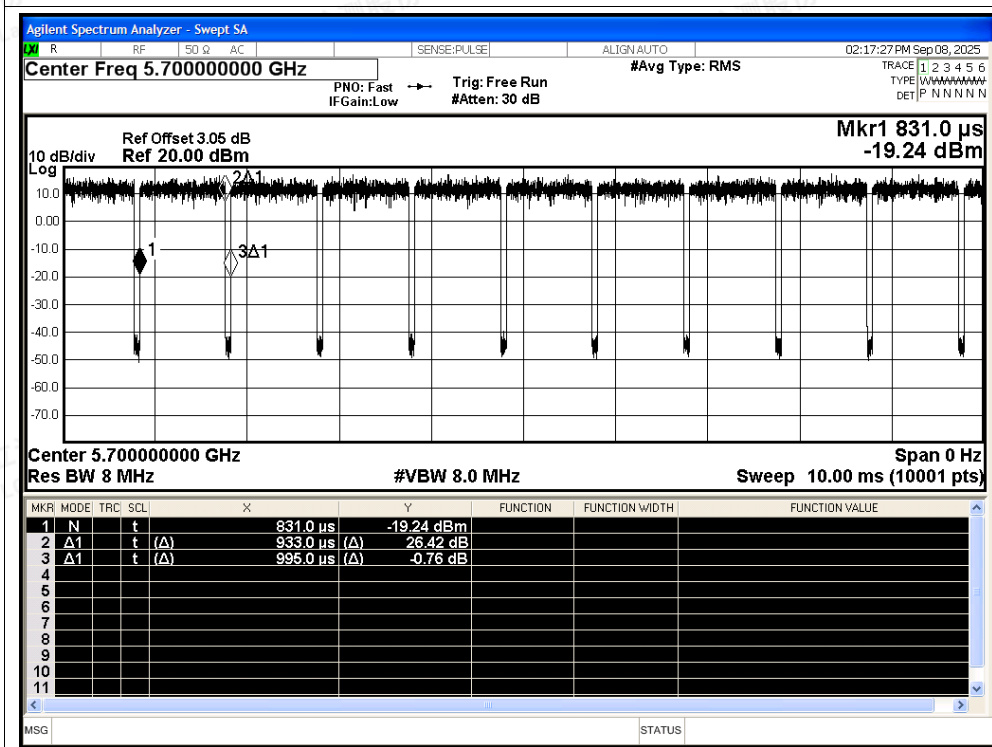

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant1

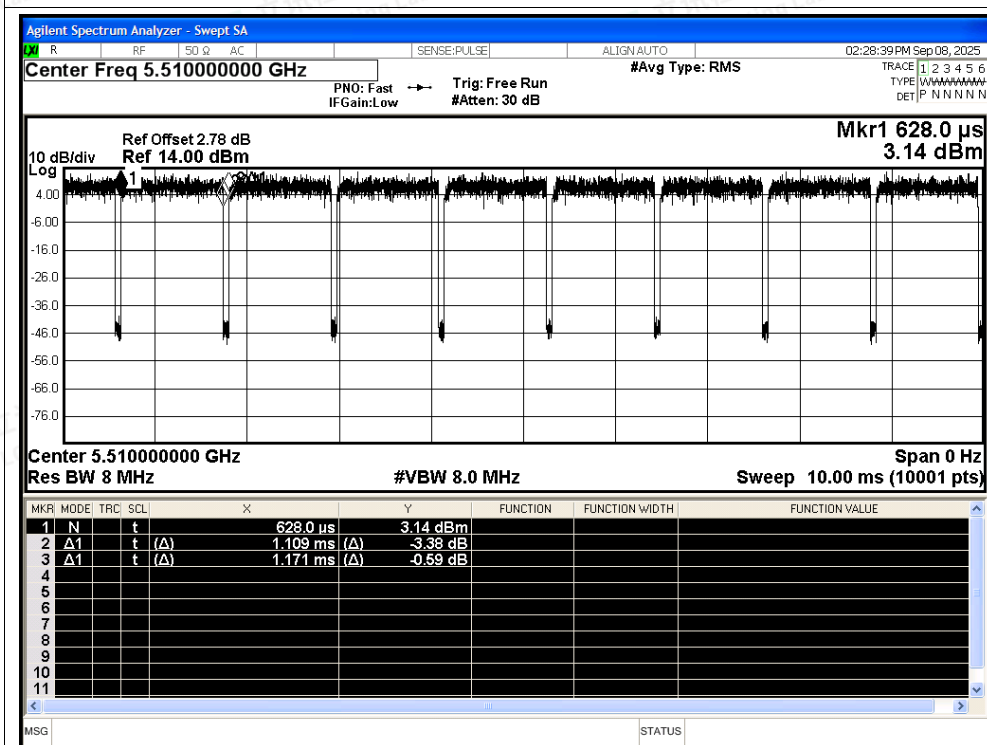

Duty Cycle NVNT n40 5550MHz Ant1

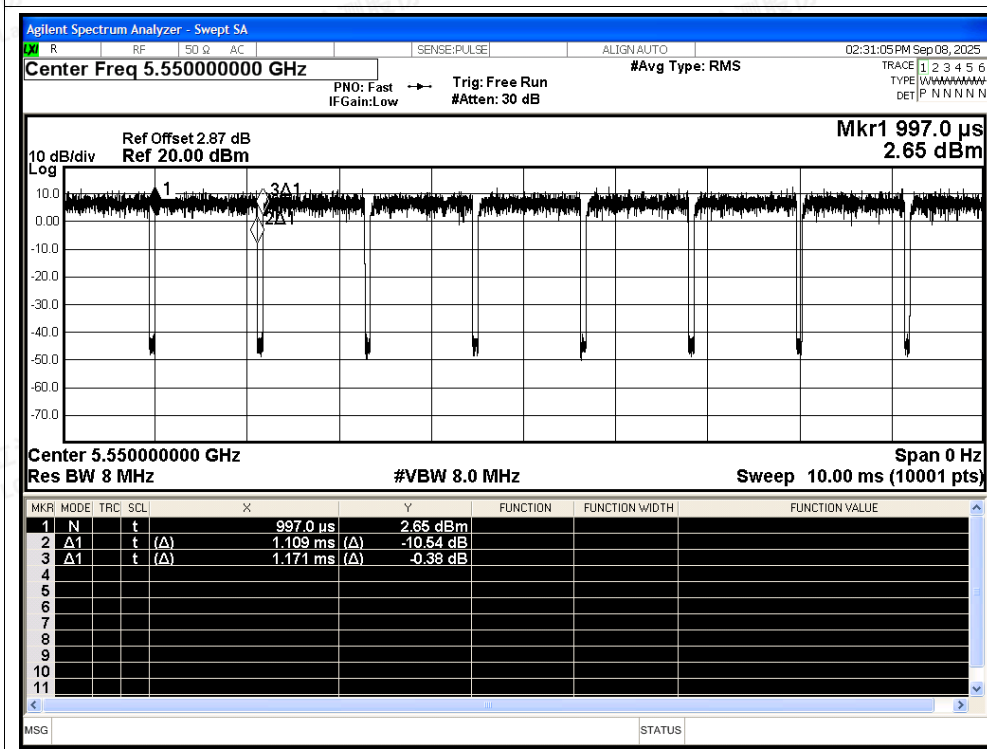

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant1

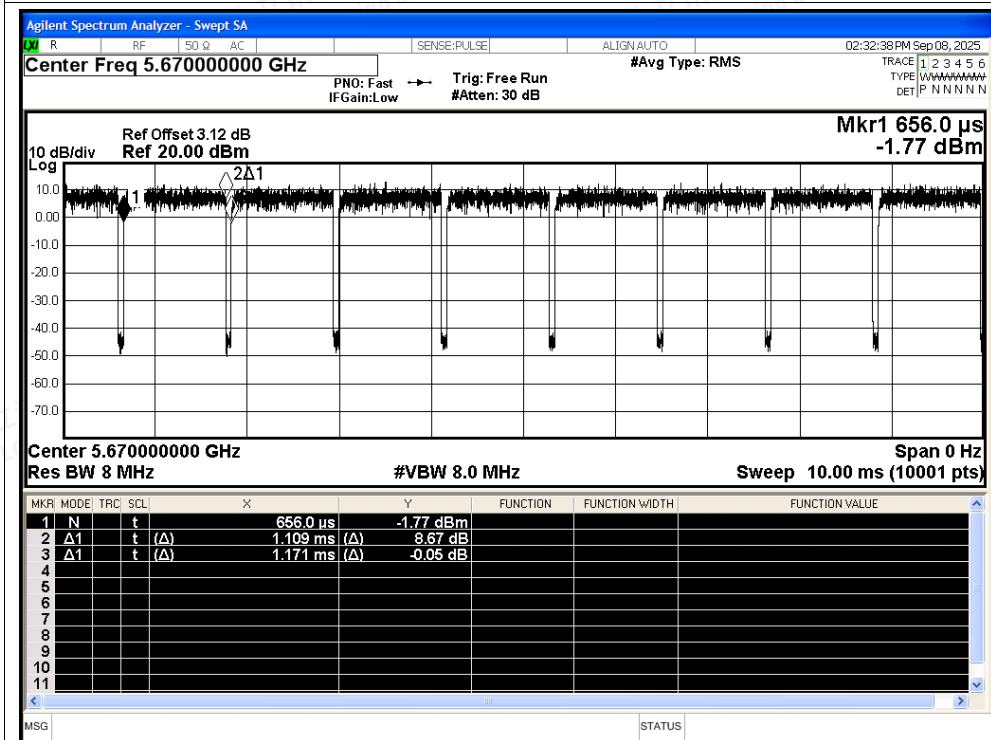

Duty Cycle NVNT ac20 5500MHz Ant1

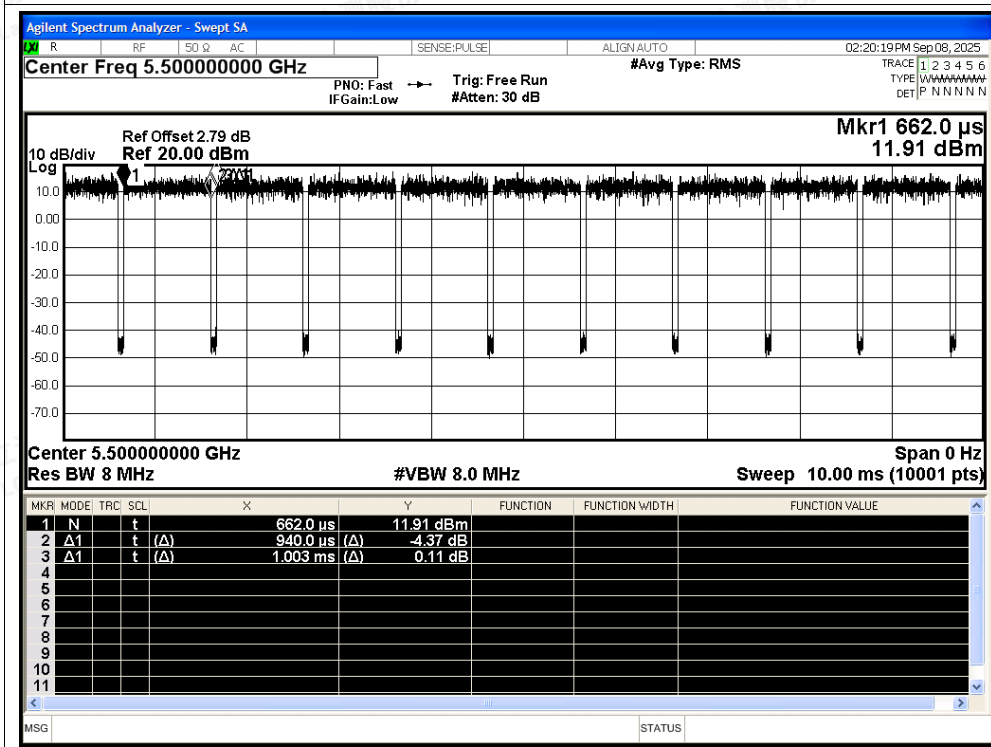

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant1

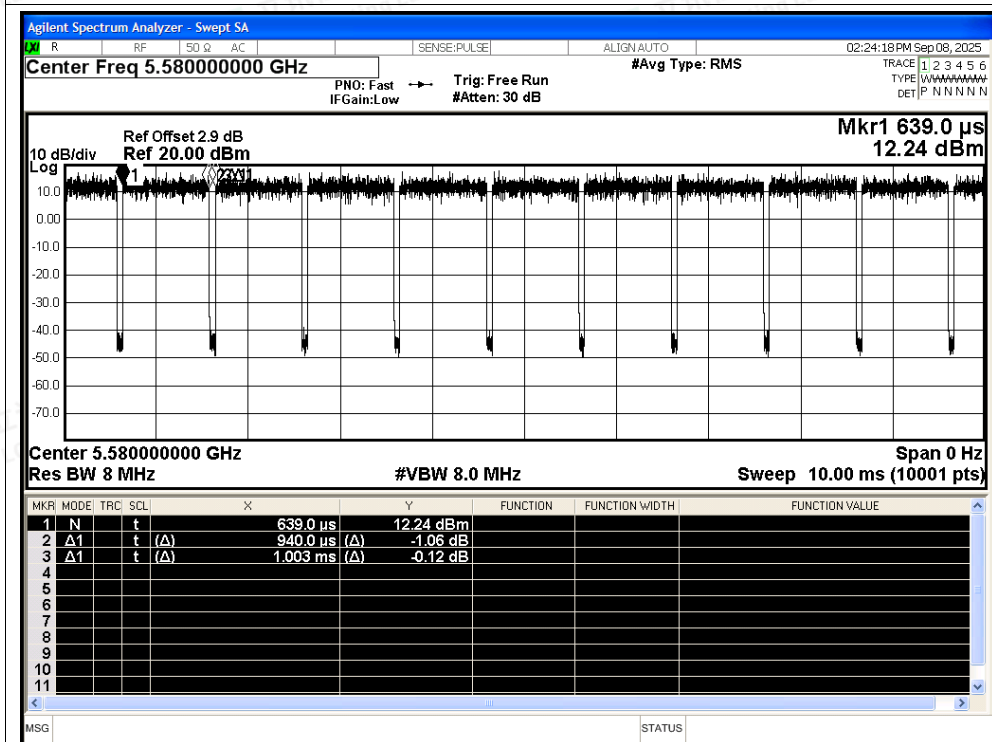

Duty Cycle NVNT ac20 5700MHz Ant1

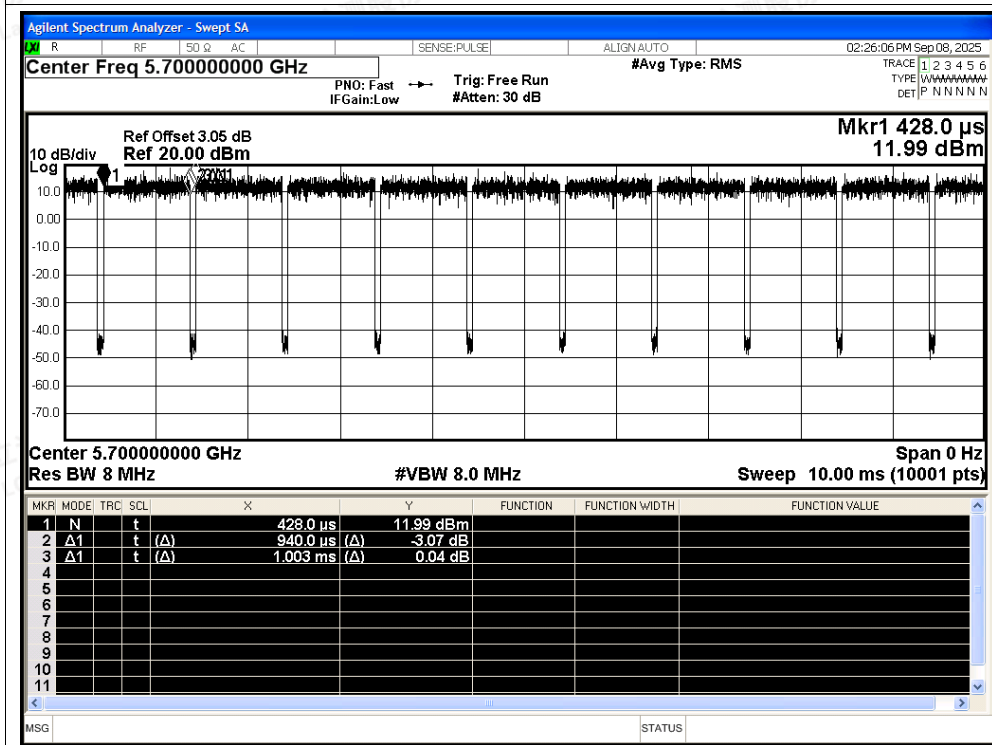

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant1

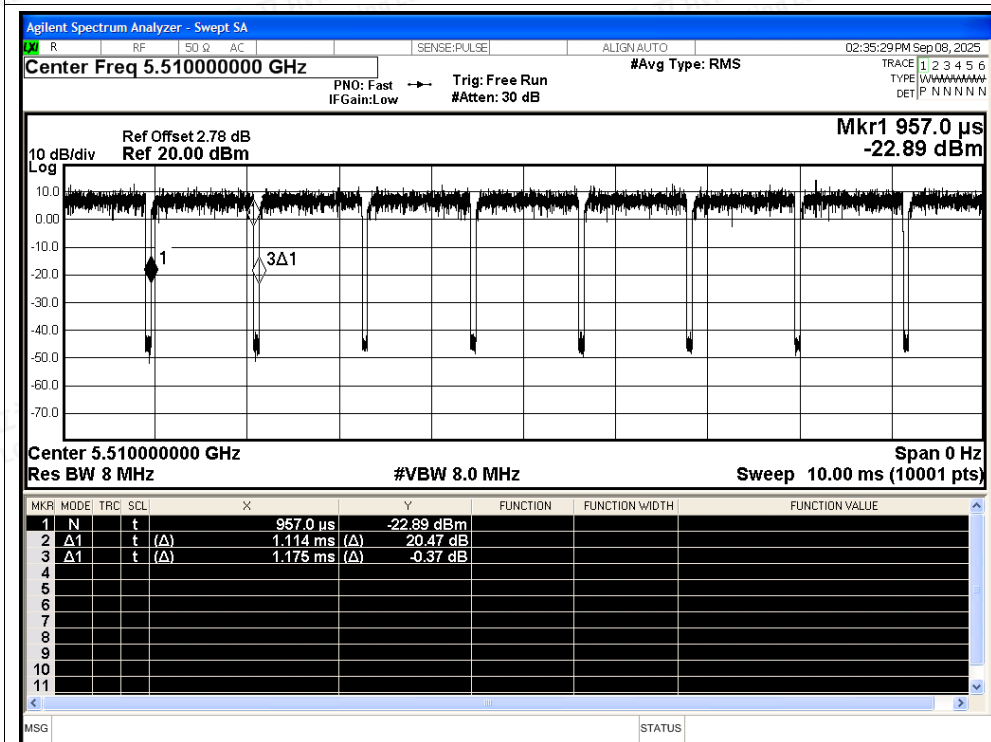

Duty Cycle NVNT ac40 5550MHz Ant1

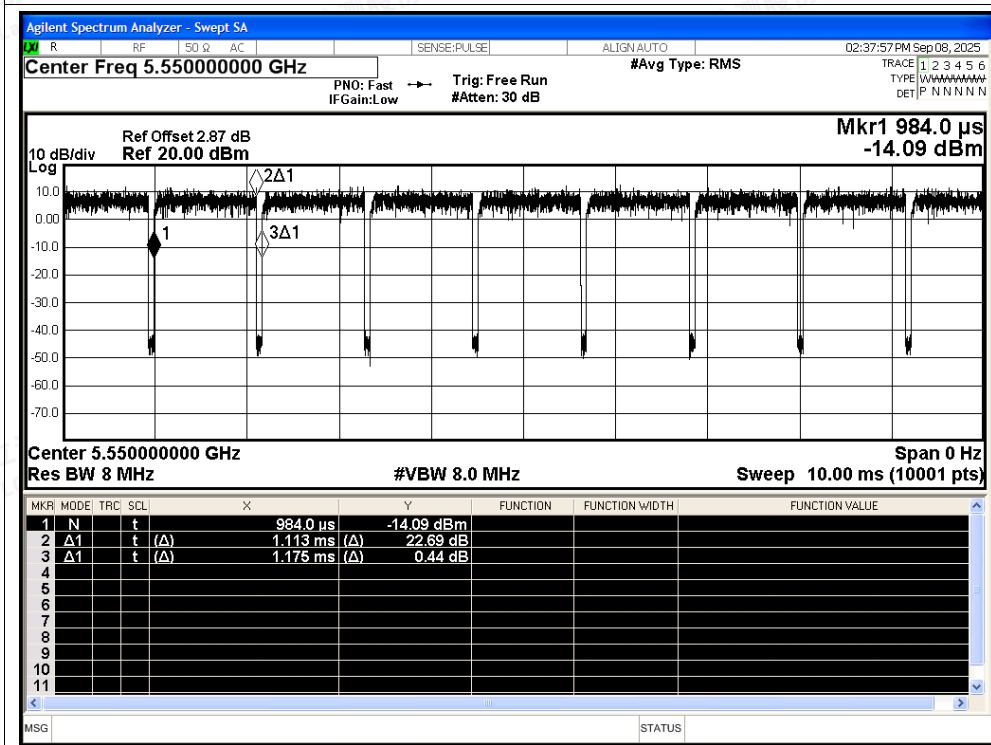

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant1

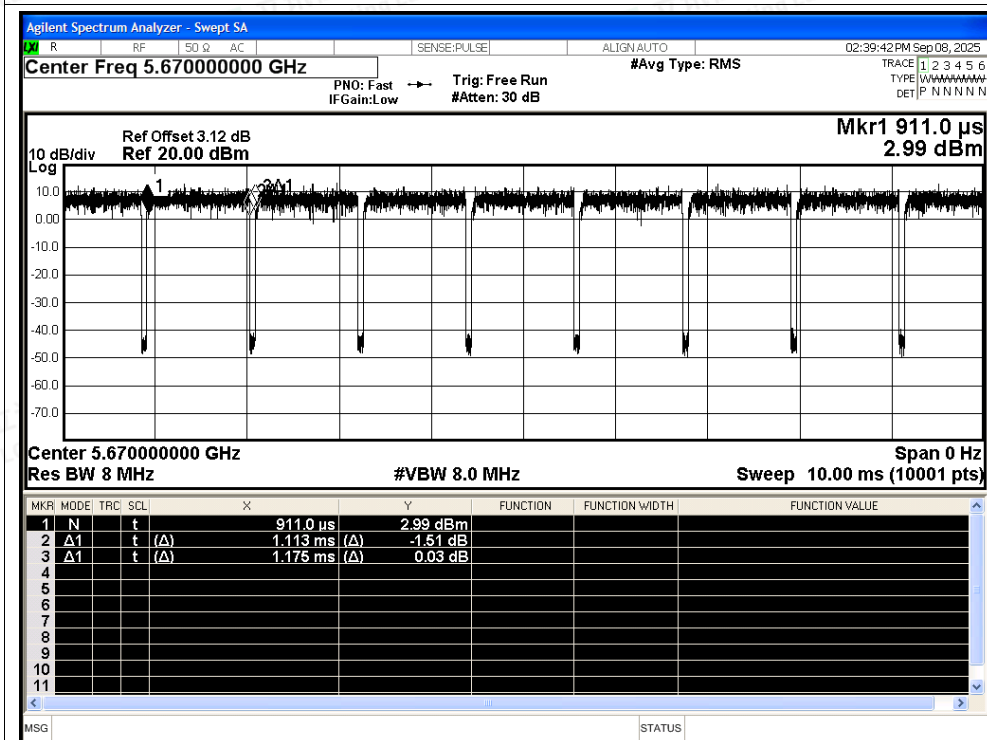

Duty Cycle NVNT ac80 5530MHz Ant1

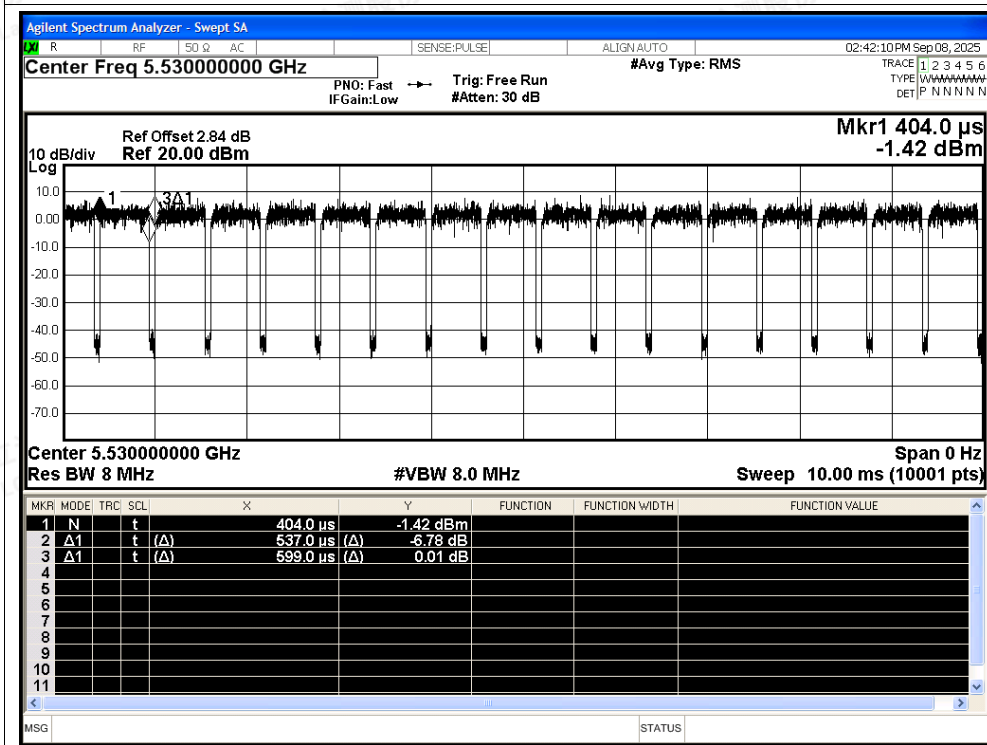


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

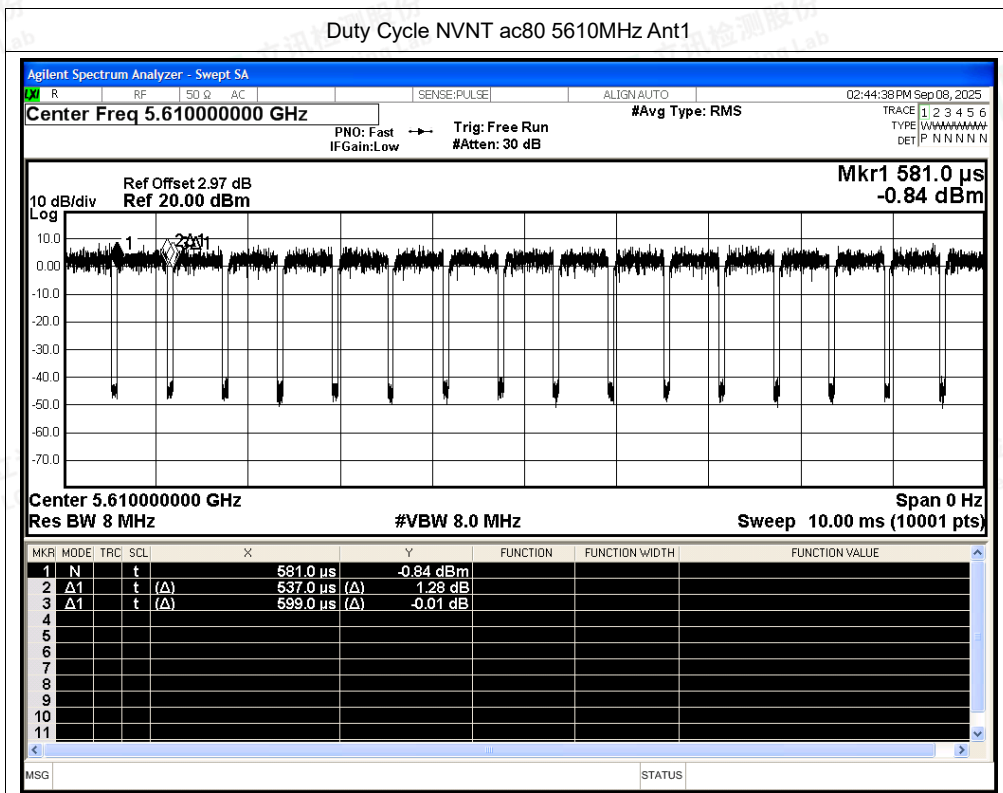

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity