



NVNT	ac20	5180	Ant1	5148.2	-40.49	2.08	-	56.82	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5147.5	-55.55	2.08	0.12	41.88	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-45.28	2.08	-	52.03	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-54.85	2.08	0.12	42.58	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-48.08	2.08	-	49.23	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-57.82	2.08	0.12	39.61	Average	54	Pass
NVNT	ac20	5240	Ant1	5410.32	-46.48	2.08	-	50.83	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5358	-56.66	2.08	0.12	40.77	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-49.99	2.08	-	47.32	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-57.97	2.08	0.12	39.46	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-50.57	2.08	-	46.74	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.21	2.08	0.24	39.34	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.97	-44.41	2.08	-	52.90	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-54.91	2.08	0.24	42.64	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-44.65	2.08	-	52.66	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-54.91	2.08	0.24	42.64	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-49.3	2.08	-	48.01	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-56.91	2.08	0.24	40.64	Average	54	Pass
NVNT	ac40	5230	Ant1	5370.09	-46.76	2.08	-	50.55	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5351.19	-56.61	2.08	0.24	40.94	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-49.55	2.08	-	47.76	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-58.2	2.08	0.24	39.35	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-47.94	2.08	-	49.37	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-56.48	2.08	0.47	41.30	Average	54	Pass
NVNT	ac80	5210	Ant1	5398.62	-45.54	2.08	-	51.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350.77	-56	2.08	0.47	41.78	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.59	2.08	-	48.72	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-57.34	2.08	0.47	40.44	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-50.62	2.08	-	46.69	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.05	2.08	0.47	39.73	Average	54	Pass
NVNT	ac80	5210	Ant1	5149.38	-42.23	2.08	-	55.08	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-54.81	2.08	0.47	42.97	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-42.07	2.08	-	55.24	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-54.55	2.08	0.47	43.23	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

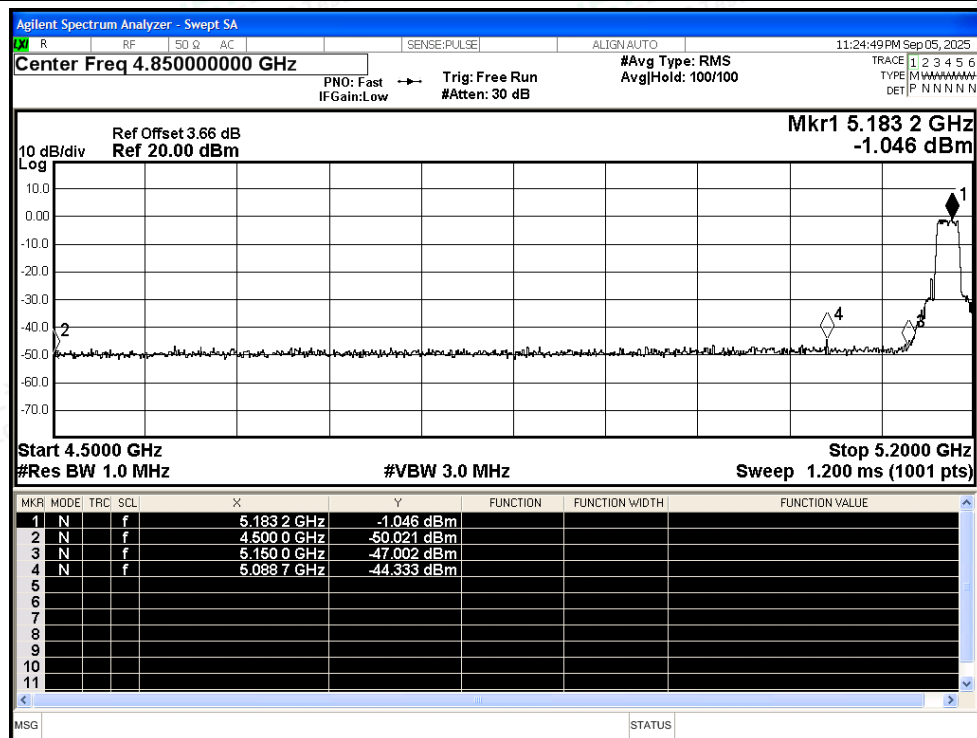

Restrict Band NVNT a 5180MHz Ant1 Average


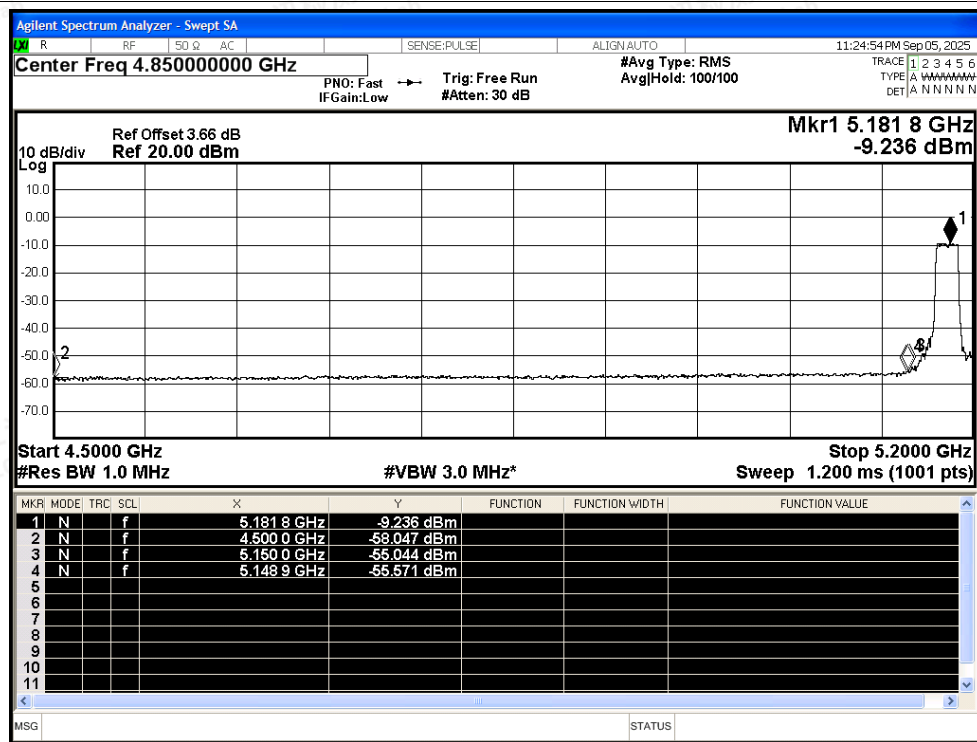


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

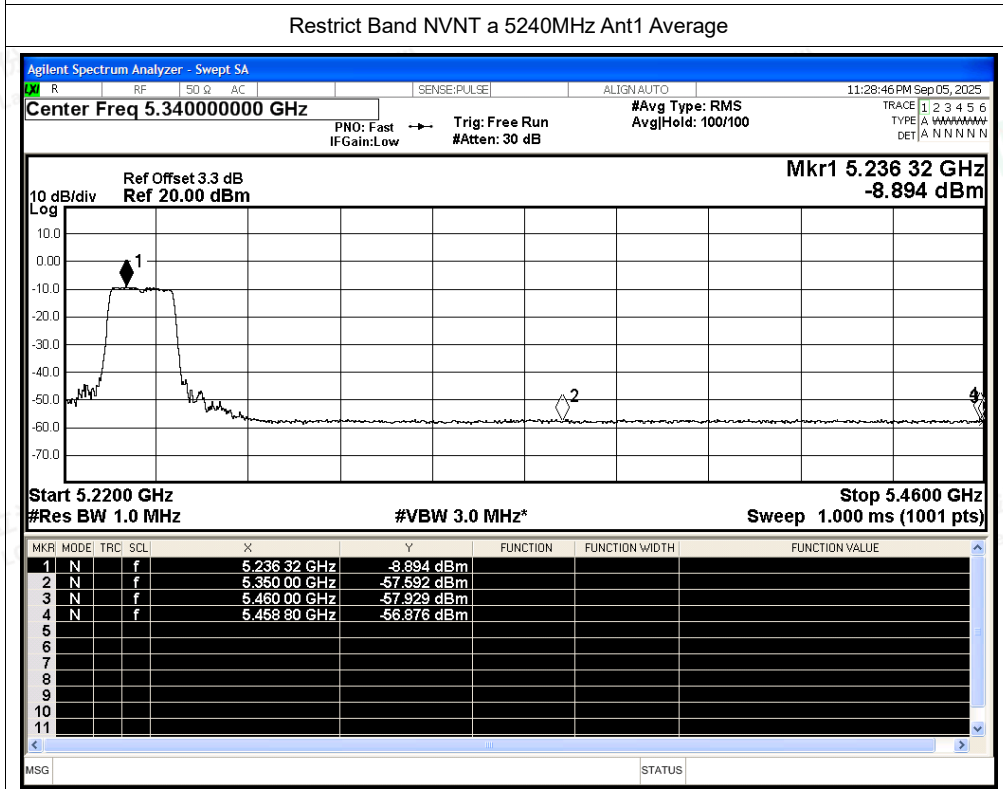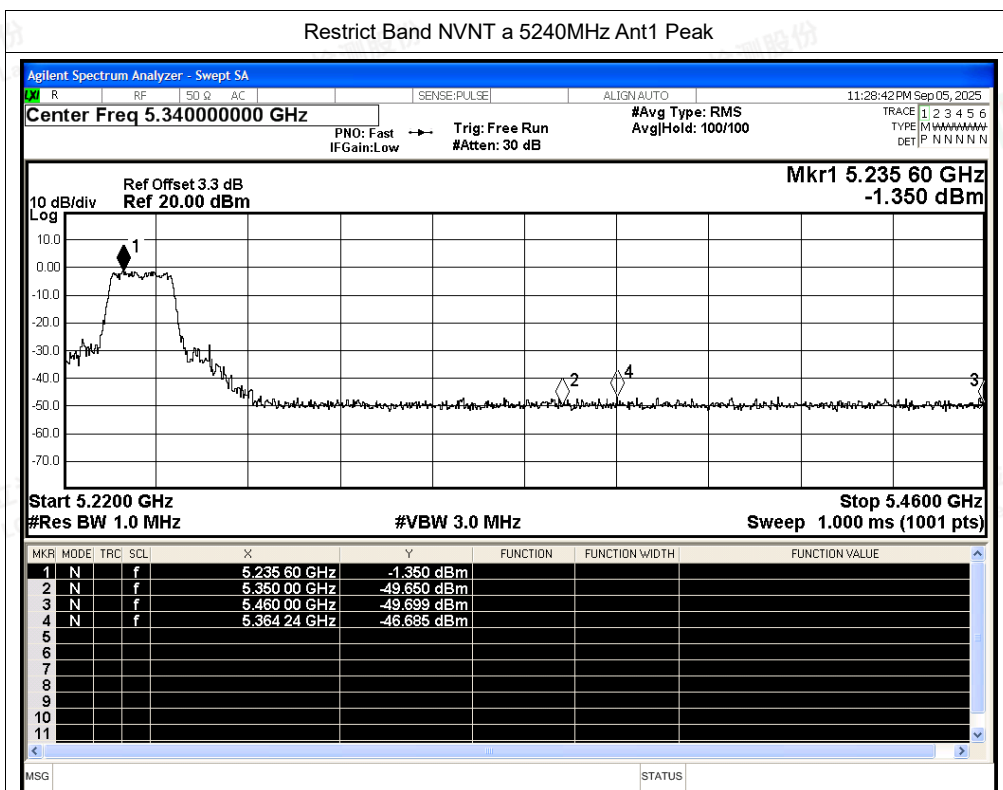

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

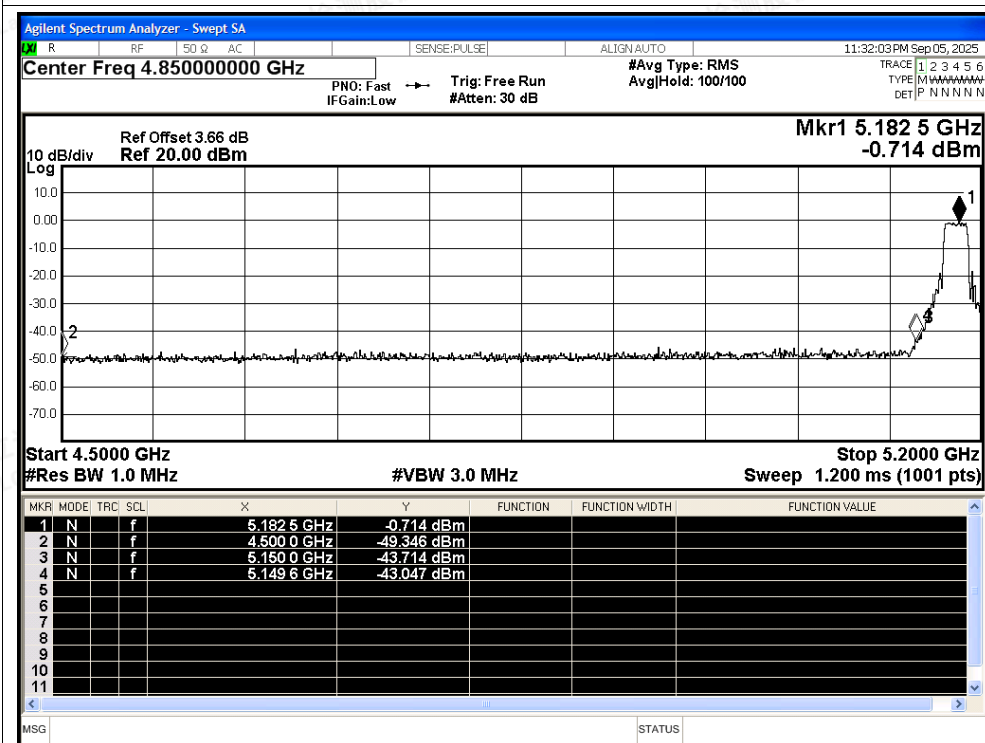

Restrict Band NVNT n20 5180MHz Ant1 Average

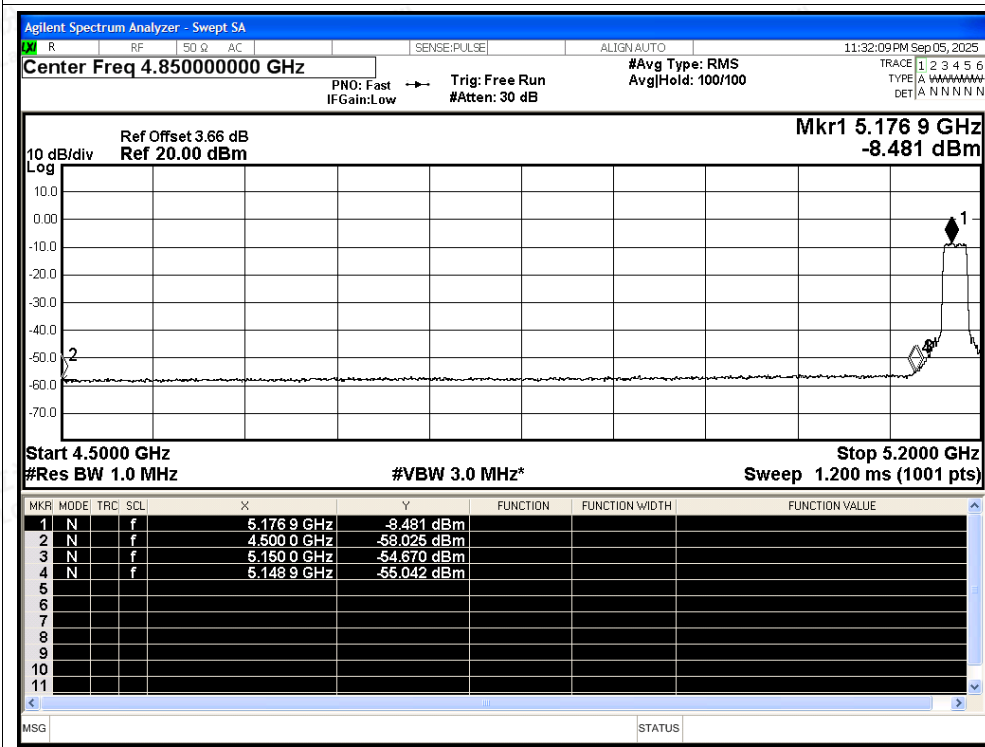

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

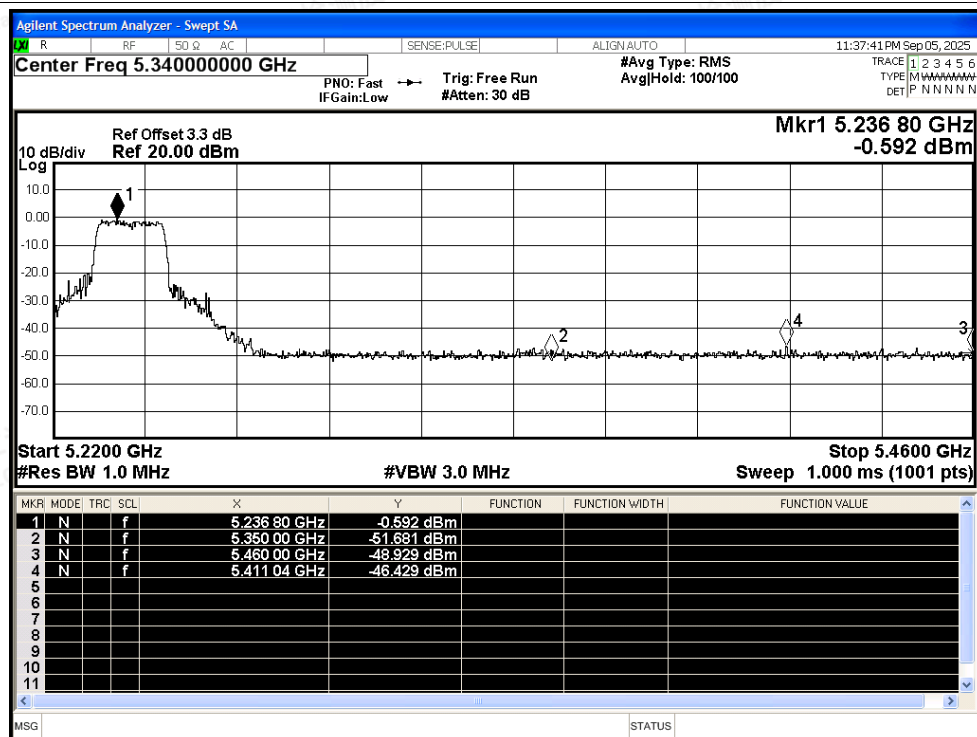

Restrict Band NVNT n20 5240MHz Ant1 Average


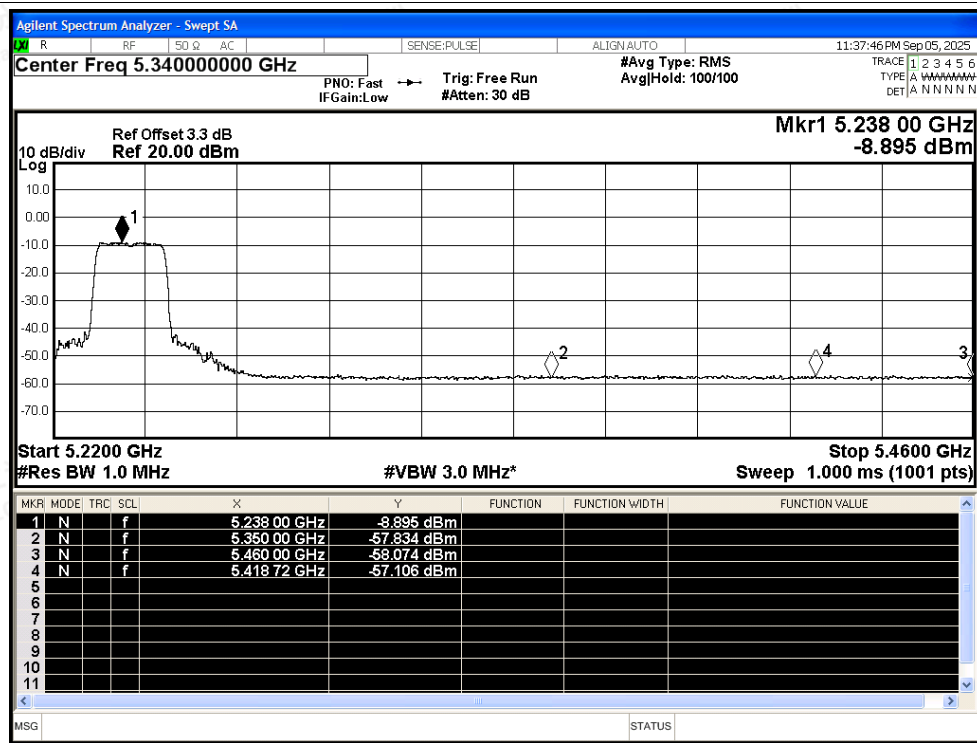


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

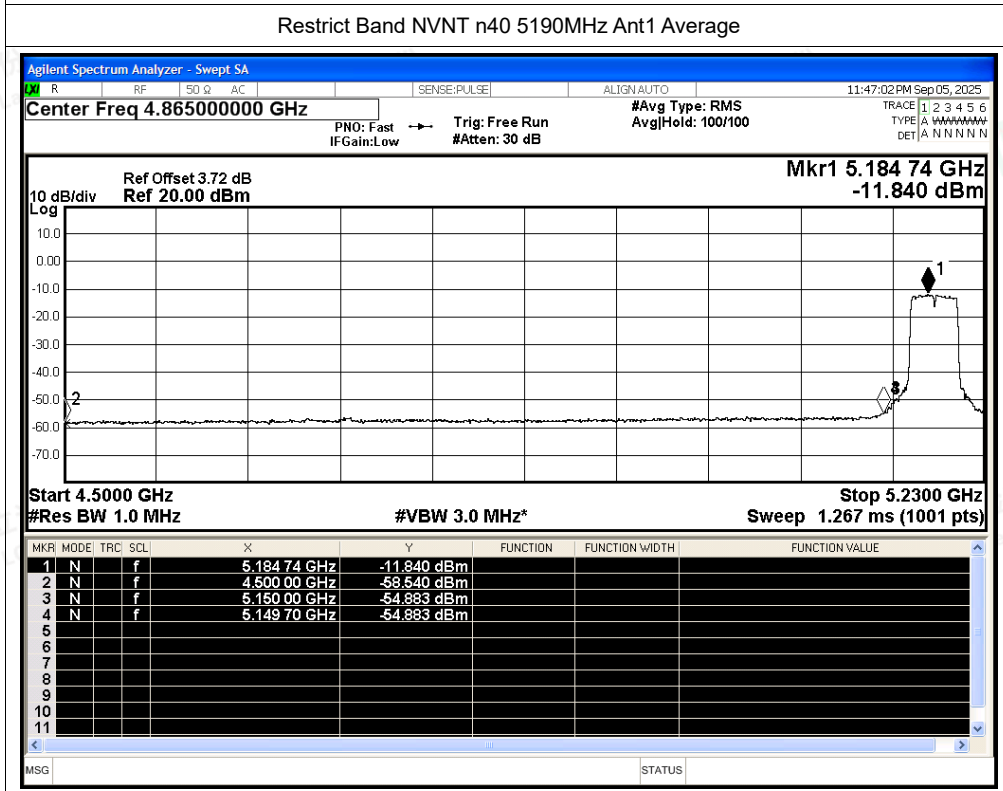
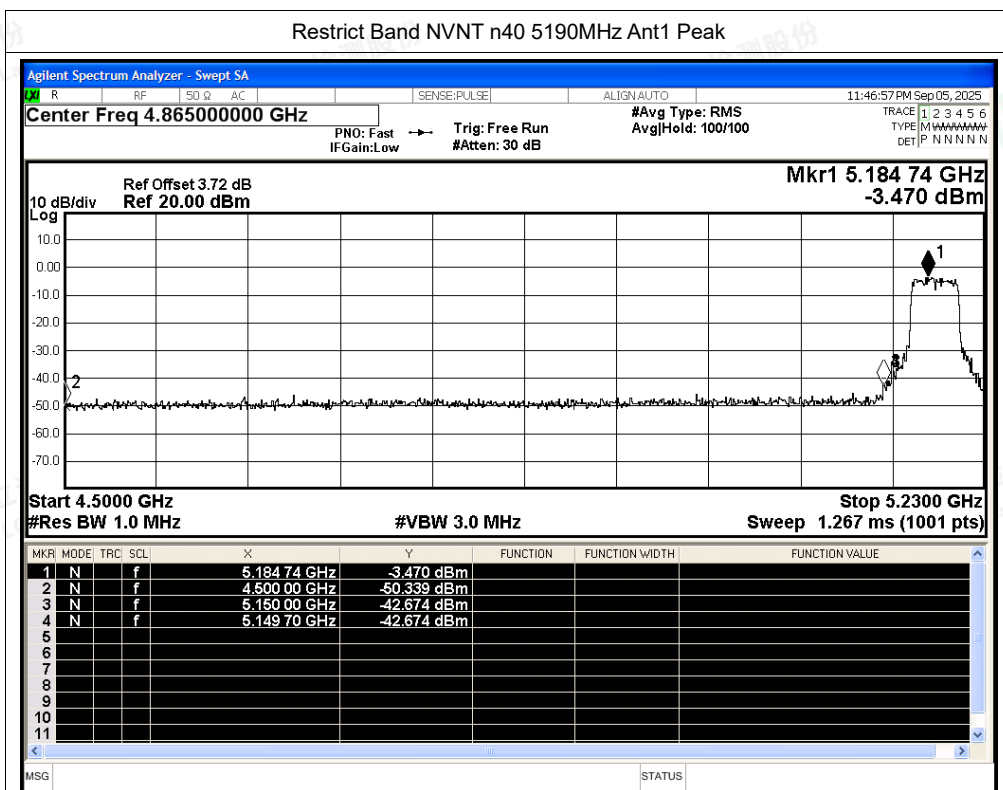


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

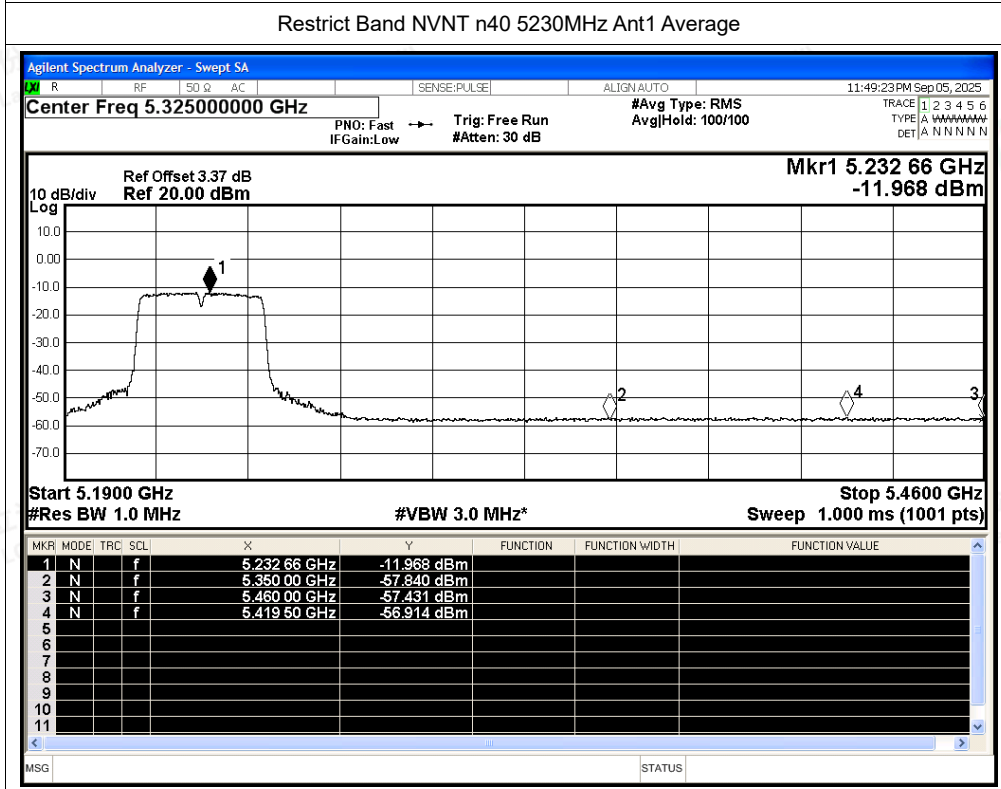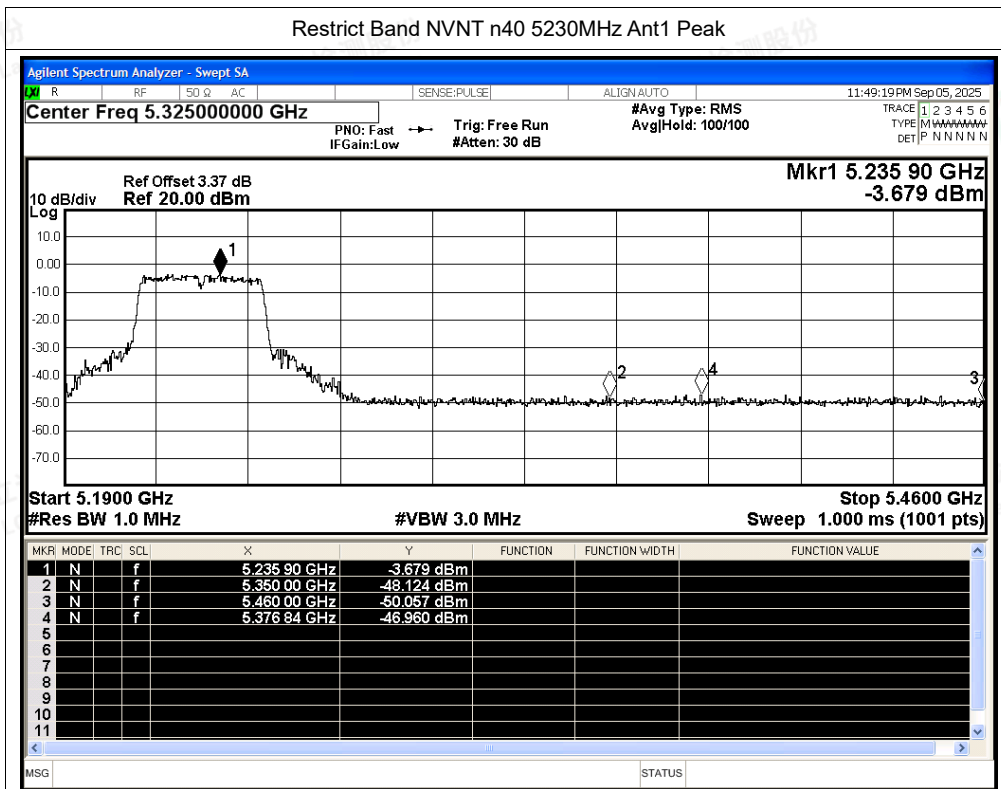

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

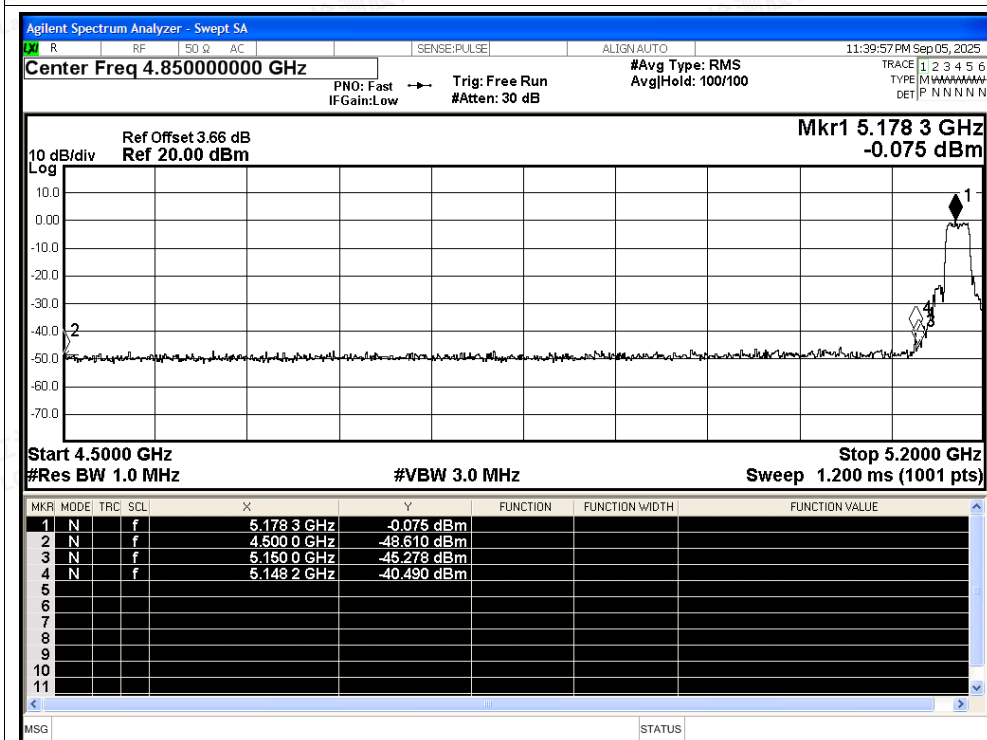

Restrict Band NVNT ac20 5180MHz Ant1 Average

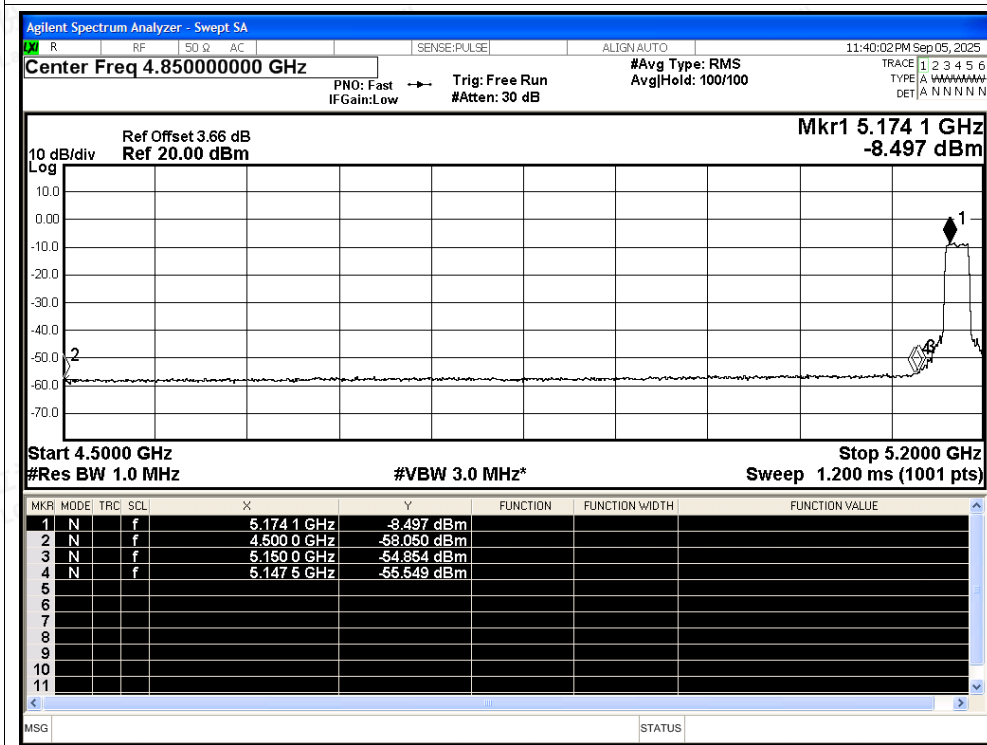

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

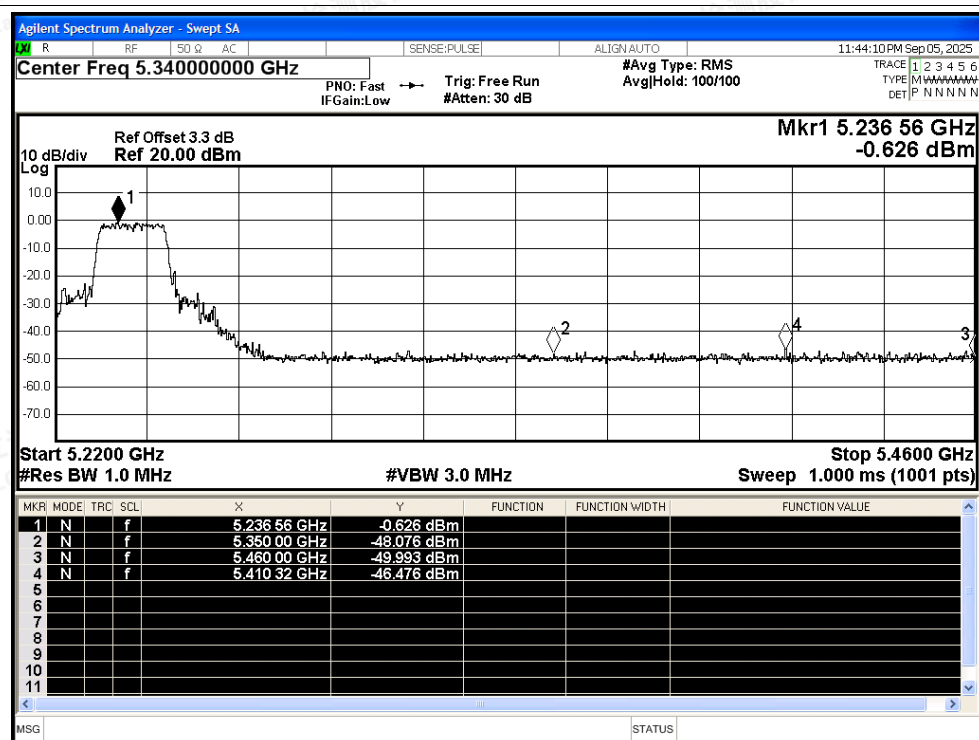

Restrict Band NVNT ac20 5240MHz Ant1 Average

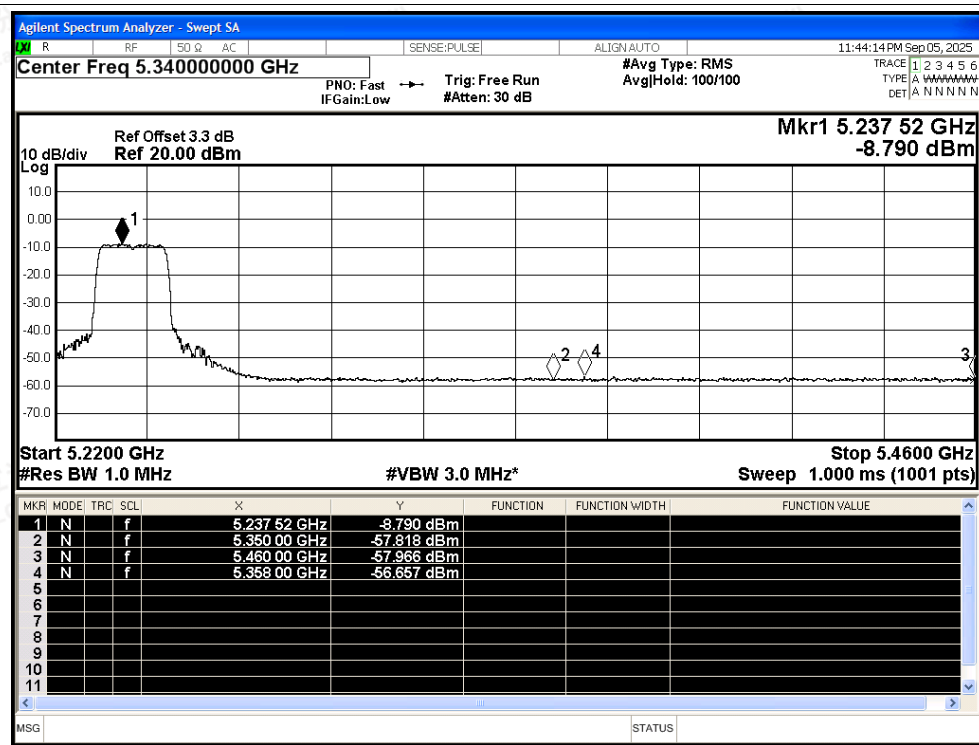

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

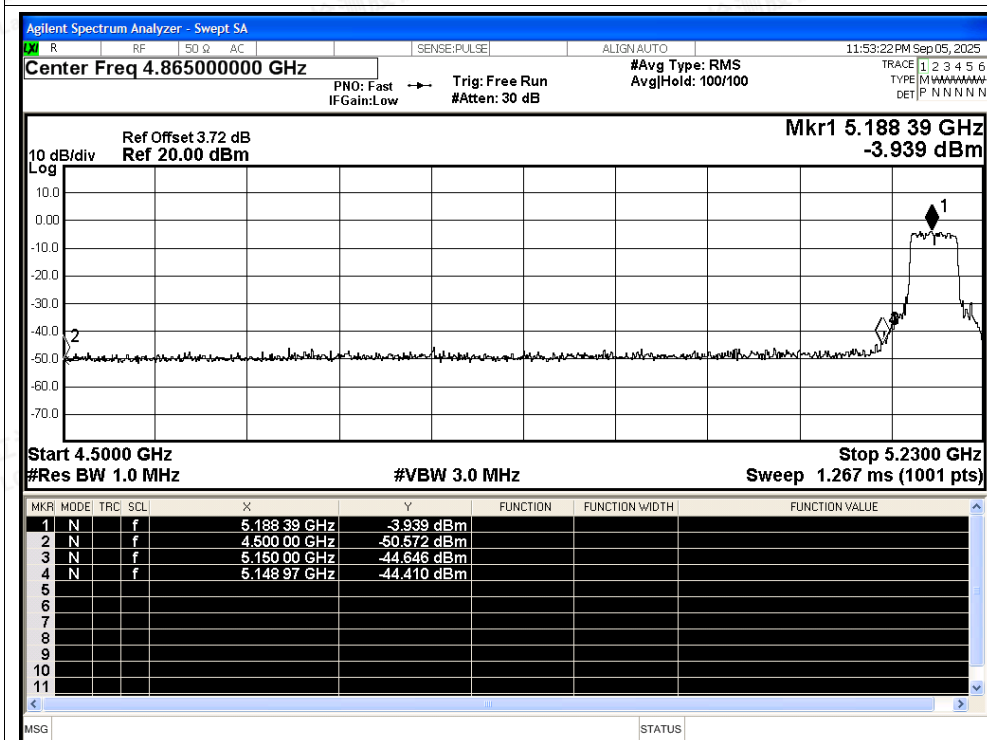

Restrict Band NVNT ac40 5190MHz Ant1 Average


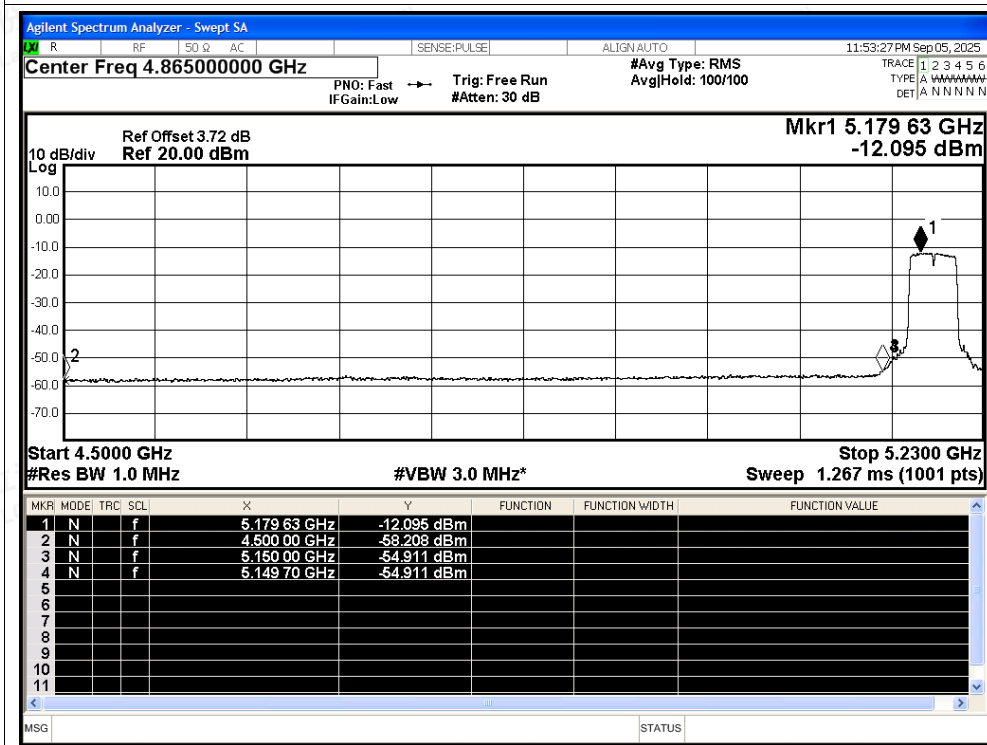


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

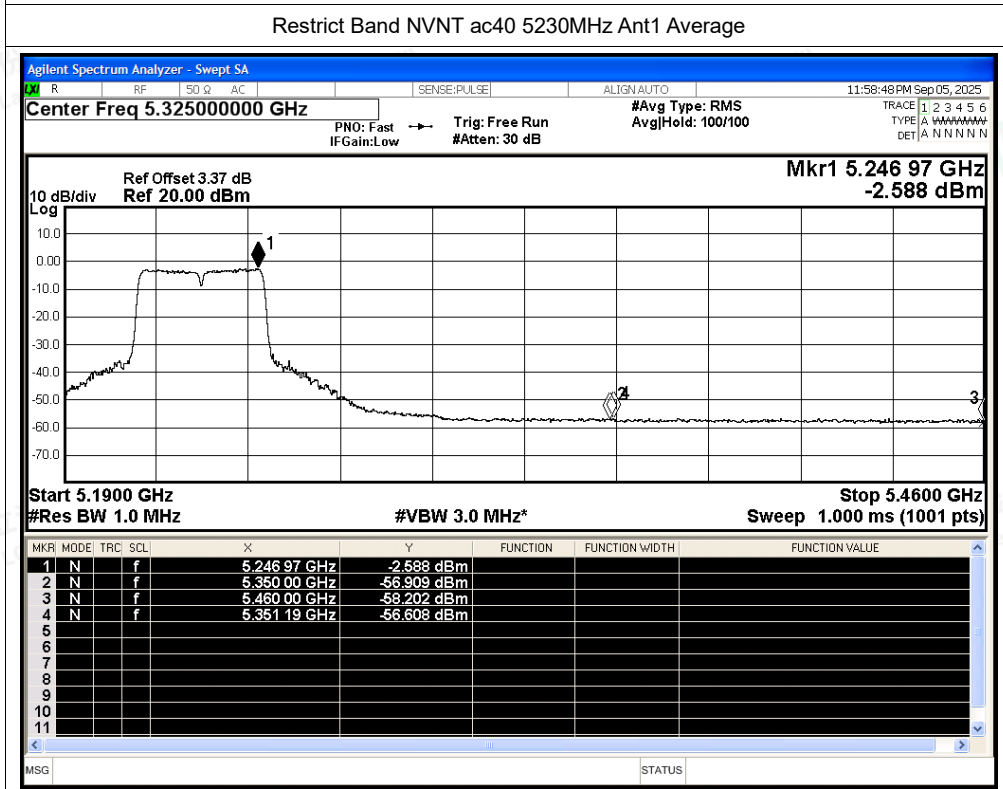
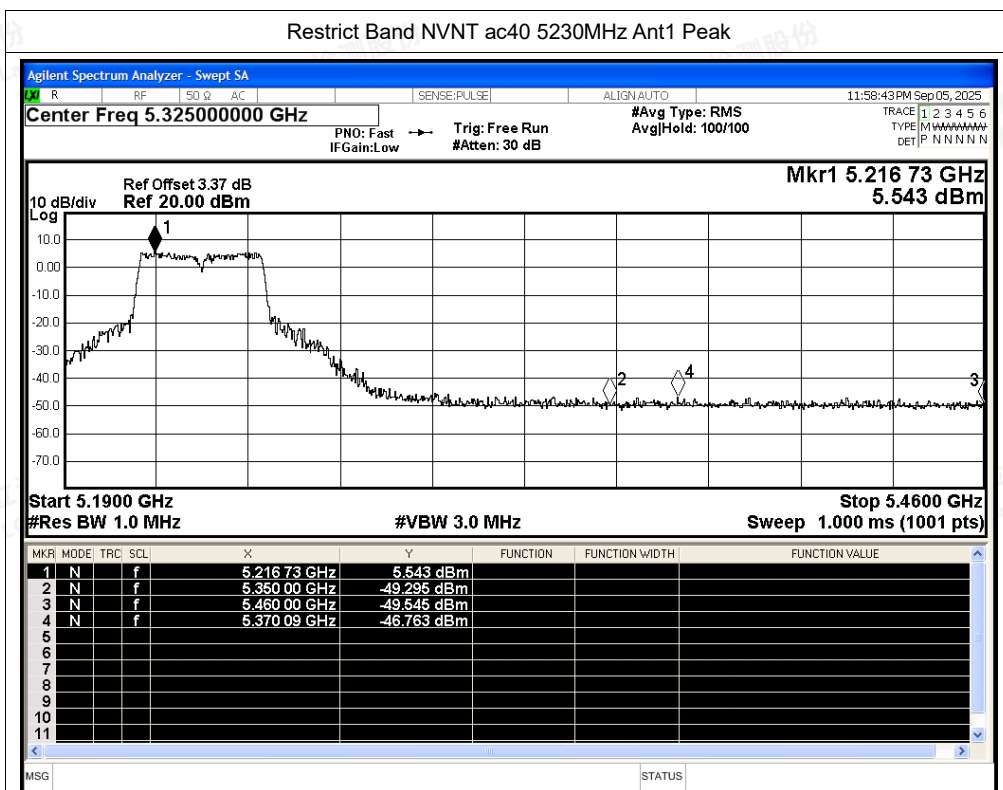


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

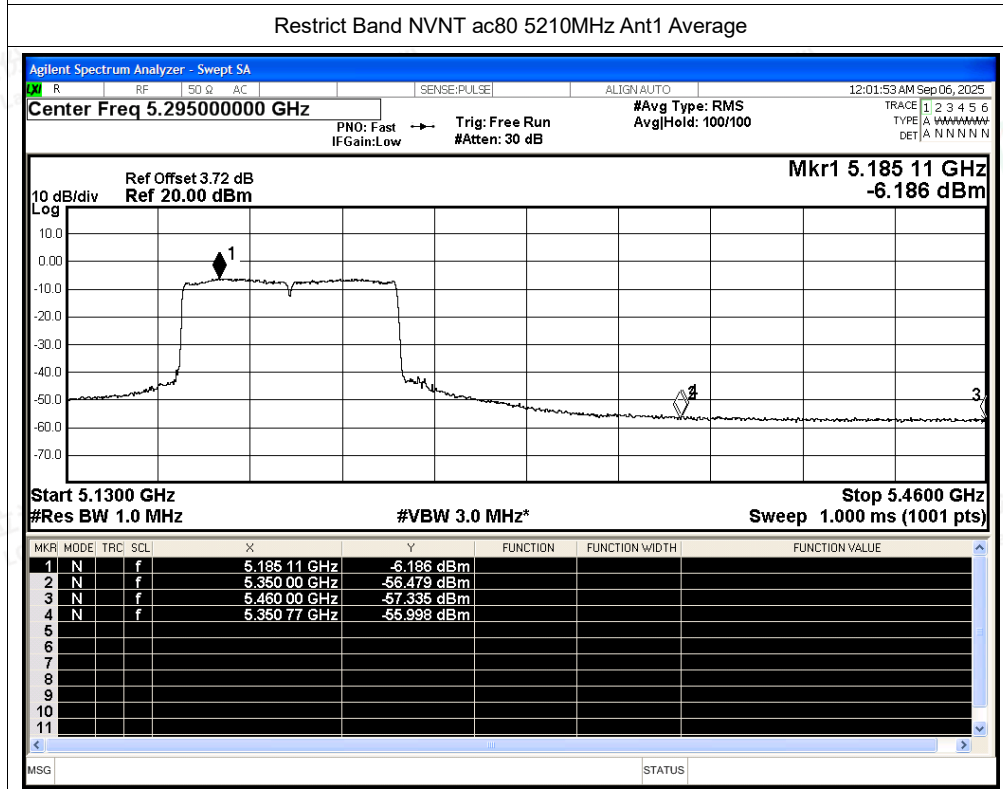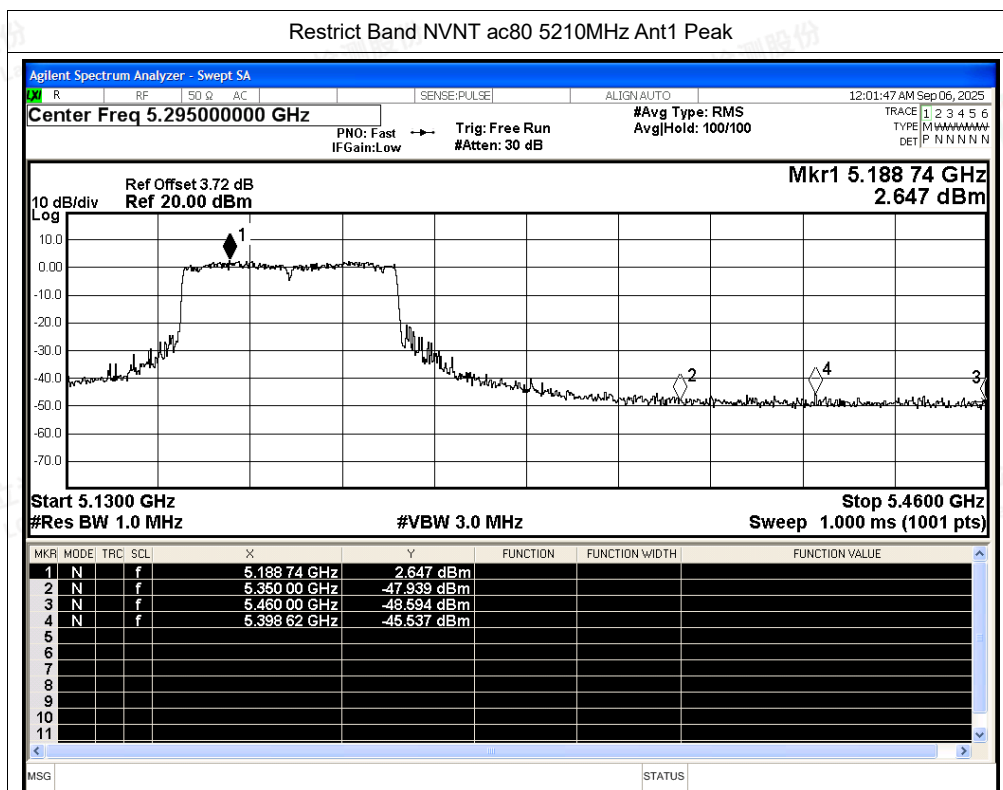

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

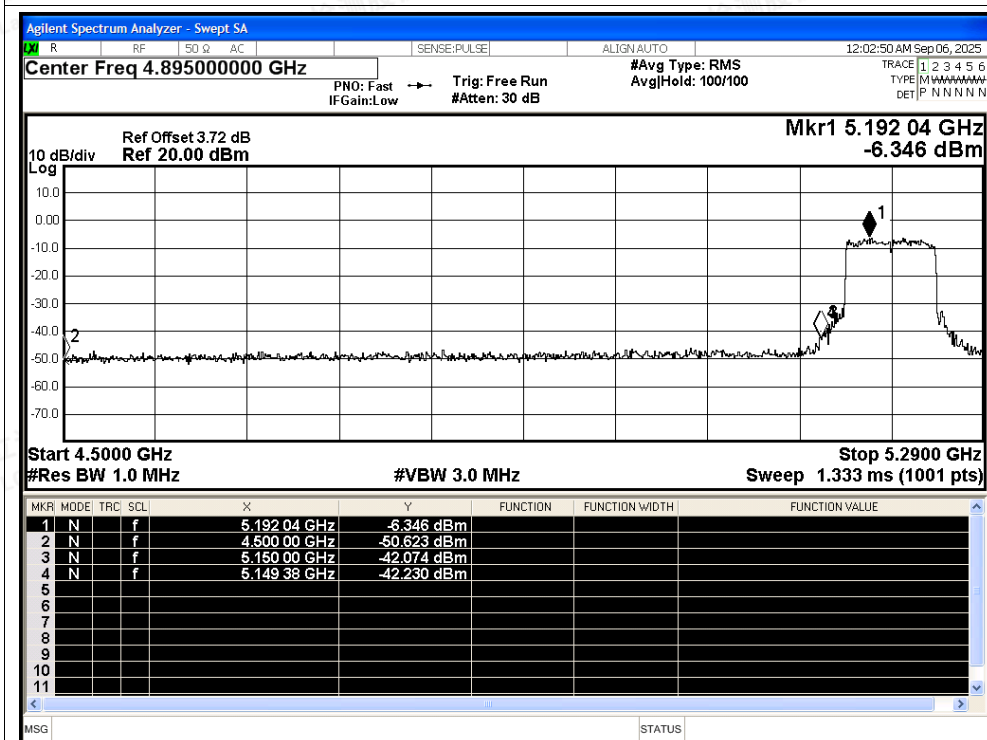

Restrict Band NVNT ac80 5210MHz Ant1 Average

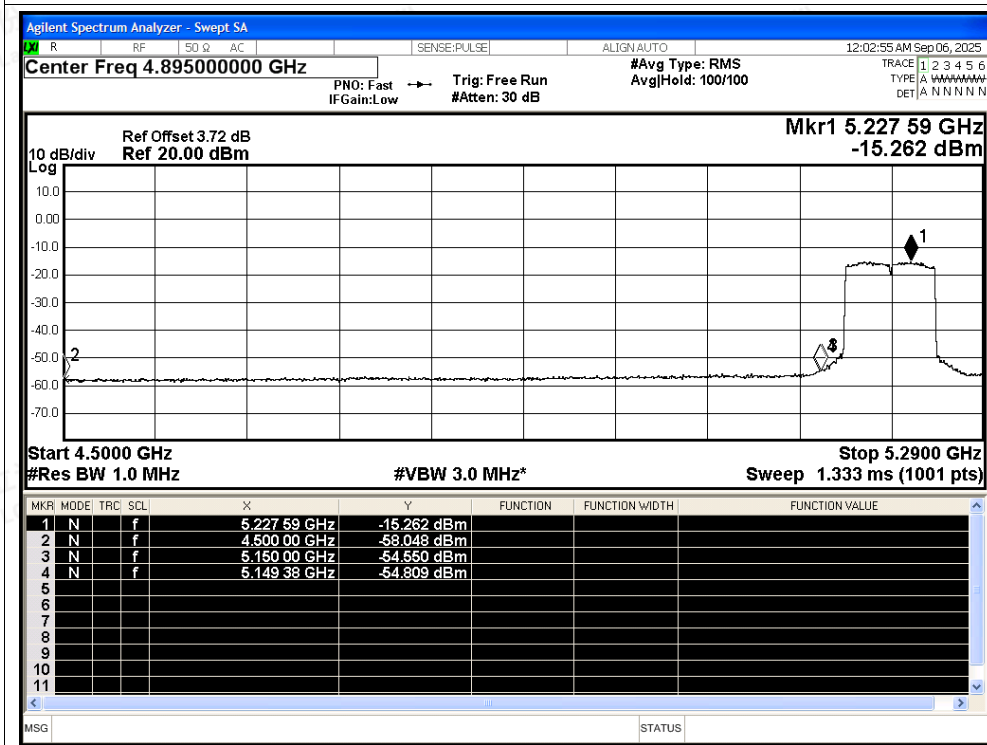

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant0	Ant1	Ant0+ Ant1			
NVNT	n20	5180	46.86	47.96	53.45	Peak	68.2	Pass
NVNT	n20	5180	39.72	39.40	45.58	Average	54	Pass
NVNT	n20	5180	52.63	54.26	59.50	Peak	68.2	Pass
NVNT	n20	5180	42.89	42.39	48.66	Average	54	Pass
NVNT	n20	5180	52.68	53.60	59.17	Peak	68.2	Pass
NVNT	n20	5180	42.51	42.76	48.66	Average	54	Pass
NVNT	n20	5240	47.98	45.63	52.90	Peak	68.2	Pass
NVNT	n20	5240	40.06	39.60	45.85	Average	54	Pass
NVNT	n20	5240	50.68	50.88	56.80	Peak	68.2	Pass
NVNT	n20	5240	40.92	40.32	46.65	Average	54	Pass
NVNT	n20	5240	48.64	48.38	54.53	Peak	68.2	Pass
NVNT	n20	5240	39.62	39.36	45.51	Average	54	Pass
NVNT	n40	5190	48.11	46.97	53.58	Peak	68.2	Pass
NVNT	n40	5190	39.68	39.01	45.37	Average	54	Pass
NVNT	n40	5190	55.79	54.64	61.25	Peak	68.2	Pass
NVNT	n40	5190	43.34	42.67	49.03	Average	54	Pass
NVNT	n40	5190	53.25	54.64	59.99	Peak	68.2	Pass
NVNT	n40	5190	43.34	42.67	49.03	Average	54	Pass
NVNT	n40	5230	47.90	49.19	54.59	Peak	68.2	Pass
NVNT	n40	5230	40.37	39.71	46.07	Average	54	Pass
NVNT	n40	5230	51.07	50.35	56.74	Peak	68.2	Pass
NVNT	n40	5230	41.19	40.64	46.94	Average	54	Pass
NVNT	n40	5230	47.82	47.25	53.56	Peak	68.2	Pass
NVNT	n40	5230	40.06	40.12	46.11	Average	54	Pass
NVNT	ac20	5180	47.36	48.70	54.08	Peak	68.2	Pass
NVNT	ac20	5180	39.39	39.38	45.41	Average	54	Pass
NVNT	ac20	5180	52.28	56.82	60.86	Peak	68.2	Pass
NVNT	ac20	5180	43.05	41.88	48.51	Average	54	Pass
NVNT	ac20	5180	52.05	52.03	58.06	Peak	68.2	Pass
NVNT	ac20	5180	43.03	42.58	48.83	Average	54	Pass
NVNT	ac20	5240	47.80	49.23	54.56	Peak	68.2	Pass
NVNT	ac20	5240	39.92	39.61	45.79	Average	54	Pass
NVNT	ac20	5240	51.60	50.83	57.24	Peak	68.2	Pass
NVNT	ac20	5240	40.81	40.77	46.81	Average	54	Pass
NVNT	ac20	5240	47.87	47.32	53.62	Peak	68.2	Pass
NVNT	ac20	5240	39.63	39.46	45.57	Average	54	Pass
NVNT	ac40	5190	47.99	46.74	53.41	Peak	68.2	Pass
NVNT	ac40	5190	39.55	39.34	45.47	Average	54	Pass
NVNT	ac40	5190	52.15	52.90	58.55	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	43.36	42.64	49.03	Average	54	Pass
NVNT	ac40	5190	52.15	52.66	58.43	Peak	68.2	Pass
NVNT	ac40	5190	43.36	42.64	49.03	Average	54	Pass
NVNT	ac40	5230	49.62	48.01	54.87	Peak	68.2	Pass
NVNT	ac40	5230	40.06	40.64	46.38	Average	54	Pass
NVNT	ac40	5230	50.51	50.55	56.55	Peak	68.2	Pass
NVNT	ac40	5230	41.03	40.94	47.01	Average	54	Pass
NVNT	ac40	5230	47.20	47.76	53.51	Peak	68.2	Pass
NVNT	ac40	5230	40.25	39.35	45.83	Average	54	Pass
NVNT	ac80	5210	49.35	49.37	55.38	Peak	68.2	Pass
NVNT	ac80	5210	41.99	41.30	47.67	Average	54	Pass
NVNT	ac80	5210	51.39	51.77	57.60	Peak	68.2	Pass
NVNT	ac80	5210	42.27	41.78	48.05	Average	54	Pass
NVNT	ac80	5210	50.35	48.72	55.59	Peak	68.2	Pass
NVNT	ac80	5210	40.21	40.44	46.35	Average	54	Pass
NVNT	ac80	5210	47.69	46.69	53.22	Peak	68.2	Pass
NVNT	ac80	5210	40.02	39.73	45.90	Average	54	Pass
NVNT	ac80	5210	53.08	55.08	60.16	Peak	68.2	Pass
NVNT	ac80	5210	43.35	42.97	49.18	Average	54	Pass
NVNT	ac80	5210	52.12	55.24	59.84	Peak	68.2	Pass
NVNT	ac80	5210	43.31	43.23	49.29	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant0	5180	0	0	25	Pass
NVNT	a	5200	Ant0	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant0	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant0	5190	0	0	25	Pass
NVNT	n40	5230	Ant0	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant0	5179.96	-40000	-7.72	25	Pass
NVNT	ac20	5200	Ant0	5199.96	-40000	-7.69	25	Pass
NVNT	ac20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant0	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant0	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant0	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant0

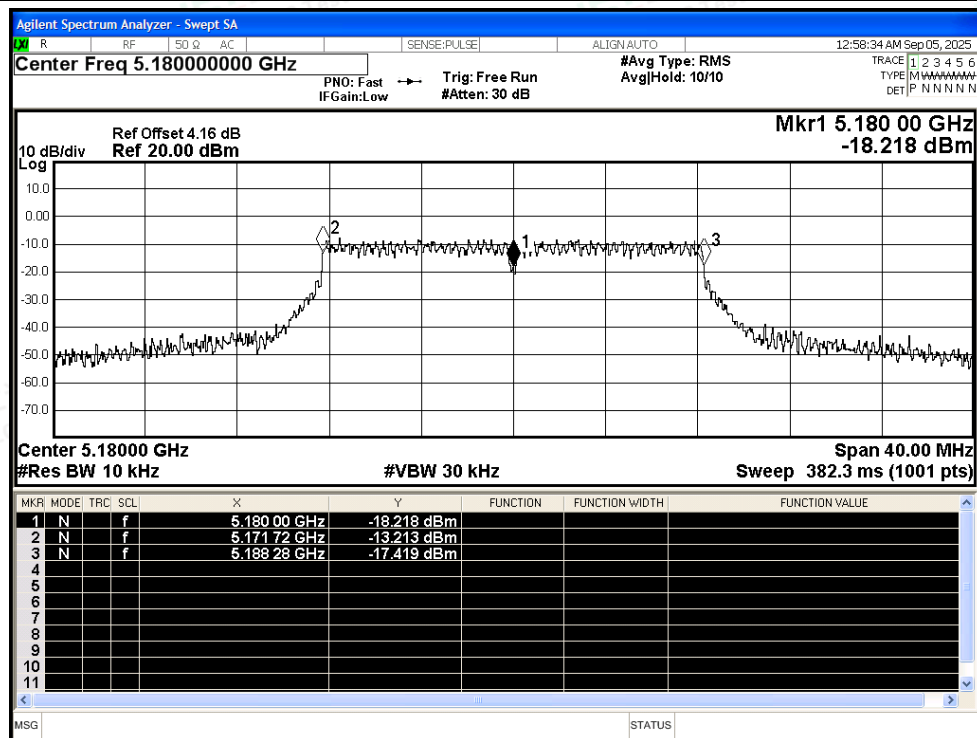

Freq. Stability NVNT a 5200MHz Ant0


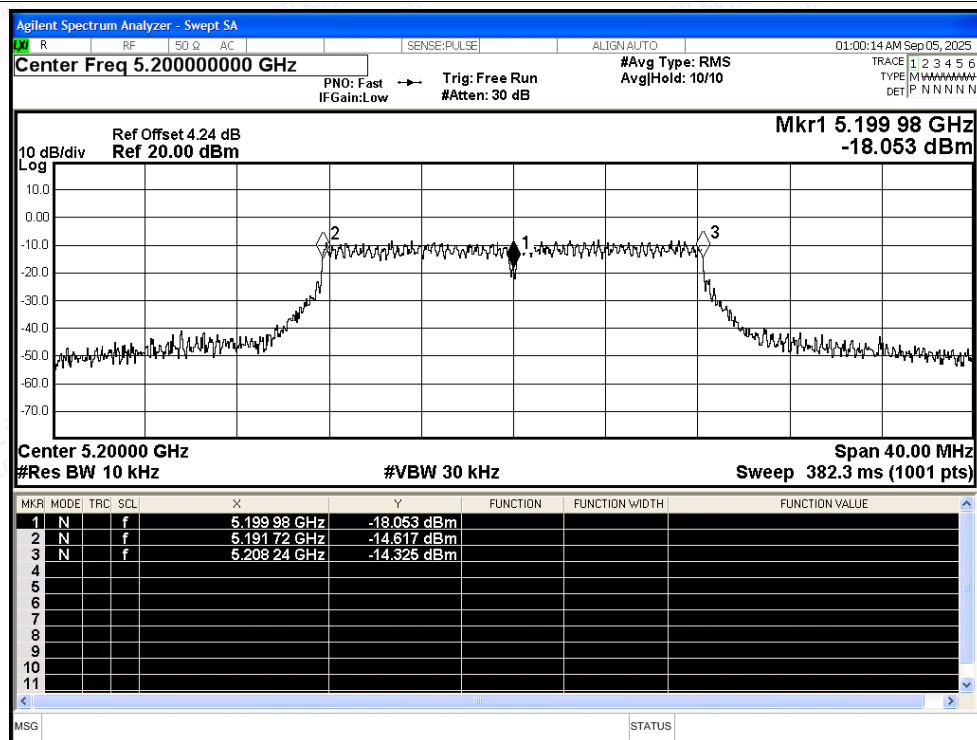


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

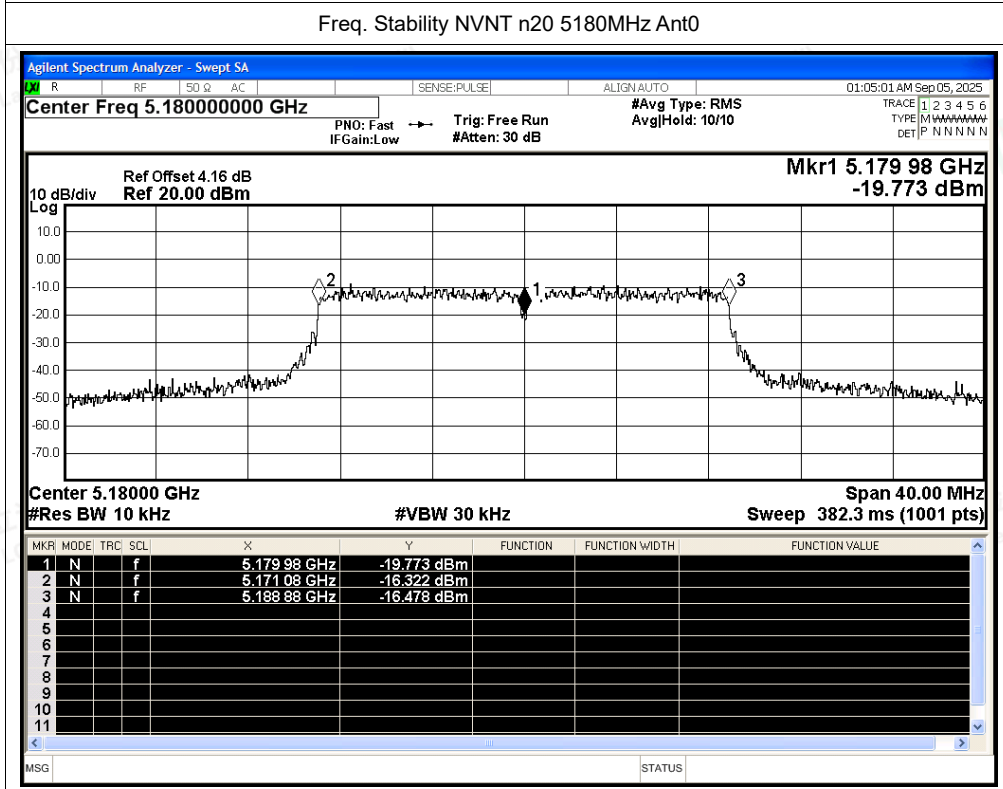
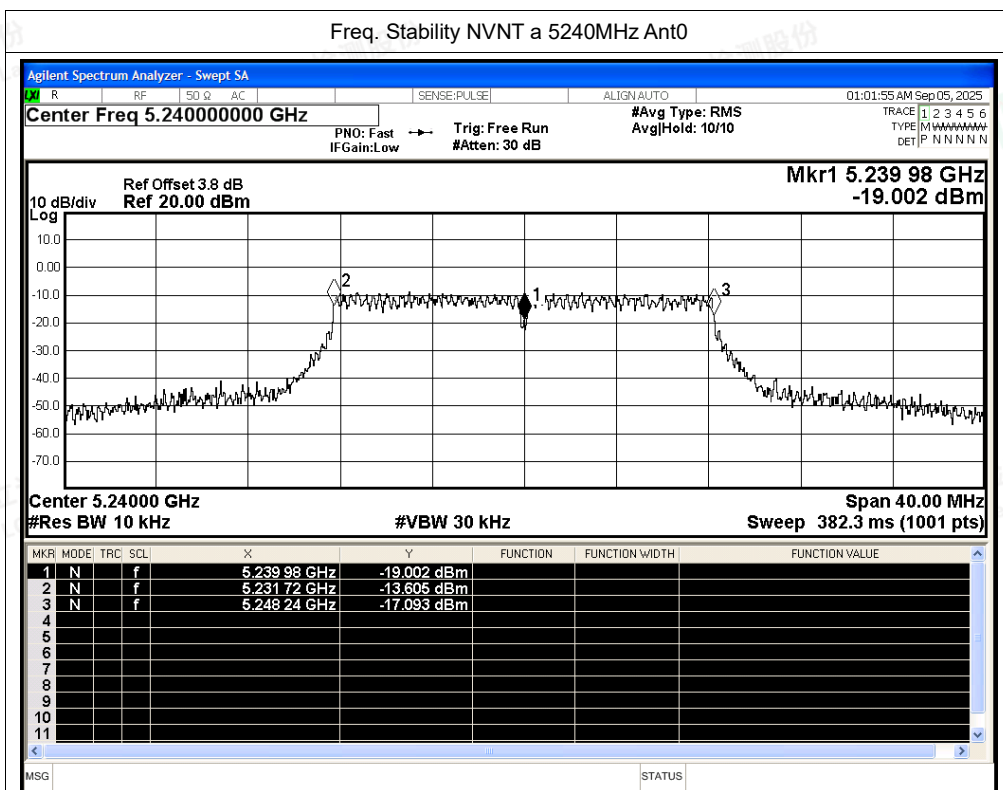


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

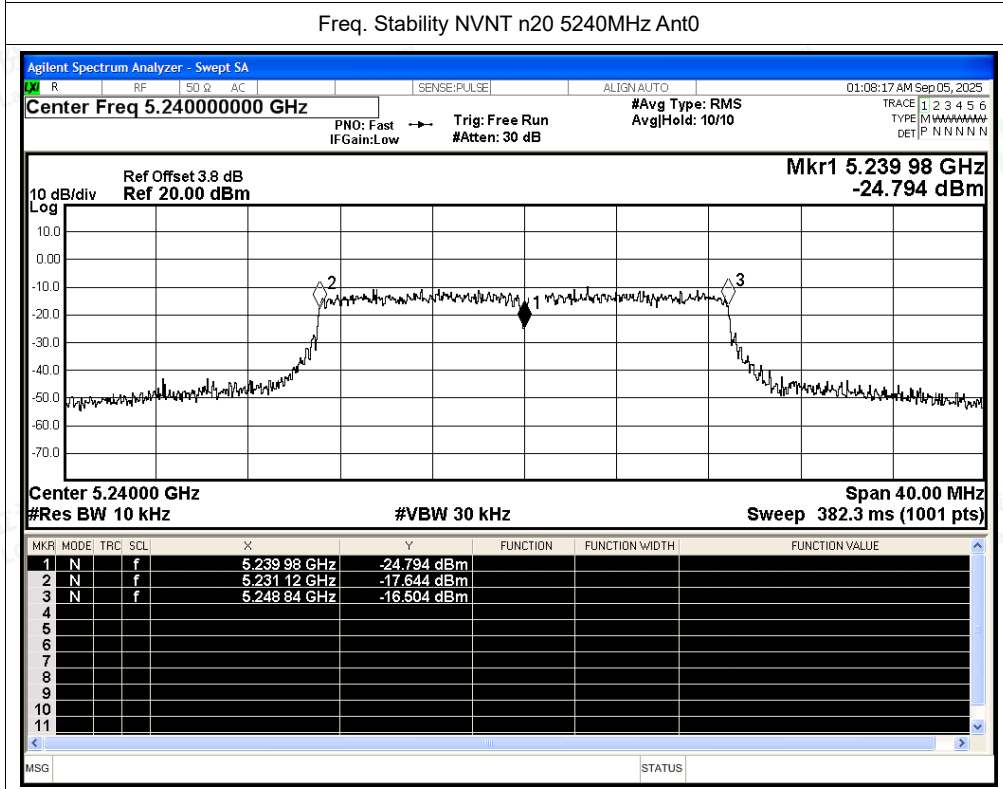
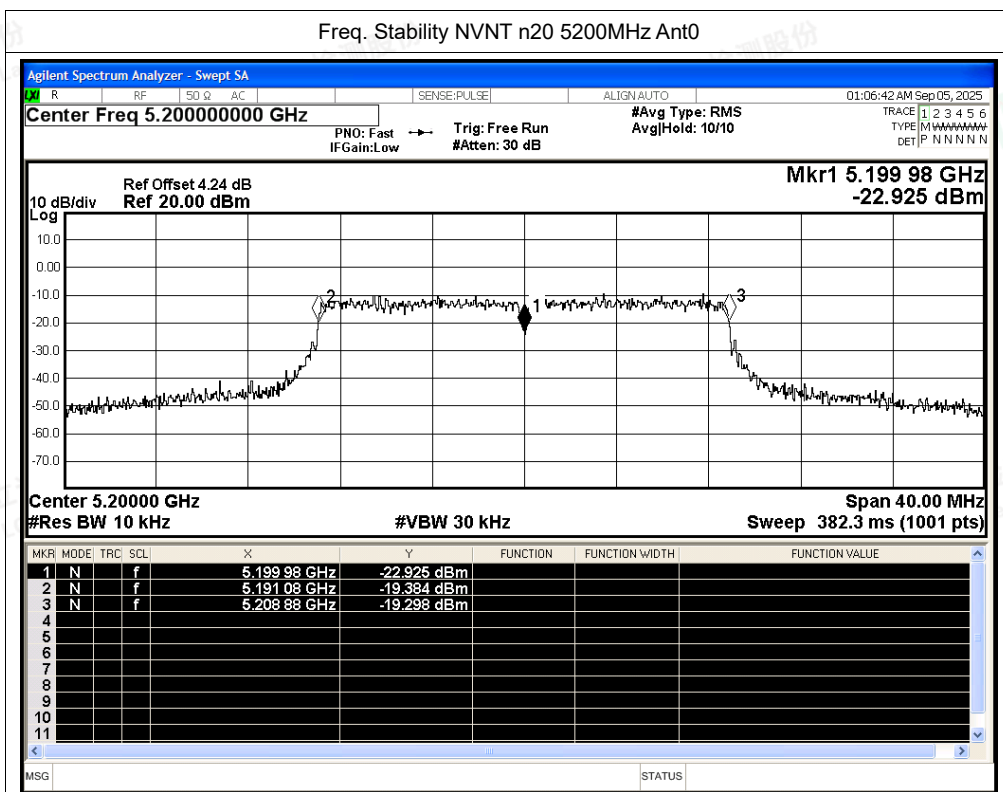


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

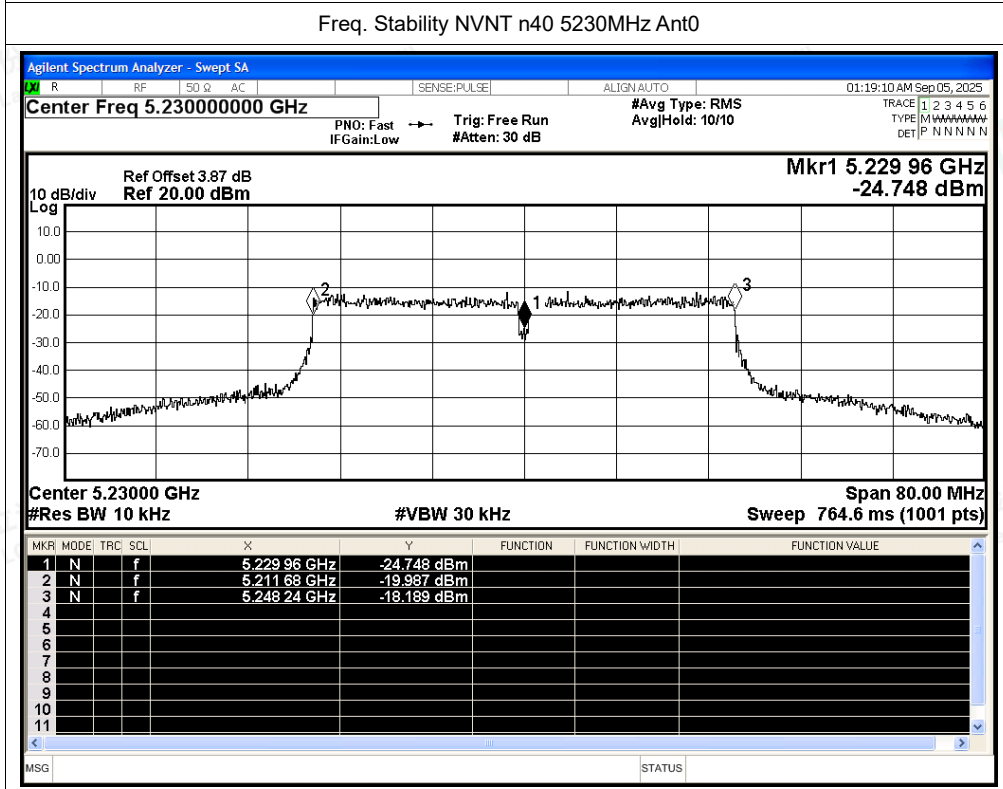
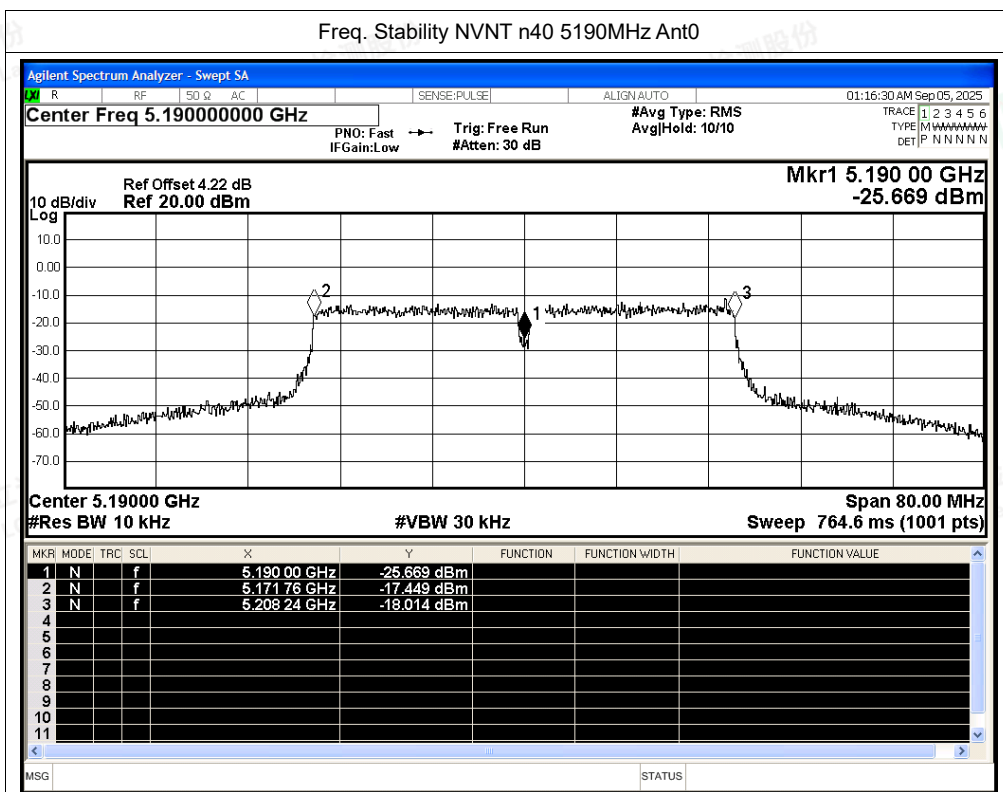


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

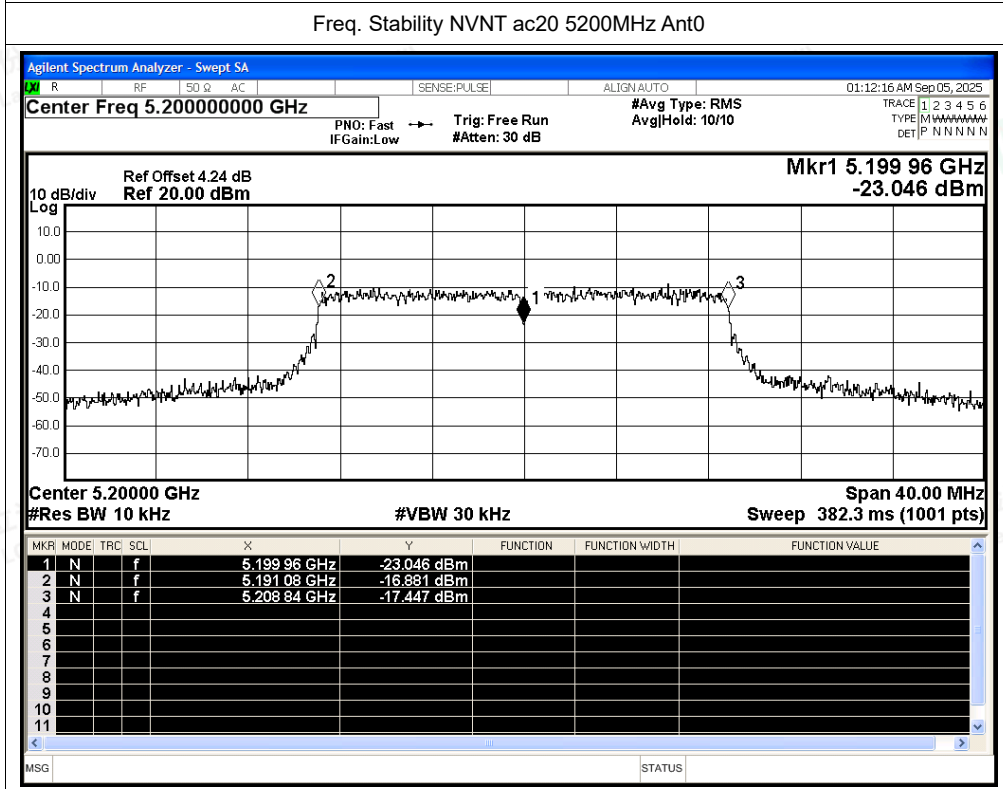
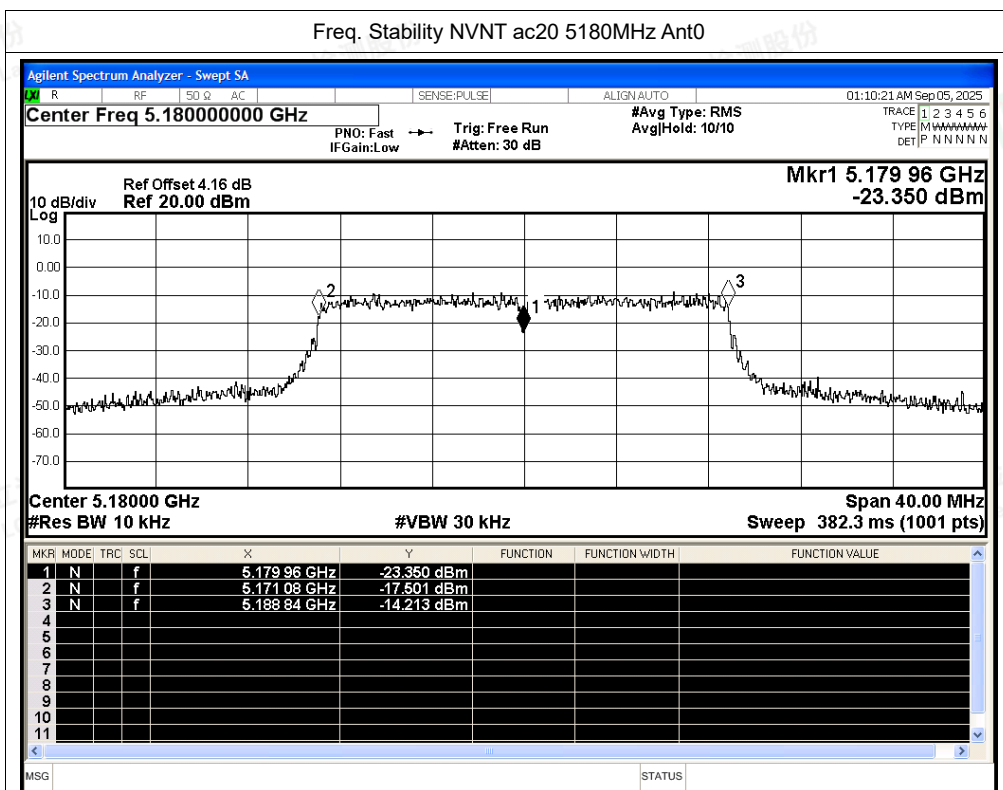


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

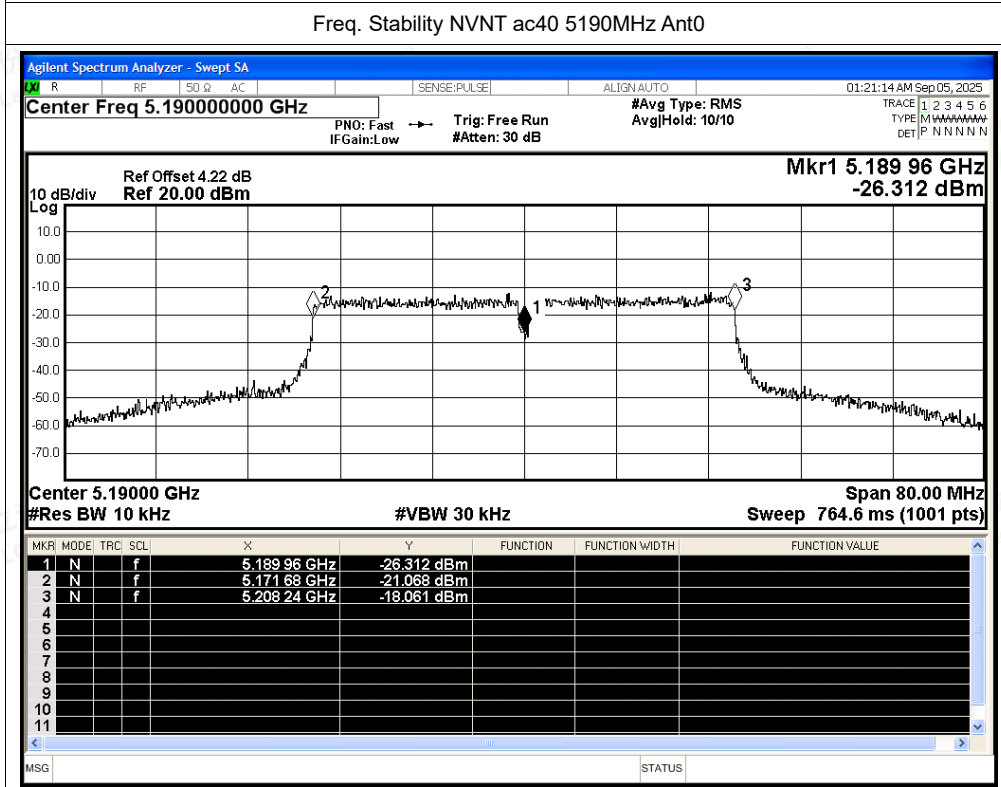
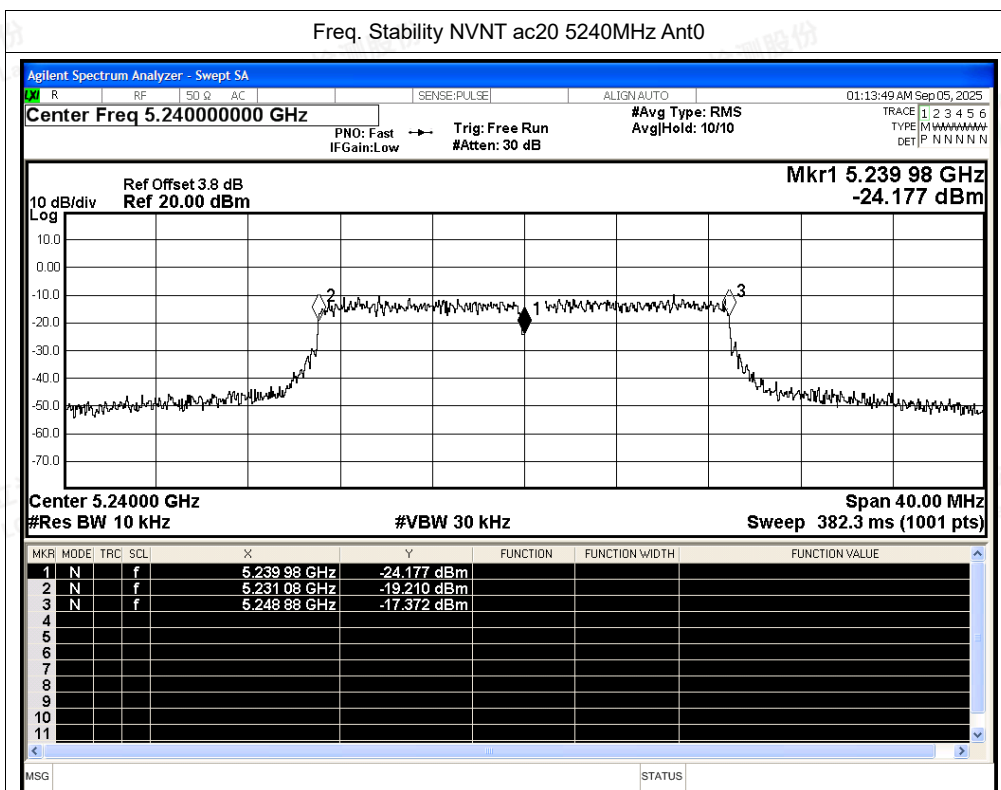


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

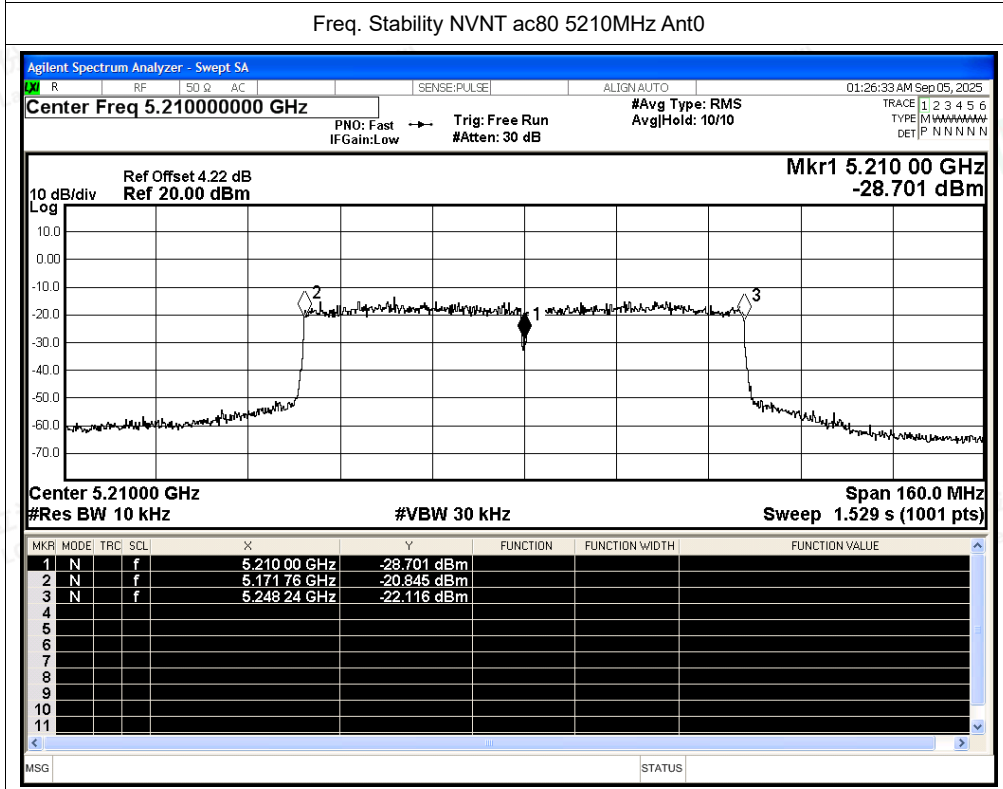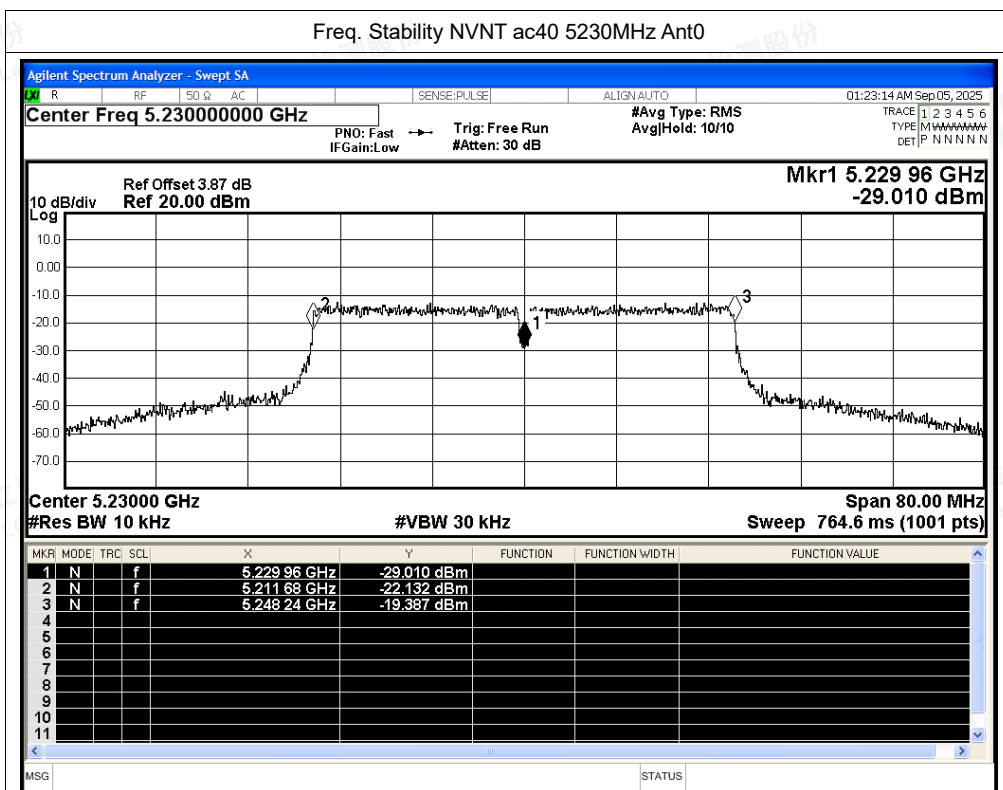


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

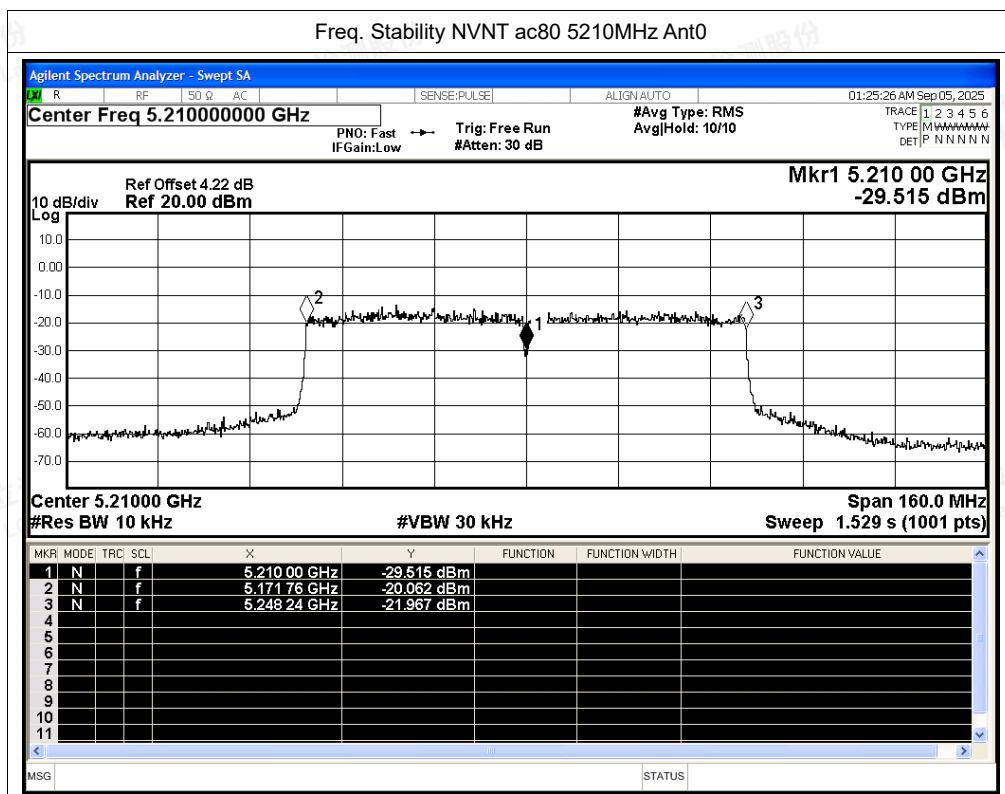

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5240	0	0	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

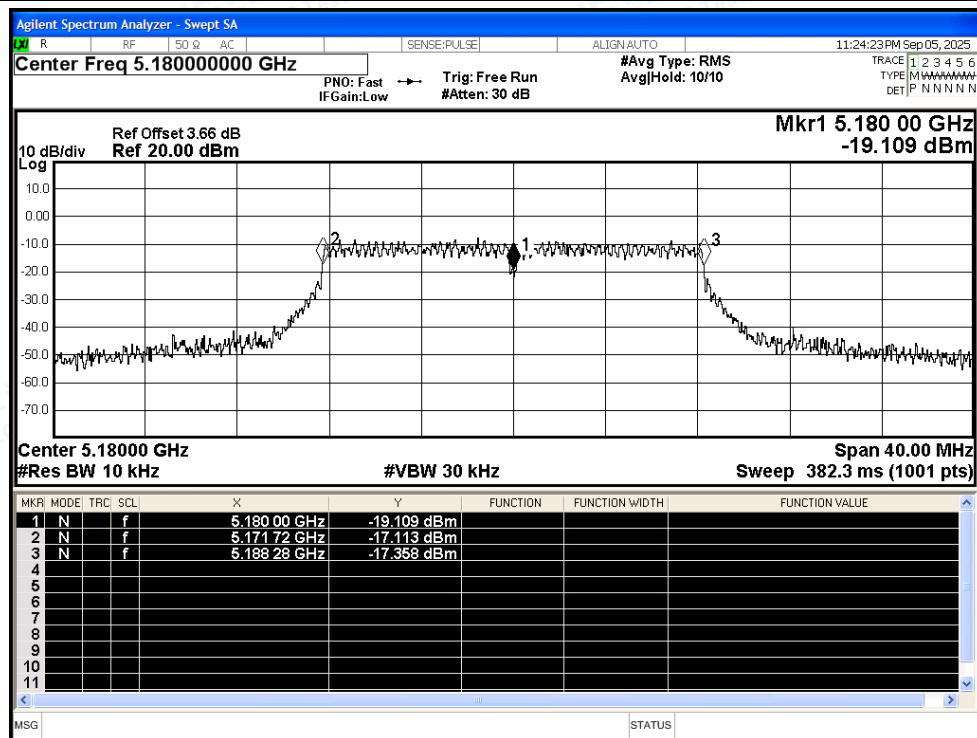

Freq. Stability NVNT a 5200MHz Ant1


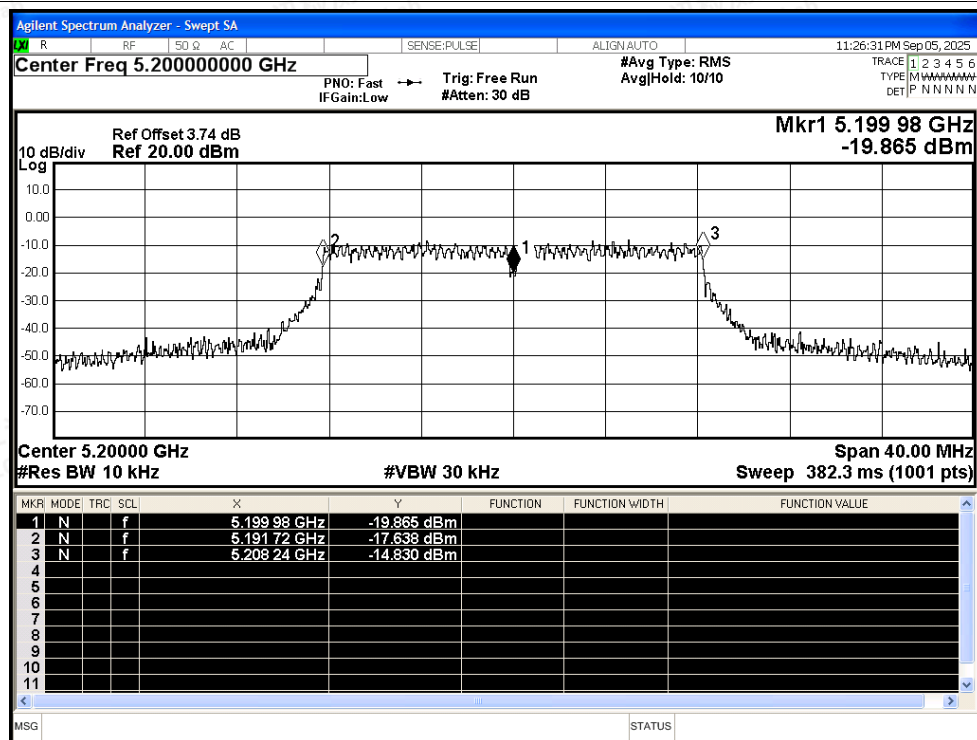


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

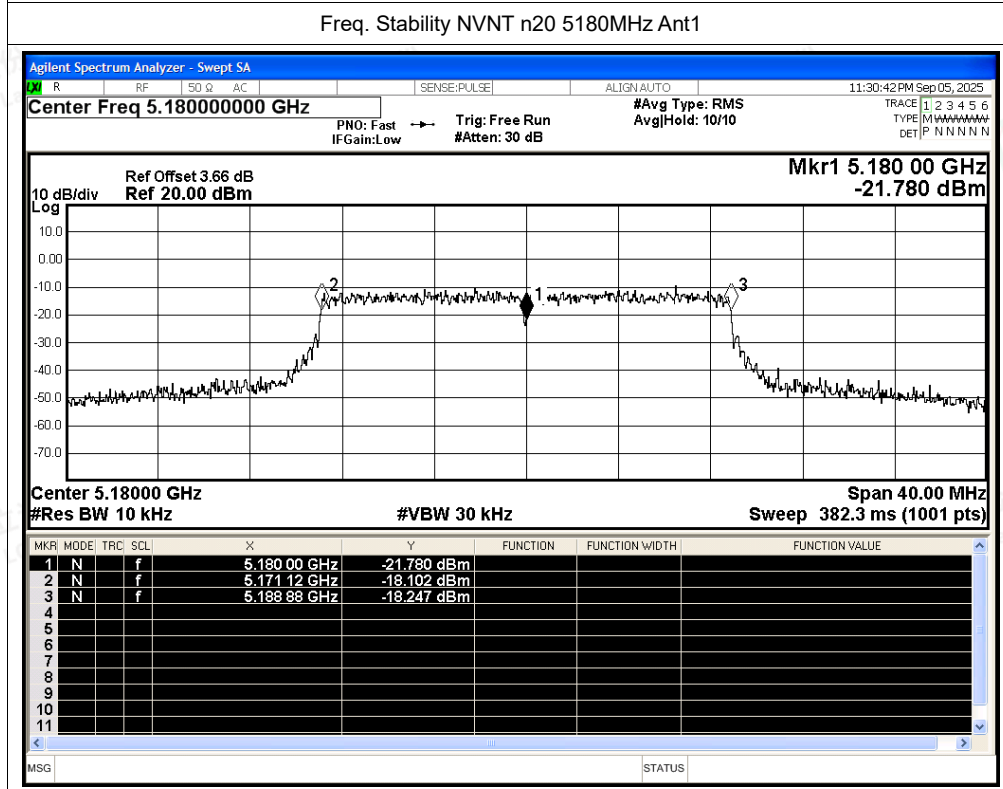
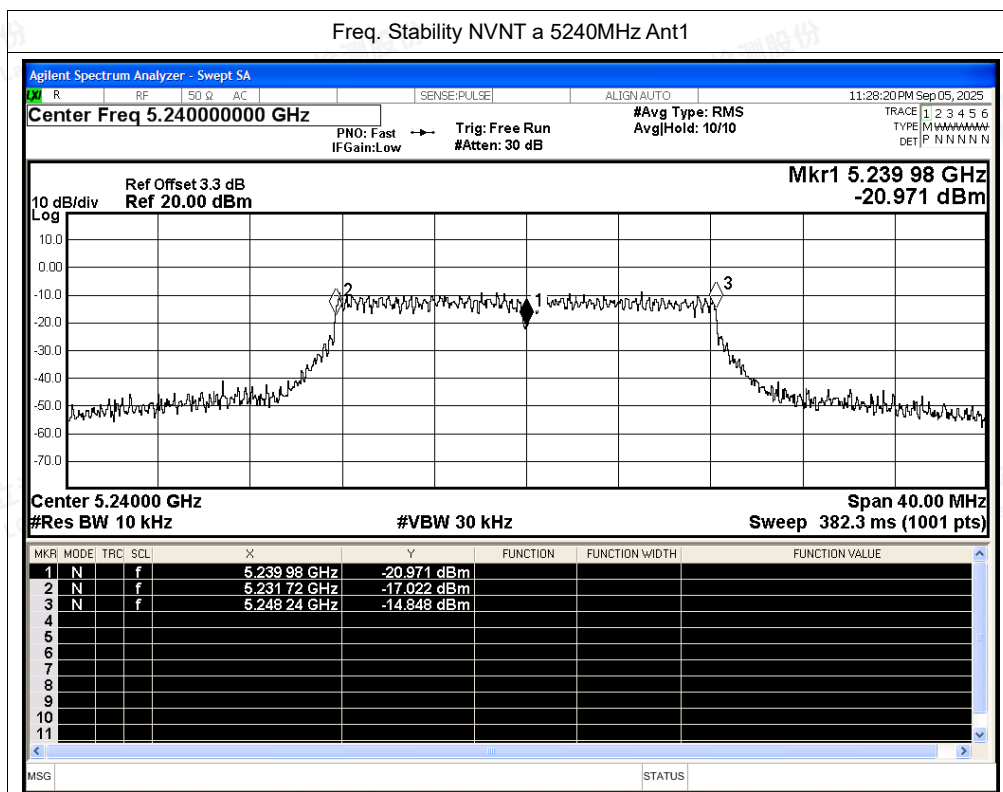


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

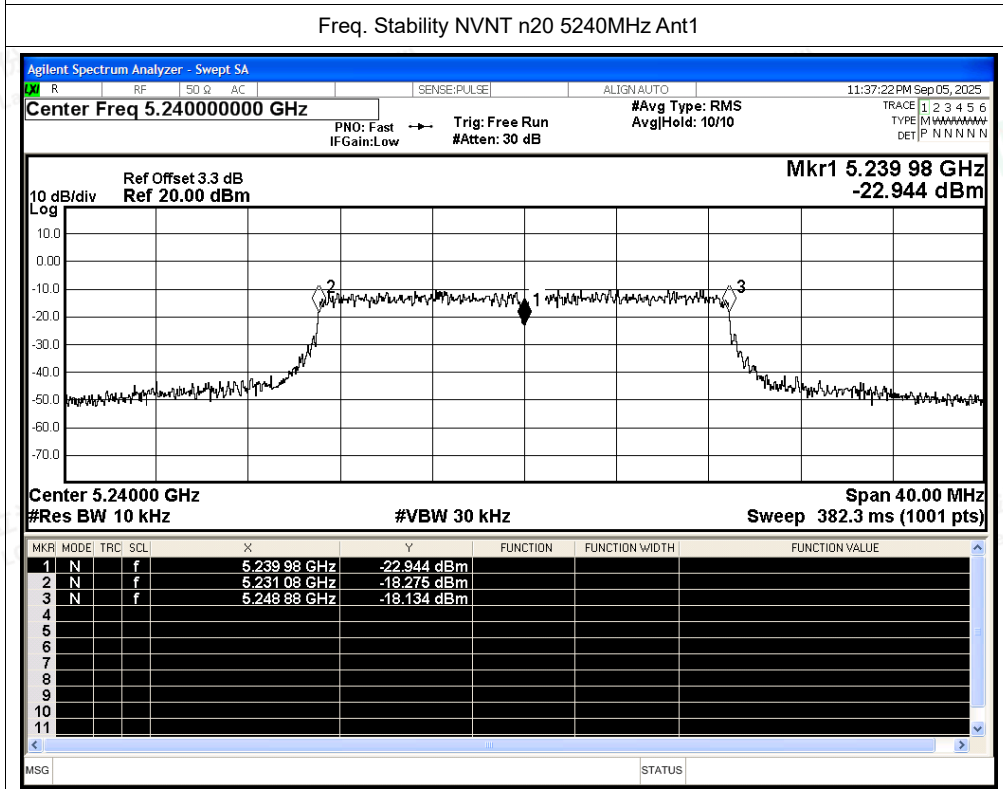
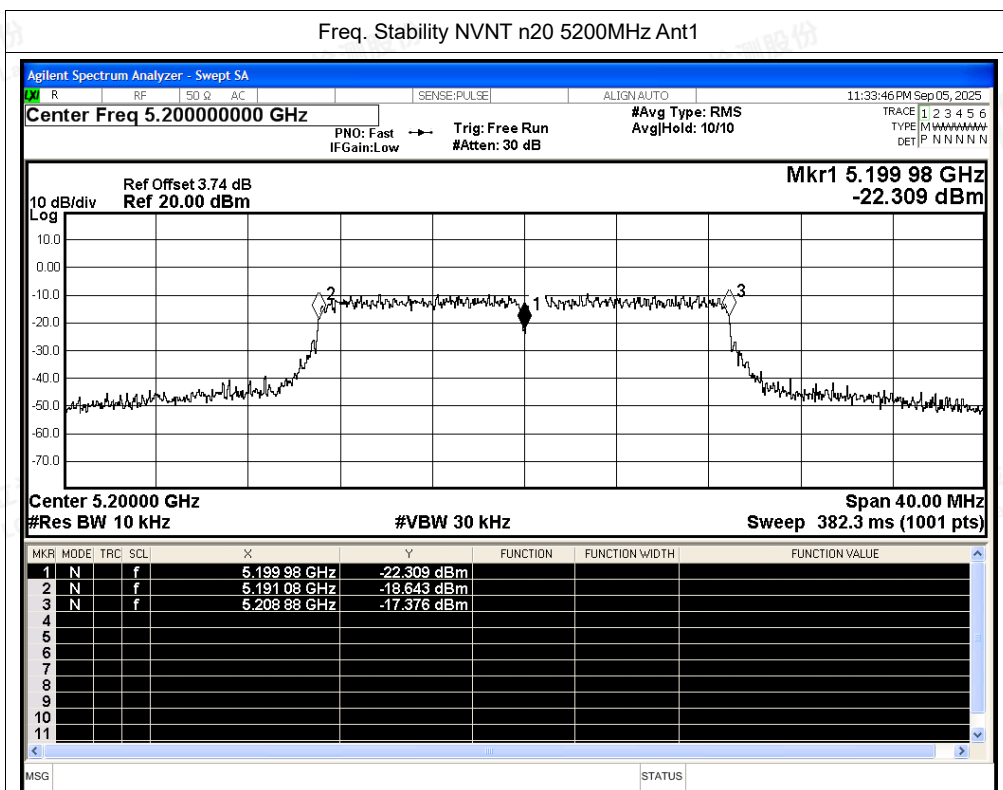


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

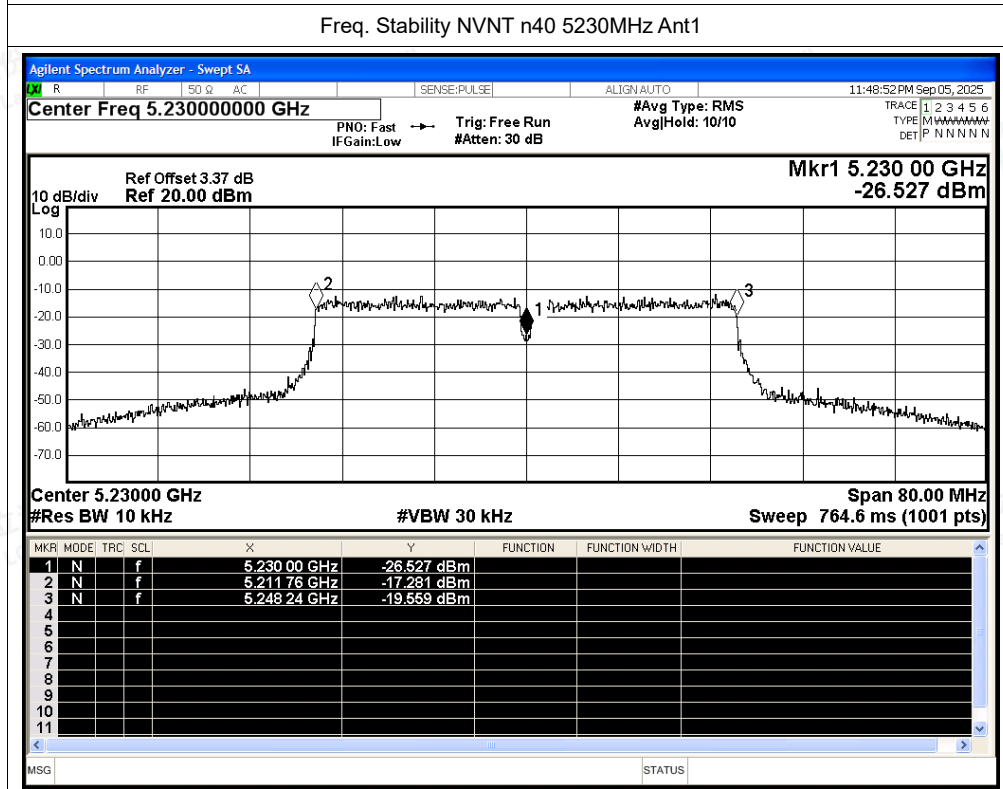
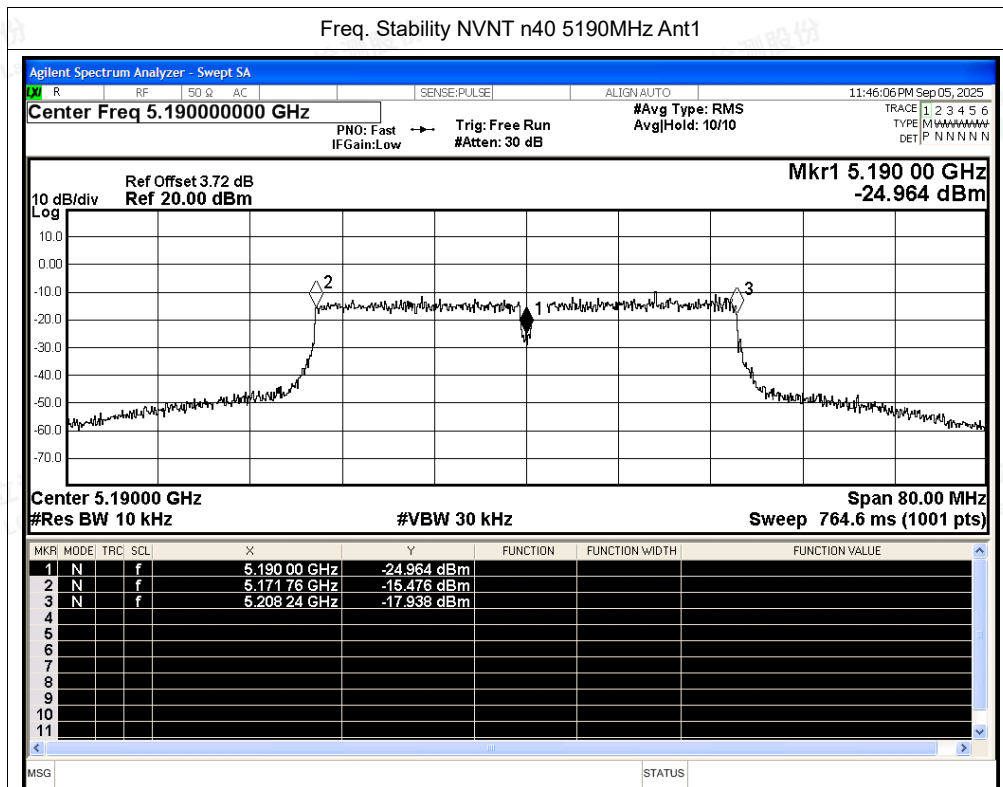


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

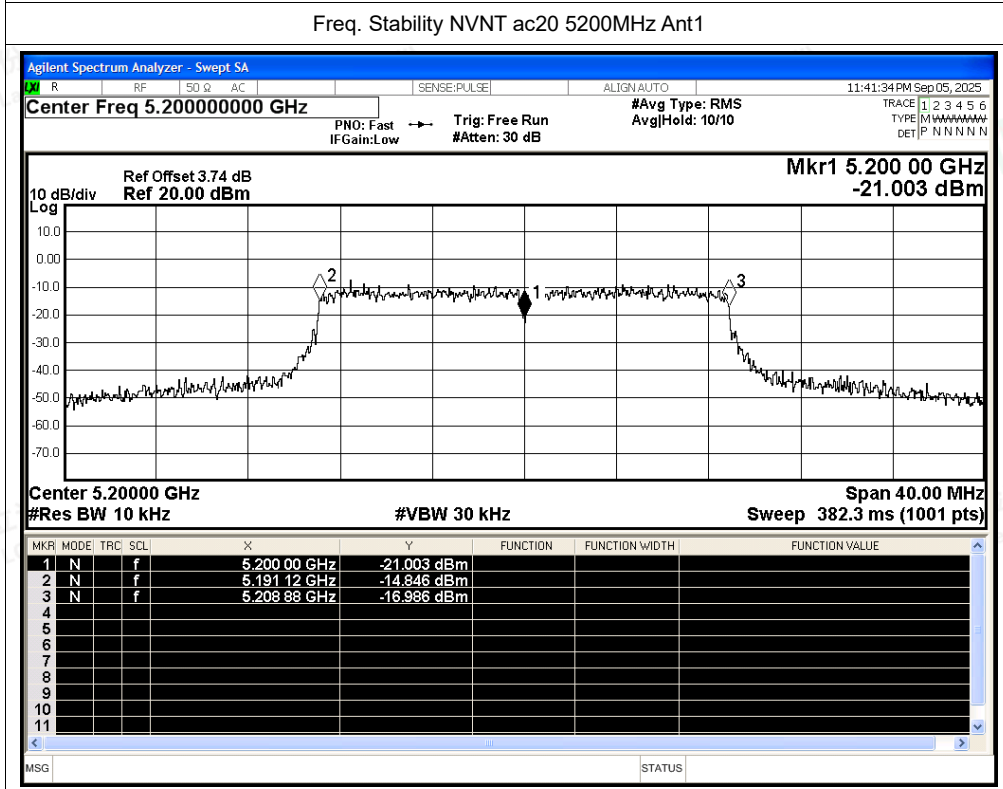
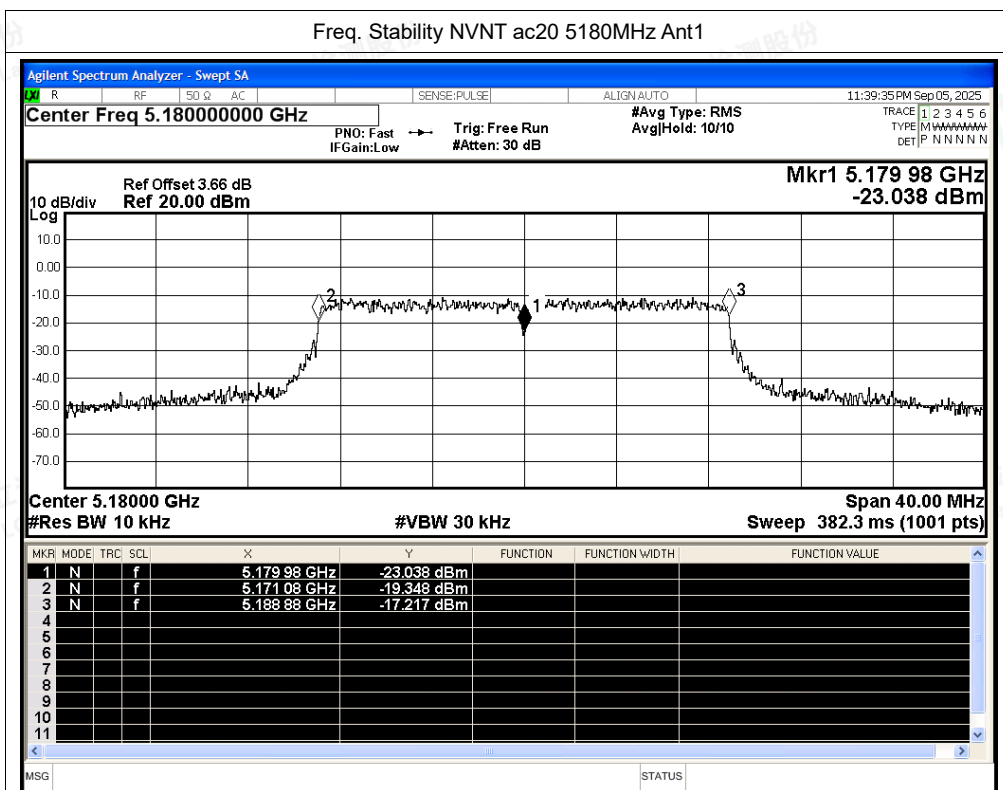


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

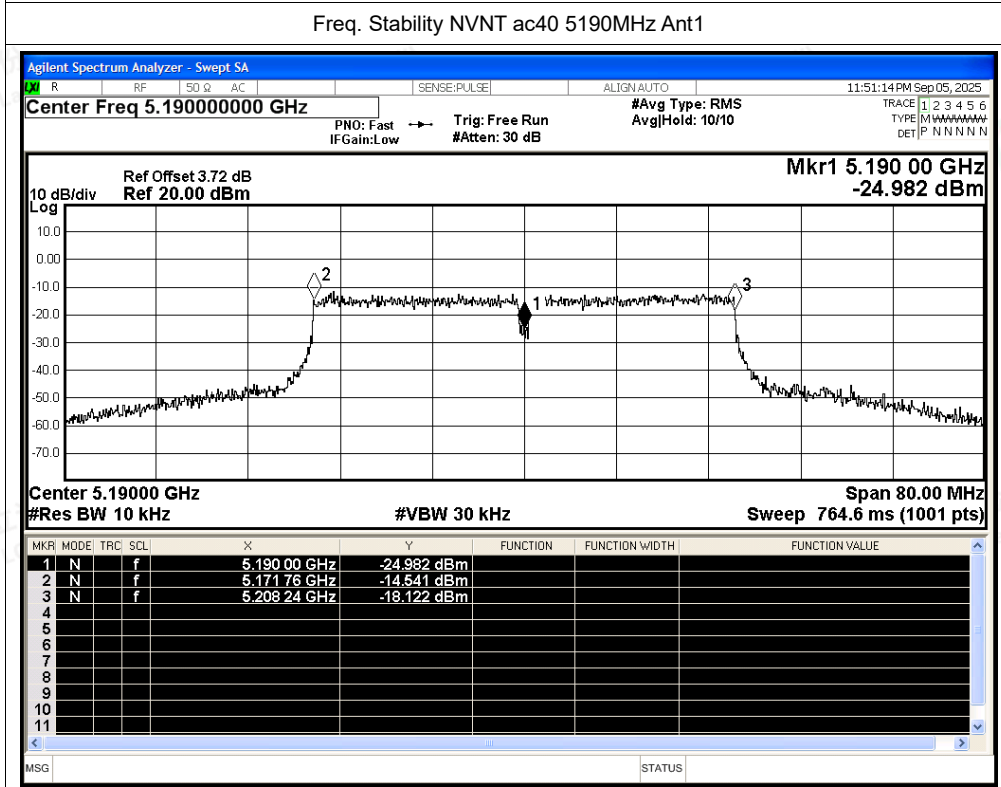
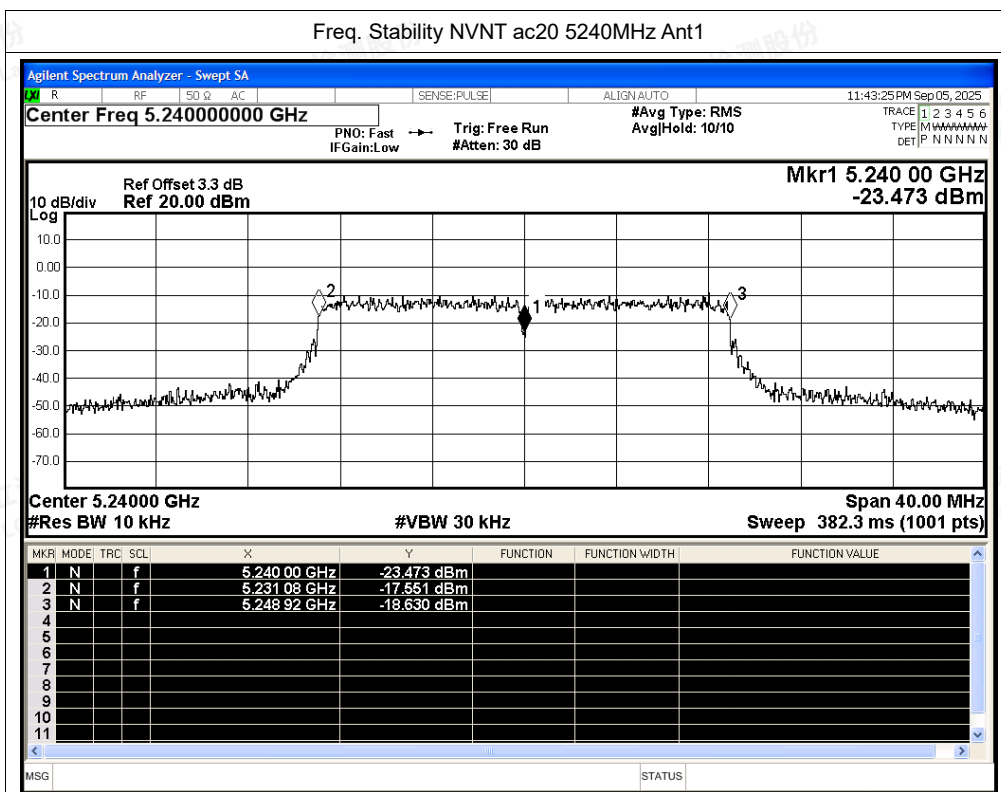


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

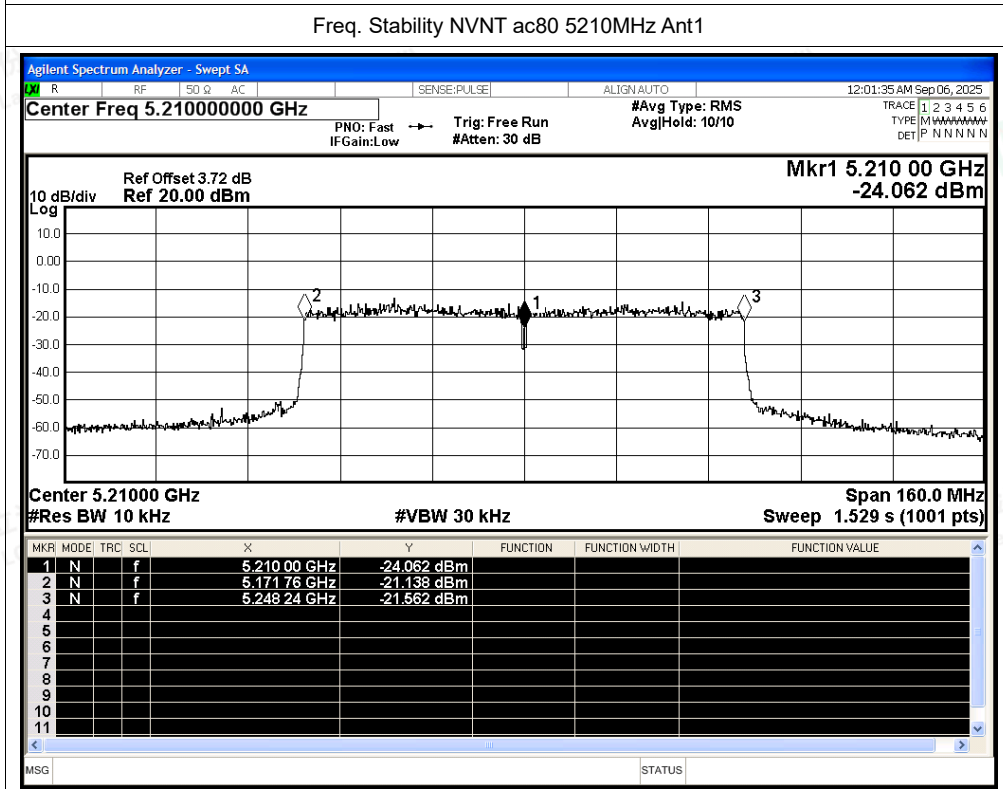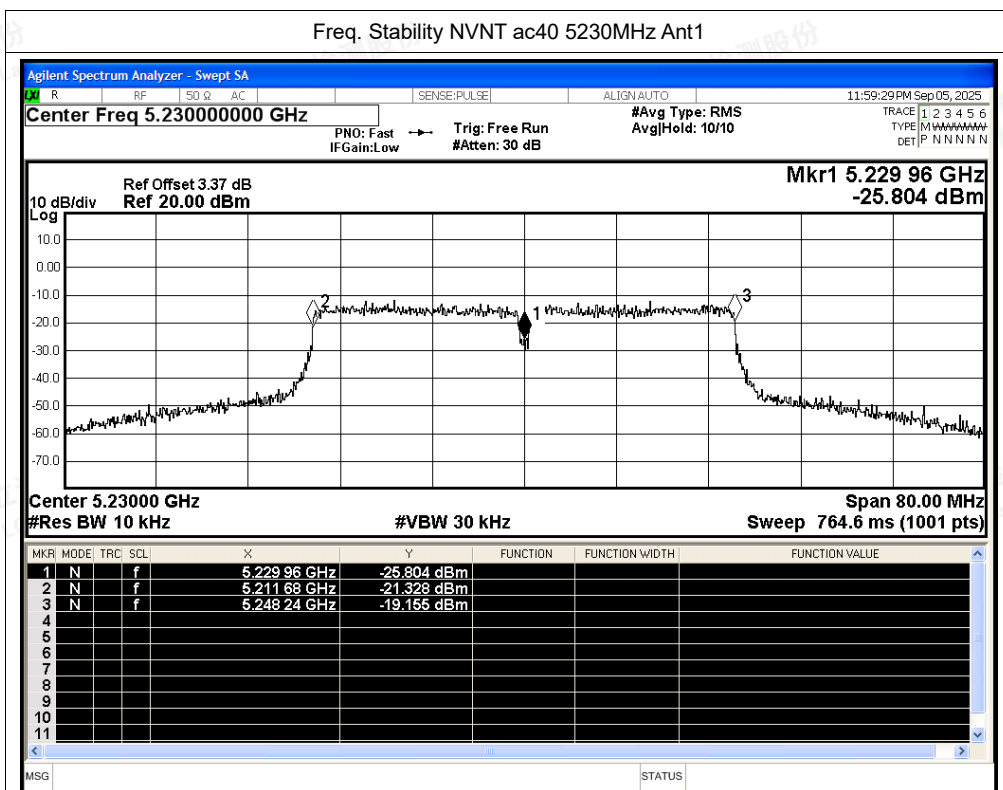

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant0	94.56	0.24	0.91
NVNT	a	5200	Ant0	94.56	0.24	0.91
NVNT	a	5240	Ant0	94.65	0.24	0.91
NVNT	n20	5180	Ant0	97.29	0.12	0.44
NVNT	n20	5200	Ant0	97.29	0.12	0.44
NVNT	n20	5240	Ant0	97.29	0.12	0.44
NVNT	n40	5190	Ant0	94.71	0.24	0.9
NVNT	n40	5230	Ant0	94.71	0.24	0.9
NVNT	ac20	5180	Ant0	97.35	0.12	0.44
NVNT	ac20	5200	Ant0	97.34	0.12	0.44
NVNT	ac20	5240	Ant0	97.34	0.12	0.44
NVNT	ac40	5190	Ant0	94.81	0.23	0.9
NVNT	ac40	5230	Ant0	94.72	0.24	0.9
NVNT	ac80	5210	Ant0	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant0

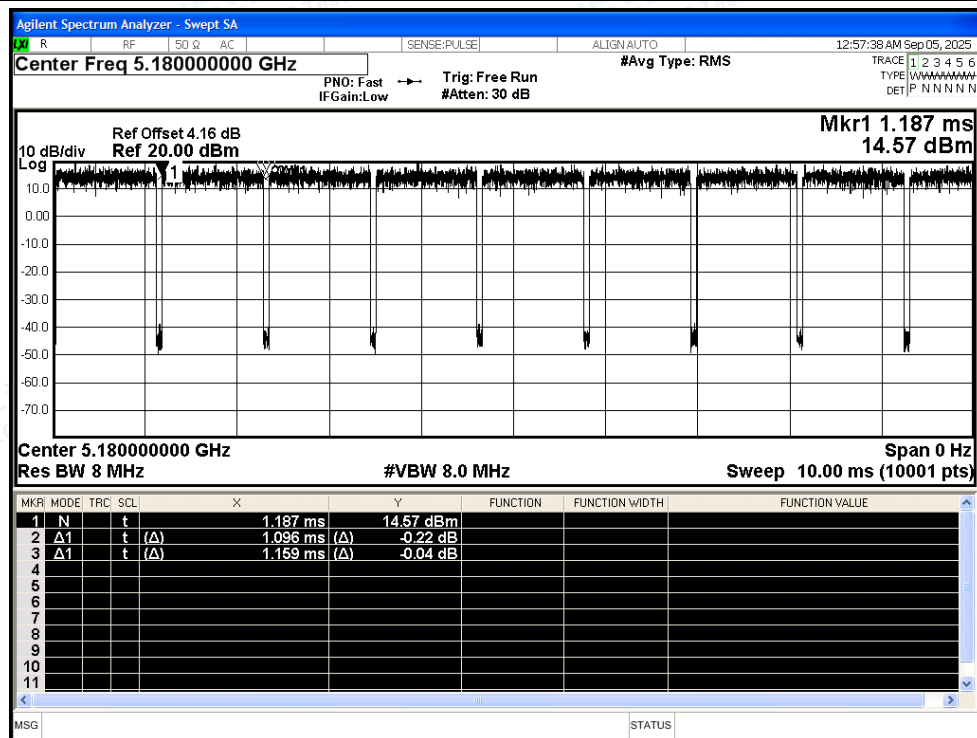

Duty Cycle NVNT a 5200MHz Ant0


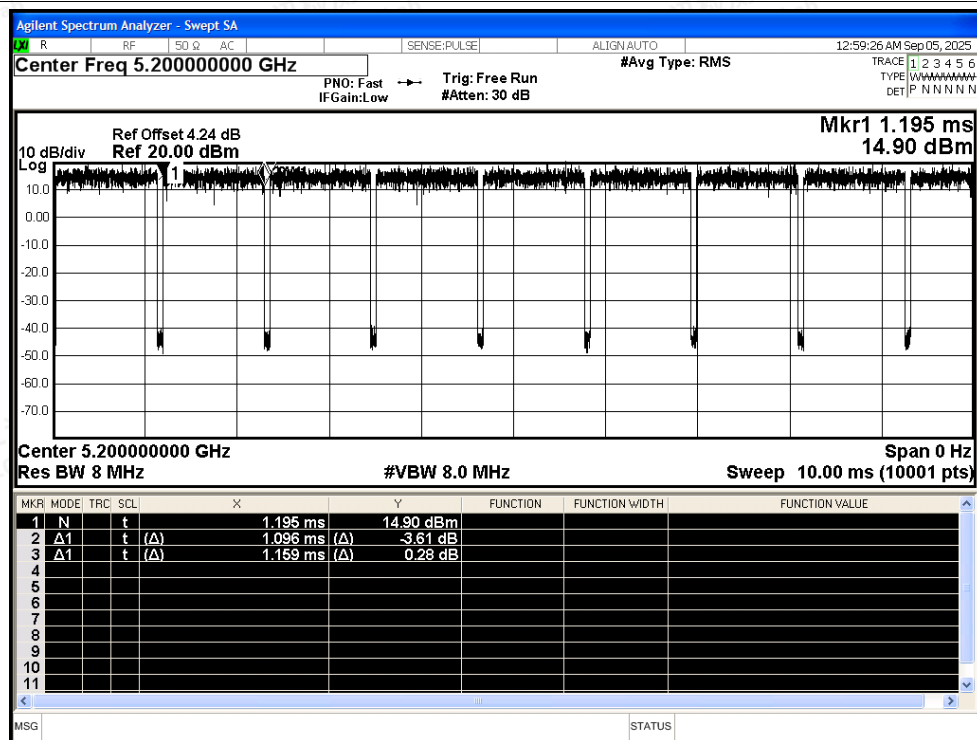


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

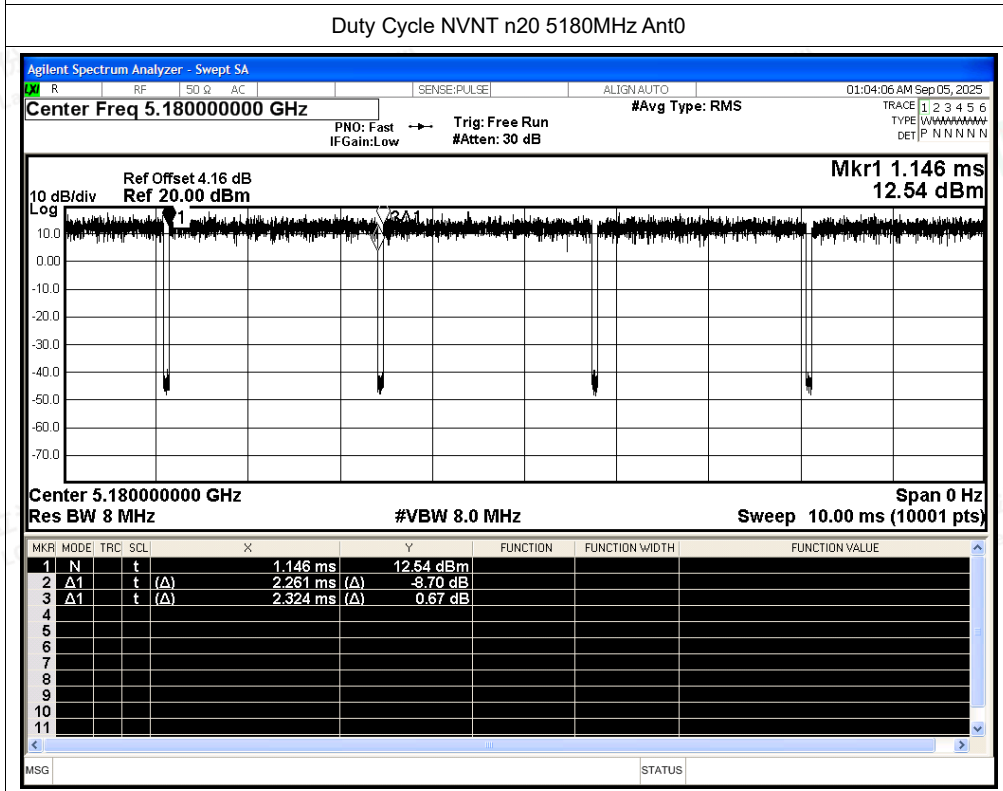
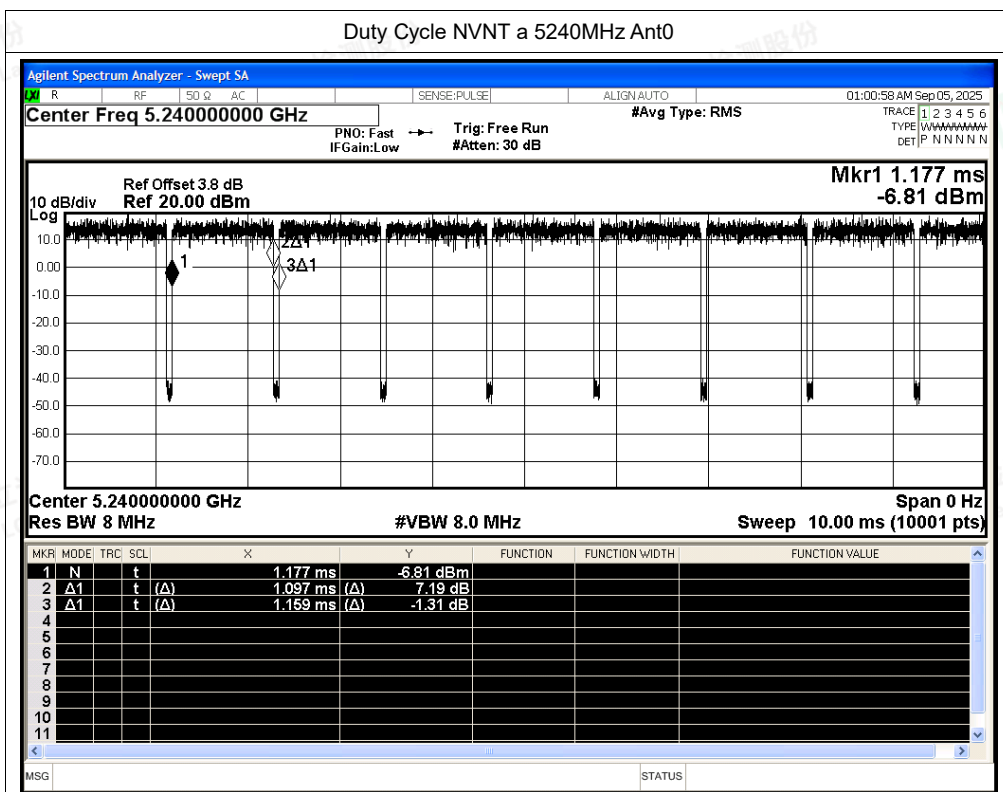


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

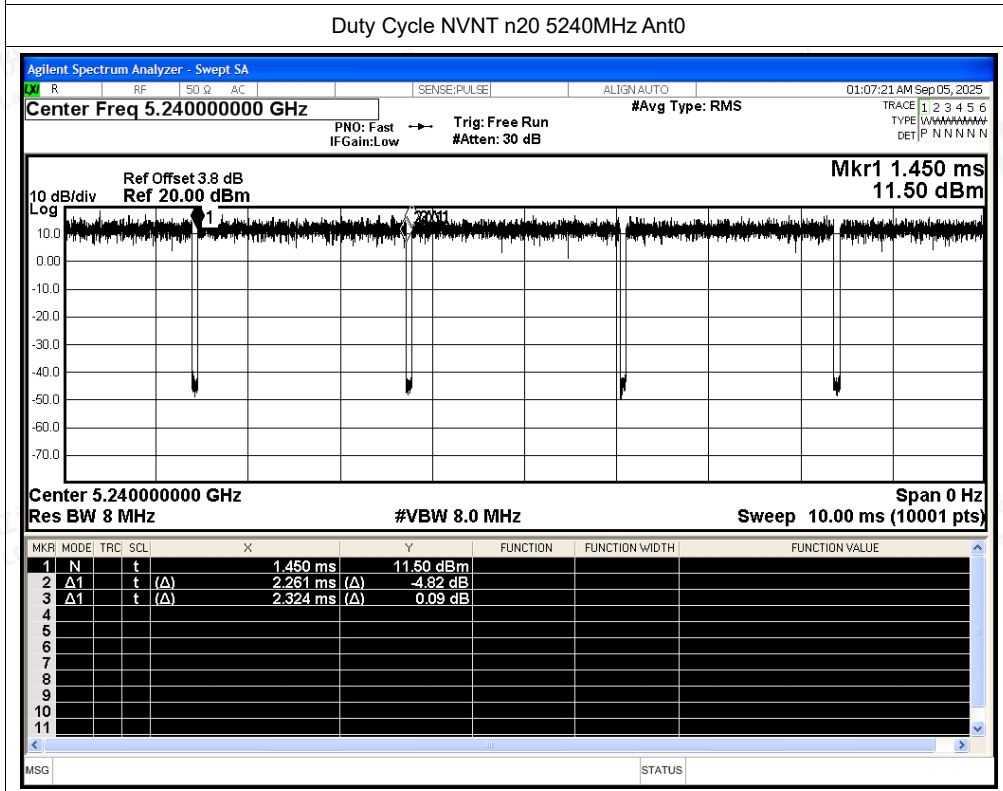
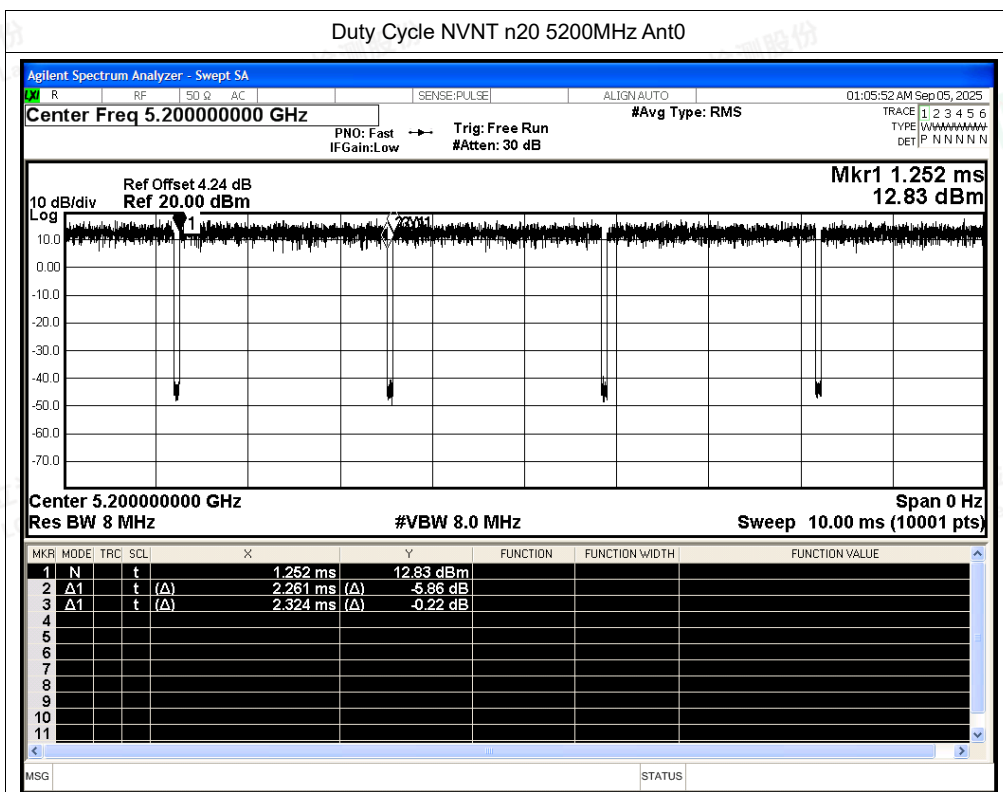


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

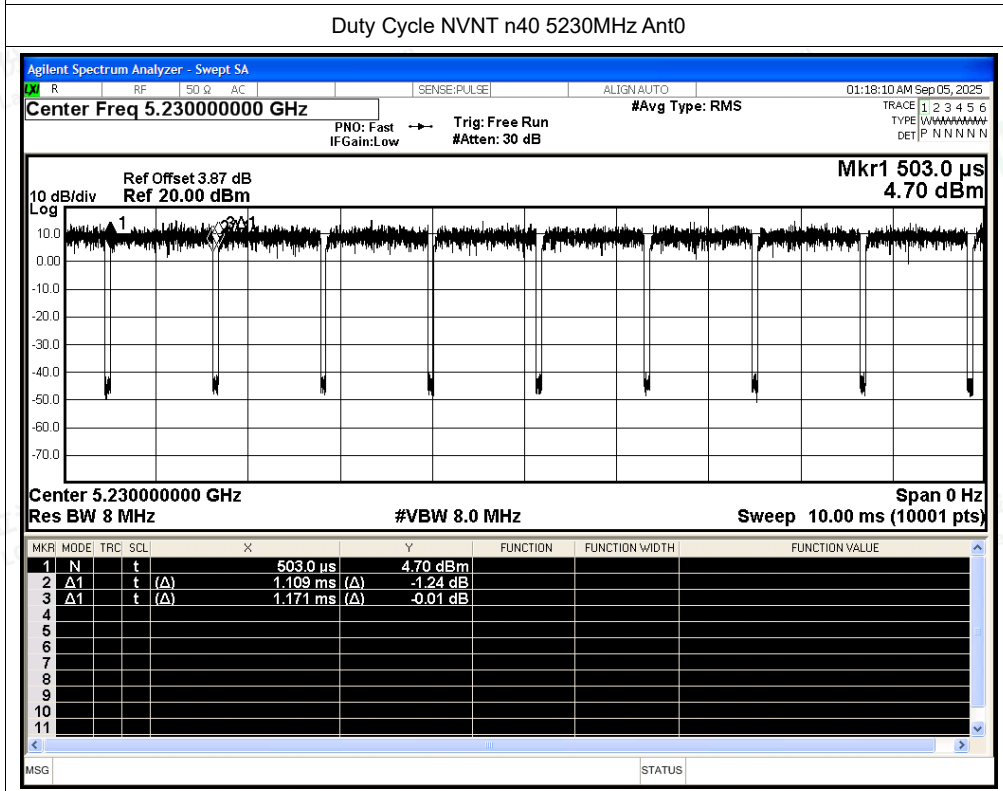
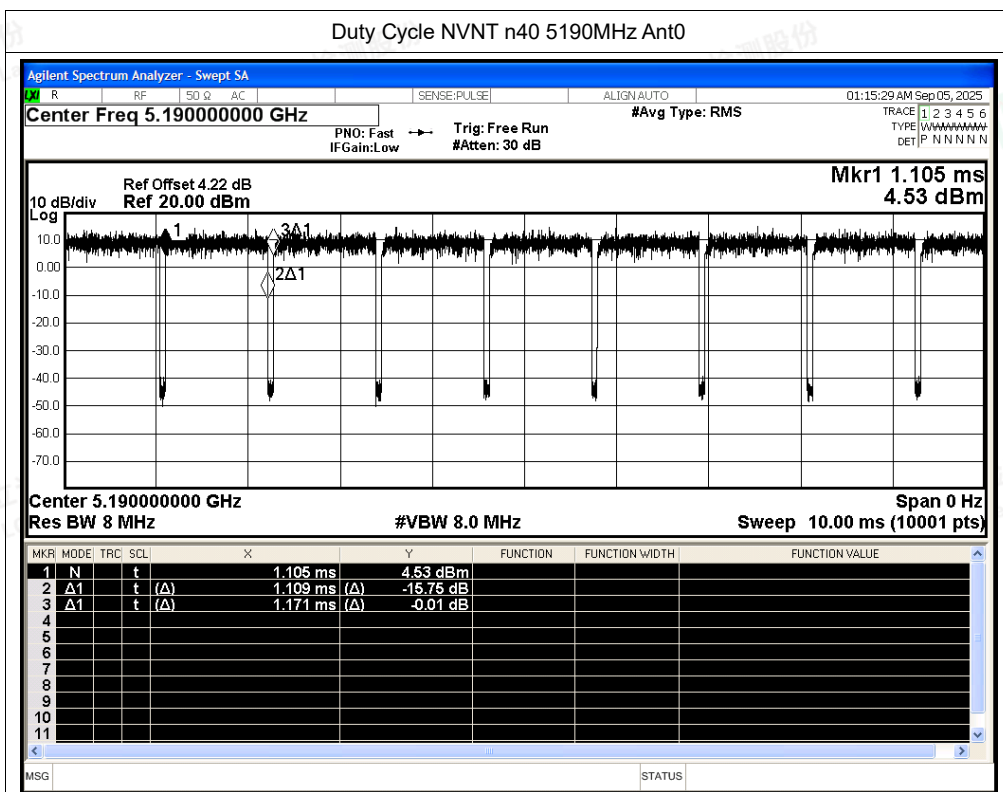


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

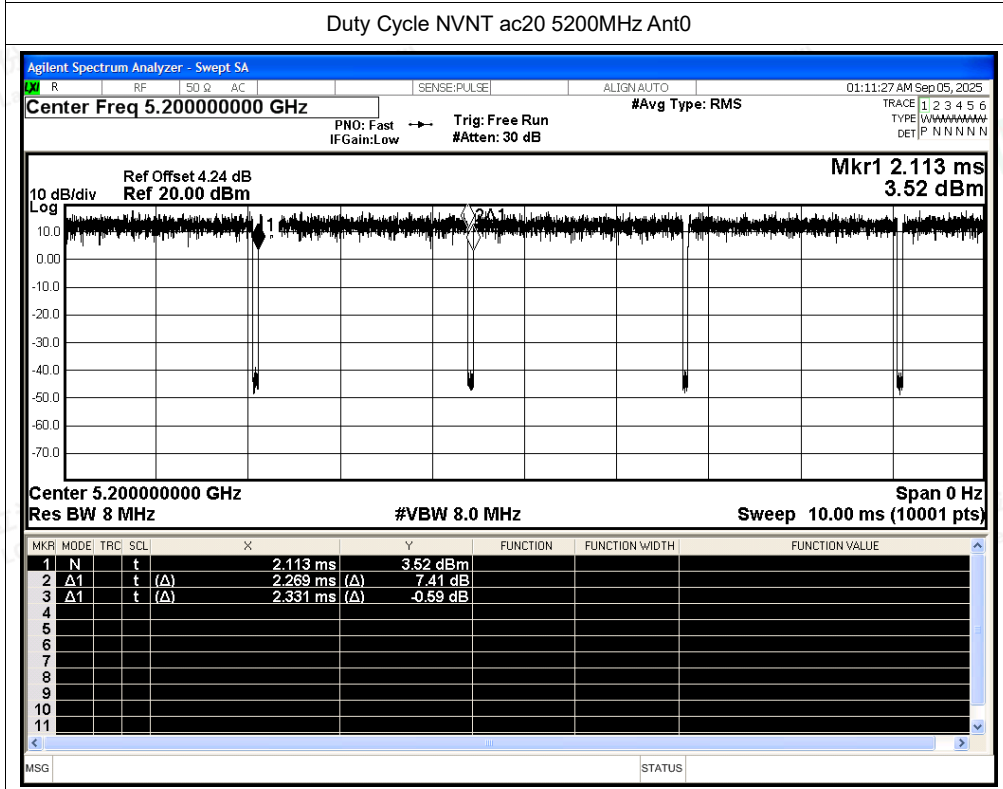
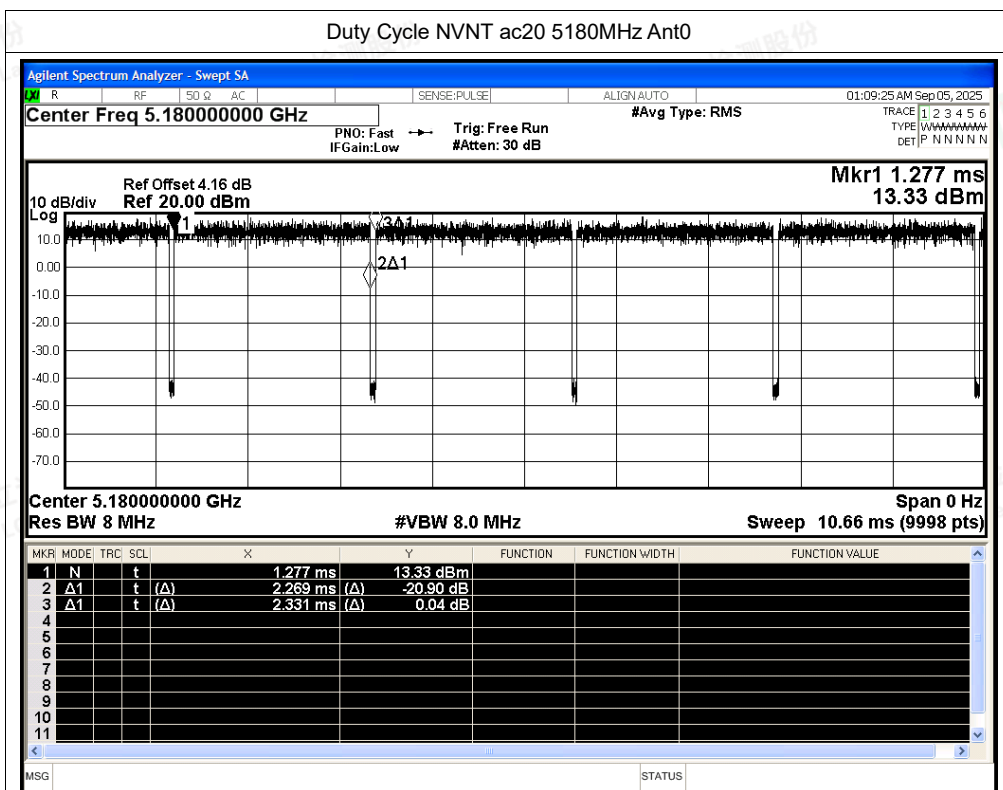


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

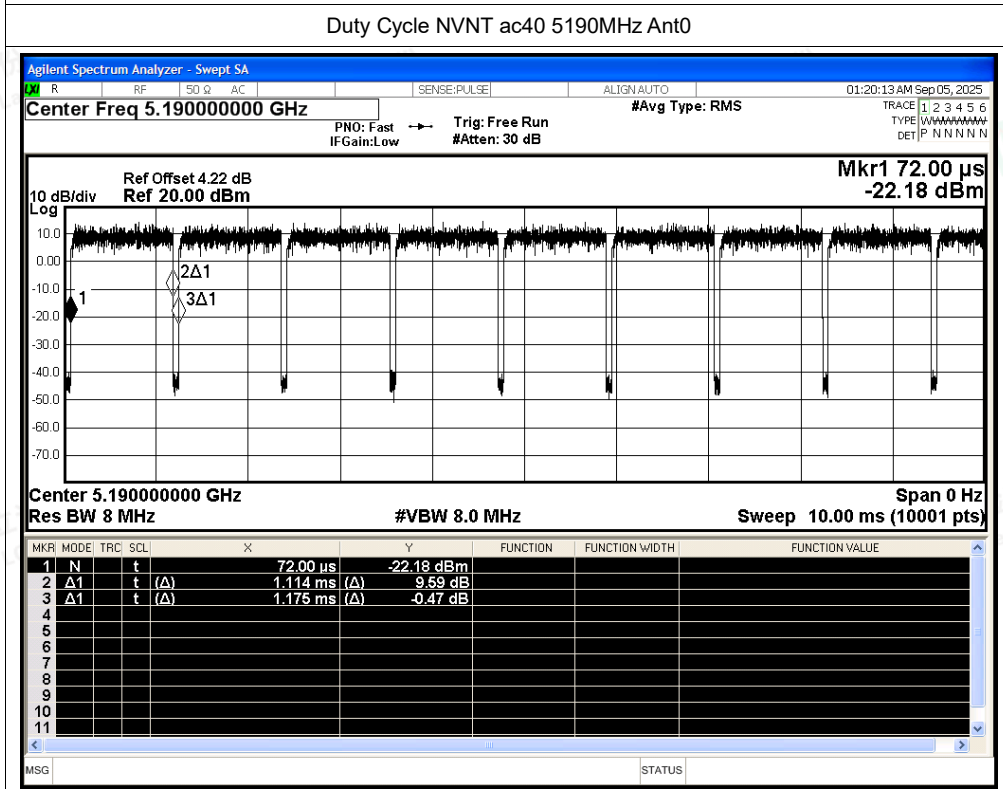
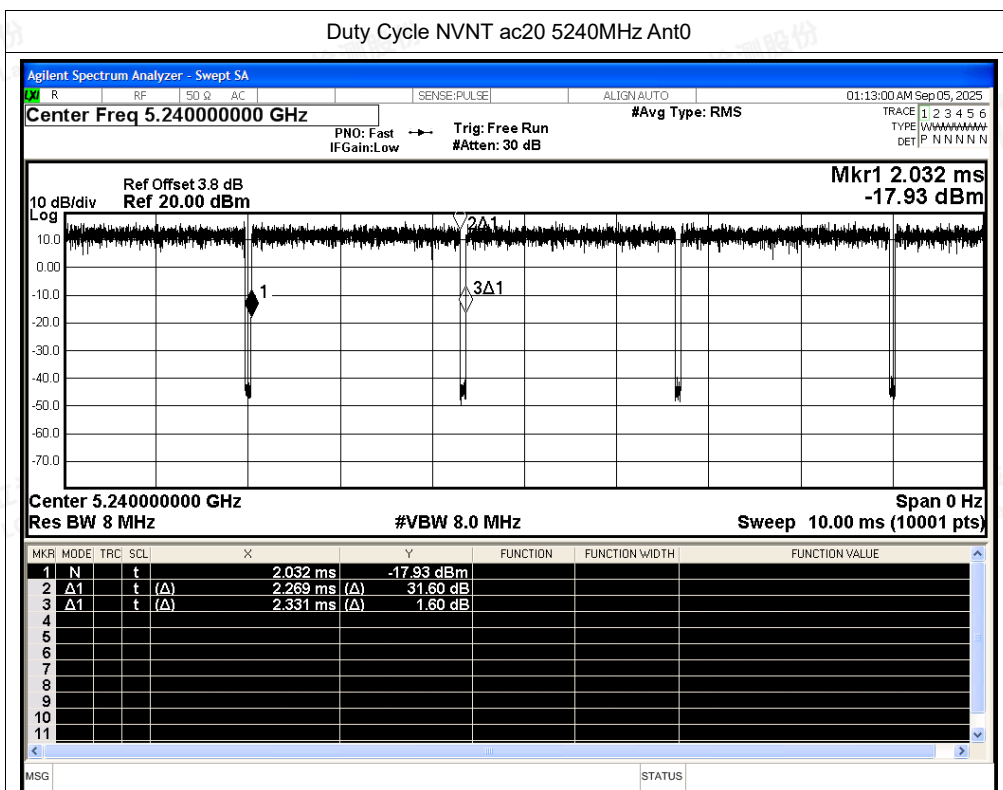


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

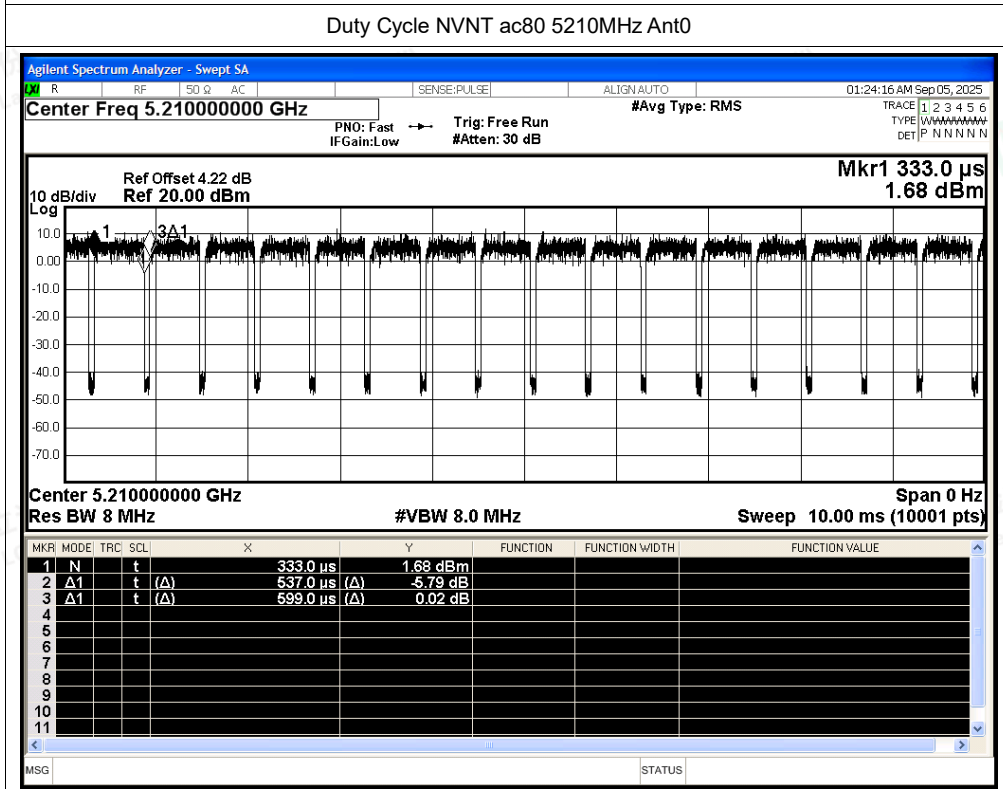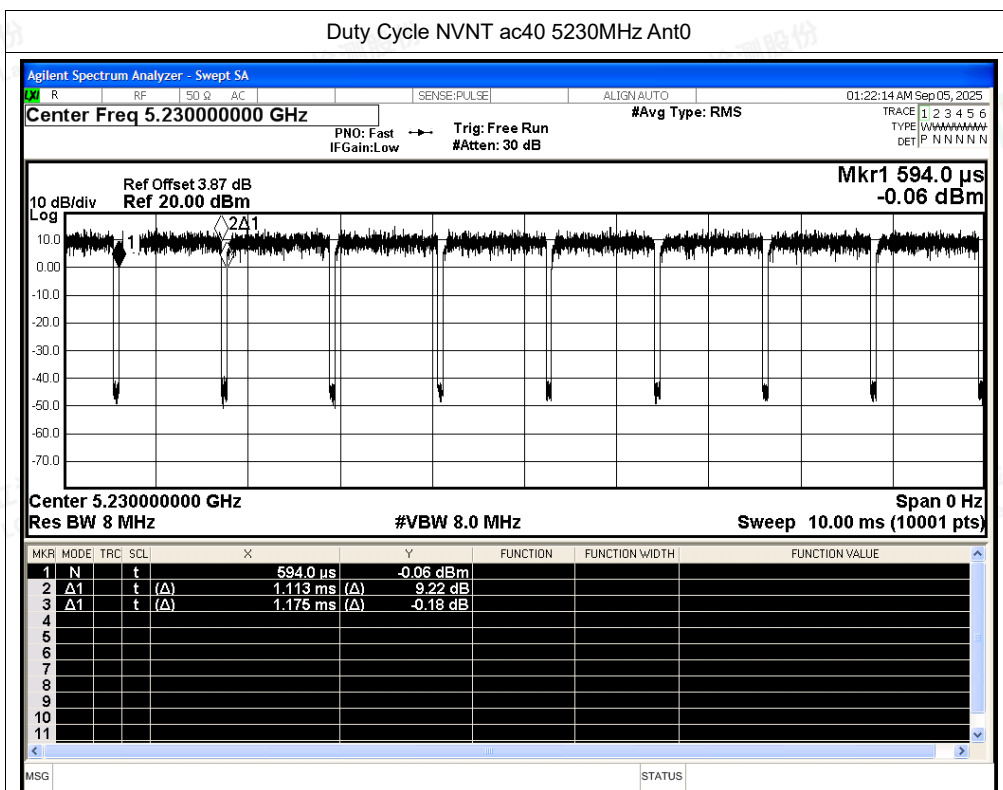

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.65	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	97.33	0.12	0.44
NVNT	n20	5200	Ant1	97.29	0.12	0.44
NVNT	n20	5240	Ant1	97.33	0.12	0.44
NVNT	n40	5190	Ant1	94.71	0.24	0.9
NVNT	n40	5230	Ant1	94.71	0.24	0.9
NVNT	ac20	5180	Ant1	97.34	0.12	0.44
NVNT	ac20	5200	Ant1	97.34	0.12	0.44
NVNT	ac20	5240	Ant1	97.34	0.12	0.44
NVNT	ac40	5190	Ant1	94.72	0.24	0.9
NVNT	ac40	5230	Ant1	94.72	0.24	0.9
NVNT	ac80	5210	Ant1	89.82	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

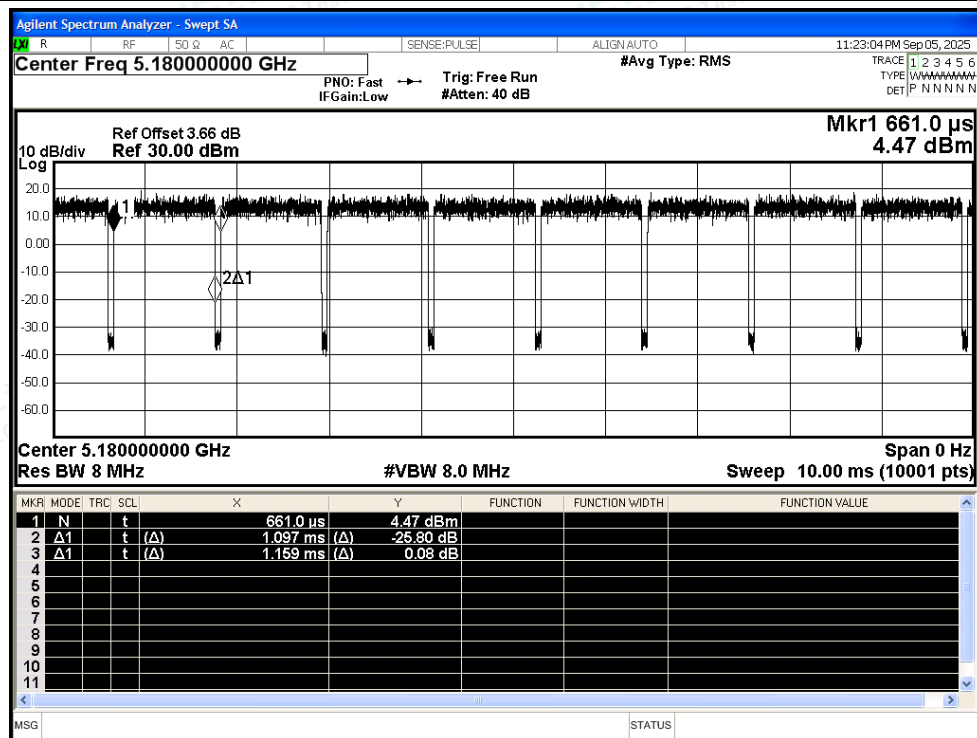

Duty Cycle NVNT a 5200MHz Ant1


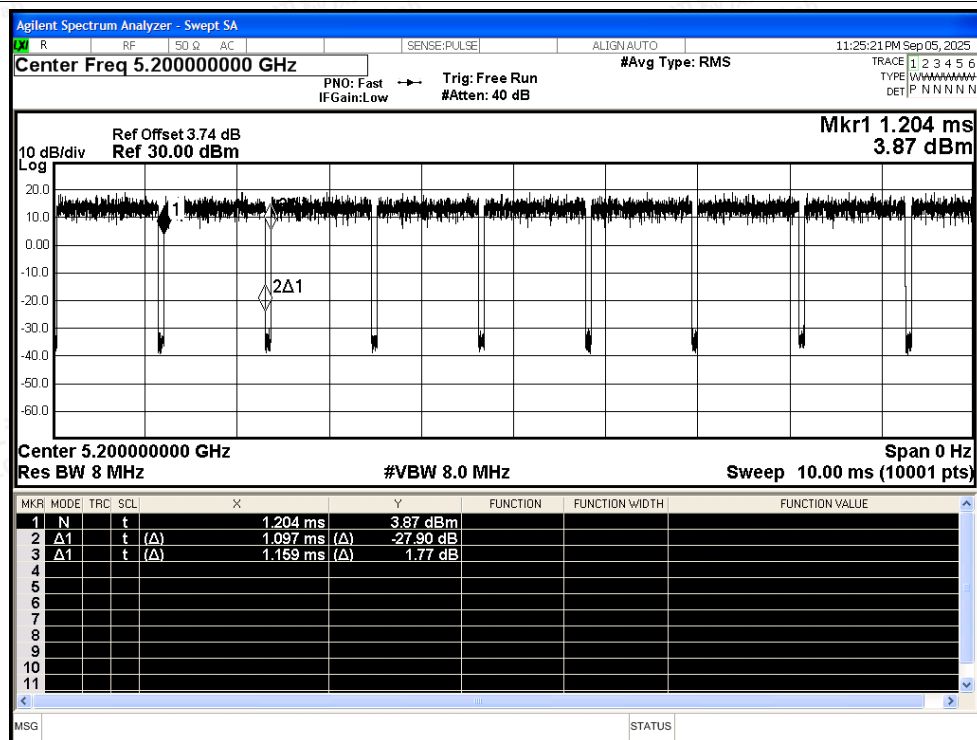


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

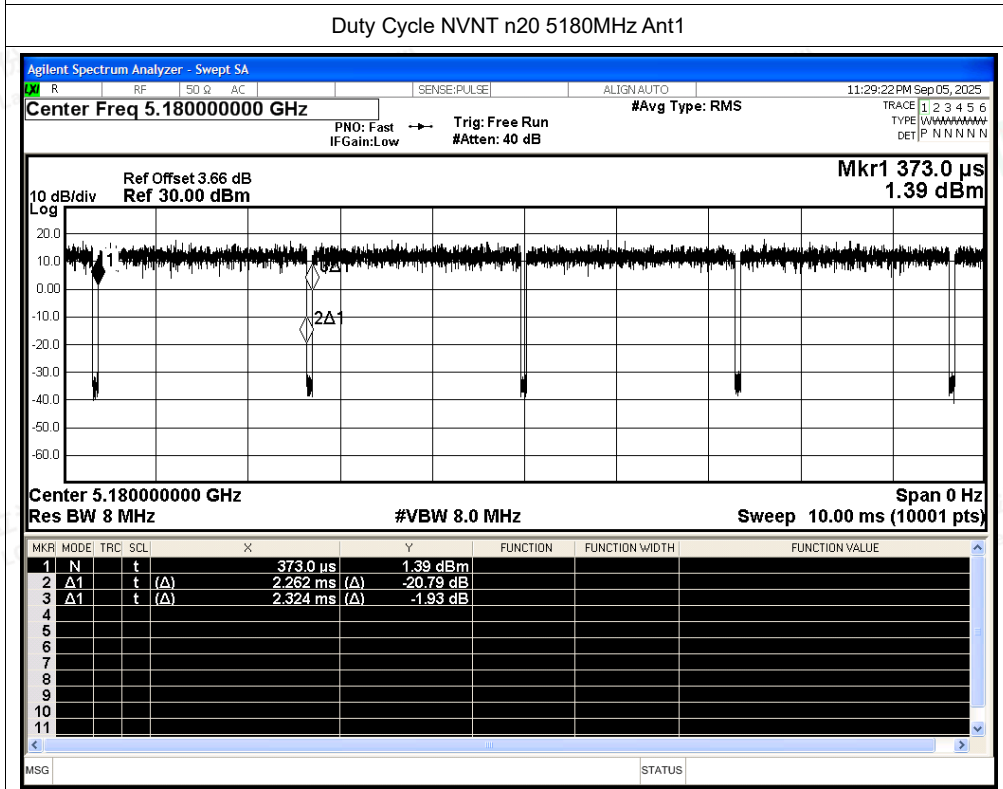
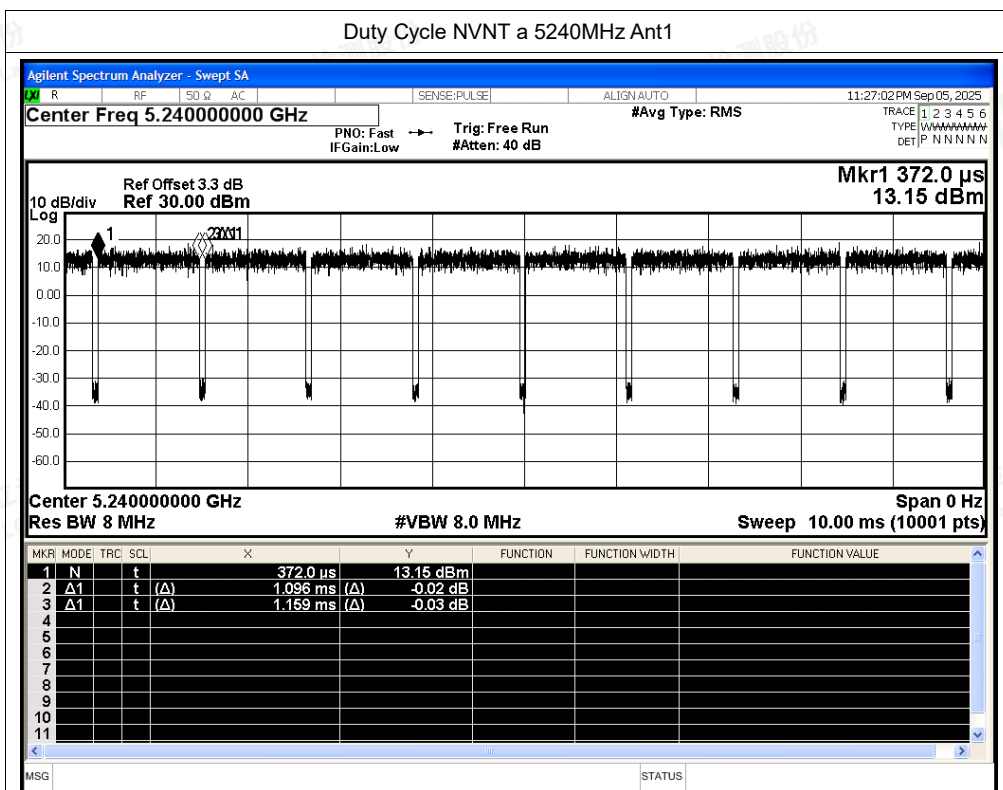


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

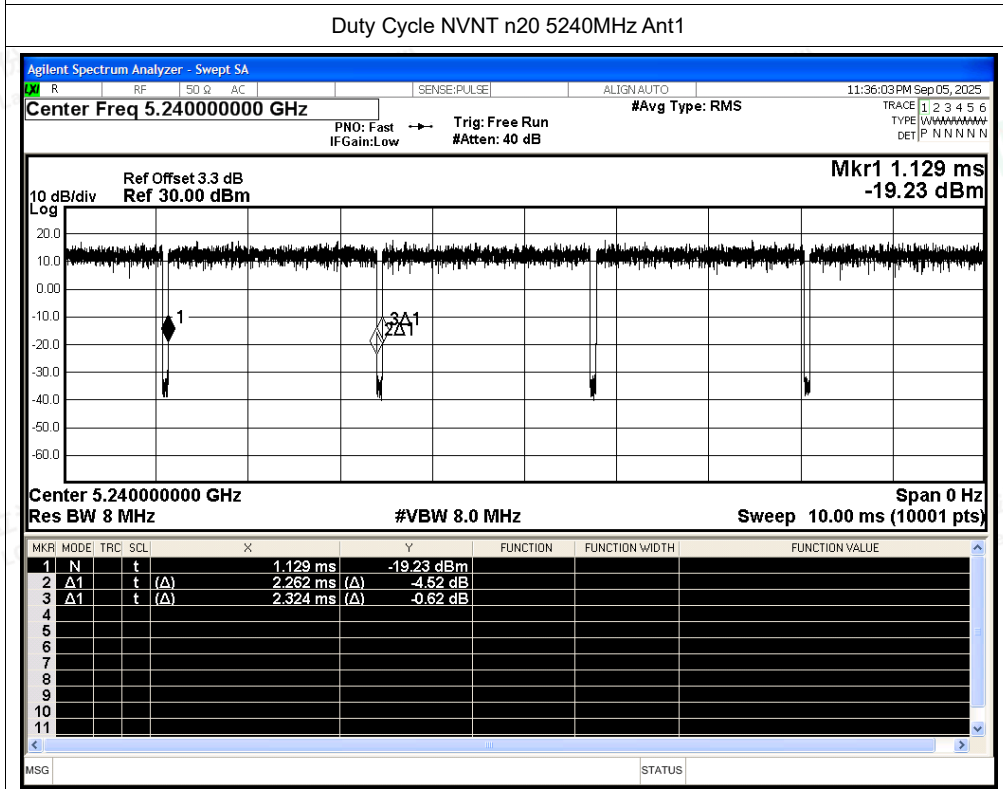
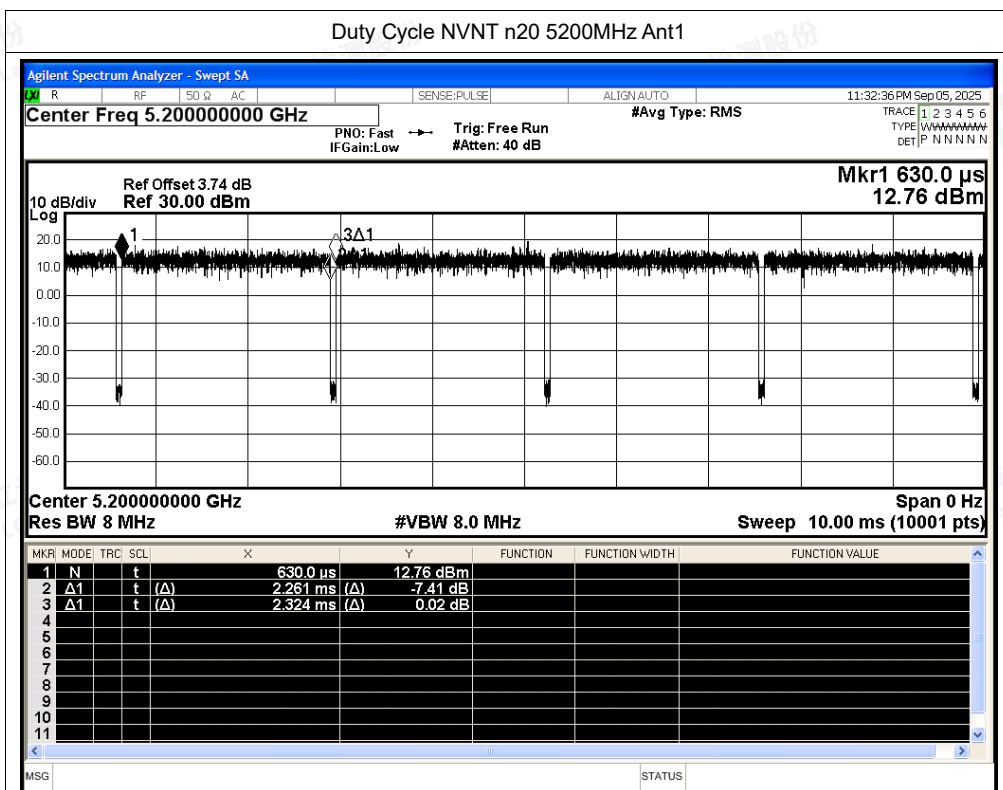


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

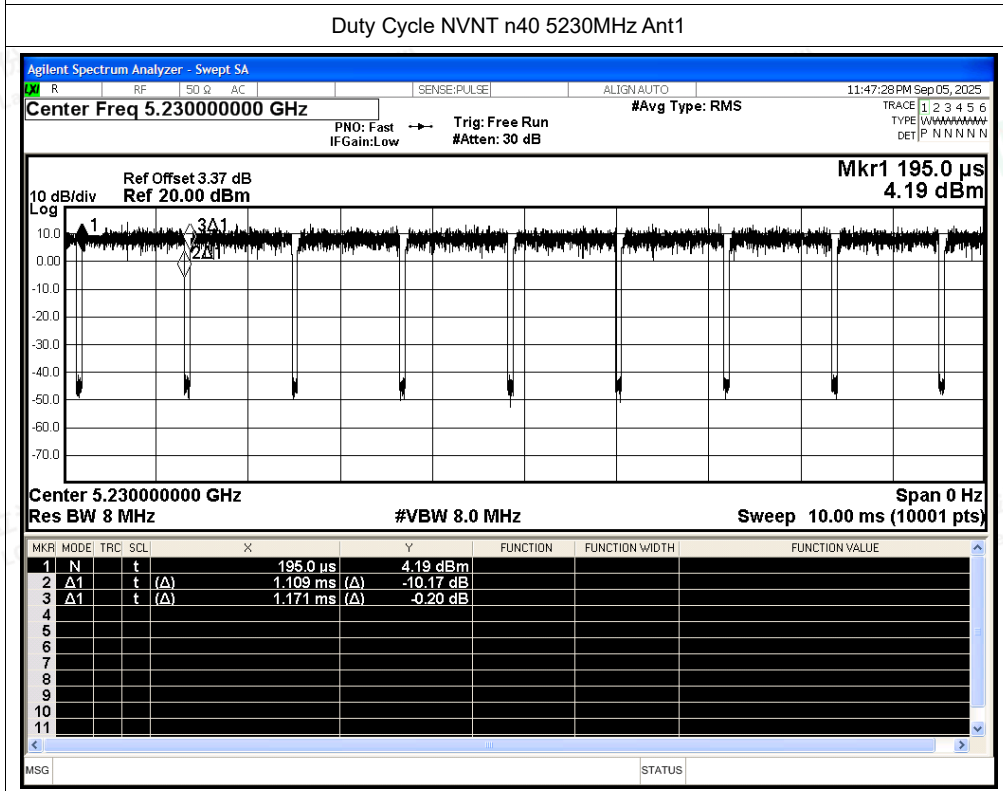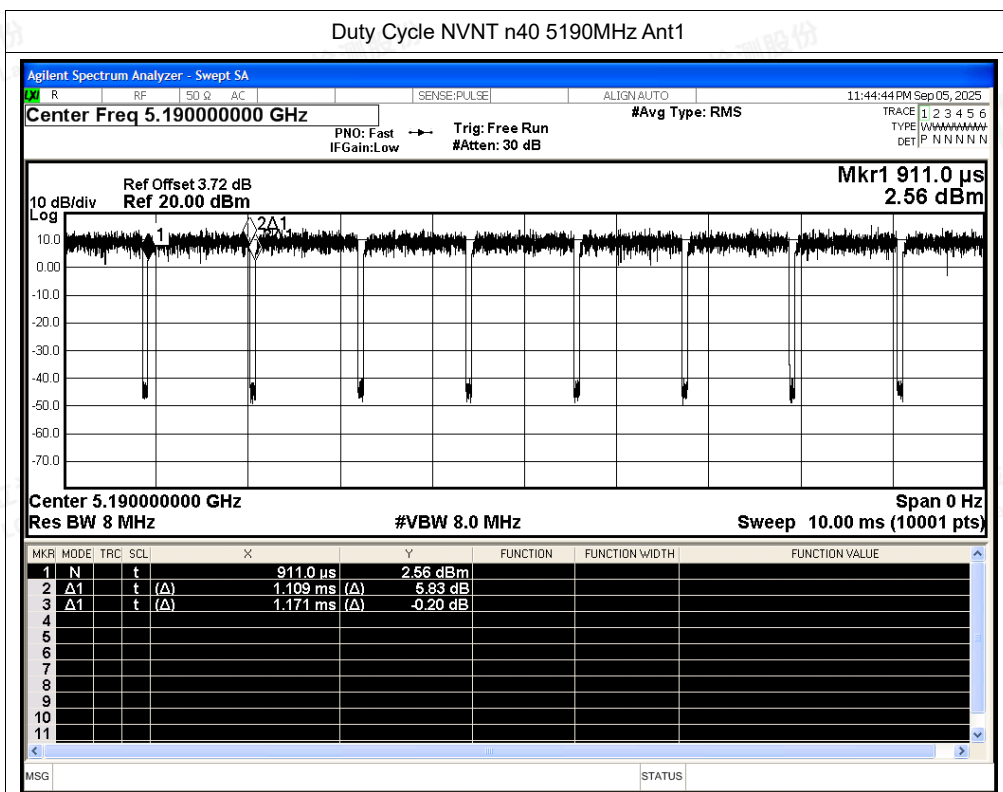

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant1

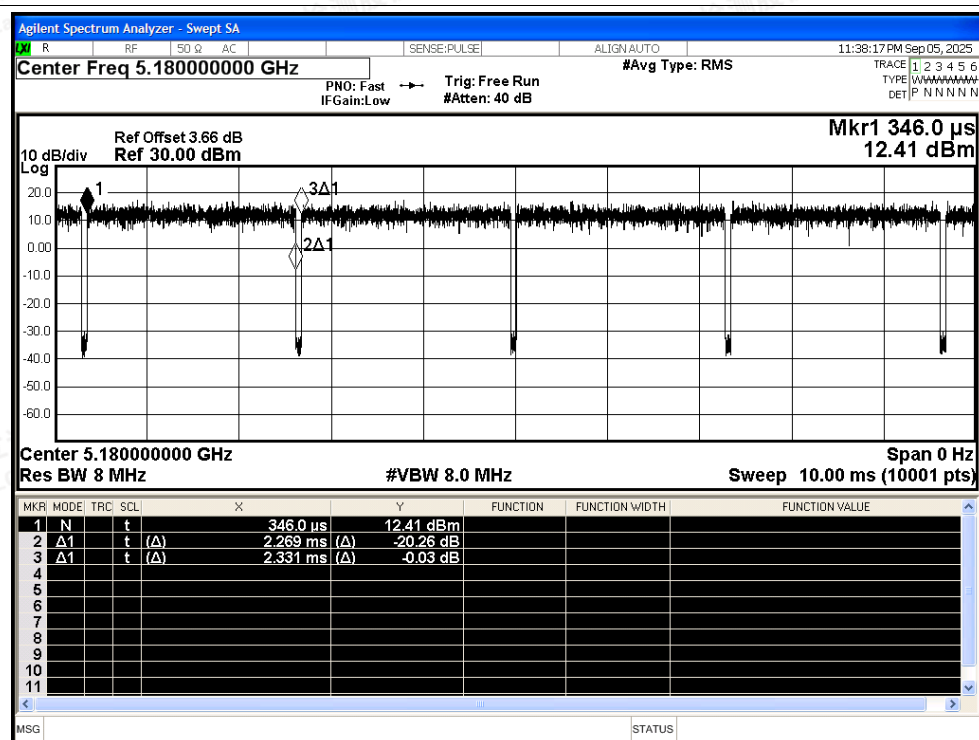

Duty Cycle NVNT ac20 5200MHz Ant1


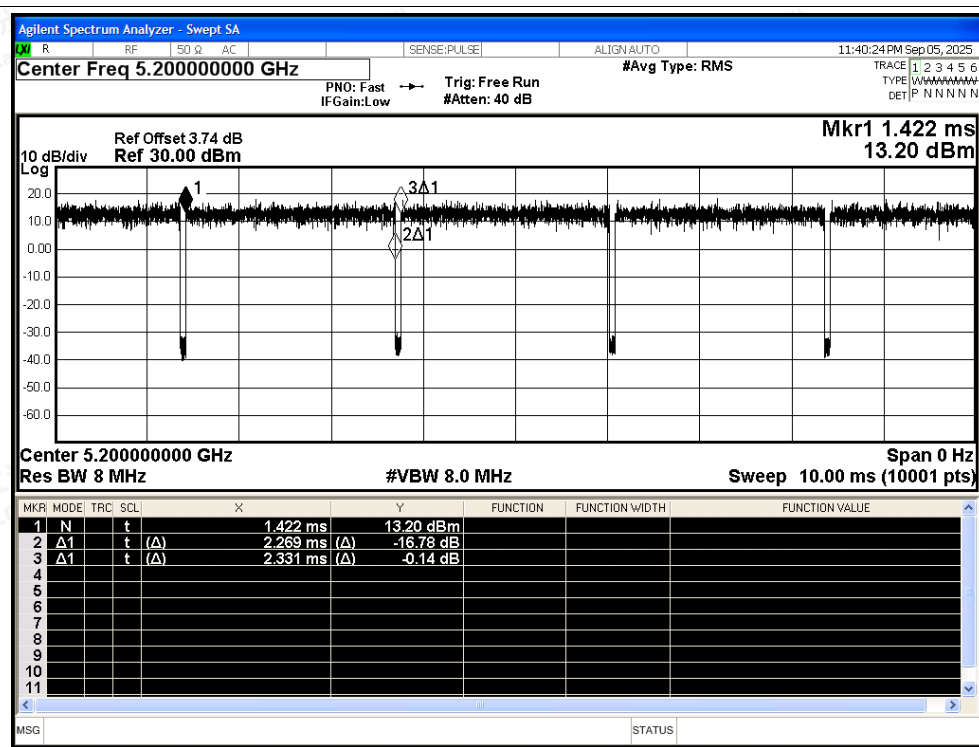


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

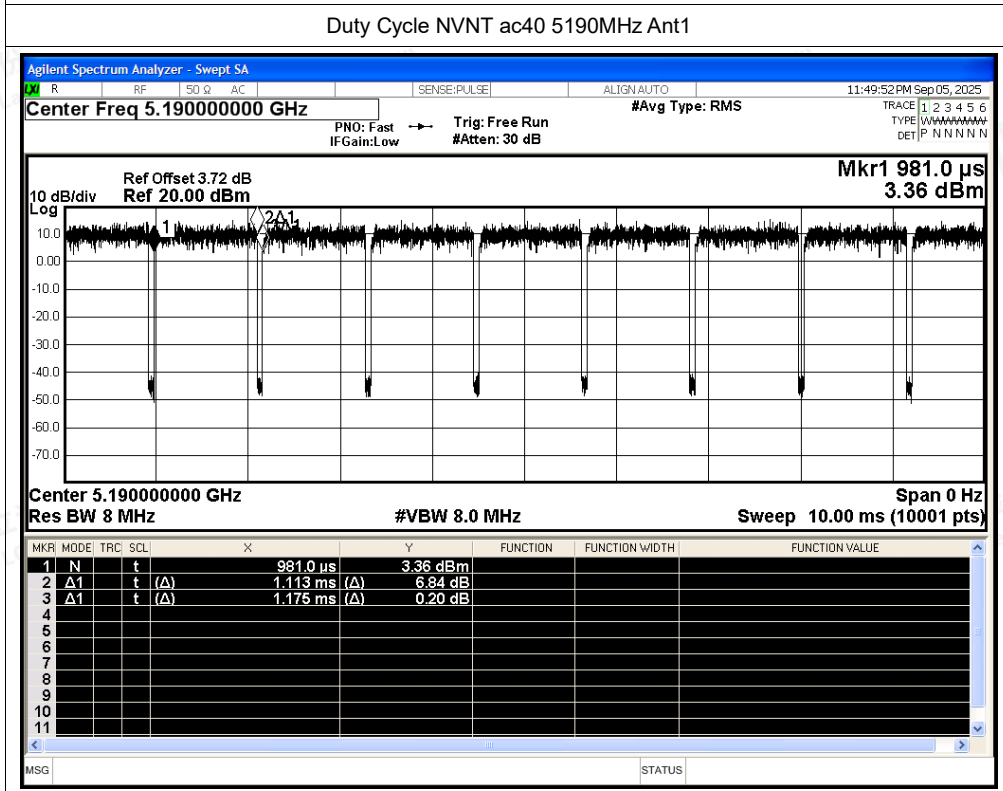
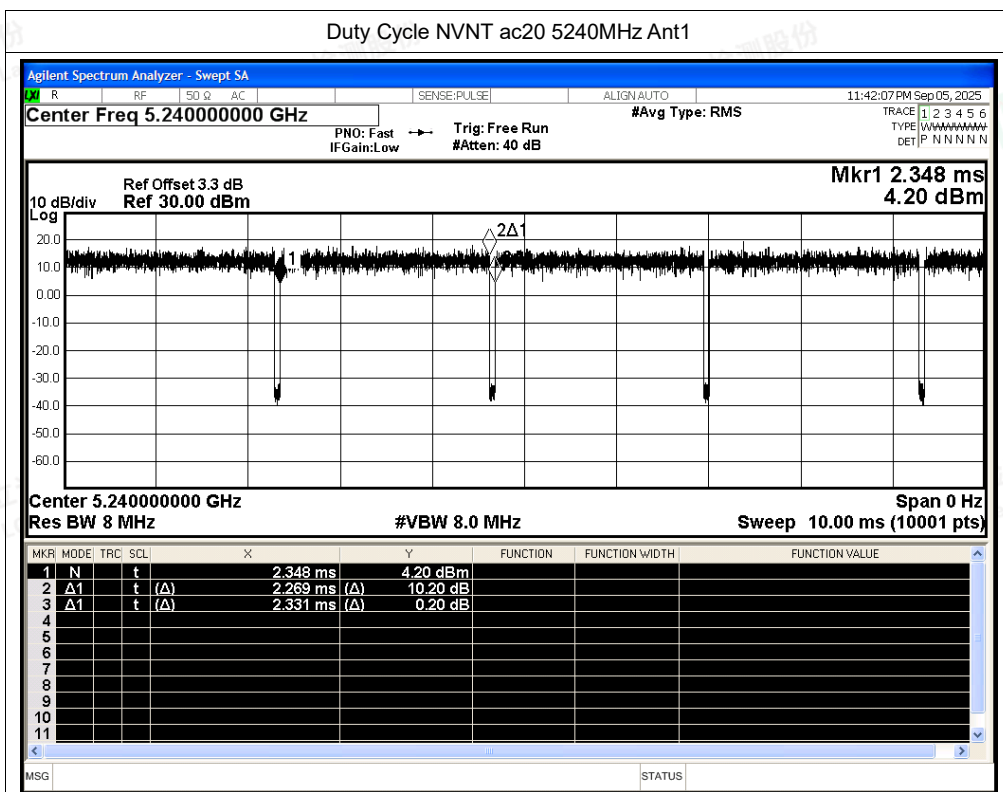


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

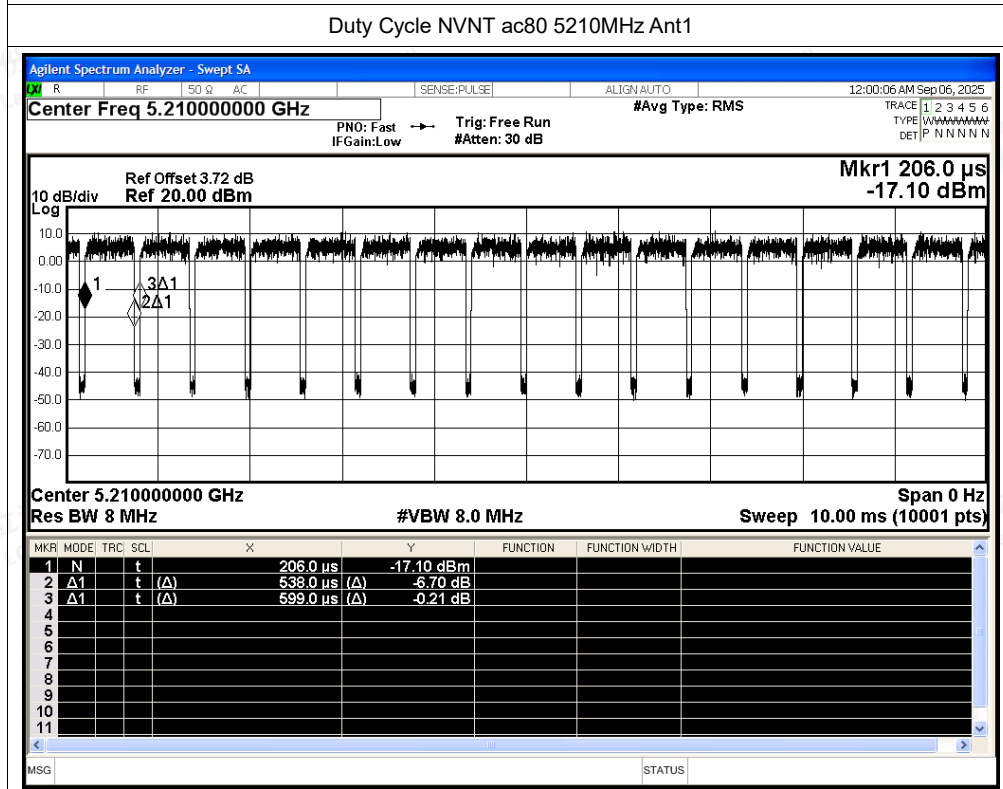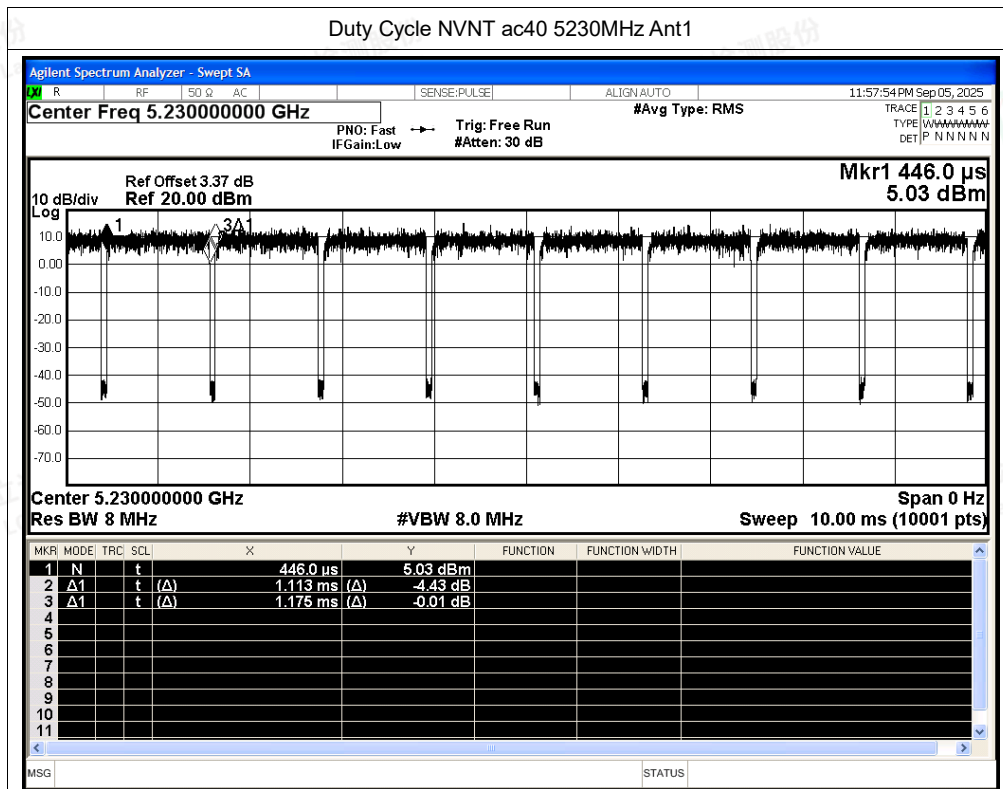

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity