



NVNT	ac20	5260	Ant1	4998.42	-46.14	2.08	-	51.17	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5036.64	-56.66	2.08	0.12	40.77	Average	54	Pass
NVNT	ac20	5260	Ant1	5150	-49.82	2.08	-	47.49	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5150	-56.68	2.08	0.12	40.75	Average	54	Pass
NVNT	ac20	5320	Ant1	5350	-46.06	2.08	-	51.25	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5350	-55.55	2.08	0.12	41.88	Average	54	Pass
NVNT	ac20	5320	Ant1	5351.4	-44.55	2.08	-	52.76	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5351.6	-55.48	2.08	0.12	41.95	Average	54	Pass
NVNT	ac20	5320	Ant1	5460	-50.03	2.08	-	47.28	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5460	-57.94	2.08	0.12	39.49	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-50.25	2.08	-	47.06	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4500	-58.47	2.08	0.24	39.08	Average	54	Pass
NVNT	ac40	5270	Ant1	5109.93	-45.73	2.08	-	51.58	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4806.99	-56.39	2.08	0.24	41.16	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-49.02	2.08	-	48.29	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5150	-57.34	2.08	0.24	40.21	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-46.44	2.08	-	50.87	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-55.41	2.08	0.24	42.14	Average	54	Pass
NVNT	ac40	5310	Ant1	5350.8	-42.79	2.08	-	54.52	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-55.41	2.08	0.24	42.14	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-48.99	2.08	-	48.32	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5460	-58.34	2.08	0.24	39.21	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-50.33	2.08	-	46.98	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4500	-58.43	2.08	0.47	39.35	Average	54	Pass
NVNT	ac80	5290	Ant1	4818.42	-44.17	2.08	-	53.14	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5144.67	-55.23	2.08	0.47	42.55	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-47.31	2.08	-	50.00	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5150	-55.69	2.08	0.47	42.09	Average	54	Pass
NVNT	ac80	5290	Ant1	5350	-43.39	2.08	-	53.92	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5350	-55.63	2.08	0.47	42.15	Average	54	Pass
NVNT	ac80	5290	Ant1	5350	-43.39	2.08	-	53.92	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5352.25	-55.58	2.08	0.47	42.20	Average	54	Pass
NVNT	ac80	5290	Ant1	5460	-49.97	2.08	-	47.34	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5460	-57.94	2.08	0.47	39.84	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant1 Peak

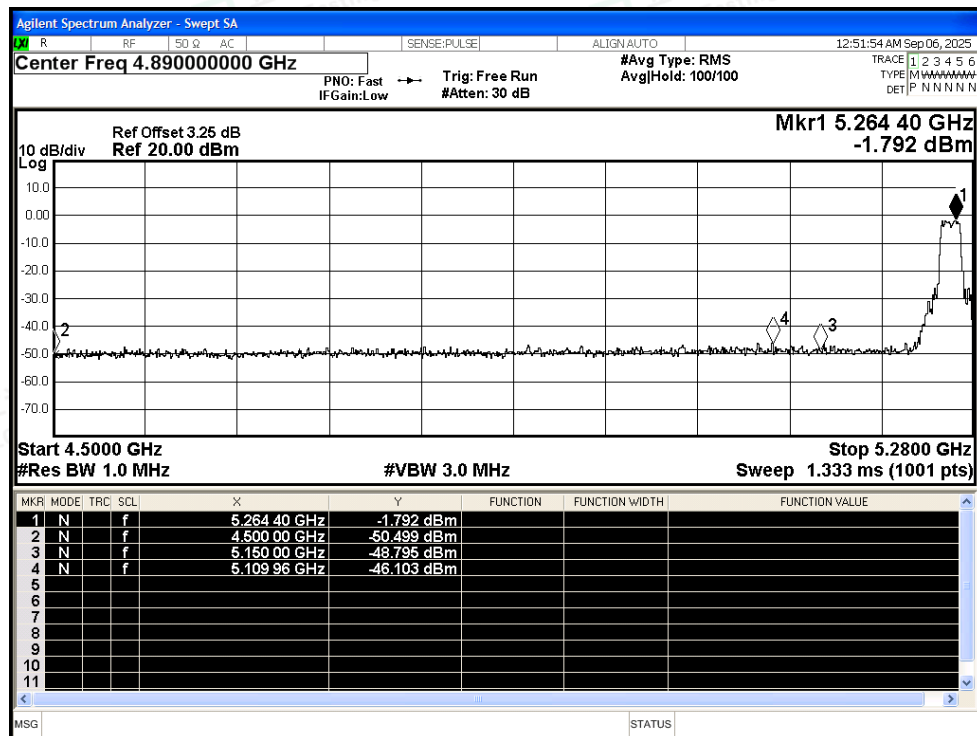

Restrict Band NVNT a 5260MHz Ant1 Average

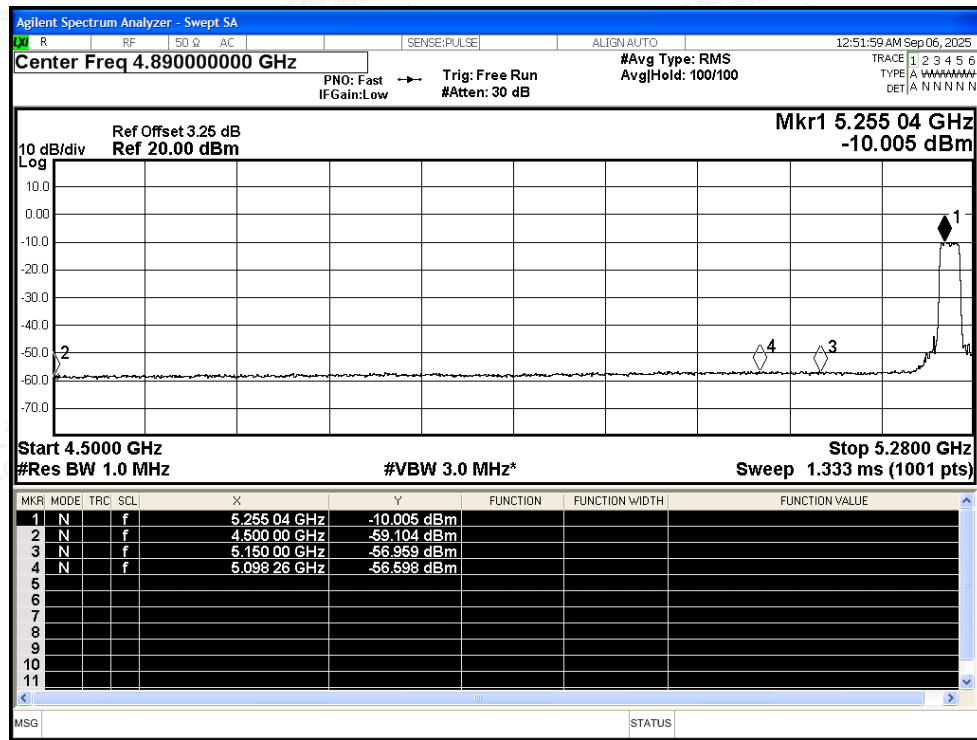

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant1 Peak

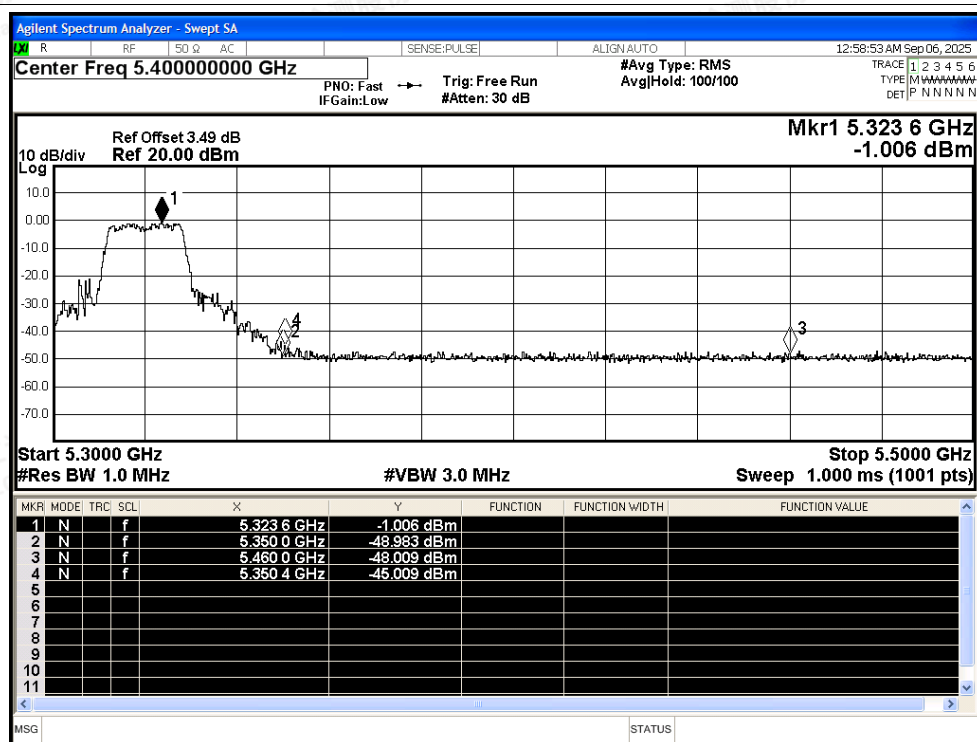

Restrict Band NVNT a 5320MHz Ant1 Average

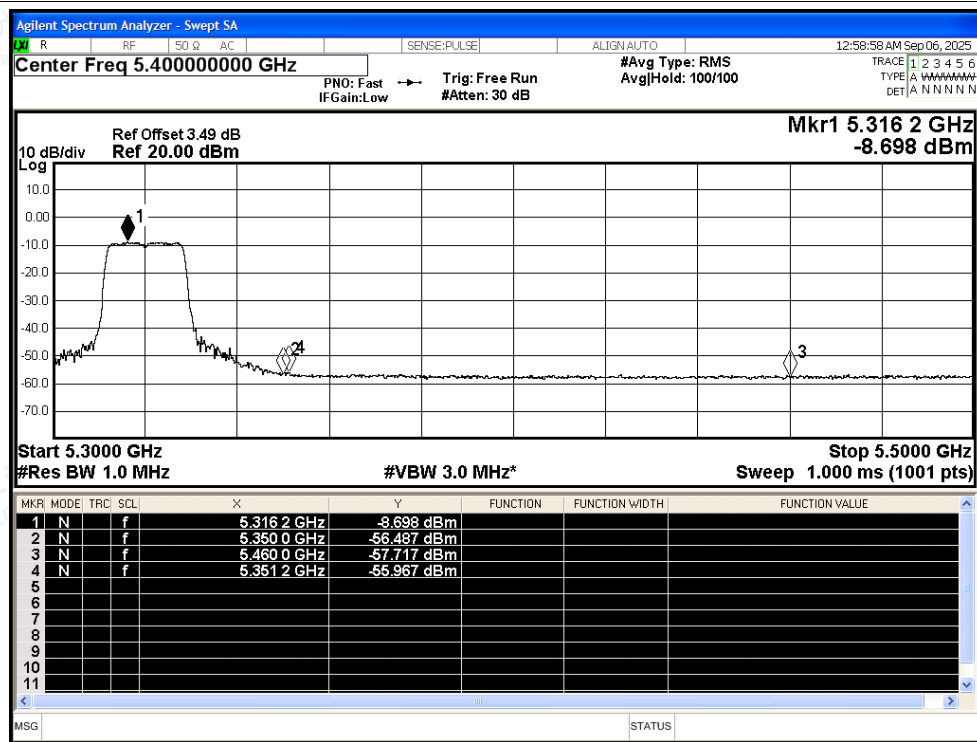

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant1 Peak

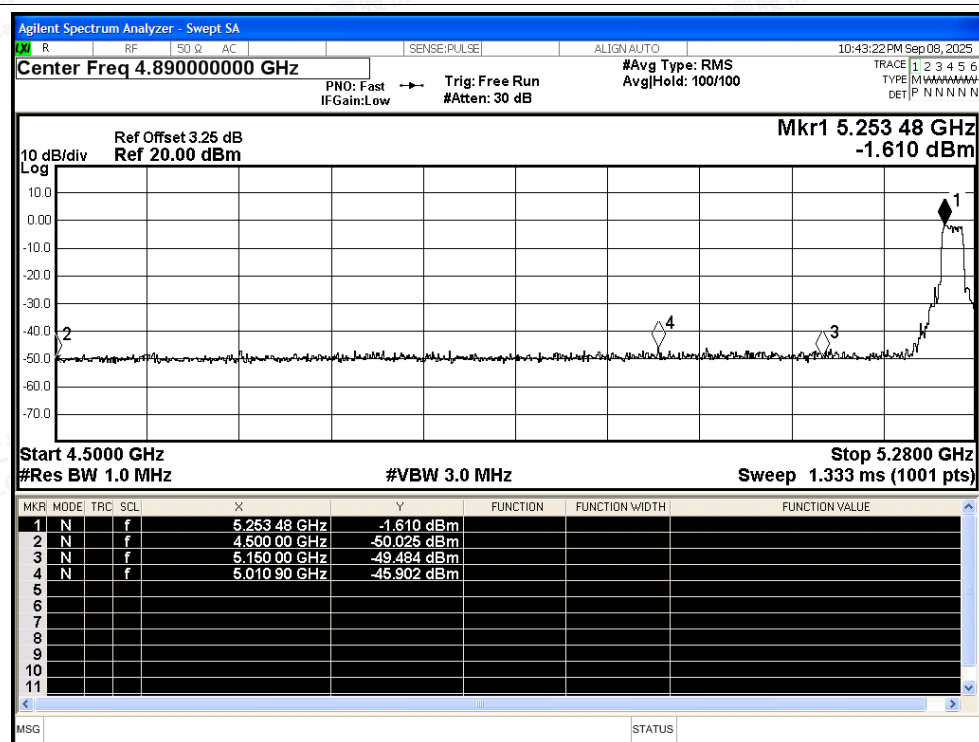

Restrict Band NVNT n20 5260MHz Ant1 Average

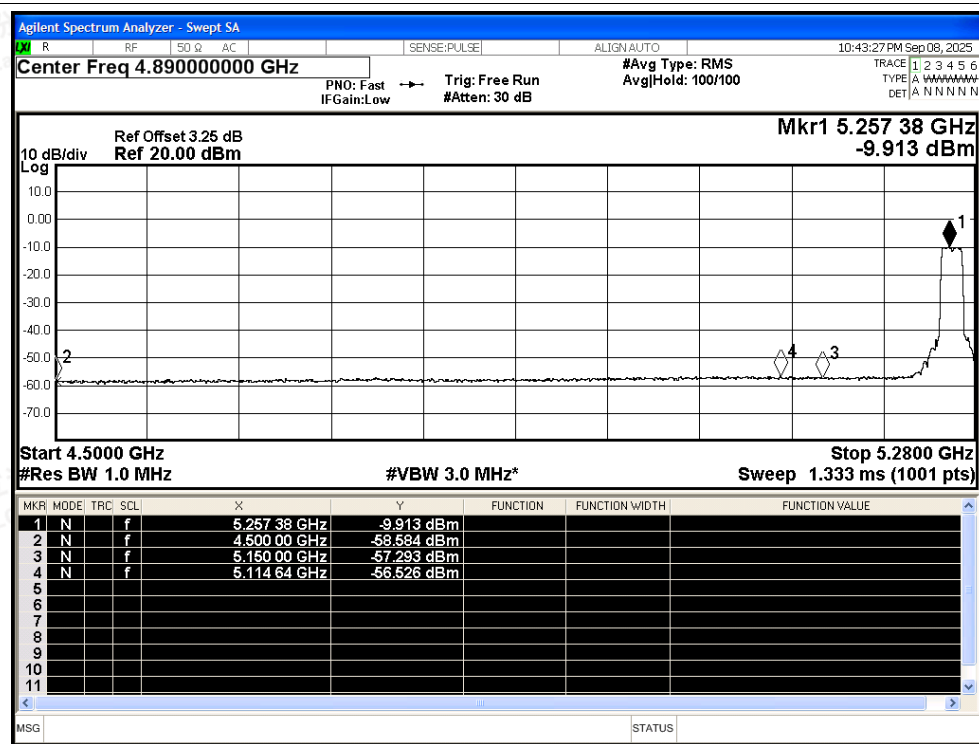

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant1 Peak

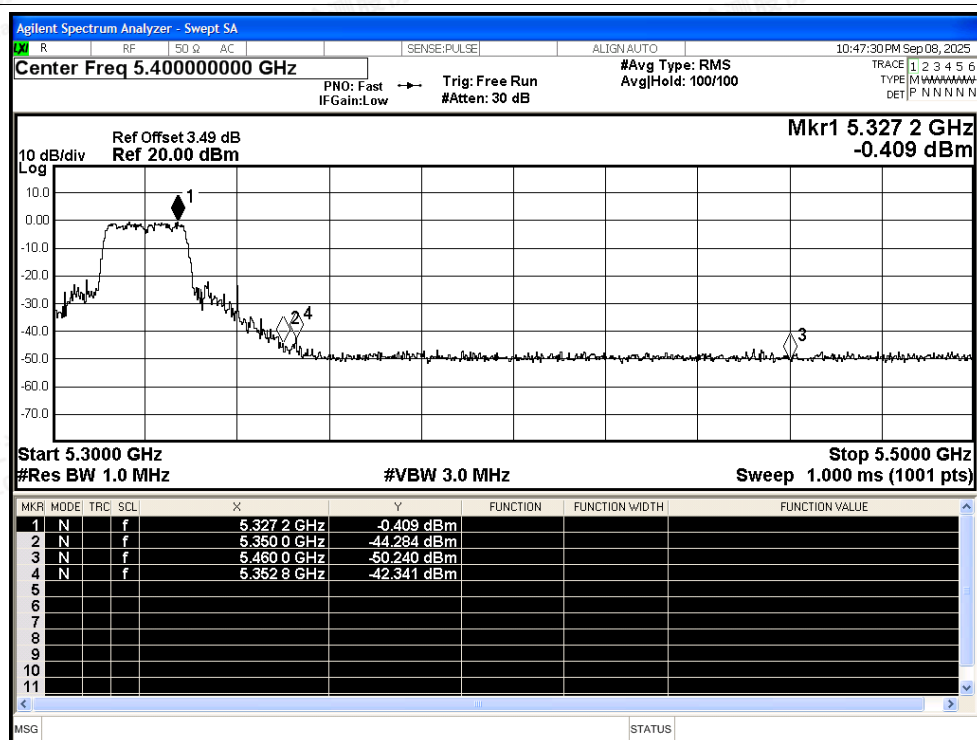

Restrict Band NVNT n20 5320MHz Ant1 Average

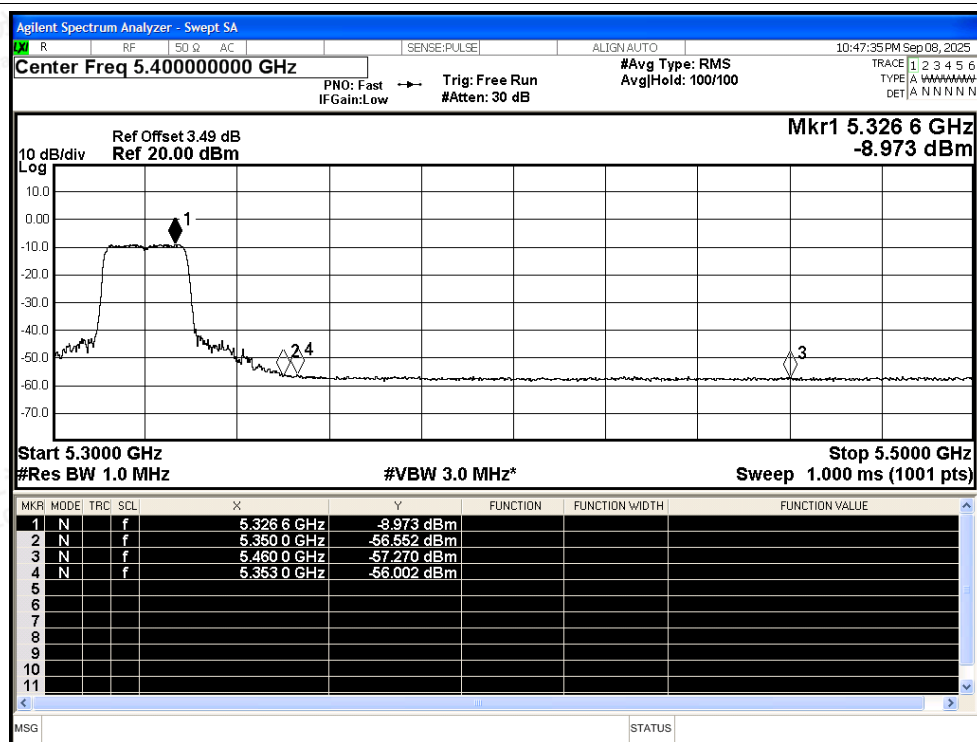

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant1 Peak

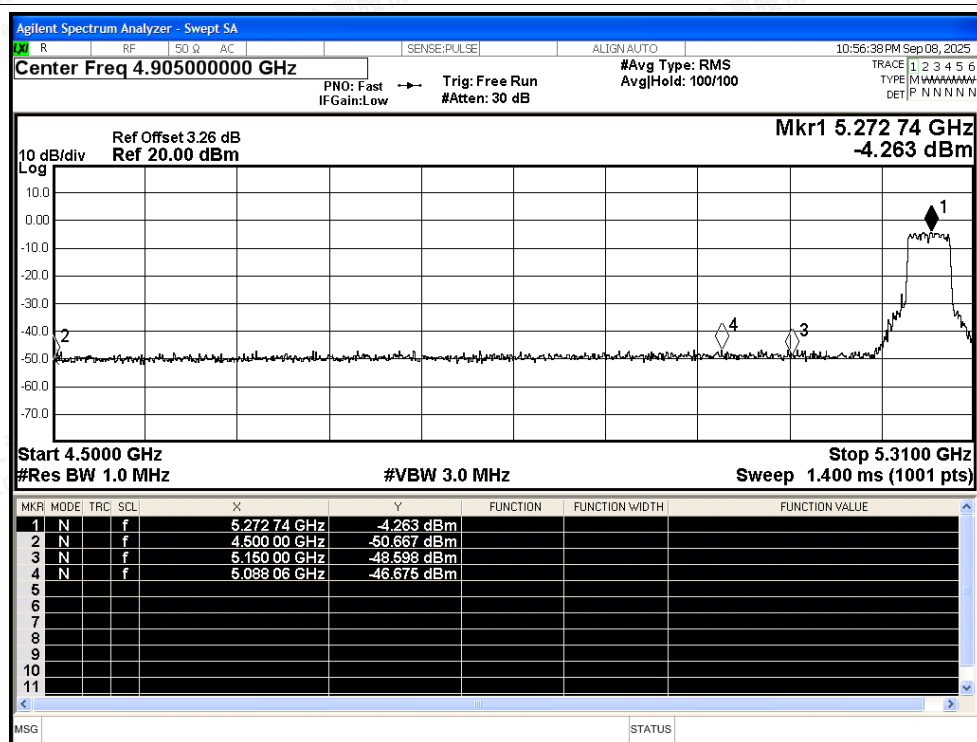

Restrict Band NVNT n40 5270MHz Ant1 Average

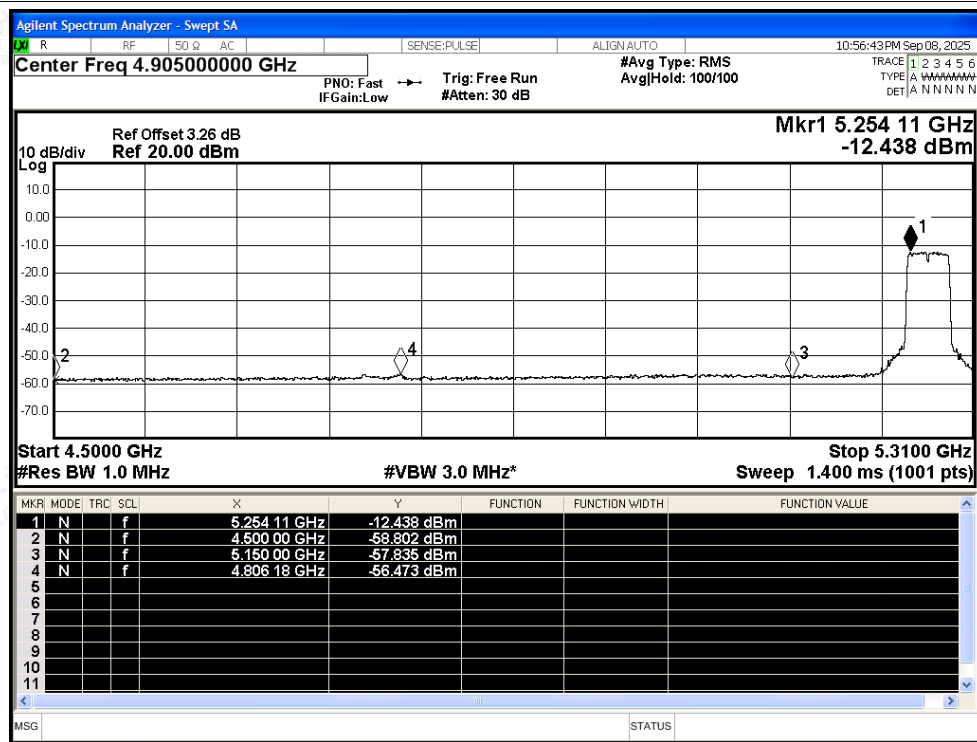

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant1 Peak

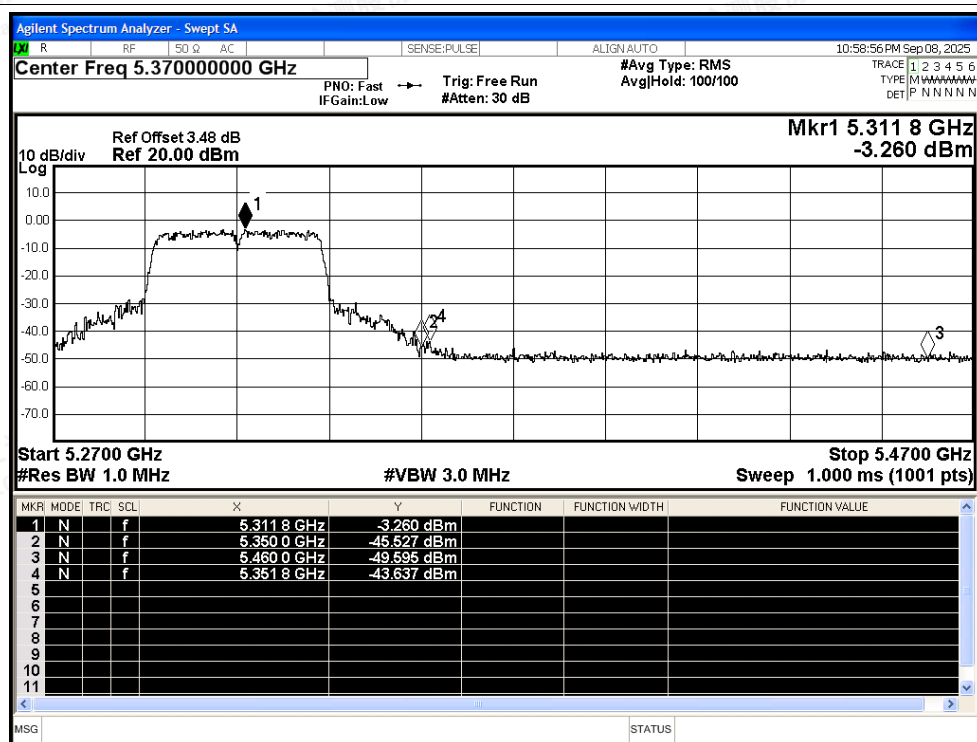

Restrict Band NVNT n40 5310MHz Ant1 Average

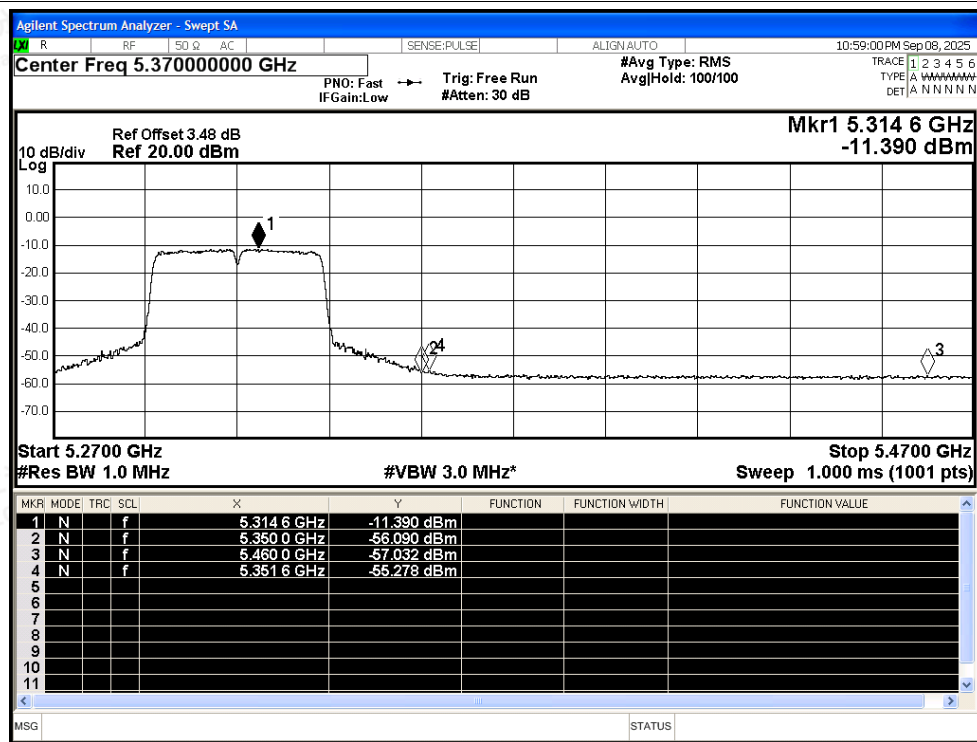

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant1 Peak

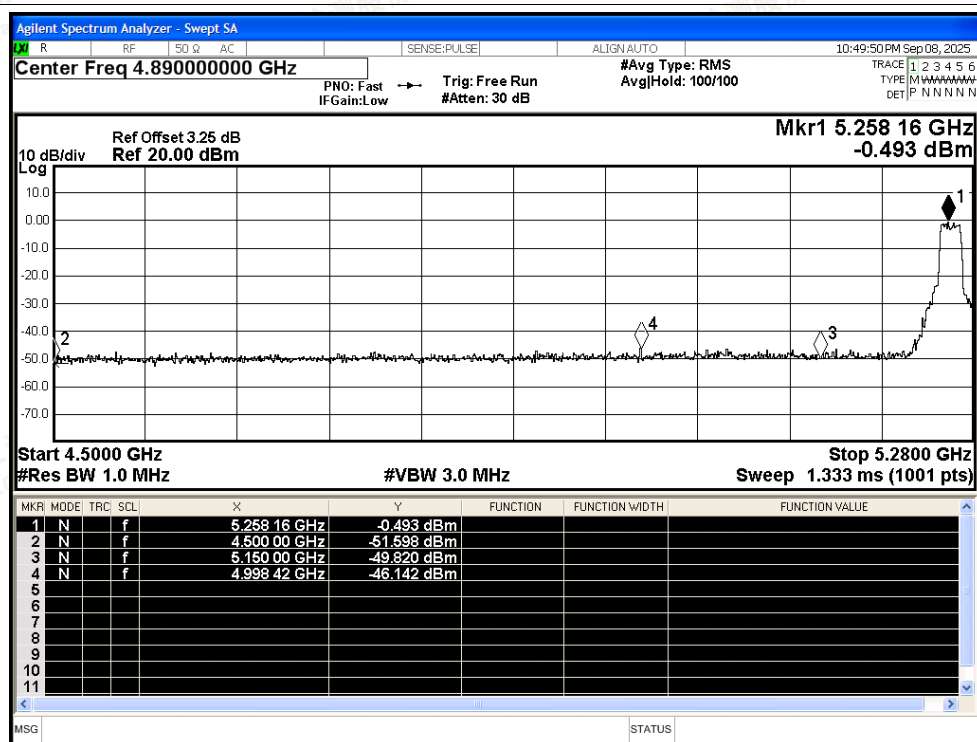

Restrict Band NVNT ac20 5260MHz Ant1 Average

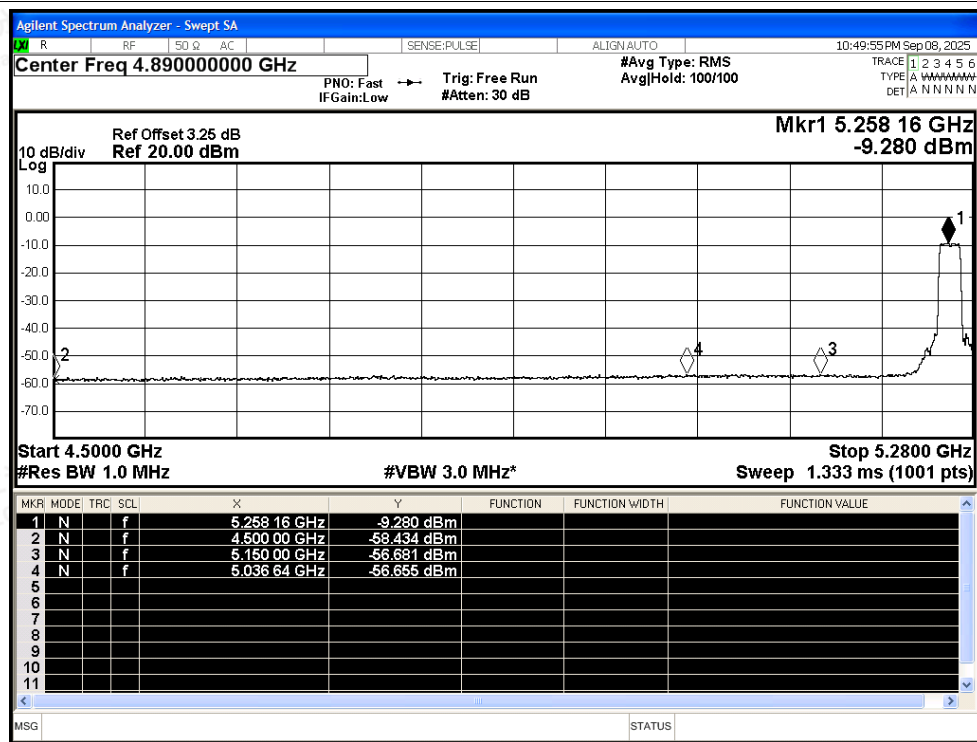

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant1 Peak

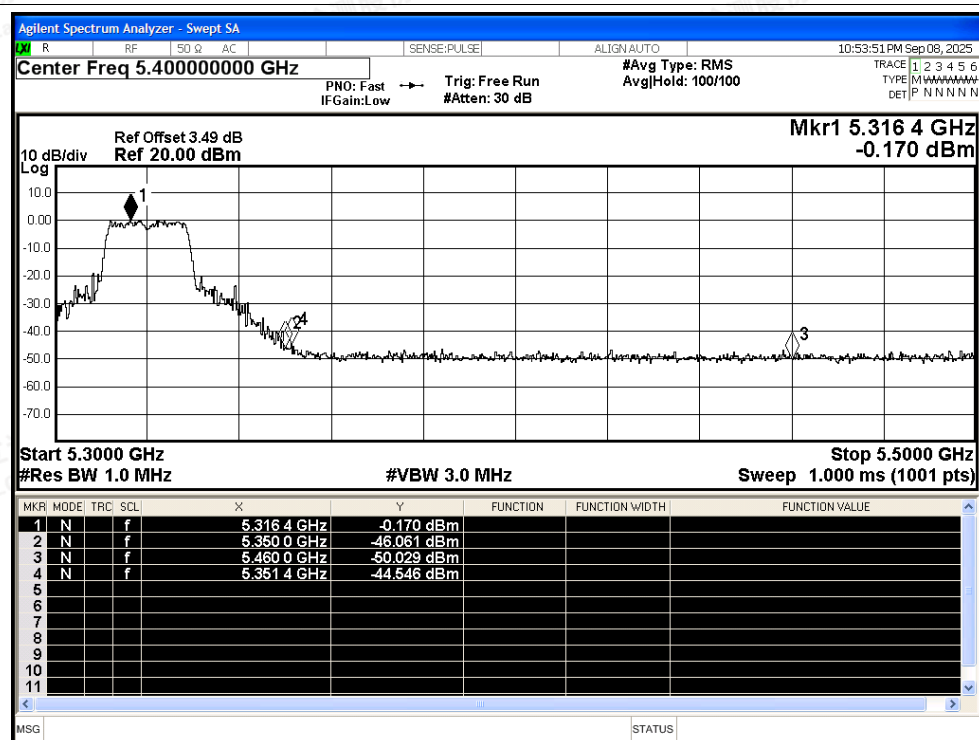

Restrict Band NVNT ac20 5320MHz Ant1 Average

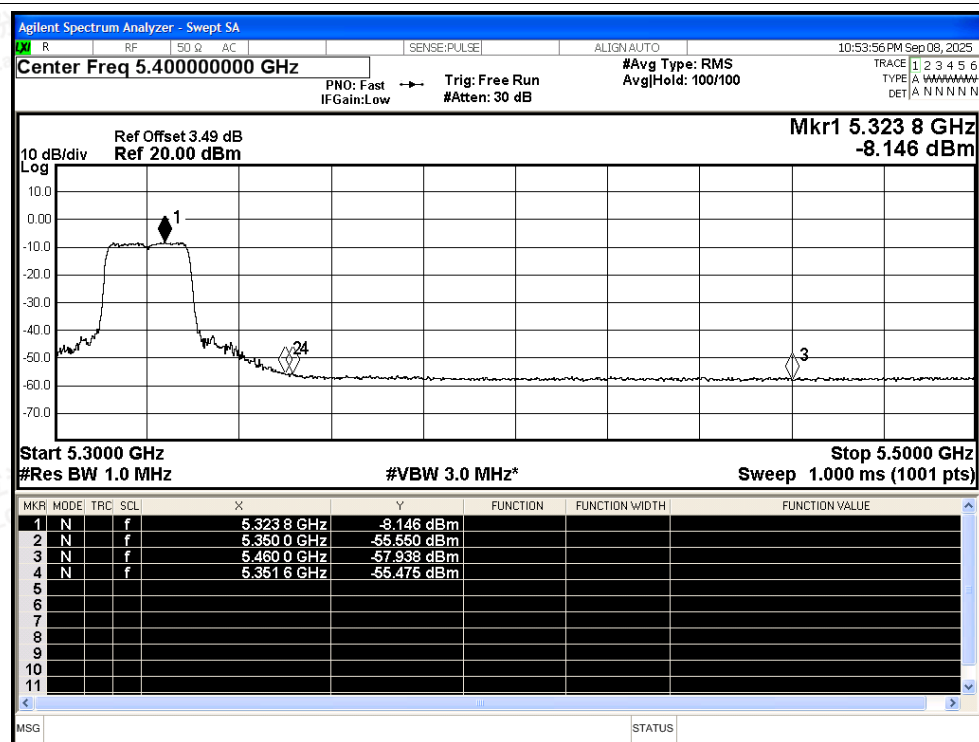

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

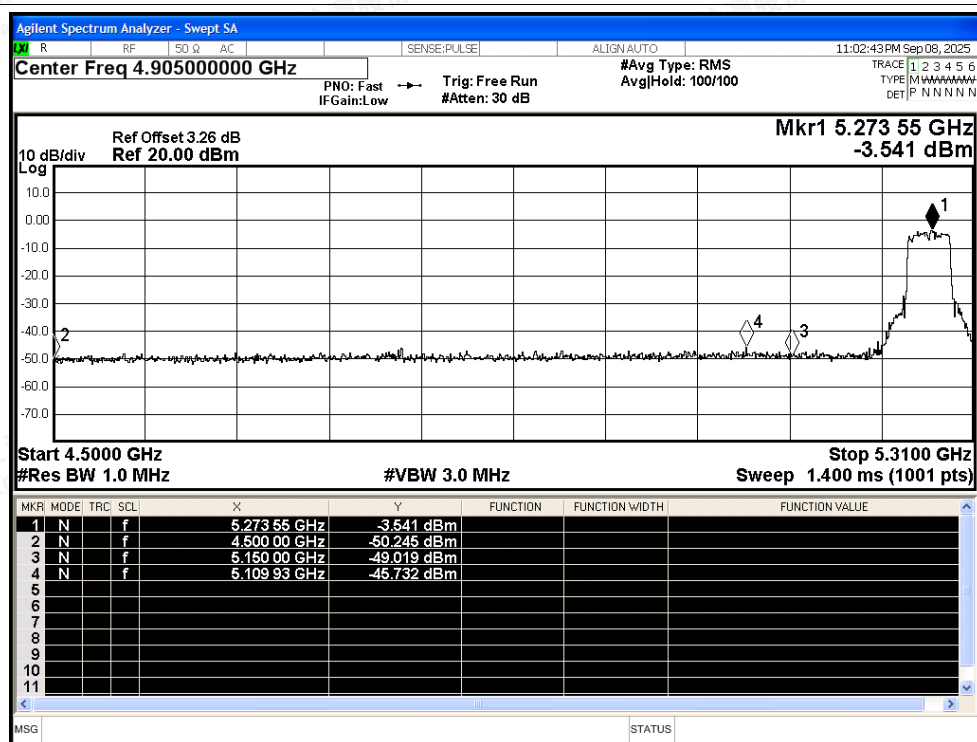

Restrict Band NVNT ac40 5270MHz Ant1 Average

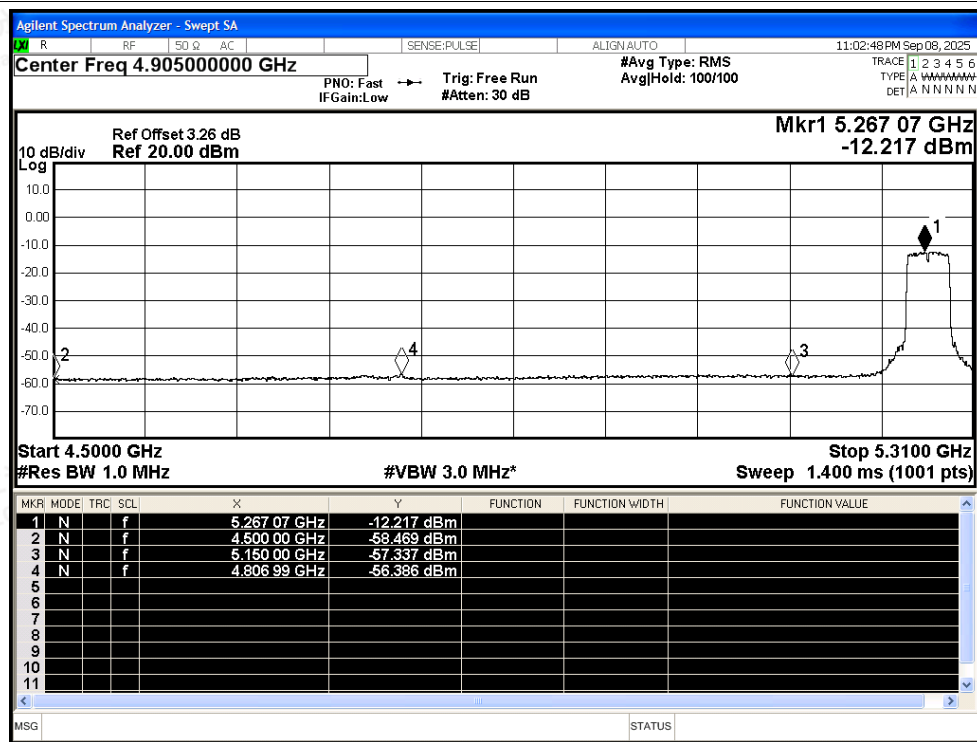

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

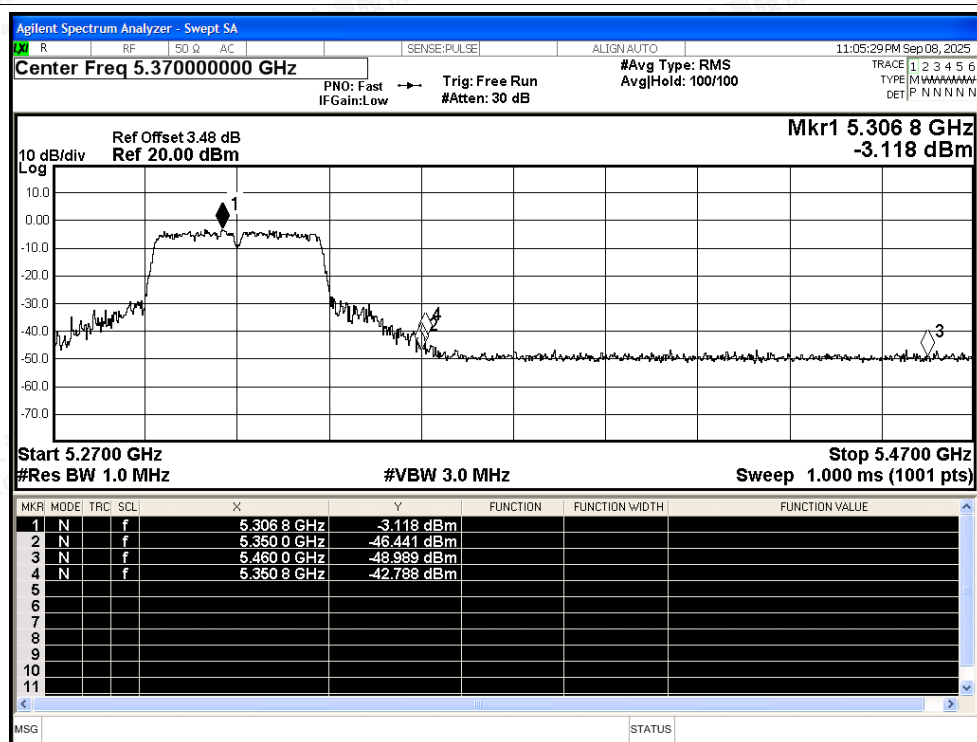

Restrict Band NVNT ac40 5310MHz Ant1 Average

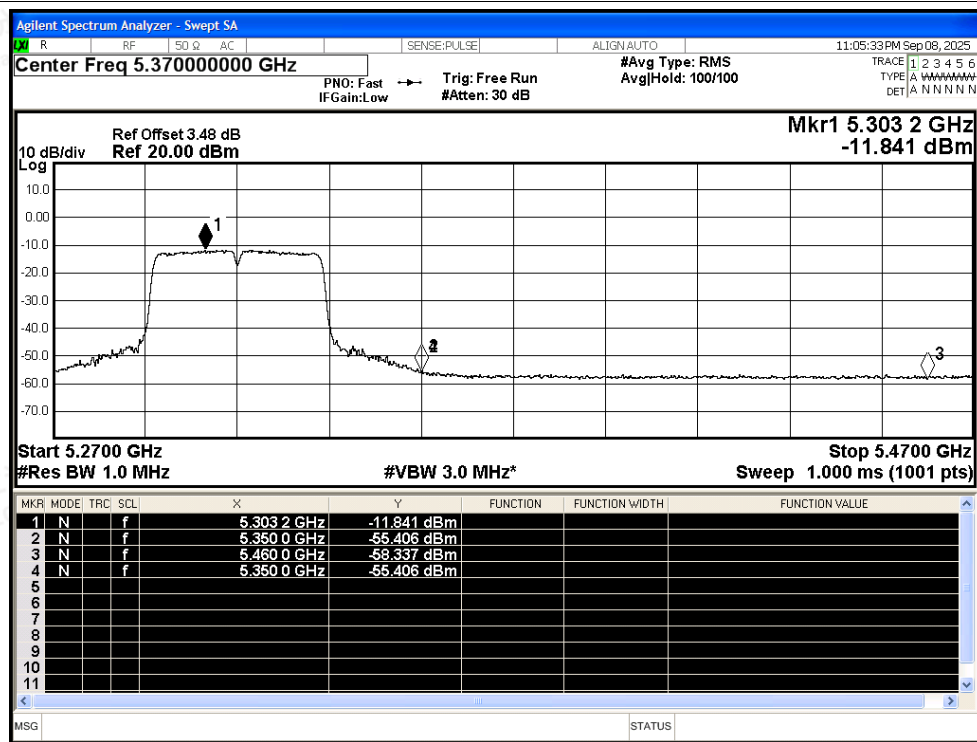

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

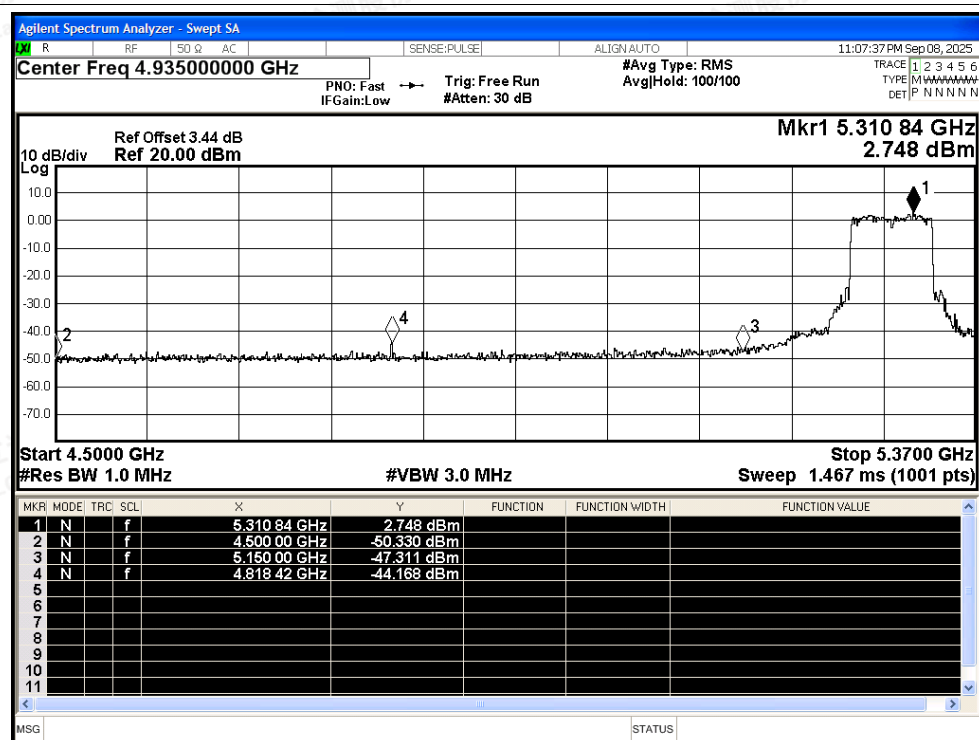

Restrict Band NVNT ac80 5290MHz Ant1 Average

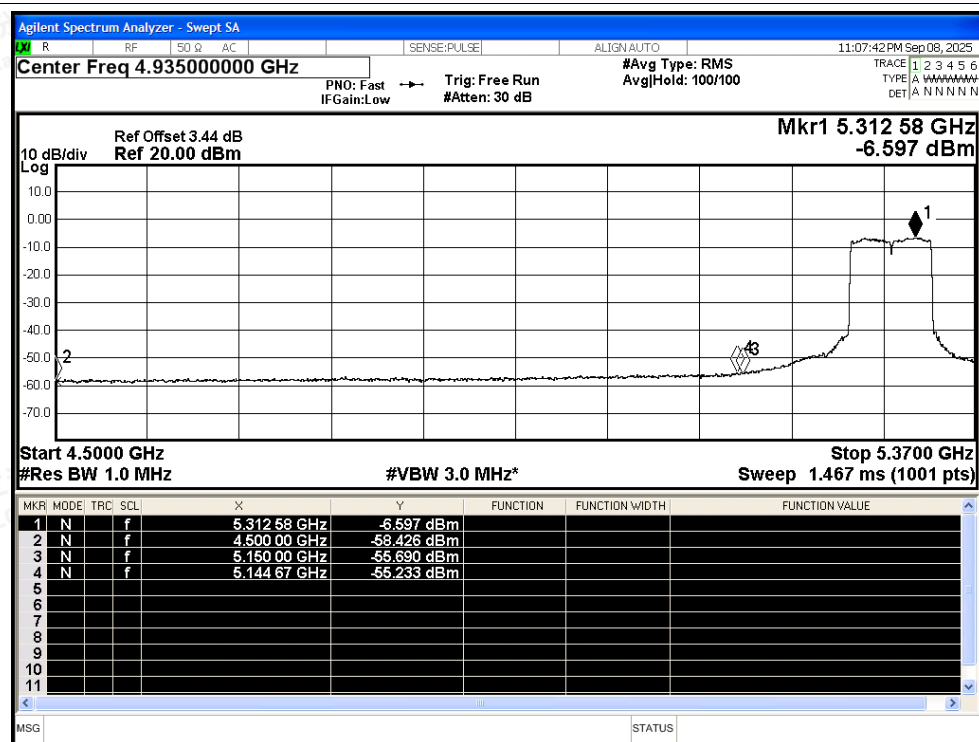

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

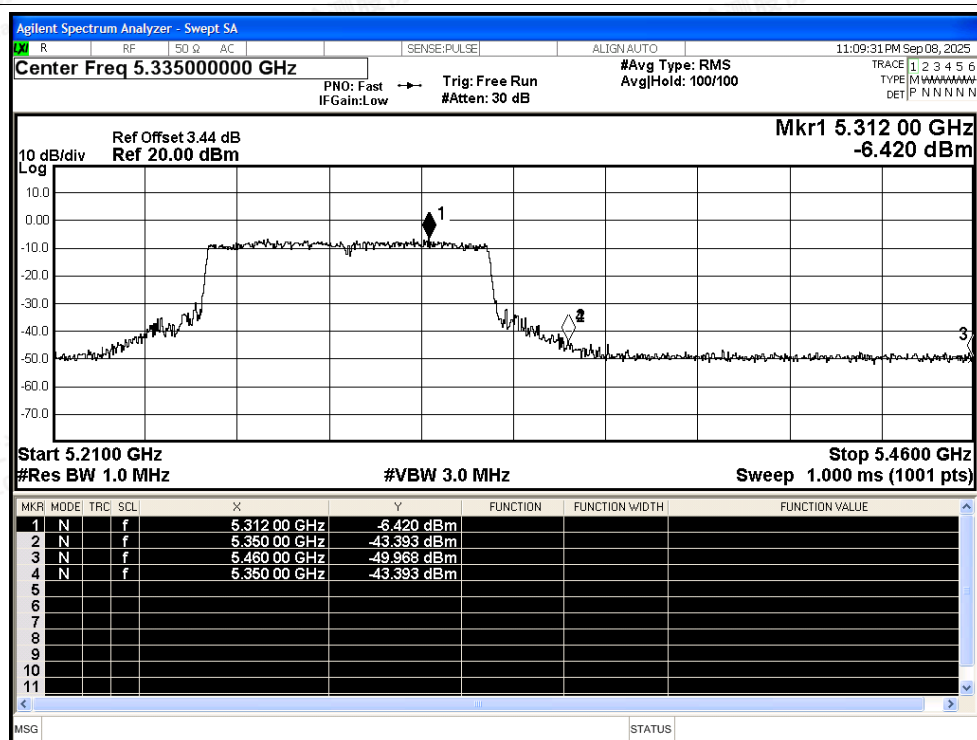

Restrict Band NVNT ac80 5290MHz Ant1 Average

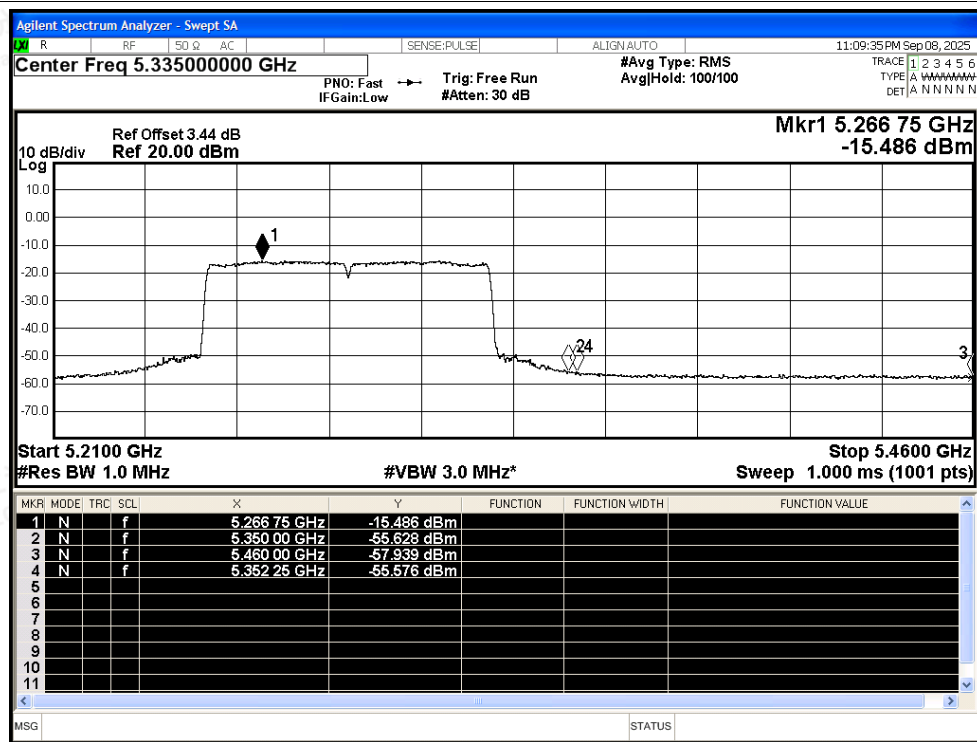

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant0	Ant1	Ant0+ Ant1			
NVNT	n20	5260	45.75	47.28	52.57	Peak	68.2	Pass
NVNT	n20	5260	38.48	39.01	44.77	Average	54	Pass
NVNT	n20	5260	51.63	51.41	57.54	Peak	68.2	Pass
NVNT	n20	5260	40.85	41.06	46.98	Average	54	Pass
NVNT	n20	5260	48.43	47.83	54.16	Peak	68.2	Pass
NVNT	n20	5260	40.40	40.30	46.37	Average	54	Pass
NVNT	n20	5320	51.88	53.03	58.49	Peak	68.2	Pass
NVNT	n20	5320	41.38	41.04	47.23	Average	54	Pass
NVNT	n20	5320	53.47	54.97	60.27	Peak	68.2	Pass
NVNT	n20	5320	41.76	41.59	47.70	Average	54	Pass
NVNT	n20	5320	48.12	47.07	53.63	Peak	68.2	Pass
NVNT	n20	5320	39.41	40.32	45.90	Average	54	Pass
NVNT	n40	5270	46.23	46.64	52.46	Peak	68.2	Pass
NVNT	n40	5270	38.84	38.75	44.82	Average	54	Pass
NVNT	n40	5270	51.12	50.63	56.90	Peak	68.2	Pass
NVNT	n40	5270	41.06	41.08	47.09	Average	54	Pass
NVNT	n40	5270	48.81	48.71	54.78	Peak	68.2	Pass
NVNT	n40	5270	39.65	39.71	45.70	Average	54	Pass
NVNT	n40	5310	52.90	51.78	58.38	Peak	68.2	Pass
NVNT	n40	5310	41.86	41.46	47.68	Average	54	Pass
NVNT	n40	5310	54.93	53.67	60.34	Peak	68.2	Pass
NVNT	n40	5310	42.10	42.27	48.21	Average	54	Pass
NVNT	n40	5310	49.50	47.71	54.67	Peak	68.2	Pass
NVNT	n40	5310	40.08	40.52	46.32	Average	54	Pass
NVNT	ac20	5260	45.96	45.71	51.86	Peak	68.2	Pass
NVNT	ac20	5260	39.08	39.00	45.06	Average	54	Pass
NVNT	ac20	5260	50.62	51.17	56.92	Peak	68.2	Pass
NVNT	ac20	5260	40.72	40.77	46.77	Average	54	Pass
NVNT	ac20	5260	48.56	47.49	54.06	Peak	68.2	Pass
NVNT	ac20	5260	39.69	40.75	46.26	Average	54	Pass
NVNT	ac20	5320	52.68	51.25	58.01	Peak	68.2	Pass
NVNT	ac20	5320	41.65	41.88	47.79	Average	54	Pass
NVNT	ac20	5320	53.04	52.76	58.92	Peak	68.2	Pass
NVNT	ac20	5320	41.77	41.95	47.88	Average	54	Pass
NVNT	ac20	5320	48.41	47.28	53.88	Peak	68.2	Pass
NVNT	ac20	5320	39.87	39.49	45.70	Average	54	Pass
NVNT	ac40	5270	46.27	47.06	52.69	Peak	68.2	Pass
NVNT	ac40	5270	38.52	39.08	44.83	Average	54	Pass
NVNT	ac40	5270	51.36	51.58	57.49	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	41.12	41.16	47.16	Average	54	Pass
NVNT	ac40	5270	47.10	48.29	53.74	Peak	68.2	Pass
NVNT	ac40	5270	39.69	40.21	45.97	Average	54	Pass
NVNT	ac40	5310	50.50	50.87	56.71	Peak	68.2	Pass
NVNT	ac40	5310	42.27	42.14	48.23	Average	54	Pass
NVNT	ac40	5310	56.90	54.52	61.81	Peak	68.2	Pass
NVNT	ac40	5310	42.27	42.14	48.23	Average	54	Pass
NVNT	ac40	5310	46.89	48.32	53.65	Peak	68.2	Pass
NVNT	ac40	5310	40.27	39.21	45.78	Average	54	Pass
NVNT	ac80	5290	46.91	46.98	52.97	Peak	68.2	Pass
NVNT	ac80	5290	38.59	39.35	45.00	Average	54	Pass
NVNT	ac80	5290	51.73	53.14	58.48	Peak	68.2	Pass
NVNT	ac80	5290	43.10	42.55	48.85	Average	54	Pass
NVNT	ac80	5290	50.87	50.00	56.47	Peak	68.2	Pass
NVNT	ac80	5290	43.10	42.09	48.63	Average	54	Pass
NVNT	ac80	5290	52.97	53.92	59.48	Peak	68.2	Pass
NVNT	ac80	5290	41.84	42.15	48.02	Average	54	Pass
NVNT	ac80	5290	55.22	53.92	60.61	Peak	68.2	Pass
NVNT	ac80	5290	42.13	42.20	48.19	Average	54	Pass
NVNT	ac80	5290	47.86	47.34	53.62	Peak	68.2	Pass
NVNT	ac80	5290	40.02	39.84	45.95	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant0	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant0	5300	0	0	25	Pass
NVNT	a	5320	Ant0	5320	0	0	25	Pass
NVNT	n20	5260	Ant0	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant0	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant0	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant0	5270	0	0	25	Pass
NVNT	n40	5310	Ant0	5310	0	0	25	Pass
NVNT	ac20	5260	Ant0	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant0	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant0	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant0	5270	0	0	25	Pass
NVNT	ac40	5310	Ant0	5310	0	0	25	Pass
NVNT	ac80	5290	Ant0	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant0

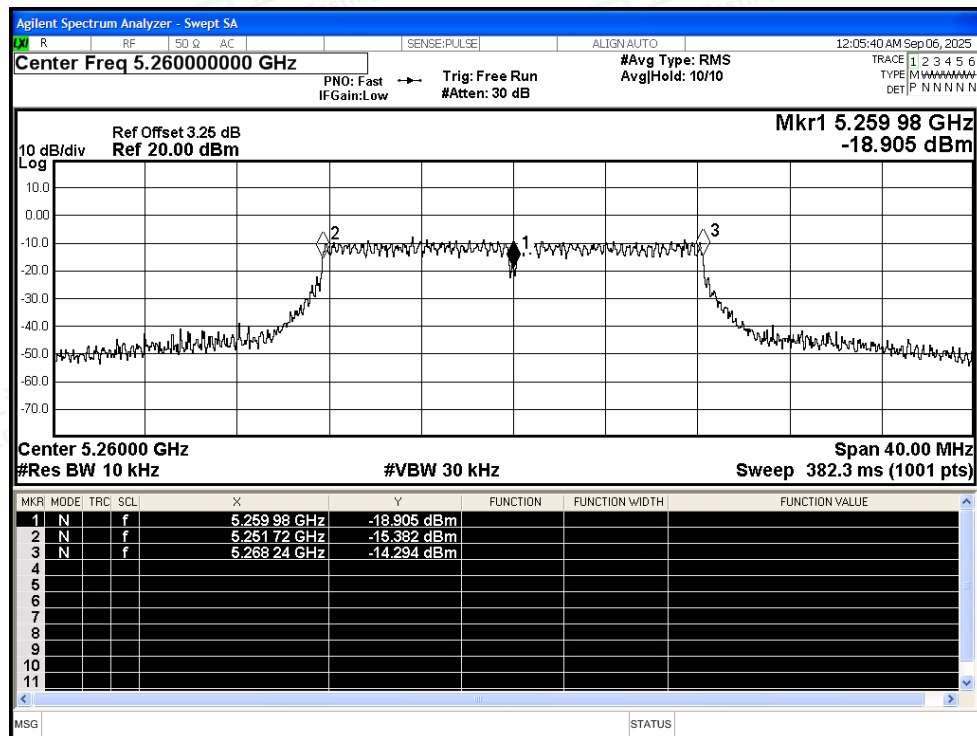

Freq. Stability NVNT a 5300MHz Ant0


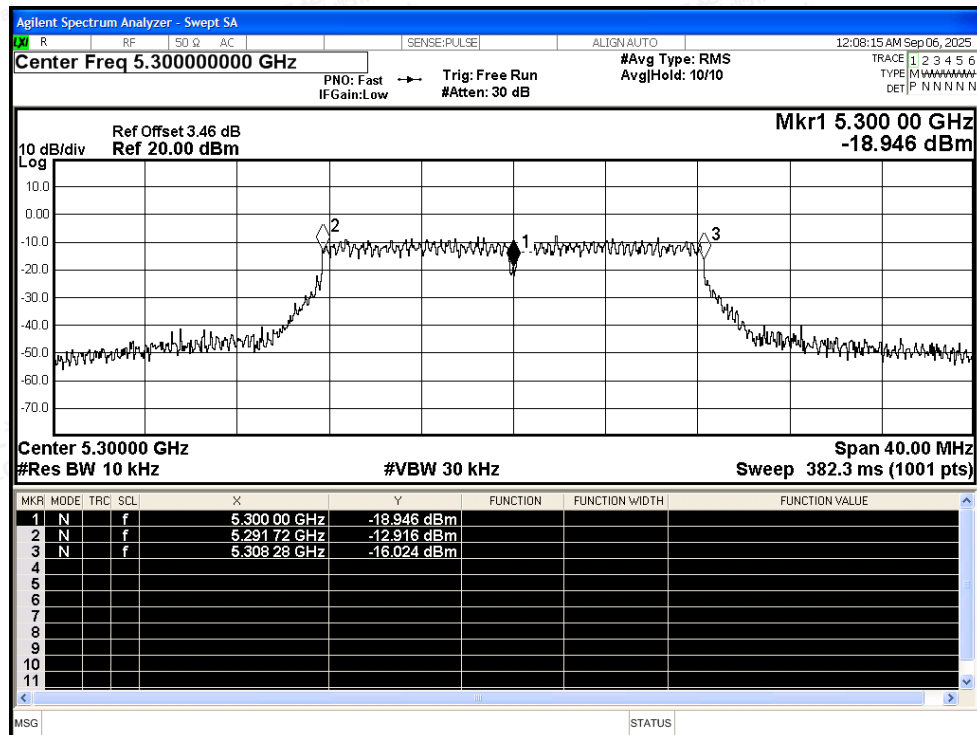


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

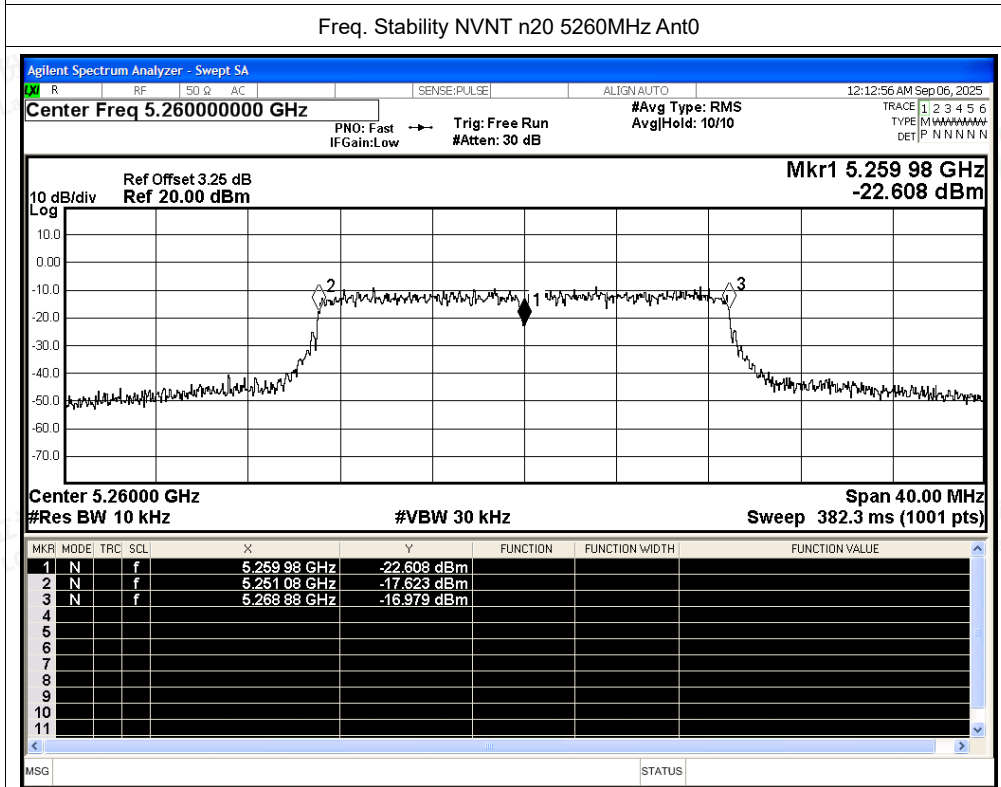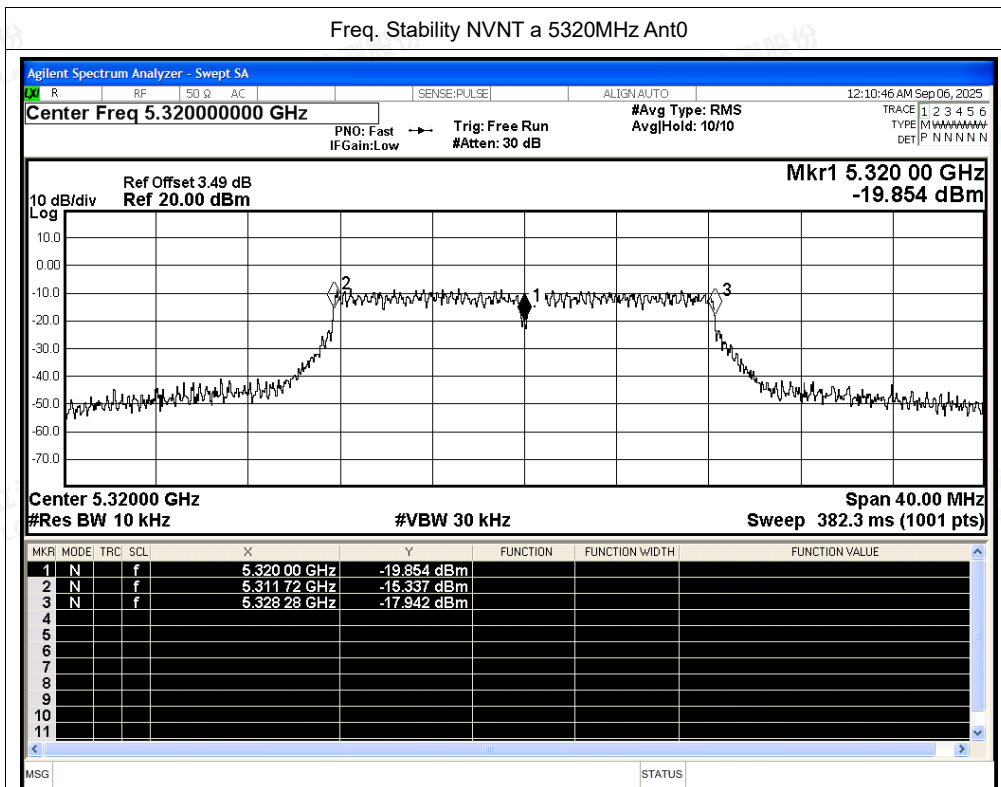

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant0

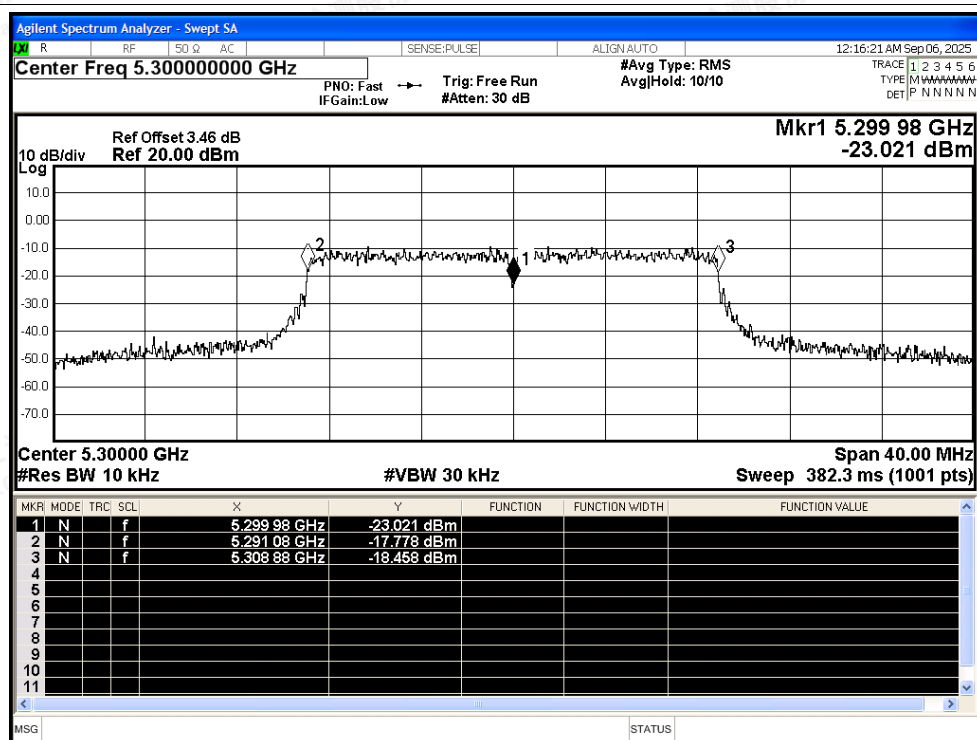

Freq. Stability NVNT n20 5320MHz Ant0

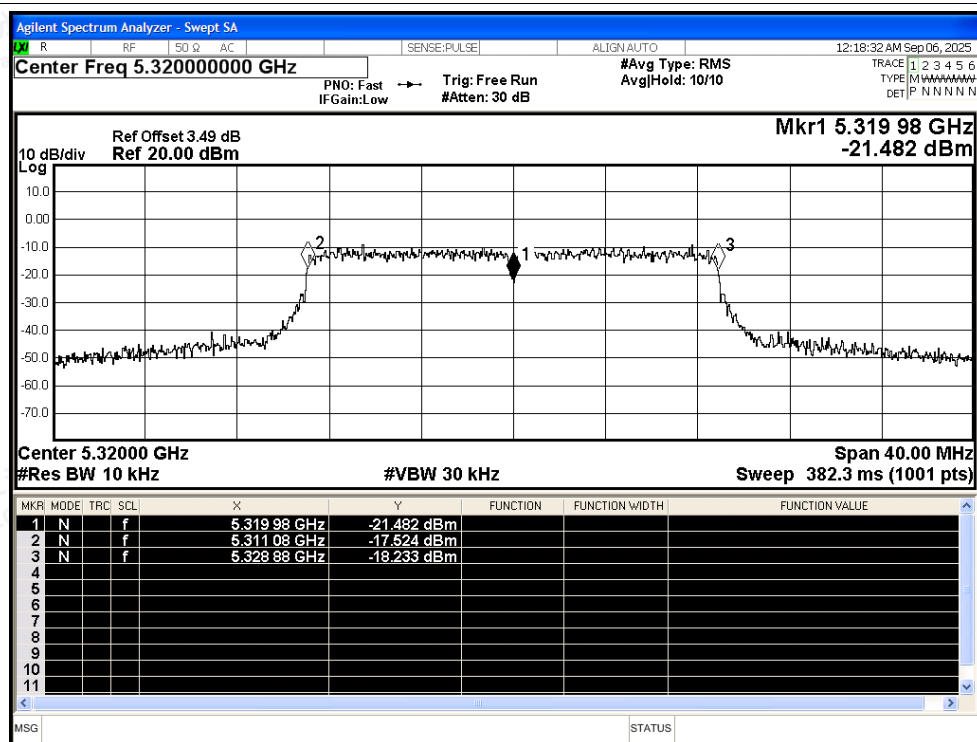

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant0

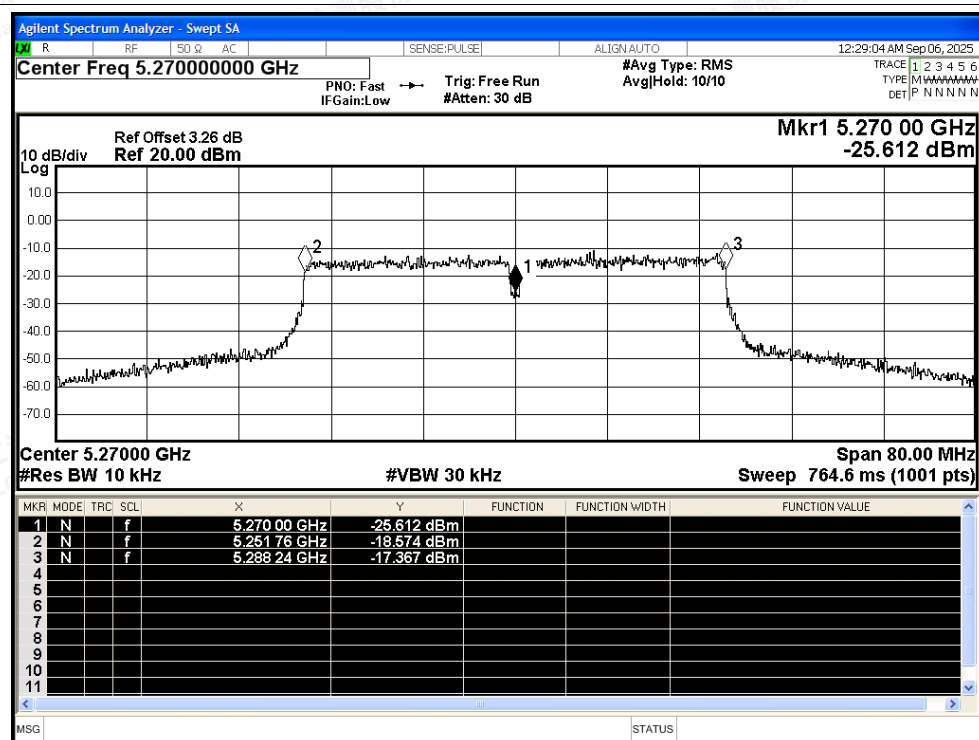

Freq. Stability NVNT n40 5310MHz Ant0


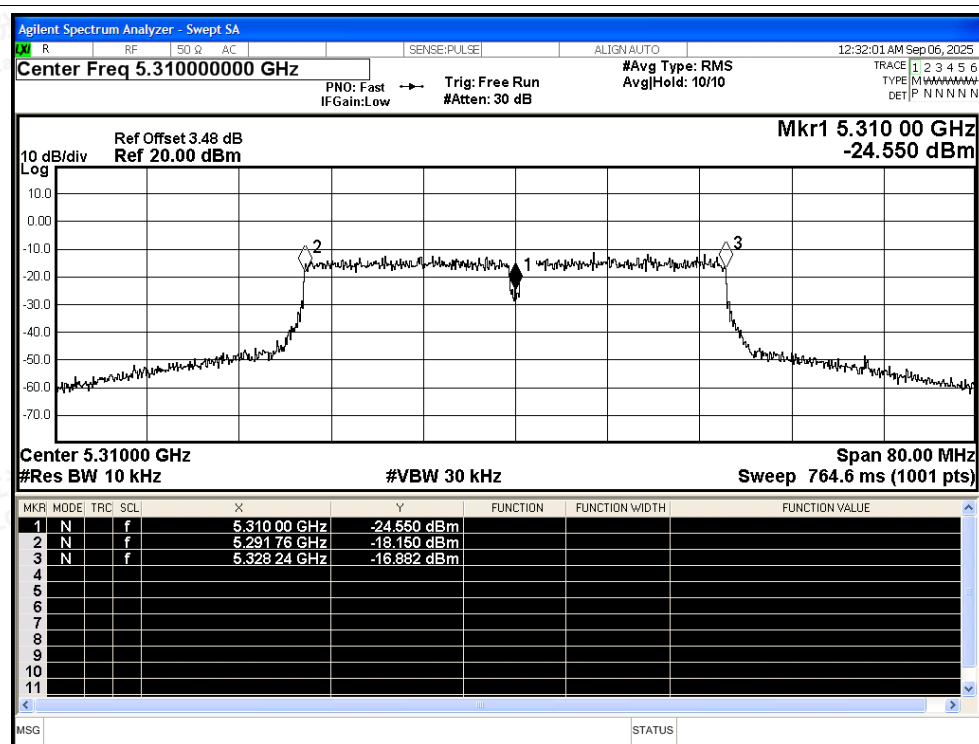


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

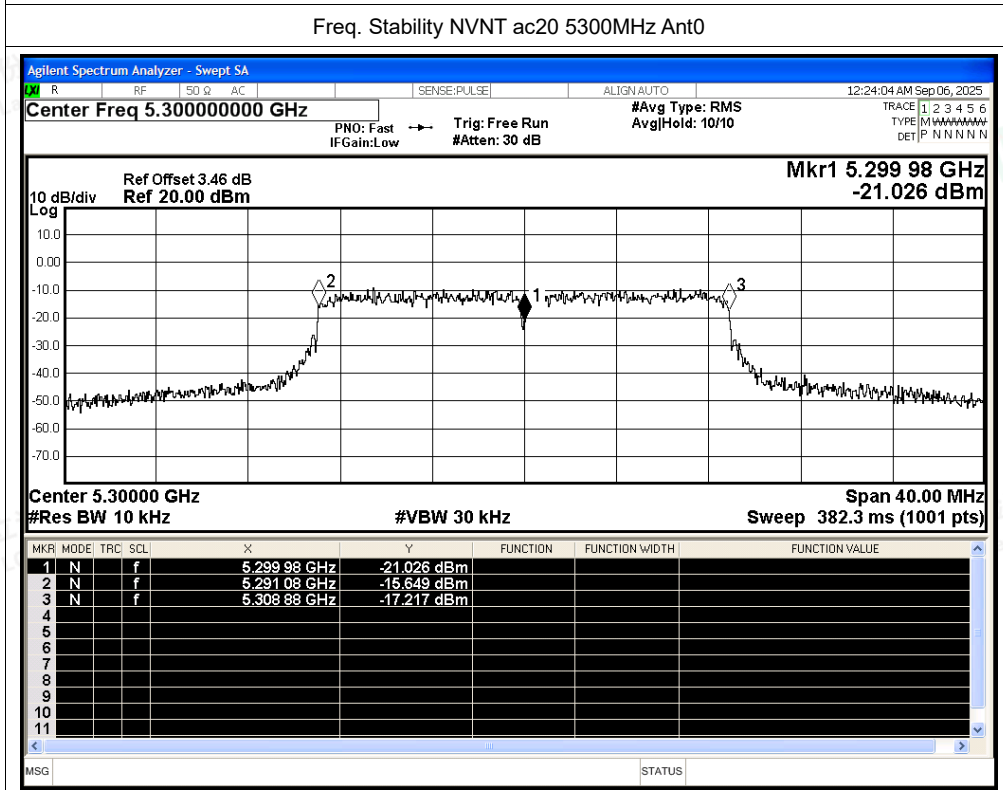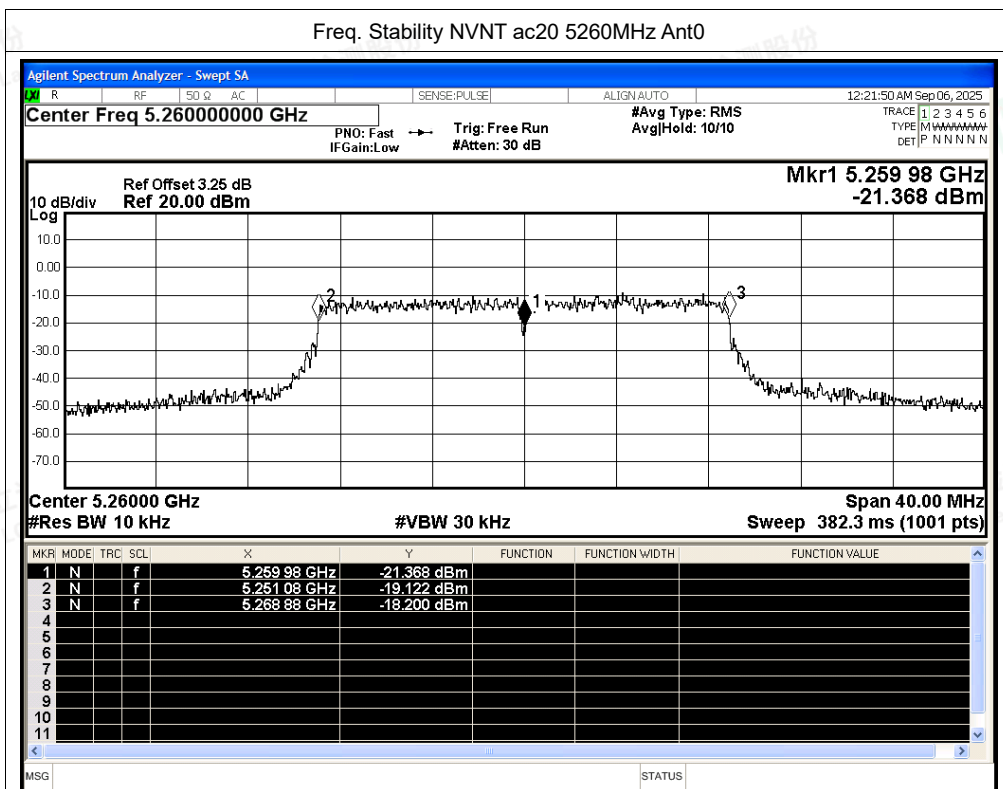

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant0

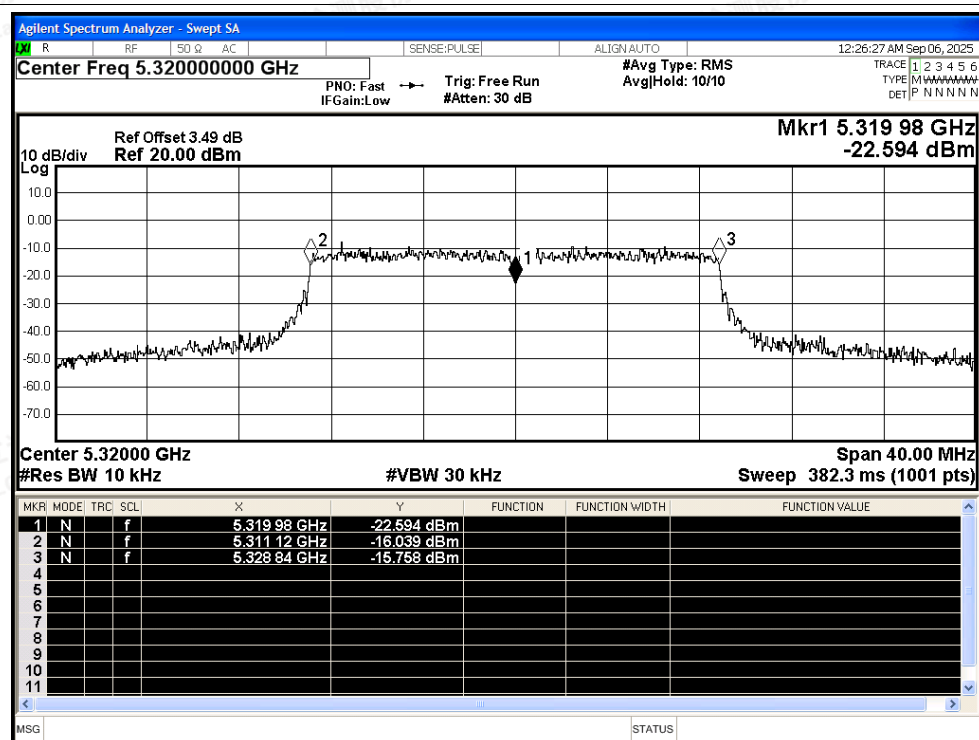

Freq. Stability NVNT ac40 5270MHz Ant0


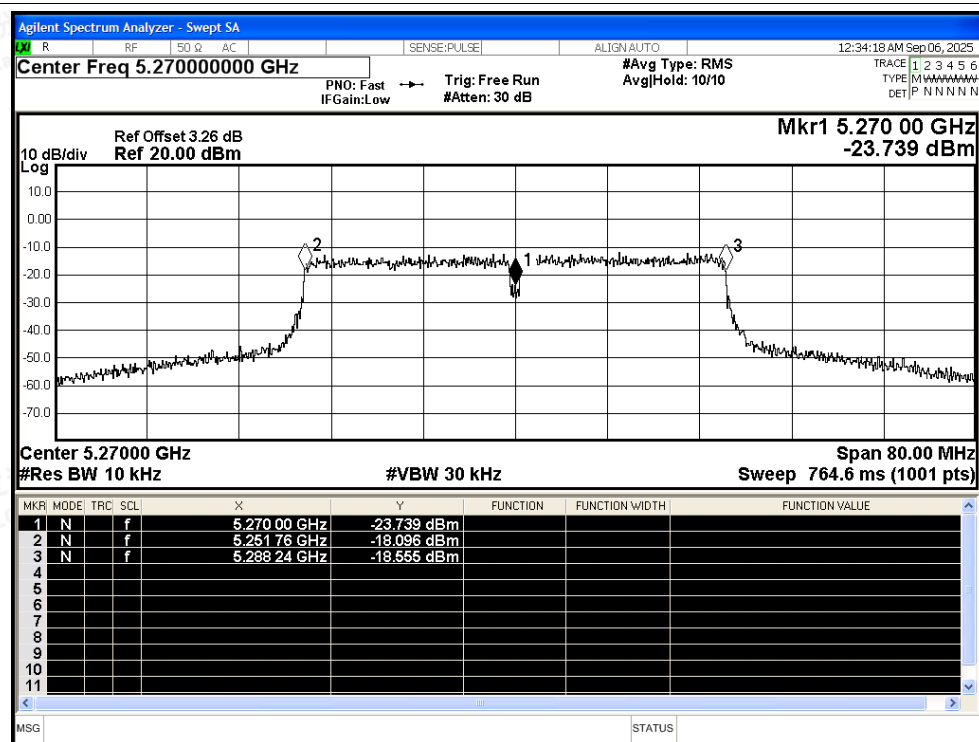


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

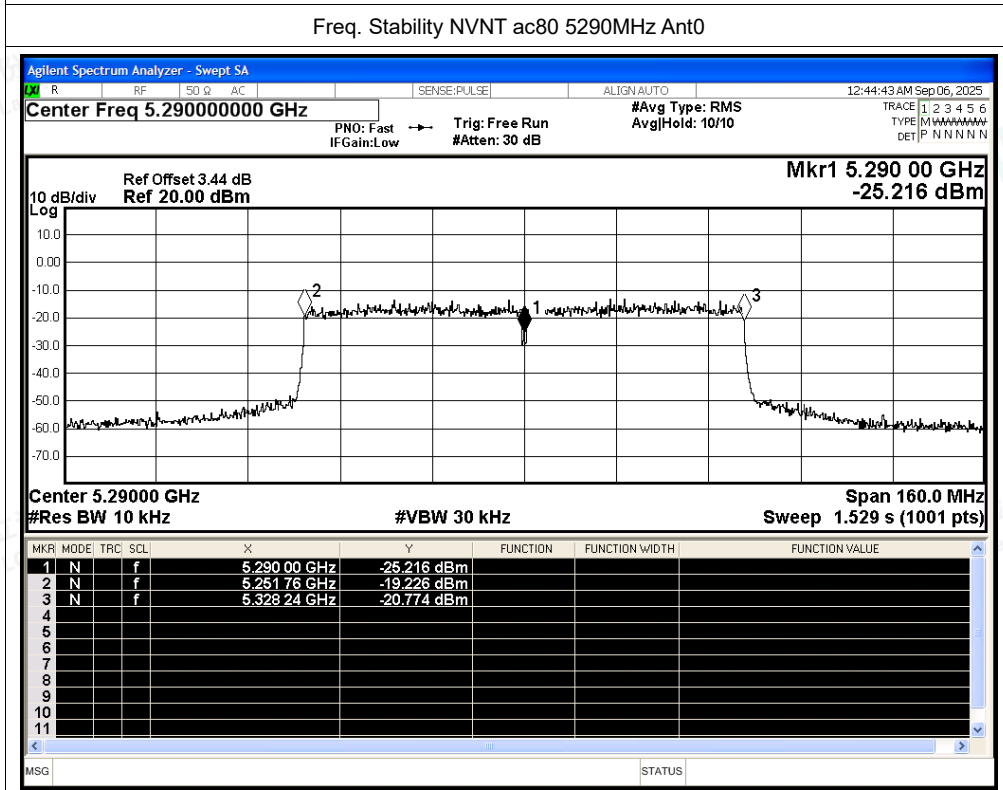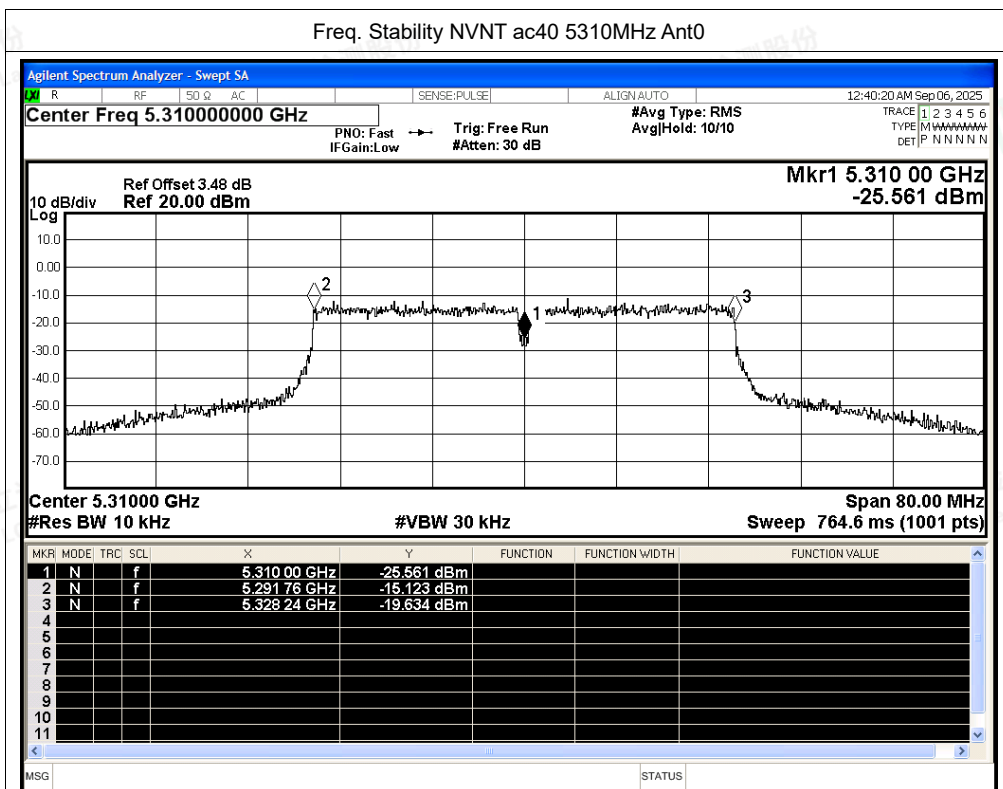

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant1	5300	0	0	25	Pass
NVNT	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant1	5320	0	0	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant1	5300.02	20000	3.77	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

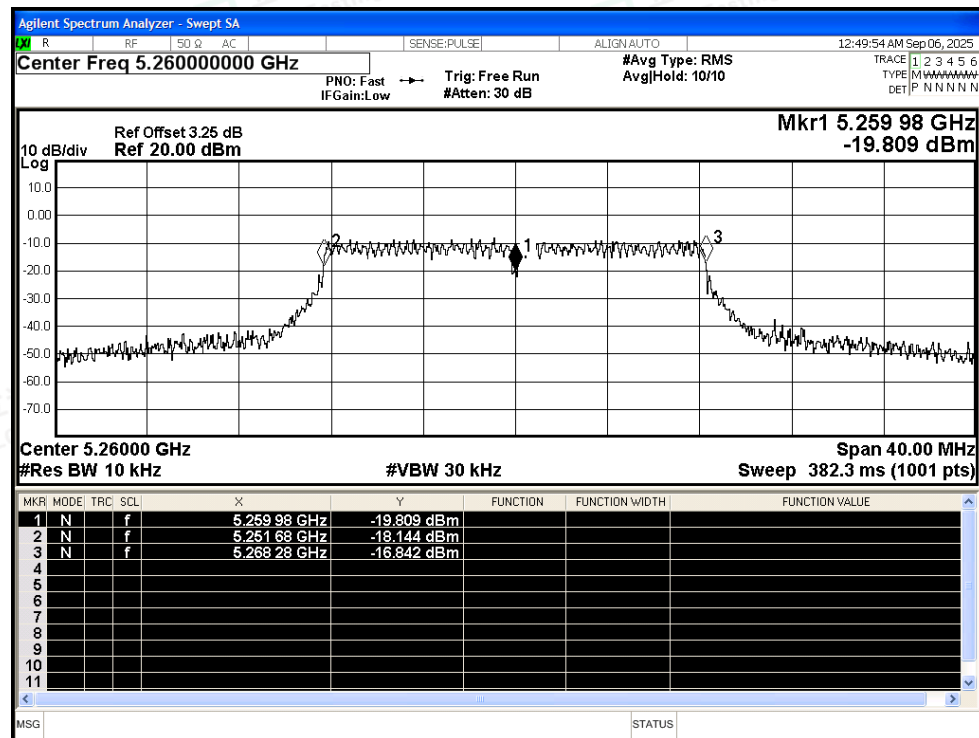

Freq. Stability NVNT a 5300MHz Ant1


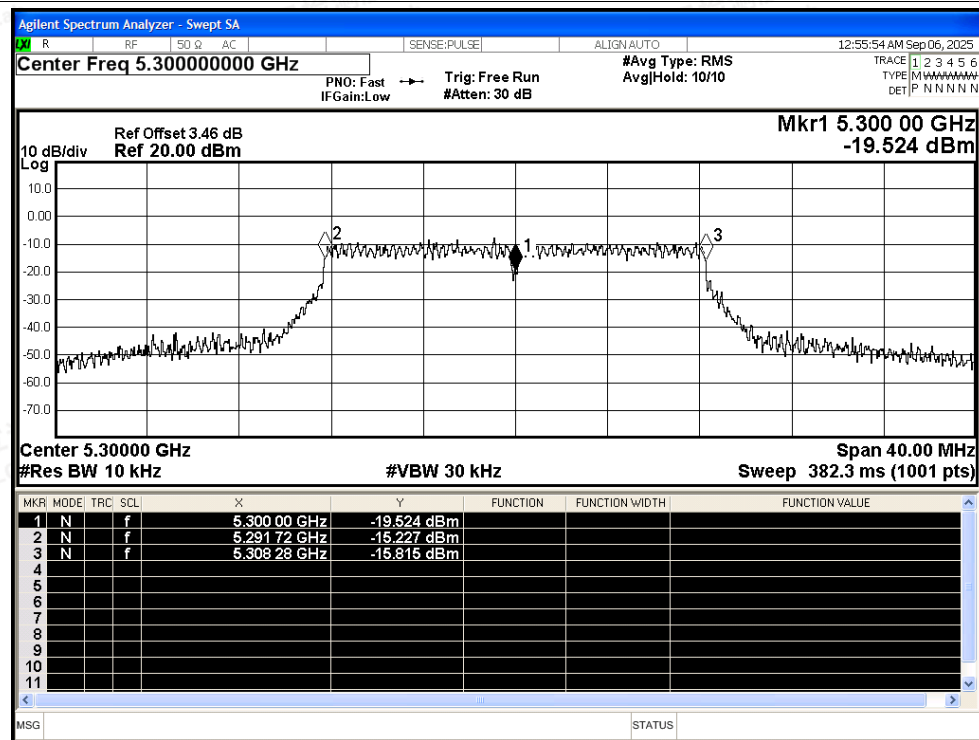


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

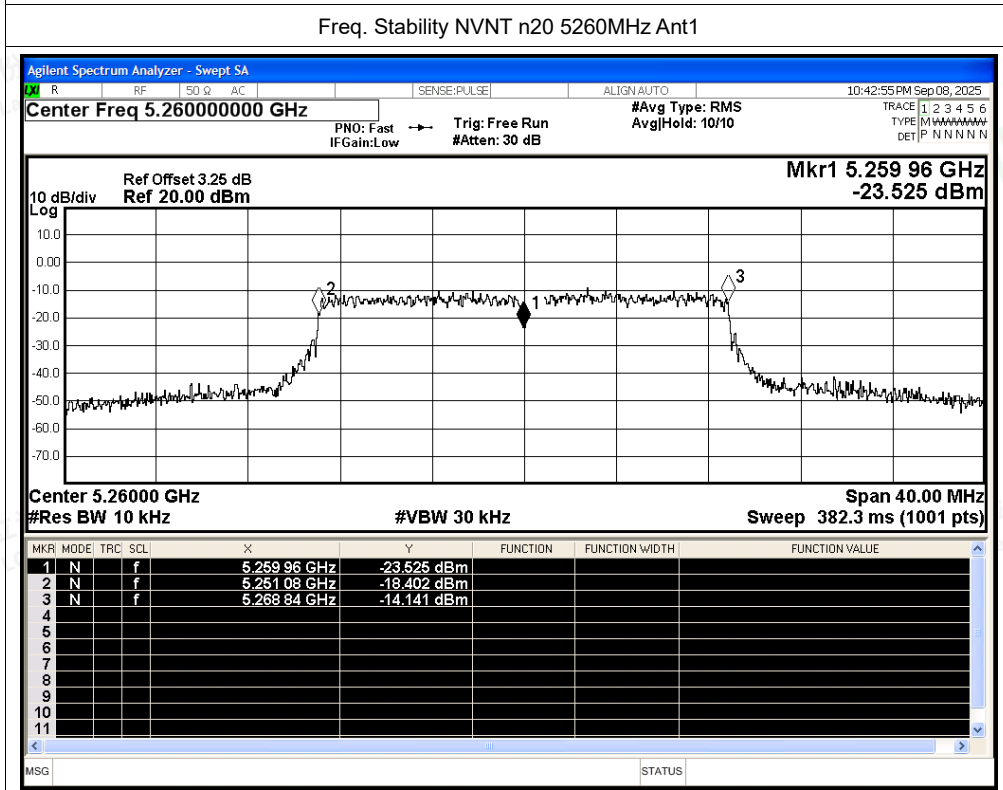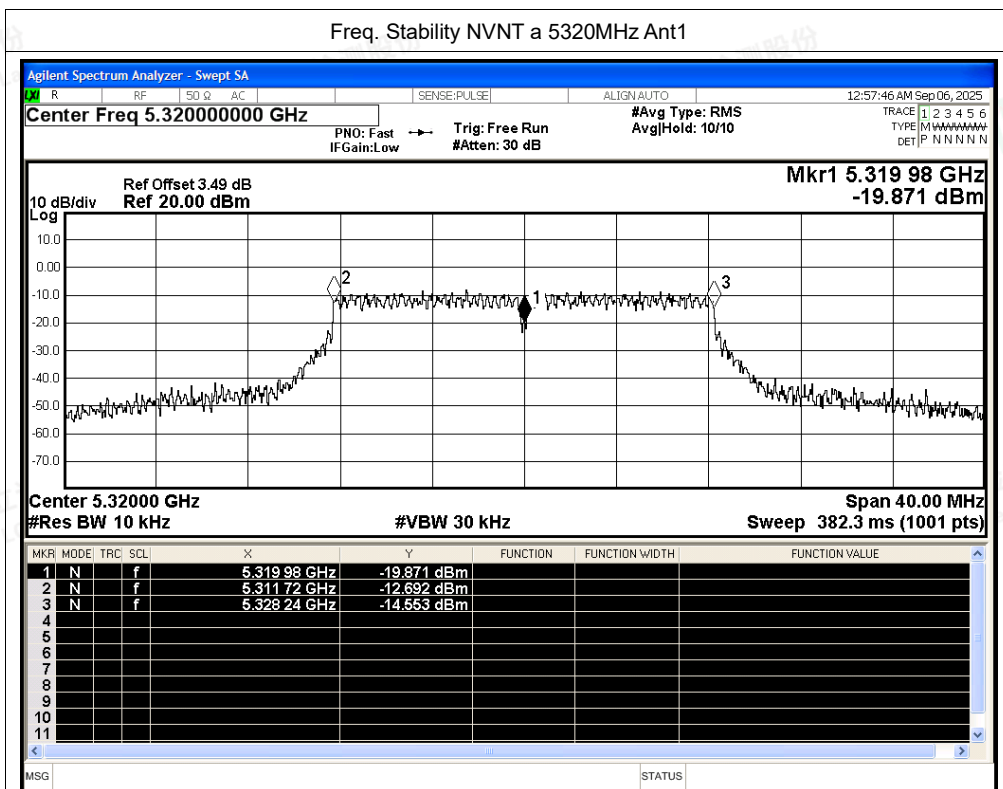

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

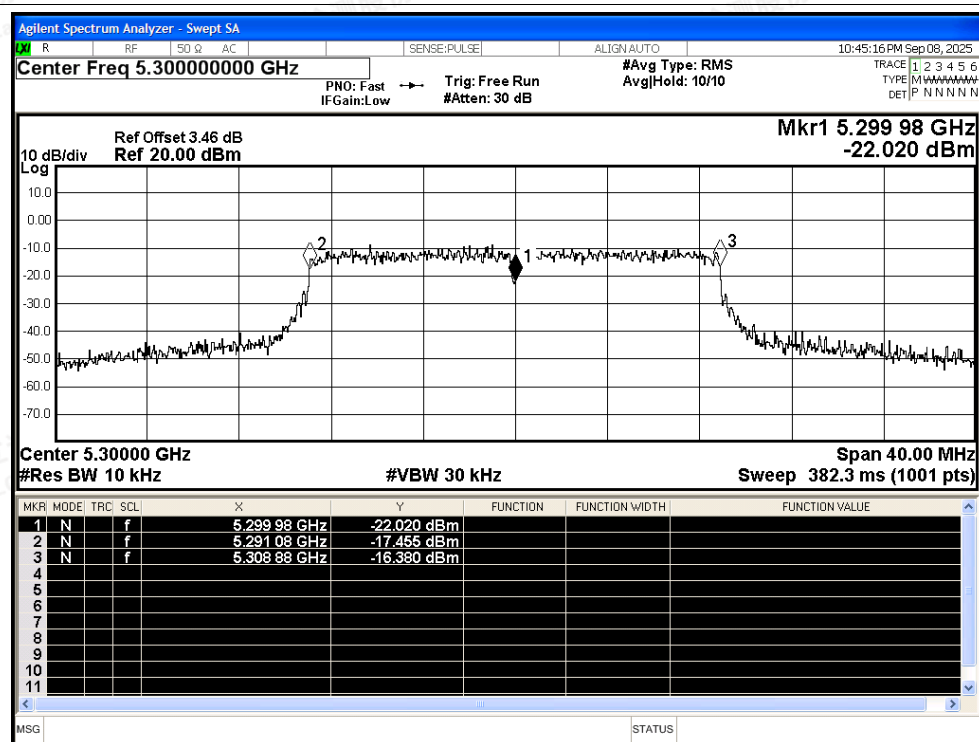

Freq. Stability NVNT n20 5320MHz Ant1

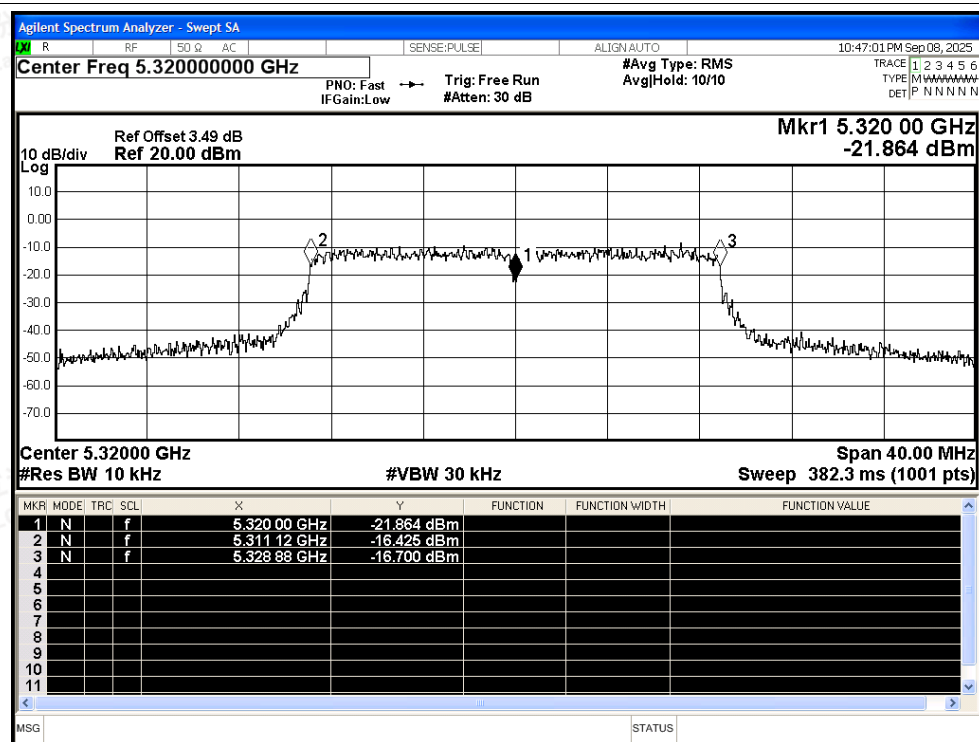

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

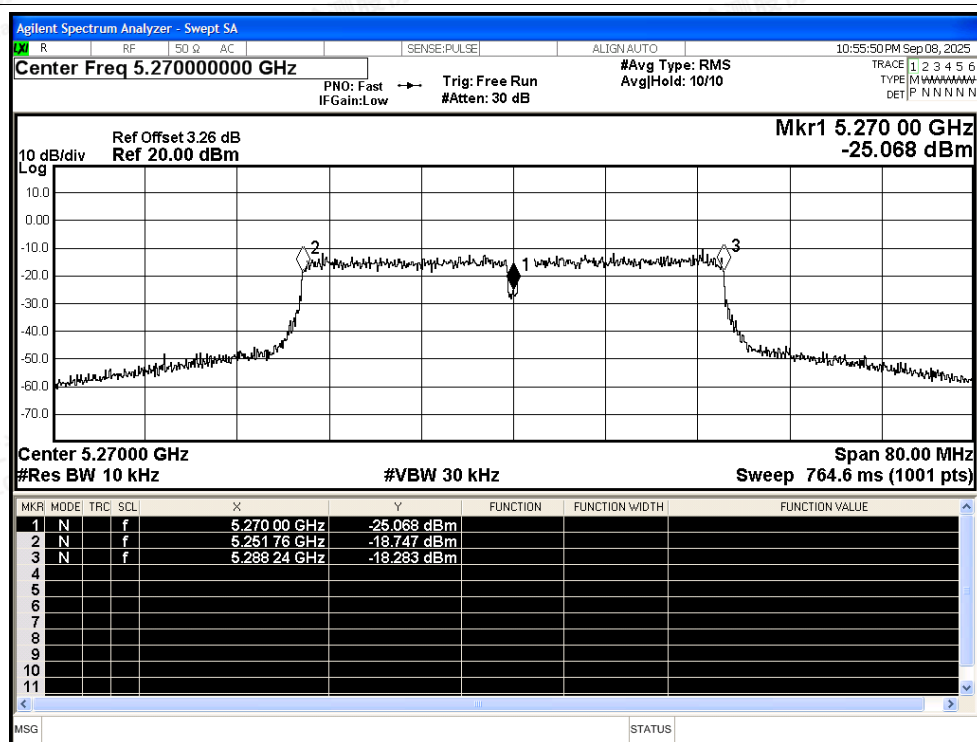

Freq. Stability NVNT n40 5310MHz Ant1

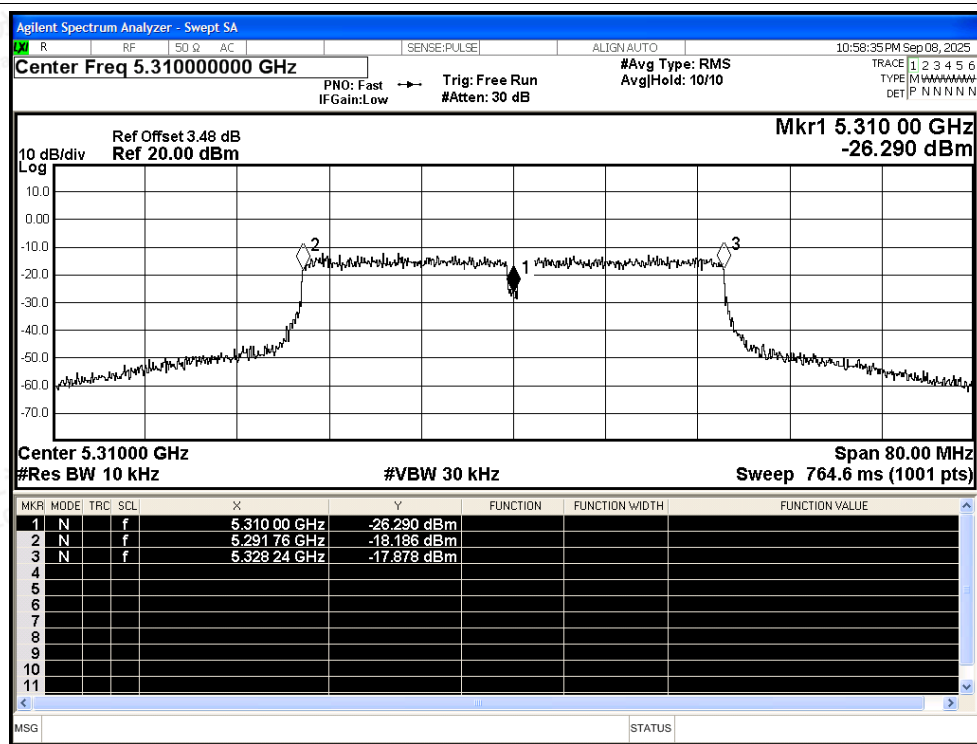

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

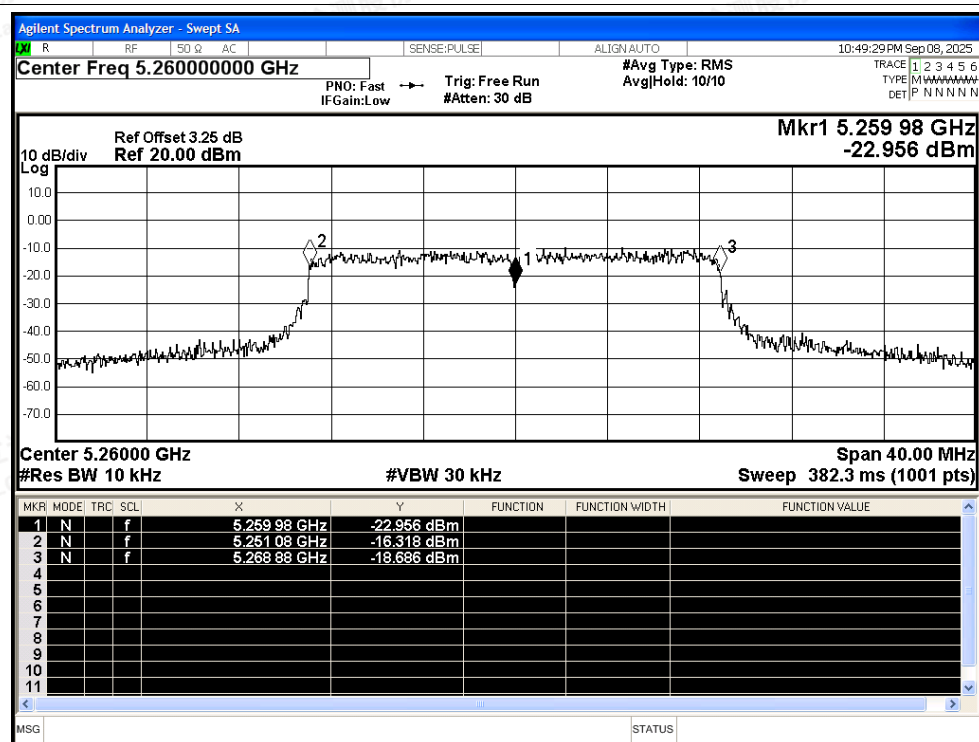

Freq. Stability NVNT ac20 5300MHz Ant1

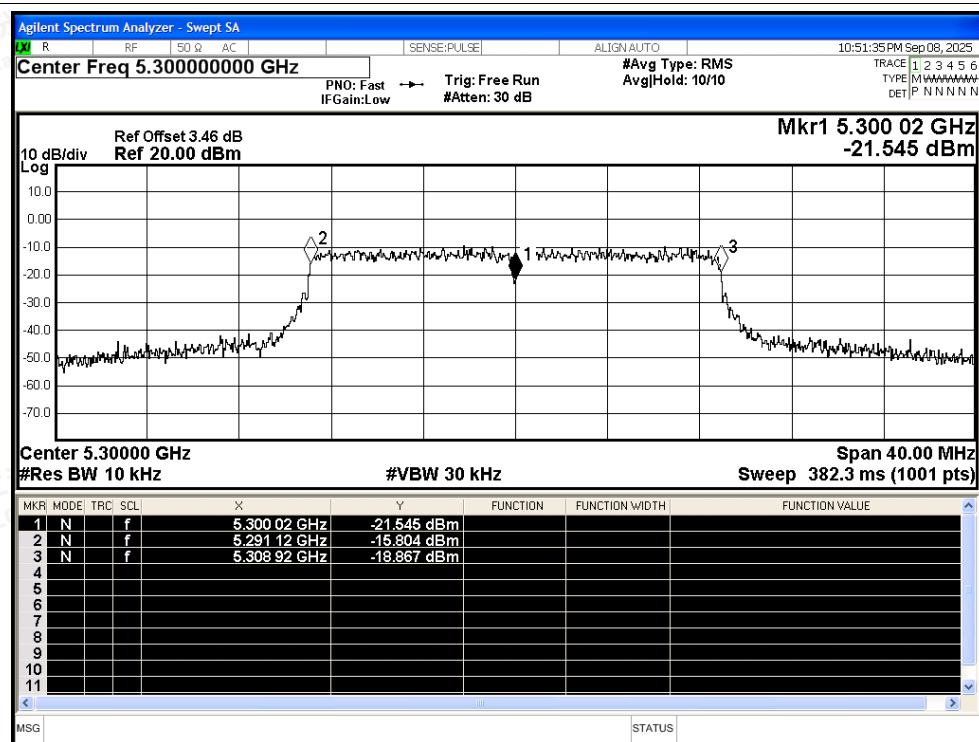

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

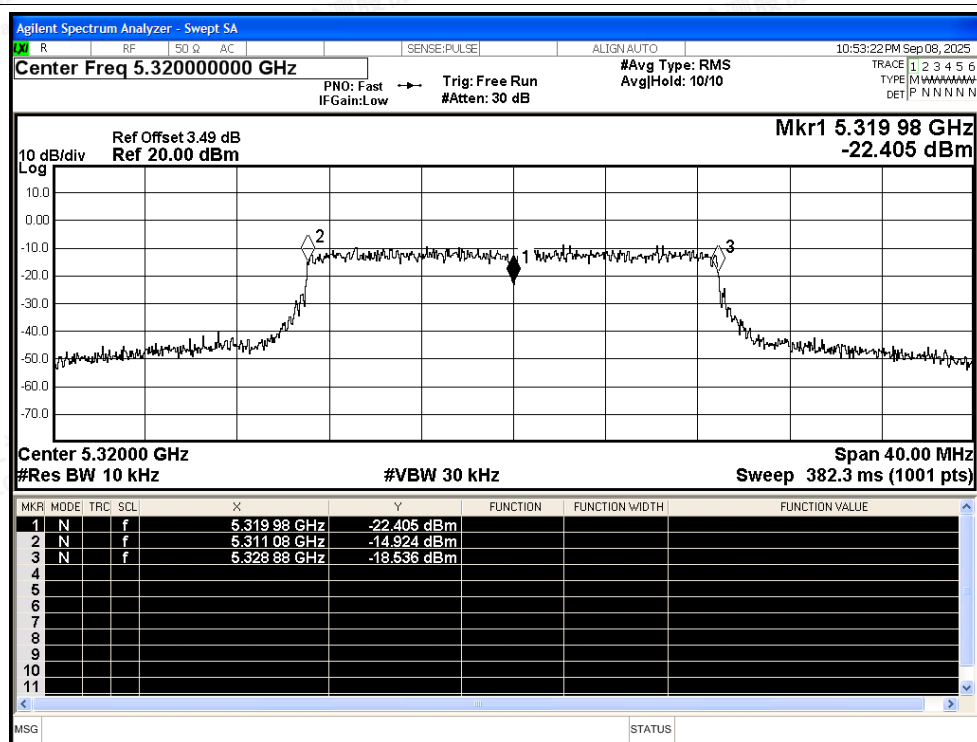

Freq. Stability NVNT ac40 5270MHz Ant1

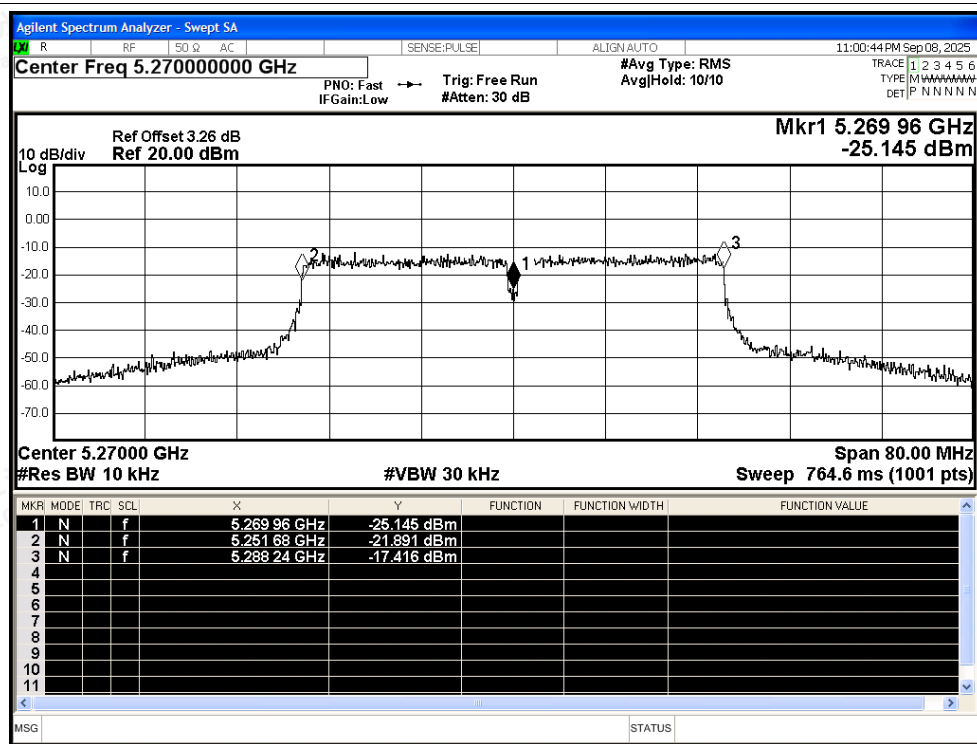

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

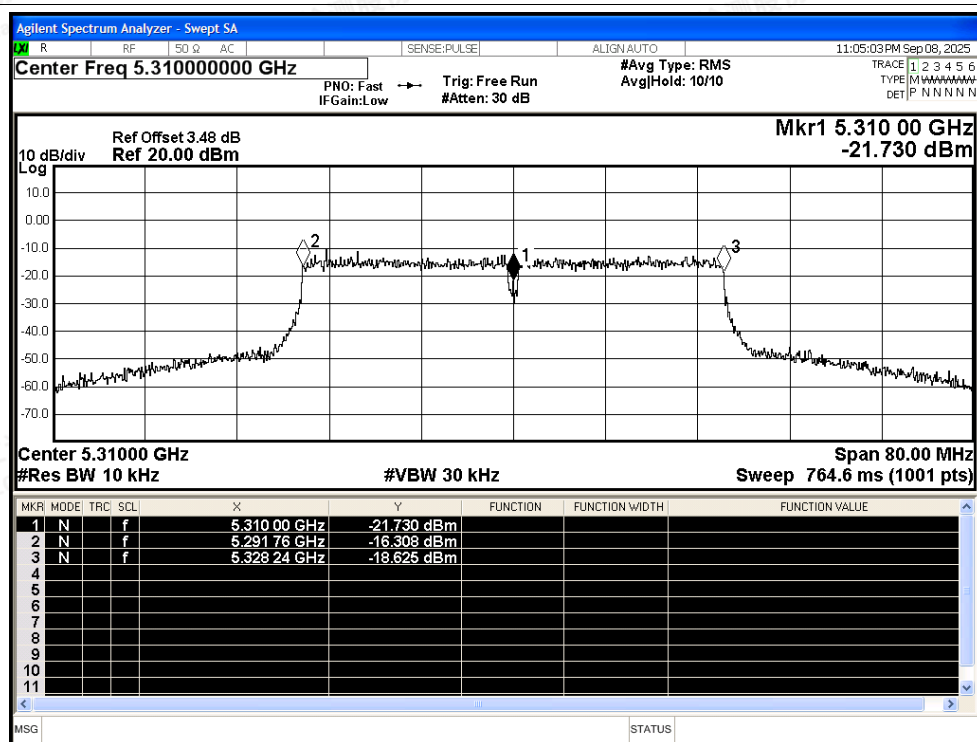

Freq. Stability NVNT ac80 5290MHz Ant1

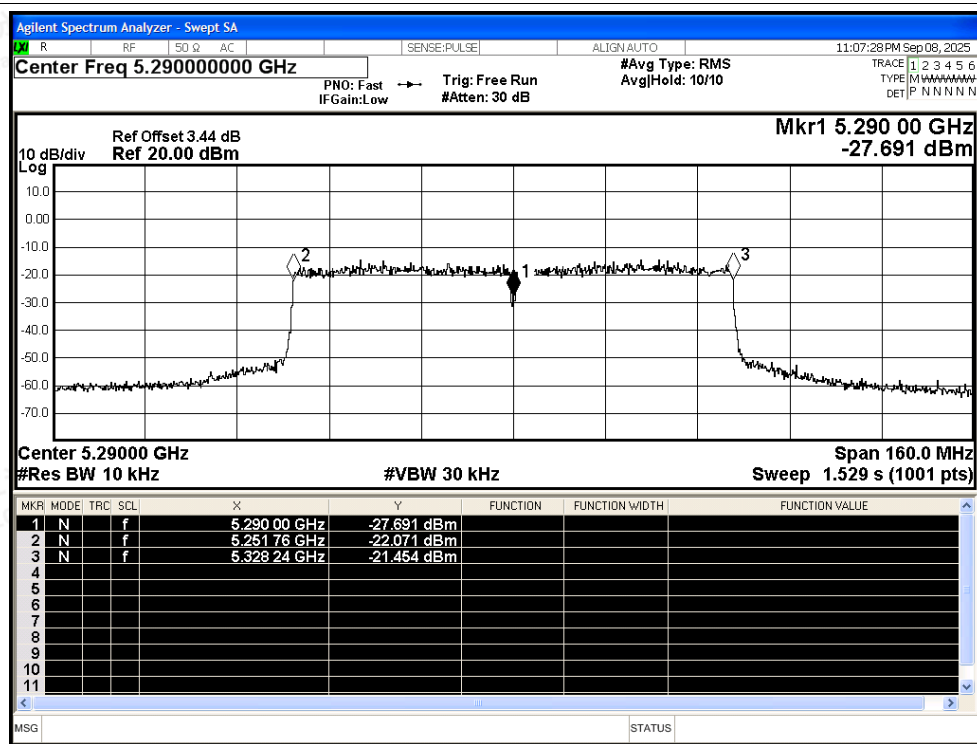

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant0	94.56	0.24	0.91
NVNT	a	5300	Ant0	94.56	0.24	0.91
NVNT	a	5320	Ant0	94.65	0.24	0.91
NVNT	n20	5260	Ant0	97.29	0.12	0.44
NVNT	n20	5300	Ant0	97.29	0.12	0.44
NVNT	n20	5320	Ant0	97.29	0.12	0.44
NVNT	n40	5270	Ant0	94.71	0.24	0.9
NVNT	n40	5310	Ant0	94.71	0.24	0.9
NVNT	ac20	5260	Ant0	97.34	0.12	0.44
NVNT	ac20	5300	Ant0	97.34	0.12	0.44
NVNT	ac20	5320	Ant0	97.34	0.12	0.44
NVNT	ac40	5270	Ant0	94.72	0.24	0.9
NVNT	ac40	5310	Ant0	94.72	0.24	0.9
NVNT	ac80	5290	Ant0	89.65	0.47	1.86



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant0

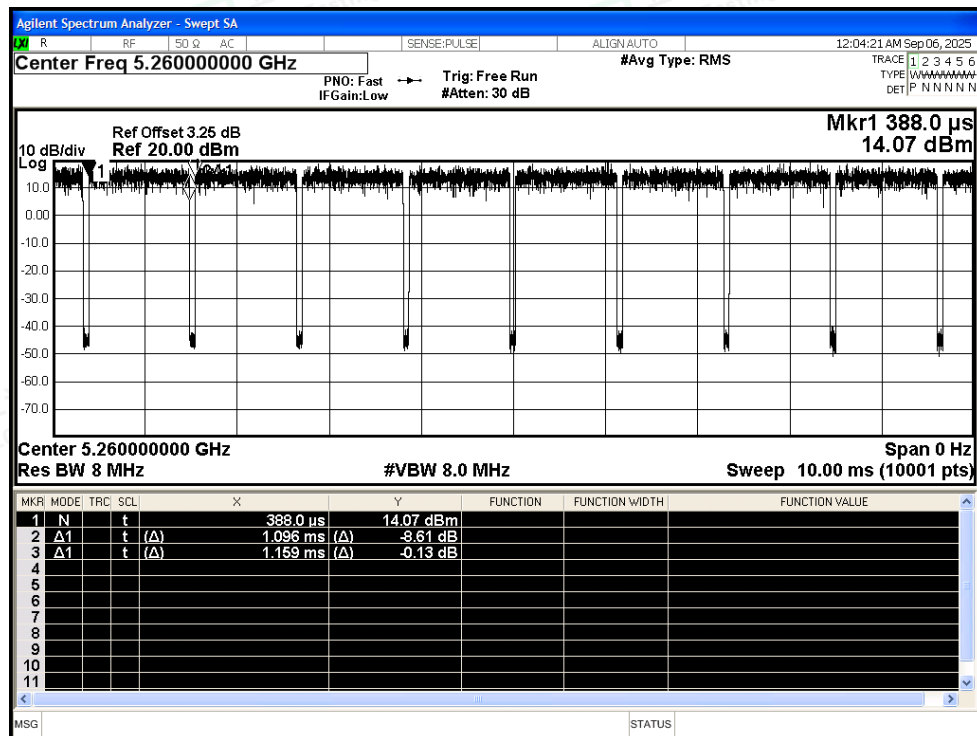

Duty Cycle NVNT a 5300MHz Ant0


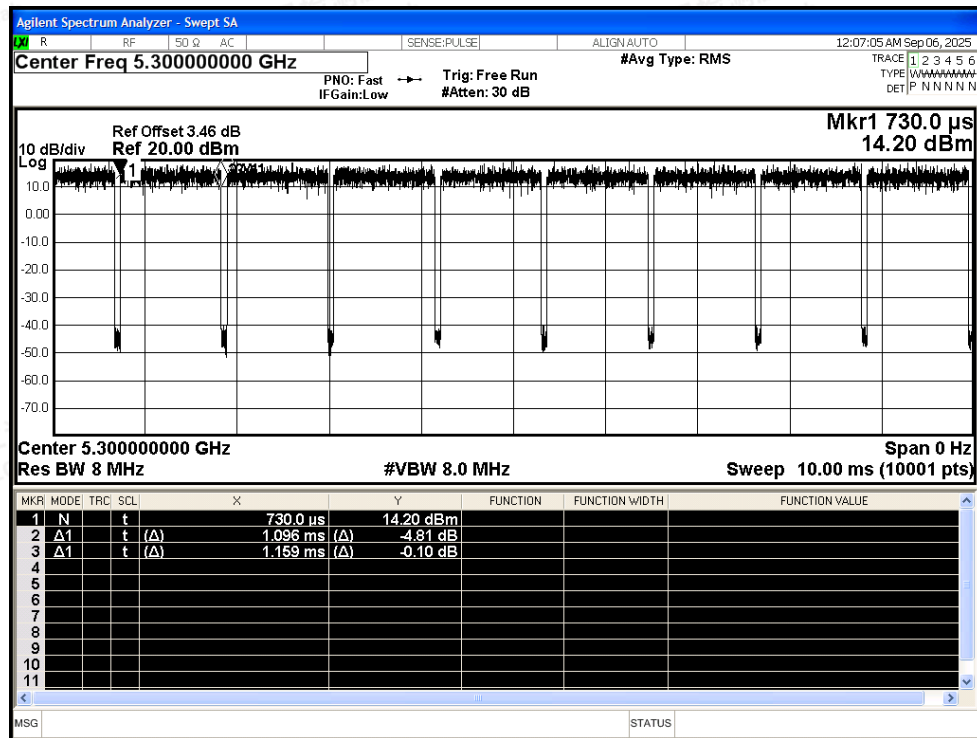


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

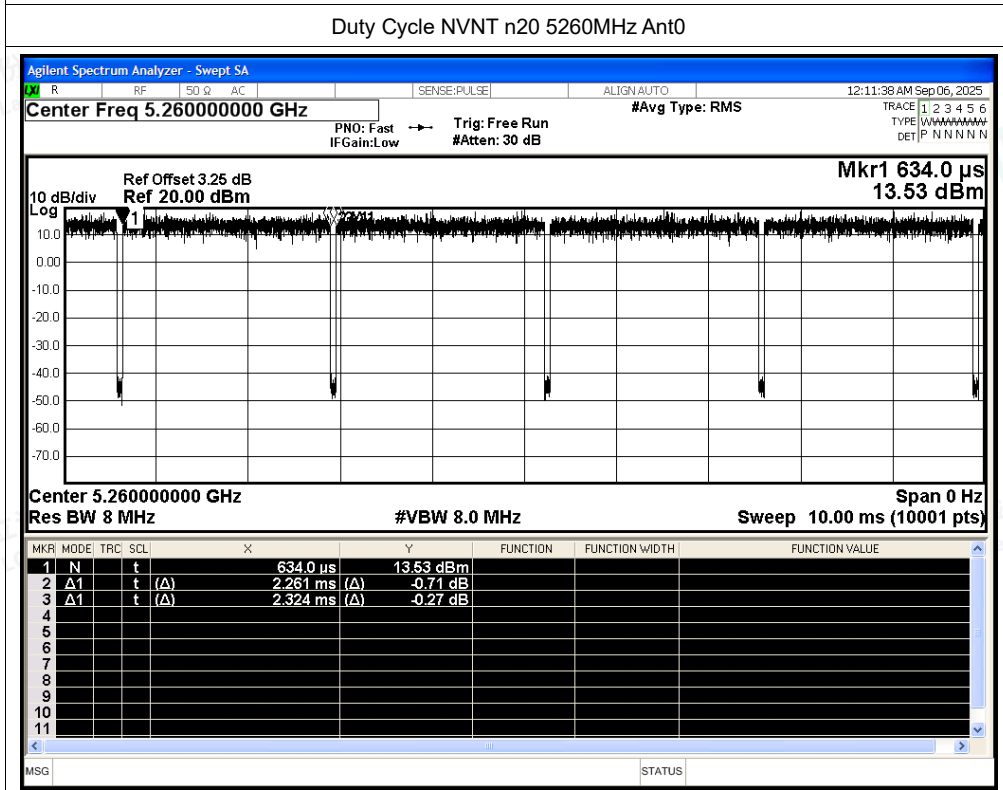
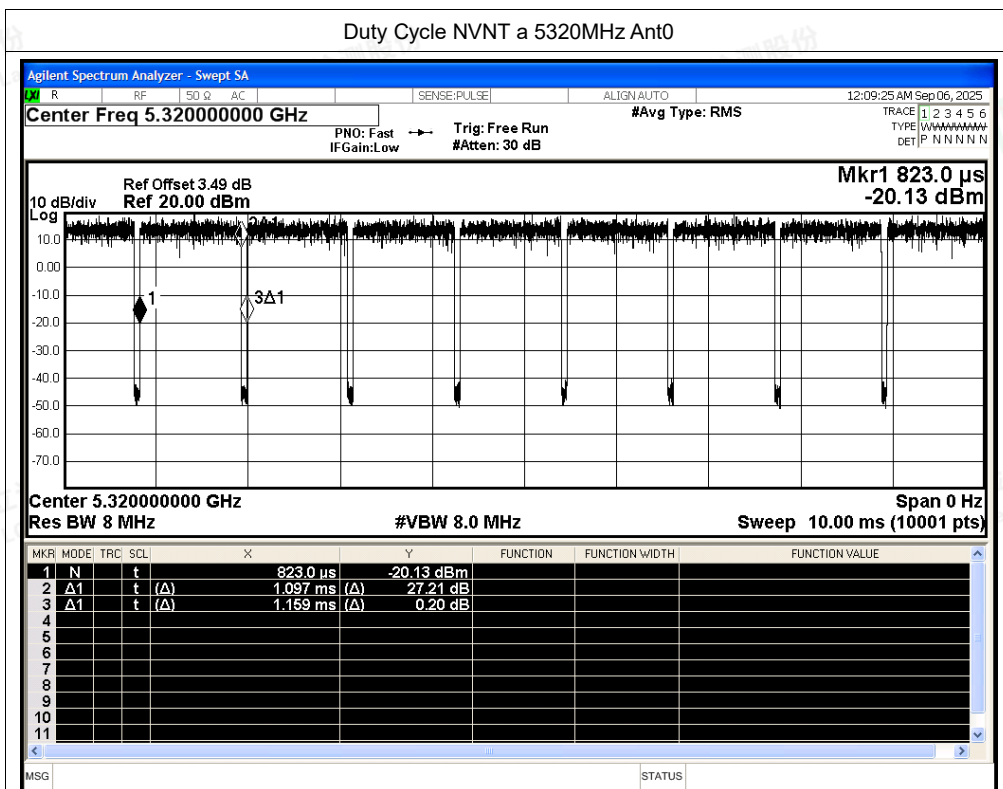


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

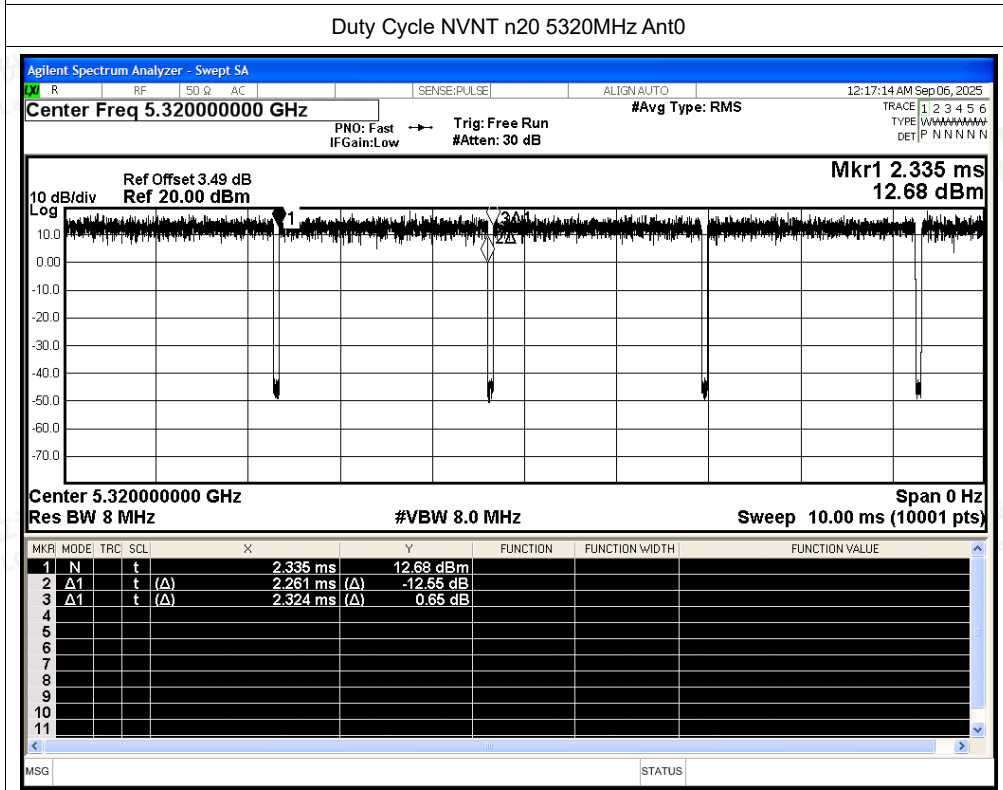
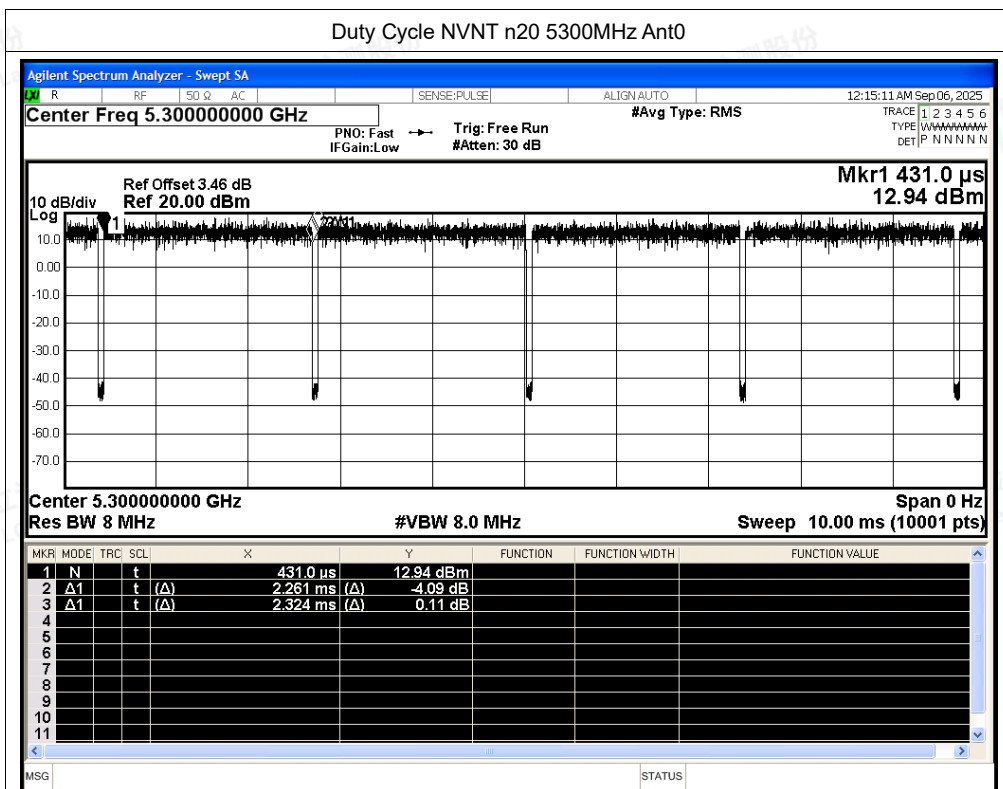


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

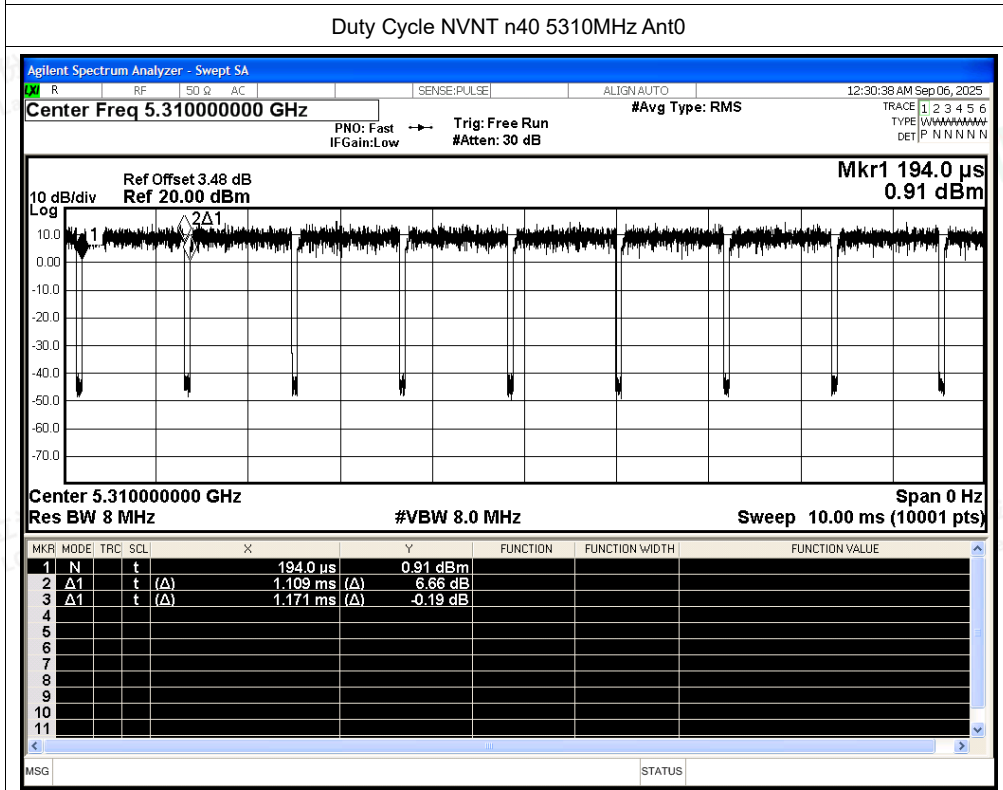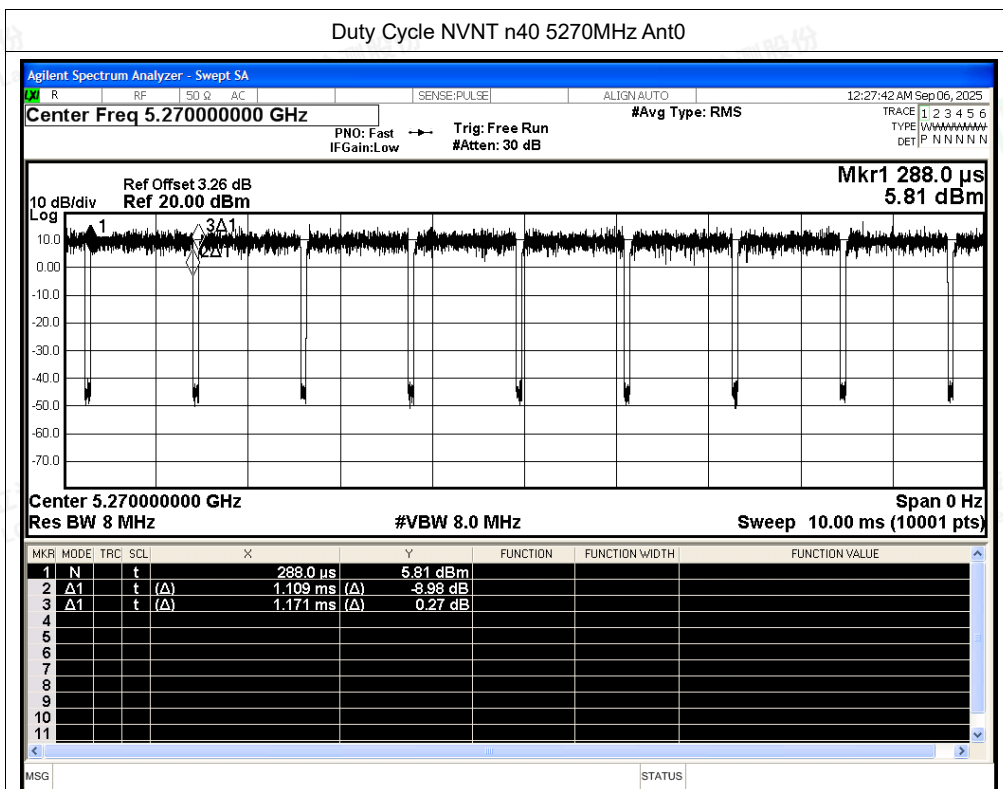

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant0

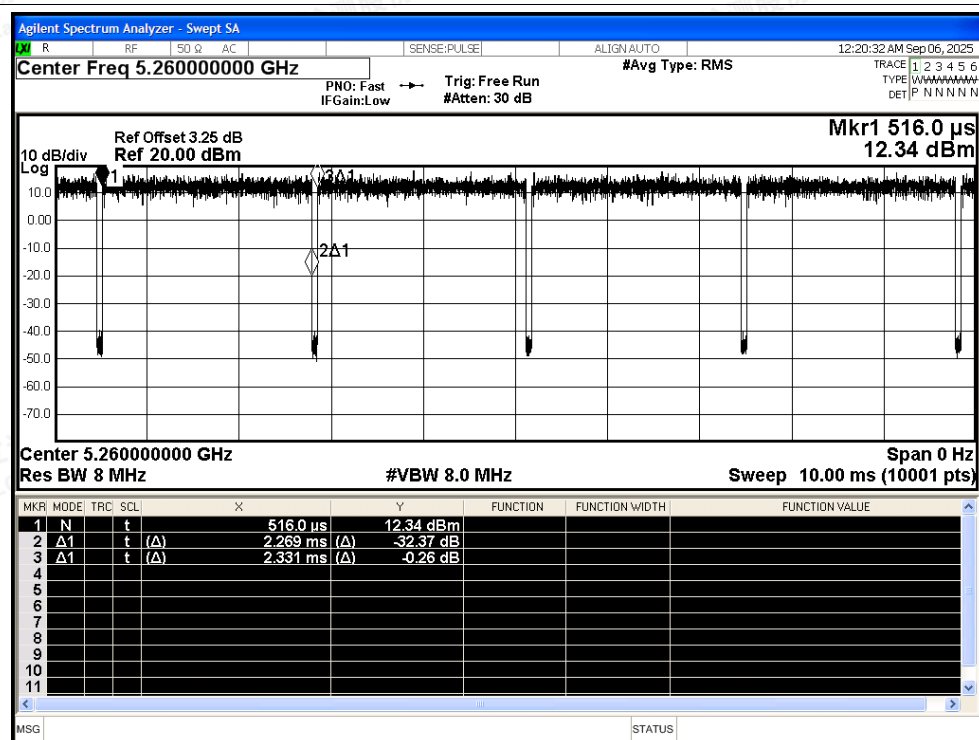

Duty Cycle NVNT ac20 5300MHz Ant0


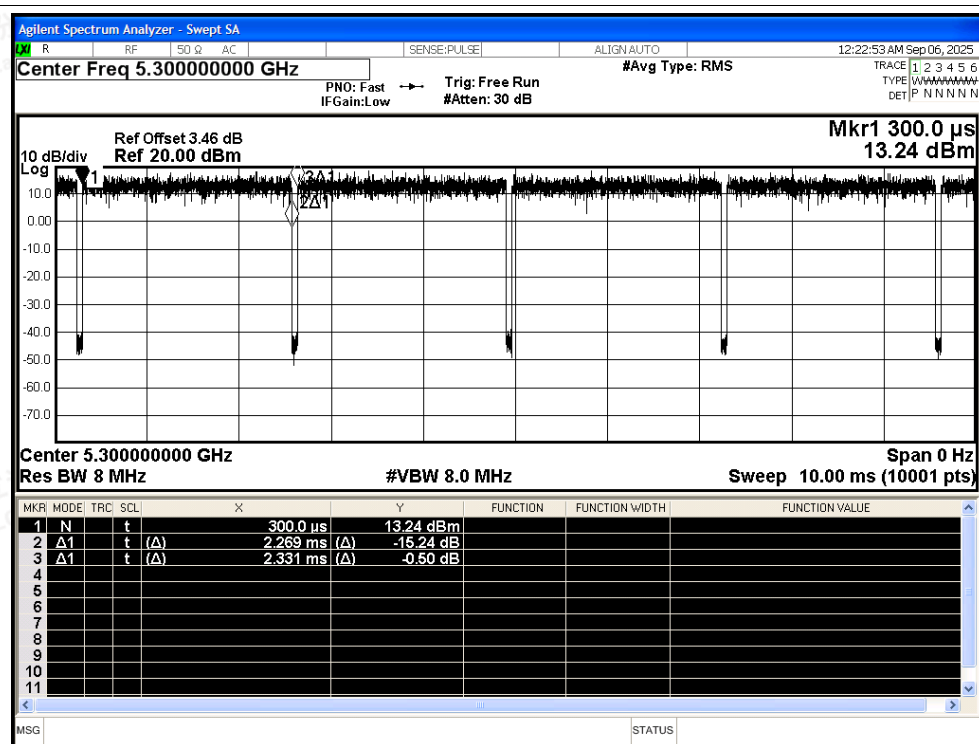


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

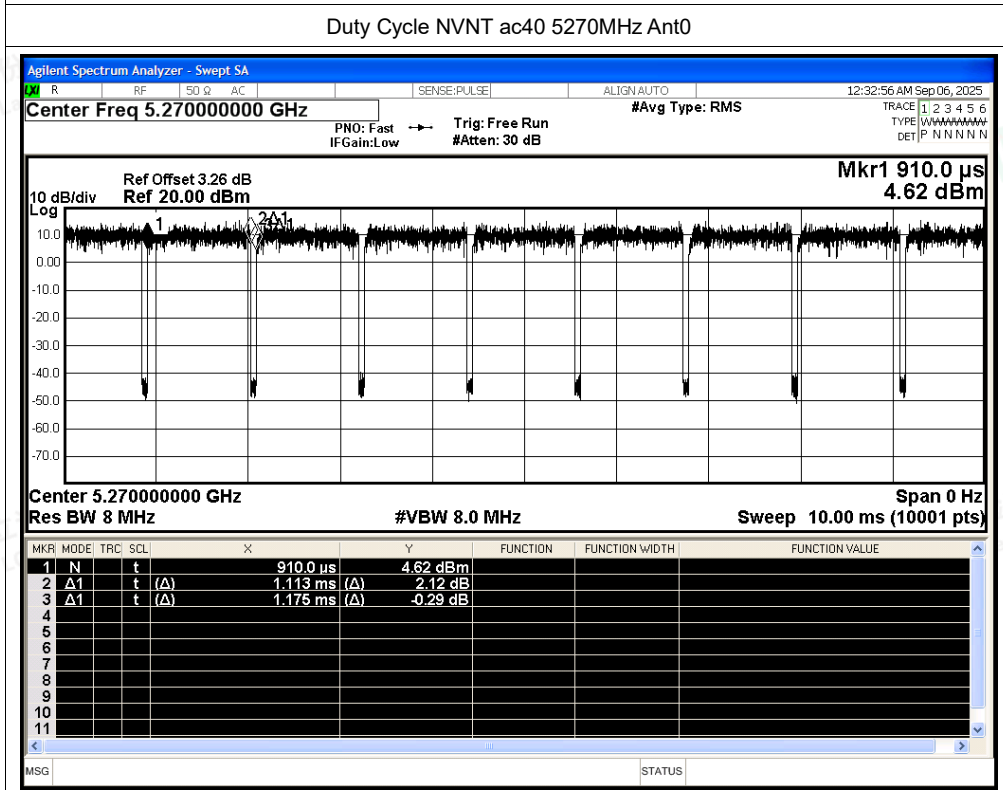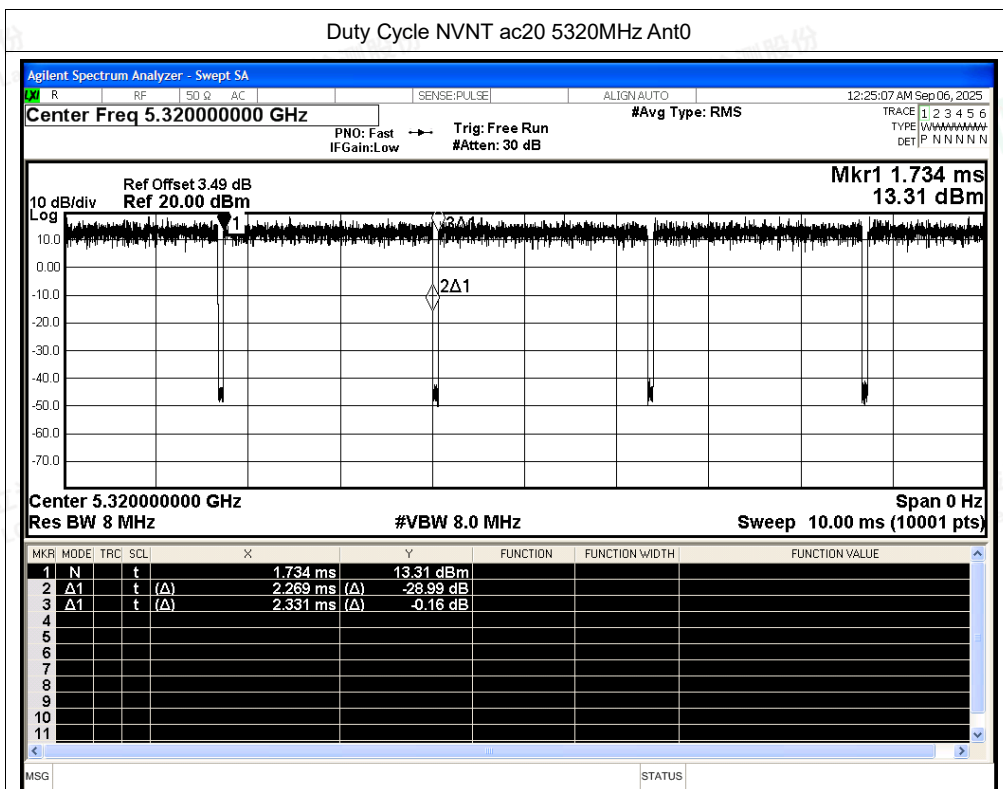

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant0

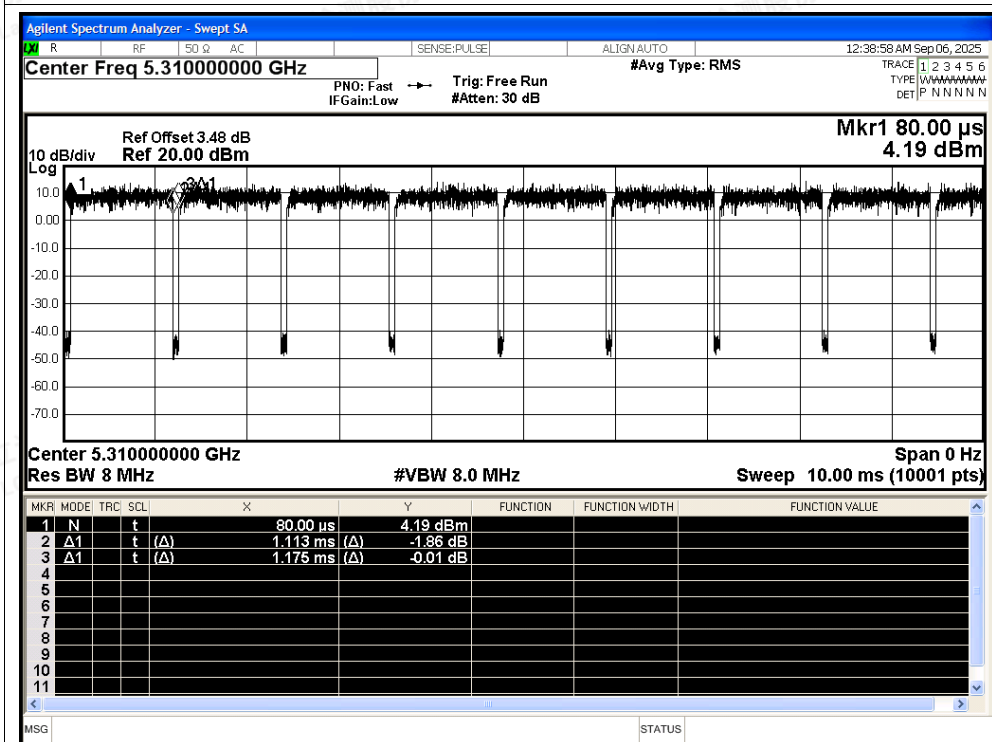

Duty Cycle NVNT ac80 5290MHz Ant0

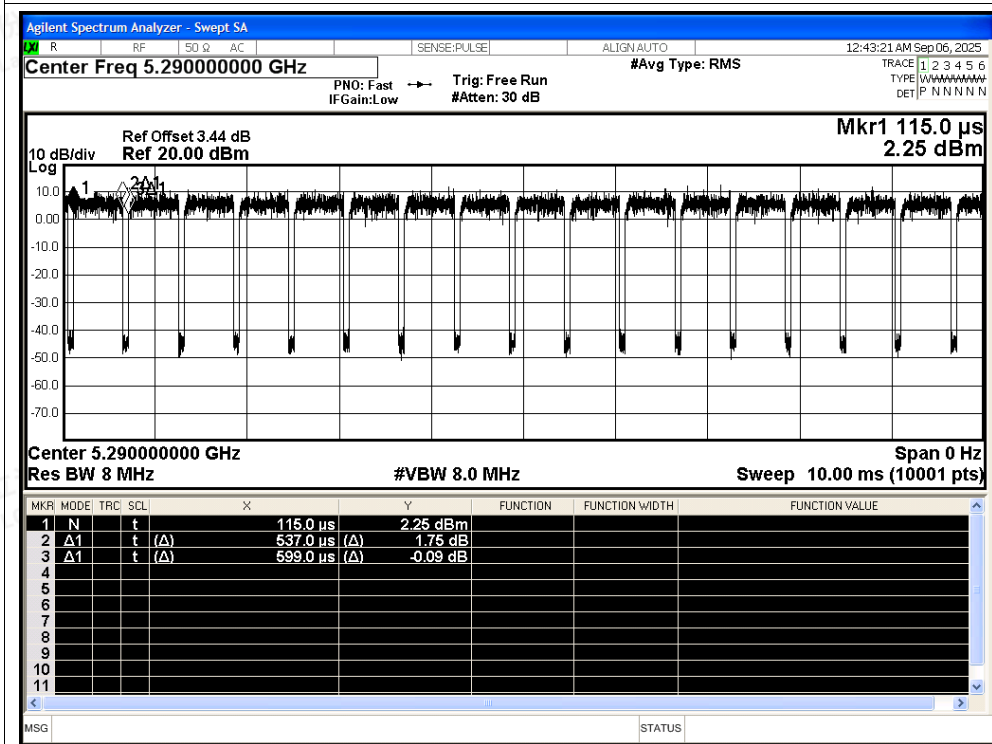

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.56	0.24	0.91
NVNT	a	5300	Ant1	94.65	0.24	0.91
NVNT	a	5320	Ant1	94.56	0.24	0.91
NVNT	n20	5260	Ant1	93.67	0.28	1.07
NVNT	n20	5300	Ant1	93.77	0.28	1.07
NVNT	n20	5320	Ant1	93.77	0.28	1.07
NVNT	n40	5270	Ant1	94.71	0.24	0.9
NVNT	n40	5310	Ant1	94.71	0.24	0.9
NVNT	ac20	5260	Ant1	97.3	0.12	0.44
NVNT	ac20	5300	Ant1	97.34	0.12	0.44
NVNT	ac20	5320	Ant1	97.34	0.12	0.44
NVNT	ac40	5270	Ant1	94.72	0.24	0.9
NVNT	ac40	5310	Ant1	94.72	0.24	0.9
NVNT	ac80	5290	Ant1	89.65	0.47	1.86



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

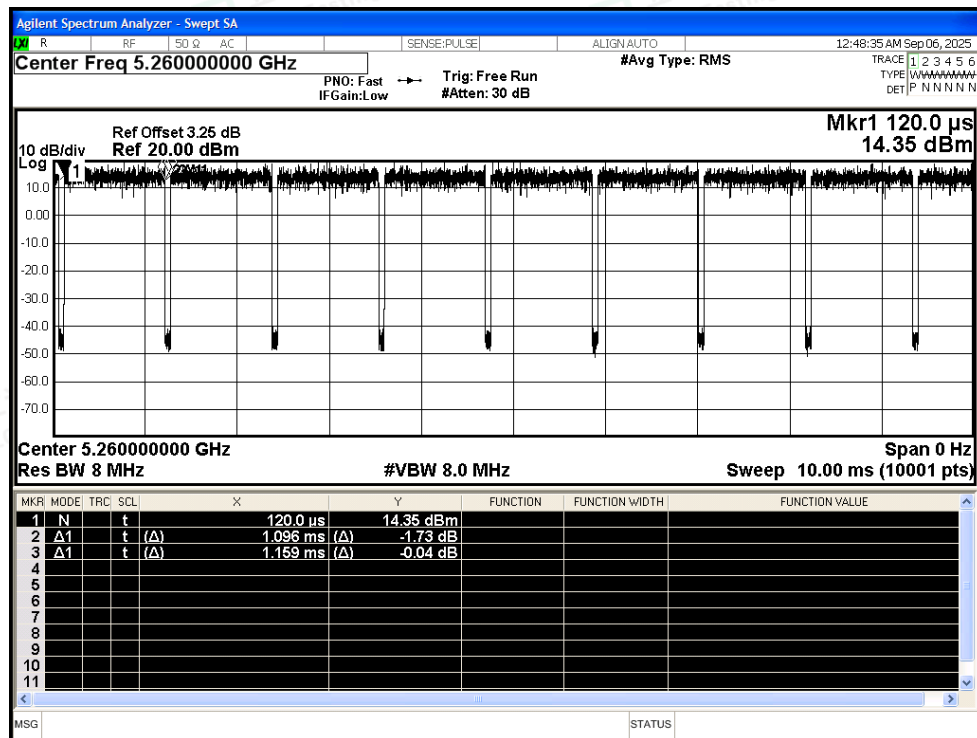

Duty Cycle NVNT a 5300MHz Ant1

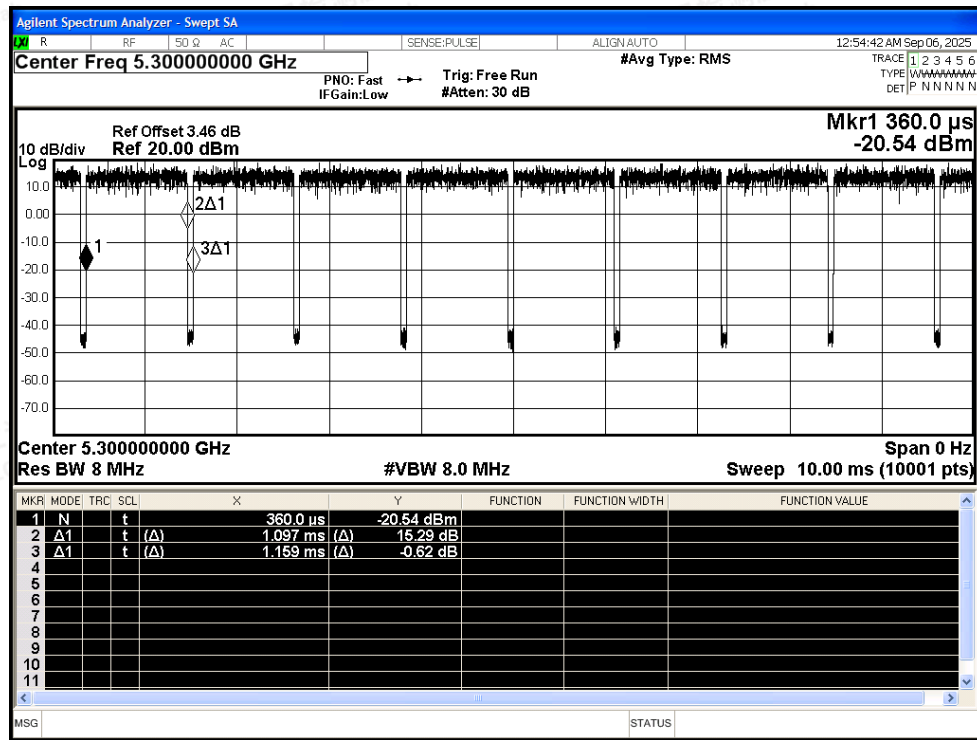

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

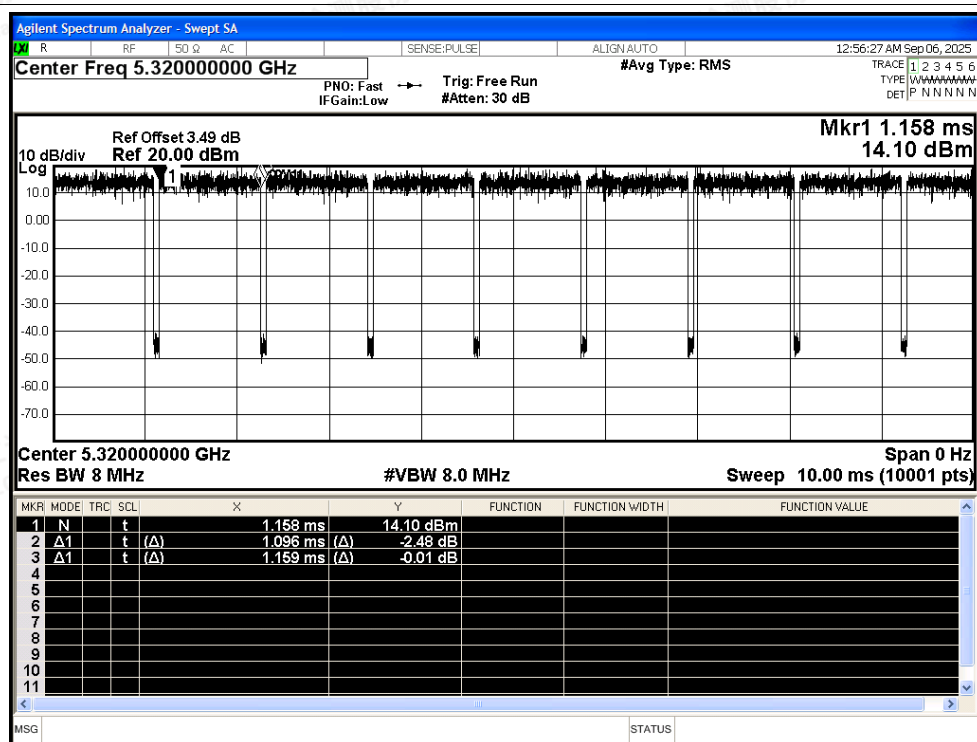

Duty Cycle NVNT n20 5260MHz Ant1


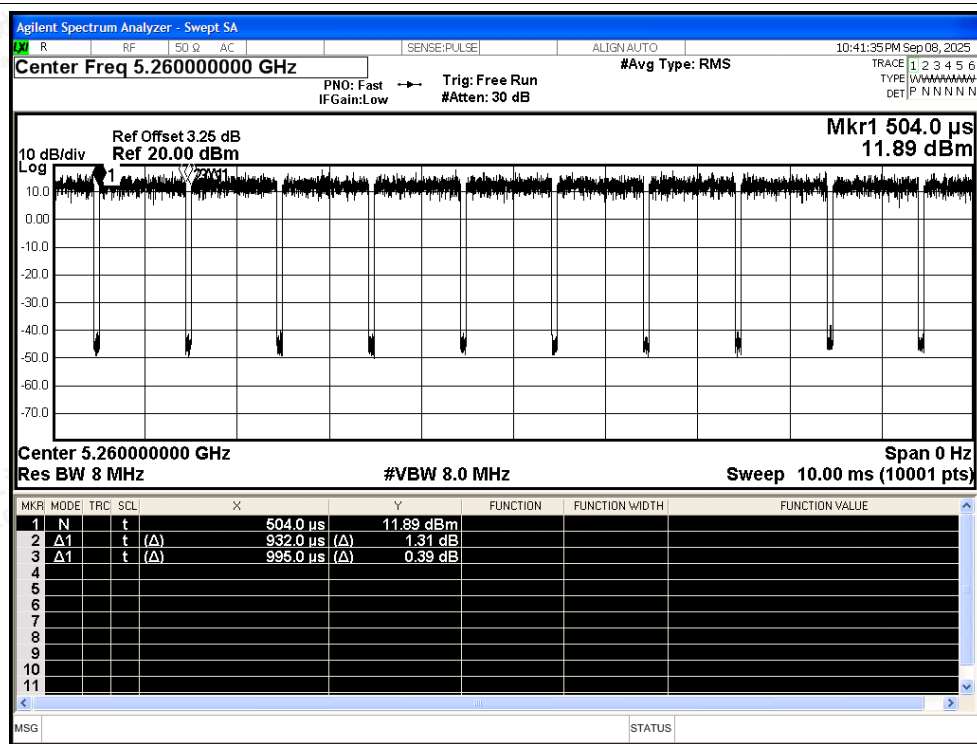


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

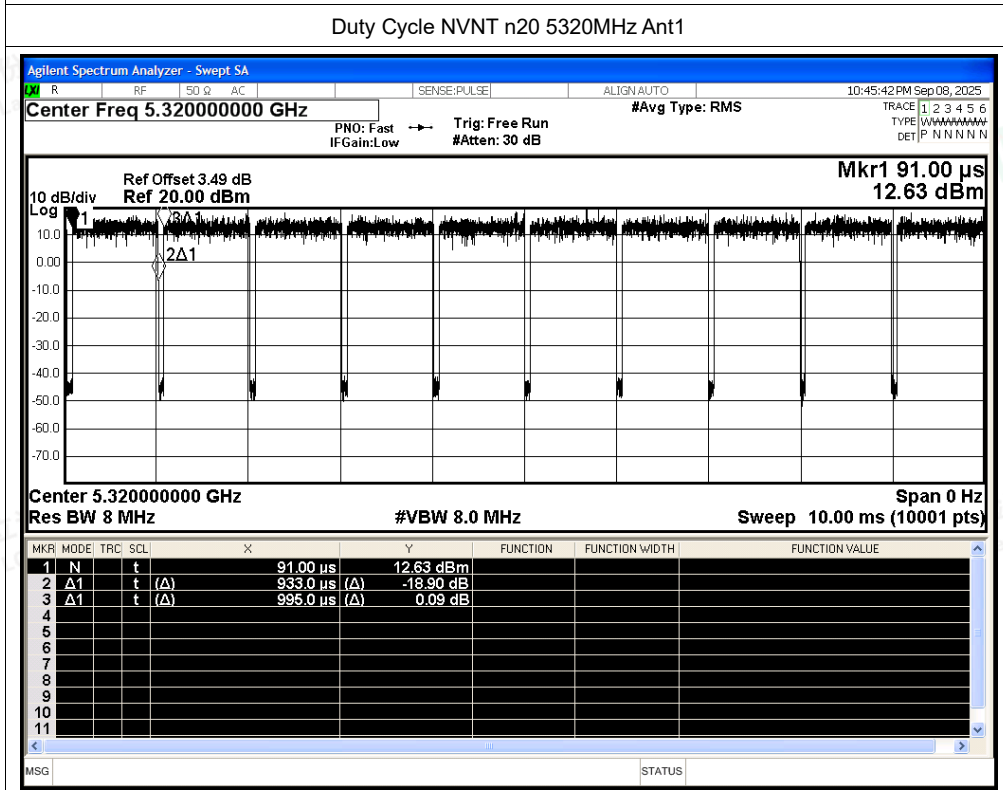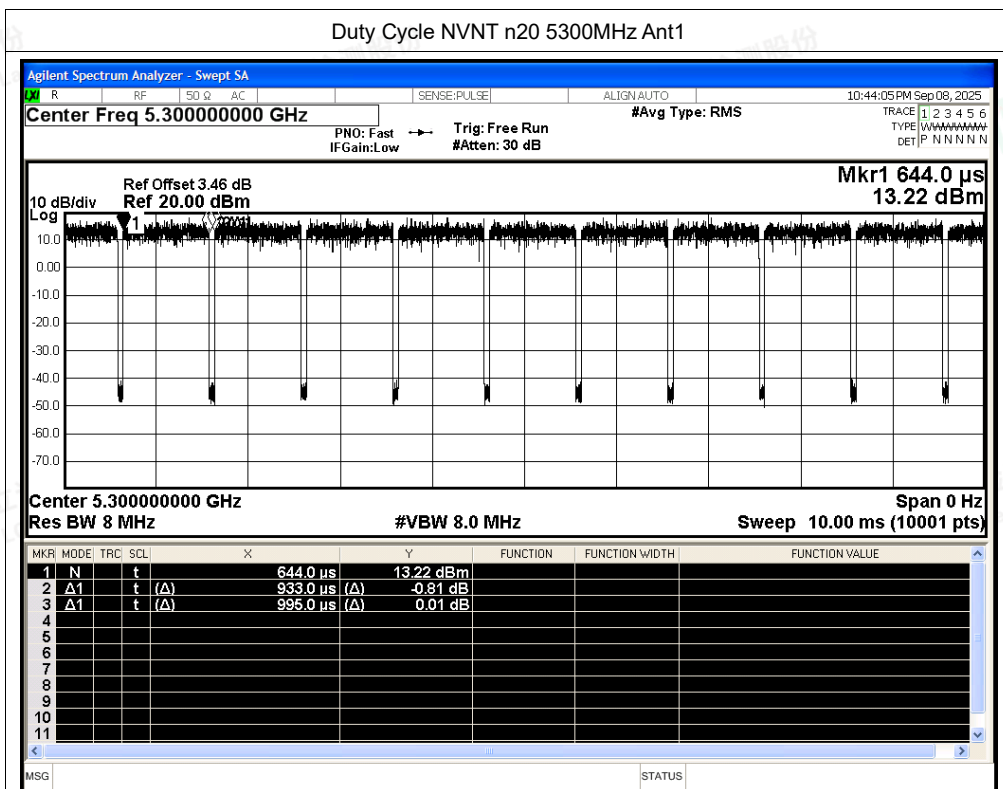

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

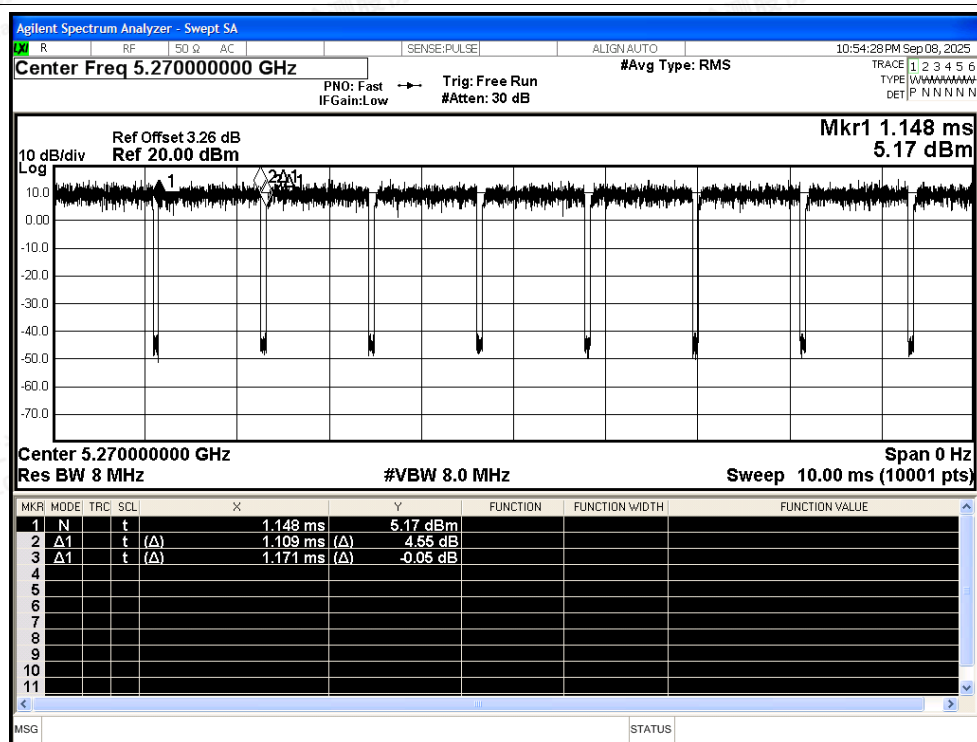

Duty Cycle NVNT n40 5310MHz Ant1

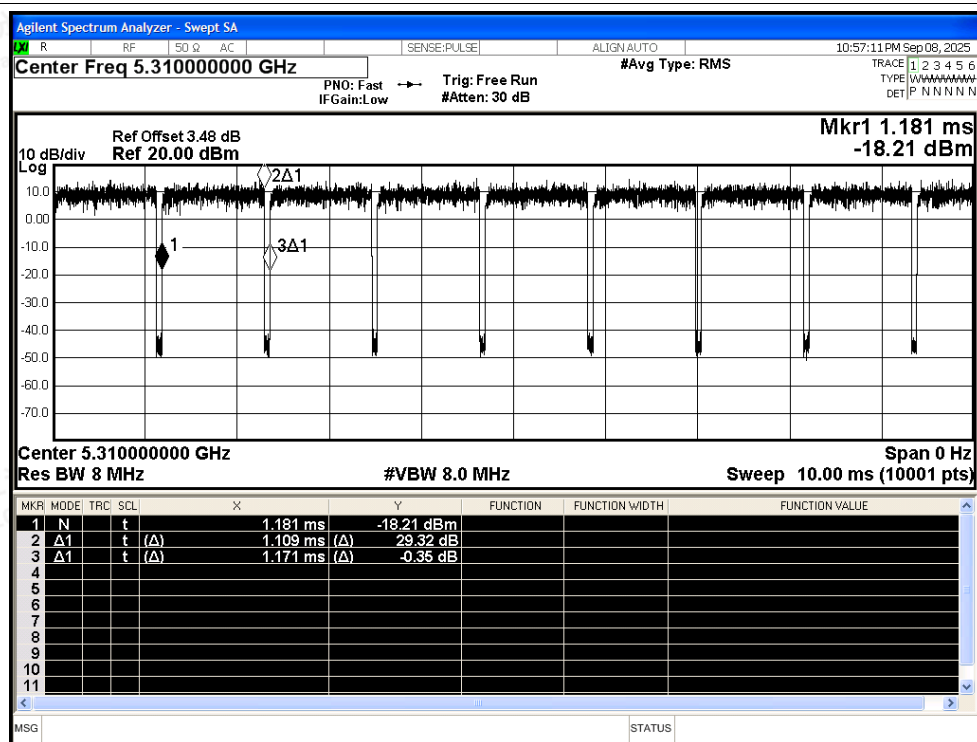

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

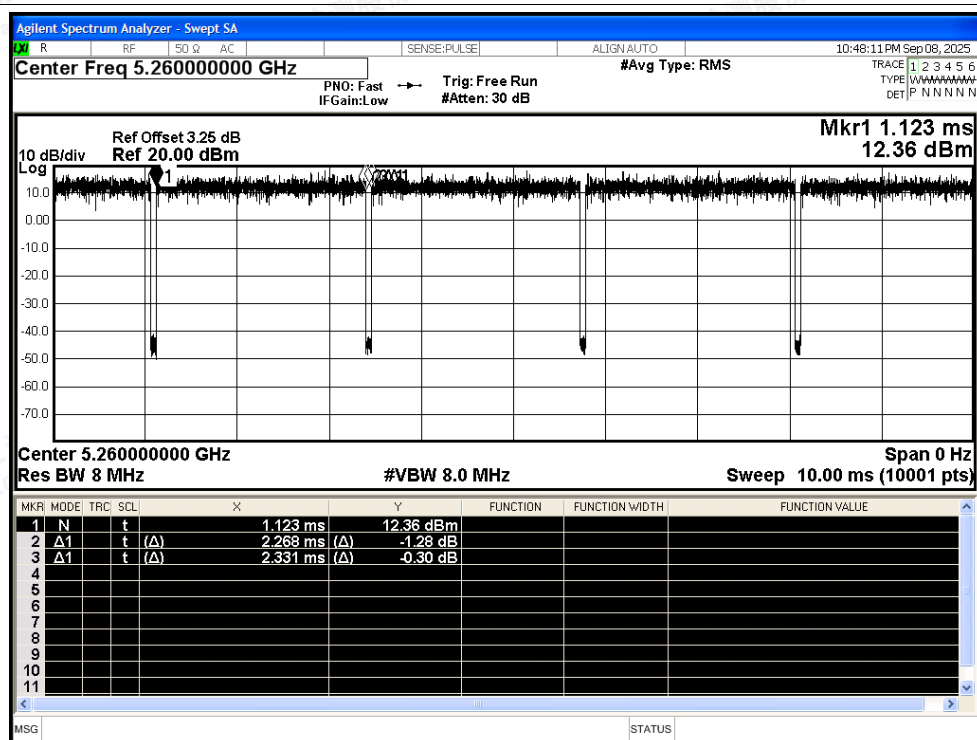

Duty Cycle NVNT ac20 5300MHz Ant1

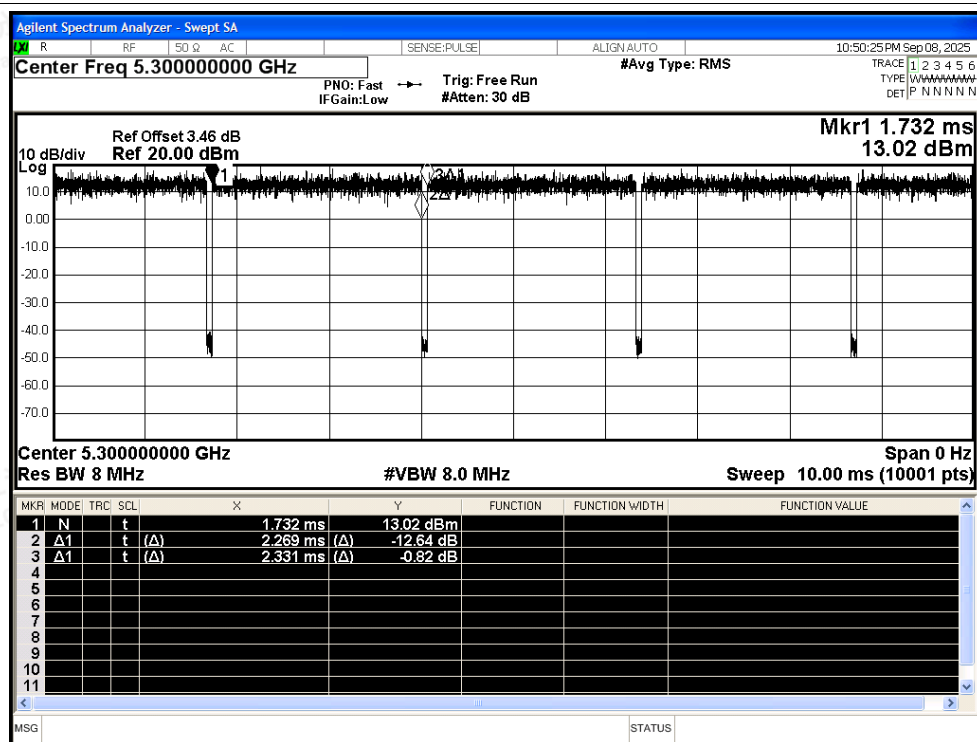

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

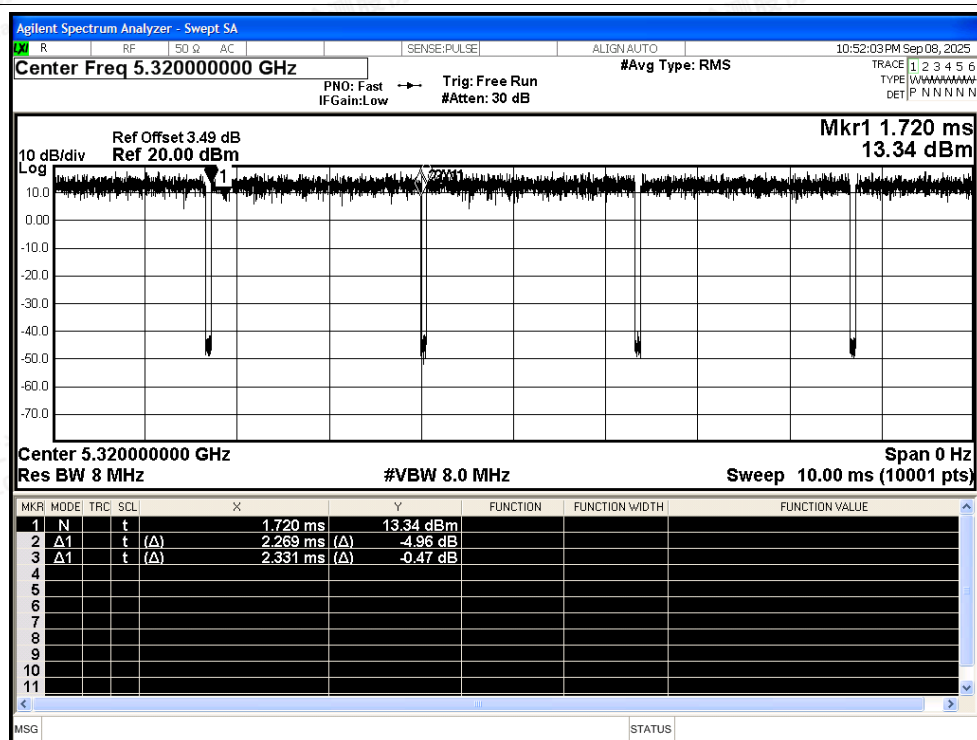

Duty Cycle NVNT ac40 5270MHz Ant1

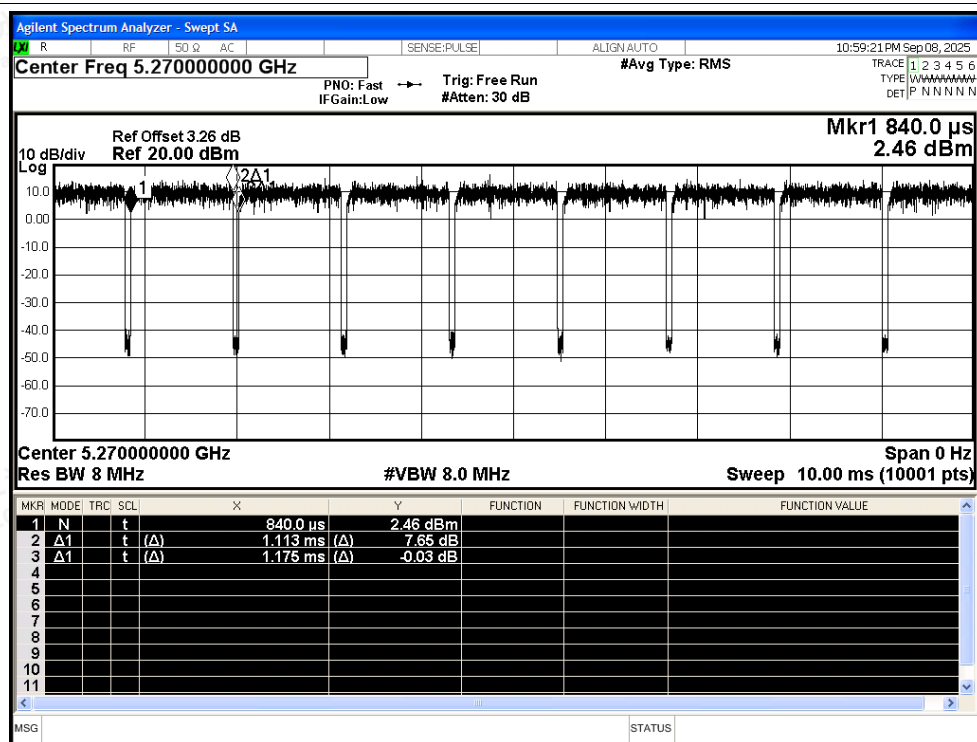

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

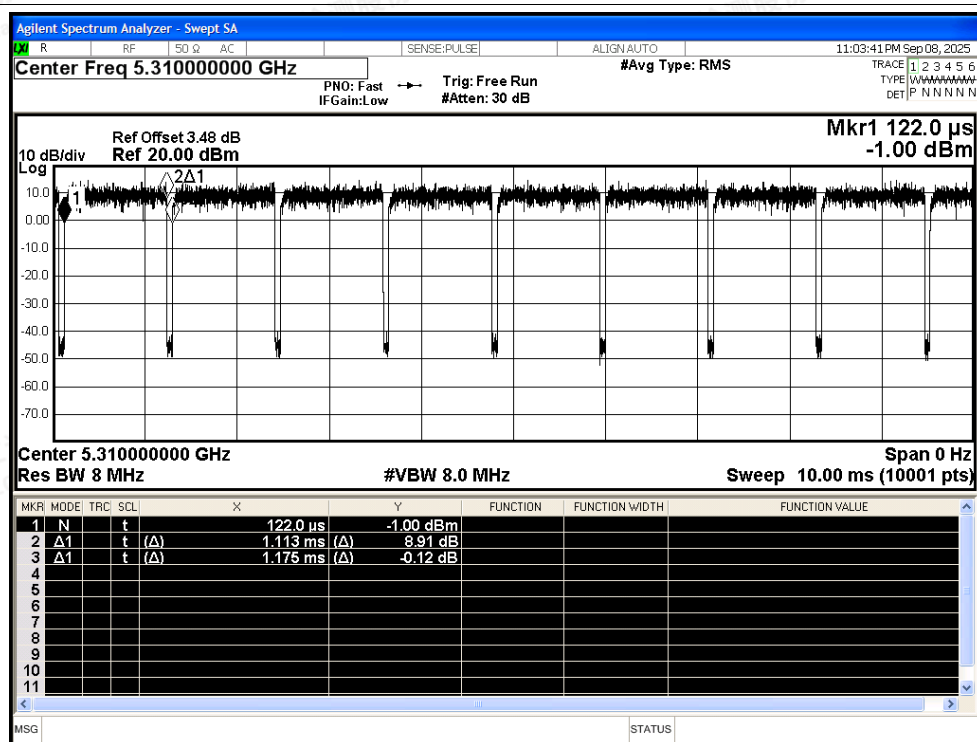

Duty Cycle NVNT ac80 5290MHz Ant1

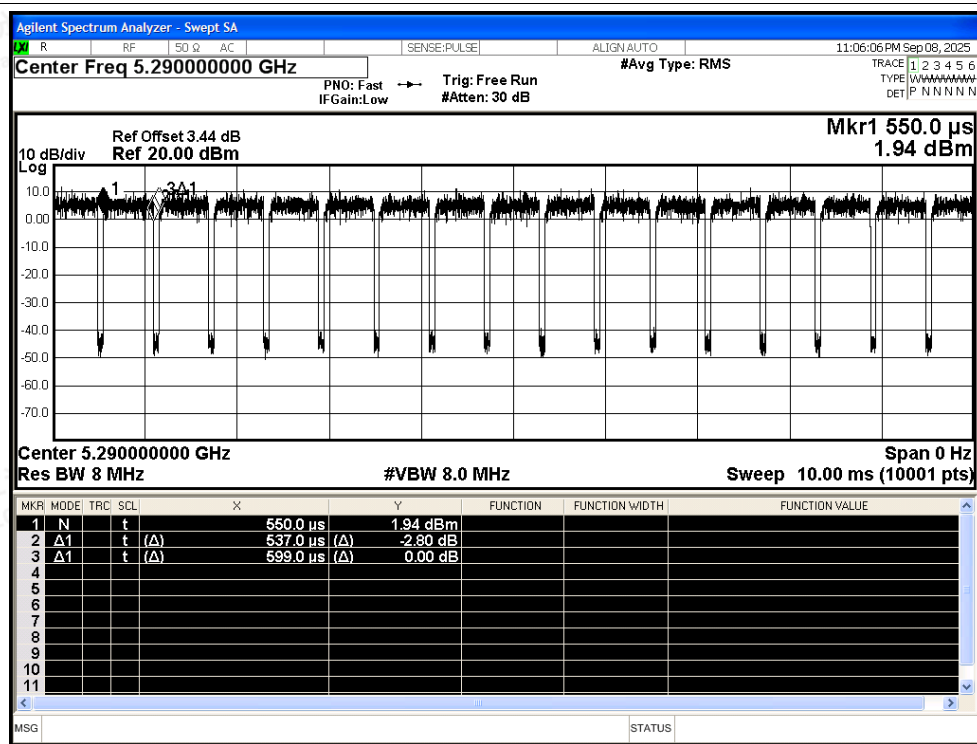

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity